



December 6, 2012

Mr. John Stroligo
M & T Bank
33 South Broadway
Tarrytown, New York

RE: Commercial Plaza
3848 Nostrand Avenue (also known as 3780-3858 Nostrand Avenue)
Borough of Brooklyn, New York
LCS Project 12H3984.21

Dear Mr. Stroligo:

At your request, Lender Consulting Services, Inc. (LCS) completed a Business/Lender Phase I Environmental Site Assessment of the subject property, identified as a commercial plaza located at 3848 Nostrand Avenue (also known as 3780-3858 Nostrand Avenue), Borough of Brooklyn, Kings County, New York. The subject property tax map shows the subject property to measure approximately 1.72 acres. Refer to the attached Business/Lender Phase I Environmental Site Assessment report. The subject property is developed with six structures that were constructed in stages between 1959 and 1982. The subject structures are utilized commercially, including banks, restaurants, a barber shop, medical offices, various stores and a parking garage. Exterior portions of the property included asphalt-paved parking areas and concrete sidewalks.

The purpose of this study was to identify recognized environmental conditions associated with the subject property. *Recognized environmental condition* is defined by the ASTM standard as "the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substance or petroleum products into structures on the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a material risk of harm to the public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be de minimis are not recognized environmental conditions."

Buffalo. Rochester. Syracuse. Albany. New York City. Mid Hudson. Pittsburgh.
Johnstown. Allentown. Wilmington. Baltimore. Annapolis. Richmond. Cleveland.

FINDINGS:

This assessment has revealed no evidence of recognized environmental conditions in connection with the subject property except for the following:

- The subject property was utilized as a drycleaners from at least 1968 through 1996. Additionally, according to the site contact, on-site operations may have historically included a photo developing lab.
- An east adjacent property, listed as Quality Cleaners/Yongs Cleaners Inc. DBA Quality Cleaners and addressed at 3801 Nostrand Avenue, was identified as a Drycleaners facility.
- An east adjacent property, listed as Texaco Station, addressed at 3755 Nostrand Avenue, was identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "active." [A status of "active" indicates further remediation or investigation is necessary.]
- A north adjacent property, listed as Former gas station, addressed at 3768 Nostrand Avenue, was identified as a NYSDEC listed Spills site. Spill No. 1107094 involved the discovery of gasoline contamination in soils while conducting a Phase II investigation and is considered "active" by the NYSDEC.

This assessment has revealed no evidence of historical recognized environmental conditions in connection with the subject property except for the following. [A historical recognized environmental condition is an environmental condition that in the past would have been considered a recognized environmental condition, but that may or may not be considered a recognized environmental condition currently. For example, a spill that has been remediated to the satisfaction of the appropriate regulators would be considered a historical recognized environmental condition.]

- An east adjacent property, listed as and addressed at 3767 Nostrand Avenue, was identified as a LTANK/Historic LTANK site. Spill No. 9206690 involved a tank test failure and is classified as "closed." [A status of "closed" indicates the spill was remediated and the NYSDEC file closed with no further remediation required.]
- An east adjacent property, listed as Al and Selwyn Service Station, addressed at 3755 Nostrand Avenue, was identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "inactive." [A status of "inactive" indicates the contamination may remain but no further remediation is required]

While not considered recognized environmental conditions under the ASTM standard, LCS notes the following:

- Hazardous and/or regulated materials, including hydraulic oil, cooking oil and paint, were noted stored and utilized on-site. Such were noted stored in less than one-gallon containers and 55-gallon drums. No evidence of releases was noted in the area of these materials.
- According to the EDR report, the subject property, listed as Supreme Petroleum, Inc. and addressed at 3858 Nostrand Avenue, was identified as a RCRA former Generator (no violations reported) and in the FINDS database due to this RCRA listing. According to the EPA ECHO report (www.epa-echo.gov) for this facility, the RCRA listing is currently inactive.

Buffalo. Rochester. Syracuse. Albany. New York City. Mid Hudson. Pittsburgh.
Johnstown. Allentown. Wilmington. Baltimore. Annapolis. Richmond. Cleveland.

Exceptions/Deletions/Limitations to this Assessment:

Due to stored materials on-site at the time of the site reconnaissance, observations on the subject property were limited. It should be noted that, due to the nature of on-site operations at the time of the site reconnaissance, LCS was not granted access to portions of the subject property/structures. Additionally, LCS did not inspect the roofs of the subject structures, as they were not readily accessible. Furthermore, LCS has yet to receive all responses from regulatory information requests. Lastly, LCS has yet to receive the owner/operator questionnaire. LCS cannot be liable for information known only to the site owner or operator and not shared with LCS.

This study was conducted using the ASTM 1527-00 Standard. The study should not be misconstrued as being completed to meet either the USEPA AAI or the ASTM 1527-05 Standard.

RECOMMENDATIONS:

Based on the information contained in this report, LCS reports the following about the subject property:

1) Further investigation that would discover or characterize contamination of the subject property by hazardous or toxic substances is warranted.

Known or Suspect RECs	Confirmed REC? Rationale	LCS Opinion/ Additional Investigation
Historic on-site drycleaners and photo developing lab.	There is the potential for impact to the subject property based on these historic uses.	Unless sufficient documentation is provided, a subsurface investigation is warranted to assess the environmental conditions on the subject property due to historic uses. Should such identify concerns, further work may be required.
Adjacent NYSDEC listed Spills sites, considered "active" by the NYSDEC.	There is the potential for impact to the subject property. Additionally, this property is located topographically up-gradient from the subject property.	Further investigation may be warranted. The NYSDEC file for this site should be reviewed to assess whether any on-site impact has occurred. This should be based, in part, on the anticipated use of the subject property (e.g., if the property is to be re-developed or a potential purchaser is concerned over this off-site impact). Although LCS' experience suggests the property owner would not be liable for such an off-site release, should future site development/excavation work encounter any impacted soils and/or materials, such should be properly addressed at that time.
Additional adjacent properties of potential environmental concern.	The potential exists for on-site impact. However, no visual evidence of impact or records of concern were identified. In addition, LCS' experience suggests the property owner would not be liable for any on-site impact from such off-site sources.	No further investigation is warranted at this time. However, should future site development/excavation work encounter any impacted soils and/or materials, such should be properly addressed at that time.

RECOMMENDATIONS (continued):

Historic RECs	Rationale	LCS Opinion/ Additional Investigation
Adjacent NYSDEC listed Spills sites, considered "inactive" or "closed by the NYSDEC.	These spills have been remediated to the satisfaction of the regulator.	No further investigation is warranted at this time.

2) Hazardous and/or regulated materials, including hydraulic oil, cooking oil and paint, were noted stored and utilized on-site. Such were noted stored in less than one-gallon containers and 55-gallon drums. No evidence of releases was noted in the area of these materials. Such should continue to be properly stored and handled.

3) The property owner should contact the EPA with regards to removing the subject property's RCRA listing based on its inactive status.

4) A full asbestos inspection was not completed. Based on LCS' limited observations, as suspected ACMs were not friable or greatly damaged, the materials can remain in-place. However, should significant renovations or demolition be anticipated, state and federal regulations require an asbestos survey and proper handling and disposal of ACMs. If such renovations or demolition is anticipated, costs for addressing ACMs should be provided in any project estimates.

5) A full lead-based paint inspection was not completed. Based on LCS' limited observations, suspect lead-based paint surfaces were not considered to be peeling or chipping at the time of the site investigation. However, caution is recommended if renovations and/or remodeling of this facility are to take place. Although the on-site operations are not residential in nature, worker safety should be considered during any future site renovations or demolition.

6) A cursory visual assessment for suspect mold was undertaken as a part of this environmental site assessment. A full mold inspection was not requested nor completed as part of this assessment. Based on LCS' limited observations, there was no visible evidence of mold and mold related odors at the time of the site inspection. It should be noted that molds can grow in hidden areas not observed during LCS' site reconnaissance. Of particular concern would be areas that experience water damage and areas of high humidity. Caution should be taken following any future water releases within the subject structure. Such water releases should be addressed immediately to help prevent the formation of the mold spores. Visual evidence of mold should be addressed immediately. It is recommended that professional remediation contractors be hired to properly address such issues.

From an environmental perspective, LCS cannot assess whether the subject property is acceptable as collateral until additional information is obtained regarding on-site environmental conditions due to historic operations.

Should you have any questions relative to this report, please contact Ms. Julie Daly, the LCS Senior Vice President associated with this project at (845) 406-0434. This report constitutes the findings and recommendations of LCS' investigation conducted for the referenced subject property as inspected and reviewed by the following:



David Crandall
Vice President



Sarah Vanderhoff
Environmental Analyst



**ASTM E1527-00 Business/Lender Phase I
Environmental Site Assessment Report For The Property
Identified as:**

**Commercial Plaza
3848 Nostrand Avenue (AKA 3780-3858 Nostrand Avenue)
Borough of Brooklyn, New York**

LCS PROJECT NO. 12H3984.21

PREPARED FOR:

**MR. JOHN STROLIGO
M & T BANK
33 SOUTH BROADWAY
TARRYTOWN, NEW YORK 10591**

PREPARED BY:

**LCS, INC.
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202
(716) 845-6145, (800) 474-6802**

December 6, 2012

Buffalo. Rochester. Syracuse. Albany. New York City. Mid Hudson. Pittsburgh.
Johnstown. Allentown. Wilmington. Baltimore. Annapolis. Richmond. Cleveland.

TABLE OF CONTENTS

1.0 EXECUTIVE SUMMARY

1.1 REPORT FINDINGS

- 1.1.1 SITE DESCRIPTION**
- 1.1.2 SITE RECONNAISSANCE**
- 1.1.3 SITE HISTORY**
- 1.1.4 REGULATORY INFORMATION/INTERVIEWS**
- 1.1.5 OTHER FINDINGS**

1.2 CONCLUSIONS

1.3 LIMITATIONS

1.4 RELIANCE

2.0 PURPOSE

3.0 SCOPE OF WORK

4.0 SUBJECT PROPERTY/VICINITY DESCRIPTION

4.1 SITE RECONNAISSANCE

- 4.1.1 OWNER/OPERATOR INTERVIEW**
- 4.1.2 OVERVIEW**
- 4.1.3 STORAGE TANKS**
- 4.1.4 HAZARDOUS OR REGULATED MATERIALS**
- 4.1.5 SOLID, HAZARDOUS OR REGULATED WASTES**
- 4.1.6 STAINING, CORROSION, STRESSED VEGETATION AND/OR DEAD VEGETATION**
- 4.1.7 FILL DIRT OR LAND DISPOSAL**
- 4.1.8 WASTEWATERS**
- 4.1.9 POTABLE WATER SUPPLY/WELLS**
- 4.1.10 AIR EMISSIONS**
- 4.1.11 SUSPECT PCBs**
- 4.1.12 SUSPECT ACMs**
- 4.1.13 SUSPECT LEAD BASED PAINT**
- 4.1.14 LEAD IN DRINKING WATER**
- 4.1.15 SUSPECT MOLD**
- 4.1.16 OTHER ISSUES**

4.2 ADJACENT SITE USE

4.3 SUBJECT SITE PHOTOGRAPHS

4.4 SUMMARY OF OBSERVATIONS OF POTENTIAL CONCERN

5.0 SUBJECT PROPERTY HISTORY AND USE

- 5.1 HISTORIC AERIAL PHOTOGRAPHS**
- 5.2 HISTORICAL MAPS/DIRECTORIES**
- 5.3 MUNICIPAL RECORDS**
- 5.4 PREVIOUS STUDY**
- 5.5 SUMMARY OF HISTORIC USES**

6.0 PHYSICAL AND HYDROGEOLOGIC SETTING

6.1 GEOLOGY

6.2 HYDROLOGY

TABLE OF CONTENTS (continued)

7.0 REGULATORY INFORMATION/INTERVIEWS

7.1 DATABASE

7.2 ENFORCEMENT ACTIONS/PERMITTED ACTIVITIES

7.3 INTERVIEWS/USER PROVIDED INFORMATION

7.3.1 LOCAL REGULATORY INTERVIEWS

7.3.2 USER PROVIDED INFORMATION

7.3.3 OWNER/OCCUPANT PROVIDED INFORMATION

7.4 SUMMARY OF REGULATORY INFORMATION

8.0 RADON

9.0 WETLANDS

10.0 APPENDIX

10.1 SITE MAPS

10.2 SITE CONDITION REPORT

10.3 SITE PHOTOGRAPHS

10.4 OWNER/OPERATOR QUESTIONNAIRE

10.5 REGULATORY INFORMATION

10.6 MUNICIPAL INFORMATION

10.7 AERIAL PHOTOGRAPHS

10.8 HISTORICAL INFORMATION

10.9 HYDROLOGIC/HYDROGEOLOGIC INFORMATION

10.10 LIMITATIONS

11.0 PERSONNEL QUALIFICATIONS

12.0 REFERENCES

13.0 ACRONYMS/ABBREVIATIONS

1.0 EXECUTIVE SUMMARY

1.1 REPORT FINDINGS

The following details specific findings presented in LCS' Business/Lender Phase I assessment. This section is provided for convenience to the reader. The reader is encouraged to read the entire report.

1.1.1 Site Description

The subject property is identified as a commercial plaza located at 3848 Nostrand Avenue (also known as 3780-3858 Nostrand Avenue), Borough of Brooklyn, Kings County, New York. The subject property tax map shows the subject property to measure approximately 1.72 acres. Refer to the Section 10.1 *SITEMAPS*. The subject property is developed with six structures that were constructed in stages between 1959 and 1982. The subject structures are utilized commercially, including banks, restaurants, a barber shop, medical offices, various stores and a parking garage. Exterior portions of the property included asphalt-paved parking areas and concrete sidewalks.

1.1.2 Site Reconnaissance

The subject property is located in a highly developed commercial and residential area. Public utility companies provide the following services to the subject property: electric; natural gas; water; and, sanitary sewer.

- Hazardous and/or regulated materials, including hydraulic oil, cooking oil and paint, were noted stored and utilized on-site. Such were noted stored in less than one-gallon containers and 55-gallon drums. No evidence of releases was noted in the area of these materials.

Refer to Section 4.0 for additional information regarding the site reconnaissance.

1.1.3 Site History

The historical use of the subject property has been researched through review of historic maps, historic aerial photographs, municipal records, city directories, and/or other reasonably obtainable documents. In general, the historical site uses were determined to be as follows.

Date Range	Apparent Use	Source
At least 1895 through 1906	Mostly vacant land with stables utilized by Coney Island Jockey along northern portion.	Sanborn maps
At least 1930 through at least 1950	Vacant lots	Sanborn maps
1959 through present	Developed with the existing subject structures in stages; utilized for commercial uses including banks, stores, a medical center, health spa and a drycleaners (at least 1968 through at least 1996). According to the site contact, a photo developing lab was historically located on-site.	Sanborn maps, municipal information, site contact and site reconnaissance.

1.1.3 Site History (continued):

The following recognized environmental conditions were identified based on LCS' historical research:

- The subject property was historically utilized as a drycleaners from at least 1968 through 1996. Additionally, on-site operations may have historically included a photo developing lab.
- The following adjacent property uses of potential environmental concern were identified:
 - o A north adjacent filling station from at least 1968 through 1991.
 - o An east adjacent drycleaners from at least 1968 through 1996.

Refer to Section 5.0 for additional information regarding the site history.

1.1.4 Regulatory Information/Interviews

A review of regulatory database information and any additional regulatory information reviewed by LCS identified the following recognized environmental conditions:

- According to the EDR report, the subject property, listed as Supreme Petroleum, Inc. and addressed at 3858 Nostrand Avenue, was identified as a RCRA former Generator (no violations reported) and in the FINDS database due to this RCRA listing. According to the EPA ECHO report (www.epa-echo.gov) for this facility, the RCRA listing is currently inactive.
- An east adjacent property, listed as Rite Aid #4876 and addressed at 3823 Nostrand Avenue, was identified as a RCRA Conditionally Exempt Small Quantity Generator (no violations reported).
- An east adjacent property, listed as Quality Cleaners/Yongs Cleaners Inc. DBA Quality Cleaners and addressed at 3801 Nostrand Avenue, was identified as the following:
 - o Drycleaners facility.
 - o RCRA former Generator (no violations reported) and in the FINDS and NY Manifest databases due to this RCRA listing.
- An east adjacent property, addressed at 3767 Nostrand Avenue, was identified the following:
 - o Listed as 3767 Nostrand Avenue:
 - As a LTANK/Historic LTANK. Spill No. 9206690 involved a tank test failure and is classified as "closed." [A status of "closed" indicates the spill was remediated and the NYSDEC file closed with no further remediation required.]
 - o Listed as Getty 00238:
 - As a UST/Historic UST site.
- An east adjacent property, addressed at 3755 Nostrand Avenue, was identified as the following:
 - o Listed as Al and Selwyn Service Station:
 - Identified as a UST/Historic UST and AST site.
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "inactive." [A status of "inactive" indicates the contamination may remain but no further remediation is required]
 - o Listed as Texaco Station:
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "active." [A status of "active" indicates further remediation or investigation is necessary.]

1.1.4 Regulatory Information/Interviews (continued):

- A north adjacent property, addressed at 3768 Nostrand Avenue, was identified as the following:
 - o Listed as Former Gas Station:
 - NYSDEC listed Spills site. Spill No. 1107094 involved the discovery of gasoline contamination in soils while conducting a Phase II investigation and is considered “active” by the NYSDEC.
 - o Listed as S & J Economic Service Ctr. Inc.:
 - UST/Historic UST facility.

In addition, interviews were conducted with various municipal representatives and/or other persons knowledgeable about the subject property.

No recognized environmental conditions were identified based on these interviews.

Refer to Section 7.0 for additional information.

1.1.5 Other Findings

LCS did not identify additional significant potential concerns.

1.2 CONCLUSIONS

We have performed this Business/Lender Phase I Environmental Site Assessment in conformance with the scope and limitations of the ASTM Practice E 1527-00 for 3848 Nostrand Avenue (AKA 3780-3858 Nostrand Avenue), Borough of Brooklyn, Kings County, New York. Any exceptions to, or deletions from, this practice are described within Section 1.3.

This assessment has revealed no evidence of recognized environmental conditions in connection with the subject property except for the following:

- The subject property was historically utilized as a drycleaners from at least 1968 through 1996. Additionally, according to the site contact, on-site operations may have historically included a photo developing lab.
- An east adjacent property, listed as Quality Cleaners/Yongs Cleaners Inc. DBA Quality Cleaners and addressed at 3801 Nostrand Avenue, was identified as a Drycleaners facility.
- An east adjacent property, listed as Texaco Station, addressed at 3755 Nostrand Avenue, was identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "active." [A status of "active" indicates further remediation or investigation is necessary.]
- A north adjacent property, listed as Former gas station, addressed at 3768 Nostrand Avenue, was identified as a NYSDEC listed Spills site. Spill No. 1107094 involved the discovery of gasoline contamination in soils while conducting a Phase II investigation and is considered "active" by the NYSDEC.

This assessment has revealed no evidence of historical recognized environmental conditions in connection with the subject property except for the following. [A historical recognized environmental condition is an environmental condition that in the past would have been considered a recognized environmental condition, but that may or may not be considered a recognized environmental condition currently. For example, a spill that has been remediated to the satisfaction of the appropriate regulators would be considered a historical recognized environmental condition.]

- An east adjacent property, listed as 3767 Nostrand Avenue, addressed at 3767 Nostrand Avenue, was identified as a LTANK/Historic LTANK site. Spill No. 9206690 involved a tank test failure and is classified as "closed." [A status of "closed" indicates the spill was remediated and the NYSDEC file closed with no further remediation required.]
- An east adjacent property, listed as Al and Selwyn Service Station, addressed at 3755 Nostrand Avenue, was identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "inactive." [A status of "inactive" indicates the contamination may remain but no further remediation is required]

While not considered recognized environmental conditions under the ASTM standard, LCS notes the following:

- Hazardous and/or regulated materials, including hydraulic oil, cooking oil and paint, were noted stored and utilized on-site. Such were noted stored in less than one-gallon containers and 55-gallon drums. No evidence of releases was noted in the area of these materials.
- According to the EDR report, the subject property, listed as Supreme Petroleum, Inc. and addressed at 3858 Nostrand Avenue, was identified as a RCRA former Generator (no violations reported) and in the FINDS database due to this RCRA listing. According to the EPA ECHO report (www.epa-echo.gov) for this facility, the RCRA listing is currently inactive.

1.3 LIMITATIONS

Due to stored materials on-site at the time of the site reconnaissance, observations on the subject property were limited. It should be noted that, due to the nature of on-site operations at the time of the site reconnaissance, LCS was not granted access to portions of the subject property/structures. Additionally, LCS did not inspect the roofs of all of the subject structures, as they were not readily accessible. Furthermore, LCS has yet to receive all responses from regulatory information requests. Lastly, LCS has yet to receive the owner/operator questionnaire. LCS cannot be liable for information known only to the site owner or operator and not shared with LCS.

This study was conducted using the ASTM 1527-00 Standard. The study should not be misconstrued as being completed to meet either the USEPA AAI or the ASTM 1527-05 Standard.

FOIA requests were sent to the appropriate regulatory agencies for information concerning the subject and adjacent sites. As of date of this report, LCS has not received a complete response(s). **LCS reserves the right to revise this report based upon any pertinent information concerning the subject property that may be forthcoming from this department.** It should be noted that LCS was not able to provide the regulatory agency 20 days to respond to our request as required by the ASTM standard due to the turn-around time required for the project.

To the best of LCS' knowledge, the information contained in this report is true and accurate. LCS personnel have exercised due diligence in the compilation of the information contained herein appropriate to environmental professionals engaged in investigations of this sort. LCS makes no guarantees regarding the accuracy of information gained from other sources.

The subject property location and boundaries as understood by LCS are depicted in the maps appended to this report. It is the responsibility of the reader to verify that the location and boundaries depicted herein are correct.

Refer to Section 10.10 for additional limitations.

1.4 RELIANCE

LCS authorizes Manufacturers and Traders Trust Company, M & T Real Estate Trust, their affiliates and subsidiaries and all successors and assigns thereof to use the above-referenced LCS report in order to determine its interest in lending on the said subject property.

We appreciate the opportunity to be of service to you and look forward to servicing your environmental needs in the future. **Should you have any questions relative to this report, please contact Ms. Julie Daly, the LCS Senior Vice President associated with this project at (845) 406-0434.** We will make ourselves available at your convenience.

Reviewed by:



David Crandall
Vice President



Sarah Vanderhoff
Environmental Analyst

2.0 PURPOSE

The primary purpose of this Business/Lender Phase I Environmental Assessment was to identify recognized environmental conditions (RECs) on the subject property. *Recognized environmental condition* is defined by the ASTM standard as “the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substance or petroleum products into structures on the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a material risk of harm to the public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be de minimis are not recognized environmental conditions.” This level of this environmental review is typically considered appropriate inquiry into the previous ownership and uses of the subject property consistent with good commercial and customary practice to permit the user to satisfy the requirements to qualify for the innocent landowner defense to the CERCLA. Secondary purposes were to assess hazardous substances stored, used, released or disposed on the subject property; provide a basis for evaluation of the subject property; evaluate business environmental risks; and assess the need for additional investigation.

3.0 SCOPE OF WORK

This Business/Lender Phase I Environmental Assessment report has been prepared in accordance with ASTM Standard E 1527-00, *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*. The scope of this Business/Lender Phase I Environmental Assessment has been limited to a review of the following sources of information. (For a list of references see Section 12.0.)

A) Recorded chain of title documents regarding the subject property, including all deeds, easements, leases, restrictions and covenants (if provided).

B) Historical maps aerial photographs and/or other Standard Historical Sources (as defined by ASTM) that may reflect prior uses of the subject property and that are reasonably ascertainable through vendors and/or state or local government agencies, back to 1940 or prior to development, whichever is earlier.

C) Reasonably ascertainable federal and state Standard Environmental Record Sources to approximate minimum search distances as defined by ASTM 1527-00 as provided by EDR, purchased by LCS and dated November 29, 2012. Interviews with local regulators were also completed.

D) A visual site reconnaissance of the subject property and facilities and improvements on the subject property, including: review of on-site topography; assessment of chemical use, hazardous waste handling/disposal practices on the subject property; assessment of the presence or likely presence of a release or threatened release of hazardous substances and/or non-hazardous waste; review of suspect PCBs; review of bulk storage tanks including ASTs and USTs; and a visual review of immediately adjacent properties from the subject property.

E) While not included in the ASTM standard, LCS' site reconnaissance also included a cursory visual inspection of the subject property, facilities and improvements for suspect mold, ACMs and lead-based painted surfaces. Such should not be considered a complete inspection for these items.

4.0 SUBJECT PROPERTY/VICINITY DESCRIPTION

4.1 SITE RECONNAISSANCE

A visual site review of the subject property, 3848 Nostrand Avenue (also known as 3780-3858 Nostrand Avenue), Borough of Brooklyn, Kings County, New York, was completed to document site conditions and to identify recognized environmental conditions. The site reconnaissance included a walkthrough of representative units/spaces on-site, including interior and exterior areas with the exception of the roofs of the subject structures as they were not readily accessible. Limitations also included stored materials on-site at the time of the site inspection.

The following summarizes LCS' observations.

4.1.1 Owner/Operator Interview

Mr. Moses Jbarah, associated with the subject property since approximately 2003, provided access and background information about the subject property. Such information has been incorporated herein.

The LCS Owner/Operator Questionnaire was forwarded to Mr. Jon Asta on November 21, 2012, for completion. As of the date of this report, LCS has yet to receive the completed questionnaire. Any response information that would alter or affect the findings and conclusions of this report will be forwarded as an addendum to this report when it is received by LCS.

4.1.2 Overview

LCS made the following observations at the time of the site reconnaissance.

General Site Information	
Name of Site	Commercial Plaza
Site Address	3848 Nostrand Avenue (also known as 3780-3858 Nostrand Avenue)
Municipality, County, State	Borough of Brooklyn, Kings County, New York
Fronting Streets	Nostrand Avenue, Avenue Y and Avenue Z
Site Size (acres)	1.72
Site Elevation (feet above mean sea level)	10
Site Topography	Level at grade
Nearest Water Body (Name/Distance)	Shell Bank Creek/2,421 feet east
Exterior Conditions/Improvements	Asphalt-paved parking areas and concrete sidewalks

4.1.2 Overview (continued):

Building Information	
No. Buildings	Six
Square Footage of Buildings (indicated by the Rent Roll Report)	3780-3790 Nostrand Ave.: 7,200 3800-3810 Nostrand Ave.: 10,100 3812-3828 Nostrand Ave.: 27,175 3830-3838 Nostrand Ave.: 10,000 3848-3852 Nostrand Ave.: 13,400 3858 (S1-T4) Nostrand Ave.: 10,850
No. Stories	3780-3790 Nostrand Ave.: one 3800-3810 Nostrand Ave.: one 3812-3828 Nostrand Ave.: two 3830-3838 Nostrand Ave.: one 3848-3852 Nostrand Ave.: two 3858 (S1-T4) Nostrand Ave.: two
Basement Present?	Full basement (parking garage) in 3812-3828 Nostrand Ave. Partial basement in 3858 (S1-T4) Nostrand Ave. Reportedly no basements in the remaining buildings
Roof Type/Age	Flat/age unknown
Current Building Uses	Various commercial (see Tenant List below)
Heating System Type/Location	Natural gas/roof top units
Building Construction Date	1959 with later additions
Utilities Provided	Public natural gas and electric and municipal sewer and water
Wastes Generated	General refuse and recycling, waste cooking oil and medical waste

Tenant List (indicated by the provided Rent Roll Report)

Tenant	Address/Unit No.
Brooklyn Federal Savings Bank, Tokyo Boy Sushi and Chop Stix Restaurant	3780-3790 Nostrand Ave.
U.S. Army recruitment office, Chase Bank, Ashurov Russian Deli, barber shop and two vacant units (3806 and 3808)	3800-3810 Nostrand Ave.
Nail salon, massage therapy, medical office, Bill Med Management, JMB Stores, MMS Medical Management, Kogan/Latkouskaia, 99 cents store, ice cream shop, Viewpoint Optical, Care Pharmacy, one vacant unit (3820T1) and a parking garage	3812-3828 Nostrand Ave.
Silver Star Meats and a vacant unit (3830)	3830-3838 Nostrand Ave.
Cactus restaurant, E and S USA Corp., Alba Management, 99 cent store and a vacant unit (3848 reportedly formerly Newsday Marketeer)	3848-3852 Nostrand Ave.
Impex, Inc., Jill Sullivan, Valevich and Motavalli, Balance Test, Inc., medical office and two vacant units	3858 (S1-T4) Nostrand Ave.

Refer to Sections 10.1 SITE MAPS, 10.2 SITE CONDITION REPORT and 10.4 OWNER/OPERATOR QUESTIONNAIRE.

4.1.3 Storage Tanks

During the LCS site inspection, there was no indication of any on-site USTs or ASTs for the containment of petroleum products (e.g., fill ports, vent pipes, accessways, etc.).

4.1.4 Hazardous or Regulated Materials

Hazardous and/or regulated materials were noted stored and utilized on the subject property at the time of the site inspection. These were as follows:

Material	Storage Location	Approximate Quantities On-Site
Hydraulic oil	55-gallon drum on the parking garage	One drum
Cooking oil	55-gallon drum exterior to the subject property	Several drums
Paint	Less than one-gallon containers in the parking garage	Several drums

There was no evidence of any releases (staining, odors, etc.) in the area of these materials at the time of the site inspection. Relevant MSDS, if provided, are included in the appendix of this report.

There were no visible signs of unidentified substance containers (unlabeled drums, etc.) noted at the time of the site inspection.

4.1.5 Solid, Hazardous or Regulated Waste

Operations on the subject property produce wastes associated with commercial operations. Refuse and recyclables are stored in several dumpsters and transferred off-site by Liberty, Action, Viking, Mr. T and Metro. Hazardous and/or regulated wastes are also generated on-site and are, as detailed below.

Material	Source/Process	Storage/Container Location	Approximate Quantity On-Site	Transporter
Waste cooking oil	Restaurant food preparation	55-gallon drums and 300-gallon dumpster exterior to the subject structures	Several drums and one dumpster	American Byproducts
Medical waste	Medical offices	Approved medical disposal containers	Several	Unknown

Relevant disposal documentation, if provided, is included in the appendix of this report.

4.1.6 Staining, Corrosion, Stressed Vegetation and/or Dead Vegetation

During the LCS site reconnaissance, there were no stained soils, stained pavement, stressed vegetation or corroded surfaces noted on-site.

4.1.7 Fill Dirt or Land Disposal

During the LCS site reconnaissance, there was no evidence of placement of fill dirt or land disposal activities currently or previously conducted on-site.

4.1.8 Wastewaters

Municipal sanitary and storm sewers service the subject property. The exact date of connection is unknown. Operations on the subject property are not believed to produce wastewaters that require treatment or monitoring.

There was no evidence of a current or historic private septic system or cesspool on the subject property. Floor drains were noted in the parking garage and are reportedly connected into the municipal sanitary sewer system. Sump pits were noted in the parking garage of 3812-3828 Nostrand Ave. and the boiler room of 3858 (S1-T4) Nostrand Ave. and are reportedly connected into the municipal sanitary sewer system.

Storm drains are located in the parking lot; these reportedly discharge to the municipal sewer system. There was no evidence of any pits, ponds or lagoons used in connection with waste treatment or waste disposal.

4.1.9 Potable Water Supply/Wells

The subject property is served by a municipal water supply system. There was no evidence of an active or abandoned supply well, drywell, monitoring well or irrigation well on-site.

4.1.10 Air Emissions

There were no process exhaust systems noted on-site at the time of the LCS site investigation.

4.1.11 Suspect PCBs

The following suspect PCB-containing materials were noted on-site.

Suspect PCB Container	Location	Owner	Evidence of Leaks (Y/N)	Labeled (Y/N)
Elevators	One centrally located within 3820 Nostrand Ave.	Private	No	No
Fluorescent lights*	Throughout the subject structures	Private	No	No

*According to ASTM, PCB-containing light ballasts are not considered a recognized environmental condition.

4.1.12 Suspect ACMs

A cursory visual assessment for ACMs was undertaken as a part of this environmental site assessment. At the time of the cursory inspection, there were suspect ACMs located within the subject structures. Asbestos may be present in the following partial list of suspect materials:

Materials*	Location	Condition	Approx. Quantity of Damaged Materials
Ceiling Tiles – 2' x 2' and 2' x 4'	Throughout the subject structures	Good	None
Drywall and plaster	Throughout the subject structure	Good	None
Floor tiles – 12" x 12", 4" x 8" and 16" x 16"	Throughout the subject structures	Good	None

*It should be noted that a cursory visual assessment was conducted by LCS; the observations listed above are based on the limited areas observed during the LCS site reconnaissance, additional suspect materials may be present on-site.

Caution is recommended if renovation and/or remodeling of this facility are to take place. Prior to renovation, remodeling or demolition of this facility, a detailed asbestos inspection and sampling protocol is recommended. All federal, state and local government rules, laws and regulations must be followed.

4.1.13 Suspect Lead Based Paint

The Consumer Product Safety Commission banned the manufacture of lead-based paints for residential and commercial application in 1978; Federal regulations enforced this ban in 1993. Structures completed prior to 1978 may contain lead-based paints. The subject buildings were constructed in 1959, according to the New York City municipal records. The possibility exists for the presence of lead-based paints in the existing structures.

The painted surfaces observed by LCS were in good condition with no significant peeling or chipping paint. If the painted surface(s) peel, chip and/or is intended to be removed, safety precautions should be taken to prevent inhalation or digestion. This cursory lead-based paint review did not include identification of suspect lead-based paint dust associated with windows, doors, etc.

4.1.14 Lead in Drinking Water

As indicated previously, the subject property is supplied with municipal water through the City of New York. Municipal water supplies are regulated under the USEPA to follow drinking water standards. The USEPA action level applicable to municipal potable water supplies and distribution systems is 0.015 mg/L. Although the municipal water supplies are below the USEPA standard, elevated lead levels are commonly a result of the piping systems. Both lead pipes and lead solder account for this elevation in lead within the municipal supplies. No on-site water samples were collected and analyzed for the presence of lead; no testing is recommended at this time.

It should be noted that at the time of the site inspection, lead pipes were not noted within the subject structures. Such are possible due to the age of the subject structures.

4.1.15 Suspect Mold

Mold can germinate and colonize when a food source (i.e., drywall, wood, insulation, paper), a certain temperature and moisture are present. The speed of the growth all depends on the combination of these conditions; roof leaks often lead to accelerated mold growth. The musty odor commonly present with mold is associated with the mVOCs produced by molds. Some, but not all, molds produce a Mycotoxin that is considered a poison and may have negative health effects on humans.

At the time of the site inspection, there were no suspect mold covered areas or mold-related odors noted within the subject structures. This does not preclude the presence of molds in hidden areas (behind walls, moldings, etc.) or the potential for future mold growth.

4.1.16 Other Issues

At the time of the site inspection, there was no evidence of any other issues of concern associated with the subject property.

4.2 ADJACENT SITE USE

The adjacent properties were observed from the subject property at the time of the site reconnaissance. The surrounding property uses include the following:

Direction	Current Use	Apparent Past Use*	Comments
North:	7-11 convenience store	Filling station	There is the potential for impact to the subject property from filling station operations
South:	Playground/park	Park	None
East:	Commercial plaza	Commercial, including drycleaners	There is the potential for impact to the subject property from drycleaners operations
West:	Residential	Residential	None

*Apparent past use is based on the site reconnaissance and other information included within this assessment.

4.3 SUBJECT SITE PHOTOGRAPHS

Photographs of the subject property were taken by LCS on November 21, 2012. Photographs were taken with the objective of documenting the physical condition of the subject property and any improvements thereon. Photographs are included in Section 10.3.

4.4 SUMMARY OF OBSERVATIONS OF POTENTIAL CONCERNS

Based solely on observations made during LCS' site reconnaissance, the following potential concerns were identified:

- Hazardous and/or regulated materials, including hydraulic oil, cooking oil and paint, were noted stored and utilized on-site. Such were noted stored in less than one-gallon containers and 55-gallon drums. No evidence of releases was noted in the area of these materials.

5.0 SUBJECT PROPERTY HISTORY AND USE

The historical use of the subject property has been researched through review of historic maps, historic aerial photographs, municipal records, city directories, historic topographic maps, and/or other reasonably obtainable documents. The following summarizes LCS' historical research.

5.1 HISTORIC AERIAL PHOTOGRAPHS

Historical aerial photographs serve to reveal former topography, buildings, structures, and man made works such as canals, lagoons, and railroads that may have been altered or may no longer be in existence. However, due to the metropolitan nature of the area of the subject property and sufficient historical data collected from additional sources, aerial photographs were not reviewed for this property.

5.2 HISTORICAL MAPS/DIRECTORIES

Sanborn Maps

EDR provided, and LCS reviewed, historical maps dating 1895, 1906, 1930, 1950, 1968, 1969, 1977, 1981, 1982, 1983, 1986, 1987, 1989, 1991, 1992, 1993, 1995, 1996, 2001, 2002, 2003, 2004, 2005, 2006 and 2007. Based on those maps, included within the appendix of this report, the subject property the historical uses and those of adjacent properties are described as below.

YEAR /SITE	OBSERVATIONS
1895	
Subject Property	Vacant lot with a portion of a stable on the northern portion of the property.
North	Developed with stables.
South	Vacant lot. [It should be noted that only a portion of this property appears on the provided maps.]
East	Vacant lot.
West	Vacant lot.
1906	
Subject Property	Vacant lot with a portion of a stable utilized by Coney Island Jockey.
North	Developed with stables utilized by Coney Island Jockey.
South	Vacant lots.
East	Vacant lot.
West	Vacant lots and a small structure on the southern portion.
1930	
Subject Property	Vacant lots.
North	Vacant lots.
South	Vacant lots.
East	Mostly vacant lots and a small green house, office and a private garage.
West	Mostly vacant lots and four dwellings with a private garage on the southern portion.
1950	
Subject Property	Appears similar to the 1930 map.
North	Vacant lots.
South	Vacant lots.
East	Appears similar to the 1930 map; an addition has been added to the greenhouse.
West	Appears similar to the 1930 map.

5.2 HISTORICAL MAPS/DIRECTORIES (continued):

1968 and 1969	
Subject Property	Developed with four of the existing subject structures utilized as a bank, various stores, a drycleaners, First National City Bank and a medical center.
North	Developed with the existing structure utilized as a filling station.
South	Vacant lot
East	Developed with the existing structures (excepting the northernmost structure) utilized as stores, a drycleaners and a bank.
West	Developed with the existing dwellings.
1977	
Subject Property	Four of the existing subject structures utilized as First National City Bank, various stores/commercial, a drycleaners, Brooklyn Federal Savings Bank and a medical center.
North	Not included on this map.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Existing dwellings.
1981 and 1982	
Subject Property	Four of the existing subject structures utilized as First National City Bank, various stores/commercial, a drycleaners and Brooklyn Federal Savings Bank.
North	Not included on this map.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Existing dwellings.
1983	
Subject Property	Appears similar to the 1981 and 1982 maps.
North	Existing structure and utilized as a filling station.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Appears similar to the 1981 and 1982 maps.
1986, 1987, 1989, 1991	
Subject Property	Developed with the existing six subject structures utilized as Brooklyn Federal Savings Bank, a drycleaners, stores, and various commercial uses including a health spa.
North	Appears similar to the 1983 map.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Appears similar to the 1981 and 1982 maps.
1992 and 1993	
Subject Property	Appears similar to the 1986, 1987, 1989 and 1991 maps.
North	Existing structure and utilized commercially.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Appears similar to the 1981 and 1982 maps.

5.2 HISTORICAL MAPS/DIRECTORIES (continued):

1995 and 1996	
Subject Property	Existing subject structures utilized as Brooklyn Federal Savings Bank, a drycleaners, offices, stores and commercial uses.
North	Appears similar to the 1992 and 1993 maps.
South	Appears similar to the 1968 and 1969 maps.
East	Appears similar to the 1968 and 1969 maps.
West	Appears similar to the 1981 and 1982 maps.
2001, 2002, 2003, 2004, 2005, 2006 and 2007	
Subject Property	Appears similar to the 1995 and 1996 maps.
North	Appears similar to the 1992 and 1993 maps.
South	Appears similar to the 1968 and 1969 maps.
East	Developed with the existing structures (including northernmost structure) and utilized as a bank, stores and other commercial uses.
West	Appears similar to the 1981 and 1982 maps.

City Directories

As the historical use of the subject property was adequately determined based on Sanborn maps, directories were not reviewed.

Historic Topographic Maps

The subject property is included on the Coney Island Quadrangle Topographic Map dated 1966, revised 1979. Due to the extensive development in the area of the subject property, individual structures are not indicated on this map.

Other Sources

According to the site contact, the subject property has been utilized commercially, including a photo developing facility, a bank and offices.

5.3 MUNICIPAL RECORDS

Municipal research available through local municipalities was completed by LCS and is summarized below.

Subject Property Information	
Sources	www.nyc.gov and www.oasisnyc.net
SBL No.	7445-1
Size (acres)	1.72
Current Owner	Nostrand Properties
Past Owners	Not indicated in these records
Square Footage of Buildings	66,496 (presumably this is the total square footage of all on-site structures)
Date of Construction	1959
Utilities Provided	Not indicated in these records

5.3 MUNICIPAL RECORDS (continued):

Permits for the subject property include the following.

Permit Date	Nature of Permit	Comments/Concerns
1959 and 1966	Oil burner application for 3824 Nostrand Ave.	Former heating system
1956, 1958, 1959, 1960, 1968 and 1982	New building	None
2009	Elevator application for 3790 Nostrand Ave.	An elevator may be present within this structure.

Certificates of Occupancy for the subject property indicate that the subject property was utilized by the following tenants:

- 3780 Nostrand Avenue:
 - o 1987: retail stores and a bank.
- 3780-3818 Nostrand Avenue:
 - o 1959: stores and a bank.
- 3804 Nostrand Avenue:
 - o 1984 and 1985: 63-car parking in cellar and a shoe store, book store, clothing store, card store and toy store on first floor.
 - o 1987: 69-car parking in cellar, retail stores on the first floor and offices on second floor.
- 3820-3846 AKA 3838 Nostrand Avenue:
 - o 1959: market and parking lot.
 - o 1965: toilets and lounge in cellar and a bank, food store, eating and drinking place, dry goods store and shoe store on first floor.
 - o 1985: toilets and lounge in cellar and a bank.
 - o 1988: a bank, self-service meat market and store.
- 3845 Nostrand Avenue:
 - o 1985: 53-car parking.
- 3848 Nostrand Avenue:
 - o 1985: 53-car parking.
 - o 1987: lobby, utility room and parking on first floor and a health spa on second floor.
- 3860 Nostrand Avenue:
 - o 1987: medical offices on first floor and 22-car parking.

There was no indication of previous site development.

The Abstract of Title Search for the subject property was not available for review.

5.4 PREVIOUS STUDY

No previous studies were supplied to LCS for review relative to the subject property.

5.5 SUMMARY OF HISTORIC USES

The historical use of the subject property has been researched through review of historic maps, historic aerial photographs, municipal records, city directories and/or other reasonably obtainable documents, as detailed below.

Date Range	Apparent Use	Source
At least 1895 through 1906	Mostly vacant land with stables utilized by Coney Island Jockey along northern portion.	Sanborn maps
At least 1930 through at least 1950	Vacant lots	Sanborn maps
1959 through present	Developed with the existing subject structures in stages; utilized for commercial uses including banks, stores, a medical center, health spa and a drycleaners (at least 1968 through at least 1996). According to the site contact, a photo developing lab was historically located on-site.	Sanborn maps, municipal information, site contact and site reconnaissance.

The following recognized environmental conditions were identified based on LCS' historical research.

- The subject property was historically utilized as a drycleaners from at least 1968 through 1996. Additionally, on-site operations may have historically included a photo developing lab.
- The following adjacent property uses of potential environmental concern were identified:
 - o A north adjacent filling station from at least 1968 through 1991.
 - o An east adjacent drycleaners from at least 1968 through 1996.

6.0 PHYSICAL AND HYDROGEOLOGIC SETTING

The subject property is included on the Coney Island Quadrangle Topographic Map dated 1966, revised 1979. Regional groundwater would appear to flow in an easterly direction based on a review of geological/soils and USGS quadrangle maps.

6.1 GEOLOGY

Geologic mapping of the area reveals the underlying bedrock as belonging to the Upper Cretaceous Period, consisting of the Monmouth Group, Matawan Group and Magothy Formation. The subject property area is characterized by silty clay, glauconitic sandy clay, sand and gravel. The thickness of these deposits is variable from zero to 2,000 feet (zero to 600 meters)

Mapping indicates the surficial geology of the area to consist primarily of outwash sand and gravel. This layer is described as well-rounded and stratified coarse to fine gravel with sand, proglacial fluvial deposition, generally finer texture away from ice border. Deposition may be calcerated beyond Wisconsinian glacial limit. The thickness of the deposition is variable from 2 to 20 meters.

6.2 HYDROLOGY

The subject property is situated regionally in the Atlantic Ocean Major Drainage Basin and locally within the Atlantic Ocean Sub-Basin.

The subject property does not have any open water bodies or surficial water bodies located on-site. Surface drainage appears to flow in a direction toward the lowest elevated points on-site and/or toward the closest storm drains on-site. Localized groundwater flow would be influenced by utilities, subsurface structures, etc. A site-specific hydrogeologic study would be required to confirm specific on-site groundwater flow direction.

7.0 REGULATORY INFORMATION/INTERVIEWS

Regulatory information involving the subject property was obtained through a commercial database search company, interviews with local municipalities and/or other knowledgeable persons, FOIA requests, and user-supplied information. The following summarizes LCS' regulatory research.

7.1 DATABASE

Federal and state environmental regulatory information was provided by EDR. [While ASTM-defined radii were used where appropriate, the radii may have been modified due to the size of the site or the nature of the area, as permitted under the ASTM standard. Databases not included in the standard ASTM standard required databases were searched to radii based on LCS' experience.]

Refer to MAP FINDINGS SUMMARY pages within the EDR report for a tabulated list of databases reviewed and sites identified within specified radii.

Any sites unplotable by EDR were also reviewed, to the extent practical based on site name and address, to assess whether they are also present within their appropriate radii. Any listings for the subject property or any adjacent sites are included in the details below.

No sites were identified within the appropriate radii, except for the following:

SUBJECT PROPERTY:

According to the EDR report, the subject property, listed as Supreme Petroleum, Inc. and addressed at 3858 Nostrand Avenue, was identified as a RCRA former Generator (no violations reported) and in the FINDS database due to this RCRA listing. According to the EPA ECHO report (www.epa-echo.gov) for this facility, the RCRA listing is currently inactive.

ADJACENT SITES:

The following adjacent properties were also identified in the EDR report:

- An east adjacent property, listed as Rite Aid #4876 and addressed at 3823 Nostrand Avenue, was identified as a RCRA Conditionally Exempt Small Quantity Generator (no violations reported).
- An east adjacent property, listed as Quality Cleaners/Yongs Cleaners Inc. DBA Quality Cleaners and addressed at 3801 Nostrand Avenue, was identified as the following:
 - o Drycleaners facility.
 - o RCRA former Generator (no violations reported) and in the FINDS and NY Manifest databases due to this RCRA listing.
- An east adjacent property, addressed at 3767 Nostrand Avenue, was identified the following:
 - o Listed as 3767 Nostrand Avenue:
 - As a LTANK/Historic LTANK. Spill No. 9206690 involved a tank test failure and is classified as "closed." [A status of "closed" indicates the spill was remediated and the NYSDEC file closed with no further remediation required.]
 - o Listed as Getty 00238:
 - As a UST/Historic UST site.

7.1 DATABASE (continued):

- An east adjacent property, addressed at 3755 Nostrand Avenue, was identified as the following:
 - o Listed as Al and Selwyn Service Station:
 - Identified as a UST/Historic UST and AST site.
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as “inactive.” [A status of “inactive” indicates the contamination may remain but no further remediation is required]
 - o Listed as Texaco Station:
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as “active.” [A status of “active” indicates further remediation or investigation is necessary.]
- A north adjacent property, addressed at 3768 Nostrand Avenue, was identified as the following:
 - o Listed as Former Gas Station:
 - NYSDEC listed Spills site. Spill No. 1107094 involved the discovery of gasoline contamination in soils while conducting a Phase II investigation and is considered “active” by the NYSDEC.
 - o Listed as S & J Economic Service Ctr. Inc.:
 - UST/Historic UST facility.

OTHER LISTINGS:

The following sites were also identified in the EDR report:

In addition to the sites listed above, there are 30 NYSDEC listed spill sites attributed to LTANKs and 96 additional spill sites located within a one-half mile radius of the subject property. [It should be noted that EDR also includes some of these spills in historic LTANK and historic NY Spills databases.] Of these 126 spill sites, six sites are still considered “active” by the NYSDEC, while the remaining sites are classified as either “inactive” or “closed.” [A status of “closed” indicates the spill was remediated and the NYSDEC file closed with no further remediation required. A status of “inactive” indicates the contamination may remain but no further remediation is required. A status of “active” indicates further remediation or investigation is necessary.] The closest “active” site, listed as Co-Op Building and addressed at 2520 Batchelter Street, is located over one-eighth mile from the subject property and involved the spill of No. 2 fuel oil due to a tank test failure. Based on this limited information, this spill is not likely to pose a significant concern to the subject property. In addition, LCS’ experience suggests the property owner would not be liable for on-site contamination that resulted from such an off-site release. This information is not a potential environmental condition at the subject property based on the listed spill sites due to the “closed” or “inactive” status of many of the listed spills and/or the distance to the subject property.

The discussion included above regarding adjacent and/or nearby properties is based on information supplied to LCS as well as LCS’ observations of nearby properties at the time of the site reconnaissance. It should be noted that any property can be affected by various sources of point and non-point source pollution. The number of reported spills and complaints in the vicinity of the subject property may be an indicator of point source pollution in the area of the subject property. Non-point sources are common in rural areas (e.g., runoff from agricultural fields). Further study would be required to positively confirm whether the subject property has been impacted by nearby properties. Refer to Section 10.5 *REGULATORY INFORMATION*.

7.2 ENFORCEMENT ACTIONS/PERMITTED ACTIVITIES

According to obtainable information to date, there have been no enforcement actions or orders imposed against the referenced subject property.

According to obtainable information to date, the subject property (identified as a former tenant) appears to be subject to RCRA permit activities, as discussed above.

7.3 INTERVIEWS/USER PROVIDED INFORMATION

LCS conducted interviews and/or collected information from regulatory personnel, the property owner and/or occupant, and the user of this report. Results of this task are summarized below.

7.3.1 LOCAL REGULATORY INTERVIEWS

FOIA requests were sent to the NYCDOH and the NYCDEP for information concerning the subject and adjacent sites. As of date of this report, a complete reply has not been received from these offices. Any response information that would alter or affect the findings and conclusions of this report will be forwarded as an addendum to this report when it is received by LCS.

To augment the information provided by EDR, a FOIA request was forwarded to the NYSDEC for information concerning the subject property. To date, a complete response has not been received by this agency.

7.3.2 USER PROVIDED INFORMATION

LCS requested the following information from the user of this report: record of environmental liens currently or historically encumbering the subject property, specialized knowledge or experience that would provide important information about previous ownership or uses of the subject property that may be material to identifying environmental conditions, or the reason for a significantly lower purchase price for the subject property (if applicable). LCS has not been made aware of information relative to these issues by the user.

7.3.3 OWNER/OCCUPANT PROVIDED INFORMATION

The LCS Owner/Operator Questionnaire was forwarded to Mr. Jon Asta on November 21, 2012. As of the date of this report, LCS has yet to receive the completed questionnaire. Any response information that would alter or affect the findings and conclusions of this report will be forwarded as an addendum to this report when it is received by LCS.

7.4 SUMMARY OF REGULATORY INFORMATION/INTERVIEWS

The following recognized environmental conditions were identified based on LCS' review of regulatory information/interviews.

- According to the EDR report, the subject property, listed as Supreme Petroleum, Inc. and addressed at 3858 Nostrand Avenue, was identified as a RCRA former Generator (no violations reported) and in the FINDS database due to this RCRA listing. According to the EPA ECHO report (www.epa-echo.gov) for this facility, the RCRA listing is currently inactive.
- An east adjacent property, listed as Rite Aid #4876 and addressed at 3823 Nostrand Avenue, was identified as a RCRA Conditionally Exempt Small Quantity Generator (no violations reported).
- An east adjacent property, listed as Quality Cleaners/Yongs Cleaners Inc. DBA Quality Cleaners and addressed at 3801 Nostrand Avenue, was identified as the following:
 - o Drycleaners facility.
 - o RCRA former Generator (no violations reported) and in the FINDS and NY Manifest databases due to this RCRA listing.
- An east adjacent property, addressed at 3767 Nostrand Avenue, was identified the following:
 - o Listed as 3767 Nostrand Avenue:
 - As a LTANK/Historic LTANK. Spill No. 9206690 involved a tank test failure and is classified as "closed." [A status of "closed" indicates the spill was remediated and the NYSDEC file closed with no further remediation required.]
 - o Listed as Getty 00238:
 - As a UST/Historic UST site.
- An east adjacent property, addressed at 3755 Nostrand Avenue, was identified as the following:
 - o Listed as Al and Selwyn Service Station:
 - Identified as a UST/Historic UST and AST site.
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "inactive." [A status of "inactive" indicates the contamination may remain but no further remediation is required]
 - o Listed as Texaco Station:
 - Identified as a NY Spills Site. Spill no. 9511527 involved contaminated soil found under a fuel canopy and is classified as "active." [A status of "active" indicates further remediation or investigation is necessary.]
- A north adjacent property, addressed at 3768 Nostrand Avenue, was identified as the following:
 - o Listed as Former Gas Station:
 - NYSDEC listed Spills site. Spill No. 1107094 involved the discovery of gasoline contamination in soils while conducting a Phase II investigation and is considered "active" by the NYSDEC.
 - o Listed as S & J Economic Service Ctr. Inc.:
 - UST/Historic UST facility.

8.0 RADON

Radon is a radioactive gas that occurs naturally from the breakdown of uranium in rock. Radon can be found in high concentrations in soils and rock containing uranium, shale, granite, phosphate and pitchblende. Radon may also be found in soils contaminated with certain types of industrial wastes such as the byproducts from uranium or phosphate mining. Radon gas can move through small fractures in soil and rock and can seep into a structure through dirt floors, cracks in the floors and walls, drains, sumps pipes and pores. Radon has been associated with increased risks of developing lung cancer.


3812-3828 Nostrand Avenue is constructed with a full basement, 3858 (S1-T4) is constructed with a partial basement and the remaining subject structures are a slab-on-grade construction. The USEPA reports that the average indoor radon concentration is estimated to be about 1.3 pCi/L and about 0.4 pCi/L of radon is normally found in the outside air. The NYSDOH Radon Detector Distribution Program report for October 2011 suggests an average basement radon reading of 1.97 pCi/L for Kings County. The NYSDOH recommends taking measures to reduce basement radon concentration to below 4.0 pCi/L. Based on the low average radon concentration for the area of the subject property, radon does not appear to pose a concern to the subject property.

9.0 WETLANDS

Due to the highly developed area in that the subject property is located, the lack of any surficial water bodies on-site and the lack of any surficial soils, no delineated wetlands are suspected on-site or in the immediate area of the subject property.

10.0 APPENDIX

10.1 SITE MAPS

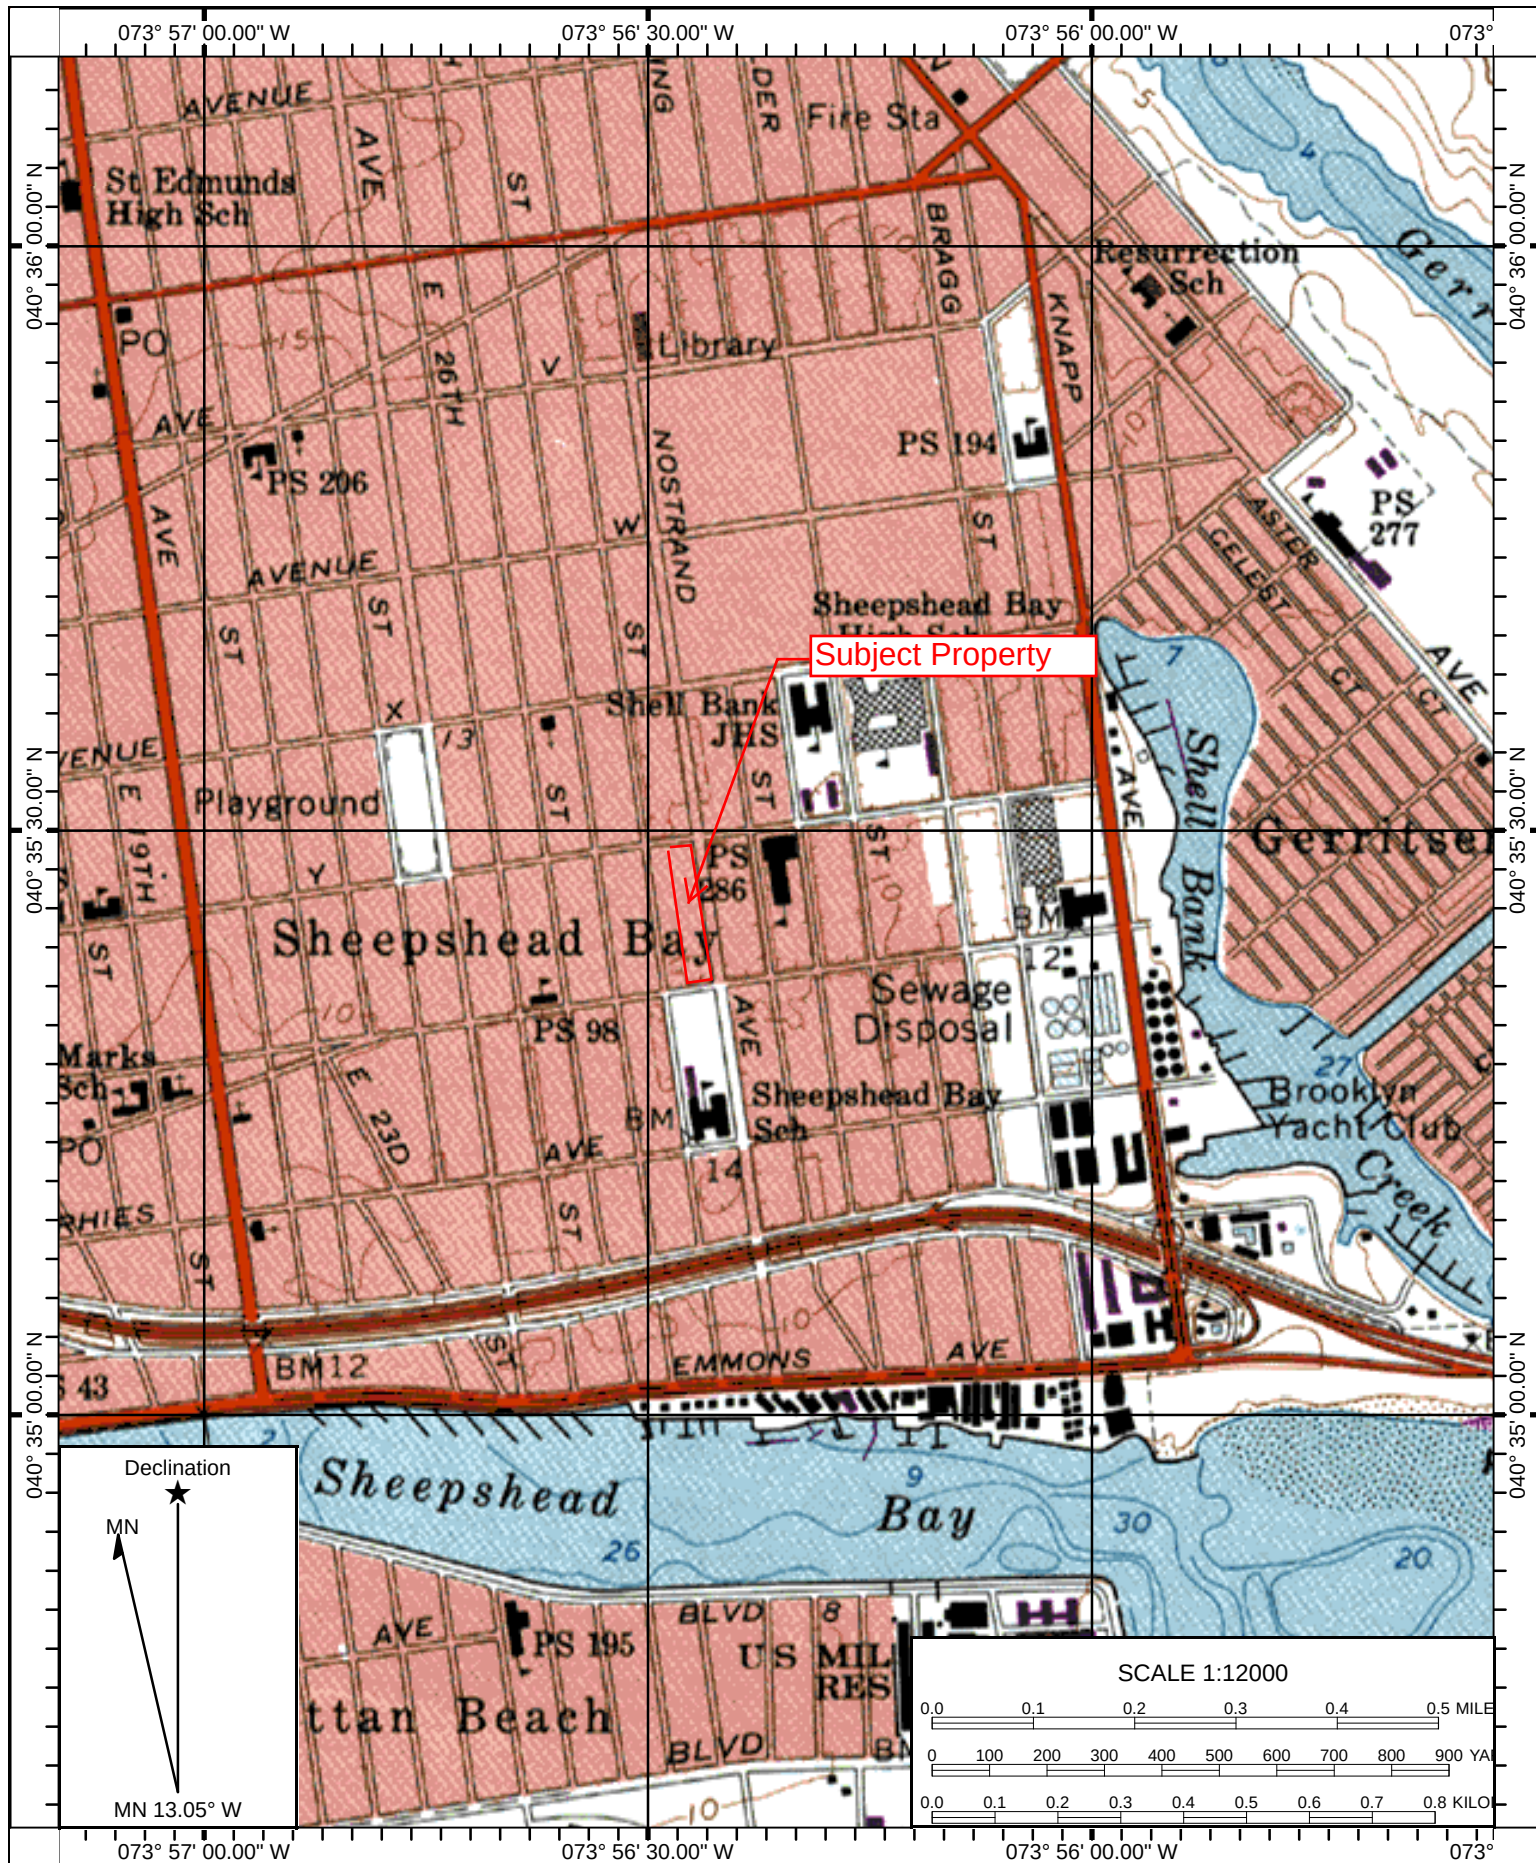

Name: CONEY ISLAND
 Date: 12/03/12
 Scale: 1 inch = 1,000 ft.

Location: 040° 35' 24.28" N 073° 56' 21.35" W
 Map date 1966, Photo revised 1979

Address

Block & Lot


ZIP Code

Neighborhood

Community District

County/Borough

Search

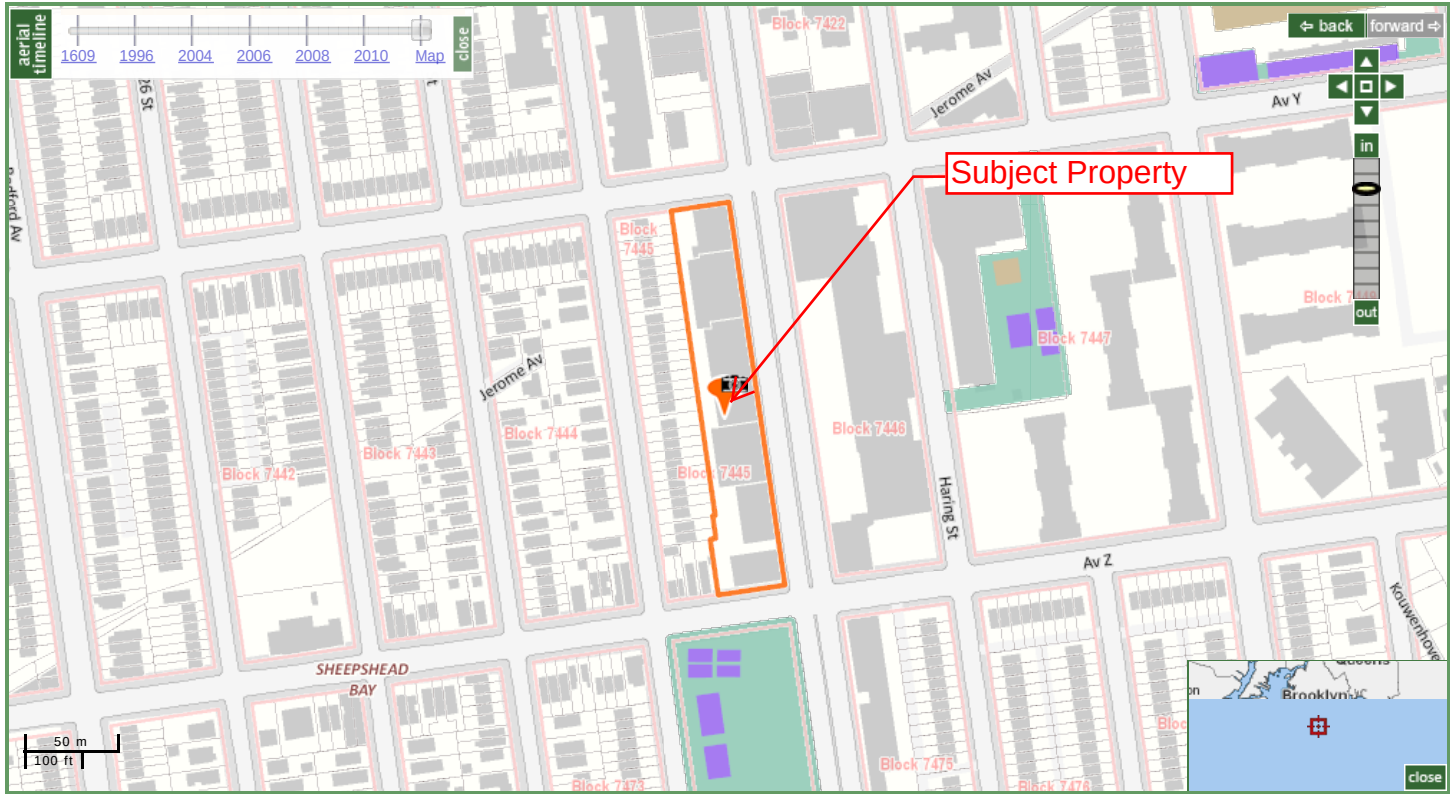

Legend

Location Report (8)

Site Search

Community Data

Property Information (1)

3780 NOSTRAND AVE, BROOKLYN 11235
Alternate address from NYC Dept of City Planning:
3860 NOSTRAND AVENUE
Commercial / Office Building
Owner: NOSTRAND PROPERTIES,
Block: 7445 Lot: 1
Property Characteristics:
Lot Area: 75,300 sq ft (700' x 105')
of Buildings: 6 Year built: 1959
of floors: 2 Building Area: 66,496 sq ft
Total Units: 41 Residential Units: 0
Primary zoning: R4 Commercial Overlay: C2-2
Floor Area Ratio: 0.88 Max. FAR: 0.9
FAR may depend on street widths or other characteristics. Contact [City Planning Dept.](#) for latest information.
MORE INFO:
• Zoning Map#: [29a](#) ([how to read](#) NYC zoning maps)
• Historical Zoning Maps: [29a](#)
• [NYC Dept. of Buildings](#)
• [Property transaction records](#)
• [NYC Dept. of Finance Assessment Roll](#)
• [NYC Digital Tax Map](#)
• [NYC zoning guide](#)
• [NYC Watershed Resources](#)
OASIS shortcut to this property:
<http://oasisnyc.net/map.aspx?zoomto=lot:3074450001>
Source: The Bytes of the Big Apple (TM) PLUTO (TM) and Tax Block & Tax Lot files are copyrighted by the New York City Department of City Planning, 2010 (ver. 10v1).
NYC Department of City Planning Census Factfinder
Find all census tracts within mile(s)
YAHOO! Local search results for this address:
[Know of something that's missing? Add it to YAHOO!](#)

10.2 SITE CONDITION REPORT

**LCS, INC.
SITE CONDITION REPORT**

PROJ. # 12H3984.21 DATE 11-21-12 EMPLOYEE NAME(s) Ryan Ward

PERSONS PRESENT/TITLES Moses Jbarah - Super Yrs. associated w/site 9

Yrs. associated w/site _____

QUESTIONNAIRE (CIRCLE ONE): completed on-site or given to: Jon Asta

LIMITATIONS: Occupied units, stored items

Roof Inspected? (circle) Yes/No

← only one roof inspected

SITE INSPECTION INCLUDED: See building Pages, Property, rear lot

General Site Information				
Name of Site	<u>Commercial</u>			
Site Address	<u>3780-3858 Nostrand Ave</u>			
Municipality, County, State	<u>NYC, Kings, New York</u>			
Fronting Streets	<u>Nostrand Ave, Avenue Y, Avenue Z</u>			
Site Size (acres)	<u>1.72 acres</u>			
Site Topography (circle)	<u>Level at grade</u>	_____ % Slope (N/S/E/W)		
Nearest Water Body	<u>Plumb Beach Channel, Shell bank Creek</u>			
Exterior Conditions/Improvements (circle all that apply)	<u>Outbuildings (#/type)</u> <u>Asphalt Parking areas</u> <u>Concrete sidewalks</u>	Green areas	Trees	Landscaping
Locality (circle)	<u>Urban</u>	Suburban	Rural	
Area Development (circle)	<u>Highly</u>	Moderately	Lightly	
Area Character (circle all that apply)	Industrial	<u>Commercial</u>	Residential	
	Agricultural	Wooded	Fallow	
Grounds (circle all that apply)	Fill material (type/location) _____			
	Dead/stressed vegetation (amt/location) _____			
	Debris/dumping (type/location) _____			
	Storm drains (location/discharge to) <u>muni</u>			

DESCRIPTION OF CURRENT ON-SITE OPERATIONS: Please See Rent Roll attached

according to Contact Commercial 5 Buildings

CURRENT TENANTS: (if multi-tenant, attach list or rent roll) _____

Oasis shows 6

ACCORDING TO THE SITE CONTACT, PAST ON-SITE OPERATIONS INCLUDED (including current buildings and previously developments and DATES): Various Commercial units, Vacant

Photo Developing art, Bank, office space

ACCORDING TO THE SITE CONTACT, HISTORIC TENANTS INCLUDED: unk

**RENT ROLL REPORT
FOR Nostrand Properties, LLC**

AS OF 9/1/12

UNIT REFERENCE NUMBER	OCCUPANT NAME	MONTHLY RENT	SQUARE FEET	RENT PER SQUARE FEET	LEASE STARTING DATE	LEASE EXP DATE	DEPOSITS HELD
30-3780	Investors Bank	20,352.95	3,100.00	78.79/yr 6.57/mth	1/01/72	12/31/22	0.00
30-3788	Ling Hang Li	3,001.36	800.00	45.02/yr 3.75/mth	12/04/03	12/31/17	5,333.34
30-3790	Peking Sun, Inc.	12,373.50	3,300.00	44.99/yr 3.75/mth	5/01/96	4/30/24	22,000.00
30-3800	U. S. Army Recruiting	6,377.88	1,700.00	45.02/yr 3.75/mth	9/01/07	11/30/12	0.00
30-3804	JPMorgan Chase Bank	11,229.17	3,000.00	44.92/yr 3.74/mth	8/11/03	8/31/13	0.00
30-3806	VACANT	0.00	1,700.00	0.00/yr 0.00/mth			0.00
30-3808	VACANT	0.00	2,500.00	0.00/yr 0.00/mth			0.00
30-3810	Ashurov Inc.	4,819.81	1,200.00	48.20/yr 4.02/mth	6/01/07	5/31/17	8,000.00
30-3812	Sensitive Nails	4,445.50	1,200.00	44.46/yr 3.70/mth	1/01/94	12/31/13	10,200.00
30-3814	Bozena Laszczyk	4,287.85	1,100.00	46.78/yr 3.90/mth	7/01/05	6/30/13	3,666.00
30-3816	Oleg Kotelskiy P. C.	6,566.38	2,400.00	32.83/yr 2.74/mth	7/01/06	6/30/16	11,500.00
30-3822	Dollar Store 1-2-3	6,409.63	2,200.00	34.96/yr 2.91/mth	1/01/10	12/31/16	0.00
30-3824	Nostrand Ice Cream	4,057.56	1,200.00	40.58/yr 3.38/mth	8/01/84	6/30/19	14,600.00
30-3826	Viewpoint Optical	3,900.00	1,200.00	39.00/yr 3.25/mth	3/01/98	2/28/18	5,100.00
30-3828	Nostrand RX Corp.	8,548.20	2,200.00	46.63/yr 3.89/mth	5/15/98	3/31/20	16,115.90
30-3830	VACANT	0.00	4,000.00	0.00/yr 0.00/mth			0.00
30-3838	Silver Star Meats	13,333.33	6,000.00	26.67/yr 2.22/mth	12/01/68	5/31/22	10,000.00
30-3848	VACANT	0.00	6,700.00	0.00/yr 0.00/mth			0.00
30-3850	Ai Hua Huang - Cactus	2,952.00	1,200.00	29.52/yr 2.46/mth	10/01/04	9/30/19	4,600.00
30-3851	E & S USA Corporation	4,326.00	1,900.00	27.32/yr 2.28/mth	11/13/09	11/30/19	10,847.48
30-3852	ALBA Management	8,103.38	3,600.00	27.01/yr 2.25/mth	7/01/02	4/30/19	14,000.00
30-3810A	Arie Express, Inc.	1,600.00	800.00	24.00/yr 2.00/mth	9/01/10	8/31/15	3,500.00
30-3820G	LAZ Parking of NY/NJ, LLC	1,500.00	0.00	0.00/yr 0.00/mth	6/01/08	5/31/13	8,000.00
30-3820S1	BillMed Management	1,900.00	877.00	26.00/yr 2.17/mth	12/01/11	1/31/14	3,800.00
30-3820S2	JMB Stores Inc.	3,400.00	1,800.00	22.67/yr 1.89/mth	6/01/11	5/31/16	6,800.00
30-3820S3	MMS Medical Management Inc	3,107.44	1,500.00	24.86/yr 2.07/mth	1/01/09	12/30/13	5,687.50
30-3820S7	VACANT	0.00	2,884.00	0.00/yr 0.00/mth			0.00
30-3820S8	I. Kogan / A. Latkovskaia	4,305.00	1,863.00	27.73/yr 2.31/mth	8/01/11	7/31/18	8,610.00

**RENT ROLL REPORT
FOR Nostrand Properties, LLC**

UNIT REFERENCE NUMBER	OCCUPANT NAME	MONTHLY RENT	SQUARE FEET	RENT PER SQUARE FEET	LEASE STARTING DATE	LEASE EXP DATE	DEPOSITS HELD
30-3820S9	Billmed Management, LLC	6,303.75	3,875.00	19.52/yr 1.63/mth	2/10/09	1/31/14	12,000.00
30-3820T1	VACANT	0.00	2,876.00	0.00/yr 0.00/mth			0.00
30-3858S1	VACANT	0.00	3,200.00	0.00/yr 0.00/mth			0.00
30-3858S2	VACANT	0.00	1,000.00	0.00/yr 0.00/mth			0.00
30-3858S3	Impex Inc.	2,513.27	1,600.00	18.85/yr 1.57/mth	10/01/08	9/30/13	0.00
30-3858T1	Jill Sullivan	4,181.59	1,350.00	37.17/yr 3.10/mth	5/01/98	5/31/13	6,100.00
30-3858T2	I. Valevich and H. Motavalli	2,207.31	1,100.00	24.08/yr 2.01/mth	6/01/08	6/30/13	4,000.00
30-3858T3	Balancetest, Inc	2,250.00	1,200.00	22.50/yr 1.88/mth	10/01/11	9/30/16	4,500.00
30-3858T4	Dr. Costa	3,700.00	1,400.00	31.71/yr 2.64/mth	3/01/93	5/31/13	7,657.00

PROPERTY TOTALS :

		<u>Percentage of Occupied Units</u>	
Total Occupied Rents	162,052.86	Total Occupied Units	29
Total Vacant Rents	0.00	Total Vacant Units	8
Total Gross Rents	162,052.86	Total Units	37
Total Square Footage	79525	Percentage Occupied	78%
Average Rent/Sq. Ft. /Yr.	24.45	<u>Percentage of Occupied Sq. Feet</u>	
Average Rent/Sq. Ft. /Mth	2.04	Total Occupied Sq. Feet	54,665
Total Security Deposits	206,617.22	Total Vacant Sq. Feet	24860
		Total Square Footage	79525
		Percentage Occupied	69%

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6**Building Information**

Building Name: <u>Com</u>	Building Construction Date				
Sq. Ft. of Building: <u>7,200</u>	No. Stories: <u>1</u>				
Building Use(s)/Operations <u>See Notes</u>					
Heating System/Location: <u>HVAC / Roof</u>	Heat Source: <u>Natural Gas</u>				
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>					
Water source (circle): <u>Municipal</u> / Private	Sanitary System (circle): <u>Municipal</u> / Private (septic)				
Basement (circle): <u>Full</u> / Partial / ~~None~~					
Building Condition (circle)	Excellent	Good	Fair	Poor	
Building Envelope (circle)	Block	Poured Concrete	Steel	Wood	Brick
Siding (circle)	Wood	Aluminum	Vinyl	Asbestos	Transite Brick
Roof (circle)	<u>Flat</u>	Peaked	Flashings	Mansard	
Elevator (circle)	<u>No</u> / Yes (location) _____			Pit? : _____	
Floor drains (circle)	<u>No</u> / Yes (location) _____			Discharge to: _____	
Sump pit (circle)	<u>No</u> / Yes (location) _____			Discharge to: _____	

NOTES:

3780 - Brooklyn Federal Savings
3788 - Tokyo Bay Sushi
3790 - Chop Stix - Restaurant

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6

Building Information	
Building Name: <u>Com</u>	Building Construction Date
Sq. Ft. of Building: <u>10,100</u>	No. Stories: <u>1</u>
Building Use(s)/Operations: <u>See Notes</u>	
Heating System/Location: <u>HVAC / Roof</u>	Heat Source: <u>Natural Gas</u>
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>	
Water source (circle): <u>Municipal</u> / Private	Sanitary System (circle): <u>Municipal</u> / Private (septic)
Basement (circle): <u>Full</u> / Partial / <u>None</u>	
Building Condition (circle): <u>Excellent</u> Good Fair Poor	
Building Envelope (circle): <u>Block</u> Poured Concrete Steel Wood Brick	
Siding (circle): <u>Wood</u> Aluminum Vinyl Asbestos Transite Brick	
Roof (circle): <u>Flat</u> Peaked Flashings Mansard	
Elevator (circle): <u>No</u> / Yes (location) _____	Pit? : _____
Floor drains (circle): <u>No</u> Yes (location) _____	Discharge to: _____
Sump pit (circle): <u>No</u> / Yes (location) _____	Discharge to: _____

NOTES:

3800 - US Army Recruiter

3804 - Chase Bank

* 3806 - Vacant - Was Photo Lab

3808 - Vacant - Unk

3810 - Ashurav Inc - Russian Deli

3810A - Barber Shop

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6

Building Information	
Building Name: <u>Com</u>	Building Construction Date
Sq. Ft. of Building: <u>27,175 + Parking Garage</u>	No. Stories: <u>2</u>
Building Use(s)/Operations: <u>See Notes</u>	
Heating System/Location: <u>HVAC / Roof</u>	Heat Source: <u>Natural Gas</u>
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>	
Water source (circle): <u>Municipal</u> / Private	Sanitary System (circle): <u>Municipal</u> / Private (septic)
Basement (circle): <u>Full</u> / Partial / None	
Building Condition (circle): <u>Excellent</u> / Good / Fair / Poor	<u>Parking Garage</u>
Building Envelope (circle): <u>Block</u> / Poured Concrete / Steel / Wood / Brick	
Siding (circle): <u>Wood</u> / Aluminum / Vinyl / Asbestos / Transite / Brick	
Roof (circle): <u>Flat</u> / Peaked / Flashings / Mansard	
Elevator (circle): <u>No</u> / <u>Yes (location)</u> <u>Central</u>	Pit?: <u>unk</u>
Floor drains (circle): <u>No</u> / <u>Yes (location)</u> <u>Parking garage</u>	Discharge to: <u>muni</u>
Sump pit (circle): <u>No</u> / <u>Yes (location)</u> <u>Parking garage</u>	Discharge to: <u>muni</u>

NOTES:

3812 - Nail Salon3814 - ~~Medical office~~ Massage Therapy3816 - medical officeSecond Fl Suites - 3820 S1 - BillMed Management3820 S2 - JMB Stores Inc3820 S3 - MMS Medical Management Inc3820 S7 - Vacant - Unk3820 S8 - Kagan / Latkouskaia - Unk3820 S9 - Billmed Management LLC3820 T1 - Vacant - unkWalk
Hallway
on 2nd
Floorinspected 3820 G - Underground parking Garageinspected 3822 - 99¢ Store3824 - Ice Cream Shop3826 - Viewpoint Optical3828 - Care Pharmacy

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6

Building Information					
Building Name: <u>Com</u>			Building Construction Date		
Sq. Ft. of Building: <u>10,000</u>			No. Stories: <u>1</u>		
Building Use(s)/Operations: <u>See Notes</u>					
Heating System/Location: <u>HVAC / Roof</u>			Heat Source: <u>Natural gas</u>		
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>					
Water source (circle): <u>Municipal</u> / Private Sanitary System (circle): <u>Municipal</u> / Private (septic)					
Basement (circle): Full / Partial / <u>None</u>					
Building Condition (circle): Excellent Good Fair Poor					
Building Envelope (circle): Block Poured Concrete Steel Wood Brick					
Siding (circle): Wood Aluminum Vinyl Asbestos Transite Brick					
Roof (circle): <u>Flat</u> Peaked Flashings Mansard					
Elevator (circle): <u>No</u> / Yes (location) _____ Pit? : _____					
Floor drains (circle): <u>No</u> / Yes (location) _____ Discharge to: _____					
Sump pit (circle): <u>No</u> / Yes (location) _____ Discharge to: _____					

NOTES:

3830 - Vacant - was CitiBank
3838 - Silver Star Meats

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6

Building Information	
Building Name: <u>Com</u>	Building Construction Date
Sq. Ft. of Building: <u>13,400</u>	No. Stories: <u>2</u>
Building Use(s)/Operations: <u>See Notes</u>	
Heating System/Location: <u>HVAC / Roof</u>	Heat Source: <u>Natural Gas</u>
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>	
Water source (circle): <u>Municipal</u> / Private	Sanitary System (circle): <u>Municipal</u> / Private (septic)
Basement (circle): <u>Full</u> / Partial / <u>None</u>	
Building Condition (circle): <u>Excellent</u> <u>Good</u> <u>Fair</u> <u>Poor</u>	
Building Envelope (circle): <u>Block</u> <u>Poured Concrete</u> <u>Steel</u> <u>Wood</u> <u>Brick</u>	
Siding (circle): <u>Wood</u> <u>Aluminum</u> <u>Vinyl</u> <u>Asbestos</u> <u>Transite</u> <u>Brick</u>	
Roof (circle): <u>Flat</u> <u>Peaked</u> <u>Flashings</u> <u>Mansard</u>	
Elevator (circle): <u>No</u> / Yes (location) _____	Pit? : _____
Floor drains (circle): <u>No</u> / Yes (location) _____	Discharge to: _____
Sump pit (circle): <u>No</u> / Yes (location) _____	Discharge to: _____

NOTES:

→ This roof was the only roof inspected
inspected → 3848 - Vacant - was Newsday Market
3850 - Cactus
3851 - ~~9848~~ EandS USA Corp - Unk
3852 - Alba Management - X-Rays ← woman on site said fight
inspected → 3850B - 99 & Store

STRUCTURES

NOTE: ALWAYS USE ONE SHEET PER STRUCTURE

TOTAL NO. OF BUILDINGS ON-SITE: 6

Building Information	
Building Name: <u>Com</u>	Building Construction Date
Sq. Ft. of Building: <u>10,850</u>	No. Stories: <u>2 - 1 floor Partial Below grade</u>
Building Use(s)/Operations: <u>See Notes</u>	
Heating System/Location: <u>HVAC / Roof</u>	Heat Source: <u>Natural gas</u>
Utilities Provided (circle): <u>Natural gas</u> <u>Electric</u>	
Water source (circle): <u>Municipal</u> / Private	Sanitary System (circle): <u>Municipal</u> / Private (septic)
Basement (circle): <u>Full</u> / <u>Partial</u> / None	<u>Boiler Room lower than fl below grade</u>
Building Condition (circle): <u>Excellent</u> <u>Good</u> <u>Fair</u> <u>Poor</u>	
Building Envelope (circle): <u>Block</u> <u>Poured Concrete</u> <u>Steel</u> <u>Wood</u> <u>Brick</u>	
Siding (circle): <u>Wood</u> <u>Aluminum</u> <u>Vinyl</u> <u>Asbestos</u> <u>Transite</u> <u>Brick</u>	
Roof (circle): <u>Flat</u> <u>Peaked</u> <u>Flashings</u> <u>Mansard</u>	
Elevator (circle): <u>No</u> / Yes (location) _____	Pit? : _____
Floor drains (circle): <u>No</u> / Yes (location) _____	Discharge to: _____
Sump pit (circle): <u>No</u> / Yes (location) <u>Boiler Room</u>	Discharge to: <u>muni</u>

NOTES:

3858 S1 - Vacant - unk ← inspected

3858 S2 - Vacant - unk

3858 S3 - Impex Inc - Unk ← inspected

3858 T1 - Jill Sullivan - Unk

3858 T2 - Valovich and Motavalli - unk

3858 T3 - Balancetest, Inc - unk

3858 T4 - Dr. Costa - Medical office

UTILITIES PROVIDED BY: NAT. GAS Natural gas ELECTRIC Con ed
 SEWER (circle): MUNICIPAL Connection date: unk PROVIDED BY: NYC
 PRIVATE SEPTIC/ Date of last passed percolation test: _____

WATER (circle): MUNICIPAL PROVIDED BY: NYC
 WELL (location) _____

EVIDENCE OF FORMER HEATING SYSTEM? (circle) NO YES, TYPE _____
 EVIDENCE OF FORMER SEPTIC SYSTEM? (circle) NO YES, LOCATION _____

DRYWELLS/INJECTION WELLS:

LOCATIONS: _____ DEPTH: _____
 USE OF WELL: _____ SAMPLE RESULTS: _____

PCBs:

Suspect PCB Container	#/Location	Owner	Evidence of Leaks (Y/N)	Labeled (Y/N)
Transformer (pole-mounted)				
Transformer (pad-mounted)				
Lifts				
<u>Elevators</u>	<u>1 / 3820 Center</u>	<u>Private</u>	<u>N</u>	<u>N</u>
Fluorescent lights	<u>T/O</u>	<u>Private</u>	<u>N</u>	<u>N</u>

BULK STORAGE TANKS: Total # USTs on-site: _____ Total # ASTs on-site: _____
 Total # vents: _____ Total # fills: _____ Total # monitoring wells: _____

Characteristics	Tank #1	Tank #2	Tank #3
AST/UST			
Location			
Registered/Permitted (Dates)			
Date of Last Test			
Capacity			
Product			
Single/Double Walled			
Age			
Type of Monitoring System			
Any releases/spills?			
Status (circle)	Active Inactive Closed	Active Inactive Closed	Active Inactive Closed

EVIDENCE OF ADDITIONAL USTs (VENT PIPES/FILL PORTS, ETC.; LOCATION): _____

WERE ANY USTs **EXCAVATED** FROM or **FILLED** IN-PLACE ON PROPERTY? DATE: _____
 CONTRACTOR NAME: _____ DOCUMENTATION AVAILABLE? _____
 CONDITIONS IN AREA OF FORMER USTs (stained, stressed, dead vegetation/surfaces) _____

LEAD:

Material/surface	Location	Approx. Quantity of Damaged Materials
Walls <i>Drywall</i>	<i>T/O / all areas inspected</i>	<i>Minimal</i>
Ceilings <i>Tile</i>	<i>T/O / ~~part~~ are all inspected areas</i>	
Pipes, soldering		

ANY PREVIOUS LBP TESTING CONDUCTED ON-SITE? ____ NO ____ YES (obtain copy)

ASBESTOS:

Year Built _____

Materials	Sizes/ Location	Condition (good, fair, poor)	Approx. Quantity of Damaged Materials
Ceiling Tiles	<i>2x4 2x2</i>	<i>good</i>	
Drywall and plaster	<i>T/O</i>	<i>↓</i>	
Floor tiles	<i>12x12 4x8 16x16 Subway</i>		
Roofing felts and/or materials			
Spray on fireproofing			
HVAC system insulating materials			

IF UNDERGOING RENOVATION: IS O & M PLAN IN-PLACE? ____ WAS ACM SURVEY DONE? ____

ODORS: (circle)

SOLVENTS

NATURAL GAS

PETROLEUM

OTHER

LOCATION: _____

SUSPECT MOLD:

Location	Approximate Quantity

IS THERE EVIDENCE OF MOISTURE AND/OR MUSTY ODORS? ☒ NO ____ YES

IF SO, WHERE? _____

Did LCS observe evidence of significant amounts of suspected mold growth within the subject building? If so, what type of material was impacted and the square footage of that impact?

No ☒ Yes ____ Explain: _____

Did LCS note any moldy odors within the subject building?

No ☒ Yes ____ Explain: _____

Did LCS observe evidence of ponding on the roof of the subject building?

Roof not inspected ☒ No ☒ Yes ____ Explain: _____

Did LCS observe evidence of excessive patching on the roof of the subject building?

Roof not inspected ☒ No ☒ Yes ____ Explain: _____

Did LCS observe any water staining, standing water or discoloration on any walls, floors, ceilings or other building materials? If so, what type of material was impacted and the square footage of that impact?

No ☒ Yes ____ Explain: _____

Areas inspected showed no

SUSPECT MOLD (continued):

Did LCS observe any evidence of flooding, plumbing/sewer leaks, roof/window leaks, groundwater intrusion or discharge of a sprinkler system within the subject building?

No ☒ Yes ☐ Explain: _____

Did LCS observe any areas of high humidity (e.g., indoor pools, spas, whirlpools, saunas, decorative fountains) located within the subject building? If so, was there any evidence of water staining or standing water within such areas?

No ☒ Yes ☐ Explain: _____

Did LCS observe any heat exchangers/cooling towers within any mechanical areas of the subject building? If so, was there any evidence of water staining or standing water within such areas?

No ☒ Yes ☐ Explain: _____

PERMITS (IF YES, OBTAIN COPIES): (circle)

NPDES/SPDES RCRA HAZ. WASTE SEWER DISCHARGE AIR EMISSIONS OTHER

HAZARDOUS MATERIALS:

Material	Source/Process	Storage Container/Location	Approx. Quantity On-Site	Condition
Cleaning supplies				
~~Hydraulic Fluid~~		55gal Drum Parking garage	1	good
~~Possible cooking oil~~		55gal Drum Rear parking	several	Fair
Paint		41gal Parking lot garage	several	good

ADEQUATE STORAGE PRACTICES? (circle) NO YES (Add comments if no.)

MSDS'S (circle) NO YES (COPIES OR REVIEWED ON-SITE)
HAZARD COMMUNICATION PROGRAM? NO YES

55-GALLON DRUMS/BARRELS OTHER CONTAINERS:

LIST AMOUNT, CONTENTS, LOCATION, LABELED, CONDITION:

Hydraulic Fluid
Possible waste cooking oil

WASTES: All Building and in some cases unit have different Transporters ↓

Material	Source/Process	Storage Container/ Location	Approx Quantity On-Site	Condition	Transporter
Solid		Dumpsters	several	good	
Recycling		Piles of Cardboard	several	good	
Waste oil		55gal drums	several	good	Several Private
Cooking		300 gal Dumpster			
Medical waste		approved containers	Few	good	unk

Liberty
Action
Viking
mr T
metro

→ American
By Products
Recycling
one that
was labeled

Obtain copies of disposal receipts, if available.

DRY CLEANERS:
CURRENT MACHINE
LOCATION OF MACH
FORMER MACHINE T
HOW LONG HAS DRY

CURRENT MACHINE TYPE? _____ AGE OF CURRENT MACHINE? _____

LOCATION OF MACHINE (basement, 1st floor, etc): _____

FORMER MACHINE TYPE? _____

HOW LONG HAS DRY CLEANING BEEN CONDUCTED ON-SITE?

FILM DEVELOPING/X-RAYS
SILVER RECOVERY S
LEAD LINED WALLS

SILVER RECOVERY SYSTEM IN PLACE? NO YES

LEAD LINED WALLS FOR X-RAY ROOMS? NO YES

ADJACENT PROPERTIES:


List names and type of operations adjacent and next adjacent to subject property.

Park →
strip
mail

~~GENERATORS:~~ (firing source?) _____ ~~COMPRESSORS:~~ (releases?) _____

ADDITIONAL NOTES:

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There are approximately 20 lines visible. The paper appears to be a standard notebook page.

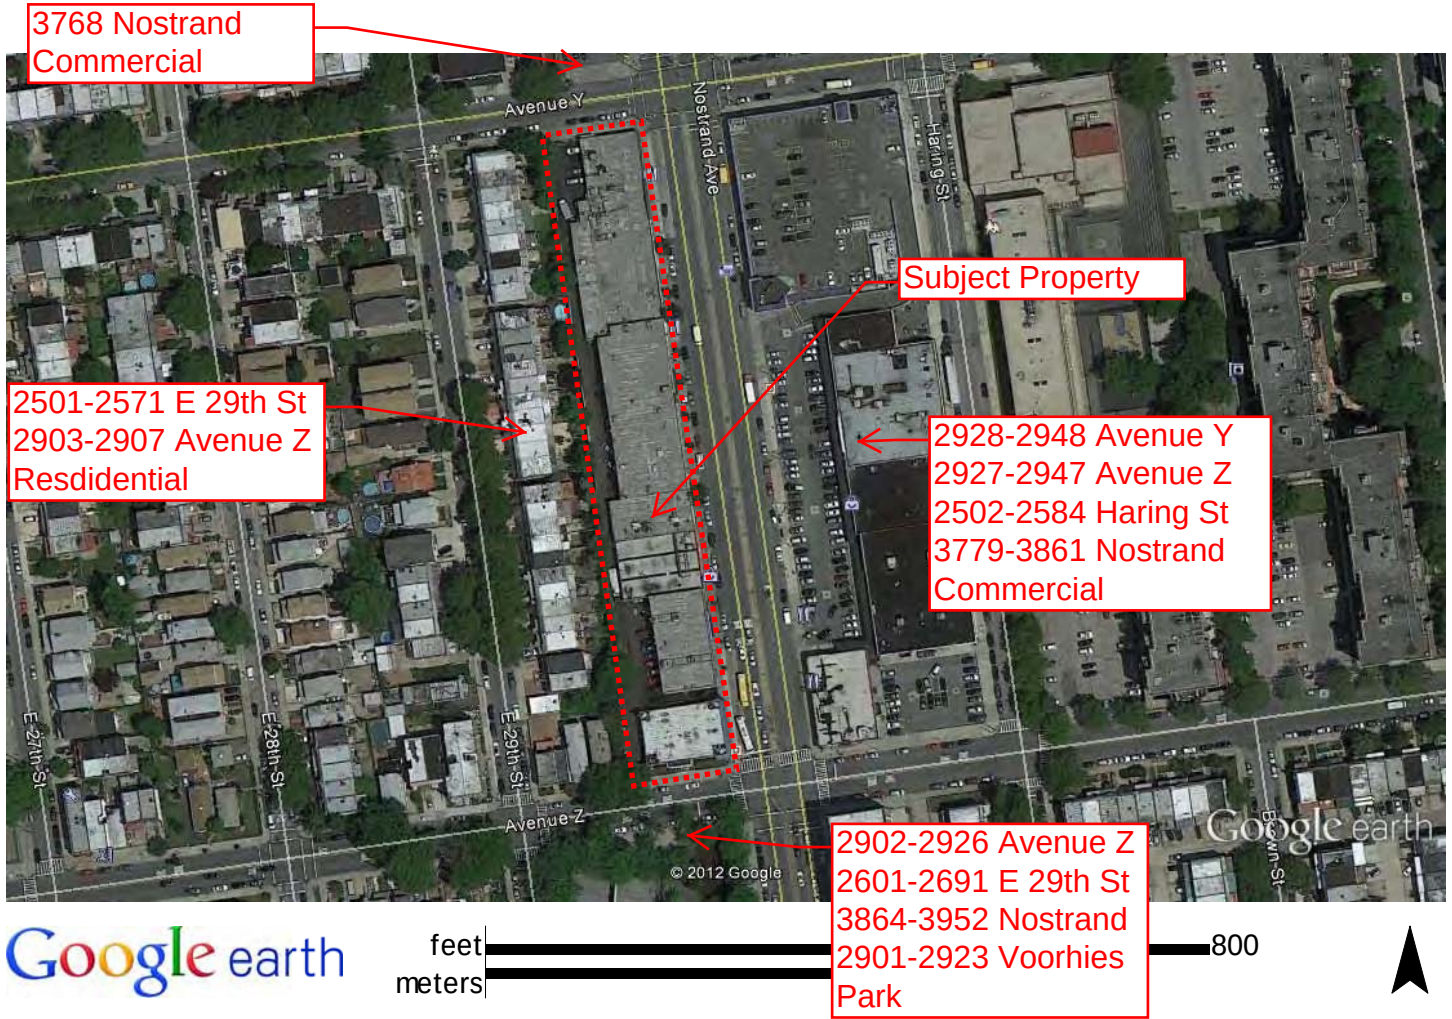

10.3 SITE PHOTOGRAPHS

PHOTOGRAPH VIEWS

Photo 1:



Photo 2:



Photo 3:



Photo 4:



Photo 1: View of the east side of subject property

Photo 2: View of the north side of subject property

Photo 3: View of the west side of subject property

Photo 4: View of the south side of subject property

LCS, INC.
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202
Project No. 12H3984.21 Photo Date: 11/21/12

SITE PHOTOGRAPHS
Commercial Plaza
3848 Nostranve Ave. (also known as 3780-3858 Nostrand
Ave.)
Borough of Brooklyn, New York

PHOTOGRAPH VIEWS

Photo 1:



Photo 2:



Photo 3:



Photo 4:



Photo 1: View of the HVAC unit

Photo 2: View of the stored paint

Photo 3: View of the sump pump

Photo 4: View of the sump pump

LCS, INC.
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202
Project No. 12H3984.21 Photo Date: 11/21/12

SITE PHOTOGRAPHS
Commercial Plaza
3848 Nostranve Ave. (also known as 3780-3858 Nostrand
Ave.)
Borough of Brooklyn, New York

PHOTOGRAPH VIEWS

Photo 1:



Photo 2:



Photo 3:



Photo 4:



Photo 1: View of the stored hydraulic fluid

Photo 2: View of the elevator system

Photo 3: View of the used cooking oil tank

Photo 4: View of the typical storm drain

LCS, INC.
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202
Project No. 12H3984.21 Photo Date: 11/21/12

SITE PHOTOGRAPHS
Commercial Plaza
3848 Nostranve Ave. (also known as 3780-3858 Nostrand
Ave.)
Borough of Brooklyn, New York

PHOTOGRAPH VIEWS

Photo 1:



Photo 2:



Photo 3:



Photo 4:



Photo 1: View of the typical interior

Photo 2: View of the typical interior

Photo 3: View of the typical interior

Photo 4: View of the parking garage

LCS, INC.
 40 LA RIVIERE DRIVE, SUITE 120
 BUFFALO, NEW YORK 14202
 Project No. 12H3984.21 Photo Date: 11/21/12

SITE PHOTOGRAPHS
 Commercial Plaza
 3848 Nostranve Ave. (also known as 3780-3858 Nostrand
 Ave.)
 Borough of Brooklyn, New York

PHOTOGRAPH VIEWS

Photo 1:



Photo 2:



Photo 3:



Photo 4:



- Photo 1: View of the east adjacent property
- Photo 2: View of the north adjacent property
- Photo 3: View of the west adjacent property
- Photo 4: View of the south adjacent property

LCS, INC. 40 LA RIVIERE DRIVE, SUITE 120 BUFFALO, NEW YORK 14202 Project No. 12H3984.21 Photo Date: 11/21/12	<u>SITE PHOTOGRAPHS</u> Commercial Plaza 3848 Nostranve Ave. (also known as 3780-3858 Nostrand Ave.) Borough of Brooklyn, New York

10.4 OWNER/OPERATOR QUESTIONNAIRE

The LCS Owner/Operator Questionnaire was forwarded to Mr. Jon Asta on November 21, 2012. As of the date of this report, LCS has yet to receive the completed questionnaire. Any response information that would alter or affect the findings and conclusions of this report will be forwarded as an addendum to this report when it is received by LCS.

10.5 REGULATORY INFORMATION



CORPORATE OFFICES
WATERFRONT VILLAGE
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202

TEL: 800.474.6802
716.845.6145
FAX: 716.845.6164
www.lenderconsulting.com

December 3, 2012

NYS Department of Environmental Conservation
Hunters Point Plaza
47-40 21st Street
Long Island City, New York 11101-5407
r2foil@gw.dec.state.ny.us

RE: Records Review Request For File No. 12H3984.21
PLEASE REFERENCE THIS # WHEN RESPONDING

Dear Sir/Madam:

Our firm is performing an Environmental Assessment of a real property located within the jurisdiction of NYSDEC Region 2. Under the Freedom of Information Law (FOIL), I am writing to request that a review be made of NYSDEC Region 2 department records, which are relevant to the purpose of this Phase I Assessment. Please forward this FOIL request to the following NYSDEC departments for review of department records, if available with regards to the subject site or facility(s) (referenced below).

- 1) Regulatory Services - permits and registrations (active and inactive).
- 2) Law Enforcement/Legal Affairs/Env. Enforcement - complaint/notice of violation files, legal proceedings.
- 3) Solid and Hazardous Waste - site files for active and inactive sites associated with the subject address.
- 4) Petroleum Bulk Storage - tank closure reports, registered facilities.
- 5) Air/Water Division - air and water quality issues/violations and contaminated public wells.
- 6) NYSDEC Site Inspection Reports associated with the subject address.
- 7) Spills Division - record of petroleum/chemical releases.

SITE: Commercial
STREET ADDRESS: 3780-3858 Nostrand Ave
MUNICIPALITY: NYC
COUNTY: Kings
CURRENT OWNER(S): Nostrand Properties
PAST OWNER(S): Unknown
PAST USE: Unknown
PRESENT USE: Mixed commercial
SIZE: 1.72 acres
BLOCK, LOT #: 7445, 1

Please forward all written responses or documents to the attention of Stephanie LaPlaca at our Corporate Office (address above) or slaplaca@lenderconsulting.com. If you have any questions regarding this request for information or to contact an individual from LCS to come in and review the file, please contact me at 646-660-4492 or rward@lenderconsulting.com. The information that you provide is greatly appreciated.

Sincerely,

Ryan Ward
Environmental Analyst
Lender Consulting Services, Inc.



Enforcement & Compliance History Online (ECHO)

You are here: [EPA Home](#) » [Compliance and Enforcement](#) » [ECHO](#) » [Search Data](#) » Search Results

Detailed Facility Report


[Report Error](#)
[Data Dictionary](#)

For Public Release - Unrestricted Dissemination Report Generated on 12/05/2012
US Environmental Protection Agency - Office of Enforcement and Compliance Assurance

Gray text in this report indicates information that is not required to be reported to EPA. These data, typically regarding non-major or smaller facilities, are often incomplete.

Facility Permits and Identifiers

[Data Dictionary](#)

Statute	System	Source ID	Facility Name	Street Address	City	State	Zip	
	FRS	110004368345	SUPREME PETROLEUM INC	3858 NOSTRAND AVE	BROOKLYN	NY	11235	
RCRA	RCR	NYD074333113	SUPREME PETROLEUM INC	3858 NOSTRAND AVE	BROOKLYN	NY	11235	

Facility Characteristics

[Data Dictionary](#)

Statute	Source ID	Universe	Status	Areas	Permit Expiration Date	Latitude/ Longitude	Indian Country?	SIC Codes	NAICS Codes	
	110004368345					LRT: 40.589681 , -73.939920	No			
RCRA	NYD074333113		Inactive			40.5897 , -73.9399	No			

If the CWA permit is past its expiration date, this normally means that the permitting authority has not yet issued a new permit. In these situations, the expired permit is normally administratively extended and kept in effect until the new permit is issued.

For the RCRA program, activities that contribute to an overall facility status of Active are displayed in parentheses using the acronym HPACS, where H indicates handler activities, P - permitting, A - corrective action, C - converter, and S - state-specific. More information is available in the Data Dictionary.

Inspection and Enforcement Summary Data

[Data Dictionary](#)

Statute	Source ID	Insp. Last 05Yrs	Date of Last Inspection	Formal Enf Act Last 05 Yrs	Penalties Last 05 Yrs	
RCRA	NYD074333113	0	Never	0	\$00	

Compliance Monitoring History (05 years)

[Data Dictionary](#)

Statute	Source ID	System	Inspection Type	Lead Agency	Date	Finding	
- No data records returned.							

Entries in *italics* are not considered inspections in official counts.

Compliance Summary Data

[Data Dictionary](#)

Information on the nature of [alleged violations](#) is available on the FAQ page.

Statute	Source ID	Current SNC/HPV?	Description	Current As Of	Qtrs in NC (of 12)	
RCRA	NYD074333113	No		11/09/2012	0	

Three Year Compliance Status by Quarter

[Data Dictionary](#)

Violations shown in a given quarter do not necessarily span the entire 3 months. Information on the nature of [alleged violations](#) is available on the FAQ page, and information on the duration of non-compliance is available at the end of this report.

RCRA Compliance Status													
Statute:Source ID		QTR1	QTR2	QTR3	QTR4	QTR5	QTR6	QTR7	QTR8	QTR9	QTR10	QTR11	QTR12
RCRA:		Jan-	Apr-	Jul-	Oct-	Jan-	Apr-	Jul-	Oct-	Jan-	Apr-	Jul-	Oct-
NYD074333113		Mar10	Jun10	Sep10	Dec10	Mar11	Jun11	Sep11	Dec11	Mar12	Jun12	Sep12	Dec12
Facility Level Status													
Type of Violation	Agency												

The first date displayed for a RCRA Violation corresponds to the violation determination date, and the next to the resolution date (if the violation has been resolved).

Notices of Violation or Informal Enforcement - AFS, PCS, ICIS-NPDES, RCRAInfo (05 year history)

[Data Dictionary](#)

Statute	Source ID	Type of Action	Lead Agency	Date	
- No data records returned.					

Formal Enforcement Actions - (05 year history)

AFS, PCS, RCRAInfo, NCDB

[Data Dictionary](#)

Statute	Source ID	Type of Action	Lead Agency	Date	Penalty	Penalty Description	
- No data records returned.							

In some cases, formal enforcement actions may be entered both at the initiation and final stages of the action. These may appear more than once above. Entries in *italics* are not "formal" actions under the PCS definitions but are either the initiation of an action or penalties assessed as a result of a previous action. This section includes US EPA and State formal enforcement actions under CAA, CWA and RCRA.

ICIS

[Data Dictionary](#)

Primary Law/Section	Case Number	Case Type	Lead Agency	Case Name	Issued/Filed Date	Settlement Date	Federal Penalty	State/Local Penalty	SEP Cost	Comp Action Cost	
- No data records returned.											

Federal enforcement actions and penalties shown in this section are from the Integrated Compliance Information System (ICIS-FE&C). These actions may duplicate records in the Formal Enforcement Actions section.

TRI History of Reported Chemicals Released in Pounds per Year at Site:

[Data Dictionary](#)

Year /	Total Air Emissions	Surface Water Discharges	Underground Injections	Releases to Land	Total On-site Releases	Total Off-site Transfers	Total Releases and Transfers	
- No data records returned.								

TRI Total Releases and Transfers by Chemical and Year

- No data records returned.

Demographic Profile of Surrounding Area (3 Miles)

Data Dictionary

Open more detailed information in a new window (links leave ECHO): [1 Mi](#) or [5 Mi](#).

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2000 US Census data, and are accurate to the extent that the facility latitude and longitude listed below are correct. The latitude and longitude are obtained from the EPA [Locational Reference Table\(LRT\)](#) when available.

Radius of Area:	3 Miles	Land Area:	66.15%	Households in area:	190,204
Center Latitude:	40.589640	Water Area:	33.85%	Housing units in area:	198,219
Center Longitude:	-73.939816	Population Density:	27176.37/sq. mi.	Households On Public Assistance:	10,456
Total Persons:	508,198	Percent Minority:	32.79%	Persons Below Poverty Level:	88,283

Race Breakdown	Persons (%)	Age Breakdown:	Persons (%)
White:	361,492 (71.13%)	Child 5 years and less:	36,833 (7.25%)
African-american:	56,824 (11.18%)	Minors 17 years and younger:	116,385 (22.90%)
Hispanic-Origin:	42,121 (8.29%)	Adults 18 years and older:	391,810 (77.10%)
Asian/Pacific Islander:	57,734 (11.36%)	Seniors 65 years and older:	87,135 (17.15%)
American Indian:	1,156 (0.23%)		
Other/Multiracial:	16,979 (3.34%)		

Education Level (Persons 25 & older)	Persons (%)	Income Breakdown:	Households (%)
Less than 9th grade:	35,542 (11.08%)	Less than \$15,000:	47,961 (25.22%)
9th-12th grades:	44,322 (13.81%)	\$15,000-\$25,000:	22,577 (11.87%)
High School Diploma:	97,686 (30.44%)	\$25,000-\$50,000:	47,183 (24.81%)
Some College/2-yr:	50,211 (15.65%)	\$50,000-\$75,000:	31,954 (16.80%)
B.S./B.A. or more:	93,110 (29.02%)	Greater than \$75,000:	40,151 (21.11%)

Notice About Duration of Violations -- The duration of violations shown on this report is an estimate of the actual duration of the violations that might be alleged or later determined in a legal proceeding. For example, the start date of the violation as shown in the ECHO database is normally when the government first became aware of the violation, not the first date that the violation occurred, and the facility may have corrected the violation before the end date shown. In some situations, violations may have been corrected by the facility, but EPA or the State has not verified the correction of these violations. In other situations, EPA does not remove the violation flag until an enforcement action has been resolved.



This report was generated by the Integrated Data for Enforcement Analysis (IDEA) system, which updates its information from program databases monthly. The data were last updated: RCRAInfo: 11/09/2012. FRS: 11/08/2012.

Some regulated facilities have expressed an interest in explaining data shown in the Detailed Facility Reports in ECHO. Please check company web sites for such explanations.


[EPA Home](#) | [Privacy and Security Notice](#) | [Contact Us](#)

3780-3858 Nostrand Ave

3780-3858 Nostrand Ave
Brooklyn, NY 11235

Inquiry Number: 3465818.2s
November 29, 2012

The EDR Radius Map™ Report with GeoCheck®

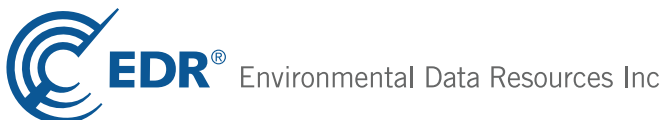

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	598
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-8
Physical Setting Source Records Searched	A-12

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2012 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

3780-3858 NOSTRAND AVE
BROOKLYN, NY 11235

COORDINATES

Latitude (North): 40.5907000 - 40° 35' 26.52"
Longitude (West): 73.9403000 - 73° 56' 25.08"
Universal Transverse Mercator: Zone 18
UTM X (Meters): 589674.6
UTM Y (Meters): 4493651.0
Elevation: 9 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 40073-E8 CONEY ISLAND, NY NJ
Most Recent Revision: 1995

AERIAL PHOTOGRAPHY IN THIS REPORT

Photo Year: 2009
Source: USDA

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
SUPREME PETROLEUM INC 3858 NOSTRAND AVE BROOKLYN, NY 11235	RCRA-NonGen FINDS	NYD074333113

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System
FEDERAL FACILITY..... Federal Facility Site Information listing

Federal CERCLIS NFRAP site List

CERC-NFRAP..... CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls
LUCIS..... Land Use Control Information System

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent CERCLIS

SHWS..... Inactive Hazardous Waste Disposal Sites in New York State

EXECUTIVE SUMMARY

VAPOR REOPENED..... Vapor Intrusion Legacy Site List

State and tribal landfill and/or solid waste disposal site lists

SWF/LF..... Facility Register

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

TANKS..... Storage Tank Facility Listing
CBS UST..... Chemical Bulk Storage Database
MOSF UST..... Major Oil Storage Facilities Database
CBS AST..... Chemical Bulk Storage Database
MOSF AST..... Major Oil Storage Facilities Database
MOSF..... Major Oil Storage Facility Site Listing
CBS..... Chemical Bulk Storage Site Listing
INDIAN UST..... Underground Storage Tanks on Indian Land
FEMA UST..... Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

ENG CONTROLS..... Registry of Engineering Controls
INST CONTROL..... Registry of Institutional Controls
RES DECL..... Restrictive Declarations Listing

State and tribal voluntary cleanup sites

VCP..... Voluntary Cleanup Agreements
INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

ERP..... Environmental Restoration Program Listing
BROWNFIELDS..... Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
ODI..... Open Dump Inventory
SWTIRE..... Registered Waste Tire Storage & Facility List
SWRCY..... Registered Recycling Facility List
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL..... Clandestine Drug Labs

EXECUTIVE SUMMARY

DEL SHWS..... Delisted Registry Sites
US HIST CDL..... National Clandestine Laboratory Register

Local Land Records

LIENS 2..... CERCLA Lien Information
LIENS..... Spill Liens Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System

Other Ascertainable Records

DOT OPS..... Incident and Accident Data
DOD..... Department of Defense Sites
FUDS..... Formerly Used Defense Sites
CONSENT..... Superfund (CERCLA) Consent Decrees
ROD..... Records Of Decision
UMTRA..... Uranium Mill Tailings Sites
MINES..... Mines Master Index File
TRIS..... Toxic Chemical Release Inventory System
TSCA..... Toxic Substances Control Act
FTTS..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing
SSTS..... Section 7 Tracking Systems
ICIS..... Integrated Compliance Information System
PADS..... PCB Activity Database System
MLTS..... Material Licensing Tracking System
RADINFO..... Radiation Information Database
RAATS..... RCRA Administrative Action Tracking System
HSWDS..... Hazardous Substance Waste Disposal Site Inventory
UIC..... Underground Injection Control Wells
NPDES..... State Pollutant Discharge Elimination System
AIRS..... Air Emissions Data
E DESIGNATION..... E DESIGNATION SITE LISTING
INDIAN RESERV..... Indian Reservations
SCRD DRYCLEANERS..... State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR..... Financial Assurance Information
PRP..... Potentially Responsible Parties
COAL ASH..... Coal Ash Disposal Site Listing
COAL ASH DOE..... Steam-Electric Plant Operation Data
COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List
2020 COR ACTION..... 2020 Corrective Action Program List
FINANCIAL ASSURANCE..... Financial Assurance Information Listing
EPA WATCH LIST..... EPA WATCH LIST
PCB TRANSFORMER..... PCB Transformer Registration Database

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants..... EDR Proprietary Manufactured Gas Plants

EXECUTIVE SUMMARY

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 03/15/2012 has revealed that there is 1 RCRA-CESQG site within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
RITE AID #4876	3823 NOSTRAND AVE	ESE 0 - 1/8 (0.011 mi.)	A2	9

State and tribal leaking storage tank lists

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 08/20/2012 has revealed that there are 30 LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>3767 NOSTRAND AVE.</i> Date Closed: 9/24/1992	<i>3767 NOSTRAND AVE</i>	<i>N 0 - 1/8 (0.028 mi.)</i>	<i>B8</i>	<i>38</i>
<i>2939 AVE Y/AVE Y TENANTS</i> Date Closed: 2/7/1994 Date Closed: 2/7/1994 <i>*Additional key fields are available in the Map Findings section</i>	<i>2939 AVE Y</i>	<i>NNE 0 - 1/8 (0.042 mi.)</i>	<i>B11</i>	<i>55</i>
<i>SHEEPSHEAD BAY</i> Date Closed: 3/25/1996 Date Closed: 3/18/2005	<i>2461 EAST 29TH ST</i>	<i>NNW 0 - 1/8 (0.068 mi.)</i>	<i>D17</i>	<i>92</i>
<i>HOUSE</i> Date Closed: 9/3/2004 Date Closed: 8/16/2004	<i>2701 AVE Z</i>	<i>SW 1/8 - 1/4 (0.127 mi.)</i>	<i>H32</i>	<i>145</i>

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
PUBLIC SCHOOL 52 - BROOKLYN Date Closed: 6/9/2009	2675 EAST 29TH STREET	S 1/8 - 1/4 (0.127 mi.)	33	149
NYC P.S. #14 Date Closed: 1/15/2003	24-24 BATCHELDER AVE	NNE 1/8 - 1/4 (0.155 mi.)	I36	171
Not reported Date Closed: 2/10/2003 Date Closed: 2/10/2003 <i>*Additional key fields are available in the Map Findings section</i>	2525 BATCHELDER ST	ENE 1/8 - 1/4 (0.157 mi.)	J37	174
2520 BATCHELDER ST. Date Closed: 7/26/1993 Date Closed: 7/26/1993 <i>*Additional key fields are available in the Map Findings section</i>	2520 BATCHELDER ST	ENE 1/8 - 1/4 (0.158 mi.)	J40	184
CO-OP BLDG 2710 AVENUE "X" Date Closed: 8/24/1995 Date Closed: 10/27/1994	2520 BATCHELTER ST 2710 AVENUE X	ENE 1/8 - 1/4 (0.158 mi.) NW 1/8 - 1/4 (0.193 mi.)	J41 50	189 220
INTERMEDIATE SCHOOL 14 - BROOK Date Closed: 1/11/2006	24-24 BATCHELDER ST	NE 1/8 - 1/4 (0.194 mi.)	L52	225
2662 EAST 24TH STREET Date Closed: 1/16/1996	2662 EAST 24TH STREET	SW 1/4 - 1/2 (0.299 mi.)	62	254
AQUILINA, RES. Date Closed: 11/28/1994	2779 BATCH ELDA STREET	SSE 1/4 - 1/2 (0.338 mi.)	68	266
FORMER GETTY GAS STATION Date Closed: 3/3/2003 Date Closed: 3/3/2003 <i>*Additional key fields are available in the Map Findings section</i>	2624 EAST 22ND ST	WSW 1/4 - 1/2 (0.381 mi.)	Q81	304
SHEEPS HEAD NOSTRAND Date Closed: 4/27/1995 Date Closed: 6/8/1994 <i>*Additional key fields are available in the Map Findings section</i>	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R84	314
CONEY ISLAND WATER POLLUTION P Date Closed: 2/13/2008	2610 KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	V97	347
VENICE MARINA/2591 KNAPP Date Closed: 4/10/1990	2591 KNAPP STREET	E 1/4 - 1/2 (0.410 mi.)	U110	379
SEWERAGE TREATMENT PLANT Date Closed: 3/25/2005 Date Closed: 1/4/2007 <i>*Additional key fields are available in the Map Findings section</i>	2591 KNAPP STREET	E 1/4 - 1/2 (0.411 mi.)	U111	382
SHELL OIL CO Date Closed: 2/2/2006 Date Closed: 4/12/1993	2472 KNAPP ST	ENE 1/4 - 1/2 (0.413 mi.)	X115	398
GETTY PETROLEUM CORP Date Closed: 5/9/2005 Date Closed: 2/27/2003 <i>*Additional key fields are available in the Map Findings section</i>	2112 AVE Z	WSW 1/4 - 1/2 (0.420 mi.)	Z118	411
SUNOCO SERVICE STATION Date Closed: 2/9/2004	2701 KNAPP ST	ESE 1/4 - 1/2 (0.443 mi.)	AC140	488
GOLDEN GATE INN TTF	3867 SHORE PARKWAY	SE 1/4 - 1/2 (0.459 mi.)	146	505
FRANK/LEE TWO-FAMILY HOUSE Date Closed: 4/20/2006	2258 EAST 24TH STREET	NW 1/4 - 1/2 (0.463 mi.)	AF148	509

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported Date Closed: 3/17/2003	2302 E 22ND ST	NW 1/4 - 1/2 (0.477 mi.)	158	541
2885 OCEAN AVE/BROOKLYN Date Closed: 5/2/2000	2885 OCEAN AVENUE	W 1/4 - 1/2 (0.480 mi.)	AI162	555
SATARA REALTY INC Date Closed: 2/24/2003	2900 OCEAN AVENUE	W 1/4 - 1/2 (0.485 mi.)	AI165	562
3010 OCEAN AV/BKLYN/AMOCO Date Closed: 12/4/1992	3010 OCEAN AVENUE	WSW 1/4 - 1/2 (0.487 mi.)	AK169	573
Not reported Date Closed: 4/10/2001	2026 AVE X	WNW 1/4 - 1/2 (0.487 mi.)	AE170	575
OCEANIC APARTMENTS	2835 OCEAN AVE	WNW 1/4 - 1/2 (0.491 mi.)	173	584
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
EXXON STATION Date Closed: 3/10/1992	4085 NOSTRAND AV	S 1/4 - 1/2 (0.370 mi.)	P78	292

HIST LTANKS: A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database.

A review of the HIST LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there are 28 HIST LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
3767 NOSTRAND AVE. Date Closed: 09/24/92	3767 NOSTRAND AVE	N 0 - 1/8 (0.028 mi.)	B8	38
2939 AVE Y/AVE Y TENANTS Date Closed: 02/07/94	2939 AVE Y	NNE 0 - 1/8 (0.042 mi.)	B11	55
2461 EAST 29TH ST Date Closed: 03/25/96	2461 EAST 29TH ST	NNW 0 - 1/8 (0.068 mi.)	D16	90
NYC P.S. #14 Date Closed: / /	24-24 BATCHELDER AVE	NNE 1/8 - 1/4 (0.155 mi.)	I36	171
Not reported Date Closed: / /	2525 BATCHELDER ST	ENE 1/8 - 1/4 (0.157 mi.)	J37	174
2520 BATCHELDER ST. Date Closed: 07/26/93	2520 BATCHELDER ST	ENE 1/8 - 1/4 (0.158 mi.)	J40	184
CO-OP BLDG Date Closed: / /	2520 BATCHELTER ST	ENE 1/8 - 1/4 (0.158 mi.)	J41	189
2710 AVENUE "X" Date Closed: 08/24/95	2710 AVENUE X	NW 1/8 - 1/4 (0.193 mi.)	50	220
INTERMEDIATE SCHOOL 14 Date Closed: / /	2424 BATCHELDER STREET	NE 1/8 - 1/4 (0.194 mi.)	L51	224
2710 AVENUE X Date Closed: 10/27/94	AT SYNOGUE-GATE-SIDEWAL	NW 1/8 - 1/4 (0.234 mi.)	55	240
4433 BEDFORD AVENUE Date Closed: 07/19/94	4433 BEDFORD AVENUE	NW 1/4 - 1/2 (0.287 mi.)	M60	249

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
2662 EAST 24TH STREET Date Closed: 01/16/96	2662 EAST 24TH STREET	SW 1/4 - 1/2 (0.299 mi.)	62	254
AQUILINA, RES. Date Closed: 11/28/94	2779 BATCH ELDA STREET	SSE 1/4 - 1/2 (0.338 mi.)	68	266
2624 EAST 22ND STREET Date Closed: / /	2624 EAST 22ND STREET	WSW 1/4 - 1/2 (0.381 mi.)	Q82	311
SHEEPSHEAD/NOSTRAND Date Closed: / /	2955 AVENUE W	NNE 1/4 - 1/2 (0.383 mi.)	R83	312
SHEEPS HEAD NOSTRAND Date Closed: / /	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R84	314
SHEEPSHEAD/NOSTRAND Date Closed: 04/27/95	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R86	325
SHEEPSHEAD/NOSTRAND Date Closed: 06/08/94	2273 BATCHELDER STREET	NNE 1/4 - 1/2 (0.383 mi.)	R88	328
SHEEPSHEAD NOSTRAND HSES Date Closed: / /	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R89	329
VENICE MARINA/2591 KNAPP Date Closed: 04/10/90	2591 KNAPP STREET	E 1/4 - 1/2 (0.410 mi.)	U110	379
2472 KNAPP ST. Date Closed: / / Date Closed: 04/12/93	2472 KNAPP ST.	ENE 1/4 - 1/2 (0.413 mi.)	X114	394
2112 AVENUE Z Date Closed: / / Date Closed: / / <i>*Additional key fields are available in the Map Findings section</i>	2112 AVENUE Z	WSW 1/4 - 1/2 (0.420 mi.)	Z120	428
Not reported Date Closed: / /	2302 E 22ND ST	NW 1/4 - 1/2 (0.477 mi.)	158	541
2885 OCEAN AVE/BROOKLYN Date Closed: 05/02/00	2885 OCEAN AVENUE	W 1/4 - 1/2 (0.480 mi.)	AI162	555
SATARA REALTY INC Date Closed: / /	2900 OCEAN AVENUE	W 1/4 - 1/2 (0.485 mi.)	AI166	566
3010 OCEAN AV/BKLYN/AMOCO Date Closed: 12/04/92	3010 OCEAN AVENUE	WSW 1/4 - 1/2 (0.487 mi.)	AK169	573
Not reported Date Closed: 04/10/01	2026 AVE X	WNW 1/4 - 1/2 (0.487 mi.)	AE170	575
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
EXXON STATION Date Closed: 03/10/92	4085 NOSTRAND AV	S 1/4 - 1/2 (0.370 mi.)	P78	292

EXECUTIVE SUMMARY

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 10/02/2012 has revealed that there are 9 UST sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
S&J ECONOMIC SERVICE CTR INC	3768 NOSTRAND AVE	N 0 - 1/8 (0.025 mi.)	B6	25
GETTY 00238	3767 NOSTRAND AVE	N 0 - 1/8 (0.028 mi.)	B9	40
2939 AVE Y TENANTS CORP	2939 AVE Y	NNE 0 - 1/8 (0.042 mi.)	B10	51
AL & SELWYN SERVICE STATION	3755 NOSTRAND AVENUE	N 0 - 1/8 (0.047 mi.)	B12	61
SEA ISLE OWNERS INC.	3903 NOSTRAND AVE	SSE 0 - 1/8 (0.077 mi.)	E19	99
NOSTRAND GARDENS CO-OP	2455-65 HARING STREET	NNE 0 - 1/8 (0.094 mi.)	F21	106
YAILLE LEASING CORP	2440 EAST 29TH ST	NNW 0 - 1/8 (0.096 mi.)	D24	113
SHEEPSHEAD TERRACE COOPERATIVE	2427-2461 EAST 29TH STR	NNW 0 - 1/8 (0.114 mi.)	D27	130
NOSTRAND GARDENS COOP, INC.	2430-50 HARING STREET	NNE 0 - 1/8 (0.121 mi.)	F29	136

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 10/02/2012 has revealed that there are 6 AST sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AL & SELWYN SERVICE STATION	3755 NOSTRAND AVENUE	N 0 - 1/8 (0.047 mi.)	B12	61
PUBLIC SCHOOL 286 - BROOKLYN	2525 HARING STREET	ENE 0 - 1/8 (0.060 mi.)	C15	88
SEA ISLE OWNERS INC.	3903 NOSTRAND AVE	SSE 0 - 1/8 (0.077 mi.)	E20	101
NOSTRAND GARDENS CO-OP	2455-65 HARING STREET	NNE 0 - 1/8 (0.094 mi.)	F23	110
STRAUSS DISCOUNT AUTO 121	3720 NOSTRAND AVENUE	N 0 - 1/8 (0.107 mi.)	G26	127
NOSTRAND GARDENS COOP, INC.	2430-50 HARING STREET	NNE 0 - 1/8 (0.121 mi.)	F30	138

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Registered Storage Tanks

HIST UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the HIST UST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 9 HIST UST sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
S&J ECONOMIC SERVICE CTR INC	3768 NOSTRAND AVE	N 0 - 1/8 (0.025 mi.)	B6	25
GETTY 00238	3767 NOSTRAND AVE	N 0 - 1/8 (0.028 mi.)	B9	40
2939 AVE Y TENANTS CORP	2939 AVE Y	NNE 0 - 1/8 (0.042 mi.)	B10	51
AL & SELWYN SERVICE STATION	3755 NOSTRAND AVENUE	N 0 - 1/8 (0.047 mi.)	B12	61
SEA ISLE OWNERS INC.	3903 NOSTRAND AVE	SSE 0 - 1/8 (0.077 mi.)	E20	101

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
NOSTRAND GARDENS CO-OP, INC.	2455-65 HARING STREET	NNE 0 - 1/8 (0.094 mi.)	F22	108
YAILLE LEASING CORP	2440 EAST 29TH ST	NNW 0 - 1/8 (0.096 mi.)	D24	113
SHEEPSHEAD TERRACE COOPERATIVE	2427-2461 EAST 29TH STR	NNW 0 - 1/8 (0.114 mi.)	D27	130
NOSTRAND GARDENS COOP, INC.	2430-50 HARING STREET	NNE 0 - 1/8 (0.121 mi.)	F30	138

HIST AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the HIST AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 3 HIST AST sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
PS 286	2525 HARING ST	ENE 0 - 1/8 (0.060 mi.)	C14	87
SEA ISLE OWNERS INC.	3903 NOSTRAND AVE	SSE 0 - 1/8 (0.077 mi.)	E20	101
NOSTRAND GARDENS COOP, INC.	2430-50 HARING STREET	NNE 0 - 1/8 (0.121 mi.)	F30	138

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 08/20/2012 has revealed that there are 110 NY Spills sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
FORMER GAS STATION	3768 NOSTRAND AVE	N 0 - 1/8 (0.025 mi.)	B7	35
2939 AVE Y/AVE Y TENANTS	2939 AVE Y	NNE 0 - 1/8 (0.042 mi.)	B11	55
Date Closed: 12/24/2009				
AL & SELWYN SERVICE STATION	3755 NOSTRAND AVENUE	N 0 - 1/8 (0.047 mi.)	B12	61
Date Closed: 2/28/2003				
SHEEPSHEAD BAY	2461 EAST 29TH ST	NNW 0 - 1/8 (0.068 mi.)	D17	92
Date Closed: 10/3/1997				
CEA ISLE OWNERS CORP	3901-3903 NOSTRAND AVE	SSE 0 - 1/8 (0.073 mi.)	E18	97
Date Closed: 5/29/2003				
APRTMENT	2435 HARING STREET	NNE 0 - 1/8 (0.117 mi.)	F28	135
Date Closed: 9/26/2007				
2515 E 27TH ST	2515 E 27TH ST	W 0 - 1/8 (0.125 mi.)	31	143
Date Closed: 11/5/2001				
TSIGEL HOME	2432 EAST 28TH STREET	NW 1/8 - 1/4 (0.129 mi.)	34	156
Date Closed: 7/22/2010				
Date Closed: 3/10/2003				
<i>*Additional key fields are available in the Map Findings section</i>				
VAULT 1124	BATCHELDER ST/AVE Y	ENE 1/8 - 1/4 (0.158 mi.)	J38	180
Date Closed: 6/19/2001				
VAULT 3138	BATCHELDER ST/AVE Y	ENE 1/8 - 1/4 (0.158 mi.)	J39	182
Date Closed: 6/3/2005				

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SIDEWALK Date Closed: 11/19/2004	2656 E. 27TH ST	SSW 1/8 - 1/4 (0.161 mi.)	42	194
2612 AVE Z Date Closed: 4/18/1993	2612 AVE Z	WSW 1/8 - 1/4 (0.170 mi.)	H43	195
Not reported Date Closed: 12/15/2003	2612 AVE Z 1ST FLOOR	WSW 1/8 - 1/4 (0.170 mi.)	H44	198
PRIVATE RESIDENCE Date Closed: 11/19/2009	2533 EAST 26TH STREET	W 1/8 - 1/4 (0.174 mi.)	45	199
3000 AVE X/BKLYN/SHEEPSHE Date Closed: 12/2/1987	3000 AVE X	N 1/8 - 1/4 (0.179 mi.)	K47	206
SHEEPSHEAD BAY HIGH SCHOOL Date Closed: 4/21/2003 Date Closed: 7/20/2012	3000 AVE X	N 1/8 - 1/4 (0.179 mi.)	K48	208
PRIVATE RESIDENCE Date Closed: 3/12/1997	2466 EAST 26TH ST	WNW 1/8 - 1/4 (0.184 mi.)	49	217
INTERMEDIATE SCHOOL 14 - BROOK 2752 E. 28TH STREET Date Closed: 3/2/1995	24-24 BATCHELDER ST 2752 E. 28TH STREET	NE 1/8 - 1/4 (0.194 mi.) S 1/8 - 1/4 (0.234 mi.)	L52 56	225 241
JAMES BEATRICE Date Closed: 5/16/2006	4648 BEDFORD AVE	SW 1/8 - 1/4 (0.238 mi.)	57	244
221215; 2502 AVE X Date Closed: 3/30/2011	2502 AVE X	NW 1/4 - 1/2 (0.270 mi.)	M58	246
SAMA HOME Date Closed: 10/29/2007	2326 EAST 28TH STREET	NNW 1/4 - 1/2 (0.270 mi.)	59	247
4433 BEDFORD AVENUE Date Closed: 7/19/1994	4433 BEDFORD AVENUE	NW 1/4 - 1/2 (0.287 mi.)	M60	249
2454 EAST 24TH STREET Date Closed: 1/5/1995	2454 EAST 24TH STREET	WNW 1/4 - 1/2 (0.287 mi.)	61	251
CON ED Date Closed: 10/12/2004	AVE X & COYLE ST	NE 1/4 - 1/2 (0.301 mi.)	N63	257
VAULT # 46275 HAS EARTHEN SUMP Date Closed: 12/28/2007	COYLE STREET & AVENUE X	NE 1/4 - 1/2 (0.301 mi.)	N64	258
NOSTRAND AV @ AVE W Date Closed: 3/29/2005	NOSTRAND AV @ AVE W	N 1/4 - 1/2 (0.314 mi.)	65	260
4766 BEDFORD AVE MANHOLE 58475 Date Closed: 3/29/2002	4766 BEDFORD AVENUE BEDFORD AVE/AVE X	SSW 1/4 - 1/2 (0.325 mi.) WNW 1/4 - 1/2 (0.326 mi.)	66 67	262 264
CONEY ISLAND STP/BKLYN Date Closed: 8/1/1988	KNAPP & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O69	269
CONEY ISLAND WWT/BKLYN Date Closed: 5/14/1991	KNAPP ST & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O70	271
CONEY ISLAND PLANT/BKLYN Date Closed: 12/14/1987	KNAPP ST & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O71	274
CONEY IS. BYPASS 5/7/86 Date Closed: 5/9/1986	AVE Z&KNAPP ST.	E 1/4 - 1/2 (0.353 mi.)	O72	276
AVE Z & KNAPP ST. BKLYN./ Date Closed: 2/6/1987	AVENUE Z & KNAPP STREET	E 1/4 - 1/2 (0.353 mi.)	O73	278

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CONEY ISLAND PLANT Date Closed: 2/15/1995	AV Z @ KNAPP ST	E 1/4 - 1/2 (0.353 mi.)	O74	281
AVE Z & KNAPP ST Date Closed: 4/4/1986 Date Closed: 8/16/1986 <i>*Additional key fields are available in the Map Findings section</i>	AVE Z & KNAPP ST	E 1/4 - 1/2 (0.353 mi.)	O75	284
PRIVATE HOME Date Closed: 8/11/2008	2282 EAST 27TH STREET	NNW 1/4 - 1/2 (0.354 mi.)	76	289
Not reported Date Closed: 9/2/2003	2356 BRAGG ST	NE 1/4 - 1/2 (0.375 mi.)	79	301
FORMER GETTY GAS STATION Date Closed: 5/3/2005 Date Closed: 5/3/2005 <i>*Additional key fields are available in the Map Findings section</i>	2624 EAST 22ND ST	WSW 1/4 - 1/2 (0.381 mi.)	Q81	304
SHEEPS HEAD NOSTRAND Date Closed: 12/30/2009 Date Closed: 6/8/1994	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R84	314
3147 VOORHIES ST & KNAPP Date Closed: 3/30/1995	3147 VOORHIES ST & KNAPP	ESE 1/4 - 1/2 (0.385 mi.)	90	330
CONEY ISLAND POLL CONT PL Date Closed: 1/11/2000	25-91 KNAPP ST	E 1/4 - 1/2 (0.405 mi.)	U95	342
CONEY ISLAND WATER POLLUTION P Date Closed: 9/8/2008 Date Closed: 9/8/2008 <i>*Additional key fields are available in the Map Findings section</i>	2610 KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	V97	347
SHORE PARKWAY Date Closed: 3/31/1995	SHORE PARKWAY	SE 1/4 - 1/2 (0.409 mi.)	W98	351
26TH AV Date Closed: 5/4/1998	26TH AVE & SHORE PARKWAY	E 1/4 - 1/2 (0.409 mi.)	W99	353
CONEY ISLAND WPCP/BKLYN Date Closed: 5/18/1991	KNAPP ST & AVENUE Z	E 1/4 - 1/2 (0.409 mi.)	U100	356
CONEY ISLAND BYPASS Date Closed: 4/3/1986	AVENUE Z & KNAPP	E 1/4 - 1/2 (0.409 mi.)	U101	358
CONEY ISLAND PLANT Date Closed: 10/21/1997	2591 KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	U102	361
CONEY ISLAND WASTE WATER Date Closed: 2/27/1998	KNAPP ST/ AVE Z	E 1/4 - 1/2 (0.409 mi.)	U103	363
AVE Z & KNAPP ST Date Closed: 9/2/1986	AVENUE Z & KNAPP STREET	E 1/4 - 1/2 (0.409 mi.)	U104	365
CONEY ISLAND TREATMENT C Date Closed: 6/19/2000	AVE Z/KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	U105	367
CONEY ISLAND WPCP Date Closed: 7/20/1987	AVE Z & KNAPP ST.	E 1/4 - 1/2 (0.409 mi.)	U106	369
CONEY ISLAND WTP Date Closed: 4/6/1986	KNAPP ST.&AVENUE Z	E 1/4 - 1/2 (0.409 mi.)	U107	373
WASTE WTR TREATMENT PLANT Date Closed: 11/15/1994	AVENUE Z & KNAPP STREET	E 1/4 - 1/2 (0.409 mi.)	U108	375
VENICE MARINA/2591 KNAPP Date Closed: 2/7/1989	2591 KNAPP STREET	E 1/4 - 1/2 (0.410 mi.)	U110	379

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEWERAGE TREATMENT PLANT Date Closed: 11/14/2005 Date Closed: 11/14/2005 <i>*Additional key fields are available in the Map Findings section</i>	2591 KNAPP STREET	E 1/4 - 1/2 (0.411 mi.)	U111	382
BROOKLYN EAST 15 ANNEX DOS -DD Date Closed: 11/20/2000	2509 KNAPP STREET	ENE 1/4 - 1/2 (0.412 mi.)	X113	392
SHELL OIL CO Date Closed: 7/6/2012 Date Closed: 8/14/1997	2472 KNAPP ST	ENE 1/4 - 1/2 (0.413 mi.)	X115	398
GETTY PETROLEUM CORP Date Closed: 4/4/2006	2112 AVE Z	WSW 1/4 - 1/2 (0.420 mi.)	Z118	411
OLD GETTY STATION Date Closed: 8/24/2001	2102 AVENUE Z	WSW 1/4 - 1/2 (0.425 mi.)	Z121	432
JONAS EQUITIES INC Date Closed: 10/16/2009	2600 EAST 21ST STREET	WSW 1/4 - 1/2 (0.428 mi.)	Z122	434
MOBIL OIL CORP SS #FFF Date Closed: 2/14/2006 Date Closed: 8/4/2008	2402 KNAPP ST	NE 1/4 - 1/2 (0.436 mi.)	AB126	447
VOORHIES AVE & KNAPP ST Date Closed: 8/12/1992	VOORHIES AVE & KNAPP ST	ESE 1/4 - 1/2 (0.437 mi.)	AC127	463
SALVATORE CAVALIERE Date Closed: 1/10/2002	2661 EAST 21ST STREET	WSW 1/4 - 1/2 (0.437 mi.)	128	465
GAS STATION Date Closed: 5/10/2010	AVENUE X AND KNAPP ST	NE 1/4 - 1/2 (0.438 mi.)	AB130	468
PARKING LOT Date Closed: 7/31/1997	VOORHIES AV & KNAPP ST	ESE 1/4 - 1/2 (0.440 mi.)	AC131	470
ONE QT DIELECTRIC FLUID Date Closed: 5/12/2008	KNAPP STREET & VOORHIES	ESE 1/4 - 1/2 (0.440 mi.)	AC132	472
Not reported Date Closed: 7/29/2002	KNAPP ST/VOORHEES AV	ESE 1/4 - 1/2 (0.440 mi.)	AC133	474
ABANDONED MARINA Date Closed: 4/21/2004	KNAPP ST & VOORHIES AVE	ESE 1/4 - 1/2 (0.440 mi.)	AC134	476
CONNIE ISLAND WATER POLLU Date Closed: 12/24/2004	2391 KNAPP STREET	NE 1/4 - 1/2 (0.442 mi.)	AB138	485
SUNOCO SERVICE STATION Date Closed: 8/19/1992	2701 KNAPP ST	ESE 1/4 - 1/2 (0.443 mi.)	AC140	488
Not reported Date Closed: 2/13/2003	ALLEN AV & KNAPP ST	NE 1/4 - 1/2 (0.446 mi.)	AB142	497
ROADWAY Date Closed: 2/5/2009	2101 AVENUE X	WNW 1/4 - 1/2 (0.450 mi.)	AE143	499
RECLOSURE SWITCH LEAK AT POLE Date Closed: 5/19/2008	EAST 21 STREET & AVENUE	WNW 1/4 - 1/2 (0.452 mi.)	AE144	501
SERVICE BOX 67885 Date Closed: 6/6/2002	2211 EAST 28TH ST	NNW 1/4 - 1/2 (0.452 mi.)	145	502
Not reported Date Closed: 7/8/1999	E 22 ST /SHORE PKY	SW 1/4 - 1/2 (0.461 mi.)	147	506
REBECCA TARAGANO HOME Date Closed: 6/21/2006	2256 EAST 24 STREET	NW 1/4 - 1/2 (0.465 mi.)	AF149	512

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
VEHICLE 60722 Date Closed: 10/20/2008	NOSTRAND AVE & AVENUE V	N 1/4 - 1/2 (0.465 mi.)	AG150	515
2348 KNAPP ST Date Closed: 2/20/1996	2348 KNAPP ST	NE 1/4 - 1/2 (0.466 mi.)	151	517
VAULT 4338 Date Closed: 10/23/2002	AVE V & NOSTRAND AVE	N 1/4 - 1/2 (0.476 mi.)	AG154	524
MANHOLE #61808 Date Closed: 8/18/2009	AVE V & NOSTRAND AVE	N 1/4 - 1/2 (0.476 mi.)	AG155	527
DEVILLE MARINA Date Closed: 12/17/2010 Date Closed: 1/11/2011	2771 KNAPP	ESE 1/4 - 1/2 (0.476 mi.)	156	530
FRIMAN CLEANERS Date Closed: 4/9/1999	2901 OCEAN AVE	W 1/4 - 1/2 (0.476 mi.)	AI157	533
BASEMENT Date Closed: 8/22/2007	2965 OCEAN AVE	WSW 1/4 - 1/2 (0.477 mi.)	159	543
AVE V BETWEEN Date Closed: 11/2/1999	E 29TH ST & NOSTRAND AV	NNW 1/4 - 1/2 (0.477 mi.)	160	545
BRONX JEWISH BOYS SYNAGOGUE/SC	2261 BRAGG ST	NNE 1/4 - 1/2 (0.480 mi.)	161	547
UNKNOWN Date Closed: 5/3/2006	2209 EAST 26TH STREET	NNW 1/4 - 1/2 (0.481 mi.)	163	558
SATARA REALTY INC Date Closed: 6/19/2001	2900 OCEAN AVENUE	W 1/4 - 1/2 (0.485 mi.)	AI165	562
3025 OCEAN AV / BKLN Date Closed: 11/6/2001	3025 OCEAN AVE	WSW 1/4 - 1/2 (0.486 mi.)	AK167	567
3030 OCEAN AVE TEN GALLONS DIESEL IN EXCAVATI	3030 OCEAN AVE IN FRONT OF 3030 OCEAN	WSW 1/4 - 1/2 (0.495 mi.) WSW 1/4 - 1/2 (0.495 mi.)	AK174 AK175	588 592
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
EXXON STATION Date Closed: 9/19/2003 Date Closed: 9/19/2003 <i>*Additional key fields are available in the Map Findings section</i>	4085 NOSTRAND AV	S 1/4 - 1/2 (0.370 mi.)	P78	292
FORMERLY ROY ROGERS REST Date Closed: 7/30/1996	2902 EMMONS AVE	S 1/4 - 1/2 (0.404 mi.)	S91	333
PORT SHEEPSHEAD MARINA Date Closed: 7/13/2005	10 WEBBERS COURT	S 1/4 - 1/2 (0.404 mi.)	S92	335
Not reported Date Closed: 6/13/2003	28TH ST & EMMONS AVE	S 1/4 - 1/2 (0.404 mi.)	T93	337
TM 1842 Date Closed: 1/18/2001	EMMONS AVE/E 28TH ST	S 1/4 - 1/2 (0.404 mi.)	T94	339
3050 EMMONS AVE/BKLYN Date Closed: 7/18/1989	3050 EMMONS AVENUE	SSE 1/4 - 1/2 (0.407 mi.)	P96	345
3030 EMMONS AVE Date Closed: 3/14/1996	3030 EMMONS AVE	SSE 1/4 - 1/2 (0.414 mi.)	116	408
SHEEPSHEAD BAY Date Closed: 2/13/2003	EAST 26TH /EMMONS AV	SSW 1/4 - 1/2 (0.419 mi.)	Y117	410
CONEY ISLAND/ AVE. Z AND Date Closed: 3/19/1987	AVE Z,/ KNAPP ST.	E 1/4 - 1/2 (0.433 mi.)	V123	437

EXECUTIVE SUMMARY

Lower Elevation	Address	Direction / Distance	Map ID	Page
SHEEPSHEAD BAY YACHT CLUB Date Closed: 2/4/2011 Date Closed: 12/15/1997 <i>*Additional key fields are available in the Map Findings section</i>	3076 EMMONS AV	SSE 1/4 - 1/2 (0.435 mi.)	AA124	440
BETWE BEDFORD EA 26TH Date Closed: 9/14/2004	2511 EMMONS AVE	SSW 1/4 - 1/2 (0.438 mi.)	Y129	467
SHEEP HEADS BAY PIER 3 Date Closed: 6/22/1999	EMMONS AVE & BEDFORD AV	SSW 1/4 - 1/2 (0.441 mi.)	AD135	479
PIER 3 Date Closed: 12/22/2006	BEDFORD & EMMONS	SSW 1/4 - 1/2 (0.441 mi.)	AD136	481
PIER 6 Date Closed: 3/21/1996	EMMONS AV/BEDFORD AV	SSW 1/4 - 1/2 (0.441 mi.)	AD137	483
CASTLE HARBOR REST. Date Closed: 3/19/1999	FORD STREET & EMMONS AV	SSE 1/4 - 1/2 (0.470 mi.)	AH152	519
VAULT 5615 Date Closed: 5/19/2000	EMMONS AVE/FORD ST	SSE 1/4 - 1/2 (0.470 mi.)	AH153	522
BRAGE ST & EMMONS AVE Date Closed: 3/18/1994	BRAGE ST & EMMONS AVE	SE 1/4 - 1/2 (0.484 mi.)	AJ164	559
3148 VOORHIES AVE Date Closed: 3/31/1994 Date Closed: 11/21/1996	3148 VOORHIES AVE	ESE 1/4 - 1/2 (0.488 mi.)	AL172	580
MANHOLE #36062 Date Closed: 2/17/1999	EMMONS AVE & COYLE ST	SE 1/4 - 1/2 (0.499 mi.)	AJ176	594

NY Hist Spills: This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database.

A review of the NY Hist Spills list, as provided by EDR, and dated 01/01/2002 has revealed that there are 76 NY Hist Spills sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TEXACO STATION	3755 NOSTRAND AVENUE	N 0 - 1/8 (0.047 mi.)	B13	86
SHEEPSHEAD BAY	2461 EAST 29TH ST	NNW 0 - 1/8 (0.068 mi.)	D17	92
CEA ISLE OWNERS CORP	3901-3903 NOSTRAND AVE	SSE 0 - 1/8 (0.073 mi.)	E18	97
2515 E 27TH ST	2515 E 27TH ST	W 0 - 1/8 (0.125 mi.)	31	143
TSIGEL HOME	2432 EAST 28TH STREET	NW 1/8 - 1/4 (0.129 mi.)	34	156
VAULT 1124	BATCHELDER ST/AVE Y	ENE 1/8 - 1/4 (0.158 mi.)	J38	180
2612 AVE Z	2612 AVE Z	WSW 1/8 - 1/4 (0.170 mi.)	H43	195
3000 AVE X/BKLYN/SHEEPSHE	3000 AVE X	N 1/8 - 1/4 (0.179 mi.)	K47	206
SHEEPSHEAD BAY HIGH SCHOOL	3000 AVE X	N 1/8 - 1/4 (0.179 mi.)	K48	208
PRIVATE RESIDENCE	2466 EAST 26TH ST	WNW 1/8 - 1/4 (0.184 mi.)	49	217
2752 E. 28TH STREE T	2752 E. 28TH STREET	S 1/8 - 1/4 (0.234 mi.)	56	241
JAMES BEATRICE	4648 BEDFORD AVE	SW 1/8 - 1/4 (0.238 mi.)	57	244
2454 EAST 24TH STREET	2454 EAST 24TH STREET	WNW 1/4 - 1/2 (0.287 mi.)	61	251
NOSTRAND AV @ AVE W	NOSTRAND AV @ AVE W	N 1/4 - 1/2 (0.314 mi.)	65	260
MANHOLE 58475	BEDFORD AVE/AVE X	WNW 1/4 - 1/2 (0.326 mi.)	67	264

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CONEY ISLAND STP/BKLYN	KNAPP & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O69	269
CONEY ISLAND WWT/BKLYN	KNAPP ST & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O70	271
CONEY ISLAND PLANT/BKLYN	KNAPP ST & AVE Z	E 1/4 - 1/2 (0.353 mi.)	O71	274
CONEY IS. BYPASS 5/7/86	AVE Z&KNAPP ST.	E 1/4 - 1/2 (0.353 mi.)	O72	276
AVE Z & KNAPP ST. BKLYN./	AVENUE Z & KNAPP STREET	E 1/4 - 1/2 (0.353 mi.)	O73	278
CONEY ISLAND PLANT	AV Z @ KNAPP ST	E 1/4 - 1/2 (0.353 mi.)	O74	281
AVE Z & KNAPP ST	AVE Z & KNAPP ST	E 1/4 - 1/2 (0.353 mi.)	O75	284
2624 E. 22ND STREET	2624 E. 22ND STREET	WSW 1/4 - 1/2 (0.381 mi.)	Q80	302
FORMER GETTY GAS STATION	2624 EAST 22ND ST	WSW 1/4 - 1/2 (0.381 mi.)	Q81	304
SHEEPSHEAD & NOSTROM	2273 BATCHELDER ST	NNE 1/4 - 1/2 (0.383 mi.)	R85	324
SHEEPSHEAD/NOSTRAND	2273 BATCHELDER STREET	NNE 1/4 - 1/2 (0.383 mi.)	R87	326
3147 VOORHIES ST & KNAPP	3147 VOORHIES ST & KNAP	ESE 1/4 - 1/2 (0.385 mi.)	90	330
CONEY ISLAND POLL CONT PL	25-91 KNAPP ST	E 1/4 - 1/2 (0.405 mi.)	U95	342
SHORE PARKWAY	SHORE PARKWAY	SE 1/4 - 1/2 (0.409 mi.)	W98	351
26TH AV	26TH AVE & SHORE PARKWAY	E 1/4 - 1/2 (0.409 mi.)	W99	353
CONEY ISLAND WPCP/BKLYN	KNAPP ST & AVENUE Z	E 1/4 - 1/2 (0.409 mi.)	U100	356
CONEY ISLAND BYPASS	AVENUE Z & KNAPP	E 1/4 - 1/2 (0.409 mi.)	U101	358
CONEY ISLAND PLANT	2591 KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	U102	361
CONEY ISLAND WASTE WATER	KNAPP ST/ AVE Z	E 1/4 - 1/2 (0.409 mi.)	U103	363
CONEY ISLAND TREATMENT C	AVE Z/KNAPP ST	E 1/4 - 1/2 (0.409 mi.)	U105	367
CONEY ISLAND WPCP	AVE Z & KNAPP ST.	E 1/4 - 1/2 (0.409 mi.)	U106	369
CONEY ISLAND WTP	KNAPP ST.&AVENUE Z	E 1/4 - 1/2 (0.409 mi.)	U107	373
WASTE WTR TREATMENT PLANT	AVENUE Z & KNAPP STREET	E 1/4 - 1/2 (0.409 mi.)	U108	375
2591 KNAPP ST/CONEY ISLAN	2591 KNAPP STREET	E 1/4 - 1/2 (0.410 mi.)	U109	377
SEWERAGE TREATMENT PLANT	2591 KNAPP STREET	E 1/4 - 1/2 (0.411 mi.)	U112	391
2472 KNAPP ST.	2472 KNAPP ST.	ENE 1/4 - 1/2 (0.413 mi.)	X114	394
2110 JEROME AVENUE	2102 AVENUE Z	WSW 1/4 - 1/2 (0.420 mi.)	Z119	426
OLD GETTY STATION	2102 AVENUE Z	WSW 1/4 - 1/2 (0.425 mi.)	Z121	432
VOORHIES AVE & KNAPP ST	VOORHIES AVE & KNAPP ST	ESE 1/4 - 1/2 (0.437 mi.)	AC127	463
PARKING LOT	VOORHIES AV & KNAPP ST	ESE 1/4 - 1/2 (0.440 mi.)	AC131	470
Not reported	KNAPP ST/VOORHEES AV	ESE 1/4 - 1/2 (0.440 mi.)	AC133	474
ABANDONED MARINA	KNAPP ST & VOORHIES AVE	ESE 1/4 - 1/2 (0.440 mi.)	AC134	476
2701 KNAPP STREET	2701 KNAPP STREET	ESE 1/4 - 1/2 (0.443 mi.)	AC139	487
SUNOCO/KNAPP ST,BROOKLYN	2701 KNAPP ST	ESE 1/4 - 1/2 (0.443 mi.)	AC141	496
Not reported	ALLEN AV & KNAPP ST	NE 1/4 - 1/2 (0.446 mi.)	AB142	497
SERVICE BOX 67885	2211 EAST 28TH ST	NNW 1/4 - 1/2 (0.452 mi.)	145	502
Not reported	E 22 ST /SHORE PKY	SW 1/4 - 1/2 (0.461 mi.)	147	506
2348 KNAPP ST	2348 KNAPP ST	NE 1/4 - 1/2 (0.466 mi.)	151	517
VAULT 4338	AVE V & NOSTRAND AVE	N 1/4 - 1/2 (0.476 mi.)	AG154	524
MANHOLE #61808	AVE V & NOSTRAND AVE	N 1/4 - 1/2 (0.476 mi.)	AG155	527
AVE V BETWEEN	E 29TH ST & NOSTRAND AV	NNW 1/4 - 1/2 (0.477 mi.)	160	545
SATARA REALTY INC	2900 OCEAN AVENUE	W 1/4 - 1/2 (0.485 mi.)	AI165	562
3025 OCEAN AV / BKLN	3025 OCEAN AV	WSW 1/4 - 1/2 (0.486 mi.)	AK168	572
Lower Elevation	Address	Direction / Distance	Map ID	Page
4085 NOSTRAND AVE.	4085 NOSTRAND AVE.	S 1/4 - 1/2 (0.370 mi.)	P77	291
EXXON STATION	4085 NOSTRAND AV	S 1/4 - 1/2 (0.370 mi.)	P78	292
FORMERLY ROY ROGERS REST	2902 EMMONS AVE	S 1/4 - 1/2 (0.404 mi.)	S91	333
Not reported	28TH ST & EMMONS AVE	S 1/4 - 1/2 (0.404 mi.)	T93	337
TM 1842	EMMONS AVE/E 28TH ST	S 1/4 - 1/2 (0.404 mi.)	T94	339
3050 EMMONS AVE/BKLYN	3050 EMMONS AVENUE	SSE 1/4 - 1/2 (0.407 mi.)	P96	345
3030 EMMONS AVE	3030 EMMONS AVE	SSE 1/4 - 1/2 (0.414 mi.)	116	408
CONEY ISLAND/ AVE. Z AND	AVE Z,/ KNAPP ST.	E 1/4 - 1/2 (0.433 mi.)	V123	437
SHEEPSHEAD BAY YACHT CLUB	3076 EMMONS AV	SSE 1/4 - 1/2 (0.435 mi.)	AA124	440
SHEEPSHEAD BAY	3076 EMMONS AVE	SSE 1/4 - 1/2 (0.435 mi.)	AA125	444

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SHEEP HEADS BAY PIER 3	EMMONS AVE & BEDFORD AVE	SSW 1/4 - 1/2 (0.441 mi.)	AD135	479
PIER 6	EMMONS AV/BEDFORD AV	SSW 1/4 - 1/2 (0.441 mi.)	AD137	483
CASTLE HARBOR REST.	FORD STREET & EMMONS AV	SSE 1/4 - 1/2 (0.470 mi.)	AH152	519
VAULT 5615	EMMONS AVE/FORD ST	SSE 1/4 - 1/2 (0.470 mi.)	AH153	522
BRAGE ST & EMMONS AVE	BRAGE ST & EMMONS AVE	SE 1/4 - 1/2 (0.484 mi.)	AJ164	559
SCHAPPS BROTHERS MARINA	3148 COORHIES AVE	ESE 1/4 - 1/2 (0.488 mi.)	AL171	578
3148 VOORHIES AVE	3148 VOORHIES AVE	ESE 1/4 - 1/2 (0.488 mi.)	AL172	580
MANHOLE #36062	EMMONS AVE & COYLE ST	SE 1/4 - 1/2 (0.499 mi.)	AJ176	594

Other Ascertainable Records

RCRA-NonGen: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA-NonGen list, as provided by EDR, and dated 03/15/2012 has revealed that there are 3 RCRA-NonGen sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
YONGS CLEANERS INC DBA QUALITY	3801 NOSTRAND AVE	NNE 0 - 1/8 (0.012 mi.)	A4	11
GETTY SERVICE STATION	AVE Y & NOSTRAND AVE	N 0 - 1/8 (0.013 mi.)	B5	22
R & S STRAUSS ASSOC	3720 NOSTRAND AVE	N 0 - 1/8 (0.107 mi.)	G25	116

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the MANIFEST list, as provided by EDR, and dated 08/01/2012 has revealed that there are 8 MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
YONGS CLEANERS INC DBA QUALITY	3801 NOSTRAND AVE	NNE 0 - 1/8 (0.012 mi.)	A4	11
GETTY SERVICE STATION	AVE Y & NOSTRAND AVE	N 0 - 1/8 (0.013 mi.)	B5	22
R & S STRAUSS ASSOC	3720 NOSTRAND AVE	N 0 - 1/8 (0.107 mi.)	G25	116
ROSE SHARON DRY CLEANING CORP	3696 NOSTRAND AVE	N 1/8 - 1/4 (0.152 mi.)	G35	161
PRIMA CLNRS	2966 AVENUE X	NNE 1/8 - 1/4 (0.178 mi.)	I46	201
SHEEPSHEAD BAY HIGH SCHOOL	3000 AVE X	N 1/8 - 1/4 (0.179 mi.)	K48	208
NYCHA - SHEEPSHEAD	3661 NOSTRAND AVE	N 1/8 - 1/4 (0.205 mi.)	53	236
CON ED - VS 2836	2998 AVE X	NNE 1/8 - 1/4 (0.223 mi.)	L54	238

DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the DRYCLEANERS list, as provided by EDR, and dated 06/20/2012 has revealed that there is 1 DRYCLEANERS site within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
QUALITY CLEANERS	3801 NOSTRAND AVENUE	NNE 0 - 1/8 (0.012 mi.)	A3	11

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 611 records.

Site Name	Database(s)
CONED	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON MH59268	MANIFEST
CONSOLIDATED EDISON MH66889	MANIFEST
BELL ATLANTIC-NY	MANIFEST
NYCHA - SHEEPSHEAD NOSTRAND HOUSE	RCRA-CESQG, FINDS, MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON MH62806	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
SARA DRY CLEANING	MANIFEST, NY Spills
BELL ATLANTIC-NY	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CON EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	MANIFEST
LEFFERTS HOMESTEAD	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON MH2292	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	MANIFEST
BP PRODUCTS OF NORTH AMERICA INC	MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
NYNEX	MANIFEST
MEEKER AVE	RCRA-NonGen, FINDS, MANIFEST, NY Spills, NY Hist Spills
CONSOLIDATED EDISON	MANIFEST
CON EDISON CO OF NYC, INC.	MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON	RCRA-NonGen, MANIFEST
CONSOLIDATED EDISON MH58898	MANIFEST
CONSOLIDATED EDISON MH453	MANIFEST
VS4664	RCRA-NonGen, MANIFEST
K - SCHOLLES ST. STATION	SHWS
CITYWIDE CESSPOOL COMPANY	SWF/LF, NY Spills, NY Hist Spills
SMITH STREET	SWF/LF, NY Spills, NY Hist Spills
1101 AVE R/N Y TEL	LTANKS, HIST LTANKS
369 KINGSLAND AVE/KRIEGER	LTANKS, HIST LTANKS
817 NEPTUNE AVE/ B.U.G.	LTANKS, HIST LTANKS
METRO	LTANKS
CONY ISLAND AVE BRIDGE AT SHORE R	LTANKS
MARINE PARKWAY BRIDGE	LTANKS
1782 GLEASON AVE	LTANKS, HIST LTANKS
MILL AVE. / BROOKLYN, NEW	LTANKS, HIST LTANKS
378 CONY ISLAND AVE.'	LTANKS, HIST LTANKS
21 E PITKIN AVE	LTANKS
592 FRANKLIN AVE	LTANKS, HIST LTANKS

EXECUTIVE SUMMARY

METROPOLITAIN AVE AND	LTANKS, HIST LTANKS
52-01A FLUSHING AVENUE	LTANKS
108-04 FLAT LANDS AVE	HIST LTANKS
1410 AVE S	UST
CON EDISON - MANHOLE 25229	RCRA-LQG
NYCDOT BIN 22231370	RCRA-LQG
BELL ATLANTIC-NY	RCRA-NonGen
BELL ATLANTIC-NY	RCRA-NonGen
CON EDISON	RCRA-NonGen
CON EDISON	RCRA-NonGen
NORTH 14TH ST. AND KENT AVE	ERNS
17TH AVE AND 59TH STREET	ERNS
18TH AVE ON THE WEST END LINE	ERNS
1ST AVE AND 53RD ST BUILDING 14C	ERNS
20TH AVE. STATION	ERNS
EAST 22 ST NORTH OF AVE S	ERNS
22ND STREET & 3RD AVE	ERNS
EAST 22ND ST BETWEEN VOORHIES AVE	ERNS
25TH ST AND 3RD AVE	ERNS
27TH ST AND 2ND AVE	ERNS
29TH ST AND 2ND AVE	ERNS
33RD AND 2ND AVE GOWANUS CANAL	ERNS
3RD AVE AND WYCKOFF ST	ERNS
3RD AVE AND WYCKOFF ST	ERNS
3RD ST AND 3RD AVE	ERNS
3RD AVE. AND 10TH ST.	ERNS
44TH ST AND 3RD AVE	ERNS
56TH ST AND 15TH AVE	ERNS
0010 57TH ST - STILLWELL AVE	ERNS
58TH STREET AND AVE U	ERNS
58TH ST. AND 1ST AVE.	ERNS
5TH AVE AND 6TH STREET	ERNS
5TH AVE AND 66TH ST LEIF ERICSON P	ERNS
60TH ST AND 4TH AVE	ERNS
60TH ST AND 4TH AVE	ERNS
MH# 62232/PROSPECT AVE 30FT WEST O	ERNS
EAST 64TH AND AVE X	ERNS
64TH STREET AND 3RD AVE	ERNS
EAST 66TH ST. AND AVE W	ERNS
67TH ST AND 5TH AVE	ERNS
67TH ST AND 5TH AVE	ERNS
EAST 68TH STREET AND AVE U	ERNS
EAST 69TH AND AVE Y	ERNS
69TH ST 2ND AVE	ERNS
6TH STREET AND 2ND AVE	ERNS
6TH STREET ADN 2ND AVE	ERNS
E. 72ND ST. BETWEEN AVE L AND AVE	ERNS
7TH AVE	ERNS
7TH AVE	ERNS
1143 ALANTIC AVE.	ERNS
712 AND 716 AVE M	ERNS
ATLANTIC AVE	ERNS
ATLANTIC AVE	ERNS
3718 AVE S	ERNS
5423 AVE N	ERNS
AVE K AND E. 18TH ST	ERNS
10 BAYRIDGE AVE	ERNS
BERGEN AVE, AVE U	ERNS
BERGEN AVE AND L	ERNS
BROOKLYN QUEENS EXPRESS ATLANTIC A	ERNS
CEAN AVE. AT THE WATER	ERNS
CHANNEL AVE	ERNS

EXECUTIVE SUMMARY

CHAUNCEY AVE & STAYVESANT	ERNS
CHESTER AVE	ERNS
CHRISTOPHER AND HAGAMAN AVE IN VAC	ERNS
CHURCH AVE STATION	ERNS
75 CLASSON AVE AND FLUSHING AVE	ERNS
COLUMBIA AVE	ERNS
CON EDISON HUDSON AVE	ERNS
CONEY ISLAND CREEK, ON NEPTUNE AVE	ERNS
NE CORNER OF HALSEY ST & TOMPKINS	ERNS
NORTHWEST CORNER OF EAST 34TH ST A	ERNS
CORNER OF CANAL AVE AND CROPSEY AV	ERNS
CORNER OF EAST 28TH AND FORESTER A	ERNS
2968 SW CORNER OF FULTON AND GRAND	ERNS
COWANUS CANAL 29TH STREET AND 2ND	ERNS
CREEK AT END OF GARRISON AVE	ERNS
CREEK AT END OF GARRISON AVE	ERNS
CROPSEY AVE. CORNER OF BAY 54TH ST	ERNS
CROPSEY AVE. CORNER OF BAY 54TH ST	ERNS
DEKALB AVE	ERNS
DEKALB AVE	ERNS
3939 EMMENS AVE	ERNS
3939 EMMENS AVE	ERNS
EMMONDS AVE AND SHORE BLVD	ERNS
EMMONS AVE	ERNS
EMMONS AVE AND SHORE AVE	ERNS
EMMONS AVE AND SHORE BLVD SHEEPS H	ERNS
EMMONS AVE AND EAST 29TH STREETS,	ERNS
EMMONS AVE AND NOSTRAND AVE	ERNS
EMMONS AVE	ERNS
EMMONS AVE	ERNS
EMMONS AVE	ERNS
EMMONS AVE	ERNS
END OF BERGAN AVE NEXT TO BRIDGE C	ERNS
END OF OCEAN AVE. AT THE	ERNS
END OF 4TH AVE AT BAYSIDE AVE	ERNS
END OF GOTHAM AVE	ERNS
NORTH FIRST STREET OIL FARM 214 KE	ERNS
2875 FLATBRUSH AVE.	ERNS
ON FLATBUSH AVE.	ERNS
FLATBUSH AVE AND ATLANTIC AVE NONE	ERNS
3062 FLAT BUSH AVE.	ERNS
122-66 FLATLANDS AVE	ERNS
FULTON ST AND PORTLAND AVE	ERNS
GATES AVE	ERNS
GEORGIA AVE FULTON ST	ERNS
GEORGIA AVE FULTON ST	ERNS
GOWANAS TURBINE PLANT 29TH ST & 2N	ERNS
GRAND ST. AND BUSHWICK AVE.	ERNS
GREEN POINT AVE	ERNS
HAMILTON AVE	ERNS
HAMILTON AVE	ERNS
2750 HOME CREST AVENUE/BETWEEN NEP	ERNS
HUDSON AVE GENERATING STATION	ERNS
HUDSON AVE GENERATING STATION	ERNS
HUDSON AVE STATION	ERNS
INTERSECTION OF JAMAICA AVE AND BU	ERNS
INTERSECTION OF FLATLANDS AVE, TRO	ERNS
INTERSECTION OF CLAIRMONT AVE AND	ERNS
500 WEST KENT AVE	ERNS
KINGSTON AVE STATION	ERNS
LAFAYETTE AVE AND BEDFORD AVE	ERNS
17 LANCONE CT AND EVERIT AVE	ERNS

EXECUTIVE SUMMARY

469 A LEXINGTON AVE	ERNS
MANHATTAN AVE FROST AVE	ERNS
MANHOLE 65414 AT 1037 LORING AVE	ERNS
MANHOLE 65414 AT 1037 LORING AVE	ERNS
MANHOLE 2889 VANDERBILT AND GATES	ERNS
ST MARKS AVE	ERNS
MILL AVE AND EAST 63RD	ERNS
NEPTUNE AND STILLWELL AVE	ERNS
NEPTUNE AVE	ERNS
NEPTUNE AVE	ERNS
NEW UTRECHT AVE	ERNS
NEWTOWN CREEK MANHATTAN AVE GREEN	ERNS
OCEAN AVE	ERNS
OFF OF EMONS AVE	ERNS
OLD ULTRAMIRE FUEL TERMINAL LOCATE	ERNS
PADICUTT AVE	ERNS
ST PAULS PLACE AT CANTON AVE MANHO	ERNS
PIER 9 EMMONS AVE	ERNS
REAR OF DYKER HEIGHTS GOLF COURSE	ERNS
REMSEN AVE	ERNS
EAST RIVER AT HUDSON AVE GENERATIN	ERNS
SCHATZ BROTHERS MARINA 3148 VOORIE	ERNS
2262 SCHENTETY AVE	ERNS
SHEEPSHEAD BAY CROSS STREET OF EMM	ERNS
SHELLBANK AVE/HARKNESS AVE	ERNS
SHEPHARD'S AVE STATION	ERNS
SOUTH SIDE OF FOSTER AVE 196FT E.	ERNS
NORTH SIDE OF LINCOLN AVE	ERNS
2712 STOWELL AVE	ERNS
SUN REFINING & MARKETING 5620 AVE	ERNS
UNKNOWN SHEEN INCIDENT EMMONS AVE	ERNS
514 VANDERBILDT AVE	ERNS
AT VANDERVOORT AVE AND MASPETH AVE	ERNS
VAULT 3122 FEEDER 9B11 SHEFFEILD A	ERNS
VAULT: VS 1198 1198 10TH AVE	ERNS
VAULT: VS 1198 1198 10TH AVE	ERNS
1211 WASHINGTON AVE	ERNS
WASHINGTON AVE FULTON	ERNS
718 WHITE AVE	ERNS
WYTHE AVE.	ERNS
MILL BASIN AREA, AVE. N AND ROYCE	FINDS
NYC EDC-GERRITSEN AVE	FINDS
NYC DOT-OCEAN AVE PED BRG	FINDS
SERVICE BOX # 18269	NY Spills
10TH AVE & FLUSHING AVE	NY Spills, NY Hist Spills
	NY Spills, NY Hist Spills
NEPTUNE AVE	NY Spills
REGINA PACIS SCHOOL	NY Spills
13TH AVE & 71ST ST	NY Spills
MANHOLE # 6210	NY Spills
14 AVE. & 15TH STREET	NY Spills, NY Hist Spills
1780 NOSTRAND & AVE N	NY Spills, NY Hist Spills
MANHOLE 57741	NY Spills, NY Hist Spills
1ST AVE BET 50 & 51ST STS	NY Spills, NY Hist Spills
22ND & 2ND AVE	NY Spills, NY Hist Spills
GOWANUS BAY	NY Spills, NY Hist Spills
MANHOLE 66767	NY Spills
MANHOLE # 62806	NY Spills
28 4TH ST BETWEEN SMITH AND HOYT	NY Spills
2934 BRIGHTON AVE & 12TH	NY Spills, NY Hist Spills
GOWANUS GAS TURBINE SITE	NY Spills, NY Hist Spills
TS 6002	NY Spills, NY Hist Spills

EXECUTIVE SUMMARY

MANHOLE 71777
MANHOLE #71776
E 29TH ST & KINGS HWY
2NS AVE & E. 154TH ST
THIRD AVE AND
CORNER FILLMORE AVE +
BETWEEN 14TH AND 15TH AVE
221218; THIRD AVE
MANHOLE #66770
4411 13TH AVE/ S. WEISS
MTA BUS 5285
EAST 5TH ST/ CROSS ST GRRENWOOD AV
MANHOLE 2668
62ND STREET 3RD AVE.
EAST 64TH & AVE. X
AVE H
EAST 68TH ST & AVE "Y"
69TH ST - AVE.W
TRANSFORMER
ROADWAY
18 AVE U BETWEEN
162 AVE T OFF WEST
MANHOLE #6574
MANHOLE 50411
17TH AVE BETWEEN
FLATLANDS AVE BETWEEN
23RD AVE AND
8501 FLATLANDS AVE @
86TH ST 19TH AVE & NEW UT
E. 9TH ST & AVE D
ENTRANCE TO 38TH STREET Y
52-01 18TH AVE
3723 18TH AVE
MANHOLE 66351
221503; ALBANY AVE
NASSAU AVE AT
RT278 AT ATLANTIC AVE
222188; ATLANTIC AVE
221578; ATLANTIC AVE
220407; ATLANTIC AVE
EUCLID AVE SUB STATION
SCHENECTADY AVE AND
BROOKLYN AVE &
MANHOLE #3703
AVE A/SHEEPSHEAD BAY RD
AVE W @ STILLWELL AVE
220773; AVE L
BETW/AVE X &
AVE U/E53RD ST
17TH AVE /
FLATBUSH AVE AND
AVE Z BET E 21ST & E 22ND
MANHOLE @ AVE I WEST OF MCDONALD A

EASTERN PKWY SERVICE RD
AVE F & MC DONALD ST
COONEY ISLAND AVE AT
AVE Z AND KNAPP STREET
AVE V PUMP STATION.
AVE P PUMP STATION
AVE V. PUMP STATION
AVE V PUMP STATION

NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills

EXECUTIVE SUMMARY

MANHOLE 6266	NY Spills, NY Hist Spills
MANHOLE 2748	NY Spills, NY Hist Spills
MANHOLE 1341	NY Spills, NY Hist Spills
MANHOLE #43243	NY Spills
POLE 35647	NY Spills
MANHOLE 68037	NY Spills
TM 1723	NY Spills
EAST 83RD STREET AT	NY Spills
MANHOLE 64798	NY Spills
MANHOLE 66081	NY Spills
CON ED MANHOLE 64150	NY Spills
MILL BASIN	NY Spills, NY Hist Spills
ONE QT OIL IN SB 60422	NY Spills
MANHOLE 1519	NY Spills, NY Hist Spills
4750 BEDFORD AVE	NY Spills, NY Hist Spills
VAULT #VS849	NY Spills
MANHOLE 63199	NY Spills
MANHOLE 3117	NY Spills
BELT PRKWY & KNAPPS AVE	NY Spills, NY Hist Spills
MANHOLE 71301 PARK AVE	NY Spills, NY Hist Spills
BET LOUISIANA & MALTA AVE	NY Spills, NY Hist Spills
KINGSLAND AVE	NY Spills, NY Hist Spills
MANHOLE#66768 3RD AVE.	NY Spills
THIRD AVE	NY Spills
KINGSLAND AVE	NY Spills, NY Hist Spills
FRANKLYN AVE	NY Spills, NY Hist Spills
CONNIEISLAND AVE	NY Spills, NY Hist Spills
CENTRAL AVE AND	NY Spills
AVE X AT	NY Spills, NY Hist Spills
BQE- W.BOUND ATLANTIC AVE	NY Spills, NY Hist Spills
BQE - ATLANTIC AVE	NY Spills, NY Hist Spills
BREE AVE AND BRIGGS AVE	NY Spills
GREEN PT. AVE BRIDGE	NY Spills
BROOKLYN/QUEENS EXPRESSWAY-ATLANTI	NY Spills
BQE @ HAMILTON AVE EXIT	NY Spills, NY Hist Spills
EASTBOUND-HAMILTON AVE EX	NY Spills
BQE-ATLANTIC AVE EXIT	NY Spills, NY Hist Spills
BROOKLYN QUEENS EXPRESSWAY @ BEDFO	NY Spills
PROPERTY(AVE. T & U)	NY Spills
MANHOLE # 6895	NY Spills
CRWAFORD AVE OFF	NY Spills, NY Hist Spills
BETWEEN AVE S & FIRST CT	NY Spills, NY Hist Spills
CORNER FORSTER AVE AND EAST 92ND S	NY Spills
FLATBUSH AVE &	NY Spills, NY Hist Spills
CROPSEY AVE PATHMARK	NY Spills, NY Hist Spills
218198; DITMAS AVE AND E.4ST	NY Spills
EAST 88TH ST/DITMAS AVE	NY Spills, NY Hist Spills
REGULATOR ON THE STREET	NY Spills
ABANDONED TANKER TRUCK	NY Spills
EASTER AVE & RALPH AVE	NY Spills, NY Hist Spills
	NY Spills, NY Hist Spills
	NY Spills, NY Hist Spills
MANHOLE 361	NY Spills
MANHOLE 1913	NY Spills
EDMOND AVE	NY Spills, NY Hist Spills
SHEEPS HEAD BAY	NY Spills
EMMONS AVE & SHORE RD	NY Spills, NY Hist Spills
EMMOS AVE/ DOOLEY ST	NY Spills, NY Hist Spills
15TH ST & THIRD AVE	NY Spills, NY Hist Spills
BQE @ ATLANTIC AVE.	NY Spills, NY Hist Spills
EUCLID AVE STATION	NY Spills, NY Hist Spills
DRUM RUN	NY Spills

EXECUTIVE SUMMARY

MANHOLE # 59048	NY Spills
MANHOLE #60386	NY Spills, NY Hist Spills
MANHOLE3137	NY Spills, NY Hist Spills
FEEDER ACCIDENT - MH 61598	NY Spills
FOOT OF 29 ST. BKLYN/SHEE	NY Spills, NY Hist Spills
FORT HAMILTON AVE.	NY Spills
WYCKOFF AVE	NY Spills, NY Hist Spills
VAULT 3606	NY Spills, NY Hist Spills
FLUSHING AVE	NY Spills, NY Hist Spills
FRANKLIN ST/MANHATTAN AVE	NY Spills, NY Hist Spills
MANHOLE 4709	NY Spills
VAULT 4514	NY Spills
HUDSON AVE	NY Spills, NY Hist Spills
WILLIAMS AVE	NY Spills
HUDSON AVE STATION	NY Spills
GOWANUS EXPRESSWAY & 7TH AVE OVERP	NY Spills
ON ROADWAY PORTER AVE AND VARICK A	NY Spills
GREENPOINT AVE BRIDGE	NY Spills
FIVE GAL OIL IN MANHOLE 61269	NY Spills
KINGSLAND AVE	NY Spills
GREENPOINT AVE	NY Spills, NY Hist Spills
VAULT 7162	NY Spills
ACCIDENT	NY Spills
GUIDER AVE, CONEY ISL AV	NY Spills
HAMILTON AVE BRIDGE	NY Spills
HAMILTON AVE & 6TH AVE	NY Spills, NY Hist Spills
GOWANUS CANAL	NY Spills, NY Hist Spills
GOWANUS CANAL	NY Spills, NY Hist Spills
BACKYARD GARDEN	NY Spills
COMPRESSOR SPILL	NY Spills
MANHOLE #73645	NY Spills
METROPOLITAN AVE/BTWN	NY Spills, NY Hist Spills
POLE #24483	NY Spills
-MANHOLE 38185	NY Spills
HUDSON AVE GEN. STATION	NY Spills, NY Hist Spills
HUDSON AVE HEAD HOUSE YARD	NY Spills
221330; HUDSON AVE	NY Spills
221108; HUDSON AVE STATION	NY Spills
HUDSON AVE	NY Spills
HUDSON AVE TUNNEL	NY Spills, NY Hist Spills
HUDSON AVE EAST RIVER	NY Spills, NY Hist Spills
HUDSON AVE STATION	NY Spills, NY Hist Spills
HUDSON AVE & EAST RIVER	NY Spills, NY Hist Spills
EAST SIDE OF HUDSON AVE/40 FEET SO	NY Spills
HUDSON AVENUE ANNEX	NY Spills, NY Hist Spills
COOLANT RELEASE IN MOTOR VEHICLE A	NY Spills
8 OZ LEAK FROM OVERHEAD CRANE	NY Spills
81 NORTH ID FAN POLE CHANGER	NY Spills
LUBE OIL FITTING FAILED # 5 GAS TU	NY Spills
SHEEN IN EAST RIVER	NY Spills
CON ED	NY Spills, NY Hist Spills
METROPLITIAN AVE JUST OFF	NY Spills, NY Hist Spills
INTERSECTION OF MALCOM X BVLD & PU	NY Spills
INTERSECTION OF FLATBUSH AVE AND N	NY Spills
JAMAICA AVE & CYPRESS AVE	NY Spills, NY Hist Spills
MANHOLE 2441	NY Spills
JEFFERSON AVE.	NY Spills, NY Hist Spills
MANHOLE #21454	NY Spills
HUDSON AVE EAST SUBSTATION	NY Spills
BOX 38486	NY Spills, NY Hist Spills
TO ROADWAY	NY Spills
ROADWAY	NY Spills

EXECUTIVE SUMMARY

KINGS HIGHWAY MOBIL
 AVE. V IS NOT VICTORIOUS
 MEEKER AVE & KOSCIOSKO BR
 LAFAYETTE AVE
 MANHOLE 5265
 MANHOLE 5143
 WILLIAMS AVE
 MH 62778
 1094 FLUSHING AVE
 FLUSHING AVE/N. OXFORD
 ON THE STREET 580 -574 MAPLE AVE
 MARINE PARK/FLATBUSH AVE
 MANHOLE TM1294
 MACDONALD AVE S OF AVE J
 AVE P &
 MCGUINNES & MESEROLE AVE
 MANHOLE 64805
 MEEKER AVE/MCGUINNESS BLVD
 MANHOLE 36339
 METROPOLITAN AVE BRIDGE
 EAST NEW YORK AVE
 0
 FLATBUSH AVE &
 221635; MYRTLE AVE
 219837; MYRTLE AVE
 MANHOLE 10412
 MANHOLE 1964
 MANHOLE 63539
 MCGINNESS AVE BETWEEN
 NEAR CROPSY AVE BRIDGE
 MH 6654
 STREET BY NYNEX GARAGE
 CORNER OF NEW YORK AVE
 NEW YORK AVE
 DRUM RUN
 TV 413
 DRUM RUN
 NEWTON CREEK\MEEKER AVE
 ROADWAY
 VAULT 1578
 MANHOLE 57023

NYCT
 221422; S NY AVE
 MANHOLE 65792
 823 CLASSON AVE
 222104; OCEAN AVE
 222004; OCEAN AVE
 NORTH SIDE AVE I 129 FEET
 0 OCEAN AVE 800 FEET
 BEHIND WHITMAN DR
 METROPOLITAN AVE BRIDGE
 KATON AVE ON OVERPASS
 RALPH AVE & FLATLANDS AVE
 SEAVIEW AVE AND
 POLE 67414
 PAIDGE AVE/DUTCH KILLS
 VANDERBUILT AVE &
 MAN HOLE 580
 MANHOLE 31211
 FOUR OZ OIL IN MANHOLE #3083
 PATTICUT BASIN-BERGEN AVE

NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills
 NY Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills, NY Hist Spills
 NY Spills
 NY Spills
 NY Spills
 NY Spills
 NY Spills, NY Hist Spills


EXECUTIVE SUMMARY

NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills, NY Hist Spills
NY Spills
NY Spills
NY Spills
NY Spills
NY Spills

EXECUTIVE SUMMARY

209681; ATLANTIC AVE; M 2594 (6B54	NY Spills
208583; 14 AVE	NY Spills
207442; AVE M	NY Spills
206649; 13 AVE	NY Spills
205848; AVENUE U	NY Spills
206257; AVENUE N	NY Spills
208115; BEDFORD AVE; M3434	NY Spills
207815; BEDFORD AVE; TM-1210	NY Spills
207081; N/S CHURCH AVE 39' E/O ROG	NY Spills
207868; CLERMONT AVE; M1995	NY Spills
209891; E/S CROPSEY AVE 112' S/O B	NY Spills
207850; DEKALB AVE; M-12031	NY Spills
210050; DUMONT AVE; MH-3868	NY Spills
206515; N/S ETNA ST 20' E/O NICHOL	NY Spills
208287; FLATBUSH AVE; M3540	NY Spills
206809; FLATBUSH AVE; M-2733	NY Spills
206224; FRANKLIN AVE; SB26112 - F/	NY Spills
210117; GARDNER AVE; V4346	NY Spills
207761; GEORGIA AVE; M3946	NY Spills
207758; GEORGIA AVE; M66371	NY Spills
208725; GEORGIA AVE; TM-730 (9B11)	NY Spills
206528; GEORGIA AVE; M66414	NY Spills
NORTH OF GREENPOINT AVE. BRIDGE	NY Spills
PARKING LOT	NY Spills
205842; KINGS HWY	NY Spills
206626; LAFAYETTE AVE	NY Spills
210159; LINCOLN AVE	NY Spills
207781; LIVONIA AVE & NEW JERSEY A	NY Spills
205393; MASPETH AVE	NY Spills
PULASKI BRIDGE	NY Spills
207889; 657 MYRTLE AVE; BET. FRANK	NY Spills
207134; N/E/C ATLANTIC AVE & HOYT	NY Spills
205081; NEPTUNE AVE VS4897 - S/S N	NY Spills
206847; NEW YORK AVE; M64729	NY Spills
207410; PROSPECT AVE; M-4146	NY Spills
204946; PROSPECT AVE	NY Spills
221745; PROSPECT AVE	NY Spills
221746; PROSPECT AVE	NY Spills
221748; PROSPECT AVE	NY Spills
209621; RALPH AVE; M-3332 E/S RALP	NY Spills
207045; RALPH AVE	NY Spills
204935; M2426 S/W/C HALSEY ST & KN	NY Spills
210053; SHEFFIELD AVE; M-66341 E/S	NY Spills
208408; VANDERBILT AVE; M1794	NY Spills
207007; M6292 W/S E.4TH ST 26' S/O	NY Spills
208432; WASHINGTON AVE; M-4788	NY Spills
207718; WASHINGTON AVE; M-2904	NY Spills
206591; WASHINGTON AVE; M4781	NY Spills
205826; WASHINGTON AVE; M-63261	NY Spills
209654; WILLIAMS AVE; M-65838	NY Spills
209392; W/S WILLIAMS AVE 300' S/O	NY Spills
209741; WYTHE AVE; M-4848	NY Spills
209267; WYTHE AVE	NY Spills
5700 AVE. U SITE	HSWDS
ATLANTIC TOWERS APT CORP.	HIST UST, HIST AST
PUBLIC SCHOOL 194	HIST AST
1410 AVE S	HIST UST
BARREN ISLAND MARINA INC	HIST UST
3203 NOSTRAND AVE OWNERS CORP.	HIST UST

DETAIL MAP - 3465818.2s

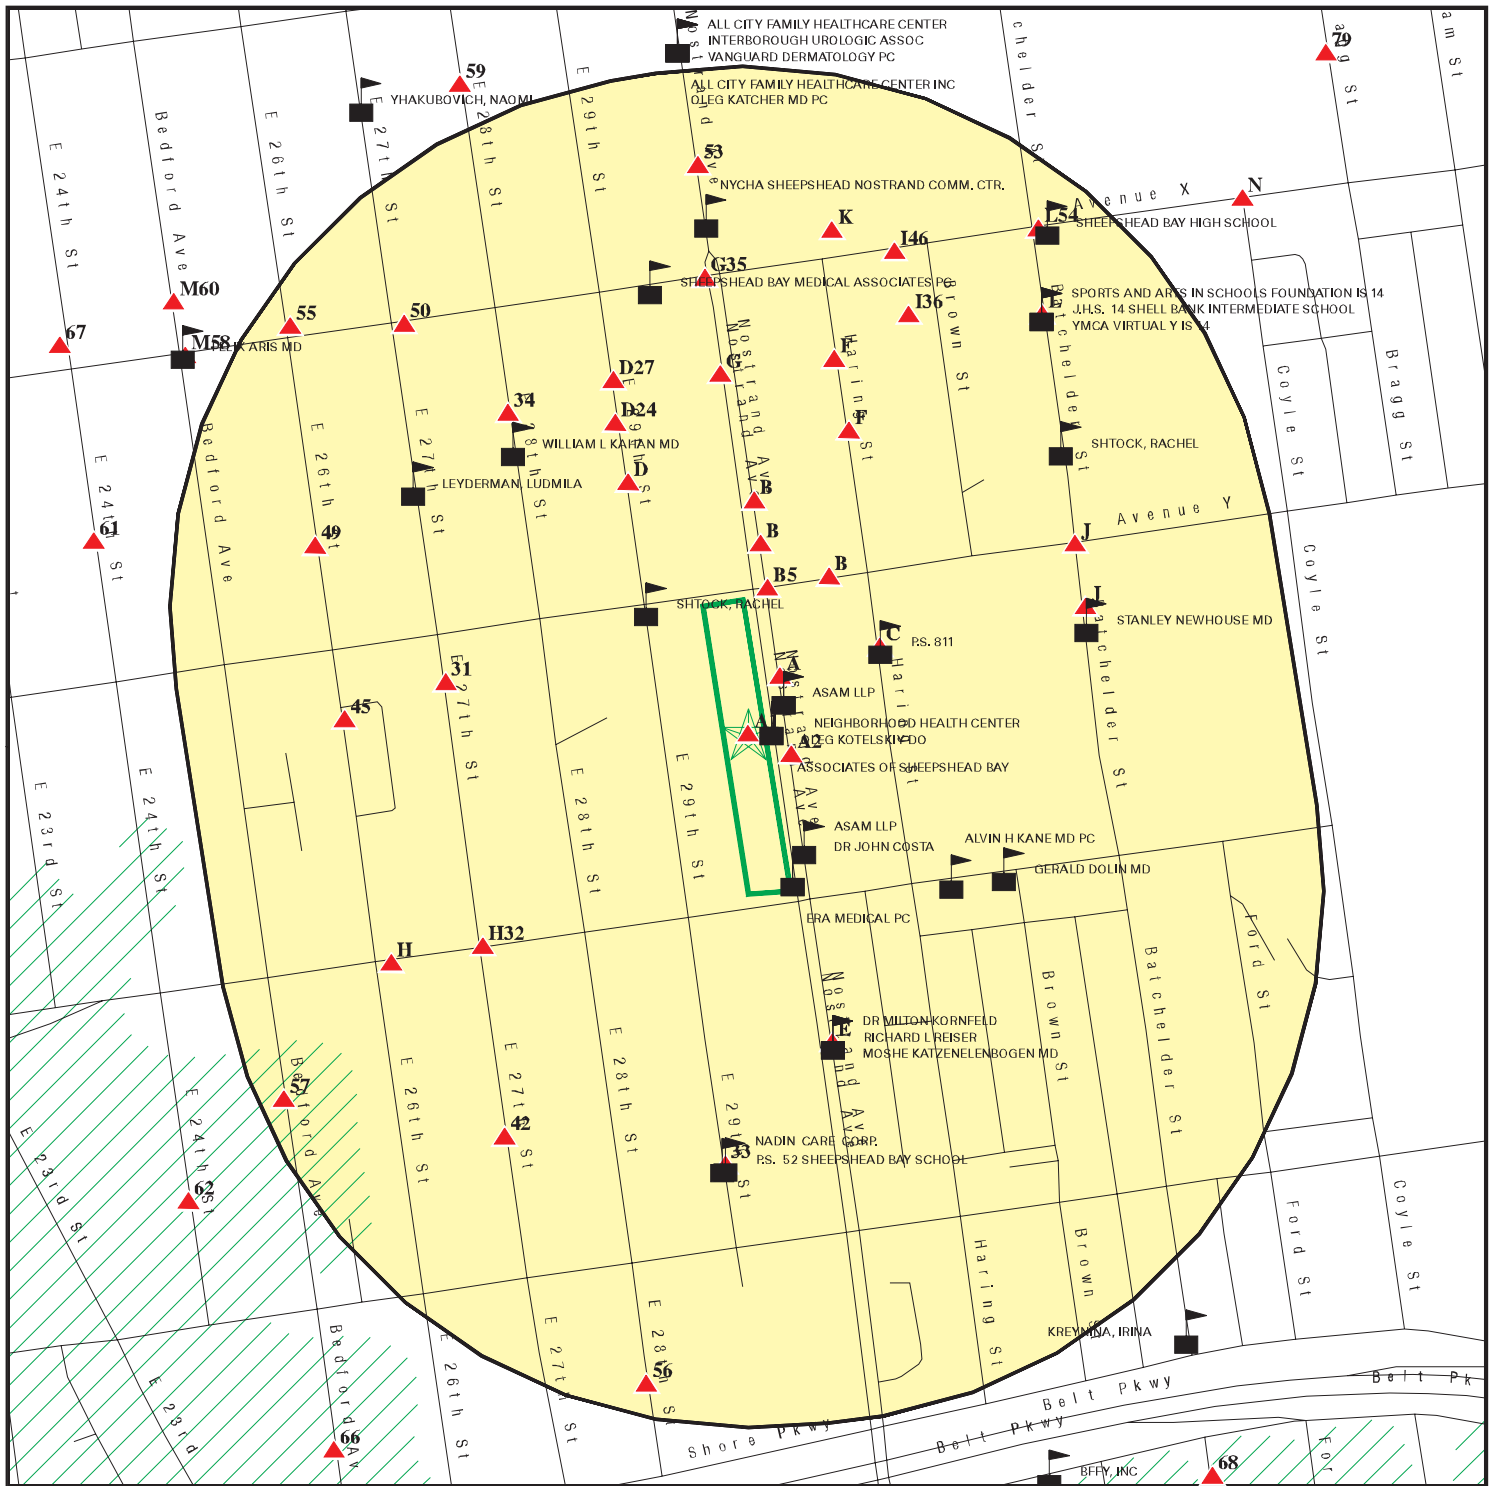

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

Indian Reservations BIA

Oil & Gas pipelines from USGS

100-year flood zone

500-year flood zone

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: 3780-3858 Nostrand Ave
ADDRESS: 3780-3858 Nostrand Ave
Brooklyn NY 11235
LAT/LONG: 40.5907 / 73.9403

CLIENT: LCS, Inc
CONTACT: Stephanie Laplaca
INQUIRY #: 3465818.2s
DATE: November 29, 2012 6:23 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<u>STANDARD ENVIRONMENTAL RECORDS</u>								
<i>Federal NPL site list</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	TP		NR	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
CERCLIS	0.500		0	0	0	NR	NR	0
FEDERAL FACILITY	1.000		0	0	0	0	NR	0
<i>Federal CERCLIS NFRAP site List</i>								
CERC-NFRAP	0.500		0	0	0	NR	NR	0
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS	1.000		0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF	1.000		0	0	0	0	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG	0.125		0	NR	NR	NR	NR	0
RCRA-SQG	0.125		0	NR	NR	NR	NR	0
RCRA-CESQG	0.125		1	NR	NR	NR	NR	1
<i>Federal institutional controls / engineering controls registries</i>								
US ENG CONTROLS	TP		NR	NR	NR	NR	NR	0
US INST CONTROL	TP		NR	NR	NR	NR	NR	0
LUCIS	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent CERCLIS</i>								
SHWS	1.000		0	0	0	0	NR	0
VAPOR REOPENED	1.000		0	0	0	0	NR	0
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF	0.500		0	0	0	NR	NR	0
<i>State and tribal leaking storage tank lists</i>								
LTANKS	0.500		3	8	19	NR	NR	30
HIST LTANKS	0.500		3	7	18	NR	NR	28
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
State and tribal registered storage tank lists								
TANKS	0.250		0	0	NR	NR	NR	0
UST	0.125		9	NR	NR	NR	NR	9
CBS UST	0.125		0	NR	NR	NR	NR	0
MOSF UST	0.125		0	NR	NR	NR	NR	0
AST	0.125		6	NR	NR	NR	NR	6
CBS AST	0.125		0	NR	NR	NR	NR	0
MOSF AST	0.125		0	NR	NR	NR	NR	0
MOSF	0.500		0	0	0	NR	NR	0
CBS	0.250		0	0	NR	NR	NR	0
INDIAN UST	0.125		0	NR	NR	NR	NR	0
FEMA UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
ENG CONTROLS	TP		NR	NR	NR	NR	NR	0
INST CONTROL	TP		NR	NR	NR	NR	NR	0
RES DECL	0.180		0	0	NR	NR	NR	0
State and tribal voluntary cleanup sites								
VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
ERP	0.500		0	0	0	NR	NR	0
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
ODI	TP		NR	NR	NR	NR	NR	0
SWTIRE	0.500		0	0	0	NR	NR	0
SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL	TP		NR	NR	NR	NR	NR	0
DEL SHWS	1.000		0	0	0	0	NR	0
US HIST CDL	TP		NR	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
HIST UST	0.125		9	NR	NR	NR	NR	9
HIST AST	0.125		3	NR	NR	NR	NR	3

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Land Records								
LIENS 2	TP		NR	NR	NR	NR	NR	0
LIENS	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0
NY Spills	0.500		7	13	90	NR	NR	110
NY Hist Spills	0.500		4	8	64	NR	NR	76
Other Ascertainable Records								
RCRA-NonGen	0.125	1	3	NR	NR	NR	NR	4
DOT OPS	TP		NR	NR	NR	NR	NR	0
DOD	TP		NR	NR	NR	NR	NR	0
FUDS	1.000		0	0	0	0	NR	0
CONSENT	1.000		0	0	0	0	NR	0
ROD	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
MINES	0.250		0	0	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
FINDS	TP	1	NR	NR	NR	NR	NR	1
RAATS	TP		NR	NR	NR	NR	NR	0
HSWDS	0.500		0	0	0	NR	NR	0
UIC	TP		NR	NR	NR	NR	NR	0
MANIFEST	0.250		3	5	NR	NR	NR	8
DRYCLEANERS	0.125		1	NR	NR	NR	NR	1
NPDES	TP		NR	NR	NR	NR	NR	0
AIRS	TP		NR	NR	NR	NR	NR	0
E DESIGNATION	TP		NR	NR	NR	NR	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
COAL ASH	0.500		0	0	0	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
FINANCIAL ASSURANCE	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
EDR PROPRIETARY RECORDS								
EDR Proprietary Records								
Manufactured Gas Plants	1.000		0	0	0	0	NR	0

MAP FINDINGS SUMMARY

<u>Database</u>	<u>Search Distance (Miles)</u>	<u>Target Property</u>	<u>< 1/8</u>	<u>1/8 - 1/4</u>	<u>1/4 - 1/2</u>	<u>1/2 - 1</u>	<u>> 1</u>	<u>Total Plotted</u>

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1
Target
Property
SUPREME PETROLEUM INC
3858 NOSTRAND AVE
BROOKLYN, NY 11235

RCRA-NonGen
FINDS
1000355738
NYD074333113

Site 1 of 4 in cluster A

Actual:
9 ft.

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: SUPREME PETROLEUM INC
Facility address: 3858 NOSTRAND AVE
BROOKLYN, NY 11235
EPA ID: NYD074333113
Mailing address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact: HOWARD ALGEO
Contact address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact country: US
Contact telephone: (215) 688-8200
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SUN OIL COMPANY OF PENNSYLVANIA
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: SUN OIL COMPANY OF PENNSYLVANIA
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUPREME PETROLEUM INC (Continued)

1000355738

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: SUPREME PETROLEUM INC
Classification: Not a generator, verified

Date form received by agency: 08/18/1980
Facility name: SUPREME PETROLEUM INC
Classification: Not a generator, verified

Violation Status: No violations found

FINDS:

Registry ID: 110004368345

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

A2
ESE
< 1/8
0.011 mi.
57 ft.

RITE AID #4876
3823 NOSTRAND AVE
BROOKLYN, NY 11235

RCRA-CESQG 1014926854
NYR000186429

Site 2 of 4 in cluster A

Relative:
Higher

RCRA-CESQG:

Date form received by agency: 11/04/2011
Facility name: RITE AID #4876
Facility address: 3823 NOSTRAND AVE
BROOKLYN, NY 11235
EPA ID: NYR000186429
Mailing address: HUNTER LANE
CAMP HILL, PA 17011
Contact: STEPHANIE A CAIATI
Contact address: HUNTER LANE
CAMP HILL, PA 17011
Contact country: US
Contact telephone: (717) 730-8225
Contact email: SSCAIATI@RITEAID.COM
EPA Region: 02

Actual:
9 ft.

Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RITE AID #4876 (Continued)

1014926854

from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: RITE AID CORP
Owner/operator address: HUNTER LANE
CAMP HILL, PA 17011
Owner/operator country: US
Owner/operator telephone: (717) 761-2633
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 07/24/1995
Owner/Op end date: Not reported

Owner/operator name: RITE AID CORP
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/24/1995
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RITE AID #4876 (Continued)

1014926854

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Waste code: D007
Waste name: CHROMIUM

Waste code: D009
Waste name: MERCURY

Waste code: D010
Waste name: SELENIUM

Waste code: D024
Waste name: M-CRESOL

Waste code: P001
Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

Waste code: P075
Waste name: NICOTINE, & SALTS

Violation Status: No violations found

A3
NNE
< 1/8
0.012 mi.
61 ft.

QUALITY CLEANERS
3801 NOSTRAND AVENUE
BROOKLYN, NY 11235

DRYCLEANERS **S110247710**
N/A

Site 3 of 4 in cluster A

Relative:
Higher

DRYCLEANERS:
Facility ID: 2-6107-00574
Phone Number: Not reported
Region: 2
Registration Effective Date: N/A
Inspection Date: 11/20/03
Install Date: Not reported
Drop Shop: Not reported
Shutdown: Y
Alternate Solvent: Not reported
Current Business: SUPERMARKET

Actual:
9 ft.

A4
NNE
< 1/8
0.012 mi.
61 ft.

YONGS CLEANERS INC DBA QUALITY CLEANERS
3801 NOSTRAND AVE
BROOKLYN, NY 11235

RCRA-NonGen **1000286891**
FINDS **NYD986888543**
MANIFEST

Site 4 of 4 in cluster A

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: YONGS CLEANERS INC DBA QUALITY CLEANERS
Facility address: 3801 NOSTRAND AVE

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

EPA ID: BROOKLYN, NY 11235
NYD986888543
Mailing address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact: Not reported
Contact address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: YONG RIM LEE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: YONG RIM LEE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: YONGS CLEANERS INC DBA QUALITY CLEANERS
Classification: Not a generator, verified

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Date form received by agency: 04/14/1995
Facility name: YONGS CLEANERS INC DBA QUALITY CLEANERS
Classification: Not a generator, verified

Date form received by agency: 01/22/1990
Facility name: YONGS CLEANERS INC DBA QUALITY CLEANERS
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004441569

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986888543
Country: USA
Mailing Name: QUALITY CLNRS
Mailing Contact: QUALITY CLNRS
Mailing Address: 3801 NASTRAND
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-646-9853

Document ID: NYC0365332
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900706
Trans1 Recv Date: 900706
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900706
Part A Recv Date: 900808
Part B Recv Date: 900724
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0408205
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900814
Trans1 Recv Date: 900814
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900814
Part A Recv Date: 900830
Part B Recv Date: 900905
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0465491
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900905
Trans1 Recv Date: 900905
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900905
Part A Recv Date: 900912
Part B Recv Date: 900911
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Year: 90

Document ID: NYC0615802
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NYAM6252
Trans2 State ID: Not reported
Generator Ship Date: 901126
Trans1 Recv Date: 901126
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901126
Part A Recv Date: 901227
Part B Recv Date: 901220
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0509668
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 901008
Trans1 Recv Date: 901008
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901008
Part A Recv Date: 901119
Part B Recv Date: 901012
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Document ID: NYC0659744
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 901228
Trans1 Recv Date: 901228
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901228
Part A Recv Date: 910109
Part B Recv Date: 910107
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0699298
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 910123
Trans1 Recv Date: 910123
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910123
Part A Recv Date: 910212
Part B Recv Date: 910131
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1025831
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 910612
Trans1 Recv Date: 910612
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910612
Part A Recv Date: 910626

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Part B Recv Date: 910620
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC0969298
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 910516
Trans1 Recv Date: 910516
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910516
Part A Recv Date: 910523
Part B Recv Date: 910523
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC0853806
Manifest Status: Completed copy
Trans1 State ID: NYEU1732
Trans2 State ID: Not reported
Generator Ship Date: 910318
Trans1 Recv Date: 910318
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910318
Part A Recv Date: 910329
Part B Recv Date: 910326
Generator EPA ID: NYD986888543

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC0905163
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 910417
Trans1 Recv Date: 910417
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910417
Part A Recv Date: 910430
Part B Recv Date: 910425
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1293164
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 911030
Trans1 Recv Date: 911030
Trans2 Recv Date: Not reported
TSD Site Recv Date: 911030
Part A Recv Date: Not reported
Part B Recv Date: 911108
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Specific Gravity: 100
Year: 91

Document ID: NYC0749125
Manifest Status: Completed copy
Trans1 State ID: LP3931NY
Trans2 State ID: Not reported
Generator Ship Date: 910222
Trans1 Recv Date: 910222
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910222
Part A Recv Date: 910305
Part B Recv Date: 910313
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1068917
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 910709
Trans1 Recv Date: 910709
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910709
Part A Recv Date: 910718
Part B Recv Date: 910717
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Document ID: NYC1350764
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 911122
Trans1 Recv Date: 911122
Trans2 Recv Date: Not reported
TSD Site Recv Date: 911122
Part A Recv Date: Not reported
Part B Recv Date: 911204
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1404459
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 911227
Trans1 Recv Date: 911227
Trans2 Recv Date: Not reported
TSD Site Recv Date: 911227
Part A Recv Date: 920109
Part B Recv Date: 920108
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00060
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1122759
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 910809
Trans1 Recv Date: 910809
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910809
Part A Recv Date: 910822

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Part B Recv Date: 910820
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1194726
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 910912
Trans1 Recv Date: 910912
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910912
Part A Recv Date: 910924
Part B Recv Date: 910920
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00130
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1249661
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 911004
Trans1 Recv Date: 911004
Trans2 Recv Date: Not reported
TSD Site Recv Date: 911004
Part A Recv Date: 911018
Part B Recv Date: 911017
Generator EPA ID: NYD986888543

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YONGS CLEANERS INC DBA QUALITY CLEANERS (Continued)

1000286891

Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1496114
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 920220
Trans1 Recv Date: 920220
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920220
Part A Recv Date: 920302
Part B Recv Date: 920228
Generator EPA ID: NYD986888543
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00070
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 92

[Click this hyperlink](#) while viewing on your computer to access
16 additional NY_MANIFEST: record(s) in the EDR Site Report.

B5
North
< 1/8
0.013 mi.
68 ft.

GETTY SERVICE STATION
AVE Y & NOSTRAND AVE
BROOKLYN, NY 11235

Site 1 of 9 in cluster B

RCRA-NonGen **1000872483**
FINDS **NYD987036969**
MANIFEST

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: GETTY SERVICE STATION
Facility address: AVE Y & NOSTRAND AVE
BROOKLYN, NY 11235
EPA ID: NYD987036969

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY SERVICE STATION (Continued)

1000872483

Mailing address: GREENPOINT AVE
LONG ISLAND CITY, NY 11101
Contact: Not reported
Contact address: GREENPOINT AVE
LONG ISLAND CITY, NY 11101
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: GETTY PETROLEUM
Owner/operator address: 30-23 GREENPOINT AVE
LONG ISLAND CITY, NY 11101
Owner/operator country: US
Owner/operator telephone: (718) 729-6500
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GETTY PETROLEUM
Owner/operator address: 30-23 GREENPOINT AVE
LONG ISLAND CITY, NY 11101
Owner/operator country: US
Owner/operator telephone: (718) 729-6500
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: GETTY SERVICE STATION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY SERVICE STATION (Continued)

1000872483

Facility name: GETTY SERVICE STATION
Classification: Not a generator, verified

Date form received by agency: 04/04/1994
Facility name: GETTY SERVICE STATION
Site name: GETTY PETROLEUM
Classification: Large Quantity Generator

Date form received by agency: 07/08/1993
Facility name: GETTY SERVICE STATION
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110008086686

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD987036969
Country: USA
Mailing Name: GETTY PETROLEUM
Mailing Contact: ELLEN PENNA
Mailing Address: 30-23 GREEN POINT AVE
Mailing Address 2: Not reported
Mailing City: LONG ISLAND CITY
Mailing State: NY
Mailing Zip: 11735
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-486-0905

Document ID: NJA1537029
Manifest Status: Completed copy
Trans1 State ID: NJDEPS500
Trans2 State ID: Not reported
Generator Ship Date: 930716
Trans1 Recv Date: 930716
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930716
Part A Recv Date: Not reported
Part B Recv Date: 930803
Generator EPA ID: NYD987036969
Trans1 EPA ID: NYD006801245
Trans2 EPA ID: Not reported
TSDF ID: NJD991291105
Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY SERVICE STATION (Continued)

1000872483

Quantity: 00440
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 008
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93

B6
North
< 1/8
0.025 mi.
134 ft.

S&J ECONOMIC SERVICE CTR INC
3768 NOSTRAND AVE
BROOKLYN, NY 11236
Site 2 of 9 in cluster B

UST **U001835091**
HIST UST **N/A**

Relative:
Higher

UST:
Facility Id: 2-269204
Region: STATE
DEC Region: 2
Site Status: Administratively Closed
Program Type: PBS
Expiration Date: N/A
UTM X: 589677.06211000006
UTM Y: 4494001.1764799999

Actual:
9 ft.

Affiliation Records:
Site Id: 11253
Affiliation Type: Owner
Company Name: SHEBA REALTY CO
Contact Type: Not reported
Contact Name: Not reported
Address1: 2253 E 66TH ST
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11234
Country Code: 001
Phone: (718) 968-9327
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 11253
Affiliation Type: Mail Contact
Company Name: 184 RIVERVIEW AVENUE
Contact Type: Not reported
Contact Name: Not reported
Address1: P.O BOX 9162
Address2: Not reported
City: WALTHAM
State: MA
Zip Code: 02254
Country Code: 001
Phone: (718) 968-9327
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 11253
Affiliation Type: On-Site Operator
Company Name: S&J ECONOMIC SERVICE CTR INC
Contact Type: Not reported
Contact Name: S&J ECONOMIC SERVICE CTR INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 646-9037
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 11253
Affiliation Type: Emergency Contact
Company Name: SHEBA REALTY CO
Contact Type: Not reported
Contact Name: JOHN CANONICO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 968-9327
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

H03 - Tank Leak Detection - Vapor Well
I00 - Overfill - None
H03 - Tank Leak Detection - Vapor Well
I00 - Overfill - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
D00 - Pipe Type - No Piping
D00 - Pipe Type - No Piping
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
D00 - Pipe Type - No Piping
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
H03 - Tank Leak Detection - Vapor Well
I00 - Overfill - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
G03 - Tank Secondary Containment - Vault (w/o access)
D00 - Pipe Type - No Piping
H03 - Tank Leak Detection - Vapor Well
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Info:

Site ID: 11253

Tank Number: 001
Tank ID: 13587
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 456078

Tank Number: 001
Tank ID: 241072
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 7000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 06/01/1991
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 09/30/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Site ID: 456078

Tank Number: 002
Tank ID: 241073
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 7000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 06/01/1991
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 09/30/2011

Site ID: 11253

Tank Number: 002
Tank ID: 13588
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 11253

Tank Number: 003
Tank ID: 13589
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Site ID: 11253

Tank Number: 004
Tank ID: 13590
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Affiliation Records:

Site Id: 456078
Affiliation Type: Owner
Company Name: ALLURE HOLDINGS LLC
Contact Type: Not reported
Contact Name: Not reported
Address1: 1113 AVENUE J
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11230
Country Code: 001
Phone: (718) 253-6100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 9/30/2011

Site Id: 456078
Affiliation Type: Mail Contact
Company Name: ALLURE HOLDINGS LLC
Contact Type: Not reported
Contact Name: JOSEPH ASHKENAZI
Address1: 1113 AVENUE J
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11230
Country Code: 001
Phone: (718) 253-6100
Phone Ext: Not reported
Email: JOSEPH@ASHMANAGEMENT.COM
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 9/30/2011

Site Id: 456078

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Affiliation Type: On-Site Operator
Company Name: 7-ELEVEN
Contact Type: Not reported
Contact Name: N/A - TANKS CLOSED
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: N/A
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 9/30/2011

Site Id: 456078
Affiliation Type: Emergency Contact
Company Name: ALLURE HOLDINGS LLC
Contact Type: Not reported
Contact Name: JOSEPH ASHKENAZI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 253-6100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 9/30/2011

Tank Info:

Site ID: 11253

Tank Number: 001
Tank ID: 13587
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 456078

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Tank Number: 001
Tank ID: 241072
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 7000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 06/01/1991
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 09/30/2011

Site ID: 456078

Tank Number: 002
Tank ID: 241073
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 7000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 06/01/1991
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 09/30/2011

Site ID: 11253

Tank Number: 002
Tank ID: 13588
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 11253

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Tank Number: 003
Tank ID: 13589
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 11253

Tank Number: 004
Tank ID: 13590
Tank Status: Administratively Closed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 04/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 10/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST UST:

PBS Number: 2-269204
SPDES Number: Not reported
Emergency Contact: JOHN CANONICO
Emergency Telephone: (718) 968-9327
Operator: S&J ECONOMIC SERVICE CTR INC
Operator Telephone: (718) 646-9037
Owner Name: SHEBA REALTY CO
Owner Address: 2253 E 66TH ST
Owner City,St,Zip: BKLYN, NY 11234
Owner Telephone: (718) 968-9327
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: 184 RIVERVIEW AVENUE
Mailing Address: P.O BOX 9162
Mailing Address 2: Not reported
Mailing City,St,Zip: WALTHAM, MA 02254
Mailing Contact: Not reported
Mailing Telephone: (718) 968-9327
Owner Mark: First Owner
Facility Status: 3 - Administratively closed (reasons include business is closed and/or

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

mail is undeliverable, and staff cannot check if tanks were removed;
or a duplicate registration was generated).

Facility Addr2: 3768 NOSTRAND AVE
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: Not reported
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/10/1987
Expiration Date: 07/10/1992
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 0
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: True
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Undefined
Install Date: 19840401
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: Vapor Well
Overfill Prot: Not reported
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: 04/01/1994
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Undefined

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Install Date: 19840401
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: Vapor Well
Overfill Prot: Not reported
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: 04/01/1994
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Undefined
Install Date: 19840401
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: Vapor Well
Overfill Prot: Not reported
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: 04/01/1994
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Undefined
Install Date: 19840401
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S&J ECONOMIC SERVICE CTR INC (Continued)

U001835091

Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: Vapor Well
Overfill Prot: Not reported
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: 04/01/1994
Missing Data for Tank: Minor Data Missing
Date Closed: 10/01/1996
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

B7
North
< 1/8
0.025 mi.
134 ft.

FORMER GAS STATION
3768 NOSTRAND AVE
BROOKLYN, NY

NY Spills S111238444
N/A

Site 3 of 9 in cluster B

Relative:
Higher

SPILLS:

Actual:
9 ft.

Facility ID: 1107094
DER Facility ID: 409379
Facility Type: ER
Site ID: 454781
DEC Region: 2
Spill Number: 1107094
Spill Date: 9/7/2011
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: RVKETANI
Referred To: Not reported
Reported to Dept: 9/7/2011
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 9/7/2011
Spill Record Last Update: 7/30/2012
Spiller Name: GREG ERNST
Spiller Company: ASH MANAGEMENT
Spiller Address: 3768 NOSTRAND AVE
Spiller City,St,Zip: BROOKLYN, NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GAS STATION (Continued)

S111238444

Spiller Company: 999
Contact Name: GREG ERNST
Contact Phone: (631) 234-4280
DEC Memo: 9/7/11 - Raphael Ketani. The spill consists of the discovery of gasoline contamination in the soil while doing a phase II investigation. The site is a former gas station. The reporting party is Gregory Ernst of Associated Environmental Services (631) 234-4280. I spoke to Mr. Ernst. The Phase II was being performed for refinancing purposes. The owner is going to develop the property. The site stopped functioning as a gas station in the nineteen eighties. There are abandoned gas tanks under the site. The tanks were opened and were filled with sand. Borings were done upgradient and downgradient. Groundwater is 12' below the site. A groundwater sample was taken from a downgradient location. AES received the data today. Gasoline contamination was found at the pump island. Downgradient samples that were taken for the garage and pump island show contamination. The source is believed to be the pump island. The samples that were taken upgradient and downgradient from the tanks were non-detect. AES will recommend that the soil be excavated at the pump island and that ORC be injected. AES is putting together the Phase II report. The owner wants to move forward quickly. The owner is Joseph Ashkenazi at Ash Management Realty, 1113 Avenue J, Brooklyn, 11230. I told Mr. Ernst to send the Phase II as an attachment to an e-mail. 10/20/11 - Raphael Ketani. I tried to contact Mr. Ernst (631) 234-4280 (Gregory) regarding receipt of the Phase II, but I could only leave a message. 10/25/11 - Raphael Ketani. I spoke to Mr. Ernst. AES still hasn't been paid for the work that was performed. So, even though the phase II is written and ready, it will not be sent to the DEC. Ash Management's phone number is (718) 253-6100 and the contact is Joseph Ashkenazie. I will send a CSL. 10/26/11 - Raphael Ketani. The CSL was sent to Mr. Ashkenazi at Ash Management Realty. 11/22/11 - Raphael Ketani. Mr. Ashkenazi called. He said that AES is still working on the Phase II. However, he would like a little more time to submit the report given that the holidays are upon us. I gave Mr. Ashkenazi two weeks or until December 9 to submit the report to the DEC. He said that would be fine. 12/9/11 - Raphael Ketani. I received the AES 9/12/11 SIR yesterday and finished my review today. The investigative work was performed on 8/23/11 for the owner, Allure Holdings, LLC. During 1991, the two 7,000 gallon gasoline USTs were abandoned in place by being filled with sand. AES will have the tanks registered. The groundwater is at about 12 feet below grade. A number of VOC exceedences were found in the SB-1 soil samples (former pump island location) from the intervals 3 to 4 feet and 10 to 11 feet. The individual analyte concentrations varied up to 44,170 ppb of total xylenes for both intervals. The 10 to 11 foot sample had five analytes with concentrations in the 5 digit range. The groundwater sample from GW-3 (directly downgradient from the former pump island location) had VOC hits up to 99.8 ppb of naphthalene. There were no SVOC hits, except naphthalene. The groundwater sample from GW-4 (down and sidegradient to the former pump island location - but directly downgradient from the former garage location) had VOC hits to 62.2 ppb of 1,2,4-trimethylbenzene with a naphthalene SVOC hit. Some of the VOC hits for GW-4 were higher than those for GW-3 for specific analytes. This suggests that there may be another source - possibly contaminated soil under the convenience store. AES wants to dig out the soil at SB-1, take end point samples, throw in a soil treatment

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GAS STATION (Continued)

S111238444

chemical and then backfill. Then they want to let natural attenuation finish the remediation. I drafted a letter for Hassan Hussein, head of the Hazardous Materials Unit, to review. The letter approved the SIR, but had three comments. I wrote that the Department felt that the chemical treatment shouldn't be done right away and that we would need to see the end point sample results and then comment on the data and whether further remediation is necessary. Also, I wrote that the VOC results for GW-4 suggest that there is a source of contamination below the former garage (convenience store) and that this should be investigated. Also, the former remote fill port and associated fill piping locations were not investigated and so more soil borings should be done there. Lastly, I commented that natural attenuation was not appropriate for this site as a final remediation method and that the Department will comment on the data when AES submits the results. 12/15/11 - Raphael Ketani. The letter was approved by Mr. Hussein and sent out. 7/30/12 - Raphael Ketani. Mr. Ernst (631) 234-4280 called. He said that his client has money now and so the project is moving forward. He wanted to send the DEC a work plan for the work that was requested in DEC's last letter. I told him that would be fine. I asked Mr. Ernst whether he can get ahold of a rig that can drill at an angle and get under the convenience store. He said that he can and that he had intended to do angled borings. Mr. Ernst added that the owner wants to keep the convenience store open. So the digging in front of the store will have to happen quickly. I told him that if more contamination is found and it requires more excavation, then maybe shoring can be used to disturb only a little area at a time in front of the store - to excavate in segments. That way, the store is affected as little as possible. Mr. Ernst agreed that he would probably do the excavation using shoring. I told him to get me the work plan quickly and I will take a look at it quickly and get back to him. He said that he will.

Remarks:

former gas station - phase 2 results - clean up - pending

Material:

Site ID: 454781
Operable Unit ID: 1204934
Operable Unit: 01
Material ID: 2201736
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GAS STATION (Continued)

S111238444

Last Modified: Not reported
Test Method: Not reported

B8
North
< 1/8
0.028 mi.
147 ft.

3767 NOSTRAND AVE.
3767 NOSTRAND AVE
BROOKLYN, NY
Site 4 of 9 in cluster B

LTANKS
HIST LTANKS

S100493880
N/A

Relative:
Higher

LTANKS:

Actual:
9 ft.

Site ID: 73826
Spill No: 9206690
Spill Date: 9/9/1992
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 9/24/1992
Facility Addr2: Not reported
Cleanup Ceased: 9/24/1992
Cleanup Meets Standard: True
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 9/9/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 9/14/1992
Spill Record Last Update: 9/29/1992
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 69451
DEC Memo: Not reported
Remarks: 4 TANKS @ 550 GALLONS MANIFOLDED(UNDERGROUND)- UNCOVER, ISOLATE
RETESTSTICK LINE MAY BE RETEST TOMORROW

Material:

Site ID: 73826
Operable Unit ID: 970481
Operable Unit: 01
Material ID: 407387
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3767 NOSTRAND AVE. (Continued)

S100493880

Material FA: Petroleum
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 73826
Spill Tank Test: 1540537
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 9206690
Spill Date: 09/09/1992
Spill Time: 16:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 09/24/92
Cleanup Ceased: 09/24/92
Cleanup Meets Standard: True
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 09/09/92
Reported to Department Time: 09:39
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3767 NOSTRAND AVE. (Continued)

S100493880

Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/14/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 09/29/92
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: UNLEADED.
Spill Cause: 4 TANKS @ 550 GALLONS MANIFOLDED UNDERGROUND)- UNCOVER, ISOLATE RETESTSTICK LINE MAY BE RETEST TOMORROW

B9
North
< 1/8
0.028 mi.
147 ft.

GETTY 00238
3767 NOSTRAND AVE
BROOKLYN, NY 11235
Site 5 of 9 in cluster B

UST **U001839016**
HIST UST **N/A**

Relative:
Higher

Actual:
9 ft.

UST:
Facility Id: 2-145696
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 589677.06211000006
UTM Y: 4494001.1764799999

Affiliation Records:
Site Id: 4185
Affiliation Type: Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Company Name:	POWER TEST PETRO DIST INC
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	125 JERICHO TURNPIKE
Address2:	Not reported
City:	JERICHO
State:	NY
Zip Code:	11753
Country Code:	001
Phone:	(516) 576-9500
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	12/14/2004
Site Id:	4185
Affiliation Type:	Mail Contact
Company Name:	GETTY PETROLEUM CORP/E.F. WALDRON
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	3023 GREEN POINT AVE.
Address2:	Not reported
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 729-6500
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	4185
Affiliation Type:	On-Site Operator
Company Name:	GETTY 00238
Contact Type:	Not reported
Contact Name:	ADRIAN CORP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 648-6026
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	3/4/2004
Site Id:	4185
Affiliation Type:	Emergency Contact
Company Name:	POWER TEST PETRO DIST INC
Contact Type:	Not reported
Contact Name:	EDWARD WALDRON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 729-6500
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
G03 - Tank Secondary Containment - Vault (w/o access)
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None

Tank Info:

Site ID: 4185

Tank Number: 001
Tank ID: 28170
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 07/01/1975
Capacity Gallons: 4000
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 11/01/1985
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Site ID: 4185

Tank Number: 002
Tank ID: 28171
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 4185

Tank Number: 003
Tank ID: 28172
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 4185

Tank Number: 004
Tank ID: 28173
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Site ID: 4185

Tank Number: 005
Tank ID: 28174
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 4185

Tank Number: 006
Tank ID: 28175
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 4185

Tank Number: 007
Tank ID: 28176
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Site ID: 4185

Tank Number: 008
Tank ID: 28177
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 4185

Tank Number: 009
Tank ID: 28178
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/01/1960
Capacity Gallons: 550
Tightness Test Method: ZZ
Next Test Date: Not reported
Date Tank Closed: 06/01/1993
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 08/01/1991
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST UST:

PBS Number: 2-145696
SPDES Number: Not reported
Emergency Contact: EDWARD WALDRON
Emergency Telephone: (718) 729-6500
Operator: ADRIAN CORP
Operator Telephone: (718) 648-6026
Owner Name: POWER TEST PETRO DIST INC
Owner Address: 125 JERICO TURNPIKE
Owner City,St,Zip: JERICO, NY 11753
Owner Telephone: (516) 576-9500
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: GETTY PETROLEUM CORP/E.F. WALDRON
Mailing Address: 3023 GREEN POINT AVE.
Mailing Address 2: Not reported
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Contact: Not reported
Mailing Telephone: (718) 729-6500

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Owner Mark: First Owner
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)
and Subpart 360-14.
Facility Addr2: 3767 NOSTRAND AVE
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: Not reported
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 10/09/1992
Expiration Date: 10/29/1997
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 0
FAMT: True
Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19750701
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 11/01/1985
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 007
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 008
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY 00238 (Continued)

U001839016

Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 009
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19600601
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 06/01/1993
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

B10
NNE
< 1/8
0.042 mi.
222 ft.

2939 AVE Y TENANTS CORP
2939 AVE Y
BROOKLYN, NY 11235

Site 6 of 9 in cluster B

UST
HIST UST

U001835950
N/A

Relative:
Higher

Actual:
9 ft.

UST:
Facility Id: 2-196819
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2012/10/02
UTM X: 589743.069550000001
UTM Y: 4493976.79801

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y TENANTS CORP (Continued)

U001835950

Affiliation Records:

Site Id: 6437
Affiliation Type: Owner
Company Name: 2939 AVE Y TENANTS CORP
Contact Type: AGENT
Contact Name: EDWARD SECKER
Address1: 112-41 QUEENS BLVD STE 201
Address2: Not reported
City: FOREST HILLS
State: NY
Zip Code: 11375
Country Code: 001
Phone: (718) 544-5900
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 3/30/2009

Site Id: 6437
Affiliation Type: Mail Contact
Company Name: 2939 AVE Y TENANTS CORP
Contact Type: AGENT
Contact Name: EDWARD SECKER
Address1: 112-41 QUEENS BLVD STE 201
Address2: Not reported
City: FOREST HILLS
State: NY
Zip Code: 11375
Country Code: 001
Phone: (718) 544-5900
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 3/30/2009

Site Id: 6437
Affiliation Type: On-Site Operator
Company Name: 2939 AVE Y TENANTS CORP
Contact Type: Not reported
Contact Name: ALEX KRASNOV -SUPER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 891-7675
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 6437
Affiliation Type: Emergency Contact

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y TENANTS CORP (Continued)

U001835950

Company Name: 2939 AVE Y TENANTS CORP
Contact Type: Not reported
Contact Name: EDWARD SECKER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (516) 466-8608
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

G07 - Tank Secondary Containment - Excavation/Trench Liner System
H04 - Tank Leak Detection - Groundwater Well
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None

Tank Info:

Site ID: 6437

Tank Number: 001
Tank ID: 16830
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 01/12/1961
Capacity Gallons: 4000
Tightness Test Method: 21
Next Test Date: 01/30/2014
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 01/30/2009
Register: True
Modified By: bkfalvey
Last Modified: 05/05/2009

HIST UST:

PBS Number: 2-196819
SPDES Number: Not reported
Emergency Contact: MAX SPILBERG
Emergency Telephone: (718) 376-0070
Operator: IZZIE GOFMAN SUPR
Operator Telephone: (718) 376-0070
Owner Name: 2939 AVE Y TENANTS CORP
Owner Address: 287 AVE X

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y TENANTS CORP (Continued)

U001835950

Owner City,St,Zip: BKLYN, NY 11223
Owner Telephone: (718) 376-0070
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: 2939 AVE Y TENANTS CORP
Mailing Address: 287 AVE X
Mailing Address 2: Not reported
Mailing City,St,Zip: BKLYN, NY 11223
Mailing Contact: Not reported
Mailing Telephone: (718) 376-0070
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: 2939 AVE Y
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 11/18/1997
Expiration Date: 10/02/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Vault (w/o access)
Leak Detection: Groundwater Well
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 07/01/1996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y TENANTS CORP (Continued)

U001835950

Next Test Date: 07/01/2001
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

B11 2939 AVE Y/AVE Y TENANTS
NNE 2939 AVE Y
< 1/8 NEW YORK CITY, NY
0.042 mi.
222 ft. Site 7 of 9 in cluster B

LTANKS S100145179
HIST LTANKS N/A
NY Spills

Relative:
Higher

LTANKS:

Actual:
9 ft.

Site ID: 243592
Spill No: 8803744
Spill Date: 7/29/1988
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/7/1994
Facility Addr2: Not reported
Cleanup Ceased: 2/7/1994
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 7/29/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/2/1988
Spill Record Last Update: 12/4/2009
Spiller Name: Not reported
Spiller Company: BEN JOSH MGNT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 200104
DEC Memo: Not reported
Remarks: 4K TANK FAILED INITIAL SYSTEM- PETRO TITE TEST WITH A LEAK RATE OF
-.575GPH, WILL EXCAVATE, ISOLATE AND RETEST.

Material:

Site ID: 243592
Operable Unit ID: 918894
Operable Unit: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

Material ID: 459278
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 243592
Spill Tank Test: 1534372
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 243592
Spill No: 8803744
Spill Date: 7/29/1988
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/7/1994
Facility Addr2: Not reported
Cleanup Ceased: 2/7/1994
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 7/29/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/2/1988
Spill Record Last Update: 12/4/2009
Spiller Name: Not reported
Spiller Company: BEN JOSH MGNT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

DER Facility ID: 200104
DEC Memo: Not reported
Remarks: 4K TANK FAILED INITIAL SYSTEM- PETRO TITE TEST WITH A LEAK RATE OF
-.575GPH, WILL EXCAVATE, ISOLATE AND RETEST.

Material:

Site ID: 243592
Operable Unit ID: 918894
Operable Unit: 01
Material ID: 459278
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 243592
Spill Tank Test: 1534372
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 243592
Spill No: 8803744
Spill Date: 7/29/1988
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/7/1994
Facility Addr2: Not reported
Cleanup Ceased: 2/7/1994
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 7/29/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/2/1988

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

Spill Record Last Update: 12/4/2009
Spiller Name: Not reported
Spiller Company: BEN JOSH MGNT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 200104
DEC Memo: Not reported
Remarks: 4K TANK FAILED INITIAL SYSTEM- PETRO TITE TEST WITH A LEAK RATE OF
-.575GPH, WILL EXCAVATE, ISOLATE AND RETEST.

Material:

Site ID: 243592
Operable Unit ID: 918894
Operable Unit: 01
Material ID: 459278
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 243592
Spill Tank Test: 1534372
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 8803744
Spill Date: 07/29/1988
Spill Time: 13:45
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/07/94
Cleanup Ceased: 02/07/94

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

Cleanup Meets Standard: False
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 07/29/88
Reported to Department Time: 14:43
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: BEN JOSH MGNT
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 373-1011
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-196819
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/02/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/07/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

DEC Remarks: 02/07/94: RETESTED AND PASSED 10/16/89.
Spill Cause: 4K TANK FAILED INITIAL SYSTEM- PETRO TITE TEST WITH A LEAK RATE OF -.575GPH,
WILL EXCAVATE, ISOLATE AND RETEST.

SPILLS:

Facility ID: 0910494
DER Facility ID: 372155
Facility Type: ER
Site ID: 423255
DEC Region: 2
Spill Number: 0910494
Spill Date: 12/24/2009
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 12/24/2009
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 12/24/2009
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/24/2009
Spill Record Last Update: 12/24/2009
Spiller Name: MIKE SAVINO
Spiller Company: MULTI FAMILY RESIDENCE
Spiller Address: 2939 AVENUE Y
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: MIKE SAVINO
Contact Phone: (646) 996-6108
DEC Memo: 12/24/09-Hiralkumar Patel.2:02 PM:- spoke with Mike. site has one
4,000 gal UST. driver checked gauge before delivery and was showing
only 830 gal oil in tank. driver delivered 2,500 gal oil and oil came
out at vent. about 10-15 gal oil spilled on sidewalk. no soil
impact.PBS #: 2-196819.2:08 PM:- left message at management
office.2939 Avenue Y Tenants Corp.112-41 Queens Blvd. Suite 201Forest
Hills, NY 11375Attn.: Edward SeckerPH. (516) 466-86082:18 PM:- spoke
with Alex (718-213-1050), building super. Alex mentioned that tank is
underground in garage. spill happened from vent pipe onto concrete
surface only. no soil/sewer impacted. all cleaned up. no odor
complaints. will contact their boiler company to check gauge.
Remarks: Caller reporting a spill of 15 gallons of #2 fuel oil to concrete.
Caller states the name of the superintendent is Alex.

Material:

Site ID: 423255
Operable Unit ID: 1179067
Operable Unit: 01
Material ID: 2172634

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2939 AVE Y/AVE Y TENANTS (Continued)

S100145179

Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

B12 **AL & SELWYN SERVICE STATION**
North **3755 NOSTRAND AVENUE**
< 1/8 **BROOKLYN, NY 11235**
0.047 mi.
249 ft. **Site 8 of 9 in cluster B**

UST **U001839527**
HIST UST **N/A**
AST
NY Spills

Relative:
Higher

UST:

Actual:
9 ft.

Facility Id: 2-346055
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2013/07/28
UTM X: 589672.49115000002
UTM Y: 4494033.91995

Affiliation Records:

Site Id: 16905
Affiliation Type: Owner
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: Not reported
Address1: 3755 NOSTRAND AVE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Site Id: 16905
Affiliation Type: Mail Contact
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI
Address1: 3755 NOSTRAND AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Site Id: 16905
Affiliation Type: On-Site Operator
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Site Id: 16905
Affiliation Type: Emergency Contact
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
A00 - Tank Internal Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
F05 - Pipe External Protection - Jacketed
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B04 - Tank External Protection - Fiberglass
D08 - Pipe Type - Equivalent Technology
H05 - Tank Leak Detection - In-Tank System (ATG)
I00 - Overfill - None
I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J01 - Dispenser - Submersible
F05 - Pipe External Protection - Jacketed
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
I01 - Overfill - Float Vent Valve
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B05 - Tank External Protection - Jacketed
E04 - Piping Secondary Containment - Double-Walled (Underground)
B05 - Tank External Protection - Jacketed
E04 - Piping Secondary Containment - Double-Walled (Underground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B04 - Tank External Protection - Fiberglass
D08 - Pipe Type - Equivalent Technology
H05 - Tank Leak Detection - In-Tank System (ATG)
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
K01 - Spill Prevention - Catch Basin
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Info:

Site ID: 16905

Tank Number: 001

Tank ID: 32855

Tank Status: Closed - Removed

Tank Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 002
Tank ID: 32856
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 003
Tank ID: 32857
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 004
Tank ID: 32858
Tank Status: Closed - Removed
Tank Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1996
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 006
Tank ID: 32848
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 007
Tank ID: 32849
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 008
Tank ID: 32850
Tank Status: Closed - Removed
Tank Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 009
Tank ID: 32851
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 010
Tank ID: 32852
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 011
Tank ID: 32853
Tank Status: Closed - Removed
Tank Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 012
Tank ID: 32854
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1959
Capacity Gallons: 550
Tightness Test Method: 03
Next Test Date: Not reported
Date Tank Closed: 08/01/1998
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 06/01/1994
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 16905

Tank Number: 013
Tank ID: 93599
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 11/01/1998
Capacity Gallons: 6000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Fiberglass coated steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 06/28/2012

Site ID: 16905

Tank Number: 013-A
Tank ID: 93600
Tank Status: Closed - Removed
Tank Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model:	Not reported
Install Date:	10/01/1959
Capacity Gallons:	550
Tightness Test Method:	03
Next Test Date:	Not reported
Date Tank Closed:	08/01/1998
Tank Location:	5
Tank Type:	Steel/carbon steel
Date Test:	06/01/1994
Register:	True
Modified By:	TRANSLAT
Last Modified:	03/04/2004
Site ID:	16905
Tank Number:	015
Tank ID:	54984
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	08/01/1998
Capacity Gallons:	6000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	11/01/1998
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True
Modified By:	msbaptis
Last Modified:	04/15/2008
Site ID:	16905
Tank Number:	016
Tank ID:	54985
Tank Status:	Closed - Removed
Tank Model:	Not reported
Pipe Model:	Not reported
Install Date:	08/01/1998
Capacity Gallons:	6000
Tightness Test Method:	NN
Next Test Date:	Not reported
Date Tank Closed:	11/01/1998
Tank Location:	5
Tank Type:	Fiberglass coated steel
Date Test:	Not reported
Register:	True
Modified By:	msbaptis
Last Modified:	04/15/2008
Site ID:	16905
Tank Number:	017
Tank ID:	55882
Tank Status:	In Service
Tank Model:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Model: Not reported
Install Date: 11/01/1998
Capacity Gallons: 6000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Fiberglass coated steel
Date Test: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 06/28/2012

HIST UST:

PBS Number: 2-346055
SPDES Number: Not reported
Emergency Contact: PAUL MEMI
Emergency Telephone: (718) 769-6280
Operator: PAUL MEMI
Operator Telephone: (718) 646-9262
Owner Name: AL & SELWYN SERV STA
Owner Address: 3755 NOSTRAND AVE
Owner City,St,Zip: BROOKLYN, NY 11235
Owner Telephone: (718) 769-6280
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: AL & SELWYN SERV STA
Mailing Address: 3755 NOSTRAND AVE
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11235
Mailing Contact: PAUL MEMI
Mailing Telephone: (718) 769-6280
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 3755 NOSTRAND AVE
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: RETAIL GASOLINE SALES
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 01/20/1999
Expiration Date: 07/28/2003
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 24275
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1996
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: Closed-Removed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 007
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 008
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 009
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 010
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 011
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 012
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 013
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19591001
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 06/01/1994
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1998
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 013
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19981101
Capacity (gals): 6000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass coated steel
Tank Internal: None
Tank External: Jacketed
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Other
Pipe External: Other
Second Containment: Vault (w/access)
Leak Detection: Electronic

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Overfill Prot: High Level Alarm
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 014
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19591001
Capacity (gals): 275
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 015
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19980801
Capacity (gals): 6000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass coated steel
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Rubber Liner
Pipe External: Jacketed
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: Catch Basin, High Level Alarm
Dispenser: Submersible
Date Tested: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 016
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19980801
Capacity (gals): 6000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass coated steel
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Rubber Liner
Pipe External: Jacketed
Second Containment: Vault (w/access)
Leak Detection: 14
Overfill Prot: Catch Basin, High Level Alarm
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 017
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19981101
Capacity (gals): 6000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass coated steel
Tank Internal: None
Tank External: Jacketed
Pipe Location: Underground
Pipe Type: FIBERGLASS REINFORCED PLASTIC
Pipe Internal: Other
Pipe External: Other
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: High Level Alarm
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-346055
Program Type: PBS
UTM X: 589672.49115000002
UTM Y: 4494033.91995
Expiration Date: 2013/07/28

Affiliation Records:

Site Id: 16905
Affiliation Type: Owner
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: Not reported
Address1: 3755 NOSTRAND AVE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Site Id: 16905
Affiliation Type: Mail Contact
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI
Address1: 3755 NOSTRAND AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Site Id: 16905
Affiliation Type: On-Site Operator
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Site Id: 16905
Affiliation Type: Emergency Contact
Company Name: AL & SELWYN SERVICE STATION
Contact Type: Not reported
Contact Name: PAUL MEMI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 646-9262
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/28/2012

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
F05 - Pipe External Protection - Jacketed
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B04 - Tank External Protection - Fiberglass
D08 - Pipe Type - Equivalent Technology
H05 - Tank Leak Detection - In-Tank System (ATG)
I00 - Overfill - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

I00 - Overfill - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
J01 - Dispenser - Submersible
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J01 - Dispenser - Submersible
F05 - Pipe External Protection - Jacketed
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
I01 - Overfill - Float Vent Valve
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

B00 - Tank External Protection - None
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
C02 - Pipe Location - Underground/On-ground
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I02 - Overfill - High Level Alarm
D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
J00 - Dispenser - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
B05 - Tank External Protection - Jacketed
E04 - Piping Secondary Containment - Double-Walled (Underground)
B05 - Tank External Protection - Jacketed
E04 - Piping Secondary Containment - Double-Walled (Underground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B04 - Tank External Protection - Fiberglass
D08 - Pipe Type - Equivalent Technology
H05 - Tank Leak Detection - In-Tank System (ATG)
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
J02 - Dispenser - Suction
B00 - Tank External Protection - None
I00 - Overfill - None
I00 - Overfill - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
I00 - Overfill - None
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
K01 - Spill Prevention - Catch Basin
F04 - Pipe External Protection - Fiberglass
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
K01 - Spill Prevention - Catch Basin
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Info:

Tank Number: 014
Tank Id: 52894
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 11/01/1998
Capacity Gallons: 150
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 06/28/2012

SPILLS:

Facility ID: 9511527
DER Facility ID: 78379
Facility Type: ER
Site ID: 85302
DEC Region: 2
Spill Number: 9511527
Spill Date: 12/12/1995
Spill Cause: Housekeeping
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AL & SELWYN SERVICE STATION (Continued)

U001839527

Willing Responsible Party. Corrective action taken.
Spill Closed Date: 2/28/2003
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 12/12/1995
CID: 266
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/12/1995
Spill Record Last Update: 2/28/2003
Spiller Name: Not reported
Spiller Company: TEXACO STATION
Spiller Address: 3755 NOSTRAND AVENUE
Spiller City,St,Zip: BROOKLYN, NY -
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: CONTAMINATED SOIL FOUND UNDER FUEL ISLAND DURING CANOPY INSTALLATION.
APPROXIMATELY 3 YARDS OF SOIL. SOIL TO BE STOCKPILED AND REMOVED.

Material:

Site ID: 85302
Operable Unit ID: 1025740
Operable Unit: 01
Material ID: 358858
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B13
North
< 1/8
0.047 mi.
249 ft.
TEXACO STATION
3755 NOSTRAND AVENUE
BROOKLYN, NY
Site 9 of 9 in cluster B

NY Hist Spills **S102238447**
N/A

Relative:
Higher

Actual:
9 ft.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9511527
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/12/1995 14:20
Reported to Dept Date/Time: 12/12/95 14:41
SWIS: 61
Spiller Name: TEXACO STATION
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Address: 3755 NOSTRAND AVENUE
Spiller City,St,Zip: BROOKLYN, NY -
Spill Cause: Housekeeping
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/12/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/04/96
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEXACO STATION (Continued)

S102238447

Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: CONTAMINATED SOIL FOUND UNDER FUEL ISLAND DURING CANOPY INSTALLATION.
APPROXIMATELY 3 YARDS OF SOIL. SOIL TO BE STOCKPILED AND REMOVED.

C14
ENE
< 1/8
0.060 mi.
316 ft.

PS 286
2525 HARING ST
BKLN, NY 11235

HIST AST 1000961235
N/A

Site 1 of 2 in cluster C

Relative:
Higher

HIST AST:

Actual:
9 ft.

PBS Number: 2-356603
SWIS Code: 6101
Operator: PLANT OPERATION
Facility Phone: (718) 391-6000
Facility Addr2: 2525 HARING ST
Facility Type: SCHOOL
Emergency: SCHOOL SAFETY
Emergency Tel: (212) 979-3300
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: CITY OF NEW YORK C/O BOARD OF EDUCATION
Owner Address: 28-11 QUEENS PLAZA NORTH
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Federal ID: Not reported
Owner Tel: (718) 391-6832
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Contact: FRANK CARDELLO-PLANT OPERNTROL
Mailing Name: BOARD OF EDUCATION
Mailing Address: 28-11 QUEENS PLAZA NORTH
Mailing Address 2: 5TH FLOOR
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Telephone: (718) 391-6832
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
or not at the facility.
Certification Flag: False
Certification Date: 09/02/1998
Expiration: 06/28/2003
Renew Flag: False
Renew Date: Not reported
Total Capacity: 10000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PS 286 (Continued)

1000961235

Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 10000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

C15
ENE
< 1/8
0.060 mi.
316 ft.
PUBLIC SCHOOL 286 - BROOKLYN
2525 HARING STREET
BROOKLYN, NY 11235
Site 2 of 2 in cluster C

AST A100320222
N/A

Relative:
Higher

AST:

Actual:
9 ft.

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-356603
Program Type: PBS
UTM X: 589771.4507499999
UTM Y: 4493918.8162799999
Expiration Date: 2013/06/28

Affiliation Records:
Site Id: 17819
Affiliation Type: Owner
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: MANAGER, FUEL DIVISION
Contact Name: JAMES A. MERLO
Address1: 44-36 VERNON BOULEVARD
Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 286 - BROOKLYN (Continued)

A100320222

City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: GDBREEN
Date Last Modified: 10/1/2012

Site Id: 17819
Affiliation Type: Mail Contact
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: JAMES A. MERLO
Address1: FIELD OPERATIONS-FUEL DIVISION
Address2: 44-36 VERNON BOULEVARD
City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: JMERLO@SCHOOLS.NYC.GOV
Fax Number: Not reported
Modified By: dxliving
Date Last Modified: 9/2/2008

Site Id: 17819
Affiliation Type: On-Site Operator
Company Name: PUBLIC SCHOOL 286 - BROOKLYN
Contact Type: Not reported
Contact Name: PLANT OPERATIONS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (718) 349-5400
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: GDBREEN
Date Last Modified: 4/4/2012

Site Id: 17819
Affiliation Type: Emergency Contact
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: SCHOOL SAFETY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 286 - BROOKLYN (Continued)

A100320222

Country Code: 999
Phone: (718) 935-3300
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: GDBREEN
Date Last Modified: 10/1/2012

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G02 - Tank Secondary Containment - Vault (w/access)
J02 - Dispenser - Suction
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
L00 - Piping Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)

Tank Info:

Tank Number: 001
Tank Id: 34851
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/21/1959
Capacity Gallons: 10000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: dxliving
Last Modified: 05/13/2008

D16
NNW
< 1/8
0.068 mi.
360 ft.

2461 EAST 29TH ST
2461 EAST 29TH ST
BROOKLYN, NY
Site 1 of 4 in cluster D

HIST LTANKS **S102150132**
N/A

Relative:
Higher

HIST LTANKS:

Actual:
9 ft.

Region of Spill: 2
Spill Number: 9501825
Spill Date: 05/13/1995
Spill Time: 09:30
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/25/96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2461 EAST 29TH ST (Continued)

S102150132

Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 05/13/95
Reported to Department Time: 09:30
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: SAME
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/23/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/26/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 75
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2461 EAST 29TH ST (Continued)

S102150132

Last Date: 19940929

DEC Remarks: Spill being cleaned up by PTC who removed oil soaked soils from site and restored.

Spill Cause: CALLER IS THE CLEANUP COMPANY AND WILL BE RESPONDING WITH A VACCUM UNKNOWN VEHICLE ABSORBENTS - NOT MUCH MORE INFO.

**D17
NNW
< 1/8
0.068 mi.
360 ft.**

**SHEEPSHEAD BAY
2461 EAST 29TH ST
BROOKLYN, NY**

**LTANKS
NY Spills
NY Hist Spills**

**S104496052
N/A**

Site 2 of 4 in cluster D

**Relative:
Higher**

LTANKS:

Site ID: 325833
Spill No: 9501825
Spill Date: 5/13/1995
Spill Cause: Tank Overfill
Spill Source: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

**Actual:
9 ft.**

Spill Closed Dt: 3/25/1996
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: MMMULQUE
Referred To: Not reported
Reported to Dept: 5/13/1995
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0

Date Entered In Computer: 5/23/1995
Spill Record Last Update: 3/26/1996
Spiller Name: Not reported
Spiller Company: SAME
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 262467

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MULQUEEN" Spill being cleaned up by PTC who removed oil soaked soils from site and restored.

Remarks: CALLER IS THE CLEANUP COMPANY AND WILL BE RESPONDING WITH A VACCUM UNKNOWN VEHICLE & ABSORBENTS - NOT MUCH MORE INFO.

Material:

Site ID: 325833
Operable Unit ID: 1013004
Operable Unit: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S104496052

Material ID: 366901
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 75
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 216032
Spill No: 0112124
Spill Date: 3/25/2002
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/18/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: CESAUYER
Referred To: Not reported
Reported to Dept: 3/25/2002
CID: 257
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 3/25/2002
Spill Record Last Update: 3/18/2005
Spiller Name: VAL GOLTSMAN
Spiller Company: Not reported
Spiller Address: 2461 EAST 29TH ST
Spiller City,St,Zip: SHEEPSHEAD BAY, BROOKLYN, NY
001
Spiller Contact: VAL GOLTSMAN
Spiller Phone: (718) 646-4056
Spiller Extention: Not reported
DEC Region: 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S104496052

DER Facility ID: 262467
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER"1/5/04-Vought-Spill transferred from Vought to Austin.01/27/04 - Sawyer - Spill transferred from Austin to Sawyer.03/18/05 - Sawyer - PTC did major pipe work on this tank for the Century Management. The suction line, fill line and return hotwell were replaced. Petroleum has forwarded the work invoices to the Department. No contamination was discovered. Closed.
Remarks: air leak on tank will uncover to locate

Material:
Site ID: 216032
Operable Unit ID: 850929
Operable Unit: 01
Material ID: 526138
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

SPILLS:
Facility ID: 9501981
DER Facility ID: 262467
Facility Type: ER
Site ID: 139308
DEC Region: 2
Spill Number: 9501981
Spill Date: 5/17/1995
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/3/1997
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 5/17/1995
CID: Not reported
Water Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S104496052

Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/27/1948
Spill Record Last Update: 2/19/2003
Spiller Name: Not reported
Spiller Company: UNK
Spiller Address: Not reported
Spiller City,St,Zip: ***UPDATE***, ZZ
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "XX"SPILL CLOSED DUE TO INSUFFICIENT DATA.
Remarks: Not reported

Material:
Site ID: 139308
Operable Unit ID: 1013076
Operable Unit: 01
Material ID: 367058
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9501981
Investigator: XX
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S104496052

Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/17/1995 00:00
Reported to Dept Date/Time: 05/17/95
SWIS: 61
Spiller Name: UNK
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/03/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/27/48
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/03/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: SPILL CLOSED DUE TO INSUFFICIENT DATA.
Remark: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

E18
SSE
< 1/8
0.073 mi.
386 ft.

CEA ISLE OWNERS CORP
3901-3903 NOSTRAND AVE
BROOKLYN, NY

NY Spills S104879930
NY Hist Spills N/A

Site 1 of 3 in cluster E

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 0008560
DER Facility ID: 245314
Facility Type: ER
Site ID: 303634
DEC Region: 2
Spill Number: 0008560
Spill Date: 10/16/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/29/2003
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 10/23/2000
CID: 382
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/23/2000
Spill Record Last Update: 5/29/2003
Spiller Name: Not reported
Spiller Company: CEA ISLE OWNERS CORP
Spiller Address: 3901-3903 NOSTRAND AVE
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: DWAYNE MONACO
Contact Phone: (914) 777-1930
DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was
"TIPPLE"12/27/2000 NORTHEAST ENVIRONMENTAL HAS BEEN CONTRACTED TO DO
THE CLEANUP WORK IS SCHEDULED TO COMMENCE THE WEEK OF JAN.3,2001
PHONE # AT NE ENV. 914-777-1930NFA LETTER SENT 4/6/01
Remarks: contaminated soil found beneath basement floor in boiler room. req
callback from rep

Material:

Site ID: 303634
Operable Unit ID: 831016
Operable Unit: 01
Material ID: 563284
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CEA ISLE OWNERS CORP (Continued)

S104879930

Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0008560
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/16/2000 12:00
Reported to Dept Date/Time: 10/23/00 09:45
SWIS: 61
Spiller Name: CEA ISLE OWNERS CORP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: DWAYNE MONACO
Spiller Phone: (914) 777-1930
Spiller Address: 3901-3903 NOSTRAND AVE
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/23/00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CEA ISLE OWNERS CORP (Continued)

S104879930

Date Spill Entered In Computer Data File: Not reported
Update Date: 02/01/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

DEC Remarks: 12/27/2000 NORTHEAST ENVIRONMENTAL HAS BEEN CONTRACTED TO DO THE CLEANUP WORK
IS SCHEDULED TO COMMENCE THE WEEK OF JAN.3,2001 PHONE AT NE ENV.
914-777-1930

Remark: contaminated soil found beneath basement floor in boiler room. req callback
from rep

E19
SSE
< 1/8
0.077 mi.
405 ft.

SEA ISLE OWNERS INC.
3903 NOSTRAND AVE
BROOKLYN, NY 11235
Site 2 of 3 in cluster E

UST **U004078108**
N/A

Relative:
Higher

UST:

Facility Id: 2-319937
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2012/10/23
UTM X: 589733.19460000005
UTM Y: 4493612.2428099997

Actual:
9 ft.

Affiliation Records:

Site Id: 14806
Affiliation Type: Owner
Company Name: SEA ISLE OWNERS INC C/O ARAS PROPERTIES INC
Contact Type: MANAGING AGENT
Contact Name: ARI SCHERTZ
Address1: 92 WASHINGTON AVENUE
Address2: Not reported
City: CEDARHURST
State: NY
Zip Code: 11516
Country Code: 001
Phone: (516) 569-5959

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U004078108

Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 8/6/2007

Site Id: 14806
Affiliation Type: Mail Contact
Company Name: SEA ISLES OWNERS CORP
Contact Type: Not reported
Contact Name: MR. ARI SCHERTZ
Address1: C/O SCHERTZ REALTY
Address2: 92 WASHINGTON AVENUE
City: CEDARHURST
State: NY
Zip Code: 11516
Country Code: 001
Phone: (516) 569-5959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 14806
Affiliation Type: On-Site Operator
Company Name: SEA ISLE OWNERS INC.
Contact Type: Not reported
Contact Name: JOSE MONTALVO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 891-9145
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 14806
Affiliation Type: Emergency Contact
Company Name: SEA ISLE OWNERS INC C/O ARAS PROPERTIES INC
Contact Type: Not reported
Contact Name: ARI SCHERTZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (516) 569-5959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U004078108

Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

C01 - Pipe Location - Aboveground
F01 - Pipe External Protection - Painted/Asphalt Coating
I05 - Overfill - Vent Whistle
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
G07 - Tank Secondary Containment - Excavation/Trench Liner System

Tank Info:

Site ID: 14806

Tank Number: 001
Tank ID: 26171
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 15000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 12/01/1999
Tank Location: 6
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

E20
SSE
< 1/8
0.077 mi.
405 ft.

SEA ISLE OWNERS INC.
3903 NOSTRAND AVE
BROOKLYN, NY 11235

Site 3 of 3 in cluster E

HIST UST U000407341
AST N/A
HIST AST

Relative:
Higher

HIST UST:
PBS Number: 2-319937
SPDES Number: Not reported
Emergency Contact: ARI SCHERTZ
Emergency Telephone: (516) 569-5959
Operator: JOSE MONTALVO
Operator Telephone: (718) 891-9145
Owner Name: SEA ISLE OWNERS INC C/O SCHERTZ REALTY

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U000407341

Owner Address: 92 WASHINGTON AVENUE
Owner City,St,Zip: CEDARHURST, NY 11516
Owner Telephone: (516) 569-5959
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: SEA ISLES OWNERS CORP
Mailing Address: C/O SCHERTZ REALTY
Mailing Address 2: 92 WASHINGTON AVENUE
Mailing City,St,Zip: CEDARHURST, NY 11516
Mailing Contact: MR. ARI SCHERTZ
Mailing Telephone: (516) 569-5959
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 3903 NOSTRAND AVE
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 12/15/1999
Expiration Date: 10/23/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: Closed-In Place
Install Date: Not reported
Capacity (gals): 15000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Vault (w/o access)
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U000407341

Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1999
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-319937
Program Type: PBS
UTM X: 589733.19460000005
UTM Y: 4493612.2428099997
Expiration Date: 2012/10/23

Affiliation Records:

Site Id: 14806
Affiliation Type: Owner
Company Name: SEA ISLE OWNERS INC C/O ARAS PROPERTIES INC
Contact Type: MANAGING AGENT
Contact Name: ARI SCHERTZ
Address1: 92 WASHINGTON AVENUE
Address2: Not reported
City: CEDARHURST
State: NY
Zip Code: 11516
Country Code: 001
Phone: (516) 569-5959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 8/6/2007

Site Id: 14806
Affiliation Type: Mail Contact
Company Name: SEA ISLES OWNERS CORP
Contact Type: Not reported
Contact Name: MR. ARI SCHERTZ
Address1: C/O SCHERTZ REALTY
Address2: 92 WASHINGTON AVENUE
City: CEDARHURST
State: NY
Zip Code: 11516
Country Code: 001
Phone: (516) 569-5959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 14806

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U000407341

Affiliation Type: On-Site Operator
Company Name: SEA ISLE OWNERS INC.
Contact Type: Not reported
Contact Name: JOSE MONTALVO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 891-9145
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 14806
Affiliation Type: Emergency Contact
Company Name: SEA ISLE OWNERS INC C/O ARAS PROPERTIES INC
Contact Type: Not reported
Contact Name: ARI SCHERTZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (516) 569-5959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Equipment Records:

C01 - Pipe Location - Aboveground
F01 - Pipe External Protection - Painted/Asphalt Coating
I05 - Overfill - Vent Whistle
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
G07 - Tank Secondary Containment - Excavation/Trench Liner System

Tank Info:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U000407341

Tank Number: 002
Tank Id: 57376
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1999
Capacity Gallons: 4000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST AST:

PBS Number: 2-319937
SWIS Code: 6101
Operator: JOSE MONTALVO
Facility Phone: (718) 891-9145
Facility Addr2: 3903 NOSTRAND AVE
Facility Type: APARTMENT BUILDING
Emergency: ARI SCHERTZ
Emergency Tel: (516) 569-5959
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: SEA ISLE OWNERS INC C/O SCHERTZ REALTY
Owner Address: 92 WASHINGTON AVENUE
Owner City,St,Zip: CEDARHURST, NY 11516
Federal ID: Not reported
Owner Tel: (516) 569-5959
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: MR. ARI SCHERTZ
Mailing Name: SEA ISLES OWNERS CORP
Mailing Address: C/O SCHERTZ REALTY
Mailing Address 2: 92 WASHINGTON AVENUE
Mailing City,St,Zip: CEDARHURST, NY 11516
Mailing Telephone: (516) 569-5959
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 12/15/1999
Expiration: 10/23/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 4000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA ISLE OWNERS INC. (Continued)

U000407341

Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 002
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Tank Status: In Service
Install Date: 19991201
Capacity (Gal): 4000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 01
Pipe Location: Aboveground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 01
Tank Containment: Diking
Leak Detection: 05
Overfill Protection: 06
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

F21
NNE
< 1/8
0.094 mi.
495 ft.
NOSTRAND GARDENS CO-OP
2455-65 HARING STREET
BROOKLYN, NY 11235
Site 1 of 6 in cluster F

UST **U004076777**
N/A

Relative: UST:
Higher Facility Id: 2-233323
Region: STATE
Actual: DEC Region: 2
9 ft. Site Status: Active
Program Type: PBS
Expiration Date: 2007/08/17
UTM X: 589745.55963000003
UTM Y: 4494085.0908899996

Affiliation Records:
Site Id: 8485
Affiliation Type: Owner
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 2465 HARING STREET
Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP (Continued)

U004076777

City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9800
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 8/1/2012

Site Id: 8485
Affiliation Type: Mail Contact
Company Name: AGGRESSIVE HEATING INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 9009 FIFTH AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11209
Country Code: 001
Phone: (718) 836-9222
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 11/23/2004

Site Id: 8485
Affiliation Type: On-Site Operator
Company Name: NOSTRAND GARDENS CO-OP
Contact Type: Not reported
Contact Name: NOSTRAND GARDENS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 10/18/2004

Site Id: 8485
Affiliation Type: Emergency Contact
Company Name: NOSTRAND GARDENS CO-OP
Contact Type: Not reported
Contact Name: HARRY HAMMERSTONE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP (Continued)

U004076777

Country Code: 999
Phone: (718) 743-9800
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 10/18/2004

Equipment Records:

J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
G01 - Tank Secondary Containment - Diking (Aboveground)
A00 - Tank Internal Protection - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
G07 - Tank Secondary Containment - Excavation/Trench Liner System
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

Tank Info:

Site ID: 8485

Tank Number: D65
Tank ID: 17998
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1952
Capacity Gallons: 12000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

F22
NNE
< 1/8
0.094 mi.
495 ft.

NOSTRAND GARDENS CO-OP, INC.
2455-65 HARING STREET
BROOKLYN, NY 11235
Site 2 of 6 in cluster F

HIST UST **U001836283**
N/A

Relative:
Higher

HIST UST:
PBS Number: 2-233323
SPDES Number: Not reported
Emergency Contact: LESTER TATUM
Emergency Telephone: (718) 743-9840

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP, INC. (Continued)

U001836283

Operator: NOSTRAND GARDENS CO-OP, INC.
Operator Telephone: (718) 743-9840
Owner Name: NOSTRAND GARDENS CO-OP, INC.
Owner Address: 2465 HARING STREET
Owner City,St,Zip: BROOKLYN, NY 11235
Owner Telephone: (718) 743-9840
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: BRITVAN REALTY ASSOCIATES, LTD.
Mailing Address: 2465 HARING STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11235
Mailing Contact: Not reported
Mailing Telephone: (718) 743-9840
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/06/1997
Expiration Date: 08/17/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19941201
Capacity (gals): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: None
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Remote Impounding Area

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP, INC. (Continued)

U001836283

Leak Detection: Electronic
Overfill Prot: None
Dispenser: Gravity
Date Tested: Not reported
Next Test Date: 12/01/2004
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: D65
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19521201
Capacity (gals): 12000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: None
Pipe Location: None
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/o access)
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

F23
NNE
< 1/8
0.094 mi.
495 ft.

NOSTRAND GARDENS CO-OP
2455-65 HARING STREET
BROOKLYN, NY 11235
Site 3 of 6 in cluster F

AST A100295314
N/A

Relative:
Higher

Actual:
9 ft.

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-233323
Program Type: PBS
UTM X: 589745.55963000003
UTM Y: 4494085.0908899996
Expiration Date: 2007/08/17

Affiliation Records:
Site Id: 8485
Affiliation Type: Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP (Continued)

A100295314

Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 2465 HARING STREET
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9800
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 8/1/2012

Site Id: 8485
Affiliation Type: Mail Contact
Company Name: AGGRESSIVE HEATING INC.
Contact Type: Not reported
Contact Name: Not reported
Address1: 9009 FIFTH AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11209
Country Code: 001
Phone: (718) 836-9222
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 11/23/2004

Site Id: 8485
Affiliation Type: On-Site Operator
Company Name: NOSTRAND GARDENS CO-OP
Contact Type: Not reported
Contact Name: NOSTRAND GARDENS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 10/18/2004

Site Id: 8485
Affiliation Type: Emergency Contact
Company Name: NOSTRAND GARDENS CO-OP
Contact Type: Not reported
Contact Name: HARRY HAMMERSTONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS CO-OP (Continued)

A100295314

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 743-9800
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 10/18/2004

Equipment Records:

J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
D01 - Pipe Type - Steel/Carbon Steel/Iron
G01 - Tank Secondary Containment - Diking (Aboveground)
A00 - Tank Internal Protection - None
A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
G07 - Tank Secondary Containment - Excavation/Trench Liner System
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

Tank Info:

Tank Number: 01
Tank Id: 49325
Tank Location: 1
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1994
Capacity Gallons: 2500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 10/18/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D24
NNW
< 1/8
0.096 mi.
505 ft.
YAILLE LEASING CORP
2440 EAST 29TH ST
BROOKLYN, NY 11235
Site 3 of 4 in cluster D

UST
HIST UST
U000398886
N/A

Relative:
Higher

UST:

Actual:
9 ft.

Facility Id: 2-200824
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2016/06/06
UTM X: 589566.39428000001
UTM Y: 4494087.34822

Affiliation Records:

Site Id: 6787
Affiliation Type: Mail Contact
Company Name: YALE REALTY LLC
Contact Type: Not reported
Contact Name: ELLA
Address1: PO BOX 340816
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11234
Country Code: 001
Phone: (718) 513-3282
Phone Ext: Not reported
Email: RIZAROREALTY@GMAIL.COM
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 7/23/2012

Site Id: 6787
Affiliation Type: On-Site Operator
Company Name: YAILLE LEASING CORP
Contact Type: Not reported
Contact Name: ANDREAS DIAZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (917) 295-3571
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 7/23/2012

Site Id: 6787
Affiliation Type: Emergency Contact
Company Name: YALE REALTY LLC
Contact Type: Not reported
Contact Name: NESSA
Address1: Not reported
Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YAILLE LEASING CORP (Continued)

U000398886

City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 513-3282
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 7/23/2012

Site Id: 6787
Affiliation Type: Owner
Company Name: YALE REALTY LLC
Contact Type: MEMBER
Contact Name: ROBERT IZSAK
Address1: PO BOX 340816
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11234
Country Code: 001
Phone: (718) 513-3282
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 7/23/2012

Equipment Records:

G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Info:

Site ID: 6787

Tank Number: 001
Tank ID: 11392
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/01/1961
Capacity Gallons: 7500
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YAILLE LEASING CORP (Continued)

U000398886

Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST UST:

PBS Number: 2-200824
SPDES Number: Not reported
Emergency Contact: LARRY LOMBARDI
Emergency Telephone: (718) 646-0181
Operator: MID STATE MANAGEMENT CORP
Operator Telephone: (718) 459-9021
Owner Name: YAILLE LEASING CORP
Owner Address: 97-77 QUEENS BLVD
Owner City,St,Zip: REGO PARK, NY 11374
Owner Telephone: (718) 459-9021
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: YAILLE LEASING CORP
Mailing Address: 97-77 QUEENS BLVD
Mailing Address 2: Not reported
Mailing City,St,Zip: REGO PARK, NY 11374
Mailing Contact: Not reported
Mailing Telephone: (718) 459-9021
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 2440 EAST 29TH ST
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 12/11/1997
Expiration Date: 01/07/2003
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 7500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19611001
Capacity (gals): 7500

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

YAILLE LEASING CORP (Continued)

U000398886

Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: None
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

G25
North
< 1/8
0.107 mi.
563 ft.

R & S STRAUSS ASSOC
3720 NOSTRAND AVE
BROOKLYN, NY 11235

Site 1 of 3 in cluster G

RCRA-NonGen
FINDS
MANIFEST

1004758330
NYD986993566

Relative:
Higher

RCRA-NonGen:

Actual:
9 ft.

Date form received by agency: 01/01/2007
Facility name: R & S STRAUSS ASSOC
Facility address: 3720 NOSTRAND AVE
BROOKLYN, NY 11235
EPA ID: NYD986993566
Mailing address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact: GARY MALANGA
Contact address: NOSTRAND AVE
BROOKLYN, NY 11235
Contact country: US
Contact telephone: (718) 891-1811
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: R & S STRAUSS
Owner/operator address: 1835 BURNETT AVE
UNION, NJ 07083
Owner/operator country: US
Owner/operator telephone: (718) 891-1811
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: R & S STRAUSS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Owner/operator address: 1835 BURNETT AVE
UNION, NJ 07083
Owner/operator country: US
Owner/operator telephone: (718) 891-1811
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: R & S STRAUSS ASSOC
Classification: Not a generator, verified

Date form received by agency: 03/06/1992
Facility name: R & S STRAUSS ASSOC
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004486422

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986993566
Country: USA
Mailing Name: R & S STRAUSS
Mailing Contact: MIKE SANTIAGO
Mailing Address: 3720 NOSTRAND AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-891-1811

Document ID: NYC2426872
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: P39183
Trans2 State ID: Not reported
Generator Ship Date: 930721
Trans1 Recv Date: 930721
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930812
Part A Recv Date: Not reported
Part B Recv Date: 930827
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: VAD105838874
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00140
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 93

Document ID: NYC3959638
Manifest Status: Completed copy
Trans1 State ID: NYJU4818
Trans2 State ID: Not reported
Generator Ship Date: 960102
Trans1 Recv Date: 960102
Trans2 Recv Date: Not reported
TSD Site Recv Date: 960105
Part A Recv Date: 960201
Part B Recv Date: 960117
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00006
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Document ID: NYC4754891
Manifest Status: Completed copy
Trans1 State ID: NYJU4818
Trans2 State ID: Not reported
Generator Ship Date: 970725
Trans1 Recv Date: 970725
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970730
Part A Recv Date: 970916
Part B Recv Date: 970819
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC4738342
Manifest Status: Completed copy
Trans1 State ID: NYJU4818
Trans2 State ID: Not reported
Generator Ship Date: 970519
Trans1 Recv Date: 970519
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970521
Part A Recv Date: 970916
Part B Recv Date: 970602
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC4896202
Manifest Status: Completed copy
Trans1 State ID: DL7754NY
Trans2 State ID: Not reported
Generator Ship Date: 971117
Trans1 Recv Date: 971117
Trans2 Recv Date: Not reported
TSD Site Recv Date: 971119
Part A Recv Date: 980115

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Part B Recv Date: 971204
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC6140981
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCR000074591
Generator Ship Date: 05/24/2000
Trans1 Recv Date: 05/24/2000
Trans2 Recv Date: 05/25/2000
TSD Site Recv Date: 05/26/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYDL7754
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC6201551
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 07/20/2000
Trans1 Recv Date: 07/20/2000
Trans2 Recv Date: 07/25/2000
TSD Site Recv Date: 07/26/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYAT8305
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC6231137
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 09/12/2000
Trans1 Recv Date: 09/12/2000
Trans2 Recv Date: 09/14/2000
TSD Site Recv Date: 09/14/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYAT8505
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00011
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC6256934
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 11/09/2000
Trans1 Recv Date: 11/09/2000
Trans2 Recv Date: 11/15/2000
TSD Site Recv Date: 11/15/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYAT8305
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00011
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC4873443
Manifest Status: Completed copy
Trans1 State ID: NYJU4818
Trans2 State ID: Not reported
Generator Ship Date: 970925
Trans1 Recv Date: 970925
Trans2 Recv Date: Not reported
TSD Site Recv Date: 971001
Part A Recv Date: 971020
Part B Recv Date: 971020
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC4677917
Manifest Status: Completed copy
Trans1 State ID: NYJE4818
Trans2 State ID: Not reported
Generator Ship Date: 970402
Trans1 Recv Date: 970402
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970404
Part A Recv Date: 970522
Part B Recv Date: 970423
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Document ID: NYC4448744
Manifest Status: Completed copy
Trans1 State ID: NYJU4818
Trans2 State ID: Not reported
Generator Ship Date: 970127
Trans1 Recv Date: 970127
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970129
Part A Recv Date: 970522
Part B Recv Date: 970210
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD000708198
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

Document ID: NYC5010311
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 02/27/1998
Trans1 Recv Date: 02/27/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 03/03/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: DL7754NY
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00010
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 98

Document ID: NYC4951192
Manifest Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 01/08/1998
Trans1 Recv Date: 01/08/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 01/14/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYDL7154
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

Document ID: PAC8150166
Manifest Status: Completed copy
Trans1 State ID: PAAH0172
Trans2 State ID: Not reported
Generator Ship Date: 921119
Trans1 Recv Date: 921119
Trans2 Recv Date: Not reported
TSD Site Recv Date: 921120
Part A Recv Date: 930106
Part B Recv Date: 921201
Generator EPA ID: NYD986993566
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: PAD987266715
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00130
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 92

Document ID: NYC5338890
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 10/30/1998
Trans1 Recv Date: 10/30/1998
Trans2 Recv Date: 11/03/1998
TSD Site Recv Date: 11/04/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYCGF4332
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00010
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

Document ID: NYC5360905
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 08/20/1998
Trans1 Recv Date: 08/20/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/26/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYCGF4332
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00012
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

Document ID: NYC5217423
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 04/29/1998
Trans1 Recv Date: 04/29/1998

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Trans2 Recv Date: Not reported
TSD Site Recv Date: 05/01/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: NYDL7154
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

Document ID: NYC5289827
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: Not reported
Generator Ship Date: 06/18/1998
Trans1 Recv Date: 06/18/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 06/24/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSD ID: DL7754NY
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00010
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00005
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.00
Year: 98

Document ID: NYC5479885
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 12/30/1998
Trans1 Recv Date: 12/30/1998
Trans2 Recv Date: 01/05/1999
TSD Site Recv Date: 01/06/1999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R & S STRAUSS ASSOC (Continued)

1004758330

Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986993566
Trans1 EPA ID: NYD000708198
Trans2 EPA ID: Not reported
TSDF ID: NYGF2881
Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Quantity: 00010
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 01.00
Year: 98

[Click this hyperlink](#) while viewing on your computer to access
15 additional NY_MANIFEST: record(s) in the EDR Site Report.

G26
North
< 1/8
0.107 mi.
563 ft.

STRAUSS DISCOUNT AUTO 121
3720 NOSTRAND AVENUE
BROOKLYN, NY 11235

AST A100298762
N/A

Site 2 of 3 in cluster G

Relative:
Higher

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-610245
Program Type: PBS
UTM X: 589640.09349
UTM Y: 4494132.8216500003
Expiration Date: 2014/08/19

Affiliation Records:

Site Id: 365613
Affiliation Type: Mail Contact
Company Name: STRAUSS DISCOUNT AUTO
Contact Type: Not reported
Contact Name: GREG SCHULTZ
Address1: 9A BRICK PLANT ROAD
Address2: Not reported
City: SOUTH RIVER
State: NJ
Zip Code: 08882
Country Code: 001
Phone: (732) 390-9000
Phone Ext: Not reported
Email: GSCHULTZ@STRAUSSAUTO.COM
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 8/19/2009

Site Id: 365613
Affiliation Type: On-Site Operator
Company Name: STRAUSS DISCOUNT AUTO 121
Contact Type: Not reported
Contact Name: STORE MGR

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STRAUSS DISCOUNT AUTO 121 (Continued)

A100298762

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 891-1811
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 8/19/2009

Site Id: 365613
Affiliation Type: Emergency Contact
Company Name: STRAUSS DISCOUNT AUTO
Contact Type: Not reported
Contact Name: GREG SCHULTZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (732) 390-9000
Phone Ext: 5213
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 6/22/2011

Site Id: 365613
Affiliation Type: Owner
Company Name: STRAUSS DISCOUNT AUTO
Contact Type: Not reported
Contact Name: Not reported
Address1: 9A BRICK PLANT RD
Address2: Not reported
City: SOUTH RIVER
State: NY
Zip Code: 08882
Country Code: 001
Phone: (732) 390-9000
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 8/19/2009

Equipment Records:

E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
E00 - Piping Secondary Containment - None
K00 - Spill Prevention - None
G09 - Tank Secondary Containment - Modified Double-Walled
(Aboveground)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STRAUSS DISCOUNT AUTO 121 (Continued)

A100298762

L00 - Piping Leak Detection - None
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D10 - Pipe Type - Copper
J02 - Dispenser - Suction
D00 - Pipe Type - No Piping
G09 - Tank Secondary Containment - Modified Double-Walled
(Aboveground)
L00 - Piping Leak Detection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
K00 - Spill Prevention - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I03 - Overfill - Automatic Shut-Off
D00 - Pipe Type - No Piping
J00 - Dispenser - None
G09 - Tank Secondary Containment - Modified Double-Walled
(Aboveground)
L00 - Piping Leak Detection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Tank Info:

Tank Number: 001
Tank Id: 212275
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: 204
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 250
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 06/19/2006

Tank Number: 121-1B
Tank Id: 230215
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STRAUSS DISCOUNT AUTO 121 (Continued)

A100298762

Tank Model: Not reported
Pipe Model: Not reported
Install Date: 08/31/2004
Capacity Gallons: 350
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 08/19/2009

Tank Number: 121-1W
Tank Id: 230214
Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 11/26/1990
Capacity Gallons: 275
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: NRLOMBAR
Last Modified: 08/19/2009

**D27
NNW
< 1/8
0.114 mi.
604 ft.**

**SHEEPSHEAD TERRACE COOPERATIVE, INC
2427-2461 EAST 29TH STREET
BROOKLYN, NY 11235**

**UST U001838529
HIST UST N/A**

Site 4 of 4 in cluster D

**Relative:
Higher**

UST:
Facility Id: 2-288969
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2013/01/07
UTM X: 589561.67972999997
UTM Y: 4494119.3241499998

**Actual:
9 ft.**

Affiliation Records:
Site Id: 12995
Affiliation Type: Owner
Company Name: SHEEPSHEAD TERRACE COOPERATIVE INC
Contact Type: ACCT. EXECUTIVE
Contact Name: HOWARD S.
Address1: 2427 & 2461 E 29 ST
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD TERRACE COOPERATIVE, INC (Continued)

U001838529

Phone: (718) 646-4056
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: msbaptis
Date Last Modified: 11/16/2007

Site Id: 12995
Affiliation Type: Mail Contact
Company Name: CENTURY MANAGEMENT SERVICES INC
Contact Type: Not reported
Contact Name: SHANTELL BENNETT
Address1: % SHEEPSHEAD TERRACE
Address2: 7 PENN PLAZA - SUITE 1400
City: NEW YORK
State: NY
Zip Code: 10001
Country Code: 001
Phone: (212) 560-6456
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 1/19/2012

Site Id: 12995
Affiliation Type: On-Site Operator
Company Name: SHEEPSHEAD TERRACE COOPERATIVE, INC
Contact Type: Not reported
Contact Name: JOSE CAESAR
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 646-4056
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: msbaptis
Date Last Modified: 11/20/2007

Site Id: 12995
Affiliation Type: Emergency Contact
Company Name: SHEEPSHEAD TERRACE COOPERATIVE INC
Contact Type: Not reported
Contact Name: JOSE CAESAR
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 646-7632
Phone Ext: Not reported
Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD TERRACE COOPERATIVE, INC (Continued)

U001838529

Fax Number: Not reported
Modified By: msbaptis
Date Last Modified: 11/20/2007

Equipment Records:

B00 - Tank External Protection - None
G99 - Tank Secondary Containment - Other
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
D00 - Pipe Type - No Piping
H99 - Tank Leak Detection - Other
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
D00 - Pipe Type - No Piping
H99 - Tank Leak Detection - Other
B00 - Tank External Protection - None
G99 - Tank Secondary Containment - Other
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Info:

Site ID: 12995

Tank Number: 001
Tank ID: 25643
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1955
Capacity Gallons: 7500
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

Site ID: 12995

Tank Number: 002
Tank ID: 25644
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1955
Capacity Gallons: 7500
Tightness Test Method: NN
Next Test Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD TERRACE COOPERATIVE, INC (Continued)

U001838529

Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST UST:

PBS Number: 2-288969
SPDES Number: Not reported
Emergency Contact: ELM MANAGEMENT
Emergency Telephone: (718) 484-2200
Operator: ELM MANAGEMENT
Operator Telephone: (718) 484-2200
Owner Name: SHEEPSHEAD TERRACE CORP INC
Owner Address: 2427&2461 E 29 ST
Owner City,St,Zip: BKLYN, NY 11235
Owner Telephone: (718) 646-4056
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: SHEEPSHEAD TERRACE CORP INC
Mailing Address: 2427&2461 E 29 ST
Mailing Address 2: Not reported
Mailing City,St,Zip: BKLYN, NY 11235
Mailing Contact: SUPER/FACILITY MANAGER
Mailing Telephone: (718) 484-2200
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: 2427 EAST 29TH ST
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 08/17/1998
Expiration Date: 01/07/2003
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 15000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2
Tank Id: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD TERRACE COOPERATIVE, INC (Continued)

U001838529

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19551201
Capacity (gals): 7500
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Other
Leak Detection: Other
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19551201
Capacity (gals): 7500
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: Not reported
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Other
Leak Detection: Other
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

F28
NNE
< 1/8
0.117 mi.
618 ft.

APRTMENT
2435 HARING STREET
BROOKLYN, NY

Site 4 of 6 in cluster F

NY Spills **S108764815**
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0707012
DER Facility ID: 337063
Facility Type: ER
Site ID: 387630
DEC Region: 2
Spill Number: 0707012
Spill Date: 9/25/2007
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 9/26/2007
SWIS: 2401
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 9/25/2007
CID: 444
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/25/2007
Spill Record Last Update: 9/26/2007
Spiller Name: JOANNE NURSE
Spiller Company: APRTMENT
Spiller Address: 2435 HARING STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: JOANNE NURSE
Contact Phone: (718) 595-4675
DEC Memo: PBS # 2-233331 Sangesland spoke to building manager: Jennifer Christman (718-743-9840)She says there was nothing wrong with the above ground tank in the basement. The building is doing waterproofing in the basement wall and some of the tenants feel it is a waste of money, so they have been calling in problems with building to prevent the work from being done.Sangesland asked her to send the super down to the basement to inspect the tank and submit a written statement that the tank was inspected on this date and everything looked OK.9/26/2007 Ms. Christman submitted a letter saying that the building super inspected the tank and everything was OK,Spill Closed

Remarks:

APARTMENT OIL TANK IS LEAKING

Material:

Site ID: 387630
Operable Unit ID: 1144829
Operable Unit: 01
Material ID: 2135141
Material Code: 0001A
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

APRTMENT (Continued)

S108764815

Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

F29
NNE
< 1/8
0.121 mi.
639 ft.

NOSTRAND GARDENS COOP, INC.
2430-50 HARING STREET
BROOKLYN, NY 11235

UST U004077072
N/A

Site 5 of 6 in cluster F

Relative:
Higher

UST:

Facility Id: 2-233358
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2017/07/07
UTM X: 589737.06784000003
UTM Y: 4494139.4884200003

Actual:
10 ft.

Affiliation Records:

Site Id: 8487
Affiliation Type: Owner
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: MGR
Contact Name: DANIEL SUBILLON
Address1: 2465 HARING STREET
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 9/26/2012

Site Id: 8487
Affiliation Type: Mail Contact

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U004077072

Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: DANIEL SUBILLON/KIM YEE
Address1: 2465 HARING STREET
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: JCHRISTMAN@WENTWORTHMGT.COM
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 9/26/2012

Site Id: 8487
Affiliation Type: On-Site Operator
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: NOSTRAND GARDENS COOP, INC.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 8487
Affiliation Type: Emergency Contact
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: JAMES PORTER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 6/15/2007

Equipment Records:

A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U004077072

C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G01 - Tank Secondary Containment - Diking (Aboveground)
I00 - Overfill - None
B00 - Tank External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G07 - Tank Secondary Containment - Excavation/Trench Liner System

Tank Info:

Site ID: 8487

Tank Number: F50
Tank ID: 10987
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1952
Capacity Gallons: 12000
Tightness Test Method: NN
Next Test Date: Not reported
Date Tank Closed: 03/01/1995
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

F30
NNE
< 1/8
0.121 mi.
639 ft.

NOSTRAND GARDENS COOP, INC.
2430-50 HARING STREET
BROOKLYN, NY 11235

HIST UST **U003074470**
AST **N/A**
HIST AST

Site 6 of 6 in cluster F

Relative:
Higher

HIST UST:

Actual:
10 ft.

PBS Number: 2-233358
SPDES Number: Not reported
Emergency Contact: LESTER TATUM
Emergency Telephone: (718) 743-9840
Operator: NOSTRAND GARDENS COOP, INC.
Operator Telephone: (718) 743-9840
Owner Name: NOSTRAND GARDENS COOP, INC.
Owner Address: 2465 HARING STREET
Owner City,St,Zip: BROOKLYN, NY 11235
Owner Telephone: (718) 743-9840
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: BRITVAN REALTY ASSOCIATES, LTD.
Mailing Address: 2465 HARING STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11235
Mailing Contact: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U003074470

Mailing Telephone: (718) 743-9840
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Addr2: Not reported
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/14/1997
Expiration Date: 07/07/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: F50
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19521201
Capacity (gals): 12000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Epoxy Liner
Tank External: None
Pipe Location: None
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/o access)
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: 03/01/1995
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U003074470

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-233358
Program Type: PBS
UTM X: 589737.06784000003
UTM Y: 4494139.4884200003
Expiration Date: 2017/07/07

Affiliation Records:

Site Id: 8487
Affiliation Type: Owner
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: MGR
Contact Name: DANIEL SUBILLON
Address1: 2465 HARING STREET
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 9/26/2012

Site Id: 8487
Affiliation Type: Mail Contact
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: DANIEL SUBILLON/KIM YEE
Address1: 2465 HARING STREET
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: JCHRISTMAN@WENTWORTHMGT.COM
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 9/26/2012

Site Id: 8487
Affiliation Type: On-Site Operator
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: NOSTRAND GARDENS COOP, INC.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U003074470

Country Code: 001
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 8487
Affiliation Type: Emergency Contact
Company Name: NOSTRAND GARDENS COOP, INC.
Contact Type: Not reported
Contact Name: JAMES PORTER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 743-9840
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: KXTANG
Date Last Modified: 6/15/2007

Equipment Records:

A01 - Tank Internal Protection - Epoxy Liner
H00 - Tank Leak Detection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G01 - Tank Secondary Containment - Diking (Aboveground)
I00 - Overfill - None
B00 - Tank External Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G07 - Tank Secondary Containment - Excavation/Trench Liner System

Tank Info:

Tank Number: 001
Tank Id: 49326
Tank Location: 1
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1994
Capacity Gallons: 2500
Tightness Test Method: NN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U003074470

Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST AST:

PBS Number: 2-233358
SWIS Code: 6101
Operator: NOSTRAND GARDENS COOP, INC.
Facility Phone: (718) 743-9840
Facility Addr2: Not reported
Facility Type: APARTMENT BUILDING
Emergency: LESTER TATUM
Emergency Tel: (718) 743-9840
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: NOSTRAND GARDENS COOP, INC.
Owner Address: 2465 HARING STREET
Owner City,St,Zip: BROOKLYN, NY 11235
Federal ID: Not reported
Owner Tel: (718) 743-9840
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: Not reported
Mailing Name: BRITVAN REALTY ASSOCIATES, LTD.
Mailing Address: 2465 HARING STREET
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11235
Mailing Telephone: (718) 743-9840
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 07/14/1997
Expiration: 07/07/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 2500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND GARDENS COOP, INC. (Continued)

U003074470

Install Date: 19941201
Capacity (Gal): 2500
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: 0
Tank External: 00
Pipe Location: None
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 00
Tank Containment: Remote Impounding Area
Leak Detection: 01
Overfill Protection: 00
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
SPDES Number: Not reported
Lat/Long: Not reported

31
West
< 1/8
0.125 mi.
658 ft.

2515 E 27TH ST
2515 E 27TH ST
BROOKLYN, NY

NY Spills
NY Hist Spills

S102141433
N/A

Relative:
Higher

SPILLS:

Actual:
10 ft.

Facility ID: 9108549
DER Facility ID: 240541
Facility Type: ER
Site ID: 297289
DEC Region: 2
Spill Number: 9108549
Spill Date: 11/10/1991
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 11/5/2001
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 11/10/1991
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: 11/5/2001
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/11/1991
Spill Record Last Update: 11/5/2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2515 E 27TH ST (Continued)

S102141433

Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: Not reported

Material:

Site ID: 297289
Operable Unit ID: 958850
Operable Unit: 01
Material ID: 420692
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9108549
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/10/1991 13:00
Reported to Dept Date/Time: 11/10/91 13:16
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2515 E 27TH ST (Continued)

S102141433

Reported to Dept: Air
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 11/05/01
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/05/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/11/91
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/05/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: ODOR. 11/05/01: MF-R9 NO FURTHER INFO ON SPILL. DEAD ISSUE, NO FURTHER ACTION POSSIBLE.
Remark: Not reported

**H32
SW
1/8-1/4
0.127 mi.
669 ft.**

**HOUSE
2701 AVE Z
BROOKLYN, NY
Site 1 of 3 in cluster H**

**LTANKS S106702550
N/A**

**Relative:
Higher**

LTANKS:
Site ID: 65335
Spill No: 0405173
Spill Date: 8/11/2004
Spill Cause: Tank Overfill

**Actual:
10 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOUSE (Continued)

S106702550

Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/3/2004
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 8/11/2004
CID: 444
Water Affected: Not reported
Spill Notifier: Local Agency
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/11/2004
Spill Record Last Update: 9/3/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: FIREDISAPTCH
Spiller Phone: (718) 965-8300
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 62780
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "KRIMGOLD"8/11/2004 Sangesland spoke to NYC FD shortly after they left the scene. Building is a Deli on the ground floor with apartments above it on corner of East 27th St. Building owner's name is "Bella" - no contact info available.FD says they have been to this address several times. Two-275 gal oil tanks in the basement, no longer in use (building on gas). Over time these tanks have rotted and began to leak. 3 days ago FD was on site and put a temp patch on one tank and cleaned a spill up with speedie dry. Today they were called back by the Deli owner to find the tank was leaking again. FD pumped out most of the oil in the leaking tank (only sludge left). Tank is no longer leaking, but the basement is a mess and needs to be properly cleaned. Both tanks should be removed. Sangesland tracked down the owner by NYC tax records as:Belle Goldstein & Helen Kleinlatzaddress: 10 Sandy Lane, Greenwich, CT 06831 - No phone listed.8/11/04. J.Krimgold @ site. Strong oil smell in the Deli. In basement oil/water stained half of the basement. 2x275 gal tanks are still in the basement and bottom of tanks covered with a speedy-dry. Also contaminated debris in the upper right hand corner of the basement. Strong oil odor throughout the basement. Pictures taken.Additional info:5 (ask Vera) or cell # 646-436-4196.Building owner: Ms. Belle Goldstein (home: 203-869-0045; work: 212-807-7943)address: 115 East 61st Street, NY, NY 100218/12/04. J.Krimgold spoke to Ms. Goldstein. She informed that she hired a contractor Bell Fuel Co. (718-256-3824 ask Mike) to remove tanks and to cleanup basement.8/13/04. J.Krimgold spoke to Mike (Bell Fuel). He stated that tanks were emptied from sludge, cut in pieces and removed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOUSE (Continued)

S106702550

Remarks: from basement. Non-Haz. Waste Manifest will be submitted to the Department.8/20/04 - AUSTIN - I CONDUCTED AN INSPECTION OF THE BASEMENT AT THIS LOCATION TODAY TO ASCERTAIN THE PROGRESS OF CLEANUP. MET WITH BELLE AND MICHAEL GOLDSTEIN -TANKS HAD BEEN REMOVED, AND THERE WERE ONLY MINOR OIL STAINS ON FLOOR - FLOOR WAS CLEAN AND COMPLETE WHERE TANKS HAD BEEN - BASEMENT HAD ALL DEBRIS REMOVED, AND WAS BROOM SWEEP - THREE BAGS OF CONTAMINATED DEBRIS WERE LEFT - BELLE INDICATED THAT OTHER DEBRIS (FURNITURE AND OTHER HARD ITEMS) WERE REMOVED BY A PRIVATE CARTER) - SUMP HOLES IN BASEMENT WERE FILLED IN WITH CONCRETE, BUT WERE SINKING - BELLE INDICATED THAT NO OIL HAD BEEN IN THESE SUMP, OR ON THE DEBRIS REMOVED - WENT UPSTAIRS TO DELI, AND FOUND NO EVIDENCE OF VAPORS IN THAT AREA - MINOR VAPORS IN BASEMENT - WILL DISCUSS WITH KRIMGOLD WHEN HE RETURNS TO OFFICE, TO SEE ORIG. PHOTOS AND STATE OF OTHER DEBRIS REMOVED BY CARTER, IN ORDER TO DETERMINE IF SPILL CAN BE CLOSED -END 9/3/04 -AUSTIN - REVIEWED PHOTOS TAKEN BY J. KRIMGOLD - ALL TRASH AND DEBRIS REMOVED - OTHER THAN OIL MATERIAL ON FLOOR, DEBRIS DOES NOT HAVE ANY STAINS, ETC. INDICATING OIL CONTAMINATION - SPILL CLOSED - END FIREDEPT. ON SCENE AND NO FURTHER DETAILS AVAILABLE

Material:

Site ID: 65335
Operable Unit ID: 888581
Operable Unit: 01
Material ID: 489225
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 65
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 65336
Spill No: 0405293
Spill Date: 8/13/2004
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 8/16/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOUSE (Continued)

S106702550

Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 8/13/2004
CID: 403
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/13/2004
Spill Record Last Update: 8/16/2004
Spiller Name: BELLA KLEINPLATZ
Spiller Company: Not reported
Spiller Address: 2701 AVE Z
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: BELLA KLEINPLATZ
Spiller Phone: (212) 371-6209
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 62780
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"KRIMGOLD"Duplicate to spill #0405173
Remarks: tank had holes in it. they removed the 2 tanks there and cleaned up
the spill

Material:

Site ID: 65336
Operable Unit ID: 888081
Operable Unit: 01
Material ID: 489399
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 65336
Operable Unit ID: 888081
Operable Unit: 01
Material ID: 489400
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HOUSE (Continued)

S106702550

Oxygenate: False

Tank Test:

Site ID: Not reported

Spill Tank Test: Not reported

Tank Number: Not reported

Tank Size: Not reported

Test Method: Not reported

Leak Rate: Not reported

Gross Fail: Not reported

Modified By: Not reported

Last Modified: Not reported

Test Method: Not reported

33
South
1/8-1/4
0.127 mi.
669 ft.

PUBLIC SCHOOL 52 - BROOKLYN
2675 EAST 29TH STREET
BROOKLYN, NY 11235

LTANKS
UST
HIST UST

U001839948
N/A

Relative:
Higher

Actual:
11 ft.

LTANKS:

Site ID: 350910

Spill No: 0505813

Spill Date: 8/11/2005

Spill Cause: Tank Test Failure

Spill Source: Institutional, Educational, Gov., Other

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/9/2009

Facility Addr2: Not reported

Cleanup Ceased: Not reported

Cleanup Meets Standard: True

SWIS: 2401

Investigator: AXDORONO

Referred To: NFA

Reported to Dept: 8/11/2005

CID: 444

Water Affected: Not reported

Spill Notifier: Other

Last Inspection: Not reported

Recommended Penalty: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 8/11/2005

Spill Record Last Update: 6/9/2009

Spiller Name: CHRIS GORGA

Spiller Company: SCHOOL

Spiller Address: 2675 EAST 29TH STREET

Spiller City,St,Zip: BROOKLYN, NY

Spiller County: 001

Spiller Contact: CHRIS GORGA

Spiller Phone: (646) 772-1404

Spiller Extention: Not reported

DEC Region: 2

DER Facility ID: 297870

DEC Memo: 04/13/06- Case was transferred from Jake Krimgold to Koon

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

Tang.

-----02/01/07: Reassigned to Chanda.03/29/07:Kartik Chanda of DEC has reviewed all documents regarding this spill case. On 3/29/07, Chanda sent a letter to James Merlo, Board of Education, requiring that the following information be submitted to the DEC for review by May 14, 2007.1. An explanation of the cause of the tank system failure;2. Either a description of the work performed to restore the integrity of the tank system (including retesting results), or a description of the work performed to close (decommission) the tank;3. Information regarding petroleum contamination found at the site and cleanup activities (if any) associated with a release from this tank system;4. Any available documentation (i.e., invoices, bills, sampling analysis reports, etc.) pertaining to the work performed at this site associated with this violation.5/1/07: Chanda received a letter with a certificate of an affidavit for the temporary abandonment of the tank from James Merlo, Manager fuel division, NYC Board of Education.5/21/07: Chanda sent a letter to James Merlo(Department of education), requiring that the following as per DER-10 Technical Guidance for Site Characterization and Remedial Investigation pursuant to section 3.9.3:1. Collection of six soil samples from abandoned tank field.2. Collection of ground water samples.3. Collection of soil samples from piping runs.Therefore, an investigation summary report be submitted to the DEC for review by July 20, 2007.5/29/07: Chanda has received a letter from James Merlo, NYC Department of Education and has the following comment:Based upon this letter, the NYC Department of Education informed to DEC that this investigation work has been raftered to the NYC School Construction Authority.5/30/07: Chanda sent a letter to Ms. Lee Guterman, NYCSCA, requiring that An Investigation Summary Report be submitted to DEC for review by July 30, 2007.6/18/07: Chanda received an Underground Storage Tank Storage investigation report from NYC School Construction Authority (NYCSCA), prepared by The Louis Berger Group, Inc., dated May 1, 2006.8/7/07: Chanda reviewed the Underground storage tank investigation report. This report showed that the results of the testing revealed Tank # 1 failed and tank #2 passed. Chanda sent a letter to Ms. Lee Guterman, NYCSCA requiring that an USTs closure report and PBS registration be submitted to the Department for review with following conditions:1.According to DER-10 Technical Guidance for UST closure, section 5.5, as a first priority during UST closure, contaminants in all media should be removed, treated, contained and/or stabilized to prevent future movement of contaminants through any pathway.2. Removal of the tank and excavation of associated contamination is the preferred method. Abandonment in place should only be considered when the physical constraints of the site prevent the safe excavation of an underground tank.3. Petroleum Bulk Storage (PBS) Registration: According to Petroleum Bulk storage Registrations 6 NYCRR 612.2 (a) "the owner of any petroleum storage facility having a capacity of over eleven hundred (1,100) gallons must register the facility with the Department. This shall include any out-of-service facility which has not been permanently closed." As per PBS regulation, within thirty (30) days prior to substantially modifying a facility, the owner must notify the Department of such modification.11/7/07: Chanda called Mr. Drew Pardus (NYCSCA) to get updated information regarding the USTs Closure Report at this site. He Stated that NYSKA is preparing specifications to abandon the USTs in place in accordance with the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

applicable laws, rules, standards and guidance. NYSCA will submit a PBS registration when the USTs are closed.12/31/07: On 12/6/07, Chanda received an email(see edoc) from Ms. Lee Guterman, NYCSCA. She stated that "Specs have been prepared for the UST Closure and the field activities are anticipated to commence in approximately mid 2008. After the closure activities are complete, a Closure Report will be prepared and submitted to DEC".2/15/08: Chanda called NYCSCA and left message to get update information regarding the Tank Closure Report for this spill site.2/21/08: Chanda received a call from NYCSCA (Mr. Pardus). He stated that they have a plan to submit the UST Closure report in April 2008.7/21/08: Chanda received a letter with several documents dated 7/18/08 from Action Remediation, Inc. The letter stated that two-5000-gallon #6 fuel oil USTs were cleaned and both tanks were completely filled with concrete slurry. (see eDocs)7/23/08: Chanda sent an email to NYCSCA (Drew Pardus) requiring that a UST Closure Report be submitted to DEC for review and approval.7/23/08: Chanda received an email from NYCSCA (Drew Pardus)regarding this spill site. He stated that NYCSCA will have a UST Closure Report prepared and submitted to DEC. (see eDocs)10/17/08: Chanda received a Tank Closure Report from NYCSCA dated 6/16/08. The Tank Closure Report indicated the abandonment of two 5,000-gallon underground storage tanks at PS 52K. This report did not show the soil and groundwater conditions at the site. The Department has not received any soil and groundwater investigation report or data to evaluate the impact of soil and groundwater contamination on and of site. Based of the above region, the NYCSCA request for No Further Action letter is denied at this time. (Chanda)10/23/08: A meeting was held on 10/21/08 among DER staff, the NYCSCA representative to discuss the site status and updated information for this site. The meeting's consensus was that the NYCSCA will submit a letter with an addendum of a tank closure report to DEC by 12/31/08 for review.05/13/2009: This spill case was transferred to A. Doronova. - ADReviewed the file. Two 5,000-gallon No. 6 fuel oil USTs were pumped out, pressure washed and cleaned. Both tanks were inspected and were found to be in good condition with no signs of hooles or corrosion. These tanks were in solid concrete vault. USTs were filled with concrete slurry. All supply and return piping were removed. All vent lines and remote fill pipes were cut at grade and filled with concrete slurry. Four soil borings were advanced, temporary well points were installed in two borings. No detectable concentrations of VOC and SVOC (except Benzo(a) pyrene) were present in all soil samples. No VOCs or SVOCs exeeding the TOGS standards were detected. The requested addendum of tank closure report was submitted. AD06/04/2009: Discussed the site with J. Kolleeny of DER. Based on the data provided, decision was made to close the case. AD06/05/2009: Issued NFA letter. AD06/09/2009: Completed eDocs file for the site with missing reports. Closed the spill. AD

Remarks:

TANK WAS NOT HOLDING VAC

Material:

Site ID: 350910
Operable Unit ID: 1108450
Operable Unit: 01
Material ID: 2098390
Material Code: 0001A
Material Name: #2 Fuel Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

UST:

Facility Id: 2-355887
Region: STATE
DEC Region: 2
Site Status: Unregulated
Program Type: PBS
Expiration Date: N/A
UTM X: 589652.7724699997
UTM Y: 4493544.8088300005

Affiliation Records:

Site Id: 17754
Affiliation Type: Owner
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: Not reported
Address1: 44-36 VERNON BOULEVARD
Address2: Not reported
City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 7/12/2012

Site Id: 17754
Affiliation Type: Mail Contact
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: JAMES A. MERLO
Address1: FIELD OPERATIONS-FUEL DIVISION
Address2: 44-36 VERNON BOULEVARD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: JMERLO@SCHOOLS.NYC.GOV
Fax Number: Not reported
Modified By: dxliving
Date Last Modified: 9/2/2008

Site Id: 17754
Affiliation Type: On-Site Operator
Company Name: PUBLIC SCHOOL 52 - BROOKLYN
Contact Type: Not reported
Contact Name: PLANT OPERATIONS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 349-5400
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 17754
Affiliation Type: Emergency Contact
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: SCHOOL SAFETY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 935-3300
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: GDBREEN
Date Last Modified: 10/1/2012

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
C03 - Pipe Location - Aboveground/Underground Combination
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
G00 - Tank Secondary Containment - None
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)

Tank Info:

Site ID: 17754

Tank Number: 001
Tank ID: 34703
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 5000
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: 06/07/2008
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 07/05/2000
Register: True
Modified By: NRLOMBAR
Last Modified: 06/17/2008

Site ID: 17754

Tank Number: 002
Tank ID: 34704
Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 5000
Tightness Test Method: 21
Next Test Date: Not reported
Date Tank Closed: 06/07/2008
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 05/26/2005
Register: True
Modified By: NRLOMBAR
Last Modified: 06/17/2008

HIST UST:

PBS Number: 2-355887
SPDES Number: Not reported
Emergency Contact: SCHOOL SAFETY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

Emergency Telephone: (212) 979-3300
Operator: PLANT OPERATION
Operator Telephone: (718) 391-6000
Owner Name: CITY OF NEW YORK C/O BOARD OF EDUCATION
Owner Address: 28-11 QUEENS PLAZA NORTH
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Owner Telephone: (718) 391-6832
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: BOARD OF EDUCATION
Mailing Address: 28-11 QUEENS PLAZA NORTH
Mailing Address 2: 5TH FLOOR
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Contact: FRANK CARDELLO NTROL
Mailing Telephone: (718) 391-6832
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Addr2: Not reported
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: SCHOOL
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 07/21/2000
Expiration Date: 06/28/2003
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 10000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: No Missing Data
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Painted/Asphalt Coating

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PUBLIC SCHOOL 52 - BROOKLYN (Continued)

U001839948

Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 07/05/2000
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: 21
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: Painted/Asphalt Coating
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 07/05/2000
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: 21
Deleted: False
Updated: True
Lat/long: Not reported

**34
NW
1/8-1/4
0.129 mi.
681 ft.**

**TSIGEL HOME
2432 EAST 28TH STREET
BROOKLYN, NY**

**NY Spills S103484776
NY Hist Spills N/A**

**Relative:
Higher**

SPILLS:

**Actual:
10 ft.**

Facility ID: 9807855
DER Facility ID: 172961
Facility Type: ER
Site ID: 254809
DEC Region: 2
Spill Number: 9807855
Spill Date: 9/27/1998
Spill Cause: Human Error
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 2/19/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TSIGEL HOME (Continued)

S103484776

SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 9/28/1998
CID: 205
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/28/1998
Spill Record Last Update: 2/19/2003
Spiller Name: Not reported
Spiller Company: HILL MANAGEMENT
Spiller Address: 29 CHURCH AVENUE
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: CALLER
Contact Phone: (718) 743-9183
DEC Memo: Not reported
Remarks: CALLER REPORTED PLUMBER WHO WORKS FOR MANAGEMENT WORKING ON WATER PIPE, BROKE FUEL LINE.MANAGEMENT HAS DONE NOTHING FOR SPILL.RESIDENT AND FAMILY FEEL ILL FROM FUMES.

Material:

Site ID: 254809
Operable Unit ID: 1069032
Operable Unit: 01
Material ID: 315397
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 300
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 0109762

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TSIGEL HOME (Continued)

S103484776

DER Facility ID: 172961
Facility Type: ER
Site ID: 323561
DEC Region: 2
Spill Number: 0109762
Spill Date: 1/8/2002
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/22/2010
SWIS: 2401
Investigator: RVKETANI
Referred To: Not reported
Reported to Dept: 1/8/2002
CID: 196
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1/8/2002
Spill Record Last Update: 7/22/2010
Spiller Name: MARK SALAMACK
Spiller Company: TSIGEL HOME
Spiller Address: 2432 EAST 28 STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: MARK SALAMACK
Contact Phone: (718) 272-2800
DEC Memo: Prior to TIPPLE, Lead DEC Field was Rossan/SangeslandSpill 0109793, DEC lead Rossan, closed and consolidated into spill 0109762. DESpill 9807855, DEC lead Tomasello, 300 gallons of #2 fuel oil spilled, closed 02/19/2003, occurred at the same address. DEPrior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE" CALLED ABC-TANKS AT 1749 HRS. ON 1/8/02, LEFT MESSAGE WITH MACHINE. CALLED HOMEOWNER, AT 1756 HRS. PHONE RING OUT. CALLED STEVE, 1759 HRS. FOR UP-DATE. ABC-TANKS CALLED 2020 HRS. ON 1/8/02 TO CONFIRM THAT CLEAN-UP IS COMPLETED. CALLED STEVE AT 2029 TO INFORM HIM ABOUT THE CLEAN-UP. CALLED MARK SALAMACK, ABC-TANKS, ON 1/9/02 AT 1000 HRS. WHO CONFIRMED THAT CLEAN-UP IS COMPLETED. HOWEVER, HE DID INDICATE THAT PERSONAL BELONGINGS WHICH ARE IN THE BASEMENT, MUST BE DISPOSED OF. CALLED HOMEOWNER, AT 1120 HRS. BUT PHONE KEEP RINGING-OUT. CALLED ABC-TANKS TO CONFIRM HOMEOWNER PHONE NO. THEY ARE NOT SURE HOW TO CONTACT HOMEOWNER. THIS SPILL WAS CALLED IN AGAIN ON 1/9/02 AT 1709 HRS. CALLED THE CONTACT, (718)743-9183), WHO CONFIRMED THAT THE ARE OIL FUMES IN BUILDING. THEY ARE THE TENNANTS. ASKED, HOW TO CONTACT HOMEOWNER. NO ONE KNOWS. ASKED, TO WHOM DO YOU PAY RENT. ANSWER: SOME MAN, WHO TAKES THE MONEY TO HOME OWNER. CALLED STEVE AND ASK TO HELP CONTACT HOMEOWNER. Michelle Tipple made a site visit. Old man who lived in the basement would not throw out his stuff even though it all was soaked in oil. Mark Salamack at ABC Tank said the basement was totally covered in oil at least 1" deep.01/10/2002 Another spill was called in from the same location by the renter of the house Mrs.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TSIGEL HOME (Continued)

S103484776

Graziano. She stated that the FDNY was on scene and the cleanup was not complete. A site visit confirmed that the cleanup was only started. After speaking to Carmine from Tiffany Oil I was assured that the oil soaked debris including the base of the saturated wallboard be removed, floor tiles removed, and the floor be powerwashed. 12/08/05 Resident's phone number no longer in service.03/29/06 Recommended next: visit site, inspect basement. New residents: Sofiya Tsigel (718) 332-7627, and Yekaterina Tsigel (718) 332-5884.Austin - 9/30/09 - Spill project assignment transferred from Albany staff(DJEATON) to Vought, for further review and action. - end6/11/10-Vought-Spill transferred from DEC Vought to DEC Ketani as per DEC Austin and Vought transfer to Section A.7/16/10 - Raphael Ketani. A 100 gal. #2 oil spill took place on 1/8/02. The oil was coming out through the bottom of the tank. PTC cleaned up the spill. There are no E-docs, nor a paper files. I tried to contact Sofiya and Yekaterina Tsigel, but I could only leave messages.7/19/10 - Raphael Ketani. Vadim Tsigel (917) 520-5693 called me today. He said that he is the owner of the private home, along with his wife Catherine, his sister and her husband. He said that he never heard of an oil spill taking place at the home. There were two tanks, but they were removed long ago. They bought the home years ago. Mr. Tsigel said that everything looks alright in the basement. I told him that back in 2002 there was a 100 gal. oil spill. I asked him whether he had any paperwork from the cleanup of the oil spill. He said that his sister keeps the paperwork for the home, but they have nothing regarding the oil spill. I asked him whether I can visit the basement of the home. Mr. Tsigel agreed and we set up an appointment for thursday 10AM on 7/22/10. 7/22/10 - Raphael Ketani. I made the site visit as scheduled. I saw a cemented fill port (see E-docs). I met Mr. Tsigel and Ms. Tsigel. They showed me the former tank room. The room is now an under the stairs store room. The floor looked clean and in good condition. The PID meter registered 115 ppb of total vapors at the first floor level of this two level attached home. The finished basement had 138 ppb of vapors. The air was warm and stagnant here. I could see that the main living area had been recently painted. Mr. Tsigel told me that the room had been painted a year ago. The wallboard also looked like recent construction. Mr. Tsigel said that he never knew that there had been a spill. As there were signs of a spill, I ended my inspection and left.As my inspection on the above date revealed that there were no apparent impacts to the site from the spill, I have determined that there is no threat to people or the environment. Therefore, I am closing the spill case.

Remarks:

CALLER STATES THAT DURING A FILL OF THE TANK BY THE OIL CO.THE BOTTOM OF THE OIL TANK STARTED TO LEAK CLEAN UP IN PROCESS

Material:

Site ID: 323561
Operable Unit ID: 848125
Operable Unit: 01
Material ID: 527411
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 100
Units: Gallons
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TSIGEL HOME (Continued)

S103484776

Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9807855
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/27/1998 12:00
Reported to Dept Date/Time: 09/28/98 09:31
SWIS: 61
Spiller Name: HILL MANAGEMENT
Spiller Contact: Not reported
Spiller Phone: (718) 972-4500
Spiller Contact: CALLER
Spiller Phone: (718) 743-9183
Spiller Address: 29 CHURCH AVENUE
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TSIGEL HOME (Continued)

S103484776

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/28/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/20/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 300
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

DEC Remarks: Not reported

Remark: CALLER REPORTED PLUMBER WHO WORKS FOR MANAGEMENT WORKING ON WATER PIPE, BROKE FUEL LINE.MANAGEMENT HAS DONE NOTHING FOR SPILL.RESIDENT AND FAMILY FEEL ILL FROM FUMES.

G35
North
1/8-1/4
0.152 mi.
804 ft.

ROSE SHARON DRY CLEANING CORP
3696 NOSTRAND AVE
BROOKLYN, NY 11235

RCRA-NonGen **1000198555**
FINDS **NYD981077506**
MANIFEST

Site 3 of 3 in cluster G

Relative:
Higher

RCRA-NonGen:

Date form received by agency: 01/01/2007
Facility name: ROSE SHARON DRY CLEANING CORP
Facility address: 3696 NOSTRAND AVE
BROOKLYN, NY 11235

EPA ID: NYD981077506
Mailing address: NOSTRAND AVE
BROOKLYN, NY 11235

Contact: Not reported
Contact address: NOSTRAND AVE
BROOKLYN, NY 11235

Contact country: US
Contact telephone: Not reported
Contact email: Not reported

EPA Region: 02
Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Owner/operator country: NOT REQUIRED, WY 99999
US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999

Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: ROSE SHARON DRY CLEANING CORP
Classification: Not a generator, verified

Date form received by agency: 04/06/1995
Facility name: ROSE SHARON DRY CLEANING CORP
Classification: Not a generator, verified

Date form received by agency: 04/15/1985
Facility name: ROSE SHARON DRY CLEANING CORP
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004394682

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD981077506
Country: USA
Mailing Name: ROSE & SHARON DRY CLNRS
Mailing Contact: ROSE & SHARON DRY CLNRS
Mailing Address: 3696 NOSTRAND AVENUE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-648-9400

Document ID: NYA6917725
Manifest Status: Completed copy
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 871201
Trans1 Recv Date: 871201
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871201
Part A Recv Date: 871204
Part B Recv Date: 871209
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87

Document ID: NYA6860981
Manifest Status: Completed copy
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 871104
Trans1 Recv Date: 871104
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871104
Part A Recv Date: 871110
Part B Recv Date: 871110
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87

Document ID: NYC0211623
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900424
Trans1 Recv Date: 900424
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900424
Part A Recv Date: 900613
Part B Recv Date: 900503
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0421233
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900612
Trans1 Recv Date: 900612
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900612
Part A Recv Date: 900730
Part B Recv Date: 900625
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Year: 90

Document ID: NYC0365321
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 900713
Trans1 Recv Date: 900713
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900713
Part A Recv Date: 900821
Part B Recv Date: 900730
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0749114
Manifest Status: Completed copy
Trans1 State ID: LP3931NY
Trans2 State ID: Not reported
Generator Ship Date: 910222
Trans1 Recv Date: 910222
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910222
Part A Recv Date: 910305
Part B Recv Date: 910313
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC2503675
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: DF2859NY
Trans2 State ID: Not reported
Generator Ship Date: 930824
Trans1 Recv Date: 930824

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Trans2 Recv Date: Not reported
TSD Site Recv Date: 930824
Part A Recv Date: 931015
Part B Recv Date: 930923
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93

Document ID: NYA6819142
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 871002
Trans1 Recv Date: 871002
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871002
Part A Recv Date: 871112
Part B Recv Date: 871008
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87

Document ID: NYC0571206
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 901030
Trans1 Recv Date: 901030
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901030
Part A Recv Date: 901108
Part B Recv Date: 901109
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0615791
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NYAM6252
Trans2 State ID: Not reported
Generator Ship Date: 901126
Trans1 Recv Date: 901126
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901126
Part A Recv Date: 901231
Part B Recv Date: 901220
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYC0699287
Manifest Status: Completed copy
Trans1 State ID: AM6252NY
Trans2 State ID: Not reported
Generator Ship Date: 910123
Trans1 Recv Date: 910123
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910123
Part A Recv Date: 910208
Part B Recv Date: 910131
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Document ID: NYC2677680
Manifest Status: Completed copy
Trans1 State ID: AY9381NY
Trans2 State ID: Not reported
Generator Ship Date: 931119
Trans1 Recv Date: 931119
Trans2 Recv Date: Not reported
TSD Site Recv Date: 931119
Part A Recv Date: 931207
Part B Recv Date: 931203
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 93

Document ID: NYC2946418
Manifest Status: Completed copy
Trans1 State ID: DF2859NY
Trans2 State ID: Not reported
Generator Ship Date: 940328
Trans1 Recv Date: 940328
Trans2 Recv Date: Not reported
TSD Site Recv Date: 940328
Part A Recv Date: 940411
Part B Recv Date: 940405
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 94

Document ID: NYC4412834
Manifest Status: Completed copy
Trans1 State ID: GF2859NY
Trans2 State ID: M0001
Generator Ship Date: 970103
Trans1 Recv Date: 970103
Trans2 Recv Date: 970108
TSD Site Recv Date: 970109
Part A Recv Date: 970121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Part B Recv Date: 970124
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: MOD095038998
TSD ID: OHD980587364
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 97

Document ID: NYA8616418
Manifest Status: Completed copy
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 871229
Trans1 Recv Date: 871229
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871229
Part A Recv Date: 880104
Part B Recv Date: 880104
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 87

Document ID: NYA8714586
Manifest Status: Completed copy
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 880224
Trans1 Recv Date: 880224
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880224
Part A Recv Date: 880229
Part B Recv Date: 880303
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88

Document ID: NYA8816196
Manifest Status: Completed copy
Trans1 State ID: NY16549GW
Trans2 State ID: Not reported
Generator Ship Date: 880322
Trans1 Recv Date: 880322
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880322
Part A Recv Date: 880329
Part B Recv Date: 880329
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100
Year: 88

Document ID: NYC0905152
Manifest Status: Completed copy
Trans1 State ID: AP4503NY
Trans2 State ID: Not reported
Generator Ship Date: 910417
Trans1 Recv Date: 910417
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910417
Part A Recv Date: 910503
Part B Recv Date: 910425
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSDF ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC1122748
Manifest Status: Completed copy
Trans1 State ID: AM6252NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROSE SHARON DRY CLEANING CORP (Continued)

1000198555

Trans2 State ID: Not reported
Generator Ship Date: 910809
Trans1 Recv Date: 910809
Trans2 Recv Date: Not reported
TSD Site Recv Date: 910809
Part A Recv Date: 910823
Part B Recv Date: 910820
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 91

Document ID: NYC3111445
Manifest Status: Completed copy
Trans1 State ID: DF2859NY
Trans2 State ID: Not reported
Generator Ship Date: 940622
Trans1 Recv Date: 940622
Trans2 Recv Date: Not reported
TSD Site Recv Date: 940622
Part A Recv Date: 940708
Part B Recv Date: 940630
Generator EPA ID: NYD981077506
Trans1 EPA ID: ILD984908202
Trans2 EPA ID: Not reported
TSD ID: NYD980785760
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 94

[Click this hyperlink](#) while viewing on your computer to access
35 additional NY_MANIFEST: record(s) in the EDR Site Report.

I36
NNE
1/8-1/4
0.155 mi.
818 ft.

NYC P.S. #14
24-24 BATCHELDER AVE
BROOKLYN, NY
Site 1 of 2 in cluster I

LTANKS S104621527
HIST LTANKS N/A

Relative:
Higher

LTANKS:
Site ID: 329161
Spill No: 0001390
Spill Date: 5/3/2000
Spill Cause: Tank Test Failure

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYC P.S. #14 (Continued)

S104621527

Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 1/15/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 5/4/2000
CID: 312
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 5/4/2000
Spill Record Last Update: 1/15/2004
Spiller Name: Not reported
Spiller Company: NYC SCHOOL DISTRICT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: FRANK CARDELLO
Spiller Phone: (718) 391-6832
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 264896
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"TIPPLE"1/15/04 tippie closed this number and referred the spill to
01-01806
Remarks: GROSS LEAK

Material:
Site ID: Not reported
Operable Unit ID: Not reported
Operable Unit: Not reported
Material ID: Not reported
Material Code: Not reported
Material Name: Not reported
Case No.: Not reported
Material FA: Not reported
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

Tank Test:
Site ID: 329161
Spill Tank Test: 1525552
Tank Number: 002
Tank Size: 10000
Test Method: 03

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYC P.S. #14 (Continued)

S104621527

Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

HIST LTANKS:

Region of Spill: 2
Spill Number: 0001390
Spill Date: 05/03/2000
Spill Time: 10:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 05/04/00
Reported to Department Time: 09:30
SWIS: 61
Spiller Contact: FRANK CARDELLO
Spiller Phone: (718) 391-6832
Spiller Extention: Not reported
Spiller Name: NYC SCHOOL DISTRICT
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-356050
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/04/00
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/04/00
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYC P.S. #14 (Continued)

S104621527

Tank:

PBS Number: Not reported
Tank Number: 002
Tank Size: 10000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
PBS Number: Not reported
Tank Number: 002
Tank Size: 10000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Not reported
Quantity Spilled: Not reported
Unkonwn Quantity Spilled: Not reported
Units: Not reported
Quantity Recovered: Not reported
Unkonwn Quantity Recovered: Not reported
Material: Not reported
Class Type: Not reported
Times Material Entry In File: Not reported
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Spill Cause: GROSS LEAK

J37
ENE
1/8-1/4
0.157 mi.
830 ft.

2525 BATCHELDER ST
BROOKLYN, NY
Site 1 of 5 in cluster J

LTANKS S105135061
HIST LTANKS N/A

Relative:
Higher

LTANKS:

Actual:
9 ft.

Site ID: 115387
Spill No: 0104911
Spill Date: 8/7/2001
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/10/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 8/7/2001
CID: 382
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105135061

Date Entered In Computer: 8/7/2001
Spill Record Last Update: 2/10/2003
Spiller Name: JEFF FREEDMAN
Spiller Company: Not reported
Spiller Address: 2525 BATCHELDER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: JEFF FREEDMAN
Spiller Phone: (212) 268-9060
Spiller Extension: Not reported
DEC Region: 2
DER Facility ID: 100548
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"7/17/2002-VOUGHT- Jeff Friedman (manager of coop) 212-268-9060 x2251: Hired Aggressive Heating to remove and replace tank with AST. Must move boiler to install AST. Tank is empty. NYSDEC should receive proposal by 9/17/2002.1/22/2003-Vought-Spoke with Mark Robbins. Soil samples and groundwater samples obtained from around tank. Also included adjacent 15000 gal UST in investigation. Owner intends to abandon in place. Soil and groundwater samples initially appear clean. Report will be sent to Sangesland by 1/31.2/10/2003 Sangesland reviewed a report from Mark Robbins - Hydro Tech Environmental, Corp. Report shows several geo probe soil samples and several geo probe water samples around a tank. All results for this work show VOC and SVOC levels below TAGM limits. Spill Closed
Remarks: tank was not in service at time of the testing.

Material:

Site ID: 115387
Operable Unit ID: 841665
Operable Unit: 01
Material ID: 533391
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 115387
Spill Tank Test: 1526510
Tank Number: Not reported
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 115387

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105135061

Spill No: 0104911
Spill Date: 8/7/2001
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/10/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 8/7/2001
CID: 382
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/7/2001
Spill Record Last Update: 2/10/2003
Spiller Name: JEFF FREEDMAN
Spiller Company: Not reported
Spiller Address: 2525 BATCHELDER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: JEFF FREEDMAN
Spiller Phone: (212) 268-9060
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 100548
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"SANGESLAND"7/17/2002-VOUGHT- Jeff Friedman (manager of coop)
212-268-9060 x2251: Hired Aggressive Heating to remove and replace
tank with AST. Must move boiler to install AST. Tank is empty. NYSDEC
should receive proposal by 9/17/2002.1/22/2003-Vought-Spoke with Mark
Robbins. Soil samples and groundwater samples obtained from around
tank. Also included adjacent 15000 gal UST in investigation. Owner
intends to abandon in place. Soil and groundwater samples initially
appear clean. Report will be sent to Sangesland by 1/31.2/10/2003
Sangesland reviewed a report from Mark Robbins - Hydro Tech
Environmental, Corp. Report shows several geo probe soil samples and
several geo probe water samples around a tank. All results for this
work show VOC and SVOC levels below TAGM limits. Spill Closed
Remarks: tank was not in service at time of the testing.

Material:
Site ID: 115387
Operable Unit ID: 841665
Operable Unit: 01
Material ID: 533391
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105135061

Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 115387
Spill Tank Test: 1526510
Tank Number: Not reported
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 115387
Spill No: 0104911
Spill Date: 8/7/2001
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/10/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 8/7/2001
CID: 382
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 8/7/2001
Spill Record Last Update: 2/10/2003
Spiller Name: JEFF FREEDMAN
Spiller Company: Not reported
Spiller Address: 2525 BATCHELDER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: JEFF FREEDMAN
Spiller Phone: (212) 268-9060
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 100548
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"SANGESLAND"7/17/2002-VOUGHT- Jeff Friedman (manager of coop)
212-268-9060 x2251: Hired Aggressive Heating to remove and replace
tank with AST. Must move boiler to install AST. Tank is empty. NYSDEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105135061

Remarks: should receive proposal by 9/17/2002.1/22/2003-Vought-Spoke with Mark Robbins. Soil samples and groundwater samples obtained from around tank. Also included adjacent 15000 gal UST in investigation. Owner intends to abandon in place. Soil and groundwater samples initially appear clean. Report will be sent to Sangesland by 1/31.2/10/2003 Sangesland reviewed a report from Mark Robbins - Hydro Tech Environmental, Corp. Report shows several geo probe soil samples and several geo probe water samples around a tank. All results for this work show VOC and SVOC levels below TAGM limits. Spill Closed tank was not in service at time of the testing.

Material:

Site ID: 115387
Operable Unit ID: 841665
Operable Unit: 01
Material ID: 533391
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 115387
Spill Tank Test: 1526510
Tank Number: Not reported
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

HIST LTANKS:

Region of Spill: 2
Spill Number: 0104911
Spill Date: 08/07/2001
Spill Time: 11:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SANGESLAND
Caller Name: Not reported
Caller Agency: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105135061

Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 08/07/01
Reported to Department Time: 13:05
SWIS: 61
Spiller Contact: JEFF FREEDMAN
Spiller Phone: (212) 268-9060
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: 2525 BATCHELDER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Cleanup Date: / /
Facility Contact: JEFF FREEDMAN
Facility Phone: (212) 268-9060
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/07/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 08/07/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 15000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: tank was not in service at time of the testing.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

J38
ENE
1/8-1/4
0.158 mi.
834 ft.

VAULT 1124
BATCHELDER ST/AVE Y
BROOKLYN, NY

NY Spills
NY Hist Spills

S105057219
N/A

Site 2 of 5 in cluster J

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 0101481
DER Facility ID: 177238
Facility Type: ER
Site ID: 213922
DEC Region: 2
Spill Number: 0101481
Spill Date: 5/8/2001
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/19/2001
SWIS: 2401
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 5/8/2001
CID: 382
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/8/2001
Spill Record Last Update: 6/20/2001
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Contact Name: RICHARD ROACH
Contact Phone: (212) 580-6764
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY"
Remarks: 2 oz oil on 200 gals water contained in mahole. clean up pending. con
ed 136-925

Material:

Site ID: 213922
Operable Unit ID: 840309
Operable Unit: 01
Material ID: 537188
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 1124 (Continued)

S105057219

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0101481
Investigator: FOLEY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/08/2001 10:00
Reported to Dept Date/Time: 05/08/01 11:33
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: RICHARD ROACH
Spiller Phone: (212) 580-6764
Spiller Address: Not reported
Spiller City,St,Zip: -
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/19/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/08/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/20/01
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 1124 (Continued)

S105057219

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: 2 o oil on 200 gals water contained in mahole. clean up pending. con ed 136-925

**J39
ENE
1/8-1/4
0.158 mi.
834 ft.**

**VAULT 3138
BATCHELDER ST/AVE Y
BROOKLYN, NY**

**NY Spills S106736595
N/A**

Site 3 of 5 in cluster J

**Relative:
Higher**

SPILLS:

Facility ID: 0410876
DER Facility ID: 177238
Facility Type: ER
Site ID: 335945
DEC Region: 2
Spill Number: 0410876
Spill Date: 1/4/2005
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/3/2005
SWIS: 2401
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 1/4/2005
CID: 404
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1/5/2005
Spill Record Last Update: 6/3/2005
Spiller Name: ERT DESK

**Actual:
9 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 3138 (Continued)

S106736595

Spiller Company: CON ED
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: ERT DESK
Contact Phone: (212) 580-8383
DEC Memo: e2mis no. 156769:1/04/2005 08:45 HRS.C. MURDAUGH # 18627 OF EQUIPMENT GROUP WHILE ON LOCATION FOR INSPECTION OF VS-3138 AT 08:35 HRS. FOUND APPROX. 1 GAL. UNKNOWN OIL ON APPROX. 900 GAL. WATER. SUMP PUMP FOUND UNPLUGGED. SPILL APPEARS TO BE CONTAINED. NO SEWERS OR WATERWAYS APPEAR TO BE AFFECTED. LIQUID SAMPLE TAKEN ON "E" PRIORITY TURNAROUND. CHAIN OF CUSTODY FORM # DD-01062 MARKED FOR 24-HOUR DEMINIMIS. UNABLE TO PRESSURE-TEST AT THIS TIME DUE TO AMOUNT OF WATER. CLEANUP PENDING PCB RESULTS AND PRESSURE TEST. ENV DESK SUPERVISOR D.HEARNS NOTIFIED EQUIPMENT GROUP TO HAVE CREW AVAILABLE ON 3PM-11PM SHIFT WITH ENV OPS TO REMOVE LIQUIDS PRIOR TO PRESSURE TEST.** TRANSFORMER INFORMATION FROM E.C.C. WAREHOUSE: Serial ID: 3415111, MFG Code: GE, KVA: 1000, Mfr Date: 01/01/1945, Install Date: 01/01/1973. HISTORICAL PCB INFO: SAMPLE DATE 12/21/2004, 10 PPM, LAB SEQ # 04-10726-004.1/04/2005 13:18 HRS. -- D. HEARNS SPOKE WITH ENV OPS O/S BRIAN BROWN AND REQUESTED THEY CLEAN STRUCTURE WHEN PCB RESULTS COME BACK AND LEAVE ENV STOP TAG IN PLACE PENDING PRESSURE TEST. HEARNS ALSO SPOKE WITH EQUIPMENT GROUP O/S GUY PALLADINO AND REQUESTED HE SEND CREW FIRST THING IN MORNING TO PRESSURE TEST TRANSFORMER. IF PRESSURE TEST PASSES, THEY WILL REMOVE ENV STOP TAG AND WILL CLOSE OUT INCIDENT.Lab Sequence Number: 05-00061-001 Date Approved: 1/04/2005TOTAL PCB < 1.0 ppmUPDATE 05-JAN-2005 12:45 HRS.ENVIR. OPER. MECH-A J.LOPRI EMP# 11179 REPORTS: ASTORIA TANKER REMOVED 1200 GAL'S OF LIQUID FROM STRUCTURE. NETWORK CREW PRESSURE TESTED UNIT & PASSED. ENVIR. CRREW THEN DBL. WASHED STRUCTURE WITH SLICKS. SUMP FOUND SEALED. ENVIR. TAG# 34900 HAS BEEN REMOVED CLEANUP COMPLETE 100%

Remarks: 1 gallon of petroleum on approx 900 gallons of water. #156769.

Material:

Site ID: 335945
Operable Unit ID: 1097995
Operable Unit: 01
Material ID: 578167
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 3138 (Continued)

S106736595

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

**J40
ENE
1/8-1/4
0.158 mi.
834 ft.**

**2520 BATCHELDER ST.
2520 BATCHELDER ST
NYC, NY

Site 4 of 5 in cluster J**

**LTANKS
HIST LTANKS**

**S100250784
N/A**

**Relative:
Higher**

**Actual:
9 ft.**

LTANKS:

Site ID: 213618
Spill No: 8805920
Spill Date: 10/12/1988
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 7/26/1993
Facility Addr2: Not reported
Cleanup Ceased: 7/26/1993
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 10/12/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/25/1988
Spill Record Last Update: 6/6/1995
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ARNOLD COHEN(CONTACT), ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 176981
DEC Memo: Not reported
Remarks: 2 15K TKS, GROSS LEAK. BERNIE PINKAS - DUTY OFFICER

Material:

Site ID: 213618
Operable Unit ID: 922806
Operable Unit: 01
Material ID: 457831
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2520 BATCHELDER ST. (Continued)

S100250784

Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 213618
Spill Tank Test: 1534750
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 213618
Spill No: 8805920
Spill Date: 10/12/1988
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 7/26/1993
Facility Addr2: Not reported
Cleanup Ceased: 7/26/1993
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 10/12/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/25/1988
Spill Record Last Update: 6/6/1995
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ARNOLD COHEN(CONTACT), ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 176981
DEC Memo: Not reported
Remarks: 2 15K TKS, GROSS LEAK. BERNIE PINKAS - DUTY OFFICER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2520 BATCHELDER ST. (Continued)

S100250784

Material:

Site ID: 213618
Operable Unit ID: 922806
Operable Unit: 01
Material ID: 457831
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 213618
Spill Tank Test: 1534750
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 213618
Spill No: 8805920
Spill Date: 10/12/1988
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 7/26/1993
Facility Addr2: Not reported
Cleanup Ceased: 7/26/1993
Cleanup Meets Standard: False
SWIS: 2401
Investigator: BATTISTA
Referred To: Not reported
Reported to Dept: 10/12/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/25/1988
Spill Record Last Update: 6/6/1995
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ARNOLD COHEN(CONTACT), ZZ

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2520 BATCHELDER ST. (Continued)

S100250784

Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 2
DER Facility ID: 176981
DEC Memo: Not reported
Remarks: 2 15K TKS, GROSS LEAK. BERNIE PINKAS - DUTY OFFICER

Material:

Site ID: 213618
Operable Unit ID: 922806
Operable Unit: 01
Material ID: 457831
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 213618
Spill Tank Test: 1534750
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 8805920
Spill Date: 10/12/1988
Spill Time: 14:00
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/26/93
Cleanup Ceased: 07/26/93
Cleanup Meets Standard: False
Investigator: BATTISTA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2520 BATCHELDER ST. (Continued)

S100250784

Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 10/12/88
Reported to Department Time: 21:30
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ARNOLD COHEN(CONTACT)
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 649-9080
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-281107
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/25/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/06/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: 07/26/93: VARSITY PLUMBING EXCAVATED, EXPOSED AND REPLACED ALL OIL TANK SUCTION RETURN, FILL ANLD PETROMETER LINE PIPING. RETESTED AND PASSED ON 8/16/89.
Spill Cause: 2 15K TKS, GROSS LEAK. BERNIE PINKAS - DUTY OFFICER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

J41
ENE
1/8-1/4
0.158 mi.
834 ft.

CO-OP BLDG
2520 BATCHELTER ST
BROOKLYN, NY

Site 5 of 5 in cluster J

LTANKS
HIST LTANKS
S103558219
N/A

Relative:
Higher

Actual:
9 ft.

LTANKS:

Site ID: 69538
Spill No: 9809607
Spill Date: 10/30/1998
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TJDMEIO
Referred To: Not reported
Reported to Dept: 10/30/1998
CID: 365
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1
Date Entered In Computer: 10/30/1998
Spill Record Last Update: 8/17/2012
Spiller Name: Not reported
Spiller Company: CO-OP BLDG
Spiller Address: 2520 BATCHELTER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: STEVEN HYATT - MANAGEMENT
Spiller Phone: (718) 332-0777
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 66104
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MULQUEEN"06/16/06: This spill is transferred from Mike Mulqueen to
Mr. Koon Tang.9/22/10 Transferred to b. falvey8/17/12 Spill
re-assigned to T. Demeo as per RSE. bf

Remarks:

TANKS 1&2 ARE MANIFESTED - 15000 GALLONS EACH

Material:

Site ID: 69538
Operable Unit ID: 1066857
Operable Unit: 01
Material ID: 313511
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CO-OP BLDG (Continued)

S103558219

Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 69538
Spill Tank Test: 1546470
Tank Number: 1&2
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: F
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 69538
Spill No: 9809607
Spill Date: 10/30/1998
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TJDEMEO
Referred To: Not reported
Reported to Dept: 10/30/1998
CID: 365
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1

Date Entered In Computer: 10/30/1998
Spill Record Last Update: 8/17/2012
Spiller Name: Not reported
Spiller Company: CO-OP BLDG
Spiller Address: 2520 BATCHELTER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: STEVEN HYATT - MANAGEMENT
Spiller Phone: (718) 332-0777
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 66104
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MULQUEEN"06/16/06: This spill is transferred from Mike Mulqueen to
Mr. Koon Tang.9/22/10 Transferred to b. falvey8/17/12 Spill
re-assigned to T. Demeo as per RSE. bf

Remarks: TANKS 1&2 ARE MANIFESTED - 15000 GALLONS EACH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CO-OP BLDG (Continued)

S103558219

Material:

Site ID: 69538
Operable Unit ID: 1066857
Operable Unit: 01
Material ID: 313511
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 69538
Spill Tank Test: 1546470
Tank Number: 1&2
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: F
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 69538
Spill No: 9809607
Spill Date: 10/30/1998
Spill Cause: Tank Test Failure
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TJDEMEO
Referred To: Not reported
Reported to Dept: 10/30/1998
CID: 365
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1
Date Entered In Computer: 10/30/1998
Spill Record Last Update: 8/17/2012
Spiller Name: Not reported
Spiller Company: CO-OP BLDG
Spiller Address: 2520 BATCHELTER ST
Spiller City,St,Zip: BROOKLYN, NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CO-OP BLDG (Continued)

S103558219

Spiller County: 001
Spiller Contact: STEVEN HYATT - MANAGEMENT
Spiller Phone: (718) 332-0777
Spiller Extension: Not reported
DEC Region: 2
DER Facility ID: 66104
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MULQUEEN"06/16/06: This spill is transferred from Mike Mulqueen to Mr. Koon Tang.9/22/10 Transferred to b. falvey8/17/12 Spill re-assigned to T. Demeo as per RSE. bf
Remarks: TANKS 1&2 ARE MANIFESTED - 15000 GALLONS EACH

Material:
Site ID: 69538
Operable Unit ID: 1066857
Operable Unit: 01
Material ID: 313511
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 69538
Spill Tank Test: 1546470
Tank Number: 1&2
Tank Size: 15000
Test Method: 03
Leak Rate: 0
Gross Fail: F
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

HIST LTANKS:
Region of Spill: 2
Spill Number: 9809607
Spill Date: 10/30/1998
Spill Time: 12:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: MULQUEEN
Caller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CO-OP BLDG (Continued)

S103558219

Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 10/30/98
Reported to Department Time: 15:48
SWIS: 61
Spiller Contact: STEVEN HYATT - MANAGEMENT
Spiller Phone: (718) 332-0777
Spiller Extension: Not reported
Spiller Name: CO-OP BLDG
Spiller Address: 2520 BATCHELTER ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: () -
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-28407
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/30/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 11/02/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: 1&2
Tank Size: 15000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Tank Test Failures only pass or fail

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: TANKS 1 2 ARE MANIFESTED - 15000 GALLONS EACH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

42
SSW
1/8-1/4
0.161 mi.
850 ft.

SIDEWALK
2656 E. 27TH ST
BROOKLYN, NY

NY Spills **S106699587**
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0406993

DER Facility ID: 137476

Facility Type: ER

Site ID: 163001

DEC Region: 2

Spill Number: 0406993

Spill Date: 9/24/2004

Spill Cause: Unknown

Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 11/19/2004

SWIS: 2401

Investigator: GDBREEN

Referred To: Not reported

Reported to Dept: 9/24/2004

CID: 74

Water Affected: Not reported

Spill Source: Unknown

Spill Notifier: Responsible Party

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 9/24/2004

Spill Record Last Update: 11/19/2004

Spiller Name: Not reported

Spiller Company: UNKNOWN SPILLER

Spiller Address: Not reported

Spiller City,St,Zip: NY

Spiller Company: 999

Contact Name: ERT DESK

Contact Phone: (212) 580-8383

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "BREEN"FOUND DRIED STAINS OF UNKNOWN OIL COVERING 5 FLAGS OF SIDEWALK (CONCRETE) AND STREET (ASPHALT) IN FRONT OF CUSTOMER'S DRIVEWAY. HE ESTIMATES SPILL AMOUNT APPROX. one GAL. REPORTS IT SMELLS LIKE MOTOR OIL. SPILL CONTAINED. NO PRIVATE PROPERTY AFFECTED. NO SEWERS OR WATERWAYS AFFECTED. NO FIRE/SMOKE. UNABLE TO TAKE A SAMPLE DUE TO DRIED OIL. 9/24/ 0:5 HRS. -- THERE IS ONLY OVERHEAD SECONDARY CABLE HERE AND NO COMPANY EQUIPMENT IN AREA THAT COULD HAVE SPILLED OIL ON SIDEWALK.Tino Fernandez and Ed Vesce, BQ-EHS, have asked Vincent Dell'Accio, BQ Overhead tree trimming supervisor, to determine whether the spill occurring at 2656 E 27 Street, Brooklyn on 09/21/04 was caused by our tree trimmers and to inspect the site (pictures below). As result, EHS has been informed that Lewis Tree was responsible for the occurrence. Lewis Tree has offered to clean the surfaces via power washer and sidewalk detergent, but will take no action until directed by Con Edison.UPDATE 9/28/04 19:40 HRS A. WALKER REPORTS HE WENT TO LOCATION WITH ENV CREW TO ATTEMPT ANOTHER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SIDEWALK (Continued)

S106699587

CLEANUP, BUT WAS UNABLE TO CLEAN DUE TO SEVERE RAINFALL. JOB TO BE RE-SCHEDULED WHEN WEATHER PERMITS.UPDATE 9/29/0421:40HRS O.JONES REPORTS, DOUBLE WASHED STRUCTURE USING 760 OIL ABSORBENT JOB 100% COMPLETED. 9/29/04 22:30 HRS. -- A. WALKER, O/S BROOKLYN ENV OPS, REPORTS NO STRUCTURE INVOLVED WITH THIS CLEANUP BUT ENV OPS CREW DID CLEAN SIDEWALK AND STREET USING "A1 HYDRO" DETERGENT AND OIL ABSORBENT. CLEANUP IS 100% COMPLETE AND E2MIS INCIDENT IS CLOSED. CUSTOMER WAS GIVEN THE PHONE NUMBER FOR CLAIMS AND WILL CONTACT THEM IF NOT SATISFIED WITH THE CLEANUP.

Remarks:

1 gallon unknown oil on sidewalk asphalt.Originally called in to Con Ed as possibly coming from one of their trucks, however when they checked it, it appeared to have been there for quite a while. Con Ed will clean it up.Ref. # 155518

Material:

Site ID: 163001
Operable Unit ID: 890308
Operable Unit: 01
Material ID: 571172
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

H43
WSW
1/8-1/4
0.170 mi.
899 ft.

2612 AVE Z
2612 AVE Z
BROOKLYN, NY
Site 2 of 3 in cluster H

NY Spills
NY Hist Spills
S102146392
N/A

Relative:
Higher

SPILLS:

Facility ID: 9300865
DER Facility ID: 119907
Facility Type: ER
Site ID: 140401
DEC Region: 2
Spill Number: 9300865
Spill Date: 4/18/1993
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2612 AVE Z (Continued)

S102146392

Willing Responsible Party. Corrective action taken.
Spill Closed Date: 4/18/1993
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 4/18/1993
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: 4/18/1993
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/1/1994
Spill Record Last Update: 9/10/2004
Spiller Name: Not reported
Spiller Company: SAME
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: PIN HOLE SIZE LEAK IN OIL BURNER - USED SPEEDY DRY TO CLEAN - NO CALL BACK NES.

Material:
Site ID: 140401
Operable Unit ID: 979463
Operable Unit: 01
Material ID: 401605
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2612 AVE Z (Continued)

S102146392

NY Hist Spills:

Region of Spill: 2
Spill Number: 9300865
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/18/1993 08:00
Reported to Dept Date/Time: 04/18/93 10:46
SWIS: 61
Spiller Name: SAME
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 04/18/93
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/18/93
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/01/94
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2612 AVE Z (Continued)

S102146392

Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: PIN HOLE SIZE LEAK IN OIL BURNER - USED SPEEDY DRY TO CLEAN - NO CALL BACK NES.

H44
WSW
1/8-1/4
0.170 mi.
899 ft.

2612 AVE Z 1ST FLOOR
BROOKLYN, NY
Site 3 of 3 in cluster H

NY Spills S106017245
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0305268
DER Facility ID: 181321
Facility Type: ER
Site ID: 219265
DEC Region: 2
Spill Number: 0305268
Spill Date: 8/1/2003
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/15/2003
SWIS: 2401
Investigator: CESA WYER
Referred To: Not reported
Reported to Dept: 8/18/2003
CID: 281
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/18/2003
Spill Record Last Update: 12/15/2003
Spiller Name: Not reported
Spiller Company: DYKER ASSOCIATES
Spiller Address: UNKNOWN
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: RADISLAV TISNOVSKY
Contact Phone: (718) 615-4475
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SAWYER"8/18/03 DDO Sawyer talked to Mr. Tisnovsky and he explained he was in the process of having the area tested and remediated. He has already retained a lawyer and plans to persue the builder (Dyker Assocites). His cell phone number is (718) 490-1313.8/25/03 1323 Hrs - Sawyer - Talked to Jim Mulvey (Allstate's Environmental Consultant) who notified me that today soil and air samples were taken to be analyzed. His number is (516) 322-4543. 12/15/03 1319 Hrs - Sawyer - Reviewed the report and sampling results forwarded by Milro, and received December 4, 2003. Judging from the information presented in

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S106017245

Remarks: the report, there is no further action needed. Closed.
Caller purchased above property on 1/2002 and noticed stain.
Caller states he brought this to builders attention and was told it
was no problem. Room was carpeted covered stain. Caller states odor
became unbearable approx 2 weeks ago and he removed carpet to find
stain still there. Caller is requesting to speak to DEC.

Material:

Site ID: 219265
Operable Unit ID: 871938
Operable Unit: 01
Material ID: 502527
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

45
West
1/8-1/4
0.174 mi.
920 ft.

PRIVATE RESIDENCE
2533 EAST 26TH STREET
BROOKLYN, NY

NY Spills S106384607
N/A

Relative:
Higher

Actual:
11 ft.

SPILLS:

Facility ID: 0400166
DER Facility ID: 180286
Facility Type: ER
Site ID: 217926
DEC Region: 2
Spill Number: 0400166
Spill Date: 4/6/2004
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 11/19/2009
SWIS: 2401
Investigator: SFRAHMAN
Referred To: Not reported
Reported to Dept: 4/6/2004
CID: 444

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

S106384607

Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/6/2004
Spill Record Last Update: 11/19/2009
Spiller Name: MR. STEANZONIE
Spiller Company: PRIVATE RESIDENCE
Spiller Address: 2533 EAST 26TH STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: MR. STEANZONIE
Contact Phone: (718) 757-1177 CELL
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"DEMO"10/30/05: CBNProperty owner mentioned that the spill has been cleaned by the oil company. Called Kenny c/o Petro Oil Co. (718) 628-3351 and he will be faxing me the paperwork for the spill closure. Nothing has been received as of this update. Transferred back from CO ("CBNG")11/16/06 - Austin - Reassigned to Rahman for followup/review - end11/19/09 Minor spill, all cleaned up as per the spill report. Case closed.(sr)
Remarks: HOMEOWNER NEEDS A NEW FILL PIPE IT IS LEAKING, OIL CO. IS SENDING A CLEAN UP CO. TO CLEAN UP THE DIRT. ABOUT 1/2 GALLON LEAKED:

Material:

Site ID: 217926
Operable Unit ID: 884584
Operable Unit: 01
Material ID: 494955
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

I46
NNE
1/8-1/4
0.178 mi.
942 ft.

PRIMA CLNRS
2966 AVENUE X
BROOKLYN, NY 11235

Site 2 of 2 in cluster I

MANIFEST
DRYCLEANERS

S110247678
N/A

Relative:
Higher

NY MANIFEST:

Actual:
10 ft.

EPA ID: NYD982535122
Country: USA
Mailing Name: PRIMA CLNRS
Mailing Contact: MIKES CLEANERS
Mailing Address: 2966 AVENUE X
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-646-2468

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2012-01-11
Trans1 Recv Date: 2012-01-11
Trans2 Recv Date: 2012-01-12
TSD Site Recv Date: 2012-01-13
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: CDX107000000
Waste Code: Not reported
Quantity: 60.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 009255425JJK
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIMA CLNRS (Continued)

S110247678

Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2012-01-11
Trans1 Recv Date: 2012-01-11
Trans2 Recv Date: 2012-01-12
TSD Site Recv Date: 2012-01-13
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: CDX107000000
Waste Code: Not reported
Quantity: 160.0
Units: P - Pounds
Number of Containers: 2.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2012
Manifest Tracking Num: 009255425JJK
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2010-03-10
Trans1 Recv Date: 2010-03-10
Trans2 Recv Date: 2010-03-12
TSD Site Recv Date: 2010-03-13
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: CDX107000000
Waste Code: Not reported
Quantity: 80.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2010
Manifest Tracking Num: 006662542JJK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIMA CLNRS (Continued)

S110247678

Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2010-02-24
Trans1 Recv Date: 2010-02-24
Trans2 Recv Date: 2010-02-25
TSD Site Recv Date: 2010-02-26
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: CDX107000000
Waste Code: Not reported
Quantity: 80.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2010
Manifest Tracking Num: 006662546JJK
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2010-02-24
Trans1 Recv Date: 2010-02-24
Trans2 Recv Date: 2010-02-25
TSD Site Recv Date: 2010-02-26

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIMA CLNRS (Continued)

S110247678

Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: CDX107000000
Waste Code: Not reported
Quantity: 130.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2010
Manifest Tracking Num: 006662546JJK
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2011-02-16
Trans1 Recv Date: 2011-02-16
Trans2 Recv Date: 2011-02-18
TSD Site Recv Date: 2011-02-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID: CDX107000000
Waste Code: Not reported
Quantity: 60.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2011
Manifest Tracking Num: 000013034TAG
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIMA CLNRS (Continued)

S110247678

Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: NJD000564906
Trans2 State ID: MIK814262374
Generator Ship Date: 2011-02-16
Trans1 Recv Date: 2011-02-16
Trans2 Recv Date: 2011-02-18
TSD Site Recv Date: 2011-02-18
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982535122
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID: CDX107000000
Waste Code: Not reported
Quantity: 130.0
Units: P - Pounds
Number of Containers: 1.0
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1.0
Year: 2011
Manifest Tracking Num: 000013034TAG
Import Ind: N
Export Ind: Y
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N
Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H020

DRYCLEANERS:

Facility ID: 2-6107-00424
Phone Number: Not reported
Region: 2
Registration Effective Date: 1/26/2009
Inspection Date: 09FEB5
Install Date: Not reported
Drop Shop: Not reported
Shutdown: Not reported
Alternate Solvent: Not reported
Current Business: PERC DRY CLEANER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

K47 **3000 AVE X/BKLYN/SHEEPSHE**
North **3000 AVE X**
1/8-1/4 **NEW YORK CITY, NY**
0.179 mi.
943 ft. **Site 1 of 2 in cluster K**

NY Spills **S102144848**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 8707508
DER Facility ID: 181450
Facility Type: ER
Site ID: 219414
DEC Region: 2
Spill Number: 8707508
Spill Date: 12/2/1987
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 12/2/1987
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 12/2/1987
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Police Department
Cleanup Ceased: 12/2/1987
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/4/1987
Spill Record Last Update: 10/14/1988
Spiller Name: Not reported
Spiller Company: SHEEPSHEAD BAY HIGH SCHOO
Spiller Address: 3000 AVE X
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: NYCDEP REQUESTED, CITY DEPT OF HEALTH, POLICE DEPT HAZMAT/FIRE DEPT HAZMAT/ RESPONDED, HIGH SCHOOL HAS BEEN EVACUATED.

Material:

Site ID: 219414
Operable Unit ID: 911821
Operable Unit: 01
Material ID: 466453
Material Code: 0253A
Material Name: SODIUM AZIDE (NA(N3))
Case No.: 26628228
Material FA: Hazardous Material
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3000 AVE X/BKLYN/SHEEPSHE (Continued)

S102144848

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8707508
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/02/1987 12:15
Reported to Dept Date/Time: 12/02/87 13:25
SWIS: 61
Spiller Name: SHEEPSHEAD BAY HIGH SCHOOL
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: 3000 AVE X
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Police Department
PBS Number: Not reported
Cleanup Ceased: 12/02/87
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 12/02/87
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/04/87
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/14/88
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3000 AVE X/BKLYN/SHEEPSHE (Continued)

S102144848

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Nonpetroleum/Nonhazardous
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: SODIUM AZIDE (NA(N3))
Class Type: SODIUM AZIDE (NA(N3))
Times Material Entry In File: 0
CAS Number: 26628228
Last Date: Not reported

DEC Remarks: Not reported

Remark: NYCDEP REQUESTED, CITY DEPT OF HEALTH, POLICE DEPT HAZMAT/FIRE DEPT HAZMAT/
RESPONDED, HIGH SCHOOL HAS BEEN EVACUATED.

K48
North
1/8-1/4
0.179 mi.
943 ft.

SHEEPSHEAD BAY HIGH SCHOOL
3000 AVE X
BROOKLYN, NY 11235
Site 2 of 2 in cluster K

MANIFEST **S104881011**
NY Spills **N/A**
NY Hist Spills

Relative:
Higher

NY MANIFEST:

EPA ID: NY0000377440
Country: USA
Mailing Name: SHEEPSHEAD BAY HIGH SCHOOL
Mailing Contact: G BRAUN
Mailing Address: 3000 AVE X
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-769-3344

Actual:
10 ft.

NY MANIFEST:

No Manifest Records Available

SPILLS:

Facility ID: 1107828
DER Facility ID: 410117
Facility Type: ER
Site ID: 455539
DEC Region: 2
Spill Number: 1107828
Spill Date: 9/20/2011
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known
release with no damage. DEC Response. Willing Responsible Party.
Corrective action taken.
Spill Closed Date: 7/20/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

SWIS: 2401
Investigator: HRPATEL
Referred To: Not reported
Reported to Dept: 9/20/2011
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/20/2011
Spill Record Last Update: 7/20/2012
Spiller Name: CHARLES GUDER
Spiller Company: SHEEPSHEAD BAY HIGH SCHOOL
Spiller Address: 3000 AVE X
Spiller City,St,Zip: BROOKLYN, NY 999
Spiller Company:
Contact Name: CHARLES GUDER
Contact Phone: (646) 660-1020
DEC Memo: DEC Piper spoke with Charles Guder. Residual contamination from historic spill #0010259 that has been closed has been observed seeping up through cracks in floor of unoccupied mechanical room. TRC has contract with SCA. Work plan is being generated to perform subsurface investigation and will be implemented mid october. Report to follow with results and recommendations.09/22/11-Hiralkumar Patel.alternate addresses: 3000-3044 Ave X, 2997-3043 Ave Y, 2400-2484 Coyle StreetPBS #: 2-355550. as per PBS record, site has/had following tanks:- one 15,000 gal #2 oil AST on legs/saddles was removed in Jun. 2000- one 15,000 gal #2 oil AST on legs/saddles was removed in Jan. 2001- one 10,000 gal #2 oil AST on legs/saddles in-service. tank installed in Oct. 2000- one 15,000 gal #2 oil AST on legs/saddles in-service. tank installed in Mar. 2001other spills : 8707508, 0010259spill #: 8707508 was reported on 12/02/1987 due to spill of sodium azide. case closed.spill #: 0010259 was reported on 12/12/2000 due to spill of 3,000 gal #2 oil. DEC project manager inspected site on 12/12/2000. PTC crew pumped out free product from impacted area. case closed. no indication of any subsurface investigation.NYC Department of Education **property/tank owner**Field Operations-Fuel Division44-36 Vernon Blvd.Long Island City, NY 11101Attn.: James MerloPh. (718) 349-5738email: jmerlo@schools.nyc.gov10:00 AM:- visited site. met Danny Graham at school. Danny mentioned that back in 2000, school was changing the tanks and associated remote fill line. as part of this process, contractor cut the remote fill lines from inside the building, but did not plug the remote fill port at the curb along Ave X. due to mis-communication between the school/contractor and oil company, oil company delivered about 3,500-4,000 gal oil into disconnected fill line which ended into the unoccupied mechanical room. spilled oil was pumped out immediately, but no subsurface investigation performed. recently, after heavy rains (specially after hurricane Irene), oil/water came up through the mechanical room floor. contractor responded and cleaned up the spill.inspected the mechanical room (crawl space in boiler room). found strong odors in mechanical room.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

found oil stains along the cracks in floor. asked Danny to install ventilation. mechanical room floor is about 20-25 ft below street level. this mechanical room/tank room/boiler room are located in the northwestern corner of the school building. the mechanical room is located along the northern foundation wall along Ave X. west wall of the mechanical room is the western foundation wall of the school along the Batchelder Street. the currently in-service fill boxes and vent lines are located on the northern foundation wall. Danny showed location where current fill/vent lines crosses the foundation wall. he also showed two concrete patches underneath the location of currently in-service fill lines and these patches are where the old fill lines ran. the existing tank room is located south of the mechanical room, along western foundation wall. Danny mentioned that the old tanks were located in the same tank room and were replaced in 2000/2001. the currently in-service 10,000 gal tank is located to the east and 15,000 gal tank is located to the west, in the tank room. the boiler room is south of the tank room along western foundation wall. the boilers are located in a 5 ft deep pit in the boiler room. a sump is located in the northwest corner of the boiler pit. found clean water in sump. Danny mentioned that they get continuous supply of groundwater and they have sump pumps running 24 hours. Danny never observed any oil in this sump. inspected boiler pit, but no sign of any oil seepage found. the mechanical room floor is about 2 ft higher than boiler room floor (and about 7 ft higher than boiler pit). Danny mentioned that the boiler pit and the blower rooms are the two lowest points in entire building. the boiler room is located in the northwestern corner of the building and the blower room is located in northeastern corner of the building. there is water seepage into the blower room, but never observed any oil. inspected blower room. no sign of oil seepage found. during inspection, found following PBS violations:- no tank label near electronic gauge or tank room entrance door- no color code at the fill boxes. Danny Graham **person-in-charge at school** Ph. (718) 769-3344 email: ck495@boe.net 09/23/11-Hiralkumar Patel. 4:11 PM:- spoke with Charles at TRC. he mentioned that they are preparing a work plan for soil delineation inside the mechanical room and outside the building. he will submit work plan to SCA next week for review and will submit final work plan to DEC by end of 10/07/11. 4:14 PM:- sent email to Charles and asked to submit investigation work plan by 10/07/11. email copied to Mr. Merlo and Danny. 10/12/11-Hiralkumar Patel. received email from Michael Sherwood (at 4:25 PM on 10/07/11) including a work plan. abstract:- will install seven (7) soil borings: four inside the mechanical room and three outside the building (surrounding the mechanical room)- soil borings will be advanced 2 to 3 ft below observed water table (anticipated at approx. 15 to 20 ft below surface grade or 5 to 10 ft below basement floor slab), refusal, or, if contamination is noted, to the first observed clean interval- one soil sample from the 2 ft interval above the observed water table will be collected, if no contamination found in boring- if impacted soils are identified, two soil samples will be collected: one from the most impacted zone and second from the first underlying clean 2 ft interval- groundwater samples will be collected from temporary well points in three bore holes- groundwater samples will be selected from soil boring location exhibiting the highest potential for contamination- if no evidence of contamination is observed in soil borings, three groundwater samples will be collected from proposed borings TRC-SB-1, TRC-SB-6 and TRC-SB-7- product sample

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

will be collected for analysis, if found in any boring2:40 PM:- sent work plan approval letter to Mr. Kanaparathi at SCA. letter emailed to Mr. Kanaparathi and Charles.NY City School Construction Authority30-30 Thomson AveLong Island City, NY 11101-3045Attn.: Srinivas KanaparathiPh. (718) 472-8620 (O) (917) 642-2742 (C)Fax (718) 472-8500 email: SKANAPARTHI@NYCSCA.ORG11/03/11-Hiralkumar Patel.4:09 PM:- received email from Charles requesting one week extension to submit an investigation report. he proposes to submit report by 12/02/11.11/14/11-Hiralkumar Patel.10:01 AM:- sent email to Charles approving his request to submit report by 12/02/11.12/05/11-Hiralkumar Patel.4:07 PM:- received email from Charles including site map, sampling results and boring logs. - total of 7 borings installed: three borings installed outside of the building and four borings installed in the mechanical room- no PID readings were found in soil samples from 0 to 10 ft bg in borings installed outside the building- found 78 ppm on PID at 10 ft in boring TRC-SB-2 and high PID reading 264 ppm and staining at the water table in boring TRC-SB-7 (which was installed east of the mechanical room)- found groundwater right under the mechanical room floor- high PID readings were noted in all four borings inside the mechanical room- oil sheen was observed on water in two borings (TRC-SB-3 and TRC-SB-6) inside the mechanical roomsoil analyticals:

-----TRC-SB-3-----TRC-SB-4-----TRC-SB-5-----T
RC-SB-5-----TRC-SB-6 6-8 inch 6-8 inch 6-8 inch 4-5 ft 6-8
inch1,2,4-Trimethylbenzene-----19,000-----5,000-----7,
400-----26,000-----36,0001,3,5-Trimethylbenzene-----4,
500-----1,600-----9,
900Naphthalene-----16,000-----5,100-----7,
900-----19,000-----40,000groundwater

analyticals:
-----TRC-SB-3-----TRC-SB-6-----TRC-SB-6A-----T
RC-SB-7Ethylbenzene-----1501,2,
4-Trimethylbenzene-----580-----380-----430Naphthalene
-----1,000-----990-----1,

100-----280Charles requested a meeting to discuss the findings and future work.12/08/11-Hiralkumar Patel.2:56 PM:- sent email to Charles and asked him to submit an investigation report with conclusions and recommendations. informed him that a meeting can be scheduled, if needed, after reviewing the report. email copied to Mr. Kanaparathi.12/21/11-Hiralkumar Patel.8:43 AM:- received email from Charles including report. abstract:- total of seven soil borings and three temporary monitoring wells were installed- four of the soil borings (TRC-SB-3 to TRC-SB-6) were installed in the basement workshop/storage (mechanical) room- the top of the basement slab is approx. 11 ft below sidewalk grade- groundwater was found at around 12 ft bg (12 ft in outside borings and about 1 ft below basement floor in basement borings)- the three outside borings (TRC-SB-1, TRC-SB-2 and TRC-SB-7) were installed to a depth of 15 ft bg- the four inside borings (TRC-SB-3 to TRC-SB-6) were installed to a depth of approx. 5 ft below the top of the basement concrete slab, where refusal encountered- soil samples generally consisted of fill material primarily composed of brown silt and fine to coarse sand with some gravel- based on site topography and location of the nearest surface water body, groundwater is expected to flow to the southwest- visual and olfactory evidence of petroleum impacts was present in soil samples collected from all four borings installed in

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

the basement area from surface to end of boring- visual and olfactory evidence of contamination was present in soil samples collected from 10-12 ft bg in TRC-SB-2 and from 11.5-12.5 ft bg in TRC-SB-7- three soil borings (TRC-SB-3, TRC-SB-6 and TRC-SB-7) were converted into 1 inch temporary wells- product was not observed in any well- groundwater samples collected from basement room did have a noticeable sheen- found contamination in soil and groundwater samples (see notes above)- there are some VOCs found in soil and groundwater samples above method detection limit, but below reporting limit, so report included an estimated values for those compounds- recommends complete (horizontal and vertical) delineation of soil contamination via installation of additional borings- recommends horizontal delineation of groundwater contamination via installation of up to four permanent monitoring wells- recommends installation of ORC socks in the wells followed by quarterly groundwater monitoring- recommends installation of a ventilation system in basement room 12/28/11-Hiralkumar Patel. 11:31 AM:- sent letter to Mr. Kanaparthi requiring submission of an investigation work plan, by end of 01/31/12, for complete delineation of soil/gw contamination. informed him that the Department does not agree with the recommendation of installation of ORC socks in wells without completing investigation. letter emailed to Mr. Kanaparthi, Charles, Patrick Narea (TRC) and Brian Gochenaur (NYC SCA). 01/26/12-Hiralkumar Patel. 3:39 PM:- received email from Brian Gochenaur from NYC SCA, including a work plan. abstract:- will install five soil borings- former boring TRC-SB-5 will be advanced to a greater depth for vertical delineation- soil borings will be advanced to 5 ft below water table, refusal or if contamination is noted, to the first observed clean interval- will collect two soil samples from boring, if contamination found or else will collect one sample at or above the water table- soil sample will be collected below 5 ft depth from former boring SB-5 location (as samples were collected at 4-5 ft depth during previous investigation)- will install four monitoring wells: three wells outside and one well inside at the former boring location TRC-SB-8- three wells outside the school building will be advanced to 10 ft below the water table and will be constructed of 15 ft of 2 inch diameter screen- one well inside the boiler room will be advanced to 5 ft below water table and will be constructed entirely of one-inch diameter screen Brian Gochenaur Industrial and Environmental Hygiene Division New York City School Construction Authority 30-30 Thomson Ave Long Island City, New York 11101 Ph. (718) 752-5312 Fax (718) 472-8500 email: bgochenaur@nycsca.org based on previous sample data, need changed in well locations:- instead of well TRC-MW-3 by the main entrance, need monitoring well within the workshop/maintenance room (in area between former borings TRC-SB-3, TRC-SB-4 and TRC-SB-6)- need to move TRC-MW-2 closer to building wall, if possible 02/01/12-Hiralkumar Patel. 11:13 AM:- spoke with Charles. asked him to install a monitoring well within the basement maintenance room, instead of well by the main entrance. also asked him to move well closer to former boring location SB-7. 11:15 AM:- sent email to Charles including a map with proposed changes in well locations. asked him to submit a revised work plan. email copied to Mr. Gochenaur and Mr. Kanaparthi. 02/02/12-Hiralkumar Patel. 3:37 PM:- received revised work plan from Brian. 02/03/12-Hiralkumar Patel. 9:50 AM:- sent work plan approval letter to Mr. Kanaparthi. asked him to submit investigation report by 03/23/12. letter emailed to Mr. Kanaparthi, Brian and Charles. 04/23/12-Hiralkumar Patel. received report from TRC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

abstract:- installed four borings- boring TRC-MW-1 was advanced outside of the school to approx. 20 ft bg; groundwater was encountered at approx. 10 ft bg- boring TRC-MW-2 was advanced outside of the school to approx. 23 ft bg; groundwater was encountered at approx. 13 ft bg- boring TRC-MW-3 was advanced in the center of the basement workshop/storage room, to approx. 21 ft below basement slab; groundwater was encountered at approx. 1 ft below basement slab- soil boring TRC-SB-5 was advanced to a depth of approx. 9 ft below basement slab; groundwater was encountered at approx. 1 ft below basement slab- proposed borings TRC-SB-8 and TRC-SB-9 were not installed as groundwater coming up through the slab under pressure when tried to install TRC-SB-8; no evidence of petroleum impacts were noted in the groundwater coming up through the slab- 2-inch wells were installed at borings TRC-MW-1 and TRC-MW-2 and 1-inch well installed at TRC-MW-3- all three wells were installed with 15 ft of screen- well TRC-MW-3 was constructed entirely of screen- the depth to groundwater in the vicinity of the site ranges from approx. 1.17 ft below basement slab in permanent well TRC-MW-3 to 11.51 ft below grade surface in well TRC-MW-2- top of the basement slab is approx. 11 ft below sidewalk grade- based on groundwater surface elevation, the hydraulic gradient at the site is to the east- LNAPL was not encountered in any well- PID readings (max 477 ppm right below the slab) and moderate to strong odors detected in TRC-MW-3 from 0 to 18 ft below basement slab- no VOC compounds found in any soil sample except soil sample at 0.5-2.5 ft below basement slab from TRC-MW-3- very minor VOC compounds found in only in TRC-MW-3 (maximum 25 ppb of Naphthalene)soil analyticals:-----TRC-MW-3 (0.5-2.5 ft below basement slab)Ethylbenzene-----2,200p-Isopropyltoluene----12,000- conclusion: considering that groundwater sample collected from upgradient and downgradient monitoring wells do not contain detectable levels of petroleum related compounds and there is no continuing source, the plume is not expected to migrate significantly from its current locationrecommendations: - installation of a ventilation system in the basement workshop/storage room to prevent odors until the waterproofing is installed. installation of the ventilation system is currently scheduled for completion in summer 2012- collection and analysis of one additional round of groundwater samples from wells TRC-MW-1, TRC-MW-2 and TRC-MW-3 during summer 201205/18/12-Hiralkumar Patel.4:05 PM:- received email from Charles.05/29/12-Hiralkumar Patel.3:50 PM:- spoke with Charles. he mentioned that the ventilation system has been installed for about two weeks. the system included 3 carbon filters. Charles mentioned that waterproofing project will begin in 6-7 months. the ventilation system will be in operation now till the end of waterproofing project. they are planning for a monthly PID survey. he asked if any further investigation/cleanup needed.06/12/12-Hiralkumar Patel. discussed with DEC Austin. as contamination contained under the mechanical room floor, no oil observed in boiler room sump (which is at lower elevation than mechanical room and has 24 hour running sump), excavation is not possible inside the mechanical room (due to possible flooding), and based on investigation performed to date, Austin mentioned that no further investigation needed. he asked for re-sampling of existing wells as recommended in Apr. 2012 report.1:45 PM:- left message for Charles. informed him that the department does not require any further delineation, but requires sampling of existing monitoring wells as recommended in the report dated Apr.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

Remarks: 2012.2:24 PM:- sent email to Charles. asked him to re-sample existing wells as recommended and submit report by 07/20/12. email copied to Mr. Kanaparthi and Mr. Gochenaur.07/20/12-Hiralkumar Patel.10:04 AM:- received email from Charles including groundwater sample results. groundwater samples were collected from wells MW-1, MW-2 and MW-3. no contamination found in any sample. no petroleum odors or sheen or product noted in any well.based on available information, case closed.12:57 PM:- sent spill closure letter to Mr. Kanaparthi. letter emailed to Mr. Kanaparthi and Charles.
2000 spill from location. With heavy rain oil from old spill seeping up through cracks in floor. Cleanup is complete for surface. Further investigation will be conducted. Original spill #0010259 and was closed 2003.

Material:

Site ID: 455539
Operable Unit ID: 1205689
Operable Unit: 01
Material ID: 2202621
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 0010259
DER Facility ID: 274898
Facility Type: ER
Site ID: 219413
DEC Region: 2
Spill Number: 0010259
Spill Date: 12/12/2000
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 4/21/2003
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 12/12/2000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

CID: 211
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/12/2000
Spill Record Last Update: 4/21/2003
Spiller Name: ISAAC MUNGRA
Spiller Company: SHEEPSHEAD BAY HS
Spiller Address: 3000 AVE X
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: ISAAC MUNGRA
Contact Phone: (718) 624-4842
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"12/12/2000 Sangesland went to the site.Rapid Petroleum (718-596-4477) made a delivery of 3,000 gallons to Sheepshead Bay High School at approx. 7 AM on 12/12/2000.8:30 AM school custodian discovered the spill. Petroleum Tank Cleaners was called.DEC was not notified until 1PM when a rep from the local Community Board called Jake Krimgold at DEC Spills to ask what was happening. Sangesland was the DEC duty officer of the day and eventually found out what happened.At 2:30PM when Sangesland arrived, Petroleum Tank Cleaners was 75% done doing the clean up. All free product was removed from the boiler room "pit" area. A final mop up and wipe down was being done and a final flush of the 4 floor drains into the sump pit was going to be finished by 7 PM.The problem was caused by a breakdown in communications between the school construction organization and the oil delivery company. Within the last week or so, the school was in the process of having a new fill line/tank piping system installed. Apparently the old fill line was not capped, so the oil delivery company just hooked up to the same site as usual.Contact at the Board Of Education "Fuel Division" is Tom Taratko (718-391-6832 -shares the phone)12/20/2000 Physical clean up of the spill is complete. Close out will occur after DEC - ECO review of any outstanding administrative problems.

Remarks: leak in fuel line caused spill - clean up crew on scene

Material:

Site ID: 219413
Operable Unit ID: 831236
Operable Unit: 01
Material ID: 544169
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 3000
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 0010259
Investigator: SANGESLAND
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/12/2000 08:30
Reported to Dept Date/Time: 12/12/00 13:58
SWIS: 61
Spiller Name: SHEEPSHEAD BAY HS
Spiller Contact: ISAAC MUNGRA
Spiller Phone: (718) 624-4842
Spiller Contact: ISAAC MUNGRA
Spiller Phone: (718) 624-4842
Spiller Address: 3000 AVE X
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/12/00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY HIGH SCHOOL (Continued)

S104881011

Date Spill Entered In Computer Data File: Not reported

Update Date: 12/20/00

Is Updated: False

Tank:

PBS Number: Not reported

Tank Number: Not reported

Tank Size: Not reported

Test Method: Not reported

Leak Rate Failed Tank: Not reported

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Quantity Spilled: 3000

Unkonwn Quantity Spilled: False

Units: Gallons

Quantity Recovered: 0

Unkonwn Quantity Recovered: True

Material: #2 FUEL OIL

Class Type: #2 FUEL OIL

Times Material Entry In File: 24464

CAS Number: Not reported

Last Date: 19941207

DEC Remarks: 12/12/2000 Sangesland went to the site. Rapid Petroleum 718-596-4477) made a delivery of 3,000 gallons to Sheepshead Bay High School at approx. 7 AM on 12/12/2000. 8:30 AM school custodian discovered the spill. Petroleum Tank Cleaners was called. DEC was not notified until 1PM when a rep from the local Community Board called Jake Krimgold at DEC Spills to ask what was happening. Sangesland was the DEC duty officer of the day and eventually found out what happened. At 2:30PM when Sangesland arrived, Petroleum Tank Cleaners was 75 done doing the clean up. All free product was removed from the boiler room pit area. A final mop up and wipe down was being done and a final flush of the 4 floor drains into the sump pit was going to be finished by 7 PM. The problem was caused by a breakdown in communications between the school construction organization and the oil delivery company. Within the last week or so, the school was in the process of having a new fill line/tank piping system installed. Apparently the old fill line was not capped, so the oil delivery company just hooked up to the same site as usual. Contact at the Board Of Education Fuel Division is Tom Taratko 718-391-6832 -shares the phone) 12/20/2000 Physical clean up of the spill is complete. Close out will occur after DEC - ECO review of any outstanding administrative problems.

Remark: leak in fuel line caused spill - clean up crew on scene

49
WNW
1/8-1/4
0.184 mi.
972 ft.

PRIVATE RESIDENCE
2466 EAST 26TH ST
SHEEPSHEAD, NY

NY Spills S102560428
NY Hist Spills N/A

Relative:
Higher

SPILLS:

Facility ID: 9614367

DER Facility ID: 109458

Facility Type: ER

Site ID: 126630

DEC Region: 2

Spill Number: 9614367

Spill Date: 3/11/1997

Spill Cause: Equipment Failure

Actual:
12 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

S102560428

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Date: 3/12/1997
SWIS: 2401
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 3/11/1997
CID: 252
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/11/1997
Spill Record Last Update: 2/19/2003
Spiller Name: DICHELLE
Spiller Company: PRIVATE RESIDENCE
Spiller Address: 2466 EAST 26TH ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: DICHELLE
Contact Phone: (718) 332-3822
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MARTINKAT" CALLED DICHELLE 3/12/97 2:20 PM WORK BEING DONE NOW. GAVE
HER #S IN CASE SHE NEEDS TO CONTACT DEC (ME)
Remarks: SPILL HAS BEEN CONTAINED-SPEEDY DRY PUT DOWN AND PROFESIONAL CLEAN UP
CREW HAS BEEN CALLED

Material:

Site ID: 126630
Operable Unit ID: 1041804
Operable Unit: 01
Material ID: 339480
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 7
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

S102560428

Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9614367
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/11/1997 15:00
Reported to Dept Date/Time: 03/11/97 16:30
SWIS: 61
Spiller Name: PRIVATE RESIDENCE
Spiller Contact: DICHELLE
Spiller Phone: (718) 332-3822
Spiller Contact: DICHELLE
Spiller Phone: (718) 332-3822
Spiller Address: 2466 EAST 26TH ST
Spiller City,St,Zip: SHEEPSHEAD, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/12/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/11/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/14/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 7

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE RESIDENCE (Continued)

S102560428

Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: CALLED DICHELLED 3/12/97 2:20 PM WORK BEING DONE NOW. GAVE HER S IN CASE SHE NEEDS TO CONTACT DEC ME)
Remark: SPILL HAS BEEN CONTAINED-SPEEDY DRY PUT DOWN AND PROFESIONAL CLEAN UP CREW HAS BEEN CALLED

50
NW
1/8-1/4
0.193 mi.
1019 ft.

2710 AVENUE "X"
2710 AVENUE X
BROOKLYN, NY

LTANKS
HIST LTANKS
S101341038
N/A

Relative:
Higher

Actual:
11 ft.

LTANKS:
Site ID: 215032
Spill No: 9407806
Spill Date: 9/12/1994
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 8/24/1995
Facility Addr2: Not reported
Cleanup Ceased: 8/24/1995
Cleanup Meets Standard: True
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 9/12/1994
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/27/1994
Spill Record Last Update: 8/24/1995
Spiller Name: Not reported
Spiller Company: SYNOGOGUE
Spiller Address: 2710 AVENUE "X"
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 178158
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O;DOWD"
Remarks: WAITING TO FIND OUT ABOUT REPAIRS- ABC DUG UP TANK WELD MANWAY & HOLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2710 AVENUE "X" (Continued)

S101341038

ON TOP OF TANK REMOVED OLD PIPING AND REPLACED NEW SUCTIONLINE.
PRESSURE TESTED 1X3K TANK 11-10-94 AND PUT BACK IN SERVICE.

Material:

Site ID: 215032
Operable Unit ID: 1005507
Operable Unit: 01
Material ID: 377267
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 215032
Spill Tank Test: 1543135
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 138406
Spill No: 9410038
Spill Date: 10/27/1994
Spill Cause: Tank Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/27/1994
Facility Addr2: Not reported
Cleanup Ceased: 10/27/1994
Cleanup Meets Standard: True
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 10/27/1994
CID: Not reported
Water Affected: Not reported
Spill Notifier: Local Agency
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 12/5/1994
Spill Record Last Update: 3/14/2002
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2710 AVENUE "X" (Continued)

S101341038

Spiller Company: SYNAGOGUE
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 178158
DEC Memo: Not reported
Remarks: A LOT SPILLED-A ODOR STRONG-ABC OIL DOING CLEANUP-DEP HAS HAZMAT NOTIFIED.

Material:

Site ID: 138406
Operable Unit ID: 1003999
Operable Unit: 01
Material ID: 375908
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9407806
Spill Date: 09/12/1994
Spill Time: 11:30
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/24/95
Cleanup Ceased: 08/24/95
Cleanup Meets Standard: True
Investigator: O;DOWD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2710 AVENUE "X" (Continued)

S101341038

Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 09/12/94
Reported to Department Time: 14:01
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: SYNOGOGUE
Spiller Address: 2710 AVENUE "X"
Spiller City,St,Zip: BROOKLYN, NEW YORK
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/27/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 08/24/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: WAITING TO FIND OUT ABOUT REPAIRS- ABC DUG UP TANK WELD MANWAY HOLE ON TOP OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2710 AVENUE "X" (Continued)

S101341038

TANK REMOVED OLD PIPING AND REPLACED NEW SUCTIONLINE. PRESSURE TESTED 1X3K TANK 11-10-94 AND PUT BACK IN SERVICE.

L51
NE
1/8-1/4
0.194 mi.
1025 ft.

INTERMEDIATE SCHOOL 14
2424 BATCHELDER STREET
BROOKLYN, NY

HIST LTANKS S105054888
N/A

Site 1 of 3 in cluster L

Relative:
Higher

Actual:
9 ft.

HIST LTANKS:

Region of Spill: 2
Spill Number: 0101806
Spill Date: 03/03/2001
Spill Time: Not reported
Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 05/16/01
Reported to Department Time: 15:26
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NEW YORK SCHOOL CONSTRUCT
Spiller Address: 3030 THOMSON AVENUE
Spiller City,St,Zip: LONG ISLAND CITY, NY 11101-
Spiller Cleanup Date: / /
Facility Contact: BOB CANAPARTHI
Facility Phone: (718) 472-8620
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/16/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/17/01
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 (Continued)

S105054888

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

DEC Remarks: Not reported

Spill Cause: SOIL AND GROUNDWATER SAMPLES WERE TAKEN ON THE DATE LISTED. REPORT WAS RECEIVED ON 3/23/01. SPILLER WAS NOTIFIED OF RESULTS. SPILLER DID NOT REPORT THE SPILL TO DEC. SOIL AND GROUNDWATER CONTAMINATION IN THE AREA OF ONE OF TWO 10,000 GALLON UNDERGROUND STORAGE TANKS. THE OTHER TANK APPEARS TO BE OK. TANK IS GOING TO BE REPLACED AT SOME POINT, AND THE GROUNDWATER AND SOIL WILL BE REMEDIATED AS NECESSARY.

**L52
NE
1/8-1/4
0.194 mi.
1025 ft.**

**INTERMEDIATE SCHOOL 14 - BROOKLYN
24-24 BATCHELDER ST
BROOKLYN, NY 11235
Site 2 of 3 in cluster L**

**LTANKS U001839964
UST N/A
HIST UST
NY Spills**

**Relative:
Higher**

LTANKS:

Site ID: 126453
Spill No: 0101806
Spill Date: 3/3/2001
Spill Cause: Tank Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 1/11/2006
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: AJWHITE
Referred To: Not reported
Reported to Dept: 5/16/2001
CID: 266
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 5/16/2001

**Actual:
9 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Spill Record Last Update: 8/19/2011
Spiller Name: BOB CANAPARTHI
Spiller Company: BOARD OF ED
Spiller Address: 3030 THOMSON AVENUE
Spiller City,St,Zip: LONG ISLAND CITY, NY 11101-
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 109314
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE"1/15/03 TIPPLE UPDATING///SEE ALSO TTF, SPILL #00-0139011/15/2005: Lead transferred to Joe White as part of the Spill Initiative Project.12/08/2005: Mr. James Merlo, the coordinator for NYC School spills, called Joe White to indicate that the tank has been retested and passed. These passing results will be sent to the DEC for closure of failed tank test.1/11/2006: Information was received from James Merlo on 1/9/2006 showing tank test passes on 4/28/05 and again on 12/13/05 for tank #2 containing #4 fuel oil. This is consistent with the information on the PBS# 2-356050 database. Additionally tank #1 containing #2 fuel oil has a passed test on 4/28/2005 as documented in the PBS database. Copies of the tank tests have been filed into the eDocs system for our records and this spill has been colsed out.

Remarks: SOIL AND GROUNDWATER SAMPLES WERE TAKEN ON THE DATE LISTED. REPORT WAS RECEIVED ON 3/23/01. SPILLER WAS NOTIFIED OF RESULTS. SPILLER DID NOT REPORT THE SPILL TO DEC. SOIL AND GROUNDWATER CONTAMINATION IN THE AREA OF ONE OF TWO 10,000 GALLON UNDERGROUND STORAGE TANKS. THE OTHER TANK APPEARS TO BE OK. TANK IS GOING TO BE REPLACED AT SOME POINT, AND THE GROUNDWATER AND SOIL WILL BE REMEDIATED AS NECESSARY.

Material:
Site ID: 126453
Operable Unit ID: 838683
Operable Unit: 01
Material ID: 537508
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Last Modified: Not reported
Test Method: Not reported

UST:

Facility Id: 2-356050
Region: STATE
DEC Region: 2
Site Status: Active
Program Type: PBS
Expiration Date: 2013/06/28
UTM X: 589895.48207000003
UTM Y: 4494167.41842

Affiliation Records:

Site Id: 17769
Affiliation Type: Owner
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: MANAGER, FUEL DIVISION
Contact Name: JAMES A. MERLO
Address1: 44-36 VERNON BOULEVARD
Address2: Not reported
City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: GDBREEN
Date Last Modified: 10/1/2012

Site Id: 17769
Affiliation Type: Mail Contact
Company Name: NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type: Not reported
Contact Name: JAMES A. MERLO
Address1: FIELD OPERATIONS-FUEL DIVISION
Address2: 44-36 VERNON BOULEVARD
City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 349-5738
Phone Ext: Not reported
Email: JMERLO@SCHOOLS.NYC.GOV
Fax Number: Not reported
Modified By: dxliving
Date Last Modified: 9/2/2008

Site Id: 17769
Affiliation Type: On-Site Operator
Company Name: INTERMEDIATE SCHOOL 14 - BROOKLYN
Contact Type: Not reported
Contact Name: PLANT OPERATIONS
Address1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Address2:	Not reported
City:	Not reported
State:	NY
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 349-5400
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	GDBREEN
Date Last Modified:	1/10/2012
Site Id:	17769
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	SCHOOL SAFETY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 935-3300
Phone Ext:	Not reported
Email:	Not reported
Fax Number:	Not reported
Modified By:	GDBREEN
Date Last Modified:	10/1/2012

Equipment Records:

J02 - Dispenser - Suction
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
B01 - Tank External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
C01 - Pipe Location - Aboveground
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
F01 - Pipe External Protection - Painted/Asphalt Coating
C01 - Pipe Location - Aboveground
G00 - Tank Secondary Containment - None
G00 - Tank Secondary Containment - None
L00 - Piping Leak Detection - None
L00 - Piping Leak Detection - None
I00 - Overfill - None
I00 - Overfill - None

Tank Info:

Site ID: 17769

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Tank Number: 001
Tank ID: 34758
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/11/1952
Capacity Gallons: 10000
Tightness Test Method: 21
Next Test Date: 03/24/2015
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 03/24/2010
Register: True
Modified By: BKFALVEY
Last Modified: 07/07/2010

Site ID: 17769

Tank Number: 002
Tank ID: 34759
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/11/1952
Capacity Gallons: 10000
Tightness Test Method: 21
Next Test Date: 03/24/2015
Date Tank Closed: Not reported
Tank Location: 5
Tank Type: Steel/carbon steel
Date Test: 03/24/2010
Register: True
Modified By: BKFALVEY
Last Modified: 05/16/2011

HIST UST:

PBS Number: 2-356050
SPDES Number: Not reported
Emergency Contact: SCHOOL SAFETY
Emergency Telephone: (212) 979-3300
Operator: PLANT OPERATION
Operator Telephone: (718) 391-6000
Owner Name: CITY OF NEW YORK C/O BOARD OF EDUCATION
Owner Address: 28-11 QUEENS PLAZA NORTH
Owner City,St,Zip: LONG ISLAND CITY, NY 11101
Owner Telephone: (718) 391-6832
Owner Type: Local Government
Owner Subtype: Not reported
Mailing Name: BOARD OF EDUCATION
Mailing Address: 28-11 QUEENS PLAZA NORTH
Mailing Address 2: 5TH FLOOR
Mailing City,St,Zip: LONG ISLAND CITY, NY 11101
Mailing Contact: FRANK CARDELLO NTROL
Mailing Telephone: (718) 391-6832
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
or not at the facility.

Facility Addr2: AVENUE X / BATCHELDER ST
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: SCHOOL
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 06/21/2000
Expiration Date: 06/28/2003
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 20000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 10000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 05/03/2000
Next Test Date: 05/03/2005
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: 21
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: In Service

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Install Date: Not reported
Capacity (gals): 10000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: 11/01/1994
Next Test Date: 11/01/1999
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Horner EZ Check
Deleted: False
Updated: True
Lat/long: Not reported

SPILLS:

Facility ID: 1101592
DER Facility ID: 403664
Facility Type: ER
Site ID: 449055
DEC Region: 2
Spill Number: 1101592
Spill Date: 5/12/2011
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: RVKETANI
Referred To: 051112 REVIEWED AKRF LNAPL MNGMNT LETTER
Reported to Dept: 5/12/2011
CID: Not reported
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 5/12/2011
Spill Record Last Update: 5/15/2012
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: ALEX LEMPERT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Contact Phone:

(718) 472-8501

DEC Memo:

5/12/11 - Raphael Ketani. The spill is a slow seep through the boiler pit wall from the outside. I spoke to Becky Kinal of AKRF (914) 922-2362 regarding the nature of the spill. She said that AKRF was recently given the case as part of the capitol improvement project for the School Construction Authority. Drew Pardis of SCA is the contact there. From what the super of the school told her, the seep has been going on for years. It's just a slow seep through the boiler pit wall and the boiler pit is below the water table. The fuel tanks were tested during March 2010 and passed. AKRF took a sample of the black oil. Ms. Kinal said that AKRF will put together an investigation proposal and submit it to the DEC for review and approval. I told her that sounded fine. The PBS registration is #2-356050. There are two 10,000 gal. USTs with #4 oil. Tank #1 is due for a tightness test on 3/24/15. Tank #2 is overdue for a tank test. It was supposed to have taken place on 12/13/10. 5/17/11 - Raphael Ketani. I spoke to Ms. Kinal (914) 922-2362. She said that they will install one boring between the building wall and each tank. They will also install one boring at each fill port. She had also sent me by e-mail passing tank system tightness test reports dated 3/24/10. I told her to proceed with the work. 6/6/11 - Raphael Ketani. I received the 5/25/11 AKRF Spill Investigation Proposal for the site. I reviewed it and found the proposal to be deficient. I had the following comments: 1) If product is present in a well, then a groundwater sample should not be taken, but, instead, product collection should start soon after the discovery. 2) Why are no borings planned along the fill lines to the tanks? 3) Why is TW-4 temporary and why is it going to be so small a diameter? It should be permanent and larger. 4) Permanent, larger diameter wells should be installed inside and outside the boiler room in order to determine groundwater flow and in order to provide access for product collection. 5) Development should consist of alternating pumping to the surface with backflushing - not just pumping to the surface. This will ensure good circulation through the well screens. Also, the longer the development continues, the better the water circulation. 6) TW-4 should be developed as a permanent well and should be sampled at the same time as the other permanent wells. This will insure that the same groundwater conditions are present during the sampling event in all wells. 7) Groundwater sampling should be performed one month after well development. 8) The DEC does not need category A deliverables, just data summary tables and the raw data. 9) Groundwater elevations must be determined and a flow map must be constructed and submitted to the DEC with the SIR. I sent the comments by e-mail to Ms. Kinal. 6/23/11 - Raphael Ketani. I received the 6/14/11 AKRF Spill Investigation Proposal/Scope of Work. I reviewed the proposal and found that it addressed the 9 comments I had from the 5/25/11 AKRF SIP. I sent an e-mail to Ms. Kinal indicating that the DEC had approved the document and to start the work as soon as possible. 7/13/11 - Raphael Ketani. Ms. Kinal sent me an e-mail that the well installation will start on 7/18/11 outside the building. 7/27/11 - Raphael Ketani. I spoke to Ms. Kinal (914) 922-2362 today. She said that all of the borings outside the building were completed and permanent wells were installed at each location. No contamination was detected in the soil samples, except right above the water table. Soil samples were sent off for analysis. The inside borings are still being done. One boring had PID detections for the soil samples that were taken under the slab. However, there are no

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

ambient air PID hits.7/27/11 - Raphael Ketani. SYNOPSIS OF CASE TO DATE:The spill was originally called in on 5/12/11 as a petroleum seep into the boiler room pit. There has been a slow seep through the boiler room pit wall for many years, according to the super. The basement floor is 9'7" below the first floor. The boiler pit floor is 3'6" below the basement floor. The water table is 2 feet above the boiler pit floor, or 11 feet below ground level. The tanks contain #4 oil and both had successful tightness tests on 3/24/10. Borings were first performed outside the building on 7/18/11. Contamination was noted in the soil samples right above the water table. AKRF is waiting for the analytical results for the soil samples that were sent to the lab. The first inside boring was started on 7/27/11. Contamination was detected in the soil samples from this boring. There are no ambient air PID detections. Groundwater sampling is scheduled to take place during August 2011.8/2/11 - Raphael Ketani. I spoke to Drew Pardus (646) 577-8280, consultant to the NYC SCA. He said that the boring installations were completed last week. He believes that the soil analytical results will be received by AKRF next week. There was nothing else to report.8/18/11 - Raphael Ketani. I received the data summary tables for the soil samples that were taken on 7/18/11 and 7/27/11. The samples were taken from 7 boring locations. Locations GB-1 to GB-4 were taken on the earlier date, and next to the fuel tanks, which are outside of the school's footprint. Locations GB-5 to GB-7 were taken on the latter date and within the school footprint. Samples GB-1 to GB-5 were almost entirely non-detect for VOCs. However, GB-1-12 and GB-2-13 had many low concentration VOC hits with 2 slight exceedences each. These samples were from the saturated zone. GB-5 was from the saturated zone and was positioned just outside of the boiler room. The GB-6 and GB-7 borings were performed just inside the school and on the other side of the school exterior wall from the tanks. Each sample from these borings had a number of low VOCs hits and low exceedences for ethylbenzene and n-propylbenzene. Regarding the SVOCs, the samples from GB-1 to GB-5 were almost entirely non-detect, except the samples from GB-2 and GB-5-2 (unsaturated zone). These samples had many moderate exceedences of the benzo series analytes and their combustion products. GB-2 is between the tank and the outside school wall. GB-5-2 had benzo(a)anthracene and chrysene hits which were similar to those from GB-6 and GB-7. It also contained a low naphthalene exceedence. The samples from GB-6 and GB-7 had a number of low concentration SVOC hits and low to moderate exceedences of benzo(a)anthracene, chrysene and naphthalene. Samples from the saturated zone appeared to have been as affected as the shallow samples.8/19/11 - Raphael Ketani. I spoke to Drew Pardus (646) 577-8280 regarding the soil results. I told him that the results from samples GB-5 to GB-7 suggested the presence of some oil as there were naphthalene exceedences. Mr. Pardus responded that there had been an old spill case with a fill line failure. I asked him when the DEC will receive the groundwater sample results. He said that groundwater sampling had been pushed back to 8/30/11.I looked up the old spill reports. One was #0001390 and had taken place as a TTF. The spill date was 5/3/00 and the call in date was 5/4/00. It was closed and referred to a later spill report - #0101806.Spill #0101806 took place on 3/3/01 as a TTF, but was not reported to the DEC until 5/16/01. It was a release of #2 oil. One 10,000 gal. UST system had failed. A 10/3/01 report in the e-docs states that 6 borings were done on 3/3/01 around the tanks in a "U" shaped fashion. Only the soil and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

groundwater samples from boring B-3 (next to the north or left tank) had hits. B-3 was in the vicinity of the fill port and was taken from the 11 to 12 foot interval. Samples from borings B-4 to B-6 had slight odors and minor PID hits. B-3 had numerous VOC hits in the soil sample and the groundwater sample. The fill line to the suspect tank system had been installed in the 1950s and was beyond its useful life. So it was suspected as the cause of the leak. The consultants sent the SCA a proposal to do at least a dig out and replacement of the fill line to the one tank.8/31/11 - Raphael Ketani. I contacted Mr. Pardus (646) 577-8280 and spoke to him about the site. I asked him whether the groundwater sampling took place on 8/30/11 as scheduled. He said that he didn't know whether it had taken place, but he believed it should have. I told him that the DEC will wait for the results.9/12/11 - Raphael Ketani. I contacted Mr. Pardus (646) 577-8280 regarding the groundwater results. He said that the SCA had received them and that they are under review. He hoped to send the results to the DEC in a week or two.9/20/11 - Raphael Ketani. Mr. Pardus hand delivered the July and August 2011 soil and groundwater analytical results. I reviewed the analytical results and the groundwater flow maps that were also contained in the package. The soil samples were taken on 7/18/11 and on 7/27/11 and were almost entirely non-detect for VOCs, except for GB 1-12, GB 2-13, GB 6-2, GB 6-5, GB 7-2 and GB 7-4. Each of these soil samples had a few low to moderate VOC exceedences of the CP-51 standards. The exceedences were typically for 1,2,4-trimethylbenzene, ethylbenzene, and n-propylbenzene. For the SVOCs, most of the samples were again essentially non-detect, except for those from GB 1-12, GB 2-11, GB 2-13, GB 5-2, GB 6-2, GB 6-5, GB 7-2 and GB 7-4. Typically, these samples had 3 or 4 low to moderate exceedences of naphthalene, chrysene, and benzo(a)anthracene. However, acenaphthene, anthracene, fluoranthene, fluorene, phenanthrene, and pyrene were present as low hits. In particular, GB 2-11 and GB 2-13 had many low level SVOC exceedences. Groundwater samples were collected on 7/27/11 and on 8/25/11. Product was present at MW-1. So no sample was collected. The samples were almost entirely non-detect for VOCs or had very low hits, except for the samples from TW-6 and TW-7. These samples had 8 and 6 low to moderate exceedences of the CP-51 VOC standards. The SVOCs were almost entirely non-detect. The samples from both TW-6 and TW-7 both had low level chrysene exceedences and some oil indicator analyte hits. Groundwater flow during 8/25/11 was to the northwest, to the northeast during 9/13/11 and to the southeast (towards the center of the school) during 9/16/11. Mr. Pardus commented that, except for slight oil odors in the boiler room, no significant PID hits were detected in the school. He also stated that further investigation will take place in the vicinity of MW-1 to determine why there is oil at this location and how extensive it is.10/4/11 - Raphael Ketani. I spoke to Mr. Pardus (646) 577-8280 regarding further investigation of the site. He said that the SCA is putting together a draft work plan for the additional investigation work in the vicinity of MW-1. A sock was recently put into MW-1 to catch the oil. The DEC should receive the work plan in the near future.10/20/11 - Raphael Ketani. I spoke to Mr. Pardus (646) 577-8280. He said that the draft work plan is still being written. He wasn't sure when the DEC would receive the work plan. 4/11/12 - Raphael Ketani. I finished my review of the AKRF 3/21/12 Subsurface Investigation Report. The report contained the same soil and groundwater analyses as had previously been reported to the Department. There were no additional chemical results. Staff from

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

AKRF recognized that free product may still be under the school from a historic fill line leak that happened during 2001 (#0101806). This was the fill line to the north tank (UST #2). The fingerprint analysis indicated that the product was either weathered fuel oil or #5 oil. In the report, AKRF remarks that this is consistent with weathered #4 oil which had thickened. They include a picture of a product seep showing black oil. As figure #3 shows, there are significant exceedences for VOCs and naphthalene in the soil at GB-1, GB-6 and GB-7. VOC exceedences in the groundwater are present at TW-6 and TW-7 with 1,2,4-trimethylbenzene reaching 120 ppb. However, the other VOCs are in the double digits and are not significantly above the standards. They propose to do 6 more borings and turn them into wells in order to further delineate the soil and groundwater contamination. The borings would be to the north, south and east of the USTs and would be both outside and within the school footprint. The borings would be as follows: 2 in the Brown Street sidewalk; 1 southeast of UST #1 in the Brown Street sidewalk; 1 in the basement boiler room east of GB-5 and GB-6; and 2 in the basement storage area east of UST #2. If additional contamination is found, then more borings may be performed. I approved the Subsurface Investigation Report and the plan to conduct contaminant delineation and drafted a letter for the approval of Hassan Hussein, EE III of the Department. Mr. Hussein approved the letter and it went out today to Ms. Gutterman, Deputy Director IEH Division of the SCA, and to Ms. Kinal. 5/11/12 - Raphael Ketani. I reviewed the AKRF 5/7/12 letter which was a response to the DEC 4/11/12 letter. In their letter, they state that the NYCSCA, AKRF, NYCDOE and the school custodians will have a meeting to discuss how to collect, dispose of and report the oil seepage into the tank room. Also, socks will be put in all wells having greater than 1/4 inch of product. There will be weekly fluid level monitoring. After one month of monitoring, AKRF will send a report to the DEC regarding the quantities of oil recovered. If the amounts of oil in the wells are decreasing, then AKRF will ask for less frequent monitoring. The funding for this work is expected to be available in 6 to 8 weeks. Lastly, the letter stated that the supplemental investigation will be carried out to assess the extent of the impacts. A RAP will be developed based upon the results of the supplemental investigation, the proposed Supplemental Site Investigation and fluid level monitoring. This will all happen once the funding is in place. The RAP will be submitted in September 2012. I drafted a letter to Ms. Kinal for Mr. Hussein's review approving the work plan contained in the letter. 5/15/12 - Raphael Ketani. The letter was approved by Mr. Hussein and was sent out today.

Not reported

Remarks:

unknown petro leaking into basement of school

Material:

Site ID: 449055
Operable Unit ID: 1199275
Operable Unit: 01
Material ID: 2195639
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERMEDIATE SCHOOL 14 - BROOKLYN (Continued)

U001839964

Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

53
North
1/8-1/4
0.205 mi.
1083 ft.

NYCHA - SHEEPSHEAD
3661 NOSTRAND AVE
BROOKLYN, NY 11229

RCRA-NonGen **1001224050**
FINDS **NYR000052662**
MANIFEST

Relative:
Higher

RCRA-NonGen:

Actual:
10 ft.

Date form received by agency: 01/01/2007
Facility name: NYCHA - SHEEPSHEAD
Facility address: 3661 NOSTRAND AVE
BROOKLYN, NY 11229
EPA ID: NYR000052662
Mailing address: BROADWAY
NEW YORK, NY 10007
Contact: FRANK OCELLO
Contact address: BROADWAY
NEW YORK, NY 10007
Contact country: US
Contact telephone: (212) 306-3229
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: NYCHA
Owner/operator address: 250 BROADWAY 16TH FLOOR
NEW YORK, NY 10007
Owner/operator country: US
Owner/operator telephone: (212) 306-3229
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYCHA
Owner/operator address: 250 BROADWAY 16TH FLOOR
NEW YORK, NY 10007
Owner/operator country: US
Owner/operator telephone: (212) 306-3229
Legal status: Municipal

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYCHA - SHEEPSHEAD (Continued)

1001224050

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: NYCHA - SHEEPSHEAD
Classification: Not a generator, verified

Date form received by agency: 03/30/1998
Facility name: NYCHA - SHEEPSHEAD
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004541620

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYR000052662
Country: USA
Mailing Name: NYCHA SHEEPSHEAD HOUSES
Mailing Contact: R VALEZ
Mailing Address: 250 BROADWAY16TH FLR
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10007
Mailing Zip4: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYCHA - SHEEPSHEAD (Continued)

1001224050

Mailing Country: USA
Mailing Phone: 212-306-3142

Document ID: NJA2788497
Manifest Status: Not reported
Trans1 State ID: NJ0000027193
Trans2 State ID: Not reported
Generator Ship Date: 05/15/1998
Trans1 Recv Date: 05/15/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 05/15/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000052662
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported
TSDF ID: S5811
Waste Code: U240 - 2,4 D,SALTS + ESTERS
Quantity: 00150
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: CW - Wooden boxes
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: U240 - 2,4 D,SALTS + ESTERS
Quantity: 00110
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 98

L54
NNE
1/8-1/4
0.223 mi.
1175 ft.

CON ED - VS 2836
2998 AVE X
BROOKLYN, NY 11235
Site 3 of 3 in cluster L

RCRA-NonGen **1007206162**
MANIFEST **NYP004004792**

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 02/28/1998
Facility name: CON ED - VS 2836
Facility address: 2998 AVE X
BROOKLYN, NY 112350000
EPA ID: NYP004004792
Mailing address: CONSOLIDATED EDISON INC
4 IRVING PL RM 300
NEW YORK, NY 100030000
Contact: ANTHONY DRUMMINGS
Contact address: CONSOLIDATED EDISON INC
NEW YORK, NY 100030000
Contact country: US
Contact telephone: (212) 460-3770
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CON ED - VS 2836 (Continued)

1007206162

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 02/27/1998
Facility name: CON ED - VS 2836
Classification: Not a generator, verified

Date form received by agency: 02/26/1998
Facility name: CON ED - VS 2836
Classification: Large Quantity Generator

Violation Status: No violations found

NY MANIFEST:

EPA ID: NYP004004792
Country: USA
Mailing Name: CONSOLIDATED EDISON
Mailing Contact: FRANKLIN MURRAY
Mailing Address: 4 IRVING PLACE RM 828
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 212-460-2808

Document ID: NYB8466687
Manifest Status: Completed copy
Trans1 State ID: GX3213
Trans2 State ID: Not reported
Generator Ship Date: 970203
Trans1 Recv Date: 970203
Trans2 Recv Date: Not reported
TSD Site Recv Date: 970204
Part A Recv Date: 970221
Part B Recv Date: 970212
Generator EPA ID: NYP004004792
Trans1 EPA ID: NYD006982359
Trans2 EPA ID: Not reported
TSDF ID: NYD980593636

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CON ED - VS 2836 (Continued)

1007206162

Waste Code: B003 - PETROLEUM OIL WITH 500 PPM OR > PCB
Quantity: 01125
Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 97

**55
NW
1/8-1/4
0.234 mi.
1236 ft.**

**2710 AVENUE X
AT SYNOGUE-GATE-SIDEWALK
BROOKLYN, NY**

**HIST LTANKS S101341126
N/A**

**Relative:
Higher**

HIST LTANKS:

**Actual:
11 ft.**

Region of Spill: 2
Spill Number: 9410038
Spill Date: 10/27/1994
Spill Time: 10:00
Spill Cause: Tank Failure
Resource Affectd: Air
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/27/94
Cleanup Ceased: 10/27/94
Cleanup Meets Standard: True
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 10/27/94
Reported to Department Time: 10:34
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: SYNOGUE
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Local Agency
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2710 AVENUE X (Continued)

S101341126

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/05/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: A LOT SPILLED-A ODOR STRONG-ABC OIL DOING CLEANUP-DEP HAS HAZMAT NOTIFIED.

56
South
1/8-1/4
0.234 mi.
1236 ft.

2752 E. 28TH STREE T
2752 E. 28TH STREET
BROOKLYN, NY

NY Spills **S102149691**
NY Hist Spills **N/A**

Relative:
Higher

SPILLS:

Facility ID: 9415639
DER Facility ID: 262609
Facility Type: ER
Site ID: 325991
DEC Region: 2
Spill Number: 9415639
Spill Date: 3/2/1995
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/2/1995
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 3/2/1995
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: 3/2/1995
Cleanup Meets Std: True

Actual:
19 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2752 E. 28TH STREE T (Continued)

S102149691

Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/17/1995
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: PETRO - DRIVER
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: AREA CLEANED BY DRIVER - SPEEDY DRY

Material:

Site ID: 325991
Operable Unit ID: 1012858
Operable Unit: 01
Material ID: 370819
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9415639
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/02/1995 14:00
Reported to Dept Date/Time: 03/02/95 14:36
SWIS: 61

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2752 E. 28TH STREE T (Continued)

S102149691

Spiller Name: PETRO - DRIVER
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 03/02/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/02/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/17/95
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: AREA CLEANED BY DRIVER - SPEEDY DRY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

57
SW
1/8-1/4
0.238 mi.
1256 ft.

**JAMES BEATRICE
4648 BEDFORD AVE
BROOKLYN, NY**

**NY Spills S104647730
NY Hist Spills N/A**

**Relative:
Higher**

**Actual:
10 ft.**

SPILLS:

Facility ID: 9806366
DER Facility ID: 237507
Facility Type: ER
Site ID: 293431
DEC Region: 2
Spill Number: 9806366
Spill Date: 8/22/1998
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/16/2006
SWIS: 2401
Investigator: NEPUTNAM
Referred To: Not reported
Reported to Dept: 8/22/1998
CID: 207
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/22/1998
Spill Record Last Update: 5/16/2006
Spiller Name: Not reported
Spiller Company: JAMES BEATRICE
Spiller Address: 4648 BEDFORD AVE
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: JAMES BEATRICE
Contact Phone: (718) 934-5431
DEC Memo: 5/16/06- Mike - Contacted owner, no longer has records of tank test.
Contacted Petro Oil, no spill occurred during tank failure, had tank repaired and tested again on 3/2/1999 which it passed. Also passed another test is 2001. 3/16/06 - Nathan - 718-934-5431 owner needs to be contacted. Prior to Sept, 2004 data translation this spill
Lead_DEC Field was "M TIBBE"

Remarks: TANK VALVE ON TANK FAILED - SERVICE MAN ON SCENE

Material:

Site ID: 293431
Operable Unit ID: 1067546
Operable Unit: 01
Material ID: 317528
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES BEATRICE (Continued)

S104647730

Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9806366
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/22/1998 21:30
Reported to Dept Date/Time: 08/22/98 21:54
SWIS: 61
Spiller Name: JAMES BEATRICE
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: JAMES BEATRICE
Spiller Phone: (718) 934-5431
Spiller Address: 4648 BEDFORD AVE
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JAMES BEATRICE (Continued)

S104647730

Date Spill Entered In Computer Data File: 08/22/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/26/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: TANK VALVE ON TANK FAILED - SERVICE MAN ON SCENE

**M58
NW
1/4-1/2
0.270 mi.
1425 ft.**

**221215; 2502 AVE X
2502 AVE X
BROOKLYN, NY
Site 1 of 2 in cluster M**

**NY Spills S110750493
N/A**

**Relative:
Higher**

SPILLS:

Facility ID: 1009061
DER Facility ID: 397468
Facility Type: ER
Site ID: 442488
DEC Region: 2
Spill Number: 1009061
Spill Date: 4/23/2010
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/30/2011
SWIS: 2401
Investigator: DMPOKRZY
Referred To: Not reported
Reported to Dept: 6/30/2010
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False

**Actual:
12 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

221215; 2502 AVE X (Continued)

S110750493

UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/24/2010
Spill Record Last Update: 11/24/2010
Spiller Name: ERT DESK
Spiller Company: CON EDISON
Spiller Address: 5030 BROADWAY
Spiller City,St,Zip: New York, NY
Spiller Company: 001
Contact Name: ERT DESK
Contact Phone: (212) 580-8383
DEC Memo: 3/30/2011 - See eDocs for Con Ed report detailing cleanup and closure.
Not reported
Remarks: Street Address = F/O 2502 AVE X Spill Volume = 3 Unit of Measure =
Ounces (Fluid) Substance Name = Dielectric Fluid - Distribution Feeder
(Cable Oil) Cause Reason = Aged equipment Status Reason = Operational
Necessity for Business Units Other Than S&TO or SSO

Material:
Site ID: 442488
Operable Unit ID: 1192990
Operable Unit: 01
Material ID: 2188532
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

59
NNW
1/4-1/2
0.270 mi.
1428 ft.

**SAMA HOME
2326 EAST 28TH STREET
BROOKLYN, NY**

**NY Spills S108638862
N/A**

**Relative:
Higher**

SPILLS:
Facility ID: 0704062
DER Facility ID: 333556
Facility Type: ER
Site ID: 384144
DEC Region: 2

**Actual:
11 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAMA HOME (Continued)

S108638862

Spill Number: 0704062
Spill Date: 7/10/2007
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/29/2007
SWIS: 2401
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 7/11/2007
CID: 444
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/11/2007
Spill Record Last Update: 10/29/2007
Spiller Name: MR SAMA
Spiller Company: SAMA HOME
Spiller Address: 2326 EAST 28TH STREET
Spiller City,St,Zip: BROOKLYN, NY
001
Contact Name: MR SAMA
Contact Phone: (718) 934-1278
DEC Memo: Mr. Sama lives next to the "Problem House - 2326 East 28th St, Brooklyn"Houses are attached with driveways and garage doors right next to each other.Problem House is owned by Ronald Michaels 2326 East 28th St, Brooklyn NY 11229Owner's brother lives in the basement apartment and runs an auto repair operation out of the garage. He changes oil for customers and leaves open pails of oil on the driveway which overflow when it rains. Oil runs into the street and onto the other driveway.Case forwarded to DEC Encon Police for a "drive by" inspection.
Remarks: ABOVE ADDRESS NIEGHBOR CHANGES HIS OIL AND IT GOES ON MR SAMA'S PROPERTY:
Material:
Site ID: 384144
Operable Unit ID: 1141454
Operable Unit: 01
Material ID: 2131667
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAMA HOME (Continued)

S108638862

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

**M60
NW
1/4-1/2
0.287 mi.
1513 ft.**

**4433 BEDFORD AVENUE
4433 BEDFORD AVENUE
BROOKLYN, NY**

**HIST LTANKS
NY Spills**

**S102672551
N/A**

Site 2 of 2 in cluster M

**Relative:
Higher**

HIST LTANKS:

**Actual:
12 ft.**

Region of Spill: 2
Spill Number: 9405332
Spill Date: 07/19/1994
Spill Time: 12:30
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/19/94
Cleanup Ceased: 07/19/94
Cleanup Meets Standard: True
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 07/19/94
Reported to Department Time: 13:50
SWIS: 62
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: MAX MALTZER
Spiller Address: 4433 BEDFORD AVENUE
Spiller City,St,Zip: BROOKLYN, NEW YORK
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 743-0543
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4433 BEDFORD AVENUE (Continued)

S102672551

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/14/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: CUSTOMER DID NOT USE ANY FUEL-DRIVER DEPENDED ON VENT WHISTLE. SPILL BEING
CLEANED WITH SPEEDI DRI AND SORBRNT PADS.

SPILLS:

Facility ID: 9405332
DER Facility ID: 102191
Facility Type: ER
Site ID: 117477
DEC Region: 2
Spill Number: 9405332
Spill Date: 7/19/1994
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/19/1994
SWIS: 2401
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 7/19/1994
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: 7/19/1994
Cleanup Meets Std: True
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4433 BEDFORD AVENUE (Continued)

S102672551

Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/14/1994
Spill Record Last Update: 10/28/2009
Spiller Name: Not reported
Spiller Company: MAX MALTZER
Spiller Address: 4433 BEDFORD AVENUE
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MARTINKAT"
Remarks: CUSTOMER DID NOT USE ANY FUEL-DRIVER DEPENDED ON VENT WHISTLE. SPILL BEING CLEANED WITH SPEEDI DRI AND SORBRNT PADS.

Material:
Site ID: 117477
Operable Unit ID: 1002538
Operable Unit: 01
Material ID: 381923
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

61
WNW
1/4-1/2
0.287 mi.
1517 ft.

2454 EAST 24TH STREET
2454 EAST 24TH STREET
BROOKLYN, NY

NY Spills **S102149313**
NY Hist Spills **N/A**

Relative:
Higher

SPILLS:
Facility ID: 9413279
DER Facility ID: 200844
Facility Type: ER
Site ID: 244510
DEC Region: 2
Spill Number: 9413279

Actual:
12 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2454 EAST 24TH STREET (Continued)

S102149313

Spill Date: 1/4/1995
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 1/5/1995
SWIS: 2401
Investigator: MMMULQUE
Referred To: Not reported
Reported to Dept: 1/5/1995
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Affected Persons
Cleanup Ceased: 1/5/1995
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/27/1995
Spill Record Last Update: 3/22/1995
Spiller Name: Not reported
Spiller Company: APRA FUEL CO.
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MULQUEEN"
Remarks: UNK. AMOUNT OF FUEL SPILLED BY OIL COMPANY, NAMED ABOVE, HAS NOT BEEN
CLEANED YET - NYCDEP SENDING REPRESENTATIVE TO INSPECT SITUATION.
NOTE: APRA FAILED TO NOTIFY & LEFT SCENE
Material:
Site ID: 244510
Operable Unit ID: 1006918
Operable Unit: 01
Material ID: 564251
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2454 EAST 24TH STREET (Continued)

S102149313

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9413279
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/04/1995 13:00
Reported to Dept Date/Time: 01/05/95 13:13
SWIS: 61
Spiller Name: APRA FUEL CO.
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: 01/05/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/05/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/27/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/22/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2454 EAST 24TH STREET (Continued)

S102149313

Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: UNK. AMOUNT OF FUEL SPILLED BY OIL COMPANY, NAMED ABOVE, HAS NOT BEEN CLEANED YET - NYCDEP SENDING REPRESENTATIVE TO INSPECT SITUATION. NOTE: APRA FAILED TO NOTIFY LEFT SCENE

**62
SW
1/4-1/2
0.299 mi.
1579 ft.**

**2662 EAST 24TH STREET
2662 EAST 24TH STREET
BROOKLYN, NY**

**LTANKS S102233270
HIST LTANKS N/A**

**Relative:
Higher**

LTANKS:
Site ID: 157257
Spill No: 9512870
Spill Date: 1/15/1996
Spill Cause: Tank Failure
Spill Source: Private Dwelling
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

**Actual:
10 ft.**

Spill Closed Dt: 1/16/1996
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: NIEVES
Referred To: Not reported
Reported to Dept: 1/16/1996
CID: 282
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1/16/1996
Spill Record Last Update: 2/2/1996
Spiller Name: STEVE SCHLISSEL
Spiller Company: SAME
Spiller Address: Not reported
Spiller City,St,Zip: NY 11235-
Spiller County: 001
Spiller Contact: STEVE SCHLISSEL
Spiller Phone: (718) 332-4444
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 133003
DEC Memo: Not reported
Remarks: tank developed a leak causing the spill.tank was a 275 gallon

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2662 EAST 24TH STREET (Continued)

S102233270

tank.they made a temporary repair for now.spill was cleaned up with
speedy dry and pigs.2 family dwelling house..

Material:

Site ID: 157257
Operable Unit ID: 1027207
Operable Unit: 01
Material ID: 356607
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 18
Units: Gallons
Recovered: 18
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9512870
Spill Date: 01/15/1996
Spill Time: 13:00
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Possible release with minimal potential for fire or hazard or Known
release with no damage. DEC Response. Willing Responsible Party.
Corrective action taken.
Spill Closed Dt: 01/16/96
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: NIEVES
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 01/16/96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2662 EAST 24TH STREET (Continued)

S102233270

Reported to Department Time: 15:06
SWIS: 61
Spiller Contact: STEVE SCHLISSEL
Spiller Phone: (718) 332-4444
Spiller Extention: Not reported
Spiller Name: SAME
Spiller Address: Not reported
Spiller City,St,Zip: NY 11235-
Spiller Cleanup Date: / /
Facility Contact: STEVE SCHLISSEL
Facility Phone: (718) 332-4444
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/16/96
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/02/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 18
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 18
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: WIFE SAID, CLEANED UP TO THEIR SATISFACTION - OIL CO 1/2 HR.
Spill Cause: tank developed a leak causing the spill.tank was a 275 gallon tank.they made a temporary repair for now.spill was cleaned up with speedy dry and pigs.2 family dwelling house..

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

N63
NE
1/4-1/2
0.301 mi.
1588 ft.

CON ED
AVE X & COYLE ST
BROOKLYN, NY
Site 1 of 2 in cluster N

NY Spills S107407953
N/A

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 0301713
DER Facility ID: 239797
Facility Type: ER
Site ID: 296331
DEC Region: 2
Spill Number: 0301713
Spill Date: 5/16/2003
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/12/2004
SWIS: 2401
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 5/17/2003
CID: 257
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/17/2003
Spill Record Last Update: 10/14/2004
Spiller Name: MR SCHLAGEL
Spiller Company: CON ED
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: MANHATTAN, NY
Spiller Company: 001
Contact Name: RON ELLIOTT
Contact Phone: (212) 580-6763
DEC Memo: Con Ed e2mis #148395:5-16-03 2015 HRS T. BULLEN # 17094 MECH "A" FOD REPORTS WHILE FOD WAS SENT TO LOCATION TO CHECK (21) MANHOLE FIRE IN MH57243 S/S AVE "X" 21' E/O COYLE ST. HE FOUND THE FIRE DEPT ON LOCATION (THERE WAS NO FIRE AND A LITTLE SMOKE) AND THERE WAS BLOWN 3C PAPER CABLE (FAULT ON O/A TROUBLE FDR. 10B64) 1 PINT DIELECTRIC FLUID ON 200 GALLON WATER IN STRUCTURE. FIRE DEPT LEFT LOCATION. HE DOES NOT SEE SEWER CONNECTION OR SUMP AT THIS TIME. LIQUID WAS CONTAINED, NO SEWERS OR WATERWAYS AFFECTED. HE TOOK A LIQUID SAMPLE AND REQUESTED EMERG PRIORITY FOR PCB SAMPLE RESULTS. CLEANUP PENDING SAMPLE RESULT. Lab Sequence Number: 03-04120-001, Aroclor 1260 < 1.0 ppmUPDATE @ 0643 HRS BLOWN CABLE IN STRUCTURE ON FDR 10B64. FDR TO BE RESTORED BY LIVE END CAP IN ANOTHER STRUCTURE. CLEANUP TO BEGIN AFTER FDR10B64 IS BACK IN SERVICE.UPDATE 5-18-03 2000 HRS S. DANTONE MECH "A" FLUSH DEPT REPORTS HE DOUBLE WASH STRUCTURE WITH BIO-JEN 760. THEY REMOVED ALL LIQUID AND SOLID WITH HIS VACTOR. THEY FOUND A SUMP THAT HAD BEEN CEMENTED , THEY RECEMENTED SUMP (NO SIGNS OF OIL IN SUMP) THEY LEFT E.S.TAG IN PLACE UNTIL UG REMOVES (CUTS OUT) LEAKING 3 C PAPER CABLE (FAULT ON FDR.) FROM STRUCTURE.20-NOV-2003 18:07

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CON ED (Continued)

S107407953

HRS.ENVIR. FLUSH DEPT. MECH-A T.SACCARA EMP# 05393 REPORTS:STRUCTURE DBL. WASHED WITH BIO-GEN 760. SUMP FOUND CEMENTED IN STRUCTURES. UPDATE: 11/21/03 - 0630AS PER FDR REP C. THUILOIT, U.G. REPORTS LEAKING JT CUT & REMOVED.

Remarks: was within the 24hr program - manhole #57243 ref #148395

Material:

Site ID: 296331
Operable Unit ID: 869737
Operable Unit: 01
Material ID: 506201
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

N64
NE
1/4-1/2
0.301 mi.
1588 ft.

VAULT # 46275 HAS EARTHEN SUMP.
COYLE STREET & AVENUE X
BROOKLYN, NY

NY Spills S108956731
N/A

Site 2 of 2 in cluster N

Relative:
Higher

SPILLS:

Facility ID: 0708889
DER Facility ID: 339453
Facility Type: ER
Site ID: 389876
DEC Region: 2
Spill Number: 0708889
Spill Date: 11/15/2007
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/28/2007
SWIS: 2401
Investigator: gdbreen
Referred To: Not reported
Reported to Dept: 11/15/2007
CID: 76
Water Affected: Not reported

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT # 46275 HAS EARTHEN SUMP. (Continued)

S108956731

Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/15/2007
Spill Record Last Update: 12/28/2007
Spiller Name: Not reported
Spiller Company: CON EDISON
Spiller Address: W COYLE ST/AVE X
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: ERT DESK
Contact Phone: (212) 580-8383
DEC Memo: 12/28/07 - See eDocs for Con Ed report detailing cleanup and closure.208883. see eDocs
Remarks: caller reports spill in vault with earthen sump. west side of coyle st -317 ft south of ave x. no to questions 1-4;unknown to 5. ref #208883.

Material:
Site ID: 389876
Operable Unit ID: 1147000
Operable Unit: 01
Material ID: 2137390
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 2
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

65
North
1/4-1/2
0.314 mi.
1656 ft.

NOSTRAND AV @ AVE W
NOSTRAND AV @ AVE W
NEW YORK CITY, NY

NY Spills
NY Hist Spills
S102560504
N/A

Relative:
Higher

Actual:
11 ft.

SPILLS:

Facility ID: 9614967
DER Facility ID: 68882
Facility Type: ER
Site ID: 73113
DEC Region: 2
Spill Number: 9614967
Spill Date: 3/26/1997
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/29/2005
SWIS: 2401
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 3/27/1997
CID: 201
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/27/1997
Spill Record Last Update: 3/29/2005
Spiller Name: CALLER
Spiller Company: CON ED
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003
Spiller Company: 001
Contact Name: CALLER
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was
"O'CONNELL"E2MIS 105680FRANK PERROTTA #07468 REPORTS ON FDR10B63
FOUND IN MH#57011 E/S NOSTRAND AVE 23' S/O AVE W LESS THAN 1-GALLON
OF OIL ON 1" OF MUD ON FLOOR & WALLS. UNKNOWN SOURCE. SAMPLE TAKEN &
PICKED UP BY BULLIT. E.S.TAG#11206 PLACED. SPILL CONTAINED TO HOLE.
UPDATE: 3/27/97 - 2230S. GIOIA - 38918 - FLUSH REPORTS 16 PPM CLEANUP
INCOMPLETE DUE TO THE ABSENCE OF A CEMENT FLOOR IN THE SUMP. MR.
GIOIA WAS INSTRUCTED TO CLEAN THE HOLE AND, AFTER CLEANING THE HOLE,
TO TAKE A SOIL SAMPLE. HE WAS ALSO TOLD TO LEAVE THE E.S. TAG IN
PLACE.update 3/29/97 1750 hrs soil results came back shows 45ppm pcb
will need to remove more dirt and seal sump with cement. S.ROSENKING
REPORTS CLEAN UP COMPLETE & SUMP SEALED WITH CEMENT ENVIROMENTAL STOP
TAG #11206 REMOVED.April 11, 2004 9:22 PMOPERATING SUPERVISOR J.
DEKANCHUK REPORTS SUMP CEMENT SEAL WAS BROKEN UP AND SUMP DUG OUT.
TWO COMPOSIT SAMPLES WERE TAKEN, ONE FROM THE BOTTOM AND ONE FROM THE
WALL.EXCESS SOIL WAS PLACED BACK INTO SUMP AND SUMP WAS SEALED WITH
CEMENT. SAMPLES WERE TAKEN TO ASTORIA CHEM LAB FOR PCB
ANALYSIS.UPDATE 5-4-04 07:10 HRS.LSN 04-03220-001MATRIX: SOIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND AV @ AVE W (Continued)

S102560504

COMPOSITESUMP BOTTOM < 1.PPMLSN 04-03220-002MATRIX SOIL COMPOSITESUMP
WALLS < 1.PPM
Remarks: APPROX 1 GAL FROM ELE FEEDER CABLES/SOAKED INTO DIRE/IS BEINGCLEANED
UP AT THIS TIME

Material:
Site ID: 73113
Operable Unit ID: 1042532
Operable Unit: 01
Material ID: 340064
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9614967
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/26/1997 17:30
Reported to Dept Date/Time: 03/27/97 22:42
SWIS: 61
Spiller Name: CON ED
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: MANHATTAN, NY 10003-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NOSTRAND AV @ AVE W (Continued)

S102560504

Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/27/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/31/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: APPROX 1 GAL FROM ELE FEEDER CABLES/SOAKED INTO DIRE/IS BEING CLEANED UP AT THIS TIME

66
SSW
1/4-1/2
0.325 mi.
1714 ft.

4766 BEDFORD AVE
4766 BEDFORD AVENUE
BROOKLYN, NY

NY Spills S106009358
N/A

Relative:
Higher

SPILLS:

Facility ID: 0208536
DER Facility ID: 67127
Facility Type: ER
Site ID: 70811
DEC Region: 2
Spill Number: 0208536
Spill Date: 11/18/2002
Spill Cause: Deliberate

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4766 BEDFORD AVE (Continued)

S106009358

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Date: Not Closed

SWIS: 2401

Investigator: SFRAHMAN

Referred To: Not reported

Reported to Dept: 11/18/2002

CID: 204

Water Affected: Not reported

Spill Source: Private Dwelling

Spill Notifier: Affected Persons

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 1

Date Entered In Computer: 11/18/2002

Spill Record Last Update: 9/30/2009

Spiller Name: YAKOV SHTIVELBERG

Spiller Company: 4766 BEDFORD AVE

Spiller Address: 4766 BEDFORD AVENUE

Spiller City,St,Zip: BROOKLYN, NY

Spiller Company: 001

Contact Name: ROBERT HOFFER

Contact Phone: (718) 934-1537

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TIPPLE"11/02 site visit, tank had been moved on the site and was actively leaking,contractor called for cleanup contractor doing work:Yakov Shtivelberg, Boyard Contracting 1100 coney Island AveBrooklyn, NY 112304/8/03 letter sent requiring cleanup documentation/ 11/9/05 Kuldeep gupta contacted the facility and talked to Caller.Contractor has done some Cleanup, and New Building is there. 1/3/06- Kuldeep Gupta talked to Caller, he told me there is no smell and no tank. New concrete slab is in that Lot and Building havingcouple of Floors. First Floor occupied by Medical Doctor's office and other Floorshave Luxury Apt's. Caller have no more complaint. It is recommended to close this spill.Austin - Spill project assignment transferred from Albany staff to Rahman, for further review and action. - end

Remarks: UNDER CONSTRUCTION AREA

Material:

Site ID: 70811

Operable Unit ID: 861534

Operable Unit: 01

Material ID: 515540

Material Code: 0001A

Material Name: #2 Fuel Oil

Case No.: Not reported

Material FA: Petroleum

Quantity: 0

Units: Gallons

Recovered: No

Resource Affected: Not reported

Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4766 BEDFORD AVE (Continued)

S106009358

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

67
WNW
1/4-1/2
0.326 mi.
1719 ft.

MANHOLE 58475
BEDFORD AVE/AVE X
BROOKLYN, NY

NY Spills
NY Hist Spills

S104284019
N/A

Relative:
Higher

Actual:
13 ft.

SPILLS:

Facility ID: 9909884
DER Facility ID: 150805
Facility Type: ER
Site ID: 179689
DEC Region: 2
Spill Number: 9909884
Spill Date: 11/15/1999
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/29/2002
SWIS: 2401
Investigator: COMENALE
Referred To: Not reported
Reported to Dept: 11/15/1999
CID: 312
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/15/1999
Spill Record Last Update: 3/29/2002
Spiller Name: Not reported
Spiller Company: CON EDISON
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: 1/2 PINT ON 400GAL OF WATER - CASE #129989

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE 58475 (Continued)

S104284019

Material:

Site ID: 179689
Operable Unit ID: 1088585
Operable Unit: 01
Material ID: 298950
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9909884
Investigator: COMENALE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/15/1999 11:30
Reported to Dept Date/Time: 11/15/99 11:59
SWIS: 61
Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: MANHATTAN, NY 10003-
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE 58475 (Continued)

S104284019

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/15/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/15/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: 1/2 PINT ON 400GAL OF WATER - CASE 129989

68
SSE
1/4-1/2
0.338 mi.
1783 ft.

**AQUILINA, RES.
2779 BATCH ELDA STREET
BROOKLYN, NY**

**LTANKS S101341194
HIST LTANKS N/A**

**Relative:
Higher**

LTANKS:

Site ID: 329735
Spill No: 9411458
Spill Date: 11/27/1994
Spill Cause: Tank Failure
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/28/1994
Facility Addr2: Not reported
Cleanup Ceased: 11/28/1994
Cleanup Meets Standard: True
SWIS: 2401
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 11/28/1994

**Actual:
9 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AQUILINA, RES. (Continued)

S101341194

CID: Not reported
Water Affected: Not reported
Spill Notifier: Affected Persons
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1/12/1995
Spill Record Last Update: 11/10/2003
Spiller Name: Not reported
Spiller Company: SAME
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 265291
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "MARTINKAT"
Remarks: SLIGHT LEAK AT BOTTOM OF TANK - OWNER WILL REPAIR TANK.

Material:

Site ID: 329735
Operable Unit ID: 1009336
Operable Unit: 01
Material ID: 373803
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9411458
Spill Date: 11/27/1994
Spill Time: 12:15

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AQUILINA, RES. (Continued)

S101341194

Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/28/94
Cleanup Ceased: 11/28/94
Cleanup Meets Standard: True
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 11/28/94
Reported to Department Time: 15:05
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: SAME
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 769-5516
Facility Extention: Not reported
Spill Notifier: Affected Persons
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/12/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AQUILINA, RES. (Continued)

S101341194

Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: SLIGHT LEAK AT BOTTOM OF TANK - OWNER WILL REPAIR TANK.

O69
East
1/4-1/2
0.353 mi.
1865 ft.

CONEY ISLAND STP/BKLYN
KNAPP & AVE Z
NEW YORK CITY, NY

NY Spills **S102145100**
NY Hist Spills **N/A**

Site 1 of 7 in cluster O

Relative:
Higher

Actual:
10 ft.

SPILLS:
Facility ID: 8803801
DER Facility ID: 110736
Facility Type: ER
Site ID: 128348
DEC Region: 2
Spill Number: 8803801
Spill Date: 8/1/1988
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 8/1/1988
SWIS: 2401
Investigator: MANDALA
Referred To: Not reported
Reported to Dept: 8/1/1988
CID: Not reported
Water Affected: SHELLBANK CREEK
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: 8/1/1988
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/2/1988
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: UNKNOWN WHITE MILKY SUBSTANCE APPROXIMATELY 50 SQUARE FT AND EXPANDING(1) DEAD DUCK & (2) OR MORE DEAD HORSESHOE CRABS.

Material:
Site ID: 128348
Operable Unit ID: 920981

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND STP/BKLYN (Continued)

S102145100

Operable Unit: 01
Material ID: 459332
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 40
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8803801
Investigator: MANDALA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/01/1988 09:30
Reported to Dept Date/Time: 08/01/88 10:47
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHELLBANK CREEK
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 08/01/88
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND STP/BKLYN (Continued)

S102145100

UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 08/01/88
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/02/88
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 40
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Remark: UNKNOWN WHITE MILKY SUBSTANCE APPROXIMATELY 50 SQUARE FT AND EXPANDING 1) DEAD DUCK 2) OR MORE DEAD HORSESHOE CRABS.

O70
East
1/4-1/2
0.353 mi.
1865 ft.

CONEY ISLAND WWT/BKLYN
KNAPP ST & AVE Z
NEW YORK CITY, NY
Site 2 of 7 in cluster O

NY Spills **S102141103**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
10 ft.

SPILLS:
Facility ID: 9101791
DER Facility ID: 80267
Facility Type: ER
Site ID: 87615
DEC Region: 2
Spill Number: 9101791
Spill Date: 5/14/1991
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 5/14/1991
SWIS: 2401
Investigator: NEWMAN
Referred To: Not reported
Reported to Dept: 5/14/1991
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WWT/BKLYN (Continued)

S102141103

Cleanup Ceased: 5/14/1991
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/15/1991
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: NYC WASTEWATER TREATMENT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: 27KV TRANSFORMER,4YRS OLD, SPILL ON CONCRETE,IN HOUSE CLEAN UP.

Material:

Site ID: 87615
Operable Unit ID: 955375
Operable Unit: 01
Material ID: 424329
Material Code: 0016A
Material Name: NON PCB OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: 2
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9101791
Investigator: NEWMAN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/14/1991 12:15

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WWT/BKLYN (Continued)

S102141103

Reported to Dept Date/Time: 05/14/91 15:33
SWIS: 61
Spiller Name: NYC WASTEWATER TREATMENT
Spiller Contact: Not reported
Spiller Phone: (718) 743-0990
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 05/14/91
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 05/14/91
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/15/91
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 2
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NON PCB OIL
Class Type: NON PCB OIL
Times Material Entry In File: 2798
CAS Number: Not reported
Last Date: 19940928
DEC Remarks: Not reported
Remark: 27KV TRANSFORMER,4YRS OLD, SPILL ON CONCRETE,IN HOUSE CLEAN UP.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O71
East
1/4-1/2
0.353 mi.
1865 ft.
CONEY ISLAND PLANT/BKLYN
KNAPP ST & AVE Z
NEW YORK CITY, NY
Site 3 of 7 in cluster O

NY Spills
NY Hist Spills
S102144876
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 8707960
DER Facility ID: 80267
Facility Type: ER
Site ID: 87614
DEC Region: 2
Spill Number: 8707960
Spill Date: 12/14/1987
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 12/14/1987
SWIS: 2401
Investigator: CANZIANI
Referred To: Not reported
Reported to Dept: 12/15/1987
CID: Not reported
Water Affected: PAERDEGAT BASIN
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 12/14/1987
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1/15/1988
Spill Record Last Update: 3/13/1989
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: CON ED FEEDER TRIPPED OUT. ENDING TIME 12/15/87 (05:30).

Material:

Site ID: 87614
Operable Unit ID: 913565
Operable Unit: 01
Material ID: 463360
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT/BKLYN (Continued)

S102144876

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8707960
Investigator: CANZIANI
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/14/1987 23:50
Reported to Dept Date/Time: 12/15/87 10:23
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: PAERDEGAT BASIN
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 12/14/87
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 12/14/87
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/15/88
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/13/89
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT/BKLYN (Continued)

S102144876

Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: Hazardous Material
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: CON ED FEEDER TRIPPED OUT. ENDING TIME 12/15/87 05:30).

072
East
1/4-1/2
0.353 mi.
1865 ft.

CONEY IS. BYPASS 5/7/86
AVE Z&KNAPP ST.
NEW YORK CITY, NY

Site 4 of 7 in cluster O

NY Spills **S102143936**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
10 ft.

SPILLS:
Facility ID: 8600906
DER Facility ID: 102575
Facility Type: ER
Site ID: 118003
DEC Region: 2
Spill Number: 8600906
Spill Date: 5/7/1986
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 5/9/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 5/7/1986
CID: Not reported
Water Affected: PAERDEGAT BASIN
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 5/9/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/9/1986
Spill Record Last Update: 8/31/1987
Spiller Name: Not reported
Spiller Company: NYC
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY IS. BYPASS 5/7/86 (Continued)

S102143936

Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: BAR SCREENS DAMAGED-TREATMENT PLANT BYPASSED
Material:
Site ID: 118003
Operable Unit ID: 897170
Operable Unit: 01
Material ID: 477472
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 8600906
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/07/1986 08:00
Reported to Dept Date/Time: 05/07/86 10:50
SWIS: 61
Spiller Name: NYC
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: PAERDEGAT BASIN
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY IS. BYPASS 5/7/86 (Continued)

S102143936

Cleanup Ceased: 05/09/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 05/09/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/09/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/31/87
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: BAR SCREENS DAMAGED-TREATMENT PLANT BYPASSED

O73
East
1/4-1/2
0.353 mi.
1865 ft.

AVE Z & KNAPP ST. BKLYN./
AVENUE Z & KNAPP STREET
BROOKLYN, NY

Site 5 of 7 in cluster O

NY Spills
NY Hist Spills
S103560194
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:
Facility ID: 8606829
DER Facility ID: 206762
Facility Type: ER
Site ID: 266505
DEC Region: 2
Spill Number: 8606829
Spill Date: 2/5/1987
Spill Cause: Other
Spill Class: Not reported
Spill Closed Date: 2/6/1987
SWIS: 2401
Investigator: UNASSIGNED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST. BKLYN./ (Continued)

S103560194

Referred To: Not reported
Reported to Dept: 2/6/1987
CID: Not reported
Water Affected: PAERDEGAT BASIN
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 2/6/1987
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/12/1987
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: 12" CROSS CONNECTION BETWEEN SANITARY SEWAR AND STORM
SEWAR/PAERDEGAT7TH ST. WAS DISCOVERED BY HAZEN AND SAWYER,COSULTANTS
FOR PDGT BASIN

Material:

Site ID: 266505
Operable Unit ID: 904422
Operable Unit: 01
Material ID: 472387
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: Yes
Resource Affected: Not reported
Oxygenate: False
Site ID: 266505
Operable Unit ID: 904422
Operable Unit: 01
Material ID: 472388
Material Code: 0063A
Material Name: UNKNOWN HAZARDOUS MATERIAL
Case No.: Not reported
Material FA: Hazardous Material
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST. BKLYN./ (Continued)

S103560194

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8606829
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/05/1987
Reported to Dept Date/Time: 02/06/87 13:14
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Other
Reported to Dept: Surface Water
Water Affected: PAERDEGAT BASIN
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 02/06/87
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 02/06/87
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/12/87
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST. BKLYN./ (Continued)

S103560194

Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: -1
Unkonwn Quantity Recovered: False

Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414

CAS Number: Not reported
Last Date: 19940929
Material Class Type: Nonpetroleum/Nonhazardous
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: UNKNOWN HAZARDOUS MATERIAL
Class Type: UNKNOWN HAZARDOUS MATERIAL
Times Material Entry In File: 2093
CAS Number: Not reported
Last Date: 19940728

DEC Remarks: Not reported

Remark: 12 CROSS CONNECTION BETWEEN SANITARY SEWAR AND STORM SEWAR/PAERDEGAT7TH ST.
WAS DISCOVERED BY HAZEN AND SAWYER,COSULTANTS FOR PDGT BASIN

O74
East
1/4-1/2
0.353 mi.
1865 ft.

CONEY ISLAND PLANT
AV Z @ KNAPP ST
NYC, NY
Site 6 of 7 in cluster O

NY Spills **S102142358**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 8806576
DER Facility ID: 103380
Facility Type: ER
Site ID: 118998
DEC Region: 2
Spill Number: 8806576
Spill Date: 11/6/1988
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 2/15/1995
SWIS: 2401
Investigator: MANDALA
Referred To: Not reported
Reported to Dept: 11/6/1988
CID: Not reported
Water Affected: SHELLBANK CREEK
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 2/15/1995

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT (Continued)

S102142358

Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/14/1987
Spill Record Last Update: 2/16/1995
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: SEWAGE SPILLED INTO CREEK; HYDRAULIC CONTROL PROBLEM. DEP REPAIRED PROBLEM.

Material:

Site ID: 118998
Operable Unit ID: 923408
Operable Unit: 01
Material ID: 454913
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8806576
Investigator: MANDALA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/06/1988 09:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT (Continued)

S102142358

Reported to Dept Date/Time: 11/06/88 16:16
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: SHELLBANK CREEK
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 02/15/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known
release with no damage. DEC Response. Willing Responsible Party.
Corrective action taken.
Spill Closed Dt: 02/15/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/14/87
Date Spill Entered In Computer Data File: Not reported
Update Date: 02/16/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: SEWAGE SPILLED INTO CREEK; HYDRAULIC CONTROL PROBLEM. DEP REPAIRED PROBLEM.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

O75
East
1/4-1/2
0.353 mi.
1865 ft.
AVE Z & KNAPP ST
AVE Z & KNAPP ST
NEW YORK CITY, NY
Site 7 of 7 in cluster O

NY Spills
NY Hist Spills
S102143884
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 8603593
DER Facility ID: 238487
Facility Type: ER
Site ID: 294667
DEC Region: 2
Spill Number: 8603593
Spill Date: 9/1/1986
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 9/1/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 9/1/1986
CID: Not reported
Water Affected: SHEEPSHEAD BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 9/1/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/9/1986
Spill Record Last Update: 12/15/1997
Spiller Name: Not reported
Spiller Company: CONEY ISLAND STP
Spiller Address: KNAPP ST
Spiller City,St,Zip: BROOKLYN, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: SHIT PUMP SHAFT BROKEN

Material:

Site ID: 294667
Operable Unit ID: 900840
Operable Unit: 01
Material ID: 476420
Material Code: 0630A
Material Name: NONENE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S102143884

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 8603259
DER Facility ID: 238487
Facility Type: ER
Site ID: 294665
DEC Region: 2
Spill Number: 8603259
Spill Date: 8/15/1986
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 8/16/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 8/16/1986
CID: Not reported
Water Affected: JAMAICA BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 8/16/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/10/1986
Spill Record Last Update: 8/31/1987
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: INCOMING GATE OPEN

Material:

Site ID: 294665
Operable Unit ID: 900534
Operable Unit: 01
Material ID: 476090
Material Code: 0630A
Material Name: NONENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S102143884

Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 8603593
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/01/1986 13:00
Reported to Dept Date/Time: 09/01/86 14:02
SWIS: 61
Spiller Name: CONEY ISLAND STP
Spiller Contact: Not reported
Spiller Phone: (718) 743-0540
Spiller Address: KNAPP ST
Spiller City,St,Zip: BROOKLYN
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 09/01/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S102143884

Spill Class: Not reported
Spill Closed Dt: 09/01/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/09/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/15/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NONENE
Class Type: NONENE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: SHIT PUMP SHAFT BROKEN

Region of Spill: 2
Spill Number: 8603259
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/15/1986 13:00
Reported to Dept Date/Time: 08/16/86 08:30
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: JAMAICA BAY
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 08/16/86
Cleanup Meets Std: True
Last Inspection: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S102143884

Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 08/16/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/10/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/31/87
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NONENE
Class Type: NONENE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: INCOMMING GATE OPEN

Region of Spill: 2
Spill Number: 8600120
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/04/1986 06:15
Reported to Dept Date/Time: 04/04/86 15:37
SWIS: 61
Spiller Name: N.Y.C. DEP.
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: Surface Water
Water Affected: PAERDEGATE BASIN
Spill Source: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S102143884

Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 04/04/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 04/04/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/22/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/31/87
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Not reported
Quantity Spilled: Not reported
Unkonwn Quantity Spilled: Not reported
Units: Not reported
Quantity Recovered: Not reported
Unkonwn Quantity Recovered: Not reported
Material: Not reported
Class Type: Not reported
Times Material Entry In File: Not reported
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: CONDOMS,ETC.
Remark: APPROX. 110 MGD FLOW

76
NNW
1/4-1/2
0.354 mi.
1870 ft.

PRIVATE HOME
2282 EAST 27TH STREET
BROOKLYN, NY

NY Spills S109206778
N/A

Relative:
Higher

SPILLS:

Actual:
12 ft.

Facility ID: 0805062
DER Facility ID: 351307
Facility Type: ER
Site ID: 402094
DEC Region: 2
Spill Number: 0805062
Spill Date: 8/1/2008
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE HOME (Continued)

S109206778

Willing Responsible Party. Corrective action taken.
Spill Closed Date: 8/11/2008
SWIS: 2401
Investigator: vszhune
Referred To: Not reported
Reported to Dept: 8/1/2008
CID: 444
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/1/2008
Spill Record Last Update: 8/11/2008
Spiller Name: Not reported
Spiller Company: PRIVATE HOME
Spiller Address: 2282 EAST 27TH STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: EDWARD
Contact Phone: (917) 453-7528
DEC Memo: 8/1/08 - Raphael Ketani. Edward called me back. He said that he had taken his family out of his home at 2280 E. 27 Street because the "oil" odors were very strong in his house next door. He said that him and a neighbor noticed the strong odors two days ago. A Con Ed meter reader visited the basement of 2282 two days ago and left because he found oil and water in the basement. The NYFD was called and they came to investigate. They couldn't get access to the house. So they went to 2284 to check the odors. They reported to him that the odors smelled like oil. Edward said that he works with oil based paint and the odor smells like oil, too. He said that two old women live there. The house has broken windows and a tree growing up through the stairs. I told him that a DEC inspector will visit the site on 8/2/08. I asked him whether 10AM would be a good time for him to meet the inspector. He said "Yes", and that he will be there. I told Randall Austin, Chief of the Spills Unit, about the problem with the owners of 2282 refusing access. He told Hassan Ahmed (EE 1 in the Spills Unit) to get ahold of a lieutenant at the ECO office and arrange for an ECO to meet him and Veronic Zhune (EE 1 Spills) at the site tomorrow. Mr. Ahmed went to make the arrangements. 08/02/08- ECO Capt. Thomas (718)-4742509, Ahmed and Zhune responded to this site. The Homeowner from 2282 East 27th st. did not allow DEC people to get in her house to do the inspection. She refused to open the door. Capt. Thomas said that he could not do anything because ECO can not force people to open doors. As per neighbors Edward and Eleomora oil odors are more perceptibles when is very hot and humid. The houses with # 2284 and # 2280 were inspected. No oil spill, no oil odors, no oil stains were found. Spill Closed
Remarks: HOUSE AT ABOVE ADDRESS IS LEAKING OIL AND EDWARD SAYS ITS TOO STRONG AND SOMETHING NEEDS TO BE DONE
Material:
Site ID: 402094
Operable Unit ID: 1158865

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIVATE HOME (Continued)

S109206778

Operable Unit: 01
Material ID: 2149967
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

P77
South
1/4-1/2
0.370 mi.
1956 ft.
4085 NOSTRAND AVE.
4085 NOSTRAND AVE.
BROOKLYN, NY
Site 1 of 3 in cluster P

NY Hist Spills **S102143293**
N/A

Relative:
Lower

NY Hist Spills:

Actual:
6 ft.

Region of Spill: 2
Spill Number: 9207441
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/28/1992 08:00
Reported to Dept Date/Time: 09/28/92 08:59
SWIS: 61
Spiller Name: EXXON
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4085 NOSTRAND AVE. (Continued)

S102143293

Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: True
Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/29/92
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/16/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported
Remark: METER IN DISPENSER LEAKING ALVIN PETRO CO. TO MAKE REPAIRS AS NECESSARY EXXON
ENGINEER PATRICK LAM TO CONTACT CONTRACTOR FOR CLEANUP.

P78
South
1/4-1/2
0.370 mi.
1956 ft.

EXXON STATION
4085 NOSTRAND AV
BROOKLYN, NY
Site 2 of 3 in cluster P

LTANKS
HIST LTANKS
MANIFEST
NY Spills
NY Hist Spills
S102150034
N/A

Relative:
Lower

Actual:
6 ft.
LTANKS:
Site ID: 196233
Spill No: 9110971
Spill Date: 1/23/1992
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/10/1992
Facility Addr2: Not reported
Cleanup Ceased: 3/10/1992
Cleanup Meets Standard: False
SWIS: 2401

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 1/23/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 2/6/1992
Spill Record Last Update: 9/19/2003
Spiller Name: Not reported
Spiller Company: EXXONMOBIL
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 163482
DEC Memo: Not reported
Remarks: 4K PRECISION PETROTITE

Material:

Site ID: 196233
Operable Unit ID: 964757
Operable Unit: 01
Material ID: 416042
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 196233
Spill Tank Test: 1539547
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 9110971

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Spill Date: 01/23/1992
Spill Time: 13:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Not reported
Spill Closed Dt: 03/10/92
Cleanup Ceased: 03/10/92
Cleanup Meets Standard: True
Investigator: SULLIVAN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 01/23/92
Reported to Department Time: 14:20
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/06/92
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/10/92
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 03/10/92: RECV D LETTER FROM EXXON- PBLM WAS WITH PUMP, RECTIFIED AND RETESTED
ON 1/28/92 AND PASSED.,
Spill Cause: 4K PRECISION PETROTYTE

NY MANIFEST:

EPA ID: NYD986894178
Country: USA
Mailing Name: EXXON COMPANY USA
Mailing Contact: CHRISTINE COLUCCIO
Mailing Address: 1900 HEMPSTEAD TURNPIKE
Mailing Address 2: Not reported
Mailing City: EAST MEADOW
Mailing State: NY
Mailing Zip: 11554
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 516-864-1772

NY MANIFEST:

No Manifest Records Available

SPILLS:

Facility ID: 9207441
DER Facility ID: 163482
Facility Type: ER
Site ID: 196234
DEC Region: 2
Spill Number: 9207441
Spill Date: 9/28/1992
Spill Cause: Equipment Failure
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 9/19/2003
SWIS: 2401
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 9/28/1992
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Date Entered In Computer: 9/29/1992
Spill Record Last Update: 9/19/2003
Spiller Name: MELISSA WINSOR
Spiller Company: EXXONMOBIL
Spiller Address: 3225 GALLOWS ROAD
Spiller City,St,Zip: FAIRFAX, VA 22037-
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: METER IN DISPENSER LEAKING ALVIN PETRO CO. TO MAKE REPAIRS AS
NECESSARY EXXON ENGINEER PATRICK LAM TO CONTACT CONTRACTOR FOR
CLEANUP.

Material:

Site ID: 196234
Operable Unit ID: 974349
Operable Unit: 01
Material ID: 408084
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9105130
DER Facility ID: 163482
Facility Type: ER
Site ID: 196232
DEC Region: 2
Spill Number: 9105130
Spill Date: 8/12/1991
Spill Cause: Equipment Failure
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/10/1992
SWIS: 2401
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 8/12/1991

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Tank Tester
Cleanup Ceased: 3/10/1992
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 8/19/1991
Spill Record Last Update: 9/19/2003
Spiller Name: Not reported
Spiller Company: EXXON
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: NYC REQUIRED DISCHARGE LINE TEST; PETROTITE -.018

Material:

Site ID: 196232
Operable Unit ID: 959304
Operable Unit: 01
Material ID: 424163
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9105130
Investigator: SULLIVAN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/12/1991 13:00
Reported to Dept Date/Time: 08/12/91 13:00
SWIS: 61
Spiller Name: EXXON
Spiller Contact: Not reported
Spiller Phone: (800) 992-3647
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Tank Tester
PBS Number: Not reported
Cleanup Ceased: 03/10/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 03/10/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/19/91
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/10/92
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 03/10/92: 3/10/92 REFER TO SPILL 9110971.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Remark: NYC REQUIRED DISCHARGE LINE TEST; PETROTITE -.018

Region of Spill: 2
Spill Number: 9501239
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/28/1995 16:30
Reported to Dept Date/Time: 04/28/95 16:57
SWIS: 61
Spiller Name: SAME
Spiller Contact: Not reported
Spiller Phone: (718) 981-9046
Spiller Address: Not reported
Spiller City,St,Zip: BROOKLYN, NY 11236
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: True
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/22/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/25/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 2
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 09/25/95: SPILL CAME INTO OFFICE AFTER HOURS - SIGONA ON DUTY.
Remark: LEAK IN DISPENSER - DISPENSER TAKEN OUT OF SERVICE - CONTRACTOR ENROUTE TO
CLEAN UP REPAIR.

Region of Spill: 2
Spill Number: 9612355
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/16/1997 07:00
Reported to Dept Date/Time: 01/16/97 07:34
SWIS: 61
Spiller Name: EXXON STATION
Spiller Contact: ANDRE SAKHARNY
Spiller Phone: (718) 891-9046
Spiller Contact: ANDRE SAKHARNY
Spiller Phone: (718) 891-9046
Spiller Address: 4085 NOSTRAND AV
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/16/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/21/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (Continued)

S102150034

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Quantity Spilled: 0

Unkonwn Quantity Spilled: True

Units: Gallons

Quantity Recovered: 0

Unkonwn Quantity Recovered: True

Material: GASOLINE

Class Type: GASOLINE

Times Material Entry In File: 21329

CAS Number: Not reported

Last Date: 19940929

DEC Remarks: Not reported

Remark: CALLER SAYS HE HAS HAD PROBLEMS WITH PUMPS LEAKING AND TODAY HIS ALARMS ARE GOING OFF HE THINKS PUMPS ARE LEAKING ***** WOULD LIKE A CALL ASAP*****

79
NE
1/4-1/2
0.375 mi.
1980 ft.

**2356 BRAGG ST
BROOKLYN, NY**

**NY Spills S106017682
N/A**

**Relative:
Higher**

SPILLS:

Facility ID: 0305794

DER Facility ID: 113808

Facility Type: ER

Site ID: 132122

DEC Region: 2

Spill Number: 0305794

Spill Date: 8/30/2003

Spill Cause: Unknown

Spill Class: Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.

Spill Closed Date: 9/2/2003

SWIS: 2401

Investigator: TJDEMEO

Referred To: Not reported

Reported to Dept: 8/31/2003

CID: 257

Water Affected: Not reported

Spill Source: Private Dwelling

Spill Notifier: Local Agency

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 0

Date Entered In Computer: 8/31/2003

Spill Record Last Update: 9/2/2003

Spiller Name: Not reported

Spiller Company: UNKNOWN

Spiller Address: Not reported

Spiller City,St,Zip: NY

Spiller Company: 999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S106017682

Contact Name: MR DIAMOND
Contact Phone: (718) 998-2164
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "DEMEO"non regulated release
Remarks: being pumped into the storm sewer and the ground - hose is on ave"x" side of property

Material:
Site ID: 132122
Operable Unit ID: 874238
Operable Unit: 01
Material ID: 503033
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Q80
WSW
1/4-1/2
0.381 mi.
2013 ft.
2624 E. 22ND STREET
2624 E. 22ND STREET
BROOKLYN, NY
Site 1 of 3 in cluster Q

NY Hist Spills S103560696
N/A

Relative:
Higher

Actual:
10 ft.

NY Hist Spills:
Region of Spill: 2
Spill Number: 9502664
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/01/1995 16:00
Reported to Dept Date/Time: 06/01/95 16:44
SWIS: 61
Spiller Name: GETTY GAS STATION
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: A/F 2624 - JEROME/ANEZ

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2624 E. 22ND STREET (Continued)

S103560696

Spiller City,St,Zip: Not reported
Spill Cause: Other
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/16/95
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: DEC WAS WORKING A PILL AT GAS STATION - CALLER COMPLAINED OF ODOR OF GAS IN HOUSE. SHE SAID SHE SMELLED ODOR A YEAR AGO WANTS DEC TO TEST SOIL. NO PROBLEM NOW. C. TOMASELLO INVOLVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

Q81
WSW
1/4-1/2
0.381 mi.
2013 ft.

FORMER GETTY GAS STATION
2624 EAST 22ND ST
BROOKLYN, NY

LTANKS
NY Spills
NY Hist Spills

S102663264
N/A

Site 2 of 3 in cluster Q

Relative:
Higher

Actual:
10 ft.

LTANKS:

Site ID: 66770
Spill No: 9701020
Spill Date: 4/23/1997
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/3/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 4/23/1997
CID: 204
Water Affected: Not reported
Spill Notifier: Citizen
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/23/1997
Spill Record Last Update: 3/3/2003
Spiller Name: UNKNOWN
Spiller Company: GETTY GAS STATION
Spiller Address: AVENUE Z
Spiller City,St,Zip: BROOKLYN, NY 11235-
Spiller County: 001
Spiller Contact: CHRIS DAMBROSI
Spiller Phone: (718) 646-0869
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 63904
DEC Memo: Not reported
Remarks: CITIZEN CURRENTLY IN PROGRESS - CALLER HAS A STRONG SMELL OFGASOLINE
TODAY - HE HAS PIPES IN HIS YARD BECAUSE OF THE CLEANUPBUT TODAYS
SMELL IS VERY STRONG

Material:

Site ID: 66770
Operable Unit ID: 1043658
Operable Unit: 01
Material ID: 337582
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 66770
Spill No: 9701020
Spill Date: 4/23/1997
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/3/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 4/23/1997
CID: 204
Water Affected: Not reported
Spill Notifier: Citizen
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/23/1997
Spill Record Last Update: 3/3/2003
Spiller Name: UNKNOWN
Spiller Company: GETTY GAS STATION
Spiller Address: AVENUE Z
Spiller City,St,Zip: BROOKLYN, NY 11235-
Spiller County: 001
Spiller Contact: CHRIS DAMBROSI
Spiller Phone: (718) 646-0869
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 63904
DEC Memo: Not reported
Remarks: CITIZEN CURRENTLY IN PROGRESS - CALLER HAS A STRONG SMELL OF GASOLINE
TODAY - HE HAS PIPES IN HIS YARD BECAUSE OF THE CLEANUP BUT TODAY'S
SMELL IS VERY STRONG

Material:

Site ID: 66770

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Operable Unit ID: 1043658
Operable Unit: 01
Material ID: 337582
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 66770
Spill No: 9701020
Spill Date: 4/23/1997
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/3/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 4/23/1997
CID: 204
Water Affected: Not reported
Spill Notifier: Citizen
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/23/1997
Spill Record Last Update: 3/3/2003
Spiller Name: UNKNOWN
Spiller Company: GETTY GAS STATION
Spiller Address: AVENUE Z
Spiller City,St,Zip: BROOKLYN, NY 11235-
Spiller County: 001
Spiller Contact: CHRIS DAMBROSI
Spiller Phone: (718) 646-0869

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 63904
DEC Memo: Not reported
Remarks: CITIZEN CURRENTLY IN PROGRESS - CALLER HAS A STRONG SMELL OF GASOLINE TODAY - HE HAS PIPES IN HIS YARD BECAUSE OF THE CLEANUP BUT TODAY'S SMELL IS VERY STRONG

Material:

Site ID: 66770
Operable Unit ID: 1043658
Operable Unit: 01
Material ID: 337582
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

SPILLS:

Facility ID: 9704146
DER Facility ID: 63904
Facility Type: ER
Site ID: 258876
DEC Region: 2
Spill Number: 9704146
Spill Date: 7/8/1997
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Date: 7/9/1997
SWIS: 2401
Investigator: MMMULQUE
Referred To: Not reported
Reported to Dept: 7/8/1997
CID: 312
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Local Agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/8/1997
Spill Record Last Update: 12/30/1997
Spiller Name: Not reported
Spiller Company: FORMER GETTY GAS STATION
Spiller Address: 2624 EAST 22ND ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MULQUEEN"PIN JOB BEING OVERSEEN BY CPT.
Remarks: NOTIFIER STATED HEAVY ODOR OF GASOLINE EMINATING FROM THE STATION -
DEP HAZ-MAT ON THE WAY - STATION CLOSED ABOUT 3 YEARS AGO

Material:

Site ID: 258876
Operable Unit ID: 1050016
Operable Unit: 01
Material ID: 333403
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9502664
DER Facility ID: 63904
Facility Type: ER
Site ID: 242515
DEC Region: 2
Spill Number: 9502664
Spill Date: 6/1/1995
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Willing Responsible Party. Corrective action taken.

Spill Closed Date: 5/3/2005
SWIS: 2401
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 6/1/1995
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/16/1995
Spill Record Last Update: 5/9/2005
Spiller Name: Not reported
Spiller Company: GETTY GAS STATION
Spiller Address: A/F 2624 - JEROME/ANEZ
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT"2/18/04 -AUSTIN - REASSIGNED FROM TOMASELLO TO VOUGHT5/3/05-Vought-This spill closed and referred to open spill #9309371. See also closed spill #'s: 9108824, 9401301, 9413634, 9501297, 9502664, and open spill 9309371.

Remarks: DEC WAS WORKING A PILL AT GAS STATION - CALLER COMPLAINED OF ODOR OF GAS IN HOUSE. SHE SAID SHE SMELLED ODOR A YEAR AGO WANTS DEC TO TEST SOIL. NO PROBLEM NOW. C. TOMASELLO INVOLVED

Material:

Site ID: 242515
Operable Unit ID: 1013889
Operable Unit: 01
Material ID: 367722
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9704146
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/08/1997 04:00
Reported to Dept Date/Time: 07/08/97 07:08
SWIS: 61
Spiller Name: FORMER GETTY GAS STATION
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: 2624 EAST 22ND ST
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 07/09/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/08/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/30/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER GETTY GAS STATION (Continued)

S102663264

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: PIN JOB BEING OVERSEEN BY CPT.

Remark: NOTIFIER STATED HEAVY ODOR OF GASOLINE EMINATING FROM THE STATION - DEP HAZ-MAT
ON THE WAY - STATION CLOSED ABOUT 3 YEARS AGO

Q82
WSW
1/4-1/2
0.381 mi.
2013 ft.

2624 EAST 22ND STREET
2624 EAST 22ND STREET
BROOKLYN, NY

HIST LTANKS **S102555973**
N/A

Site 3 of 3 in cluster Q

Relative:
Higher

HIST LTANKS:

Region of Spill: 2
Spill Number: 9701020
Spill Date: 04/23/1997
Spill Time: 13:07
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /

Cleanup Ceased: / /

Cleanup Meets Standard: False

Investigator: TOMASELLO

Caller Name: Not reported

Caller Agency: Not reported

Caller Phone: Not reported

Caller Extension: Not reported

Notifier Name: Not reported

Notifier Agency: Not reported

Notifier Phone: Not reported

Notifier Extension: Not reported

Reported to Department Date: 04/23/97

Reported to Department Time: 13:07

SWIS: 61

Spiller Contact: CHRIS DAMBROSI

Spiller Phone: (718) 646-0869

Spiller Extention: Not reported

Spiller Name: GETTY GAS STATION

Spiller Address: AVENUE Z

Spiller City,St,Zip: BROOKLYN, NY 11235-

Spiller Cleanup Date: / /

Facility Contact: UNKNOWN

Facility Phone: () -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2624 EAST 22ND STREET (Continued)

S102555973

Facility Extention: Not reported
Spill Notifier: Citizen
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/23/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/24/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: CLEANUP. HE WAS WORKING IN HIS YARD, ODOR IS IN THE SOIL. REF. SPILL 9501297, 9413634 AND 9401301.

Spill Cause: CITIZEN CURRENTLY IN PROGRESS - CALLER HAS A STRONG SMELL OF GASOLINE TODAY - HE HAS PIPES IN HIS YARD BECAUSE OF THE CLEANUP BUT TODAYS SMELL IS VERY STRONG

R83
NNE
1/4-1/2
0.383 mi.
2023 ft.

SHEEPSHEAD/NOSTRAND
2955 AVENUE W
BROOKLYN, NY
Site 1 of 7 in cluster R

HIST LTANKS **S101174422**
N/A

Relative:
Higher

HIST LTANKS:

Actual:
11 ft.

Region of Spill: 2
Spill Number: 9407807
Spill Date: 09/12/1994
Spill Time: 12:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD/NOSTRAND (Continued)

S101174422

Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 09/12/94
Reported to Department Time: 14:28
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (212) 306-3142
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-474029
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/16/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 09/26/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: 002
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD/NOSTRAND (Continued)

S101174422

Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: WILL REPAIR AND RETEST - VISUAL LEAK

R84
NNE
1/4-1/2
0.383 mi.
2023 ft.

SHEEPS HEAD NOSTRAND
2273 BATCHELDER ST
BROOKLYN, NY

LTANKS
HIST LTANKS
NY Spills

S103558760
N/A

Site 2 of 7 in cluster R

Relative:
Higher

LTANKS:

Actual:
11 ft.

Site ID: 91885
Spill No: 9811418
Spill Date: 12/10/1998
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: jkkann
Referred To: CONSOLIDATED WITH 0007240, IWP RCVD 3/3/11
Reported to Dept: 12/10/1998
CID: 297
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1
Date Entered In Computer: 12/10/1998
Spill Record Last Update: 3/10/2011
Spiller Name: DON FORTE - NYC HOUSING
Spiller Company: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY 10007-001
Spiller Contact: DON FORTE - NYC HOUSING
Spiller Phone: (213) 306-3233
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 172183
DEC Memo: 12/27/05: This spill transferred from J.Kolleeny to S.Kraszewski.
Failed one test in 1998 and has passed its subsequent test in 2004.
Tank was installed in 1985, unsure of it's proximity and orientation
to other tanks. - SK02/03/06: This spill transferred from
S.Kraszewski to Q.Abidi.04/04/06: This spill transferred from Q.
Abidi to Koon Tang.12/30/09: spill transferred to J.Kann3/10/11:
J.Kann - Investigative work plan submitted on 3/3/11.

Remarks: NO CONTAMINATION FOUND

Material:

Site ID: 91885
Operable Unit ID: 1072283

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Operable Unit: 01
Material ID: 311718
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 91885
Spill Tank Test: 1546621
Tank Number: 3
Tank Size: 40000
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 91883
Spill No: 9106596
Spill Date: 9/18/1991
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 4/27/1995
Facility Addr2: Not reported
Cleanup Ceased: 4/27/1995
Cleanup Meets Standard: True
SWIS: 2401
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 9/18/1991
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 9/27/1991
Spill Record Last Update: 12/27/2005
Spiller Name: Not reported
Spiller Company: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

DEC Region: 2
DER Facility ID: 172183
DEC Memo: Not reported
Remarks: EXCAVATE, ISOLATE, REPAIR & RETEST. SEE SPILL # 9407807

Material:

Site ID: 91883
Operable Unit ID: 960834
Operable Unit: 01
Material ID: 564791
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 91883
Spill Tank Test: 1539066
Tank Number: 002
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 207516
Spill No: 9001735
Spill Date: 5/15/1990
Spill Cause: Tank Overfill
Spill Source: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 6/8/1994
Facility Addr2: Not reported
Cleanup Ceased: 6/8/1994
Cleanup Meets Standard: True
SWIS: 2401
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 5/15/1990
CID: Not reported
Water Affected: Not reported
Spill Notifier: Fire Department
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 5/17/1990

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Spill Record Last Update: 1/17/2003
Spiller Name: MR CARTER
Spiller Company: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 172183
DEC Memo: Not reported
Remarks: UNDERGROUND PIPE LEAKING INTO SEWER, BUILDING EVACUATED, USCG & NYC FD ON SCENE TRYING TO CONTAIN, BUILDING BELONGS TO CITY,TANK OVERFILL.

Material:

Site ID: 207516
Operable Unit ID: 941596
Operable Unit: 01
Material ID: 440058
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 4700
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 207516
Spill Tank Test: 1537073
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 91884
Spill No: 9612795
Spill Date: 1/28/1997
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/9/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SWKRASZE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Referred To: Not reported
Reported to Dept: 1/28/1997
CID: 312
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1/28/1997
Spill Record Last Update: 11/9/2005
Spiller Name: DAVE FORTE
Spiller Company: NYC HOUSING AUTHORITY
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: DAVE FORTE
Spiller Phone: (213) 306-8894
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 172183
DEC Memo: 11/09/05: This spill transferred from J.Kolleeny to S.Kraszewski.This
spill closed to consolidate with open spill #0007240.
Remarks: TANK FAILED

Material:

Site ID: Not reported
Operable Unit ID: Not reported
Operable Unit: Not reported
Material ID: Not reported
Material Code: Not reported
Material Name: Not reported
Case No.: Not reported
Material FA: Not reported
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

Tank Test:

Site ID: 91884
Spill Tank Test: 1544978
Tank Number: 001RED
Tank Size: 35155
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Horner EZ Check I or II

Site ID: 223958
Spill No: 9407807
Spill Date: 9/12/1994

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/9/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SWKRASZE
Referred To: Not reported
Reported to Dept: 9/12/1994
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 9/16/1994
Spill Record Last Update: 11/9/2005
Spiller Name: Not reported
Spiller Company: NYC HOUSING AUTHORITY
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 172183
DEC Memo: 11/09/05: This spill transferred from J.Kolleeny to S.Kraszewski.This
spill closed to consolidate with open spill #0007240.
Remarks: WILL REPAIR AND RETEST - VISUAL LEAK

Material:

Site ID: 223958
Operable Unit ID: 1005509
Operable Unit: 01
Material ID: 377268
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 223958
Spill Tank Test: 1543136
Tank Number: 002
Tank Size: 0
Test Method: 00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 9811418
Spill Date: 12/10/1998
Spill Time: 13:30
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 12/10/98
Reported to Department Time: 14:06
SWIS: 61
Spiller Contact: DON FORTE - NYC HOUSING
Spiller Phone: (213) 306-3233
Spiller Extention: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller City,St,Zip: NEW YORK, NY 10007-
Spiller Cleanup Date: / /
Facility Contact: DON FORTE - NYC HOUSING
Facility Phone: (213) 306-3233
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: 2-474029
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/10/98
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/14/99
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Tank:

PBS Number: Not reported
Tank Number: 3
Tank Size: 40000
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: NO CONTAMINATION FOUND

SPILLS:

Facility ID: 0007240
DER Facility ID: 172183
Facility Type: ER
Site ID: 91882
DEC Region: 2
Spill Number: 0007240
Spill Date: 9/20/2000
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/30/2009
SWIS: 2401
Investigator: jkkann
Referred To: CONSOLIDATED WITH 9811418
Reported to Dept: 9/20/2000
CID: 312
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/20/2000
Spill Record Last Update: 12/30/2009
Spiller Name: CALLER
Spiller Company: NYC HOUSING
Spiller Address: 123 WILLIAMS ST
Spiller City,St,Zip: NYC, NY 10038-
Spiller Company: 001
Contact Name: CALLER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Contact Phone: Not reported
DEC Memo: 11/09/05: This spill transferred from J.Kolleeny to S.Kraszewski.12/27/05: No post-exc data or history of investigation activity. Needs a tank closure assessment. - SK01/30/06: This spill transferred from S.Kraszewski to Q.Abidi.04/03/06: This spill transferred from Q. Abidi to Koon Tang.12/30/09: site reassigned to J.Kann and consolidated with 9811418
Remarks: REMOVED 2 30,000GAL UST'S - CONTAMINATED SOIL

Material:

Site ID: 91882
Operable Unit ID: 828103
Operable Unit: 01
Material ID: 548338
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9001731
DER Facility ID: 172183
Facility Type: ER
Site ID: 207515
DEC Region: 2
Spill Number: 9001731
Spill Date: 5/15/1990
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/8/1994
SWIS: 2401
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 5/15/1990
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 6/8/1994

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPS HEAD NOSTRAND (Continued)

S103558760

Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/22/1990
Spill Record Last Update: 10/8/2003
Spiller Name: Not reported
Spiller Company: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: OIL IN SEWERS & SOIL SATURATED, (1) 40K TANK, (2) 35K TANKS FILLED WITH #2 FUEL OIL, TRANSFER OF OIL TO 40K TANK CAUSED OVERFILL & SPILLAGE ONTO GROUND, STREET & SEWER.

Material:

Site ID: 207515
Operable Unit ID: 940023
Operable Unit: 01
Material ID: 440054
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 3000
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 207515
Spill Tank Test: 1537072
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R85
NNE
1/4-1/2
0.383 mi.
2023 ft.
SHEEPSHEAD & NOSTROM
2273 BATCHELDER ST
BROOKLYN, NY
Site 3 of 7 in cluster R

NY Hist Spills
S104789723
N/A

Relative:
Higher

Actual:
11 ft.

NY Hist Spills:
Region of Spill: 2
Spill Number: 0007240
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/20/2000 13:00
Reported to Dept Date/Time: 09/20/00 14:21
SWIS: 61
Spiller Name: NYC HOUSING
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Address: 123 WILLIAMS ST
Spiller City,St,Zip: NYC, NY 10038-
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/20/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/21/00
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD & NOSTROM (Continued)

S104789723

Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: REMOVED 2 30,000GAL UST S - CONTAMINATED SOIL

R86
NNE
1/4-1/2
0.383 mi.
2023 ft.

SHEEPSHEAD/NOSTRAND
2273 BATCHELDER ST
BKLYN, NY

HIST LTANKS **S100177047**
N/A

Site 4 of 7 in cluster R

Relative:
Higher

HIST LTANKS:

Actual:
11 ft.

Region of Spill: 2
Spill Number: 9106596
Spill Date: 09/18/1991
Spill Time: 11:30
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/27/95
Cleanup Ceased: 04/27/95
Cleanup Meets Standard: True
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 09/18/91
Reported to Department Time: 15:32
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-474029
Last Inspection: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD/NOSTRAND (Continued)

S100177047

Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/27/91
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/27/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: 002
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: EXCAVATE, ISOLATE, REPAIR RETEST. SEE SPILL 9407807

R87
NNE
1/4-1/2
0.383 mi.
2023 ft.

SHEEPSHEAD/NOSTRAND
2273 BATCHELDER STREET
NEW YORK CITY, NY

NY Hist Spills **S100146013**
N/A

Site 5 of 7 in cluster R

Relative:
Higher

NY Hist Spills:

Region of Spill: 2
Spill Number: 9001731
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/15/1990 00:30
Reported to Dept Date/Time: 05/15/90 01:20
SWIS: 61
Spiller Name: NYCHA
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported

Actual:
11 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD/NOSTRAND (Continued)

S100146013

Spill Cause: Unknown
Reported to Dept: In Sewer
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: 2-474029
Cleanup Ceased: 06/08/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/08/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/22/90
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/08/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 3000
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: 05/15/90: FENLY NICOL CALLED IN BY NYCHA TO DO CLEAN UP.
Remark: OIL IN SEWERS SOIL SATURATED, 1) 40K TANK, 2) 35K TANKS FILLED WITH 2
FUEL OIL, TRANSFER OF OIL TO 40K TANK CAUSED OVERFILL SPILLAGE ONTO
GROUND, STREET SEWER.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R88
NNE
1/4-1/2
0.383 mi.
2023 ft.
SHEEPSHEAD/NOSTRAND
2273 BATCHELDER STREET
NEW YORK CITY, NY
Site 6 of 7 in cluster R

HIST LTANKS **S106703434**
N/A

Relative:
Higher

Actual:
11 ft.

HIST LTANKS:

Region of Spill: 2
Spill Number: 9001735
Spill Date: 05/15/1990
Spill Time: 00:03
Spill Cause: Tank Overfill
Resource Affectd: In Sewer
Water Affected: Not reported
Spill Source: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/08/94
Cleanup Ceased: 06/08/94
Cleanup Meets Standard: True
Investigator: HEALY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 05/15/90
Reported to Department Time: 07:35
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: NYCHA
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (212) 306-3129
Facility Extention: Not reported
Spill Notifier: Fire Department
PBS Number: 2-474029
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/17/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/08/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD/NOSTRAND (Continued)

S106703434

Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 4700
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

DEC Remarks: Not reported

Spill Cause: UNDERGROUND PIPE LEAKING INTO SEWER, BUILDING EVACUATED, USCG NYCFD ON SCENE TRYING TO CONTAIN, BUILDING BELONGS TO CITY,TANK OVERFILL.

R89
NNE
1/4-1/2
0.383 mi.
2023 ft.

SHEEPSHEAD NOSTRAND HSES
2273 BATCHELDER ST
BROOKLYN, NY

HIST LTANKS S102555804
N/A

Site 7 of 7 in cluster R

Relative:
Higher

HIST LTANKS:

Region of Spill: 2
Spill Number: 9612795
Spill Date: 01/28/1997
Spill Time: 12:39
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Non Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Actual:
11 ft.

Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 01/28/97
Reported to Department Time: 13:04
SWIS: 61
Spiller Contact: DAVE FORTE
Spiller Phone: (213) 306-8894
Spiller Extention: Not reported
Spiller Name: NYC HOUSING AUTHORITY
Spiller Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD NOSTRAND HSES (Continued)

S102555804

Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: DAVE FORTE
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 4-74029
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/28/97
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 02/03/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: 001RED
Tank Size: 35155
Test Method: Horner EZ Check
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Not reported
Quantity Spilled: Not reported
Unkonwn Quantity Spilled: Not reported
Units: Not reported
Quantity Recovered: Not reported
Unkonwn Quantity Recovered: Not reported
Material: Not reported
Class Type: Not reported
Times Material Entry In File: Not reported
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Spill Cause: TANK FAILED

**90
ESE
1/4-1/2
0.385 mi.
2034 ft.**

**3147 VOORHIES ST & KNAPP
3147 VOORHIES ST & KNAPP
BROOKLYN, NY**

**NY Spills S102149870
NY Hist Spills N/A**

**Relative:
Higher**

SPILLS:

**Actual:
14 ft.**

Facility ID: 9416893
DER Facility ID: 161021
Facility Type: ER
Site ID: 193117
DEC Region: 2
Spill Number: 9416893
Spill Date: 3/29/1995
Spill Cause: Deliberate
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3147 VOORHIES ST & KNAPP (Continued)

S102149870

Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/30/1995
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 3/29/1995
CID: Not reported
Water Affected: SHEELBANK BASIN
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: 3/30/1995
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/2/1995
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: BROOKLYN YACHT CLUB
Spiller Address: SAME
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: WORKERS WORKING ON DOCKS

Material:

Site ID: 193117
Operable Unit ID: 1014009
Operable Unit: 01
Material ID: 368519
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3147 VOORHIES ST & KNAPP (Continued)

S102149870

NY Hist Spills:

Region of Spill: 2
Spill Number: 9416893
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/29/1995 15:00
Reported to Dept Date/Time: 03/29/95 16:00
SWIS: 61
Spiller Name: BROOKLYN YACHT CLUB
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: SAME
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: Surface Water
Water Affected: SHEELBANK BASIN
Spill Source: 12
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 03/30/95
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/30/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/02/95
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3147 VOORHIES ST & KNAPP (Continued)

S102149870

Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: WORKERS WORKING ON DOCKS

S91
South
1/4-1/2
0.404 mi.
2131 ft.

FORMERLY ROY ROGERS REST
2902 EMMONS AVE
BROOKLYN, NY

NY Spills
NY Hist Spills

S102240505
N/A

Site 1 of 2 in cluster S

Relative:
Lower

SPILLS:

Actual:
3 ft.

Facility ID: 9605168
DER Facility ID: 89819
Facility Type: ER
Site ID: 101363
DEC Region: 2
Spill Number: 9605168
Spill Date: 7/21/1996
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/30/1996
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 7/21/1996
CID: 312
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/21/1996
Spill Record Last Update: 9/3/1996
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: unk construction outfit removed a large unit from the site - when they went to break it up, on site, a white cloud started to form and the workers left - unk info on the trucks - ongoing construction

Material:

Site ID: 101363
Operable Unit ID: 1036113
Operable Unit: 01
Material ID: 347922

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMERLY ROY ROGERS REST (Continued)

S102240505

Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9605168
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/21/1996 09:30
Reported to Dept Date/Time: 07/21/96 14:52
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: -
Spill Cause: Human Error
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMERLY ROY ROGERS REST (Continued)

S102240505

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/30/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/21/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/03/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: 7/30/96 @ 11:55am ARRIVED AT SITE - NO ONE THERE - NO TRUCKS, ONLY DUMPSTER
WITH GARBAGE IN IT - FENCED OFF.
Remark: unk construction outfit removed a large unit from the site - when they went to
break it up, on site, a white cloud started to form and the workers left - unk
info on the trucks - ongoing construction

S92
South
1/4-1/2
0.404 mi.
2132 ft.

PORT SHEEPSHEAD MARINA
10 WEBBERS COURT
BROOKLYN, NY
Site 2 of 2 in cluster S

NY Spills S106968562
N/A

Relative:
Lower

Actual:
3 ft.

SPILLS:

Facility ID: 0502815
DER Facility ID: 293564
Facility Type: ER
Site ID: 347256
DEC Region: 2
Spill Number: 0502815
Spill Date: 6/8/2005
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/13/2005
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 6/8/2005
CID: 408
Water Affected: SHEEPSHEAD BAY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PORT SHEEPSHEAD MARINA (Continued)

S106968562

Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/8/2005
Spill Record Last Update: 7/13/2005
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: PETTY OFFICER BREMMER
Contact Phone: (718) 354-4121
DEC Memo: 7/13/05//mt updating////Sea Spill cleaned surface water spill impacts//ECO's issued tickets//NFA
Remarks: SHEEN OF THICK BLACK OIL, WILDLIFE IS COVERED WITH OIL AND DEAD FISH AND CRAB. THE AREA IS 500 FT LONG BY 30 FT WIDE. COAST GUARD IS ON SCENE,

Material:
Site ID: 347256
Operable Unit ID: 1104994
Operable Unit: 01
Material ID: 1262320
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T93
South
1/4-1/2
0.404 mi.
2135 ft.

28TH ST & EMMONS AVE
BROOKLYN, NY

Site 1 of 2 in cluster T

NY Spills S104879734
NY Hist Spills N/A

Relative:
Lower

Actual:
3 ft.

SPILLS:

Facility ID: 0010364
DER Facility ID: 151125
Facility Type: ER
Site ID: 180083
DEC Region: 2
Spill Number: 0010364
Spill Date: 12/14/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/13/2003
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 12/14/2000
CID: 266
Water Affected: SHEEPS HEAD BAY
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/14/2000
Spill Record Last Update: 6/13/2003
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was
"TIPPLE"6/13/03 SHEEN NO LONGER ON WATER.
Remarks: CITIZEN REPORTED A SHEEN ON THE WATER. COAST GUARD RESPONDED AND
INVESTIGATED. LIGHT SHEEN COVERING MOST OF THE BAY. THERE APPEARS TO
BE SMALL GLOBBULES OF EITHER DIESEL, OR SOME UNKNOWN RED-COLORED
SUBSTANCE. SHEEN IS UNRECOVERABLE. THERE WAS A SPILL THE OTHER DAY AT
THE SHEEPS HEAD BAY. UNKNOWN IF IT'S RELATED OR NOT.

Material:

Site ID: 180083
Operable Unit ID: 831492
Operable Unit: 01
Material ID: 544271
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104879734

Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0010364
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/14/2000 17:00
Reported to Dept Date/Time: 12/14/00 19:23
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPS HEAD BAY
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/14/00
Date Spill Entered In Computer Data File: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104879734

Update Date: 12/18/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Remark: CITIZEN REPORTED A SHEEN ON THE WATER. COAST GUARD RESPONDED AND INVESTIGATED. LIGHT SHEEN COVERING MOST OF THE BAY. THERE APPEARS TO BE SMALL GLOBBULES OF EITHER DIESEL, OR SOME UNKNOWN RED-COLORED SUBSTANCE. SHEEN IS UNRECOVERABLE. THERE WAS ASPILL THE OTHER DAY AT THE SHEEPS HEAD BAY. UNKNOWN IF IT S RELATED OR NOT.

T94
South
1/4-1/2
0.404 mi.
2135 ft.

TM 1842
EMMONS AVE/E 28TH ST
BROOKLYN, NY

NY Spills S104880931
NY Hist Spills N/A

Site 2 of 2 in cluster T

Relative:
Lower

SPILLS:

Facility ID: 0010121
DER Facility ID: 103215
Facility Type: ER
Site ID: 118783
DEC Region: 2
Spill Number: 0010121
Spill Date: 12/8/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Actual:
3 ft.

Spill Closed Date: 1/18/2001
SWIS: 2401
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 12/8/2000
CID: 389
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TM 1842 (Continued)

S104880931

Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/8/2000
Spill Record Last Update: 3/19/2001
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999
Contact Name: CALLER
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "FOLEY"e2MIS Notes:While on location for inspection of TM1842 found an undiaperable sheen of unknown oil on approx 100 gal of water. Due to water condition, unable to determine if sewer connection or sump is present. TM1842 was pressure tested and passed. Lab results returned 12/8/00 as <1ppm. On 12/11/00, Flush employee reports cleanup is complete, no sump in structure, and E.S. tag removed. Cleanup was completed by double washing. Liquids were removed by tanker, and sollids by vactor. No leaking company equipment was found. KMF 3/19/01.

Remarks: CALLER REPORTING A SPILL OF MATERIAL (UNDIAPERABLE SHEEN) INTO A TRANSFORMER MANHOLE SAMPLES TAKEN CLEAN UP PENDING RESULTS NO CALLBACK CONED#134679

Material:
Site ID: 118783
Operable Unit ID: 832223
Operable Unit: 01
Material ID: 544039
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0010121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TM 1842 (Continued)

S104880931

Investigator: FOLEY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/08/2000 09:18
Reported to Dept Date/Time: 12/08/00 10:21
SWIS: 61
Spiller Name: UNK
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Address: UNK
Spiller City,St,Zip: UNK
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/18/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/08/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/19/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TM 1842 (Continued)

S104880931

Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: e2MIS Notes: While on location for inspection of TM1842 found an undiaperable sheen of unknown oil on approx 100 gal of water. Due to water condition, unable to determine if sewer connection or sump is present. TM1842 was pressure tested and passed. Lab results returned 12/8/00 as <1ppm. On 12/11/00, Flush employee reports cleanup is complete, no sump in structure, and E.S. tag removed. Cleanup was completed by double washing. Liquids were removed by tanker, and solids by vacuor. Noleaking company equipment was found. KMF 3/19/01.

Remark: CALLER REPORTING A SPILL OF MATERIAL (UNDIAPERABLE SHEEN) INTO A TRANSFORMER MANHOLE. SAMPLES TAKEN. CLEAN UP PENDING RESULTS. NO CALLBACK. CONED 134679

U95
East
1/4-1/2
0.405 mi.
2139 ft.

CONEY ISLAND POLL CONT PL
25-91 KNAPP ST
BROOKLYN, NY

NY Spills **S104193913**
NY Hist Spills **N/A**

Site 1 of 14 in cluster U

Relative:
Higher

SPILLS:

Facility ID: 9905711
DER Facility ID: 88536
Facility Type: ER
Site ID: 99659
DEC Region: 2
Spill Number: 9905711
Spill Date: 8/12/1999
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Actual:
9 ft.

Spill Closed Date: 1/11/2000
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 8/12/1999
CID: 198
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/12/1999
Spill Record Last Update: 1/12/2000
Spiller Name: DAVID BARGAK
Spiller Company: CONEY ISLAND POLL CONT PL
Spiller Address: 25-91 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY 001
Contact Name: DAVID BARGAK
Contact Phone: (718) 743-0540
DEC Memo: Not reported
Remarks: STRAINER FAILED ON PUMP FROM A TANK AT FACILITY. SPILL CONTAINED TO PAD AT THIS TIME.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND POLL CONT PL (Continued)

S104193913

Material:

Site ID: 99659
Operable Unit ID: 1080155
Operable Unit: 01
Material ID: 302001
Material Code: 0124A
Material Name: SODIUM HYPOCHLORITE
Case No.: 07681529
Material FA: Hazardous Material
Quantity: 5500
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9905711
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/12/1999 09:00
Reported to Dept Date/Time: 08/12/99 10:20
SWIS: 61
Spiller Name: CONEY ISLAND POLL CONT PL
Spiller Contact: DAVID BARGAK
Spiller Phone: (718) 743-0540
Spiller Contact: DAVID BARGAK
Spiller Phone: (718) 743-0540
Spiller Address: 25-91 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND POLL CONT PL (Continued)

S104193913

Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/11/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/12/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/12/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 5500
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: SODIUM HYPERCHLORIDE
Class Type: SODIUM HYPERCHLORIDE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported

DEC Remarks: COPIED DIVISION OF WATER, ARMAN TOUMARI. CONEY ISLAND POLLUTION CONTROL PLANT. 8/12/99- 10:55HRS. SPOKE TO JOE VACCARELLA/CONEY ISLAND. HE SAID A SEWAGE TREATMENT WORKER EXPECTED TO SEE A LOT OF HYPO IN THE EFFIVENT (RESIDUAL) BUT HE DIDN TSEE IT. CHECKED THE CHEMICAL PUMP STATION. TOTAL COMBINED HYPO TANKS CAPACITY=6,600 GAL. RECEIVED A DELIVERY LAST NIGHT. ONE OF THE SUCTION STRAINERS ON A PUMP CAME APART. IT SPILLED INTO A CONTAINMENT AREA (APPROX. 600 GLS.) AND OVERFLOWED INTO A TROFT DRAIN. ESTIMATED LOST APPROX. 5,500 GAL. THIS DRAIN LEADS BACK TO 1 BAR SCREEN, HEAD OF PLANT. THEREFORE, BASICALLY PRECHLORINATING. CLEANUP: FLUSHED DRAIN WITH WATER. PUMPED OUT CONTAINMENT AREA TO DRAIN. NO STRONG ODOR. CLEANUPESSENTIALLY DONE. REFERRED TO SPDES UNIT/ARMAN TOUMARI.

Remark: STRAINER FAILED ON PUMP FROM A TANK AT FACILITY. SPILL CONTAINED TO PAD AT THIS TIME.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

P96
SSE
1/4-1/2
0.407 mi.
2147 ft.
3050 EMMONS AVE/BKLYN
3050 EMMONS AVENUE
NEW YORK CITY, NY
Site 3 of 3 in cluster P

NY Spills
NY Hist Spills
S102145407
N/A

Relative:
Lower

Actual:
3 ft.

SPILLS:

Facility ID: 8903852
DER Facility ID: 63210
Facility Type: ER
Site ID: 65941
DEC Region: 2
Spill Number: 8903852
Spill Date: 7/18/1989
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 7/18/1989
SWIS: 2401
Investigator: FINGER
Referred To: Not reported
Reported to Dept: 7/18/1989
CID: Not reported
Water Affected: SHEEPSHEAD BAY
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: 7/18/1989
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/20/1989
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: 1/2 MILE SHEEN, USCG TO SEND TEAM, USCG INVESTIGATED FOUND NOTHING, SHEEN DISSIPATED.

Material:

Site ID: 65941
Operable Unit ID: 929269
Operable Unit: 01
Material ID: 557542
Material Code: 0012A
Material Name: Kerosene
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3050 EMMONS AVE/BKLYN (Continued)

S102145407

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8903852
Investigator: FINGER
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/18/1989 06:00
Reported to Dept Date/Time: 07/18/89 09:13
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: (718) 646-9436
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 12
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 07/18/89
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 07/18/89
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/20/89
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3050 EMMONS AVE/BKLYN (Continued)

S102145407

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: KEROSENE
Class Type: KEROSENE
Times Material Entry In File: 2052
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Remark: 1/2 MILE SHEEN, USCG TO SEND TEAM, USCG INVESTIGATED FOUND NOTHING, SHEEN DISSIPATED.

V97
East
1/4-1/2
0.409 mi.
2157 ft.

CONEY ISLAND WATER POLLUTION PLANT
2610 KNAPP ST
BROOKLYN, NY

LTANKS **S109372923**
NY Spills **N/A**

Site 1 of 2 in cluster V

Relative:
Higher

LTANKS:

Site ID: 388854
Spill No: 0708030
Spill Date: 10/19/2007
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/13/2008

Facility Addr2: Not reported

Cleanup Ceased: Not reported

Cleanup Meets Standard: False

SWIS: 2401

Investigator: bkfalvey

Referred To: Not reported

Reported to Dept: 10/23/2007

CID: 444

Water Affected: Not reported

Spill Notifier: Other

Last Inspection: Not reported

Recommended Penalty: False

UST Involvement: False

Remediation Phase: 0

Date Entered In Computer: 10/23/2007

Spill Record Last Update: 2/13/2008

Spiller Name: KAVITA SAZAWAL

Spiller Company: CONEY ISLAND DEP

Spiller Address: 2610 KNAPP STREET

Spiller City,St,Zip: BROOKLYN, NY

Spiller County: 001

Spiller Contact: KAVITA SAZAWAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WATER POLLUTION PLANT (Continued)

S109372923

Spiller Phone: (718) 595-5538
Spiller Extension: Not reported
DEC Region: 2
DER Facility ID: 338405
DEC Memo: 10/29/07 bf: Called Kavita Sazawal of DEP (718)595-5538. Left message to call me back. Sent ttf letter to:Kavita SazawalNYCDEPBureau of Wastewater96-05 Horace Harding Expwy.Corona, NY 1136810/30/07 Received call from K. Sazawal. She told me that the tank is AST day tank. Problem appears to be a faulty gasket. They will change gasket and retest. i told her I sent her a ttf letter. Contractor will need to respond. She told me she also received message from S. Sangesland and wanted to know if she needs to call him back. He was calling about the status of the spill and repairs. I told her she does not have to call him back. bf2/13/08 Received letter from Mohammad Mahmud of NYCDEP. Gasket was replaced. Tank passed tightness test. NFA. bf
Remarks: PBS No: 2-350605TANK TOP FAILURE

Material:
Site ID: 388854
Operable Unit ID: 1146008
Operable Unit: 01
Material ID: 2136352
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: 388854
Spill Tank Test: 1815673
Tank Number: 1428B
Tank Size: 325
Test Method: 03
Leak Rate: 0
Gross Fail: Not reported
Modified By: Watchdog
Last Modified: 10/23/2007
Test Method: Horner EZ Check I or II

SPILLS:
Facility ID: 0806378
DER Facility ID: 352879
Facility Type: ER
Site ID: 403660
DEC Region: 2
Spill Number: 0806378
Spill Date: 9/6/2008
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WATER POLLUTION PLANT (Continued)

S109372923

Corrective action taken.
Spill Closed Date: 9/8/2008
SWIS: 2401
Investigator: RMPIPER
Referred To: Not reported
Reported to Dept: 9/6/2008
CID: Not reported
Water Affected: Not reported
Spill Source: Major Facility > 400,000 gal
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/6/2008
Spill Record Last Update: 9/8/2008
Spiller Name: BARTIK
Spiller Company: WATER POLLUTION CONTROL PLANT
Spiller Address: 2610 KNAPP STREET
Spiller City,St,Zip: KINGS, NY 11235
Spiller Company: 999
Contact Name: JIM DALY
Contact Phone: (718) 372-7193
DEC Memo: Due to heavy rains. closed and referreed to DEC water.
Remarks: 2241 The caller advised dispatch the spill amount is unknown at this time. The sewage by passed Jamaica Bay. DEP is in charge of clean up.
2244 Dispatch called Ryan Piper n/c left message. 2249 Dispatch advised Ryan Piper .

Material:

Site ID: 403660
Operable Unit ID: 1160347
Operable Unit: 01
Material ID: 2151515
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WATER POLLUTION PLANT (Continued)

S109372923

Facility ID: 0806379
DER Facility ID: 352880
Facility Type: ER
Site ID: 403661
DEC Region: 2
Spill Number: 0806379
Spill Date: 9/6/2008
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 9/8/2008
SWIS: 2401
Investigator: RMP/IPER
Referred To: Not reported
Reported to Dept: 9/7/2008
CID: Not reported
Water Affected: JAMAICA BAY
Spill Source: Major Facility > 400,000 gal
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/7/2008
Spill Record Last Update: 9/8/2008
Spiller Name: MR BARTIK
Spiller Company: MR BARTIK
Spiller Address: 2610 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY 11235
Spiller Company: 999
Contact Name: MR BARTIK
Contact Phone: Not reported
DEC Memo: Due to heavy rains. closed and referred to DEC water.
Remarks: Engine failure - #1, 3, and 4 engines failed; engines would not start. Plant switched to ConEd power to fix problem - unknown amount of raw sewage discharge at this time. Dispatch advised R2 Spills/Ryan at 0042, 9/7/08 via cell phone.

Material:
Site ID: 403661
Operable Unit ID: 1160348
Operable Unit: 01
Material ID: 2151516
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WATER POLLUTION PLANT (Continued)

S109372923

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

W98
SE
1/4-1/2
0.409 mi.
2159 ft.

SHORE PARKWAY
SHORE PARKWAY
BROOKLYN, NY
Site 1 of 2 in cluster W

NY Spills
NY Hist Spills

S102143571
N/A

Relative:
Higher

Actual:
11 ft.

SPILLS:
Facility ID: 9210723
DER Facility ID: 275835
Facility Type: ER
Site ID: 259962
DEC Region: 2
Spill Number: 9210723
Spill Date: 12/16/1992
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/31/1995
SWIS: 2401
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 12/16/1992
CID: Not reported
Water Affected: THE NARROWS
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: 3/31/1995
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/17/1992
Spill Record Last Update: 3/31/1995
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TANG"10/10/95: This is additional information about material spilled

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHORE PARKWAY (Continued)

S102143571

Remarks: from the translation of the old spill file: SHEEN.
USCG ENROUTE-POTENTIAL LEAK NOT CONFIRMED-DRIVERS TO DO SURVEY-MILLER
ENVIRONMENTAL TO BOOM USCG POLLUTION TEAM ON THE VESSEL

Material:

Site ID: 259962
Operable Unit ID: 977362
Operable Unit: 01
Material ID: 404166
Material Code: 0003A
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9210723
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/16/1992 10:30
Reported to Dept Date/Time: 12/16/92 11:08
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: THE NARROWS
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: 03/31/95

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHORE PARKWAY (Continued)

S102143571

Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/31/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/17/92
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/31/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: 10/10/95: This is additional information about material spilled from the
translation of the old spill file: SHEEN.
Remark: USCG ENROUTE-POTENTIAL LEAK NOT CONFIRMED-DRIVERS TO DO SURVEY-MILLER
ENVIRONMENTAL TO BOOM USCG POLLUTION TEAM ON THE VESSEL

W99
SE
1/4-1/2
0.409 mi.
2159 ft.

26TH AV
26TH AVE & SHORE PARKWAY
BROOKLYN, NY
Site 2 of 2 in cluster W

NY Spills **S103273693**
NY Hist Spills **N/A**

Relative:
Higher

SPILLS:

Actual:
11 ft.

Facility ID: 9800823
DER Facility ID: 143855
Facility Type: ER
Site ID: 170953
DEC Region: 2
Spill Number: 9800823
Spill Date: 4/20/1998
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

26TH AV (Continued)

S103273693

Spill Closed Date: 5/4/1998
SWIS: 2401
Investigator: MMMULQUE
Referred To: Not reported
Reported to Dept: 4/20/1998
CID: 211
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/20/1998
Spill Record Last Update: 8/22/2003
Spiller Name: FREDERICK CAPUTO
Spiller Company: BAYSIDE FUEL OIL
Spiller Address: 1810 SHORE PARKWAY
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: FREDERICK CAPUTO
Contact Phone: (718) 946-4000
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MULQUEEN"SPILL HAPPEDED TWO BLOCKS FROM TERMINAL. BAYSIDE AND DOS
CLEANED UP SPILL.
Remarks: AIR ELIMINATOR LINE BROKE CAUSING SPILL / SPILL CONATINED WITH PADS
AND OIL ABSORBANT / REMAINING PRODUCT BEING PUMPED FROM TANK

Material:

Site ID: 170953
Operable Unit ID: 1061472
Operable Unit: 01
Material ID: 322768
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 75
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

26TH AV (Continued)

S103273693

NY Hist Spills:

Region of Spill: 2
Spill Number: 9800823
Investigator: MULQUEEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/20/1998 08:20
Reported to Dept Date/Time: 04/20/98 09:37
SWIS: 61
Spiller Name: BAYSIDE FUEL OIL
Spiller Contact: FREDERICK CAPUTO
Spiller Phone: (718) 946-4000
Spiller Contact: FREDERICK CAPUTO
Spiller Phone: (718) 946-4000
Spiller Address: 1810 SHORE PARKWAY
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 08
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/04/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/20/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 05/04/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 75
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

26TH AV (Continued)

S103273693

Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: SPILL HAPPEDED TWO BLOCKS FROM TERMINAL. BAYSIDE AND DOS CLEANED UP SPILL.
Remark: AIR ELIMINATOR LINE BROKE CAUSING SPILL / SPILL CONATINED WITH PADS AND OIL
ABSORBANT / REMAINING PRODUCT BEING PUMPED FROM TANK

U100
East
1/4-1/2
0.409 mi.
2159 ft.

CONEY ISLAND WPCP/BKLYN
KNAPP ST & AVENUE Z
NEW YORK CITY, NY
Site 2 of 14 in cluster U

NY Spills **S102141111**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
9 ft.

SPILLS:
Facility ID: 9101959
DER Facility ID: 212086
Facility Type: ER
Site ID: 259232
DEC Region: 2
Spill Number: 9101959
Spill Date: 5/18/1991
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 5/18/1991
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 5/18/1991
CID: Not reported
Water Affected: PAERDEGAT BASIN
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 5/18/1991
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/23/1991
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: CON ED LOST POWER SO EVERYTHING BACKED UP, THE GATES WERE THROTTLED
TOCUT FLOW IN HALF,NO OTHER AGENCIES NOTIFIED,REFERRED TO SPEDES.

Material:
Site ID: 259232
Operable Unit ID: 953079
Operable Unit: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP/BKLYN (Continued)

S102141111

Material ID: 424497
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9101959
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/18/1991 18:30
Reported to Dept Date/Time: 05/18/91 21:38
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: PAERDEGAT BASIN
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 05/18/91
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP/BKLYN (Continued)

S102141111

Spill Class: Not reported
Spill Closed Dt: 05/18/91
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/23/91
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: CON ED LOST POWER SO EVERYTHING BACKED UP, THE GATES WERE THROTTLED TO CUT FLOW IN HALF, NO OTHER AGENCIES NOTIFIED, REFERRED TO SPEDES.

U101 **CONEY ISLAND BYPASS**
East **AVENUE Z & KNAPP**
1/4-1/2 **NEW YORK CITY, NY**
0.409 mi.
2159 ft. **Site 3 of 14 in cluster U**

NY Spills **S102143880**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
9 ft.

SPILLS:
Facility ID: 8600076
DER Facility ID: 105982
Facility Type: ER
Site ID: 122222
DEC Region: 2
Spill Number: 8600076
Spill Date: 4/3/1986
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 4/3/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 4/3/1986
CID: Not reported
Water Affected: JAMAICA BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Local Agency
Cleanup Ceased: 4/3/1986

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND BYPASS (Continued)

S102143880

Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/18/1986
Spill Record Last Update: 8/31/1987
Spiller Name: Not reported
Spiller Company: CONEY ISLAND WWTP
Spiller Address: AVENUE Z & KNAPP
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "
"10/10/95: This is additional information about material spilled from
the translation of the old spill file: WASTE WATER

Remarks: MAINTENANCE-APPROVED PLANT SHUT DOWN

Material:

Site ID: Not reported
Operable Unit ID: Not reported
Operable Unit: Not reported
Material ID: Not reported
Material Code: Not reported
Material Name: Not reported
Case No.: Not reported
Material FA: Not reported
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8600076
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND BYPASS (Continued)

S102143880

Spill Date/Time: 04/03/1986 05:15
Reported to Dept Date/Time: 04/03/86 11:48
SWIS: 61
Spiller Name: CONEY ISLAND WWTP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: AVENUE Z & KNAPP
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: JAMAICA BAY
Spill Source: 02
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 04/03/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 04/03/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/18/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/31/87
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Not reported
Quantity Spilled: Not reported
Unkonwn Quantity Spilled: Not reported
Units: Not reported
Quantity Recovered: Not reported
Unkonwn Quantity Recovered: Not reported
Material: Not reported
Class Type: Not reported
Times Material Entry In File: Not reported
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: WASTE WATER
Remark: MAINTENANCE-APPROVED PLANT SHUT DOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

U102
East
1/4-1/2
0.409 mi.
2160 ft.
CONEY ISLAND PLANT
2591 KNAPP ST
CONEY ISLAND, NY
Site 4 of 14 in cluster U

NY Spills
NY Hist Spills
S102961683
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 9708535
DER Facility ID: 182202
Facility Type: ER
Site ID: 220284
DEC Region: 2
Spill Number: 9708535
Spill Date: 10/21/1997
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/21/1997
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 10/21/1997
CID: 267
Water Affected: SHELL BANK CREEK
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/21/1997
Spill Record Last Update: 12/9/1997
Spiller Name: DENNIS
Spiller Company: CONEY ISLAND PLANT
Spiller Address: 2591 KNAPP ST
Spiller City,St,Zip: CONEY ISLAND, ZZ
Spiller Company: 001
Contact Name: DENNIS
Contact Phone: (718) 743-0540
DEC Memo: Not reported
Remarks: UNKNOWN WHY BUT SOMEHOW MATERIAL SPILLED INTO THE WATER

Material:

Site ID: 220284
Operable Unit ID: 1051707
Operable Unit: 01
Material ID: 330499
Material Code: 1705A
Material Name: SODIUM HYPERCHLORIDE
Case No.: Not reported
Material FA: Other
Quantity: 2360
Units: Gallons
Recovered: 2360
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT (Continued)

S102961683

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9708535
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/21/1997 14:50
Reported to Dept Date/Time: 10/21/97 15:08
SWIS: 61
Spiller Name: CONEY ISLAND PLANT
Spiller Contact: DENNIS
Spiller Phone: (718) 743-0540
Spiller Contact: DENNIS
Spiller Phone: (718) 743-0540
Spiller Address: 2591 KNAPP ST
Spiller City,St,Zip: CONEY ISLAND
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHELL BANK CREEK
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/21/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/21/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/09/97
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND PLANT (Continued)

S102961683

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 2360
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 2360
Unkonwn Quantity Recovered: False
Material: SODIUM HYPERCHLORIDE
Class Type: SODIUM HYPERCHLORIDE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: REFFERED TO DIV. OF WATER.
Remark: UNKNOWN WHY BUT SOMEHOW MATERIAL SPILLED INTO THE WATER

U103
East
1/4-1/2
0.409 mi.
2161 ft.

CONEY ISLAND WASTE WATER
KNAPP ST/ AVE Z
BROOKLYN, NY

NY Spills **S103036318**
NY Hist Spills **N/A**

Site 5 of 14 in cluster U

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 9713263
DER Facility ID: 164260
Facility Type: ER
Site ID: 197366
DEC Region: 2
Spill Number: 9713263
Spill Date: 2/27/1998
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 2/27/1998
SWIS: 2401
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 2/27/1998
CID: 370
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/27/1998
Spill Record Last Update: 3/2/1998
Spiller Name: ABOVE NOTIFIER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WASTE WATER (Continued)

S103036318

Spiller Company: CONEY ISLAND WASTE WATER
Spiller Address: KNAPP ST/ AVE Z
Spiller City,St,Zip: BROOKLYN, ZZ
Spiller Company: 001
Contact Name: ABOVE NOTIFIER
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MARTINKAT" SAME AS 9713237.
Remarks: spill from defective valve spill to containment area

Material:

Site ID: 197366
Operable Unit ID: 1056160
Operable Unit: 01
Material ID: 560927
Material Code: 0124A
Material Name: SODIUM HYPOCHLORITE
Case No.: 07681529
Material FA: Hazardous Material
Quantity: 7850
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9713263
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/27/1998 07:00
Reported to Dept Date/Time: 02/27/98 12:26
SWIS: 61
Spiller Name: CONEY ISLAND WASTE WATER
Spiller Contact: ABOVE NOTIFIER
Spiller Phone: Not reported
Spiller Contact: ABOVE NOTIFIER
Spiller Address: KNAPP ST/ AVE Z
Spiller City,St,Zip: BROOKLYN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WASTE WATER (Continued)

S103036318

Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/27/98
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/27/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/02/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Nonpetroleum/Nonhazardous
Quantity Spilled: 7850
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: SODIUM HYPOCHLORITE
Class Type: SODIUM HYPOCHLORITE
Times Material Entry In File: 0
CAS Number: 07681529
Last Date: Not reported
DEC Remarks: SAME AS 9713237.
Remark: spill from defective valve spill to containment area

U104
East
1/4-1/2
0.409 mi.
2161 ft.

AVE Z & KNAPP ST
AVENUE Z & KNAPP STREET
BROOKLYN, NY
Site 6 of 14 in cluster U

NY Spills **S107407936**
N/A

Relative:
Higher

SPILLS:
Facility ID: 8603591
DER Facility ID: 206762
Facility Type: ER
Site ID: 294666
DEC Region: 2

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S107407936

Spill Number: 8603591
Spill Date: 9/1/1986
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 9/2/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 9/1/1986
CID: Not reported
Water Affected: SHEEPSHEAD BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 9/2/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/9/1986
Spill Record Last Update: 1/30/1998
Spiller Name: Not reported
Spiller Company: CONEY ISLAND STP
Spiller Address: KNAPP ST
Spiller City,St,Zip: BROOKLYN, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "
"THE WORD SHIT SHOULD NOT BE IN THE REPORT. THAT ALL SO GOES FOR
SPILL # 8603593.
Remarks: SHIT SHAFT ON PUMP BROKEN

Material:
Site ID: 294666
Operable Unit ID: 900479
Operable Unit: 01
Material ID: 476418
Material Code: 0630A
Material Name: NONENE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE Z & KNAPP ST (Continued)

S107407936

Last Modified: Not reported
Test Method: Not reported

U105
East
1/4-1/2
0.409 mi.
2161 ft.

CONEY ISLAND TREATMENT C
AVE Z/KNAPP ST
BROOKLYN, NY

NY Spills
NY Hist Spills

S104653180
N/A

Site 7 of 14 in cluster U

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 0002499
DER Facility ID: 20091
Facility Type: ER
Site ID: 155481
DEC Region: 2
Spill Number: 0002499
Spill Date: 5/30/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Date: 6/19/2000
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 5/30/2000
CID: 281
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/30/2000
Spill Record Last Update: 6/19/2000
Spiller Name: RICARDO FREYRE
Spiller Company: NYC DEP
Spiller Address: 59-17 JUNCTION BLVD
Spiller City,St,Zip: CORONA, NY 11368-
Spiller Company: 001
Contact Name: RICARDO FREYRE
Contact Phone: (914) 987-1755
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"TIPPLE"CLEAN HARBORS DOING CLEANUP

Remarks: ABOVE MATERIAL SPILLED AT ABOVE LOCATION. MATERIAL WAS SPILLED INTO
CONTAINMENT AREA. NO FURTHER INFO AVAILABLE ON SPILL FROM NYC DEP AT
TIME OF CALL.

Material:

Site ID: 155481
Operable Unit ID: 824427
Operable Unit: 01
Material ID: 550860
Material Code: 0124A
Material Name: SODIUM HYPOCHLORITE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND TREATMENT C (Continued)

S104653180

Case No.: 07681529
Material FA: Hazardous Material
Quantity: 40
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0002499
Investigator: TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/30/2000 11:30
Reported to Dept Date/Time: 05/30/00 13:24
SWIS: 61
Spiller Name: NYC DEP
Spiller Contact: RICARDO FREYRE
Spiller Phone: (914) 987-1755
Spiller Contact: RICARDO FREYRE
Spiller Phone: (914) 987-1755
Spiller Address: 59-17 JUNCTION BLVD
Spiller City,St,Zip: CORONA, NY 11368-
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND TREATMENT C (Continued)

S104653180

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/19/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/30/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/19/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Nonpetroleum/Nonhazardous
Quantity Spilled: 40
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: SODIUM HYPOCHLORITE
Class Type: SODIUM HYPOCHLORITE
Times Material Entry In File: 0
CAS Number: 07681529
Last Date: Not reported
DEC Remarks: CLEAN HARBORS DOING CLEANUP
Remark: ABOVE MATERIAL SPILLED AT ABOVE LOCATION. MATERIAL WAS SPILLED INTO
CONTAINMENT AREA. NO FURTHER INFO AVAILABLE ON SPILL FROM NYC DEP AT TIME OF
CALL.

U106
East
1/4-1/2
0.409 mi.
2161 ft.

CONEY ISLAND WPCP
AVE Z & KNAPP ST.
BROOKLYN, NY
Site 8 of 14 in cluster U

NY Spills **S102144708**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
9 ft.

SPILLS:
Facility ID: 8703167
DER Facility ID: 206762
Facility Type: ER
Site ID: 266506
DEC Region: 2
Spill Number: 8703167
Spill Date: 7/20/1987
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 7/20/1987
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 7/20/1987
CID: Not reported
Water Affected: PAERDEGATE BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP (Continued)

S102144708

Cleanup Ceased: 7/20/1987
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/11/1987
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: PLANT SHUTDOWN BECAUSE OF LOST POWER

Material:

Site ID: 266506
Operable Unit ID: 909677
Operable Unit: 01
Material ID: 469431
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8603591
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP (Continued)

S102144708

Spill Date/Time: 09/01/1986 06:15
Reported to Dept Date/Time: 09/01/86 12:33
SWIS: 61
Spiller Name: CONEY ISLAND STP
Spiller Contact: Not reported
Spiller Phone: (718) 743-0540
Spiller Address: KNAPP ST
Spiller City,St,Zip: BROOKLYN
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 09/02/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 09/02/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/09/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/30/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NONENE
Class Type: NONENE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: THE WORD SHIT SHOULD NOT BE IN THE REPORT. THAT ALL SO GOES FOR SPILL
8603593.
Remark: SHIT SHAFT ON PUMP BROKEN

Region of Spill: 2
Spill Number: 8703167
Investigator: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP (Continued)

S102144708

Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/20/1987 08:30
Reported to Dept Date/Time: 07/20/87 14:59
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: PAERDEGATE BAY
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 07/20/87
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 07/20/87
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/11/87
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WPCP (Continued)

S102144708

Remark: PLANT SHUTDOWN BECAUSE OF LOST POWER

U107
East
1/4-1/2
0.409 mi.
2161 ft.

CONEY ISLAND WTP
KNAPP ST.&AVENUE Z
BROOKLYN, NY

Site 9 of 14 in cluster U

NY Spills
NY Hist Spills

S102143887
N/A

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 8600139
DER Facility ID: 122001
Facility Type: ER
Site ID: 143004
DEC Region: 2
Spill Number: 8600139
Spill Date: 4/5/1986
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 4/6/1986
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 4/6/1986
CID: Not reported
Water Affected: JAMAICA BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Local Agency
Cleanup Ceased: 4/6/1986
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/29/1986
Spill Record Last Update: 6/26/1986
Spiller Name: Not reported
Spiller Company: CONEY ISLAND SEWAGE PLANT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported

Remarks: PUMPING STATION @ SEWAGE PLANT

Material:

Site ID: 143004
Operable Unit ID: 898053
Operable Unit: 01
Material ID: 480310
Material Code: 0630A
Material Name: NONENE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WTP (Continued)

S102143887

Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8600139
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/05/1986 06:30
Reported to Dept Date/Time: 04/06/86 08:44
SWIS: 61
Spiller Name: CONEY ISLAND SEWAGE PLANT
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: JAMAICA BAY
Spill Source: 02
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 04/06/86
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 04/06/86
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/29/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/26/86
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND WTP (Continued)

S102143887

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: NONENE
Class Type: NONENE
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: Not reported
Remark: PUMPING STATION @ SEWAGE PLANT

U108
East
1/4-1/2
0.409 mi.
2161 ft.

WASTE WTR TREATMENT PLANT
AVENUE Z & KNAPP STREET
BROOKLYN, NY

NY Spills **S102148997**
NY Hist Spills **N/A**

Site 10 of 14 in cluster U

Relative:
Higher

SPILLS:

Actual:
9 ft.

Facility ID: 9410872
DER Facility ID: 206762
Facility Type: ER
Site ID: 252319
DEC Region: 2
Spill Number: 9410872
Spill Date: 11/15/1994
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 11/15/1994
SWIS: 2401
Investigator: SMMARTIN
Referred To: Not reported
Reported to Dept: 11/15/1994
CID: Not reported
Water Affected: SHELL BANK CREEK
Spill Source: Vessel
Spill Notifier: Federal Government
Cleanup Ceased: 11/15/1994
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/12/1994
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WASTE WTR TREATMENT PLANT (Continued)

S102148997

Spiller Company: UNKNOWN -OWNER
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"MARTINKAT"
Remarks: 3'X 10' SHEEN- 26' FIBER GLASS VESSEL SUNK AT SITE- USCG TO
INVESTIGATE.

Material:
Site ID: 252319
Operable Unit ID: 1004798
Operable Unit: 01
Material ID: 376740
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9410872
Investigator: MARTINKAT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/15/1994 09:00
Reported to Dept Date/Time: 11/15/94 09:51
SWIS: 61
Spiller Name: UNKNOWN -OWNER
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WASTE WTR TREATMENT PLANT (Continued)

S102148997

Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHELL BANK CREEK
Spill Source: 10
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: 11/15/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/15/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/12/94
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: 3 X 10 SHEEN- 26 FIBER GLASS VESSEL SUNK AT SITE- USCG TO INVESTIGATE.

U109 2591 KNAPP ST/CONEY ISLAN
East 2591 KNAPP STREET
1/4-1/2 NEW YORK CITY, NY
0.410 mi.
2165 ft. Site 11 of 14 in cluster U

NY Hist Spills S103560283
N/A

Relative:
Higher

NY Hist Spills:
Region of Spill: 2
Spill Number: 8808032
Investigator: AUSTIN
Caller Name: Not reported
Caller Agency: Not reported

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2591 KNAPP ST/CONEY ISLAN (Continued)

S103560283

Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 01/06/1989 16:00
Reported to Dept Date/Time: 01/07/89 12:29
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: (718) 891-1000
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Other
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 02/07/89
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 02/07/89
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/07/89
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: PCB OIL
Class Type: PCB OIL
Times Material Entry In File: 1229
CAS Number: Not reported
Last Date: 19940728

DEC Remarks: Not reported

Remark: TIPPED OVER TRANSFORMER, CONTAINED IN ONE AREA, TEST RESULTS ON 3/18/85
59.7 PPM, NOTIFIED NRC CREW IS PREPARING CLEAN UP EFFORT.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U110
East
1/4-1/2
0.410 mi.
2165 ft.
VENICE MARINA/2591 KNAPP
2591 KNAPP STREET
NEW YORK CITY, NY
Site 12 of 14 in cluster U

LTANKS
HIST LTANKS
NY Spills
S102671521
N/A

Relative:
Higher

LTANKS:

Actual:
9 ft.

Site ID: 129686
Spill No: 9000332
Spill Date: 4/9/1990
Spill Cause: Tank Overfill
Spill Source: Vessel
Spill Class: Not reported
Spill Closed Dt: 4/10/1990
Facility Addr2: Not reported
Cleanup Ceased: 4/10/1990
Cleanup Meets Standard: True
SWIS: 2401
Investigator: RWAUSTIN
Referred To: Not reported
Reported to Dept: 4/10/1990
CID: Not reported
Water Affected: SHELL BANK CREEK
Spill Notifier: Federal Government
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 5/11/1990
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 275548
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "AUSTIN"
Remarks: REFER TO SP# 9000277, SUNKEN LOBSTER BOAT, USCG TO HANDLE CLEAN UP.

Material:

Site ID: 129686
Operable Unit ID: 939708
Operable Unit: 01
Material ID: 438733
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VENICE MARINA/2591 KNAPP (Continued)

S102671521

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 9000332
Spill Date: 04/09/1990
Spill Time: 16:00
Spill Cause: Tank Overfill
Resource Affectd: Surface Water
Water Affected: SHELL BANK CREEK
Spill Source: Vessel
Spill Class: Not reported
Spill Closed Dt: 04/10/90
Cleanup Ceased: 04/10/90
Cleanup Meets Standard: True
Investigator: AUSTIN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 04/10/90
Reported to Department Time: 12:45
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Federal Government
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VENICE MARINA/2591 KNAPP (Continued)

S102671521

Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/11/90
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Spill Cause: REFER TO SP 9000277, SUNKEN LOBSTER BOAT, USCG TO HANDLE CLEAN UP.

SPILLS:

Facility ID: 8808032
DER Facility ID: 275548
Facility Type: ER
Site ID: 129685
DEC Region: 2
Spill Number: 8808032
Spill Date: 1/6/1989
Spill Cause: Other
Spill Class: Not reported
Spill Closed Date: 2/7/1989
SWIS: 2401
Investigator: RWAUSTIN
Referred To: Not reported
Reported to Dept: 1/7/1989
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: 2/7/1989
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/7/1989
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VENICE MARINA/2591 KNAPP (Continued)

S102671521

Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "AUSTIN"
Remarks: TIPPED OVER TRANSFORMER, CONTAINED IN ONE AREA, TEST RESULTS ON 3/18/85 59.7 PPM, NOTIFIED NRC & CREW IS PREPARING CLEAN UP EFFORT.

Material:
Site ID: 129685
Operable Unit ID: 924475
Operable Unit: 01
Material ID: 452797
Material Code: 0017A
Material Name: PCB OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

U111
East
1/4-1/2
0.411 mi.
2168 ft.
SEWERAGE TREATMENT PLANT
2591 KNAPP STREET
BROOKLYN, NY
Site 13 of 14 in cluster U

LTANKS
MANIFEST
NY Spills
NPDES
CBS
S107788776
N/A

Relative:
Higher

Actual:
9 ft.

LTANKS:
Site ID: 342461
Spill No: 0413375
Spill Date: 3/23/2005
Spill Cause: Tank Overfill
Spill Source: Major Facility > 400,000 gal
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/25/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 3/23/2005
CID: 71
Water Affected: JAMAICA BAY
Spill Notifier: Affected Persons
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 3/24/2005
Spill Record Last Update: 3/25/2005
Spiller Name: MICHAEL KOWALSKI
Spiller Company: CONEY ISLAND WPC
Spiller Address: 2591 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY 11235
Spiller County: 001
Spiller Contact: MICHAEL KOWALSKI
Spiller Phone: (718) 372-7193
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 111790
DEC Memo: Not reported
Remarks: SEWAGEBY-PASS DUE TO WEATHER.

Material:

Site ID: 342461
Operable Unit ID: 1101189
Operable Unit: 01
Material ID: 581316
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 373894
Spill No: 0609614

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Spill Date: 11/21/2006
Spill Cause: Tank Overfill
Spill Source: Major Facility > 400,000 gal
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/4/2007
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 11/21/2006
CID: 410
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 11/21/2006
Spill Record Last Update: 1/4/2007
Spiller Name: STANLEY BATYCKI
Spiller Company: CONEY ISLAND PLANT
Spiller Address: 2591 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY 11235
Spiller County: 001
Spiller Contact: STANLEY BATYCKI
Spiller Phone: (718) 743-0990
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 111790
DEC Memo: spill was contained - no release to environment
Remarks: SPILL IS COMPLETELY CONTAINED, TANK WAS OVERFILLED: DID NOT IMPACT ENVIRONMENT: DEP WAS NOTIFIED:

Material:

Site ID: 373894
Operable Unit ID: 1131585
Operable Unit: 01
Material ID: 2121295
Material Code: 0038A
Material Name: CAUSTIC SODA
Case No.: 01310732
Material FA: Hazardous Material
Quantity: 250
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 220283
Spill No: 0307227
Spill Date: 10/9/2003
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/10/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 10/9/2003
CID: 216
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0

Date Entered In Computer: 10/9/2003
Spill Record Last Update: 10/10/2003
Spiller Name: JOE REDDINGTON
Spiller Company: NYC DEP
Spiller Address: JUNCTION BLVD
Spiller City,St,Zip: QUEENS, NY -
Spiller County: 001
Spiller Contact: JOE REDDINGTON
Spiller Phone: (212) 860-9315
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 111790
DEC Memo:

Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"SANGESLAND"Sangesland spoke with Mr. Reddington of NYC DEP. This is
a waste water treatment plant in Brooklyn. The oil delivery was in a
cement paved area into a UST. No drains were involved and the DEP
hired a contractor to clean it up.

Remarks: SPILL FROM OVER FILL WILL BE RECOVERED

Material:
Site ID: 220283
Operable Unit ID: 875978
Operable Unit: 01
Material ID: 500782
Material Code: 0022
Material Name: Waste Oil/Used Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Case No.: Not reported
Material FA: Petroleum
Quantity: 40
Units: Gallons
Recovered: 40
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY MANIFEST:

EPA ID: NYD000867861
Country: USA
Mailing Name: NYCDEP
Mailing Contact: R ITWARU
Mailing Address: 2591 KNAPP STREET
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-891-4000

NY MANIFEST:

No Manifest Records Available

SPILLS:

Facility ID: 0906506
DER Facility ID: 360306
Facility Type: ER
Site ID: 418844
DEC Region: 2
Spill Number: 0906506
Spill Date: 9/4/2009
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 9/8/2009
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 9/5/2009
CID: Not reported
Water Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/5/2009
Spill Record Last Update: 9/8/2009
Spiller Name: Not reported
Spiller Company: NYC DEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: MOHAMMAD AHSAN
Contact Phone: (718) 743-0990
DEC Memo: case closed. referred to water division.
Remarks: loading flange let loose on tank #44018, while excepting delivery had spill into secondary containment area. It is contained, and has been cleaned up. No resources have been affected

Material:

Site ID: 418844
Operable Unit ID: 1175005
Operable Unit: 01
Material ID: 2167447
Material Code: 0124A
Material Name: SODIUM HYPOCHLORITE
Case No.: 07681529
Material FA: Hazardous Material
Quantity: 200
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 0606364
DER Facility ID: 111790
Facility Type: ER
Site ID: 369701
DEC Region: 2
Spill Number: 0606364
Spill Date: 9/2/2006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.

Spill Closed Date: 9/5/2006
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 9/3/2006
CID: 75
Water Affected: PAEDUCK BASIN
Spill Source: Major Facility > 400,000 gal
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/3/2006
Spill Record Last Update: 9/5/2006
Spiller Name: Not reported
Spiller Company: CONEY ISLAND WATER POLL P
Spiller Address: 2591 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY 11208
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: WASTE PLANT-#5 CHANNEL OUT OF SERVICE-PLANT CANNOT PUMP 2 X-DRY WEATHER FLOW-INTO pAEDUCK bASIN-TO jAMAICIA bAY EVENTUALLY-STILL ONGOING-CALLER TRIED TO CONTAC T TIMELT FASHION-TECH DIFFICLUTY AT CALL IN WAS UNABLE TO CONTACT DEC

Material:

Site ID: 369701
Operable Unit ID: 1127535
Operable Unit: 01
Material ID: 2117134
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

SPDES:

Permit Number: NY0026182
State-Region: 02
Expiration Date: 12/31/2015
Current Major Minor Status: Major
Primary Facility SIC Code: 4952
State Water Body Name: ROCKAWAY INLET
Limit Set Status Flag: Active
Total Actual Average Flow(MGD): Not reported
Total App Design Flow(MGD): 110
UDF1: EDT
Lat/Long: 40.585611 / -73.929583
DMR Cognizant Official: THERESA NORRIS, PE
UDF2: 001701
UDF3: SB
FIPS County Code: NY047

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address
Non-Gov Permit Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Permit Supplemental Location: 59- 17 JUNCTION BLVD
Non-Gov Permit City: CORONA
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11368
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Facility Supplemental Location: 2591 KNAPP STREET
Non-Gov Facility City: BROOKLYN
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11235
State Water Body: 02030202010

UDF2: 001701
UDF3: SB
FIPS County Code: NY047

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address
Non-Gov Permit Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Permit Supplemental Location: 59- 17 JUNCTION BLVD
Non-Gov Permit City: CORONA
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11368
Non-Gov Facility Affiliation Type Desc: Owner
Non-Gov Facility Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Facility Supplemental Location: 59- 17 JUNCTION BLVD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S107788776

Non-Gov Facility City: CORONA
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11368
State Water Body: 02030202010

UDF2: 001701
UDF3: SB
FIPS County Code: NY047

Non-Gov Permit Affiliation Type Desc: Permittee
Non-Gov Permit Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address: 59- 17 JUNCTION BLVD
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: CORONA
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11368
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Facility Supplemental Location: 2591 KNAPP STREET
Non-Gov Facility City: BROOKLYN
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11235
State Water Body: 02030202010

UDF2: 001701
UDF3: SB
FIPS County Code: NY047

Non-Gov Permit Affiliation Type Desc: Permittee
Non-Gov Permit Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address: 59- 17 JUNCTION BLVD
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: CORONA
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11368
Non-Gov Facility Affiliation Type Desc: Owner
Non-Gov Facility Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address: NYCDEP - CONEY ISLAND WPCP
Non-Gov Facility Supplemental Location: 59- 17 JUNCTION BLVD
Non-Gov Facility City: CORONA
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11368
State Water Body: 02030202010

CBS:

CBS Number: 2-000238
Program Type: CBS
Dec Region: 2
Expiration Date: 2013/11/12
Facility Status: Active
UTMX: 590234.76491999
UTMY: 4493959.4638

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U112
East
1/4-1/2
0.411 mi.
2168 ft.
SEWERAGE TREATMENT PLANT
2591 KNAPP STREET
BROOKLYN, NY
Site 14 of 14 in cluster U

NY Hist Spills
S102560574
N/A

Relative:
Higher

Actual:
9 ft.

NY Hist Spills:
Region of Spill: 2
Spill Number: 9700663
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 04/15/1997 10:50
Reported to Dept Date/Time: 04/15/97 10:55
SWIS: 61
Spiller Name: SEWERAGE TREATMENT PLANT
Spiller Contact: ROBERT KEPICH
Spiller Phone: (718) 595-6777
Spiller Contact: ROBERT KEPICH
Spiller Phone: (718) 595-6777
Spiller Address: 2591 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: In Sewer
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. (Highly Improbable)
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/15/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 04/16/97
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: Hazardous Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEWERAGE TREATMENT PLANT (Continued)

S102560574

Quantity Spilled: 20
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: HYPOCHLORIC ACID
Class Type: HYPOCHLORIC ACID
Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: SPILL IN DRAINS OUTSIDE BUILDING. 11:49 TIBBE HAD CONVERSATION WITH PLANT - MATERIAL IS SODIUM HYPOCHLORIDE- MATERIAL IS USED IN SEWAGE TREATMENT. MATERIAL WENT THROUGH DRAINS INTO THE TREATMENT AREA. NO DEC ACTION REQUIRED.
Remark: CALLER SAYS THAT IT IS BEING CLEANED - NOT KNOWN HOW IT HAPPENED

X113
ENE
1/4-1/2
0.412 mi.
2177 ft.

BROOKLYN EAST 15 ANNEX DOS -DDC
2509 KNAPP STREET
BROOKLYN, NY

MANIFEST **1009244338**
NY Spills **N/A**

Site 1 of 3 in cluster X

Relative:
Higher

NY MANIFEST:
EPA ID: NYP010001899
Country: USA
Mailing Name: NYCDEP
Mailing Contact: NYCDEP
Mailing Address: 59-17 JUNCTION BOULEVARD
Mailing Address 2: Not reported
Mailing City: FLUSHING
Mailing State: NY
Mailing Zip: 11373
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-595-4656

Actual:
9 ft.

Document ID: NYB7125417
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: Not reported
Trans2 State ID: MA7222
Generator Ship Date: 961125
Trans1 Recv Date: 961125
Trans2 Recv Date: Not reported
TSD Site Recv Date: 961125
Part A Recv Date: Not reported
Part B Recv Date: 961226
Generator EPA ID: NYP010001899
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00075
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BROOKLYN EAST 15 ANNEX DOS -DDC (Continued)

1009244338

SPILLS:

Facility ID: 0002361
DER Facility ID: 97935
Facility Type: ER
Site ID: 112073
DEC Region: 2
Spill Number: 0002361
Spill Date: 5/25/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Date: 11/20/2000
SWIS: 2401
Investigator: JAKOLLEE
Referred To: Not reported
Reported to Dept: 5/25/2000
CID: 312
Water Affected: SHELL BANK CREEK
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 11/8/2000
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/25/2000
Spill Record Last Update: 2/4/2005
Spiller Name: Not reported
Spiller Company: NYC SANITATION
Spiller Address: Not reported
Spiller City,St,Zip: NEW YORK, NY
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"KOLLEENY"APPEARS THAT SURFACE RUNOFF PICKED UP OIL DRIPPED FROM DOS
TRUCKS IN PARKING LOT, RUNOFF DRAINED FROM S.E. CORNER OF LOT DOWN
EMBANKMENT INTO SHELL BANK CREEK(SHEEN WAS OBSERVED IN AREA OF CREEK
CONTAINED BY METAL SHEETING). SURFACE WATER SAMPLE SHOWED PRESENCE OF
MOTOR OIL, WITH ONE INDIVIDUAL COMPOUND EXCEEDING STANDARDS
(p-CYMENE, 164 PPB). DOS BUILT EARTHEN BERM TO PREVENT SURFACE RUNOFF
INTO CREEK, EXCAVATED CONTAMINATED SOIL FROM EMBANKMENT. ANOTHER
SURFACE WATER SAMPLE WAS TAKEN AND CAME BACK NON-DETECT FOR ALL STARS
LIST VOCS AND SVOCS. JON KOLLEENY OF DEC VISITED SITE ON 11/08/00 AND
OBSERVED NO SHEEN IN CREEK.

Remarks: SHEEN FROM THE DOS - UNK IF COMING FROM THE TRUCKS OR OTHER - SAMPLE
TAKEN. [SEE DEC REMARKS, 2ND PAGE]

Material:

Site ID: 112073
Operable Unit ID: 823873
Operable Unit: 01
Material ID: 550723
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BROOKLYN EAST 15 ANNEX DOS -DDC (Continued)

1009244338

Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

X114
ENE
1/4-1/2
0.413 mi.
2181 ft.

2472 KNAPP ST.
2472 KNAPP ST.
BROOKLYN, NY
Site 2 of 3 in cluster X

HIST LTANKS **S100494966**
NY Hist Spills **N/A**

Relative:
Higher

Actual:
9 ft.

HIST LTANKS:
Region of Spill: 2
Spill Number: 9214538
Spill Date: 03/31/1993
Spill Time: 15:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/12/93
Cleanup Ceased: 04/12/93
Cleanup Meets Standard: True
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/31/93
Reported to Department Time: 15:48
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: SHELL STATION
Spiller Address: 2472 KNAPP ST.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2472 KNAPP ST. (Continued)

S100494966

Spiller City,St,Zip: BROOKLYN, NY
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 646-6008
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/01/93
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 06/26/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 04/12/93: AIR BUBBLE IN LINE. RETESTED AND PASSED 4/6/93. 10/10/95: This is additional information about material spilled from the translation of the old spill file: SUPER NO LEAD.
Spill Cause: Not reported

Region of Spill: 2
Spill Number: 8710519
Spill Date: 03/16/1988
Spill Time: 14:30
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: a3
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: MULQUEEN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2472 KNAPP ST. (Continued)

S100494966

Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/16/88
Reported to Department Time: 15:02
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: (718) 891-4076
Spiller Extension: Not reported
Spiller Name: SHELL OIL COMPANY
Spiller Address: 30 JERICHO TPKE 500W
Spiller City,St,Zip: JERICHO, NY 11753-
Spiller Cleanup Date: / /
Facility Contact: DAVE MCNEIL
Facility Phone: (516) 365-7240
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-190861
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/22/88
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/09/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: ALSO SPILL 93-14538 CLOSED) DTW: 10 GWF: SE SPILL CALLED IN AFTER EXTENSIVE
CONATIMATION WAS FOUND AFTER TANK REMOVAL. SITE HAS SVES SYSTEM BUT STILL HAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2472 KNAPP ST. (Continued)

S100494966

Spill Cause: HIGH DISSOLVED. SHELL WIL DELINEATE DOWN GRADIENT AND DETERMINE IF THERE IS ANYMMORE FREE PRODUCT ON SITE, AND SEND PROPOSAL FOR NEW WELLS. 4/9/97
mmm:DOWN GRADIENT WELLS ALSO HAVE HIGH DISSOLVED. ENVIRTRAK INSTALLED TWO WELL CYCLOPS STRIPPERS TO STRIP VOA S WITH VES SYSTEM. STILL HIGH NUMBERS AT STRIPPERS BUT DROPPING DOWN GRADIENT. NOFREE PRODUCT.
4K TANK FAILED WITH A LEAK RATE OF 1.036GPH, SHELL WILL EXCAVATE, REPAIR AND RETEST. CONTACT: ROBERT BROSNAN 718) 891-4076.WAS SULLIVAN SPILL, RE ASSIGNED 4/18/95. ACTIVE REMEDIATION.

NY Hist Spills:

Region of Spill: 2
Spill Number: 8504360
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/07/1986 01:00
Reported to Dept Date/Time: 03/07/86 03:04
SWIS: 61
Spiller Name: SHELL OIL CO.
Spiller Contact: DAVE MCNEIL
Spiller Phone: Not reported
Spiller Address: 30 JERICHO TPKE 500 W
Spiller City,St,Zip: JERICHO NY, NY
Spill Cause: Equipment Failure
Reported to Dept: Groundwater
Water Affected: GROUNDWATER
Spill Source: 05
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/14/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/11/92
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/14/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2472 KNAPP ST. (Continued)

S100494966

Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109

DEC Remarks: mmm 8/14/97: SHELL SERVICE STATION WITH PRODUCT RELEASE, WHICH IS STILL ACTIVE
AND IN REMEDIATION UNDER SPILL 9314538.
Remark: PRESENTLY GOING TO PUMP THE TANKS DRY.

X115
ENE
1/4-1/2
0.413 mi.
2181 ft.

**SHELL OIL CO
2472 KNAPP ST
BROOKLYN, NY 11235**
Site 3 of 3 in cluster X

**RCRA-NonGen
LTANKS
MANIFEST
NY Spills**

**1000694377
NYD987006897**

**Relative:
Higher**

RCRA-NonGen:

Date form received by agency: 01/01/2007
Facility name: SHELL OIL CO
Facility address: 2472 KNAPP ST
BROOKLYN, NY 11235
EPA ID: NYD987006897
Mailing address: JERICO PLZ
JERICO, NY 11753
Contact: Not reported
Contact address: JERICO PLZ
JERICO, NY 11753

Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: VICTOR A SUTTER
Owner/operator address: NOT REQUIRED
NOT REQUIRED, NY 99999
Owner/operator country: US
Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: VICTOR A SUTTER
Owner/operator address: NOT REQUIRED
NOT REQUIRED, NY 99999
Owner/operator country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: SHELL OIL CO
Classification: Not a generator, verified

Date form received by agency: 07/14/1999
Facility name: SHELL OIL CO
Classification: Small Quantity Generator

Date form received by agency: 06/25/1992
Facility name: SHELL OIL CO
Classification: Large Quantity Generator

Violation Status: No violations found

LTANKS:

Site ID: 352651
Spill No: 0507273
Spill Date: 9/16/2005
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Not reported
Spill Closed Dt: 2/2/2006
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 9/16/2005
CID: 444
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 9/16/2005
Spill Record Last Update: 2/2/2006
Spiller Name: MATT SCHNICK
Spiller Company: SHELL GAS STATION
Spiller Address: 2472 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: MATT SCHNICK
Spiller Phone: (631) 979-5946
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 299949
DEC Memo: 09.16.05 SR//Sharif spoke to Matt Schnick of Long Shore Environmental(631-979-5946). He said they came across contaminated soil while removing a heating oil tank of 550 gallons. The tank was found corroded and removed. End point samples were being taken and a final report will be sent to DEC Jie Zhao.I sent a contaminated soil letter to Shell Oil Products, US, O.O. Box 1243, Waynes Boro, Virginia, 22980.2/2/06 Reassigned from Zhao to Foley. Received UST closure report for 550gal heating oil UST. Excavated area 12' wide X 14' long X 12' deep. Approx 50 cu yds of soil removed. PID ranged from 98ppm to > 2000ppm for presence of VOCs. Two VOCs were detected above RSCOs in south sidewall soil sample (xylenes and 1,2,4-trimethylbenzene) and one VOC above RSCOs in the west sidewall sample(MTBE). North and east sidewalls were below VOC RSCOs. All SVOCs were below RSCOs. A groundwater sample from the excavation indicated 10 VOCs and 5 SVOCs above gw standards. To be investigated and remediated under spill #8710519.
Remarks: 550 GALLON WAS CORROIDED: EXCAVATED SOIL AS MUCH AS POSSIBLE;

Material:

Site ID: 352651
Operable Unit ID: 1110141
Operable Unit: 01
Material ID: 2100157
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: True
Site ID: 352651
Operable Unit ID: 1110141
Operable Unit: 01
Material ID: 2106753
Material Code: 1213A
Material Name: MTBE (METHYL-TERT-BUTYL ETHER)
Case No.: 01634044
Material FA: Hazardous Material
Quantity: Not reported
Units: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Recovered: Not reported
Resource Affected: Not reported
Oxygenate: True

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 105575
Spill No: 8710519
Spill Date: 3/16/1988
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.

Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: 10/3/2006
Cleanup Meets Standard: False
SWIS: 2401
Investigator: aaobliga
Referred To: 5/2/12 - BIMONTHLY AS/SVE EVENTS
Reported to Dept: 3/16/1988
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 4
Date Entered In Computer: 3/22/1988
Spill Record Last Update: 8/1/2012
Spiller Name: DAVE MCNEIL
Spiller Company: SHELL OIL COMPANY
Spiller Address: 30 JERICHO TPKE 500W
Spiller City,St,Zip: JERICHO, NY 11753-
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: (718) 891-4076
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 299949
DEC Memo:

ALSO SPILL 93-14538(CLOSED)DTW: 10' GWF: SESPILL CALLED IN AFTER
EXTENSIVE CONATIMATION WAS FOUND AFTER TANK REMOVAL. SITE HAS SVES
SYSTEM BUT STILL HAS HIGH DISSOLVED. SHELL WIL DELINEATE DOWN
GRADIENT AND DETERMINE IF THERE IS ANYMMORE FREE PRODUCT ON SITE, AND
SEND PROPOSAL FOR NEW WELLS.4/9/97 mmm:DOWN GRADIENT WELLS ALSO HAVE
HIGH DISSOLVED. ENVIRTRAK INSTALLED TWO WELL CYCLOPS STRIPPERS TO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

STRIP VOA'S WITH VES SYSTEM. STILL HIGH NUMBERS AT STRIPPERS BUT DROPPING DOWN GRADIENT. NO FREE PRODUCT.12/1/03 Reassigned from Sangesland to K Foley.6/8/04 Meeting with Shell and Phoenix. System equipment has not been hooked up since 1998. Pilot test showed very low influence. Have been doing Hi-Vac events on MW-6. Requested they excavate a trench in the area of MW-5, MW-6. Groundwater is at 8'bgs. Phoenix suspected MTBE spike was due to a dispenser pan issue that was fixed in 2002. 6/8/04 May 2004 update report received. GW samples collected 4/13/04. BTEX ranged from ND(MW-7, MW-3, MW-2) to 2474ppb(MW-6). 3/28/2011 - Obligado - I reviewed a RAP for MNA. I rejected MNA based on grossly contaminated soil at shallow depth, significantly impacted gw (5000 ug/L benzene and >20,000 ug/L BTEX,) and the failure to demonstrate that alternate in-situ remedial methods are infeasible. 3/28/11 - Obligado - I emailed a letter to RP rejecting MNA and requiring an alternate RAWP within 90 days.5/16/11 - Obligado - I reviewed the 1Q11 monitoring report. BTEX was detected up to 19,300 ug/L including 6340 ug/L benzene. Several wells were not sampled due to snow. A RAP will be submitted in June.7/26/11 - Obligado - I reviewed a RAP submitted 6/30/11. The RAP again proposed MNA. I sent an email to Rob Rule and URS notifying them that DEC already rejected MNA and they are in violation of the Stipulation. I required submission of a new RAP within 30 days.11/28/11 - Obligado - I reviewed the revised RAP which proposed AS/SVE events on 2 air sparge wells in the vicinity of monitoring wells MW8 and MW9. They propose to install 2 air sparge wells, 2 SVE wells, and conduct bimonthly air sparge/SVE events. I emailed a letter to Shell and URS with some comments and required resubmission of the RAP within 30 days.12/5/11- Obligado - I approved the RAWP Addendum. Sent RAWP addendum letter via email to Rob Rule and Sarah at URS. AS/SVE wells to be installed within 60 days. 1/13/12 - Obligado - I received an updated RAWP from Sarah Burke. They will install 4 AS wells instead of 2. 8/1/12 - Obligado - According to 2Q12 update report, bimonthly AS/SVE events started on 5/2/12.

Remarks: 4K TANK FAILED WITH A LEAK RATE OF 1.036GPH, SHELL WILL EXCAVATE, REPAIR AND RETEST. CONTACT: ROBERT BROSNAN (718) 891-4076.WAS SULLIVAN SPILL, RE ASSIGNED 4/18/95. ACTIVE REMEDIATION.

Material:

Site ID: 105575
Operable Unit ID: 916394
Operable Unit: 01
Material ID: 572293
Material Code: 1213A
Material Name: MTBE (METHYL-TERT-BUTYL ETHER)
Case No.: 01634044
Material FA: Hazardous Material
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: True
Site ID: 105575
Operable Unit ID: 916394
Operable Unit: 01
Material ID: 462294
Material Code: 0009
Material Name: Gasoline

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: True

Tank Test:

Site ID: 105575
Spill Tank Test: 1533449
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 176639
Spill No: 9214538
Spill Date: 3/31/1993
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 4/12/1993
Facility Addr2: Not reported
Cleanup Ceased: 4/12/1993
Cleanup Meets Standard: True
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 3/31/1993
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/1/1993
Spill Record Last Update: 6/9/2005
Spiller Name: Not reported
Spiller Company: SHELL STATION
Spiller Address: 2472 KNAPP ST.
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 299949
DEC Memo: Not reported
Remarks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Material:

Site ID: 176639
Operable Unit ID: 978624
Operable Unit: 01
Material ID: 400739
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 176639
Spill Tank Test: 1541342
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

NY MANIFEST:

EPA ID: NYD987006897
Country: USA
Mailing Name: EAGLE 11 SHELL
Mailing Contact: STEPHANIE RICE
Mailing Address: P.O. BOX 4540
Mailing Address 2: Not reported
Mailing City: HOUSTON
Mailing State: TX
Mailing Zip: 77210
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 713-241-2258

Document ID: ARA9257340
Manifest Status: Not reported
Trans1 State ID: OHD009865825
Trans2 State ID: Not reported
Generator Ship Date: 02/10/1998
Trans1 Recv Date: 02/10/1998
Trans2 Recv Date: Not reported
TSD Site Recv Date: 02/19/1998
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD987006897
Trans1 EPA ID: ARD069748192
Trans2 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

TSD ID: 0902H205
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00492
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00492
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 98

Document ID: PAC8375920
Manifest Status: Completed copy
Trans1 State ID: PAAH0172
Trans2 State ID: Not reported
Generator Ship Date: 930119
Trans1 Recv Date: 930119
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930121
Part A Recv Date: 930203
Part B Recv Date: 930201
Generator EPA ID: NYD987006897
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: Not reported
TSD ID: PAD987266715
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00125
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 001
Container Type: TT - Cargo tank, tank trucks
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 93

SPILLS:

Facility ID: 1203159
DER Facility ID: 420297
Facility Type: ER
Site ID: 465950
DEC Region: 2
Spill Number: 1203159
Spill Date: 6/29/2012
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/6/2012
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 6/29/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/29/2012
Spill Record Last Update: 7/6/2012
Spiller Name: BRIAN WARNER
Spiller Company: METRO NY DEALER STATIONS
Spiller Address: 2472 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: BRIAN WARNER
Contact Phone: 2037408200
DEC Memo: cleanup completed by Tyree
Remarks: "Less than 5 gallons" spilled during fuel delivery. Contained in tank's spill bucket. Vac truck will pump out container.

Material:

Site ID: 465950
Operable Unit ID: 1215963
Operable Unit: 01
Material ID: 2214125
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 5
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 8504360
DER Facility ID: 299949
Facility Type: ER
Site ID: 105574
DEC Region: 2
Spill Number: 8504360

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Spill Date: 3/7/1986
Spill Cause: Equipment Failure
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 8/14/1997
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 3/7/1986
CID: Not reported
Water Affected: GROUNDWATER
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/11/1992
Spill Record Last Update: 3/10/2004
Spiller Name: DAVE MCNEIL
Spiller Company: SHELL OIL CO.
Spiller Address: 30 JERICO TPKE 500 W
Spiller City,St,Zip: JERICO NY, NY 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: PRESENTLY GOING TO PUMP THE TANKS DRY.

Material:
Site ID: 105574
Operable Unit ID: 896096
Operable Unit: 01
Material ID: 479959
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000694377

Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

116
SSE
1/4-1/2
0.414 mi.
2185 ft.

3030 EMMONS AVE
3030 EMMONS AVE
BROOKLYN, NY

NY Spills
NY Hist Spills

S102239424
N/A

Relative:
Lower

Actual:
3 ft.

SPILLS:

Facility ID: 9516027
DER Facility ID: 235067
Facility Type: ER
Site ID: 290298
DEC Region: 2
Spill Number: 9516027
Spill Date: 3/14/1996
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/14/1996
SWIS: 2401
Investigator: NIEVES
Referred To: Not reported
Reported to Dept: 3/14/1996
CID: 205
Water Affected: SHEEPS HEAD BAY
Spill Source: Missing Code in Old Data - Must be fixed
Spill Notifier: Missing Code in Old Data - Must be fixed
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/14/1996
Spill Record Last Update: 3/29/1996
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999
Contact Name: JOHN HALL
Contact Phone: (718) 934-1560
DEC Memo: Not reported
Remarks: sheen on water.

Material:

Site ID: 290298
Operable Unit ID: 1030672
Operable Unit: 01
Material ID: 352570
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 EMMONS AVE (Continued)

S102239424

Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9516027
Investigator: NIEVES
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/14/1996 06:15
Reported to Dept Date/Time: 03/14/96 09:04
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: UNKNOWN
Spiller Phone: Not reported
Spiller Contact: JOHN HALL
Spiller Phone: (718) 934-1560
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPS HEAD BAY
Spill Source: Not reported
Spill Notifier: Not reported
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 EMMONS AVE (Continued)

S102239424

Spill Closed Dt: 03/14/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/14/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/29/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: sheen on water.

Y117
SSW
1/4-1/2
0.419 mi.
2214 ft.

**SHEEPSHEAD BAY
EAST 26TH /EMMONS AV
NEW YORK CITY, NY**

**NY Spills S106006791
N/A**

Site 1 of 2 in cluster Y

**Relative:
Lower**

SPILLS:

Facility ID: 0205382
DER Facility ID: 106007
Facility Type: ER
Site ID: 122249
DEC Region: 2
Spill Number: 0205382
Spill Date: 8/22/2002
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 2/13/2003
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 8/22/2002
CID: 211
Water Affected: SHEEPSHEAD BAY
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: False

**Actual:
3 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S106006791

Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/22/2002
Spill Record Last Update: 2/13/2003
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Contact Name: PETTY OFFICER LIKENS
Contact Phone: (718) 354-4136
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"SANGESLAND" COPY GIVEN TO S. ZAHN(MARINE RESOURCES). SPILL CLOSED
Remarks: CALLER STATES THERE IS A LARGE AMOUNT OF DEAD FISH

Material:
Site ID: 122249
Operable Unit ID: 858056
Operable Unit: 01
Material ID: 519580
Material Code: 0988A
Material Name: FISHKILL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Z118
WSW
1/4-1/2
0.420 mi.
2219 ft.
GETTY PETROLEUM CORP
2112 AVE Z
BROOKLYN, NY 11235
Site 1 of 5 in cluster Z

RCRA-NonGen
FINDS
LTANKS
MANIFEST
NY Spills
1000990444
NYR000004036

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: GETTY PETROLEUM CORP
Facility address: 2112 AVE Z
BROOKLYN, NY 112352812
EPA ID: NYR000004036
Mailing address: JERICHO TNPK

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Contact: JERICO, NY 11735
Contact address: Not reported
JERICO TNPK
JERICO, NY 11735
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: GETTY PETROLEUM CORP
Owner/operator address: 125 JERICO TNPK
JERICO, NY 11735
Owner/operator country: US
Owner/operator telephone: (516) 338-6000
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GETTY PETROLEUM CORP
Owner/operator address: 125 JERICO TNPK
JERICO, NY 11735
Owner/operator country: US
Owner/operator telephone: (516) 338-6000
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: GETTY PETROLEUM CORP
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: GETTY PETROLEUM CORP

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Classification: Not a generator, verified

Date form received by agency: 05/02/1995

Facility name: GETTY PETROLEUM CORP

Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110009484174

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

LTANKS:

Site ID: 182169
Spill No: 9413634
Spill Date: 1/12/1995
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 5/9/2005
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 1/12/1995
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 2/1/1995
Spill Record Last Update: 5/9/2005
Spiller Name: Not reported
Spiller Company: GETTY
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 152697
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Remarks: "VOUGHT"Reassigned fro Sigona to Vought on April 25, 2003.11/20/2003-Vought-See closed spill #9309371 of odors from this site.7/27/04-Vought-Spoke to property owner and faxed FOIL request.Arkagy Nabatov (718-743-0435)4/29/2005-Vought-Received message from Kay Diambrosi (718-646-0869). Vought returned call and she is owner of 2624 East 22nd street. Diambrosi is looking to sell property.See also closed spill #'s: 9108824, 9401301, 9413634, 9501297, 9502664, and open spill 9309371.
HOLE IN UPPER PORTION IN ONE OF TANKS AND CONTRACTOR TO EXCAVATE TANK

Material:

Site ID: 182169
Operable Unit ID: 1011200
Operable Unit: 01
Material ID: 372376
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 182169
Spill Tank Test: 1543530
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 182168
Spill No: 9401301
Spill Date: 4/27/1994
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/27/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 4/27/1992
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 4/28/1994
Spill Record Last Update: 5/9/2005
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 152697
DEC Memo: See also closed spill #'s: 9108824, 9401301, 9413634, 9501297, 9502664, and open spill 9309371.
Remarks: TANK HAD 300-400 GALLON YESTERDAY & IS DRY TO DAY.

Material:

Site ID: 182168
Operable Unit ID: 998571
Operable Unit: 01
Material ID: 385062
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Site ID: 182170
Spill No: 9501297
Spill Date: 3/28/1995
Spill Cause: Tank Failure
Spill Source: Gasoline Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 5/15/1995

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 5/1/1995
CID: Not reported
Water Affected: Not reported
Spill Notifier: DEC
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 5/18/1995
Spill Record Last Update: 5/9/2005
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 152697
DEC Memo: See also closed spill #'s: 9108824, 9401301, 9413634, 9501297,
9502664, and open spill 9309371.

Remarks: CONTAMINATED SOIL BEING PILED AT SITE OF TANK REMOVAL, TANKS WERE
BEING REMOVED A MONTH AGO - SOIL IS BLOWING AROUND - HAS NOT BEEN
REMOVED BY CONTRACTOR.

Material:
Site ID: 182170
Operable Unit ID: 1015698
Operable Unit: 01
Material ID: 369907
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Last Modified: Not reported
Test Method: Not reported

NY MANIFEST:

EPA ID: NYR000004036
Country: USA
Mailing Name: GETTY PETROLEUM CORP
Mailing Contact: STEVE GORDON
Mailing Address: 2112 AVENUE Z
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11204
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 800-645-8265

Document ID: MAG2629390
Manifest Status: Completed copy
Trans1 State ID: CT2142A
Trans2 State ID: ME620895
Generator Ship Date: 950823
Trans1 Recv Date: 950823
Trans2 Recv Date: 950826
TSD Site Recv Date: 950828
Part A Recv Date: 950913
Part B Recv Date: 950914
Generator EPA ID: NYR000004036
Trans1 EPA ID: MAD039322250
Trans2 EPA ID: MAD039322250
TSDF ID: MAD053452637
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00220
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 95

SPILLS:

Facility ID: 9309371
DER Facility ID: 152697
Facility Type: ER
Site ID: 124497
DEC Region: 2
Spill Number: 9309371
Spill Date: 11/2/1993
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 4/4/2006
SWIS: 2401
Investigator: rjfeng

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Referred To: P&T, SVE SHUTDOWN 4/2005
Reported to Dept: 11/2/1993
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 4/7/1994
Spill Record Last Update: 4/4/2006
Spiller Name: Not reported
Spiller Company: Getty Petroleum
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT"10/10/95: This is additional information about material spilled from the translation of the old spill file: ODOR.08/23/01Reassigned from Tomasello to RommelSpill 0005548 closed and cross-referenced to this spill (odors during EVR visit.)Address corrected from 2110 Jerome Avenue to 2101 Avenue Z (as it appears on the PBS registration. 3/13/03 REASSIGNED FROM ROMMEL TO VOUGHT. 5/9/05-Vought-New file review by Vought:See also closed spill #'s: 9108824, 9401301, 9413634, 9501297, 9502664, 9309371.Status Report(Fenley & Nicol)-Nov 1993 thru June 1994. Fenley & Nicol(F&N) hired by DEC to investigate Rizzutto Residence at 2110 Jerome Avenue due to "several complaints were reported to NYSDEC of petroleum vapors in the basement and house of Joseph Rizzuto. "F&N immediately installed a Vapor Abatement System(VAS) and five VAS wells in the November of 1993". Fifteen additional monitoring wells and one recovery well were also installed from Nov to Dec 1993. Free product was also recovered via vaccum truck. A groundwater pump and treat system was also installed and started in March 1994. Weekly well gauging and system maintenance, quarterly groundwater sampling, collection of a free product sample for fingerprinting, collection of monthly water samples from influent and effluent sampling ports of stripper tower, analyses of VAS emmissions via portable gas chromatograph. VAS was started on 11/19/93. Groundwater flow to the southwest. Fingerprinting results of product from wells and gasoline from Getty match. Report recommends the installation of one additional monitoring well on Getty property, performance of a slug test and performance of soil borings at new recovery well location. Groundwater analyticals show 68ppb benzene(FN4), 940ppb toluene(FN4), 1100ethylbenzene(FN4), 3900ppb xylene(FN4), 1700ppb MTBE(FN4), 1000ppb benzene(FN5), 590ppb toluene(FN5), 160ppb ethylbenzene(FN5), 1300ppb xylene(FN5), 3700ppb MTBE(FN5), 5ppb toluene(FN6), 13ppb xylene(FN6), 13ppb MTBE(FN6), 69ppb xylene(FN7), 11ppb MTBE(FN7), 65ppb benzene(FN10), 18ppb toluene(FN10), 140ppb xylene(FN10), 290ppb MTBE(FN10), 24ppb MTBE(FN11), 20ppb benzene(FN12), 14ppb toluene(FN12), 76ppb xylene(FN12), 1400ppb MTBE(FN12), 120ppb MTBE(FN13), 46ppb benzene(FN14), 330ppb toluene(FN14), 1000ppb

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

ethylbenzene(FN14), 2900ppb xylene(FN14), 1600ppb MTBE(FN14), 3800ppb benzene(Y1), 16000ppb toluene(Y1), 10000ppb ethylbenzene(Y1), 53000ppb xylene(Y1), 20000ppb MTBE(Y1), 61ppb xylene(Y5), 680ppb benzene(W4), 2600ppb toluene(W4), 2700ppb ethylbenzene(W4), 9900ppb xylene(W4), 7000ppb MTBE(W4), 260ppb benzene(W5), 1200ppb xylene(W5), 17000ppb MTBE(W5), 21ppb MTBE(W6), 9ppb xylene(W7), 770ppb benzene(W10), 850ppb toluene(W10), 1800ppb xylene(W10), 55000ppb MTBE(W10), 190ppb benzene(W11), 17ppb toluene(W11), 66ppb xylene(W11), 6200ppb MTBE(W11), 20ppb benzene(W12), 9ppb toluene(W12), 73ppb MTBE(W12), 16ppb MTBE(W13), 260ppb benzene(W14), 31ppb toluene(W14), 1000ppb xylene(W14), 6700ppb MTBE(W14).Indoor Air Sample Analyticals (Pedneault Assoc)-5/19/04. One air sample was collected from Rizutto residence(2110 Jerome Ave). "In summary all of the parameters detected during this analysis as shown upon the data report, were found in concentrations below the method detection limit of 1.0ug/Kg and therefore present no significant consequence."Letter from Public Advocate(Green)for the City of New York to DEC Atwater-6/1/04. "I would appreciate a detailed explanation about the nature of the work in the vicinity of Ms Stone's apartment(2110 Jerome Ave), the results of any tests taken for DEC, and what if any steps DEC is taking to provide information to residents along this block of the work and any risks to their Health".Letter from DEC Atwater to Green-6/10/94. History of investigation and remediation to date (installation of VAS, collection of indoor air samples), copy of indoor analyticals (which were also forwarded to NYCDOH Minishi), installation of groundwater pump and treat system. NYCDOH to prepare review letter.Monthly Influent Analyticals (EcoTest) June 1994 thru August 1994.Monthly Status Report (F&N) July 1994 thru August 1994.Work Proposal (F&N)-9/9/94. Work to be conducted at the site: 1)installation of one soil boring and collection of split spoon samples at new recovery well (RW2) location 2)installation of recovery well 3)trench new well to system 4)operate system.Monthly Monitoring Report (F&N)-Sept 1994. System recovery to date: 953.29 gallons. Quantity in recovery tank=7 gallons. "On 9/8/04 vacuum truck pumped 188.00 gallons. Sheen in FN1,8,9, Y1 and Y3.Meeting Minutes-9/13/04. DEC Tomasello approved the installation of an additional recovery well located near the Getty Station site.Letter from F&N Hale to DEC Tomasello-10/21/94. "The purpose of this letter is to provide you with the cost analysis you requested regarding the periodic changes of carbon in the 2000-lb GF Carbon Canister located at the Jerome Ave. site".Monthly Monitoring Reports(F&N) October 1994 thru Dec 1994.Monthly Influent Analyticals (EcoTest) Nov 1994.Groundwater Analyticals (EcoTest) Dec 1994.Meeting Minutes (F&N)-1/5/95. "F&N will measure the recharge of floating product from Recovery Well #2. If recharge is high, F&N will investigate to determine the source of continued floating product. Mostafa will perform research on the use of a thermal oxidizer and present a proposal to Mr. Tomasello".Monthly Influent and Effluent Analyticals for Vapor Extraction System-September 1994 thru December 1994.Semi-Annual Report (F&N) July 1994 thru January 1995. Existing system consists of twenty monitoring wells and two recovery wells, a vapor abatement system and a pump and treat system. Groundwater at a depth of 9' below grade. Site OM&M consists of weekly well gauging, weekly bailing of free product. Soil boring for second recovery well was performed and installation of second recovery well was on 11/11/94. Pump test was performed in Jan 1995 to "establish rate of recharge of floating product into the recovery wells". Site maybe

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

tidally influenced. "The distribution of dissolved BTEX beneath the site indicates that the plume has been hydraulically been captured by the remediation system". "The quantity of product in RW2 after a four hour period suggests that the source of this product is an active leak". Report recommends: 1)current schedule of groundwater monitoring, sampling and quarterly reporting should continue 2)Getty service station should be investigated to determine the source of the floating product currently accumulating in the recovery wells. Groundwater analyticals show: 320ppb benzene(Y1), 7400ppb toluene(Y1), 4000ppb ethylbenzene(Y1), 41000ppb xylene(Y1), 610ppb benzene(FN2), 3500ppb toluene(FN2), 750ppb ethylbenzene(FN2), 5400ppb xylene(FN2), 130ppb MTBE(FN2), 260ppb benzene(FN3), 450ppb toluene(FN3), 20ppb ethylbenzene(FN3), 2000ppb xylene(FN3), 160ppb MTBE(FN3), 87ppb xylene(FN4), 44ppb MTBE(FN5), 10ppb MTBE(W6), 14ppb benzene(FN9), 31ppb xylene(FN9), 8900ppb MTBE(FN9), 110ppb MTBE(FN10), 5ppb xylene(FN12), 38ppb MTBE(FN12).Letter from DEC Tomasello to Getty (Ochotorena)-1/11/95. "The Department is now giving formal notice to the Getty Petroleum Corporation that our investigation has concluded that the source of this contamination of the waters of the State has originated from the Getty Service Station at 2112 Avenue Z, Brooklyn, NY." "The Getty Petroleum Corporation will be responsible for the reimbursement of all monies expended...".Monthly Monitoring Report (F&N) January 1995 thru July 1995.Effluent analysis from Vapor Extraction System (F&N) Jan 1995 thru June 1995.5/10/04-Vought-Continued File Review:Letter from F&N(Porsche) to DEC Tomasello-2/10/95. "Enclosed please find the updated Recovery System as built drawings."Letter from F&N(Ash) to DEC Tomasello-6/2/95. Proposal for the installation of a VES on the Getty Service Station site sidewalk to prevent migration of vapors to the Rizzuto residence. New VES will consist of 3 new 2" VES wells to be tied to the existing monitoring wells onsite.Semi-Annual Report (F&N) January 1995 thru July 1995. Twenty monitoring wells onsite with two recovery wells. Report recommends "the current remedial system, the schedule of groundwater monitoring, sampling and quarterly reporting should continue". Groundwater analyticals show 8ppb benzene(FN8), 13ppb toluene(FN8), 39ppb xylene(FN8), 5ppb benzene(FN9), 5ppb toluene(FN9), 8ppb xylene(FN9), 350ppb benzene(FN10), 700ppb toluene(FN10), 400ppb ethylbenzene(FN10), 1100ppb xylene(FN10), 120ppb MTBE(FN10), 15ppb toluene(Y1), 1800ppb xylene(Y1), 1800ppb benzene(FN4), 100ppb toluene(FN4), 100ppb ethylbenzene(FN4), 330ppb xylene(FN4), 20ppb MTBE(FN4), 610ppb toluene(FN3), 600ppb ethylbenzene(FN3), 1900ppb xylene(FN4), 21ppb MTBE(FN4), 16ppb benzene(FN2), 820ppb toluene(FN2), 960ppb ethylbenzene(FN2), 3700ppb xylene(FN2), 200ppb MTBE(FN2), 450ppb benzene(FN1), 2700ppb toluene(FN1), 300ppb ethylbenzene(FN1), 4700ppb xylene(FN1), 16ppb MTBE(FN1). Monthly Monitoring Reports (F&N) August 1995 thru Sept 1995.Effluent analysis from Vapor Extraction System (F&N) July 1995 thru Sept 1995.Remediation Plan (Tyree Brothers)-9/19/95. "Tyree Brothers Inc has been instructed by Getty Petroleum Corp. to request the assumption of responsibilities for all monitoring sampling operation and maintenance of all remediation activities associated with this spill location". "Getty Petroleum wishes to enter into a Stipualtion Agreement with the NYSDEC...". "Getty agrees to take over all of the currently on-going activities associated with the site...".Letter from DEC Tomasello to D'Ambrosi(owner of 2624 East 22nd St)-9/24/95. "The Department has determined that property belonging to you is within the affected

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

area". "Specific work to be performed includes, but is not limited to, air wuality monitoring within the house, the installation of a soil vapor abatement system on the property side adjacent to 2110 Jerome Avenue". Monthly Monitoring Reports (F&N) August 1995 thru Dec 1995. Effluent analysis from Vapor Extraction System (F&N) Oct 1995 thru Nov 1995. Indoor Air Analyticals (Pedneault Assoc)-10/5/95. Samples collected from 2624 East 22nd Street. Analyticals show 37.9ppb v/v toluene. Semi-Annual Report (F&N) July 1995 thru Dec 1995. "A complaint about the petroleum odors from the basement of the next door neighbor of the private residence prompted installatoin of additional soil borings in the yard area. Groundwater samples from these borings indicated high BTEX concentrations. Therefore as per NYSDEC, F&N installed four additional VAS wells in October 1995." Groundwater samples collected semi-annually. "Like that of BTEX, the MTBE plume has also migrated toward the VES stack and the recovery system". Report concludes "the current reovery system is operating effectively and it should be continued until the cleanup. In addition, the scheduled groundwater monitoring and reporting should continue". Groundwater analyticals show: 160ppb benzene(FN1), 4200ppb toluene(FN1), 2100ppb ethylbenzene(FN1), 8100ppb xylene(FN1), 50ppb MTBE(FN1), 74ppb benzene(FN2), 520ppb toluene(FN2), 1600ppb ethylbenzene(FN2), 8500ppb xylene(FN2), 140ppb MTBE(FN2), 19ppb benzene(FN3), 60ppb toluene(FN3), 410ppb xylene(FN3), 5ppb toluene(FN5), 16ppb xylene(FN5), 75ppb benzene(FN8), 280ppb toluene(FN8), 25ppb ethylbenzene(FN8), 2200ppb xylene(FN8), 60ppb MTBE(FN8), 150ppb benzene(FN9), 650ppb toluene(FN9), 440ppb xylene(FN9), 38ppb MTBE(FN9), 11ppb benzene(FN10), 5ppb toluene(FN10), 100ppb xylene(FN10), 8ppb xylene(FN14). Closure Report for the Excavation Of Underground Storage Tanks (Tyree)-January 1996. Removal of twelve (550-gallon) gasoline USTs and one (550-gallon) waste oil UST. Two of the gasoline tanks were previously abandoned. "Two of the gasoline tanks which were not in service, had one hole below the fill. The holes were approximately 1" in diameter". 716.26 tons of impacted soil was removed. Seven endpoint soil samples were collected. Soil analyticals show: 1760ppb xylene(east south). Letter from Tyree Brothers-1/14/96. "Enclosed please find the analytical data for the stipper tower sampling performed at the above referenced site during the month of December 1996". Stipulation Agreement from DEC Tomasello to Getty Petroleum (Delgadio)-2/9/96. Letter from Getty Petroleum (Jones) to DEC Tomasello-2/16/96. "I am enclosing herewith executed Stipulations for the above referenced locations". Signed STIP for 2112 Ave Z included. Monthly Monitoring Reports (F&N) January 1996 thru April 1996. VES Emmission Data (F&N)-2/2/96. Air Stipper Tower Data(Tyree Brothers)-3/24/96. Quarterly Monitoring Reports (Tyree) April 1996 thru June 1996. Site being used as an "active taxi/livery station". Twenty monitoring wells onsite and two recovery wells for pump and treat system. VES(aka SVES) also offsite and operating. Site undergoing monthly gauging, quarterly sampling. Pump and treat system being sampled monthly. Recovery to date of LNAPL is 1766.42 gallons. Groundwater is 6-9' below grade and flow to the south. Groundwater analyticals show 493ppb toluene(W1), 1690ppb ethylbenzene(W1), 7360ppb xylene(W1), 142ppb toluene(W2), 2800ppb ethylbenzene(W2), 12170ppb xylene(W2), 250ppb toluene(W3), 1280ppb ethylbenzene(W3), 6200ppb xylene(W3), 146ppb MTBE(W3), 840ppb toluene(W4), 1220ppb ethylbenzene(W4), 3950ppb xylene(W4), 130ppb MTBE(W4), 6ppb toluene(W5), 42ppb ethylbenzene(W5), 181ppb xylene(W5), 36ppb toluene(W6), 7ppb toluene(W7), 21ppb MTBE(W7), 9ppb

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

benzene(W8), 53ppb toluene(W8), 17ppb ethylbenzene(W8), 271ppb xylene(W8), 7pp benzene(W9), 17ppb toluene(W9), 21ppb xylene(W9), 24ppb MTBE(W9), 19ppb benzene(W10), 38ppb toluene(W10), 102ppb ethylbenzene(W10), 208ppb xylene(W10), 65ppb MTBE(W11), 134ppb benzene(W16), 1300ppb toluene(W16), 436ppb ethylbenzene(W16), 5170ppb xylene(W16), 19ppb ethylbenzene(W17), 607ppb xylene(W17), 8ppb toluene(W20), 34ppb xylene(W20).Stripper Tower Sampling Data (Tyree Brothers) July 1996 thru August 1996.Letter from Getty (Delgadío) to Attorney General-8/26/96. "This letter is in response to your request for an offer from Getty Petroleum Corp. to settle all of the State's past claims for clean up of other costs incurred by the spill fund in connection with the petroleum spill referred to above". "Accordingly Getty offers the State reimbursement for its costs during the period of February 7, 1994 through February 23, 1995 in the sum of \$225,000.Letter from New York State Comptrollers Office (Hohenstein) to Getty (Delgadío)-10/3/97. "If it is shown that certain costs were inappropriate and went undetected in prior reviews and/or audits, of said costs by representatives of the State of New York, I will consider and reduction in the amount owing for past costs". "The penalty amounts demanded will not change".Letter from F&N Blumberg to DEC Tomasello-10/2/96. "As per your request the G-5 Carbitrol carbon unit was removed from the above referenced site...". Two 55-gallon drums of carbon were installed as replacement.Quarterly Monitoring Reports (Tyree Brothers) July 1996 thru Sept 1996.Synopsis of Activities Conducted to Date (Tyree Brothers)-11/15/96. Air samples were collected from the basement of the Rizzuto residence. "Tyree will continue to conduct monthly air testing of the SVE system and the basement of the Rizzuto residence". Air samples show below method detection limits for BTEX.Letter from DEC Tomasello to Tyree Rennie-12/09/96. For VAS system on Rizzuto residence "levels from the system after the carbon are the only samples that need to be taken to satisfy air discharge rates. A quarterly sample should be taken from the pipe prior to the treatment system to show what is being removed from the ground". Letter also requires that addressing odor complaints of D'Ambrosi residence and Salimeri residence is "taken care of".Stripper Tower Data (Tyree) November 1996.Letter from Tyree Brothers(Rennie) to Salermi Residence(2623 E 21st Street)-1/16/97. "This correspondence is in response to to your complaint regarding odors in your basement". "...Tyree must conduct air monitoring in the basement of your residence". Request for access included in letter.Corrective Action Plan (Tyree Brothers). In June 1995 "the city replaced a leaking sewer pipe in Jerome Avenue located between the former Getty station and the Rizzutto residence. 200 tons of soil is removed by the city and disposed of by Getty". Tyree proposed increasing the pumping rate of RW2 and decreasing RW1 rate to pull plume away from Rizzutto residence. Included were figures on the radius of influence calculated during a pumping test. "Tyree proposes the periodic additions of hydrogen peroxide to aid in the desorption of the contaminants". Proposal to also check vacuum in onsite wells and to increase blower size to see if soil venting shall be continued due to effluent at non-detect.Stripper Tower Data (Tyree) March 1997.Quarterly Monitoring Reports (Tyree)October 1996 thru December 1997.Stripper Tower Data (Tyree) April 1997 thru October 1997.Letter from NYS Comptroller (Hohenstein) to Getty (Delgadío)-10/1/97. "Your previous settlement offer of \$317,500 plus "interest at a rate the State pays on its obligations" is inadequate". "In accordance with your request, a copy of every invoice for spill No. 93-9371 paid by

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

the Fund in 1996 has been sent to you under a separate cover". Biorem Proposal (Tyree Brothers)-12/23/97. Proposal for augmentation of remediation via the addition of H-10 bacteria. Stripper Tower Data (Tyree) December 1997 thru February 1998. Quarterly Monitoring Report (Tyree Org) Jan 1998 thru March 1998. Seventeen monitoring wells onsite, three venting wells and two recovery wells. Monthly well gauging, quarterly sampling, Monthly sampling of influent/effluent from SVES and monthly sampling of influent/effluent from pump and treat system. Groundwater at depth of 7-11' below grade and flow to the southwest. No free product on of offsite. Groundwater analyticals show: 137ppb toluene(FN1), 2360ppb ethylbenzene(FN1), 17000ppb xylene(FN1), 327ppb toluene(RW1), 530ppb ethylbenzene(RW1), 5080ppb xylene(RW1), 35ppb benzene(Y1), 723ppb toluene(Y1), 651ppb ethylbenzene(Y1), 5300ppb xylene(Y1), 73ppb toluene(FN2), 2520ppb ethylbenzene(FN2), 18300ppb xylene(FN2), 76ppv toluene(RW2), 25ppb ethylbenzene(RW2), 178ppb xylene(RW2), 303ppb toluene(FN3), 2070ppb ethylbenzene(FN3), 11700ppb xylene(FN3), 188ppb toluene(FN4), 250ppb ethylbenzene(FN4), 2330ppb xylene(FN4), 33ppb MTBE(FN5), 32ppb MTBE(Y5), 8ppb toluene(FN8), 9ppb ethylbenzene(FN8), 81ppb xylene(FN8), 14ppb toluene(FN10), 16ppb ethylbenzene(FN10), 181ppb MTBE(FN10). Letter from OSC Hohenstein to Getty Delgado-4/7/98. "Regrettably your offer as yet falls short and must be rejected by the New York State Environmental Protection and Spill Compensation Fund". "With this letter I refer the two above spill matters back to the office of the Attorney General for litigation." Quarterly Monitoring Reports (Tyree Org) April 1998 thru July 1998. Stripper Tower Data (Tyree) December 1997 thru February 1998. Water Discharge Analyticals (Tyree) May 1998 thru February 1999. Quarterly Monitoring Reports (Tyree Org) July 1998 thru Jan 1999. Letter from Tyree (Rennie) to Salermi residence-4/7/99. "...Tyree must conduct air monitoring in the basement of your residence". "Tyree kindly requests access to your residence". Letter from Tyree (Rennie) to D'Ambrosi residence-4/7/99. "...Tyree must conduct air monitoring in the basement of your residence". "Tyree kindly requests access to your residence". Letter from Tyree (Rennie) to Rizzutto residence-4/7/99. "...Tyree must conduct air monitoring in the basement of your residence". "Tyree kindly requests access to your residence". Quarterly Monitoring Reports (Tyree Org) Jan 1999 thru August 1999. Water Discharge Analyticals (Tyree) June 1999 thru July 1999. Letter from Attorney General to DEC-7/12/99. "I am pleased to inform you that I have recently received the settlement checks from Getty Properties Corp...." "As such I will begin to take the necessary steps to close our files on these cases". 5/11/05-Vought-Continued file review by Vought: Quarterly Monitoring Reports (Tyree Org) Sept 1999 thru February 2001. Seventeen monitoring wells, three venting wells and two recovery wells. Groundwater at depths of 7-9' below grade and flow to the south. Monthly gauging, quarterly groundwater sampling, monthly effluent sampling of VES and monthly sampling of groundwater pump and treat discharge. "Remediation system shut down in October for servicing". "Missed SVE sampling for July and August". SVE shut down from Dec 2001 thru Feb 2001 for "blower/piping repairs". Groundwater analyticals show: 51ppb toluene(FN1), 561ppb ethylbenzene(FN1), 6770ppb xylene(FN1), 95ppb ethylbenzene(FN1), 1086ppb xylene(FN1), 19ppb MTBE(FN2), 16ppb toluene(FN3), 12ppb xylene(FN3), 6ppb toluene(FN4), 62ppb ethylbenzene(FN4), 119ppb xylene(FN4), 22ppb ethylbenzene(FN10), 38ppb xylene(FN10), 41ppb ethylbenzene(Y1),

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

486ppb xylene(Y1), Dry(Y2), 12ppb ethylbenzene(Y3), 60ppb xylene(Y3), dry(Y5).Letter from Tyree Org to DEC Rommel-6/15/01. Request to "remove wells 7, 12, 13 and 15 from the monitoring/sampling regimen, leaving wells 1-6, 8-11 and 14. "Influent sampling will be changed to quarterly". "weekly system component maintenance schedule is to be scaled back to Bi-monthly". "These changed will be effected as of July 1, 2001."Quarterly Monitoring Reports (Tyree Org) March 2001 thru February 2004. Seventeen monitoring wells, three venting wells and two recovery wells. Groundwater at depths of 8-9' below grade and flow to the south. Quarterly gauging, quarterly groundwater sampling. Groundwater analyticals from 2/04 show: 14ppb ethylbenzene(FN1), 99ppb xylene(FN1), 21ppb ethylbenzene(FN2), 60ppb xylene(FN2), 38ppb ethylbenzene(FN2), 94ppb xylene(FN2), 6ppb xylene(FN10), 37ppb ethylbenzene(FN14), 73ppb xylene(FN14), 33ppb toluene(Y1), 415ppb ethylbenzene(Y1), 2650ppb xylene(Y1), Dry(Y2).Fax from HydroTech (Devoe 631-462-5866) for Spill #0501198 located at 2624 East 22nd Street-5/6/05. Three borings performed and three water samples and one soil sample collected. Soil analyticals show no TAGM 4046 Soil Cleanup Objective exceedence. Groundwater analyticals show 185ppb ethylbenzene(GP3), 774ppb xylene(GP3), 1080ppb 1,2,4-trimethylbenzene(GP3), 9ppb ethylbenzene(GP4), 17ppb xylene(GP4), 170ppb 1,2,4-trimethylbenzene(GP4). DEC requires: 1)submission of well development/purge logs from HydroTech 2)scaled site plan with boring locations and property boundaries from HydroTech 3)resampling of locations by Tyree 4)installation of vapor barrier by HydroTech and submission of building plans so that wells may be installed by Tyree at locations of exceedence. Vought called D'Ambrosi (718-646-0869)and informed her of requirements. Vought sent letter to HydroTech for site plan and installation of vapor barrier and cc'd Getty, D'Ambrosi and Banthitta. Vought also sent requirement letter to Getty for soil borings/well installation and future purging logs and cc'd HydroTech, Banthitta and D'Ambrosi. Vought called Devoe (HydroTech) and spoke with Robbins and work was performed for potential purchaser. Potential purchaser info is Mario Banthitta. Vought called Joe Rennie, informed him of letter and will fax him Hydrotech results with letter.6/1/05-Vought-Called Mark Robbins for status of scaled site plan and DEC will receive site plan by today. Vought spoke to D'Ambrosi and her attorney is Guy Guiliano (718-645-2251 718-645-7004). Vought received copy of site plan and forwarded to Delta and Tyree with analyticals. Vought spoke with DEC Urda and Oliva and will send letter stating that Department is not requiring soil excavation as part of remediation upon receiving letter from D'Ambrosi's attorney regarding necessity of soil excavation as part of remediation. Vought called Guy Guiliano and no answer at either phone number.6/2/05-Vought-Called Guy Guiliano and spoke to his secretary and left message to send letter to DEC with request.6/3/05-Vought-Received letter from Guy Giuliano dated 6/2/05. "I represent Katharine D'Ambrosi in the sale of the above mentioned premises. I would like some information as to the status of the problem as to the groundwater contamination and any results of tests that were conducted". Vought sent letter stating that with respect to groundwater contamination, the state was requiring the continued monitoring of wells onsite and had no requirements with respect to the soil and the soil source was offsite.3/14/05-Vought-Received call from Micheal Prober (917-771-5558) who is potential purchaser of 2624 East 22nd Street who did not hire Hydro Tech who was asking about site requirements.6/23/05-Vought-Received call from Getty Shea that

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

he will hold meeting with developers of 2624 East 22nd st and get back to DEC with results in late July. 7/22/05-Vought-Received call from Chris D'Ambrosi (718-646-0869). Vought returned call and meeting set up at DEC for 7/25 at 10am to discuss site development. Vought called Shea for status of meeting and left message to return call. Vought received message from Lindell returning call to Shea. Vought called Lindell and he will be available on 7/25/04 to discuss site via teleconference. 7/25/05-Vought-Spoke to Paul Lindell and required installation of soil borings at former HydroTech boring locations. Lindell agreed to perform borings. 9/16/05-Vought-Received call from Kay D'Ambrosi (718-646-0863) regarding status of borings performed by Lindell. Vought referred call to DEC Oblgado. 9/28/2005 - Feng - Quarterly Monitoring Report from Tyree for June 2005 thru Aug 2005. 17 monitoring wells, 3 monitoring/venting wells and 2 recovery wells were on and off site. Groundwater depth is 8.66' to 6.77' below grade and flow southerly. NO LNAPL detected. Most of the MTBE concentration are low or below detection limit. For total BTEX, 45ppb (FN-1), 15ppb (FN-2), 161ppb (FN-3), and 23ppb (FN-4). 9/28/2005 - Feng - Subsurface Investigation Report from Tyree for work that was conducted at the D'Ambrosi residence associated with this spill, dated August 15, 2005. Soil Boring were performed on August 4, 2005. There were some VOCs and SVOCs detected in the groundwater samples. Listing below were the concentration that exceeded the TAGM 4046 groundwater standard, for monitoring well(DR-1), Ethylbenzene was 118ppb, Xylenes was 764ppb, Isopropylbenzene was 32.2ppb, n-Propylbenzene was 135ppb, 1,3,5-Trimethylbenzene was 250ppb, 1,2,4-Trimethylbenzene was 763ppb, sec-Butylbenzene was 12.4ppb, n-Butylbenzene was 36.8ppb and Naphthalene was 44.2ppb. for monitoring well(DR-2), Xylenes was 6.69ppb, n-Propylbenzene was 13.8ppb, 1,3,5-Trimethylbenzene was 35.2ppb, 1,2,4-Trimethylbenzene was 94.4ppb, sec-Butylbenzene was 6.26ppb, n-Butylbenzene was 11.1ppb and Naphthalene was 44.2ppb. 10/3/2005 - Feng - Discussed with DEC Vought regarding the groundwater contamination that found in the D'Ambrosi residence (DR-1), he suggested keep monitoring the groundwater. Emailed to Tyree Joe Rennie and inquired the cleanup plan of this site. 1/17/2006 - Feng - Quarterly Monitoring Report, 9/2005 - 11/2005. The site is currently a motor vehicle service station. Groundwater flows to south at depth of 6.56' to 8.51' below grade. There are 17 monitoring wells, 3 monitoring/venting wells, and 2 recovery wells. Most of the BTEX and MTBE concentration are low. FN-2, 44 ppb BTEX. Pump-and-Treat, and SVE system shut down on 4/2005. Monitoring only. (RJF)3/24/2006 - Feng - Quarterly Monitoring Report, 12/2005 - 2/2006. The site is currently a motor vehicle service station. Groundwater flows to south at depth of 6.70' to 8.60' bg. 17 monitoring wells, 3 monitoring/venting wells, and 2 recovery wells. 12 monitoring wells are active. BTEX and MTBE concentration are low in most of the wells. FN-2, 46 ppb BTEX. FN-3, 24 ppb BTEX. DR-1, 10 ppb BTEX. (RJF)4/4/2006 - Feng - Discussed with DEC Joe Sun for spill closure. The site has been monitoring for 4 consecutive quarters since the Dual Phase Extraction system shut down in 4/2005. Low concentration has detected and no concentration rebound has observed. DEC Jeff Vought has sent the letter to Mario Banthitta, the new owner of the property at 2624 East 22nd Street, Brooklyn, NY (the former D'Ambrosi's house) on 4/11/2005 and requesting installation of vapor barrier for the development of the property. For low groundwater concentration and the new owner's awareness of vapor barrier installation, spill closed. NFA to Getty and cc to Tyree and Delta.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GETTY PETROLEUM CORP (Continued)

1000990444

Remarks: (RJF)
STRONG ODORS FROM S/S ACROSS STREET ODORS MAKING CALLER & FAMILY
NAUSIOUS- CALLED CON ED SAID IT IS GASOLINE WANT CALLBACK.

Material:
Site ID: 124497
Operable Unit ID: 990917
Operable Unit: 01
Material ID: 392027
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Z119 **2110 JEROME AVENUE**
WSW **2102 AVENUE Z**
1/4-1/2 **KINGS, NY**
0.420 mi.
2219 ft. **Site 2 of 5 in cluster Z**

NY Hist Spills **S106701694**
N/A

Relative:
Higher

Actual:
10 ft.

NY Hist Spills:
Region of Spill: 2
Spill Number: 9309371
Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/02/1993 12:00
Reported to Dept Date/Time: 11/02/93 18:38
SWIS: 61
Spiller Name: GETTY PETROLEUM
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Air

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2110 JEROME AVENUE (Continued)

S106701694

Water Affected: Not reported
Spill Source: 05
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/07/94
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/24/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: ODOR. 08/23/01 Reassigned from Tomasello to Rommel Spill 0005548 closed and cross-referenced to this spill odors during EVR visit.) Address corrected from 2110 Jerome Avenue to 2101 Avenue Z as it appears on the PBS registration.

Remark: STRONG ODORS FROM S/S ACROSS STREET ODORS MAKING CALLER FAMILY NAUSIOUS- CALLED CON ED SAID IT IS GASOLINE WANT CALLBACK.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Z120
WSW
1/4-1/2
0.420 mi.
2219 ft.

2112 AVENUE Z
2112 AVENUE Z
BROOKLYN, NY
Site 3 of 5 in cluster Z

HIST LTANKS S101102988
N/A

Relative:
Higher

Actual:
10 ft.

HIST LTANKS:
Region of Spill: 2
Spill Number: 9401301
Spill Date: 04/27/1994
Spill Time: 09:00
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 04/27/92
Reported to Department Time: 11:48
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/28/94
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/03/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2112 AVENUE Z (Continued)

S101102988

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Spill Cause: TANK HAD 300-400 GALLON YESTERDAY IS DRY TO DAY.

Region of Spill: 2
Spill Number: 9501297
Spill Date: 03/28/1995
Spill Time: 12:00
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 05/01/95
Reported to Department Time: 11:30
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: DEC
PBS Number: Not reported
Last Inspection: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2112 AVENUE Z (Continued)

S101102988

Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 05/18/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 08/09/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Spill Cause: CONTAMINATED SOIL BEING PILED AT SITE OF TANK REMOVAL, TANKS WERE BEING REMOVED
A MONTH AGO - SOIL IS BLOWING AROUND - HAS NOT BEEN REMOVED BY CONTRACTOR.

Region of Spill: 2
Spill Number: 9413634
Spill Date: 01/12/1995
Spill Time: 16:00
Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2112 AVENUE Z (Continued)

S101102988

Reported to Department Date: 01/12/95
Reported to Department Time: 17:00
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: GETTY SVCE STATION
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 332-1877
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 02/01/95
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/22/95
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Spill Cause: HOLE IN UPPER PORTION IN ONE OF TANKS AND CONTRACTOR TO EXCAVATE TANK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Z121
WSW
1/4-1/2
0.425 mi.
2245 ft.

OLD GETTY STATION
2102 AVENUE Z
BROOKLYN, NY

Site 4 of 5 in cluster Z

NY Spills
NY Hist Spills

S104788205
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0005548
DER Facility ID: 107805
Facility Type: ER
Site ID: 124496
DEC Region: 2
Spill Number: 0005548
Spill Date: 8/8/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 8/24/2001
SWIS: 2401
Investigator: JMROMMEL
Referred To: Not reported
Reported to Dept: 8/9/2000
CID: 270
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/9/2000
Spill Record Last Update: 8/6/2002
Spiller Name: UNKNOW
Spiller Company: OLD GETTY STATION
Spiller Address: 2102 AVE Z
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: TYREE
Contact Phone: (631) 249-3150
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL"8/22/01 Email from Tyree (Joe Rennie):Rick Caputo was reviewing the NYSDEC spill database and noticed that another spill, #00-05548, has been opened on August 8, 2000 for the location noted above. It appears from the spill info that someone complained about gasoline fumes while pumping wells. Just to let you know, that on that day Tyree was conducting EVR on some monitoring wells associated with the original open spill (#93-09371). Therefore, to prevent any confusion associated with the original spill number, is it possibly for you to close this new spill? Spill Closed 08/23/01
Remarks: caller states that tyree was using some sort of pump at station and created a strong odor.

Material:

Site ID: 124496
Operable Unit ID: 826604
Operable Unit: 01
Material ID: 546702
Material Code: 0009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD GETTY STATION (Continued)

S104788205

Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0005548
Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/08/2000 10:15
Reported to Dept Date/Time: 08/09/00 11:29
SWIS: 61
Spiller Name: OLD GETTY STATION
Spiller Contact: UNKNOW
Spiller Phone: Not reported
Spiller Contact: TYREE
Spiller Phone: (631) 249-3150
Spiller Address: 2102 AVENUE Z
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Unknown
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD GETTY STATION (Continued)

S104788205

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/24/01

Corrective Action Plan Submitted: / /

Date Region Sent Summary to Central Office: / /

Date Spill Entered In Computer Data File: 08/09/00

Date Spill Entered In Computer Data File: Not reported

Update Date: 08/24/01

Is Updated: False

Tank:

PBS Number: Not reported

Tank Number: Not reported

Tank Size: Not reported

Test Method: Not reported

Leak Rate Failed Tank: Not reported

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Quantity Spilled: 0

Unkonwn Quantity Spilled: True

Units: Gallons

Quantity Recovered: 0

Unkonwn Quantity Recovered: True

Material: GASOLINE

Class Type: GASOLINE

Times Material Entry In File: 21329

CAS Number: Not reported

Last Date: 19940929

DEC Remarks: 8/22/01 Email from Tyree Joe Rennie): Rick Caputo was reviewing the NYSDEC spill database and noticed that another spill, 00-05548, has been opened on August 8, 2000 for the location noted above. It appears from the spill info that someone complained about gasoline fumes while pumping wells. Just to let you know, that on that day Tyree was conducting EVR on some monitoring wells associated with the original open spill 93-09371). Therefore, to prevent any confusion associated with the original spill number, is it possibly for you to close this new spill? Spill Closed 08/23/01

Remark: caller states that tyree was using some sort of pump at station and created a strong odor.

Z122
WSW
1/4-1/2
0.428 mi.
2260 ft.

JONAS EQUITIES INC
2600 EAST 21ST STREET
BROOKLYN, NY
Site 5 of 5 in cluster Z

NY Spills S107408005
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 9907354

DER Facility ID: 247700

Facility Type: ER

Site ID: 306693

DEC Region: 2

Spill Number: 9907354

Spill Date: 9/18/1999

Spill Cause: Equipment Failure

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)

Spill Closed Date: 10/16/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JONAS EQUITIES INC (Continued)

S107408005

SWIS: 2401
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 9/18/1999
CID: 390
Water Affected: SHEEPSHEAD BAY
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/18/1999
Spill Record Last Update: 10/16/2009
Spiller Name: BEN LIPSCHITZ
Spiller Company: JONAS EQUITIES INC.
Spiller Address: 2600 EAST 21ST STREET
Spiller City,St,Zip: BROOKLYN, NY 11235-001
Spiller Company: 001
Contact Name: UNK
Contact Phone: (000) 000-0000
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SANGESLAND"Saccacio - On 9/18/99, I responded to a report of 25 gallons of diesel floating in sheepshead bay, Spill No. 9907354. Upon arrival I observed approximately 45 gallons of #6 oil floating in the bay. At this time the oil was moving with the tide towards the west end of the bay and was very spread out in many small patches of product. The USCG had contracted Miller Environmental to boom Ocean Avenue outfall since it was the apparent point of entry into the bay and small amounts of oil was still coming out of it. The USCG felt recovery efforts of the oil currently in the bay would be ineffective at night so nothing else was done that night. They also said that this was the third time this year they cleaned oil that entered the bay from this outfall. On 9/19/99, another spill was reported for the product in the bay, Spill No. 9907368. According to the USCG, the spill had gotten worse and they now estimated 60 gallons of product in the bay. They also said that during the ebb tide the product moved towards the southeast end to the bay near Kingsboro College and may have entered the ocean. Miller Environmental placed boom across the entire bay just east of the outfall and began sweeping the oil to the northwest corner of the bay where a skimmer was used to recover the product. Not counting the product recovered with absorbents, 85 gallons of product was recovered. On 9/20/99 an addition 100 gallons of product had entered the bay. On 9/21/99 the USCG reported, Spill No. 9907484, that the situation had gotten worse. They said that a total 1,700 gallons of oil had been recovered with 500 gallons still in the bay and that they had identified the source. The RP was unwilling to take responsibility for the cleanup in the bay so Miller Environmental continued its recovery efforts under the authority of the USCG. Since the wind changed skimmers were now set up to collect the oil coming out the outfall and by the college where the oil that was getting around the outfall boom was collecting. Upon the completion of the oil recovery efforts. The USCG was going to have the bulkheads of the bay power washed. The RP, an apartment building located at 2600 East 21st Street had oil in its boiler room and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JONAS EQUITIES INC (Continued)

S107408005

sumps. The oil was entering the boiler room from cracks in the walls and was seeping into the sumps where it was being pumped into the storm sewer. The Superintendent told I that they first noticed the oil on 9/19/99 when he called Starr Industrial to send a technician. Starr Industrial cleaned the boiler room with speedy-dry and tested the fuel lines. The lines failed the test and on 9/20/99, Starr Industrial installed a fuel line bypass and cleaned the oil that had entered the boiler room since the previous cleaning. On 9/27/99, I met the building management with its consultant, Tyree who is to develop a investigative work plan and treatment system for the contaminated sumps.12/13/00 - Changed DEC lead to Sangesland12/20/2000 Sangesland spoke with Joel Charleston 516-791-9111 (attorney for building). DEC has requested a meeting with owner and environmental consultant to discuss clean up. Mr. Charleston said he would schedule a meeting for early January with all parties involved.1/12/2004 Sangesland spoke with "Bill" at Tyree to request any information they had on work done at the site. Also called Joel Charleston (attorney) to ask for status/update. He is working on a lawsuit with the Feds for the cost of cleanup to Sheepshead Bay. He will gather as much information as he can and get back to the DEC within a week or so.2/4/2004 Sangesland heard from Rick Caputo at Tyree. They have done a full records search and have never worked on this site. He thinks they may have sent a person to the site once to bid on the job, but was never hired.2/5/2004 Sangesland again spoke with Mr. Charleston (attorney for the building). He is still argueing that the spill problem in Sheepshead Bay being tracked back to this building is not the fault of the building. He says that all of the surface contamination in the basement of this building has been cleaned up and the piping has been repaired and therefore the spill should be closed out.... NO.Sangesland said that a series of soil borings need to be made in the basement/boiler/tank room area to determine if there is contamination under the cement slab floor. If these samples come back clean then the case can be closed out. If they come back "hot" then a site delineation will need to be conducted and a remediation plan will need to be prepared.A "Contaminated Soil Letter" was prepared and sent to the building property manager and copy to building attorney:Manager: Mr. Ben Lipschitz, Jonas Equities Inc., 725 Church Ave, Brooklyn, NY 11218Attorney: Mr. Joel Charleston, 11 Pearl St. North Woodmere, NY 11581 2/10/2004 Return receipt from letter to Mr. Lipschitz returned.4/7/2004 Sangesland called both Mr. Lipschitz and Mr. Charleston.Neither would take the call, neither responded to the DEC.4/8/2004 Sangesland forwarded a "Case Initiation Form" to DEC Legal Dept. - David Rubinton will be assigned the case. 7/27/2005 Sangesland and DEC Legal met with Mr. Joel Charleston (Co-op Attorney) about 2 weeks ago. Mr. Charleston was directed to hire an Environmental firm to do test borings around both the abandoned buried tank and around the boiler room floor.Rep from F&N called today to ask for specific direction of what work will be needed. Sangesland reviewed the tasks. F&N will prepare a work plan for submittal and will then conduct borings around the abandoned buried tank and around the basement floor. The next step will depend on the test results. 11/16/2005 Mr Charleston has set up another meeting on 11/17 with DEC to discuss the site. Sangesland spoke to Brian McCabe at F&N about the site. He said no contract has been signed with F&N to do anything and no work has been done. 6/3/2009 Sangesland left a voice message with Mr. Charleston (516-791-9111) asking for an update

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JONAS EQUITIES INC (Continued)

S107408005

on the monitoring well testing request. In May 2009 Sangesland/Urda spoke to Mr. Charleston who said "all that work was done years ago by Fenly & Nichol".... Call to F&N said they were hired to install monitoring wells, but they were never hired to sample them. 10/16/2009 Sangesland reviewed a report from Fenly & Nicol dated Aug 24, 2009. The 5 existing monitoring wells around the site were resampled on July 14, 2009 and results came back "Non-Detect" for both VOC's and SVOC's. F&N report states: "Based on F&N's review of the analytical data generated from the July 14, 2009 groundwater sampling event it appears that the groundwater beneath the site has not been impacted by the leaking return line for the former number 6 heating oil tank at the site. F&N recommends that no addition monitoring or sampling be performed at the site and that Spill Number 99-07354 be closed and a No Further Action letter be provided for the site." Copy of this final sampling report is attached in eDocs. Spill Case is closed.

Remarks: coast guard reported a spill unk how much or where it came from the coast guard is with it

Material:

Site ID: 306693
Operable Unit ID: 1085786
Operable Unit: 01
Material ID: 300049
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

V123
East
1/4-1/2
0.433 mi.
2286 ft.
CONEY ISLAND/ AVE. Z AND
AVE Z,/ KNAPP ST.
CONEY ISLAND, NY
Site 2 of 2 in cluster V

NY Spills S102144422
NY Hist Spills N/A

Relative:
Lower

SPILLS:
Facility ID: 8607747
DER Facility ID: 111130
Facility Type: ER
Site ID: 128869

Actual:
6 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND/ AVE. Z AND (Continued)

S102144422

DEC Region: 2
Spill Number: 8607747
Spill Date: 3/18/1987
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: 3/19/1987
SWIS: 2401
Investigator: UNASSIGNED
Referred To: Not reported
Reported to Dept: 3/19/1987
CID: Not reported
Water Affected: PAERDEGAT BASIN
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 3/19/1987
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/3/1987
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: NYCDEP
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was " "
Not reported
Remarks: CONTRACTOR REMOVED PLANKS IN EFFLUENT CHANNEL

Material:
Site ID: 128869
Operable Unit ID: 904324
Operable Unit: 01
Material ID: 473239
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND/ AVE. Z AND (Continued)

S102144422

Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 8607747
Investigator: Not reported
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/18/1987 00:30
Reported to Dept Date/Time: 03/19/87 15:42
SWIS: 61
Spiller Name: NYCDEP
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure
Reported to Dept: Surface Water
Water Affected: PAERDEGAT BASIN
Spill Source: 02
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 03/19/87
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 03/19/87
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/03/87
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONEY ISLAND/ AVE. Z AND (Continued)

S102144422

Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: RAW SEWAGE
Class Type: RAW SEWAGE
Times Material Entry In File: 1993
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: CONTRACTOR REMOVED PLANKS IN EFFLUENT CHANNEL

AA124
SSE
1/4-1/2
0.435 mi.
2299 ft.

SHEEPSHEAD BAY YACHT CLUB
3076 EMMONS AV
BROOKLYN, NY
Site 1 of 2 in cluster AA

NY Spills **S102663454**
NY Hist Spills **N/A**

Relative:
Lower

Actual:
2 ft.

SPILLS:

Facility ID: 9907845
DER Facility ID: 231677
Facility Type: ER
Site ID: 285809
DEC Region: 2
Spill Number: 9907845
Spill Date: 9/28/1999
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/15/2004
SWIS: 2401
Investigator: RWAUSTIN
Referred To: Not reported
Reported to Dept: 9/28/1999
CID: 388
Water Affected: SHEEPSHEAD BAY
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/28/1999
Spill Record Last Update: 3/15/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: PO RIEMER
Contact Phone: (718) 354-4120
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"AUSTIN"3/15/04 - AUSTIN - UNK. SHEEN HANDLED BY USCG - CLOSED -
ORIG. ASSIGNED TO COMENALE - END
Remarks: CALLER REPORTS UNKNOWN SHEEN ON WATER. COAST GUARD IS SENDING TEAM
OUT TO INVESTIGATE.

Material:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY YACHT CLUB (Continued)

S102663454

Site ID: 285809
Operable Unit ID: 1082125
Operable Unit: 01
Material ID: 300530
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9705650
DER Facility ID: 231677
Facility Type: ER
Site ID: 261399
DEC Region: 2
Spill Number: 9705650
Spill Date: 8/9/1997
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/15/1997
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 8/9/1997
CID: 297
Water Affected: SHEEPSHEAD BAY
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/9/1997
Spill Record Last Update: 12/15/1997
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY YACHT CLUB (Continued)

S102663454

Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: STEVE BUXBAUM
Contact Phone: (718) 891-0991
DEC Memo: Not reported
Remarks: THERE IS AN OIL SLICK THAT THE CALLER NOTICED WHEN THE TIDE GOES OUT
- UNKNOWN WHERE IT IS COMING FROM - CALLER STATES THERE WAS A DEC
OFFICER IN THE BAY LAST WEEK AND IT LOOKED LIKE HE WAS INVESTIGATING
THE OIL

Material:

Site ID: 261399
Operable Unit ID: 1049029
Operable Unit: 01
Material ID: 331282
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access
additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9705650
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/09/1997 09:00
Reported to Dept Date/Time: 08/09/97 09:05
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY YACHT CLUB (Continued)

S102663454

Spiller Contact: STEVE BUXBAUM
Spiller Phone: (718) 891-0991
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 12
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/15/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/09/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/15/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: 10:05 SPOKE TO USCG P.O. MARTINEZ. HE WILL CALL THE CALLER AND PROBABLY SEND OUT A TEAM. SEE SPILL NUMBER 9705654.

Remark: THERE IS AN OIL SLICK THAT THE CALLER NOTICED WHEN THE TIDE GOES OUT - UNKNOWN WHERE IT IS COMING FROM - CALLER STATES THERE WAS A DEC OFFICER IN THE BAY LAST WEEK AND IT LOOKED LIKE HE WAS INVESTIGATING THE OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AA125
SSE
1/4-1/2
0.435 mi.
2299 ft.

SHEEPSHEAD BAY
3076 EMMONS AVE
BROOKLYN, NY
Site 2 of 2 in cluster AA

NY Hist Spills **S102663456**
N/A

Relative:
Lower

NY Hist Spills:

Region of Spill: 2
Spill Number: 9907845
Investigator: COMENALE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/28/1999 17:20
Reported to Dept Date/Time: 09/28/99 18:10
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: PO RIEMER
Spiller Phone: (718) 354-4120
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/28/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/29/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S102663456

Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: CALLER REPORTS UNKNOWN SHEEN ON WATER. COAST GUARD IS SENDING TEAM OUT TO INVESTIGATE.

Region of Spill: 2
Spill Number: 9705654
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/09/1997 10:00
Reported to Dept Date/Time: 08/09/97 11:25
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 12/15/97
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/09/97
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/15/97
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S102663456

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: RECALL REP PER CALLER- HE WAS PREVIOUSLY UNAVAILABLE FOR PHONE. SAME AS 9705650
8/9/97 3:15 PM SPOKE TO LT. MARTINEZ. TEAM WENT OUT THERE IT DISSIPATED.
COULDN T FIND A SOURCE. APPEARS TO HAPPEN OFTEN IN THAT AREA.

Remark: sheen found in the bay

Region of Spill: 2
Spill Number: 9905525
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/06/1999 17:00
Reported to Dept Date/Time: 08/06/99 19:41
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: PO RIEMER
Spiller Phone: (718) 354-4120
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 12
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/30/99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEPSHEAD BAY (Continued)

S102663456

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/06/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/03/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: UNRECOVERABLE. HANDLED BY USCG.
Remark: SHEEN ON THE WATER 800 X20 TEAM ON WAY TO CHECK

AB126
NE
1/4-1/2
0.436 mi.
2301 ft.
MOBIL OIL CORP SS #FFF
2402 KNAPP ST
BROOKLYN, NY 11235
Site 1 of 4 in cluster AB

RCRA-NonGen
FINDS
HIST UST
NY Spills
1000553815
NYD986962496

Relative:
Higher

RCRA-NonGen:

Date form received by agency: 07/06/2011
Facility name: MOBIL OIL CORP SS #FFF
Facility address: 2402 KNAPP ST
BROOKLYN, NY 112351006
EPA ID: NYD986962496
Mailing address: GALLOWES RD - MKTG ENVIRON
FAIRFAX, NY 220370001
Contact: DONNA HYMES
Contact address: E WASHINGTON ST
WEST CHESTER, PA 19380
Contact country: US
Contact telephone: (610) 430-8151
Contact email: WWW.JD2ENV.COM
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Actual:
9 ft.

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2007
Facility name: MOBIL OIL CORP SS #FFF
Classification: Not a generator, verified

Date form received by agency: 01/01/2006
Facility name: MOBIL OIL CORP SS #FFF
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Facility name: MOBIL OIL CORP SS #FFF
Classification: Not a generator, verified

Date form received by agency: 04/10/1991
Facility name: MOBIL OIL CORP SS #FFF
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004472400

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

of Environmental Conservation (DEC) information system for tracking
environmental facility information found across the State.

HIST UST:

PBS Number: 2-157708
SPDES Number: Not reported
Emergency Contact: ENVIRONMENTAL HELP DESK
Emergency Telephone: (800) 662-4567
Operator: HARRY GUT
Operator Telephone: (718) 769-5050
Owner Name: EXXONMOBIL OIL CORP
Owner Address: 3225 GALLOWS RD.,6W307
Owner City,St,Zip: FAIRFAX, VA 22037
Owner Telephone: (703) 849-6252
Owner Type: Corporate/Commercial
Owner Subtype: Mobil Oil Company
Mailing Name: EXXONMOBIL OIL CORP C/O NDE ENVIRONMENTAL
Mailing Address: P. O. BOX 142667
Mailing Address 2: Not reported
Mailing City,St,Zip: AUSTIN, TX 78714-2667
Mailing Contact: EMILY MILLER
Mailing Telephone: (800) 800-4633
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is
greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist
or not at the facility.
Facility Addr2: 2402 KNAPP ST
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: RETAIL GASOLINE SALES
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 03/23/1999
Expiration Date: 10/29/2002
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 22000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: 19741201
Capacity (gals): 550

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 002
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 003
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 004
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 005
Tank Location: UNDERGROUND
Tank Status: Closed Before April 1, 1991
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank Id: 006
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 007
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 008
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 009
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 010
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741201
Capacity (gals): 550
Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 011
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19711201
Capacity (gals): 4000
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 012
Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19551201
Capacity (gals): 550
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1987
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 017
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19891101
Capacity (gals): 1000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/access)
Leak Detection: None
Overfill Prot: High Level Alarm
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Updated: True
Lat/long: Not reported

Tank Id: 017
Tank Location: UNDERGROUND
Tank Status: Tank Converted To Non-Regulated Use
Install Date: 19891101
Capacity (gals): 1000
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: Not reported
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Vault (w/access)
Leak Detection: 13
Overfill Prot: Float Vent Valve
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 08/01/1996
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 101
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19870101
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: None
Pipe External: 40
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Float Vent Valve, Catch Basin
Dispenser: Submersible
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Tank Id: 102
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19870101
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: None
Pipe Type: NONE
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Float Vent Valve, Catch Basin
Dispenser: Submersible
Date Tested: 08/01/1991
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 103
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19870101
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: None
Pipe External: 40
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Float Vent Valve, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 104
Tank Location: UNDERGROUND
Tank Status: In Service

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Install Date: 19870101
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: None
Pipe Type: NONE
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Float Vent Valve, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 105
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19870101
Capacity (gals): 4000
Product Stored: UNLEADED GASOLINE
Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground
Pipe Type: STAINLESS STEEL ALLOY
Pipe Internal: None
Pipe External: 40
Second Containment: Vault (w/access)
Leak Detection: Electronic
Overfill Prot: Float Vent Valve, Catch Basin
Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Tank Id: 106
Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19870101
Capacity (gals): 1000
Product Stored: USED OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Tank Type: Fiberglass reinforced plastic [FRP]
Tank Internal: None
Tank External: Fiberglass
Pipe Location: None
Pipe Type: NONE
Pipe Internal: None
Pipe External: None
Second Containment: Vault (w/access)
Leak Detection: None
Overfill Prot: Float Vent Valve
Dispenser: Not reported
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

SPILLS:

Facility ID: 0801101
DER Facility ID: 304634
Facility Type: ER
Site ID: 396966
DEC Region: 2
Spill Number: 0801101
Spill Date: 4/28/2008
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 8/4/2008
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 4/28/2008
CID: 444
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/28/2008
Spill Record Last Update: 9/2/2010
Spiller Name: GLENN SPATARO
Spiller Company: GAS STATION
Spiller Address: 4202 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY
001
Contact Name: GLENN SPATARO
Contact Phone: (631) 218-0612
DEC Memo: 4/28 Operating gasoline station - They found a forgotten waste oil
tank at this site with staining.Sangesland left a voice mail with

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Remarks: Glenn at Kleinfelder asking for contact info to send a CSL letter.5/15/2008 Sangesland spoke to Glenn Spataro at Kleinfelder. He said the waste oil tank has been removed and the area excavated. End point samples have just come back and they look "OK". He will put together a report and submit it to Kumar Patel.08/04/08-Hiralkumar Patel. received tank closure report from Mr. Michels from Kleinfelder. removed one 550 gal waste oil UST and collected endpoint samples. no VOCs found in endpoint samples. some SVOCs found over the limit in all samples at depth below 5.5 ft. Tammy Michels KleinfelderPh. (631) 218-0612Fax (631) 218-0787 email: TMichels@kleinfelder.combased on submitted report, case closed. STAINING IN SOIL FROM AN OIL LINE:

Material:

Site ID: 396966
Operable Unit ID: 1153933
Operable Unit: 01
Material ID: 2144712
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 0909223
DER Facility ID: 304634
Facility Type: ER
Site ID: 421903
DEC Region: 2
Spill Number: 0909223
Spill Date: 11/17/2009
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: DKHARRIN
Referred To: Not reported
Reported to Dept: 11/17/2009
CID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 4
Date Entered In Computer: 11/17/2009
Spill Record Last Update: 5/21/2012
Spiller Name: EDWARD SAVARACE
Spiller Company: MOBIL 12798 / 17-FFF
Spiller Address: 242 KNAPT ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: EDWARD SAVARACE
Contact Phone: (631) 218-0612
DEC Memo: See also spill nos. 05-08933 (contaminated soil beneath middle product dispenser - closed), 08-01101 (contaminated soil encountered during waste oil UST excavation - closed), and 10-00168 (strong petroleum odors noted by NYCDEP during reconstruction of collapsed sewer line in NE corner of property - closed).11/25/2009: Left message for Ed Savarace (Kleinfelder) to follow up on the case.(sr)09/02/2010: Phase II report reviewed by Intern Hasan Mohamed.Spill No. 09-09223 Mobil Station No. 17-FFF2402 Knapp Street, Brooklyn, NY Site Description: This property is 0.32 acres and is currently used as an active petroleum filling station, convenience store and automotive repair facility. Repair facility contains three auto-motive service bays; each bay contains an in-ground hydraulic lift. There are three pump islands containing three dispenser islands and one active UST-system consisting of five (5) 4,000-gallon gasoline USTs which are located in the southeastern portion of the property. Also there is one (1) 1,000-gallon gasoline USTs which is present north of the station building. The Site previously contained fifteen (15) 550-gallon USTs that were removed. Environmental Assessment: Monitoring Wells/Borings: 6 monitoring wells (MW-A thru MW-F) and eight soil borings (SB-A thru SB-E) on site. Groundwater flow direction: Northeast Maximum Contaminant Concentrations: In Soil: 652ppb benzene, 4990ppb xylene, PAHs attributable to fill material In Groundwater: 1830ppb benzene, 42ppb toluene, 823ppb ethylbenzene, 86ppb xylene, 84ppb MTBE Suspected Sources as Per Submitted Reports: As per the Phase II Environmental Site Assessment submitted by Kleinfelder and dated 11/09, "Suspected source is from REC-2 and REC-4". Recommendations and Suspected Sources After File Review: According to the Phase II ESA dated 11/09, petroleum contaminated groundwater is noted directly down-gradient of the pump islands and USTs along Knapp Street and not from REC 2 and REC 4. The data distribution suggests that the source of groundwater contamination may be the pumps islands and/or tanks. A recommendation is made for additional investigation via the collection of additional soil and groundwater samples to delineate the plume prior to acceptance of a Remedial Action Plan. 10/26/2010: Site transferred from Region 2 to Central Office (Remedial Bureau B, Section C) for management. File currently under review. (Harrington) 12/7/2010: PM conducted a site visit. No other project personnel were present. (Harrington) 12/15/2010: PM sent e-mail to Kleinfelder and ExxonMobil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

requiring additional monitoring wells to be installed: (1) downgradient of the northern dispenser island; (2) downgradient of the current gasoline UST field; and (3) the open space south of the sidewalk along Avenue X. PM indicated that work plan may be submitted in conjunction with the next quarterly report (August - October 2010). (Harrington)1/10/2011: PM sent e-mail to ExxonMobil and Kleinfelder approving the SI work plan, which included monitoring well installation as required in 12/15/2010 e-mail described above. Sent NYCDOT permit letter for work on Knapp Street. (Harrington)1/19/2011: PM received letter from Bolla EM Realty, LLC indicating that, effective today, they have assumed all responsibility for remediation of the site from ExxonMobil. ARCADIS will be taking over for Kleinfelder as the technical consultant. (Harrington)3/9/2011: PM spoke to Peter Morris (ARCADIS; 609.860.0590 x219), the new project contact. Peter indicated that he was in possession of the SI work plan, my e-mail approving it, and the NYCDOT permit letter. Field work to begin at this site within 60-90 days. (Harrington)6/21/2011: February - April 2011 Site Status Update Report was reviewed. Report indicated that the SI work plan approved in January was implemented in May. SI report is expected by late Summer. (Harrington)1/18/2012: PM conducted a site visit to inspect recent field work. All new monitoring wells were installed as per the approved SI work plan. (Harrington)3/26/2012: PM sent an e-mail to ARCADIS requiring additional investigatory work be completed at the property based on a review of the last 3 rounds of quarterly groundwater sampling. Work requested included soil borings in the vicinity of MW-H (where petroleum-contaminated soil was recently identified), and further groundwater investigation downgradient of the site in order to fully define the nature and extent of contamination. (Harrington)5/21/2012: PM sent e-mail to ARCADIS approving the SI workplan pending the inclusion of an additional downgradient monitoring well on the east side of Knapp Street. The NYCDOT road-opening permit letter was included with the e-mail. (Harrington)

Remarks: BORING SHOWS CONTAMINATED SOIL.CLEAN UP PENDING

Material:

Site ID: 421903
Operable Unit ID: 1177776
Operable Unit: 01
Material ID: 2170600
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS #FFF (Continued)

1000553815

Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

AC127
ESE
1/4-1/2
0.437 mi.
2306 ft.

VOORHIES AVE & KNAPP ST
VOORHIES AVE & KNAPP ST
BROOKLYN, NY

NY Spills
NY Hist Spills

S102143173
N/A

Site 1 of 8 in cluster AC

Relative:
Higher

Actual:
11 ft.

SPILLS:

Facility ID: 9205467
DER Facility ID: 177659
Facility Type: ER
Site ID: 214418
DEC Region: 2
Spill Number: 9205467
Spill Date: 8/5/1992
Spill Cause: Deliberate
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 8/12/1992
SWIS: 2401
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 8/12/1992
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: 8/12/1992
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/21/1992
Spill Record Last Update: 9/30/2004
Spiller Name: Not reported
Spiller Company: BKLYN YACHT CLUB
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "TANG"

Remarks: GERRITSEN CREEK

Material:

Site ID: 214418

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VOORHIES AVE & KNAPP ST (Continued)

S102143173

Operable Unit ID: 972864
Operable Unit: 01
Material ID: 409679
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9205467
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/05/1992 12:00
Reported to Dept Date/Time: 08/12/92 11:26
SWIS: 61
Spiller Name: BKLYN YACHT CLUB
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: Surface Water
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 08/12/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VOORHIES AVE & KNAPP ST (Continued)

S102143173

Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/12/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/21/92
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: GERRITSEN CREEK

128
WSW
1/4-1/2
0.437 mi.
2307 ft.

**SALVATORE CAVALIERE
2661 EAST 21ST STREET
BROOKLYN, NY**

**NY Spills S106000348
N/A**

**Relative:
Higher**

SPILLS:

**Actual:
10 ft.**

Facility ID: 0130044
DER Facility ID: 254639
Facility Type: ER
Site ID: 315866
DEC Region: 2
Spill Number: 0130044
Spill Date: 1/8/2002
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 1/10/2002
SWIS: 2401
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 1/10/2002
CID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SALVATORE CAVALIERE (Continued)

S106000348

Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1/10/2002
Spill Record Last Update:	1/10/2002
Spiller Name:	Not reported
Spiller Company:	FORMER GETTY STATION
Spiller Address:	JEROME AVE & AVENUE Z
Spiller City,St,Zip:	SHEEPSHEAD BAY, NY 11235-
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	(718) 382-8384
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT"1/10/02-VOUGHT-Spill initially reported to National Response Center. Officer Shawn Dussault responded to the spill. Upon arriving on-site the officer noticed that a large spray painting operation was taking place and there were significant vapors from the aerosol paint. Officer Dussault ordered three violations: 1) for air contamination without a permit 2) no secondary containment for waste oil storage 3) order of proper disposal of lead-acid batteries. There was no evidence of any gasoline spill. Spill closed 1/10/2001.
Remarks:	GASOLINE ODOR IS RELEASING FROM UNDERGROUND STORAGE TANKS CREATING A GASOLINE ODOR THRU A DRAIN AT THE REPORTING PARTY'S PROPERTY
Material:	
Site ID:	315866
Operable Unit ID:	849577
Operable Unit:	01
Material ID:	526736
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0
Units:	Gallons
Recovered:	No
Resource Affected:	Not reported
Oxygenate:	False
Tank Test:	
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Y129
SSW
1/4-1/2
0.438 mi.
2311 ft.

BETWE BEDFORD EA 26TH
2511 EMMONS AVE
BROOKLYN, NY

NY Spills S106699187
N/A

Site 2 of 2 in cluster Y

Relative:
Lower

Actual:
4 ft.

SPILLS:

Facility ID: 0406443
DER Facility ID: 99954
Facility Type: ER
Site ID: 114608
DEC Region: 2
Spill Number: 0406443
Spill Date: 9/12/2004
Spill Cause: Unknown
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.
Spill Closed Date: 9/14/2004
SWIS: 2401
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 9/12/2004
CID: 41
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Health Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/12/2004
Spill Record Last Update: 9/14/2004
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "KRIMGOLD"
Remarks: Unknown type oil in water at fishing dock - dead fish - caller was anonymous

Material:

Site ID: 114608
Operable Unit ID: 889996
Operable Unit: 01
Material ID: 487518
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BETWE BEDFORD EA 26TH (Continued)

S106699187

Oxygenate: False
Site ID: 114608
Operable Unit ID: 889996
Operable Unit: 01
Material ID: 487519
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

AB130
NE
1/4-1/2
0.438 mi.
2315 ft.
GAS STATION
AVENUE X AND KNAPP ST
BROOKLYN, NY
Site 2 of 4 in cluster AB

NY Spills **S110307728**
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:
Facility ID: 1000168
DER Facility ID: 380293
Facility Type: ER
Site ID: 431323
DEC Region: 2
Spill Number: 1000168
Spill Date: 4/5/2010
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/10/2010
SWIS: 2401
Investigator: RMP/IPER
Referred To: Not reported
Reported to Dept: 4/5/2010
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GAS STATION (Continued)

S110307728

Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/5/2010
Spill Record Last Update: 5/10/2010
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: CALLER
Contact Phone: Not reported
DEC Memo: 04;/05/10- Zhune spoke to Tim 917-769-1161 from Hazmat DEP. Tim said

that the sewer collapsed at this location. The NYCDEP contract a private contractor to fix the sewer collapse. They did excavation to fix the problem. A local residence called to say that strong petroleum odors were coming out from this excavation located in the corner of Avenue X and Knapp St. next to a gas station. Gas Station is a Mobil located at 2402 knapp ST. PBS # 2-157708. Tim and his pattner inspected the site they did not find any petroleum liquid in the excavation site but odors kind of heavy. There is one open spill case at the Mobil gas station. the spill case is: # 0909223- boring shows contaminated soil. This spill is closed and consolidated inot spill 0909223. See 0909223

Remarks: Excavating being performed discovered contaminated soil/clean up dependant upon remediation.

Material:

Site ID: 431323
Operable Unit ID: 1182780
Operable Unit: 01
Material ID: 2176982
Material Code: 1430A
Material Name: PETROLEUM SOLVENTS
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Pounds
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

AC131
ESE
1/4-1/2
0.440 mi.
2325 ft.
PARKING LOT
VOORHIES AV & KNAPP ST
BROOKLYN, NY
Site 2 of 8 in cluster AC

NY Spills
NY Hist Spills
S102238283
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 9510642
DER Facility ID: 171080
Facility Type: ER
Site ID: 206016
DEC Region: 2
Spill Number: 9510642
Spill Date: 11/24/1995
Spill Cause: Unknown
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/31/1997
SWIS: 2401
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 11/24/1995
CID: 257
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 12/11/1995
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/24/1995
Spill Record Last Update: 8/6/1997
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: LT.CUHLKE
Contact Phone: (718) 965-8321
DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was
"TANG" Lot owned by the Brooklyn Yoacht Club, who was made aware of
the release and will clean up. AFTER CONSIDERING THE FACT THAT THIS
SPILL OCCURRED A LONG TIME AGO, AND THE REMARKS INDICATE NO LONG-TERM
FOLLOW-UP IS NEEDED; THEREFORE, I HAVE DECIDED TO CLOSE THIS SPILL.
CALLER CALLED DEP TO SAY THAT A PERSON CAME INTO FIRE HOUSE TO REPORT
A TRUCK SPILLED ABOUT 50 GALS OF A OIL PRODUCT ON GROUND(A PARKING
LOT) UNKNOWN TRCUKING COMP

Remarks:

Material:

Site ID: 206016
Operable Unit ID: 1025125
Operable Unit: 01
Material ID: 358001
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 50

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PARKING LOT (Continued)

S102238283

Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9510642
Investigator: TANG
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/24/1995 13:15
Reported to Dept Date/Time: 11/24/95 13:27
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: LT.CUHLKE
Spiller Phone: (718) 965-8321
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: 12/11/95
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/31/97
Corrective Action Plan Submitted: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PARKING LOT (Continued)

S102238283

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/24/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/06/97
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Lot owned by the Brooklyn Yoacht Club, who was made aware of the release and will clean up. AFTER CONSIDERING THE FACT THAT THIS SPILL OCCURRED A LONG TIME AGO, AND THE REMARKS INDICATE NO LONG-TERM FOLLOW-UP IS NEEDED; THEREFORE, I HAVE DECIDED TOCLOSE THIS SPILL.
Remark: CALLER CALLED DEP TO SAY THAT A PERSON CAME INTO FIRE HOUSE TO REPORT A TRUCK SPILLED ABOUT 50 GALS OF A OIL PRODUCT ON GROUND A PARKING LOT) UNKNOWN TRCUKING COMP

AC132
ESE
1/4-1/2
0.440 mi.
2325 ft.

**ONE QT DIELECTRIC FLUID
KNAPP STREET & VOORHIES AVENUE
BROOKLYN, NY**

**NY Spills S109060909
N/A**

Site 3 of 8 in cluster AC

**Relative:
Higher**

SPILLS:

Facility ID: 0713546
DER Facility ID: 344841
Facility Type: ER
Site ID: 395313
DEC Region: 2
Spill Number: 0713546
Spill Date: 3/24/2008
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/12/2008
SWIS: 2401
Investigator: gdbreen
Referred To: Not reported
Reported to Dept: 3/24/2008
CID: 444
Water Affected: Not reported
Spill Source: Commercial/Industrial

**Actual:
10 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE QT DIELECTRIC FLUID (Continued)

S109060909

Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/24/2008
Spill Record Last Update: 5/12/2008
Spiller Name: ERTSDESK
Spiller Company: CON EDISON
Spiller Address: KNAPP STREET & VORHEES BL
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: ERTSDESK
Contact Phone: (212) 580-8383
DEC Memo: 05/12/08 - See eDocs for Con Ed report detailing cleanup and closure.210477. see eDocs
Remarks: LEAKED FORM TWO SMALL FEEDERS ABOUT 1 QUART. 210477

Material:
Site ID: 395313
Operable Unit ID: 1152256
Operable Unit: 01
Material ID: 2143035
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AC133
ESE
1/4-1/2
0.440 mi.
2325 ft.

KNAPP ST/VOORHEES AV
BROOKLYN, NY

Site 4 of 8 in cluster AC

NY Spills
NY Hist Spills

S105140214
N/A

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0104104
DER Facility ID: 158721
Facility Type: ER
Site ID: 190218
DEC Region: 2
Spill Number: 0104104
Spill Date: 7/18/2001
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/29/2002
SWIS: 2401
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 7/18/2001
CID: 211
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/18/2001
Spill Record Last Update: 11/5/2003
Spiller Name: CALLER
Spiller Company: NYC TRANSIT
Spiller Address: 370 JAY ST
Spiller City,St,Zip: BROOKLYN, NY 11201-
Spiller Company: 001
Contact Name: NILESH CHOKSHI
Contact Phone: (718) 243-4581
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"TIBBE"CONTAINED AND CLEANED BY NYCT.
Remarks: bus 4863 developed transmission problem that caused leak - clean up
in progress

Material:

Site ID: 190218
Operable Unit ID: 842606
Operable Unit: 01
Material ID: 532607
Material Code: 0021
Material Name: Transmission Fluid
Case No.: Not reported
Material FA: Petroleum
Quantity: 8
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105140214

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0104104
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/18/2001 06:04
Reported to Dept Date/Time: 07/18/01 07:28
SWIS: 61
Spiller Name: NYC TRANSIT
Spiller Contact: CALLER
Spiller Phone: () -
Spiller Contact: NILESH CHOKSHI
Spiller Phone: (718) 243-4581
Spiller Address: 370 JAY ST
Spiller City,St,Zip: BROOKLYN, NY 11201-
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/18/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 07/18/01
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105140214

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 8
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: TRANSMISSION FLUID
Class Type: TRANSMISSION FLUID
Times Material Entry In File: 295
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: Not reported
Remark: bus 4863 developed transmission problem that caused leak - clean up in progress

AC134
ESE
1/4-1/2
0.440 mi.
2325 ft.

ABANDONED MARINA
KNAPP ST & VOORHIES AVE
BROOKLYN, NY

NY Spills
NY Hist Spills

S104881091
N/A

Site 5 of 8 in cluster AC

Relative:
Higher

Actual:
10 ft.

SPILLS:

Facility ID: 0010395
DER Facility ID: 215971
Facility Type: ER
Site ID: 265050
DEC Region: 2
Spill Number: 0010395
Spill Date: 12/15/2000
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 4/21/2004
SWIS: 2401
Investigator: JBVOUGHT
Referred To: Not reported
Reported to Dept: 12/15/2000
CID: 252
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/15/2000
Spill Record Last Update: 4/21/2004
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABANDONED MARINA (Continued)

S104881091

Spiller Company: MARTIN SALAMA
Spiller Address: UNK
Spiller City,St,Zip: UNK, ZZ
Spiller Company: 001
Contact Name: MATT BOECKEL
Contact Phone: (516) 851-1600
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "VOUGHT"6/4/03 TJDTank Excavation Report prepared by GCI reviewed. Additional investigation required. Letter sent to RP.12/9/03 TJDSpill reassigned Demeo >>> Rommel.03/12/04Results of soil and groundwater sampling received.03/30/04Reassigned from Rommel to Vought.3/31/04-Vought-File review by Vought after inquiry by Mark Robbins (Hydro Tech 631-462-5866). Report reviewed was from Hydro Tech dated 2/26/04. The purpose of the sampling to characterize the soil and groundwater quality in the vicinity of the former tank bed area located in the northeast corner of the site. Nine Geoprobe borings performed. Groundwater at a depth of 8'. Two groundwater samples were collected, one from upgradient of tank pad and one from downgradient of tank pad. "The screen was placed so that it bisected the water table, which was encountered at approximately 50 feet below grade". Soil analyticals show no Required Soil Cleanup Objective exceedences and groundwater analyticals show 63ppb MTBE. Report recommends no further action.NYSDEC requires: 1)depth to groundwater (8 or 50'?) 2)locations of former fill ports and dispenser islands.4/1/04-Vought-left message for Robbins to return call to DEC. Vought spoke to Robbins and depth to groundwater is 8' below grade. Robbins will perform GPR to investigate for presence of fill ports and dispenser islands.4/21/04-Vought-Received GPR results from Hyrdro Tech dated 4/14/04. "The purpose of the survey was to identify the preswnce of a former tank pad area and a former pump island area". GPR was performed in the northeast portion of the site based on historical data. "No anomalies indicative of either a former tank pad or a former pump island were identified during the survey. Spill closed by Vought.

Remarks: GEO PROBE - SOIL AND GROUND WATER FOUND TO BE IMPACTED WITHELEVATED LEVELS VOC'S.

Material:

Site ID: 265050
Operable Unit ID: 831514
Operable Unit: 01
Material ID: 555736
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABANDONED MARINA (Continued)

S104881091

Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0010395
Investigator: DEMEO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/15/2000 12:15
Reported to Dept Date/Time: 12/15/00 15:16
SWIS: 61
Spiller Name: MARTIN SALAMA
Spiller Contact: Not reported
Spiller Phone: (000) 000-0000
Spiller Contact: MATT BOECKEL
Spiller Phone: (516) 851-1600
Spiller Address: UNK
Spiller City,St,Zip: UNK
Spill Cause: Equipment Failure
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/15/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 12/18/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABANDONED MARINA (Continued)

S104881091

Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Remark: GEO PROBE - SOIL AND GROUND WATER FOUND TO BE IMPACTED WITH ELEVATED LEVELS VOC S.

AD135
SSW
1/4-1/2
0.441 mi.
2327 ft.

**SHEEP HEADS BAY PIER 3
EMMONS AVE & BEDFORD AVE
BROOKLYN, NY**

**NY Spills S103937154
NY Hist Spills N/A**

Site 1 of 3 in cluster AD

**Relative:
Lower**

SPILLS:

**Actual:
3 ft.**

Facility ID: 9901603
DER Facility ID: 153831
Facility Type: ER
Site ID: 183789
DEC Region: 2
Spill Number: 9901603
Spill Date: 5/11/1999
Spill Cause: Abandoned Drums
Spill Class: Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
Spill Closed Date: 6/22/1999
SWIS: 2401
Investigator: JMROMMEL
Referred To: Not reported
Reported to Dept: 5/11/1999
CID: 322
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/11/1999
Spill Record Last Update: 9/7/1999
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEP HEADS BAY PIER 3 (Continued)

S103937154

Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ROMMEL"NO DRUMS FOUND
Remarks: a 55 gal drum left at pier - contains unk material - poss oil & unkwaste - local fire dept is enroute and dep has been notified

Material:

Site ID: 183789
Operable Unit ID: 1076385
Operable Unit: 01
Material ID: 305137
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 55
Units: Gallons
Recovered: 55
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9901603
Investigator: ROMMEL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/11/1999 13:34
Reported to Dept Date/Time: 05/11/99 14:21
SWIS: 61
Spiller Name: UNK
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Address: UNK
Spiller City,St,Zip: UNK
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHEEP HEADS BAY PIER 3 (Continued)

S103937154

Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. No DEC
Response. No corrective action required.
Spill Closed Dt: 06/22/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/11/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/07/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 55
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 55
Unkonwn Quantity Recovered: False
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: NO DRUMS FOUND
Remark: a 55 gal drum left at pier - contains unk material - poss oil unk waste -
local fire dept is enroute and dep has been notified

**AD136
SSW
1/4-1/2
0.441 mi.
2327 ft.**

**PIER 3
BEDFORD & EMMONS
BROOKLYN, NY
Site 2 of 3 in cluster AD**

**NY Spills S108296977
N/A**

**Relative:
Lower**

SPILLS:

Facility ID: 0610709
DER Facility ID: 324846
Facility Type: ER
Site ID: 375204
DEC Region: 2
Spill Number: 0610709
Spill Date: 12/21/2006
Spill Cause: Equipment Failure

**Actual:
3 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIER 3 (Continued)

S108296977

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/22/2006
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 12/21/2006
CID: 444
Water Affected: SHEEPS HEAD BAY
Spill Source: Vessel
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/21/2006
Spill Record Last Update: 12/22/2006
Spiller Name: RICHARD
Spiller Company: PIER 3
Spiller Address: BEDFORD& EMMONS
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: RICHARD
Contact Phone: (718) 996-1814
DEC Memo: Case was forwarded to US Coast Guard for review
Remarks: SEEMS TO BE COMING FROM A BOAT:

Material:
Site ID: 375204
Operable Unit ID: 1132848
Operable Unit: 01
Material ID: 2122639
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 375204
Operable Unit ID: 1132848
Operable Unit: 01
Material ID: 2122638
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIER 3 (Continued)

S108296977

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

AD137
SSW
1/4-1/2
0.441 mi.
2327 ft.

PIER 6
EMMONS AV/BEDFORD AV
BROOKLYN, NY

NY Spills
NY Hist Spills

S102239483
N/A

Site 3 of 3 in cluster AD

Relative:
Lower

SPILLS:

Actual:
3 ft.

Facility ID: 9516336
DER Facility ID: 179504
Facility Type: ER
Site ID: 216801
DEC Region: 2
Spill Number: 9516336
Spill Date: 3/20/1996
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/21/1996
SWIS: 2401
Investigator: O'DOWD
Referred To: Not reported
Reported to Dept: 3/20/1996
CID: 349
Water Affected: SHEEPSHEAD BAY
Spill Source: Vessel
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/20/1996
Spill Record Last Update: 12/2/2002
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: fishing boat sunk, as result spill occurred - contacting uscg

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIER 6 (Continued)

S102239483

Material:

Site ID: 216801
Operable Unit ID: 1027304
Operable Unit: 01
Material ID: 352852
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9516336
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/20/1996 00:00
Reported to Dept Date/Time: 03/20/96 09:26
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: UNKNOWN
Spiller Phone: Not reported
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY
Spill Source: 10
Spill Notifier: DEC
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PIER 6 (Continued)

S102239483

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/21/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/20/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 04/01/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: fishing boat sunk, as result spill occurred - contacting uscg

AB138
NE
1/4-1/2
0.442 mi.
2334 ft.

CONNIE ISLAND WATER POLLU
2391 KNAPP STREET
BROOKLYN, NY

NY Spills S106736397
N/A

Site 3 of 4 in cluster AB

Relative:
Higher

SPILLS:

Actual:
9 ft.

Facility ID: 0410579
DER Facility ID: 270836
Facility Type: ER
Site ID: 335592
DEC Region: 2
Spill Number: 0410579
Spill Date: 12/23/2004
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 12/24/2004
SWIS: 2401
Investigator: MXTIPPLE
Referred To: Not reported
Reported to Dept: 12/23/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONNIE ISLAND WATER POLLU (Continued)

S106736397

CID: 408
Water Affected: JAMAICA BAY
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/23/2004
Spill Record Last Update: 12/24/2004
Spiller Name: DALY,JAMES
Spiller Company: CONNIE ISLAND WATER POLLU
Spiller Address: 2391 KNAPP STREET
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: DALY,JAMES
Contact Phone: (718) 372-7193
DEC Memo: referred to water
Remarks: DUE TO THE RAIN AND A BAR SCREEN OUT OF SERVICE. THEY ARE SUPPOSED TO PUMP 220 MEAN GALLONS A DAY, THEY ARE ONLY PUMPING 170. THIS IS A COMPLAINT.

Material:
Site ID: 335592
Operable Unit ID: 1097652
Operable Unit: 01
Material ID: 577678
Material Code: 0062A
Material Name: RAW SEWAGE
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AC139
ESE
1/4-1/2
0.443 mi.
2341 ft.
2701 KNAPP STREET
2701 KNAPP STREET
BROOKLYN, NY
Site 6 of 8 in cluster AC

NY Hist Spills
S102150044
N/A

Relative:
Higher

Actual:
10 ft.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9501327
Investigator: O'DOWD
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/15/1995 12:00
Reported to Dept Date/Time: 05/01/95 16:25
SWIS: 61
Spiller Name: SUNOCO
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/18/95
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/30/95
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2701 KNAPP STREET (Continued)

S102150044

Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: Not reported
Remark: CONTAMINATED SOIL FOUND DURING MONITORING WELL INSTALLATION.

**AC140
ESE
1/4-1/2
0.443 mi.
2341 ft.**

**SUNOCO SERVICE STATION
2701 KNAPP ST
BROOKLYN, NY 11235
Site 7 of 8 in cluster AC**

**RCRA-NonGen 1004756224
LTANKS NYD000818013
MANIFEST
NY Spills**

**Relative:
Higher**

RCRA-NonGen:
Date form received by agency: 01/01/2007
Facility name: SUNOCO SERVICE STATION
Facility address: 2701 KNAPP ST
BROOKLYN, NY 11235
EPA ID: NYD000818013
Mailing address: MARKET ST - 20-10 PC
PHILADELPHIA, NY 191031699
Contact: SUSAN HICKEY
Contact address: MARKET ST - 20-10 PC
PHILADELPHIA, NY 191031699
Contact country: US
Contact telephone: (610) 941-9054
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

**Actual:
10 ft.**

Owner/Operator Summary:

Owner/operator name: SUN CO INC - R & M
Owner/operator address: 1801 MARKET ST
PHILADELPHIA, PA 19103
Owner/operator country: US
Owner/operator telephone: (610) 941-9054
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: SUN CO INC - R & M
Owner/operator address: 1801 MARKET ST
PHILADELPHIA, PA 19103
Owner/operator country: US
Owner/operator telephone: (610) 941-9054
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: SUNOCO SERVICE STATION
Classification: Not a generator, verified

Date form received by agency: 09/08/1998
Facility name: SUNOCO SERVICE STATION
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

LTANKS:

Site ID: 175468
Spill No: 0110554
Spill Date: 12/17/2001
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/9/2004
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: WXSUN
Referred To: Not reported
Reported to Dept: 2/4/2002
CID: 270
Water Affected: Not reported
Spill Notifier: Affected Persons
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 2/4/2002
Spill Record Last Update: 2/23/2004
Spiller Name: ROBERT JONES
Spiller Company: SUNOCO
Spiller Address: 2701 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY 13159-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

Spiller County: 001
Spiller Contact: ROBERT JONES
Spiller Phone: (215) 977-6801
Spiller Extension: Not reported
DEC Region: 2
DER Facility ID: 94814
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SUN"11/05/03 see file in Sunoco drawers. Also Refer to Spill # 95-01327. 12/10/2003 Reassigned from Tipple to Sun. 2/9/2004-Sun-File Update by Sun:-Semi-Annual Monitoring and Sampling Report (June through December 2003), by EnviroTrac (Anthony Fiorentine, 631-471-1500): On July 16, 2003, three (3) monitoring wells (MW 5, 6 and 7) were gauged and sampled. No liquid-phase hydrocarbons (LPH) were detected. The depth to water ranged from 6.98 feet (MW-5) to 9.91 feet (MW-6) on July 16, 2003. BTEX concentrations ranged from ND (MW-6) to 8,166 ug/l (MW-5). MTBE concentrations ranged from 5.8 ug/l (MW-6) to 590 ug/l (MW-5). -On 2/6/2004, Joe Sun sent a letter to Russel Hammond of Sunoco, requiring a subsurface investigation to completely delineate the full extent of petroleum contamination both on-site and off-site must be performed. The investigation at a minimum must include installation of borings/wells: (1) northwest of MW-5 on the sidewalk west of Voorhies Street, (2) one shallow monitoring well above clay layer at the location of abandoned RW-1. 02/09/2004-Sun-This spill is closed. To be investigated and remediated under Spill #95-01327.

Remarks: The spill was caused by tank test failure.

Material:

Site ID: 175468
Operable Unit ID: 849031
Operable Unit: 01
Material ID: 528176
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 175468
Spill Tank Test: 1526855
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

NY MANIFEST:

EPA ID: NYD000818013
Country: USA
Mailing Name: SUN
Mailing Contact: ORLAN HURTT
Mailing Address: 1801 MARKET STREET
Mailing Address 2: Not reported
Mailing City: PHILADELPHIA
Mailing State: PA
Mailing Zip: 19103
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 000-000-0000

Document ID: NYB6712677
Manifest Status: Completed copy
Trans1 State ID: PD9938
Trans2 State ID: Not reported
Generator Ship Date: 950417
Trans1 Recv Date: 950417
Trans2 Recv Date: Not reported
TSD Site Recv Date: 950417
Part A Recv Date: 950510
Part B Recv Date: 950426
Generator EPA ID: NYD000818013
Trans1 EPA ID: NYD082785429
Trans2 EPA ID: Not reported
TSDF ID: NYD082785429
Waste Code: D018 - BENZENE 0.5 MG/L TCLP
Quantity: 04200
Units: P - Pounds
Number of Containers: 007
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 95

SPILLS:

Facility ID: 8500435
DER Facility ID: 94814
Facility Type: ER
Site ID: 175469
DEC Region: 2
Spill Number: 8500435
Spill Date: Not reported
Spill Cause: Unknown
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 8/19/1992
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: Not reported
CID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: 8/19/1992
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 6/10/1986
Spill Record Last Update: 9/25/1995
Spiller Name: Not reported
Spiller Company: AA-PIN-WILL REASSESSMENT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: NO PAYMENT IN 2 YEARS.

Material:

Site ID: 175469
Operable Unit ID: 896299
Operable Unit: 01
Material ID: 482594
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9501327
DER Facility ID: 94814
Facility Type: ER
Site ID: 107848
DEC Region: 2
Spill Number: 9501327
Spill Date: 2/15/1995
Spill Cause: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: Not Closed

SWIS: 2401

Investigator: RJFENG

Referred To: RAWP DUE 10/13/2010

Reported to Dept: 5/1/1995

CID: Not reported

Water Affected: Not reported

Spill Source: Gasoline Station

Spill Notifier: Other

Cleanup Ceased: Not reported

Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: False

UST Trust: False

Remediation Phase: 1

Date Entered In Computer: 5/18/1995

Spill Record Last Update: 6/5/2012

Spiller Name: RUSSELL HAMMOND

Spiller Company: SUNOCO

Spiller Address: Not reported

Spiller City,St,Zip: ***Update***, ZZ

Spiller Company: 001

Contact Name: Not reported

Contact Phone: Not reported

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "SUN"2/12/2003- AUSTIN As per directive to close out spills with no recent history.11/5/2003 tipple updating--see spill # 01-10554 for recent history.2/9/2004-Sun re-open this spill since this spill No. has been used for all the Quarterly or Semi-Annual Monitoring and Sampling Reports. The Spill #01-10554 is closed and will be investigated and remediated under Spill #95-01327.2/9/2004-Sun-File Update by Sun:-Semi-Annual Monitoring and Sampling Report (June throughDecember 2003), by EnviroTrac (Anthony Fiorentine,631-471-1500):On July 16, 2003, three (3) monitoring wells (MW 5,6 and 7) were gauged and sampled. No liquid-phase hydrocarbons(LPH) were detected. The depth to water ranged from 6.98 feet(MW-5) to 9.91 feet (MW-6) on July 16, 2003. BTEX concentrationsranged from ND (MW-6) to 8,166 ug/l (MW-5). MTBE concentrationsranged from 5.8 ug/l (MW-6) to 590 ug/l (MW-5).-On 2/6/2004, Joe Sun sent a letter to Russel Hammond of Sunoco,requiring a subsurface investigation to completely delineate thefull extent of petroleum contamination both on-site and off-sitemust be performed. The investigation at a minimum must includeinstallation of borings/wells: (1) northwest of MW-5 on thesidewalk west of Voorhies Street, (2) one shallow monitoring wellabove clay layer at the location of abandoned RW-1.11/4/05: Sent letter to Russell Hammond requiring an RAP for additional remediation at site. 12/9/05: December 8 meeting between Sunoco, EnviroTrac and NYSDEC. There is a clay lense at 8ft. Unknown source of product in CPT2. Awaiting submission of latest quarterly report and an RAP.2/2/06: Reviewed Second Biannual 2005 report: LPH in TW-2 and TW-3. Depth to water in MW-8 is 4.91 feet. July 1, 2005 sampling date, max BTEX 1,079 ppb (MW5), max MTBE 440 ppb (MW5). Monthly product recovery from July - December 2005. Short term remediation event with 3% Biosolve solution injected into TW-2 and TW-3, and then recovered on August 8 and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

October 31, 2005. Reviewed first biannual 2006 report. No LPH detected. Max BTEX 78 ppb (MW4), max MTBE 90 ppb (MW5). Depth to water is 4.24 feet in MW8. Large decrease in BTEX concentration in MW5. 5/18/06: Received info on tank tightness tests performed on 4/4/06/ and 4/10/06. Tank and system passed. 8/11/06: Reviewed biannual update report. Max BTEX 1,362ppb (MW5). Max MTBE 230ppb (MW5). A sewage treatment system is located directly downgradient. Quarterly sampling required. 8/18/06: Meeting on 8/27/06 with Sunoco, ET, and NYSDEC. This site may be tidely influence. Sunoco plans on vaccing out MW5. Sunoco thinks that 7-11 across the street may be an off-site source. I could not locate a spill number for the 7-11 across the street. Quarterly sampling required. 11/29/06: Received update report. Five MW's sampled on 10/8/06. Max BTEX 410ppb (MW5), max MTBE 90ppb (MW5). Fluctuating gw concentrations. Site is on a quarterly sampling plan. 1/26/07: Received update report. Wells sampled on 1/3/07. Max BTEX 219 ppb (MW5), max MTBE 78 ppb (MW5). General downward trend in contamination. 3/22/07: Meeting with Sunoco, NYSDEC, and EnviroTrac on 3/22/07. 5/29/07: Received update report. Wells sampled on 4/25/07. Max BTEX 379 ppb (MW5), max MTBE 130 ppb (MW5). MNA. 9/7/07: Reviewed update report. Wells sampled on 7/3/07. Max BTEX 2,296 ppb (MW5), max MTBE 770 pb (MW5). Fluctuating concentrations. MNA. 2/11/08: Reviewed September - December 2007 Monitoring and Sampling Report. Max BTEX 542 ppb in MW5, max MTBE 530 ppb in MW5. Fluctuating concentrations in MW5. 7/2/08 - Carlson: Reviewed update report dated June 18, 2008. Max BTEX 288 ppb (MW5). Max MTBE 100 ppb (MW5). MNA does not appear to be effective. Emailed Erin Quell regarding purpose of CPT wells. 7/9/08 - Carlson: Received email from Erin Quell: "Most of them can not be sampled. They are above groundwater and the intent was to utilize them as SVE wells. If the CPT wells are still accessible, we can gauge them to see if they generate water. Please also be reminded that Sunoco has made several attempts to install wells on the north side of Voorhies Street. Refuel was encountered due to metal plating that may be associated to the sewer treatment plant that is across the street from the station. There are also several utilities that run a long the Voorhies." 7/10/08 - Carlson: Performed site visit. Emailed Erin Quell and requested boring logs for CPT wells, inquired as to whether soil samples were collected during CPT well installation, and asked that locations where off-site delineation was attempted be indicated on the site plan. 8/6/08 - Carlson: Received email from Erin Quell with site plan that indicates off-site well locations that were attempted in 2005, and CPT well installation report from 1999. 10/8/08 - Carlson: Met with Russell Hammond of Sunoco and Erin Quell of Envirotrac on 9/29/08. Review old soil information before evaluating further action. 1/29/09 - Carlson: Meeting with Sunoco. CPT borings were just points, not wells. Delineation workplan due in April 2009. 3/18/09 - Carlson: Approved workplan for installation of four on-site soil borings. 5/27/09 - Carlson: Reviewed update report. Wells sampled on 4/30/09. Maximum BTEX concentration 359 ppb (MW5). Maximum MTBE concentration 80 ppb (MW5). 6/1/09 - Carlson: Meeting held with Sunoco and Envirotrac. Investigation report submission deadline extended to 7/15/09. 10/13/09 - Carlson: Reviewed update report. Two borings and two wells were installed on August 20-21st 2009. Soil impact found in MW10. 12/3/09 - Carlson: Reviewed Quarterly Monitoring Report. Wells sampled on 10/21/09. Maximum BTEX concentration 2,371 ppb in MW5. Meeting with Sunoco and Envirotrac scheduled for 12/8/09. 12/8/2009 - Carlson: Meeting with Sunoco.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

Excavation planned during fuel oil tank removal. NYSDEC to issue letter requiring RAP.3/24/2010 - Carlson: Reviewed December 2009 through February 2010 Monitoring and Sampling Report. A RAP for excavation was included. Excavation of two area is proposed: fuel oil tank removal and excavation of area GP2, and area of MW10 and MW5. The two areas will be over excavated until impact in removed. Sent email requiring a revised plan with endpoint sample spacing procedures (sidewall samples for every 30 linear ft, bottom samples for every 900 sq ft). Revision due in 30 days.4/29/2010 - Carlson: Received addendum email with soil sampling procedure. Issued approval letter for excavation RAP. Excavation report due 7/29/2010.7/7/2010 - Carlson: Reviewed update report. RAP was implemented. Separate RAR will be submitted.7/22/2010 - Carlson: Reviewed UST closure report. Fuel oil UST removed. Five endpoints collected. VOCs above standard in bottom sample, SVOCs above standard in north wall sample, reviewed soil excavation report. Soil excavation in two areas conducted in April 2010. excavation to 9 ft only because of a confining layer. Groundwater was not encountered. Bottom samples in both excavations have VOCs above soil standard. Three destroyed wells to be reinstalled.8/31/2010 - Carlson: Reviewed June through August 2010 Monitoring and Sampling Report. MW11 and MW12 installed in excavated areas to replace destroyed wells MW9 and MW10.9/13/2010 - Carlson: Issued letter requiring RAWP to address remaining soil impact. Due 10/13/2010.12/9/11 - Carlson: Reviewed August 2011 Monitoring and Sampling Report. BTEX and MTBE at low to non-detect levels. Groundwater was tested for salinity and found to be saline. Closure was requested. High soil impact remains at site as indicated in excavation June 2010 Soil Excavation Report. Sent email indicating a RAWP is required as per 9/13/2010 letter. RAWP is overdue.

Remarks: CONTAMINATED SOIL FOUND DURING MONITORING WELL INSTALLATION.

Material:

Site ID: 107848
Operable Unit ID: 1015730
Operable Unit: 01
Material ID: 369935
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004756224

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

AC141 **SUNOCO/KNAPP ST,BROOKLYN**
ESE **2701 KNAPP ST**
1/4-1/2 **BROOKLYN, NY**
0.443 mi.
2341 ft. **Site 8 of 8 in cluster AC**

NY Hist Spills **S102142225**
 N/A

Relative:
Higher

Actual:
10 ft.

NY Hist Spills:
Region of Spill: 2
Spill Number: 8500435
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: / /
Reported to Dept Date/Time: / /
SWIS: 61
Spiller Name: AA-PIN-WILL REASSESSMENT
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Air
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 08/19/92
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 08/19/92
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/10/86
Date Spill Entered In Computer Data File: Not reported
Update Date: 09/25/95
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNOCO/KNAPP ST,BROOKLYN (Continued)

S102142225

Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109

DEC Remarks: / / : PIN-5558. 09/25/95: PIN-5558 - ASSIGNED TO CHRIS FOR TRACKING PURPOSES.

Remark: NO PAYMENT IN 2 YEARS.

AB142
NE
1/4-1/2
0.446 mi.
2355 ft.

ALLEN AV & KNAPP ST
BROOKLYN, NY

Site 4 of 4 in cluster AB

NY Spills S104879477
NY Hist Spills N/A

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 0008468
DER Facility ID: 218461
Facility Type: ER
Site ID: 268187
DEC Region: 2
Spill Number: 0008468
Spill Date: 10/19/2000
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 2/13/2003
SWIS: 2401
Investigator: SACCACIO
Referred To: Not reported
Reported to Dept: 10/19/2000
CID: 322
Water Affected: SHORE PARK CREEK
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/19/2000
Spill Record Last Update: 2/13/2003
Spiller Name: UNKNOWN
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104879477

Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: coast guard reports unk material on shore park creek TURQUER GREEN
WATER IN SHELL BANK CREEK NEAR S.H.BAY

Material:
Site ID: 268187
Operable Unit ID: 829071
Operable Unit: 01
Material ID: 545975
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 0008468
Investigator: SACCACIO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 10/19/2000 14:41
Reported to Dept Date/Time: 10/19/00 15:22
SWIS: 61
Spiller Name: UNK
Spiller Contact: UNK
Spiller Phone: (000) 000-0000
Spiller Address: UNK
Spiller City,St,Zip: UNK
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: SHORE PARK CREEK
Spill Source: 12
Spill Notifier: Local Agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104879477

PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/19/00
Date Spill Entered In Computer Data File: Not reported
Update Date: 10/20/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: Not reported
Remark: coast guard reports unk material on shore park creek

AE143
WNW
1/4-1/2
0.450 mi.
2377 ft.

ROADWAY
2101 AVENUE X
BROOKLYN, NY
Site 1 of 3 in cluster AE

NY Spills S109414921
N/A

Relative:
Higher

Actual:
14 ft.

SPILLS:

Facility ID: 0811928
DER Facility ID: 358774
Facility Type: ER
Site ID: 409520
DEC Region: 2
Spill Number: 0811928
Spill Date: 2/2/2009
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ROADWAY (Continued)

S109414921

Spill Closed Date: 2/5/2009
SWIS: 2401
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 2/2/2009
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/2/2009
Spill Record Last Update: 2/5/2009
Spiller Name: MIKE BLEE
Spiller Company: UNKNOWN
Spiller Address: 2101 AVENUE X
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: MIKE BLEE
Contact Phone: Not reported
DEC Memo: Sangesland requested sanitation to sand.
Remarks: Caller states a third party contacted them and stated the street in front of thier house was covered with oil. No further info.

Material:

Site ID: 409520
Operable Unit ID: 1166028
Operable Unit: 01
Material ID: 2157463
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AE144
WNW
1/4-1/2
0.452 mi.
2384 ft.

RECLOSURE SWITCH LEAK AT POLE 37281
EAST 21 STREET & AVENUE X
BROOKLYN, NY

NY Spills

S109062583
N/A

Site 2 of 3 in cluster AE

Relative:
Higher

Actual:
14 ft.

SPILLS:

Facility ID: 0801453
DER Facility ID: 346800
Facility Type: ER
Site ID: 397375
DEC Region: 2
Spill Number: 0801453
Spill Date: 5/6/2008
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/19/2008
SWIS: 2401
Investigator: gdbreen
Referred To: Not reported
Reported to Dept: 5/6/2008
CID: 78
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/7/2008
Spill Record Last Update: 5/19/2008
Spiller Name: ERT
Spiller Company: CON EDISON
Spiller Address: EAST 21ST / AVE X
Spiller City,St,Zip: BROOKLYN, NY 11229
Spiller Company: 999
Contact Name: ERT
Contact Phone: (212) 580-8383
DEC Memo: 05/19/08 - See eDocs for Con Ed report detailing cleanup and closure.211229. see eDocs

Remarks: 1/2 pint spilled onto the ground from pole. A reclosure failed. No to the 5 questions. Spill is not yet cleaned, but a crew is enroute to evaluate. Con Ed Referenced No. is 211229.

Material:

Site ID: 397375
Operable Unit ID: 1154343
Operable Unit: 01
Material ID: 2145136
Material Code: 0541A
Material Name: DIELECTRIC FLUID
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RECLOSURE SWITCH LEAK AT POLE 37281 (Continued)

S109062583

Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

145
NNW
1/4-1/2
0.452 mi.
2388 ft.

**SERVICE BOX 67885
2211 EAST 28TH ST
BROOKLYN, NY**

**NY Spills
NY Hist Spills**

**S103829355
N/A**

**Relative:
Higher**

**Actual:
11 ft.**

SPILLS:

Facility ID: 9815237
DER Facility ID: 146679
Facility Type: ER
Site ID: 174395
DEC Region: 2
Spill Number: 9815237
Spill Date: 3/24/1999
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/6/2002
SWIS: 2401
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 3/24/1999
CID: 312
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/24/1999
Spill Record Last Update: 6/6/2002
Spiller Name: Not reported
Spiller Company: CON EDISON
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003
Spiller Company: 999
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SERVICE BOX 67885 (Continued)

S103829355

"O'CONNELL"Con Ed e2mis #123819:3/24/99 10:40 hrsR. Bocignone #07942, Splicer with Underground, reports that at 10:05 hrs, while working on open main, found approx. 1/2 pint of an unknown liquid on approx. 10 gal water in SB-67885, F/O 2211 E. 28 St. (liquid may be oil, but he was not sure). Spill is contained. No sewers or waterways are affected. Env. stop tag #21442 placed. Sample taken on a 4-6 hour priority turnaround. Cleanup is pending results from Chem Lab. No parking restrictions.3/24/99 10:59 hrs -- Notified R. Roach of C.I.G. 3/24/99 14:55 hrs -- Lab Seq #99-03019, "Analysis indicates presence of oily substance similar to a mixture of dielectric fluid and lubricating oil."3/24/99 15:55 hrs -- Lab Seq #99-03018, <1.0 ppm PCBUPDATE3/31/99-15:15HRS-M. KNOX-38504-FLUSH OPS-REPORTS CLEANUP COMPLETED WITH SLIX AT THIS TIME AND TAG#21442 REMOVED. INCIDENT IS CLOSED. TJ - 50495

Remarks: 1/2 PINT OF UNK LIQUID ON 10GAL OF WATER - CONTAINED - CASE #123819

Material:

Site ID: 174395
Operable Unit ID: 1073256
Operable Unit: 01
Material ID: 308352
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9815237
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/24/1999 10:05
Reported to Dept Date/Time: 03/24/99 11:05
SWIS: 61

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SERVICE BOX 67885 (Continued)

S103829355

Spiller Name: CON EDISON
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Address: 4 IRVING PLACE
Spiller City,St,Zip: NEW YORK, NY 10003-
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/24/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/24/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN MATERIAL
Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109
DEC Remarks: Not reported
Remark: 1/2 PINT OF UNK LIQUID ON 10GAL OF WATER - CONTAINED - CASE 123819

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

146
SE
1/4-1/2
0.459 mi.
2422 ft.

GOLDEN GATE INN TTF
3867 SHORE PARKWAY
BROOKLYN, NY

LTANKS S110490732
N/A

Relative:
Higher

Actual:
15 ft.

LTANKS:

Site ID: 438998
Spill No: 1005673
Spill Date: 8/21/2010
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SFRAHMAN
Referred To: Not reported
Reported to Dept: 8/21/2010
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1
Date Entered In Computer: 8/21/2010
Spill Record Last Update: 11/3/2011
Spiller Name: NICK PATEL
Spiller Company: GOLDEN GATE INN
Spiller Address: 3867 SHORE PARKWAY
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 999
Spiller Contact: TJ OCONNOR
Spiller Phone: (516) 678-5115
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 393990
DEC Memo: Ahmed was off hours DEC rep for this date/time.10/20/2010 Sangesland spoke to rep from Airteck Environmental who is working for the potential purchaser of this hotel. Buried tank is located in the parking lot under the West side awning. They put in a monitoring well and a soil boring in the area of the tank and found contamination. Sangesland asked them to send in copies of the soil/water test results along with drawings and photographs of the work/area. The case will be assigned at that time.Judah Lebow is the engineer at Airteck Environmental 718-937-3720 1/14/2011 - Airteck Env. submitted a report today - case assigned to Ahmed - report in eDocs10/27/11 - Austin - Spill Transferred from Ahmed to Rahman - end

Remarks:

Caller reporting a tank test failure

Material:

Site ID: 438998
Operable Unit ID: 1189649
Operable Unit: 01
Material ID: 2184602

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN GATE INN TTF (Continued)

S110490732

Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

147
SW
1/4-1/2
0.461 mi.
2436 ft.

E 22 ST /SHORE PKY
BROOKLYN, NY

NY Spills S104649255
NY Hist Spills N/A

Relative:
Higher

Actual:
19 ft.

SPILLS:

Facility ID: 9903836
DER Facility ID: 97129
Facility Type: ER
Site ID: 110989
DEC Region: 2
Spill Number: 9903836
Spill Date: 7/3/1999
Spill Cause: Deliberate
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 7/8/1999
SWIS: 2401
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 7/3/1999
CID: 207
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 7/3/1999
Spill Record Last Update: 12/24/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104649255

Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: CALLER
Contact Phone: (718) 648-9043
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"TIBBE"SEE ALSO 99-03838. NYC FD ONSCENE. EPA & USCG NOTIFIED. USCG ENROUTE. SMALL AMOUNT OF OIL. NYC DEP NOTIFIED. HANDLED BY NYC DEP.

Remarks: Not reported

Material:

Site ID: 110989
Operable Unit ID: 1082773
Operable Unit: 01
Material ID: 303738
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9903836
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 07/03/1999 14:00
Reported to Dept Date/Time: 07/03/99 15:01
SWIS: 61
Spiller Name: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: CALLER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104649255

Spiller Phone: (718) 648-9043
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: Surface Water
Water Affected: Not reported
Spill Source: Not reported
Spill Notifier: Not reported
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/08/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/03/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 07/08/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: SEE ALSO 99-03838. NYC FD ONSCENE. EPA USCG NOTIFIED. USCG ENROUTE. SMALL
AMOUNT OF OIL. NYC DEP NOTIFIED. HANDLED BY NYC DEP.
Remark: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

AF148 NW
1/4-1/2
0.463 mi.
2442 ft.

FRANK/LEE TWO-FAMILY HOUSE
2258 EAST 24TH STREET
BROOKLYN, NY

Site 1 of 2 in cluster AF

LTANKS S107523398
N/A

Relative:
Higher

Actual:
13 ft.

LTANKS:

Site ID: 358180
Spill No: 0511936
Spill Date: 1/17/2006
Spill Cause: Tank Overfill
Spill Source: Private Dwelling
Spill Class: Not reported
Spill Closed Dt: 4/20/2006
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: rvketani
Referred To: Not reported
Reported to Dept: 1/17/2006
CID: 444
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1/17/2006
Spill Record Last Update: 4/20/2006
Spiller Name: MARCUS LEE
Spiller Company: TWO-FAMILY HOUSE
Spiller Address: 2258 EAST 24TH STREET
Spiller City,St,Zip: BROOKLYN, NY 001
Spiller Contact: MARCUS LEE
Spiller Phone: (212) 275-7909
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 308199
DEC Memo: 1/17/06 - Raphael Ketani. I talked to Marcus Lee (212) 275-7909 today (cell (917) 560-8948). He said that on 12/28/05 he noticed an odor in his basement. It turned out, he said, that the neighbor had a suction line leak. He said the line was repaired. However, there is still a strong odor in his front basement. He said the first floor neighbor is Rebecca (718) 743-4356 and the second floor neighbors are David and Michelle (718) 934-0590. The Lee residence uses gas and has been doing so for a long while. Mr. Lee arranged for me to visit both residences at 3PM on 1/18/06. 1/18/06 - Raphael Ketani. I called Mr. Lee back and told him that I had to cancel the appointment to inspect the 2 basements due to a spill emergency. He said he understood and that he is willing to set up an appointment for next week. I told him I would contact him later. 1/23/06 - Raphael Ketani. I made a site visit today. First, I met Mr. Jimmy Lee (the father of Marcus) and checked the basement. Vapors were noticeable only in the front room of the basement. Ambient vapor concentrations were about 560ppb. However, at a crack above the wall molding in a corner with the closet, the concentration was 3,000ppb. There was not sign of product having entered this basement. Next, I went to the Frank residence and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRANK/LEE TWO-FAMILY HOUSE (Continued)

S107523398

met Rebecca and David. They showed me the suction line that was replaced and the old suction line that was below the new one. They explained that less than a gallon escaped the old line due to a hairline crack. I looked at the old line, but could not see the crack even though Mr. Frank pointed out the location. I looked at the concrete floor below the pipes and saw a little Speedi-Dri, but nothing else. The PID detected about 350ppb in the ambient air of the front basement of the Frank home and 3,000ppb right at the corner where the spill took place. I told Mr. Frank that the cement, concrete, and wood that was affected would have to be removed in order to get rid of the odors. He said he would do the work himself. Later, I called Marcus Lee back and told him to keep me informed as to whether the vapors decrease or stay the same during the concrete, cement and wood removal. He said he would. 1/30/06 - Raphael Ketani. Mr. Marcus Lee called today. He said that the odors in his basement are still strong. He said that he spoke to Rebecca and she said that David had just removed the old suction line. This was supposed to have been done a week ago, but Mr. Lee was told that David couldn't do it the day I was there. I spoke to Rebecca and she said that David did remove the line and some wood and paneling. She added that the oil company gave her something to take the odors away. I told her that was fine, but the oil is probably soaked into the concrete. She said that David didn't remove any concrete yet because they want to see how the odors are with just this amount of work. I told her that if the odors persist, then she will have to hire a company to remove the concrete. She said that she wanted to wait a few days. I told her that I would be back in touch soon. 2/3/06 - Raphael Ketani. I received a call from Mr. Lee. He said that his basement still has a strong odor. He asked me have Rebecca and Mr. Frank do more to remove the source of the odor. Mr. Lee asked me to contact Rebecca and tell her so. I called Rebecca and asked her how her basement was. She said that she didn't smell anything. I told her that I would be coming over to inspect both her basement and Mr. Lee's. She said that would be fine. Mr. Lee set up a time that was good for both of them to be home so I can enter the basements. This will be between 9:30AM and 12 noon on monday, 2/6/06. 2/6/06 - Raphael Ketani. I visited the basement of the Lee home. Ambient air was 800ppb and concentrations at the corner of the room at the gap in the molding and the closet were 6700ppb. Next, I visited the Taragano home. I spoke to Rebecca and David and Michelle Frank. Vapors on their side of the corner were 2400ppb. I told them that they have to hire a contractor to take away the oil and any oil soaked cement. Ms. Taragano said she was ready to do this. I gave her a list of contractors. I set up an associated spill case for 2256 E. 24 St., Taragano/Frank home (#0551591). 2/27/06 - Raphael Ketani. I visited the Lee home today and his father let me into the basement. There was no odor of oil. The room vapors were about 280 ppb. However, the gap between the molding and the wall board in the corner next to the wood closet had 1300 ppb. The concentration of the vapors in the closet next to the staining was 4500 ppb and smelled strongly. I advised Mr. Lee, the son, to remove the wall paneling, ventilate the closet and the room and see what is behind the wall board. I asked him to let me know what he finds. 3/17/06 - Raphael Ketani. Mr. Lee called me today. He said that he removed the sheet rock from the wall of the closet and saw several fine cracks. He said that the odors are still the same as when I last visited. He said that the odors increase when his furnace starts running. I told him this is probably due to the furnace drawing air

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRANK/LEE TWO-FAMILY HOUSE (Continued)

S107523398

from the room which creates an atmospheric pressure drop and allows air from Ms. Terragano's basement to come in which has odors. He asked when I could come over and test the vapors. I told him on teusday 3/21 at 10:30AM. He said he'll be there.3/21/06 - Raphael Ketani. I made a site visit to the Lee basement today. Odors in the front basement were very slight. Almost not noticeable. The ambient air vapor level in the front basement was 250 ppb. Mr. Lee had taken out a section of dry wall from within the closet in the room. The vapors in the new space were about 560 ppb - which is greatly improved from the previous 4500 ppb. The crack 2 inches above the floor in the wall just outside of the closet had 1800 ppb vapors. I told Mr. Lee to open up the dry wall here with an opening of at least 1 1/2 feet by 2 feet and to ventilate the entire room. He said he would do this.4/6/06 - Raphael Ketani. I tried calling Mr. Lee to find out how the odors are in his basement, but could only leave a message. I tried calling Isaac of Eastmond to find out when I will get the closure report, but could only leave a message. I called Rebecca to find out how things are in her basement. She said she doesn't have any odors. She asked that I bother Eastmond and not her regarding getting the closure report. 4/17/06 - Raphael Ketani. I tried to call Mr. Lee regarding the odors in his basment, but could only leave a voice mail.4/20/06 - Raphael Ketani. Mr. Lee called me back today. He said that he broke open a section of the sheet rock wall about 1 1/2 feet away from the wood closet to get at the odors trapped there. He said that now the odors are very slight and he can't smell the oil odors unless he puts his nose right up to the cinder block wall. He said he has the windows open and is ventilating the basement. Mr. Lee added that he will seal the exposed sections of the wall with 2-part expoxy sealant this summer. As the odors have been alleviated in the Lee's basement and Mrs. Taragano had the oil soaked concrete and paneling removed and the suction line fixed, I am closing this spill case.

Remarks: CALLER SAYS THAT HIS NIEGHBOR HAD AN OIL LEAK AND THE PIPE WAS REPLACED, AND HE STILL HAS AN ODOR OF OIL; STEVE SANGESLAND FROM DEC WAS NOTIFIED:

Material:

Site ID: 358180
Operable Unit ID: 1115432
Operable Unit: 01
Material ID: 2105497
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRANK/LEE TWO-FAMILY HOUSE (Continued)

S107523398

Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

AF149 REBECCA TARAGANO HOME
NW 2256 EAST 24 STREET
1/4-1/2 BROOKLYN, NY 11229
0.465 mi.
2455 ft. Site 2 of 2 in cluster AF

NY Spills S107523093
N/A

Relative:
Higher

Actual:
13 ft.

SPILLS:

Facility ID: 0551591
DER Facility ID: 309243
Facility Type: ER
Site ID: 359223
DEC Region: 2
Spill Number: 0551591
Spill Date: 1/17/2006
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/21/2006
SWIS: 2401
Investigator: rvketani
Referred To: Not reported
Reported to Dept: 1/17/2006
CID: Not reported
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/6/2006
Spill Record Last Update: 6/21/2006
Spiller Name: REBECCA TARAGANO
Spiller Company: REBECCA TARAGANO
Spiller Address: 2256 EAST 24 STREET
Spiller City,St,Zip: BROOKLYN, NY 11229
Spiller Company: 001
Contact Name: REBECCA TARAGANO
Contact Phone: rebecca taragano
DEC Memo: Associated spill case is #0511936 for 2258 East 24 Street, Brooklyn. However, 2258 has only natural gas.1/17/06 - Raphael Ketani. I talked to Marcus Lee (212) 275-7909 today (#0511936). He said that on 12/28/05 he noticed an odor in his basement. It turned out, he said, that the neighbor had a suction line leak. He said the line was repaired. However, there is still a strong odor in his front basement. He said the first floor neighbor is Rebecca (718) 743-4356 and the second floor neighbors are David and Michelle (718) 934-0590. The Lee residence uses gas and has been doing so for a long while.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

REBECCA TARAGANO HOME (Continued)

S107523093

Mr. Lee arranged for me to visit both residences at 3PM on 1/18/06. 1/18/06 - Raphael Ketani. I called Mr. Lee back and told him that I had to cancel the appointment to inspect the 2 basements due to a spill emergency. He said he understood and that he is willing to set up an appointment for next week. I told him I would contact him later. 1/23/06 - Raphael Ketani. I made a site visit today. First, I met Mr. Jimmy Lee (the father of Marcus) and checked the basement. Vapors were noticeable only in the front room of the basement. Ambient vapor concentrations were about 560ppb. However, at a crack above the wall molding in a corner with the closet, the concentration was 3,000ppb. There was not sign of product having entered this basement. Next, I went to the Frank residence and met Rebecca and David. They showed me the suction line that was replaced and the old suction line that was below the new one. They explained that less than a gallon escaped the old line due to a hairline crack. I looked at the old line, but could not see the crack even though Mr. Frank pointed out the location. I looked at the concrete floor below the pipes and saw a little Speedi-Dri, but nothing else. The PID detected about 350ppb in the ambient air of the front basement of the Frank home and 3,000ppb right at the corner where the spill took place. I told Mr. Frank that the cement, concrete, and wood that was affected would have to be removed in order to get rid of the odors. He said he would do the work himself. Later, I called Marcus Lee back and told him to keep me informed as to whether the vapors decrease or stay the same during the concrete, cement and wood removal. He said he would. 1/30/06 - Raphael Ketani. Mr. Marcus Lee called today. He said that the odors in his basement are still strong. He said that he spoke to Rebecca and she said that David had just removed the old suction line. This was supposed to have been done a week ago, but Mr. Lee was told that David couldn't do it the day I was there. I spoke to Rebecca and she said that David did remove the line and some wood and paneling. She added that the oil company gave her something to take the odors away. I told her that was fine, but the oil is probably soaked into the concrete. She said that David didn't remove any concrete yet because they want to see how the odors are with just this amount of work. I told her that if the odors persist, then she will have to hire a company to remove the concrete. She said that she wanted to wait a few days. I told her that I would be back in touch soon. 2/3/06 - Raphael Ketani. I received a call from Mr. Lee. He said that his basement still has a strong odor. He asked me have Rebecca and Mr. Frank do more to remove the source of the odor. Mr. Lee asked me to contact Rebecca and tell her so. I called Rebecca and asked her how her basement was. She said that she didn't smell anything. I told her that I would be coming over to inspect both her basement and Mr. Lee's. She said that would be fine. Mr. Lee set up a time that was good for both of them to be home so I can enter the basements. This will be between 9:30AM and 12 noon on monday, 2/6/06. 2/6/06 - Raphael Ketani. I visited the Lee residence. The vapors were 800ppb in the room and 6700ppb at the gap in the molding next to the closet. In the Taragano home, the concentration was 2400ppb. I told Rebecca, David, and Michelle that their efforts weren't enough to get rid of the vapors and that they will have to hire a professional contractor. Rebecca said she was ready to do it. I gave her a list of contractors. I will send her a letter stating that she has to cleanup the spill with a professional contractor. At 2:45PM today, I spoke again to Rebecca. She said she had called Eastmond & Sons to give her an estimate regarding what it would possibly cost to do the removal

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

REBECCA TARAGANO HOME (Continued)

S107523093

work. She said she spoke to Isaac of Eastmond and he asked that I call him. I spoke to Isaac and explained the history of the spill and the conditions under which it took place. He said he understood and that he will call Rebecca back to arrange a visit. 2/7/06 - Raphael Ketani. I received a call from Ms. Taragano. She said that Isaac of A.L. Eastmond & Sons ((718) 378-3000) never showed up at her house to do the estimate. I called up Isaac and he said he couldn't make the appointment with Ms. Taragano today, but he will try to meet with her tomorrow. 2/10/06 - Raphael Ketani. I received a call from Ms. Taragano. She said that the workers from Eastmond were there and they were taking away the contaminated material. I spoke to Mani Centano of Eastmond. He said that they broke up the floor and dug down about 8 feet. He said they found only some contaminated dust that was against a hot water pipe. He said they found that the wall separating the two houses has a 1/4 inch crack in it. So the warmed vapors were traveling into the Lee house. Mr. Centano said this was all they found. I told him to have someone from Eastmond send me a letter stating what they did, what they found, and how the situation was fixed. He said they would. I called Mr. Lee's voice mail and left the same information and I said that he should call me if the odors are bad again. 2/17/06 - Raphael Ketani. Ms. Taragano called to say that she asked Isaac of Eastmond to send DEC a work completion report. 2/27/06 - Raphael Ketani. I made a site visit to the home. I met Frank and he showed me the basement. Eastmond had dug out the floor about 3 inches at the corner where the leak had been and had removed some wood paneling. The floor looked dry and didn't have an oily odor - not even when I rubbed my hand on the concrete. The pipes looked clean. However, there was an odor in the basement that was strongest in the corner. The breathing zone had about 560 ppb. The crack in the cinder block wall had 1300 ppb. However, there was no sign of oil anywhere. 3/2/06 - Raphael Ketani. Isaac of Eastmond called me up today and asked whether more concrete removal was necessary at the Taragano home. I told him that I had inspected the site and that I didn't find more contamination. However, I told him the odors were still stronger than what I would have liked to end up with after the cleanup. I told him that I didn't understand why the odors were so strong, especially in the closet of the Lee home. So I had suggested to Mr. Lee to remove the paneling and wallboard next to the closet to relieve the odors and then ventilate the basement. Isaac said he understood and he added that he will wait until he finds out what is the situation with the Lee home before he cements up the Taragano home. 3/20/06 - Raphael Ketani. Michelle Frank, the daughter of Mrs. Taragano, called to say that nothing is happening in her mom's basement as her mom is in the hospital. I told her nothing much needs to happen and that the odors will slowly abate to a lower level over time with ventilation. I told her she or her mom should have Eastmond come over and fill in the hole in the floor and the crack in the wall in the basement, and paint the wall with sealing epoxy paint. She said that her husband will probably do this. She asked what was happening with the Lee basement. I told her that he took off the closet paneling and the wall board and that he still has bad odors. I mentioned that the vapors got into the cement of the supporting wall and that there is nothing that can remove the odors, short of tearing out the wall. However, I didn't recommend this as it is a structural wall. I said that I will make a visit on 3/21 to assess the situation. I told her that the Lee basement will also have to be filled and painted. She said that the Lees can fill in their

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

REBECCA TARAGANO HOME (Continued)

S107523093

Remarks: own cracks and paint their own wall.4/24/06 - Raphael Ketani. I spoke to Isaac of Eastmond and asked him when I will receive the cleanup report. He said that Mrs. Taragano still hasn't paid him for the work, but that he will send me the report anyway.6/16/06 - Raphael Ketani. I spoke to Issac again. He said that Ms. Taragano paid him for the work. So he will send me a letter report soon.6/21/06 - Raphael Ketani. I received a FAX from Isaac of Eastmond. It contained a cover letter describing the work that was done and a manifest for the contaminated material that was removed. I tried to get ahold of Michelle Taragano, the daughter, to remind her (if it hasn't already been done) to have the bare cement wall and floor covered with sealing epoxy paint and ventilate the basement as much as possible. Based upon the work that I observed performed by Eastmond and the documentation I received from them, I am closing the spill case. 2256 East 24 Street is the source of the spill. Not 2258. 2258 doesn't have an oil tank. So I'm opening up this spill case. Associated case is #0511936.

Material:

Site ID: 359223
Operable Unit ID: 1116446
Operable Unit: 01
Material ID: 2106837
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 359223
Spill Tank Test: 1549704
Tank Number: 1
Tank Size: 275
Test Method: NN
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: rvketani
Last Modified: 2/6/2006
Test Method: Testing Not Required

AG150
North
1/4-1/2
0.465 mi.
2457 ft.

VEHICLE 60722
NOSTRAND AVE & AVENUE V
BROOKLYN, NY
Site 1 of 3 in cluster AG

NY Spills S109372054
N/A

Relative:
Higher

SPILLS:

Facility ID: 0807408
DER Facility ID: 354024
Facility Type: ER
Site ID: 404754
DEC Region: 2

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VEHICLE 60722 (Continued)

S109372054

Spill Number: 0807408
Spill Date: 10/1/2008
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/20/2008
SWIS: 2401
Investigator: asnagi
Referred To: Not reported
Reported to Dept: 10/1/2008
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 10/1/2008
Spill Record Last Update: 10/20/2008
Spiller Name: ERT
Spiller Company: CON ED
Spiller Address: NOSTRAND AVE & AVENUE V
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: ERT
Contact Phone: (212) 580-8383
DEC Memo: 10/20/08 - See eDocs for Con Ed report detailing cleanup and closure.
Remarks: A con ed vehicle leaked 2 quarts of oil onto a puddle of water. Clean up is pending.

Material:
Site ID: 404754
Operable Unit ID: 1161399
Operable Unit: 01
Material ID: 2152597
Material Code: 0010
Material Name: Hydraulic Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VEHICLE 60722 (Continued)

S109372054

Last Modified: Not reported
Test Method: Not reported

151
NE
1/4-1/2
0.466 mi.
2463 ft.

2348 KNAPP ST
2348 KNAPP ST
BROOKLYN, NY

NY Spills
NY Hist Spills

S102239129
N/A

Relative:
Higher

Actual:
9 ft.

SPILLS:

Facility ID: 9514663
DER Facility ID: 92472
Facility Type: ER
Site ID: 104751
DEC Region: 2
Spill Number: 9514663
Spill Date: 2/15/1996
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Date: 2/20/1996
SWIS: 2401
Investigator: ADZHITOM
Referred To: Not reported
Reported to Dept: 2/15/1996
CID: 252
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False

Remediation Phase: 0
Date Entered In Computer: 2/15/1996
Spill Record Last Update: 3/18/1996
Spiller Name: MR JCE POWERS
Spiller Company: PRIVATE RESIDENCE
Spiller Address: 2348 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: MR JCE POWERS
Contact Phone: (718) 743-3746
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ZHITOMIRSKY"

Remarks: leaking oil filter caused spill onto cement basement floorfilter has been replaced and spill cleaned up

Material:

Site ID: 104751
Operable Unit ID: 1025773
Operable Unit: 01
Material ID: 354792
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2348 KNAPP ST (Continued)

S102239129

Material FA: Petroleum
Quantity: 3
Units: Gallons
Recovered: 3
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9514663
Investigator: ZHITOMIRSKY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/15/1996 17:30
Reported to Dept Date/Time: 02/15/96 17:51
SWIS: 61
Spiller Name: PRIVATE RESIDENCE
Spiller Contact: MR JCE POWERS
Spiller Phone: (718) 743-3746
Spiller Contact: MR JCE POWERS
Spiller Phone: (718) 743-3746
Spiller Address: 2348 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 09
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2348 KNAPP ST (Continued)

S102239129

Spill Closed Dt: 02/20/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/15/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/18/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 3
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 3
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Remark: leaking oil filter caused spill onto cement basement floor filter has been replaced and spill cleaned up

AH152
SSE
1/4-1/2
0.470 mi.
2484 ft.

CASTLE HARBOR REST.
FORD STREET & EMMONS AVE
BROOKLYN, NY

NY Spills
NY Hist Spills

S103829113
N/A

Site 1 of 2 in cluster AH

Relative:
Lower

SPILLS:

Facility ID: 9814975
DER Facility ID: 111814
Facility Type: ER
Site ID: 129713
DEC Region: 2
Spill Number: 9814975
Spill Date: 3/17/1999
Spill Cause: Abandoned Drums
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/19/1999
SWIS: 2401
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 3/17/1999
CID: 199
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: Not reported

Actual:
3 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASTLE HARBOR REST. (Continued)

S103829113

Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 3/17/1999
Spill Record Last Update: 3/19/1999
Spiller Name: UNKNOWN
Spiller Company: CASTLE HARBOR REST.
Spiller Address: FORD ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 001
Contact Name: TASHA PITT
Contact Phone: (718) 595-6700
DEC Memo: Not reported
Remarks: CITIZEN REPORTS OUTSIDE THE LOCATION THERE IS A CONTAINER THAT ISLEAKING FUEL OIL - MATERIAL IS GOING INTO THE STREET - ENTRANCE IS OFF FORD ST

Material:

Site ID: 129713
Operable Unit ID: 1072843
Operable Unit: 01
Material ID: 308089
Material Code: 0046A
Material Name: COOKING GREASE
Case No.: Not reported
Material FA: Other
Quantity: 5
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9814975
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASTLE HARBOR REST. (Continued)

S103829113

Spill Date/Time: 03/17/1999 14:33
Reported to Dept Date/Time: 03/17/99 14:43
SWIS: 61
Spiller Name: CASTLE HARBOR REST.
Spiller Contact: UNKNOWN
Spiller Phone: Not reported
Spiller Contact: TASHA PITT
Spiller Phone: (718) 595-6700
Spiller Address: FORD ST
Spiller City,St,Zip: BROOKLYN, NY
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/19/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/17/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/19/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: COOKING GREASE
Class Type: COOKING GREASE
Times Material Entry In File: 59
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: DEC SIGONA) investigated complaint issued by the NYCDEP that there were 55-gallon drums of 2 fuel oil leaking at this location. DEC s investigation on 3/17/1999 at 4 :00 P.M. revealed that the drums were not leaking and they contained used cooking oil. Called DEP spoke with DEP Ha Mat Seidenberg) who

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CASTLE HARBOR REST. (Continued)

S103829113

Remark: said the DEP would not investigate cooking oil drums. Referred to NYCDOS called 212)837-8452 spoke to envir. police unit who said they no longer investigate ha material. Also, cooking oil can be stored in drums on property. No spillage on public sidewalk.
CITIZEN REPORTS OUTSIDE THE LOCATION THERE IS A CONTAINER THAT IS LEAKING FUEL OIL - MATERIAL IS GOING INTO THE STREET - ENTRANCE IS OFF FORD ST

AH153
SSE
1/4-1/2
0.470 mi.
2484 ft.

VAULT 5615
EMMONS AVE/FORD ST
BROOKLYN, NY
Site 2 of 2 in cluster AH

NY Spills
NY Hist Spills
S103827950
N/A

Relative:
Lower

Actual:
3 ft.

SPILLS:

Facility ID: 9813551
DER Facility ID: 191112
Facility Type: ER
Site ID: 231917
DEC Region: 2
Spill Number: 9813551
Spill Date: 2/5/1999
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/19/2000
SWIS: 2401
Investigator: JHOCONNE
Referred To: Not reported
Reported to Dept: 2/5/1999
CID: 270
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/5/1999
Spill Record Last Update: 10/21/2002
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY 999
Contact Name: MIKE CEASER
Contact Phone: (212) 580-6763
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "O'CONNELL"Con ed e2mis 122-872 notes:2/5/99 1015HRS-- ADAMO NETW. REPORTS FOUND A SHEEN OF UNKNOWN FLUID ON 60 GALLONS OF WATER IN V5615.CONTAINED NO SEWERSOR WATERWAYS EFFECTED,SAMPLE TAKEN ,TAG#122872 PLACED.1240HRS--ADAMO REPORTS UNIT PRESSURE TESTED ,PASSED OK. UNABLE TO SEE ANY SUMP PUMPS DUE TO WATER IN STRUCTURE.UPDATE** 2-5-99 6:25HRS LAB SEQ# 99-01269 <1.0PPM.UPDATE**2-6-99 12:15HRS J. RUSSO REPORTS, CLEANUP COMPLETED & ENV. STOP TAG # 122872 REMOVED. 760 SOLUTION USED TO CLEANSTRUCTURE.2/8/99 - 1100. INCIDENT RE-OPENED DUE TO OIL STILL IN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 5615 (Continued)

S103827950

STRUCTURE. TAG #08294 PLACED.UPDATE: 2/8/99 - 1530A. WALKER - 55495 - ENV. OPS., REPORTS <1.0 PPM CLEANUP COMPLETE AND TAG #08294 REMOVED. INCIDENT IS CLOSED. NO LEAKING COMPANY EQUIPMENT FOUND.
1 OZ OIL ON 60 GAL WATER CON ED 122872 SAMPLES TAKEN

Remarks:

Material:

Site ID: 231917
Operable Unit ID: 1071089
Operable Unit: 01
Material ID: 310266
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9813551
Investigator: O'CONNELL
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/05/1999 10:15
Reported to Dept Date/Time: 02/05/99 11:14
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: MIKE CEASER
Spiller Phone: (212) 580-6763
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 5615 (Continued)

S103827950

Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 05/19/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/05/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/22/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Con ed e2mis notes: A sheen of unknown fluid on 60 gallons of water in V5615. Unit pressure tested, passed ok. <1.00ppm 12:15, J.Russo reports, cleanup completed 2/8/99 1100, incident re-opened due to oil still in structure. 2/8/99-1530: Reprots <1.0 ppm cleanup complete, and tag removed.
Remark: 1 OZ OIL ON 60 GAL WATER CON ED 122872 SAMPLES TAKEN

AG154
North
1/4-1/2
0.476 mi.
2512 ft.

VAULT 4338
AVE V & NOSTRAND AVE
BROOKLYN, NY
Site 2 of 3 in cluster AG

NY Spills **S103574776**
NY Hist Spills **N/A**

Relative:
Higher

SPILLS:
Facility ID: 9810796
DER Facility ID: 162732
Facility Type: ER
Site ID: 195295
DEC Region: 2
Spill Number: 9810796

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 4338 (Continued)

S103574776

Spill Date: 11/25/1998
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 10/23/2002
SWIS: 2401
Investigator: CAENGELH
Referred To: Not reported
Reported to Dept: 11/25/1998
CID: 252
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/25/1998
Spill Record Last Update: 10/28/2002
Spiller Name: Not reported
Spiller Company: UNK
Spiller Address: Not reported
Spiller City,St,Zip: ***UPDATE***, ZZ
Spiller Company: 999
Contact Name: MIKE CESARE
Contact Phone: (212) 580-6763
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"e2mis notes 121521A. HOWELL #68121 OS FLUSH REPORTS IN VS4338 S/S AVE V 193' E/O NOSTRAND AVE HE FOUND 5 GAL OF UNKNOWN OIL (TRANSF WASPRESSURE TESTED, DID LEAK, TRANSF TO BE REMOVED. FDR.10B65) MIXED IN DIRT. FOUND OIL WHILE CLEANING HOLE FOR TRANSFREMOVAL FLUSH VACTOR WAS CONTAMINATED WHILE DOING THIS JOB. HOLE CONTAINED AND NO SEWERS OR WATERWAYS AFFECTED.CLEANUP IN PROGRESS WITH CONTAMINATED TRUCK # 60442 . DOING CLEANUP AS 50-499 PPM. SAMPLE TAKEN FOR (4- 6 HRS PRIORITYFOR SAMPLE RESULTS) PURPOSE OF TRUCK TO BE CLEANED. NO E.S.TAG PLACED. CIG CESARE NOTIFIED 1343 HRS LAZ #04425+UPDATE 11-25-98 1401HRSHOWELL#68121 REPORTS STRUCTURE DOUBLE WASHED. THE SUMP IS CLEAR 1 FT OF DEBRI REMOVED. VACTOR 60442 TO BE QUARENTEENED.TAG # 21945 LEFT IN PLACE PENDING RESULTS. TM DROP POSTPONED PENDING RESULTS11/25/98 - 1500VACTOR 60442 IS QUARANTINED IN 3RD AVE YD PENDING RESULTS. TJ - UPDATE - 11/25/98 - 2115HRS - PCB RESULT <1. PPM LAB SEQ #98-13103 ---UPDATE - 11/27/98 - UNIT WAS REMOVED BY EQUIPMENT JR 78448UPDATE 11-30-98 CLEAN UP COMPLETE AS OF 11-25-98 AT 1300HRS DREVITCH TAG REMOVED 21945
Remarks: 5 GALLONS OF OIL AND DEBRIS ARE NOW CONTAINED IN A FLUSH TRUCK.SAMPLE TAKEN FOR FURTHER ANALYSIS. CON ED #121521
Material:
Site ID: 195295
Operable Unit ID: 1068170
Operable Unit: 01
Material ID: 314660
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 4338 (Continued)

S103574776

Quantity: 5
Units: Gallons
Recovered: 5
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9810796
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/25/1998 13:00
Reported to Dept Date/Time: 11/25/98 14:06
SWIS: 61
Spiller Name: UNK
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Contact: MIKE CESARE
Spiller Phone: (212) 580-6763
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VAULT 4338 (Continued)

S103574776

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/25/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/30/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 5
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: Not reported

Remark: 5 GALLONS OF OIL AND DEBRIS ARE NOW CONTAINED IN A FLUSH TRUCK. SAMPLE TAKEN FOR FURTHER ANALYSIS. CON ED 121521

AG155
North
1/4-1/2
0.476 mi.
2512 ft.

MANHOLE #61808
AVE V & NOSTRAND AVE
BROOKLYN, NY

NY Spills **S103574710**
NY Hist Spills **N/A**

Site 3 of 3 in cluster AG

Relative:
Higher

SPILLS:

Facility ID: 9810722
DER Facility ID: 162732
Facility Type: ER
Site ID: 213697
DEC Region: 2
Spill Number: 9810722
Spill Date: 11/24/1998
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Date: 8/18/2009
SWIS: 2401
Investigator: JMKRIMGO
Referred To: Not reported
Reported to Dept: 11/24/1998
CID: 252
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Actual:
9 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #61808 (Continued)

S103574710

Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/24/1998
Spill Record Last Update: 8/18/2009
Spiller Name: RICHARD ROACHE
Spiller Company: MANHOLE #61808
Spiller Address: AVE V & NOSTRAND AVE
Spiller City,St,Zip: BROOKLYN, ZZ
Spiller Company: 001
Contact Name: RICHARD ROACHE
Contact Phone: (212) 580-6766
DEC Memo: 08/18/09 - See eDocs for Con Ed report detailing cleanup and closure. Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"E2MIS 121488J.LEONARDI #73722 SENIOR FIELD OPERATOR WHILE IDENTIFYING 3W1W JOINT ON FDR-10B65 REPORTS FINDING ATTACHED TUBING HAD LEAKED APPROX 10 OUNCES OF DIELECTRIC FLUID ONTO FLOOR OF MH. CONTAINED TO STRUCTURE, NO SEWERS OR WATERWAYS AFFECTED. TUBING WAS CRIMPED BUT NOT TIGHT ENOUGH. MR LEONARDI IS GOING TO TRY TO TAKE A SAMPLE FROM IT & RECRIMP TUBING TO STOP LEAK. STOP TAG & 00395 PLACED. SAMPLE MARKED FOR A 4-6 HR TURNAROUND. #12255 VDC. NOTE ; INITIAL REPORT #121486 PLACED INTO QUEENS EDS BY MISTAKE. #12255 . 1220 HRS UPDATE J.LEONARDI UNABLE TO GET AN OIL SAMPLE FROM TUBING HAD TO TAKE SAMPLE FROM FLOOR OF MH, SAMPLE IS A MIX OF OIL & MUD. WILL DO CLEANUP AS 50-499 AS PER FEEDER REP, #12255 VDC.--11/25/98-1335HRS POLITO O.S. U/G REPORTS SPOT CLEANED, TREATED AS 50-499 TAG REMAINS TILL SAMPLE RETURNS --G DONATONE-----1350HRS--MS LIMA CHEMLAB CALLED AND SAID OIL RESULTS WILL BE READY IN 2-HRS AND WILL EXCEED 500PPM UPDATE: 11/25/98 - 1500J. POLITO - O.S. - U.G. REPORTS PCB SOLIDS ONLY ("NO LEAD") BROUGHT BACK TO 3RD AVE YD UNDER 1 TRIP RULE. WILL PUT MATS. IN BARREL IN PCB HOLDING AREA PENDING RESULTS. POLTO REPORTS 2 1/2 FT BY 2 1/2 FT AREA SPOT CLEANED. ENV. OPS. TO GET GRID AND FOLLOW UP WITH OVER 500 PPM CLEANUP AND WIPE SAMPLES AFTER RESULTS ARE POSTED. *LAB RESULT RECEIVED 11/25/98 - 1605. 98-13075. 24248 PPM. TJ - 11/30/98 15:20 hrs Bob Hagerty of Underground reports that at 14:20 hrs he took a pure oil sample directly from leaking joint in MH-61808, as requested by Ron Cosentino. He then sealed tubing and stopped leak. Sample was sent to Chem Lab on a 4-6 hour priority turnaround. UPDATE 11/30/98 - SAMPLE RESULTS RECEIVED <1.0 PPM - LAB SEQUENCE # 98-132012/1/99 - 2/1/99 - GRID RECEIVED FROM R. O'KANE. 9 WIPE SAMPLES TO BE TAKEN. UPDATE: 2/3/99 - 1800K. KAVANAGH - O.S. - ENV. OPS., REPORTS STRUCTURE CLEANED, SUMP SAMPLE TAKEN AND 9 WIPE SAMPLES TAKEN. STAG REMAINS PENDING RESULTS. TJ - 50495 UPDATE 2/5/99 23:36HRS-LAB SEQ 99-01197. 9 WIPE SAMPLES RETURNED. WIPE MARKED FDR: S-1= 14. UGS/100CM2 WIPE MARKED FDR: S-2= 13. UGS/100CM2 WIPE MARKED FDR: S-3= 3. UGS/100CM2 WIPE MARKED FDR: S-4= 4. UGS/100CM2 WIPE MARKED FDR: S-5= 34. UGS/100CM2 WIPE MARKED FDR: S-6= 9. UGS/100CM2 WIPE MARKED FDR: S-7= 7. UGS/100CM2 WIPE MARKED FDR: S-8= 18. UGS/100CM2 WIPE MARKED FDR: S-9= 34. UGS/100CM2 UPDATE 2/8/99-01:45HRS-LAB SEQ# 99-01168-SOIL SAMPLE RESULTS 13. PPM UPDATE: 3/2/99A. HOWELL - O.S. - ENV. OPS., REPORTS STRUCTURE CLEANED AND 5 WIPE SAMPLES TAKEN. WIPE RESULTS RECEIVED 3/6/99 - 2356. 99-02193. ALL 5 WIPES PASSED. UPDATE: 3/8/99G. KERN - 50632 - ENV. OPS., REPORTS SUMP DUG DOWN 1'. SOIL SAMPLE TAKEN. TJ - 50495 UPDATE ***** 3-10-99 5:35HRS LAB SEQ# 99-02420 7.PPMSUMP SAMPLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #61808 (Continued)

S103574710

Remarks: CAME BACK 7 PPM. THIS STRUCTURE IS NOW CLEAN. STAG TO BE REMOVED. TJ
- 50495UPDATE: 3/11/99 - 1300STAG # 00395 REMOVED BY A. HOWELL - O.S.
- ENV. OPS. OVER 500 PPM CLEANUP PAPERWORK RETAINED WITH ENV. OPS.
INCIDENT IS CLOSED.
TUBING LEAK CAUSED SPILL OF APPROX 8 OUNCES TRANSFORMER OIL-CLEANUP
TO BE PERFORMED AS SOON AS SAMPLE RESULTS ARE BACK. CON ED #121486

Material:

Site ID: 213697
Operable Unit ID: 1071738
Operable Unit: 01
Material ID: 314584
Material Code: 0020A
Material Name: TRANSFORMER OIL
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9810722
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/24/1998 10:40
Reported to Dept Date/Time: 11/24/98 11:48
SWIS: 61
Spiller Name: MANHOLE #61808
Spiller Contact: RICHARD ROACHE
Spiller Phone: (212) 580-6766
Spiller Contact: RICHARD ROACHE
Spiller Phone: (212) 580-6766
Spiller Address: AVE V & NOSTRAND AVE
Spiller City,St,Zip: BROOKLYN
Spill Cause: Equipment Failure
Reported to Dept: On Land

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #61808 (Continued)

S103574710

Water Affected: Not reported
Spill Source: 01
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/24/98
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/30/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: TRANSFORMER OIL
Class Type: TRANSFORMER OIL
Times Material Entry In File: 533
CAS Number: Not reported
Last Date: 19940926
DEC Remarks: Not reported
Remark: TUBING LEAK CAUSED SPILL OF APPROX 8 OUNCES TRANSFORMER OIL-CLEANUP TO BE PERFORMED AS SOON AS SAMPLE RESULTS ARE BACK. CON ED 121486

156
ESE
1/4-1/2
0.476 mi.
2513 ft.

DEVILLE MARINA
2771 KNAPP
BROOKLYN, NY

NY Spills S110751111
N/A

Relative:
Higher

SPILLS:
Facility ID: 1009889
DER Facility ID: 398403
Facility Type: ER
Site ID: 443467
DEC Region: 2
Spill Number: 1009889

Actual:
11 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DEVILLE MARINA (Continued)

S110751111

Spill Date: 12/16/2010
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 12/17/2010
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 12/16/2010
CID: Not reported
Water Affected: BAY
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/16/2010
Spill Record Last Update: 12/17/2010
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: UNKNOWN
Contact Phone: Not reported
DEC Memo: duplicate spill. refer to spill #: 1009897.
Remarks: Sheen on the water, caller believes it is from a nearby restuarants

Material:

Site ID: 443467
Operable Unit ID: 1193924
Operable Unit: 01
Material ID: 2189535
Material Code: 0820A
Material Name: COOKING OIL
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DEVILLE MARINA (Continued)

S110751111

Facility ID: 1009897
DER Facility ID: 398412
Facility Type: ER
Site ID: 443475
DEC Region: 2
Spill Number: 1009897
Spill Date: 12/16/2010
Spill Cause: Unknown
Spill Class: Not reported
Spill Closed Date: 1/11/2011
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 12/16/2010
CID: Not reported
Water Affected: SHEEPSHEAD BAY
Spill Source: Commercial/Industrial
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 12/16/2010
Spill Record Last Update: 1/11/2011
Spiller Name: ECO BRASSARD
Spiller Company: ECO ALAN BRASSARD
Spiller Address: 2771 KNAPP ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: ECO BRASSARD
Contact Phone: (718) 979-0610
DEC Memo: 12/17/10-Hiralkumar Patel. spoke with ECO Brassard (at 5:21 PM on 12/16/10). officer mentioned that they have on-going investigation at the site. site has a restaurant and he observed very small amount of substance on water which looks like cooking oil.01/11/11-Hiralkumar Patel. after discussing with DEC Austin, case closed.
Remarks: SMALL AMT LOOKS TO BE COOKING OIL

Material:
Site ID: 443475
Operable Unit ID: 1193932
Operable Unit: 01
Material ID: 2189544
Material Code: 0046A
Material Name: COOKING GREASE
Case No.: Not reported
Material FA: Other
Quantity: 5
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DEVILLE MARINA (Continued)

S110751111

Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

AI157 FRIMAN CLEANERS
West 2901 OCEAN AVE
1/4-1/2 BROOKLYN, NY 11235
0.476 mi.
2515 ft. Site 1 of 4 in cluster AI

RCRA-CESQG 1004760638
FINDS NYR000053959
MANIFEST
NY Spills

Relative:
Higher

RCRA-CESQG:

Date form received by agency: 01/01/2007

Facility name: FRIMAN CLEANERS

Facility address: 2901 OCEAN AVE
BROOKLYN, NY 11235

EPA ID: NYR000053959

Mailing address: OCEAN AVE
BROOKLYN, NY 11235

Contact: YEFIM FRIMAN

Contact address: OCEAN AVE
BROOKLYN, NY 11235

Contact country: US

Contact telephone: (718) 646-5008

Contact email: Not reported

EPA Region: 02

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: FRIMAN

Owner/operator address: 2901 OCEAN AVE
BROOKLYN, NY 11235

Owner/operator country: US

Owner/operator telephone: (718) 646-5008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: FRIMAN
Owner/operator address: 2901 OCEAN AVE
BROOKLYN, NY 11235

Owner/operator country: US
Owner/operator telephone: (718) 646-5008
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: FRIMAN CLEANERS
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 04/21/1998
Facility name: FRIMAN CLEANERS
Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110006816099

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

NY MANIFEST:

EPA ID: NYR000053959
Country: USA
Mailing Name: FRIMAN CLNRS
Mailing Contact: Y FRIMAN
Mailing Address: 2901 OCEAN AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11235
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 718-646-5008

Document ID: NYC6228336
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: NJD071629976
Generator Ship Date: 08/08/2000
Trans1 Recv Date: 08/08/2000
Trans2 Recv Date: 08/11/2000
TSD Site Recv Date: 08/14/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSDF ID: NYGF2859
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC5097475
Manifest Status: Not reported
Trans1 State ID: ILD984908202

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Trans2 State ID: SCR000074591
Generator Ship Date: 01/26/2000
Trans1 Recv Date: 01/26/2000
Trans2 Recv Date: 02/02/2000
TSD Site Recv Date: 02/04/2000
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSD ID: NYGF2859
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2000

Document ID: NYC6984167
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: NJD071629976
Generator Ship Date: 02/20/2003
Trans1 Recv Date: 02/20/2003
Trans2 Recv Date: 02/28/2003
TSD Site Recv Date: 03/03/2003
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSD ID: NY94886JE
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00190
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2003

Document ID: NYC7742406
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: NJD000692061
Generator Ship Date: 02/01/2006
Trans1 Recv Date: 02/01/2006
Trans2 Recv Date: 02/09/2006
TSD Site Recv Date: 02/10/2006
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: NYC584685

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Trans2 EPA ID: Not reported
TSDF ID: OHD980587364
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00193
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2006

Document ID: NYC7210372
Manifest Status: Not reported
Trans1 State ID: NYAT8011
Trans2 State ID: T39K7HNJ
Generator Ship Date: 05/20/2004
Trans1 Recv Date: 05/20/2004
Trans2 Recv Date: 05/28/2004
TSD Site Recv Date: 06/01/2004
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: TXR000050930
Trans2 EPA ID: Not reported
TSDF ID: OHD980587
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2004

Document ID: 06
Manifest Status: NYC7742406
Trans1 State ID: NYR000053959
Trans2 State ID: Not reported
Generator Ship Date: OHD980587364
Trans1 Recv Date: Not reported
Trans2 Recv Date: TXR000050930
TSD Site Recv Date: Not reported
Part A Recv Date: NJD000692061
Part B Recv Date: 2006-02-09
Generator EPA ID: N
Trans1 EPA ID: N
Trans2 EPA ID: N
TSDF ID: N
Waste Code: N
Quantity: Not reported
Units: 1
Number of Containers: DF
Container Type: 193
Handling Method: P
Specific Gravity: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Waste Code: B
Quantity: Not reported
Units: Not reported
Number of Containers: Not reported
Container Type: Not reported
Handling Method: Not reported
Specific Gravity: Not reported
Year: Not reported

Document ID: NYC6349263
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 01/25/2001
Trans1 Recv Date: 01/25/2001
Trans2 Recv Date: 01/30/2001
TSD Site Recv Date: 02/02/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSDF ID: NYGF2859
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2001

Document ID: NYC6561347
Manifest Status: Not reported
Trans1 State ID: SCR000075150
Trans2 State ID: SCR000074591
Generator Ship Date: 09/07/2001
Trans1 Recv Date: 09/07/2001
Trans2 Recv Date: 09/17/2001
TSD Site Recv Date: 09/18/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSDF ID: JE4744NY
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00095
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Document ID: NYC7742406
Manifest Status: Not reported
Trans1 State ID: TXR000050930
Trans2 State ID: NJD000692061
Generator Ship Date: 02/01/2006
Trans1 Recv Date: 02/01/2006
Trans2 Recv Date: 02/09/2006
TSD Site Recv Date: 02/10/2006
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: NYC584685
Trans2 EPA ID: Not reported
TSD ID: OHD980587364
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00193
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 2006

Document ID: NYC5543076
Manifest Status: Not reported
Trans1 State ID: ILD984908202
Trans2 State ID: SCD987574647
Generator Ship Date: 02/19/1999
Trans1 Recv Date: 02/19/1999
Trans2 Recv Date: 02/24/1999
TSD Site Recv Date: 03/03/1999
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000053959
Trans1 EPA ID: OHD980587364
Trans2 EPA ID: Not reported
TSD ID: NYGF2859
Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity: 00195
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00
Year: 99

SPILLS:

Facility ID: 9900345
DER Facility ID: 149032
Facility Type: ER
Site ID: 177364
DEC Region: 2
Spill Number: 9900345
Spill Date: 4/9/1999
Spill Cause: Deliberate
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRIMAN CLEANERS (Continued)

1004760638

Willing Responsible Party. Corrective action taken.
Spill Closed Date: 4/9/1999
SWIS: 2401
Investigator: JXZHAO
Referred To: Not reported
Reported to Dept: 4/9/1999
CID: 270
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/9/1999
Spill Record Last Update: 4/9/1999
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: CALLER
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"ZHAO"REFERRED TO NYCDEP, FAXED TO ECS INDUSTRIAL WASTE.
Remarks: CALLER STATES THAT A COMPANY IS CLEANING A BOILER W/UNKNOWN CHEMICAL
AND IS RUNNING IT TO A STORM SEWER.

Material:
Site ID: 177364
Operable Unit ID: 1079112
Operable Unit: 01
Material ID: 307482
Material Code: 0064A
Material Name: UNKNOWN MATERIAL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

158
NW
1/4-1/2
0.477 mi.
2517 ft.

2302 E 22ND ST
BROOKLYN, NY

LTANKS
HIST LTANKS S105229981
N/A

Relative:
Higher

Actual:
13 ft.

LTANKS:

Site ID: 219436
Spill No: 0106937
Spill Date: 10/3/2001
Spill Cause: Tank Failure
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 3/17/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: SMITH/TIPPLE
Referred To: Not reported
Reported to Dept: 10/4/2001
CID: 257
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/4/2001
Spill Record Last Update: 3/17/2003
Spiller Name: MRS ADLER
Spiller Company: Not reported
Spiller Address: 2302 E 22ND ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller County: 001
Spiller Contact: MRS ADLER
Spiller Phone: (718) 648-5627
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 181470
DEC Memo: Not reported
Remarks: tank is leaking caller wants a call back ASAP

Material:

Site ID: 219436
Operable Unit ID: 845138
Operable Unit: 01
Material ID: 531777
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105229981

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 0106937
Spill Date: 10/03/2001
Spill Time: 10:00
Spill Cause: Tank Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Private Dwelling
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: SMITH/TIPPLE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 10/04/01
Reported to Department Time: 09:49
SWIS: 61
Spiller Contact: MRS ADLER
Spiller Phone: (718) 648-5627
Spiller Extention: Not reported
Spiller Name: Not reported
Spiller Address: 2302 E 22ND ST
Spiller City,St,Zip: BROOKLYN, NY
Spiller Cleanup Date: / /
Facility Contact: MRS ADLER
Facility Phone: (718) 648-5627
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105229981

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/04/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 10/05/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207
DEC Remarks: Not reported
Spill Cause: tank is leaking caller wants a call back ASAP

159
WSW
1/4-1/2
0.477 mi.
2521 ft.

BASEMENT
2965 OCEAN AVE
BROOKLYN, NY

NY Spills S108763843
N/A

Relative:
Higher

SPILLS:

Facility ID: 0705729
DER Facility ID: 335488
Facility Type: ER
Site ID: 386095
DEC Region: 2
Spill Number: 0705729
Spill Date: 8/18/2007
Spill Cause: Human Error
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 8/22/2007
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 8/18/2007
CID: 76
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BASEMENT (Continued)

S108763843

Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 8/18/2007
Spill Record Last Update: 8/22/2007
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: FF MACINTYER
Contact Phone: (347) 203-6886
DEC Memo: 08/20/07-Hiralkumar Patel. visited site on 08/18/07. met Mr. Sriedman, owner's representative and FDNY. as per FDNY, owner was cutting tank and during that time, fire occurred. found 3000 gal tank sitting on floor. found water inside tank and inside basement. no odors inside basement. use stick to check contents inside tank. found muddy water, but no oil. no oil observed on water on basement floor also. no sign of oil spill (stain or rainbow colors on water). as per Mr. Sriedman, tank was out-of-service for about 6 years. site using gas heating system. FDNY was called because of fire that occurred while cutting tank. found that tank was not gas free before cutting it. looks like un-licensed person was working on tank. FDNY didn't issue any violation for such work.Marlon SriedmanPh. (718) 916-504208/22/07-Hiralkumar Patel. spoke with Mr. Sriedman. they have pumped out muddy water from tank and basement. asked him to register existing tank before doing any more work on tank. he will register tank and will consult PBS unit in DEC prior to any more work on tank removal.in absence of any odor or sign of oil spill, case closed.
Remarks: caller reports workers removing fuel tank when spill occurred. spill is a mixture of oil and water. dep#1708031.

Material:
Site ID: 386095
Operable Unit ID: 1143344
Operable Unit: 01
Material ID: 2133621
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BASEMENT (Continued)

S108763843

Last Modified: Not reported
Test Method: Not reported

160
NNW
1/4-1/2
0.477 mi.
2521 ft.

**AVE V BETWEEN
E 29TH ST & NOSTRAND AV
BROOKLYN, NY**

**NY Spills
NY Hist Spills**

**S104195698
N/A**

**Relative:
Higher**

**Actual:
9 ft.**

SPILLS:

Facility ID: 9907818
DER Facility ID: 109024
Facility Type: ER
Site ID: 126068
DEC Region: 2
Spill Number: 9907818
Spill Date: 9/28/1999
Spill Cause: Abandoned Drums
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unknown Responsible Party. Corrective action taken. (ISR)

Spill Closed Date: 11/2/1999
SWIS: 2401
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 9/28/1999
CID: 257
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 9/28/1999
Spill Record Last Update: 11/17/1999
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: NONE
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"SANGESLAND"

Remarks: a 5gal pale of use oil sitting on the side of the road - has been
there about a week*****11/2/99 -- Drum Run -- NOT FOUND*****

Material:

Site ID: 126068
Operable Unit ID: 1082095
Operable Unit: 01
Material ID: 300502
Material Code: 0022
Material Name: Waste Oil/Used Oil
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE V BETWEEN (Continued)

S104195698

Material FA: Petroleum
Quantity: 5
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9907818
Investigator: SANGESLAND
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 09/28/1999 13:00
Reported to Dept Date/Time: 09/28/99 13:20
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: NONE
Spiller Phone: () -
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unknown Responsible Party. Corrective action taken. (ISR)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVE V BETWEEN (Continued)

S104195698

Spill Closed Dt: 11/02/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 09/28/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/17/99
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927
DEC Remarks: Not reported
Remark: a 5gal pale of use oil sitting on the side of the road - has been there about a week *****11/2/99 -- Drum Run -- NOT FOUND*****

161
NNE
1/4-1/2
0.480 mi.
2534 ft.

**BRONX JEWISH BOYS SYNAGOGUE/SCHOOL
2261 BRAGG ST
BROOKLYN, NY**

**NY Spills S109060138
N/A**

**Relative:
Higher**

SPILLS:

**Actual:
10 ft.**

Facility ID: 0712666
DER Facility ID: 343883
Facility Type: ER
Site ID: 394317
DEC Region: 2
Spill Number: 0712666
Spill Date: 3/3/2008
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: hrpatel
Referred To: Not reported
Reported to Dept: 3/3/2008
CID: 408
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 3/3/2008
Spill Record Last Update: 8/17/2012
Spiller Name: RABBI MORDECHAI FRIEDMAN
Spiller Company: BRONX JEWISH BOYS
Spiller Address: 1328 ALLERTON AVENUE
Spiller City,St,Zip: BRONX, NY 10469
Spiller Company: 999
Contact Name: NICK RECCHIA
Contact Phone: (516) 746-4400 12
DEC Memo: Sangesland left voice message with Nick at EEA asking for more information EEA submitted a Phase 2 report on the site. 07/08/08-Vought-File review by Vought: Phase II Environmental Subsurface Investigation (EEA Nick Recchia Ph: 516-746-4400 Fax: 516-746-4432)-2008 (no specific date). Report prepared for: Mr. Anthony Salvati/o Valerie Salvati & Sons Architects 26 Court Street #1804 Brooklyn, NY Ph: (718) 855-4686 Fax: (718) 935-0199 and: Bronx Jewish Boys 2261 Bragg Street Brooklyn, NY 11229 Site composed of two story synagogue and three story school and both buildings "are not in use". Magnetometer survey showed no tanks. Six geoprobe soil borings were performed (two inside building and four outside building). Groundwater at 8-10' bg. Two groundwater samples and six soil samples analyzed. Soil analyticals show: 4200ppb benzene (B12 8-12'), 57000ppb toluene (B12 8-12'), 23000ppb ethylbenzene (B12 8-12'), 85000ppb xylene (B12 8-12'), 530ppb MTBE (B12 8-12'), 56000ppb 1,2,4-trimethylbenzene (B12 8-12' bg), 20000ppb 1,3,5-trimethylbenzene (B12 8-12' bg). Minor PAH exceedences attributable to fill material also present in soil borings throughout site. Groundwater analyticals show: 370ppb benzene (B2-GW), 2800ppb toluene (B2-GW), 380ppb ethylbenzene (B2-GW), 1300ppb xylene (B2-GW), 38ppb naphthalene (B2-GW), 400ppb benzene (B5-GW), 2500ppb toluene (B5-GW), 360ppb ethylbenzene (B5-GW), 1200ppb xylene (B5-GW), 55ppb naphthalene (B5-GW), 91ppb trichlorethene (B5-GW), 86ppb c-1,2 dichlorethene (B5-GW). Report recommends submittal to DEC for comments. DEC requires: 1) delineation of soil and groundwater contamination 2) future plans and possible installation of vapor barrier and SSDS 3) collection of endpoint samples if soil to be excavated 4) surrounding area site plan 5) cc to EEA. 07/09/08-Vought-Called Nick Recchia (EEA) for future plans of site and discussion of above requirements. BSA Hearing coming soon. Fire at property years ago and proposal to add floors however no changes to foundation. 07/11/08-Vought-Sent letter with above requirements and two month due date to above addresses 07/14/08-Vought-Spoke with Valerie and former address incorrect and new letter sent to: Bronx Jewish Boys 2102 Avenue T Brooklyn, NY 11229 6/11/10-Vought-Spill transferred from DEC Vought to DEC Patel as per DEC Austin and Vought transfer to Section A. 08/31/10-Hiralkumar Patel. 4:12 PM:- left message for Nick at EEA. 4:13 PM:- spoke with Mr. Salvati. he asked to contact Rabbi Sam. he mentioned that property is same as in 2008. 4:18 PM:- left message for Rabbi Sam (347-499-4893, 917-216-1728). 09/01/10-Hiralkumar Patel. 11:31 AM:- left message for Rabbi Sam. alternate address: 2261-2269 Bragg Street no PBS record or other spills found at the site. reviewed documents in

S109060138

file*****abstract of Phase II:- site consists of 100 ft by 80 ft lot housing 2-story synagogue building and 3-story school building- no anomalies found during magnetometer survey- total of 6 borings installed: four boring (B-1 through B-4) installed outside of the building and two borings (B-5 and B-6) installed inside synagogue building- soils at the site consisted of brown medium to fine grained sand with top 1 to 8 ft of urban fill material consisting of red bricks, coal ash and cinders- one soil sample collected from each boring: at 4-8 ft in B-1, 2-4 ft in B-2, 8-12 ft in B-3, 12-16 ft in B-4, 4-8 ft in B-5 and 10-12 ft in B-6- groundwater was encountered around 8 to 10 ft bg in all borings <----- groundwater samples collected from borings B-2 and B-5- found soil and groundwater contaminated soil analyticals:-----B-3 8-12 ft Benzene-----4,200 Toluene-----57, 000 Ethylbenzene-----23,000 Xylene-----119, 000 1,2,4-Trimethylbenzene-----56,000 1,3,5-Trimethylbenzene-----20, 000 Naphthalene-----6, 600 MTBE-----530 groundwater analyticals:-----B-2-----B-5 Benzene-----570-----400 Toluene-----2,800-----2, 500 Ethylbenzene-----350-----360 Xylene-----1,850-----1,720 1,2,4-Trimethylbenzene-----370-----330 1,3, 5-Trimethylbenzene-----50-----67 Naphthalene-----3 8-----55 MTBE-----no values recorded in table Trichloroethene-----91 cis-1, 2-Dichloroethene-----86 there is no match between the text and site map regarding sampling locations <-----DEC Vought sent CSL on 07/14/08 to Mr. Salvati (architect) and Bronx Jewish Boys requiring site map with all current/former tank systems and delineation of soil and groundwater contamination via installation of monitoring wells.*****discussed with DEC Vought due to chlorinated compounds in groundwater. Vought spoke with DEC Jane and confirmed that investigation for chlorinated solvents will be done in Jane's section and petroleum investigation will be handled in spills unit.4:03 PM:- left message for Rabbi Sam to return call by end of 09/03/10.4:30 PM:- left message at (718) 646-9368, a number for property at 2102 Ave T, Brooklyn where DEC Vought sent letter in 2008.09/07/10-Hiralkumar Patel.4:00 PM:- went to site. found an abandoned building at the site surrounded by multi-story apartment buildings. one of the neighbour told that building was on fire about 10 years ago. went to school at 2102 Ave T and spoke with Rabbi who refused to give his information and mentioned that they are not connected with the spill site.09/08/10-Hiralkumar Patel. during review of mortgage document on city ACRIS, found address for Bronx Jewish Boys as 1328 Allerton Ave, Bronx. Young Israel of Astor Garden (718-653-1363) is located at 1328 Allerton Ave. Synagogue School Spill No: 07126663/10/2011-Begum-Performed record search- Searched ScoreCard: Top polluters in zip code (ammonia, TCE, MTBE, BTEX).PBS database: No records found CBS Database: No records found NYC Day Care: King Bay Y AfterSchool Annex, 3043 Avenue W, and YMCA Virtually Y P.S 194, 3114 Avenue W. One day care center is two blocks to the east and to the west.EPA Envirofacts Database: No facilities listed in that

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

area. Suspected Gw flow direction found from another spill report of Mobil Exxon (gw flow: northeast) 3/17/2011- Begum- Complete file review by Begum: Phase II Environmental SSI from EEA prepared for Salvati & Son Architects- 4/4/2008-Executive Summary: A magnetometer survey was initiated to identify presence of USTs. No indication of the presence of USTs. Total of six borings were advanced to identify subsurface quality. (B1-B4) were outside the building, while B5 and B6 were inside. GW detected 8-10' bg. Scope of Work: Samples were field screened using organic vapor meter (OVP). One gw sample from boring 2 and 5 were collected. Sample depth varied fm 4-16 ft bg. B1: Soil: 270 ppb benzo (a) anthracene, 240 ppb benzo (a) pyrene, 26 ppb PCEB2: Soil: 11 ppb chromium, 460 ppb lead, 13 ppb mercury Gw: 370 ppb 1,2,4 trimethylbenzene, 50 ppb 1,3,5 trimethylbenzene, 370 ppb benzene, 380 ppb ethylbenzene, 1300 ppb m+p xylene, 29 ppb n-propylbenzene, 38 ppb naphthalene, 550 ppb o-xylene, 2800 ppb toluene, B3: Soil: 56,000 ppb 1,2,4 trimethylbenzene, 20,000 ppb 1,3,5 trimethylbenzene, 4,200 ppb benzene, 23,000 ethyl benzene, 85,000 ppb isopropylbenzene, 85,000 ppb m+p xylene, 10000 ppb n-propylbenzene, 6600 ppb naphthalene, 34000 ppb o xylene, 52000 ppb p-ethyltoluene, 690 ppb p-isopropyltoluene, 1400 sec-butylbenzene, 57000 ppb toluene, 330 ppb benzo (a) anthracene, 320 ppb benzo (a) pyrene, and 400 ppb chrysene, 460 ppb mercury, 13 ppb lead, B4: Soil: 15 ppb Chromium, 0.75 ppb mercury B5: Soil: 12 ppb Chromium Gw: 330 ppb 1,2,4 trimethylbenzene, 67 ppb 1,3,5- trimethylbenzene, 400 ppb benzene, 86 ppb cis 1,2 dichloroethene, 360 ppb ethylbenzene, 1200 ppb m+p-xylene, n-propylbenzene, 55 ppb naphthalene, 520 ppb o-xylene, 350 ppb p-ethyltoluene, 2500 ppb toluene, and 91 ppb trichloroethene B6: Soil: 940 ppb benzo(a) anthracene, 980 ppb benzo(a) pyrene, and 1200 ppb chrysene, 25 ppb cadmium, 36 ppb chromium, 0.25 ppb mercury, Letter from DEC to Bronx Jewish Boys, Mr. Anthony Salvati-07/11/2008- DEC has reviewed Phase II Env SSI, dept requires the following to be submitted two months: Submission of a surrounding area site map and former/current locations of USTs. Delineation of soil and gw contamination via installation of monitoring wells. Same letter was resent 07/14/2008 4/14/11- Begum- Intern Begum and Vought reviewed notes and copied into UIS and spoke with RHWRE and sent info with site plans and summary to DEC Cozzy for assistance in site classification. Initial suggestions by Cozzy were for plume trackdown and Vought to discuss with RHWRE. RHWRE confirmed that site will be a P-Site plume trackdown and Spills Unit will continue with on-site petroleum remediation. Vought informed DEC Patel and DEC Cozzy of same and will have Intern Begum assist in P-Site Memo package. 4/21/2011- Begum- The owner of site as per ACRIS is Bronx Jewish Boys whose address is listed as 1328 Allerton Avenue, Bronx, NY 10469. When address entered into google, the name of Young Israel of Astor Gardens was listed. When site address was entered into google, the name Yeshiva Gedolah Academy was listed. P-Site package prepared by Begum with review by Vought. 4/22/11- Vought- Spoke with RHWRE who noted that PM should wait on transmission of P-Site package until she could address email from DEC Shick regarding the possible installation of upgradient borings by Bronx Jewish Boys. 04/29/11- Hiralkumar Patel. 9:45 AM:- went to site. found a monitoring well in dirt area in front of building, on right side of main entrance. well is located along the side of sidewalk. no success in finding property owner as no change in property since last visit. 05/02/11- Hiralkumar Patel. while searching for Young Israel of Astor Gardens (whose address is same as the subject site's owner), found Ira Tyszler as the president. 10:57 AM:-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

spoke with Mr. Tyszler. he mentioned that the organization Young Israel of Astor Gardens no longer exists and he doesn't know anything about the site. Ira Tyszler Dean of Enrollment Management and Institutional Research Touro College Ph. (212) 463-0400 Ext. 5491 email: tysz@touro.edu from ACRIS, mortgage record: previous property owner: Beth Aaron Synagogue 2901 Ave R Brooklyn, NY found number for Young Israel of Bedford Bay, who is affiliated with Young Israel of Astor Gardens. as per receptionist at Young Israel of Astor Gardens, Young Israel of Bedford Bay is one of their affiliated synagogue, but they Young Israel of Astor Gardens doesn't own or manage the property. she also mentioned that Young Israel of Bedford Bay has two locations: one at 2114 Brown Street and other at 2261 Bragg Street. Young Israel of Bedford Bay Ph. (718) 332-4120 during searching ACRIS record, found Abraham Sorscher as the president of Bronx Jewish Boys. Abraham Sorscher President of Bronx Jewish Boys 2165 Bringham Street Ph. (718) 648-7721 (718) 436-4622 tried Mr. Sorscher's numbers, but not in-service. 11:35 AM:- spoke with Rabbi Sam (347-499-4893 - contact provided by Mr. Salvati). he will find out person-in-charge. he asked to call back tomorrow. 2:22 PM:- spoke with operator at Young Israel of Bedford Bay and she mentioned that they are not involved with 2261 Bragg Street. she asked to call Beth Aaron at 718-646-8646. tried number for Beth Aaron, but number is out-of-service. 5/2/11-Vought-DEC Cozzy sent email dated 4/21 to DEC Mike Komoroske asking if he new of PM to take over Site Characterization/Plume Trackdown. Mike responded that on-site groundwater flow is not determined and he asked if Spills Program could install three permanent wells with two rounds of groundwater samples for Full List VOCs and confirmation of flow direction to confirm CVOC problem before going for a plume trackdown. DEC Cozzy forwarded Komoroske request to RHWRE who forwarded it to DEC Patel. RHWRE instructed Vought to hold on transmission of P-Site package until determination is made if Spills can seek three permanent wells and two rounds of full list groundwater samples. Spills Unit agreed to request three well and two rounds of samples however DEC Patel noted difficulty with finding new owner. RHWRE requested that DEC Patel update Section A in one month and if no installation is performed than P-Site Memo Package may be sent and Site listed as P-Site. 05/03/11-Hiralkumar Patel. 2:32 PM:- left message for Rabbi Sam. 2:46 PM:- spoke with Nick at EEA. he mentioned that the number he had is out-of-service and they are also waiting for their payments. 6/21/11-Vought-DEC Patel to complete search for responsible party. 06/21/11-Hiralkumar Patel. 2:50 PM:- went to 1328 Allerton Ave in Bronx, the address listed for the subject site's owner. its an abandoned building (Young Israel of Astor Gardens) at 1328 Allerton Ave. searched for owner of 1328 Allerton Ave, Bronx and it is owned by City of New York. 06/24/11-Hiralkumar Patel. discussed with DEC Austin. as no RP found, he will talk to Dennis Farrar (Albany) about use of spill fund for investigation. 06/27/11-Hiralkumar Patel. DEC Austin spoke with Dennis Farrar and decided to use spill fund. Austin asked to get cost estimate for required work and talk to DEC Urda regarding property access. 6/29/11-Vought On 6/27, RSE spoke with DEC Farrar noting that responsible party unable to be located and whether Spill Fund monies should be used for a petroleum investigation. RSE requested Spills PM obtain cost estimate for work and consult with OGC regarding property access. PM to discuss with RHWRE issues including possible addition of Full List VOCs to petroleum investigation and preparation of Plume Trackdown Memo. Vought spoke

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

with RHWRE and RHWRE noted that Spills Unit will be determining groundwater flow and analyzing for Full List VOCs as per her prior email to DEC Patel on 5/2. RHWRE also noted to hold transmission of Plume Trackdown memo until results received and interpreted from possible Spills Unit investigation.06/29/11-Hiralkumar Patel.4:03 PM:- sent email to Dave Lothior at Envirotrac requesting cost estimate for following items:- quick Phase I (including Sanborn Maps and site inspection)- Phase II investigation including installation of three monitoring well (during previous investigation, groundwater was found at around 8-10 ft bg), collection of soil samples during well installation, survey of wells to define site-specific groundwater flow direction, collection of water samples and analysis of all soil and groundwater samples via full list VOCs and STARs list SVOCs- report preparationcase referred to DEC legal.07/12/11-Hiralkumar Patel. received cost estimate from Envirotrac (at 4:30 PM on 07/11/11).forwarded cost estimate (from Envirotrac) to DEC Austin. he will talk to DEC Farrar about approval for a PIN job.11/09/11-Hiralkumar Patel.2:00 PM:- met with Matthew Kaufman, Arthur Fisch and Nick Recchia in DEC office with DEC Urda. this meeting was scheduled as settlement conference for a consent order issued earlier to the property owner. Mr. Kaufman and Mr. Fisch are attorneys representing property owner. Mr. Kaufman provided copy of Affidavit of Ownership. as per the affidavit, Abraham Sorcher is the president of Bronx Jewish Boys. during meeting, Mr. Kaufman mentioned that a Phase I work was done in past. asked him to submit copy of Phase I report. Mr. Kaufman will be the point-of-contact for the property owner.based on available information, informed Mr. Kaufman and Mr. Fisch that the Department requires complete delineation of soil and groundwater contamination, both on and off-site, including monitoring wells on-site as well as upgradient and downgradient of the site. Mr. Kaufman mentioned that Phase I will be submitted by 11/16/11.Bronx Jewish Boys **property owner**c/o Abraham SorcherPresident2165 Bringham StreetBrooklyn, NYMatthew A. Kaufman **property owner's attorney**Rimland & Associates225 Broadway, Suite 1606New York, NY 10007Ph. (212) 619-2200Fax (866) 784-1378email: makaufman01@yahoo.comArthur P. Fisch **property owner's attorney**Ph. (718) 237-0603 (917) 991-0615 (C)Fax (718) 852-2509email: afisch8711@aol.com11/16/11-Hiralkumar Patel.11:35 AM:- received email from Nick including copy of Phase I report. abstract:- the subject building was constructed in 1958 for the Beth Aaron Synagogue- an additiona to the structure was built in 1963- Beth Aaron Synagogue occupied the building until circa 2000, at which time a fire occurred and building was vacated- prior to the construction of the subject building, the property was vacant land with no identified on-site uses from at least 1930 to 1958- the 1906 sanborn map shows that the site was part of the Coney Island Jockey Club grounds at that time- a Phase II was performed in Jan. 2006 via installation of total of six soil borings- one soil sample was collected from each boring at depths ranging from between 2 and 16 ft bg- groundwater found at depths ranging from 8 to 10 ft bg- groundwater samples were collected from two of the borings at the site- magnetometer survey was performed during Phase II, but no amomalies found indicative of the presence of USTs- there were not any fill ports, vent lines or other visible indications of the presence of USTs observed during site inspection- no ASTs found during site inspection12/15/11-Hiralkumar Patel1:54 PM:- spoke with Nick. he has sent scope of work to property owner but no response

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

yet.spoke with DEC Urda. he was told by owner's attorney that a signed consent order and penalty will be submitted tomorrow.01/05/12-Hiralkumar Patel.7:32 AM:- received email from DEC Urda. he received a response from owner regarding the consent order. Urda asked not to review/approve any discussion with consultant/owner until they resolve legal matter.03/07/12-Hiralkumar Patel.8:33 AM:- received email from DEC Urda including copy of cross-motion document from owner's attorney. the cross-motion document includes copy of Phase II report prepared by EEA and submitted to DEC in 2008. the Phase II copy of cross-motion is different than what was submitted to DEC in 2008.- Phase II copy in cross-motion is dated Jan. 2006 while previously submitted copy had no date on it- Phase II copy in cross-motion included laboratory data package, pics and boring logs, which were not included in previously submitted copywhile reviewing Phase II copy in cross-motion document, found following additional information:- coal ash/cinder found in all borings- result of groundwater sample from boring B-5 shows findings of 1,200 ppb of PCE; this data was not included in previously submitted copyreviewed Phase I and following sites listed under dry cleaner catagory:2166 Coyle Street2128 Knapp Street3023 Ave Ualso, Phase I has listed multiple sites including historical tanks, leaking tanks and USTs/ASTs. out of this list, two closest sites with gasoline contamination are: 2940 Avenue U and 2975 Avenue U.while reviewing aerial view of the area, found that there are two water bodies closer to the subject site: Marine Park to the east and Plumb Beach Channel to the southeast.04/13/12-Hiralkumar Patel. reviewed the Phase II report and corrected sample locations on the site map, as per the text. based on sampling results, groundwater contamination was found in boring B-2 and B-5 and soil contamination was found in boring B-3. as per affidavit from PW Grosser, regional groundwater flows to the southeast. based on regional groundwater flow direction, borings B-2 and B-5 were located downgradient from the subject site and boring B-3 was located within the building. as per the Phase II report, groundwater was not sampled from borings located upgradient (B-1, B-6 and B-4) from the site. there were soil samples collected from upgradient borings (at 4-8 ft from B-1, 12-16 ft from B-4 and 10-12 ft from B-6), but no contamination found in those samples. so, based on available information, there is no data confirming off-site source.04/25/12-Hiralkumar Patel. signed affidavit in response to cross-motion.05/04/12-Hiralkumar Patel.10:40 AM:- received email from DEC Urda including copy of email from David Yudelson. Mr. Yudelson submitted a report dated 04/26/12, prepared by PAL Environmental Services. abstract:- two borings were installed to 12 ft beneath the water table (site map only shows one boring B-7): one boring was in the northern portion of the chapel and the other in the northern alleyway area- no detections on the PID meter during soil screening- three existing wells were purged of three volumes of water- water samples were collected from two borings and three wells- samples from borings were analyzed for VOCs via STARS 8021- samples from wells were analyzed for BTEX only- no contamination found in any samplethe submitted report is not acceptable for following reasons:- missing scaled site map with correct north arrow and sampling/well locations- as per the report, two borings B-3 and B-7 were installed, but boring B-3 was installed in 2006- missing detailed logs for recently installed two borings- missing detailed installation logs for monitoring wells MW-1, MW-2 and MW-3- missing well development log- requires analysis of samples for 8260 Full List (not only BTEX) as

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

chlorinated compounds were found during earlier investigation.- requires site-specific groundwater flow direction.12:33 PM:- sent email to DEC Urda with above comments regarding the report dated 04/26/12.05/29/12-Hiralkumar Patel.12:45 PM:- received copy of email sent by Mr. Yudelson to DEC Urda. Mr. Yudelson mentioned that Zeb Youngman is preparin a work plan and he will call to discuss the requirements.3:42 PM:- received message from Mr. Youngman.Zeb YoungmanZeb Environmental Solutmions, Inc.PH. (516) 807-6896email: zyoungman@ZEBenvironmental.com05/30/12-Hiralkumar Patel.1:07 PM:- received message from Mr. Youngman.06/01/12-Hiralkumar Patel.4:58 PM:- left message for Mr. Youngman.5:01 PM:- received call from Mr. Youngman inquiring what work needs to be done. informed him the department requires delineation of soil and groundwater contamination and determination of site-specific groundwater flow direction. Mr. Youngman will submit a work plan for review.06/04/12-Hiralkumar Patel.10:18 AM:- received email from Mr. Youngman. while reviewing available documents, he found that at lease 3 monitoring wells were installed at the site. Mr. Youngman aksed if additional wells/borings are required or they use existing wells be resampled and surveyed to obtain gw flow direction.4:18 PM:- sent email to Mr. Youngman. asked him if he has well installation logs to confirm proper installation of those wells. also asked him about soil sampling during well installation.06/05/12-Hiralkumar Patel.1:47 PM:- received email from Mr. Youngman. he does not have well construction logs for three on-site monitoring wells.06/08/12-Hiralkumar Patel.10:29 AM:- spoke with Mr. Youngman and asked him about well construction logs. he mentioned that EEA installed those wells on-site, but never generated a report. EEA is currently looking for field notes and will provide well logs, if available. informed Mr. Youngman that if well logs are not available and/or if wells were not installed properly, then the department requires installation of three additional wells for investigation. Mr. Youngman will talk to property owner and EEA and will send update by this afternoon.06/18/12-Hiralkumar Patel.11:50 AM:- spoke with Mr. Youngman. he hasn't received any response from Mr. Yudelson.11:51 AM:- sent email to DEC Urda with update.08/01/12-Hiralkumar Patel. DEC Urda sent email to Mr. Yudelson and asked for submission of a work plan, including scaled site map with former boring/well locations and proposed well locations, and a work schedule.08/10/12-Hiralkumar Patel.11:55 AM:- received message from Mr. Youngman.08/13/12-Hiralkumar Patel.9:32 AM:- left message for Mr. Youngman.10:32 AM:- received call from Mr. Youngman. as installation logs for existing wells are not available, property owner decided to install three new wells. Mr. Youngman will submit work plan today.08/17/12-Hiralkumar Patel.12:47 PM:- left message for Mr. Youngman, inquiring about work plan.**if no response by 06/22/12, asked to submit work plan.**

Remarks:

CONTAMINATION FOUND DURING A PHASE 2 INVESTIGATION;

Material:

Site ID: 394317
Operable Unit ID: 1151267
Operable Unit: 01
Material ID: 2141965
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRONX JEWISH BOYS SYNAGOGUE/SCHOOL (Continued)

S109060138

Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 394317
Operable Unit ID: 1151267
Operable Unit: 01
Material ID: 2194681
Material Code: 0776A
Material Name: CHLORINATED SOLVENTS
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

AI162 **2885 OCEAN AVE/BROOKLYN**
West **2885 OCEAN AVENUE**
1/4-1/2 **NEW YORK CITY, NY**
0.480 mi.
2536 ft. **Site 2 of 4 in cluster AI**

LTANKS **S100142779**
HIST LTANKS **N/A**

Relative:
Higher

Actual:
11 ft.

LTANKS:
Site ID: 99429
Spill No: 8904459
Spill Date: 8/3/1989
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Spill Closed Dt: 5/2/2000
Facility Addr2: Not reported
Cleanup Ceased: 6/29/1990
Cleanup Meets Standard: True
SWIS: 2401
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 8/4/1989
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2885 OCEAN AVE/BROOKLYN (Continued)

S100142779

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 8/25/1989
Spill Record Last Update: 5/2/2000
Spiller Name: Not reported
Spiller Company: NYTEL
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 88346
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"TIBBE"transferred from sullivanse file
Remarks: 5K TANK FAILED PETRO TITE WITH A GROSS LEAK, WILL POSSIBLY ISOLATE &
RETEST, RETEST PERFORMED ON 6/19/90, TANK PASSED TEST.

Material:

Site ID: 99429
Operable Unit ID: 932080
Operable Unit: 01
Material ID: 448508
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 99429
Spill Tank Test: 1535797
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 8904459
Spill Date: 08/03/1989
Spill Time: 16:40
Spill Cause: Tank Test Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Commercial/Industrial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2885 OCEAN AVE/BROOKLYN (Continued)

S100142779

Spill Class: Not reported
Spill Closed Dt: 05/02/00
Cleanup Ceased: 06/29/90
Cleanup Meets Standard: True
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 08/04/89
Reported to Department Time: 09:35
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
Spiller Name: NYTEL
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 330-8474
Facility Extension: Not reported
Spill Notifier: Tank Tester
PBS Number: 2-344567
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 08/25/89
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 05/02/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

2885 OCEAN AVE/BROOKLYN (Continued)

S100142779

Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: transfered from sullivan se file
Spill Cause: 5K TANK FAILED PETRO TITE WITH A GROSS LEAK, WILL POSSIBLY ISOLATE RETEST, RETEST PERFORMED ON 6/19/90, TANK PASSED TEST.

**163
NNW
1/4-1/2
0.481 mi.
2541 ft.**

**UNKNOWN
2209 EAST 26TH STREET
BROOKLYN, NY**

**NY Spills S107787861
N/A**

**Relative:
Higher**

**Actual:
13 ft.**

SPILLS:

Facility ID: 0601256
DER Facility ID: 313620
Facility Type: ER
Site ID: 363443
DEC Region: 2
Spill Number: 0601256
Spill Date: 5/3/2006
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Date: 5/3/2006
SWIS: 2401
Investigator: HRPATEL
Referred To: Not reported
Reported to Dept: 5/3/2006
CID: 444
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/3/2006
Spill Record Last Update: 5/3/2006
Spiller Name: RICH
Spiller Company: MADDSION OIL
Spiller Address: 2125 MILL AVE
Spiller City,St,Zip: BROOKLYN, NY 001
Contact Name: RICH TURCHIANO
Contact Phone: (718) 444-3400
DEC Memo: 05/03/06-Hiralkumar Patel. Spoke to Rich at Madison Oil. as per him, oil splash out of nozzle as O ring on nozzle was cracked and happened when an operator start delivering oil. operator immediately stopped oil delivery. all cleaned up. case closed.
Remarks: LESS THEN 1/2 GALLON AN O RING BROKE AND IS IN PROCESS OF CLEANING UP AND SPEEDI DRI WAS APPLIED

Material:

Site ID: 363443
Operable Unit ID: 1121497

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UNKNOWN (Continued)

S107787861

Operable Unit: 01
Material ID: 2110994
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

**AJ164
SE
1/4-1/2
0.484 mi.
2558 ft.**

**BRAGE ST & EMMONS AVE
BRAGE ST & EMMONS AVE
BROOKLYN, NY**

**NY Spills
NY Hist Spills**

**S102147874
N/A**

Site 1 of 2 in cluster AJ

**Relative:
Lower**

**Actual:
6 ft.**

SPILLS:

Facility ID: 9314244
DER Facility ID: 99290
Facility Type: ER
Site ID: 113805
DEC Region: 2
Spill Number: 9314244
Spill Date: 3/6/1994
Spill Cause: Abandoned Drums
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/18/1994
SWIS: 2401
Investigator: ADZHITOM
Referred To: Not reported
Reported to Dept: 3/6/1994
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: 3/18/1994
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRAGE ST & EMMONS AVE (Continued)

S102147874

Date Entered In Computer: 3/23/1994
Spill Record Last Update: 3/28/1994
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: ***Update***, ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"ALEX Z."10/10/95: This is additional information about material
spilled from the translation of the old spill file: 1 BARREL (55GAL).
Remarks: CITIZEN FOUND DRUM AND NOTIFIED DEP THEY SENT HAZ MAT TEAM ON THE
SITE.

Material:
Site ID: 113805
Operable Unit ID: 992541
Operable Unit: 01
Material ID: 389580
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Not reported
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:
Region of Spill: 2
Spill Number: 9314244
Investigator: ALEX Z.
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/06/1994 14:50
Reported to Dept Date/Time: 03/06/94 14:55
SWIS: 61
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRAGE ST & EMMONS AVE (Continued)

S102147874

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Abandoned Drums
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Local Agency
PBS Number: Not reported
Cleanup Ceased: 03/18/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/18/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/23/94
Date Spill Entered In Computer Data File: Not reported
Update Date: 03/28/94
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: 10/10/95: This is additional information about material spilled from the translation of the old spill file: 1 BARREL 55GAL).
Remark: CITIZEN FOUND DRUM AND NOTIFIED DEP THEY SENT HAZ MAT TEAM ON THE SITE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AI165
West
1/4-1/2
0.485 mi.
2560 ft.
SATARA REALTY INC
2900 OCEAN AVENUE
BROOKLYN, NY
Site 3 of 4 in cluster AI

LTANKS
NY Spills
NY Hist Spills
S105057382
N/A

Relative:
Higher

Actual:
10 ft.

LTANKS:

Site ID: 197130
Spill No: 9515460
Spill Date: 3/1/1996
Spill Cause: Tank Overfill
Spill Source: Tank Truck
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 2/24/2003
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 3/1/1996
CID: 266
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 3/1/1996
Spill Record Last Update: 2/24/2003
Spiller Name: JANET MATOS
Spiller Company: CASTLE OIL COMPANY
Spiller Address: 290 LOCUST AVENUE
Spiller City,St,Zip: BRONX, NY 10454-
Spiller County: 001
Spiller Contact: JOSE REYAS
Spiller Phone: (718) 332-1506
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 164083
DEC Memo: Not reported
Remarks: DRIVER OVERFILLED TANK. ONTO CONCRETE IN REAR OF BUILDING. CONTAINED.
NEW YORK CITY DEP CONTACTED FOR CLEAN UP.

Material:

Site ID: 197130
Operable Unit ID: 1026565
Operable Unit: 01
Material ID: 355586
Material Code: 0003A
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SATARA REALTY INC (Continued)

S105057382

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

SPILLS:

Facility ID: 0101720
DER Facility ID: 164083
Facility Type: ER
Site ID: 196083
DEC Region: 2
Spill Number: 0101720
Spill Date: 5/14/2001
Spill Cause: Equipment Failure
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 6/19/2001
SWIS: 2401
Investigator: KMFOLEY
Referred To: Not reported
Reported to Dept: 5/15/2001
CID: 216
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 5/15/2001
Spill Record Last Update: 8/31/2001
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ -
Spiller Company: 001
Contact Name: TONY NATALE
Contact Phone: (212) 580-6763
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"FOLEY"CON ED E2MIS REPORT 5-14-01Responding to a (21) MH fire in
MH36824. no fire/smoke was observed upon arrival. Found blown
Primary Joint that looks to be on FDR 10B63. feeder will have to be
verified by FOD. There was approx. 10ozs. of unknown oil on 1500gals.
of water. no oil appears to be coming from the Blown Joint at this
time. Only oil filled equipment in structure is cable. 1 liquid
sample taken. will begin cleanup as 50-499ppm2355hrs.An earthen sump

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SATARA REALTY INC (Continued)

S105057382

Remarks: foun in structure. Incident type will be changed from- spill
deminimus to spill-oil (unknown)LSN 01-05651 <1.0pp0400hrs.Cleanup
completed by double washing structure with slix. 1300gals. of liquid
waste removed by tanker, solids removed by vactor.blown Joint wrapped
by FOD. sump cemented.5-16-01 1415hrs.No sign of burnout or
soot/smell of burnout.
spill in manhole on top of 1500 gallons of water will be picked up
pending results con edison ref # 137076

Material:

Site ID: 196083
Operable Unit ID: 840541
Operable Unit: 01
Material ID: 537425
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 0101720
Investigator: FOLEY
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 05/14/2001 18:15
Reported to Dept Date/Time: 05/15/01 00:52
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: TONY NATALE
Spiller Phone: (212) 580-6763
Spiller Address: Not reported
Spiller City,St,Zip: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SATARA REALTY INC (Continued)

S105057382

Spill Cause: Equipment Failure
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 06/19/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/15/01
Date Spill Entered In Computer Data File: Not reported
Update Date: 08/31/01
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: CON ED E2MIS REPORT 5-14-01 Responding to a 21) MH fire in MH36824. no fire/smoke was observed upon arrival. Found blown Primary Joint that looks to be on FDR 10B63. feeder will have to be verified by FOD. There was approx. 100 s. of unknown oil on 1500gals. of water. no oil appears to be coming from the Blown Joint at this time. Only oil filled equipment in structure is cable. 1 liquid sample taken. will begin cleanup as 50-499ppm 2355hrs. An earthen sump found in structure. Incident type will be changed from- spill de minimus to spill-oil (unknown) LSN 01-05651 <1.0pp 0400hrs. Cleanup completed by double washing structure with slix. 1300gals. of liquid waste removed by tanker, solids removed by vacuor. blown Joint wrapped by FOD. sump cemented. 5-16-01 1415hrs. No sign of burnout or soot/smell of burnout.
Remark: spill in manhole on top of 1500 gallons of water will be picked up pending results con edison ref 137076

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

AI166
West
1/4-1/2
0.485 mi.
2560 ft.

SATARA REALTY INC
2900 OCEAN AVENUE
BROOKLYN, NY
Site 4 of 4 in cluster AI

HIST LTANKS S102673303
N/A

Relative:
Higher

Actual:
10 ft.

HIST LTANKS:

Region of Spill: 2
Spill Number: 9515460
Spill Date: 03/01/1996
Spill Time: 12:47
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Tank Truck
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: / /
Cleanup Ceased: / /
Cleanup Meets Standard: False
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/01/96
Reported to Department Time: 12:58
SWIS: 61
Spiller Contact: JOSE REYAS
Spiller Phone: (718) 332-1506
Spiller Extention: Not reported
Spiller Name: CASTLE OIL COMPANY
Spiller Address: 290 LOCUST AVENUE
Spiller City,St,Zip: BRONX, NY 10454-
Spiller Cleanup Date: / /
Facility Contact: JANET MATOS
Facility Phone: (718) 579-3413
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/01/96
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 03/26/96
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SATARA REALTY INC (Continued)

S102673303

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728

DEC Remarks: Not reported

Spill Cause: DRIVER OVERFILLED TANK. ONTO CONCRETE IN REAR OF BUILDING. CONTAINED. NEW YORK CITY DEP CONTACTED FOR CLEAN UP.

AK167
WSW
1/4-1/2
0.486 mi.
2564 ft.

3025 OCEAN AV / BKLN
3025 OCEAN AVE
BROOKLYN, NY
Site 1 of 5 in cluster AK

AST **U003388805**
HIST AST **N/A**
NY Spills

Relative:
Higher

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-281050
Program Type: PBS
UTM X: 588941.85606000002
UTM Y: 4493476.3356400002
Expiration Date: 2014/04/07

Actual:
11 ft.

Affiliation Records:

Site Id: 12305
Affiliation Type: Mail Contact
Company Name: WENTWORTH PROPERTY MANAGEMENT
Contact Type: Not reported
Contact Name: STEVEN SCHWARTZ
Address1: 3646 NOSTRAND AVENUE
Address2: 4TH FLOOR
City: BROOKLYN
State: NY
Zip Code: 11229
Country Code: 001
Phone: (718) 332-0777
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 2/2/2009

Site Id: 12305
Affiliation Type: On-Site Operator
Company Name: OCEAN RIDGE COOP APTS INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3025 OCEAN AV / BKLN (Continued)

U003388805

Contact Type: Not reported
Contact Name: CARLOS GUERRERO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 648-1718
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 12305
Affiliation Type: Emergency Contact
Company Name: OCEAN RIDGE COOP APTS INC
Contact Type: Not reported
Contact Name: CARLOS GUERRERO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 648-1718
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 12305
Affiliation Type: Owner
Company Name: MARYILYN SCHOENBERGER, PRESIDENT
Contact Type: AGENT
Contact Name: STEVEN SCHWARTZ
Address1: 3025 OCEAN AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 648-1718
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 2/2/2009

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
H00 - Tank Leak Detection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3025 OCEAN AV / BKLN (Continued)

U003388805

I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None
C00 - Pipe Location - No Piping

Tank Info:

Tank Number: 001
Tank Id: 14669
Tank Location: 1
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 06/04/1979
Capacity Gallons: 9000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: MSBAPTIS
Last Modified: 02/02/2009

HIST AST:

PBS Number: 2-281050
SWIS Code: 6101
Operator: CARLOS GUERRERO
Facility Phone: (718) 648-1718
Facility Addr2: 3025 OCEAN AVE
Facility Type: APARTMENT BUILDING
Emergency: CARLOS GUERRERO
Emergency Tel: (718) 648-1718
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: OCEAN RIDGE COOP APTS INC
Owner Address: 3025 OCEAN AVE
Owner City,St,Zip: BROOKLYN, NY 11235
Federal ID: Not reported
Owner Tel: (718) 648-1718
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Contact: MARVIN GOLD MGMT CO, INC
Mailing Name: OCEAN RIDGE COOP APTS INC
Mailing Address: C/O MARVIN GOLD MGMT CO
Mailing Address 2: 2940 AVE X
Mailing City,St,Zip: BROOKLYN, NY 11235
Mailing Telephone: (718) 648-1718
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 08/01/1997
Expiration: 07/14/2002
Renew Flag: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3025 OCEAN AV / BKLN (Continued)

U003388805

Renew Date: Not reported
Total Capacity: 9000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: Not reported
Capacity (Gal): 9000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: None
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Gravity
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

SPILLS:

Facility ID: 8909228
DER Facility ID: 116606
Facility Type: ER
Site ID: 135814
DEC Region: 2
Spill Number: 8909228
Spill Date: 12/20/1989
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 11/6/2001
SWIS: 2401
Investigator: TOMASELLO
Referred To: Not reported
Reported to Dept: 12/20/1989
CID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3025 OCEAN AV / BKLN (Continued)

U003388805

Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: 11/6/2001
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1/3/1990
Spill Record Last Update: 11/6/2001
Spiller Name: Not reported
Spiller Company: MARVIN GOLD MGMT
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: CONTAINED IN TANK RM - VAL HIRED TO CLEAN.

Material:

Site ID: 135814
Operable Unit ID: 934157
Operable Unit: 01
Material ID: 442401
Material Code: 0003A
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AK168
WSW
1/4-1/2
0.486 mi.
2564 ft.
3025 OCEAN AV / BKLN
3025 OCEAN AV
BKLN, NY
Site 2 of 5 in cluster AK

NY Hist Spills
S102142093
N/A

Relative:
Higher

Actual:
11 ft.

NY Hist Spills:

Region of Spill: 2
Spill Number: 8909228
Investigator: TOMASELLO
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 12/20/1989 12:30
Reported to Dept Date/Time: 12/20/89 14:03
SWIS: 61
Spiller Name: MARVIN GOLD MGMT
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 11/06/01
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/06/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 01/03/90
Date Spill Entered In Computer Data File: Not reported
Update Date: 11/06/01
Is Updated: False
Tank:
PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3025 OCEAN AV / BKLN (Continued)

S102142093

Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: #6 FUEL OIL
Class Type: #6 FUEL OIL
Times Material Entry In File: 2190
CAS Number: Not reported
Last Date: 19940728
DEC Remarks: 11/06/01: MF-R9 SPILL 12 YEARS OLD. NO OTHER INFO IN FILE. NO FURTHER ACTION
POSSIBLE*****COMPUTER FILE*****
Remark: CONTAINED IN TANK RM - VAL HIRED TO CLEAN.

AK169
WSW
1/4-1/2
0.487 mi.
2571 ft.

3010 OCEAN AV/BKLYN/AMOCO
3010 OCEAN AVENUE
NEW YORK CITY, NY

LTANKS **S102671373**
HIST LTANKS **N/A**

Site 3 of 5 in cluster AK

Relative:
Higher

LTANKS:

Actual:
11 ft.

Site ID: 304197
Spill No: 8809861
Spill Date: 3/23/1989
Spill Cause: Tank Overfill
Spill Source: Gasoline Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 12/4/1992
Facility Addr2: Not reported
Cleanup Ceased: 12/4/1992
Cleanup Meets Standard: True
SWIS: 2401
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 3/23/1989
CID: Not reported
Water Affected: Not reported
Spill Notifier: Fire Department
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 3/24/1989
Spill Record Last Update: 12/4/1992
Spiller Name: Not reported
Spiller Company: AMOCO GAS TRANSPORTER
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 245765
DEC Memo: Not reported
Remarks: JOHN CASSIDY OF NYC FD HAZ MAT I RESPONDED AND APPLIED SPEEDY DRY.

Material:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3010 OCEAN AV/BKLYN/AMOCO (Continued)

S102671373

Site ID: 304197
Operable Unit ID: 926187
Operable Unit: 01
Material ID: 451034
Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 50
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: 304197
Spill Tank Test: 1535276
Tank Number: Not reported
Tank Size: 0
Test Method: 00
Leak Rate: 0
Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 2
Spill Number: 8809861
Spill Date: 03/23/1989
Spill Time: 01:30
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 12/04/92
Cleanup Ceased: 12/04/92
Cleanup Meets Standard: True
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/23/89
Reported to Department Time: 02:10
SWIS: 61
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3010 OCEAN AV/BKLYN/AMOCO (Continued)

S102671373

Spiller Name: AMOCO GAS TRANSPORTER
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (718) 389-2687
Facility Extension: Not reported
Spill Notifier: Fire Department
PBS Number: 2-277509
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/24/89
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 12/04/92
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 50
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929
DEC Remarks: 03/23/89: 20-30 BAGS OF SPEEDY DRY WERE APPLIED TO SPILL, AMOCO TRANSPORTER
WILL SEND A.A.A. POLLUTION SPECIALISTS TO PICK UP WASTE MATERIAL.
Spill Cause: JOHN CASSIDY OF NYCFD HAZ MAT I RESPONDED AND APPLIED SPEEDY DRY.

AE170
WNW
1/4-1/2
0.487 mi.
2573 ft.

2026 AVE X
BROOKLYN, NY

Site 3 of 3 in cluster AE

LTANKS **S104950643**
HIST LTANKS **N/A**

Relative:
Higher

LTANKS:

Site ID: 185332
Spill No: 0012943
Spill Date: 3/9/2001
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Actual:
14 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104950643

Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 4/10/2001
Facility Addr2: Not reported
Cleanup Ceased: Not reported
Cleanup Meets Standard: True
SWIS: 2401
Investigator: SIGONA
Referred To: Not reported
Reported to Dept: 3/9/2001
CID: 281
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 3/9/2001
Spill Record Last Update: 4/30/2001
Spiller Name: MARY
Spiller Company: EDWARD T MINOR OIL COMPA
Spiller Address: 6205 5TH AVE
Spiller City,St,Zip: BROOKLYN, NY 11220-
Spiller County: 001
Spiller Contact: STEPHANIE LYNCH
Spiller Phone: (508) 795-0110
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 155001
DEC Memo: Not reported
Remarks: DELIVERY MADE TO WRONG ADDRESS AT ABOVE LOCATION. OIL COMPANY ONSCENE
AND TRI STATE ENVIRONMENTAL RESPONDING . MATERIAL SPILLEDINSIDE AND
OUTSIDE RESIDENCE.

Material:

Site ID: 185332
Operable Unit ID: 834486
Operable Unit: 01
Material ID: 539662
Material Code: 0001A
Material Name: #2 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 5
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104950643

Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST LTANKS:

Region of Spill: 2
Spill Number: 0012943
Spill Date: 03/09/2001
Spill Time: 10:00
Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Other Commercial/Industrial
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 04/10/01
Cleanup Ceased: / /
Cleanup Meets Standard: True
Investigator: SIGONA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 03/09/01
Reported to Department Time: 11:27
SWIS: 61
Spiller Contact: STEPHANIE LYNCH
Spiller Phone: (508) 795-0110
Spiller Extention: Not reported
Spiller Name: EDWARD T MINOR OIL COMPA
Spiller Address: 6205 5TH AVE
Spiller City,St,Zip: BROOKLYN, NY 11220-
Spiller Cleanup Date: / /
Facility Contact: MARY
Facility Phone: (718) 439-5066
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False
Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/09/01
Time Spill Entered In Computer Data File: Not reported
Spill Record Last Update: 04/30/01
Is Updated: False

Tank:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S104950643

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 5
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OIL
Class Type: #2 FUEL OIL
Times Material Entry In File: 24464
CAS Number: Not reported
Last Date: 19941207

DEC Remarks: DEC Sigona investigated at 15:00 hours on 3/9/01 found that Tri-State Environmental was already on-site and nearly finished with the cleanup. DEC requested that some absorbant pads be placed into the sump where ther was some free product present. The conscrete was being cleaned with bio-solve and speedy dry. The building is a comercial/residential with Laundry facility and apartement building over the basement area. There was no signifcnat petroleum odors observed, Tri-State to complete the cleanup witin a few hours. DEC Sigona left site at 15:30 hours. DEC Sigona received a report from Response Environmental , dated April 24, 2001.

Spill Cause: DELIVERY MADE TO WRONG ADDRESS AT ABOVE LOCATION. OIL COMPANY ON SCENE AND TRI STATE ENVIRONMENTAL RESPONDING . MATERIAL SPILLED INSIDE AND OUTSIDE RESIDENCE.

AL171
ESE
1/4-1/2
0.488 mi.
2579 ft.

SCHAPPS BROTHERS MARINA
3148 COORHIES AVE
BROOKLYN, NY
Site 1 of 2 in cluster AL

NY Hist Spills S103570021
N/A

Relative:
Lower

NY Hist Spills:
Region of Spill: 2
Spill Number: 9609696
Investigator: TIBBE
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 11/04/1996 08:30
Reported to Dept Date/Time: 11/04/96 09:18
SWIS: 61
Spiller Name: JIM HORAN
Spiller Contact: Not reported
Spiller Phone: (718) 646-3333
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Other
Reported to Dept: Surface Water
Water Affected: SHEEPSHEAD BAY

Actual:
5 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCHAPPS BROTHERS MARINA (Continued)

S103570021

Spill Source: 10
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 11/21/96
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 11/04/96
Date Spill Entered In Computer Data File: Not reported
Update Date: 01/28/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728
Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: MOTOR OIL
Class Type: MOTOR OIL
Times Material Entry In File: 508
CAS Number: Not reported
Last Date: 19940728
Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCHAPPS BROTHERS MARINA (Continued)

S103570021

Material: ANTIFREEZE
Class Type: ANTIFREEZE
Times Material Entry In File: 0
CAS Number: Not reported
Last Date: Not reported
DEC Remarks: ON SCENE - HARDT TIME GETTING OWNER OF VESSEL - OIL BUILDING UP - DIESEL BOAT
SUBMERGED - CG TRYING TO WARN MARINA THAT THEY DON T WANT TO FEDERALIZE THE
CLEAN-UP - 10:30 SPOKE TO MOW. HANDLED BY USCG.
Remark: boat sank at the marina - uscg crew on the way

AL172
ESE
1/4-1/2
0.488 mi.
2579 ft.

3148 VOORHIES AVE
3148 VOORHIES AVE
BROOKLYN, NY
Site 2 of 2 in cluster AL

NY Spills **S104495677**
NY Hist Spills **N/A**

Relative:
Lower

Actual:
5 ft.

SPILLS:
Facility ID: 9315429
DER Facility ID: 242009
Facility Type: ER
Site ID: 299129
DEC Region: 2
Spill Number: 9315429
Spill Date: 3/30/1994
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 3/31/1994
SWIS: 2401
Investigator: CAMMISA
Referred To: Not reported
Reported to Dept: 3/30/1994
CID: Not reported
Water Affected: GERRITSEN CREEK
Spill Source: Vessel
Spill Notifier: Federal Government
Cleanup Ceased: 3/31/1994
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 4/5/1994
Spill Record Last Update: 11/5/2003
Spiller Name: Not reported
Spiller Company: NY 6951 PN - VESSEL
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Not reported
Remarks: NOTIFIED DEP - NATIONAL RESPONSE NOTIFIED - TREE BOATS SEEM TO BE
SINKING AT SITE.

Material:
Site ID: 299129
Operable Unit ID: 993549

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3148 VOORHIES AVE (Continued)

S104495677

Operable Unit: 01
Material ID: 387182
Material Code: 1688A
Material Name: SINKING VESSEL
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 299129
Operable Unit ID: 993549
Operable Unit: 01
Material ID: 387181
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: -1
Units: Pounds
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

Facility ID: 9609696
DER Facility ID: 242009
Facility Type: ER
Site ID: 236274
DEC Region: 2
Spill Number: 9609696
Spill Date: 11/4/1996
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: 11/21/1996
SWIS: 2401
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 11/4/1996
CID: 312
Water Affected: SHEEPSHEAD BAY
Spill Source: Vessel
Spill Notifier: Federal Government

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3148 VOORHIES AVE (Continued)

S104495677

Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 11/4/1996
Spill Record Last Update: 1/28/1998
Spiller Name: Not reported
Spiller Company: JIM HORAN
Spiller Address: Not reported
Spiller City,St,Zip: ZZ
Spiller Company: 001
Contact Name: Not reported
Contact Phone: Not reported
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"TIBBE"ON SCENE - HARDT TIME GETTING OWNER OF VESSEL - OIL BUILDING
UP - DIESEL BOAT SUBMERGED - CG TRYING TO WARN MARINA THAT THEY DON'T
WANT TO FEDERALIZE THE CLEAN-UP - 10:30 SPOKE TO MOW. HANDLED BY USCG.
Not reported
Remarks: boat sank at the marina - uscg crew on the way

Material:

Site ID: 236274
Operable Unit ID: 1041191
Operable Unit: 01
Material ID: 341899
Material Code: 0043A
Material Name: ANTIFREEZE
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 236274
Operable Unit ID: 1041191
Operable Unit: 01
Material ID: 341898
Material Code: 0015
Material Name: Motor Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Site ID: 236274
Operable Unit ID: 1041191
Operable Unit: 01
Material ID: 341897
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3148 VOORHIES AVE (Continued)

S104495677

Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.

NY Hist Spills:

Region of Spill: 2
Spill Number: 9315429
Investigator: CAMMISA
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 03/30/1994 08:50
Reported to Dept Date/Time: 03/30/94 12:00
SWIS: 61
Spiller Name: NY 6951 PN - VESSEL
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Unknown
Reported to Dept: Surface Water
Water Affected: GERRITSEN CREEK
Spill Source: 10
Spill Notifier: Federal Government
PBS Number: Not reported
Cleanup Ceased: 03/31/94
Cleanup Meets Std: True
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/31/94

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3148 VOORHIES AVE (Continued)

S104495677

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/05/94
Date Spill Entered In Computer Data File: Not reported
Update Date: / /
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: -1
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM

Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929
Material Class Type: Hazardous Material
Quantity Spilled: 0
Unkonwn Quantity Spilled: False
Units: Not reported
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: SINKING VESSEL
Class Type: SINKING VESSEL

Times Material Entry In File: 1
CAS Number: Not reported
Last Date: Not reported

DEC Remarks: Not reported

Remark: NOTIFIED DEP - NATIONAL RESPONSE NOTIFIED - TREE BOATS SEEM TO BE SINKING AT SITE.

173
WNW
1/4-1/2
0.491 mi.
2592 ft.

**OCEANIC APARTMENTS
2835 OCEAN AVE
BROOKLYN, NY**

**LTANKS U001831395
HIST UST N/A**

**Relative:
Higher**

LTANKS:

Site ID: 434365
Spill No: 1001320
Spill Date: 5/4/2010
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Facility Addr2: Not reported
Cleanup Ceased: Not reported

**Actual:
14 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OCEANIC APARTMENTS (Continued)

U001831395

Cleanup Meets Standard: False
SWIS: 2401
Investigator: VXBREVD0
Referred To: Not reported
Reported to Dept: 5/4/2010
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
UST Involvement: False
Remediation Phase: 1
Date Entered In Computer: 5/4/2010
Spill Record Last Update: 11/8/2010
Spiller Name: Not reported
Spiller Company: TANK TEST FAILURE
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller County: 999
Spiller Contact: KRISTIN CIABURRI
Spiller Phone: (646) 533-2290
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 389242
DEC Memo: 5/4/2010 - Sangesland spoke to Kristin at ATEC. They tested the tank on Friday and it appeared OK. They came back on Monday to do other work and noticed the tank was 10 inches lower. They pumped out the tank completely and came back the next day and found 4 inches had come back in. 6/3/2010- DEC Piper met ATEC on site to discuss work plan. Tank has been removed and excavation extends to footing of building. There is some soil to be removed thought they are near the structural endpoint. Endpoints will be collected and geoprobe investigation to be performed in area and in basement. ATEC will look into injection thereafter. Work plan requested. 6/7/10- DEC Piper received call from ATEC. Excavation has filled up with oil. I instructed them to begin collecting oil via vac truck. Site meeting scheduled for Tues am. 6/8/10- DEC Piper- I met with Co-op Board member and Atec. ABC Tank was onsite vacating excavation. I recommended installing recovery pits to aid in free product recovery. Once recovery wells are in place, the new tank installation can begin. I requested a work plan for the proposed work. 7/6/10- DEC Piper spoke with ATEC. They have buried 5- 55 gallon drums with holes in it and are recovering approx 80 gal per day. ATEC will send summary of work performed and future plans. 8/19/10- DEC Piper received call from tenant that cover blew off, there is a lot of oil and the vapors are really bad. I spoke with contractor ATEC Kristen, and instructed them to clean and cover immediately. DEC Piper responded to site. 8/26/10 - Austin - Received message and returned call of Marilyn Geller (718-743-4518) regarding continuing odors at site, along with the disruptive activities. I dispatched Veronica Zhune to visit the site ASAP and verify the odor complaint. Veronica will contact Ryan Piper (currently not in office) to have him contact consultant to rectify any problems. - end 8/30/10- DEC Piper performed site visit. A new tarp had been placed down though had not been secured as directed. Oil was observed at base of excavation. Area will be backfill 1-2 feet with gravel and plastic to minimize vapors. Additional excavation below the foundation is not feasible. Product

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OCEANIC APARTMENTS (Continued)

U001831395

Remarks: recovery will continue once per week. 8/31/10 DECPiper recieved product recovery data. Approx 5,000 gal of oil water mixture has been recovered from pit and recovery points. Referred to remediation for long term cleanup.
tank test failure - clean up pending -

Material:

Site ID: 434365
Operable Unit ID: 1185197
Operable Unit: 01
Material ID: 2179497
Material Code: 0003A
Material Name: #6 Fuel Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

HIST UST:

PBS Number: 2-044679
SPDES Number: Not reported
Emergency Contact: ROBERT PALMER OR OPERATOR
Emergency Telephone: (718) 891-9337
Operator: ROMAN RAYKIS
Operator Telephone: (718) 769-4096
Owner Name: OCEANA APARTMENTS
Owner Address: 2123 AVENUE U
Owner City,St,Zip: BROOKLYN, NY 11229
Owner Telephone: (718) 891-3326
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Name: OCEANA APARTMENTS
Mailing Address: 2123 AVENUE U
Mailing Address 2: Not reported
Mailing City,St,Zip: BROOKLYN, NY 11229
Mailing Contact: Not reported
Mailing Telephone: (718) 891-3326
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OCEANIC APARTMENTS (Continued)

U001831395

or not at the facility.
Facility Addr2: 2835 OCEAN AVE
SWIS ID: 6101
Old PBS Number: Not reported
Facility Type: APARTMENT BUILDING
Inspected Date: Not reported
Inspector: Not reported
Inspection Result: Not reported
Federal ID: Not reported
Certification Flag: False
Certification Date: 09/14/2001
Expiration Date: 12/02/2006
Renew Flag: False
Renewal Date: Not reported
Total Capacity: 5000
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City: 01
Region: 2

Tank Id: 001
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
Tank Status: In Service
Install Date: Not reported
Capacity (gals): 5000
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Aboveground/Underground Combination
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Second Containment: Diking
Leak Detection: None
Overfill Prot: Product Level Gauge
Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AK174
WSW
1/4-1/2
0.495 mi.
2612 ft.
3030 OCEAN AVE
3030 OCEAN AVE
BROOKLYN, NY 11235
Site 4 of 5 in cluster AK

AST
HIST AST
NY Spills
U003387957
N/A

Relative:
Higher

AST:

Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-315680
Program Type: PBS
UTM X: 588944.26575000002
UTM Y: 4493462.8969799997
Expiration Date: 2014/08/10

Actual:
12 ft.

Affiliation Records:

Site Id: 14442
Affiliation Type: Mail Contact
Company Name: RIZAR OCEAN AVE, LLC
Contact Type: Not reported
Contact Name: NUSSA
Address1: PO BOX 340816
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11234
Country Code: 001
Phone: (718) 436-2246
Phone Ext: Not reported
Email: RIZAROREALTY@GMAIL.COM
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 7/16/2012

Site Id: 14442
Affiliation Type: On-Site Operator
Company Name: 3030 OCEAN AVE
Contact Type: Not reported
Contact Name: VITALY BELETSKY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (646) 595-6417
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 7/16/2012

Site Id: 14442
Affiliation Type: Emergency Contact
Company Name: RIZAR OCEAN AVE, LLC
Contact Type: Not reported
Contact Name: VITALY BELETSKY
Address1: Not reported
Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 OCEAN AVE (Continued)

U003387957

City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (646) 595-6417
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 7/16/2012

Site Id: 14442
Affiliation Type: Owner
Company Name: RIZARO OCEAN AVE, LLC
Contact Type: MEMBER
Contact Name: ROBERT IZSAK
Address1: 3030 OCEAN AVE, UNIT AA
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11235
Country Code: 001
Phone: (718) 513-3282
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 7/16/2012

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
J02 - Dispenser - Suction
L09 - Piping Leak Detection - Exempt Suction Piping
G03 - Tank Secondary Containment - Vault (w/o access)
C03 - Pipe Location - Aboveground/Underground Combination
F01 - Pipe External Protection - Painted/Asphalt Coating
H00 - Tank Leak Detection - None

Tank Info:

Tank Number: 001
Tank Id: 12888
Tank Location: 1
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/01/1957
Capacity Gallons: 7500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 OCEAN AVE (Continued)

U003387957

Modified By: TRANSLAT
Last Modified: 03/04/2004

HIST AST:

PBS Number: 2-315680
SWIS Code: 6101
Operator: PEDRO NUNEZ
Facility Phone: (718) 796-4220
Facility Addr2: 3030 OCEAN AVE
Facility Type: APARTMENT BUILDING
Emergency: PEDRO NUNEZ
Emergency Tel: (718) 769-4299
Old PBSNO: Not reported
Date Inspected: Not reported
Inspector: Not reported
Result of Inspection: Not reported
Owner Name: ESTATE OF A.J. MARCUS DBA PALAMAS REALTY
Owner Address: 500 MAMARONECK AVE., SUITE 312
Owner City,St,Zip: HARRISON, NY 10528
Federal ID: Not reported
Owner Tel: (914) 670-0700
Owner Type: Corporate/Commercial
Owner Subtype: Not reported
Mailing Contact: J. ERSKINE
Mailing Name: EST. OF A.J. MARCUS DBA
Mailing Address: PALAMAS REALTY
Mailing Address 2: 500 MAMARONECK AVE- SUITE 312
Mailing City,St,Zip: HARRISON, NY 10528
Mailing Telephone: (914) 670-0700
Owner Mark: First Owner
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Certification Flag: False
Certification Date: 09/28/2001
Expiration: 07/10/2002
Renew Flag: False
Renew Date: Not reported
Total Capacity: 7500
FAMT: True
Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: Minor Data Missing
Dead Letter: False
CBS Number: Not reported
Town or City: NEW YORK CITY
County Code: 61
Town or City Code: 01
Region: 2

Tank ID: 001
Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19571201
Capacity (Gal): 7500
Product Stored: NOS 5 OR 6 FUEL OIL
Tank Type: Steel/carbon steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 OCEAN AVE (Continued)

U003387957

Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: STEEL/IRON
Pipe Internal: Not reported
Pipe External: Not reported
Tank Containment: Diking
Leak Detection: 0
Overfill Protection: 4
Dispenser Method: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
SPDES Number: Not reported
Lat/Long: Not reported

SPILLS:

Facility ID: 1201391
DER Facility ID: 418494
Facility Type: ER
Site ID: 464092
DEC Region: 2
Spill Number: 1201391
Spill Date: 5/12/2012
Spill Cause: Equipment Failure
Spill Class: Not reported
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: mxferoze
Referred To: Not reported
Reported to Dept: 5/12/2012
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 5/12/2012
Spill Record Last Update: 5/14/2012
Spiller Name: Not reported
Spiller Company: CONN ED
Spiller Address: Not reported
Spiller City,St,Zip: NY
Spiller Company: 999
Contact Name: ERT
Contact Phone: 212 580 8383
DEC Memo: Not reported
Remarks: Caller advised 1 pint of unknown oil from a continuous leak down a manhole. Clean up is pending.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3030 OCEAN AVE (Continued)

U003387957

Material:

Site ID: 464092
Operable Unit ID: 1214166
Operable Unit: 01
Material ID: 2212192
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

AK175
WSW
1/4-1/2
0.495 mi.
2612 ft.

TEN GALLONS DIESEL IN EXCAVATION
IN FRONT OF 3030 OCEAN AVENUE
BROOKLYN, NY

NY Spills S108982612
N/A

Site 5 of 5 in cluster AK

Relative:
Higher

Actual:
12 ft.

SPILLS:

Facility ID: 0711474
DER Facility ID: 342557
Facility Type: ER
Site ID: 392964
DEC Region: 2
Spill Number: 0711474
Spill Date: 1/31/2008
Spill Cause: Other
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Date: Not Closed
SWIS: 2401
Investigator: vszhune
Referred To: Not reported
Reported to Dept: 1/31/2008
CID: 444
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEN GALLONS DIESEL IN EXCAVATION (Continued)

S108982612

Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 1/31/2008
Spill Record Last Update: 12/22/2010
Spiller Name: ERTSDESK
Spiller Company: NOT CON EDISON
Spiller Address: 3030 OCEAN AVE
Spiller City,St,Zip: BROOKLYN, NY
Spiller Company: 999
Contact Name: ERTSDESK
Contact Phone: (212) 580-8383
DEC Memo: 209737. see eDocsReferred to Spills Group. 2/4/08 - Raphael Ketani. This spill came back to the Spills Unit from DER Unit B of Region 2. It is a third party spill. Con Ed discovered 10 gals. of what they call diesel fuel in the soil at a location where they were digging to install a future vault. The incident number is #209737. It is not known how they determined that 10 gals. of oil had spilled.I contacted the Con Ed ERTSDESK at (212) 580-8383. The person on the line knew nothing about the spill. However, he said he will get back to me with some information and he will send me the latest version of the incident report.The site is a large apartment building at 3030 Ocean Avenue in Brooklyn. The block and lot are 7464 and 22. The owners are CALC, LLC, 223 Wall Street, #224, Huntington, NY, 11743.The site has a 7500 gal. tank that is in service with #6 oil. The registration number is #2-315680. I sent a standard to CALC, LLC. Herman Baker of the Con Ed ERTSDESK called back and said that there were no other updates to the Incident Report. 2/21/08 - Raphael Ketani. Geraldine Marcus (516) 662-4160 called regarding the oil release. She said that she is one of the trustees of the building. She said that the repair work is done. She asked what DEC needed from her. I told her that the owners of the building need to submit manifests for the contaminated soil that was removed, end point sample results, repair bills for the broken pipe and any available pictures. She said she will send the documentation. She said that the repair company was Thermatech Combustion and the contact there is Sammy at his cell (516) 779-6363.Ms. Marcus called me back. She said that Thermatech doesn't do soil investigations. She asked whether I knew of any companies that did this sort of work. I gave her the names and phone numbers of a bunch of companies and told her to try anyone she wants, but that DEC doesn't recommend anyone in particular. She said she will get back to me. 4/8/08 - Raphael Ketani. I tried to contact Ms. Marcus, but could only leave a message.Later, Sam Parrinello of Thermotech called. He asked what DEC wanted in a cleanup report. I told him we wanted the contamination delineation end point results, the soil manifests, and the clean end point results. He said he will hire a company to do the investigation and cleanup. Ms. Marcus called and asked whether Mr. Parrinello had contacted me regarding the investigation and remediation. I told her he had and that I had explained to him what DEC needed in the way of documentation. She asked that I keep her informed as regards what is taking place. I told her I will.4/9/08 - Raphael Ketani. Kevin O'Connor of Action Remediation (516) 781-3000 called to inquire as to what was needed to be done at the site. I told him DEC needed an investigation, delineation, and remediation. He said he will give the customer a price and get on it. 8/19/08 - Raphael Ketani. The case is being prepared for transfer due to a case realignment within the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEN GALLONS DIESEL IN EXCAVATION (Continued)

S108982612

unit. The case manager needs to make followup calls to see what progress has been made in delineating the contamination, removing it, and possibly remediating the soil. DEC is owed an investigation report. 03/21/09- Zhune called Geraldine she said call Sammy 631-844-1515.03/30/09- Zhune spoke to Sammy from Thermotech. he said we only repaired the broken line. We did not do the cleanup. Another company is going to do the cleanup. Call Kevin O'Connor from Action Remediation 12/16/10- Zhune spoke to Kevin. He said I sent the proposal to previuos and new owner and never received any response. New owner- Rizaro Management. Robert(718)513-3283 Ext.101. P.O Box 340816 Brooklyn NY 11234-0816
Remarks: found in soil; CONTRACTOR WILL CLEAN UP. 209737

Material:

Site ID: 392964
Operable Unit ID: 1149941
Operable Unit: 01
Material ID: 2140502
Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 10
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

**AJ176
SE
1/4-1/2
0.499 mi.
2637 ft.**

**MANHOLE #36062
EMMONS AVE & COYLE ST
BROOKLYN, NY
Site 2 of 2 in cluster AJ**

**NY Spills S103828189
NY Hist Spills N/A**

**Relative:
Lower**

SPILLS:

Facility ID: 9813838
DER Facility ID: 101227
Facility Type: ER
Site ID: 116346
DEC Region: 2
Spill Number: 9813838
Spill Date: 2/14/1999
Spill Cause: Unknown
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #36062 (Continued)

S103828189

Spill Closed Date: 2/17/1999
SWIS: 2401
Investigator: CAENGELH
Referred To: Not reported
Reported to Dept: 2/14/1999
CID: 257
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2/14/1999
Spill Record Last Update: 10/21/2002
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN, NY
Spiller Company: 999
Contact Name: JOE DEVOTI
Contact Phone: (212) 580-6763
DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was "ENGELHARDT"DEC Inspector NOTES:2/16/99: ERT Kessler 2/14/99 <1ppm pcb, cleanup complete as of 2/15 bklN queens Underground ops.e2mis no. 123-028:m.brillante#30456 splicer u.g. reports found approximately 1/2 quart unknown oil on 100 gallons of water in mh36062 n/s emmons ave 21' e/o coyle st. --- crew was on location to splice fdr10b63.tried to diaper but could not. no sewers or waterways affected. cannot see if sump in manhole due to amount of water in structure.UPDATE 2/14/99 19:00 MR. HENDRICKS CHEM LAB CALLED WITH OIL RESULTS FOR MH36062 LESS THEN 1 PPM PCB LAB SEQ. 99-01577.UPDATE - 2/15/99 - 1030HRS - C. COTSIFAS, #13827 -FLUSH OPERATOR REPORTS CLEAN UP COMPLETED WITH SLIX AND STOP TAG #189728 REMOVED.
Remarks: sample taking cleanup pending lab results ref #123028 - spill is about 1/2 quart of oil in 100gals of water
Material:
Site ID: 116346
Operable Unit ID: 1074550
Operable Unit: 01
Material ID: 310544
Material Code: 0066A
Material Name: UNKNOWN PETROLEUM
Case No.: Not reported
Material FA: Petroleum
Quantity: 1
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False
Tank Test:
Site ID: Not reported
Spill Tank Test: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #36062 (Continued)

S103828189

Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 2
Spill Number: 9813838
Investigator: ENGELHARDT
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/14/1999 10:00
Reported to Dept Date/Time: 02/14/99 11:05
SWIS: 61
Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: () -
Spiller Contact: JOE DEVOTI
Spiller Phone: (212) 580-6763
Spiller Address: UNKNOWN
Spiller City,St,Zip: UNKNOWN
Spill Cause: Unknown
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 12
Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /
Recommended Penalty: Penalty Not Recommended
Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 02/17/99
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/14/99
Date Spill Entered In Computer Data File: Not reported
Update Date: 06/21/00
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MANHOLE #36062 (Continued)

S103828189

Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: UNKNOWN PETROLEUM
Times Material Entry In File: 16414
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: DEC Inspector NOtes: 2/16/99: ERT Kessler 2/14/99 <1ppm pcb, cleanup complete as of 2/15 bkln queens Underground ops.
Remark: sample taking cleanup pending lab results ref 123028 - spill is about 1/2 quart of oil in 100gals of water

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	1010327348	CONED	E & S BEDFORD AVENUE OF CANTO		RCRA-NonGen, MANIFEST
BROOKLYN	S106721504	SERVICE BOX # 18269	1046TH BERGEN ST & NOSTRAND		NY Spills
BROOKLYN	S102402019	10TH AVE & FLUSHING AVE	10TH AVE & FLUSHING AVE		NY Spills, NY Hist Spills
BROOKLYN	S106703607	1101 AVE R/N Y TEL	1101ST AVE R & NY TEL		LTANKS, HIST LTANKS
BROOKLYN	S104646690		11TH AVENUE NO OF 70TH ST		NY Spills, NY Hist Spills
BROOKLYN	S106008441	NEPTUNE AVE	E 12TH ST		NY Spills
BROOKLYN	S106010622	REGINA PACIS SCHOOL	12TH AVENUE AT 66TH ST		NY Spills
BROOKLYN	S111238512	13TH AVE & 71ST ST	13TH AVE		NY Spills
BROOKLYN	S106968860	MANHOLE # 6210	13TH AVENUE 47TH ST		NY Spills
BROOKLYN	99620261	NORTH 14TH ST. AND KENT AVE	NORTH 14TH ST. AND KENT AVE		ERNS
BROOKLYN	S102148192	14 AVE. & 15TH STREET	14TH AVE & 15TH ST		NY Spills, NY Hist Spills
BROOKLYN	1014397482	CON EDISON - MANHOLE 25229	1757TH EAST 24TH ST & AVENUE	11229	RCRA-LQG
BROOKLYN	S106701812	1780 NOSTRAND & AVE N	1780TH NOSTRAND & AVE N		NY Spills, NY Hist Spills
BROOKLYN	99617157	17TH AVE AND 59TH STREET	17TH AVE AND 59TH STREET		ERNS
BROOKLYN	2008859756	18TH AVE ON THE WEST END LINE	18TH AVE ON THE WEST END LINE		ERNS
BROOKLYN	S104509044	MANHOLE 57741	18TH AVENUE W OF OCEAN PKWY		NY Spills, NY Hist Spills
BROOKLYN	96476186	1ST AVE AND 53RD ST BUILDING 14C	1ST AVE AND 53RD ST BUILDING 1		ERNS
BROOKLYN	S103560388	1ST AVE BET 50 & 51ST STS	1ST AVE		NY Spills, NY Hist Spills
BROOKLYN	2008860349	20TH AVE. STATION	20TH AVE. STATION		ERNS
BROOKLYN	93308352	EAST 22 ST NORTH OF AVE S	EAST 22 ST NORTH OF AVE S		ERNS
BROOKLYN	974086311	22ND STREET & 3RD AVE	22ND ST & 3RD AVE		ERNS
BROOKLYN	99637844	EAST 22ND ST BETWEEN VOORHIES AVE	EAST 22ND ST BETWEEN VOORHIES		ERNS
BROOKLYN	S102143029	22ND & 2ND AVE	22ND ST & 2ND AVE		NY Spills, NY Hist Spills
BROOKLYN	98445584	25TH ST AND 3RD AVE	25TH ST AND 3RD AVE		ERNS
BROOKLYN	94377843	27TH ST AND 2ND AVE	27TH ST AND 2ND AVE		ERNS
BROOKLYN	S104653077	GOWANUS BAY	28TH ST & 1ST AVE		NY Spills, NY Hist Spills
BROOKLYN	S106970645	MANHOLE 66767	28TH STAND 3RD AVE		NY Spills
BROOKLYN	S106469849	MANHOLE # 62806	E 28TH ST		NY Spills
BROOKLYN	S109371236	28 4TH ST BETWEEN SMITH AND HOYT	28TH 4TH SAINT BETWEEN SMITH &		NY Spills
BROOKLYN	S102141373	2934 BRIGHTON AVE & 12TH	2934TH BRIGHTON AVE & 12TH		NY Spills, NY Hist Spills
BROOKLYN	96506868	29TH ST AND 2ND AVE	29TH ST AND 2ND AVE		ERNS
BROOKLYN	S102149934	GOWANUS GAS TURBINE SITE	29TH ST & 240TH AVE		NY Spills, NY Hist Spills
BROOKLYN	S104283577	TS 6002	W 29TH SAINT SURF AVE		NY Spills, NY Hist Spills
BROOKLYN	S106007990	MANHOLE 71777	W 29TH		NY Spills
BROOKLYN	S106469659	MANHOLE #71776	W 29TH ST & NESURF AVE		NY Spills
BROOKLYN	1008195822	CONSOLIDATED EDISON	5993 W 29TH SAINT SURF AVE		RCRA-NonGen, MANIFEST
BROOKLYN	S102142527	E 29TH ST & KINGS HWY	E 29TH ST & KINGS HWY		NY Spills, NY Hist Spills
BROOKLYN	S102149730	2NS AVE & E. 154TH ST	2ND AVE & E 145TH ST		NY Spills, NY Hist Spills
BROOKLYN	S110046940	CONSOLIDATED EDISON MH59268	59268 2ND AVENUE 13TH ST		MANIFEST
BROOKLYN	S106006465	THIRD AVE AND	30TH ST		NY Spills
BROOKLYN	96504865	33RD AND 2ND AVE GOWANUS CANAL	33RD AND 2ND AVE GOWANUS CANAL		ERNS
BROOKLYN	S103273498	CORNER FILLMORE AVE +	34TH ST		NY Spills, NY Hist Spills
BROOKLYN	S102671701	369 KINGSLAND AVE/KRIEGER	369TH KINGSLAND AVE & KRIEGER		LTANKS, HIST LTANKS

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S106698622	BETWEEN 14TH AND 15TH AVE	37TH ST		NY Spills
BROOKLYN	2009898050	3RD AVE AND WYCKOFF ST	3RD AVE AND WYCKOFF ST		ERNS
BROOKLYN	2008898050	3RD AVE AND WYCKOFF ST	3RD AVE AND WYCKOFF ST		ERNS
BROOKLYN	2008877769	3RD ST AND 3RD AVE	3RD ST AND 3RD AVE		ERNS
BROOKLYN	S110750323	221218; THIRD AVE	3RD AVE		NY Spills
BROOKLYN	2006793625	3RD AVE. AND 10TH ST.	3RD AVE. AND 10TH ST.		ERNS
BROOKLYN	S106008280	MANHOLE #66770	3RD AVENUE 51ST ST		NY Spills
BROOKLYN	S110046960	CONSOLIDATED EDISON MH66889	66889 3RD AVENUE 29TH ST		MANIFEST
BROOKLYN	S102141329	4411 13TH AVE/ S. WEISS	4411TH 13TH AVE & S WEISS		NY Spills, NY Hist Spills
BROOKLYN	2007323288	44TH ST AND 3RD AVE	44TH ST AND 3RD AVE		ERNS
BROOKLYN	S110488992	MTA BUS 5285	4TH AVENUE BETWEEN 86TH ST &		NY Spills
BROOKLYN	2008885422	56TH ST AND 15TH AVE	56TH ST AND 15TH AVE		ERNS
BROOKLYN	2004738423	0010 57TH ST - STILLWELL AVE	0010 57TH ST - STILLWELL AVE		ERNS
BROOKLYN	2000538334	58TH STREET AND AVE U	58TH STREET AND AVE U	0	ERNS
BROOKLYN	2008876925	58TH ST. AND 1ST AVE.	58TH ST. AND 1ST AVE.		ERNS
BROOKLYN	S110044197	EAST 5TH ST/ CROSS ST GRRENWOOD AV	E 5TH ST		NY Spills
BROOKLYN	2001561173	5TH AVE AND 6TH STREET	5TH AVE AND 6TH STREET	0	ERNS
BROOKLYN	99636184	5TH AVE AND 66TH ST LEIF ERICSON P	5TH AVE AND 66TH ST LEIF ERICS		ERNS
BROOKLYN	S106006727	MANHOLE 2668	5TH AVENUE NEAR DEAN ST		NY Spills
BROOKLYN	96488043	60TH ST AND 4TH AVE	60TH ST AND 4TH AVE		ERNS
BROOKLYN	96484603	60TH ST AND 4TH AVE	60TH ST AND 4TH AVE		ERNS
BROOKLYN	96509065	MH# 62232/PROSPECT AVE 30FT WEST O	MH# 62232/PROSPECT AVE 30FT WE		ERNS
BROOKLYN	S102143299	62ND STREET 3RD AVE.	62ND STREET 3RD AVE		NY Spills, NY Hist Spills
BROOKLYN	93307597	EAST 64TH AND AVE X	EAST 64TH AND AVE X		ERNS
BROOKLYN	2002618389	64TH STREET AND 3RD AVE	64TH STREET AND 3RD AVE	0	ERNS
BROOKLYN	S102143853	EAST 64TH & AVE. X	E 64TH & AVE X		NY Spills, NY Hist Spills
BROOKLYN	2000522197	EAST 66TH ST. AND AVE W	EAST 66TH ST. AND AVE W	11234	ERNS
BROOKLYN	2009898531	67TH ST AND 5TH AVE	67TH ST AND 5TH AVE		ERNS
BROOKLYN	2008898531	67TH ST AND 5TH AVE	67TH ST AND 5TH AVE		ERNS
BROOKLYN	S102663717	AVE H	E 68TH ST		NY Spills, NY Hist Spills
BROOKLYN	99649722	EAST 68TH STREET AND AVE U	EAST 68TH STREET AND AVE U		ERNS
BROOKLYN	S102147023	EAST 68TH ST & AVE "Y"	E 68TH ST & AVE Y		NY Spills, NY Hist Spills
BROOKLYN	S102240366	69TH ST - AVE.W	69TH SAINT AREA OF AVE W		NY Spills, NY Hist Spills
BROOKLYN	93307596	EAST 69TH AND AVE Y	EAST 69TH AND AVE Y		ERNS
BROOKLYN	2005605934	69TH ST 2ND AVE	69TH ST 2ND AVE		ERNS
BROOKLYN	S109415742	TRANSFORMER	1471 E 69TH SAINT BTWN AVENUE		NY Spills
BROOKLYN	94372754	6TH STREET AND 2ND AVE	6TH STREET AND 2ND AVE		ERNS
BROOKLYN	94390836	6TH STREET ADN 2ND AVE	6TH STREET ADN 2ND AVE		ERNS
BROOKLYN	S111010874	ROADWAY	6TH AVENUE BETWEEN 56 AND 57 S		NY Spills
BROOKLYN	S106017607	18 AVE U BETWEEN	E 70TH & E 71ST ST		NY Spills
BROOKLYN	90187796	E. 72ND ST. BETWEEN AVE L AND AVE	E. 72ND ST. BETWEEN AVE L AND		ERNS
BROOKLYN	2004734224	7TH AVE	7TH AVE		ERNS
BROOKLYN	2005617256	7TH AVE	7TH AVE		ERNS
BROOKLYN	S104880520	162 AVE T OFF WEST	7TH ST		NY Spills, NY Hist Spills
BROOKLYN	S104788510	MANHOLE #6574	7TH AVENUE 86TH ST		NY Spills, NY Hist Spills
BROOKLYN	S106469073	MANHOLE 50411	7TH AVENUE 15TH ST		NY Spills
BROOKLYN	S106014264	17TH AVE BETWEEN	80TH & 81ST ST		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S106703592	817 NEPTUNE AVE/ B.U.G.	817TH NEPTUNE AVE & BUG		LTANKS, HIST LTANKS
BROOKLYN	S106000821	FLATLANDS AVE BETWEEN	81ST & 82ND ST		NY Spills
BROOKLYN	S106013103	23RD AVE AND	81ST ST		NY Spills
BROOKLYN	S103273770	8501 FLATLANDS AVE @	E 85TH ST		NY Spills, NY Hist Spills
BROOKLYN	S102961641	86TH ST 19TH AVE & NEW UT	86TH ST & NEW UT		NY Spills, NY Hist Spills
BROOKLYN	S109064521	BELL ATLANTIC-NY	E 94TH ST & BET CLARKSON AVEN		MANIFEST
BROOKLYN	S102239125	E. 9TH ST & AVE D	E 9TH ST & AVE D		NY Spills, NY Hist Spills
BROOKLYN	S106736914	ENTRANCE TO 38TH STREET Y	9TH AVENUE 38TH ST		NY Spills
BROOKLYN	S109064186	METRO	9TH AVENUE 38TH ST		LTANKS
BROOKLYN	S107521854	52-01 18TH AVE	ABONDONED		NY Spills
BROOKLYN	S106007472	3723 18TH AVE	ADJACENT TO ABOVE		NY Spills
BROOKLYN	S106383264	MANHOLE 66351	ALABAMA AVENUE DUMONT AVE		NY Spills
BROOKLYN	2002596753	1143 ALANTIC AVE.	1143 ALANTIC AVE.	0	ERNS
BROOKLYN	S110750530	221503; ALBANY AVE	ALBANY AVE		NY Spills
BROOKLYN	89121333	712 AND 716 AVE M	712 AND 716 AVE M		ERNS
BROOKLYN	S104509879	NASSAU AVE AT	APPOLLO ST		NY Spills, NY Hist Spills
BROOKLYN	S105056950	RT278 AT ATLANTIC AVE	RT278 AT ATLANTIC AVE		NY Spills, NY Hist Spills
BROOKLYN	99630107	ATLANTIC AVE	ATLANTIC AVE		ERNS
BROOKLYN	S110750350	222188; ATLANTIC AVE	ATLANTIC AVE		NY Spills
BROOKLYN	S110750333	221578; ATLANTIC AVE	ATLANTIC AVE		NY Spills
BROOKLYN	S110750314	220407; ATLANTIC AVE	ATLANTIC AVE		NY Spills
BROOKLYN	S111011389	EUCLID AVE SUB STATION	ATLANTIC AND EUCLID AVE		NY Spills
BROOKLYN	2006790412	ATLANTIC AVE	ATLANTIC AVE		ERNS
BROOKLYN	S103573810	SCHENECTADY AVE AND	ATLANTIC AVE		NY Spills, NY Hist Spills
BROOKLYN	S103937396	BROOKLYN AVE &	ATLANTIC AVE		NY Spills, NY Hist Spills
BROOKLYN	S103573811	MANHOLE #3703	ATLANTIC AVENUE OF CRES E		NY Spills, NY Hist Spills
BROOKLYN	S102560247	AVE A/SHEEPSHEAD BAY RD	AVE A & SHEEPSHEAD BAY RD		NY Spills, NY Hist Spills
BROOKLYN	S110487760	AVE W @ STILLWELL AVE	AVE W & STILLWELL AVE		NY Spills
BROOKLYN	90175028	3718 AVE S	3718 AVE S		ERNS
BROOKLYN	90179068	5423 AVE N	5423 AVE N		ERNS
BROOKLYN	2002599638	AVE K AND E. 18TH ST	AVE K AND E. 18TH ST	0	ERNS
BROOKLYN	1006810224	NYCHA - SHEEPSHEAD NOSTRAND HOUSE	2955 AVE W	11229	RCRA-CESQG, FINDS, MANIFEST
BROOKLYN	S110750448	220773; AVE L	AVE L		NY Spills
BROOKLYN	S106737045	BETW/AVE X &	AVE KINGS HWY		NY Spills
BROOKLYN	S112148363	AVE U/E53RD ST	AVE U & E53RD ST		NY Spills
BROOKLYN	S104789238	17TH AVE /	AVE I		NY Spills, NY Hist Spills
BROOKLYN	S104654003	FLATBUSH AVE AND	AVE N & 2100 FLATBUSH AVE		NY Spills, NY Hist Spills
BROOKLYN	S102141454	AVE Z BET E 21ST & E 22ND	AVE ZBET 21ST E & E 22ND		NY Spills, NY Hist Spills
BROOKLYN	S111158497	MANHOLE @ AVE I WEST OF MCDONALD A	AVE I		NY Spills
BROOKLYN	S105055981		AVE S & NOSTRAND AVE	11229	NY Spills, NY Hist Spills
BROOKLYN	S104653517	EASTERN PKWY SERVICE RD	NY AVE & NOSTRAND AVE		NY Spills, NY Hist Spills
BROOKLYN	1008195808	CONSOLIDATED EDISON	MH54788 AVE I & NOSTRAND AVE		RCRA-NonGen, MANIFEST
BROOKLYN	1008195596	CONSOLIDATED EDISON	MH24788 AVE I & NOSTRAND AVE		RCRA-NonGen, MANIFEST
BROOKLYN	S109321243	CONSOLIDATED EDISON	AVE J & E 28TH ST MH61493		MANIFEST
BROOKLYN	S109584454	CONSOLIDATED EDISON MH62806	MH62806 AVE M & E 28TH ST		MANIFEST
BROOKLYN	S102148511	AVE F & MC DONALD ST	AVENUE F MC DONALD ST		NY Spills, NY Hist Spills
BROOKLYN	1010030146	MILL BASIN AREA, AVE. N AND ROYCE	AVENUE N	11234	FINDS

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	U004077461	1410 AVE S	1410 AVENUE S	11229	UST
BROOKLYN	S106008231	COONEY ISLAND AVE AT	AVENUE N		NY Spills
BROOKLYN	U001839305	1410 AVE S	1410 AVENUE S	11229	HIST UST
BROOKLYN	S102142994	AVE Z AND KNAPP STREET	AVENUE Z AND KNAPP ST		NY Spills, NY Hist Spills
BROOKLYN	S102146418	AVE V PUMP STATION.	AVENUE V PUMP STA		NY Spills, NY Hist Spills
BROOKLYN	S102146416	AVE P PUMP STATION	AVENUE V PUMP STA		NY Spills, NY Hist Spills
BROOKLYN	S102146393	AVE V. PUMP STATION	AVENUE V PUMP STA		NY Spills, NY Hist Spills
BROOKLYN	S102146610	AVE V PUMP STATION	AVENUE V PUMP STA		NY Spills, NY Hist Spills
BROOKLYN	U001444806	ATLANTIC TOWERS APT CORP.	1213 AVENUE Z	11235	HIST UST, HIST AST
BROOKLYN	S103939251	MANHOLE 6266	AVENUE C E 2ND ST		NY Spills, NY Hist Spills
BROOKLYN	S104652848	MANHOLE 2748	AVENUE CUMBERLAND ST		NY Spills, NY Hist Spills
BROOKLYN	S105236396	MANHOLE 1341	AVENUE P AND OCEAN PKWY		NY Spills, NY Hist Spills
BROOKLYN	1009238748	CONSOLIDATED EDISON	V2361 AVENUE K & 24TH ST		MANIFEST
BROOKLYN	1009238457	CONSOLIDATED EDISON	MH59841 AVENUE J & E 28TH ST		MANIFEST
BROOKLYN	S107408398	MANHOLE #43243	AVENUE NEAR HEYWARD ST		NY Spills
BROOKLYN	S106969841	POLE 35647	AVENUE J AT UTICA AVE		NY Spills
BROOKLYN	S106721398	MANHOLE 68037	FT AVENUE H87 OF 8TH E		NY Spills
BROOKLYN	S106017421	TM 1723	AVENUE J AT NOSTRAND AVE		NY Spills
BROOKLYN	S106010679	EAST 83RD STREET AT	AVENUE SUB STA N		NY Spills
BROOKLYN	S107657370	MANHOLE 64798	AVENUE NEAR PORTLAND AVE		NY Spills
BROOKLYN	S107787393	MANHOLE 66081	AVENUE NEAR AVE		NY Spills
BROOKLYN	S108296922	SARA DRY CLEANING	5813 AVENUE N	11234	MANIFEST, NY Spills
BROOKLYN	S109064468	BELL ATLANTIC-NY	3 AVENUE 53 ST		MANIFEST
BROOKLYN	S109373909	CON ED MANHOLE 64150	20 AVENUE 59 ST		NY Spills
BROOKLYN	S110046603	CONSOLIDATED EDISON	AVENUE NAVY ST		MANIFEST
BROOKLYN	S102663662	MILL BASIN	AVENUE U BET 66TH ST &		NY Spills, NY Hist Spills
BROOKLYN	S107784955	PUBLIC SCHOOL 194	3117 AVENUE W	11229	HIST AST
BROOKLYN	S108466443	ONE QT OIL IN SB 60422	6919 8 AVENUE AT 70TH ST		NY Spills
BROOKLYN	S104652938	MANHOLE 1519	BANNER AVENUE CONEY IS		NY Spills, NY Hist Spills
BROOKLYN	2010953980	10 BAYRIDGE AVE	10 BAYRIDGE AVE		ERNS
BROOKLYN	S102146539	4750 BEDFORD AVE	BEDFORD AVE	11235	NY Spills, NY Hist Spills
BROOKLYN	S107416700	VAULT #VS849	BEDFORD AVENUE OF NASSAU AVE S		NY Spills
BROOKLYN	S107488262	MANHOLE 63199	BEDFORD AVENUE NEAR BEVERLY RD		NY Spills
BROOKLYN	S107787637	MANHOLE 3117	BEDFORD AVENUE NEAR CATON AVE		NY Spills
BROOKLYN	S102146913	BELT PRKWY & KNAPPS AVE	BELT PKWY & KNAPPS AVE		NY Spills, NY Hist Spills
BROOKLYN	S110046138	CONSOLIDATED EDISON	BENSON AVENUE STILLWELL AVE		MANIFEST
BROOKLYN	2004732401	BERGEN AVE, AVE U	BERGEN AVE, AVE U		ERNS
BROOKLYN	2010929420	BERGEN AVE AND L	BERGEN AVE		ERNS
BROOKLYN	S104195810	MANHOLE 71301 PARK AVE	BET N PORTLAND & N ELLIOT		NY Spills, NY Hist Spills
BROOKLYN	S102147863	BET LOUISIANA & MALTA AVE	BET LOUISIANA & MALTA AVE		NY Spills, NY Hist Spills
BROOKLYN	S105057935	KINGSLAND AVE	BETW GREENPOINT & RUSSELL		NY Spills, NY Hist Spills
BROOKLYN	S108130312	MANHOLE#66768 3RD AVE.	BETWE 35TH & 36TH ST		NY Spills
BROOKLYN	S106006327	THIRD AVE	BETWEEN 71ST & ST7		NY Spills
BROOKLYN	S105057933	KINGSLAND AVE	BETWEEN MESEROLE & NASSAU		NY Spills, NY Hist Spills
BROOKLYN	S103936219	FRANKLYN AVE	BETWEEN N14TH & N15TH		NY Spills, NY Hist Spills
BROOKLYN	S104194746	CONNIEISLAND AVE	BEVERLY AVE		NY Spills, NY Hist Spills
BROOKLYN	S106012297	CENTRAL AVE AND	BLEEKER ST		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S104880306	AVE X AT	BOYTON AVE		NY Spills, NY Hist Spills
BROOKLYN	S102149233	BQE- W.BOUND ATLANTIC AVE	BQE WBOUND ATLANTIC AVE		NY Spills, NY Hist Spills
BROOKLYN	S102149254	BQE - ATLANTIC AVE	BQE ATLANTIC AVENUE NR BRG		NY Spills, NY Hist Spills
BROOKLYN	S109060361	BREE AVE AND BRIGGS AVE	BREE AVE & BRIGGS AVE		NY Spills
BROOKLYN	S111011052	GREEN PT. AVE BRIDGE	BRIDGE		NY Spills
BROOKLYN	S106123970	CONEY ISLAND AVE BRIDGE AT SHORE R	BRIDGE AT SHR		LTANKS
BROOKLYN	S110611794	BROOKLYN/QUEENS EXPRESSWAY-ATLANTI	BROOKLYN QUEEN EXPY		NY Spills
BROOKLYN	S103560382	BQE @ HAMILTON AVE EXIT	BROOKLYN QUEENS EXPY & HAMILT		NY Spills, NY Hist Spills
BROOKLYN	94407466	BROOKLYN QUEENS EXPRESS ATLANTIC A	BROOKLYN QUEENS EXPRESS ATLANT	11229	ERNS
BROOKLYN	S106969402	EASTBOUND-HAMILTON AVE EX	BROOKLYN QUEENS EXPY		NY Spills
BROOKLYN	S102141327	BQE-ATLANTIC AVE EXIT	BROOKLYN QUEENS EXPY & ATLANT		NY Spills, NY Hist Spills
BROOKLYN	S111158676	BROOKLYN QUEENS EXPRESSWAY @ BEDFO	BROOKLYN QUEENS EXPY		NY Spills
BROOKLYN	S106698672	PROPERTY(AVE. T & U)	2080 BROWN ST	11229	NY Spills
BROOKLYN	S107416032	MANHOLE # 6895	CARLTON AVENUE NEAR FULTON ST		NY Spills
BROOKLYN	2000671378	CEAN AVE. AT THE WATER	CEAN AVE. AT THE WATER		ERNS
BROOKLYN	2008886766	CHANNEL AVE	CHANNEL AVE		ERNS
BROOKLYN	91216184	CHAUNCEY AVE & STAYVESANT	CHAUNCEY AVE & STAYVESANT		ERNS
BROOKLYN	96498190	CHESTER AVE	CHESTER AVE		ERNS
BROOKLYN	98437805	CHRISTOPHER AND HAGAMAN AVE IN VAC	CHRISTOPHER AND HAGAMAN AVE IN		ERNS
BROOKLYN	2007314234	CHURCH AVE STATION	CHURCH AVE STATION		ERNS
BROOKLYN	96502952	75 CLASSON AVE AND FLUSHING AVE	75 CLASSON AVE AND FLUSHING AV		ERNS
BROOKLYN	2004712100	COLUMBIA AVE	COLUMBIA AVE		ERNS
BROOKLYN	94388169	CON EDISON HUDSON AVE	CON EDISON HUDSON AVE		ERNS
BROOKLYN	876991	CONEY ISLAND CREEK, ON NEPTUNE AVE	CONEY ISLAND CREEK ON NEPTUNE		ERNS
BROOKLYN	S103484280	CRWAFORD AVE OFF	CONEY ISLAND AVE		NY Spills, NY Hist Spills
BROOKLYN	1009244085	CONSOLIDATED EDISON	5995 CONEY ISL AVENUE FRIEL PL		MANIFEST
BROOKLYN	S104510171	BETWEEN AVE S & FIRST CT	COONEY ISLAND AVE		NY Spills, NY Hist Spills
BROOKLYN	96510370	NE CORNER OF HALSEY ST & TOMPKINS	NE CORNER OF HALSEY ST & TOMPK		ERNS
BROOKLYN	98432121	NORTHWEST CORNER OF EAST 34TH ST A	NORTHWEST CORNER OF EAST 34TH		ERNS
BROOKLYN	2003657331	CORNER OF CANAL AVE AND CROPSEY AV	CORNER OF CANAL AVE AND CROPSE		ERNS
BROOKLYN	89114925	CORNER OF EAST 28TH AND FORESTER A	CORNER OF EAST 28TH AND FOREST		ERNS
BROOKLYN	96498392	2968 SW CORNER OF FULTON AND GRAND	2968 SW CORNER OF FULTON AND G		ERNS
BROOKLYN	S109371777	CORNER FORSTER AVE AND EAST 92ND S	CORNER FORSTER AVE & E 92ND S		NY Spills
BROOKLYN	S112140889	CON EDISON	SW CORNER NOSTRAND AVE & BERG		MANIFEST
BROOKLYN	S105056994	FLATBUSH AVE &	CORTLEYOU RD		NY Spills, NY Hist Spills
BROOKLYN	98463809	COWANUS CANAL 29TH STREET AND 2ND	COWANUS CANAL 29TH STREET AND		ERNS
BROOKLYN	2009908325	CREEK AT END OF GARRISON AVE	CREEK AT END OF GARRISON AVE		ERNS
BROOKLYN	2008908325	CREEK AT END OF GARRISON AVE	CREEK AT END OF GARRISON AVE		ERNS
BROOKLYN	974109761	CROPSEY AVE. CORNER OF BAY 54TH ST	CROPSEY AVE. CORNER OF BAY 54T		ERNS
BROOKLYN	974109760	CROPSEY AVE. CORNER OF BAY 54TH ST	CROPSEY AVE. CORNER OF BAY 54T		ERNS
BROOKLYN	S102142711	CROPSEY AVE PATHMARK	CROPSEY AVE		NY Spills, NY Hist Spills
BROOKLYN	S110046200	CONSOLIDATED EDISON	CYPRESS AVE & STATE ST		MANIFEST
BROOKLYN	2000532897	DEKALB AVE	DEKALB AVE	0	ERNS
BROOKLYN	2004742642	DEKALB AVE	DEKALB AVE		ERNS
BROOKLYN	1009243456	CONSOLIDATED EDISON	MH10892 DEKALB AVE & NOSTRAND		MANIFEST
BROOKLYN	1008195611	CONSOLIDATED EDISON	V6207 DEKALB AVE & NOSTRAND A		RCRA-NonGen, MANIFEST
BROOKLYN	S110307352	218198; DITMAS AVE AND E.4ST	DITMAS AVE & E4ST		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S102150981	EAST 88TH ST/DITMAS AVE	DITMAS AVE		NY Spills, NY Hist Spills
BROOKLYN	1009243194	CONSOLIDATED EDISON	DITMAS AVENUE 7 DAHILL RD		MANIFEST
BROOKLYN	S111458021	REGULATOR ON THE STREET	DIVISION AVENUE OF KENT AVE W		NY Spills
BROOKLYN	S109371365	ABANDONED TANKER TRUCK	DUMONT AVENUE BET DREW ST & R		NY Spills
BROOKLYN	S102148923	EASTER AVE & RALPH AVE	EASTER AVE & RALPH AVE		NY Spills, NY Hist Spills
BROOKLYN	S104648412		EASTERN PKWY & NOSTRAND A		NY Spills, NY Hist Spills
BROOKLYN	S104648413		EASTERN PKWY & NOSTRAND A		NY Spills, NY Hist Spills
BROOKLYN	S106001969	MANHOLE 361	EASTERN PKWY & NOSTRAND A		NY Spills
BROOKLYN	S111835561	MANHOLE 1913	EASTSIDE HUDSON AVENUE 35 DEKA		NY Spills
BROOKLYN	S102144461	EDMOND AVE	EDMOND AVE		NY Spills, NY Hist Spills
BROOKLYN	2009906879	3939 EMMENS AVE	3939 EMMENS AVE	11235	ERNS
BROOKLYN	2008906879	3939 EMMENS AVE	3939 EMMENS AVE	11235	ERNS
BROOKLYN	2009918166	EMMONDS AVE AND SHORE BLVD	EMMONDS AVE AND SHORE BLVD		ERNS
BROOKLYN	S109372454	SHEEPS HEAD BAY	EMMONDS AVENUE OCEAN AVE		NY Spills
BROOKLYN	2009918880	EMMONS AVE	EMMONS AVE		ERNS
BROOKLYN	2000525536	EMMONS AVE AND SHORE AVE	EMMONS AVE AND SHORE AVE	0	ERNS
BROOKLYN	93312537	EMMONS AVE AND SHORE BLVD SHEEPS H	EMMONS AVE AND SHORE BLVD SHEE		ERNS
BROOKLYN	93338118	EMMONS AVE AND EAST 29TH STREETS,	EMMONS AVE AND EAST 29TH STREE		ERNS
BROOKLYN	2004734758	EMMONS AVE AND NOSTRAND AVE	EMMONS AVE AND NOSTRAND AVE		ERNS
BROOKLYN	2004733048	EMMONS AVE	EMMONS AVE		ERNS
BROOKLYN	2003704616	EMMONS AVE	EMMONS AVE	11235	ERNS
BROOKLYN	2007323333	EMMONS AVE	EMMONS AVE		ERNS
BROOKLYN	2005625030	EMMONS AVE	EMMONS AVE		ERNS
BROOKLYN	S102141417	EMMONS AVE & SHORE RD	EMMONS AVE & SHORE RD		NY Spills, NY Hist Spills
BROOKLYN	S102146540	EMMOS AVE/ DOOLEY ST	7 EMMOS AVE		NY Spills, NY Hist Spills
BROOKLYN	S102148447	15TH ST & THIRD AVE	EMPTY LOT 15TH ST & 3RD AVE		NY Spills, NY Hist Spills
BROOKLYN	89124792	END OF BERGAN AVE NEXT TO BRIDGE C	END OF BERGAN AVE NEXT TO BRID		ERNS
BROOKLYN	2000535206	END OF OCEAN AVE. AT THE	END OF OCEAN AVE. AT THE	0	ERNS
BROOKLYN	99642507	END OF 4TH AVE AT BAYSIDE AVE	END OF 4TH AVE AT BAYSIDE AVE		ERNS
BROOKLYN	2010948143	END OF GOTHAM AVE	END OF GOTHAM AVE		ERNS
BROOKLYN	S102662590	BQE @ ATLANTIC AVE.	ENTRANCE RAMP BQE & ATLAN		NY Spills, NY Hist Spills
BROOKLYN	S104952654	EUCLID AVE STATION	EUCLID AVE		NY Spills, NY Hist Spills
BROOKLYN	S109371245	DRUM RUN	FILLMORE AVENUE BWT 53RD ST E		NY Spills
BROOKLYN	99607598	NORTH FIRST STREET OIL FARM 214 KE	NORTH FIRST STREET OIL FARM 21		ERNS
BROOKLYN	2010937016	2875 FLATBRUSH AVE.	2875 FLATBRUSH AVE		ERNS
BROOKLYN	2008883211	ON FLATBUSH AVE.	ON FLATBUSH AVE.	11234	ERNS
BROOKLYN	2011964850	FLATBUSH AVE AND ATLANTIC AVE NONE	FLATBUSH AVE AND ATLANTIC AVE		ERNS
BROOKLYN	2010950640	3062 FLAT BUSH AVE.	3062 FLATBUSH AVE	11234	ERNS
BROOKLYN	U003644414	BARREN ISLAND MARINA INC	3260 FLATBUSH AVENUE	11234	HIST UST
BROOKLYN	S105995473	MARINE PARKWAY BRIDGE	FLATBUSH AVENUE MARINE PKWY		LTANKS
BROOKLYN	S106968023	MANHOLE # 59048	FLATBUSH AVENUE CHESTER CT		NY Spills
BROOKLYN	S109584578	LEFFERTS HOMESTEAD	440 FLATBUSH AVENUE PROSPECT P		MANIFEST
BROOKLYN	2005629652	122-66 FLATLANDS AVE	122-66 FLATLANDS AVE		ERNS
BROOKLYN	S103573626	CITYWIDE CESSPOOL COMPANY	FLATLANDS AVE		SWF/LF, NY Spills, NY Hist Spills
BROOKLYN	S103936767	MANHOLE #60386	FLUSHING AVENUE OF NAVY ST E		NY Spills, NY Hist Spills
BROOKLYN	S103937447	MANHOLE3137	FLUSHING AVENUE ELLIOT PL N		NY Spills, NY Hist Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S107416589	FEEDER ACCIDENT - MH 61598	FLUSHING AVENUE NEAR ADELPHI S		NY Spills
BROOKLYN	S102144262	FOOT OF 29 ST. BKLYN/SHEE	FOOT OF 29TH ST		NY Spills, NY Hist Spills
BROOKLYN	S106125613	FORT HAMILTON AVE.	FORT HAMILTON AVE		NY Spills
BROOKLYN	S103828113	WYCKOFF AVE	25 FORT OF STARR E		NY Spills, NY Hist Spills
BROOKLYN	S105057544	VAULT 3606	FOSTER AVENUE NOSTRAND AVE		NY Spills, NY Hist Spills
BROOKLYN	S105141391	FLUSHING AVE	FRANKLIN AVE		NY Spills, NY Hist Spills
BROOKLYN	S104193268	FRANKLIN ST/MANHATTAN AVE	FRANKLIN ST & MANHATTAN AVE		NY Spills, NY Hist Spills
BROOKLYN	S107521229	MANHOLE 4709	FRANKLIN AVENUE NEAR SULLIVAN		NY Spills
BROOKLYN	2005618361	FULTON ST AND PORTLAND AVE	FULTON ST AND PORTLAND AVE		ERNS
BROOKLYN	S110610857	CONSOLIDATED EDISON	FULTON & CLIFF SAINT RIDER AL		MANIFEST
BROOKLYN	S106866819	VAULT 4514	GARDENER AVENUE INGRESHAM ST		NY Spills
BROOKLYN	2000537547	GATES AVE	GATES AVE	0	ERNS
BROOKLYN	S102663597	HUDSON AVE	GENERATOR STA		NY Spills, NY Hist Spills
BROOKLYN	984613731	GEORGIA AVE FULTON ST	GEORGIA AVE FULTON ST		ERNS
BROOKLYN	984613730	GEORGIA AVE FULTON ST	GEORGIA AVE FULTON ST		ERNS
BROOKLYN	1007821076	NYC EDC-GERRITSEN AVE	GERRITSEN AVENUE BET BARTLETT	11229	FINDS
BROOKLYN	S101103178	1782 GLEASON AVE	1782 GLEASON AVE		LTANKS, HIST LTANKS
BROOKLYN	S107408143	WILLIAMS AVE	GLENWOOD RD		NY Spills
BROOKLYN	S110488548	HUDSON AVE STATION	GOLD ST		NY Spills
BROOKLYN	96508009	GOWANAS TURBINE PLANT 29TH ST & 2N	GOWANAS TURBINE PLANT 29TH ST		ERNS
BROOKLYN	S111010927	GOWANUS EXPRESSWAY & 7TH AVE OVERP	GOWANUS EXPY & 7TH AVENUE OPA		NY Spills
BROOKLYN	2003709239	GRAND ST. AND BUSHWICK AVE.	GRAND ST. AND BUSHWICK AVE.		ERNS
BROOKLYN	S110489281	ON ROADWAY PORTER AVE AND VARICK A	GRATTAN ST		NY Spills
BROOKLYN	S109829125	GREENPOINT AVE BRIDGE	GREEN POINT AVE		NY Spills
BROOKLYN	2008882450	GREEN POINT AVE	GREEN POINT AVE		ERNS
BROOKLYN	S108956593	FIVE GAL OIL IN MANHOLE 61269	GREENE AVENUE AT BEDFORD AVE		NY Spills
BROOKLYN	S110046877	CONSOLIDATED EDISON MH2292	2292 GREENE AVENUE PATCHEN AVE		MANIFEST
BROOKLYN	S107408081	KINGSLAND AVE	GREENPOINT AVE		NY Spills
BROOKLYN	S102148344	GREENPOINT AVE	GREENPOINT AVE & MCGUINNES BL		NY Spills, NY Hist Spills
BROOKLYN	S106866834	VAULT 7162	GREENPOINT AVENUE 31 FT W		NY Spills
BROOKLYN	S109063411	ACCIDENT	GREENPOINT AVENUE BRG		NY Spills
BROOKLYN	S106000631	GUIDER AVE, CONEY ISL AV	GUIDER CONEY ISLAND AVE		NY Spills
BROOKLYN	1014399305	NYCDOT BIN 22231370	GUIDER AVENUE RAMP	11235	RCRA-LQG
BROOKLYN	S108956306	HAMILTON AVE BRIDGE	HAMILTON AVE		NY Spills
BROOKLYN	2009913053	HAMILTON AVE	HAMILTON AVE		ERNS
BROOKLYN	2008913053	HAMILTON AVE	HAMILTON AVE		ERNS
BROOKLYN	S102238450	HAMILTON AVE & 6TH AVE	HAMILTON AVE & 6TH AVE		NY Spills, NY Hist Spills
BROOKLYN	S102961717	GOWANUS CANAL	HAMILTON AVENUE BRG		NY Spills, NY Hist Spills
BROOKLYN	S103571533	GOWANUS CANAL	HAMILTON AVENUE BRG		NY Spills, NY Hist Spills
BROOKLYN	S106127367	BACKYARD GARDEN	HAMILTON AVENUE BTWN SMT		NY Spills
BROOKLYN	S108762897	COMPRESSOR SPILL	HAMILTON AVENUE BRG		NY Spills
BROOKLYN	S106969804	MANHOLE #73645	HARRISON AVENUE NEAR BARTLETT		NY Spills
BROOKLYN	S103569009	METROPOLITAN AVE/BTWN	HAVEMEYER ST		NY Spills, NY Hist Spills
BROOKLYN	S106970456	POLE #24483	HEGARMAN AVENUE NEAR ASHFORD S		NY Spills
BROOKLYN	1009241536	CONSOLIDATED EDISON	2679 HEGEMAN AVENUE BRISTOL ST		MANIFEST
BROOKLYN	1009240821	CONSOLIDATED EDISON	TM788 HERKIMER & NOSTRAND AVE		MANIFEST
BROOKLYN	S112140786	CONSOLIDATED EDISON	HINSDALE AVENUE BELMONT AVE		MANIFEST

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	96502167	2750 HOME CREST AVENUE/BETWEEN NEP	2750 HOME CREST AVENUE/BETWEEN	0	ERNS
BROOKLYN	S109415716	-MANHOLE 38185	HOME CREST AVENUE AVE		NY Spills
BROOKLYN	S102144340	HUDSON AVE GEN. STATION	HUDSON AVE		NY Spills, NY Hist Spills
BROOKLYN	S110044787	HUDSON AVE HEAD HOUSE YARD	HUDSON AVE		NY Spills
BROOKLYN	2000516760	HUDSON AVE GENERATING STATION	HUDSON AVE GENERATING STATION		ERNS
BROOKLYN	94356472	HUDSON AVE GENERATING STATION	HUDSON AVE GENERATING STATION		ERNS
BROOKLYN	2004733299	HUDSON AVE STATION	HUDSON AVE STATION		ERNS
BROOKLYN	S110750507	221330; HUDSON AVE	HUDSON AVE		NY Spills
BROOKLYN	S110750322	221108; HUDSON AVE STATION	HUDSON AVENUE STA		NY Spills
BROOKLYN	S107407179	HUDSON AVE	HUDSON AVE		NY Spills
BROOKLYN	S103483425	HUDSON AVE TUNNEL	HUDSON AVENUE TUNL		NY Spills, NY Hist Spills
BROOKLYN	S102143907	HUDSON AVE EAST RIVER	HUDSON AVE EAST RIV		NY Spills, NY Hist Spills
BROOKLYN	S102147384	HUDSON AVE STATION	HUDSON AVENUE STA		NY Spills, NY Hist Spills
BROOKLYN	S102141539	HUDSON AVE & EAST RIVER	HUDSON AVE & EAST RIV		NY Spills, NY Hist Spills
BROOKLYN	S111159203	EAST SIDE OF HUDSON AVE/40 FEET SO	HUDSON AVE		NY Spills
BROOKLYN	S102150508	HUDSON AVENUE ANNEX	HUDSON AVENUE ANX		NY Spills, NY Hist Spills
BROOKLYN	S107788160	COOLANT RELEASE IN MOTOR VEHICLE A	HUDSON AVENUE GENERATING STA		NY Spills
BROOKLYN	S108297370	8 OZ LEAK FROM OVERHEAD CRANE	HUDSON AVENUE GENERATING STA		NY Spills
BROOKLYN	S108295410	81 NORTH ID FAN POLE CHANGER	HUDSON AVENUE GENERATING STA		NY Spills
BROOKLYN	S108295242	LUBE OIL FITTING FAILED # 5 GAS TU	HUDSON AVENUE GEN STA		NY Spills
BROOKLYN	S109060621	SHEEN IN EAST RIVER	HUDSON AVENUE GEN STA		NY Spills
BROOKLYN	S103569507	CON ED	HUDSON AVENUE STA		NY Spills, NY Hist Spills
BROOKLYN	S102446686	METROPLITIAN AVE JUST OFF	INTER BORO PKWY		NY Spills, NY Hist Spills
BROOKLYN	S110140115	INTERSECTION OF MALCOM X BLVD & PU	INTERSECTION OF MALCOM X BLVD		NY Spills
BROOKLYN	98456697	INTERSECTION OF JAMAICA AVE AND BU	INTERSECTION OF JAMAICA AVE AN		ERNS
BROOKLYN	89103151	INTERSECTION OF FLATLANDS AVE, TRO	INTERSECTION OF FLATLANDS AVE,		ERNS
BROOKLYN	S110488657	INTERSECTION OF FLATBUSH AVE AND N	INTERSECTION OF FLATBUSH AVE &		NY Spills
BROOKLYN	2010934306	INTERSECTION OF CLAIRMONT AVE AND	INTERSECTION OF CLAIRMONT AVE		ERNS
BROOKLYN	S102401993	JAMAICA AVE & CYPRESS AVE	JAMAICA AVE & CYPRESS AVE		NY Spills, NY Hist Spills
BROOKLYN	S106002196	MANJHOLE 2441	JAMAICA AVENUE LINCOLN AVE		NY Spills
BROOKLYN	S102144912	JEFFERSON AVE.	JEFFERSON AVE		NY Spills, NY Hist Spills
BROOKLYN	S106968262	MANHOLE #21454	JEFFERSON AVENUE MALCOM X BLVD		NY Spills
BROOKLYN	S112148435	HUDSON AVE EAST SUBSTATION	JOHN AND GOLD ST		NY Spills
BROOKLYN	2010959717	500 WEST KENT AVE	500 W KENT AVE		ERNS
BROOKLYN	S109321231	CONSOLIDATED EDISON	485 KENT AVENUE OFF DIVISION S	11234	MANIFEST
BROOKLYN	S103938400	BOX 38486	KINGS HWY & ROCKAWAY PARK		NY Spills, NY Hist Spills
BROOKLYN	1009235114	BP PRODUCTS OF NORTH AMERICA INC	5001 KINGS HWY		MANIFEST
BROOKLYN	S111011885	TO ROADWAY	KINGS HWY		NY Spills
BROOKLYN	S111011715	ROADWAY	KINGS HIGHWAY AND OCEAN PKWY		NY Spills
BROOKLYN	1007208397	CONSOLIDATED EDISON	MH38210 KINGS HWY & W 7TH ST		RCRA-NonGen, MANIFEST
BROOKLYN	1009234540	NYNEX	KINGS HWY & AVE H		MANIFEST
BROOKLYN	S107407580	KINGS HIGHWAY MOBIL	KINGS HWY		NY Spills
BROOKLYN	2010959134	KINGSTON AVE STATION	KINGSTON AVENUE STA		ERNS
BROOKLYN	S102144170	AVE. V IS NOT VICTORIOUS	KNAPP ST		NY Spills, NY Hist Spills
BROOKLYN	S102149336	MEEKER AVE & KOSCIOSKO BR	KOCIOSKO BRG		NY Spills, NY Hist Spills
BROOKLYN	99607304	LAFAYETTE AVE AND BEDFORD AVE	LAFAYETTE AVE AND BEDFORD AVE		ERNS
BROOKLYN	S102148302	LAFAYETTE AVE	LAFAYETTE AVE		NY Spills, NY Hist Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	2010951731	17 LANCONE CT AND EVERIT AVE	17 LANCONE CT AND EVERIT AVE		ERNS
BROOKLYN	S100560035	108-04 FLAT LANDS AVE	108 LAT LANDS AVE		HIST LTANKS
BROOKLYN	2003641831	469 A LEXINGTON AVE	469 A LEXINGTON AVE		ERNS
BROOKLYN	S104880176	MANHOLE 5265	LIBERTY AVENUE WILLIAMS AVE		NY Spills, NY Hist Spills
BROOKLYN	S106699381	MANHOLE 5143	LIBERTY AVENUE JUNDIST ST		NY Spills
BROOKLYN	S107407305	WILLIAMS AVE	LINDEN BLVD		NY Spills
BROOKLYN	S106469836	MH 62778	E M OF EAST 28TH ST		NY Spills
BROOKLYN	2011966551	MANHATTAN AVE FROST AVE	MANHATTAN AVENUE FROST AVE		ERNS
BROOKLYN	984272531	MANHOLE 65414 AT 1037 LORING AVE	MANHOLE 65414 AT 1037 LORING A		ERNS
BROOKLYN	984272530	MANHOLE 65414 AT 1037 LORING AVE	MANHOLE 65414 AT 1037 LORING A		ERNS
BROOKLYN	99643178	MANHOLE 2889 VANDERBILT AND GATES	MANHOLE 2889 VANDERBILT AND GA		ERNS
BROOKLYN	S103936060	1094 FLUSHING AVE	MANHOLE 7464		NY Spills, NY Hist Spills
BROOKLYN	S102150531	FLUSHING AVE/N. OXFORD	MANHOLE & FLUSHING		NY Spills, NY Hist Spills
BROOKLYN	S110752200	ON THE STREET 580 -574 MAPLE AVE	MAPLE AVE		NY Spills
BROOKLYN	S102141134	MARINE PARK/FLATBUSH AVE	MARINE PARK & FLATBUSH AVE		NY Spills, NY Hist Spills
BROOKLYN	2004725911	ST MARKS AVE	ST MARKS AVE		ERNS
BROOKLYN	S107488495	MANHOLE TM1294	MASPETH AVENUE NEAR MORGAN AVE		NY Spills
BROOKLYN	S106014111	MACDONALD AVE S OF AVE J	MCDONALD AVENUE OF AVE S		NY Spills
BROOKLYN	S104880625	AVE P &	MCDONALD AVE		NY Spills, NY Hist Spills
BROOKLYN	S106009589	MCGUINNES & MESEROLE AVE	MCGUINNES & MESEROLE AVE		NY Spills
BROOKLYN	S109827523	MANHOLE 64805	MEECKER AVENUE A DN FROST ST		NY Spills
BROOKLYN	1000268846	MEEKER AVE	MEEKER AVE		RCRA-NonGen, FINDS, MANIFEST, N Spills, NY Hist Spills
BROOKLYN	S104787824	MEEKER AVE/MCGUINESS BLVD	MEEKER AVE & MCGUINESS BLVD		NY Spills, NY Hist Spills
BROOKLYN	S108650790	CONSOLIDATED EDISON	MEEKER AVENUE 7 6TH ST		MANIFEST
BROOKLYN	S105236781	MANHOLE 36339	MERMAID AVE & S 29TH		NY Spills, NY Hist Spills
BROOKLYN	S107409500	METROPOLITAN AVE BRIDGE	METROPOLITAN AVE		NY Spills
BROOKLYN	S106125308	EAST NEW YORK AVE	MIDWOOD AVE		NY Spills
BROOKLYN	2005621944	MILL AVE AND EAST 63RD	MILL AVE AND EAST 63RD		ERNS
BROOKLYN	S102662541	MILL AVE. / BROOKLYN, NEW	MILL AVE		LTANKS, HIST LTANKS
BROOKLYN	S104510528	0	MILL AVENUE AVE		NY Spills, NY Hist Spills
BROOKLYN	S102671882	378 CONEY ISLAND AVE.'	MOBIL OIL SERVICE STA		LTANKS, HIST LTANKS
BROOKLYN	S107407661	FLATBUSH AVE &	MYRTLE AVE		NY Spills
BROOKLYN	S110750549	221635; MYRTLE AVE	MYRTLE AVE		NY Spills
BROOKLYN	S110750370	219837; MYRTLE AVE	MYRTLE AVE		NY Spills
BROOKLYN	S105057575	MANHOLE 10412	MYRTLE AVENUE TROUTMAN ST		NY Spills, NY Hist Spills
BROOKLYN	S104195520	MANHOLE 1964	MYRTLE AVENUE EDWARD ST		NY Spills, NY Hist Spills
BROOKLYN	S106471157	MANHOLE 63539	MYRTLE AVENUE MALL & EMERSON		NY Spills
BROOKLYN	S109787067	CON EDISON CO OF NYC,INC.	MYRTLE AVENUE OF PALMETTO ST E		MANIFEST
BROOKLYN	S102663610	MCGINNESS AVE BETWEEN	NASSAU AVENUE DRIBBS AVE		NY Spills, NY Hist Spills
BROOKLYN	1007207442	CONSOLIDATED EDISON	NBV632452 W 29TH ST & SURF AV		RCRA-NonGen, MANIFEST
BROOKLYN	S102146757	NEAR CROPSEY AVE BRIDGE	NEAR CROPSEY AVENUE BRG		NY Spills, NY Hist Spills
BROOKLYN	S107788349	MH 6654	NEAR HUDSON AVENUE GEN STA		NY Spills
BROOKLYN	96498747	NEPTUNE AND STILLWELL AVE	NEPTUNE AND STILLWELL AVE		ERNS
BROOKLYN	2003643378	NEPTUNE AVE	NEPTUNE AVE		ERNS
BROOKLYN	2002618392	NEPTUNE AVE	NEPTUNE AVE		ERNS
BROOKLYN	S103274217	STREET BY NYNEX GARAGE	NEPTUNE AVENUE BY 12TH ST		NY Spills, NY Hist Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	2008883104	NEW UTRECHT AVE	NEW UTRECHT AVE		ERNS
BROOKLYN	S106011358	CORNER OF NEW YORK AVE	NEW YORK AVENUE PRESIDENT ST		NY Spills
BROOKLYN	S102560355	NEW YORK AVE	NEW YORK AVE & EASTERN PKWY		NY Spills, NY Hist Spills
BROOKLYN	S109582709	DRUM RUN	NEW LOTS AVENUE LINWOOD ST		NY Spills
BROOKLYN	S106011325	TV 413	NEWARK AVE & NOSTRAND AVE		NY Spills
BROOKLYN	S109374264	DRUM RUN	NEWPORT AVENUE BY POWELL ST		NY Spills
BROOKLYN	S102150600	NEWTON CREEK\MEEKER AVE	NEWTON CREEK\MEEKER		NY Spills, NY Hist Spills
BROOKLYN	90169398	NEWTOWN CREEK MANHATTAN AVE GREEN	NEWTOWN CREEK MANHATTAN AVE GR		ERNS
BROOKLYN	U001839625	3203 NOSTRAND AVE OWNERS CORP.	3203 NOSTRAND AVE	11235	HIST UST
BROOKLYN	S111158886	ROADWAY	NOSTRAND AVE AND LAFAYETTE ST		NY Spills
BROOKLYN	S104789618	VAULT 1578	NOSTRAND AVE & AVE Z	11235	NY Spills, NY Hist Spills
BROOKLYN	1009243557	CONSOLIDATED EDISON	TM1009 NOSTRAND AVE & PARK AV		MANIFEST
BROOKLYN	S106010397	MANHOLE 57023	NOSTRAND AVE & AVE X	11235	NY Spills
BROOKLYN	S106004332		NOSTRAND AVE & SHR PWAY		NY Spills
BROOKLYN	1008195488	CONSOLIDATED EDISON	TM985 NOSTRAND AVE & WILLOUGH		RCRA-NonGen, MANIFEST
BROOKLYN	1008195694	CONSOLIDATED EDISON	MH03623 NOSTRAND & NEWKIRK AV		RCRA-NonGen, MANIFEST
BROOKLYN	S109060614	NYCT	NOSTRAND AVE & SAINT JOHNS P		NY Spills
BROOKLYN	1007205481	BELL ATLANTIC-NY	NOSTRAND AVE BET SULLIVAN PL/	00000	RCRA-NonGen
BROOKLYN	1007205482	BELL ATLANTIC-NY	NOSTRAND AVE BET SULLIVAN PL/	00000	RCRA-NonGen
BROOKLYN	S110306011	CONSOLIDATED EDISON MH58898	MH58898 NOSTRAND AVE & AVE T		MANIFEST
BROOKLYN	S110750520	221422; S NY AVE	S NY AVE		NY Spills
BROOKLYN	S110243591	MANHOLE 65792	E NY & AVENUE REMSEN AVE		NY Spills
BROOKLYN	96502400	OCEAN AVE	OCEAN AVE		ERNS
BROOKLYN	S109063140	823 CLASSON AVE	OCEAN		NY Spills
BROOKLYN	1014813528	NYC DOT-OCEAN AVE PED BRG	OCEAN AVE		FINDS
BROOKLYN	S110750601	222104; OCEAN AVE	OCEAN AVE		NY Spills
BROOKLYN	S110750594	222004; OCEAN AVE	OCEAN AVE		NY Spills
BROOKLYN	S106017323	NORTH SIDE AVE I 129 FEET	E OF EAST 7TH ST		NY Spills
BROOKLYN	S104953494	0 OCEAN AVE 800 FEET	S OF LINCOLN RD		NY Spills, NY Hist Spills
BROOKLYN	99620999	OFF OF EMONS AVE	OFF OF EMONS AVE	11235	ERNS
BROOKLYN	S103936168	BEHIND WHITMAN DR	OHIO STATE WALK & E 66TH ST		NY Spills, NY Hist Spills
BROOKLYN	89114931	OLD ULTRAMIRE FUEL TERMINAL LOCATE	OLD ULTRAMIRE FUEL TERMINAL LO		ERNS
BROOKLYN	S106469921	METROPOLITAN AVE BRIDGE	OVER ENGLISH KILLS CRK		NY Spills
BROOKLYN	S103828796	KATON AVE ON OVERPASS	OVER OCEAN PKWY		NY Spills, NY Hist Spills
BROOKLYN	S102148502	RALPH AVE & FLATLANDS AVE	PADEREGAT PUMP STA		NY Spills, NY Hist Spills
BROOKLYN	96493641	PADICUTT AVE	PADICUTT AVE		ERNS
BROOKLYN	S105057696	SEAVIEW AVE AND	PAERDEGAT AVE		NY Spills, NY Hist Spills
BROOKLYN	S106698239	POLE 67414	PAERDEGAT ST & AVENUE NORTH		NY Spills
BROOKLYN	S102143144	PAIDGE AVE/DUTCH KILLS	PAIDGE AVE & DUTCH KILLS		NY Spills, NY Hist Spills
BROOKLYN	S107407085	VANDEBUILT AVE &	PARK AVE		NY Spills
BROOKLYN	S106004499	MAN HOLE 580	PARK AVENUE OF ELLIOT E		NY Spills
BROOKLYN	S107415807	MANHOLE 31211	PARKSIDE AVENUE NEAR FLATBUSH		NY Spills
BROOKLYN	S108637023	FOUR OZ OIL IN MANHOLE #3083	PARKSIDE AVENUE NEAR OCEAN AVE		NY Spills
BROOKLYN	S102148536	PATTICUT BASIN-BERGEN AVE	PATTICUT BASIN BERGEN AVE		NY Spills, NY Hist Spills
BROOKLYN	93336865	ST PAULS PLACE AT CANTON AVE MANHO	ST PAULS PLACE AT CANTON AVE M		ERNS
BROOKLYN	S102150235	W. SIDE PENNSYLVANIA AVE	W PENNSYLVANIA AVE		NY Spills, NY Hist Spills
BROOKLYN	2008886779	PIER 9 EMMONS AVE	PIER 9 EMMONS AVE		ERNS

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S106471964	21 E PITKIN AVE	21 E PITKIN AVE		LTANKS
BROOKLYN	S102141300	SHORE PKWY OFF 26TH AVE	PKWY OFF 26TH AVE		NY Spills, NY Hist Spills
BROOKLYN	S106001971	MH 4629	E PKWY & NOSTRAND AVE		NY Spills
BROOKLYN	S102146856	SHORE PRKWY - 17TH AVE	PRKWY 17TH AVE		NY Spills, NY Hist Spills
BROOKLYN	S109828411	RALPH AVE AND CLARIDON AVE INTERSE	RALPH AVE & CLARIDON AVE INTE		NY Spills
BROOKLYN	S107409843	RALPH AVE SUB STATION	RALPH AVE		NY Spills
BROOKLYN	S107407296	RALPH AVE SUSSTATION	RALPH AVE		NY Spills
BROOKLYN	S111835641	E NY AVE RALPH AVE	RALPH AVE		NY Spills
BROOKLYN	S103272937	RALPH AVE SUBSTATION	RALPH AVE		NY Spills, NY Hist Spills
BROOKLYN	98457570	REAR OF DYKER HEIGHTS GOLF COURSE	REAR OF DYKER HEIGHTS GOLF COU		ERNS
BROOKLYN	2000551224	REMSEN AVE	REMSEN AVE	0	ERNS
BROOKLYN	S106017571		REMSEN AVENUE NEAR AVE		NY Spills
BROOKLYN	S102663525	592 FRANKLIN AVE	RESIDENTS		LTANKS, HIST LTANKS
BROOKLYN	96492243	EAST RIVER AT HUDSON AVE GENERATIN	EAST RIVER AT HUDSON AVE GENER		ERNS
BROOKLYN	S105141266	ROCKAWAY AVE SUBWAY STA	ROCKAWAY AVE		NY Spills, NY Hist Spills
BROOKLYN	S106868308	MANHOLE #32755	ROCKAWAY AVENUE OF AVE N		NY Spills
BROOKLYN	S109062830	SUBWAY	ROCKAWAY AVENUE STA		NY Spills
BROOKLYN	S102663268	MANHOLE #339	ROCKAWAY AVENUE 7 AVE		NY Spills, NY Hist Spills
BROOKLYN	S106009207	BETWEEN ALBANY & TROY AVE	ROCKLAND RD		NY Spills
BROOKLYN	S103038509	METROPOLITAIN AVE AND	ROEBLING ST		LTANKS, HIST LTANKS
BROOKLYN	S103574405	DS 5371	ROGERS AVENUE OF SNYDER AVE N		NY Spills, NY Hist Spills
BROOKLYN	S106010517	MANHOLE #4546	ROGERS AVENUE PRESIDENT ST		NY Spills
BROOKLYN	S103829768	VS 326	SAINT JOHNS PL & NOSTRAND A		NY Spills, NY Hist Spills
BROOKLYN	S106969680	MANHOLE # 5100	SAINT MARKS AVENUE NEAR ROCKAW		NY Spills
BROOKLYN	S110307441	218641; SANDS ST AND HUDSON AVE	SANDS ST & HUDSON AVE		NY Spills
BROOKLYN	96514161	SCHATZ BROTHERS MARINA 3148 VOORIE	SCHATZ BROTHERS MARINA 3148 VO		ERNS
BROOKLYN	S104788982	CHURCH AVE AND	SCHENECTADY AVE		NY Spills, NY Hist Spills
BROOKLYN	2005633910	2262 SCHENTETY AVE	2262 SCHENTETY AVE		ERNS
BROOKLYN	S110487592	K - SCHOLES ST. STATION	SCHOLES ST 7 BOGART STS MESSER		SHWS
BROOKLYN	S106126180	MANHOLE 38746	SECOND AVENUE AT SIXTH		NY Spills
BROOKLYN	S106126179	MANHOLE 5388	SECOND AVENUE AT SIXTH		NY Spills
BROOKLYN	S106018117	BUSHWICK AVE AND	SEGAL AVE		NY Spills
BROOKLYN	S105235095	SHEEPHEAD BAY EMMONS AVE	SHEEPHEAD BAY EMMONS AVE		NY Spills, NY Hist Spills
BROOKLYN	99609665	SHEEPSHEAD BAY CROSS STREET OF EMM	SHEEPSHEAD BAY CROSS STREET OF		ERNS
BROOKLYN	2000522195	SHELLBANK AVE/HARKNESS AVE	SHELLBANK AVE/HARKNESS AVE	11229	ERNS
BROOKLYN	2011969353	SHEPHARD'S AVE STATION	SHEPHARDS AVENUE STA		ERNS
BROOKLYN	S103569274	EAST SIDE OF KENT AVE	EAST SIDE OF KENT AVE		NY Spills, NY Hist Spills
BROOKLYN	S109414751	WEST SIDE OF SCHENECTADY AVE	WEST SIDE OF SCHENECTADY AVE		NY Spills
BROOKLYN	96476508	SOUTH SIDE OF FOSTER AVE 196FT E.	SOUTH SIDE OF FOSTER AVE 196FT		ERNS
BROOKLYN	2004719996	NORTH SIDE OF LINCOLN AVE	NORTH SIDE OF LINCOLN AVE		ERNS
BROOKLYN	S103939231	SOUTH OF BAYVIEW AVE	WEST SIDE OF SEAGATE AVE		NY Spills, NY Hist Spills
BROOKLYN	S111237906	MANHOLE	EAST SIDE CONE ALLEY AVE		NY Spills
BROOKLYN	S107787670	VAULT VS 7238	S SIDE AVENUE X NEAR STILLWELL		NY Spills
BROOKLYN	S107416301	MANHOLE 867	N SIDE OF FLUSHING AVENUE NEAR		NY Spills
BROOKLYN	S102143752	SMITH STREET	SMITH ST		SWF/LF, NY Spills, NY Hist Spills
BROOKLYN	S106699727	205	STATE ST		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S102147409	STEWART & INGRAM AVE	STEWART & INGRAM AVE		NY Spills, NY Hist Spills
BROOKLYN	S110044711	VAULT VF 6340	STEWART AVENUE MESEROLOE AVE		NY Spills
BROOKLYN	S103576326	MANHOLE 40789	STILLWELL AVENUE SURF AVE		NY Spills, NY Hist Spills
BROOKLYN	S108129915	MANHOLE # TM 700	STONE AVENUE 31 FT W		NY Spills
BROOKLYN	98430337	2712 STOWELL AVE	2712 STOWELL AVE		ERNS
BROOKLYN	S104510468	BEDFORD AVE AND NORTH 9TH	STREET		NY Spills, NY Hist Spills
BROOKLYN	91200240	SUN REFINING & MARKETING 5620 AVE	SUN REFINING & MARKETING 5620		ERNS
BROOKLYN	S104650151		SUTTER AVENUE OF ALABAMA AVE E		NY Spills, NY Hist Spills
BROOKLYN	S110046912	CONSOLIDATED EDISON MH453	MH453 SWC OF DEKALB & NOSTRAN		MANIFEST
BROOKLYN	1014398096	CON EDISON	SS T22 OF NOSTRAND AVE W	11229	RCRA-NonGen
BROOKLYN	1014397830	CON EDISON	SS T25 OF NOSTRAND AVE W	11234	RCRA-NonGen
BROOKLYN	S106968135	ATLANTIC AVE STATION	4 TRACK S		NY Spills
BROOKLYN	S104193737	ATLANTIC AVE AND	TROY AVE		NY Spills, NY Hist Spills
BROOKLYN	S108147060	5700 AVE. U SITE	U	11234	HSWDS
BROOKLYN	2011969737	UNKNOWN SHEEN INCIDENT EMMONS AVE	UNKNOWN SHEEN INCIDENT EMMONS		ERNS
BROOKLYN	S102662997	UTICA AVE SUBSTATION	UTICA AVE		NY Spills, NY Hist Spills
BROOKLYN	2005616774	514 VANDERBILT AVE	514 VANDERBILT AVE		ERNS
BROOKLYN	S102147388	VANDERBILT AVE & MARKS AV	VANDERBILT AVE & MARKS AVE		NY Spills, NY Hist Spills
BROOKLYN	S102148254	VANDERBUILT AVE/ST MARKS	VANDERBUILT AVE		NY Spills, NY Hist Spills
BROOKLYN	2007321529	AT VANDERVOORT AVE AND MASPETH AVE	AT VANDERVOORT AVE AND MASPETH		ERNS
BROOKLYN	S105234978		VARICK AVENUE OF JOHNSON AVE N		NY Spills, NY Hist Spills
BROOKLYN	96473909	VAULT 3122 FEEDER 9B11 SHEFFEILD A	VAULT 3122 FEEDER 9B11 SHEFFEIL		ERNS
BROOKLYN	984649831	VAULT: VS 1198 1198 10TH AVE	VAULT: VS 1198 1198 10TH AVE		ERNS
BROOKLYN	984649830	VAULT: VS 1198 1198 10TH AVE	VAULT: VS 1198 1198 10TH AVE		ERNS
BROOKLYN	S108763263	HALF GALLON RELEASE IN MH 29345	VERNON AVENUE AT LEWIS AVE		NY Spills
BROOKLYN	S102240411	FLUSHING AVE AND	WALLABOUT ST		NY Spills, NY Hist Spills
BROOKLYN	2000546047	1211 WASHINGTON AVE	1211 WASHINGTON AVE		ERNS
BROOKLYN	96503733	WASHINGTON AVE FULTON	WASHINGTON AVE FULTON		ERNS
BROOKLYN	S103484586	ATLANTIC AVE AND	WASHINGTON AVE		NY Spills, NY Hist Spills
BROOKLYN	S102143319	WASHINGTON AVE.	WASHINGTON AVE		NY Spills, NY Hist Spills
BROOKLYN	8715203	718 WHITE AVE	718 WHITE AVE		ERNS
BROOKLYN	S105235362	BOGART AVE AND	WHITE ST		NY Spills, NY Hist Spills
BROOKLYN	S103273454	IFO 240 WHITE AVE	240 WHITE AVE		NY Spills, NY Hist Spills
BROOKLYN	S109373119	76 WILLIAM AVE	76 WILLIAM AVE		NY Spills
BROOKLYN	S110540008	KENT AVE DOT YARD	WILLIAMBURG BRG		NY Spills
BROOKLYN	S110750456	220796; WILLIAMS AVE	WILLIAMS AVE		NY Spills
BROOKLYN	S110750454	220787; WILLIAMS AVE	WILLIAMS AVE		NY Spills
BROOKLYN	S110750460	220816; WILLIAMS AVE	WILLIAMS AVE		NY Spills
BROOKLYN	S104284881	MANHOLE #TM696	WILLIAMS AVENUE RIVERDALE AVE		NY Spills, NY Hist Spills
BROOKLYN	S109373859	WYONA ST BETWEEN BLACK AVE & DUMON	WYONA ST		NY Spills
BROOKLYN	2000544281	WYTHE AVE.	WYTHE AVE.	0	ERNS
BROOKLYN	S104194939	TM 2470	YORK STATE & HUDSON AVE		NY Spills, NY Hist Spills
KINGS COUNTY	S109208149	208921; E 108 ST W 150 N SEAVIEW A	E 108 ST W 150 N SEAVIEW AVE		NY Spills
KINGS COUNTY	S109207907	206018; N/S 16 ST 24' E/O 8 AVE PR	N/S 16 ST 24' E/O 8 AVE PROSPE		NY Spills
KINGS COUNTY	S111835983	FORMER BP SITE	363 4TH AVENUE		NY Spills
KINGS COUNTY	S109208267	209759; E/S ALABAMA AVE	E/S ALABAMA AVE		NY Spills
KINGS COUNTY	S109208186	209681; ATLANTIC AVE; M 2594 (6B54	ATLANTIC AVE; M 2594 (6B54)		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
KINGS COUNTY	S109208110	208583; 14 AVE	14 AVE		NY Spills
KINGS COUNTY	S109208009	207442; AVE M	AVE M		NY Spills
KINGS COUNTY	S109207946	206649; 13 AVE	13 AVE		NY Spills
KINGS COUNTY	S109207896	205848; AVENUE U	AVENUE U		NY Spills
KINGS COUNTY	S109207918	206257; AVENUE N	AVENUE N		NY Spills
KINGS COUNTY	S109208056	208115; BEDFORD AVE; M3434	BEDFORD AVE; M3434		NY Spills
KINGS COUNTY	S109208039	207815; BEDFORD AVE; TM-1210	BEDFORD AVE; TM-1210		NY Spills
KINGS COUNTY	S109207978	207081; N/S CHURCH AVE 39' E/O ROG	N/S CHURCH AVE 39' E/O ROGERS		NY Spills
KINGS COUNTY	S109208259	207868; CLERMONT AVE; M1995	CLERMONT AVE; M1995		NY Spills
KINGS COUNTY	S109208268	209891; E/S CROPSEY AVE 112' S/O B	E/S CROPSEY AVE 112' S/O BAY 4		NY Spills
KINGS COUNTY	S109208040	207850; DEKALB AVE; M-12031	DEKALB AVE; M-12031		NY Spills
KINGS COUNTY	S109208270	210050; DUMONT AVE; MH-3868	DUMONT AVE; MH-3868		NY Spills
KINGS COUNTY	S109207933	206515; N/S ETNA ST 20' E/O NICHOL	N/S ETNA ST 20' E/O NICHOLS AV		NY Spills
KINGS COUNTY	S109208069	208287; FLATBUSH AVE; M3540	FLATBUSH AVE; M3540		NY Spills
KINGS COUNTY	S109207956	206809; FLATBUSH AVE; M-2733	FLATBUSH AVE; M-2733		NY Spills
KINGS COUNTY	S107410746	52-01A FLUSHING AVENUE	FLUSHING AVENUE		LTANKS
KINGS COUNTY	S109207916	206224; FRANKLIN AVE; SB26112 - F/	FRANKLIN AVE; SB26112 - F/O 10		NY Spills
KINGS COUNTY	S109208210	210117; GARDNER AVE; V4346	GARDNER AVE; V4346		NY Spills
KINGS COUNTY	S109208255	207761; GEORGIA AVE; M3946	GEORGIA AVE; M3946		NY Spills
KINGS COUNTY	S109208254	207758; GEORGIA AVE; M66371	GEORGIA AVE; M66371		NY Spills
KINGS COUNTY	S109208124	208725; GEORGIA AVE; TM-730 (9B11)	GEORGIA AVE; TM-730 (9B11)		NY Spills
KINGS COUNTY	S109207934	206528; GEORGIA AVE; M66414	GEORGIA AVE; M66414		NY Spills
KINGS COUNTY	S111835985	NORTH OF GREENPOINT AVE. BRIDGE	GREENPOINT AVE BRIDGE		NY Spills
KINGS COUNTY	S112146850	PARKING LOT	475 KENT AVENUE		NY Spills
KINGS COUNTY	S109207895	205842; KINGS HWY	KINGS HWY		NY Spills
KINGS COUNTY	S109207944	206626; LAFAYETTE AVE	LAFAYETTE AVE		NY Spills
KINGS COUNTY	S109208213	210159; LINCOLN AVE	LINCOLN AVE		NY Spills
KINGS COUNTY	S109208256	207781; LIVONIA AVE & NEW JERSEY A	LIVONIA AVE / NEW JERSEY AVE		NY Spills
KINGS COUNTY	S109207872	205393; MASPETH AVE	MASPETH AVE		NY Spills
KINGS COUNTY	S110138936	PULASKI BRIDGE	MCGUINNESS AVENUE		NY Spills
KINGS COUNTY	S109208044	207889; 657 MYRTLE AVE; BET. FRANK	657 MYRTLE AVE; BET. FRANKLIN		NY Spills
KINGS COUNTY	S109207984	207134; N/E/C ATLANTIC AVE & HOYT	N/E/C ATLANTIC AVE / HOYT ST		NY Spills
KINGS COUNTY	S109207858	205081; NEPTUNE AVE VS4897 - S/S N	NEPTUNE AVE VS4897 - S/S NEPTU		NY Spills
KINGS COUNTY	S109207961	206847; NEW YORK AVE; M64729	NEW YORK AVE; M64729		NY Spills
KINGS COUNTY	S109208005	207410; PROSPECT AVE; M-4146	PROSPECT AVE; M-4146		NY Spills
KINGS COUNTY	S109207848	204946; PROSPECT AVE	PROSPECT AVE		NY Spills
KINGS COUNTY	S110750337	221745; PROSPECT AVE	PROSPECT AVE		NY Spills
KINGS COUNTY	S110750338	221746; PROSPECT AVE	PROSPECT AVE		NY Spills
KINGS COUNTY	S110750339	221748; PROSPECT AVE	PROSPECT AVE		NY Spills
KINGS COUNTY	S109208183	209621; RALPH AVE; M-3332 E/S RALP	RALPH AVE; M-3332 E/S RALPH AV		NY Spills
KINGS COUNTY	S109207975	207045; RALPH AVE	RALPH AVE		NY Spills
KINGS COUNTY	S109207843	204935; M2426 S/W/C HALSEY ST & KN	M2426 S/W/C HALSEY ST / KNIC		NY Spills
KINGS COUNTY	S109208271	210053; SHEFFIELD AVE; M-66341 E/S	SHEFFIELD AVE; M-66341 E/S SHE		NY Spills
KINGS COUNTY	S109208087	208408; VANDERBILT AVE; M1794	VANDERBILT AVE; M1794		NY Spills
KINGS COUNTY	S109207973	207007; M6292 W/S E.4TH ST 26' S/O	M6292 W/S E.4TH ST 26' S/O AVE		NY Spills
KINGS COUNTY	S109208090	208432; WASHINGTON AVE; M-4788	WASHINGTON AVE; M-4788		NY Spills
KINGS COUNTY	S109208033	207718; WASHINGTON AVE; M-2904	WASHINGTON AVE; M-2904		NY Spills

Count: 611 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
KINGS COUNTY	S109207937	206591; WASHINGTON AVE; M4781	WASHINGTON AVE; M4781		NY Spills
KINGS COUNTY	S109207892	205826; WASHINGTON AVE; M-63261	WASHINGTON AVE; M-63261		NY Spills
KINGS COUNTY	S109208185	209654; WILLIAMS AVE; M-65838	WILLIAMS AVE; M-65838		NY Spills
KINGS COUNTY	S109208173	209392; W/S WILLIAMS AVE 300' S/O	W/S WILLIAMS AVE 300' S/O NEWL		NY Spills
KINGS COUNTY	S109208187	209741; WYTHE AVE; M-4848	WYTHE AVE; M-4848		NY Spills
KINGS COUNTY	S109208167	209267; WYTHE AVE	WYTHE AVE		NY Spills
NEW YORK	1007207488	VS4664	AVE. X E345 NOSTRAND AVE.	11229	RCRA-NonGen, MANIFEST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 06/07/2012	Source: EPA
Date Data Arrived at EDR: 07/05/2012	Telephone: N/A
Date Made Active in Reports: 09/18/2012	Last EDR Contact: 10/11/2012
Number of Days to Update: 75	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 06/07/2012	Source: EPA
Date Data Arrived at EDR: 07/05/2012	Telephone: N/A
Date Made Active in Reports: 09/18/2012	Last EDR Contact: 10/11/2012
Number of Days to Update: 75	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 08/15/2011
Number of Days to Update: 56	Next Scheduled EDR Contact: 11/28/2011
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 06/07/2012	Source: EPA
Date Data Arrived at EDR: 07/05/2012	Telephone: N/A
Date Made Active in Reports: 09/18/2012	Last EDR Contact: 10/11/2012
Number of Days to Update: 75	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 12/27/2011	Source: EPA
Date Data Arrived at EDR: 02/27/2012	Telephone: 703-412-9810
Date Made Active in Reports: 03/12/2012	Last EDR Contact: 11/28/2012
Number of Days to Update: 14	Next Scheduled EDR Contact: 03/11/2013
	Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 12/10/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/11/2011	Telephone: 703-603-8704
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 10/09/2012
Number of Days to Update: 36	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 12/28/2011	Source: EPA
Date Data Arrived at EDR: 02/27/2012	Telephone: 703-412-9810
Date Made Active in Reports: 03/12/2012	Last EDR Contact: 11/28/2012
Number of Days to Update: 14	Next Scheduled EDR Contact: 03/11/2013
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/19/2011
Date Data Arrived at EDR: 08/31/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 132

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 11/12/2012
Next Scheduled EDR Contact: 02/25/2013
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/15/2012
Date Data Arrived at EDR: 04/04/2012
Date Made Active in Reports: 05/15/2012
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 11/29/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/15/2012
Date Data Arrived at EDR: 04/04/2012
Date Made Active in Reports: 05/15/2012
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 11/29/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/15/2012
Date Data Arrived at EDR: 04/04/2012
Date Made Active in Reports: 05/15/2012
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 11/29/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/15/2012
Date Data Arrived at EDR: 04/04/2012
Date Made Active in Reports: 05/15/2012
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 11/29/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 07/18/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/24/2012	Telephone: 703-603-0695
Date Made Active in Reports: 11/05/2012	Last EDR Contact: 11/05/2012
Number of Days to Update: 104	Next Scheduled EDR Contact: 12/24/2012
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 07/18/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/24/2012	Telephone: 703-603-0695
Date Made Active in Reports: 11/05/2012	Last EDR Contact: 11/05/2012
Number of Days to Update: 104	Next Scheduled EDR Contact: 12/24/2012
	Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005	Source: Department of the Navy
Date Data Arrived at EDR: 12/11/2006	Telephone: 843-820-7326
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 11/15/2012
Number of Days to Update: 31	Next Scheduled EDR Contact: 03/04/2013
	Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 04/02/2012	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 04/03/2012	Telephone: 202-267-2180
Date Made Active in Reports: 06/14/2012	Last EDR Contact: 10/02/2012
Number of Days to Update: 72	Next Scheduled EDR Contact: 01/14/2013
	Data Release Frequency: Annually

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 10/03/2012	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 10/04/2012	Telephone: 518-402-9622
Date Made Active in Reports: 11/09/2012	Last EDR Contact: 11/20/2012
Number of Days to Update: 36	Next Scheduled EDR Contact: 03/04/2013
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

VAPOR REOPENED: Vapor Intrusion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 05/01/2012	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 05/23/2012	Telephone: 518-402-9814
Date Made Active in Reports: 07/03/2012	Last EDR Contact: 08/24/2012
Number of Days to Update: 41	Next Scheduled EDR Contact: 12/03/2012
	Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 10/10/2012	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 10/11/2012	Telephone: 518-457-2051
Date Made Active in Reports: 11/09/2012	Last EDR Contact: 10/04/2012
Number of Days to Update: 29	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Semi-Annually

State and tribal leaking storage tank lists

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 08/20/2012	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 08/23/2012	Telephone: 518-402-9549
Date Made Active in Reports: 10/05/2012	Last EDR Contact: 11/20/2012
Number of Days to Update: 43	Next Scheduled EDR Contact: 03/04/2013
	Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/08/2005	Telephone: 518-402-9549
Date Made Active in Reports: 07/14/2005	Last EDR Contact: 07/07/2005
Number of Days to Update: 6	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 12/14/2011	Source: EPA Region 4
Date Data Arrived at EDR: 12/15/2011	Telephone: 404-562-8677
Date Made Active in Reports: 01/10/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 26	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 09/12/2011	Source: EPA Region 6
Date Data Arrived at EDR: 09/13/2011	Telephone: 214-665-6597
Date Made Active in Reports: 11/11/2011	Last EDR Contact: 07/26/2012
Number of Days to Update: 59	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/12/2012	Source: EPA Region 1
Date Data Arrived at EDR: 05/09/2012	Telephone: 617-918-1313
Date Made Active in Reports: 07/10/2012	Last EDR Contact: 11/01/2012
Number of Days to Update: 62	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 08/17/2012	Source: EPA Region 7
Date Data Arrived at EDR: 08/28/2012	Telephone: 913-551-7003
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 49	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 09/06/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 09/07/2012	Telephone: 415-972-3372
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 39	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 08/01/2012	Source: EPA Region 10
Date Data Arrived at EDR: 08/02/2012	Telephone: 206-553-2857
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 10/30/2012
Number of Days to Update: 75	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 08/27/2012	Source: EPA Region 8
Date Data Arrived at EDR: 08/28/2012	Telephone: 303-312-6271
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 49	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

State and tribal registered storage tank lists

TANKS: Storage Tank Facility Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 37

Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Quarterly

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 11/08/2012
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: Varies

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 11/08/2012
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 37

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Quarterly

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 10/02/2012
Date Data Arrived at EDR: 10/03/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 37

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 04/12/2012
Date Data Arrived at EDR: 05/02/2012
Date Made Active in Reports: 07/16/2012
Number of Days to Update: 75

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 11/01/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 12/14/2011
Date Data Arrived at EDR: 12/15/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 26

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 07/26/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Semi-Annually

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 08/02/2012
Date Data Arrived at EDR: 08/03/2012
Date Made Active in Reports: 11/05/2012
Number of Days to Update: 94

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 07/26/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 05/10/2011
Date Data Arrived at EDR: 05/11/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 34

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 07/26/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 08/17/2012	Source: EPA Region 7
Date Data Arrived at EDR: 08/28/2012	Telephone: 913-551-7003
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 49	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 08/27/2012	Source: EPA Region 8
Date Data Arrived at EDR: 08/28/2012	Telephone: 303-312-6137
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 49	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 08/01/2012	Source: EPA Region 10
Date Data Arrived at EDR: 08/02/2012	Telephone: 206-553-2857
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 75	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 09/06/2012	Source: EPA Region 9
Date Data Arrived at EDR: 09/07/2012	Telephone: 415-972-3368
Date Made Active in Reports: 10/16/2012	Last EDR Contact: 07/26/2012
Number of Days to Update: 39	Next Scheduled EDR Contact: 02/11/2013
	Data Release Frequency: Quarterly

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010	Source: FEMA
Date Data Arrived at EDR: 02/16/2010	Telephone: 202-646-5797
Date Made Active in Reports: 04/12/2010	Last EDR Contact: 10/15/2012
Number of Days to Update: 55	Next Scheduled EDR Contact: 01/28/2013
	Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 10/03/2012	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 10/04/2012	Telephone: 518-402-9553
Date Made Active in Reports: 11/09/2012	Last EDR Contact: 11/20/2012
Number of Days to Update: 36	Next Scheduled EDR Contact: 03/04/2013
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 10/03/2012

Date Data Arrived at EDR: 10/04/2012

Date Made Active in Reports: 11/09/2012

Number of Days to Update: 36

Source: Department of Environmental Conservation

Telephone: 518-402-9553

Last EDR Contact: 11/20/2012

Next Scheduled EDR Contact: 03/04/2013

Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 11/18/2010

Date Data Arrived at EDR: 12/23/2010

Date Made Active in Reports: 02/11/2011

Number of Days to Update: 50

Source: NYC Department of City Planning

Telephone: 212-720-3401

Last EDR Contact: 09/28/2012

Next Scheduled EDR Contact: 01/07/2013

Data Release Frequency: No Update Planned

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 10/03/2012

Date Data Arrived at EDR: 10/04/2012

Date Made Active in Reports: 11/09/2012

Number of Days to Update: 36

Source: Department of Environmental Conservation

Telephone: 518-402-9711

Last EDR Contact: 11/20/2012

Next Scheduled EDR Contact: 03/04/2013

Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/28/2012

Date Data Arrived at EDR: 10/02/2012

Date Made Active in Reports: 10/16/2012

Number of Days to Update: 14

Source: EPA, Region 1

Telephone: 617-918-1102

Last EDR Contact: 10/02/2012

Next Scheduled EDR Contact: 01/14/2013

Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008

Date Data Arrived at EDR: 04/22/2008

Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 7

Telephone: 913-551-7365

Last EDR Contact: 04/20/2009

Next Scheduled EDR Contact: 07/20/2009

Data Release Frequency: Varies

State and tribal Brownfields sites

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/03/2012
Date Data Arrived at EDR: 10/04/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Quarterly

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 10/03/2012
Date Data Arrived at EDR: 10/04/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 10/24/2012
Date Data Arrived at EDR: 10/26/2012
Date Made Active in Reports: 11/05/2012
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 09/24/2012
Next Scheduled EDR Contact: 01/07/2013
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 07/03/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: No Update Planned

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/01/2006
Date Data Arrived at EDR: 11/15/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 15

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 10/26/2012
Next Scheduled EDR Contact: 02/04/2013
Data Release Frequency: Annually

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 10/10/2012
Date Data Arrived at EDR: 10/11/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-8705
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: Semi-Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 07/11/2012
Date Data Arrived at EDR: 09/12/2012
Date Made Active in Reports: 11/05/2012
Number of Days to Update: 54

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 09/05/2012
Next Scheduled EDR Contact: 12/17/2012
Data Release Frequency: Quarterly

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 10/03/2012
Date Data Arrived at EDR: 10/04/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 36

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Annually

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007
Date Data Arrived at EDR: 11/19/2008
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 131

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/16/2012
Date Data Arrived at EDR: 03/26/2012
Date Made Active in Reports: 06/14/2012
Number of Days to Update: 80

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 11/01/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Varies

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 08/08/2012
Date Data Arrived at EDR: 08/14/2012
Date Made Active in Reports: 10/03/2012
Number of Days to Update: 50

Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 11/12/2012
Next Scheduled EDR Contact: 02/25/2013
Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 04/01/2012
Date Data Arrived at EDR: 04/03/2012
Date Made Active in Reports: 06/14/2012
Number of Days to Update: 72

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 10/02/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Annually

SPIILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/20/2012
Date Data Arrived at EDR: 08/23/2012
Date Made Active in Reports: 10/05/2012
Number of Days to Update: 43

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 11/20/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/15/2012
Date Data Arrived at EDR: 04/04/2012
Date Made Active in Reports: 05/15/2012
Number of Days to Update: 41

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 11/29/2012
Next Scheduled EDR Contact: 01/14/2013
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012
Date Data Arrived at EDR: 08/07/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 42

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 11/06/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 10/18/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 08/12/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 112

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 09/10/2012
Next Scheduled EDR Contact: 12/24/2012
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 06/01/2012	Source: Department of Justice, Consent Decree Library
Date Data Arrived at EDR: 07/24/2012	Telephone: Varies
Date Made Active in Reports: 09/18/2012	Last EDR Contact: 10/01/2012
Number of Days to Update: 56	Next Scheduled EDR Contact: 01/14/2013
	Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 02/27/2012	Source: EPA
Date Data Arrived at EDR: 03/14/2012	Telephone: 703-416-0223
Date Made Active in Reports: 06/14/2012	Last EDR Contact: 09/12/2012
Number of Days to Update: 92	Next Scheduled EDR Contact: 12/24/2012
	Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010	Source: Department of Energy
Date Data Arrived at EDR: 10/07/2011	Telephone: 505-845-0011
Date Made Active in Reports: 03/01/2012	Last EDR Contact: 11/28/2012
Number of Days to Update: 146	Next Scheduled EDR Contact: 03/11/2013
	Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/18/2011	Source: Department of Labor, Mine Safety and Health Administration
Date Data Arrived at EDR: 09/08/2011	Telephone: 303-231-5959
Date Made Active in Reports: 09/29/2011	Last EDR Contact: 09/04/2012
Number of Days to Update: 21	Next Scheduled EDR Contact: 12/17/2012
	Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2009	Source: EPA
Date Data Arrived at EDR: 09/01/2011	Telephone: 202-566-0250
Date Made Active in Reports: 01/10/2012	Last EDR Contact: 11/28/2012
Number of Days to Update: 131	Next Scheduled EDR Contact: 03/11/2013
	Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006	Source: EPA
Date Data Arrived at EDR: 09/29/2010	Telephone: 202-260-5521
Date Made Active in Reports: 12/02/2010	Last EDR Contact: 06/29/2012
Number of Days to Update: 64	Next Scheduled EDR Contact: 01/07/2013
	Data Release Frequency: Every 4 Years

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 11/26/2012
Next Scheduled EDR Contact: 03/11/2013
Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 11/26/2012
Next Scheduled EDR Contact: 03/11/2013
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 11/01/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 07/20/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/10/2011	Telephone: 202-564-5088
Date Made Active in Reports: 01/10/2012	Last EDR Contact: 10/19/2012
Number of Days to Update: 61	Next Scheduled EDR Contact: 01/28/2013
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 11/01/2010	Source: EPA
Date Data Arrived at EDR: 11/10/2010	Telephone: 202-566-0500
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 10/19/2012
Number of Days to Update: 98	Next Scheduled EDR Contact: 01/28/2013
	Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 06/21/2011	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 07/15/2011	Telephone: 301-415-7169
Date Made Active in Reports: 09/13/2011	Last EDR Contact: 09/05/2012
Number of Days to Update: 60	Next Scheduled EDR Contact: 12/24/2012
	Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 10/02/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 10/02/2012	Telephone: 202-343-9775
Date Made Active in Reports: 11/05/2012	Last EDR Contact: 10/02/2012
Number of Days to Update: 34	Next Scheduled EDR Contact: 01/21/2013
	Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 10/23/2011	Source: EPA
Date Data Arrived at EDR: 12/13/2011	Telephone: (212) 637-3000
Date Made Active in Reports: 03/01/2012	Last EDR Contact: 09/11/2012
Number of Days to Update: 79	Next Scheduled EDR Contact: 12/24/2012
	Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 03/01/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 62

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 08/31/2012
Next Scheduled EDR Contact: 12/10/2012
Data Release Frequency: Biennially

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 09/07/2012
Date Data Arrived at EDR: 09/12/2012
Date Made Active in Reports: 10/04/2012
Number of Days to Update: 22

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 09/12/2012
Next Scheduled EDR Contact: 12/24/2012
Data Release Frequency: Quarterly

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 08/01/2012
Date Data Arrived at EDR: 08/09/2012
Date Made Active in Reports: 10/03/2012
Number of Days to Update: 55

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 11/07/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 06/20/2012
Date Data Arrived at EDR: 07/16/2012
Date Made Active in Reports: 09/06/2012
Number of Days to Update: 52

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 10/23/2012
Date Data Arrived at EDR: 10/24/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 16

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 10/15/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: No Update Planned

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 08/02/2012
Date Made Active in Reports: 10/03/2012
Number of Days to Update: 62

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 11/01/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 10/11/2012
Date Data Arrived at EDR: 11/01/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 8

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 10/29/2012
Next Scheduled EDR Contact: 01/07/2013
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 10/18/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011
Date Data Arrived at EDR: 03/09/2011
Date Made Active in Reports: 05/02/2011
Number of Days to Update: 54

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 10/22/2012
Next Scheduled EDR Contact: 02/04/2013
Data Release Frequency: Varies

FINANCIAL ASSURANCE 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/31/2008
Date Data Arrived at EDR: 11/25/2008
Date Made Active in Reports: 12/11/2008
Number of Days to Update: 16

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: Varies

FINANCIAL ASSURANCE 1: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 10/05/2012
Date Data Arrived at EDR: 10/11/2012
Date Made Active in Reports: 11/09/2012
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: Quarterly

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010
Date Data Arrived at EDR: 01/03/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 77

Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 09/14/2012
Next Scheduled EDR Contact: 12/24/2012
Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 08/07/2009
Date Made Active in Reports: 10/22/2009
Number of Days to Update: 76

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 10/16/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: Varies

COAL ASH: Coal Ash Disposal Site Listing

A listing of coal ash disposal site locations.

Date of Government Version: 10/10/2012
Date Data Arrived at EDR: 10/11/2012
Date Made Active in Reports: 11/19/2012
Number of Days to Update: 39

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011
Date Data Arrived at EDR: 10/19/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 83

Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 11/02/2012
Next Scheduled EDR Contact: 02/11/2013
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 10/18/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: N/A

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 07/31/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/13/2012	Telephone: 617-520-3000
Date Made Active in Reports: 09/18/2012	Last EDR Contact: 11/12/2012
Number of Days to Update: 36	Next Scheduled EDR Contact: 02/25/2013
	Data Release Frequency: Quarterly

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 10/01/2012	Source: EPA
Date Data Arrived at EDR: 10/04/2012	Telephone: 202-564-6023
Date Made Active in Reports: 11/05/2012	Last EDR Contact: 10/04/2012
Number of Days to Update: 32	Next Scheduled EDR Contact: 01/14/2013
	Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 11/11/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 05/18/2012	Telephone: 703-308-4044
Date Made Active in Reports: 05/25/2012	Last EDR Contact: 08/16/2012
Number of Days to Update: 7	Next Scheduled EDR Contact: 11/26/2012
	Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 08/20/2012	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/28/2012	Telephone: 202-566-1917
Date Made Active in Reports: 11/05/2012	Last EDR Contact: 11/16/2012
Number of Days to Update: 69	Next Scheduled EDR Contact: 03/04/2013
	Data Release Frequency: Quarterly

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 09/11/2012
Date Data Arrived at EDR: 09/12/2012
Date Made Active in Reports: 10/04/2012
Number of Days to Update: 22

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 05/07/8062
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 09/11/2012
Date Data Arrived at EDR: 09/12/2012
Date Made Active in Reports: 10/04/2012
Number of Days to Update: 22

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 05/07/8062
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: No Update Planned

Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003
Date Data Arrived at EDR: 05/27/2003
Date Made Active in Reports: 06/09/2003
Number of Days to Update: 13

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 10/04/2012
Next Scheduled EDR Contact: 01/21/2013
Data Release Frequency: No Update Planned

Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 10/11/2012
Date Data Arrived at EDR: 10/12/2012
Date Made Active in Reports: 11/14/2012
Number of Days to Update: 33

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 09/10/2012
Next Scheduled EDR Contact: 12/24/2012
Data Release Frequency: Quarterly

Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 10/11/2012
Date Data Arrived at EDR: 10/12/2012
Date Made Active in Reports: 11/14/2012
Number of Days to Update: 33

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 09/10/2012
Next Scheduled EDR Contact: 12/24/2012
Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Annually

Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006
Date Data Arrived at EDR: 01/11/2007
Date Made Active in Reports: 02/07/2007
Number of Days to Update: 27

Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Annually

WESTCHESTER COUNTY:

Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 08/16/2012
Date Data Arrived at EDR: 08/16/2012
Date Made Active in Reports: 10/04/2012
Number of Days to Update: 49

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 08/16/2012
Date Data Arrived at EDR: 08/16/2012
Date Made Active in Reports: 10/04/2012
Number of Days to Update: 49

Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 11/05/2012
Next Scheduled EDR Contact: 02/18/2013
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 08/20/2012
Date Data Arrived at EDR: 08/20/2012
Date Made Active in Reports: 09/20/2012
Number of Days to Update: 31

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 11/19/2012
Next Scheduled EDR Contact: 03/04/2013
Data Release Frequency: Annually

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/19/2012
Date Made Active in Reports: 08/28/2012
Number of Days to Update: 40

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 10/16/2012
Next Scheduled EDR Contact: 01/28/2013
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 07/23/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 57

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 10/22/2012
Next Scheduled EDR Contact: 02/04/2013
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2011
Date Data Arrived at EDR: 06/22/2012
Date Made Active in Reports: 07/31/2012
Number of Days to Update: 39

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 11/26/2012
Next Scheduled EDR Contact: 03/11/2013
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 08/09/2012
Date Data Arrived at EDR: 08/15/2012
Date Made Active in Reports: 09/13/2012
Number of Days to Update: 29

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 10/22/2012
Next Scheduled EDR Contact: 02/04/2013
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2011

Date Data Arrived at EDR: 07/19/2012

Date Made Active in Reports: 09/27/2012

Number of Days to Update: 70

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 09/18/2012

Next Scheduled EDR Contact: 12/31/2012

Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: Rextag Strategies Corp.

Telephone: (281) 769-2247

U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers

Source: Department of Health

Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

3780-3858 NOSTRAND AVE
3780-3858 NOSTRAND AVE
BROOKLYN, NY 11235

TARGET PROPERTY COORDINATES

Latitude (North):	40.5907 - 40° 35' 26.52"
Longitude (West):	73.9403 - 73° 56' 25.08"
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	589674.6
UTM Y (Meters):	4493651.0
Elevation:	9 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	40073-E8 CONEY ISLAND, NY NJ
Most Recent Revision:	1995

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General ENE

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

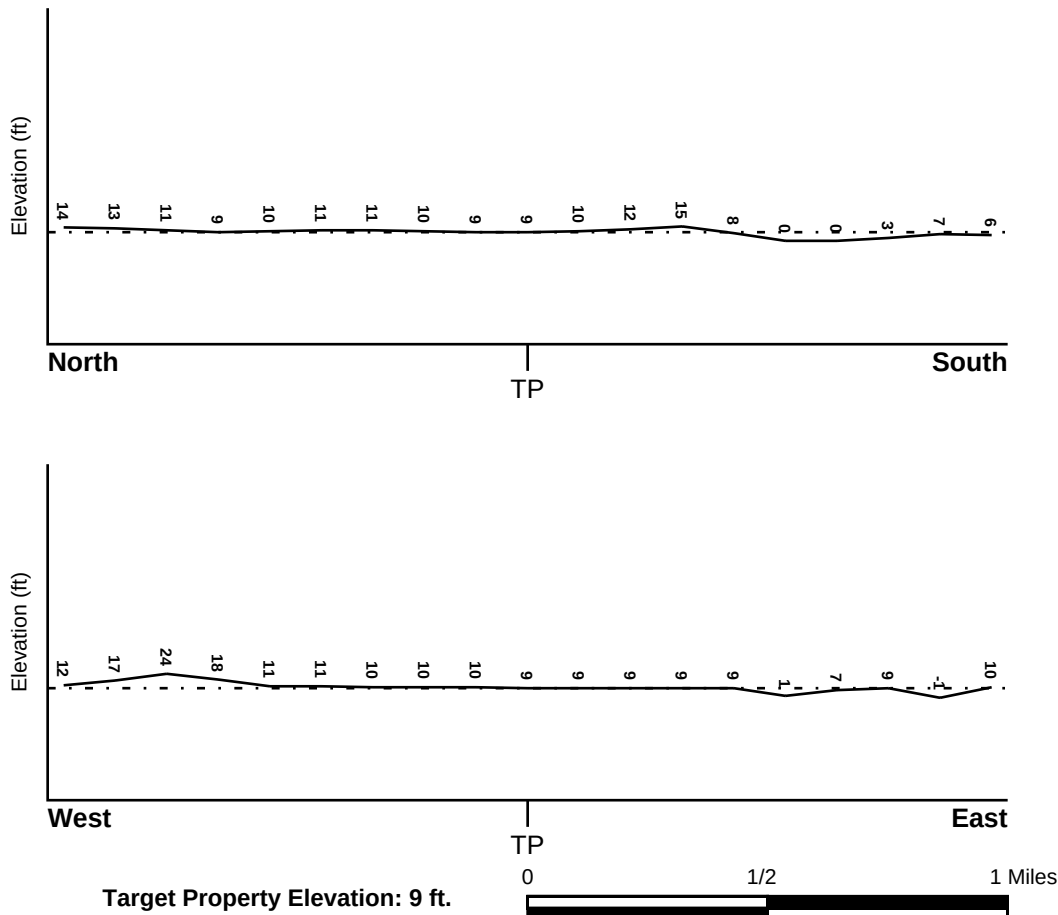

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County
KINGS, NY

FEMA Flood
Electronic Data
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 360497 - FEMA DFIRM Flood data

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property
CONEY ISLAND

NWI Electronic
Data Coverage
YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data:*

Search Radius: 1.25 miles
Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era: Cenozoic
System: Quaternary
Series: Pleistocene
Code: Qp *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Permeability Rate (in/hr)	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam
loamy sand
sandy loam
fine sandy loam

Surficial Soil Types: silt loam
loamy sand
sandy loam
fine sandy loam

Shallow Soil Types: sandy loam

Deeper Soil Types: unweathered bedrock
very gravelly - loamy sand
stratified
sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS2121021	1/2 - 1 Mile NW
2	USGS2121025	1/2 - 1 Mile NW
3	USGS2121035	1/2 - 1 Mile NW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 3465818.2s



- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

0 1/4 1/2 1 Miles

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil, gas or related wells



SITE NAME: 3780-3858 Nostrand Ave
 ADDRESS: 3780-3858 Nostrand Ave
 Brooklyn NY 11235
 LAT/LONG: 40.5907 / 73.9403

CLIENT: LCS, Inc
 CONTACT: Stephanie Laplaca
 INQUIRY #: 3465818.2s
 DATE: November 29, 2012 6:23 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1
NW
1/2 - 1 Mile
Higher

FED USGS USGS2121021

Agency cd:	USGS	Site no:	403549073570101
Site name:	K 1678. 1		
Latitude:	403549	EDR Site id:	USGS2121021
Longitude:	0735701	Dec lat:	40.59704928
Dec lon:	-73.94986008	Coor meth:	M
Coor accr:	S	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	047
Country:	US	Land net:	Not Reported
Location map:	KE1738	Map scale:	Not Reported
Altitude:	9.0		
Altitude method:	Level or other surveying method		
Altitude accuracy:	0.1		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Southern Long Island. New York. Area = 1660 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	GLACIAL AQUIFER,UPPER		
Well depth:	124.	Hole depth:	Not Reported
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00
Peak flow data count:	0	Water quality data begin date:	1981-04-07
Water quality data end date:	2002-08-01	Water quality data count:	6
Ground water data begin date:	0000-00-00	Ground water data end date:	0000-00-00
Ground water data count:	0		

Ground-water levels, Number of Measurements: 0

2
NW
1/2 - 1 Mile
Higher

FED USGS USGS2121025

Agency cd:	USGS	Site no:	403555073572001
Site name:	K 1910. 1		
Latitude:	403555	EDR Site id:	USGS2121025
Longitude:	0735720	Dec lat:	40.59871592
Dec lon:	-73.95513801	Coor meth:	M
Coor accr:	S	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	36
State:	36	County:	047
Country:	US	Land net:	Not Reported
Location map:	KE1717	Map scale:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Altitude:	17.0		
Altitude method:	Level or other surveying method		
Altitude accuracy:	0.1		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Southern Long Island. New York. Area = 1660 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	GLACIAL AQUIFER,UPPER		
Well depth:	Not Reported	Hole depth:	150.
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00
Peak flow data count:	0	Water quality data begin date:	1970-07-22
Water quality data end date:	1970-07-22	Water quality data count:	1
Ground water data begin date:	0000-00-00	Ground water data end date:	0000-00-00
Ground water data count:	0		

Ground-water levels, Number of Measurements: 0

3
NW
1/2 - 1 Mile
Higher

FED USGS USGS2121035

Agency cd:	USGS	Site no:	403605073571201
Site name:	K 3247. 1	EDR Site id:	USGS2121035
Latitude:	403605	Dec lat:	40.60149364
Longitude:	0735712	Coor meth:	M
Dec lon:	-73.95291572	Latlong datum:	NAD27
Coor accr:	S	District:	36
Dec latlong datum:	NAD83	County:	047
State:	36	Land net:	Not Reported
Country:	US	Map scale:	Not Reported
Location map:	KE1821		
Altitude:	18.6		
Altitude method:	Level or other surveying method		
Altitude accuracy:	0.1		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Southern Long Island. New York. Area = 1660 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	GLACIAL AQUIFER,UPPER		
Well depth:	24.	Hole depth:	Not Reported
Source of depth data:	Not Reported		
Project number:	Not Reported		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Peak flow data count: 0

Water quality data end date: 1983-08-22

Ground water data begin date: 1980-04-09

Ground water data count: 63

Water quality data begin date: 1983-08-22

Water quality data count: 1

Ground water data end date: 1998-05-28

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for KINGS County: 3

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for KINGS COUNTY, NY

Number of sites tested: 51

<u>Area</u>	<u>Average Activity</u>	<u>% <4 pCi/L</u>	<u>% 4-20 pCi/L</u>	<u>% >20 pCi/L</u>
Living Area	0.750 pCi/L	100%	0%	0%
Basement	1.370 pCi/L	88%	10%	2%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Department of Environmental Conservation

Telephone: 518-402-8072

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon

Source: Department of Health

Telephone: 518-402-7556

Radon Test Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

10.6 MUNICIPAL INFORMATION



CORPORATE OFFICES
WATERFRONT VILLAGE
40 LA RIVIERE DRIVE, SUITE 120
BUFFALO, NEW YORK 14202
TEL: 800.474.6802
716.845.6145
FAX: 716.845.6164
www.lenderconsulting.com

December 3, 2012

Secretary of the Health Department
New York City Department of Health
125 Worth Street
Room 604A, Box 31
New York, New York 10013

RE: Records Review Request For File No. 12H3984.21
PLEASE REFERENCE THIS # WHEN RESPONDING

To Whom It May Concern:

Our firm is performing a Phase I Environmental Audit of a real property located within New York City. I am writing to request that a review be made of New York City Department of Health records, which are relevant to the purpose of this Phase I Audit. Please review the following records which pertain to the below referenced site.

- 1) NY State Registry of Inactive Hazardous Waste Sites for New York County.
- 2) Complaint files.
- 3) Underground storage tank database for subject property area.
- 4) Unpermitted spills and discharges.
- 5) Site inspection records and septic system inspection reports.
- 6) Tank closure reports

SITE:	Commercial
STREET ADDRESS:	3780-3858 Nostrand Ave
MUNICIPALITY:	NYC
COUNTY:	Kings
CURRENT OWNER(S):	Nostrand Properties
PAST OWNER(S):	Unknown
PAST USE:	Unknown
PRESENT USE:	Mixed commercial
SIZE: 1.72	acres
BLOCK, LOT #:	7445, 1

Please forward all written responses or documents to the attention of Stephanie LaPlaca at our Corporate Office (address above) or slaplaca@lenderconsulting.com. If you have any questions regarding this request for information or to contact an individual from LCS to come in and review the file, please contact me at 646-660-4492 or rward@lenderconsulting.com. The information that you provide is greatly appreciated.

Sincerely,

Ryan Ward
Environmental Analyst
Lender Consulting Services, Inc.

NEW YORK CITY DEPARTMENT OF ENVIRONMENTAL PROTECTION

Application for Records, Article 6 - New York State Public Officers Law, Freedom of Information Law

Complete Part I of this form. Please refer to instruction sheet for assistance in completing this form. If responsive records are located, you will be notified and informed of the required payment. Advance payment is required in check or money order payable to the City of New York before documents will be released. Send the complete application to the Records Access Officer at NYC DEP, Bureau of Legal Affairs, 59-17 Junction Blvd., 19th Fl., Flushing, NY 11373 or fax to (718) 595-6543

PART I. APPLICATION - Check Bureau(s) known or believed to have the record(s):

☐ Executive	☒ Hazardous Materials	☐ Planning and Assessment	☒ Water Records
☐ General Counsel	☒ Air & Noise	☒ Bureau of Wastewater Treatment	☒ Sewer Records
☐ Agency Chief Contracting Office	☒ Environmental Control Board	☒ Sewer discharge violations	☒ Bureau of Water Supply
☐ Bureau of Customer Services (Water Bills)	☒ Bureau of Environmental Engineering	☒ Bureau of Water and Sewer Operations	☐ Water Quality
☒ Bureau of Environmental Compliance	☒ Office of Environmental		☐ DEP Police
☒ Asbestos			

I HEREBY APPLY TO ☐ INSPECT OR ☐ RECEIVE COPIES OF THE FOLLOWING RECORDS (use additional sheets as needed and attach):

12H3984.21

STREET ADDRESS: 3780-3858 Nostrand Ave, Kings, New York

CURRENT OWNER(S): Nostrand Properties

BLOCK, LOT #: 7445, 1

Name: Ryan Ward, (646) 660-4492, rward@LenderConsulting.Com

Firm: Lender Consulting Services, Inc.

Address: 40 La Riviere Drive, Suite 120, Buffalo, NY 14202

Signature: _____ Date: _____

PART II. DISPOSITION OF REQUEST (TO BE COMPLETED BY THE DEPARTMENT)

☐ APPROVED ☐ APPROVED IN PART - - To arrange for access to the records, please contact:

(Department Representative)

(Bureau)

(Phone No.)

Number of Pages: _____

x\$.25 per page = Cost: _____

☐ DENIED ☐ DENIED IN PART - - for reason(s) checked: References are to Sec. 87 of the Public Officers Law.

☐ Exempt: State/Fed. Statute (2(a))

☐ Exempt: Law Enforcement (2(e))

☐ Invasion of personal privacy (2(b))

☐ Inter/Intra-agency material (2(g))

☐ Competitive position injury (2(d))

☐ (Other) _____

Brief Description of records not subject to disclosure _____

A denial, in whole or in part, may be appealed within 30 days by writing to the NYCDEP FOIL Appeals Officer, 59-17 Junction Blvd., 19th Fl., Flushing, NY 11373

☐ UNAVAILABLE - - for reason(s) checked:

☐ Not described in sufficient detail

☐ Not maintained by this Department

☐ After search, no records responsive to request located

☐ (Other) _____

LOG NO.: _____

(Department Representative)

(Bureau)

(Date)

☐ Fee Waived ☐ Check/M.O. received ☐ Check/M.O. requested

DOC# 050303

LCS, INC.
MUNICIPAL INFORMATION

PROJECT#: 12H3984.21

MUNICIPALITY (identify Village/Town/City): nyc.gov and oasisnyc.net

ADDRESS (identify all potential addresses): 3780 to 3855 Nostrand Ave

Office: Assessment

Date: _____

***obtain copy of tax map**

Block and Lot

7445, 1

Owner: Nostrand Properties

Past owner(s): not indicated

Lot Size: 700 x 105

Utilities: not indicated

Additional info.: Building footprint = unk

Office: Building/Code Enforcement Department

Date: _____

*Review permits, complaints, violations, records of historic heating systems, etc.

See attached

Office: oasisnyc.net

Date: _____

*Use this section for any additional or as extra for sections above.

LOT SF = 75,300 1.72 acres

BUILDING SF = 66,496

BUILDING CONSTRUCTED IN= 1959

~~3780~~ 3780 Nostrand - Complaints - failure to maintain
3788 Nostrand - Complaint - work without permit
 ↖ No boiler records

3790 Nostrand - Complaint - basement ceiling
Violation - Elevator ← contact ^{said nothing}
Elevator App - 2009 ~~about~~ about elevator in this building
No Boiler records

3824 Nostrand - Complaints - of Failure to maintain and DOB
Violations - 34 Dismissed Violations
- 10 Active

 ↖ 7 relate to elevator
 3 Plumbing

Alterations - 11 total
New Building ⁵⁶⁵⁸ total, 58, 59, 59, 59, 59, 60, 68, 828
O.I. Burner App - 1959, 1966
No Boiler Records for Prop

3830 Nostrand - ~~complaints~~ - work without permits
No boiler records

3850 Nostrand - Complaints - Failure to maintain
No boiler records

3860 Nostrand - No Complaints
No Boiler Records


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3850 NOSTRAND AVENUE

NOSTRAND AVENUE 3850 - 3850

BROOKLYN 11235

BIN# 3327492

Health Area : 8900

Census Tract : 596

Community Board : 315

Buildings on Lot : 6

Tax Block : 7445

Tax Lot : 1

Condo : NO

Vacant : NO

[View DCP Addresses...](#)
[Browse Block](#)
[View Zoning Documents](#)
[View Challenge Results](#)
[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: NO

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: NONE

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records
Complaints	3	0	Electrical Applications
Violations-DOB	0	0	Permits In-Process / Issued
Violations-ECB (DOB)	0	0	Illuminated Signs Annual Permits
Jobs/Filings	7		Plumbing Inspections
ARA / LAA Jobs	0		Open Plumbing Jobs / Work Types
Total Jobs	7		Facades
Total Actions	0		Marquee Annual Permits
OR Enter Action Type:			Boiler Records
OR Select from List:			DEP Boiler Information
Select...			Crane Information
AND Show Actions			After Hours Variance Permits

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3830 NOSTRAND AVENUE

NOSTRAND AVENUE 3830 - 3846

BROOKLYN 11235

Health Area : 8900
Census Tract : 596
Community Board : 315
Buildings on Lot : **6**

BIN# 3327491

Tax Block : 7445
Tax Lot : 1
Condo : NO
Vacant : NO

[View DCP Addresses...](#)
[Browse Block](#)
[View Zoning Documents](#)
[View Challenge Results](#)
[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: NO

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: NONE

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records
Complaints	5	0	Electrical Applications
Violations-DOB	0	0	Permits In-Process / Issued
Violations-ECB (DOB)	0	0	Illuminated Signs Annual Permits
Jobs/Filings	7		Plumbing Inspections
ARA / LAA Jobs	0		Open Plumbing Jobs / Work Types
Total Jobs	7		Facades
Total Actions	0		Marquee Annual Permits
OR Enter Action Type:			Boiler Records
OR Select from List:			DEP Boiler Information
Select...			Crane Information
			After Hours Variance Permits

AND

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3824 NOSTRAND AVENUE

NOSTRAND AVENUE 3806 - 3826

BROOKLYN 11235

Health Area : 8900

Census Tract : 596

Community Board : 315

Buildings on Lot : 6

BIN# 3327490

Tax Block : 7445

Tax Lot : 1

Condo : NO

Vacant : NO

[View DCP Addresses...](#)[Browse Block](#)[View Zoning Documents](#)[View Challenge Results](#)[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: YES

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: [3840947](#)

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open
Complaints	15	0
Violations-DOB	44	10
Violations-ECB (DOB)	6	4

This property has [1 open ECB](#) "Work Without A Permit" Violations and may be subject to DOB civil penalties upon application for a permit. After obtaining the permit, a certificate of correction must be filed on the ECB violations.

Jobs/Filings	18
ARA / LAA Jobs	0
Total Jobs	18
Actions	143

OR Enter Action Type:

OR Select from List:

Select...

AND [Elevator Records](#)[Electrical Applications](#)[Permits In-Process / Issued](#)[Illuminated Signs Annual Permits](#)[Plumbing Inspections](#)[Open Plumbing Jobs / Work Types](#)[Facades](#)[Marquee Annual Permits](#)[Boiler Records](#)[DEP Boiler Information](#)[Crane Information](#)[After Hours Variance Permits](#)

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3790 NOSTRAND AVENUE

NOSTRAND AVENUE 3790 - 3790

BROOKLYN 11235

Health Area : 8900

Census Tract : 596

Community Board : 315

Buildings on Lot : 6

BIN# 3327489

Tax Block : 7445

Tax Lot : 1

Condo : NO

Vacant : NO

[View DCP Addresses...](#)
[Browse Block](#)
[View Zoning Documents](#)
[View Challenge Results](#)
[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: YES

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: NONE

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records
Complaints	2	0	Electrical Applications
Violations-DOB	1	1	Permits In-Process / Issued
Violations-ECB (DOB)	0	0	Illuminated Signs Annual Permits
Jobs/Filings	10		Plumbing Inspections
ARA / LAA Jobs	0		Open Plumbing Jobs / Work Types
Total Jobs	10		Facades
Actions	1		Marquee Annual Permits
OR Enter Action Type:			Boiler Records
OR Select from List:			DEP Boiler Information
Select...			Crane Information
			After Hours Variance Permits

AND

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3860 NOSTRAND AVENUE

AVENUE Z 2911 - 2923
NOSTRAND AVENUE 3860 - 3860

BROOKLYN 11235

Health Area : 8900
Census Tract : 596
Community Board : 315
Buildings on Lot : 6

BIN# 3327488

Tax Block : 7445
Tax Lot : 1
Condo : NO
Vacant : NO

[View DCP Addresses...](#)
[Browse Block](#)
[View Zoning Documents](#)
[View Challenge Results](#)
[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z
DOB Special Place Name: NOSTRAND AVE
DOB Building Remarks:
Landmark Status:
Local Law: NO
SRO Restricted: NO
UB Restricted: NO
Little 'E' Restricted: N/A
Legal Adult Use: NO
Additional BINs for Building: NONE

Special Status: N/A
Loft Law: NO
TA Restricted: NO

Grandfathered Sign: NO
City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records Electrical Applications Permits In-Process / Issued Illuminated Signs Annual Permits Plumbing Inspections Open Plumbing Jobs / Work Types Facades Marquee Annual Permits Boiler Records DEP Boiler Information Crane Information After Hours Variance Permits
Complaints	0	0	
Violations-DOB	0	0	
Violations-ECB (DOB)	0	0	
Jobs/Filings	1		
ARA / LAA Jobs	1		
Total Jobs	2		
Total Actions	0		
OR Enter Action Type:			
OR Select from List:			
Select...			
AND Show Actions			

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.

	Statements List	Select a B-B-L	NYC.GOV Home	DEP Home	DOF Home	NYCProperty Home
<i>The Official New York City Web Site</i>						

FINAL ASSESSMENT ROLL 2012-2013 | City of New York

Taxable Status Date: January 5, 2012

[EXPLANATION OF ASSESSMENT ROLL](#)

[View May 25, 2012 - Market Value History](#)

[View 2012 TENTATIVE ASSESSMENT ROLL](#)

[View 2011 FINAL ASSESSMENT ROLL](#)

[View May 25, 2011 - Market Value History](#)

[View 2011 TENTATIVE ASSESSMENT ROLL](#)

[View January 15, 2011 - Market Value History](#)

[View 2010 FINAL ASSESSMENT ROLL](#)

[View May 25, 2010 - Market Value History](#)

[View 2010 TENTATIVE ASSESSMENT ROLL](#)

[View 2009 FINAL ASSESSMENT ROLL](#)

[View 2008 FINAL ASSESSMENT ROLL](#)

[View 2007 FINAL ASSESSMENT ROLL](#)

[View 2006 FINAL ASSESSMENT ROLL](#)

Parcel Information

[◀Previous BBL](#)

[Next BBL▶](#)

Owner Name:

NOSTRAND PROPERTIES,

Property Address and Zip Code:

3860 NOSTRAND AVENUE 11235

Real Estate Billing Name and Address:

SOVEREIGN BANK NY

195 MONTAGUE ST FL GRD

BROOKLYN NY 11201

Borough: BROOKLYN

Block: 7445

Lot: 1

Tax Class: 4

Building Class: K2[Codes](#)

Land Information

Lot Size	Irregular	Corner
700.00FT X 105.00FT	IRREG	SW

Building Information

Number of Buildings	Building Size	Extension	Stories
6	19.00FT X 100.00FT		2

Assessment Information

Description	Land	Total
ESTIMATED MARKET VALUE		14,789,000
ACTUAL AV	1,197,000	6,655,050
ACTUAL EX AV	0	317,160
TRANS AV	1,197,000	5,676,282

TRANS EX AV	0	317,160

Taxable/Billable Assessed Value**Assessed Value**

SUBJECT TO ADJUSTMENTS, YOUR 2012/13 TAXES WILL BE BASED ON	5,359,122

Exemption Information

#	Code	Description	Exempt Value
1	1985-01 (47660)	ICIP REG. COMML EX	158,580
2	1985-02 (47660)	ICIP REG. COMML EX	158,580

Property is assessed at the following uniform percentages of full market value, unless limited to a lesser amount by law:

Class 1 - 6%**Class 2 - 45%****Class 3 - 45%****Class 4 - 45%**

[Statements List](#) | [Select a BBL](#) | [Logon to NYCProperty](#)

Go To: [Finance Home Page](#) | [NYC.gov Home Page](#) | [Contact NYC.gov](#) | [FAQs](#) | [Privacy Statement](#) | [Site Map](#)


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings

ECB Query By Location

Page: 1 of 1

Premises: 3780 NOSTRAND AVENUE BROOKLYN

BIN: [3327493](#) Block: 7445 Lot: 1 CB: 315

Dept. of Buildings Violations & Compliance	
Total Issued = 2	Open (Non-Compliance) = 0

ECB Hearings	
Completed / Defaulted = 2	Pending = 0

ECB Number	Dept. of Buildings Violation Status	Respondent	ECB Hearing Status	Viol Date	Infraction Codes	ECB Penalty Due
34532395M	RESOLVED - CERTIFICATE ACCEPTED Severity: NON-HAZARDOUS	NOSTRAND PROPERTIES Inspect Unit: BROOKLYN CONSTRUCTION	DEFAULT	08/07/2006	B07	\$0.00
34222662Y	RESOLVED - CERTIFICATE ACCEPTED Severity: NON-HAZARDOUS	OWNER OF 3788TO 3810 NOST	WRITTEN OFF	12/15/1999	B04 , BJ1	\$0.00

Compliance Status (Open/Resolved) relates to whether a violation has been corrected/uncorrected. Dismissed violations do not require filing a Certificate of Correction.

ECB Hearing Status and the **ECB Penalty Due** are separate from **Compliance Status** (i.e. a penalty is still due in many cases even when the violating condition has been fixed).

Severity Class	
Class 1 - Immediately Hazardous	HAZ - Hazardous - 1968 Building Code
Class 2 - Major	NON-HAZ - Non-hazardous - 1968 Building Code
Class 3 - Lesser	

Violation Status Descriptions	ECB Hearing Status
OPEN - No Compliance Recorded	CURED/IN-VIO - In Violation/no hearing required
OPEN - Certificate Pending (Certificate of Correction submitted and under review)	STIPULATION/IN-VIO - No hearing required/in violation
OPEN - Certificate Disapproved (Certificate of Correction disapproved/not in compliance)	IN VIOLATION - Hearing decision completed
RESOLVED - N/A-Dismissed (at ECB - no Certificate of Correction required)	DISMISSED - Hearing decision completed
RESOLVED - Certificate Accepted (Certification of Correction Accepted/in compliance)	DEFAULT - Respondent failed to appear at hearing
RESOLVED - Cure Accepted (early correction accepted - in violation/no penalty or hearing)	PUBLICLY-OWNED - No hearing required
RESOLVED - Compliance Insp/Doc (condition verified by Inspector or by Dept. documentation)	PENDING - Awaiting ECB hearing or decision
	ADMIT/IN-VIO - In Violation/no hearing required
	WRITTEN OFF - Imposed penalty legally uncollectable

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

NO BOILER RECORDS FOUND FOR THIS PROPERTY

3780 NOSTRAND AVENUE

AVENUE Y 2924 - 2924
NOSTRAND AVENUE 3780 - 3788

BROOKLYN 11235

Health Area : 8900
Census Tract : 596
Community Board : 315
Buildings on Lot : **6**

BIN# 3327493

Tax Block : 7445
Tax Lot : 1
Condo : NO
Vacant : NO

[View DCP Addresses...](#) [Browse Block](#)

[View Zoning Documents](#)

[View Challenge Results](#)

[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: NO

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: NONE

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records
Complaints	2	0	Electrical Applications
Violations-DOB	1	1	Permits In-Process / Issued
Violations-ECB (DOB)	2	0	Illuminated Signs Annual Permits
Jobs/Filings	5		Plumbing Inspections
ARA / LAA Jobs	0		Open Plumbing Jobs / Work Types
Total Jobs	5		Facades
Total Actions	0		Marquee Annual Permits
OR Enter Action Type:			Boiler Records
OR Select from List:			DEP Boiler Information
Select...			Crane Information
			After Hours Variance Permits

AND

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.


[CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings
Property Profile Overview

3780 NOSTRAND AVENUE

AVENUE Y 2924 - 2924
NOSTRAND AVENUE 3780 - 3788

BROOKLYN 11235

Health Area : 8900
Census Tract : 596
Community Board : 315
[Buildings on Lot](#) : 6

BIN# 3327493

Tax Block : 7445
Tax Lot : 1
Condo : NO
Vacant : NO

[View DCP Addresses...](#)
[Browse Block](#)
[View Zoning Documents](#)
[View Challenge Results](#)
[View Certificates of Occupancy](#)

Cross Street(s): AVENUE Y, AVENUE Z

DOB Special Place Name:

DOB Building Remarks:

Landmark Status:

Local Law: NO

SRO Restricted: NO

UB Restricted: NO

Little 'E' Restricted: N/A

Legal Adult Use: NO

Additional BINs for Building: NONE

Special Status: N/A

Loft Law: NO

TA Restricted: NO

Grandfathered Sign: NO

City Owned: NO

Special District: UNKNOWN

This property is not located in an area that may be affected by Tidal Wetlands, Freshwater Wetlands, or Coastal Erosion Hazard Area. [Click here for more information](#)

Department of Finance Building Classification: K2-STORE BUILDING

Please Note: The Department of Finance's building classification information shows a building's tax status, which may not be the same as the legal use of the structure. To determine the legal use of a structure, research the records of the Department of Buildings.

	Total	Open	Elevator Records
Complaints	2	0	Electrical Applications
Violations-DOB	1	1	Permits In-Process / Issued
Violations-ECB (DOB)	2	0	Illuminated Signs Annual Permits
Jobs/Filings	5		Plumbing Inspections
ARA / LAA Jobs	0		Open Plumbing Jobs / Work Types
Total Jobs	5		Facades
Total Actions	0		Marquee Annual Permits
OR Enter Action Type:			Boiler Records
OR Select from List:			DEP Boiler Information
Select...			Crane Information
AND Show Actions			After Hours Variance Permits

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.



 [CLICK HERE TO SIGN UP FOR BUILDINGS NEWS](#)

NYC Department of Buildings

Address Information From Department of City Planning

Page: 1 of 1

Premises: 3780 NOSTRAND AVENUE BROOKLYN

BIN: [3327493](#) Block: 7445 Lot: 1

LOW NUMBER	HIGH NUMBER	STREET NAME	STCDE	BIN
3780	3788	NOSTRAND AVENUE	67030	3327493
2924	2924	AVENUE Y	14830	3327493
2911	2923	AVENUE Z	14880	3327488
3860	3860	NOSTRAND AVENUE	67030	3327488
3790	3790	NOSTRAND AVENUE	67030	3327489
3806	3826	NOSTRAND AVENUE	67030	3327490
3830	3846	NOSTRAND AVENUE	67030	3327491
3850	3850	NOSTRAND AVENUE	67030	3327492

If you have any questions please review these [Frequently Asked Questions](#), the [Glossary](#), or call the 311 Citizen Service Center by dialing 311 or (212) NEW YORK outside of New York City.

THE CITY OF NEW YORK



DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH Brooklyn

DATE:

NO. 229866

This certificate supersedes C.O. No. 192328

JUN 27 1988

ZONING DISTRICT C2-2 in R-4

THIS CERTIFIES that the new-altered-existing-building-premises located at

3820/46 Nostrand Avenue A/K/A 3838 Nostrand Avenue

Block 7445

Lot 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS PER SQ FT	MAXIMUM NO OF PERSONS PERMITTED	ZONING DOWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Op. Ground						Ordinary, Storage
		10					Toilets and Lounge
First	120	48			6		Bank
	120	48			6		Self-Service Meat Market
	120	48			6		Store
							Open Accessory Parking
TOTAL: Bank, Market and Store							
Old Code							

OPEN SPACE USES

(SPECIFY - PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
SPECIFICATIONS NOTED ON THE REVERSE SIDE.

Shirley Klein
BOROUGH SUPERINTENDENT

Clark W. Smith
COMMISSIONER

☐ ORIGINAL☐ OFFICE COPY - DEPARTMENT OF BUILDINGS☐ COPY

229866

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the
 distant 0' West
 South Avenue Y
 running thence West 105' feet;
 thence East 105' feet; thence
 thence North 700' feet;
 thence South 700' feet;
 to the point or place of beginning.

Alteration #23/83
 BUILDING OCCUPANCY GROUP CLASSIFICATION

DATE OF COMPLETION 5/20/88

CONSTRUCTION CLASSIFICATION - 3
 HEIGHT One STORIES, 15' FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO
STANDPIPE SYSTEM		
YARD HYDRANT SYSTEM		
STANDPIPE FIRE TELEPHONE AND SIGNALING SYSTEM		
SMOKE DETECTOR		
FIRE ALARM AND SIGNAL SYSTEM		
AUTOMATIC SPRINKLER SYSTEM (Existing)	X	

STORM DRAINAGE DISCHARGES INTO:
 A) STORM SEWER ☐ B) COMBINED SEWER ☐

C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:
 A) SANITARY SEWER ☐ B) COMBINED SEWER ☐

C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESERVATIONS:
 BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS:



THE CITY OF NEW YORK



DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH Brooklyn

DATE:

OCT 13 1987

NO. 228630This certificate supersedes C.O. No. 169756

ZONING DISTRICT

THIS CERTIFIES that the new—altered—existing—building—premises located at

3860 Bostrand AvenueBlock 7445Lot Part of 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
<u>Cellar</u>	<u>24</u> <u>on</u> <u>Ground</u>	<u>41</u>			<u>4</u>	<u>E</u>	<u>Boiler Room</u> <u>Medical Offices</u>
<u>First</u>	<u>190</u>	<u>38</u>			<u>4</u>	<u>E</u>	<u>Medical Offices</u> <u>Parking for Twenty-Two (22)</u> <u>Cars.</u>
TOTAL: Medical Offices and Twenty-Two (22) Car Parking New Code							
NOTE: The Site is One Zoning Lot and is not to be Subdivided. Accessory Parking is provided for the entire lot in common as follows: Four (4) Spaces at rear of 3780 Bostrand Avenue; 69 spaces in underground garage with attendant, and 10 spaces on grade at rear of 3804 Bostrand Avenue; 39 spaces on grade at 3848 Bostrand Avenue. Cellar Parking N.B. 67/82 shall have paid attendants employed by the owners or operators to handle parking and moving of automobiles at all times when such spaces are in use.							

OPEN SPACE USES See N.B. #67/82

(SPECIFY—PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND SPECIFICATIONS NOTED ON THE REVERSE SIDE

BOROUGH SUPERINTENDENT

COMMISSIONER

☒ ORIGINAL ☐ OFFICE COPY—DEPARTMENT OF BUILDINGS ☐ COPY

225630

110452

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the Northwest side of
 distant Westrand Avenue and Avenue Z
 running thence West 121' feet; thence North 100' feet;
 thence East 11' feet; thence North 40' feet;
 thence East 52' feet; thence North 560' feet;
 thence East 105' feet; thence _____ feet;
 to the point or place of beginning.

or A.L.T. No. 1616/82 DATE OF COMPLETION 11/7/88 CONSTRUCTION CLASSIFICATION Class II-B
 BUILDING OCCUPANCY GROUP CLASSIFICATION B HEIGHT One STORIES 16-5' FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____



THE CITY OF NEW YORK



DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH Brooklyn

DATE:

OCT 13 1987 NO. 228631

ZONING DISTRICT C2-2/R-4

This certificate supersedes C.O. No.

THIS CERTIFIES that the new-altered-existing-building-premises located at

3848 Nostrand Avenue

Block 7445 Lot Pt. of 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
First	Slab on Ground					F	Lobby, Utility Room, Accessory Parking
Second	100	57			9	F	Health Spa

NOTE: THE SITE IS ONE ZONING LOT AND MAY NOT BE SUBDIVIDED.

ACCESSORY PARKING IS PROVIDED FOR THE ENTIRE LOT IN COMMON AS FOLLOWS:
FOUR (4) SPACES AT THE REAR OF 3780 NOSTRAND AVENUE, SIXTY-NINE (69)
SPACES IN UNDERGROUND GARAGE WITH ATTENDANT, AND TEN (10) SPACES ON
GRADE AT REAR OF 3804 NOSTRAND AVENUE, THIRTY-NINE (39) SPACES ON GRADE
AT 3848 NOSTRAND AVENUE.

CELLAR PARKING N.B. #67/82 SHALL HAVE PAID ATTENDANTS EMPLOYED BY THE
OWNERS OR OPERATORS TO HANDLE THE PARKING AND MOVING OF AUTOMOBILES AT
ALL TIMES WHEN SUCH SPACES ARE IN USE.

THE SPECIAL PERMIT SHALL BE LIMITED TO A TERM OF TEN (10) YEARS, THERE
SHALL BE NO CHANGE IN THE OWNERSHIP OR OPERATION CONTROL OF THE PHYSICAL
CULTURE ESTABLISHMENT WITHOUT PRIOR APPROVAL OF THE BOARD, THESE CONDI-
TIONS SHALL APPEAR ON THE CERTIFICATE OF OCCUPANCY, NO PERMIT SHALL BE
ISSUED FOR THIRTY-ONE (31) DAYS AFTER THE DATE OF THIS RESOLUTION, THE
DEVELOPMENT AS APPROVED IS SUBJECT TO THE VERIFICATION OF THE DEPARTMENT,
SUBSTANTIAL COMPLETION SHALL BE PER L.R. 73-70.

TOTAL: Health Spa and Accessory Parking

New Code

OPEN SPACE USES Parking-See N.B. #67/82 & Alt. #1055/82 Loading Berths-See Alt. #1055/82
(SPECIFY PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)
Other Open Spaces See N.B. #67/82

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
SPECIFICATIONS NOTED ON THE REVERSE SIDE

Shirley Klei
BOROUGH SUPERINTENDENT

Charles M. Smith
COMMISSIONER

☐ ORIGINAL ☐ OFFICE COPY - DEPARTMENT OF BUILDINGS ☐ COPY

228631

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West side of Westrand Avenue
~~between~~ Avenue Y and Avenue Z
 running thence West 121' feet; thence North 100' feet;
 thence East 11' feet; thence North 40' feet;
 thence East 5' feet; thence North 560' feet;
 thence East 105' feet; thence South 700' feet;
 to the point or place of beginning.

~~Building~~ #325/82DATE OF COMPLETION 12/12/86CONSTRUCTION CLASSIFICATION Class 1-BBUILDING OCCUPANCY GROUP CLASSIFICATION FHEIGHT Two STORIES, 21'-6" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☒B) COMBINED SEWER ☐C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☒B) COMBINED SEWER ☐C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESERVATIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. 791-85-82

CITY PLANNING COMMISSION CAL. NO. _____

OTHERS: _____



THE CITY OF NEW YORK



DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH Brooklyn

DATE:

OCT 13 1987

NO. 228629

ZONING DISTRICT C2-2/R-4

This certificate supersedes C.O. No.

THIS CERTIFIES that the new—altered—existing—building—premises located at

3804 Nostrand AvenueBlock 7445 Lot Part of 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Slab on Ground	72			6C	B2	Accessory Parking 69 cars with paid Attendant.
First	100	45			6C	C	Retail Store
		45			6C	C	Retail Store
		82			6C	C	Retail Store
		60			6C	C	Retail Store
		44			6C	C	Retail Store
		45			6C	C	Retail Store
		82			6C	C	Retail Store
Second	100	103			6B	E	Offices
NOTE: THE SITE IS ONE ZONING LOT AND IS NOT TO BE SUBDIVIDED. Accessory Parking is provided for the entire lot in common as follows: Four (4) spaces in rear of 3780 Nostrand Avenue; Sixty-nine (69) spaces in underground garage with attendant, and Ten (10) spaces at rear of 3804 Nostrand Avenue on grade; Thirty-nine (39) spaces on grade at 3848 Nostrand Avenue. Cellar parking N.B. 67/82 shall have paid attendants employed by the owners or operators to handle the parking and moving of automobiles at all times when such spaces are in use. TOTAL: Retail Stores, Offices and Accessory Parking Use Code							

OPEN SPACE USES 16,978 Square Feet - Parking - See Alt. 1055/82.

(SPECIFY - PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND SPECIFICATIONS NOTED ON THE REVERSE SIDE.

Shirley Klein
BOROUGH SUPERINTENDENT

Mark W. Smith
COMMISSIONER

☒ ORIGINAL ☐ OFFICE COPY - DEPARTMENT OF BUILDINGS ☐ COPY

228629

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West side of Westroad Avenue
~~between~~ between Westroad Avenue
Avenue Y and Avenue Z and Westroad Avenue
 running thence West 121' feet; thence North 100' feet;
 thence East 11' feet; thence North 40' feet;
 thence East 5' feet; thence North 560' feet;
 thence East 105' feet; thence South 700' feet;
 to the point or place of beginning.

N.B. CHECK No. 67/82 DATE OF COMPLETION 10/10/86 CONSTRUCTION CLASSIFICATION Class 1-E
 BUILDING OCCUPANCY GROUP CLASSIFICATION C HEIGHT NO STORIES, 21'6" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM	☒	☐	AUTOMATIC SPRINKLER SYSTEM	☒	☐
YARD HYDRANT SYSTEM	☐	☐			
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM	☐	☐			
SMOKE DETECTOR	☐	☐			
FIRE ALARM AND SIGNAL SYSTEM	☐	☐			

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☒B) COMBINED SEWER ☐C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☒B) COMBINED SEWER ☐C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____

CITY PLANNING COMMISSION CAL. NO. _____

OTHERS _____



THE CITY OF NEW YORK



DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH **Brooklyn**

DATE:

OCT 13 1987

NO. **228628**ZONING DISTRICT **C2-2/B-4**

This certificate supersedes C.O. No.

THIS CERTIFIES that the new—altered—existing—building—premises located at

Block **745** Lot **Part of 1****3780 Nostrand Avenue**

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Slab OR Ground				6	C	Accessory Storage
First	100	674			6	C	Retail Stores, Bank and One One (1) Loading Berth
NOTE: THE SITE IS ONE ZONING LOT AND IS NOT TO BE SUBDIVIDED. ACCESSORY PARKING IS PROVIDED FOR THE ENTIRE LOT IN COMMON AS FOLLOWS: FOUR (4) SPACES IN REAR OF 3780 NOSTRAND AVENUE, SIXTY-NINE (69) SPACES IN UNDERGROUND GARAGE WITH ATTENDANT AND TEN (10) SPACES ON GRADE AT REAR OF 3804 NOSTRAND AVENUE, THIRTY-NINE PARKING SPACES ON GRADE AT 3848 NOSTRAND AVENUE. CELLAR PARKING NEW BUILDING #67/82 SHALL HAVE PAID ATTENDANTS EMPLOYED BY THE OWNERS OR OPERATORS TO HANDLE THE PARKING AND MOVING OF AUTOMOBILES AT ALL TIMES WHEN SUCH SPACES ARE IN USE. TOTAL: Retail Stores and Bank New Code							

OPEN SPACE USES Parking—See New Building #67/82 Loading Berths—28 Spaces Feet and
 SPECIFY: PARKING SPACES, LOADING BERTHS, OTHER USES, NONE!
 Other Open Spaces —See New Building #67/82.

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
 A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
 SPECIFICATIONS NOTED ON THE REVERSE SIDE:

Shirley Klein
 BOROUGH SUPERINTENDENT

Charles W. Smith
 COMMISSIONER

☐ ORIGINAL ☐ OFFICE COPY—DEPARTMENT OF BUILDINGS ☐ COPY

228628

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West between Street
~~Street~~ Avenue Y and Avenue Z
 running thence West 121' North 100' feet; thence East 31' North 40' feet;
 thence East 5' feet; thence North 560' feet;
 thence East 105' feet; thence South 700' feet;
 thence _____ feet; thence _____ feet;
 to the point or place of beginning.

Alteration #1055/82
~~RECONSTRUCTION~~ DATE OF COMPLETION 12/2/86 CONSTRUCTION CLASSIFICATION Class II-B
 BUILDING OCCUPANCY GROUP CLASSIFICATION C HEIGHT One STORIES, 13' FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM	☒	
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____



THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

TEMPORARY

BOROUGH BROOKLYN

DATE:

DEC 5 1985 NO. 225087

ZONING DISTRICT C2-2/R4

This certificate supersedes C.O. No. 224369

THIS CERTIFIES that the new—altered—existing—building—premises located at

3848 Nostrand Avenue

Block 7445

Lot 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING Dwelling OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
FIRST	S.O.G.				6	E	Accessory Parking on grade Fifth-three(53) cars in conjunction with N.B.67/82.
NOTE: THE PARCEL IS ONE ZONING LOT AND MAY NOT BE SUBDIVIDED.							
Cellar Parking (NB 67/82) shall have paid attendants employed by the owners or operators to handle the parking and moving of automobiles at all times when such spaces are in use.							
TOTAL: Accessory Parking New Code							
TEMPORARY: For Ninety Days (90) to expire March 6, 1986 from December 6, 1985.							

OPEN SPACE USES PARKING: See NB 67/82 LOADING BERTH: See Alt. 1055/82
(SPECIFY—PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
SPECIFICATIONS NOTED ON THE REVERSE SIDE.

Shirley Klein
BOROUGH SUPERINTENDENT

Clark M. Smith
COMMISSIONER

☐ ORIGINAL ☐ OFFICE COPY—DEPARTMENT OF BUILDINGS ☐ COPY

225087

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West side of Nostrand Avenue
 distant feet from the corner formed by the intersection of
 between Avenue Y and Avenue Z

running thence West 121'	feet; thence North 100'	feet;
thence East 5'	feet; thence North 560'	feet;
thence East 105'	feet; thence South 700'	feet;
thence East 11'	feet; thence North 40'	feet;

to the point or place of beginning.

MS. or JCK No. 325/82 DATE OF COMPLETION
 BUILDING OCCUPANCY GROUP CLASSIFICATION 6

CONSTRUCTION CLASSIFICATION 1E
 HEIGHT 2 STORIES, 21'6" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

- A) STORM SEWER ☒ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

- A) SANITARY SEWER ☒ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____

THE CITY OF NEW YORK

EWA

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH

BROOKLYN

DATE:

1985

NO.

224882

This certificate supersedes C.O. No.

224369

ZONING DISTRICT

C2-2/B

THIS CERTIFIES that the new—altered—existing—building—premises located at

Block 7445

Lot 1

3845 West End Avenue
 CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LOADS LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
First	S.O.G.				6	E	Accessory parking on grade Fifty-three (53) cars in conjunction with N.Y.C. 24/82.
NOTES: THE PARCEL IS ONE ZONING LOT AND MAY NOT BE SUBDIVIDED. Cellar parking (see 67/82) shall have paid attendants employed by the owners or operators to handle the parking and moving of automobiles at all times when such spaces are in use. TERMS: Accessory Parking New Code TEMPORARY - For Ninety (90) days to expire December 6, 1985. from September 7, 1985							

Parkings: See 67/82 Loading Berths: See Alt. 1855/82

OPEN SPACE USES

(SPECIFY—PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
 A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
 SPECIFICATIONS NOTED ON THE REVERSE SIDE.

BOROUGH SUPERINTENDENT

COMMISSIONER

☐ ORIGINAL☐ OFFICE COPY—DEPARTMENT OF BUILDINGS☐ COPY

224882

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West side of Westland Avenue
 distant between Y feet from the corner formed by the intersection of
 and
 running thence West 133° feet; thence North 100° feet;
 thence West 5° feet; thence North 56° feet;
 thence West 185° feet; thence North 70° feet;
 to the point or place of beginning.

N.S. 125/02

U.S. ex. A.T. No. DATE OF COMPLETION 6
 SHELTER OCCUPANCY GROUP CLASSIFICATION

CONSTRUCTION CLASSIFICATION 1B
 HEIGHT 2 STORIES, 21/8 FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☒ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____

THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

TEMPORARY

BOROUGH **BROOKLYN**

DATE:

JUN 7 - 1985

NO.

224369

ZONING DISTRICT **C2-2/B4**

This certificate supersedes C.O. No.

THIS CERTIFIES that the new altered-existing-building-premises located at

Block **7445** Lot **1****3848 Nostrand Avenue**

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	SEWERAGE NO. OF SINKS, TOILETS, ETC.	ZONING DWELLING UNITS PER LOT	BUILDING TYPE MAINTAIN GROUP	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
First	S.O.G.				6	E	Accessory Parking on grade Fifty-three (53) cars in conjunction with N.B. 67/82.
NOTE: THE PARCEL IS ONE ZONING LOT AND MAY NOT BE SUBDIVIDED cellar parking (NB 67/82) SHALL HAVE PAID ATTENDANTS EMPLOYED BY THE OWNERS OR OPERATORS TO HANDLE THE PARKING AND MOVING OF AUTOMOBILES AT ALL TIMES WHEN SUCH SPACES ARE IN USE. TOTAL: Accessory Parking New Code TEMPORARY FOR NINETY (90) days to expire September 7, 1985.							

PARKING: See NB 67/82 LOADING BERTHS: SEE ALT 1055/82

OPEN SPACE USES

(SPECIFY PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
SPECIFICATIONS NOTED ON THE REVERSE SIDE.

BOROUGH SUPERINTENDENT

COMMISSIONER

☐ ORIGINAL☐ OFFICE COPY-DEPARTMENT OF BUILDINGS☐ COPY



THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY TEMPORARY

BOROUGH

BROOKLYN

DATE:

JUN 12 1985NO. **224381**

This certificate supersedes C.O. No.

222953ZONING DISTRICT **C2-2/B4**

THIS CERTIFIES that the new-altered-existing-building-premises located at

3804 Bostrand AvenueBlock **7445**Lot **1**

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN.

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Slab on Ground	72			6c	B2	Accessory Parking for 63 Cars
First	100	73			6c	c	Shoe Store
		90			6c	c	Book Store
		117			6c	c	Clothing Store
		64			6c	c	Card Store
		109			6c	c	Toy Store
TOTAL: As stated above							
NEW CODE							
NOTES: 1. The site is one Zoning Lot and may be subdivided. 2. One (1) Fire Guard continuously on premises with Certificate of Fitness from the Fire Department with portable Fire Extinguishing System in cellar.							
TEMPORARY: For Ninety (90) Days to expire September 4, 1985.							

OPEN SPACE USES


Parking: 17,656 Square Feet

(SPECIFY-PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)


NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS

A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND SPECIFICATIONS NOTED ON THE REVERSE SIDE.



Borough Superintendent



Commissioner
☐ ORIGINAL☐ OFFICE COPY-DEPARTMENT OF BUILDINGS☐ COPY

224381

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the distant West side of Westrand Avenue feet from the corner formed by the intersection of Between Avenues Y & Z and Westrand Avenue

running thence N. 121 feet; thence N. 100 feet;

thence E. 11 feet; thence N. 40 feet;

thence E. 5 feet; thence N. 560 E. 105 S. 700 feet;

thence _____ feet; thence _____ feet;

to the point or place of beginning.

P.L.B. No. 67/82 DATE OF COMPLETION _____BUILDING OCCUPANCY GROUP CLASSIFICATION CCONSTRUCTION CLASSIFICATION IB
HEIGHT 2 STORIES, 21' 6" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
YARD HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
CITY PLANNING COMMISSION CAL. NO. _____

OTHERS: _____

THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH

BROOKLYN

DATE:

JAN 4 1985

NO.

223553

TEMPORARY

ZONING DISTRICT

This certificate supersedes C.O. No. T222953

THIS CERTIFIES that the new-altered-existing-building-premises located at

3804 NOSTRAND AVE

Block 7445

Lot 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD, LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
CELLAR	SLAB ON GROUND	72			6C	B2	ACCESSORY PARKING FOR 63 CARS
FIRST	100	73			6C	C	SHOE STORE
		90			6C	C	BOOK STORE
		117			6C	C	CLOTHING STORE
		64			6C	C	CARD STORE
		109			6C	C	TOY STORE
TOTAL: AS STATED ABOVE NEW CODE							

NOTE: 1. THE SITE IS ONE ZONING LOT AND MAY NOT BE SUBDIVIDED

2. ONE (1) FIRE GUARD CONTINUOUSLY ON PREMISES WITH CERTIFICATE OF FITNESS FROM THE FIRE DEPARTMENT WITH PORTABLE FIRE EXTINGUISHING SYSTEM IN CELLAR

TEMPORARY - FOR NINETY (90) DAYS TO EXPIRE MARCH 29, 1985

OPEN SPACE USES

PARKING: 17,656 SQ. FT.

(SPECIFY - PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND SPECIFICATIONS NOTED ON THE REVERSE SIDE.

Joseph E. [Signature]
BOROUGH SUPERINTENDENT

Charles M. [Signature]
COMMISSIONER

☒ ORIGINAL☒ OFFICE COPY - DEPARTMENT OF BUILDINGS☐ COPY

223553

40 JDA 28

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the WEST side of NOSTRAND AVE
 distant BETWEEN AVE Y & AVE Z feet from the corner formed by the intersection of
 and NOSTRAND AVE
 running thence feet; thence
 thence W. 121' feet; thence N. 100' feet;
 thence E. 11' feet; thence N. 40' feet;
 thence E. 5' feet; thence N. 560' E. 105' S. 700' feet;
 to the point or place of beginning.

M.B. or A.L.T. No. NB 67/88 DATE OF COMPLETION
 BUILDING OCCUPANCY GROUP CLASSIFICATION C

CONSTRUCTION CLASSIFICATION
 HEIGHT 2 STORIES, 21'6" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO		YES	NO
STANDPIPE SYSTEM			AUTOMATIC SPRINKLER SYSTEM		
WATER HYDRANT SYSTEM					
STANDPIPE FIRE TELEPHONE AND SIGNALING SYSTEM					
SMOKE DETECTOR					
FIRE ALARM AND SIGNAL SYSTEM					

STORM DRAINAGE DISCHARGES INTO:

A) STORM SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:

A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:

BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____

THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

BOROUGH **BROOKLYN**DATE: **SEP 14 1984**NO. **222953**ZONING DISTRICT **GS-2/4b**This certificate supersedes C.O. No. **T 22295**THIS CERTIFIES THAT THE NEW-ALTERED-EXISTING-BUILDING-PREMISES LOCATED AT
3804 Postroad AvenueBlock **745** Lot **10**


CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY


STORY	LIVE LOAD LBS PER SQ FT	MAXIMUM NO OF PERSONS PERMITTED	ZONING DWELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Slab on Ground	72			6a	B2	Accessory parking for 43 cars
First	100	73			6a	C	Shoe store
		90			6a	C	Book Store
		117			6a	C	Clothing Store
		4			6a	C	Card Store
		100			6a	C	Toy Store
Total: As Stated above New Code							
Note: 1. The site is one zoning lot and may not be subdivided.							
2. One (1) Fire Guard continuously on premises with Certificate of Fitness from the Fire Department with portable fire extinguishing system in cellar.							
TEMPORARY - For Ninety (90) day to expire December 15, 1984							

OPEN SPACE USES **Parking: 17,466 Square Feet**

SPECIFY: PARKING SPACES, LOADING BERTHS, OTHER USES, NONE

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINEDTHIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
SPECIFICATIONS NOTED ON THE REVERSE SIDE.


BOROUGH SUPERINTENDENT

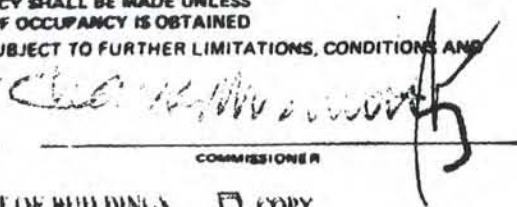

COMMISSIONER

☐ ORIGINAL☐ CHECK COPY DEPARTMENT OF BUILDINGS☐ COPY

222953

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the West side of Westrand Avenue
distant Avenue I and Avenue E feet from the corner formed by the intersection of
Westrand Avenue
running thence W. 121' feet; thence N. 100' feet;
thence E. 11' feet; thence N. 40' feet;
thence E. 3' feet; thence E. 940' E. 105' S. 720' feet;
thence to the point or place of beginning.

N.B. or 67/62 DATE OF COMPLETION
BUILDING OCCUPANCY GROUP CLASSIFICATION 0

CONSTRUCTION CLASSIFICATION
HEIGHT 2 STORIES, 21'-4" FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO
STANDPIPE SYSTEM		
YARD HYDRANT SYSTEM		
STANDPIPE FIRE TELEPHONE AND SIGNALLING SYSTEM		
SMOKE DETECTOR		
FIRE ALARM AND SIGNAL SYSTEM		
AUTOMATIC SPRINKLER SYSTEM		

STORM DRAINAGE DISCHARGES INTO:
A) STORM SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐
SANITARY DRAINAGE DISCHARGES INTO:
A) SANITARY SEWER ☐ B) COMBINED SEWER ☐ C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:
BOARD OF STANDARDS AND APPEALS CAL. NO. _____
CITY PLANNING COMMISSION CAL. NO. _____
OTHERS: _____



THE CITY OF NEW YORK

DEPARTMENT OF BUILDINGS

CERTIFICATE OF OCCUPANCY

TEMPORARY

BOROUGH

BROOKLYN

DATE:

JUN 15 1984

NO.

222545

This certificate supersedes C.O. No.

ZONING DISTRICT C2-2/R4

THIS CERTIFIES that the new-altered-existing-building-premises located at

1804 Westrand Avenue

Block 7445 Lot 1

CONFORMS SUBSTANTIALLY TO THE APPROVED PLANS AND SPECIFICATIONS AND TO THE REQUIREMENTS OF ALL APPLICABLE LAWS, RULES, AND REGULATIONS FOR THE USES AND OCCUPANCIES SPECIFIED HEREIN

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOAD LBS. PER SQ. FT.	MAXIMUM NO. OF PERSONS PERMITTED	ZONING DRELLING OR ROOMING UNITS	BUILDING CODE HABITABLE ROOMS	ZONING USE GROUP	BUILDING CODE OCCUPANCY GROUP	DESCRIPTION OF USE
Cellar	Slab On Ground	72			6c	B2	Accessory parking for 63 cars.
First	100	73			6c	C	Shoe Store
		90			6c		Book Store
		117			6c	C	Clothing Store
		64			6c	C	Card Store
		109			6c	C	Toy Store
TOTAL: As Stated Above							
New Code							
NOTE: 1. The Site is one Zoning Lot and May not be subdivided. 2. One (1) Fire Guard continuously on premises with Certificate of Fitness from the Fire Department with portable fire extinguishing system in cellar.							
TEMPORARY - For Ninety (90) days to expire September 15, 1984.							

OPEN SPACE USES

Parking: 17.656 Square Feet

(SPECIFY - PARKING SPACES, LOADING BERTHS, OTHER USES, NONE)

NO CHANGES OF USE OR OCCUPANCY SHALL BE MADE UNLESS
 A NEW AMENDED CERTIFICATE OF OCCUPANCY IS OBTAINED

THIS CERTIFICATE OF OCCUPANCY IS ISSUED SUBJECT TO FURTHER LIMITATIONS, CONDITIONS AND
 SPECIFICATIONS NOTED ON THE REVERSE SIDE.

BOROUGH SUPERINTENDENT

COMMISSIONER

☐ ORIGINAL☐ OFFICE COPY DEPARTMENT OF BUILDINGS☐ COPY

222545

THAT THE ZONING LOT ON WHICH THE PREMISES IS LOCATED IS BOUNDED AS FOLLOWS:

BEGINNING at a point on the distant **West** side of **Nostrand Avenue**
 running thence **Avenue Y and Avenue X** feet from the corner formed by the intersection of
 thence **W. 121'** feet; thence **N. 100'** feet;
 thence **E. 11'** feet; thence **N. 40'** feet;
 thence **E. 5'** feet; thence **N. 560' E. 105' S. 700'** feet;
 to the point or place of beginning.

N.B. 67/82
 N.B. or ALT. No. DATE OF COMPLETION
 BUILDING OCCUPANCY GROUP CLASSIFICATION **C**

CONSTRUCTION CLASSIFICATION **1B**
 HEIGHT **2** STORIES, **21'-6"** FEET

THE FOLLOWING FIRE DETECTION AND EXTINGUISHING SYSTEMS ARE REQUIRED AND WERE INSTALLED IN COMPLIANCE WITH APPLICABLE LAWS.

	YES	NO
AUTOMATIC SPRINKLER SYSTEM		
STANDPIPE SYSTEM		
WATER HYDRANT SYSTEM		
STANDPIPE FIRE TELEPHONE AND SIGNALING SYSTEM		
SMOKE DETECTOR		
FIRE ALARM AND SIGNAL SYSTEM		

STORM DRAINAGE DISCHARGES INTO:
 A) STORM SEWER ☐ B) COMBINED SEWER ☐

C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

SANITARY DRAINAGE DISCHARGES INTO:
 A) SANITARY SEWER ☐ B) COMBINED SEWER ☐

C) PRIVATE SEWAGE DISPOSAL SYSTEM ☐

LIMITATIONS OR RESTRICTIONS:
 BOARD OF STANDARDS AND APPEALS CAL. NO. _____
 CITY PLANNING COMMISSION CAL. NO. _____
 OTHERS: _____

DEPARTMENT OF BUILDINGS

et BOROUGH OF Brooklyn, THE CITY OF NEW YORK
 Date JUL 23 1965 No. 192328
CERTIFICATE OF OCCUPANCY

NO CHANGES OF USE OR OCCUPANCY NOT CONSISTENT WITH THIS CERTIFICATE SHALL BE MADE UNLESS FIRST APPROVED BY THE BOROUGH SUPERINTENDENT

This certificate supersedes C. O. No. 141492, 168894

THIS CERTIFIES that the ~~new~~ altered ~~existing~~ building—premises located at

3820-3846 Westrand Avenue

Block 745 Lot 1

That the zoning lot and premises above referred to are situated, bounded and described as follows:

BEGINNING at a point on the west side of Westrand Avenue
 distant 0 feet south from the corner formed by the intersection of
 Westrand Avenue and Avenue Y
 running thence south 700 feet; thence west 105 feet;
 thence north 700 feet; thence east 105 feet;
 running thence feet; thence feet;

to the point or place of beginning, conforms substantially to the approved plans and specifications, and to the requirements of the Building Code, the Zoning Resolution and all other laws and ordinances, and of the rules of the Board of Standards and Appeals, applicable to a building of its class and kind at the time the permit was issued; and

CERTIFIES FURTHER that, any provisions of Section 646 of the New York Charter have been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent.

Permit No.—alt. 1810-1963

Construction classification—Class 3 nonfireproof

Occupancy classification—See occupancy below

Height 1 stories, 14 feet.

Date of completion—const. 7-6-65

Located in C 2 - 2

Zoning District.

at time of issuance of permit. plumb. 7-2-65

This certificate is issued subject to the limitations hereinafter specified and to the following resolutions of the Board of Standards and Appeals:
 and The City Planning Commission:

(Calendar numbers to be inserted here)

PERMISSIBLE USE AND OCCUPANCY

Off-Street Parking Spaces for more than five (5) cars

Off-Street Loading Berths

STORY	LIVE LOADS Lbs. per Sq. Ft.	PERSONS ACCOMMODATED	USE
Cellar	ground	-	ordinary, storage
Cellar	ground	10	toilets and lounge
First	120	48	Bank (Use Group 6)
First	120	48	Food Store (Use Group 6)
First	120	100	eating and drinking place (Use Group 6)
First	120	48	dry goods store (Use Group 6)
first	120	48	shoe store (Use group 6)

TOTAL:- AS STATED ABOVE

William F. ...

Borough Superintendent

OFFICE COPY—DEPARTMENT OF BUILDINGS

M. ...

204103173 TO 72101147-10

PERMISSIBLE USE AND OCCUPANCY (continued)

STORY	LIVE LOADS Lbs. per Sq. Ft.	PERSONS ACCOMMODATED	USE
1	100	100	Office
2	100	100	Office
3	100	100	Office
4	100	100	Office
5	100	100	Office
6	100	100	Office
7	100	100	Office
8	100	100	Office
9	100	100	Office
10	100	100	Office
11	100	100	Office
12	100	100	Office
13	100	100	Office
14	100	100	Office
15	100	100	Office
16	100	100	Office
17	100	100	Office
18	100	100	Office
19	100	100	Office
20	100	100	Office
21	100	100	Office
22	100	100	Office
23	100	100	Office
24	100	100	Office
25	100	100	Office
26	100	100	Office
27	100	100	Office
28	100	100	Office
29	100	100	Office
30	100	100	Office
31	100	100	Office
32	100	100	Office
33	100	100	Office
34	100	100	Office
35	100	100	Office
36	100	100	Office
37	100	100	Office
38	100	100	Office
39	100	100	Office
40	100	100	Office
41	100	100	Office
42	100	100	Office
43	100	100	Office

Borough Superintendent

DEPARTMENT OF BUILDINGS

CK

BOROUGH OF Brooklyn

, THE CITY OF NEW YORK

Date

APR 15 1965

No.

191492

CERTIFICATE OF OCCUPANCY

NO CHANGES OF USE OR OCCUPANCY NOT CONSISTENT WITH THIS CERTIFICATE SHALL BE MADE UNLESS FIRST APPROVED BY THE BOROUGH SUPERINTENDENT

This certificate supersedes C. O. No.

THIS CERTIFIES that the ~~new~~ ^{part of} altered ~~existing~~ building—premises located at
3820-3846 Nostrand Avenue, W/S 335' S Ave. Y Block 745 Lot 1

That the zoning lot and premises above referred to are situated, bounded and described as follows:

BEGINNING at a point on the **west** side of **Nostrand Avenue**
 distant **0** feet **south** from the corner formed by the intersection of
Nostrand Avenue and **Avenue Y**
 running thence **south 700** feet; thence **west 105** feet;
 thence **north 700** feet; thence **east 105** feet;
 running thence _____ feet; thence _____ feet;

to the point or place of beginning, conforms substantially to the approved plans and specifications, and to the requirements of the Building Code, the Zoning Resolution and all other laws and ordinances, and of the rules of the Board of Standards and Appeals, applicable to a building of its class and kind at the time the permit was issued; and

CERTIFIES FURTHER that, any provisions of Section 646e of the New York Charter have been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent.

Alt. 1810-1963 Construction classification—**class 3**

Occupancy classification—**Bank (Use Group 6)** Height **1** stories, **14** feet.

Date of completion—**const. 4-8-65** Located in **C 2-2** Zoning District.

at time of issuance of permit **plumb. 11-12-64** **P. S. 4-13-65**

This certificate is issued subject to the limitations hereinafter specified and to the following resolutions of the Board of Standards and Appeals:
 and The City Planning Commission: } (Calendar numbers to be inserted here)

PERMISSIBLE USE AND OCCUPANCY

Off-Street Parking Spaces _____

Off-Street Loading Berths _____

STORY	LIVE LOADS Lbs. per Sq. Ft.	PERSONS ACCOMMODATED	USE
Cellar	ground	10	toilets and lounge
First	120	48	bank (Use Group 6)
TOTAL:- Bank - (Use Group 6)			
TEMPORARY - Ninety (90) days - EXPIRES JULY 14, 1965			

OFFICE COPY—DEPARTMENT OF BUILDINGS

Borough Superintendent

DEPARTMENT OF BUILDINGS

THE CITY OF NEW YORK

BOROUGH OF MANHATTAN

PERMISSIBLE USE AND OCCUPANCY (continued)

101330

CERTIFICATE OF OCCUPANCY

STORY	LIVE LOADS Lb. per Sq. Ft.	PERSONS ACCOMMODATED	USE
1	100	100	Office
2	100	100	Office
3	100	100	Office
4	100	100	Office
5	100	100	Office
6	100	100	Office
7	100	100	Office
8	100	100	Office
9	100	100	Office
10	100	100	Office
11	100	100	Office
12	100	100	Office
13	100	100	Office
14	100	100	Office
15	100	100	Office
16	100	100	Office
17	100	100	Office
18	100	100	Office
19	100	100	Office
20	100	100	Office
21	100	100	Office
22	100	100	Office
23	100	100	Office
24	100	100	Office
25	100	100	Office
26	100	100	Office
27	100	100	Office
28	100	100	Office
29	100	100	Office
30	100	100	Office
31	100	100	Office
32	100	100	Office
33	100	100	Office
34	100	100	Office
35	100	100	Office
36	100	100	Office
37	100	100	Office
38	100	100	Office
39	100	100	Office
40	100	100	Office
41	100	100	Office
42	100	100	Office
43	100	100	Office
44	100	100	Office
45	100	100	Office
46	100	100	Office
47	100	100	Office
48	100	100	Office
49	100	100	Office
50	100	100	Office
51	100	100	Office
52	100	100	Office
53	100	100	Office
54	100	100	Office
55	100	100	Office
56	100	100	Office
57	100	100	Office
58	100	100	Office
59	100	100	Office
60	100	100	Office
61	100	100	Office
62	100	100	Office
63	100	100	Office
64	100	100	Office
65	100	100	Office
66	100	100	Office
67	100	100	Office
68	100	100	Office
69	100	100	Office
70	100	100	Office
71	100	100	Office
72	100	100	Office
73	100	100	Office
74	100	100	Office
75	100	100	Office
76	100	100	Office
77	100	100	Office
78	100	100	Office
79	100	100	Office
80	100	100	Office
81	100	100	Office
82	100	100	Office
83	100	100	Office
84	100	100	Office
85	100	100	Office
86	100	100	Office
87	100	100	Office
88	100	100	Office
89	100	100	Office
90	100	100	Office
91	100	100	Office
92	100	100	Office
93	100	100	Office
94	100	100	Office
95	100	100	Office
96	100	100	Office
97	100	100	Office
98	100	100	Office
99	100	100	Office
100	100	100	Office

Borough Superintendent

OFFICE OF THE DEPARTMENT OF BUILDINGS

DEPARTMENT OF BUILDINGS

BOROUGH OF

BROOKLYN

, THE CITY OF NEW YORK

No.

5-984

Date

CERTIFICATE OF OCCUPANCY

JAN 11 1960

(Standard form adopted by the Board of Standards and Appeals and issued pursuant to Section 646 of the New York Charter, and Sections C.20-181.0 to C.26-187.0 inclusive Administrative Code 2.1.3.1. to 2.1.3.7, Building Code.)

This certificate supersedes C. O. No.

To the owner or owners of the building or premises:

THIS CERTIFIES that the new ~~substructure~~ building—premises located at

3820 to 3846 Westrand Avenue, West Side, 335'0" South of Avenue Y

Block 7443 Lot 15 (tentative)

, conforms substantially to the approved plans and specifications, and to the requirements of the building code and all other laws and ordinances, and of the rules and regulations of the Board of Standards and Appeals, applicable to a building of its class and kind at the time the permit was issued; and

CERTIFIES FURTHER that, any provisions of Section 646F of the New York Charter have been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent.

N.B. ~~const~~ No. 656/1959

Construction classification—non-fireproof

Occupancy classification—market, parking lot

Height

1 stories,

14 feet.

Date of completion—

const: 12/29/59 &

1/5/60

Located in

Local Retail

Use District.

D Area

Height Zone at time of issuance of permit

This certificate is issued subject to the limitations hereinafter specified and to the following resolutions of the Board of Standards and Appeals:

(Calendar numbers to be inserted here)

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOADS lbs. per Sq. Ft.	PERSONS ACCOMMODATED			USE
		MALE	FEMALE	TOTAL	
cellar	ground	-	-	-	ordinary storage
first	120	200	200	400	market
on ground	ground	-	-	-	parking for more than five (5) cars
TOTAL - market and parking lot					

**NO CHANCES OF USE OR OCCUPANCY NOT CONSISTENT WITH THIS CERTIFICATE SHALL
BE MADE UNLESS FIRST APPROVED BY THE BOROUGH SUPERINTENDENT**

Unless an approval for the same has been obtained from the Borough Superintendent, no change or rearrangement in the structural parts of the building, or affecting the light and ventilation of any part thereof, or in the exit facilities, shall be made; no enlargement, whether by extending on any side or by increasing in height shall be made; nor shall the building be moved from one location or position to another; nor shall there be any reduction or diminution of the area of the lot or plot on which the building is located.

The building or any part thereof shall not be used for any purpose other than that for which it is certified.

The superimposed, uniformly distributed loads, or concentrated loads producing the same stresses in the construction in any story shall not exceed the live loads specified on reverse side; the number of persons of either sex in any story shall not exceed that specified when sex is indicated, nor shall the aggregate number of persons in any story exceed the specified total; and the use to which any story may be put shall be restricted to that fixed by this certificate except as specifically stated.

This certificate does not in any way relieve the owner or owners or any other person or persons in possession or control of the building, or any part thereof from obtaining such other permits, licenses or approvals as may be prescribed by law for the uses or purposes for which the building is designed or intended; nor from obtaining the special certificates required for the use and operation of elevators; nor from the installation of fire alarm systems where required by law; nor from complying with any lawful order for additional fire extinguishing appliances under the discretionary powers of the fire commissioner; nor from complying with any lawful order issued with the object of maintaining the building in a safe or lawful condition; nor from complying with any authorized direction to remove encroachments into a public highway or other public place, whether attached to or part of the building or not.

If this certificate is marked "Temporary", it is applicable only to those parts of the building indicated on its face, and certifies to the legal use and occupancy of only such parts of the building; it is subject to all the provisions and conditions applying to a final or permanent certificate; it is not applicable to any building under the jurisdiction of the Housing Division unless it is also approved and endorsed by them, and it must be replaced by a full certificate at the date of expiration.

If this certificate is for an existing building, erected prior to March 14, 1916, it has been duly inspected and it has been found to have been occupied or arranged to be occupied prior to March 14, 1916, as noted on the reverse side, and that on information and belief, since that date there has been no alteration or conversion to a use that changed its classification as defined in the Building Code, or that would necessitate compliance with some special requirement or with the State Labor Law or any other law or ordinance; that there are no notices of violations or orders pending in the Department of Buildings at this time; that Section 646F of the New York City Charter has been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent, and that, so long as the building is not altered, except by permission of the Borough Superintendent, the existing use and occupancy may be continued.

"§ 646 F. No certificate of occupancy shall be issued for any building, structure, enclosure, place or premises wherein containers for combustibles, chemicals, explosives, inflammables and other dangerous substances, articles, compounds or mixtures are stored, or wherein automatic or other fire alarm systems or fire extinguishing equipment are required by law to be or are installed, until the fire commissioner has tested and inspected and has certified his approval in writing of the installation of such containers, systems or equipment to the Borough Superintendent of the borough in which the installation has been made. Such approval shall be recorded on the certificate of occupancy."

Additional copies of this certificate will be furnished to persons having an interest in the building or premises, upon payment of a fee of fifty cents per copy.

DEPARTMENT OF BUILDINGS

BOROUGH OF **BROOKLYN**, THE CITY OF NEW YORKNo. **108897**

Date

CERTIFICATE OF OCCUPANCY **1960**

(Standard form adopted by the Board of Standards and Appeals and issued pursuant to Section 646 of the New York Charter, and Sections C.26-181.0 to C.26-187.0 inclusive Administrative Code 2.1.3.1. to 2.1.3.7. Building Code.)

This certificate supersedes C. O. No.

To the owner or owners of the building or premises:

THIS CERTIFIES that the new ~~building~~ building—premises located at
3780-3818 Westrand Avenue, South West Corner of Avenue Y

Block **7445** Lot **1 (tentative)**

, conforms substantially to the approved plans and specifications, and to the requirements of the building code and all other laws and ordinances, and of the rules and regulations of the Board of Standards and Appeals, applicable to a building of its class and kind at the time the permit was issued; and

CERTIFIES FURTHER that, any provisions of Section 646F of the New York Charter have been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent.

N.B. ~~XXXX~~ No. **655/1959**Construction classification—**non-fireproof**

Occupancy classification—**stores and bank** Height **1** stories, **19** feet.

Date of completion—**comstr. 12/29/59 & 1/5/60** Located in **Local Retail** Use District.

D Area **plumb. 12/4/59** Height Zone at time of issuance of permit

This certificate is issued subject to the limitations hereinafter specified and to the following resolutions of the Board of Standards and Appeals: (Calendar numbers to be inserted here)

PERMISSIBLE USE AND OCCUPANCY

STORY	LIVE LOADS Lbs. per Sq. Ft.	PERSONS ACCOMMODATED			USE
		MALE	FEMALE	TOTAL	
cellar	ground	-	-	-	ordinary storage
first	100	325	325	650	stores and bank
on ground		-	-	-	parking for more than five (5) cars
TOTAL - as stated above					

**NO CHANGES OF USE OR OCCUPANCY NOT CONSISTENT WITH THIS CERTIFICATE SHALL
BE MADE UNLESS FIRST APPROVED BY THE BOROUGH SUPERINTENDENT**

Unless an approval for the same has been obtained from the Borough Superintendent, no change or rearrangement in the structural parts of the building, or affecting the light and ventilation of any part thereof, or in the exit facilities, shall be made; no enlargement, whether by extending on any side or by increasing in height shall be made; nor shall the building be moved from one location or position to another; nor shall there be any reduction or diminution of the area of the lot or plot on which the building is located.

The building or any part thereof shall not be used for any purpose other than that for which it is certified.

The superimposed, uniformly distributed loads, or concentrated loads producing the same stresses in the construction in any story shall not exceed the live loads specified on reverse side; the number of persons of either sex in any story shall not exceed that specified when sex is indicated, nor shall the aggregate number of persons in any story exceed the specified total; and the use to which any story may be put shall be restricted to that fixed by this certificate except as specifically stated.

This certificate does not in any way relieve the owner or owners or any other person or persons in possession or control of the building, or any part thereof from obtaining such other permits, licenses or approvals as may be prescribed by law for the uses or purposes for which the building is designed or intended; nor from obtaining the special certificates required for the use and operation of elevators; nor from the installation of fire alarm systems where required by law; nor from complying with any lawful order for additional fire extinguishing appliances under the discretionary powers of the fire commissioner; nor from complying with any lawful order issued with the object of maintaining the building in a safe or lawful condition; nor from complying with any authorized direction to remove encroachments into a public highway or other public place, whether attached to or part of the building or not.

If this certificate is marked "Temporary", it is applicable only to those parts of the building indicated on its face, and certifies to the legal use and occupancy of only such parts of the building; it is subject to all the provisions and conditions applying to a final or permanent certificate; it is not applicable to any building under the jurisdiction of the Housing Division unless it is also approved and endorsed by them, and it must be replaced by a full certificate at the date of expiration.

If this certificate is for an existing building, erected prior to March 14, 1916, it has been duly inspected and it has been found to have been occupied or arranged to be occupied prior to March 14, 1916, as noted on the reverse side, and that on information and belief, since that date there has been no alteration or conversion to a use that changed its classification as defined in the Building Code, or that would necessitate compliance with some special requirement or with the State Labor Law or any other law or ordinance; that there are no notices of violations or orders pending in the Department of Buildings at this time; that Section 646F of the New York City Charter has been complied with as certified by a report of the Fire Commissioner to the Borough Superintendent, and that, so long as the building is not altered, except by permission of the Borough Superintendent, the existing use and occupancy may be continued.

"§ 646 F. No certificate of occupancy shall be issued for any building, structure, enclosure, place or premises wherein containers for combustibles, chemicals, explosives, inflammables and other dangerous substances, articles, compounds or mixtures are stored, or wherein automatic or other fire alarm systems or fire extinguishing equipment are required by law to be or are installed, until the fire commissioner has tested and inspected and has certified his approval in writing of the installation of such containers, systems or equipment to the Borough Superintendent of the borough in which the installation has been made. Such approval shall be recorded on the certificate of occupancy."

Additional copies of this certificate will be furnished to persons having an interest in the building or premises, upon payment of a fee of fifty cents per copy.

10.7 AERIAL PHOTOGRAPHS



Due to the metropolitan area in that the subject property is located within and the sufficient historical data collected from additional sources, aerial photographs were not reviewed for the subject property.

10.8 HISTORICAL INFORMATION

2007 Certified Sanborn Map




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

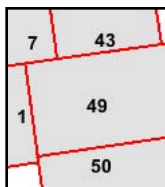


Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 18, Sheet 1
Volume 14, Sheet 7





2006 Certified Sanborn Map

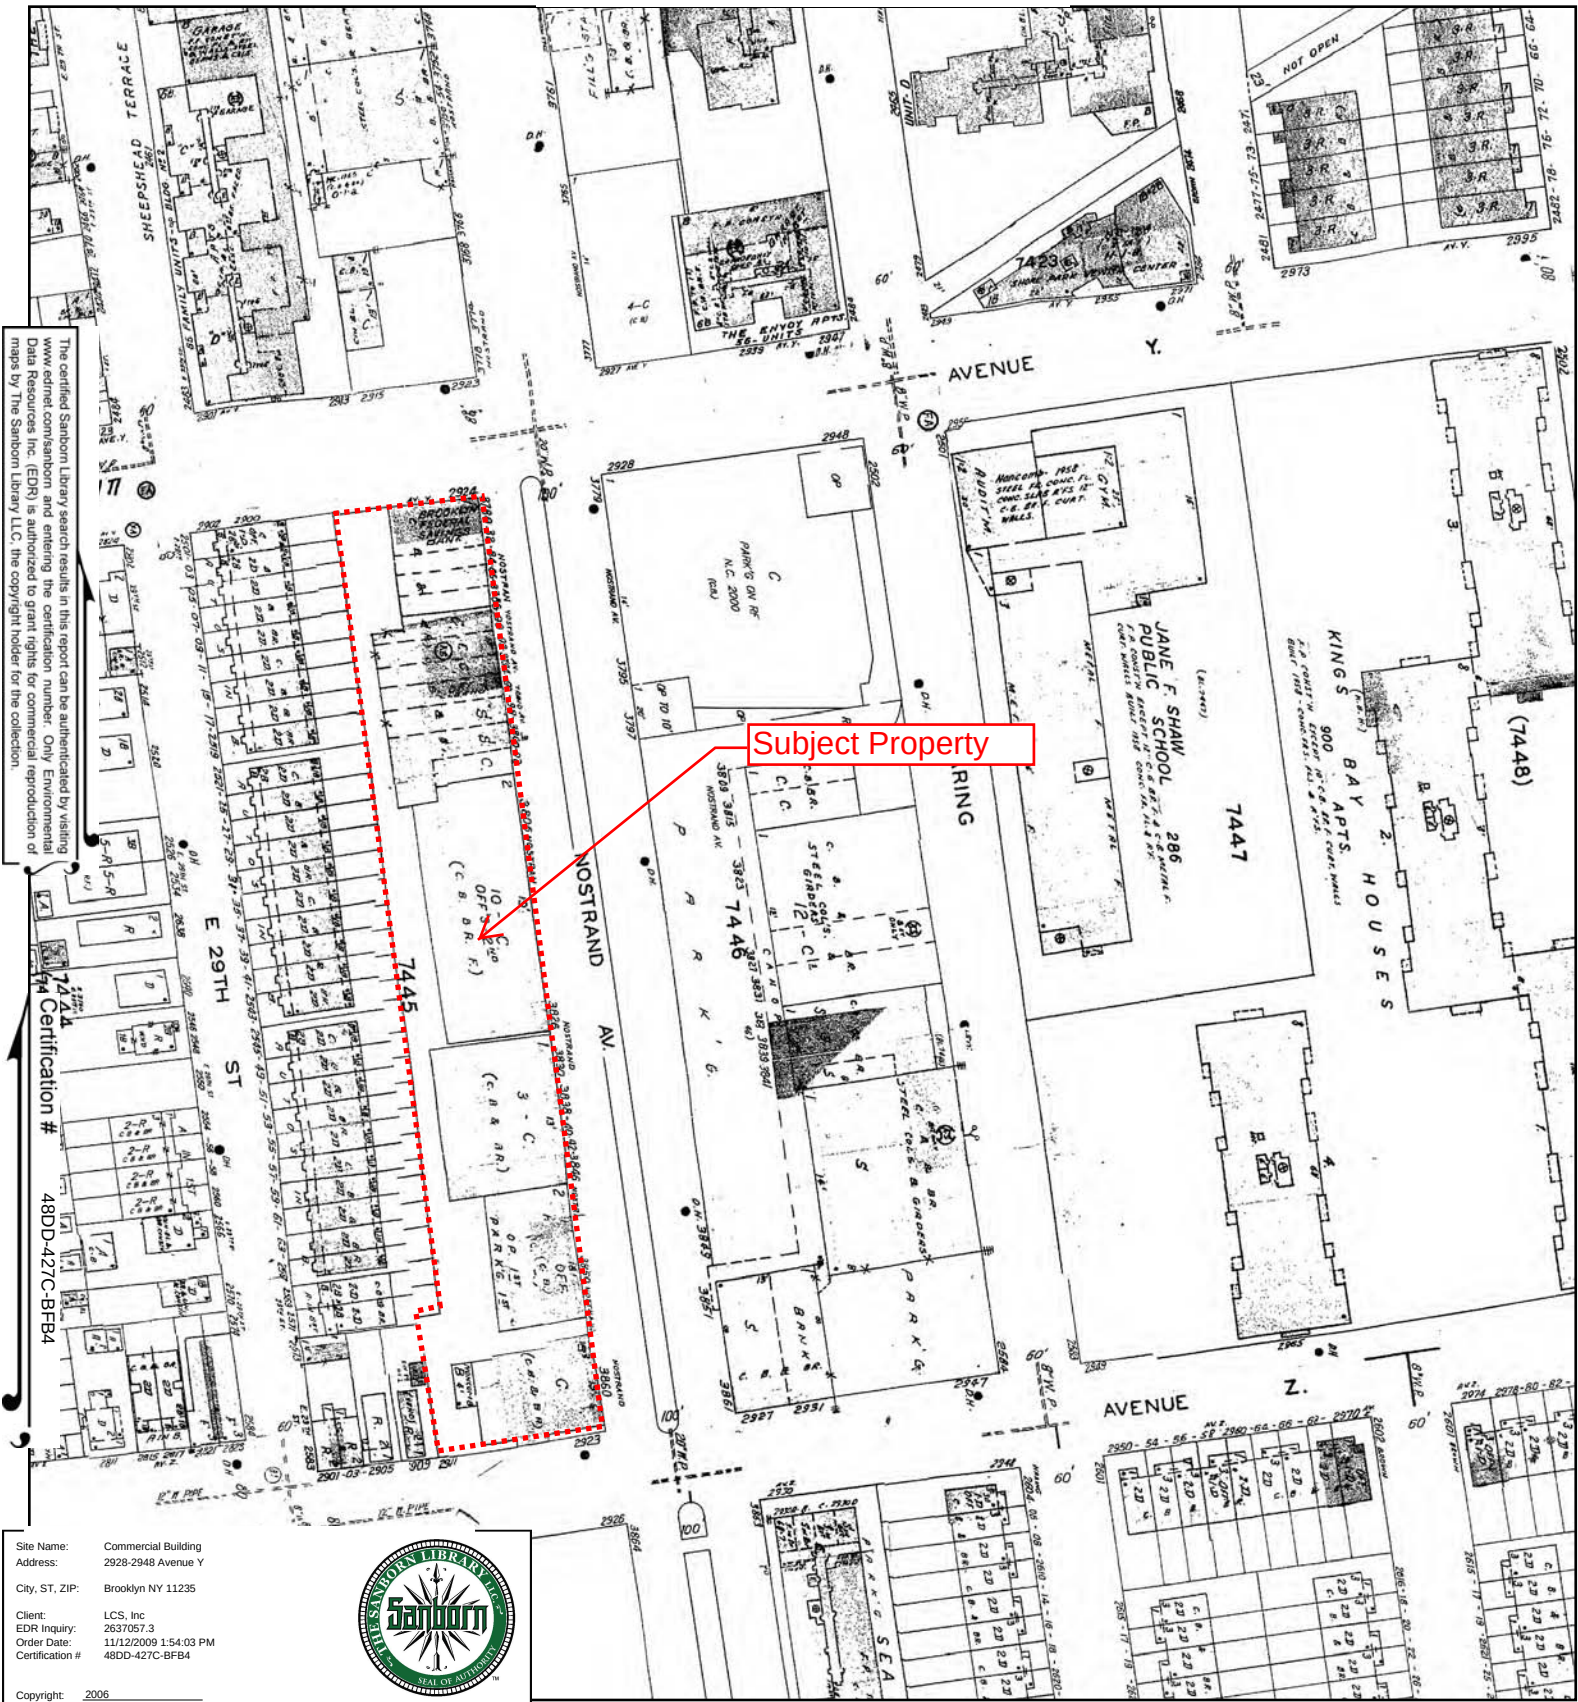

2005 Certified Sanborn Map

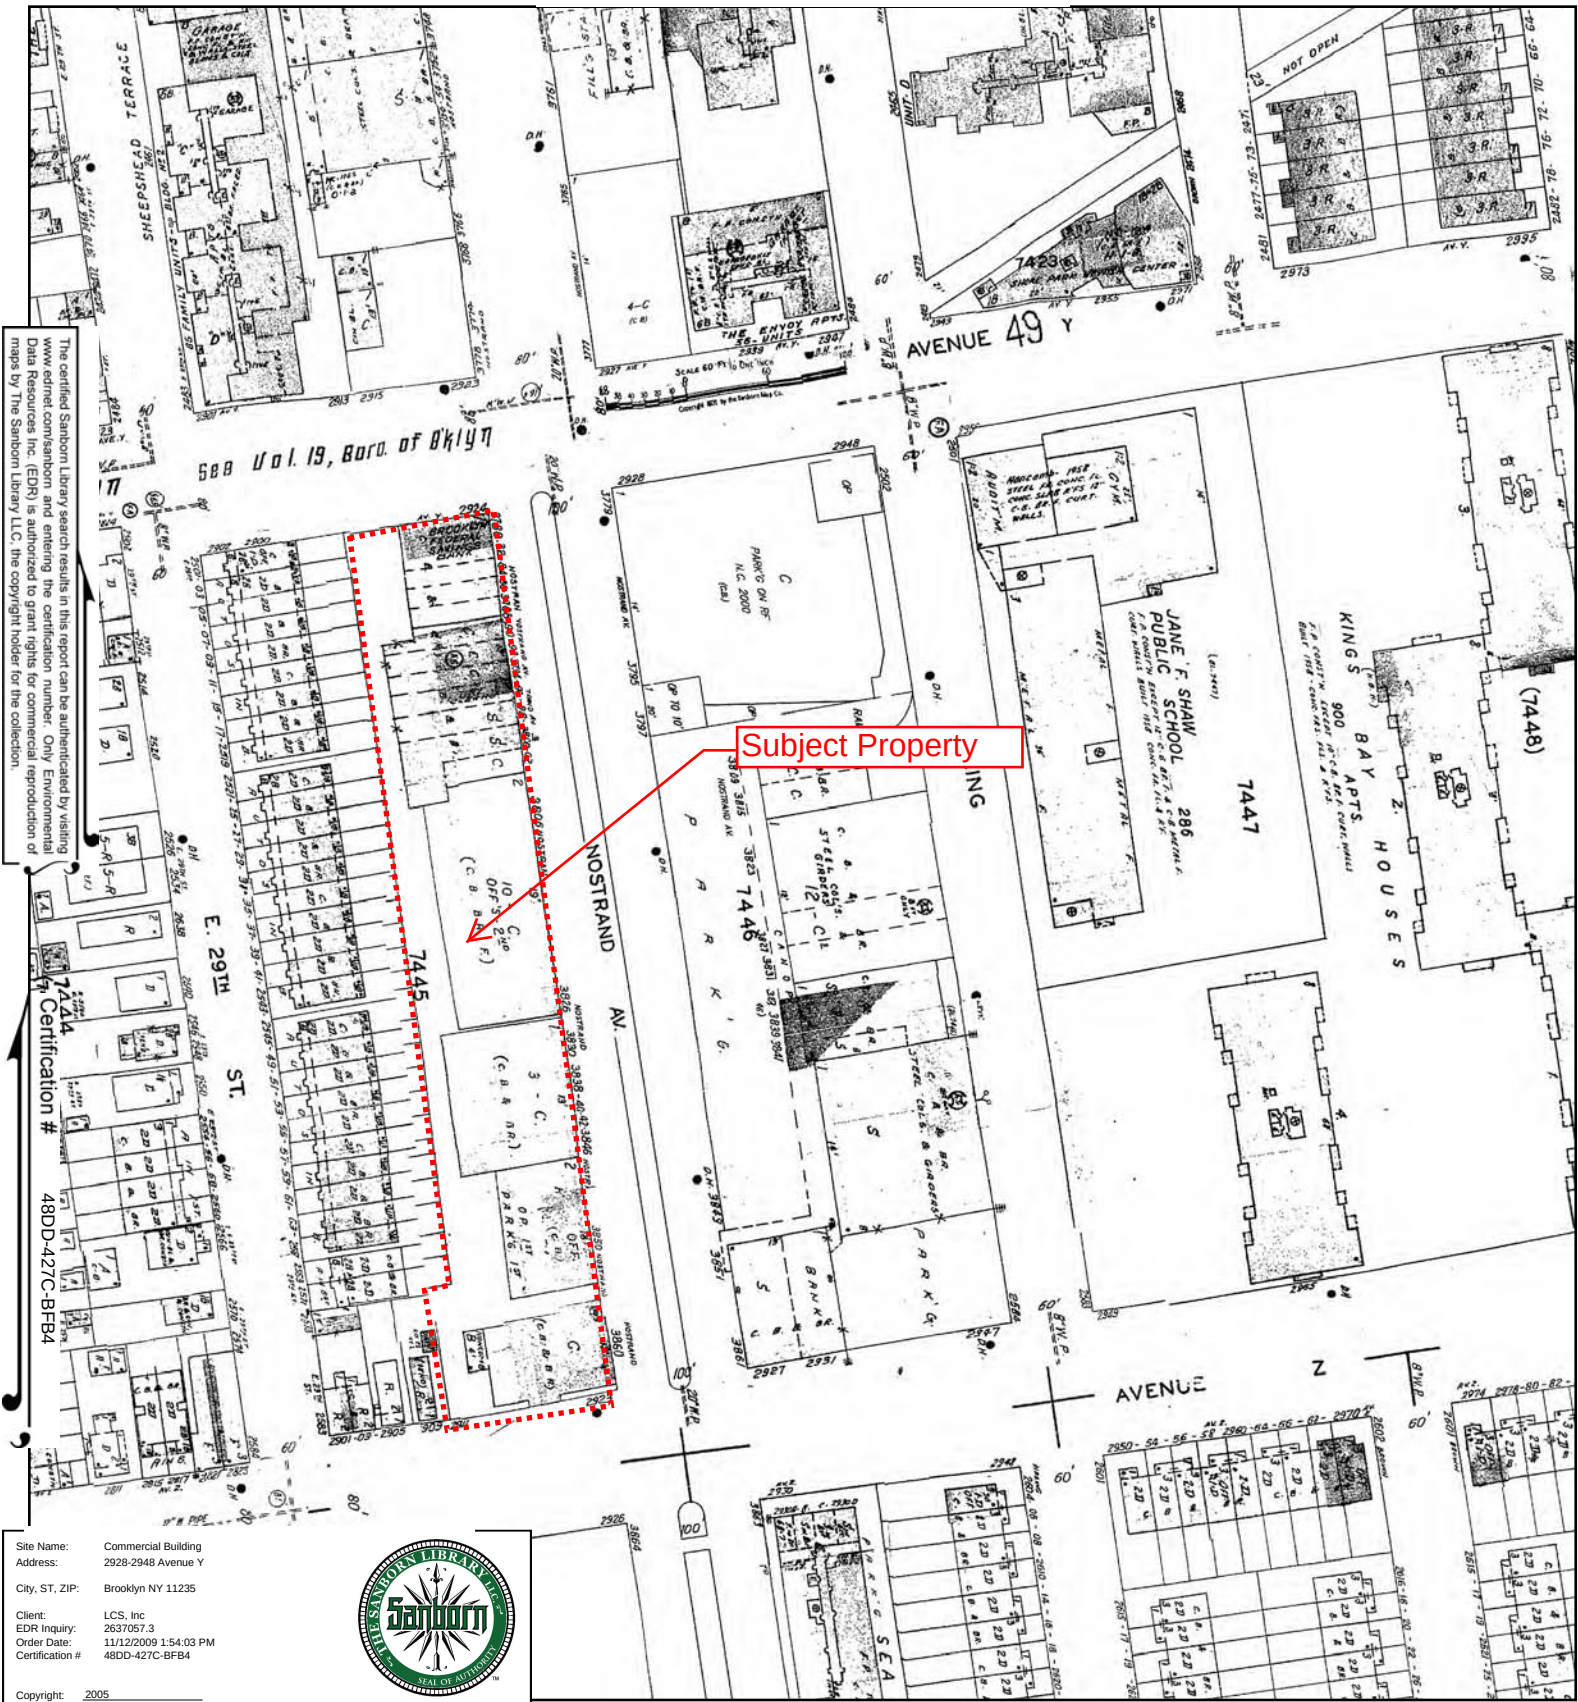

This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

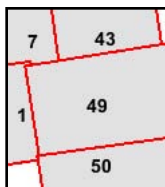



Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50
 Volume 14, Sheet 7
 Volume 18, Sheet 1



2004 Certified Sanborn Map




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

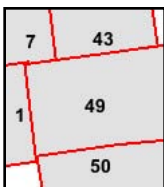



Volume 18, Sheet 1
 Volume 14, Sheet 7
 Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50



2003 Certified Sanborn Map

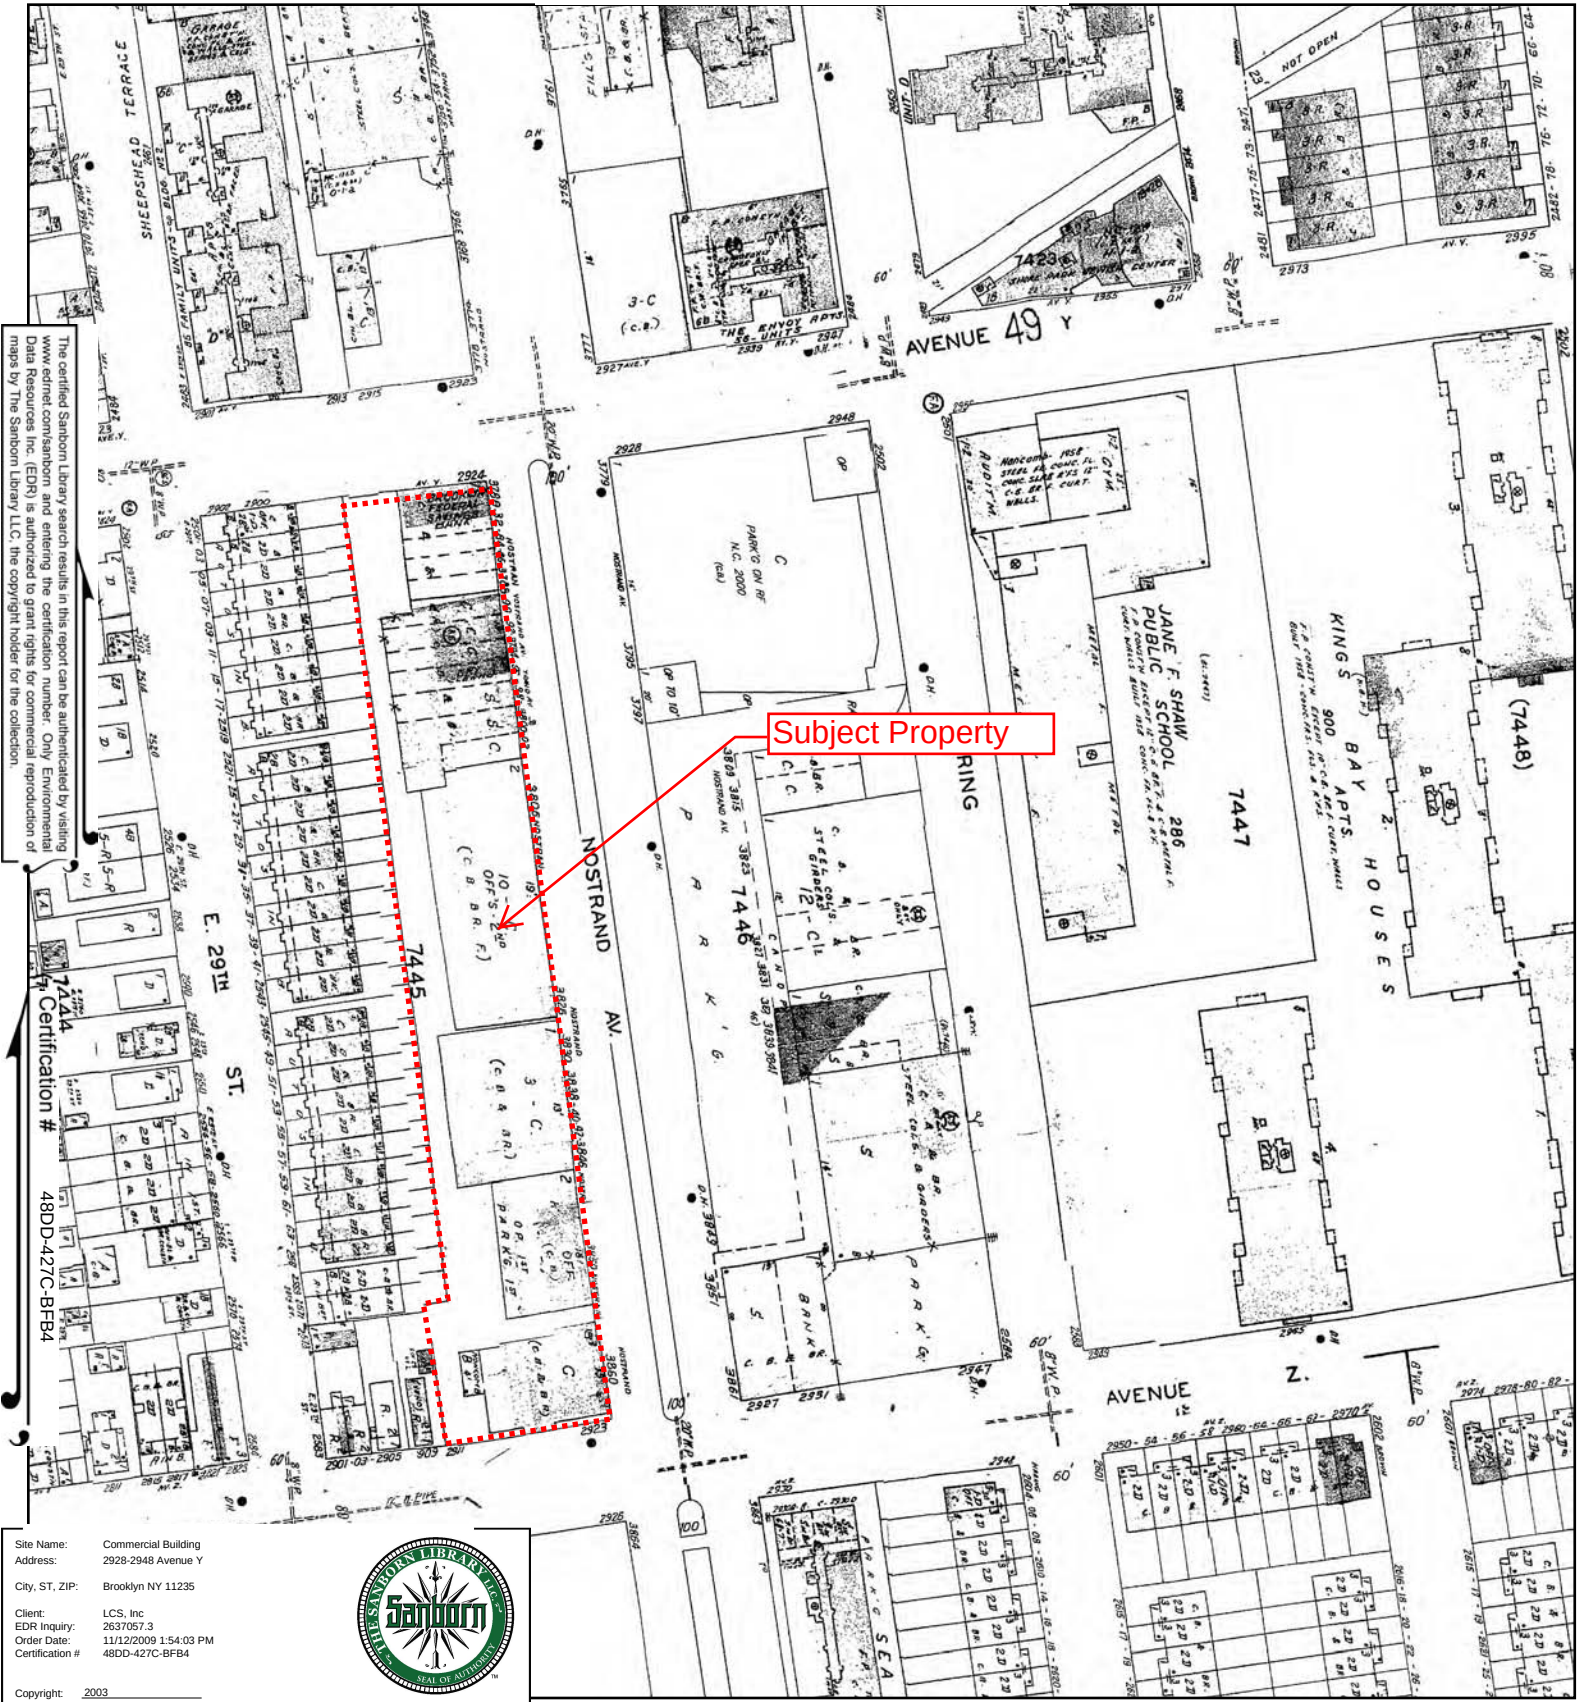


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

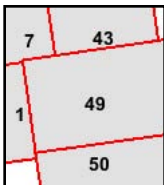


Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 18, Sheet 1
Volume 14, Sheet 7



2002 Certified Sanborn Map

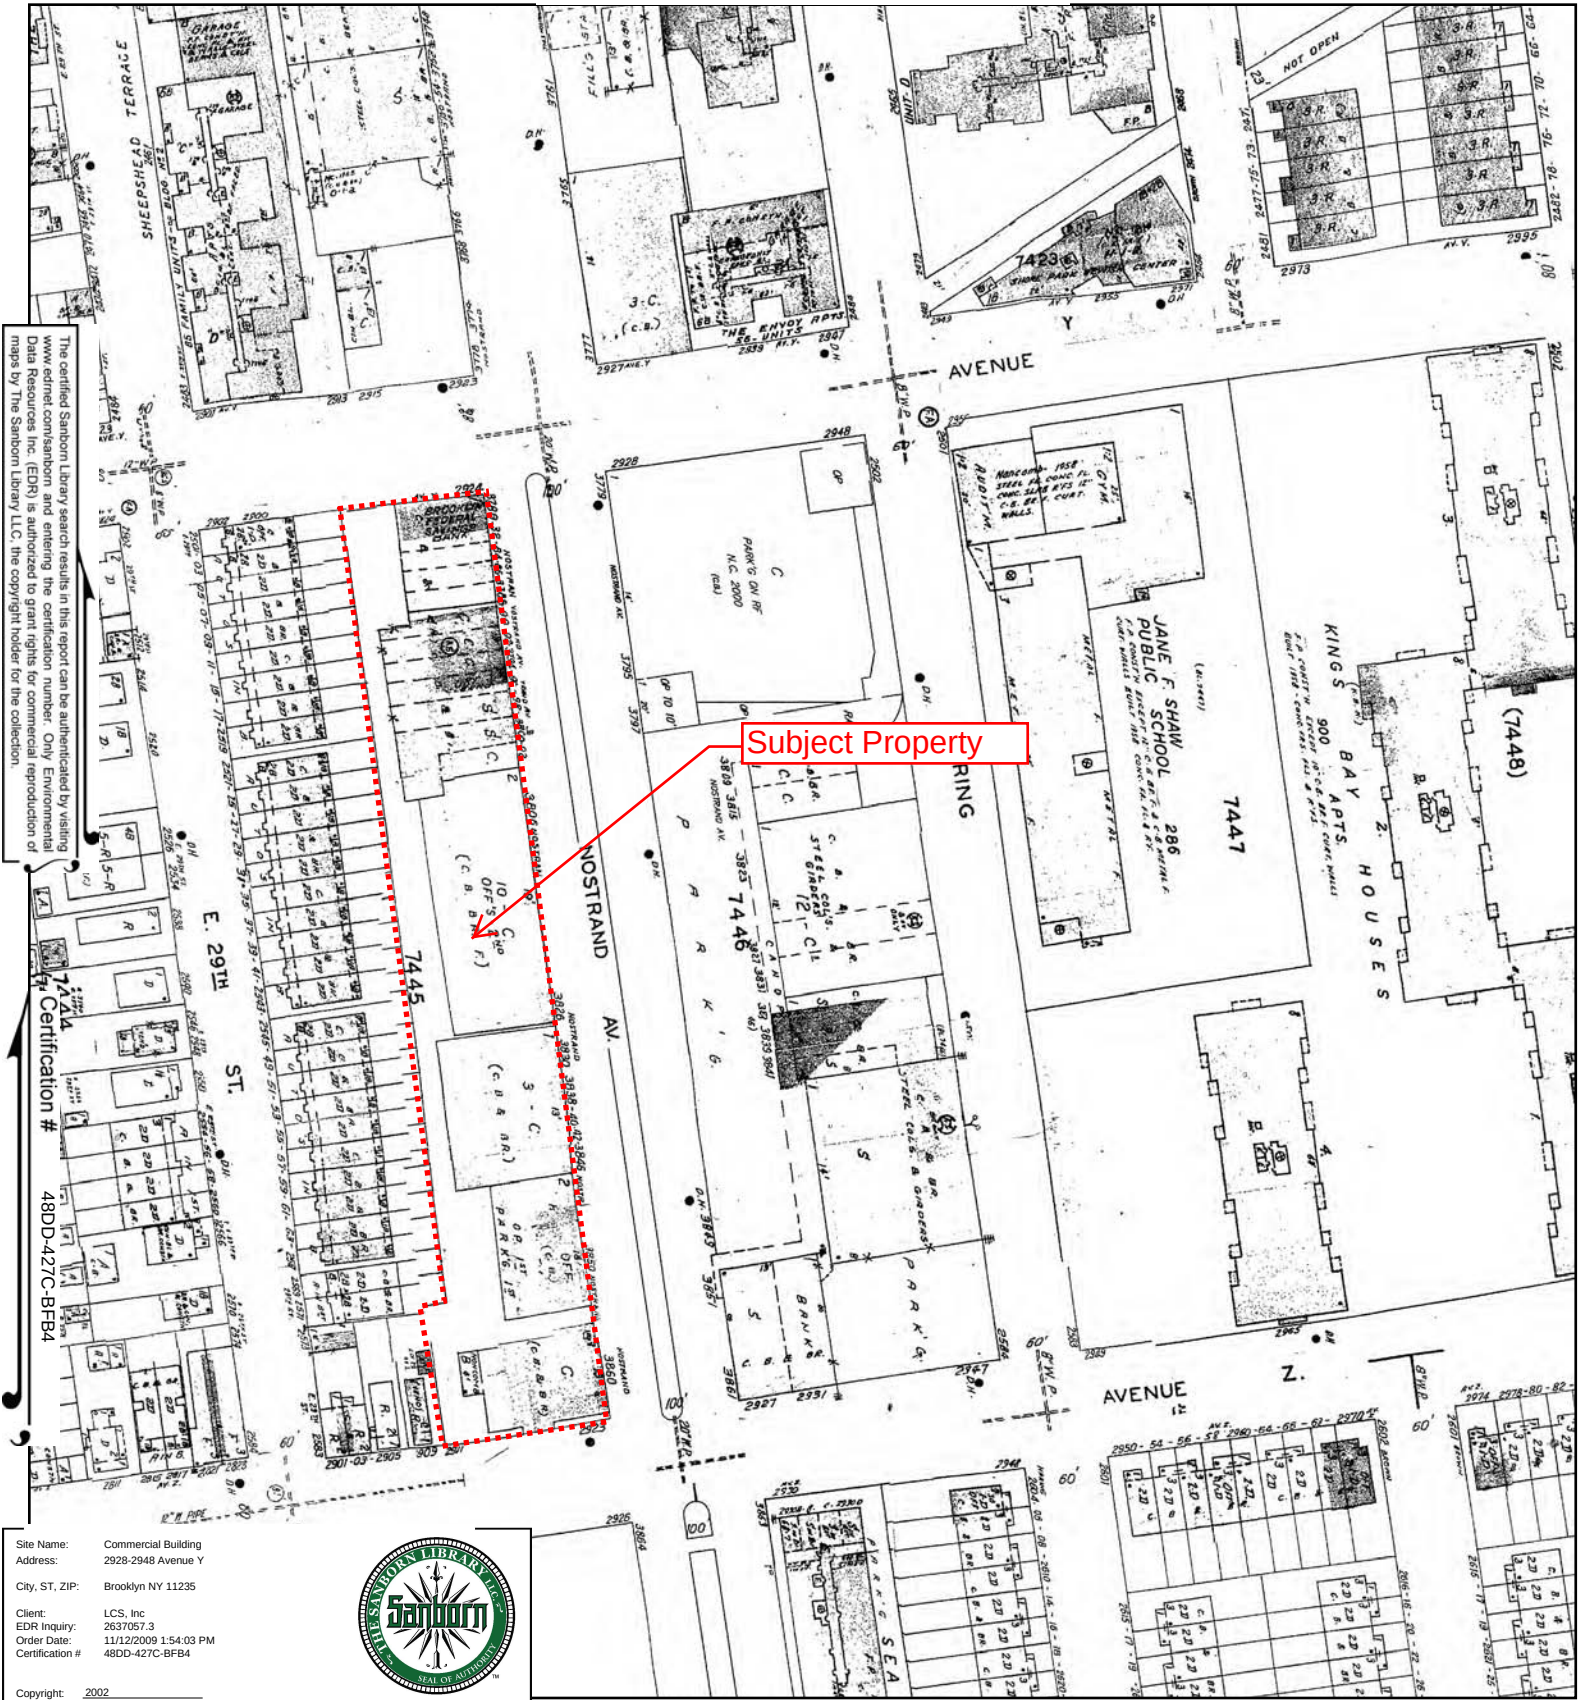


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

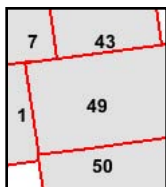

Volume 14, Sheet 7
 Volume 18, Sheet 1
 Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50



2001 Certified Sanborn Map

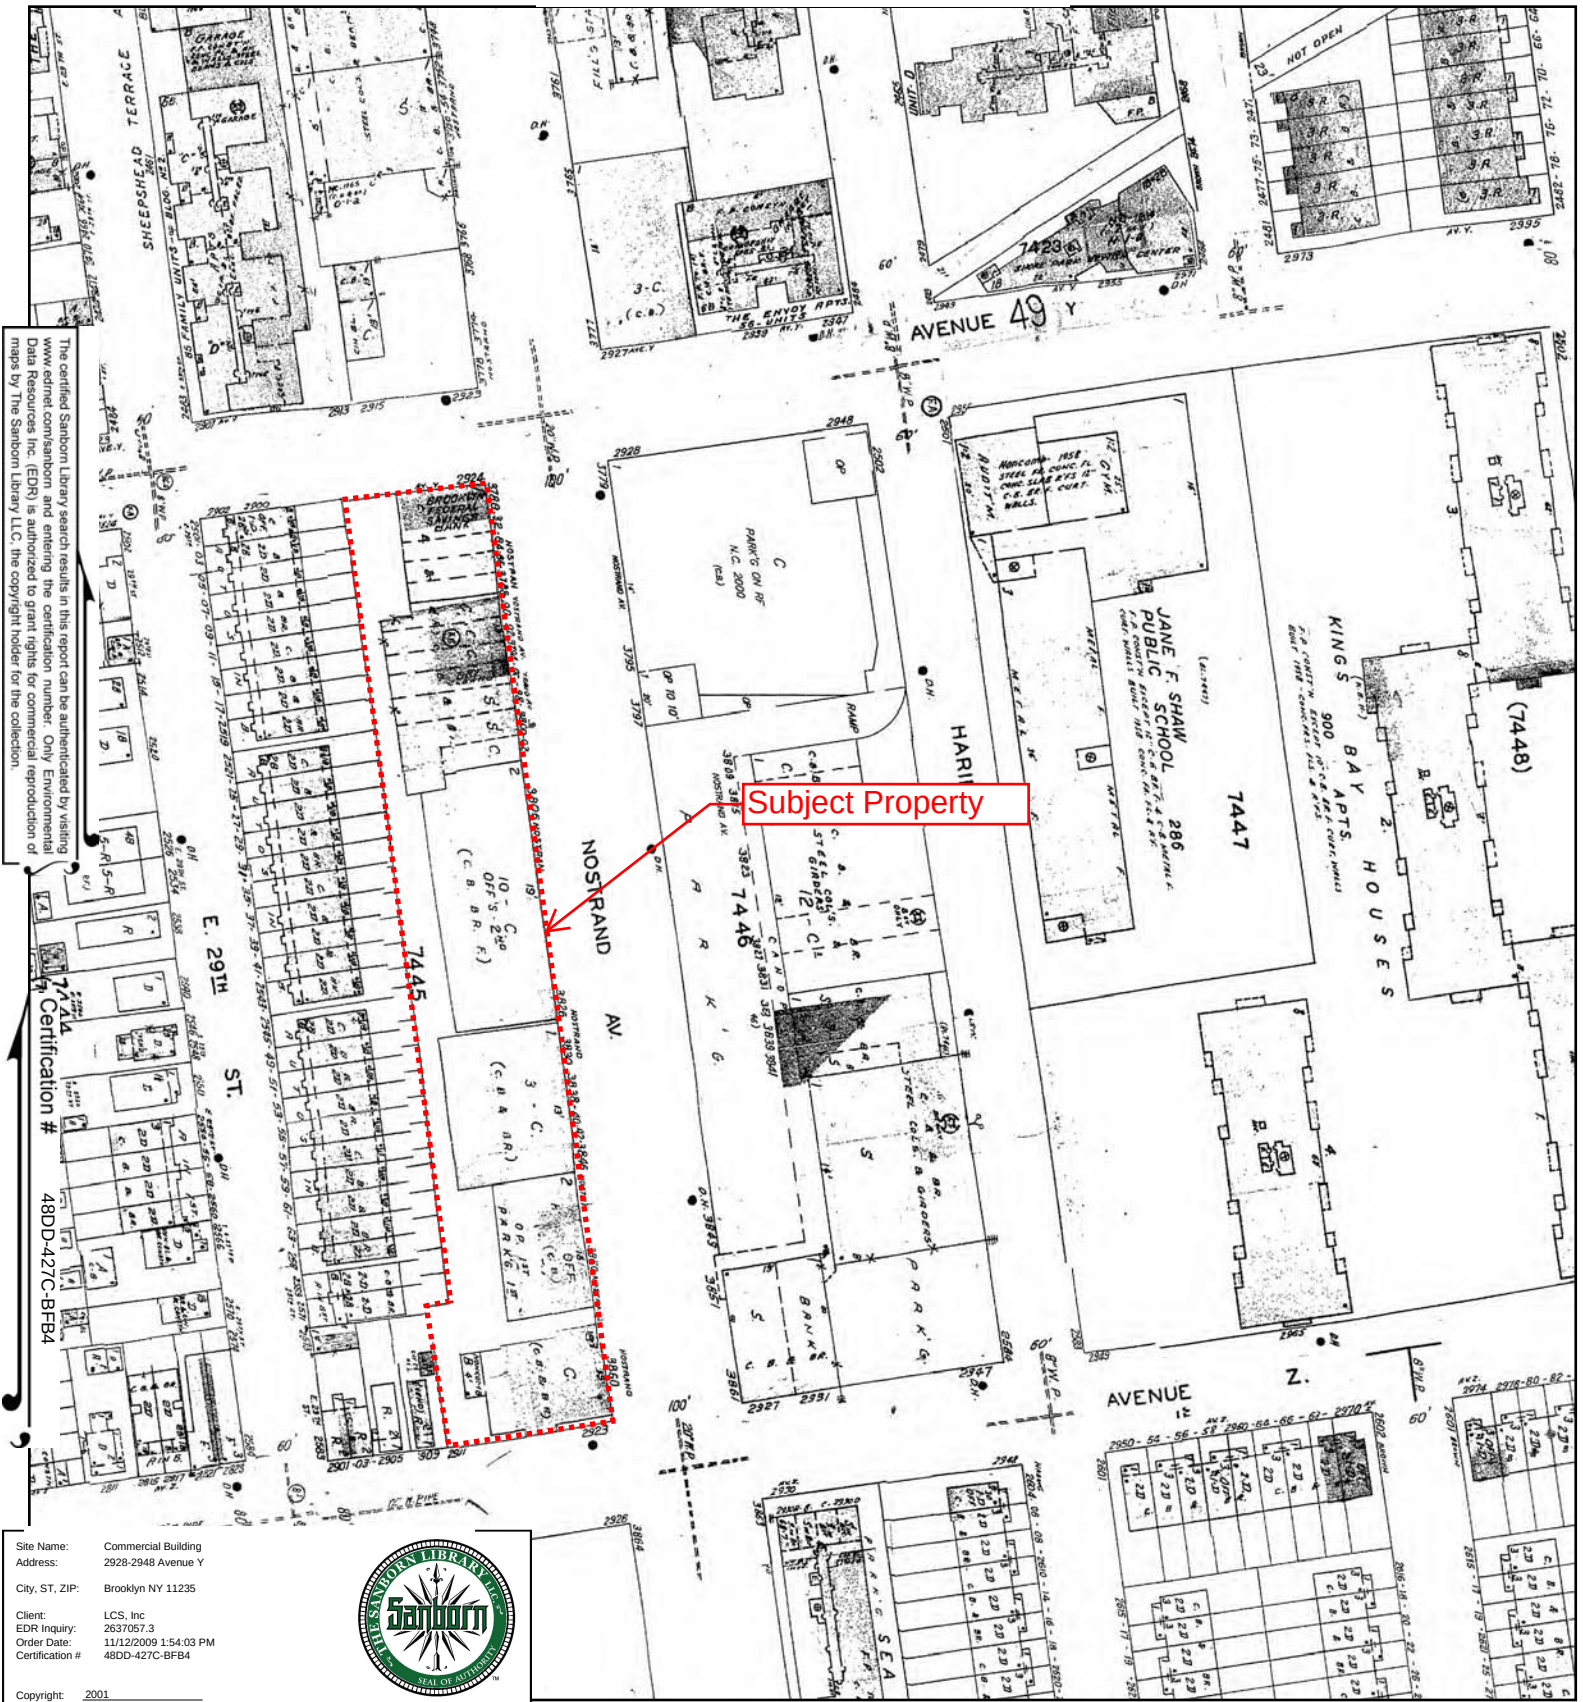

Site Name: Commercial Building
 Address: 2928-2948 Avenue Y
 City, ST, ZIP: Brooklyn NY 11235
 Client: LCS, Inc
 EDR Inquiry: 2637057.3
 Order Date: 11/12/2009 1:54:03 PM
 Certification # 48DD-427C-BF84




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

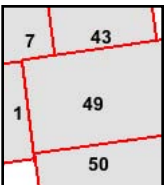



Volume 18, Sheet 1
 Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50
 Volume 14, Sheet 7



1996 Certified Sanborn Map

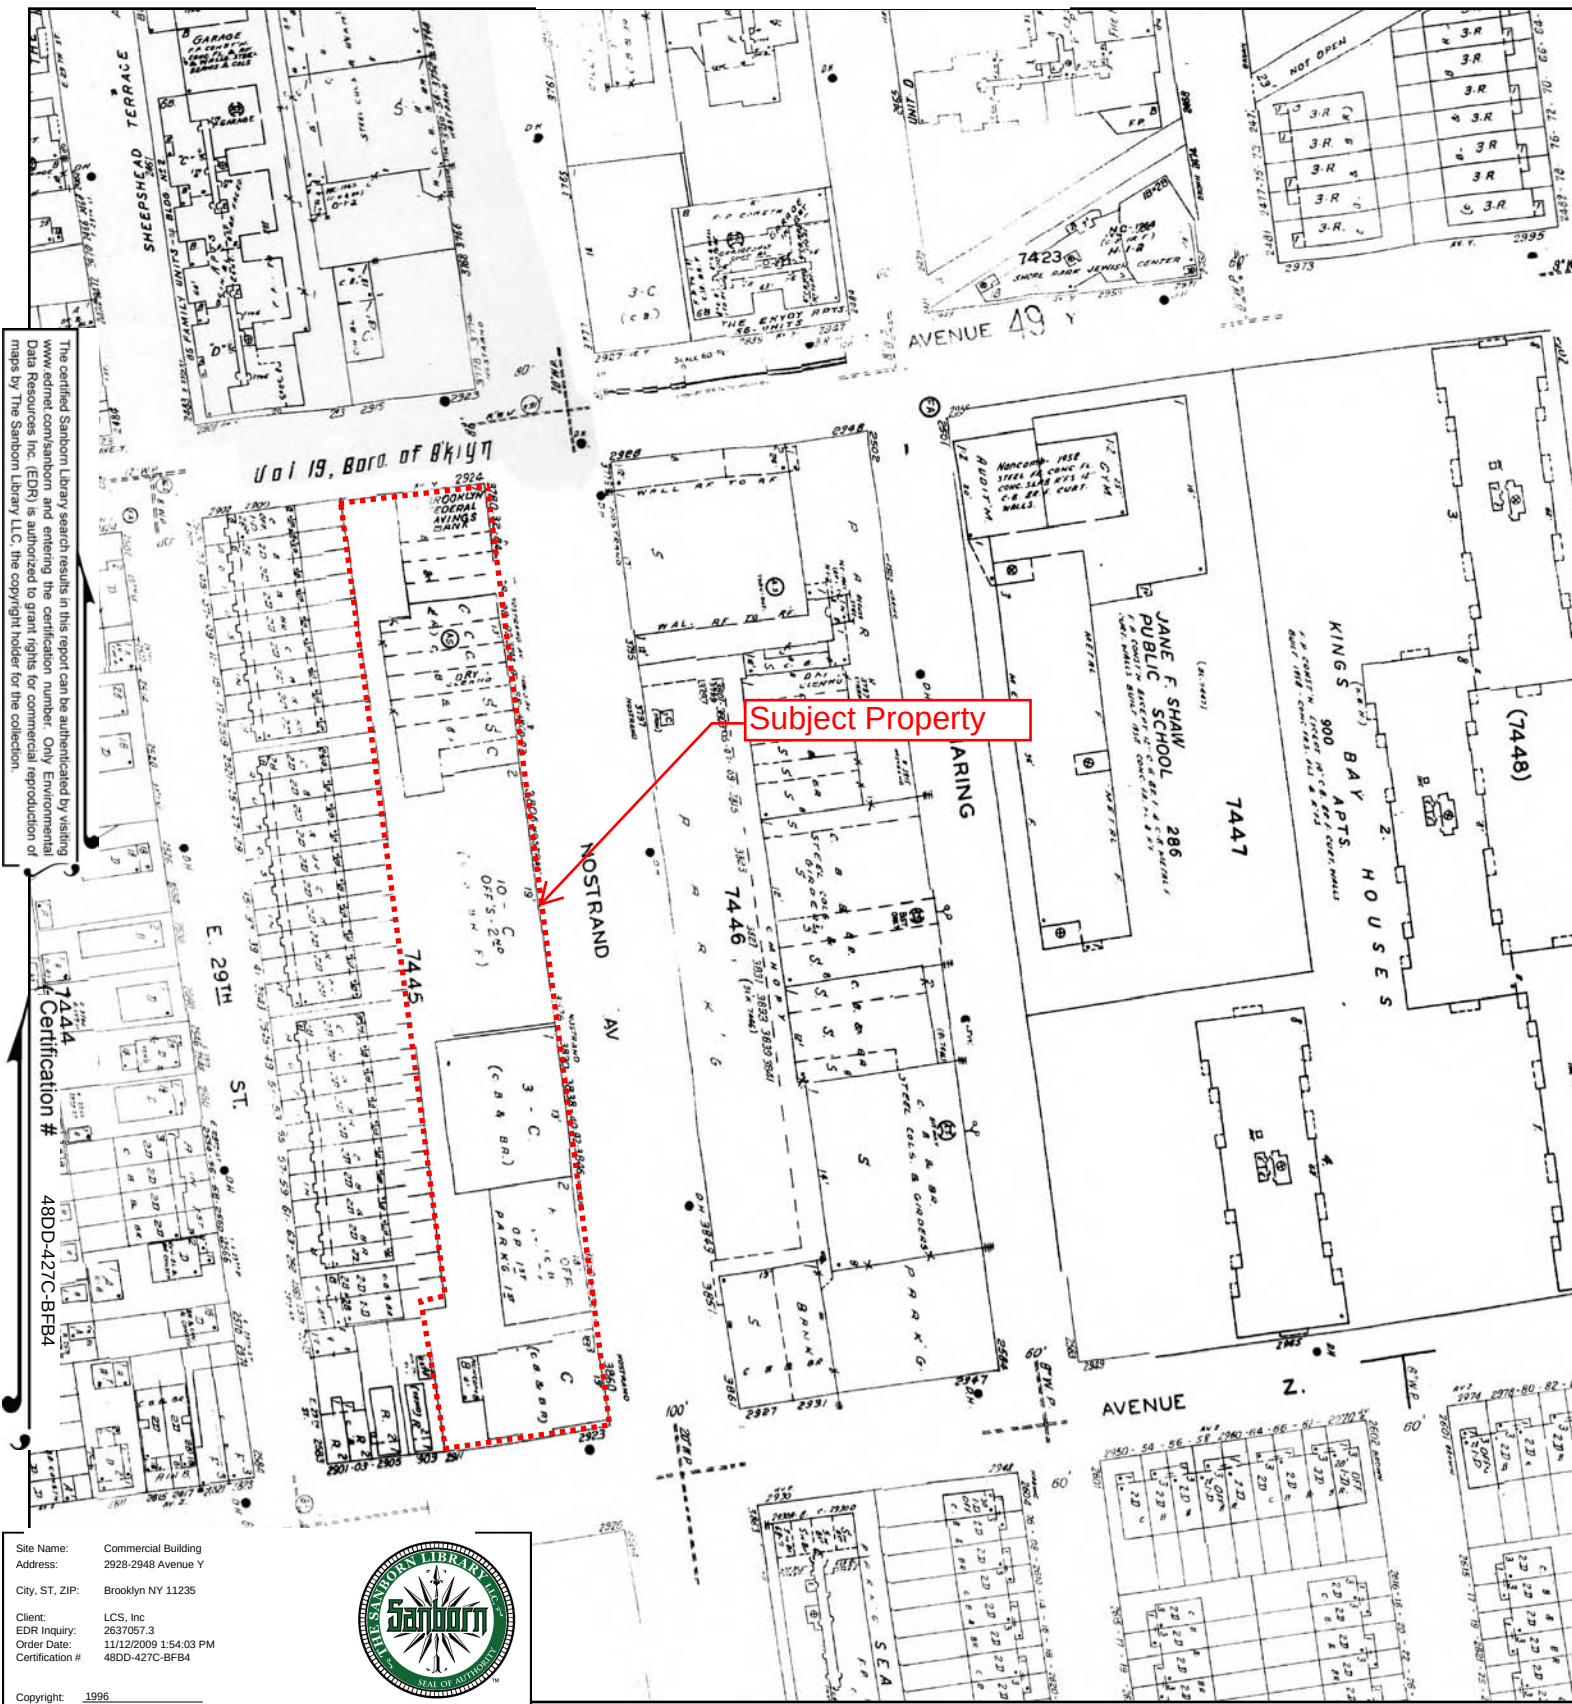


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

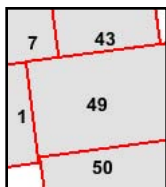



Volume 18, Sheet 1
 Volume 14, Sheet 7
 Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50



1995 Certified Sanborn Map

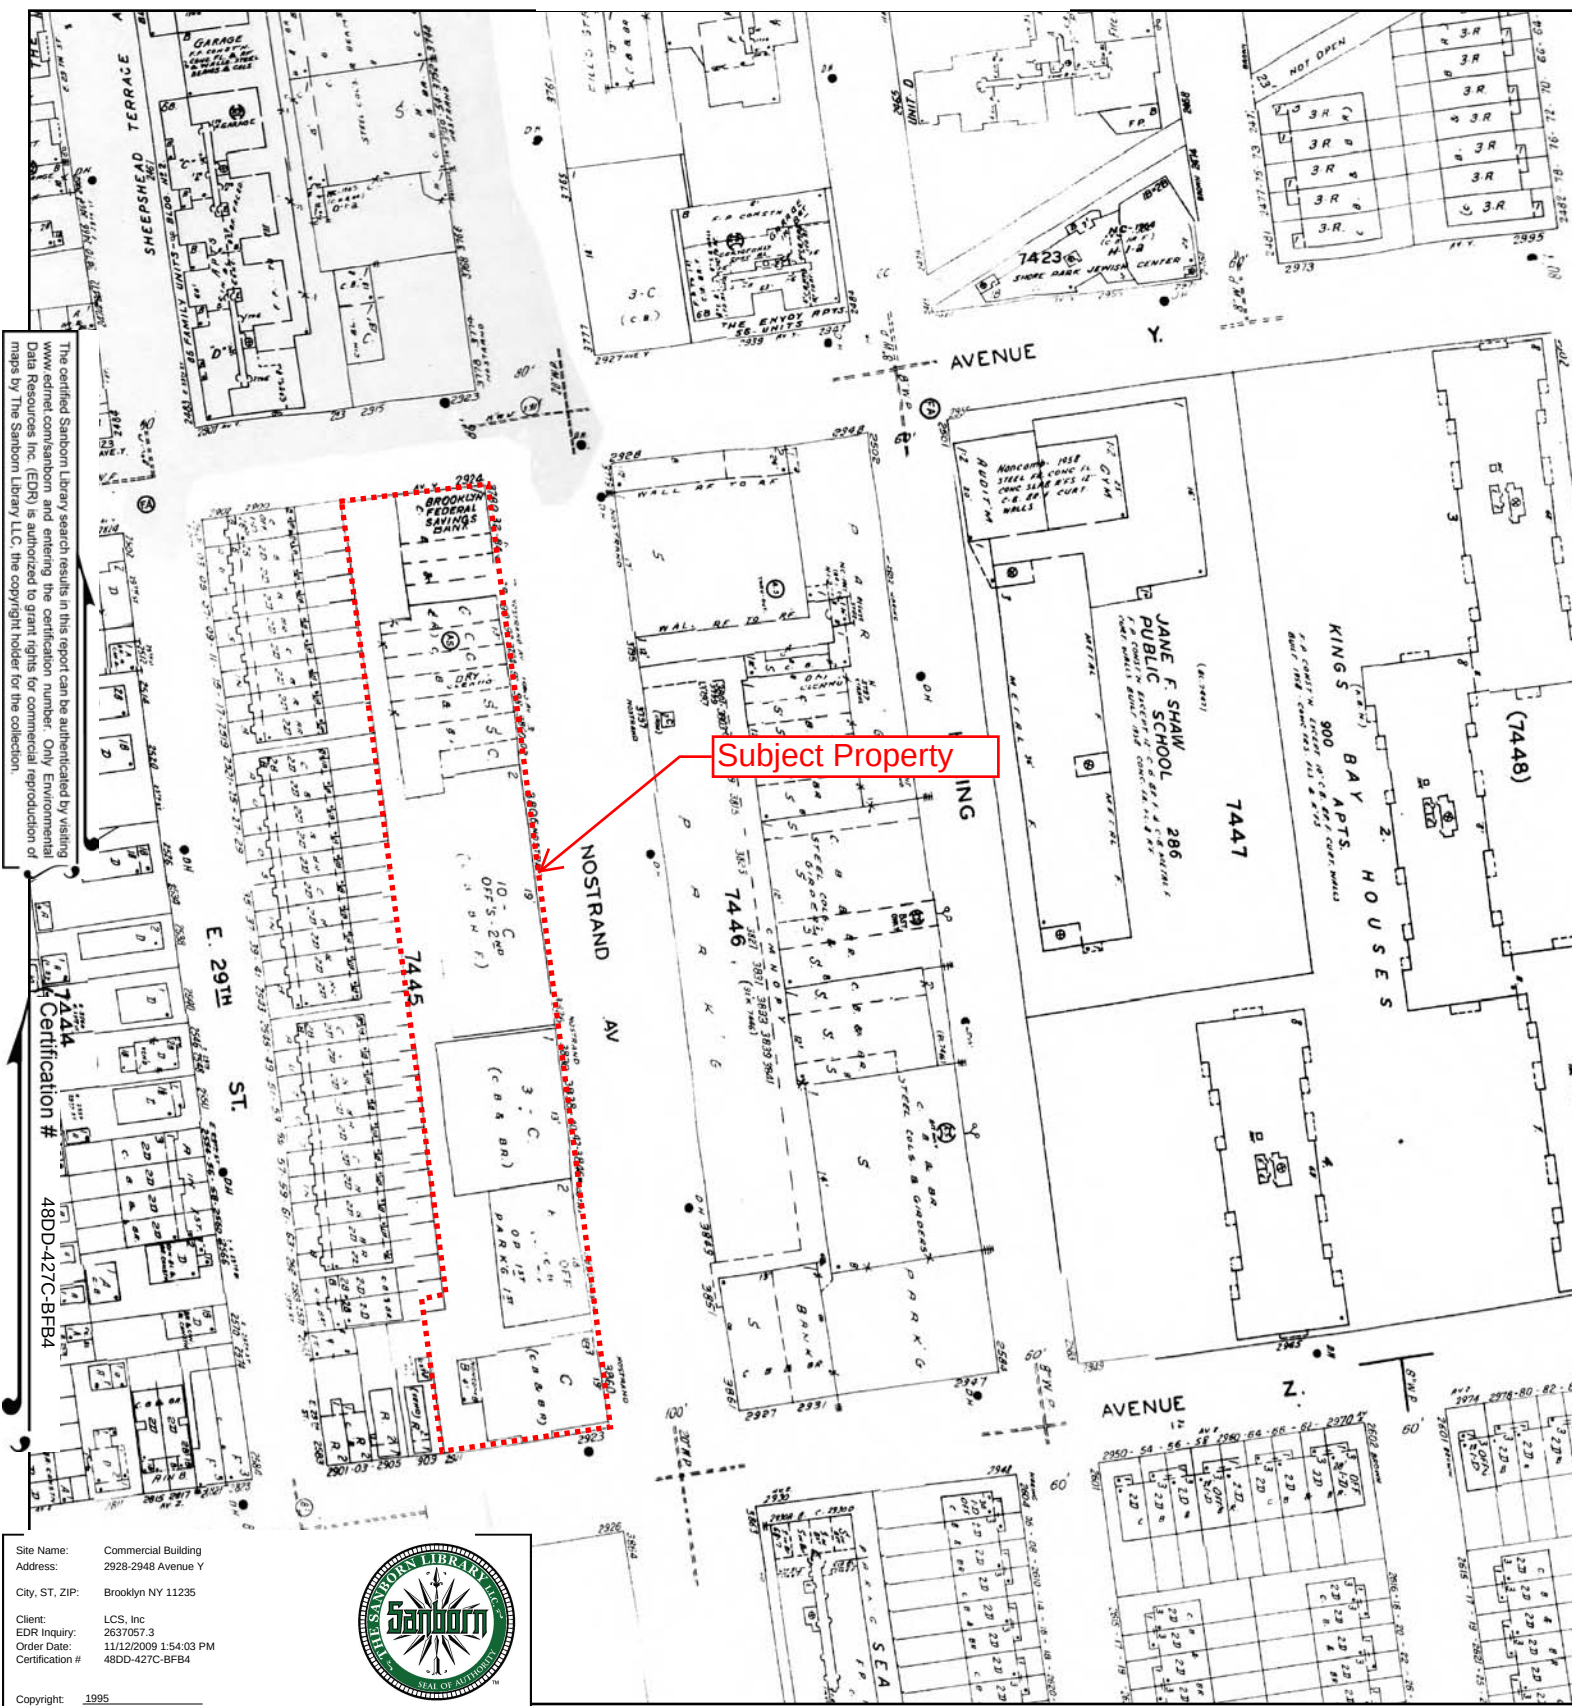


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

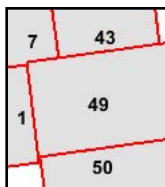



Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 14, Sheet 7
Volume 18, Sheet 1



1993 Certified Sanborn Map

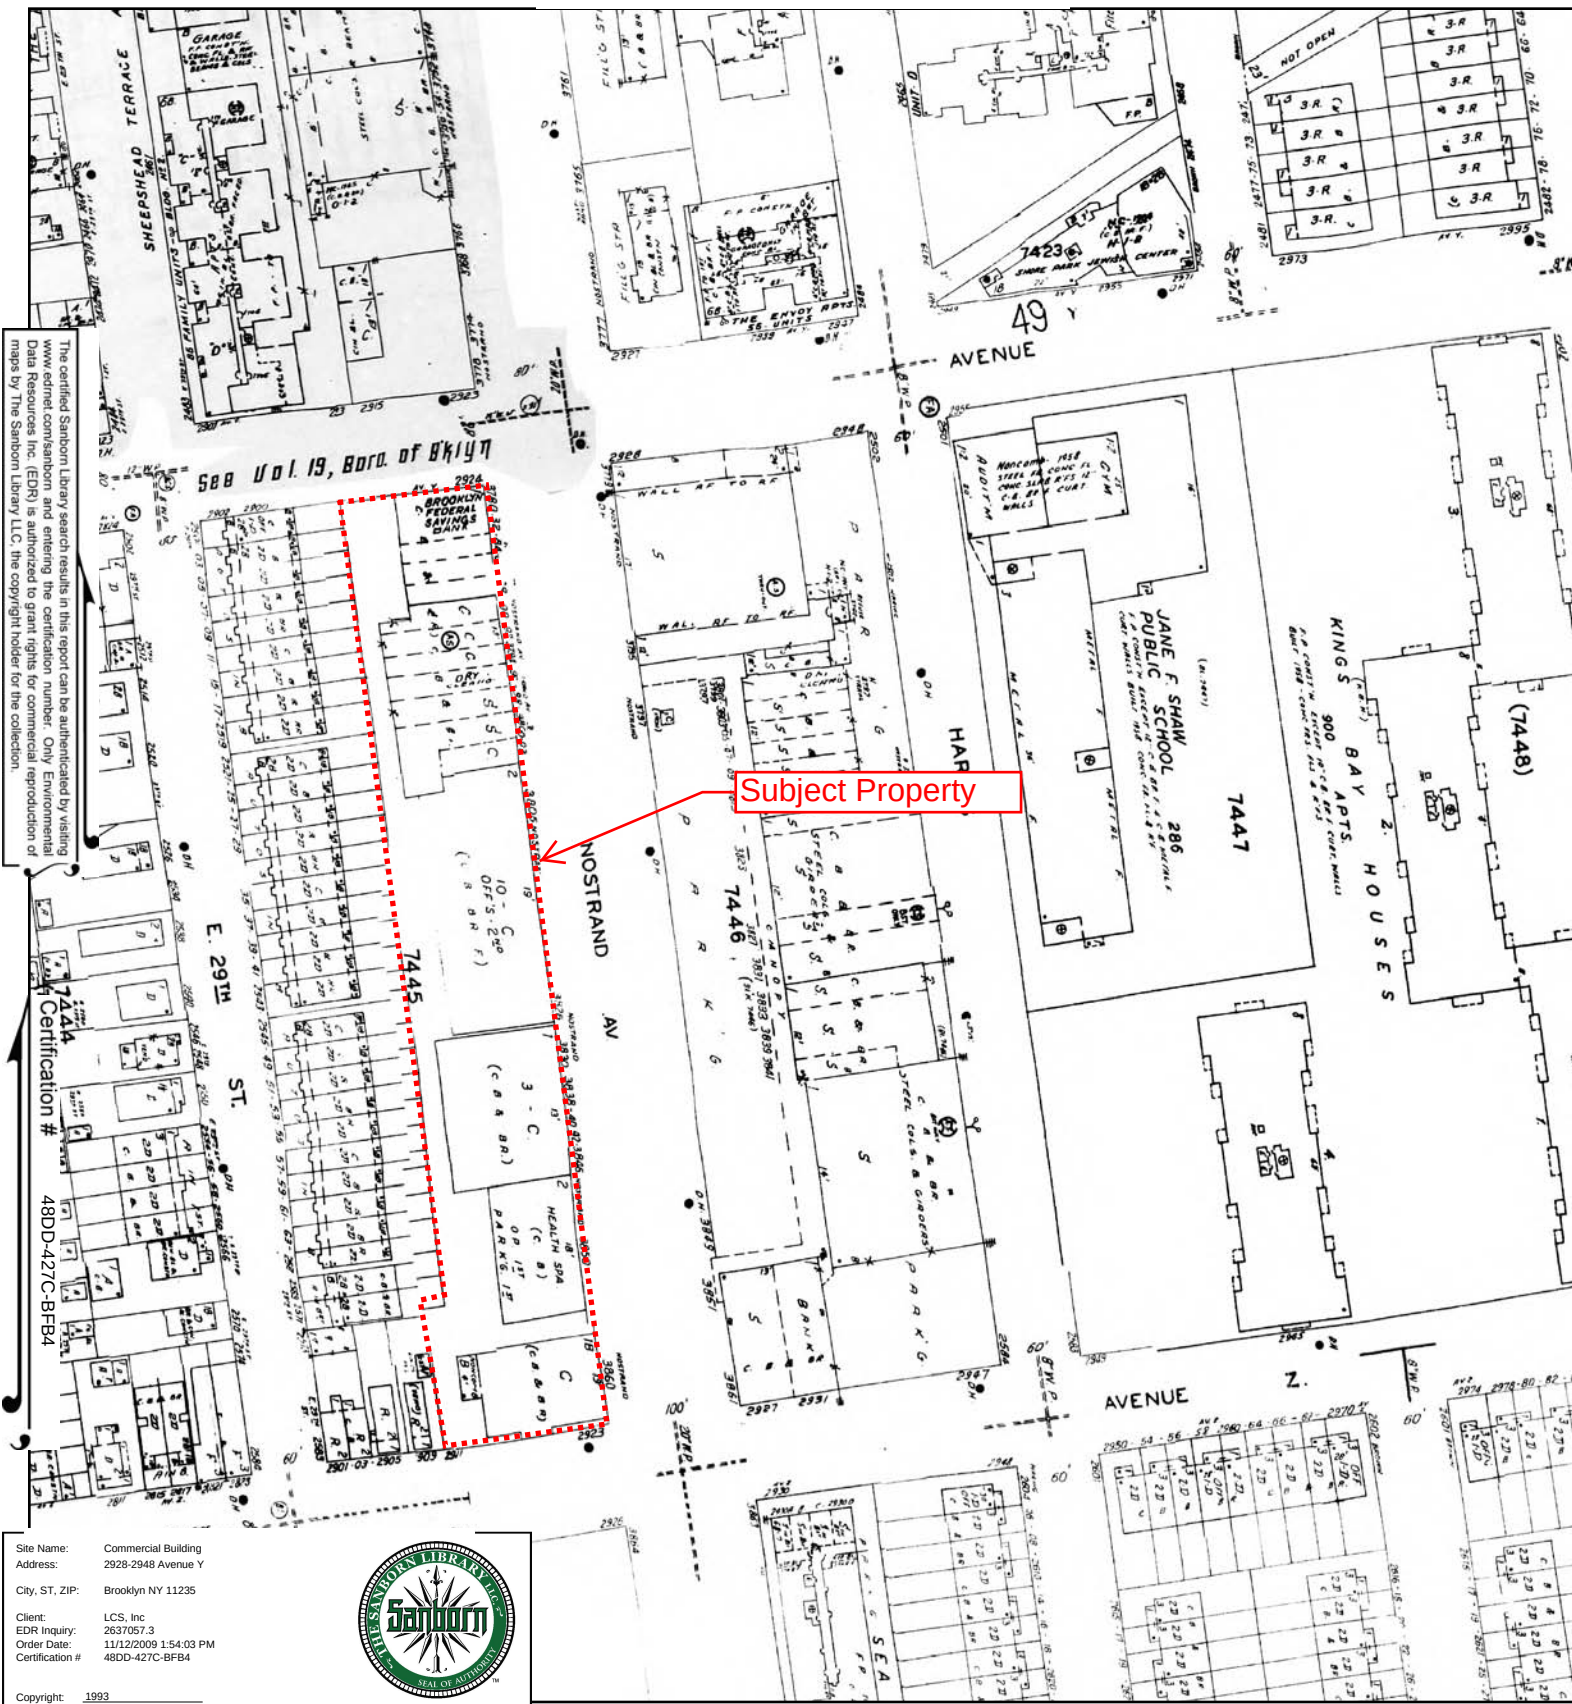


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

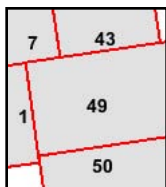


Volume 14, Sheet 7
 Volume 18, Sheet 1
 Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50




1992 Certified Sanborn Map

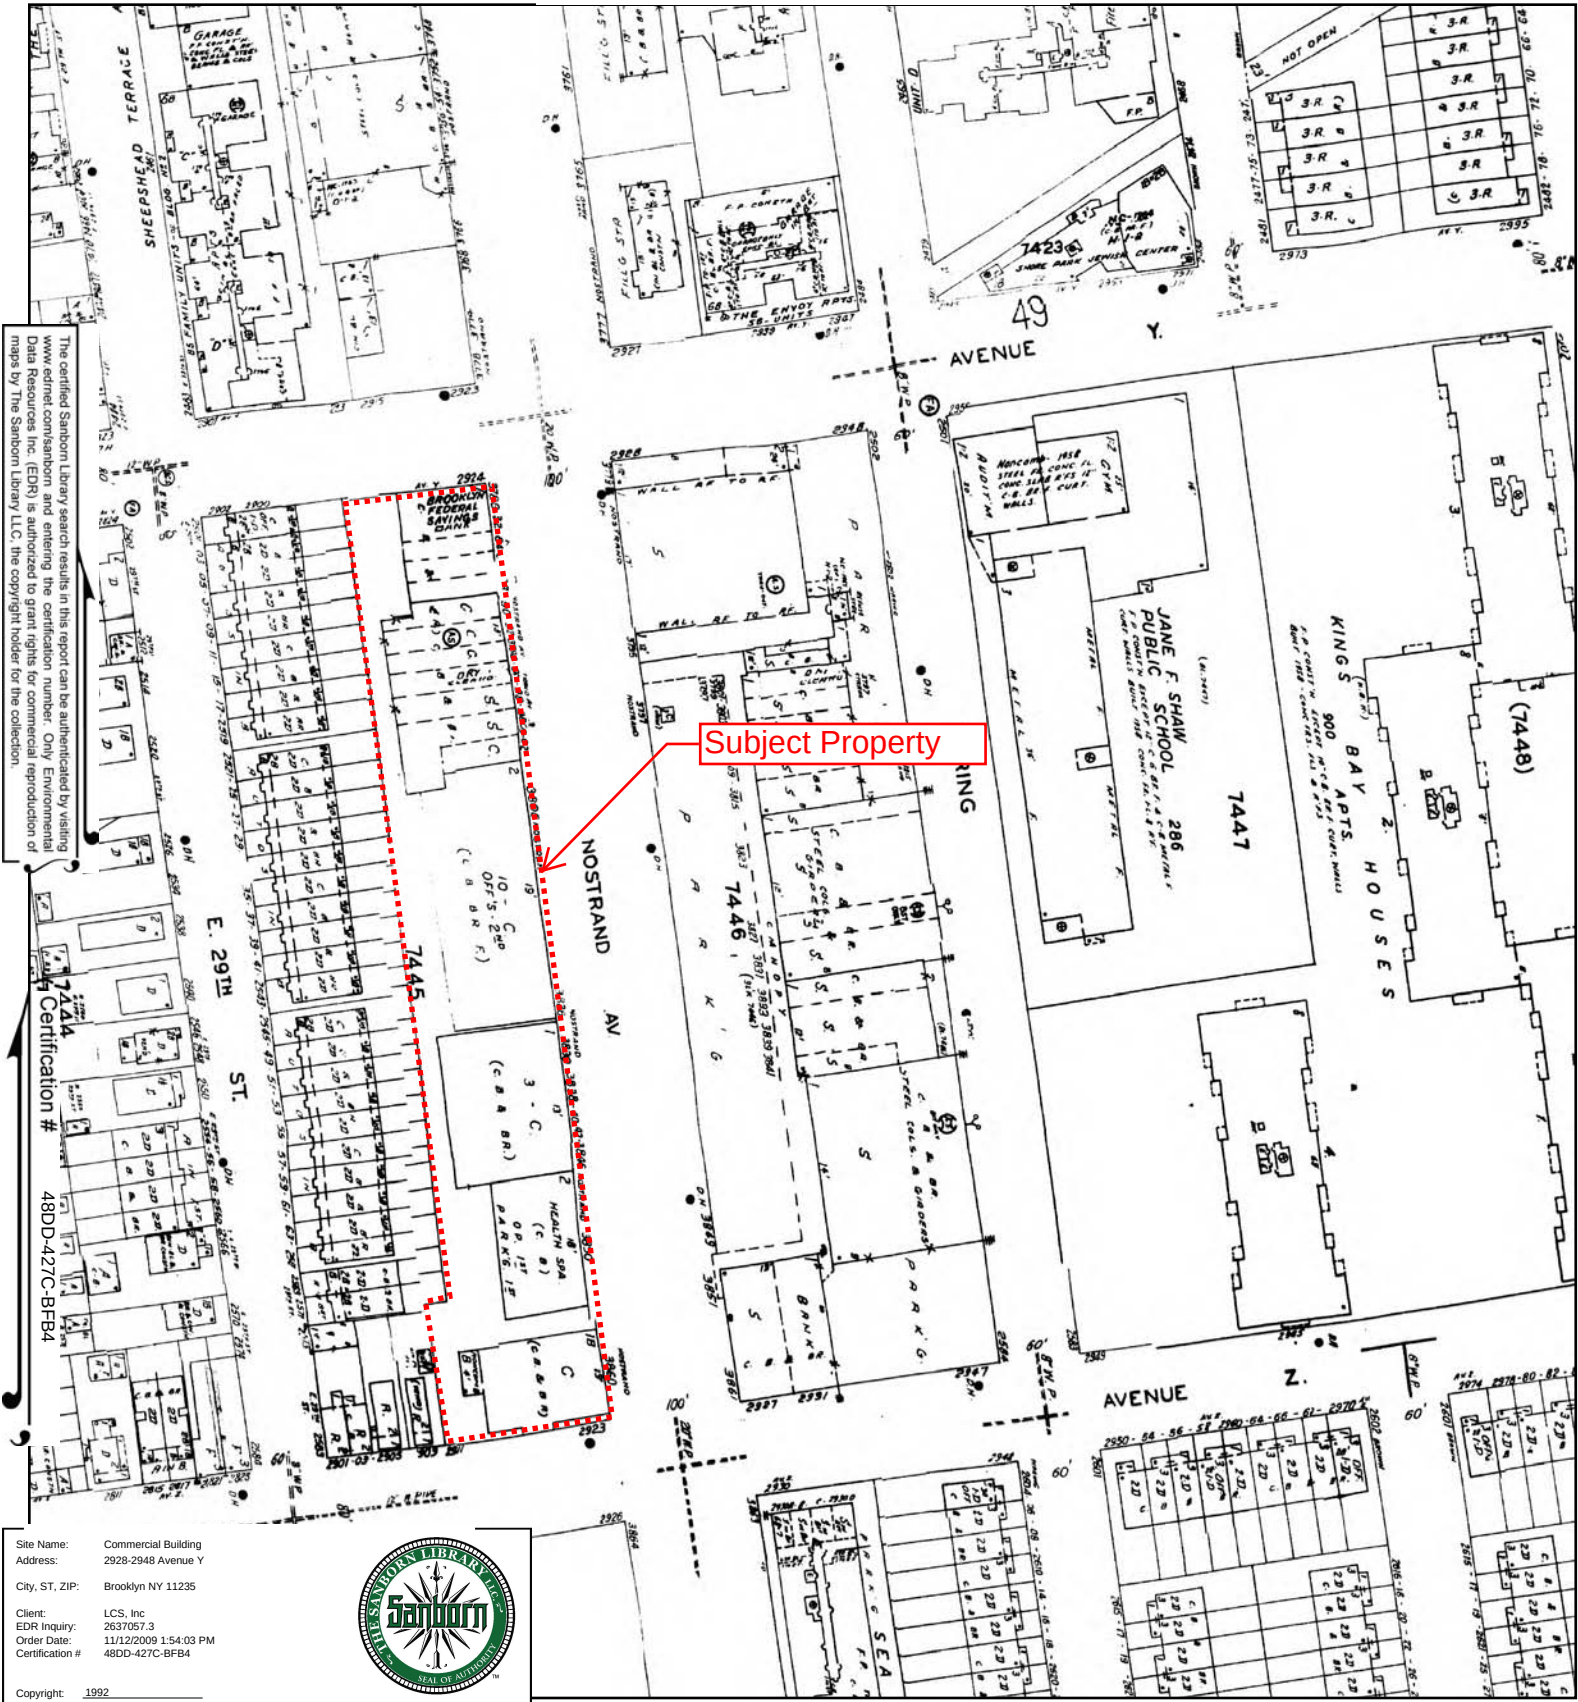


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

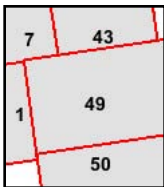


Volume 19, Sheet 43
 Volume 19, Sheet 49
 Volume 19, Sheet 50
 Volume 18, Sheet 1
 Volume 14, Sheet 7




1991 Certified Sanborn Map

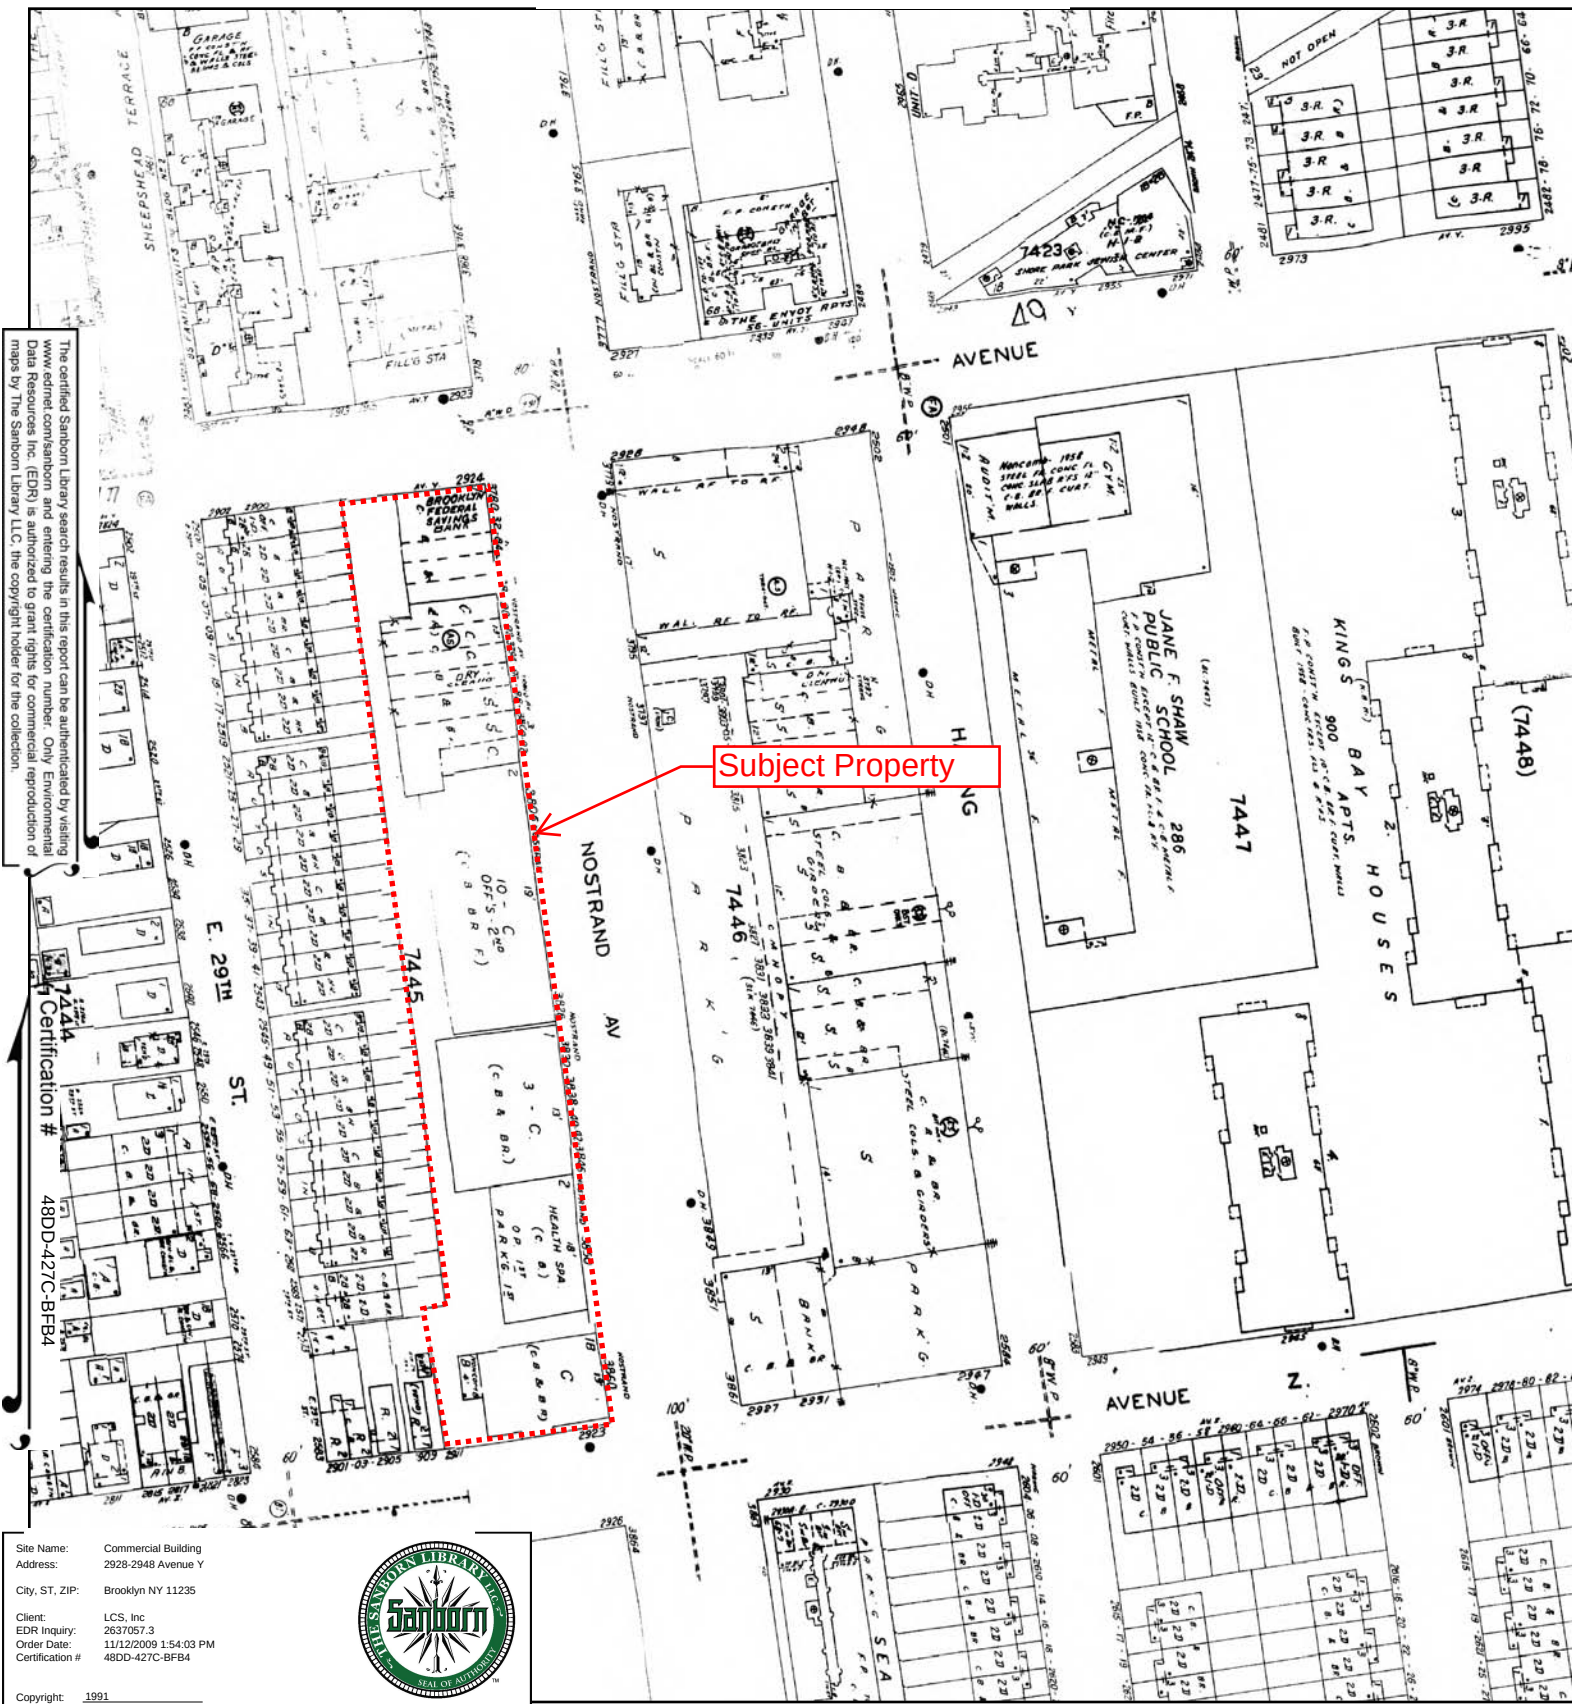

1989 Certified Sanborn Map

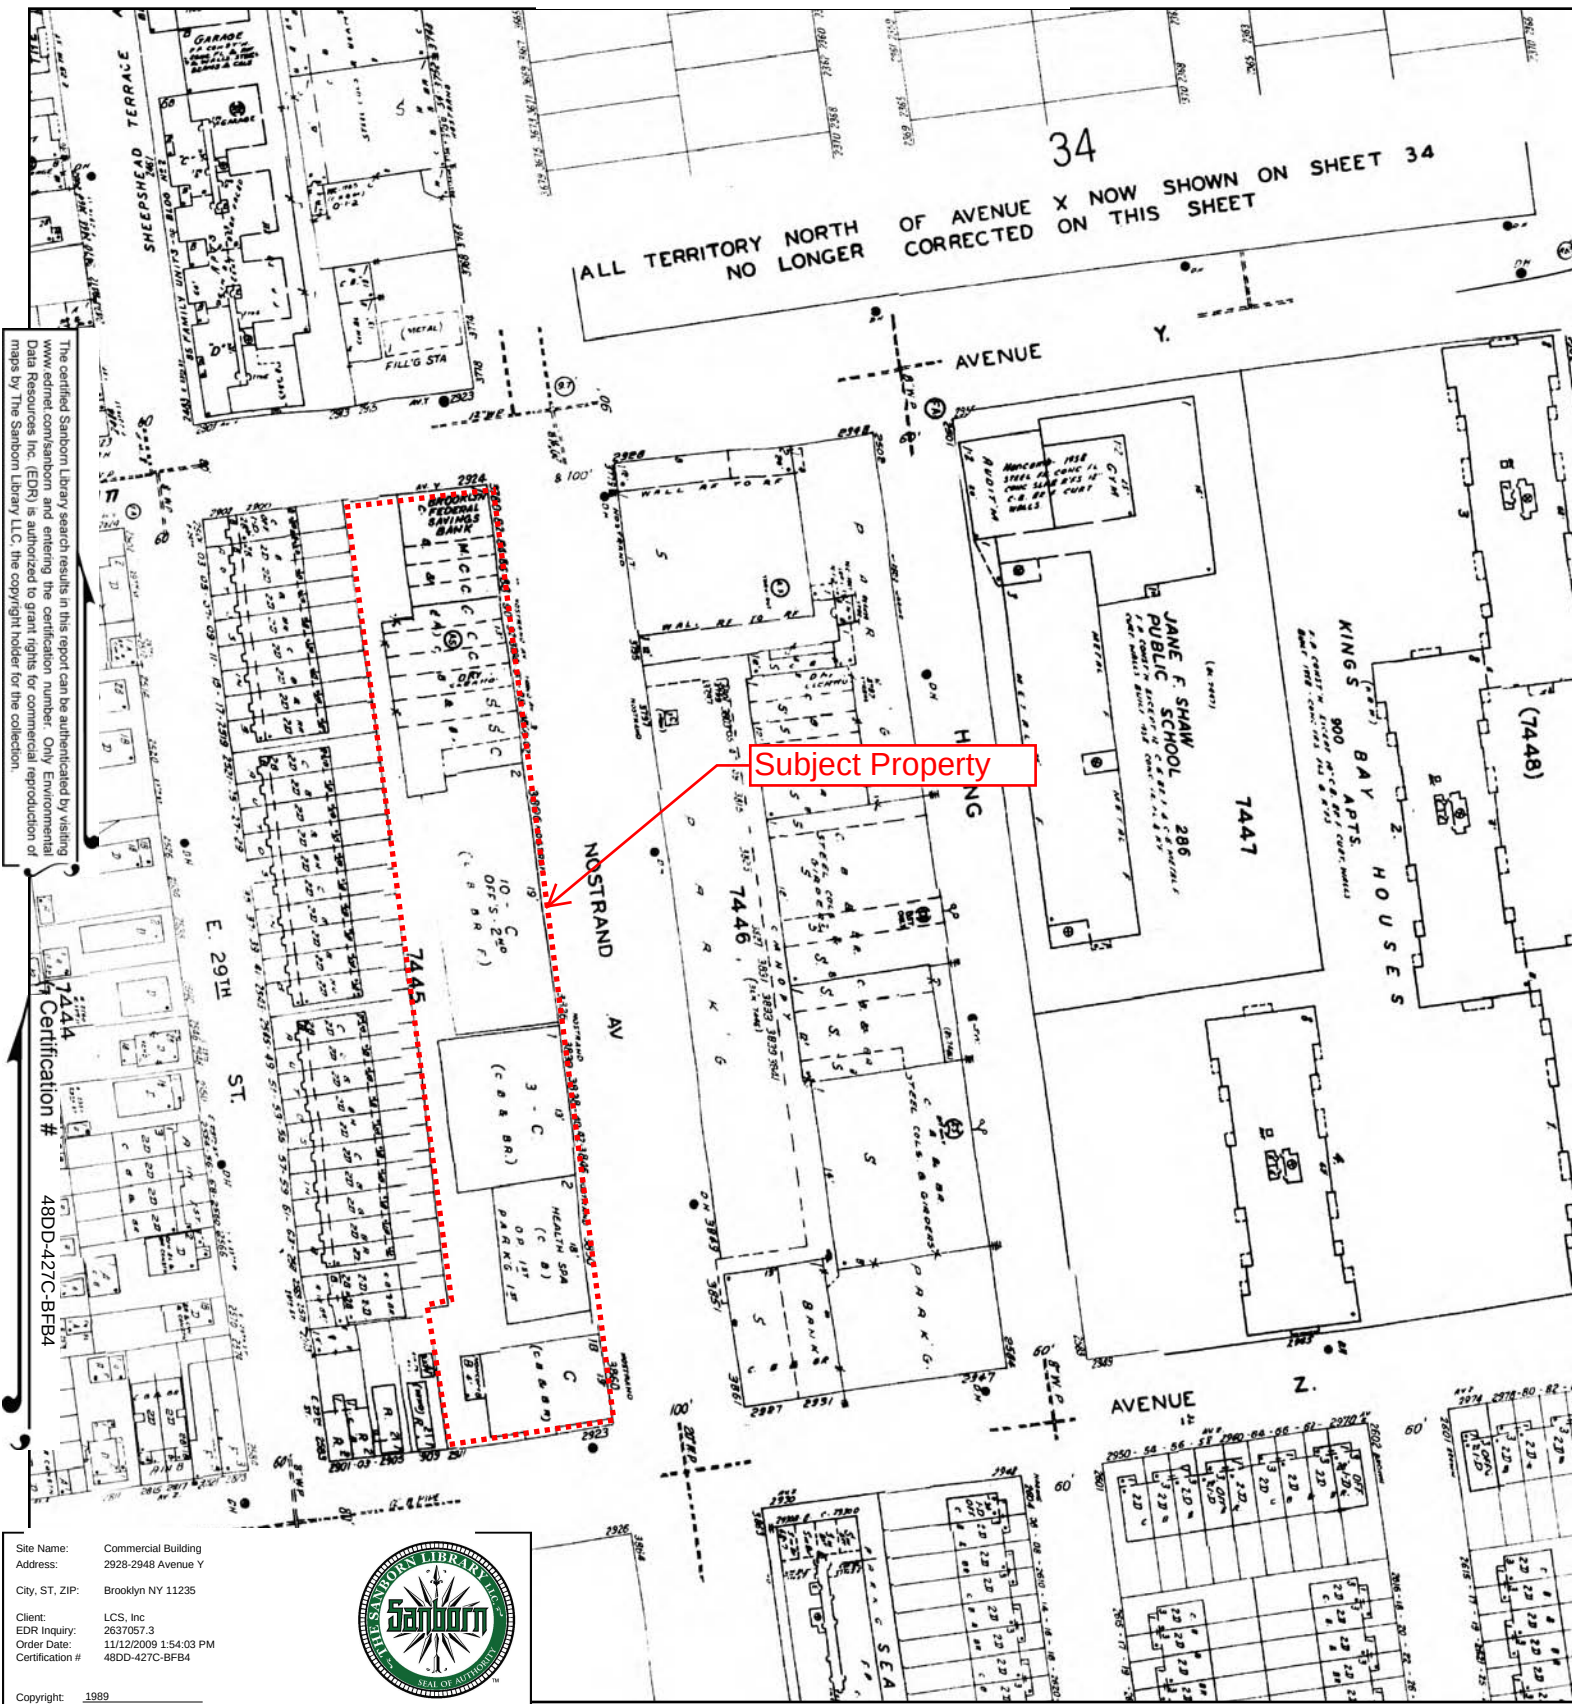



1987 Certified Sanborn Map

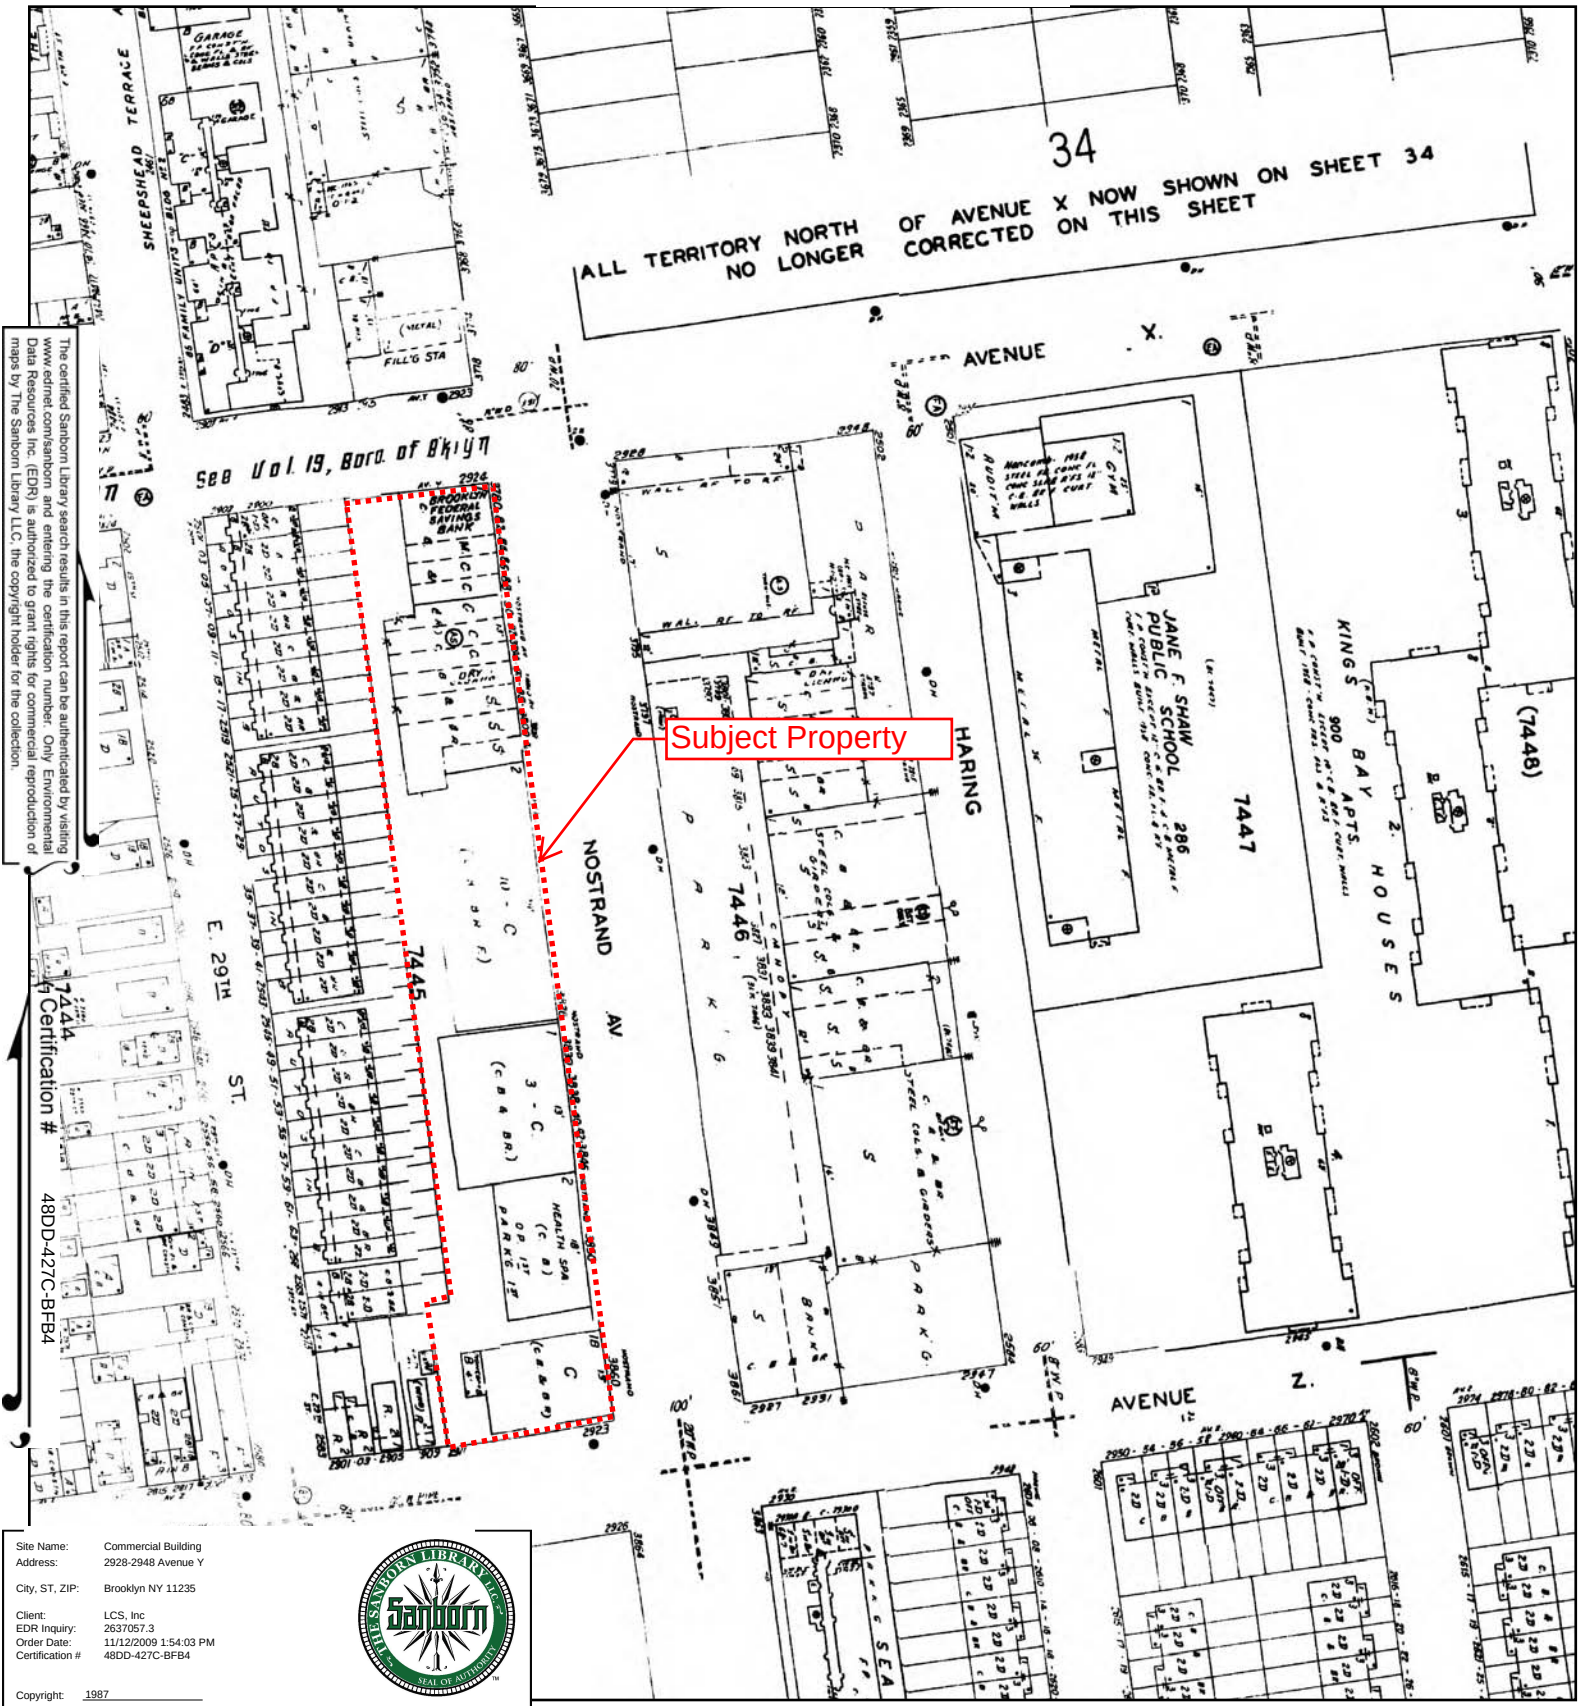

Site Name: Commercial Building
 Address: 2928-2948 Avenue Y
 City, ST, ZIP: Brooklyn NY 11235
 Client: LCS, Inc
 EDR Inquiry: 2637057.3
 Order Date: 11/12/2009 1:54:03 PM
 Certification # 48DD-427C-BF84




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

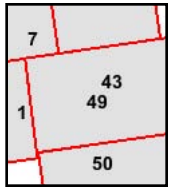



- Volume 19, Sheet 43
- Volume 19, Sheet 49
- Volume 19, Sheet 50
- Volume 18, Sheet 1
- Volume 14, Sheet 7



1986 Certified Sanborn Map

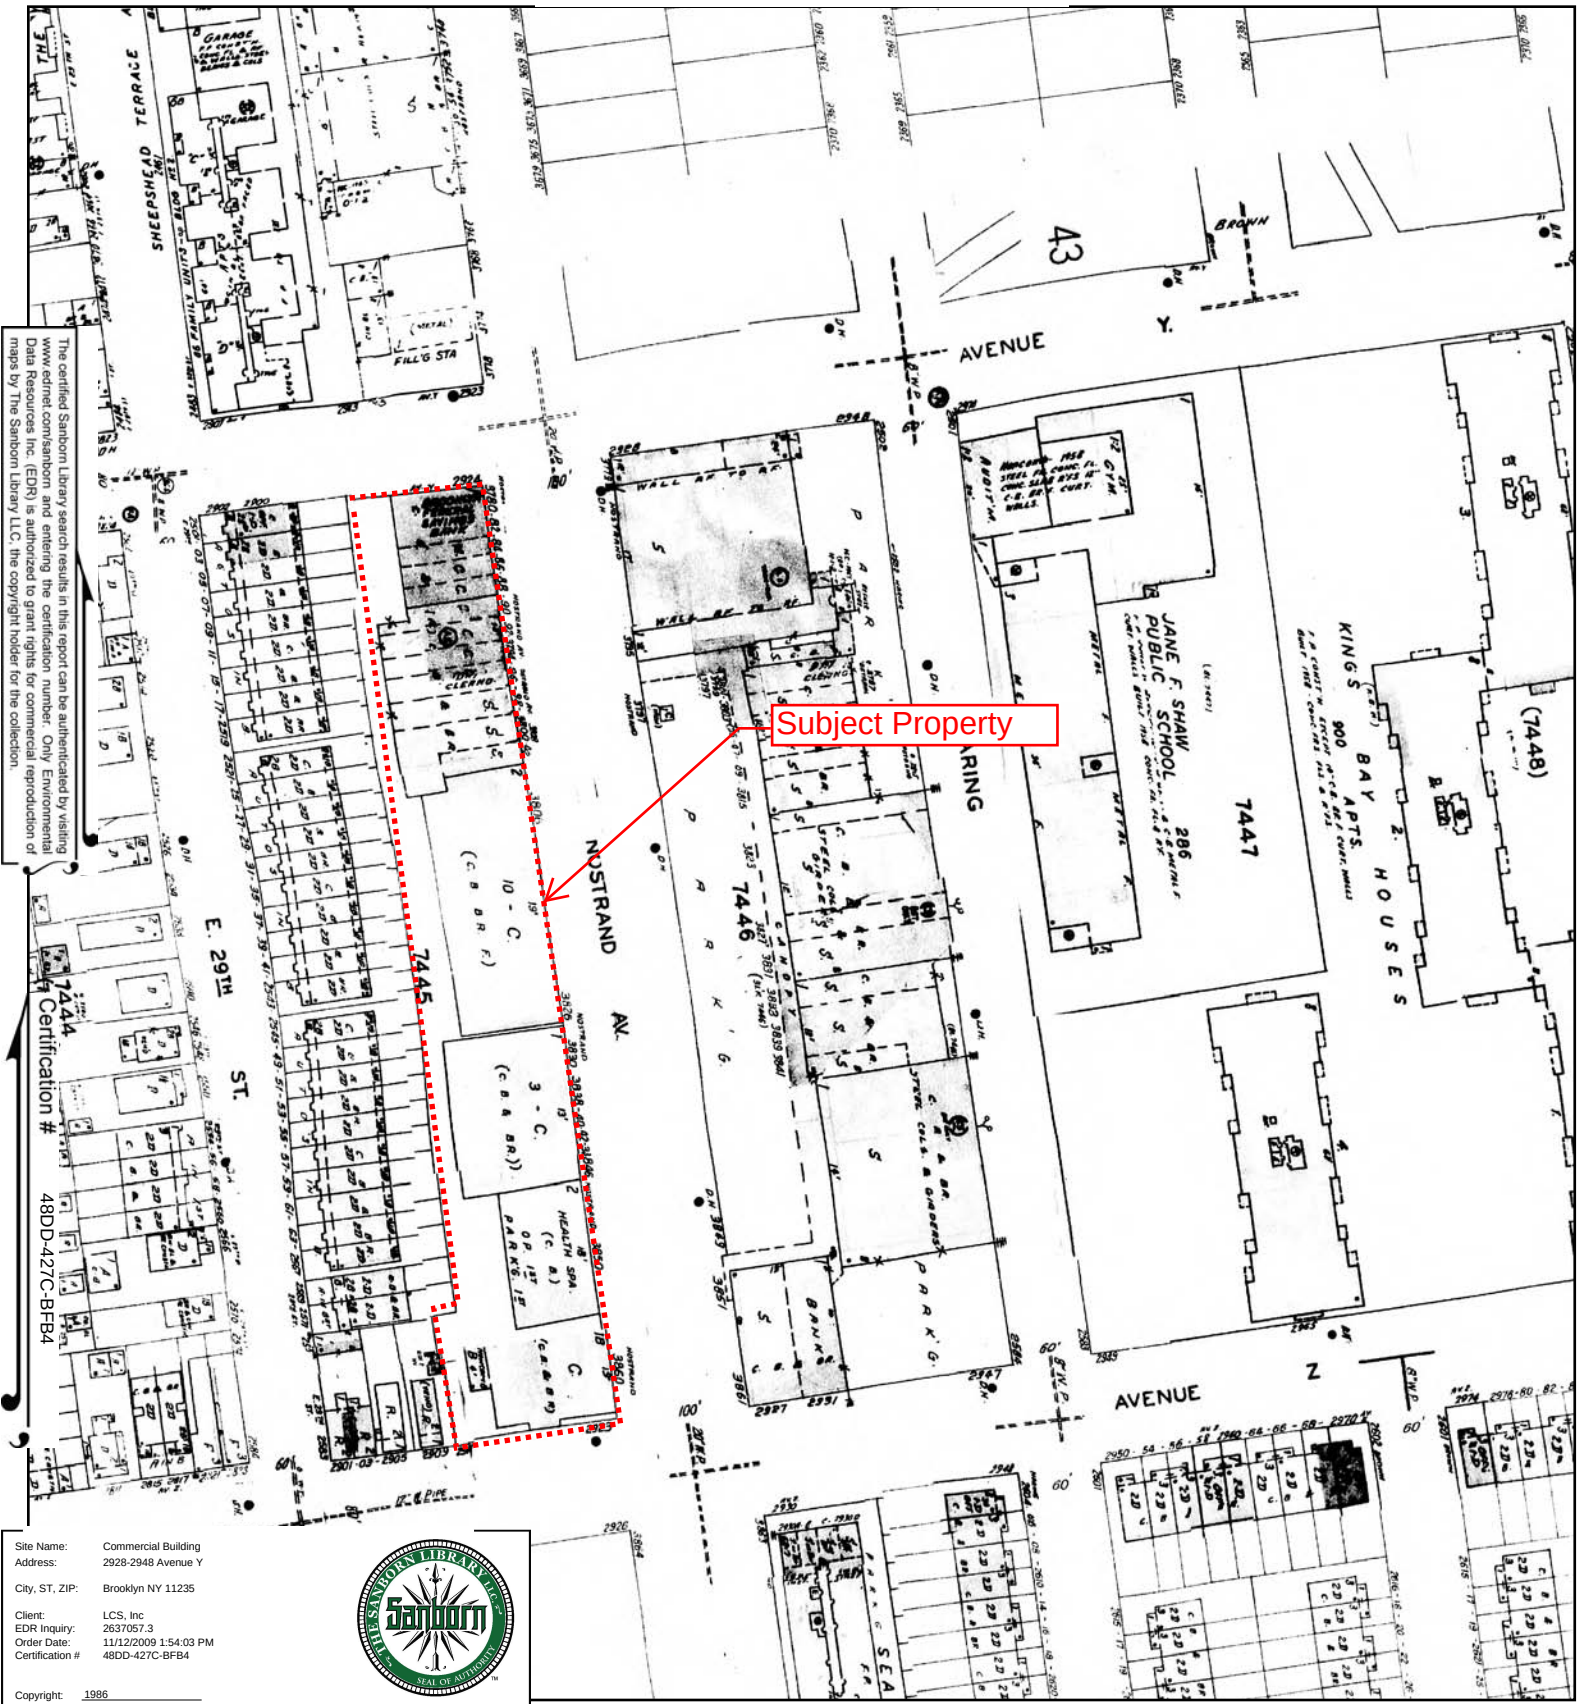


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

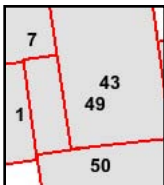


Volume 18, Sheet 1
Volume 14, Sheet 7
Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50



1983 Certified Sanborn Map

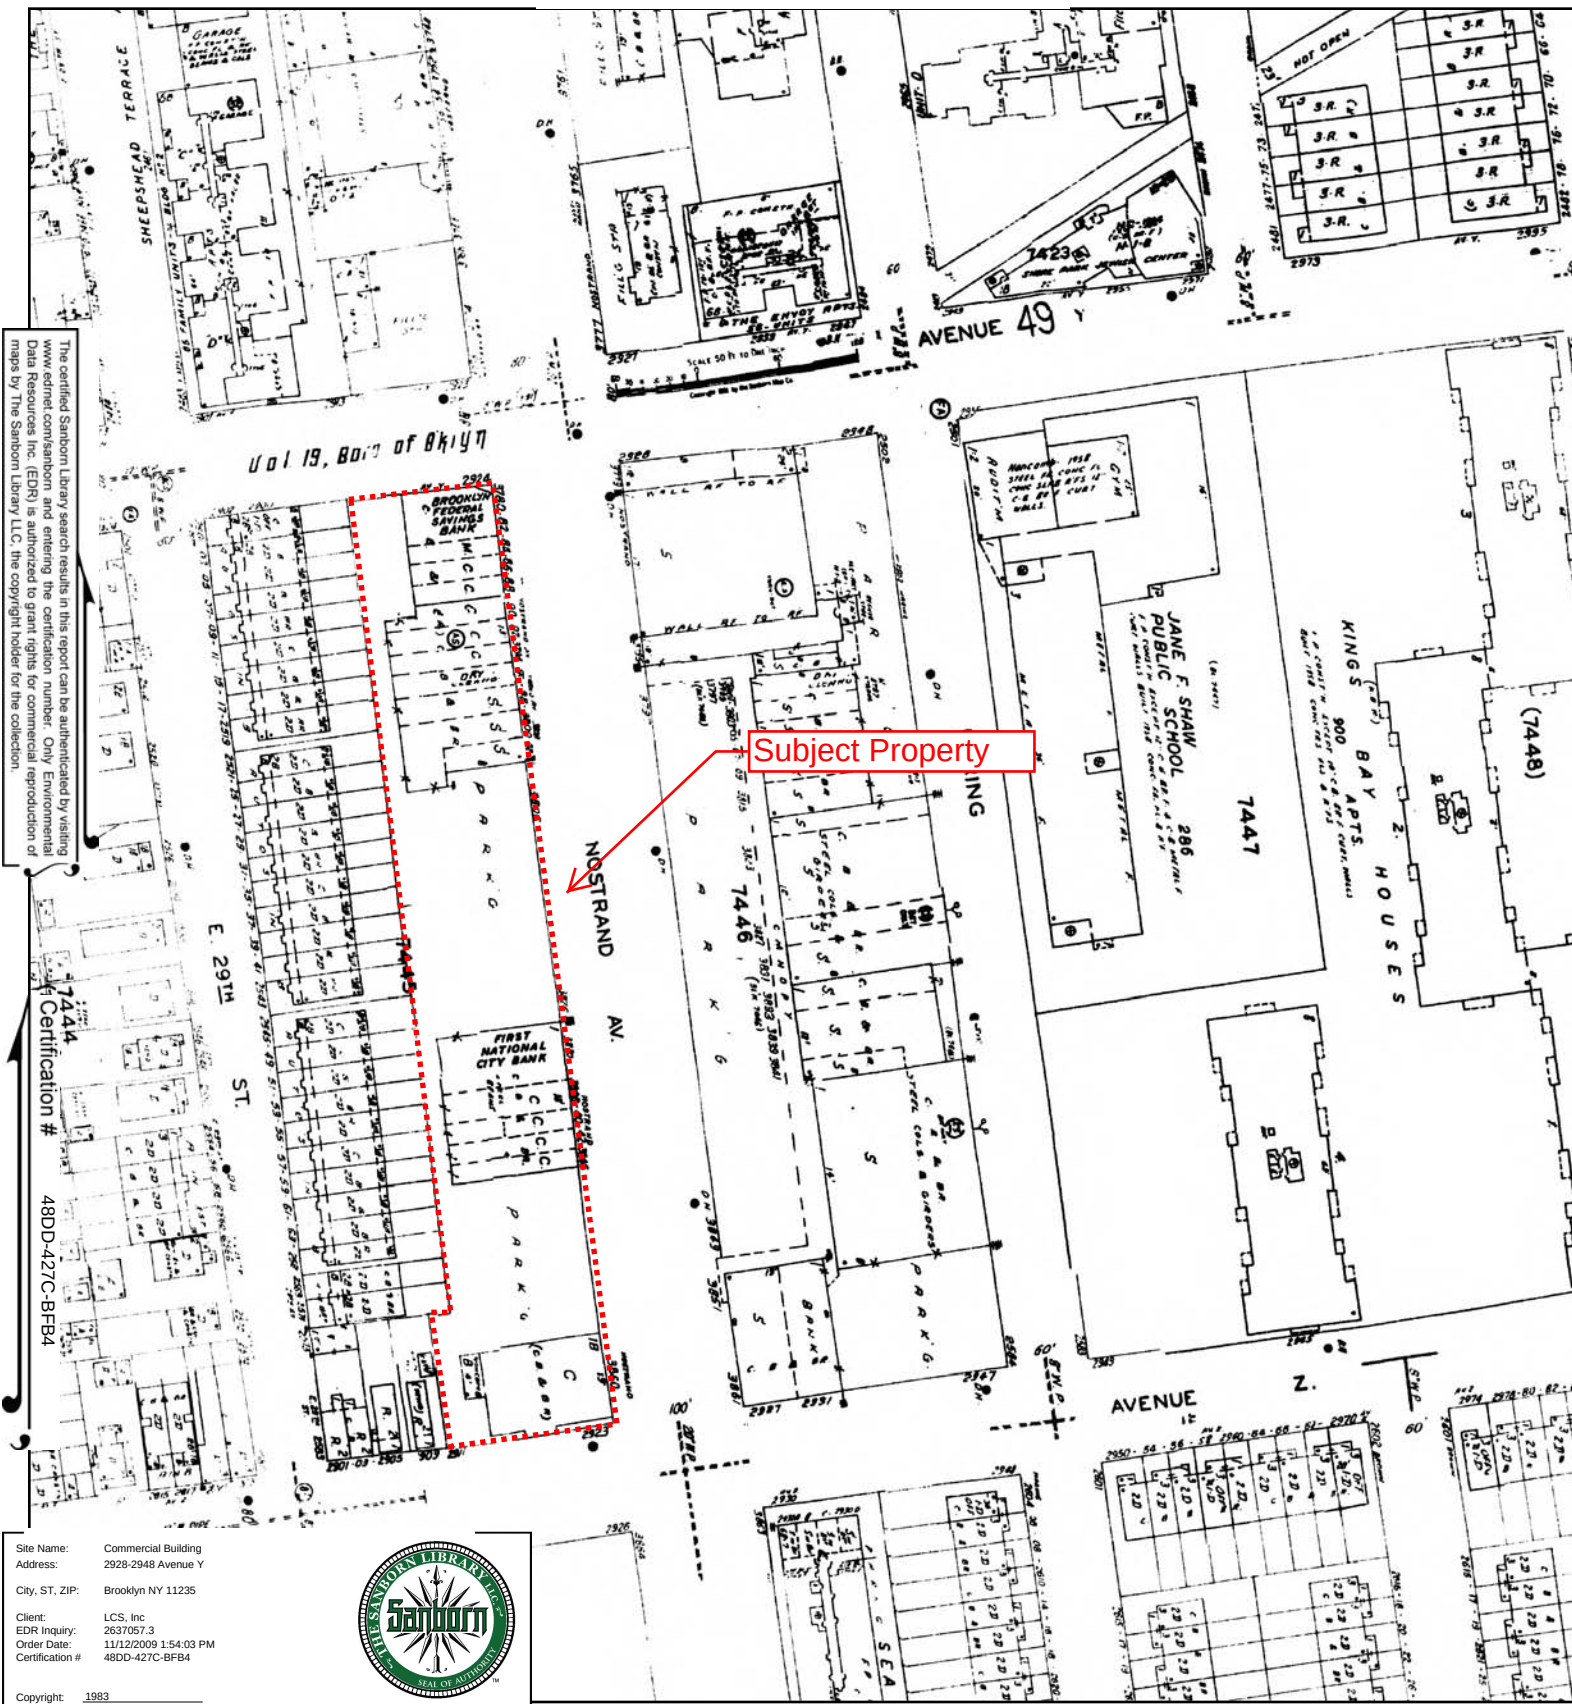

This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

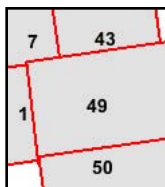

Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 14, Sheet 7
Volume 18, Sheet 1

1982 Certified Sanborn Map




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name: Commercial Building
Address: 2928-2948 Avenue Y
City, ST, ZIP: Brooklyn NY 11235
Client: LCS, Inc.
EDR Inquiry: 2637057-3
Order Date: 11/12/2009 1:54:03 PM
Certification # 48DD-427C-BF84
Copyright: 1982




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

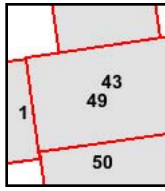


Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 18, Sheet 1


1981 Certified Sanborn Map

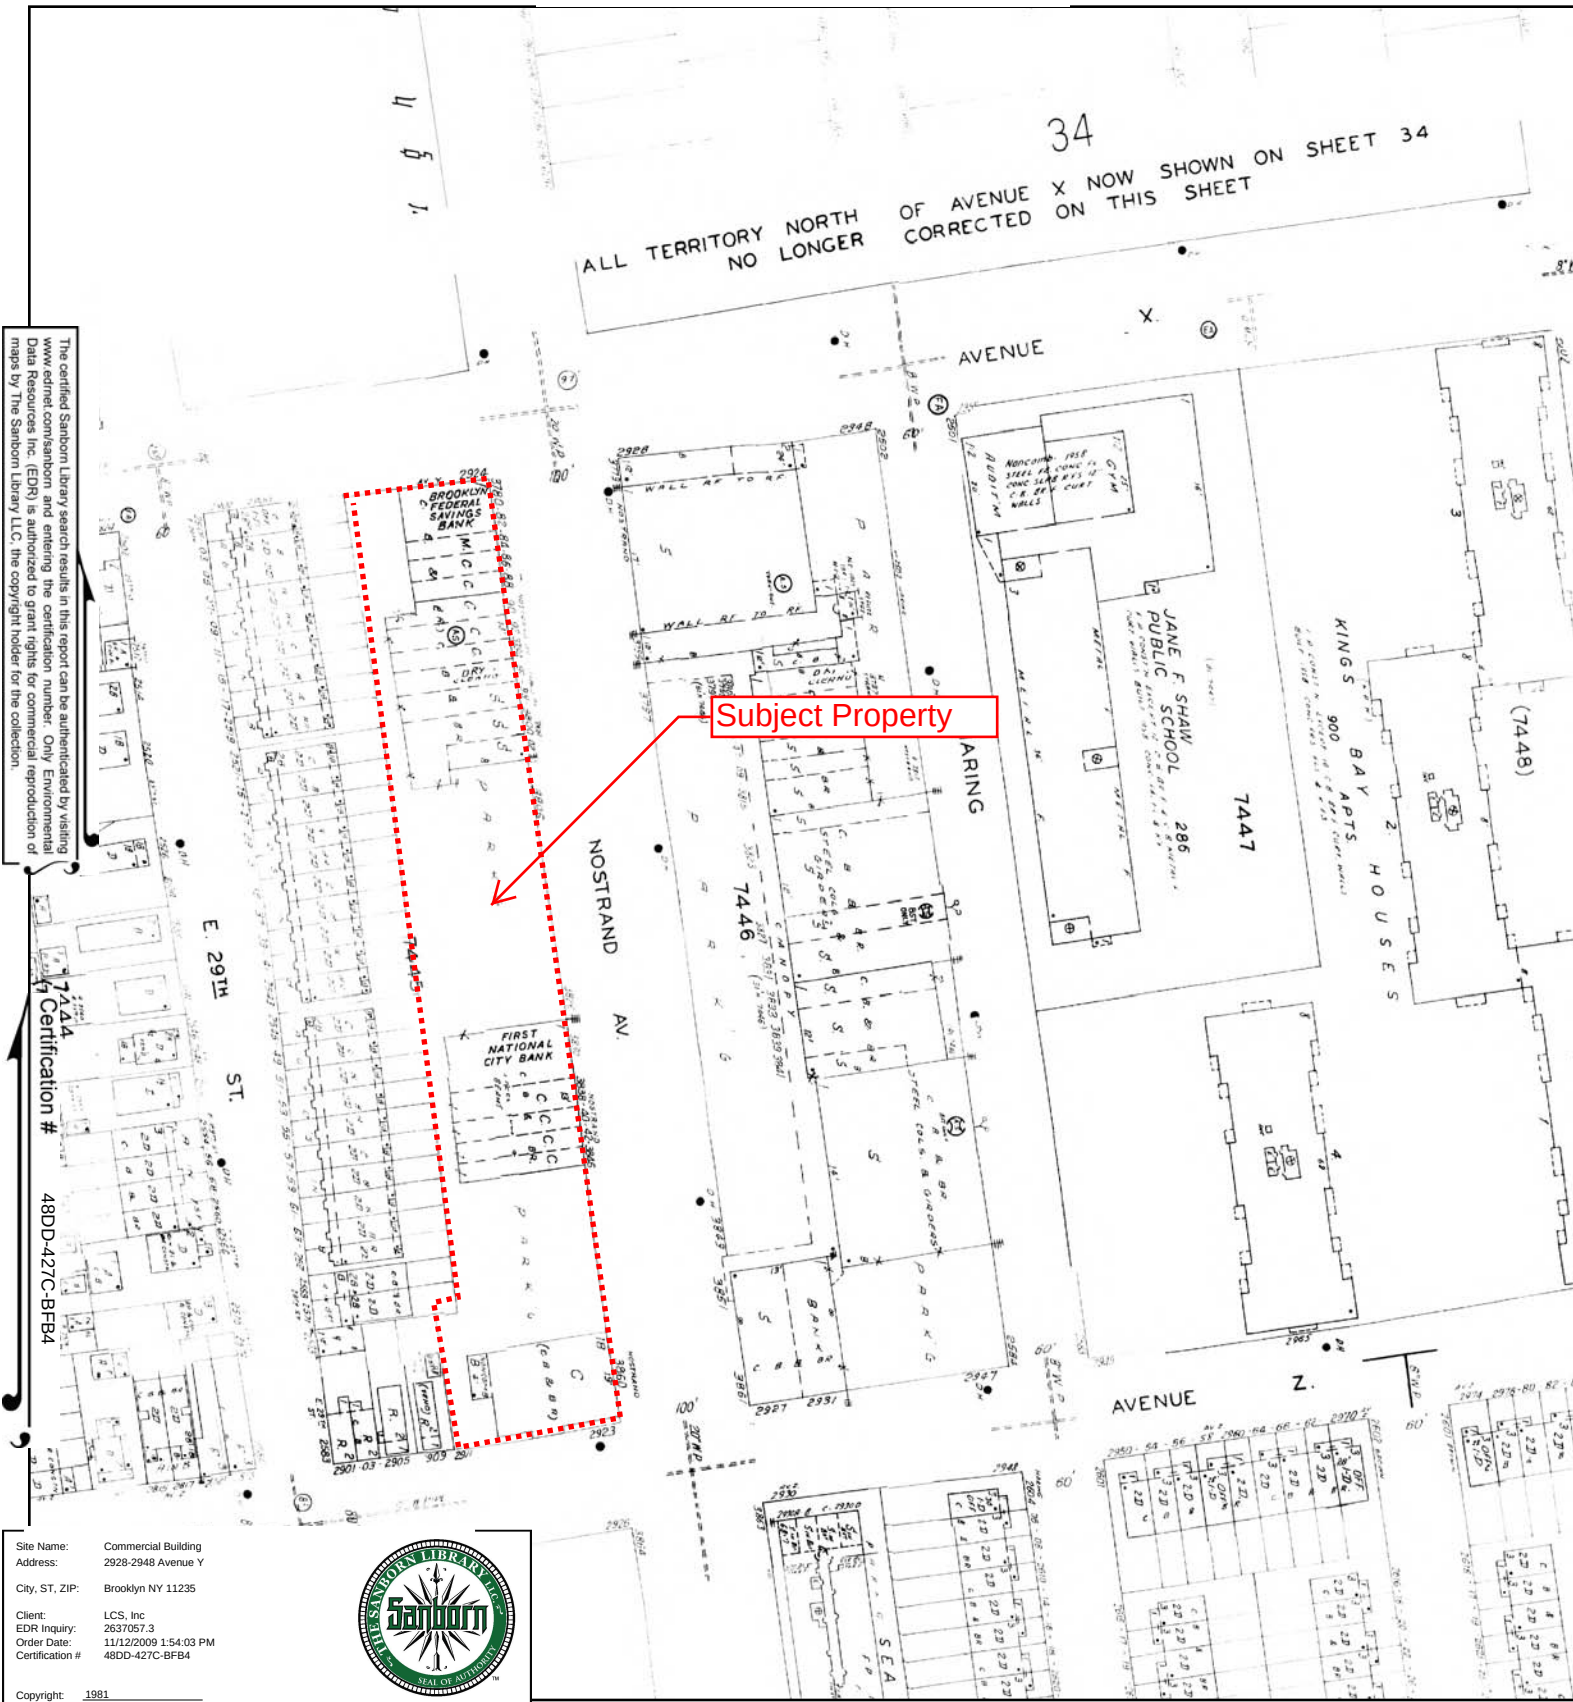



1977 Certified Sanborn Map

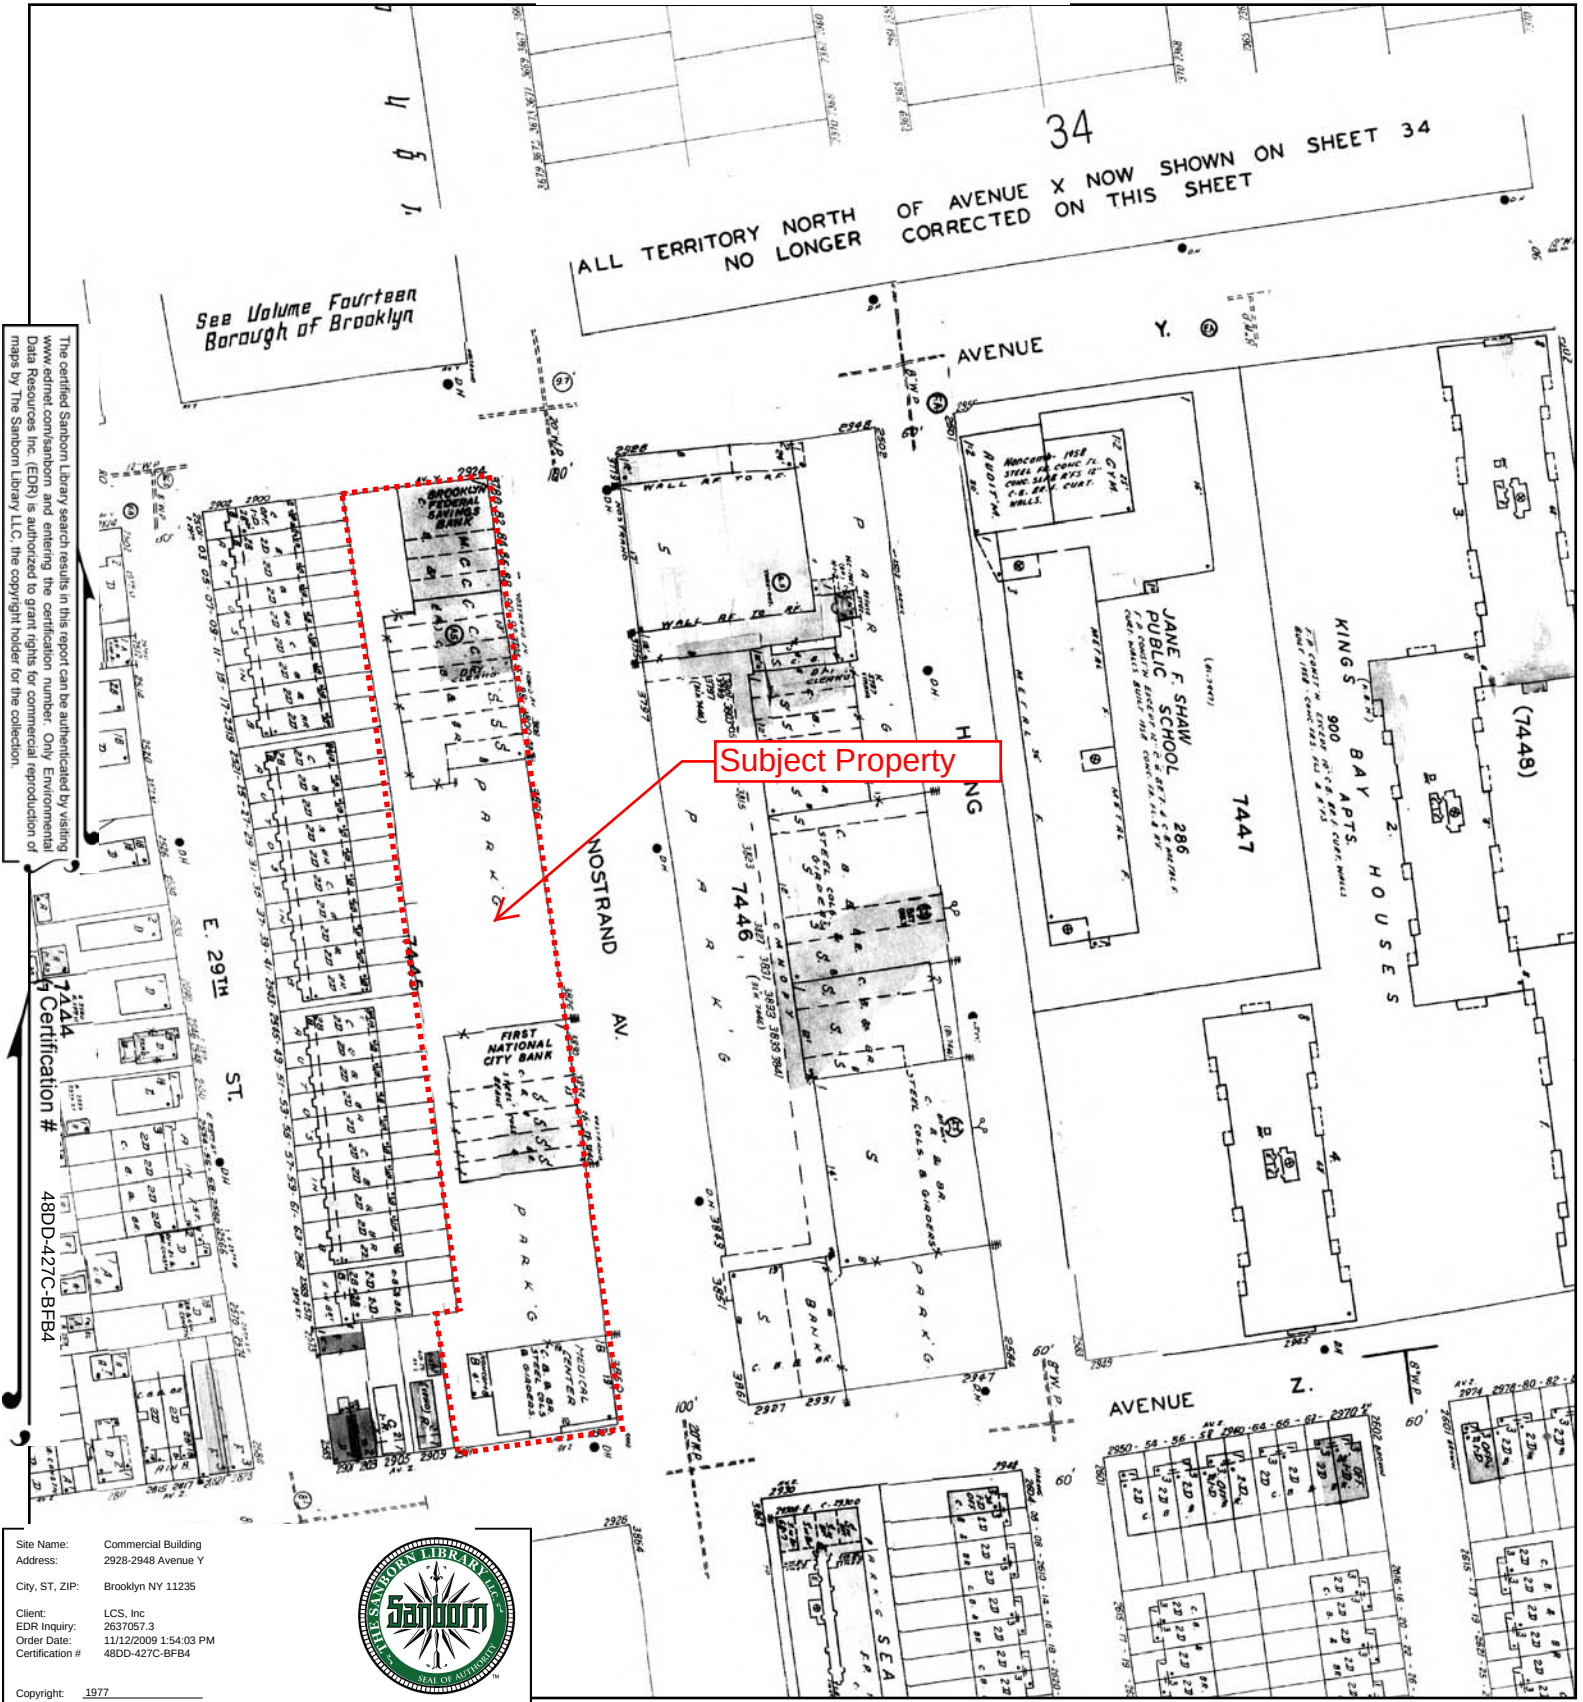

1969 Certified Sanborn Map

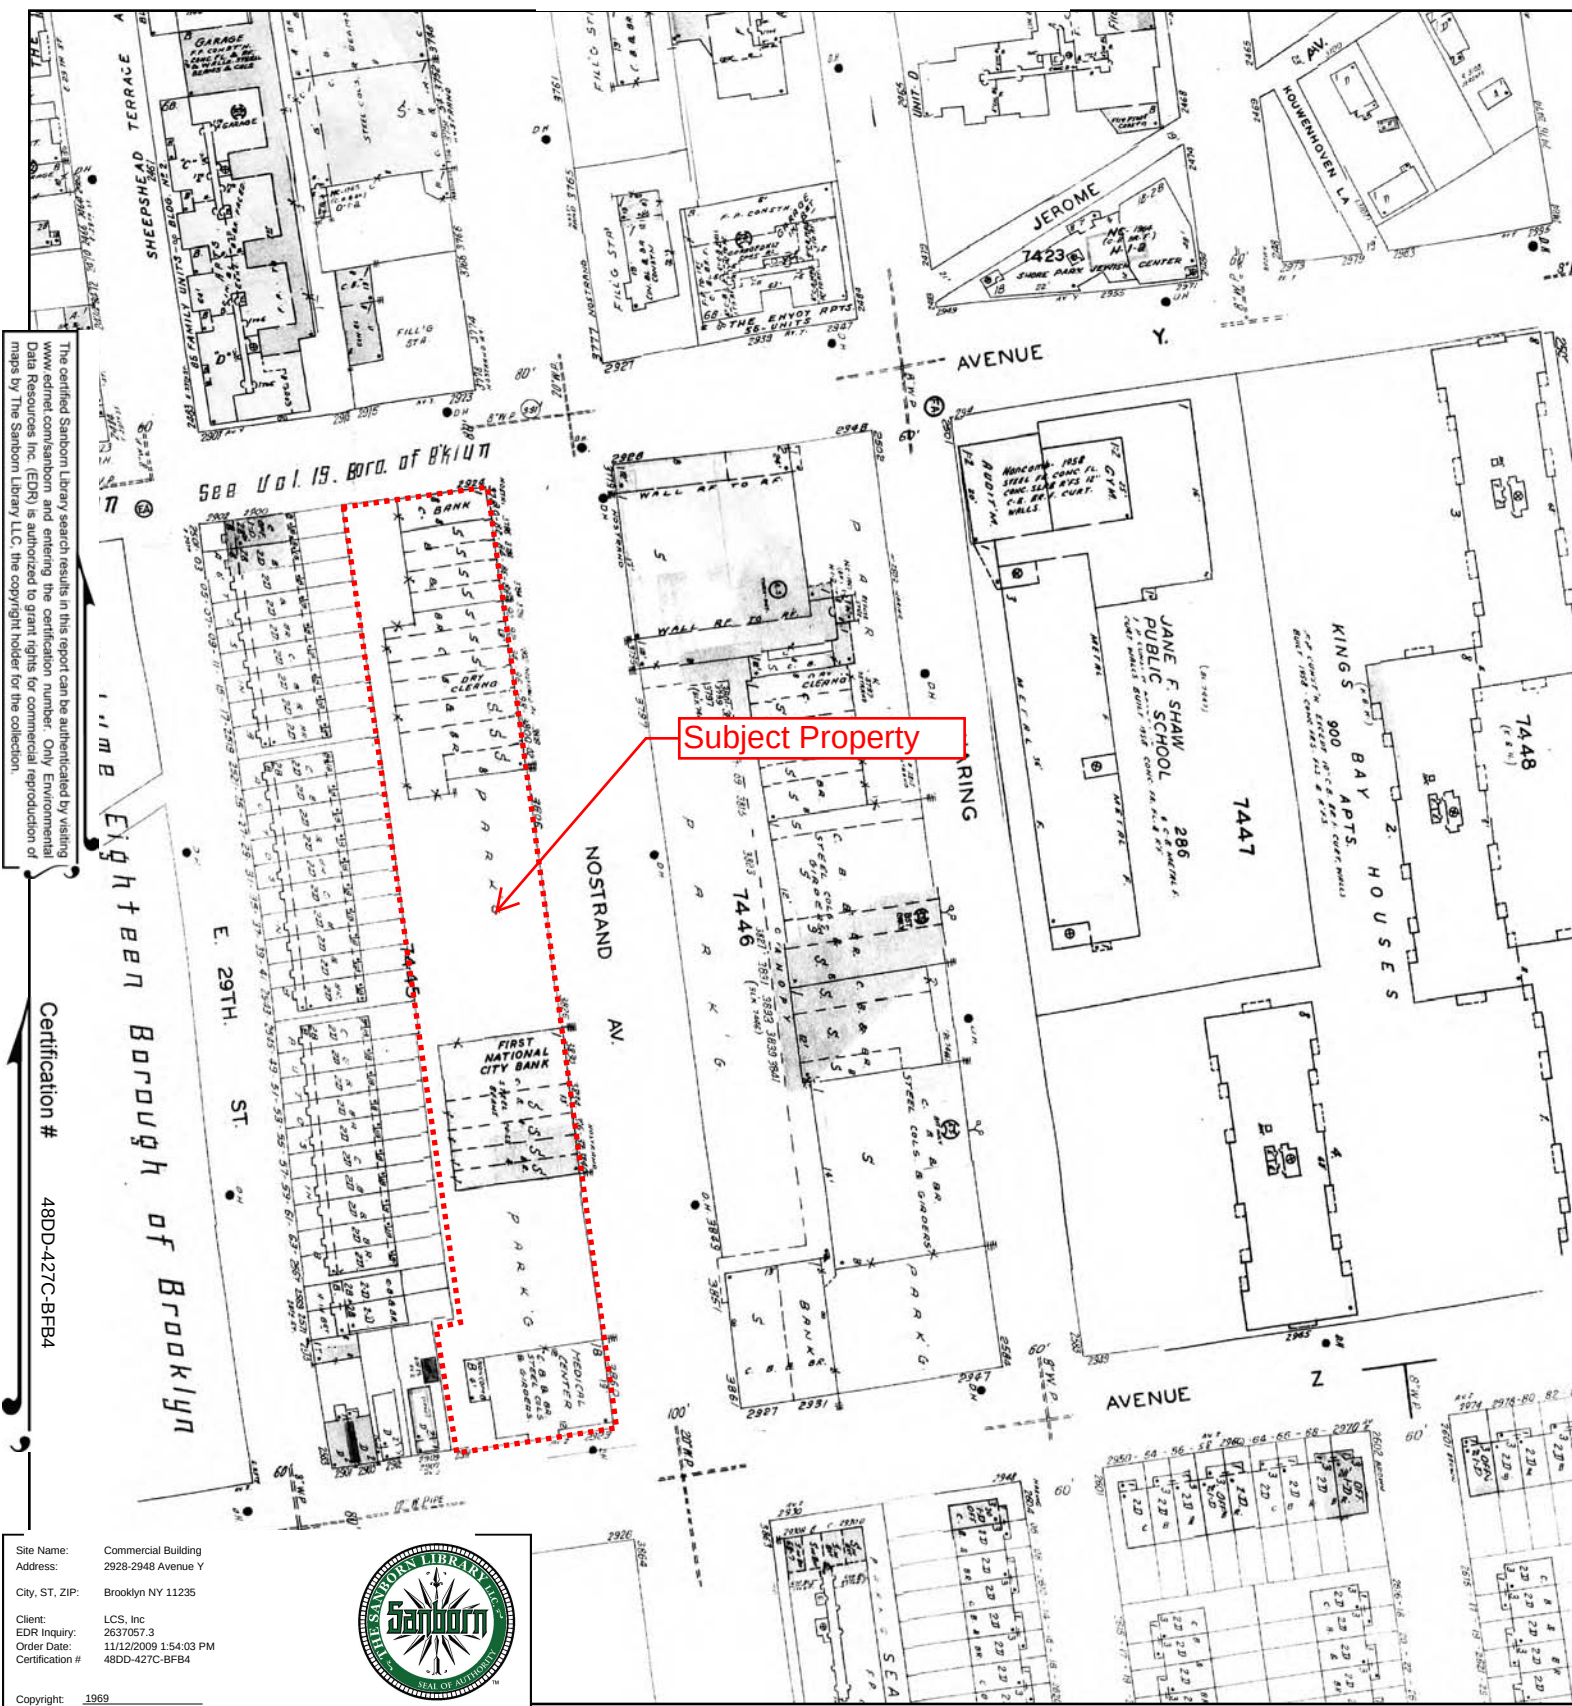


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

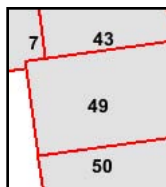



Volume 14, Sheet 7
Volume 19, Sheet 43
Volume 19, Sheet .49
Volume 19, Sheet 50



1968 Certified Sanborn Map

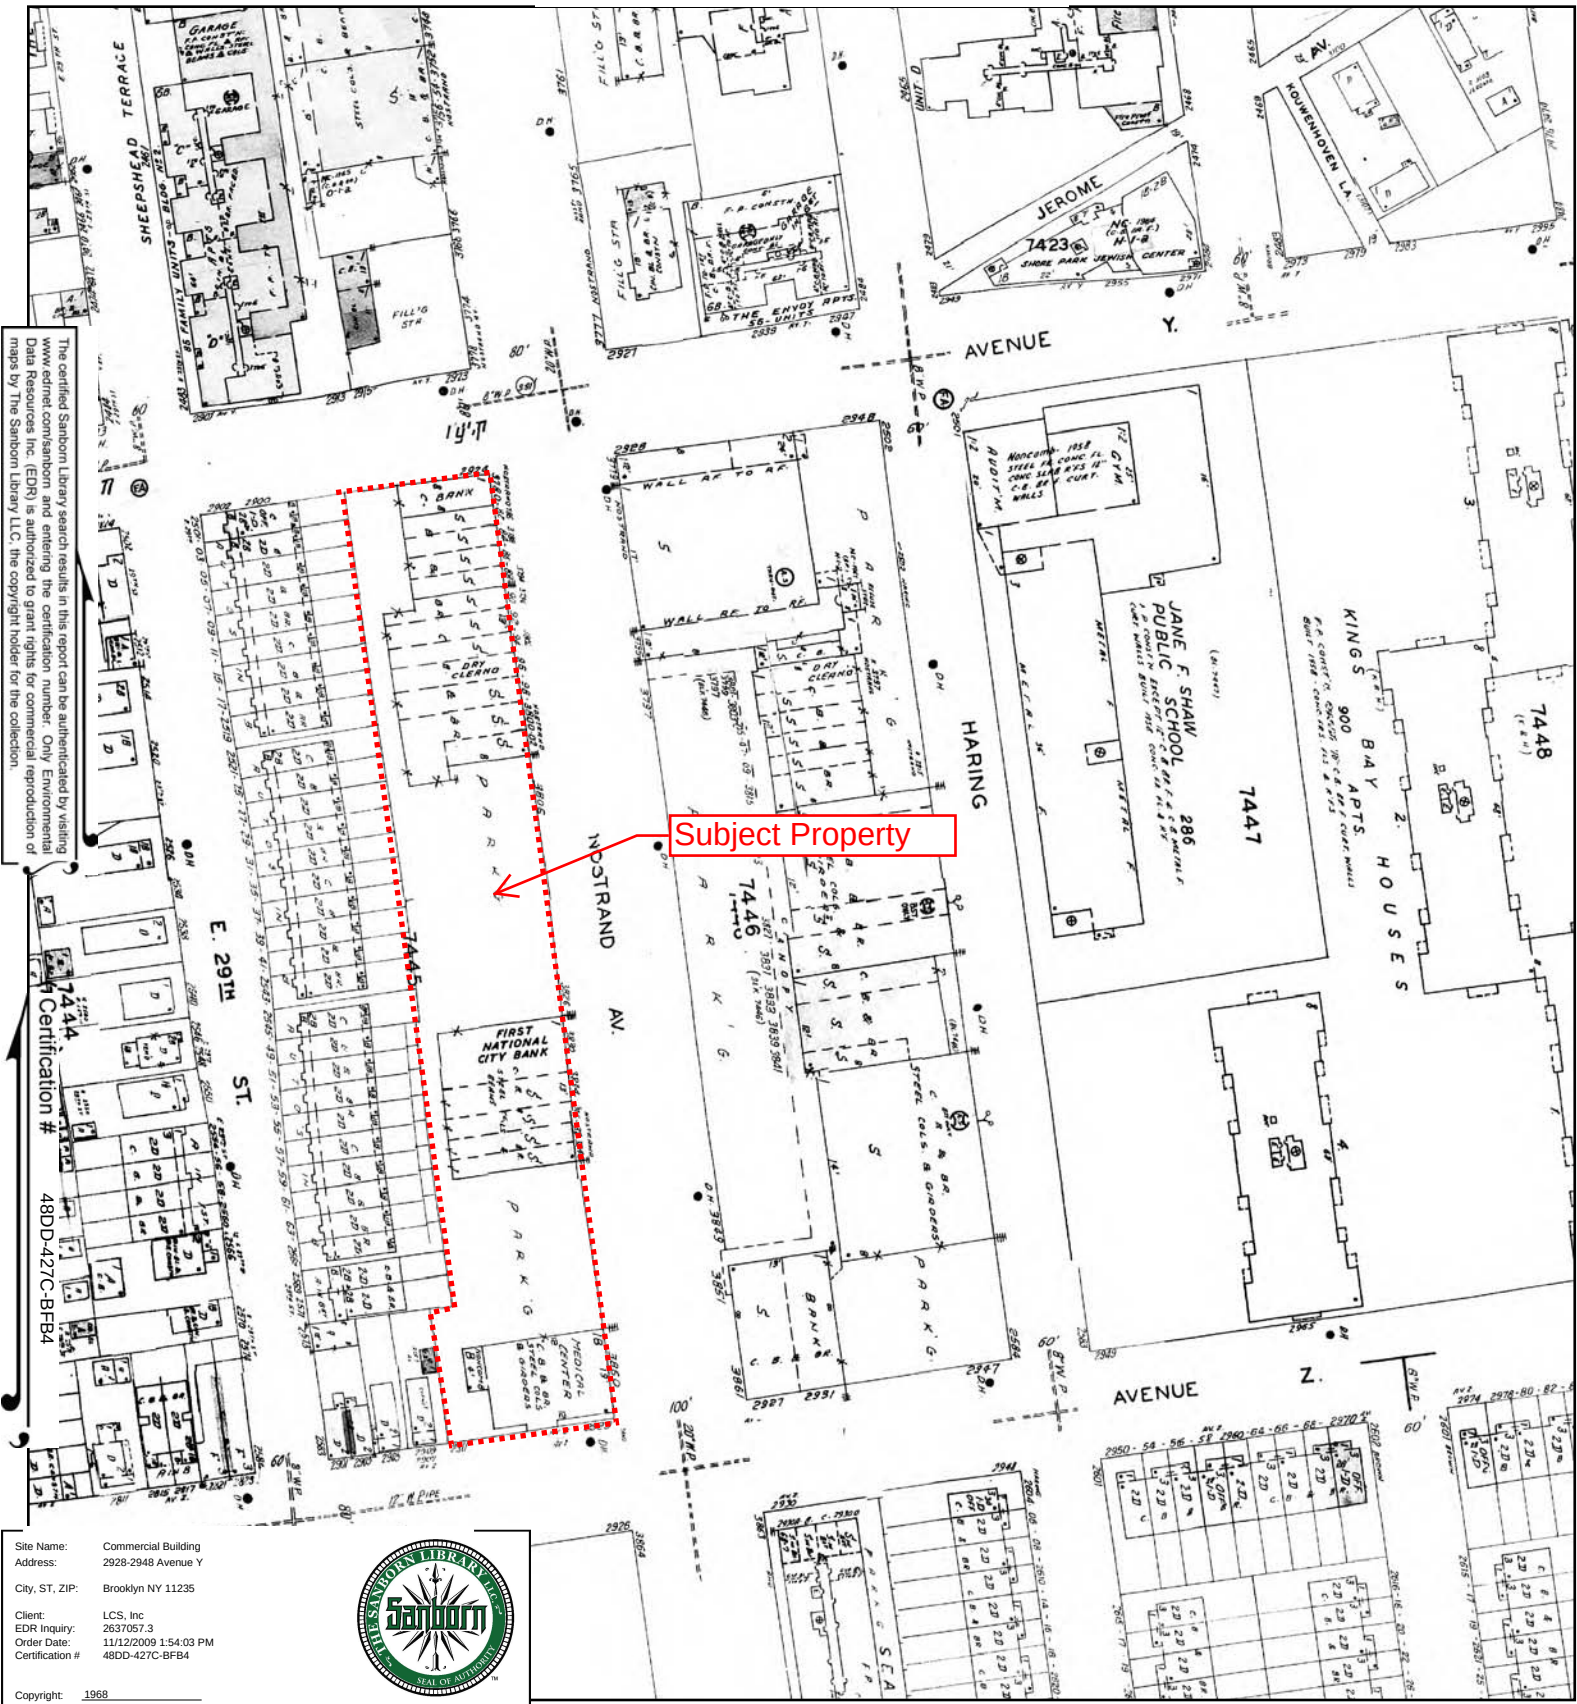


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

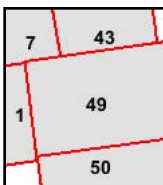



Volume 18, Sheet 1
Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 14, Sheet 7



1950 Certified Sanborn Map

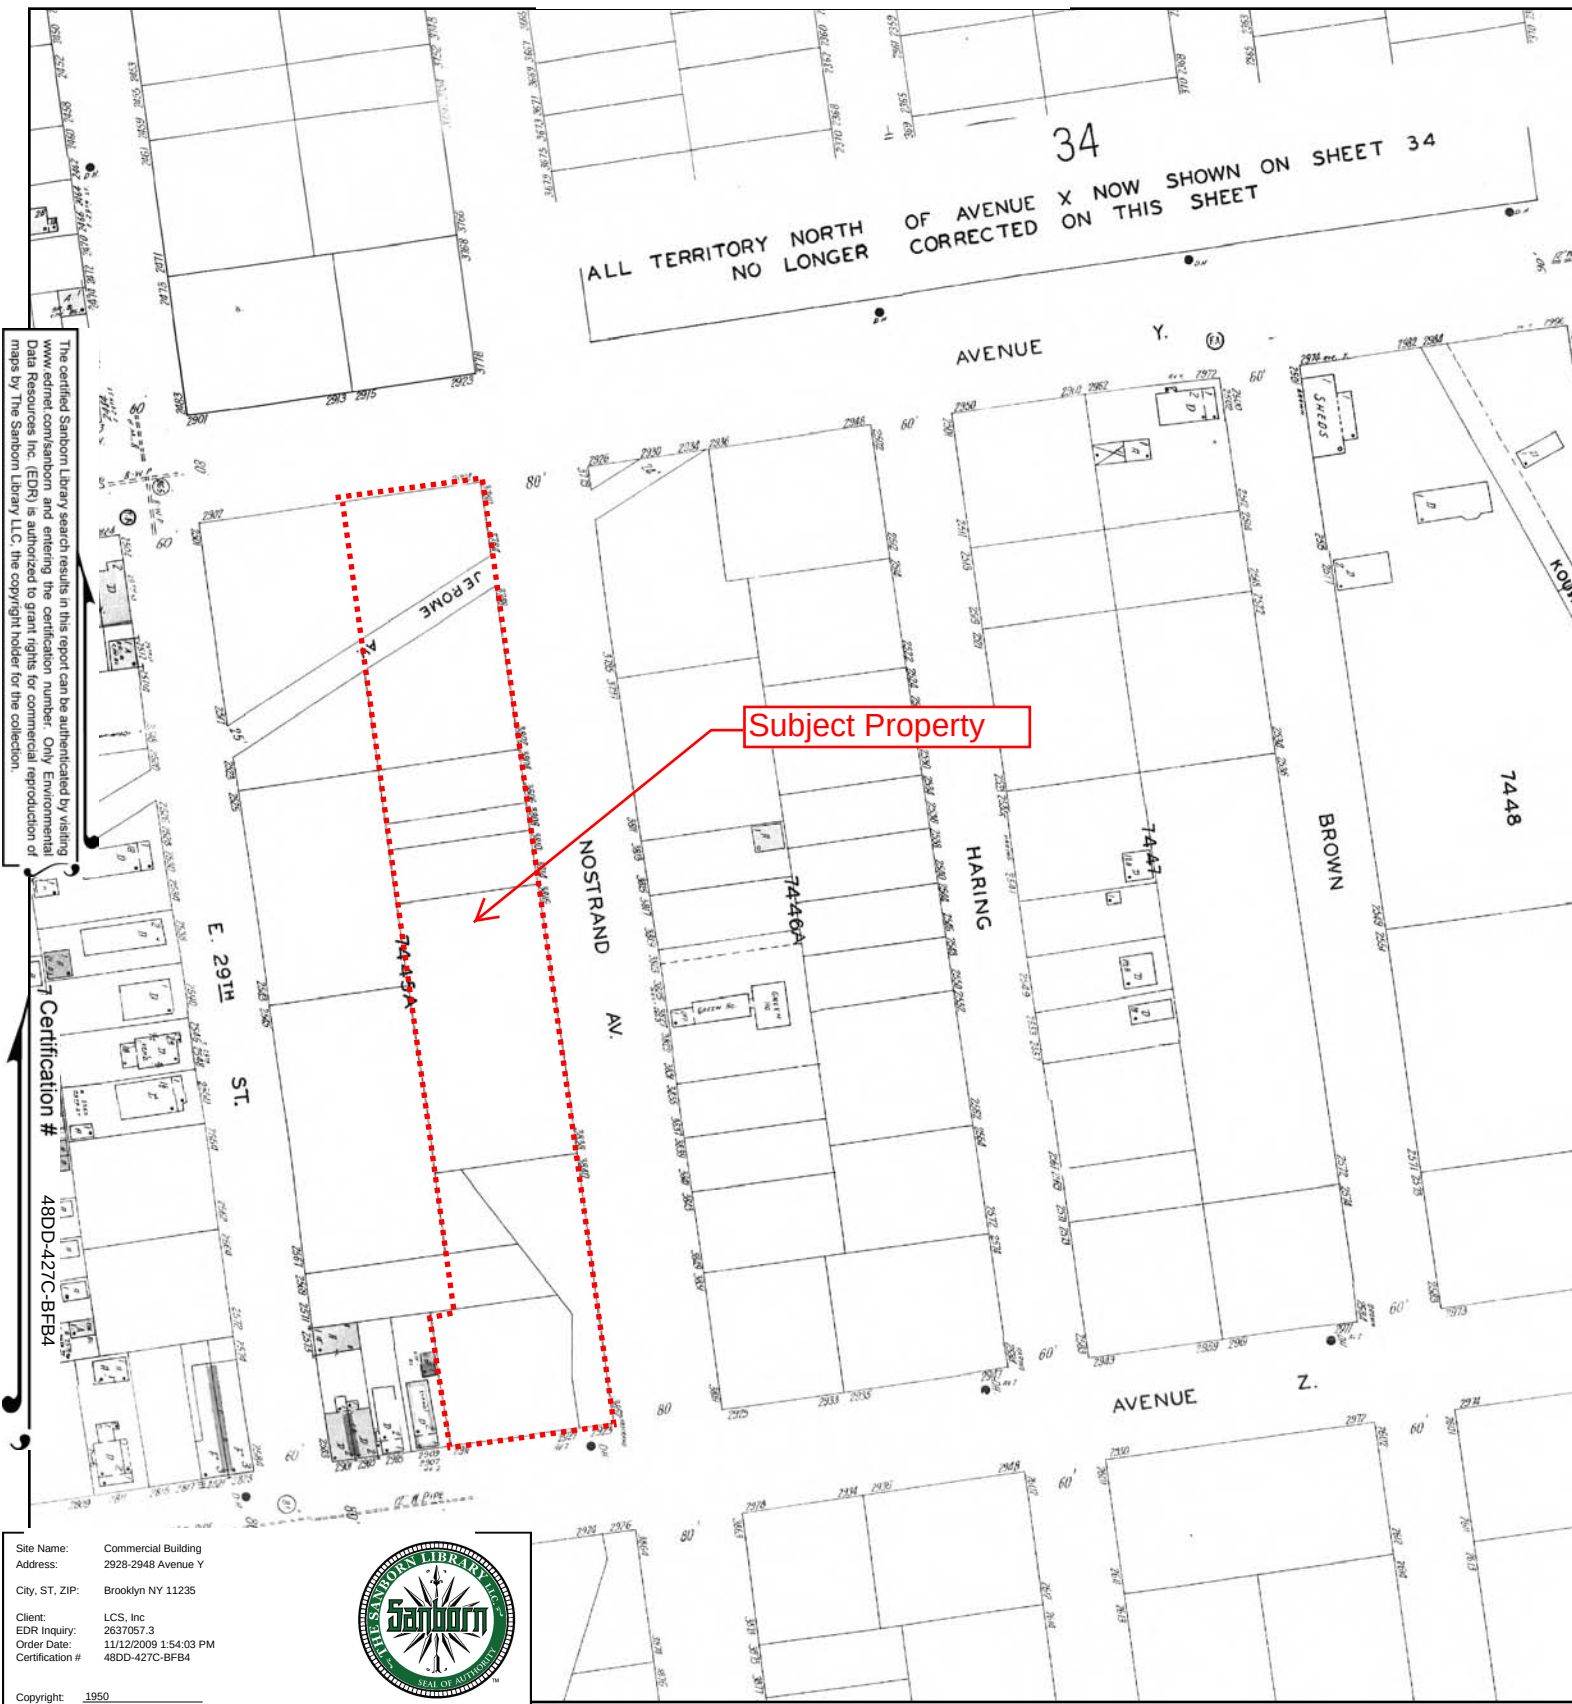

This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

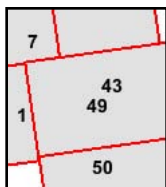



Volume 18, Sheet 1
Volume 14, Sheet 7
Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50



1930 Certified Sanborn Map




This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

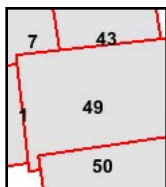



Volume 18, Sheet 1
Volume 19, Sheet 43
Volume 19, Sheet 49
Volume 19, Sheet 50
Volume 14, Sheet 7



1906 Certified Sanborn Map

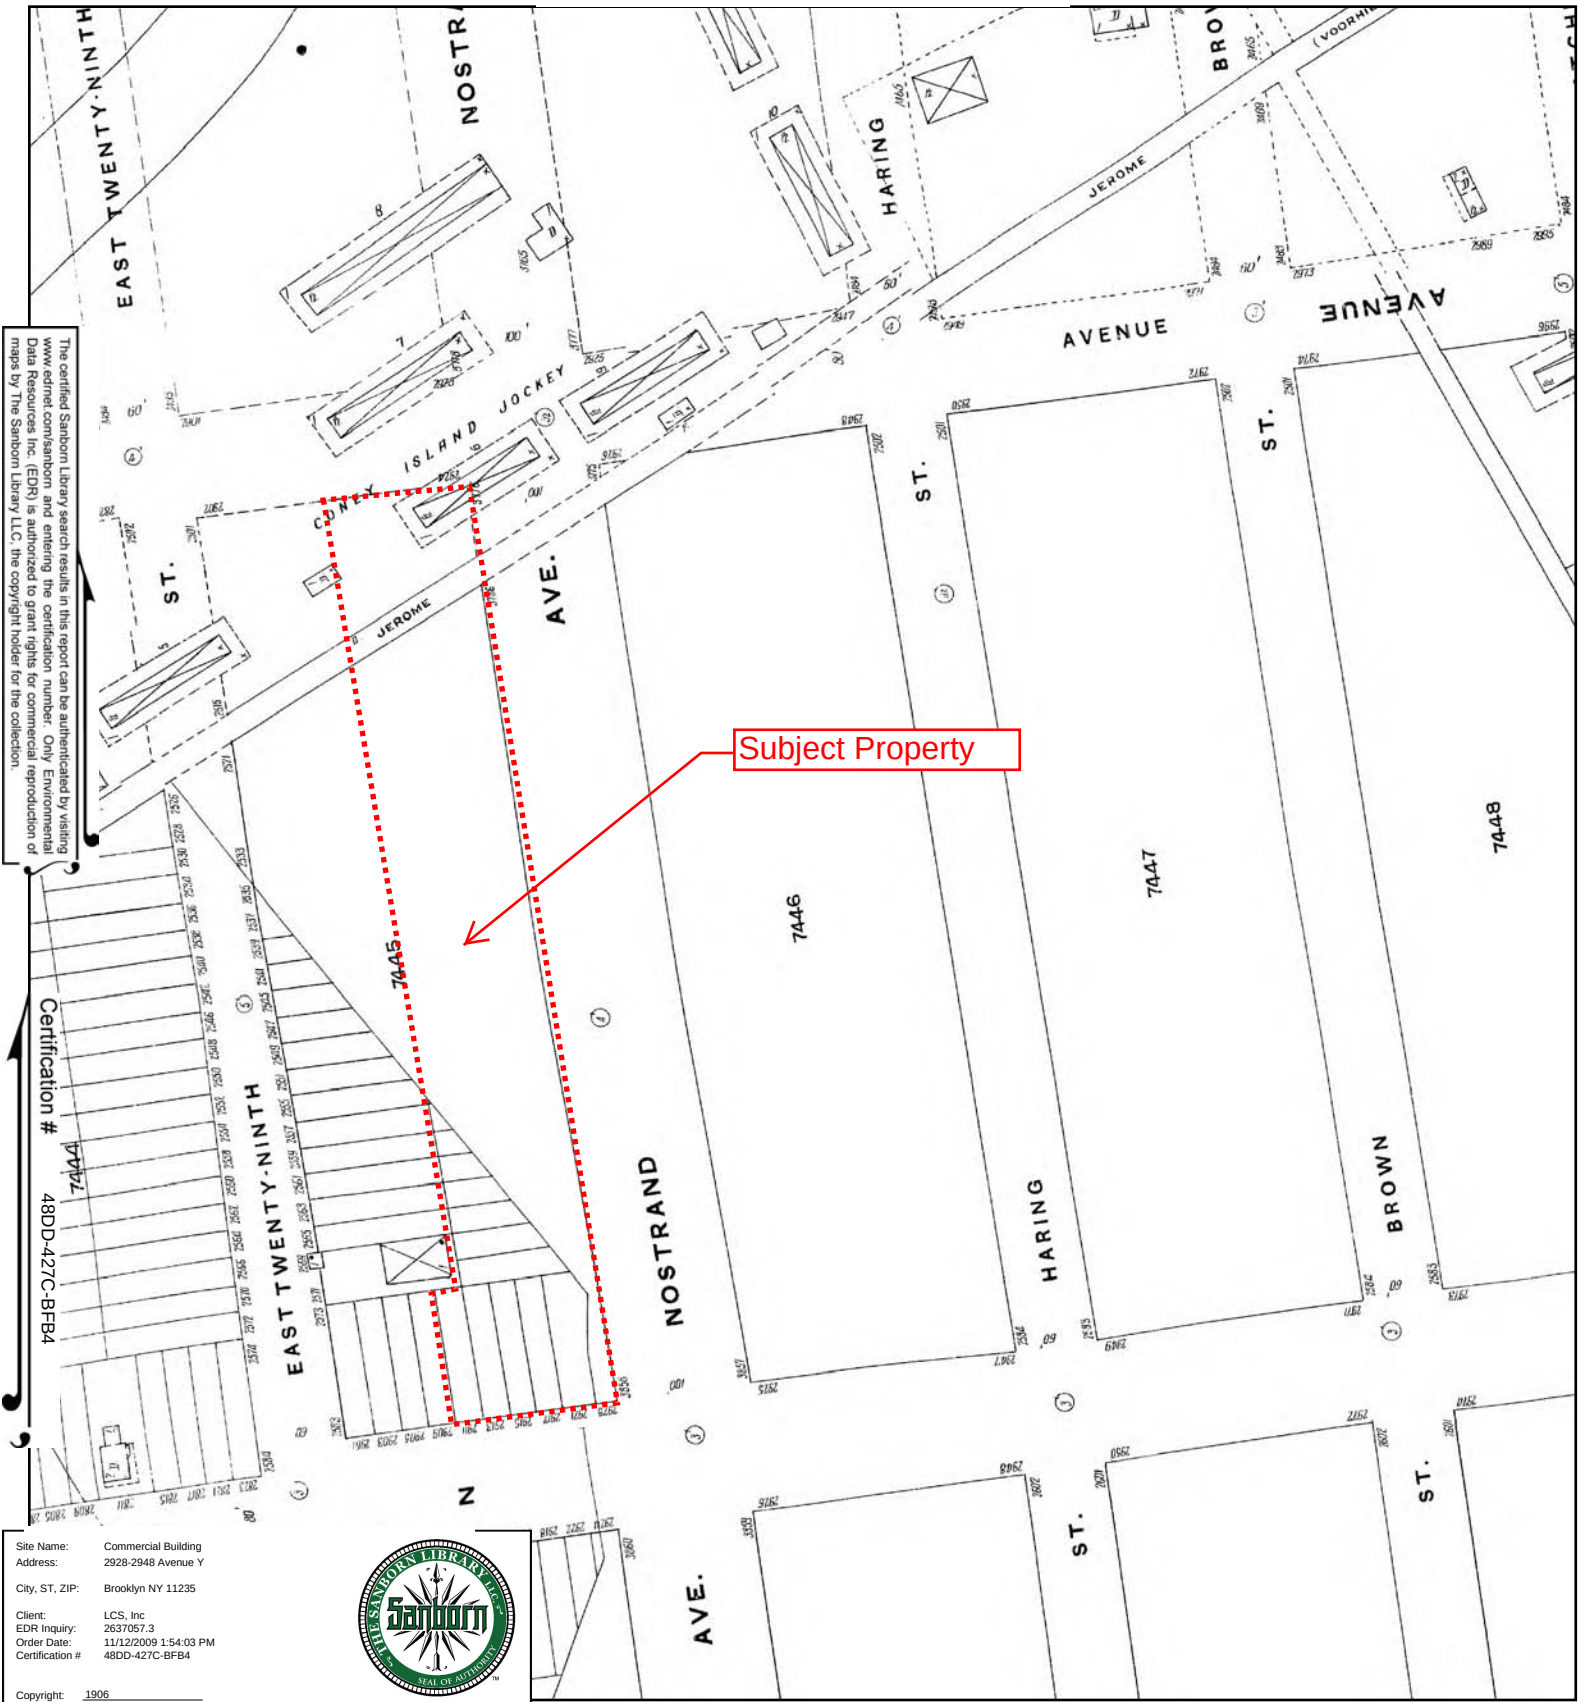


This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

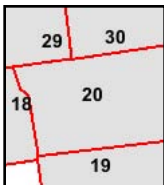



Volume 14, Sheet 18
 Volume 14, Sheet 19
 Volume 14, Sheet 20
 Volume 14, Sheet 29
 Volume 14, Sheet 30



1895 Certified Sanborn Map

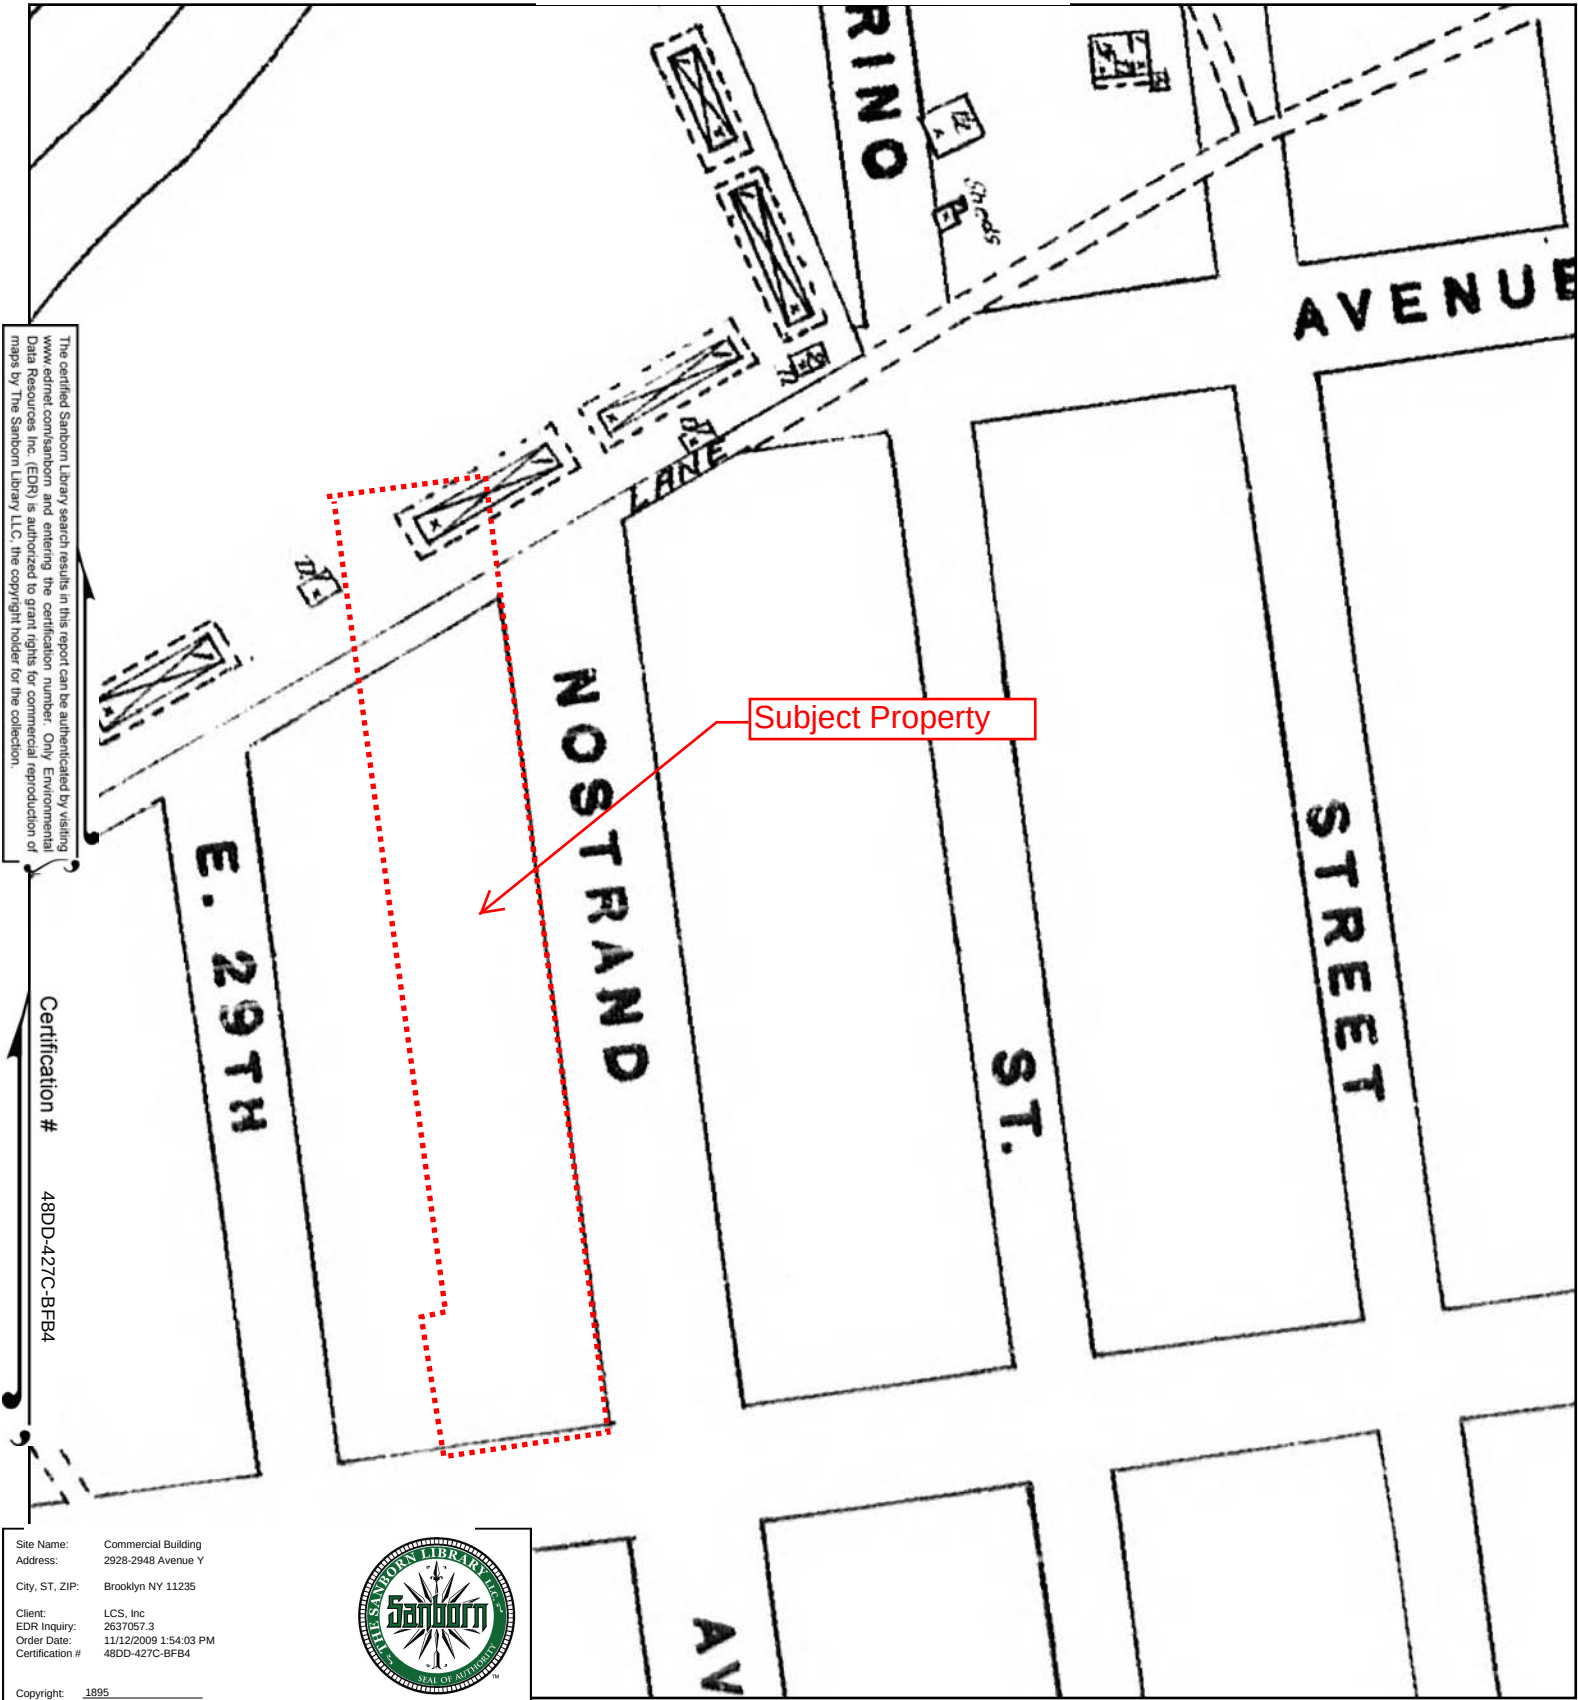

This Certified Sanborn Map combines the following sheets (thumbnails on page 3).

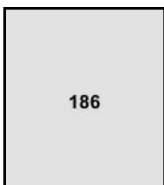

Volume B, Sheet 186



10.9 HYDROLOGIC/HYDROGEOLOGIC INFORMATION

LCS, INC.
QUAD/WETLANDS/SOILS/GEOLOGY

PROJECT #: 12H3984.21
SITE ADDRESS: 3780-3856 Nostrand
OFFICE REVIEWED AT: In-house
DATE REVIEWED: 12-3-12

USGS QUAD: Coney Island ELEV.: 10 ft DATE: 1966 1979

Anticipated groundwater flow: East

Nearest creek: Shell Bank Creek Dist.: 2421 Dir.: East

NYSDEC: www.dec.ny.gov/imsmaps/ERM/viewer.htm DATE: _____

(indicate if none within 2 miles)

NEAREST WETLAND: MI: _____ NSEW _____ CLASS _____

USFWS: www.fws.gov/wetlands/Data/Mapper.html DATE: _____

(indicate if none within 2 miles)

NEAREST WETLAND: MI: _____ NSEW _____ CLASS _____

<http://www.nysm.nysed.gov/gis/>

GEOLOGY: SHEET: _____

CLASS: _____

SUBCLASS: _____

<http://www.nysm.nysed.gov/gis/>

SURFICIAL GEOLOGY: SHEET: _____

CLASS: _____

SOILS: SOIL SURVEY (CO.): <http://websoilsurvey.nrcs.usda.gov> DATE: _____

CLASS: _____ HYDRIC _____

CLASS: _____ HYDRIC _____

CLASS: _____ HYDRIC _____

CLASS: _____ HYDRIC _____

CLASS: _____ HYDRIC _____

CLASS: _____ HYDRIC _____

RADON: COUNTY NAME: Kings New York VALUE: 1.59

TOWN NAME: Kings VALUE: 1.97

DRAINAGE BASIN: Major: Atlantic Ocean Minor: Atlantic Ocean

LEAD IN DRINKING WATER: NOT NEEDED - template

10.10 LIMITATIONS

This **ENVIRONMENTAL SITE ASSESSMENT BUSINESS/LENDER PHASE I, ASTM E1527-00** is based on the SCOPE OF SERVICES contained within this report. This report is not to be considered as an environmental audit of the subject property or a complete environmental investigation of the subject property.

We have prepared this report for the exclusive use of our client. LCS' liability is limited to use by this client for a period of five years. Use by any other party is strictly prohibited except by authorization in writing from this consultant. LCS has no liability for others' use of this report.

The purpose of this assessment is not to proclaim a property is devoid of environmental impact but rather to identify recognized environmental condition. This is defined by the ASTM standard as "the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substance or petroleum products into structures on the property. The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include de minimis conditions that generally do not present a material risk of harm to the public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be de minimis are not recognized environmental conditions."

This study was conducted using the ASTM 1527-00 Standard. The study should not be misconstrued as being completed to meet either the USEPA AAI or the ASTM 1527-05 Standard. This assessment (as defined by ASTM) is intended to reduce, but not eliminate, uncertainty regarding the potential for RECs in connection with a subject property. This assessment does not include any testing or sampling of materials.

This **ENVIRONMENTAL SITE ASSESSMENT BUSINESS/LENDER PHASE I, ASTM E1527-00** makes no warranties nor implies any liability regarding:

- 1) Site specific practices and/or disposal methods of the past or future owners.
- 2) The presence of lead containing materials, asbestos, radon and/or environmental impact of such substances on the subject property or buildings and structures on the subject property, other than noted here in.
- 3) Adjacent property owners, their environmental practices and/or impact of such properties and practices on the subject property other than observed from the subject property.
- 4) Unreported spills.
- 5) Practices, waste disposal, environmental concerns and/or modifications to waste site indexes after the date on this report.
- 6) Site groundwater or soil conditions.

10.10 LIMITATIONS (continued)

7) Accuracy or completeness of information supplied to LCS by others, including local municipalities.

8) Environmental conditions in areas that were not accessible or not otherwise shown to LCS (locked rooms, behind walls or ceilings, etc.).

This report is also subject to any and all limitations defined within the ASTM Business/Lender Phase I Standard. This includes, but is not limited to, the limitation that this report is intended to identify environmental conditions at a specific time and the report is only valid for a period of six months from the date of issuance. According to ASTM, asphalt pavement is considered a limitation.

11.0 PERSONNEL QUALIFICATIONS

Name: **Mark V. LiPuma**
Title: Chief Executive Officer
Years with Firm: Twenty-One
Education: Bachelors of Science, Canisius College, Buffalo, New York
Affiliations: AIA, CSI, NLAC
Certifications: EPA Certified Contractor/Supervisor
New York State Department of Labor Certified Asbestos Contractor/Supervisor
Certified Lead Designer, Planner and Inspector
Certified HUD/EPA Inspector and DELEADER
ASTM Conference on Environmental Site Assessments for Property Transfer

Experience: Mr. LiPuma is a graduate of Canisius College with a Bachelors Degree of Science. Over the years, Mr. LiPuma has developed and administered the operations of LCS, Inc.

As the Chief Executive Officer of LCS, Mr. LiPuma retains overall responsibility for all environmental investigation projects. Mr. LiPuma is knowledgeable of applicable environmental laws, rules and regulations; and is well recognized in Western New York as well as with select national companies throughout the United States.

Mr. LiPuma recently prepared the asbestos abatement plans and specifications for a \$2,000,000 project involving the removal of sprayed-on fireproofing in a facility. Scaffold decking, tight containment requirements and difficult working conditions added to the challenges of this project. The project was recently completed successfully.

Mr. LiPuma has prepared and assisted in the development of asbestos inspection reports for over 800 clients encompassing over 22,000,000 square feet of building space. Additionally, Mr. LiPuma has supervised the inspection, specifications design and project management for LBP and asbestos abatement in over 20 Public housing projects.

Mr. LiPuma's experience is sought after by many lenders and developers. He has assisted in designing environmental policies and has experience in property re-development. This includes asbestos inspection and removal projects through building demolition.

Name: **Thomas Duffy**
Title: President
Years with firm: Eleven
Education: Bachelors of Arts, St. Bonaventure University, Olean, New York
Certifications: Lead Inspector
New York State Department of Labor Asbestos Project Monitor, Inspector and Air Sampling Technician
Steel Structures Painting Council (SSPC) QP-1 Certified for removal of lead paint on complex steel structures
ASTM Conference on Environmental Site Assessments for Property Transfer

Experience: Mr. Duffy is currently the President of operations and is responsible for the oversight of all systems and operations, including research, development and implementation of such systems company-wide, as well as marketing and client retention in the Albany/Hudson Valley/NYC regions. Mr. Duffy's previous positions within LCS include Buffalo General Manager, Syracuse General Manager, and Regional Manager for Albany, Hudson Valley and New York City.

Mr. Duffy is a graduate of St. Bonaventure University with a Bachelors of Arts in Communications. Over the past eight years, Mr. Duffy has been involved in all aspects of environmental field projects throughout New York State.

He has provided services to clients including the closure of gasoline stations, closure of past industrial dumping grounds, Sewer System Evaluation Surveys, demolition and remediation projects, and soil and water sampling.

While with LCS, Mr. Duffy has conducted nearly 800 Phase I and Transaction Screen Environmental Site Assessments, and has participated as a team leader on asbestos inspections and lead-based paint surveys. In addition, he is knowledgeable in environmental laws.

Mr. Duffy has collected samples of water, soil, PCB's, asbestos and lead-based paint materials for analysis at independent laboratories. He is a skilled field technician and is well versed in the operation and use of HnU meters, PID and other air monitoring equipment.

Name: **Margaret Mary Battin**
Title: Chief Operating Officer
Years with Firm: Nine
Education: Bachelor of Science degree in Biology, Cornell University, Ithaca, New York

Certifications: ASTM Conference on Environmental Site Assessments for Property Transfer
Underground Storage Tank Removal Technician
HAZWOPPER Training

Experience: Ms. Battin is currently the Chief Operating Officer of LCS, Inc. Her current role involves overall business management, business development, supervision of Regional General Managers and Vice Presidents, and assessment of various environmental due diligence requirements and environmental risk for various financial institutions.

Ms. Battin has over nineteen years of experience in various aspects of the environmental field including environmental management, compliance, research and site investigation. Ms. Battin has acted as a liaison between property owners, and governmental and financial agencies. She was previously a partner and Vice President of an environmental consulting firm in the Chesapeake Bay Region.

Ms. Battin has conducted and reviewed over 5000 Phase I and Transaction Screen Environmental Site Assessments, environmental compliance and research projects, as well as conducted and managed numerous Phase II and Phase III projects including hydrogeologic investigations, storage tank management and underground storage tank (UST) removal and closure projects, Resource Conservation and Recovery Act (RCRA) monitoring, assessment and reporting, groundwater monitoring well installation and monitoring, landfill delineation projects, and site characterization and remedial design projects.

Name: **Mary Beth Facklam**
Title: Senior Vice President, Due Diligence Services
Years with Firm: Eleven
Education: Master's Degree in Science Education, State University of New York at Buffalo, Buffalo, New York
Bachelor of Arts degree in Geology and Anthropology, University of Rochester, Rochester, New York

Affiliations: American Society of Testing and Materials

Experience: Ms. Facklam is currently Senior Vice President of Environmental Due Diligence Services. She is responsible for the management, preparation and/or review of every environmental report prepared by LCS.

Prior to joining LCS, Ms. Facklam held a position with a local environmental consulting firm where she performed various duties as Geologist and Environmental Specialist.

Ms. Facklam has conducted over 500 Phase I Environmental Site Assessments of commercial properties, including automotive dealerships, office buildings and apartment complexes. In addition, she maintained databases for environmental information, coordinated operations for drilling and environmental fieldwork, classified soil and rock samples, performed physical laboratory soil testing and wrote final reports.

While at LCS, Ms. Facklam has been involved with over 5,000 Environmental Site Assessments. In addition, she is knowledgeable in environmental laws.

Name: **David Crandall**
Title: Vice President
Years with Firm: 3
Total years: 8
Years with Education: Bachelor of Science, Environmental Studies Policy and Management, Cum Laude, State University of New York College of Environmental Science and Forestry, Syracuse, New York

Certifications: ASTM Conference on Environmental Site Assessments for Property Transfer
OSHA HAZWOPER 40-Hour Course/8-Hour Refresher
OSHA 8-Hour HAZWOPER Supervisor

Experience: Mr. Crandall has 8 years of experience in environmental consulting. During a previous tenure as an Environmental Technician with LCS, he performed over 500 EA Quicks, Transaction Screens, and Phase I Environmental Site Assessments. Mr. Crandall also participated in numerous Phase II Investigations and remedial projects including soil excavations and UST and in-ground hydraulic lift closures.

In 5.5 years with an international environmental firm, Mr. Crandall was responsible for Remedial Investigations, Feasibility Studies, and Remedial Actions for Federal, State, and commercial clients. He has been responsible for developing scopes of work and costing projects, performing soil and groundwater sampling, groundwater well installations, soil vapor and vapor intrusion assessments, and for the preparation of summary reports along with developing recommendations for future work. Mr. Crandall was also responsible for performing contractor oversight during remedial actions, and developing post remedial action Site Management Plans.

Mr. Crandall is currently Vice President at LCS, performing report reviews and assisting in Phase II and Remedial Action scoping, costing, and performance.

While studying at SUNY-ESF, Mr. Crandall focused primarily on environmental policy, law, and sciences, developing a strong wealth of knowledge in the environmental field.

Name: **Julie A. Daly**
Title: General Manager – Tri-State Area
Years with Firm: Twelve
Education: Bachelors of Science degree in Environmental Science,
University of Tampa, Tampa, Florida
Certifications: New York State Department of Labor Asbestos Inspector
ASTM Conference on Environmental Site Assessments for Property Transfer
Fundamentals of Mold/Microbial Remediation and Assessment
RMD's Lead Paint Inspection
Experience: Currently, Mrs. Daly is the General Manager of New York City and the greater Tri-State area. As GM, her duties include the maintenance of existing clients as well as managing all Phase I and abbreviated ESAs within New York City and the greater Tri-State area. Additionally, Mrs. Daly's responsibilities include the management and completion of third-party report reviews for lenders.

Mrs. Daly has over thirteen years of experience in various aspects of the environmental field including environmental compliance, research and site investigation. Mrs. Daly has conducted countless Environmental Site Assessments across the United States for commercial and industrial properties, including automotive repair centers, manufacturing facilities, shopping centers, office buildings and apartment complexes. This has included all aspects of data collection, data-review and report preparation. Her responsibilities have also included conducting asbestos surveys, conducting lead-based paint surveys, managing large property portfolios, training environmental professionals and assisting in Phase II investigations. In addition, Mrs. Daly performs construction-related services, including Construction Draw Inspections.

While studying at the University of Tampa, Mrs. Daly volunteered with the Florida Department of Environmental Protection, Domestic Waste Water Compliance and Enforcement Division. This involved conducting assessments to determine compliance with local, state and federal laws pertaining to operation and maintenance of waste water treatment plants, as well as collecting samples, analyzing data, and preparing reports to submit to various agencies.

Name: **Heather J. Lamb**
Title: Vice President, Due Diligence Services
Years with Firm: Eleven
Education: Bachelors of Science degree in Environmental Science, State University of New York at Fredonia, Fredonia, New York
Certifications: ASTM Conference on Environmental Site Assessments for Property Transfer
Experience: Currently, Ms. Lamb is the Vice President of Due Diligence Services for LCS. While at LCS, Ms. Lamb has been involved with over 5,000 Transaction Screen and Phase I Environmental Site Assessments. Her duties include performing site inspections, data collection, report preparation and review of final reports as well as supervision and management of report writers.

While attending SUNY Fredonia, Ms. Lamb was involved with research for the State of the Lake Report for Chautauqua Lake. Her research involved sampling and testing of rainwater for such atmospheric pollutants as nitrous oxides and total phosphorous load. Additionally, Ms. Lamb spent a summer in China researching the effects of biogenic silica on marine life in addition to researching the exchange of nutrients between sediment and water and the chemical method of wet alkaline extraction. Her research involved testing sediment from the Yellow and Bohai Seas and researching various methods of chemical analyses related to biogenic silica.

Name: **Ryan Ward**
Title: Environmental Analyst
Years with Firm: One
Education: Bachelors of Arts in Environmental Studies, Stony Brook University, Stony Brook, NY

Experience: Currently, Mr. Ward is an Environmental Analyst serving the LCS Tri-State Region. Mr. Ward performs environmental site assessments for EAQuick, Transaction Screens and Phase I reports, including site surveillance, data collection and data review. In addition, Mr. Ward performs construction-related services, including Construction Draw Inspections.

Prior to joining LCS, Mr. Ward studied at Stony Brook University where his studies concentrated on the marine environment. During his time there Mr. Ward became proficient in the proper techniques for sampling, surveying and analyzing potential environmental issues.

Name: **Sarah Vanderhoff**
Title: Environmental Analyst
Years with firm: Less than one
Education: Bachelors of Science Degree in Biological Sciences with a minor in Environmental Studies, State University of New York at Buffalo, Buffalo, New York (2011); Associates of Science Degree in Science and Mathematics, Erie Community College, State University of New York (2008).

Experience: Currently, Ms. Vanderhoff is an environmental analyst working in the corporate office of LCS as a technical report writer of EA Quick Loan Plus reports, Transaction Screens and Phase I Environmental Site Assessments.

While studying at SUNY at Buffalo, Ms. Vanderhoff conducted a reptile population survey during an internship with the Senior Wildlife Biologist of the Region 9 office of the New York State Department of Environmental Conservation. This study involved in-field data collection regarding several reptile species in Erie and Niagara Counties of New York and the reporting of population findings.

12.0 REFERENCES

1 GEOLOGIC MAP OF NEW YORK-- LOWER HUDSON SHEET

Compiled and edited by Lawrence V. Rickard and Donald W. Fisher, March 1970.
University of the State of New York; The State of New York Education Department.

2 SURFICIAL GEOLOGIC MAP OF NEW YORK-- LOWER HUDSON SHEET

Compiled and edited by Donald H. Cadwell, 1988.
University of the State of New York; The State of New York Education Department.

3 EDR, Environmental Data Resources, Inc., The EDR-Radius Map Report, Inquiry #3465818.2s. Report Dated November 29, 2012.

4 EDR, Environmental Data Resources, Inc., Certified Sanborn Map Report, Inquiry #2637057.3. Report Dated November 12, 2009.

5 <http://maps.google.com>

6 www.propertyshark.com

7 www.nyc.gov

8 www.oasisnyc.net

9 <http://historical.mytopo.com>

10 <http://www.health.state.ny.us/environmental/radiological/radon/towns.htm>

13.0 ACRONYMS/ABBREVIATIONS

ACM	Asbestos-Containing Materials
AIRS	Aerometric Information Retrieval System
AST	Aboveground Storage Tank
ASTM	American Society for Testing and Materials
CBS	Chemical Bulk Storage
CERCLA	Comprehensive Environmental Response, Compensation and Liability Act
CERCLIS	Comprehensive Environmental Response, Compensation and Liability Information System
CORRACTS	Corrective Action
EDR	Environmental Data Resources
ERNS	Emergency Response and Notification System
FINDS	Facility Index System
FOIA	Freedom of Information Act
FOIL	Freedom of Information Law
FWM	Freshwater Wetlands Map
LCS	Lender Consulting Services, Inc.
LQG	Large Quantity Generator
LTANK	Leaking Tank
LUST	Leaking Underground Storage Tank
MOSF	Major Oil Storage Facility
MSDS	Material Data Safety Sheets
mVOC	Microbial Volatile Organic Compound
N/A	Not Available, Not Applicable
NFRAP	No Further Remedial Action Planned
NPDES	National Pollution Discharge Elimination System
NPL	National Priorities List ("Superfund")
NRCS	Natural Resource Conservation Service (by County)
NWI	National Wetlands Inventory
NYCDOH	New York City Department of Health
NYCDEP	New York City Department of Environmental Protection
NYS	New York State
NYSDEC	New York State Department of Environmental Conservation
NYSDOH	New York State Department of Health
PBS	Petroleum Bulk Storage
PCB	Polychlorinated Biphenyl
PCi/L	Pico Curies per Liter
RCRA	Resource Conservation and Recovery Act
RCRIS	Resource Conservation and Recovery Information System
REC	Recognized Environmental Condition
SPDES	State Pollution Discharge Elimination System
SQG	Small Quantity Generator
TSDF	Treatment, Storage and Disposal Facility
USDA	United States Department of Agriculture
USEPA	United States Environmental Protection Agency
USFWS	United State Fish and Wildlife Service
USGS	United States Geological Survey
UST	Underground Storage Tanks