

CAK RF		Daily Activity Report						
		975 Nostrand Avenue Brooklyn, NY						
	BCP Site No. C224335							
Date:	General Site Information Date: Tuesday, August 1, 2023							
Weather:	er: 67-83°F, Clear							
Wind Direction/Spee AKRF Personnel on S								
AKRF Equipment on S	Mini RAE 3000 Photoionization Detectors [(PID) x3] and DustTrak Aerosol Monitors (x3)							
Visitors:		Contractor Information				None.		
Subcontractor					Service			
	Olivero)			SOE Installation				
	oadway)			General Contractor (GC)				
	Description and Location of Work Activitie							
Approximately 60 cubic yards of soil were excavated and exported from Grid 2 for off-site disposal at the Impact Recovery and Reuse Center (IRRC) facility located in Lyndhurst, NJ. A total of 47.42 tons of GPA stone were imported to Grid 1 from Tilcon West Nyack Quarry, NY. Concrete was poured along the western site wall in Grids, and 7. Grading occurred in Grid 4.								
Material Disposal Tracking Information								
ı	Destination Facility	Daily Trucks	Total Trucks	Daily Approx. Cubic Yds	Total Approx. Cubic Yds	Total Site Loads	Total Approximate Cubic Yards	
	locco Recycling - C&D ngsland Ave, Brooklyn, NY	0	16	0	320			
IRRC (Impact F	Recovery and Reuse Center) - C&D Lyndhurst, NJ	0 13		0	260	2433	48,660	
IRRC (Impact Recovery and Reuse Center) - soil/fill Lyndhurst, NJ		3	791	60	15,820			
KSR Corp Development - soil/fill 936 Harrison Ave, Kearny, NJ		0	22	0	440			
	e Soil Management - soil/fill ows Mill Road, Keasbey, NJ	0	1,517	0	30,340			
Clean Earth of Carteret - soil/fill 24 Middlesex Avenue, Carteret NJ		0	74	0	1,480			
			rt Material Trac					
	Origin Facility	Daily Trucks	Total Trucks	Daily Tonnage	Total Tonnage	Total Site Loads	Total Quantity (tons)	
IRRC (Impact Recovery and Reuse Center) - 3/4" Clean Blue Stone		0	9	0	166.45	221	5,066.27	
IRRC (Impact Recovery and Reuse Center) - 1.5" Clean Blue Stone		0	17	0	415.81			
IRRC - DGA		0	2	0	46.55			
Stone Industries, Inc 2.5" Crushed Stone		0	7	0	158.19			
Impact Materials Jersey City - 3/4" Clean Blue Stone		0	2	0	45.20			
Vulcan Materials (Hamburg Quarry) - GPA		0	87	0	2,145.00			
Tilcon Mt. Hope Quarry - GPA		0	1	0	25.86			
Tilcon West Nyack Quarry - GPA		2	78	47.42	1650.80			
Evergreen Recycling of Corona - 2.5" Quarried Stone		0	1	0	20.87			
Impact Materials Jersey City - DGA		0	17	0	391.54			
CAMP Air Monitoring Results CAMP Station UPWIND DOWNWIND								
Odors:	None				None			
VOC Action Level Exceedance(s):		None				None		
Particulate Action Level Exceedance(s): Maximum VOC Level (ppm) 15-min avg:		None 0.2447				None 0.0000		
Maximum Particulate Level (mg/m³) 15-min avg:		0.0875				0.0005		
CAMP Response Acti		•	-		J			
,			Additonal In	formation				
Planned Work Activity Installation of COE coil execution installation of the yangs harrier membrane rehar work and installation of the SCOS								
for Next Day/Week:								
Comments:	None.							





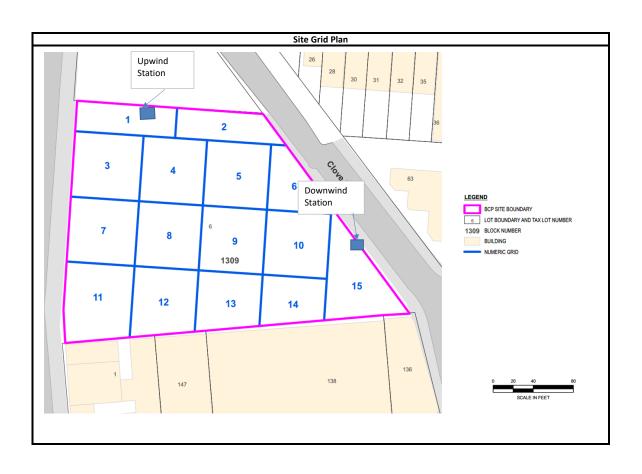

Photograph 1 -Loading soil onto trucks for export, view facing east.

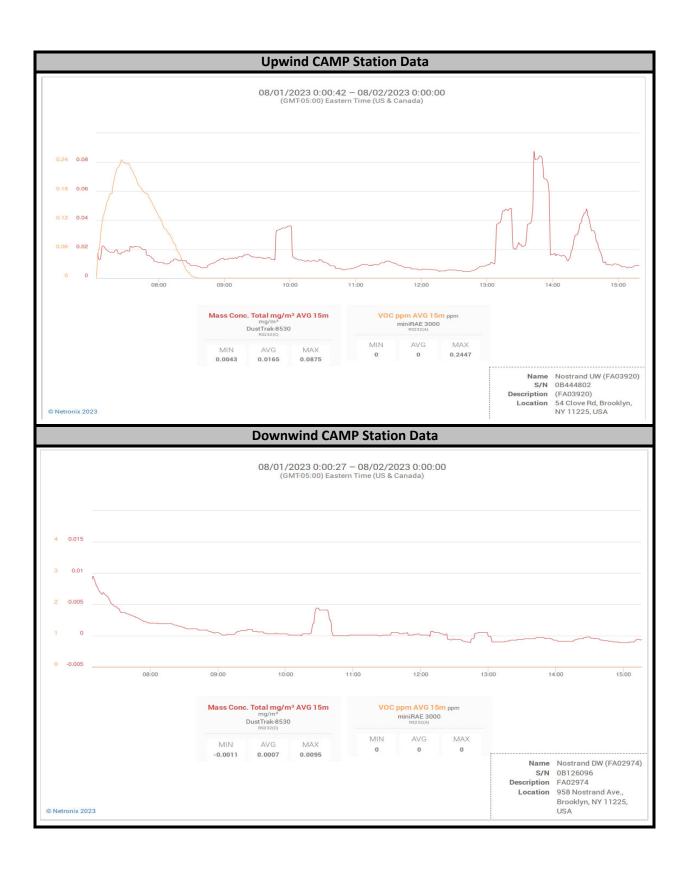



Photograph 3 -Pouring concrete for the western foundation wall in Grids 3 and 7, view facing south.

