PHASE I ENVIRONMENTAL SITE ASSESSMENT

for

CHRISTIAN CULTURAL CENTER
12020 Flatlands Avenue
Brooklyn, Kings County, New York

Prepared For:

GO UCL, LLC
432 Park Avenue South, 2nd Floor
New York, New York 10016

Prepared By:

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
300 Kimball Drive
Parsippany, New Jersey 07054
NJ Certificate of Authorization No: 24GA27996400

Amanda Forsburg, CHMM
Project Scientist

Steven A. Ciambruschini, P.G., L.E.P.
Principal / Vice President

Commencement Date: 15 January 2018
Report Completion: 19 March 2018

100688801

LANGAN

TABLE OF CONTENTS

Page No.

EXECUTIVE SUMMARY i

1.0 INTRODUCTION 1

2.0 RELIANCE/LIMITATIONS 1

3.0 SITE DESCRIPTION 3

4.0 GEOLOGIC AND HYDROGEOLOGIC CONDITIONS 5

5.0 USER PROVIDED INFORMATION 5

5.1 Title Records 5

5.2 Environmental Liens or Activity and Use Limitations 5

5.3 Specialized Knowledge 6

5.4 Valuation Reduction for Environmental Issues 6

5.5 Commonly Known Information 6

5.6 Documentation Provided by the User 7

6.0 REVIEW OF PREVIOUS LAND USE 9

6.1 Sanborn Fire Insurance Maps 9

6.2 City Directory Search 12

7.0 REGULATORY DATABASE SEARCH 13

8.0 GOVERNMENT AGENCY RECORDS REVIEW 30

9.0 SITE RECONNAISSANCE 34

10.0 ADDITIONAL ISSUES 37

10.1 Wetlands/Floodplain Designation 37

10.2 Protected Endangered Species / Critical Habitats 37

10.3 Asbestos 38

10.4 Lead-based Paint 38

10.5 Lead in Drinking Water 38

10.6 Indoor Air / Microbial Assessment (Mold) 39

10.7 Radon 39

10.8 Historical and Archaeological Review 39

TABLE OF CONTENTS
(Continued)

11.0 DEVIATIONS 40

12.0 FINDINGS/OPINIONS 41

13.0 CONCLUSIONS 42

14.0 QUALIFICATIONS / CERTIFICATION 44

LIST OF TABLES

Table 1 **List of Contacts**

LIST OF FIGURES

Figure 1 **Site Location Map**
Figure 2 **Tax Map**
Figure 3 **Zoning Map**

APPENDICES

Appendix A **User Questionnaire**
Appendix B **Property Owner/Operator/Key Site Manager Questionnaire**
Appendix C **Sanborn Maps**
Appendix D **City Directory Search**
Appendix E **Environmental Database Radius Report**
Appendix F **Government Correspondence and Records**
Appendix G **Site Photographs**
Appendix H **Langan Resumes**

EXECUTIVE SUMMARY

This Phase I Environmental Site Assessment (ESA) was prepared by Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. on behalf of GO UCL, LLC to identify current or potential environmental concerns and Recognized Environmental Conditions (RECs) at the ±10.32 acre proposed development site consisting of the property at 12020 Flatlands Avenue (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and Block 4434, Lot 1) located in Brooklyn, New York. The ESA included a site inspection, review of historical information, completion of a federal/state/local environmental database search, and interviews with local and state agencies to assess current and past site conditions.

Block 4434, Lot 1 on the northeastern portion of the subject property is currently a vacant lot covered with compacted recycled concrete aggregate (RCA) currently used for parking by the Christian Cultural Center and previously used for auto wrecking and dismantling. Portions of Block 4430 Lot 1, Block 4431 Lots 1 and 200, Block 4432 Lot 1, and the Alabama Avenue roadway are currently developed with a one- to two-story building occupied by the Christian Cultural Center containing auditorium spaces for church services, administrative offices, two hydraulic elevators, a kitchen, and a day care center. The surrounding parking area is paved with asphalt and contains multiple interconnected stormwater drainage grates that are not connected to the municipal sewer system according to on-site personnel. One exhaust blower connected to an eight-inch diameter steel pipe was observed on the roof and is connected to a sub-slab methane venting system according to interviews with on-site personnel.

Based on information obtained during the visual inspection of the subject property, review of environmental databases and historic information, and contact with federal/state/local official agencies, the following recognized environmental conditions (RECs) and business environmental risks that may impact proposed redevelopment of the site were identified:

Recognized Environmental Conditions

A REC is defined as the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: (1) due to release to the environment; (2) under conditions indicative of a release to the environment; or (3) under conditions that pose a material threat of a future release to the environment. It is the opinion of the environmental professional that the following represent RECs:

Former On-Site Gasoline Filling Station

Based on the review of historic Sanborn Maps, a gasoline filling station was identified on the northeastern portion of the subject property (Block 4434, Lot 1) in 1950. Although not labeled as a gasoline filling station in the subsequent 1967 historic Sanborn Map, the one-story structure identified as a gasoline filling station in 1950 remained until 1986. No information was included in the EDR Radius Report or NYSDEC PBS online database to confirm the presence of registered USTs at this location. A limited geophysical survey was completed by Naeva Geophysics Inc. (Naeva) in the vicinity of the former gasoline filling station (Block 4434, Lot 1) in November 2017 and identified five subgrade anomalies using a combination of electromagnetic (EM) detection, and ground penetrating radar (GPR). One of the geophysical anomalies (identified as Anomaly 5 in the Naeva Geophysical Investigation Report) was detected at approximately 2- to 3-feet below grade surface (bgs), produced a hyperbolic GPR response indicative of a potential Underground Storage Tank (UST), and was the approximate size and shape of a potential 275-gallon UST. Three of the four other geophysical anomalies (identified as Anomalies 2 through 4 by Naeva) did not produce hyperbolic GPR responses, but were identified as potential USTs based on the location, size, shape, and detection depth of 2- to 3-foot bgs. Based on the historic site use of the northeast portion of the subject property as a gasoline filling station and detection of multiple geophysical anomalies in this vicinity that are consistent with potential USTs, it is in the opinion of the environmental professional that the potential exists for adverse impacts to the subject property from former site use as a gasoline filling stations or any associated undocumented USTs that may or may not have been previously removed.

It is recommended that a subsurface investigation be completed in the vicinity of the geophysical anomalies identified as potential USTs to identify any subsurface impacts associated with these potential USTs and historic use of this portion of the site as a gasoline filling station. If adverse impacts to the subsurface as the result of historical site operations are identified as the result of a subsurface investigation, the subject property may be a candidate for acceptance into the NYSDEC Brownfield Cleanup Program (BCP).

Former On-Site Automobile Junkyards

Based on the review of historic Sanborn Maps, automobile junkyards were identified on the entire northern portion of the subject property along Flatlands Avenue between Louisiana and Pennsylvania Avenues between 1967 and 1981. A Certificate of Occupancy for Block 4432, Lot 1 classified site operations as the sale and storage of used cars in 1959. Subsequent to 1981, automobile dismantling/junking operations were identified on the eastern portion of Block 4434, Lot 1 until 1987, on Block 4430, Lot 1 until 1996, and on the western portion of Block 4434, Lot 1 until 2001. As auto dismantling/junking operations on the subject property

were identified between 1959 and 2001, the potential exists for adverse environmental impacts to the subsurface due to the potential cumulative effect of unreported petroleum releases associated with these operations; therefore, historical automobile dismantling operations represents a REC.

Presence of Methane in the Subsurface

Based on observations made during the site inspection, interviews with the on-site facilities manager at the time of the site inspection, and a follow up telephone interview with the safety director assigned to the Christian Cultural Center, a methane venting/mitigations system is present on the subject property. According to information provided to Langan, the system consists of subgrade horizontal piping beneath the current site building which is vented through an exhaust blower mounted on the roof when unknown specified concentration triggers an alarm condition. Based on the 2003 Phase I ESA prepared by Soil Mechanics Environmental Services, an historical soil gas investigation conducted in the northeastern portion of the site in 1991 revealed the presence of methane and recommended that a methane mitigation system may be required for any future building construction. As the presence of methane has not been evaluated or investigated on the remainder of the subject property, the potential exists for methane to be present below the eastern and southern portions of the subject property which may require monitoring and/or mitigation associated with any future site development. The presence of methane in the subsurface of the subject property represents a REC.

Business Environmental Risks

A BER is defined as a risk which can have a material environmental or environmentally-driven impact on the business associated with the current or planned use of a parcel of commercial real estate, not necessarily limited to those environmental issues required to be investigated in this practice. Consideration of BER issues may involve addressing one or more non-scope considerations. It is the opinion of the environmental professional that the following represent business environmental risks:

Potential Presence of Historic Urban Fill

Based on the review of historical topographic maps, an approximately 120,200-square foot area in the southwest portion of the subject property was historically subject to periodic inundation. Based on the 2003 Phase I ESA prepared by Soil Mechanics Environmental Services, the subject property historically consisted of marshland and was filled in the early 1900's with ash and waste from the city's solid waste incinerator. Furthermore, the Phase I ESA documented subsurface investigations completed in 1991 and 1994 which revealed and 18- to 35-foot thick layer of historic fill and elevated concentrations of total petroleum hydrocarbons, volatile organic compounds, semi-volatile organic compounds, and metals. The presence of fill will require

implementation of soil handling and management procedures to address excavation, reuse, handling, and possible offsite disposal of this material if the site were to be redeveloped; therefore, the potential presence of historic fill is identified as a BER.

Langan recommends that, if possible, the minimal disturbance of this material (i.e., maintaining current grades or onsite reuse of this material) should be given serious consideration during site redevelopment planning due to the potential disposal issues, unanticipated costs, and potential construction delays associated with offsite disposal.

Potential Presence of Undocumented Underground Heating Oil Storage Tanks

While no evidence or records confirming use of fuel oil USTs was observed during the site inspection or noted during this ESA, small one-story structures were historically identified throughout the subject property associated with historic site use for auto junking/dismantling. Due to the presence of these structures and this historical use of the site, it is the opinion of the environmental professional that the potential presence of heating oil USTs beneath the lots or adjacent sidewalks associated with these former buildings represents a business environmental risk. Preparation and implementation of a contingency plan to address the presence of any USTs that may be encountered during site excavation activities would adequately address this issue.

Surrounding Sites

Potential impacts from current and historical operations conducted at adjacent and nearby properties involving auto wrecking/dismantling sites, auto repair, gasoline filling stations, dry cleaners, the use of USTs, spills, and the generation and disposal of hazardous waste represent a business environmental risk due to the potential for offsite migration of contaminants to impact sub-slab soil and/or groundwater below the subject site. This may impact any proposed dewatering operations as laboratory analytical results documenting discharge water quality are required for city sewer discharge permits.

1.0 INTRODUCTION

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) has completed a Phase I Environmental Site Assessment (ESA) of a ±10-acre site located at 12020 Flatlands Avenue, Brooklyn, Kings County, New York (Figure 1).

This ESA was conducted to identify current or potential environmental concerns and/or Recognized Environmental Conditions (RECs) resulting from past or current activities on the subject property, as well as to evaluate immediately surrounding environs with the potential to impact upon the property. The assessment consisted of a site reconnaissance of all accessible property areas, a review of State and Federal environmental databases as they concern the subject property and surrounding areas, contact with Federal, State and local agencies, a review of Sanborn Fire Insurance Maps of the subject property and surrounding areas, and a review of local/county records.

The ESA was conducted in a manner consistent with industry standard and practice and in accordance with the Standards of the American Society for Testing and Materials (ASTM) E1527-13 Standard Practice for Environmental Site Assessments. Any deviations from this practice are provided in Section 11.0 of this report.

2.0 RELIANCE/LIMITATIONS

This ESA report was prepared for GO UCL, LLC, for the Proposed Christian Cultural Center Development and for the objectives of due diligence. The report is intended to be used in its entirety. Excerpts taken from this report are not necessarily representative of the assessment findings. Langan cannot assume responsibility for use of this report for any property other than the subject property addressed herein, or by any third party without a written authorization from Langan.

Langan's scope of services, as described in the proposal dated 2 November 2017, revised 21 November 2017, was limited to that agreed to with GO UCL, LLC and no other services beyond those explicitly stated are implied. No exploratory borings, sampling of soil, soil vapor, or groundwater, or laboratory analysis were performed by Langan as part of the scope of services.

This Phase I ESA was not intended to be a definitive investigation of possible environmental impacts at the subject property. The purpose of this investigation was limited to determining if there is reason to suspect the possibility of Recognized Environmental Conditions (RECs) at the subject property. It should be understood that even the most comprehensive Phase I ESA may fail to detect environmental liabilities at a particular site. Therefore, Langan cannot "insure" or "certify" that the subject property is free of environmental impacts. No expressed or implied representation or warranty is included or intended in this report, except that our services were performed, within the limits prescribed by our client, with the customary thoroughness and competence of our profession. The user is cautioned that federal, state, and local laws may impose environmental obligations that are beyond the scope of ASTM Practice E 1527-13.

The conclusions, opinions and recommendations provided in this report are based solely on the following activities:

- Visual observations of the subject property and the immediate vicinity at the time of Langan's site visit;
- Review of relevant available historical information; and,
- Correspondence and/or discussion with personnel knowledgeable about the site.

The conclusions, opinions and recommendations are intended exclusively for the purpose stated herein, at the specified subject property, as it existed at the time of our site visit.

The User is responsible for the review and identification of environmental liens, activity, and use limitations, and for ascertaining reasons for significantly lower purchase property price in accordance with Section 6 of ASTM E 1527-13. A questionnaire covering these above-concerns was provided to GO UCL, LLC and is included as Appendix A. In addition, a similar questionnaire was provided to Mr. Elder Gerald Shaw Sr., the current site manager, and is included as Appendix B. If any of these above-concerns were uncovered during the course of the Phase I ESA, they are addressed in this report.

The report findings are based in part on information provided by local, county and state officials and environmental databases from Federal and State sources. Langan assumes no responsibility for the accuracy and completeness of this information.

Visual observations discussed in this report represent conditions at the time of the site inspection and may not be representative of the past or future site conditions.

As per ASTM E1527-13, Phase I ESA Report deviations, as well as professional opinions regarding these deviations, are listed in Section 11.0.

This ESA has been prepared for the sole use of GO UCL, LLC. This ESA should not be relied upon by other parties without the express consent of Langan and GO UCL, LLC. In accordance with Section 4.6 of ASTM E 1527-13 and 40 CFR §312.20, a Phase I ESA may be considered valid for one year starting from the commencement date of the assessment listed on the front cover of this report. The formal property acquisition/real estate transaction must take place during this period. However, the following components must be conducted or updated within 180 days (six months) prior to the date of the property acquisition/real estate transaction:

- Interviews with past and present owners, operators and occupants;
- Searches for recorded environmental cleanup liens;
- Review of governmental records;
- Site Reconnaissance of the property and adjoining properties; and,
- The declaration by the Environmental Professional.

3.0 SITE DESCRIPTION

The subject property is designated as Block 4430 Lot 1, Block 4431 Lots 1 and 200, Block 4432 Lot 1, and Block 4434 Lot 1 by the New York City Department of Finance (Figure 2); according to the property survey prepared by Leonard J. Strandberg and Associates dated 5 February 2009, the subject property also includes the de-mapped former Alabama Avenue roadway which is not currently designated with a Tax Block and Lot number by the New York City Department of Finance. The Christian Cultural Center building and on-grade accessory parking lot was reportedly constructed in 1997 currently occupies portions of Block 4430 Lot 1, Block 4431 Lots 1 and 200, Block 4432 Lot 1, and the de-mapped former Alabama Avenue roadway. Block 4434 Lot 1 consists of a large vacant and unpaved lot on the northeast portion of the site.

According to the 1950 historical Sanborn Map, historical address ranges associated with the subject property include:

- 365-395 Louisiana Avenue;
- 1140-1164 Pennsylvania Avenue; and,
- 20-24 Fairfield Avenue.

In 1967, Fairfield Avenue is converted to Flatlands Avenue and the addresses associated with the subject property include:

- 365-395 Louisiana Avenue;
- 12020-12120 Flatlands Avenue; and,
- 1140-1164 Pennsylvania Avenue.

According to information maintained online in the New York City Department of Buildings (NYC DOB) Building Information System (BIS) and New York City Department of City Planning (NYC DCP) databases, current address ranges associated with the subject property include 463-483 Louisiana Avenue, 1140 Pennsylvania Avenue, and 12020-12120 Flatlands Avenue.

The subject property is bound to the north by Flatlands Avenue (formerly Fairfield Avenue prior to 1967) followed by a storage facility, an automobile sales and storage yard, an automobile dismantling company and used automobile parts business, a medical offices, the Oasis Hotel, a car wash, and an automobile repair/gasoline filling station. The site is bound to the east by a twelve-story multi-family residential apartment building, and Pennsylvania Avenue followed by a vacant landscaped lot. Block 4434 Lot 1 is bound to the south by two twelve-story multi-family residential apartment buildings and the remaining lots on the western portion of the subject property are bound to the south by the 10-story New York City Housing Authority (NYCHA) Vandalia Houses residential complex. The site is bound to the west by Louisiana Avenue followed by a shopping mall that contains a Pathmark Supermarket, on-grade accessory parking and various one-story commercial stores and restaurants.

The subject property is currently zoned as a residential district (R5) according to the New York City Department of City Planning (NYCDCP) zoning map effective 7 September 2017.

4.0 GEOLOGIC AND HYDROGEOLOGIC CONDITIONS

For the purpose of report completeness and to better understand the subsurface conditions, the geologic conditions in the general area of the subject property are discussed in this section.

The "Surficial Geologic Map of New York" Lower Hudson Sheet by the New York State Museum State Geological Survey identifies that the surficial geology at the site consists of outwash sand and gravel which is generally a well-rounded and stratified layer of coarse to fine gravel with sand. According to the "Geologic Map of New York – Lower Hudson Sheet" by the University of the State of New York, geology at the site consists of silty clay, sand, and gravel.

Based on site/area topography, groundwater flow within the overburden material is anticipated to be to the southeast, towards the North Channel of Jamaica Bay.

5.0 USER PROVIDED INFORMATION

A questionnaire was completed by the User and is included in Appendix A. Information typically obtained from this questionnaire is discussed in the sections below. Documents provided by the User are discussed in this section.

5.1 Title Records

A Title Search was not provided by the User for this ESA. Langan completed a limited review of available online records maintained by the New York City Department of Finance to determine current and former site ownership. These records are discussed in Section 8.0.

5.2 Environmental Liens or Activity and Use Limitations

Reasonably ascertainable recorded land title records and lien records that are filed under federal, tribal, state, or local law should be reviewed to identify environmental liens or activity and use limitations, if any, that are currently recorded against the property. Any environmental liens or activity and use limitations are required to be reported to the Environmental Professional conducting the ESA per ASTM E1527-13.

No environmental liens or use limitations (engineering or institutional controls) were identified for the subject property in the EDR report or by the User. Information regarding the 'E'-designation status of the property can be found in Section 8 of this report.

5.3 Specialized Knowledge

Specialized knowledge is defined by ASTM E 1527-13 as *"any specialized knowledge or experience that is material to recognized environmental conditions in connection with the property*". For example, a User is involved in the same line of business as current or former occupants of the property or adjoining property and has specialized knowledge of the chemicals and processes used in this line of business.

The User did not provide specialized knowledge material related to recognized environmental conditions in connection with the property as part of this ESA.

5.4 Valuation Reduction for Environmental Issues

In a transaction involving the purchase of a parcel of commercial real estate, the User shall consider the relationship of the purchase price of the property to the fair market value of the property if the property was not affected by hazardous substances or petroleum products. The User should try to identify an explanation for a lower price which does not reasonably reflect fair market value if the property were not contaminated.

The User indicated that no valuation reduction for environmental issues occurred for the subject property.

5.5 Commonly Known Information

If the user is aware of any commonly known or reasonably ascertainable information within the local community about the property that is material to recognized environmental conditions in connection with the property, it is the User's responsibility to communicate such information. This information may include past uses of the property, specific chemicals that were used on site, spills or releases or environmental cleanups that have taken place.

No additional information regarding the environmental condition of the subject site was provided to Langan other than that discussed in Section 5.6, below.

5.6 Documentation Provided by the User

Limited Geophysical Investigation, November 2017 (Langan)

A limited geophysical investigation was completed on 29 November 2017 in the northeast portion of the subject property identified as a former gasoline filling station according to a review of historic Sanborn Maps. The geophysical investigation was completed by Naeva Geophysics, Inc. of Congers, New York (Naeva) over an approximately 14,700-square foot area in the northeast portion of Block 4434, Lot 1. The geophysical survey was completed using a combination of electromagnetic (EM) detection and ground penetrating radar (GPR). According to the Geophysical Investigation Results letter report prepared by Naeva, five significant buried anomalies were identified in the approximate footprint of the former gasoline filling station. The largest geophysical anomaly was detected at approximately 2- to 3-feet below grade surface (bgs) and was determined to most likely be related to buried foundations or concrete debris based on the size, location, and flat GPR response. Three geophysical anomalies were located adjacent to the northern and eastern property boundaries and were detected at approximately 2- to 3-feet bgs. Although these anomalies did not exhibit a hyperbolic GPR response consistent with potential buried USTs, based on the size, shape, and depths detected, it was determined that each anomaly may represent one or more potential USTs. The fifth anomaly was detected in the northwest portion of the former gasoline filling station at a depth of approximately 2- to 3-feet bgs and exhibited a hyperbolic GPR response consisted with a potential buried UST. Based on the size, shape, and hyperbolic GPR response detected, Naeva concluded that anomaly 5 is most likely a buried 275-gallon UST.

Phase I ESA, Soil Mechanics Environmental Services (April 2003)

GO UCL, LLC provided Langan with a Phase I ESA prepared for the site by Soil Mechanics Environmental Services (Soil Mechanics) and dated April 2003. The Phase I ESA included summaries of historical investigations that were completed for the subject property, although copies of reports were not attached.

According to the Phase I ESA, a Technical Memorandum for the Draft Environmental Impact Statement (DEIS) was prepared for the subject property in June 1991 by AKRF, Inc. as part of the New York City Environmental Quality Review (CEQR) process for the New York City Department of City Planning (NYCDCP) and New York City Department of Environmental Protection

(NYCDEP). The Technical Memorandum documented that the subject property originally consisted of marshlands and was filled in during the early 1900's with ash and waste from the city solid waste incinerator. A subsurface assessment was completed to establish baseline soil and groundwater quality conditions at the site.

A geophysical investigation revealed two anomalies near Flatlands Avenue and one near Vandalia Avenue; test pits completed to approximately 7-feet below ground surface in these areas identified the presence of automobile parts such as gasoline tanks and tire rims, and a crushed drum in one location.

A soil gas survey completed in the area of the former gasoline station revealed the presence of methane gas which was attributed to the former marsh deposits and presence of historic fill; no volatile organic compounds (VOCs) associated with gasoline were detected. Soil sampling activities revealed the presence of elevated concentrations of total petroleum hydrocarbons and metals throughout the site as well as elevated concentrations of semi-volatile organic compounds (SVOCs) in several surficial and subsurface soil samples.

Elevated concentrations of metals, VOCs, and SVOCs, were also detected in groundwater, which were attributed to the presence of historic fill that was identified as being impacted with the same compounds, which is in contact with groundwater.

Based on the results of the investigation, AKRF, Inc. recommended the implementation of a health and safety plan (HASP) during future construction activities and the construction of a soil capping system to prevent human exposure to remaining impacts in soil.

The Phase I ESA also included a summary of a Subsurface Investigation and Report prepared by SESI Consulting Engineers and dated March 1994. The investigation included the installation of eight soil borings to between 26- and 51.5-feet below ground surface. Miscellaneous fill was encountered in all locations at depths ranging from 18.5- to 35-feet below ground surface. The fill reportedly consisted of cinders and ash mixed with sand, silt, gravel, and clay and various debris such as concrete, wood, rubble, metal, brick, glass, and asphalt. Groundwater was encountered between 17- and 23-feet below ground surface.

Soil Mechanics' concluded that the recommendations for a HASP and soil capping system detailed by AKRF Inc. be strictly followed and noted that a methane mitigation system may be required as part of any future building construction. Soil Mechanics also recommended that future site activities be conducted under the oversight of NYCDEP or NYSDEC and that all USTs encountered during redevelopment be removed in accordance with all applicable laws. Finally, Soil Mechanics recommended the proper removal of all miscellaneous waste that was observed on the subject property including an abandoned crane, rubber tires, and demolition debris and noted that a groundwater investigation would be required to evaluate for potential impacts from upgradient properties of concern.

6.0 REVIEW OF PREVIOUS LAND USE

Historic Sanborn Fire Insurance Maps and City Directory Information were requested from Environmental Data Resources (EDR) of Shelton, Connecticut. Provided are descriptions of the materials provided by these resources.

6.1 Sanborn Fire Insurance Maps

Sanborn Fire Insurance Maps of the subject property and surrounding area dated 1908, 1928, 1950, 1967, 1969, 1977, 1979, 1980, 1981, 1983, 1986, 1987, 1989, 1991, 1992, 1993, 1994, 1995, 1996, 2001, 2002, 2003, 2004, 2005, 2006, and 2007 were obtained from Environmental Data Resources and reviewed as part of this ESA. Copies of Sanborn Maps are provided in Appendix C.

Subject Property

Historical Sanborn Fire Insurance Maps show the subject property as mostly vacant undeveloped lots in 1908; a one-story shed and one-story wagon house are located on the western portion of current Block 4434. The subject property is shown as being crossed from west to east by Malta Avenue, Alabama Avenue, Georgia Avenue, and Sheffield Avenue from north to south, and Flatlands Avenue is identified as Fairfield Avenue. The two one-story structures shown on Block 4434 in 1908 are shown on the 1928 Sanborn Map in a slightly different orientation and are labeled as vacant sheds. Additionally, a one-story shed and one-story residential building are shown at the western boundary of current Block 4431 and a one-story building of unspecified use is shown in the Malta Street roadway.

The five one-story buildings are no longer shown in 1950; a one-story filling station is shown on the northeastern corner of Block 4434 at the intersection of Pennsylvania Avenue and Fairfield Avenue (currently Flatlands Avenue) and a one-story storage building is shown with a frontage along Pennsylvania Avenue. The southeastern corner of the subject property south of the one-story storage building is a vacant lot labeled as a portion of Masons Materials. In 1967, the northern frontage of the subject property between Louisiana Avenue and Sheffield Avenue is labeled as auto junk and contains two one-story office buildings at 12058 Flatlands Avenue (Block 4432, Lot 1) and 12096 Flatlands Avenue (Block 4434, Lot 1). The northern frontage east of Sheffield Avenue is labeled as auto wrecking; the one-story building previously identified as a filling station on the northeast corner of the subject property is no longer labeled as a filling station. Conditions shown on the 1969 through 1981 Sanborn Maps are similar to those shown on the 1967 Sanborn Map and include the addition of a one-story building of unspecified use at 12048 Flatlands Avenue (Block 4431, Lot 1) shown in 1969, a one-story office at 12026 Flatlands Avenue (Block 4431, Lot 1) between 1977 and 1981, and a one-story building of unspecified use at 12120 Flatlands Avenue (Block 4434, Lot 1) in 1979. Fairfield Avenue is renamed to Flatlands Avenue in 1969 and the Avenues crossing the subject property are identified as not being open in 1977.

In 1983, current Lots 4431 and 4432 are vacant and no longer labeled as auto junk. In 1986, the former filling station building in the northeastern corner of the subject property and the one-story office building at 12096 Flatlands Avenue are no longer shown. The one-story storage building at the southeastern portion of the subject property is no longer shown in 1989. Conditions shown on the through 1996 Sanborn Maps are similar to those shown on the 1989 Sanborn Map. In 2001, the current two-story church building is shown on the northwestern portion of current Block 4434. The one-story unlabeled building formerly located at 12120 Flatlands Avenue is no longer shown and current Block 4430 in the northwestern portion of the site is no longer labeled as auto junk. No other changes are shown for the subject property through 2007.

Adjacent Properties

In 1908, the subject property is surrounding by predominantly vacant lots to the north and west and visible portions to the east and south; not all properties to the south and east are visible. One residential building with a basement is adjacent to the north of the subject property. Adjacent properties remain mostly vacant on the 1928 Sanborn Maps; a shed, a stable, and two ancillary buildings of unspecified use are shown north of the residential building and a shed and building of unspecified use are shown north of the subject property in the vicinity of Fairfield and Sheffield Avenues.

Structures shown on the 1928 Sanborn Map are not present in 1950. In 1950, the adjacent properties to the north of the subject property are developed with automobile related facilities including a filling station with three gasoline tanks shown (northeast corner at the intersection of Fairfield and Sheffield Avenues), two filling stations with no gasoline tanks shown (northwest corner at the intersection of Pennsylvania and Fairfield Avenues and northwest corner at the intersection of Alabama and Fairfield Avenues), and a used automobile parts facility (northwest corner at the intersection of Sheffield and Fairfield Avenues). A building is present at the northwest corner of the intersection of Malta and Fairfield Avenues; however, due to the extents of the map the building use is not visible. No buildings are shown in the visible portions of the adjacent properties to the east, south, or west.

Fairfield Avenue is renamed at Flatlands Avenue on the 1967 Sanborn Map. All developed adjacent properties to the north of the subject property are used for automobile related facilities; buildings shown on the 1950 Sanborn Map are still present; however, the gasoline tanks are no longer shown. An auto junking and repair facility is now shown between Alabama and Georgia Avenues and an auto junk yard and used auto sales facility is shown between Malta and Alabama Avenues. A building of unspecified use is shown on one of the visible properties adjacent to the east, a vacant lot labeled as mason's materials is shown adjacent to the south, and a commercial building and large building of unspecified use with a paint locker labeled are shown on the visible portion of the adjacent property to the west.

No changes are shown on adjacent properties to the north, south, or west in 1969. Visible adjacent properties to the east are vacant. No changes are shown on the 1977 through 1981 Sanborn Map with the exception that one of the

gasoline filling stations to the north is labeled as an auto junk yard and mason's materials are no longer labeled to the south in 1977 and another filling station to the north is labeled for automobile repairs in 1979 and unspecified commercial use in 1981. The adjacent property to the west is labeled as parking for a Pathmark shopping center in 1981.

In 1983, two residential towers are shown adjacent to the south of the subject property and a commercial building is shown adjacent to the west. No changes are shown on the 1986 Sanborn Map; however, the building adjacent to the north at the northwest corner of the intersection of Malta and Flatlands Avenue is labeled for auto repairs. In 1987 the used auto parts building at the intersection of Sheffield and Flatlands Avenues is no longer shown. In 1989, the property is developed with a four-story hotel. A car wash is shown in 1991 at the northeast corner of the intersection of Sheffield and Flatlands Avenues. No changes are shown until 2001 and 2002 when two more residential buildings are shown adjacent to the south. No other changes are shown through 2007.

Sanborn Map Review Conclusions

Based on the identification of a gasoline filling station on the northeast portion of the subject property in 1950 and auto dismantling companies and junk yards on the northern portion of the subject property along Flatlands Avenue between 1967 and 2001, it is in the opinion of the environmental professional that the historical site use may have adversely impacted the subject property and, therefore represents a REC.

Historical uses of concern were identified on adjacent properties to the north, including gasoline filling stations between 1950 and 2007 and multiple auto dismantling, auto repair, and used auto parts salvage/sales companies adjacent to the north of the subject property between 1950 and 2007. It is in the opinion of the environmental professional that the historical uses of adjacent properties to the north represent a business environmental risk.

6.2 City Directory Search

City directory information was obtained from EDR in an attempt to identify past uses of the subject property and establishments in the surrounding area. As provided in the City Directory Abstract (Appendix D), business directories including city, cross-reference and telephone directories were reviewed. City

directories records for the subject property and surrounding properties were available for the years 1965 through 2014 including 1965, 1970, 1976, 1985, 1992, 1997, 2010, and 2014.

The City Directory Abstract included listed for site addresses 12020 Flatlands Avenue and 12026 Flatlands Avenue. The address 12020 Flatlands Avenue included listings associated with the existing Christian Cultural Center from 2010 and 2014. The address 12026 Flatlands Avenue included listings for ISO Auto Wreckrs from 1960 through 1976. This listing corresponds to the property use (auto junk) identified for 12026 Flatlands Avenue on the Sanborn Maps from 1967 through 1981. Although the dates to not match those listed in the City Directory Abstract, an office building is shown on the Sanborn Maps located at 12026 Flatlands Avenue from 1977 through 1981.

Due to the size of the subject property, no adjacent properties were listed in the City Directory Abstract.

City Directory Review Conclusions

It is the opinion of the environmental professional that historical on site auto wrecking operations represents a REC.

7.0 REGULATORY DATABASE SEARCH

A database search report that identifies sites listed on state and federal databases within the ASTM-required radii was obtained for the property from Environmental Data Resources, Inc. (EDR) of Shelton, Connecticut. A copy of EDR's complete report is provided as Appendix E.

The report included the following databases specified by the ASTM Phase I protocol as well as non-ASTM databases (not listed):

RECOMMENDED/**REQUIRED** SEARCH DISTANCES
1.0-mile
Federal National Priority List (NPL)
Federal RCRA CORRACTS Facilities List
State- and Tribal-Equivalent NPL
0.5-mile
Federal Delisted NPL
Federal CERCLIS/SEMS**
Federal CERCLIS NFRAP List/SEMS-Archive**
Federal RCRA non-CORRACTS TSD Facilities List
State- and Tribal-Equivalent CERCLIS
State and Tribal Landfill and/or Solid Waste Disposal Site Lists
State and Tribal Leaking Underground Storage Tanks (LUSTs)
State and Tribal Voluntary Cleanup Sites
State and Tribal Brownfields Sites
Subject Property and Adjacent Properties Only
Federal RCRA Generators List
State and Tribal Registered Storage Tanks
Subject Property Only
Federal ERNS List
Federal Institutional Controls/Engineering Controls Registries
State and Tribal Institutional Controls/Engineering Controls Registries

* A description of these databases and a complete listing of sites identified on the above-referenced databases is provided in the EDR Report.

** As of March 2016, SEMS replaced the CERCLIS database and SEMS-Archive replaced the CERCLIS NFRAP database.

Subject Property

The subject property was identified in the EDR Gas Stations database as the ISO Auto Service gasoline filling station located at 12026 Flatlands Avenue which operated between 1969 and 1975. The subject property was not identified in any other of the databases according to the Radius Report.

Surrounding Properties

Database	No. of Sites within 1-mile	Adjacent sites (Y/N)	No. of Adjacent Sites
NPL	0	N	0

Database	No. of Sites within 1/2-mile	Adjacent sites (Y/N)	No. of Adjacent Sites
RCRA-TSDF	0	N	0

Database	No. of Sites within 1/8-mile	Adjacent sites (Y/N)	No. of Adjacent Sites
RCRA LQG	1	N	0
RCRA-CESQG	3	N	0
RCRA-NLR	11	Y	4
USTs	9	Y	4
ASTs	4	Y	2
NY SWF/LF	2	Y	2
RES DECL	1	Y	1
AIRS (AFS)	1	Y	1
MANIFEST	12	N	0
Dry Cleaners	2	N	0
EDR Dry Cleaners	3	N	0
EDR Gas Stations	5	Y	3

Database	No. of Sites within 1/8-mile	No. Cases Open/Closed	Open Upgradient Cases	No of Adjacent Sites
LTANKS	1	0 / 1	0	1
NY Spills	19	0 / 22	0	8

Based on the large number of database records identified within one mile of the subject property (153), Langan limited the review of surrounding properties to sites within 1/8-mile from the subject property. It is the environmental professional's opinion that based on the dense development of the site area, and former, current and proposed use of the site that the review of the database pertaining to this more limited area is appropriate.

Langan evaluated the following to determine whether additional environmental records with respect to these facilities, including the orphan sites, should be reviewed:

- Case status (i.e., whether a No Further Action letter has been issued or a case has been closed);
- Type of database and whether the presence of soil or ground water contamination is known;
- Distance of the site from the subject property; and,
- Whether the site is upgradient or downgradient of the subject property based on local topography and the anticipated southeastern groundwater flow direction. Although EDR defines properties north as topographically downgradient from the subject property and properties to the south as topographically upgradient from the subject property, it is assumed that the site is assumed that properties to the north of the subject property at hydraulically upgradient based on the inferred groundwater flow direction to the south.

Langan reviewed the information provided using the above criteria and the findings are discussed below.

Former Gasoline Stations

Two adjacent gasoline filling and/or service stations were identified to the north of the subject property across Flatlands Avenue and one gasoline filling/service station was identified across the Flatlands and Pennsylvania Avenue intersection from the subject property. Each of these sites was identified as a filling station on the Sanborn Maps as discussed above.

Flat Gas Inc., 120-99 Flatlands Avenue

Flat Gas Inc. located adjacent to the north and hydraulically upgradient from the subject property is identified in the NY AST and NY UST databases as an active petroleum bulk storage (PBS) facility. According to the Radius Report, the site is listed in the NY AST database for one 275-gallon AST containing motor oil, one 275-gallon AST containing transmission fluid, and one 275-gallon AST containing waste oil, all of which were installed in January 1991 and are currently in service. The site is identified in the NY UST database for a 1,000-gallon UST installed in January 1990 containing motor oil, a 2,500-gallon UST installed in February 1990 containing waste oil, and a 2,500-gallon UST installed in February 1990 containing motor oil. All three USTs identified at this site are currently in service.

No spills or releases were reported on this property and based on the review of historical Sanborn Maps, this site is identified as a filling station from 1950 to 1977, and auto repair facility from 1979 to 1980, and an auto wash between 1991 and 2007.

Flat Gas Inc. / Spartan Petroleum Inc. (Former Flat Gas), 1130 Pennsylvania Avenue
This site, located adjacent to the north and hydraulically upgradient from the subject property is identified in the NY Spills, RCRA NonGen/NLR, US AIRS, EDR Hist Auto, NY Manifest, and NY UST databases. According to the EDR Radius Report, this site is identified in the NY UST database as an active PBS facility for two 4,000-gallon gasoline USTs installed in December 1972 and reportedly closed-in-place in June 1993, for three 4,000-gallon gasoline USTs installed in December 1978 and removed in June 1993, and for five 4,000-gallon gasoline USTs installed in June 1993 that are currently in service. This site is identified in the EDR Hist Auto database as a gasoline service station between 1996 and 2014. The site is identified in the NY Spills database for a minor (less than one-gallon) gasoline release due to a leaky fuel pump flex hose on 21 January 2003 and assigned Spill No. 0210596 by the New York State Department of Environmental Conservation (NYSDEC). No further information was provided and NYSDEC administratively closed Spill No. 0210596 on 10 March 2003.

This site is identified in the RCRA NonGen/NLR database for forms received by the United States Environmental Protection Agency (USEPA) on 1 January 2007 classifying the site as a non-generator. Historical generator information reveals that the site was classified as a non-generator of hazardous wastes in 2006 and 1999 and that the site was classified as a Large Quantity Generator (LQG) in 1991 for the generation of undefined hazardous waste, ignitable waste, and waste impacted with hazardous concentrations of lead and benzene. No violations are reported for the site. The site is identified in the AIRS database, which classified this facility as a minor air emissions facility regulated under the USEPA Clean Air Act (CAA), and as a gasoline service station according to the Standard Industry Classification (SIC) Code reported for this facility. This site is identified in the NY Manifest database for the disposal of waste impacted with hazardous concentrations of lead in 2014 and ignitable waste in 1995 and 1998.

Only a portion of this site is visible on historical Sanborn Maps, but the visible area was labeled as a filling station between 1950 and 2007.

Penn & Flat Getty, Joe's Archer Thriftway Autorama, 1121 Pennsylvania Avenue
This site, located approximately 134-feet northeast and hydraulically cross-gradient from the subject property at 1121-1133 Pennsylvania Avenue (alternate address 12121-12133 Flatlands Avenue) is identified in the NY UST, EDR Hist Auto, RCRA NonGen/NLR, and NY Spills databases according to the EDR Radius Report. The site is identified as an active PBS facility for two 4,000-gallon gasoline USTs installed in January 1978 and removed in October 1996, for seven 550-gallon gasoline USTs installed in December 1969 and closed-removed in October 1996, for three 4,000-gallon gasoline USTs installed in April 1997 that are currently in-service, and for one 4,000-gallon gasoline/ethanol UST installed in April 1997 that is currently in-service. This site is listed in the EDR Hist Auto database as a gasoline service station between 1969 and 1974, as a general automotive repair shop between 1989 and 1992, and as a gasoline service station in 1995 and from 2001 to 2014.

This site is identified in the NYSDEC Spills database for the observation of petroleum impacts in soil during excavation for removal of seven 550-gallon and two 4,000-gallon gasoline USTs, reported to NYSDEC on 29 October 1996 and assigned Spill No. 9609479. The removal of the seven 550-gallon and two 4,000-gallon gasoline USTs in October 1996 are consistent with information provided in the NY UST database. According to the NYSDEC case narrative provided by EDR, all but one of twenty post-excavation soil endpoint samples collected revealed volatile organic compounds (VOCs) and semi-volatile organic compounds (SVOCs) below the NYSDEC Technical and Administrative Guidance Memorandum (TAGM) soil cleanup objectives (SCOs). An underground storage tank closure report that included disposal documentation for the petroleum contaminated soil surrounding the USTs was submitted and NYSDEC administratively closed Spill No. 9609479 on 20 March 2007. Additionally, this site is identified in the NY Spills database for the release of approximately 20-gallons of gasoline during unspecified equipment repair that was reported to NYSDEC on 24 January 1998 and assigned Spill No. 9711920. According to the NYSDEC case narrative provided by EDR, 15-gallons were recovered and the remaining 5-gallons were released into the sewer. The NYSDEC administratively closed Spill No. 9711920 on 23 April 1998.

This site is identified in the RCRA NonGen/NLR database for forms received by the USEPA on 1 January 2007 classifying the site as a non-generator of hazardous waste. Historical generator information identified the site as a non-generator of

hazardous waste in 1995, 2006, and 2007, and as a conditionally exempt small quantity generator (CESQG) of ignitable waste for forms received by the USEPA on 23 October 2003. No violations were reported for this facility.

This site was not included on historic Sanborn Maps; therefore, historic use of this site could not be confirmed based on a review of historical Sanborn Maps.

Hoffinger Industries, 960 Alabama Avenue, 966-988 Alabama Avenue

This site is located approximately 390-feet northwest and hydraulically upgradient from the subject property at 966-988 Alabama Avenue and is identified in the RCRA NonGen/NLR, NY Manifest, NY Spills, and NY UST databases. According to the Radius Report, this site is identified in the NY UST database as an unregulated/closed site for one 2,500-gallon no. 2 fuel oil UST installed in removed in 2015. According to the NYSDEC case narrative provided in the NY Spills record discussed below, the 5,000-gallon no. 2 fuel oil UST closed-in-place in February 1999 located at 960 Alabama Avenue is also associated with this site.

This site is identified in the NY Spills database for petroleum impacts in soil borings reported on 2 April 2015 and assigned Spill No. 1500053 by NYSDEC. According to the NYSDEC case narrative provided by EDR, an initial subsurface investigation was completed and identified petroleum impacts in soil borings. A subsequent investigation did not identify subsurface petroleum impacts in soil borings. A third investigation confirmed the presence of petroleum impacts in soil and NYSDEC was notified. Excavation was performed to remove the 2,500-gallon UST, which appeared to be improperly abandoned-in-place and was determined to be the source of petroleum impacts observed in investigative soil borings. A total of 30 55-gallon drums of oily sand were removed from the UST and an additional 16 55-gallon drums of petroleum impacted soil were removed from the excavation extents. Soil analytical results of four post-excavation soil endpoint samples did not exceed NYSDEC Commissioner's Policy CP-51 soil cleanup objectives. A UST closure report was prepared and NYSDEC administratively closed Spill No. 1500053 on 24 August 2015. No information was provided regarding investigation or removal of the 5,000-gallon No. 2 Fuel Oil UST associated with the site.

RCRA Large Quantity Generators (LQG)

The RCRA LQG database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kg of hazardous waste per month or over 1 kg of acutely hazardous waste per month.

According to EDR, there are no RCRA LQG sites located adjacent to the subject property.

RCRA Conditionally-Exempt Small Quantity Generators (CESQG)

The RCRA CESQG database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally-exempt small quantity generators (CESQGs) generate less than 100 kg and 1,000 kg of hazardous waste per month or less than 1 kg of acutely hazardous waste per month.

According to EDR, there are no CESQG sites located adjacent to the subject property.

RCRA Non-Generators (NonGen)

The RCRA NonGen database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). RCRA Non-Generators do not currently generate hazardous waste.

According to EDR, there are 11 RCRA NonGen sites within 1/8-mile of the subject property. The following RCRA NonGen sites are located adjacent to the subject property:

- NYC-HA Vandalia House, 47 Vandalia Avenue
- NYCHA – Penn Wortman, 17 Vandalia Avenue
- Pathmark 72634, 111-10 Flatlands Avenue
- Flat Gas Inc., 1130 Pennsylvania Avenue

The NYC-HA Vandalia House site is located adjacent to the south and hydraulically downgradient of the subject property at 47 Vandalia Avenue. The site is identified in the RCRA NonGen database for forms received by the USEPA on 1 January 2007

classifying the site as a non-generator of hazardous waste. Historical generator information for the site includes forms received by the USEPA on 1 January 2006 classifying the site as a non-generator and forms received by the USEPA on 12 August 1999 classifying the site as a small quantity generator (SQG) of ignitable waste. No violations are reported for this facility.

The NYCHA – Penn Wortman site is located adjacent to the south and hydraulically downgradient of the subject property at 17 Vandalia Avenue. The site is identified in the RCRA NonGen database for forms received by the USEPA on 1 January 2007 classifying the site as a non-generator of hazardous waste. Historical generator information included forms received by the USEPA on 1 January 2006 and 3 April 1998 classifying the site as a non-generator and for forms received by the USEPA on 27 February 1998 classifying the site as a SQG of an unreported type of hazardous waste. No violations are reported for this facility.

Pathmark Store #72634, located adjacent to the west and inferred to be hydraulically cross-gradient from the subject property at 111-10 Flatlands Avenue is identified in the RCRA NonGen database for forms received by the USEPA on 18 April 2017 classifying the site as a non-generator. Historical generator information for the site includes forms received by the USEPA on 13 October 2015 classifying the site as a SQG of reactive waste, ignitable waste, corrosive waste, waste impacted with hazardous concentrations of metals, and hazardous wastes associated with commercial pharmacies. No violations are reported for the facility.

Based on the lack of violations associated with these sites, it is in the opinion of the environmental professional that the potential for adverse environmental impacts to the subject property from these sites is low.

MANIFEST

The NY Manifest and NJ Manifest databases list and track hazardous waste from the generator through transporters to a TSD facility.

According to the EDR Radius Report, there are 13 Manifest sites within 1/8-mile of the subject property. The only Manifest site located adjacent to the subject property is Spartan Petroleum Inc./Former Flat Gas located adjacent to the subject property to the north at 1130 Pennsylvania Avenue, which is discussed in detail above.

NY UST

The Underground Storage Tank (UST) database contains USTs registered with the NYSDEC under the PBS division. These USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the NYSDEC PBS Database.

According to the Radius Report provided by EDR, there are nine NY UST sites located within 1/8-mile of the subject property. The following NY UST sites are located adjacent to the subject property:

- Vandalia Avenue (Penn Wortman), 17 Vandalia Avenue
- Flat Gas Inc., 120-99 Flatlands Avenue
- Flat Gas Inc, 1130 Pennsylvania Avenue

The Vandalia Avenue (Penn Wortman) site located adjacent to and hydraulically downgradient from the subject property to the south is identified in the NY UST database as an active PBS facility for one 15,000-gallon no. 2 fuel oil UST currently in service. This site is identified in the NY LTANKS and NY Spills databases as discussed in detail below.

The Flat Gas Inc. site, located at 120-99 Flatlands Avenue and the Flat Gas Inc. site located at 1130 Pennsylvania Avenue are discussed in detail above.

Although not located adjacent to the subject property, the following NY UST sites identified within 1/8-mile of the subject property are also identified in the NY SPILLS database:

- 980 Alabama Avenue (a.k.a. 966-988 Alabama Avenue), 966-988 Alabama Avenue
- Iron Shop South (a.k.a. Cozine Island Shop, NYCTA Cozine Avenue Iron Shop), 50 Cozine Avenue

Each of these spill cases was administratively closed between 2015 and 2004, respectively.

Due to the administratively closed status of NYSDEC Spill cases associated with these NY UST sites it is in the opinion of the environmental professional that the potential for adverse impacts to the subject property from these sites is low. However, it should be noted that the number and proximity of NY Spill cases

associated with gasoline filling stations may have a cumulative effect on regional groundwater and/or soil vapor quality.

NY AST

The Aboveground Storage Tank (AST) database contains NYSDEC registered ASTs. ASTs are regulated under Subtitle I of RCRA. The information for this database comes from the NYSDEC PBS Database.

According to the Radius Report provided by EDR, there are four NY AST sites located within 1/8-mile of the subject property. The following NY AST sites are located adjacent to the subject property:

- U.S.-1 Auto Sales & Repair, Inc., 12047 Flatlands Avenue
- Flat Gas Inc., 120-99 Flatlands Avenue

The U.S.-1 Auto Sales & Repair, Inc. site located adjacent to the north and hydraulically upgradient from the subject property at 12047 Flatlands Avenue is identified in the NY AST database for one 275-gallon waste oil AST that is currently in service. The address 12047 Flatlands Avenue was not identified in any of the databases searched by EDR; however, based on review of historic Sanborn Maps this site is likely collocated with the Flat Gas Inc. site, discussed below.

Flat Gas Inc., located adjacent to the north and hydraulically up gradient from the subject property at 12099 Flatlands Avenue is identified in the NY AST database for one 275-gallon motor oil AST, one 275-gallon waste oil AST, and one 275-gallon AST containing transmission fluid, all of which are currently in service. No releases were reported associated with these ASTs; however, the Flat Gas Inc. site is identified in multiple databases searched by EDR and is discussed separately in the beginning of this section.

Based on the administratively closed status of petroleum releases and/or observed petroleum impacts in soil associated with the Flat Gas Inc. site, it is in the opinion of the environmental professional that the potential for adverse impacts to the subject property from these sites is low. However, it should be noted that the number and proximity of NY Spill cases associated with gasoline filling stations may have a cumulative effect on regional groundwater and/or soil vapor quality.

New York State Solid Waste Facilities/Landfill Sites (NY SWF/LF)

The NY SWF/LF database contains records of solid waste disposal facilities or landfills in New York State.

According to the Radius Report provided by EDR, the following NY SWF/LF sites are located adjacent to the subject property:

- East New York Auto Sales Inc., 73 Flatlands Avenue
- Ultimate Used Auto Parts Inc., 120-49 Flatlands Avenue

East New York Auto Sales Inc. located adjacent to the north and hydraulically upgradient from the subject property at 73 Flatlands Avenue is identified in the NY SWF/LF database as an inactive vehicle dismantling facility.

Ultimate Used Auto Parts Inc., located adjacent to the north and hydraulically upgradient from the subject property at 120-49 Flatlands Avenue is identified in the NY SWF/LF database as an active vehicle dismantling facility. This site is identified as auto junking on historical Sanborn Maps.

Based on the lack of violations or releases reported for these facilities, it is in the opinion of the environmental professional that the potential for adverse impacts to the subject property from these sites is low. However, it should be noted that based on the close proximity of these sites to the subject property, historical auto junking and/or dismantling operations performed, and the potential for unreported releases associated with former site use may have a cumulative effect on regional groundwater and/or soil vapor quality.

New York City Restrictive Declaration (NY RES DECL)

The NY RES DECL database includes a list of sites that are currently bound to specified conditions on the future use and development of a property. Restrictive declarations are assigned to property lots by the New York City Planning Commission and are applicable to present and future property owners.

The only NY RES DECL site located adjacent to the subject property is New York City Tax Block 8235, Lot 48 located adjacent to the west of the subject property at 430 Louisiana Avenue. The site is assigned Restrictive Declaration No. D-47 as part of the Uniform Land Use Review Procedure (ULURP) No. M770445(A) ZMK. According to the zoning map amendment application prepared by the New York City

Department of City Planning (NYCDCP) dated 19 October 1979, the Restrictive Declaration D-47 included provisions to change the former residential (R5) land use to residential (R5) land use with a commercial (C2-2) overlay for construction of a supermarket, satellite stores, and a parking lot on the property.

As no environmental restrictions or conditions were included in the proposed rezoning, it is in the opinion of the environmental professional that the potential for adverse impacts to the subject property from this site is low.

EDR Hist Auto

EDR searched selected national collections of business directories and collected listings of potential gas station/filling station/service station sites. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

According to the Radius Report provided by EDR, there are six EDR Hist Auto sites located within 1/8-mile of the subject property. The following EDR Hist Auto sites are located adjacent to the subject property:

- Single Pine Service Center Inc., 121-09 Flatlands Avenue
- Flat Gas Inc., 1130 Pennsylvania Avenue

Each of these sites is discussed in detail above.

NY LTANKS

The NY LTANKS database contains an inventory of reported leaking storage tank incidents from April 1986 to the present. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents identified within this database are either tank test failures, tank failures or tank overfills.

According to the Radius Report provided by EDR, the only NY LTANKS site located within 1/8-mile of the subject property is Vandalia-NYCHA, located adjacent to the south and hydraulically downgradient of the subject property at 17 Vandalia Avenue. The site is identified in the NY LTANKS database for the release of approximately 15-gallons of no. 2 fuel oil as a result of a tank overfill that occurred on 23 January 1991 and was assigned NYSDEC Spill No. 9011231. According to the NYSDEC case narrative provided by EDR, fuel oil was released onto exposed soil from the vent pipe during a tank overfill. NYSDEC administratively closed Spill No. 9011231 on

6 July 1993 following a reported cleanup by NYCHA personnel. This site is also identified in the NY Spills database for releases of no. 2 fuel oil related to equipment failures as discussed below. The Vandalia-NYCHA site is also identified in the NY database.

Based on the closed regulatory status of the NY LTANKS spill record, the small volume of no. 2 fuel oil, and the downgradient location from the subject property, it is in the opinion of the environmental professional that the potential for adverse impacts to the subject property from this site is low.

NY Spills

The NY Spills database includes data collected on spills reported to NYSDEC. It includes spills active as of April 1, 1986, as well as spills occurring since this date.

According to the Radius Report provided by EDR, there are 19 NY Spills sites associated with 22 separate release incidents located within 1/8-mile of the subject property; each of the 22 NY Spills cases were administratively closed between 1987 and 2016. The following NY Spills sites are located adjacent to the subject property:

- 1121 Pennsylvania Avenue
- Flat Gas Inc., 1130 Pennsylvania Avenue
- 120-33 Flatlands Avenue
- Vandalia – NYCHA, 17 Vandalia Avenue
- Construction Site, 127-205 Flatlands Avenue
- Fresh Creek, Flatlands Avenue and Louisiana Avenue
- Fresh Creek Outpour, Flatlands Avenue and Louisiana Avenue
- Car Accident, Malta Street and Flatlands Avenue

The 1121 Pennsylvania Avenue and Flat Gas Inc. sites are discussed in detail above.

The 120-33 Flatlands Avenue site is identified as an automotive parts business located adjacent to the north and hydraulically upgradient from the subject property. According to the NYSDEC case narrative provided by EDR, waste oil was deliberately dumped onto the roadway on 24 September 1998 and reported on 4 October 1998, resulting in the assignment of Spill No. 9808202. No additional information was provided in the EDR Radius Report and NYSDEC administratively closed Spill No. 9808202 on 30 October 1998. The address associated with this spill

corresponds to the location of an auto junkyard and used automobile sales facility identified on the Sanborn Maps from 1967 through 2007.

Vandalia - NYCHA located adjacent to the south and hydraulically downgradient from the subject property at 17 Vandalia Avenue is identified in the NY Spills database due to equipment failure and assigned NYSDEC Spill No. 0211342 on 13 February 2003. According to the NYSDEC case narrative provided by EDR, approximately 20-gallons of no. 2 fuel oil was spill into a concrete-lined pit. NYSDEC administratively closed the spill on 13 March 2003 following a reported cleanup. A second spill was reported for the site as the result of equipment failure on 23 January 2003 and assigned NYSDEC Spill No. 0210638. According to the case narrative provided by EDR, 12-inches of Fuel Oil (approximately 120-gallons) was observed in a concrete lined basement sump pit in the boiler room. NYCDEP was notified of the potential and a NYCHA vacuum truck was on-site for cleanup activities. The NYSDEC administratively closed Spill No. 0210638 on 4 November 2005. A third spill was reported for the site on 16 January 2004 and assigned NYSDEC Spill No. 0311656 as the result of equipment failure. According to the NYSDEC case narrative provided by EDR, approximately 60-gallons of no. 2 fuel oil was released due to a boiler malfunction. The spill was administratively closed by NYSDEC on 13 January 2006 following receipt of a NYCHA Spill Report and cleanup documentation. This site is also identified in the NY UST and NY LTANKS databases as discussed in detail above.

The Construction Site located adjacent to the north and hydraulically upgradient from the subject property at 127-205 Flatlands Avenue is identified in the NY Spills database for the release of approximately 5 gallons of hydraulic oil due to human error on 6 January 2004 and assigned Spill No. 0311317 by NYSDEC. According to the NYSDEC case narrative provided by EDR, the affected soil was containerized in an unspecified number of 55-gallon drums and no further action was required. Spill No. 0311317 was administratively closed by NYSDEC on 14 January 2004.

The Fresh Creek and Fresh Creek Outpour sites are located adjacent to the northwest and hydraulically cross-gradient of the subject property at the intersection of Flatlands Avenue and Louisiana Avenue. In both cases, an unknown type of petroleum was observed floating on top of surface water; NYSDEC assigned Spill No. 0005213 on 1 August 2000 and Spill No. 0705343 on 9 August 2007. Both cases were administratively closed by NYSDEC in 2003 and 2007, respectively, without additional investigation required by NYSDEC or NYCDEP.

Approximately 40-gallons of diesel was released to the NYCDEP municipal sewer due to a car accident at the intersection of Malta Street and Flatlands Avenue, located adjacent to the north and hydraulically upgradient from the subject property, on 4 June 2007. NYSDEC assigned Spill No. 0702669 as the NY Fire Department and NYCDEP responded to the scene for emergency response and cleanup. NYSDEC administratively closed Spill No. 0702669 on 11 June 2007.

Due to the cleanup activities completed and the closed regulatory status of the spill cases, it is the opinion of the environmental professional that the potential for adverse impacts to the subject property from these sites is low. It should be noted that 22 spill reports were identified within 1/8-mile of the subject property which have the potential for adverse impacts to regional groundwater and/or soil vapor quality.

Drycleaners

The Drycleaners database is a list of registered drycleaning facilities.

According to the Radius Report provided by EDR, the following NY Drycleaners sites located within 1/8-mile of the subject property:

- 1110 Pennsylvania Cleaners, 1110 Pennsylvania Avenue
- Kent Cleaners, 111-18 Flatlands Avenue

The 1110 Pennsylvania Cleaners site, located approximately 345-feet to the north-northwest and hydraulically upgradient of the subject property at 1110 Pennsylvania Avenue is identified in the NY Drycleaners database with an installation date in 1994 and is reportedly shut down. The 1110 Pennsylvania Avenue address is identified in the RCRA CESQG database in 2006 and 2007 and as a SQG in 1994 and NY Manifest database in 2007 as Professional Cleaners Inc., for the generation and disposal of spent halogenated solvents commonly used in drycleaning operations. No violations are reported for this facility. Professional Cleaners Inc. is also identified in the EDR Hist Cleaner database as a drycleaning plant, except rugs, between 1996 and 2011.

The Kent Cleaners site, located approximately 496-feet west-southwest and hydraulically crossgradient from the subject property at 111-18 Flatlands Avenue is identified in the NY Drycleaners database with an installation date in 1998. It is not identified if this facility is shutdown or currently operational. This site is also

identified in the RCRA CESQG database in 1998, 2006, and 2007 and NY Manifest database in 2016 for the generation and disposal of waste impacted with hazardous concentrations of chromium, lead, tetrachloroethylene, tricholoroethylene and an undefined type of hazardous waste. No violations are reported for this facility. This site is also identified in the EDR Hist Cleaner database as a garment pressing and cleaners' agents facility between 1986 and 2011.

Based on the distance of the active drycleaning operations from the subject property, it is the opinion of the environmental professional that the potential for adverse impacts to the subject property from these sites is low. However, it should be noted that any unreported releases associated with these facilities may contribute to an adverse impact on regional groundwater and/or soil vapor quality.

EDR Hist Cleaner

EDR searched selected national collections of business directories and collected listings of potential dry cleaner sites. The review was limited to those categories of sources that might include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

According to the Radius Report provided by EDR, there are three EDR Hist Cleaners sites located within 1/8-mile of the subject property. The following listings were identified as sites with potentially active drycleaning operations:

- Professional Cleaner, 1110 Pennsylvania Avenue
- Kent Cleaner, 11118 Flatlands Avenue

Each of these sites is discussed in detail above.

Government Databases Review Conclusions

Based on Langan's review of the sites identified above, environmental impacts to the subject property from the above identified sites are not anticipated. Specific sites of concern that may have contributed to a cumulative impact on regional groundwater and/or soil vapor quality are discussed in detail at the beginning of this section and include Flat Gas Inc., Flat Gas Inc./Spartan Petroleum Inc. (Former Flat Gas), Penn & Flat Getty/Joe's Archer Thriftway Autorama, and Hoffinger Industries. However, it should be noted that 153 sites were identified in the radius report and

the potential exists that these urban sites may have a cumulative impact on regional groundwater quality. It is the opinion of the environmental profession that this represents a business environmental risk.

Additionally, the potential for vapor intrusion impacts to the subject property from onsite or nearby sources was evaluated. No specific potential vapor intrusion concerns (pVICs) were identified as part of this Phase I ESA; however, it should be noted that due to the number of spill sites, gasoline stations, and historical uses associated with automobile junking identified in the area of the subject property, the potential for groundwater impacts in the site area, vapor intrusion issues at the site may exist.

8.0 GOVERNMENT AGENCY RECORDS REVIEW

Federal, state and local agencies were contacted via written correspondence, telephone interviews and/or personnel interviews regarding records of environmental concerns, violations, and/or permits, or any other potentially environmentally-relevant records on the subject property. In additional, government information that was readily available online on government websites was also reviewed. A listing of agencies/individuals contacted by Langan as part of this ESA is provided in Table 1. Copies of government correspondence are provided in Appendix F.

US Environmental Protection Agency (USEPA)

The USEPA online FOIL request form was submitted for the subject property. In a letter dated 17 January 2018, Langan received a response from the USEPA indicating that all records are publically available on the online database (https://www.epa.gov/enviro/frs-query-page). Upon review of the USEPA database, no records are available for the subject property. If any additional pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum.

Langan also reviewed the RCRAInfo Search, Enforcement and Compliance History Online, and the Superfund Enterprise Management System (SEMS) databases maintained online by USEPA. No records were identified for the subject property.

US Fish and Wildlife Service (US FWS)

Information regarding critical habitats or endangered species with the vicinity of the subject property was obtained from the US FWS Information Service Information for Planning and Conservation online database (http://ecos.fws.gov/ipac/wizard/

chooseLocation!prepare.action;jsessionid=8E0AF61206046AE7AC0F01D38BC87E45). Two threatened bird species, the Piping Plover and Red Knot, as well as one endangered bird species, the Roseate Tern, were identified in the vicinity of the subject property. The threatened flowering plant species Seabeach Amaranth is also identified in the vicinity of the subject property. No critical habitats are defined for the four species identified by the US FWS IPaC database and no critical habitats were identified within the extents of the subject property.

In a letter from the US FWS Long Island Ecological Services Field Office dated 15 January 2018, the findings of the US FWS IPaC online database review were confirmed.

New York State Department of Environmental Conservation Region 2

A file review request was submitted to the NYSDEC online record request database on 15 January 2018. In an email dated 15 January 2018, Langan received a response acknowledging receipt of the request. To date, no further response has been received by Langan regarding this request. If any additional pertinent information is provided subsequent to issuance of this report, it will be provided as an addendum. Langan also reviewed the Environmental Site Database records maintained online by the NYSDEC. No spills, storage tanks, or remediation sites were identified for the subject property.

NYSDEC Division of Fish, Wildlife, & Marine Resources

Langan reviewed records maintained online on the NYSDEC Environmental Resource Mapper (http://www.dec.ny.gov/gis/erm/) which revealed that no significant natural communities or rare plants and animals are found in the vicinity of the subject property. An online file review request was submitted to the NYSDEC Division of Fish, Wildlife, & Marine Resources. In a letter dated 19 January 2018, the NYSDEC Division of Fish, Wildlife, & Marine Resources identified no records of rare or state-listed animals or plants, or significant natural communities at the project site or in its immediate vicinity. If any additional pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum.

New York State Department of Health (NYSDOH)

The NYSDOH Records Access Officer was contacted by Langan and a written file review request was submitted for the subject property. In a letter dated 18 January 2018, Langan received acknowledgement from the NYSDOH of the records request. To date, no further response has been received by Langan regarding this request. If any additional

pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum

New York City Department of Environmental Protection (NYCDEP)

The NYCDEP online FOIL request form was submitted for the subject property. In an electronic response dated 15 January 2018, Langan received acknowledgement from the NYCDEP of the records request. In a letter dated 8 February 2018, Langan received a response from the NYCDEP Division of Emergency Response and Technical Assessment (DERTA) stating that no records were identified related to this request. If any additional pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum.

According to records maintained online by the NYCDEP Clean Air Tracking System (CATS), one expired application for a boiler fired by natural gas and one expired application for a boiler fired by no. 2 fuel oil are documented for the property. These expired boiler applications are associated with the address 100 Flatlands Avenue, which is historically associated with Block 4434, Lot 1.

New York City Department of Health & Mental Hygiene (NYC DOHMH)

Ms. Rene Bryant, the NYC DOHMH Records Access Officer, was contacted by Langan and a written file review request was submitted for the subject property. To date, no response has been received by Langan regarding this request. If any additional pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum.

New York City Department of City Planning (NYC DCP)

An electronic version (effective zoning date 7 September 2017) of the NYC Zoning Map for the subject property was downloaded from the NYC DCP website (http://www.nyc.gov/html/dcp/html/zone/zh_zmaptable.shtml).

New York City Mayor's Office of Environmental Coordination (NYC MOEC)

Records maintained online by NYC MOEC through the CEQR Access Portal (https://a002-ceqraccess.nyc.gov/ceqr/) were reviewed on 15 January 2018. The subject property was not identified as being a part of the CEQR program.

'E'-Designation Status

The New York City Department of City Planning coordinated a program identifying properties for special environmental concerns based on documented historical use,

neighborhood noise concerns, and neighborhood air quality issues. These properties are identified on 'E'-designated sites on zoning maps and in the NYC Department of Buildings (NYCDOB) Building Information System (BIS) database. The NYCDOB is restricted from issuing building permits for the property until the NYC Mayor's Office of Environmental Remediation (NYC OER) has reviewed information prepared by an environmental professional and made a determination to issue of "Notice-of-No-Objection" or a "Notice-to-Proceed" to the NYCDOB. Prior to the NYCOER's creation in 2008, the NYC Department of Environmental Protection (NYCDEP) conducted these reviews.

- Appendix C: CEQR Environmental Designations List dated 19 December 2017 (http://www.nyc.gov/html/dcp/pdf/zone/appendixc_tab1.pdf),
- Appendix C: CEQR Restrictive Declaration List dated 17 October 2017 (http://www.nyc.gov/html/dcp/pdf/zone/appendixc_tab2.pdf),
- NYCOER Environmental Project Information Center (EPIC) (https://a002-epic.nyc.gov/app/search/erdproperty) on 30 January 2018, and,
- NYCDOB BIS on 15 January 2018 (http://a810-bisweb.nyc.gov/ bisweb/ bispi00.jsp).

The subject property was not listed as an E'-designated site based on these resources.

Fire Department of New York City (FDNY)

Information regarding the presence of petroleum or chemical storage tanks was requested from the FDNY. To date, no response has been received to our written request to the New York City Fire Department. If any pertinent information is provided subsequent to issuance of this report that will change the conclusions of this report, it will be provided as an addendum.

New York City Department of Buildings (NYC DOB)

Langan completed a limited review of available online records maintained by the NYC DOB. Certificates of Occupancy records were available Block 4431, Lot 1 and Block 4432, Lot 1. The Certificate of Occupancy for Block 4431, Lot 1 indicated that the property was not developed with structures in 1952 or 1954 and was used as an auto wrecking yard. The next available Certificate of Occupancy for Block 4431 Lot 1, effective date of 2 October 2001, identified a one-story church with mechanical, utility, and accessory rooms, and a parking lot at street level. A 1959 Certificate of Occupancy for Block 4432, Lot 1 permitted site use for sales and storage of used cars.

Certificates of Occupancy records were not available for Block 4434 Lot 1, or for Block 4430 Lot 1. No information was available for Block 4431, Lot 200.

Based on the review of Certificates of Occupancy maintained by the NYCDOB for the subject property, no potential RECs were identified.

New York City Department of Finance (NYC DOF)

A review of online records maintained by the NYC DOF was conducted as part of this ESA to determine current and former site ownership (http://www.nyc.gov/html/dof/html/home/home.shtml). Ownership history was available from 1916 to present.

According to the DOF, the subject property is currently owned by Christian Cultural Center Inc. It is in the opinion of the environmental professional that ownership information maintained by the NYC DOF provides no additional information regarding environmental conditions related to past usage different than represented by review of other historical information sources.

9.0 SITE RECONNAISSANCE

Langan conducted an inspection of the site on 9 February 2018. The inspection included a walk-through inspection of the entire site for the purposes of identifying Recognized Environmental Conditions (RECs). Typical RECs may include:

Drum storage	Dumpsters	Aboveground storage tanks	Stained areas
Drains and Sumps	Wells	Underground storage tanks	Pump stations
Waste piles	Landfills	Loading and transfer areas	Boiler rooms
Pits, Ponds, Lagoons	Swales	Process air vents	Process sinks
Storm sewers	Trenches	Detention ponds	PCBs
Impoundments	Lagoons	Floor drains and piping	Transformers
Septic systems	Dry wells	Waste treatment areas	Capacitors
Rail spurs	Incinerators	Compressor discharges	Odors
Pools of liquid	Wastewater	Stressed vegetation	Surface waters

Limiting conditions encountered during the inspection of the site included the following:

- The hydraulic piston below each elevator could not be inspected for potential leakage;
- High ceilings throughout the site building were not accessible for inspection; and,

- Inspection of a methane venting system could not be completed (with the exception of the roof-mounted exhaust blower), as the majority of the system is below the current site building.

Photographs of the subject property taken during the site inspection are provided in Appendix G. Langan was accompanied by Mr. Elder Gerald Shaw, Sr. who provided access to onsite buildings and answered questions during the site inspection. Mr. Shaw has been the on-site facilities manager for approximately 18 years. A questionnaire was completed by the property site manager and is included as Appendix B. The inspection included a walk-through inspection of the entire site for the purposes of identifying Recognized Environmental Conditions (RECs) as detailed below.

Block 4430 Lot 1, Block 4431 Lots 1 and 200, and Block 4432 Lot 1

The Christian Cultural Center two-story site building is located on the eastern portion of Block 4431 Lot 1, the de-mapped Alabama Avenue roadway, and the western portion of Block 4432 Lot 1. An asphalt-paved parking area, landscaped monuments and two gazebo outdoor seating areas are located in the northwest and southwest corners of the subject property. Each outdoor gazebo contains a water feature that utilized recirculating water in a closed system. The southwest corner of the subject property along Louisiana Avenue is approximately three- to four-feet above street level, enclosed with a concrete retaining wall, indicative of prior filling activities to raise the surface grade in this area, as confirmed by a review of historical topographic maps.

Approximately twelve separate stormwater drainage grates were observed in the asphalt paved parking area surrounding the Christian Cultural Center building. Upon inspection, connective piping was observed exiting the drainage grates. Mr. Shaw identified that the stormwater drainage structures were interconnected, and did not discharge to the municipal sewer system, based on his observations when the parking lot and site building were initially constructed between 1996 and 1997.

The two-story Christian Cultural Center site building is one- to two-stories and contains a large sanctuary/auditorium used for regular church services, two smaller sanctuaries used for private services, a kitchen and café, a day care center, two hydraulic elevators, and church offices. The ground floor contained a mechanical room where natural gas, water, and sewer entered the southwestern side of the building. Staining was not observed surrounding or below grease traps beneath kitchen sinks, or in the vicinity of two above-grade hydraulic tanks connected to the two elevators. The two hydraulic tanks were mounted on top of finish floor and contained automatic leveling pumps

submerged within each tank. A regular service and maintenance record was kept with each hydraulic oil tank. According to Mr. Shaw, a hydraulic piston is present in the bottom of each elevator pit, but could not be inspected due to access constraints.

The roof contains five separate HVAC units, solar panels, and an eight-inch-diameter steel pipe connected to an exhaust blower. According to Mr. Shaw, this structure is connected to a methane venting system that consists of horizontal piping installed below the site building. As there is no basement or sub-grade access within the site building, the presence of sub-grade horizontal piping could not be verified; the roof-mounted blower was not operating at the time of the site inspection. Mr. Christopher Brustego, the safety director assigned to the Christian Cultural Center, was contacted by telephone on 12 February 2018. Mr. Brustego confirmed the presence of a methane mitigation system at the subject property. The system is reportedly linked to the building security system and activates when alarm conditions are met. The type of monitoring equipment, alarm levels, or system maintenance intervals were not specified and no additional installation reports, as-built drawings, operation, or discharge permits were provided for review.

Block 4434, Lot 1

The northeastern portion of the subject property consists of a vacant lot used for additional parking and storage. According to Mr. Shaw, the parking lot surface is compacted recycled concrete aggregate (RCA). One trash compactor, one 30-cubic-yard dumpster, and four metal storage trailers were identified at the southwest corner of Block 4434, Lot 1. The storage trailers contained household lighting, decorations, wardrobe clothing, and audio equipment used for special events at the Christian Cultural Center.

Adjacent Properties

A visual inspection of adjoining properties from the subject property line, public rights-of-way or other vantage point (e.g. aerial photography) including a visual inspection where hazardous substances may be or may have been stored, treated, handled or disposed was also conducted.

Limiting conditions encountered during the inspection of adjoining properties were encountered due to the dense urban nature of the surrounding areas which only allowed for limited line of sight that did not extend to areas where hazardous materials or substances might be stored.

Properties located adjacent to the subject property consist of commercial and residential buildings. Fill and vent pipes associated with underground or aboveground storage tanks were not observed; however, an active gasoline filling station was observed adjacent to the north of the subject property, northwest of the intersection of Flatlands and Pennsylvania Avenues. Adjoining properties to the north of the subject property included a self-storage building, an automobile sales lot, an automobile dismantling/junkyard business for used automoible parts sales, medical offices, a hotel, a car wash and automobile repair business, and the aforementioned gasoline station. Additionally, an active gasoline filling station is located northeast of the intersection of Flatlands and Pennsylvania Avenues, but is not adjacent to the subject property. One groundwater monitoring well was observed in the Pennsylvania Avenue sidewalk east of Block 4434 Lot 1, and one groundwater monitoring well was observed in the Flatlands Avenue sidewalk north of Block 4434, Lot 1.

A vacant lot and residential apartment buildings adjoin the subject property to the east across Pennsylvania Avenue, two residential apartment buildings are adjacent to the south of Block 4434, Lot 1, two residential apartment buildings are adjacent to the south of Blocks 4430, 4431, and 4432, and a commercial shopping center with attached parking on street level is adjacent to the west across Louisiana Avenue.

10.0 ADDITIONAL ISSUES

The following items fall outside the scope of ASTM 1527-13, however Langan can and often does provide these services to its clients if specifically requested and included in the proposed scope of work or are issues that may impact current or proposed site use.

10.1 Wetlands/Floodplain Designation

A wetland and floodplain designation assessment was not conducted as part of this ESA.

Langan reviewed the United States Fish and Wildlife National Wetland Inventory (NWI) and New York State Freshwater Wetlands maps. Based on these documents no mapped wetlands are listed on the subject property.

10.2 Protected Endangered Species / Critical Habitats

A determination regarding the potential presence of protected or endangered species and critical habitats on or near the subject property was not conducted

as part of this ESA. This determination is often required in order to receive state or federal grants, loans, and/or permits.

The presence of endangered species and critical habitats on the subject property was evaluated and information requests were submitted the NYSDEC Division of Fish and Wildlife Natural Heritage Program and the US FWS as discussed in section 8.0 above.

10.3 Asbestos

In 1973, use of sprayed on fireproofing on structural building components was prohibited by the EPA. On July 12, 1989, EPA issued a final rule banning most friable asbestos-containing products. The following specific asbestos-containing products remain banned: flooring felt, roll board, and corrugated, commercial, or specialty paper. In addition, the regulation continues to ban the use of asbestos in products that have not historically contained asbestos, otherwise referred to as "new uses" of asbestos. Use of asbestos in textured paint and in patching compounds used on wall and ceiling joints was banned in 1977. An asbestos survey of the existing building was not conducted as part of this ESA; however, based on the review of Sanborn Maps, the existing building was constructed circa 2001. As such, the presence of asbestos-containing building materials is not anticipated.

10.4 Lead-based Paint

In 1977, the Consumer Product Safety Commission (CPSC) banned the use of lead based paint (LBP) in housing and restricted maximum levels in lead in new residential paint to less than 0.05% by weight. Based on the age of the onsite building, there is a potential that LBP is present in the onsite building. Interior painted surfaces generally appeared to be in good condition, with little paint peeling and cracking. A lead-based paint inspection was not conducted as part of this ESA; however, based on the review of Sanborn Maps, the existing building was constructed circa 2001. As such, the presence of lead based paint is not anticipated.

10.5 Lead in Drinking Water

A lead in drinking water survey of the existing building was not conducted as part of this ESA.

10.6 Indoor Air / Microbial Assessment (Mold)

A mold survey of the existing building was not conducted as part of this ESA.

10.7 Radon

The subject property is located in a Tier 3 Zone as identified by USEPA based on sampling conducted of buildings within the site area. The Tier 3 Zone is considered an area of low radon gas intrusion potential with typically concentrations less than 2 pCi/liter. A radon survey of the existing building was not conducted as part of this ESA. Radon test results from adjacent or surrounding properties are not necessarily indicative of radon conditions on the subject property. As no building specific radon survey documentation was provided to Langan, no opinion regarding potential risks associated with radon gas exposure can be made.

As per USEPA guidelines, the only way to assess potential radon gas exposure risks is to conduct a radon assessment. In addition, the US EPA recommends that follow-up tests on large buildings should be conducted when major modifications are made either to the building structure or HVAC system or the HVAC system's operation settings.

10.8 Historical and Archaeological Review

Langan reviewed the NYCityMap (http://maps.nyc.gov/doitt/nycitymap/) to review the potential presence of historical landmark buildings near the subject property. No designated historic districts, designated scenic landmarks, landmarked structures, or landmarked interior structures were identified.

In addition, Langan reviewed the NYSHPO online database (http://nysparks.com/shpo/online-tools/). As of 6 February 2018, no National Register Listed or State Register Listed sites were identified on or adjacent to the subject property. In addition, Langan reviewed the New York City Landmarks Preservation Commission (NYCLPC) online historic maps (https://nyclpc.maps.arcgis.com/apps/webappviewer/index.html?id=93a88691cace4067828b1eede432022b). As of 6 February 2018, no Historic Districts or Landmarks were identified on the subject property.

10.9 Universal Waste

A universal waste survey was not completed as part of this Phase I ESA.

11.0 DEVIATIONS

This Phase I ESA conforms with ASTM with the following deviations noted:

- Property use was only determined back to 1908, not to first development, as historical property records were not reasonably available;
- Data gaps in excess of 5 years were encountered during the review of historic resources;
- Government agencies that have not responded to record review inquiries are listed above - additional pertinent information provided to Langan subsequent to the issuance of this report will be provided in an addendum;
- Limited access was provided to the existing buildings as part of this ESA access as identified in Section 9.0;
- Based on the large number of database records identified within one mile of the subject property (153), Langan limited the review of surrounding properties to sites within 1/8-mile from the subject property; and,
- Interviews of former business operators were not conducted.

It is the opinion of the reviewing Environmental Professional that the above-deficiencies will not detrimentally affect the identification of potential recognized environmental conditions. This opinion is based on the following factors:

- Based on the Sanborn Maps and the City Directory information reviewed, the use of the property is consistent between the 5 year data gaps. Therefore, operations on the site between these data gaps will not detrimentally affect the identification potential RECs.
- Langan limited the database review to sites within 1/8-mile from the subject property. It is the environmental professional's opinion that based on the dense development of the site area, and former, current and proposed use of the site that the review of the database pertaining to this more limited area (1/8-mile) is appropriate and will not detrimentally affect the identification of potential recognized environmental conditions.

12.0 FINDINGS/OPINIONS

Based on information obtained during the visual inspection of the subject property, review of environmental databases and historic information, and contact with federal/state/local official agencies, the following recognized environmental conditions (RECs) and business environmental risks that may impact proposed redevelopment of the site were identified:

1. Former On-Site Gasoline Filling Station;
2. Former On-Site Automobile Junkyards;
3. Presence of Methane in Subsurface;
4. Potential presence of historic fill material;
5. Potential Presence of Undocumented Underground Heating Oil Storage Tanks; and,
6. Potential impacts from current and historical operations conducted at adjacent and nearby properties.

Based on the review of historic Sanborn Maps, a gasoline filling station was historically located on the northeastern portion of the subject property 1950. A limited geophysical survey completed at this location identified five subsurface anomalies, four of which may be potential USTs based on the size, shape, and depth of the anomalies. Therefore, Finding 1 represents a REC. Based on the review of historical Sanborn Maps and NYC DOB Certificates of Occupancy, automobile junkyards and/or auto dismantling operations were identified on the northern portion of the subject property along Flatlands Avenue from 1967 2001. Therefore, Finding 2 represents a REC. An exhaust blower connected to eight-inch steel piping was observed on the roof during the site inspection and determined to be the outlet of a methane venting/mitigation system installed below the site building based on interviews with on-site personnel. Methane may be present in the subsurface on the remainder of the subject property; therefore, Finding 3 represents a REC.

Based on the review of historical topographic maps, an approximately 120,000-square foot area in the southwest portion of the subject property was historically subject to periodic inundation. Although elevations changes are not shown on the topographic maps, it is assumed that this area was historically filled in with material of unknown origin to raise the surface grade and prevent flooding. Finding 4 represents a BER. It is in the opinion of the environmental professional that undocumented heating oil USTs may be present beneath the lots or adjacent sidewalks associated with small structures

shown on historical Sanborn Maps and associated with former auto junkyard/dismantling operations on the subject property. Therefore, Finding 5 represents a BER.

Auto junkyards/dismantling facilities, auto repair shops, and gasoline filling stations located adjacent to the north of the subject property between 1950 and 2007were identified on historical Sanborn Maps and in the Radius Report. Finding 6 represents a BER.

13.0 CONCLUSIONS

Langan has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of a ±10-acre site located at 12020 Flatlands Avenue, Brooklyn, Kings County in New York, the subject property. Any exceptions to, or deletions from, this practice are described in Section 11.0 of this report.

Based on information obtained during the visual inspection of the subject property, review of environmental databases and historic information, and contact with federal/state/local official agencies, this assessment has revealed the following recognized environmental conditions (RECs) in connection with the property:

Recognized Environmental Conditions

It is the opinion of the environmental professional that the following represent RECs:

Former On-Site Gasoline Filling Station

Based on the review of historical Sanborn Maps, a gasoline filling station was identified on the northeastern portion of the subject property (Block 4434, Lot 1) in 1950. Although not labeled as a gasoline filling station in the subsequent 1967 historic Sanborn Map, the one-story structure identified as a gasoline filling station in 1950 remained until 1986. No information was included in the EDR Radius Report or NYSDEC PBS online database to confirm the presence of registered USTs at this location. A limited geophysical survey was completed in the vicinity of the former gasoline filling station in November 2017 and identified five subgrade Two of the geophysical anomalies were identified along the north property boundary and detected at approximately 2- to 3-feet bgs with a relatively flat GPR response; however, based on the size and shape of these anomalies the possibility that these anomalies are USTs could not be ruled out. One geophysical anomaly was investigated with inconclusive

GPR results, but was of sufficient size and shape to potentially contain one or more USTs. Another anomaly, located to the west of the former gasoline filling station building, was detected at approximately 2- to 3-feet bgs and exhibited a hyperbolic GPR reflection typically associated with buried USTs; additionally, the size and shape was consistent with a potential 275-gallon UST. As historical operations as a gasoline filling station and potential USTs were historically located on the subject property, the potential exists for adverse environmental impacts to the subsurface due to use and storage of gasoline associated with these operations; therefore, former site operations as a gasoline filling station represents a REC.

Former On-Site Automobile Junkyards

Based on the review of historical Sanborn Maps, automobile junkyards were identified on the entire northern portion of the subject property along Flatlands Avenue between Louisiana and Pennsylvania Avenues from 1967 through 1981. A Certificate of Occupancy for Block 4432, Lot 1 classified site operations as the sale and storage of used cars in 1959. Although no longer identified on the entire northern portion of the subject property, automobile dismantling/junking operations were identified on the eastern portion of Block 4434, Lot 1 until 1987, on Block 4430, Lot 1 until 1996, and on the western portion of Block 4434, Lot 1 until 2001. As auto dismantling/junking operations on the subject property were identified between 1959 and 2001, the potential exists for adverse environmental impacts to the subsurface due to the potential cumulative effect of unreported petroleum releases associated with these operations; therefore, historical automobile dismantling operations represents a REC.

Presence of Methane in the Subsurface

Based on observations made during the site inspection, interviews with the on-site facilities manager at the time of the site inspection, and a follow up telephone interview with the safety director assigned to the Christian Cultural Center, a methane venting/mitigations system is present on the subject property. According to information provided to Langan, the system consists of subgrade horizontal piping beneath the current site building which is vented through an exhaust blower mounted on the roof when unknown specified concentration triggers an alarm condition. Based on the 2003 Phase I ESA prepared by Soil Mechanics Environmental Services, an historical soil gas investigation conducted in the northeastern portion of the site in 1991 revealed the presence of methane and recommended that methane mitigation system may be required for any future building construction. As the presence of methane has not been evaluated or investigated on the remainder of the subject property, the potential exists for methane to be present below the eastern and southern portions of the subject

property which may require monitoring and/or mitigation associated with any future site development. The presence of methane in the subsurface of the subject property represents a REC.

14.0 QUALIFICATIONS / CERTIFICATION

The following professionals assisted in the completion of this report.

We, the undersigned, declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in §312.10 of 40 CFR 312 and we have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property as documented in Appendix H. We have developed and performed all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Site Inspection and Report Written By:

Matthew Oleske
Senior Staff Engineer

Report Reviewed By:

Amanda Forsburg, CHMM
Project Scientist

Steven A. Ciambruschini, P.G., L.E.P.
Principal / Vice President

TABLES

TABLE 1
TABLE OF CONTACTS

Federal

United States Environmental Protection Agency
Region 2 (NJ, NY, PR, VI)
https://foiaonline.regulations.gov/foia/action/public/home

United States Fish and Wildlife Service
https://ecos.fws.gov/ipac/gettingStarted/map

State

New York State Department of Environmental Conservation – Region II
http://www.dec.ny.gov/public/103696.html

Records Access Office
New York State Department of Health
Corning Tower, Room 2364
Albany, New York 12237-0044
foil@health.ny.gov

The New York Natural Heritage Program
http://www.dec.ny.gov/gis/erm/
http://nynhp.org/ProjectScreening

City


New York City Mayor's Office of Environmental Coordination
http://www.nyc.gov/html/oec/html/ceqr/ceqr_access.shtml

New York City Department of Environmental Protection
http://www.nyc.gov/html/dep/html/contact_us/foil.shtml

Ms. Renee Bryant, Records Access Officer
New York City Department of Health and Mental Hygiene
Gotham Center
42-09 28th Street, 14th Floor, CN31
Long Island City, NY 11101
recordsaccess@health.nyc.gov

Ms. Leslie Ifill
Fire Department of New York City
FDNY Bureau of Legal Affairs
Public Records Unit
9 MetroTech Center, 4th Floor
Brooklyn, NY 11201

FIGURES

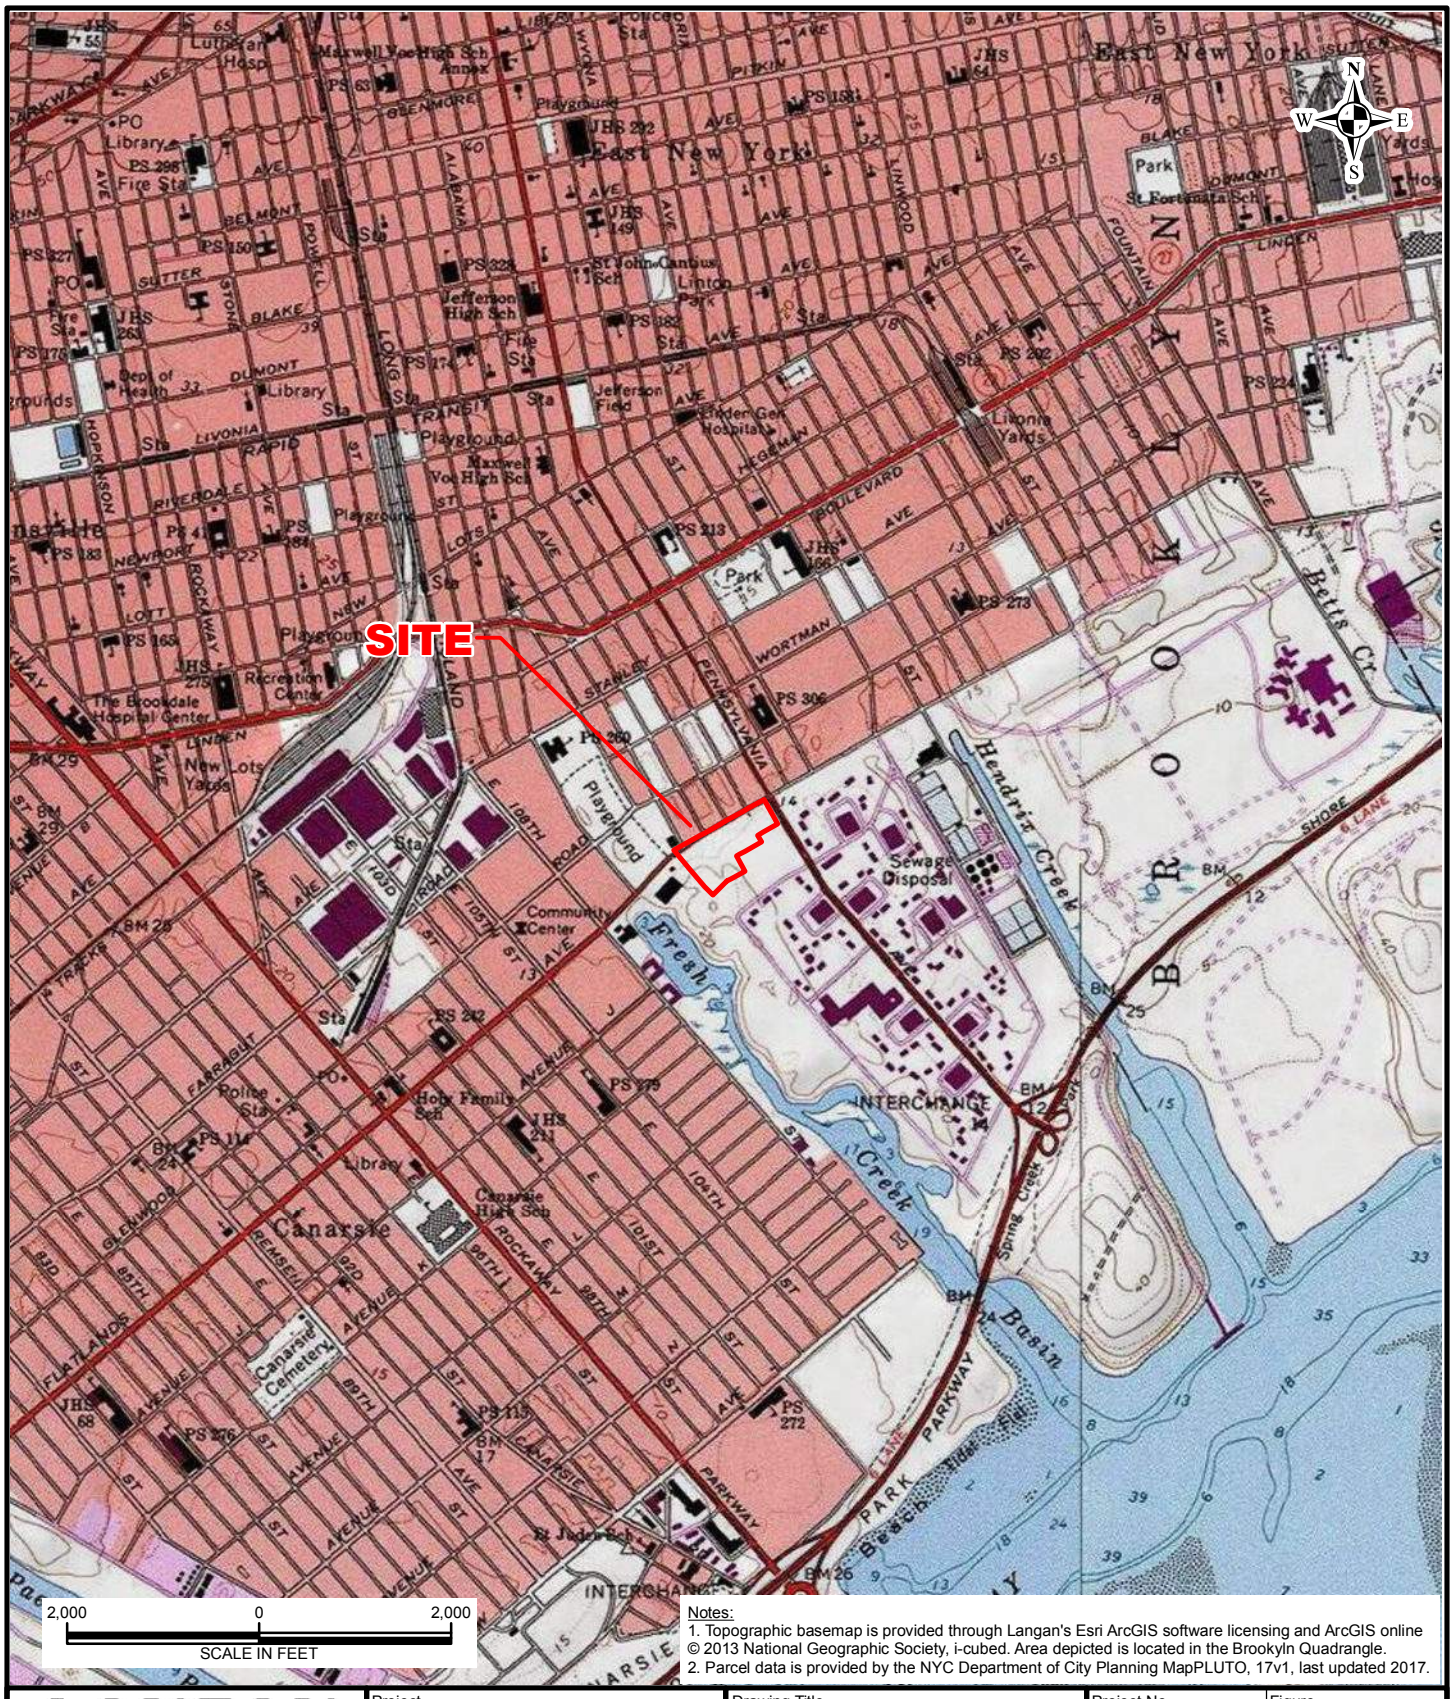

Notes:
1. Topographic basemap is provided through Langan's Esri ArcGIS software licensing and ArcGIS online © 2013 National Geographic Society, i-cubed. Area depicted is located in the Brookyln Quadrangle.
2. Parcel data is provided by the NYC Department of City Planning MapPLUTO, 17v1, last updated 2017.

LANGAN
300 Kimball Drive
Parsippany, NJ 07054
T: 973.560.4900 F: 973.560.4901 www.langan.com

Langan Engineering & Environmental Services, Inc.
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
Langan International LLC
Collectively known as Langan

NJ CERTIFICATE OF AUTHORIZATION No. 24GA27996400

Project

12020 FLATLANDS AVENUE
BLOCK No. 4430, LOT No. 1
BLOCK No. 4431, LOT No. 1, 200
BLOCK No. 4432, LOT No. 1
BLOCK No. 4434, LOT No. 1

BROOKLYN


KINGS COUNTY NEW YORK

Drawing Title

SITE
LOCATION MAP

Project No.	100688801
Date	2/7/2018
Scale	1 " = 2,000 '
Drawn By	AB
Last Revised	01/15/2018
Figure	1

© 2018 Langan

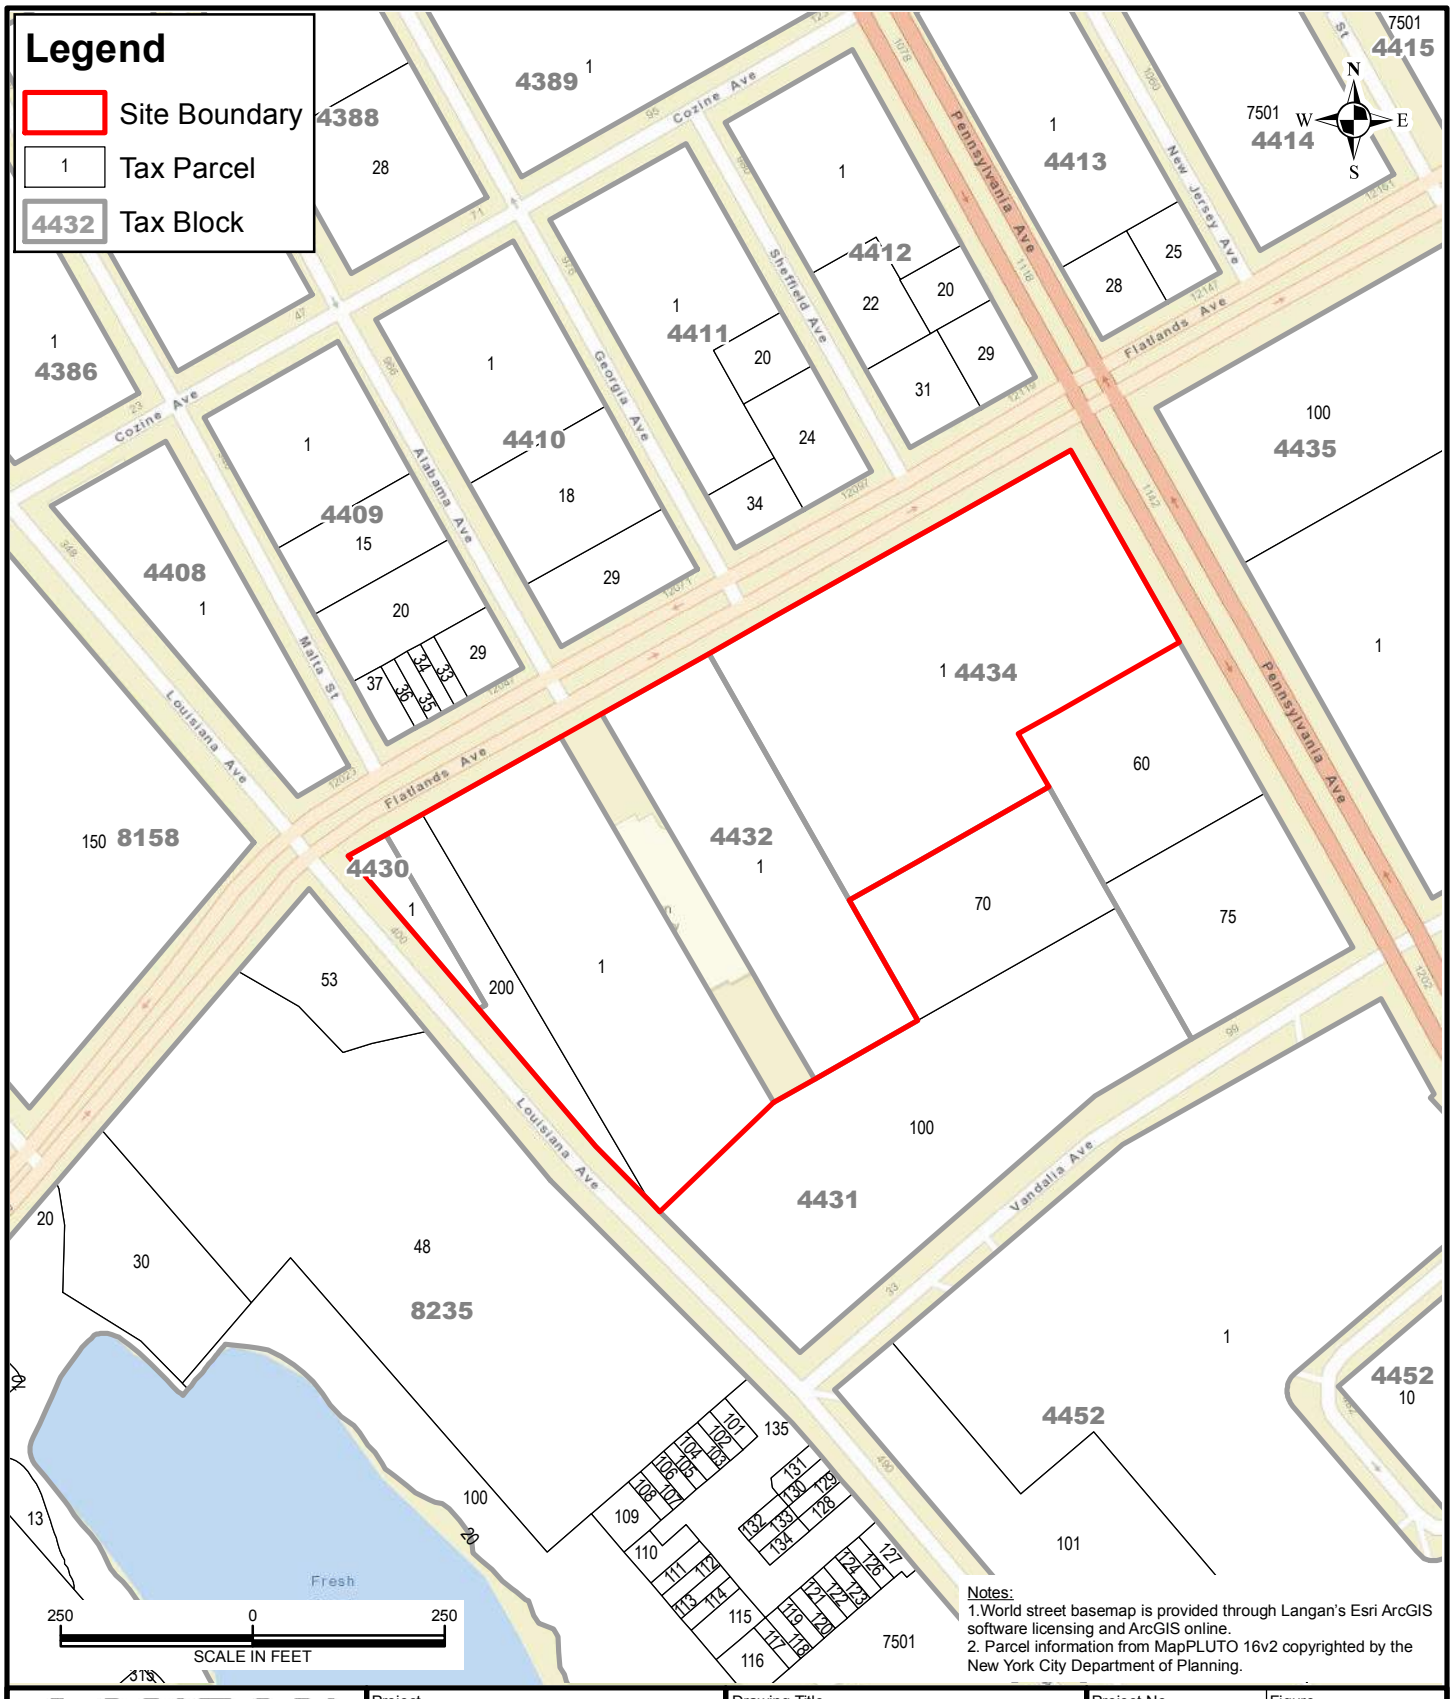

LANGAN
300 Kimball Drive
Parsippany, NJ 07054
T: 973.560.4900 F: 973.560.4901 www.langan.com

Langan Engineering & Environmental Services, Inc.
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
Langan International LLC
Collectively known as Langan

NJ CERTIFICATE OF AUTHORIZATION No. 24GA27996400

Project

12020 FLATLANDS AVENUE
BLOCK No. 4430, LOT No. 1
BLOCK No. 4431, LOT No. 1, 200
BLOCK No. 4432, LOT No. 1
BLOCK No. 4434, LOT No. 1

BROOKLYN

KINGS COUNTY NEW YORK


Drawing Title

TAX MAP

Project No.	100688801
Date	2/7/2018
Scale	1 " = 250 '
Drawn By	ATR
Last Revised	2/7/2018
Figure	2

© 2018 Langan

Path: \\langan.com\data\PAR\data8\100688801\Project Data\ArcGIS\MXD\Environmental_Figures\2018-01 - FOIL\Tax Map.mxd Date: 2/7/2018 User: aruane Time: 4:38:12 PM

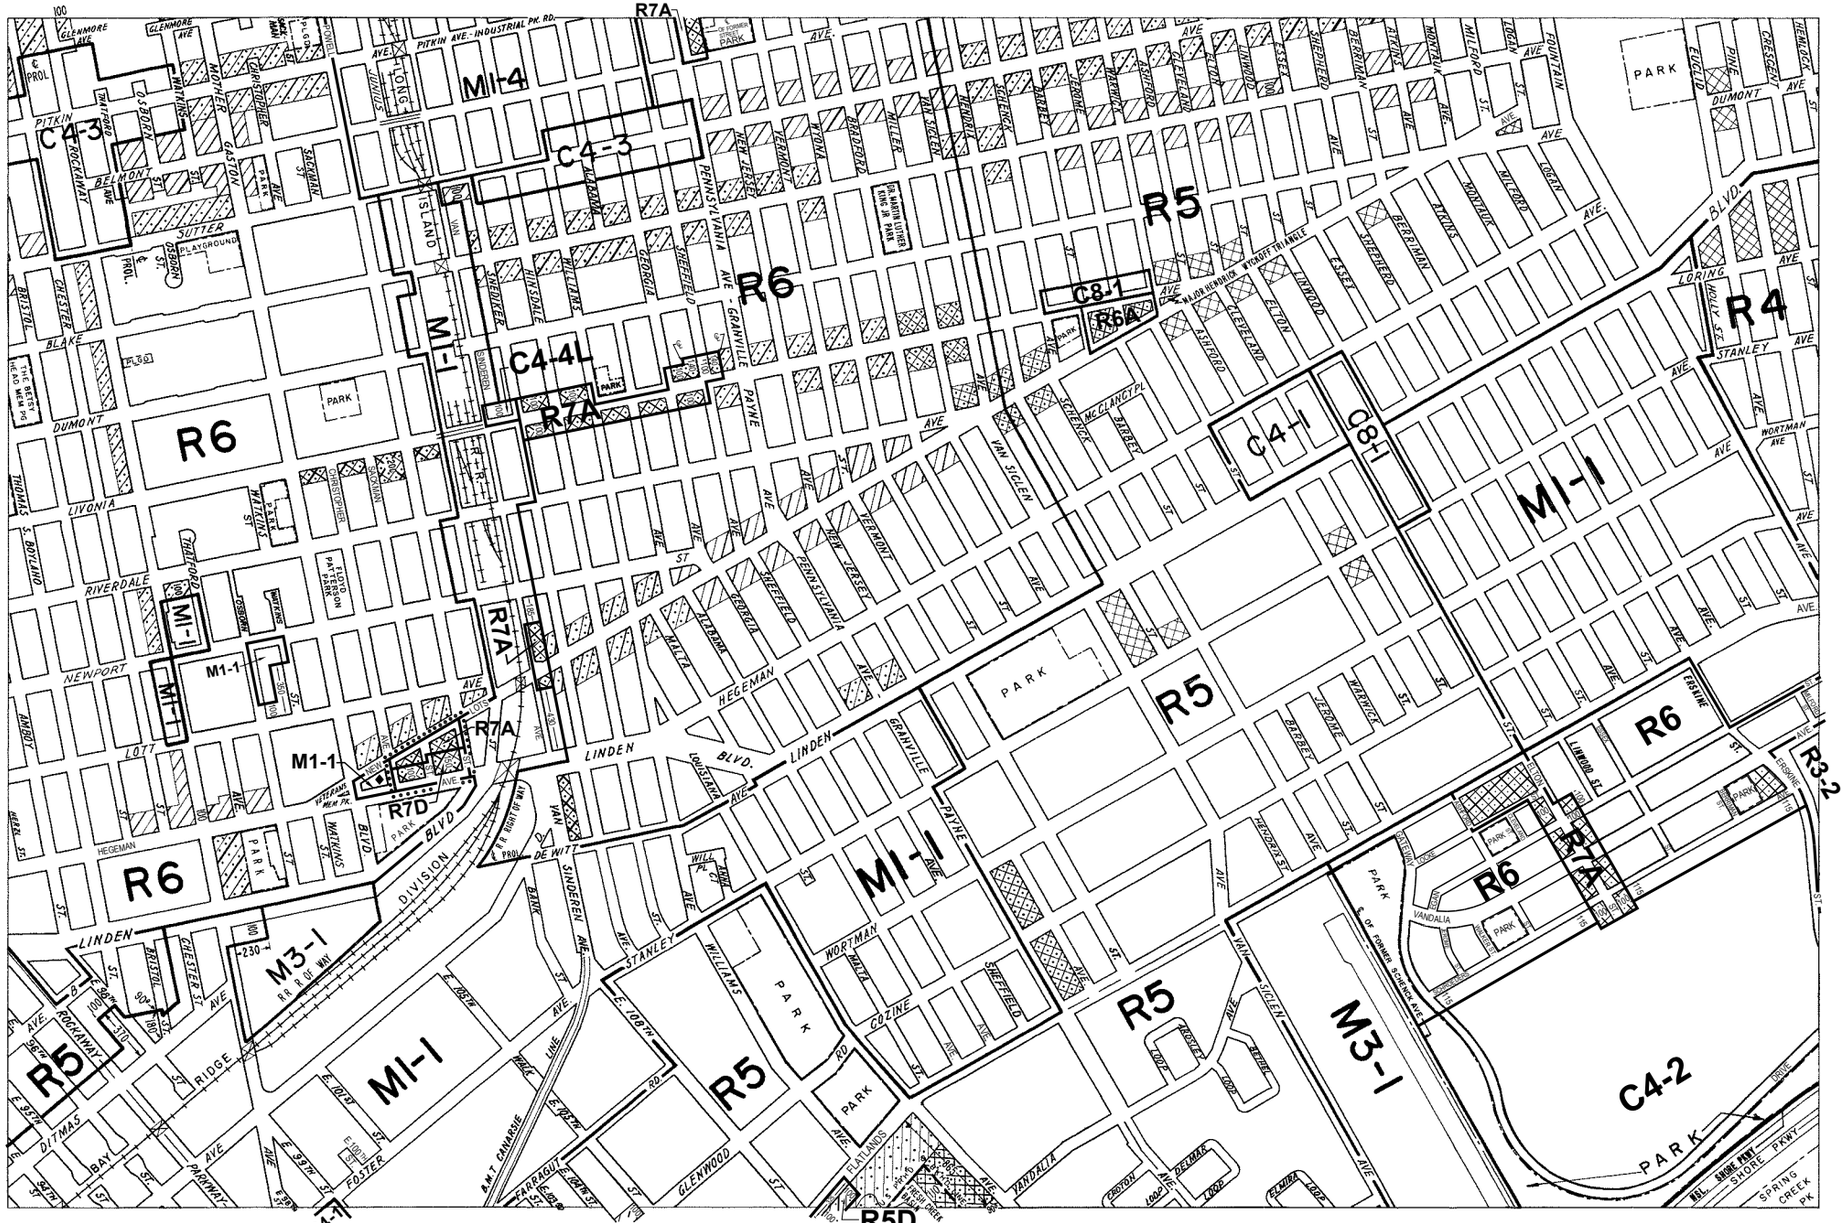

NOTE: Where no dimensions for zoning district boundaries appear on the zoning maps, such dimensions are determined in Article VII, Chapter 6 (Location of District Boundaries) of the Zoning Resolution.

ZONING MAP

THE NEW YORK CITY PLANNING COMMISSION

Major Zoning Classifications:

The number(s) and/or letter(s) that follows an R, C or M District designation indicates use, bulk and other controls as described in the text of the Zoning Resolution.

R – RESIDENTIAL DISTRICT

C – COMMERCIAL DISTRICT

M – MANUFACTURING DISTRICT

SPECIAL PURPOSE DISTRICT
The letter(s) within the shaded area designates the special purpose district as described in the text of the Zoning Resolution.

AREA(S) REZONED

Effective Date(s) of Rezoning:

09–07–2017 C 170189 ZMK

Special Requirements:

For a list of lots subject to CEQR environmental requirements, see APPENDIX C.

For a list of lots subject to "D" restrictive declarations, see APPENDIX D.

For Inclusionary Housing designated areas and Mandatory Inclusionary Housing areas on this map, see APPENDIX F.

◆ AS CORRECTED 11–02–2017

N

MAP KEY

17a	17c	18a
17b	**17d**	18b
23a	23c	24a

© Copyrighted by the City of New York

ZONING MAP **17d**

NOTE: Zoning information as shown on this map is subject to change. For the most up-to-date zoning information for this map, visit the Zoning section of the Department of City Planning website: **www.nyc.gov/planning** or contact the Zoning Information Desk at (212) 720-3291.

APPENDIX A

USER QUESTIONNAIRE

LANGAN

ASTM PRACTICE E 1527-13: USER/CLIENT QUESTIONNAIRE

Please complete the below form and return to
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.

Providing the following information (if available) to the environmental professional (Langan) is one of the requirements to qualify for one of the *Landowner Liability Protections* offered under CERCLA. Missing or incomplete information could result in a determination that "all appropriate inquiry" is not complete.

General Information

User/Client Name (s): GO UCL LLC

Property Name: Christian Cultural Center

Address: 1020 Flatlands Avenue
Brooklyn, NY 11207

Property Type: Existing community facility + parking at grade

Type of Property Transaction:

- [x] Purchase of property
- [ ] Financing of property
- [ ] Sale of property
- [ ] Ground Lease
- [ ] Build to Suit Lease
- Other JV development w/owner

Reason Why Phase I ESA is required: Diligence

Site Contact (s): Stephen Strateman, Gotham ORG
SStrateman@gothamorg.com 212-716-2585

Required Information

The citation at the end of each item (e.g. 40 CFR 312.XX) is the section of EPA's November 1, 2005 AAI Final Rule which discusses that item.

(1.) Environmental cleanup liens that are filed or recorded against the site (40 CFR 312.25).
Did a search of recorded land title records (or judicial records where appropriate) identify any environmental liens filed or recorded against the property under federal, tribal, state or local law?

Yes ☐ No ☑

(2.) Activity and Land Use (AUL) limitations that are in place on the site or that have been filed or recorded in a registry (40 CFR 312.26).
Did a search of recorded land title records (or judicial records where appropriate) identify any AULs, such as engineering controls, land use restrictions or institutional controls that are in place at the property and/or have been filed or recorded against the property under federal, tribal, state or local law?

Yes ☐ No ☑

LANGAN

	Yes	No
(3.) Specialized knowledge or experience of the person seeking to qualify for LLP (40 CFR 312.28). Do you have any specialized knowledge or experience related to the property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?	☐	☑
(4.) Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29).	Yes	No
(a.) Does the purchase price being paid for this property reasonably reflect the fair market value of the property? [If no, proceed to Parts 4a and 4b.]	☑	☐
(b.) If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property?	☐	☐
(c.) Identify an explanation for the lower price and provide a written record of such explanation as an attachment.		
(5.) Commonly known or reasonably known or reasonably ascertainable information about the property (40 CFR 312.30).	Yes	No
Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example,	☑	☐
(a.) Do you know the past uses of the property?	☑	☐
(b.) Do you know of specific chemicals that are present or once were present at the property?	☐	☑
(c.) Do you know of spills or other chemical releases that have taken place at the property?	☐	☑
(d.) Do you know of any environmental cleanups that have taken place at the property?	☐	☑
(6.) The degree of obviousness of the presence or likely presence of contamination at the property, and the ability to detect the contamination by appropriate Investigation (40 CFR 312.31).	Yes	No
Based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of releases at the property?	☑	☐

SIGNATURE:

It is understood that the information presented in this form is an integral part of the Phase I ESA process and that Langan will evaluate and rely on this information in the development of the final Phase I ESA report.

Completed By: [signature]

Print/Type Name: BRYAN KELLY

Title: EVP of Development

Company: GO UCL LLC

Date: 2/20/2018

APPENDIX B

PROPERTY OWNER / OPERATOR / KEY SITE MANAGER QUESTIONNAIRE

LANGAN

ASTM PRACTICE E 1527-13:
OWNER/OPERATOR/SITE-MANAGER QUESTIONNAIRE

Please complete the below form and return to
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.

Project Location/Address: Christian Cultural Center

12020 Flatlands Avenue, Brooklyn NY.

ASTM E-1527-13, Section 9.4

Are you aware of any of the following located on the subject property:

Pits, Ponds, or Lagoons? Decorative by Gazebo (2). Recirculating Closed System.	Yes ☑ No ☐
Stained Soil or Pavement?	Yes ☐ No ☑
Stressed Vegetation?	Yes ☐ No ☑
Solid Waste (including trash, construction debris, or demolition debris)?	Yes ☑ No ☐
Wastewater or Discharges into Drains, Ditches, Underground Injection System, or Stream?	Yes ☐ No ☑
Wells (including dry wells, irrigation wells, injection wells, abandoned wells, or other wells)?	Yes ☐ No ☑
Septic Systems or Cesspools?	Yes ☐ No ☑

ASTM E-1527-13, Section 10.9

Do you know of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the property?	Yes ☐ No ☑
Do you know of any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, or from the property?	Yes ☐ No ☑
Do you know of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products?	Yes ☐ No ☑

ASTM E-1527-13, Section 10.8

Are you aware if any of the documents listed below exists and if so, whether copies can and will be provided to the Consultant performing the ESA?

	Unaware	Document Exists	Copy will be provided
Environmental site assessment reports	☑	☐	☐
Environmental compliance audit reports	☑	☐	☐
Environmental permits (such as solid waste disposal permits, hazardous waste disposal permits, NPDES permits, wastewater permits, underground injection permits)	☑	☐	☐
Registrations for underground and aboveground storage tanks	☑	☐	☐
Material safety data sheets	☑	☐	☐
Community-right-to-know plan	☑	☐	☐
Safety plans; preparedness and prevention plans; spill prevention, countermeasure and control plans, facility response plan, etc.	☑	☐	☐
Reports regarding hydrogeologic conditions on the property or surrounding area	☑	☐	☐
Notices or other correspondence from any governmental agency relating to past or current violations of environmental laws with respect to the property or relating to environmental liens encumbering the property	☑	☐	☐
Hazardous waste generator notices or reports	☑	☐	☐
Geotechnical studies	☑	☐	☐
Risk Assessments	☑	☐	☐
Recorded Activity and Use Limitations	☑	☐	☐
Environmental Cleanup Reports	☑	☐	☐

SAFETY DIRECTOR EVAC. PLANS.

SAFETY DIRECTOR- CHRISTOPHER ~~BRUSTEGO~~ BRUSTEGO
(917) 417-4070

Do you have contact information for the prior owner of the property? **Yes** ☐ **No** ☑
If yes, please provide information below:

Prior Owner's Name STARETT CITY.

Contact person _____

Address _____

_____

Telephone _____

Do you have contact information for the prior occupant of the property? **Yes** ☐ **No** ☑
If yes, please provide information below:

Prior Occupant's Name STARETT CITY.

Contact person _____

Address _____

_____

Telephone _____

Do you have information on the prior facility manager of the property? **Yes** ☐ **No** ☑
If yes, please provide information below:

Prior Facility Manager's Name STARETT CITY.

Contact person _____

Address _____

_____

Telephone _____

This form was completed by:

Property Owner ☐ Operator ☐ Key Site Manager ☑ User ☐ EP ☑

Name: MR. ELDER GERALD SHAW SR.

Address: _____

_____

Signature: Elder Gerald Shaw Sr. Date: 9 FEBRUARY 2018

APPENDIX C

SANBORN MAPS

Christian Cultural Center
12020 Flatlands Avenue
Brooklyn, NY 11207

Inquiry Number: 5113516.3
November 20, 2017

Certified Sanborn® Map Report

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

11/20/17

Site Name:

Christian Cultural Center
12020 Flatlands Avenue
Brooklyn, NY 11207
EDR Inquiry # 5113516.3

Client Name:

Langan Engineering
300 Kimball Drive, 4th Floor
Parsippany, NJ 07054-2172
Contact: Amanda Forsburg

The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Langan Engineering were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 3AAA-4A66-92F4

PO # 100688801

Project Christian Cultural Center

Maps Provided:

2007	1995	1983	1928
2006	1994	1981	1908
2005	1993	1980	
2004	1992	1979	
2003	1991	1977	
2002	1989	1969	
2001	1987	1967	
1996	1986	1950	

Sanborn® Library search results

Certification #: 3AAA-4A66-92F4

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☑ Library of Congress
- ☑ University Publications of America
- ☑ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Langan Engineering (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.


Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.


2007 Source Sheets

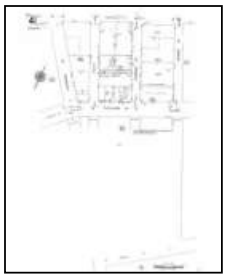
Volume 17, Sheet 41
2007


Volume 17, Sheet 42
2007


Volume 17, Sheet 86
2007


2006 Source Sheets

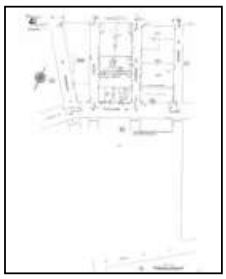
Volume 17, Sheet 41
2006


Volume 17, Sheet 42
2006


Volume 17, Sheet 86
2006


2005 Source Sheets

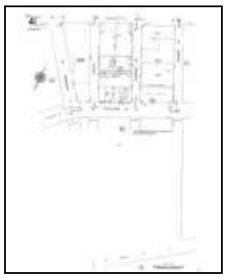
Volume 17, Sheet 41
2005


Volume 17, Sheet 42
2005


Volume 17, Sheet 86
2005

2004 Source Sheets

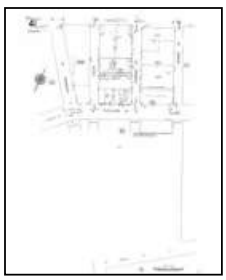
Volume 17, Sheet 41
2004


Volume 17, Sheet 42
2004



Volume 17, Sheet 86
2004

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.


2003 Source Sheets


Volume 17, Sheet 86
2003

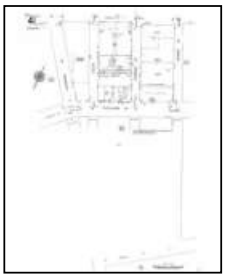
Volume 17, Sheet 41
2003


Volume 17, Sheet 42
2003


2002 Source Sheets

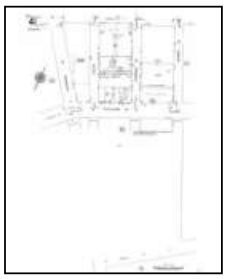
Volume 17, Sheet 41
2002


Volume 17, Sheet 42
2002


Volume 17, Sheet 86
2002

2001 Source Sheets

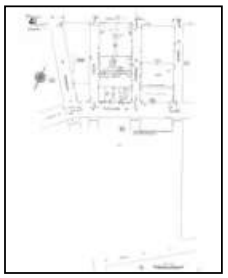

Volume 17, Sheet 41
2001


Volume 17, Sheet 42
2001


Volume 17, Sheet 86
2001

1996 Source Sheets


Volume 17, Sheet 42
1996

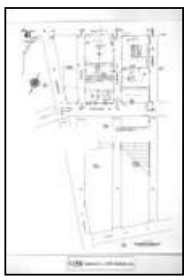

Volume 17, Sheet 41
1996


Volume 17, Sheet 86
1996

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.


1995 Source Sheets

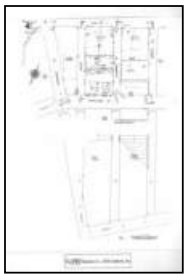
Volume 17, Sheet 41
1995


Volume 17, Sheet 42
1995


Volume 17, Sheet 86
1995

1994 Source Sheets

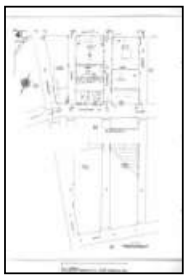

Volume 17, Sheet 41
1994


Volume 17, Sheet 42
1994


Volume 17, Sheet 86
1994


1993 Source Sheets


Volume 17, Sheet 41
1993

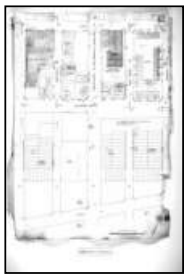
Volume 17, Sheet 42
1993


Volume 17, Sheet 86
1993

1992 Source Sheets

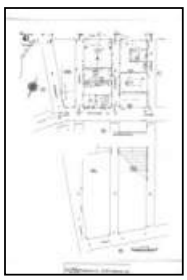
Volume 17, Sheet 41
1992



Volume 17, Sheet 42
1992



Volume 17, Sheet 86
1992

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1991 Source Sheets

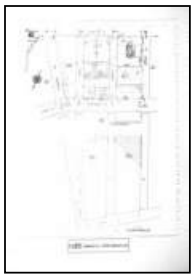
Volume 17, Sheet 41
1991

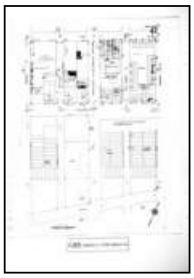
Volume 17, Sheet 42
1991


Volume 17, Sheet 86
1991

1989 Source Sheets



Volume 17, Sheet 41
1989


Volume 17, Sheet 42
1989


Volume 17, Sheet 86
1989


Volume 19, Sheet 42
1989


1987 Source Sheets

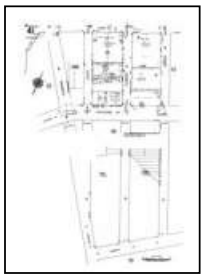

Volume 17, Sheet 41
1987


Volume 17, Sheet 42
1987


Volume 17, Sheet 86
1987

1986 Source Sheets

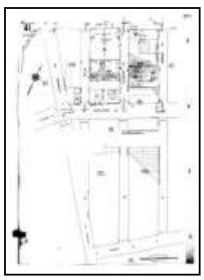
Volume 17, Sheet 41
1986

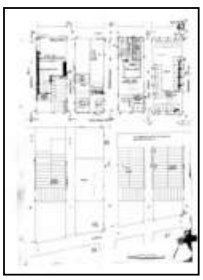
Volume 17, Sheet 42
1986


Volume 17, Sheet 86
1986

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1983 Source Sheets


Volume 17, Sheet 41
1983


Volume 17, Sheet 42
1983


Volume 17, Sheet 86
1983


1981 Source Sheets


Volume 17, Sheet 41
1981


Volume 17, Sheet 42
1981


Volume 17, Sheet 86
1981

1980 Source Sheets

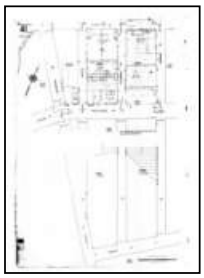

Volume 17, Sheet 41
1980



Volume 17, Sheet 42
1980


Volume 17, Sheet 86
1980

1979 Source Sheets


Volume 17, Sheet 86
1979

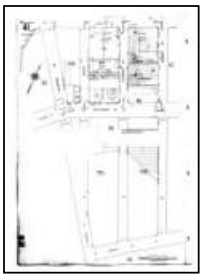

Volume 17, Sheet 41
1979

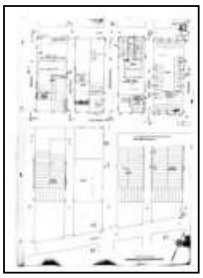
Volume 17, Sheet 42
1979

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.


1977 Source Sheets

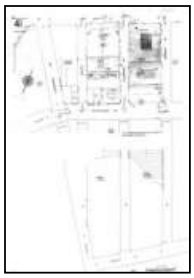

Volume 17, Sheet 41
1977


Volume 17, Sheet 42
1977



Volume 17, Sheet 86
1977


1969 Source Sheets

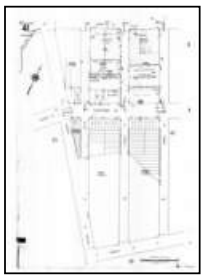
Volume 17, Sheet 41
1969

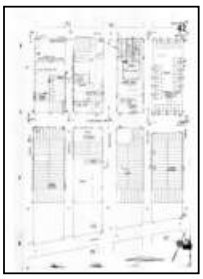

Volume 17, Sheet 42
1969

1967 Source Sheets

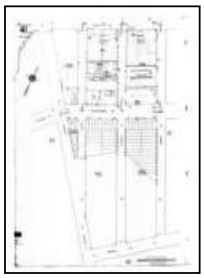
Volume 17, Sheet 41
1967

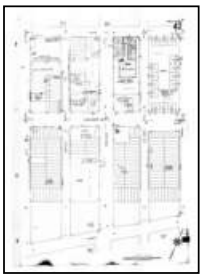
Volume 17, Sheet 42
1967

1950 Source Sheets

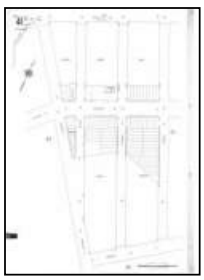

Volume 17, Sheet 41
1950


Volume 17, Sheet 42
1950

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1928 Source Sheets

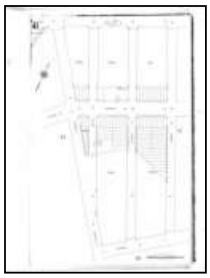


Volume 17, Sheet 41
1928




Volume 17, Sheet 42
1928


1908 Source Sheets

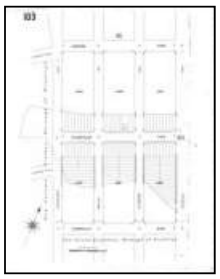

Volume 8, Sheet 103
1908

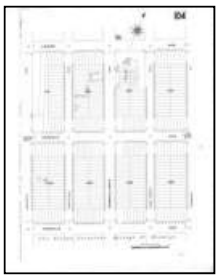

Volume 8, Sheet 104
1908

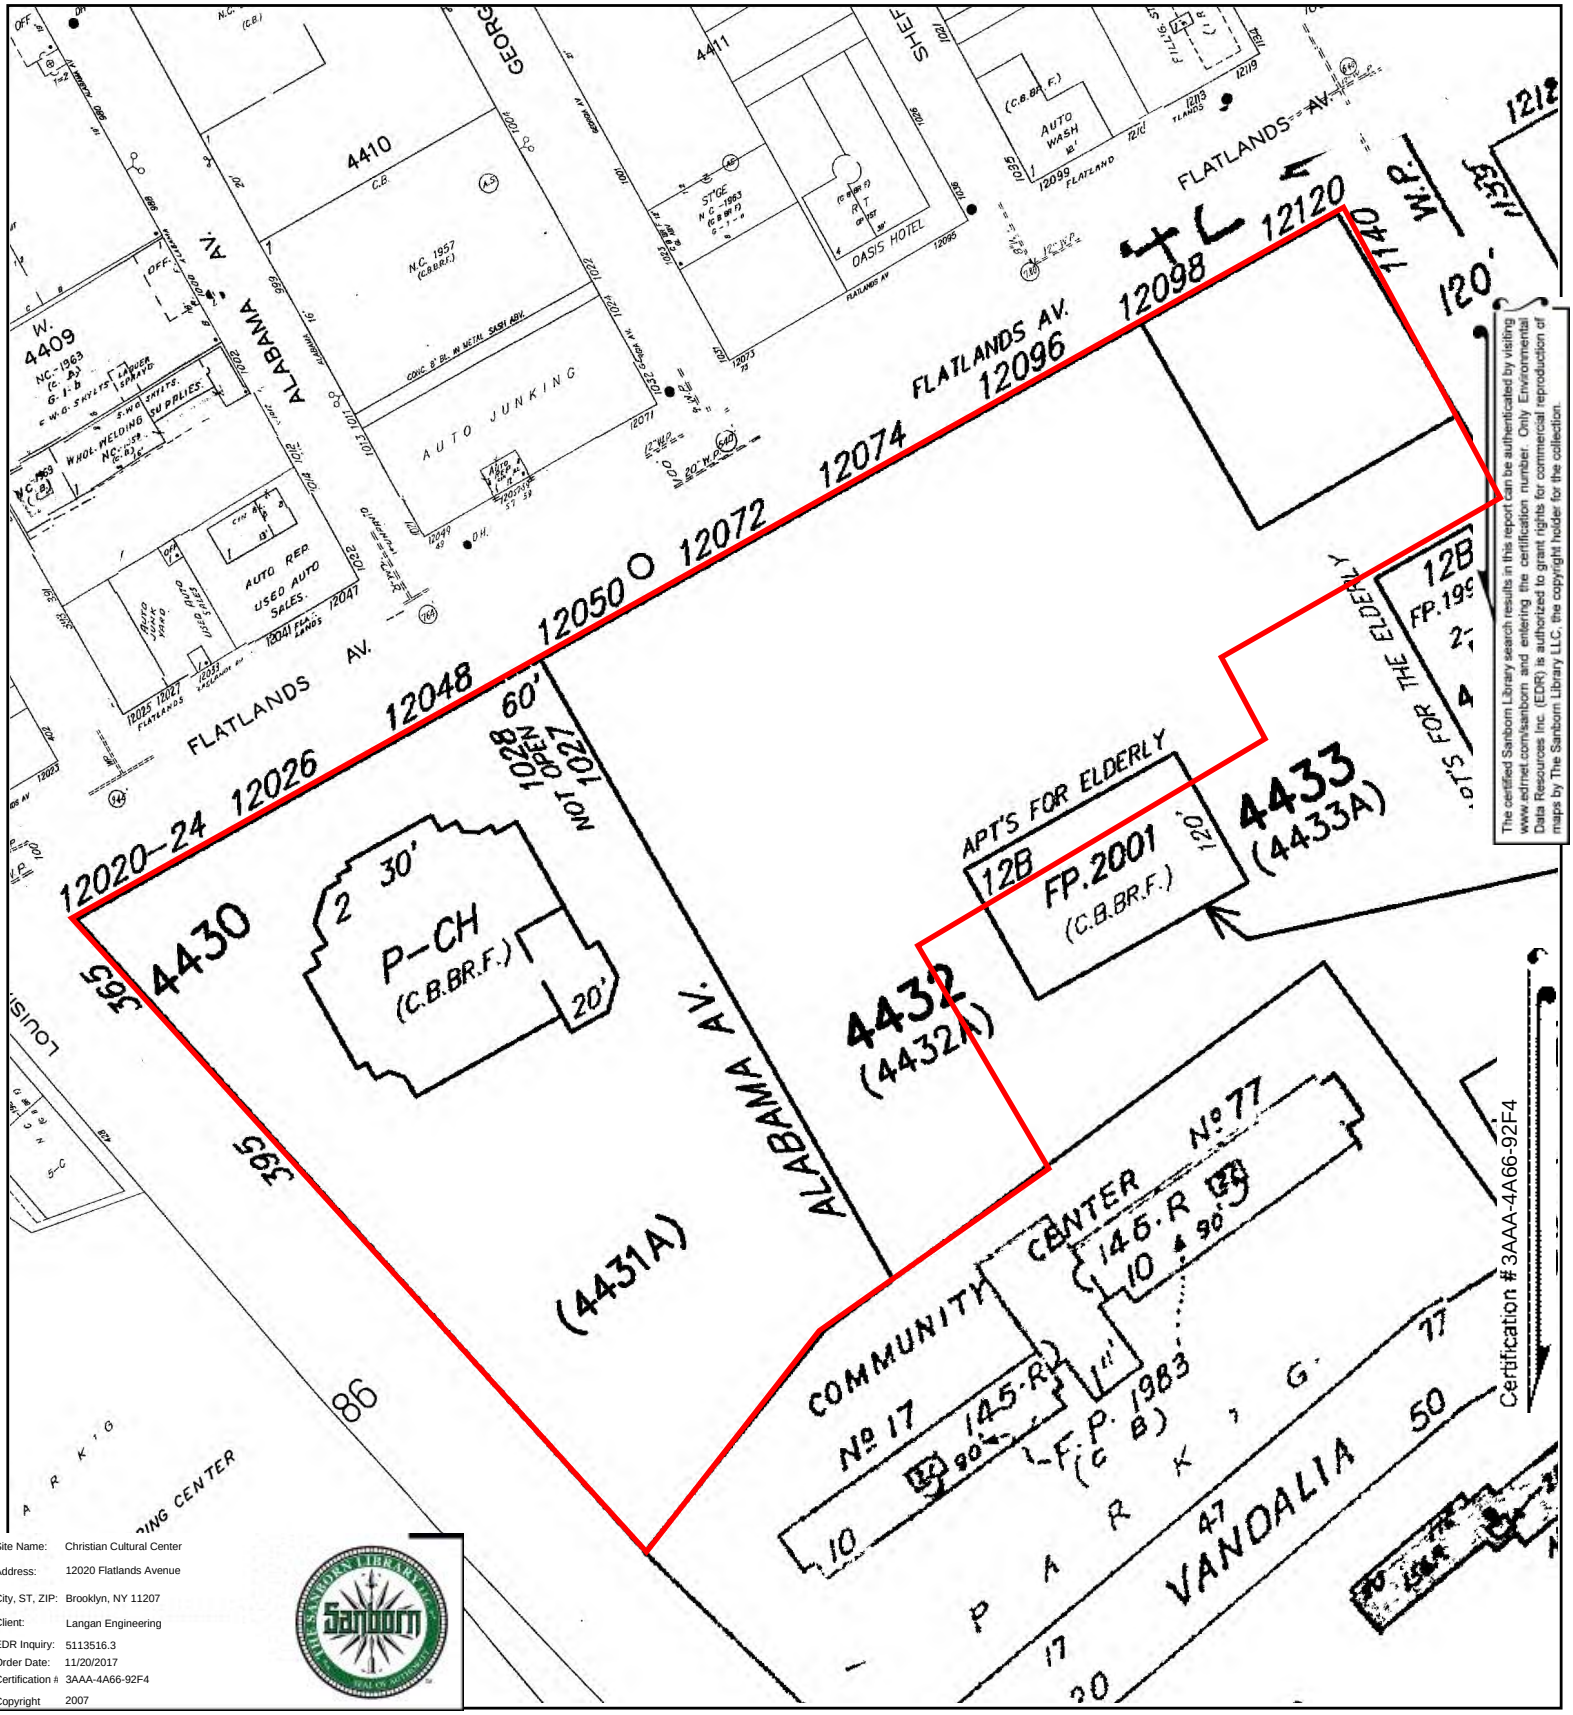


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2007

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600



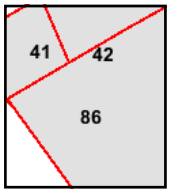

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

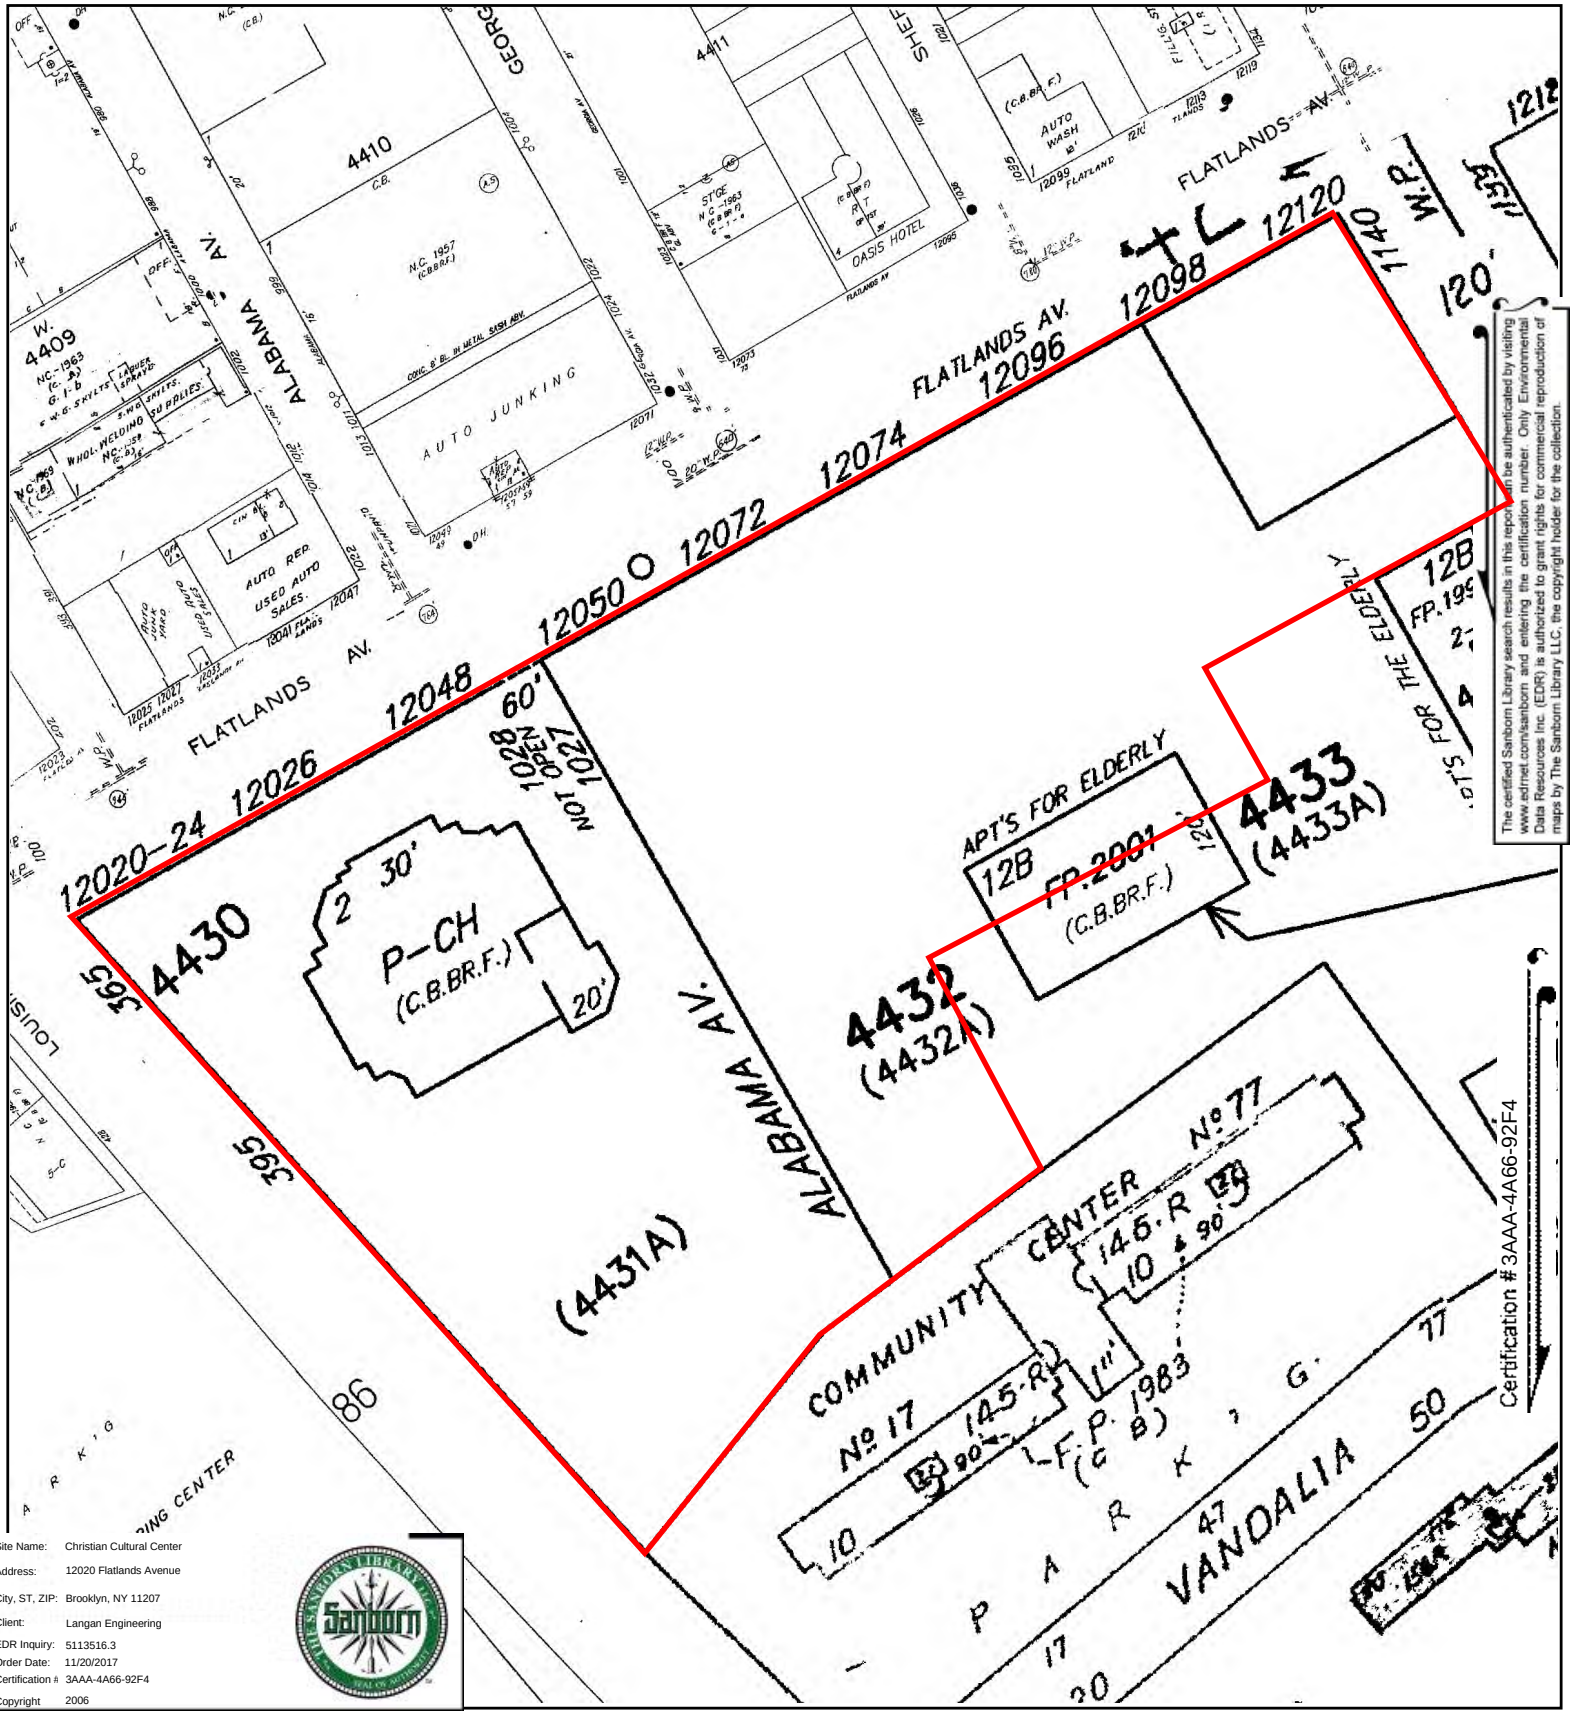



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2006

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

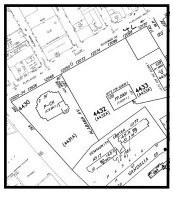

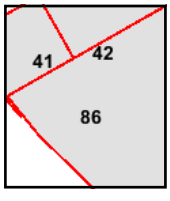

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

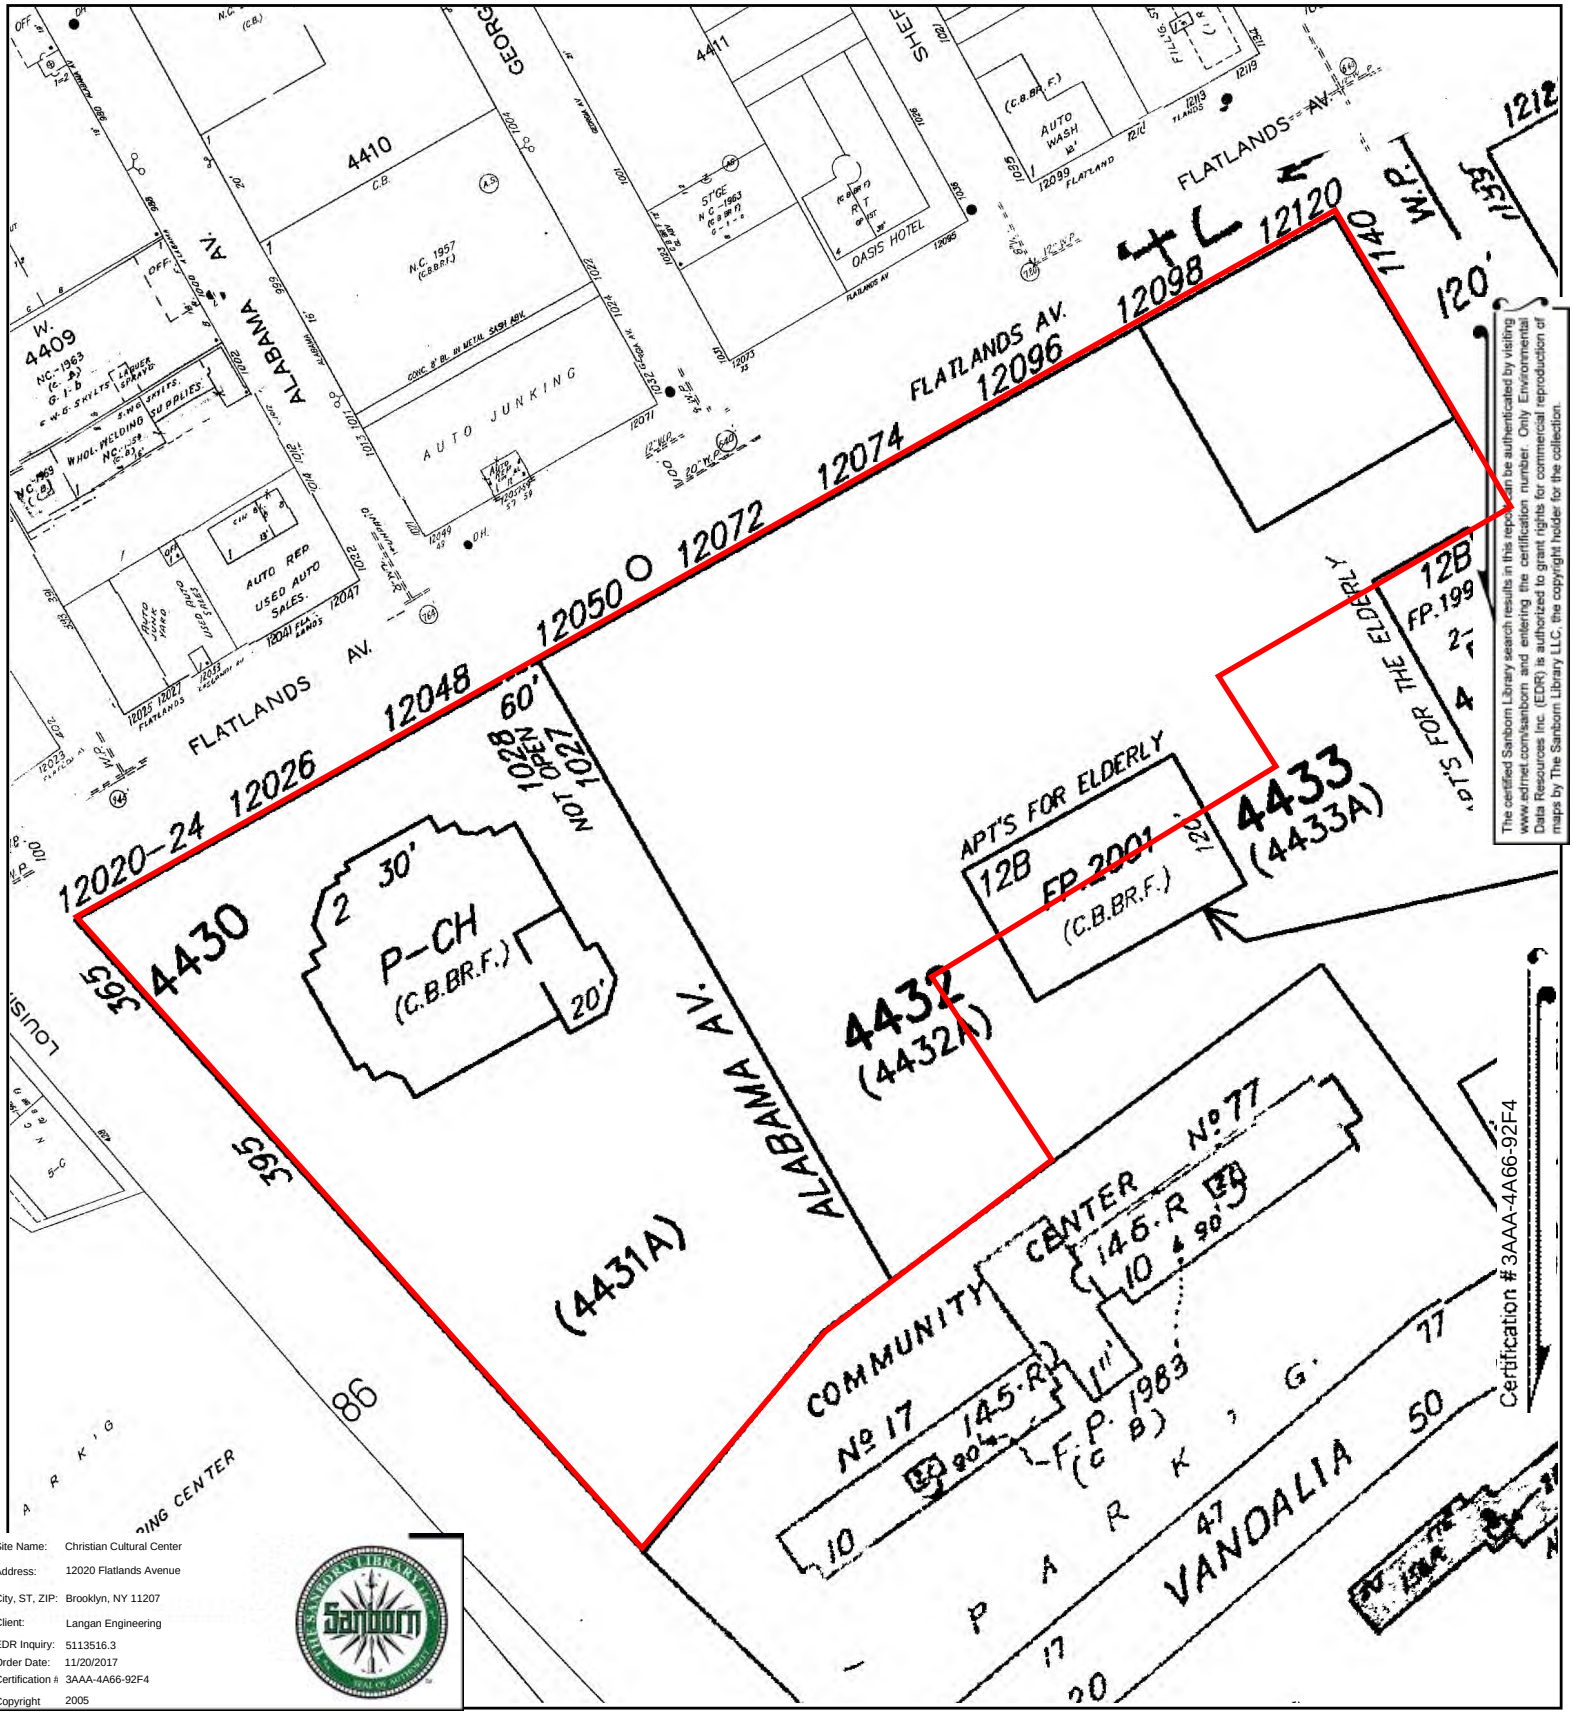


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2005

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600



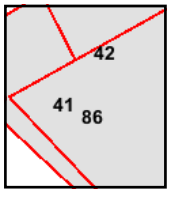

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

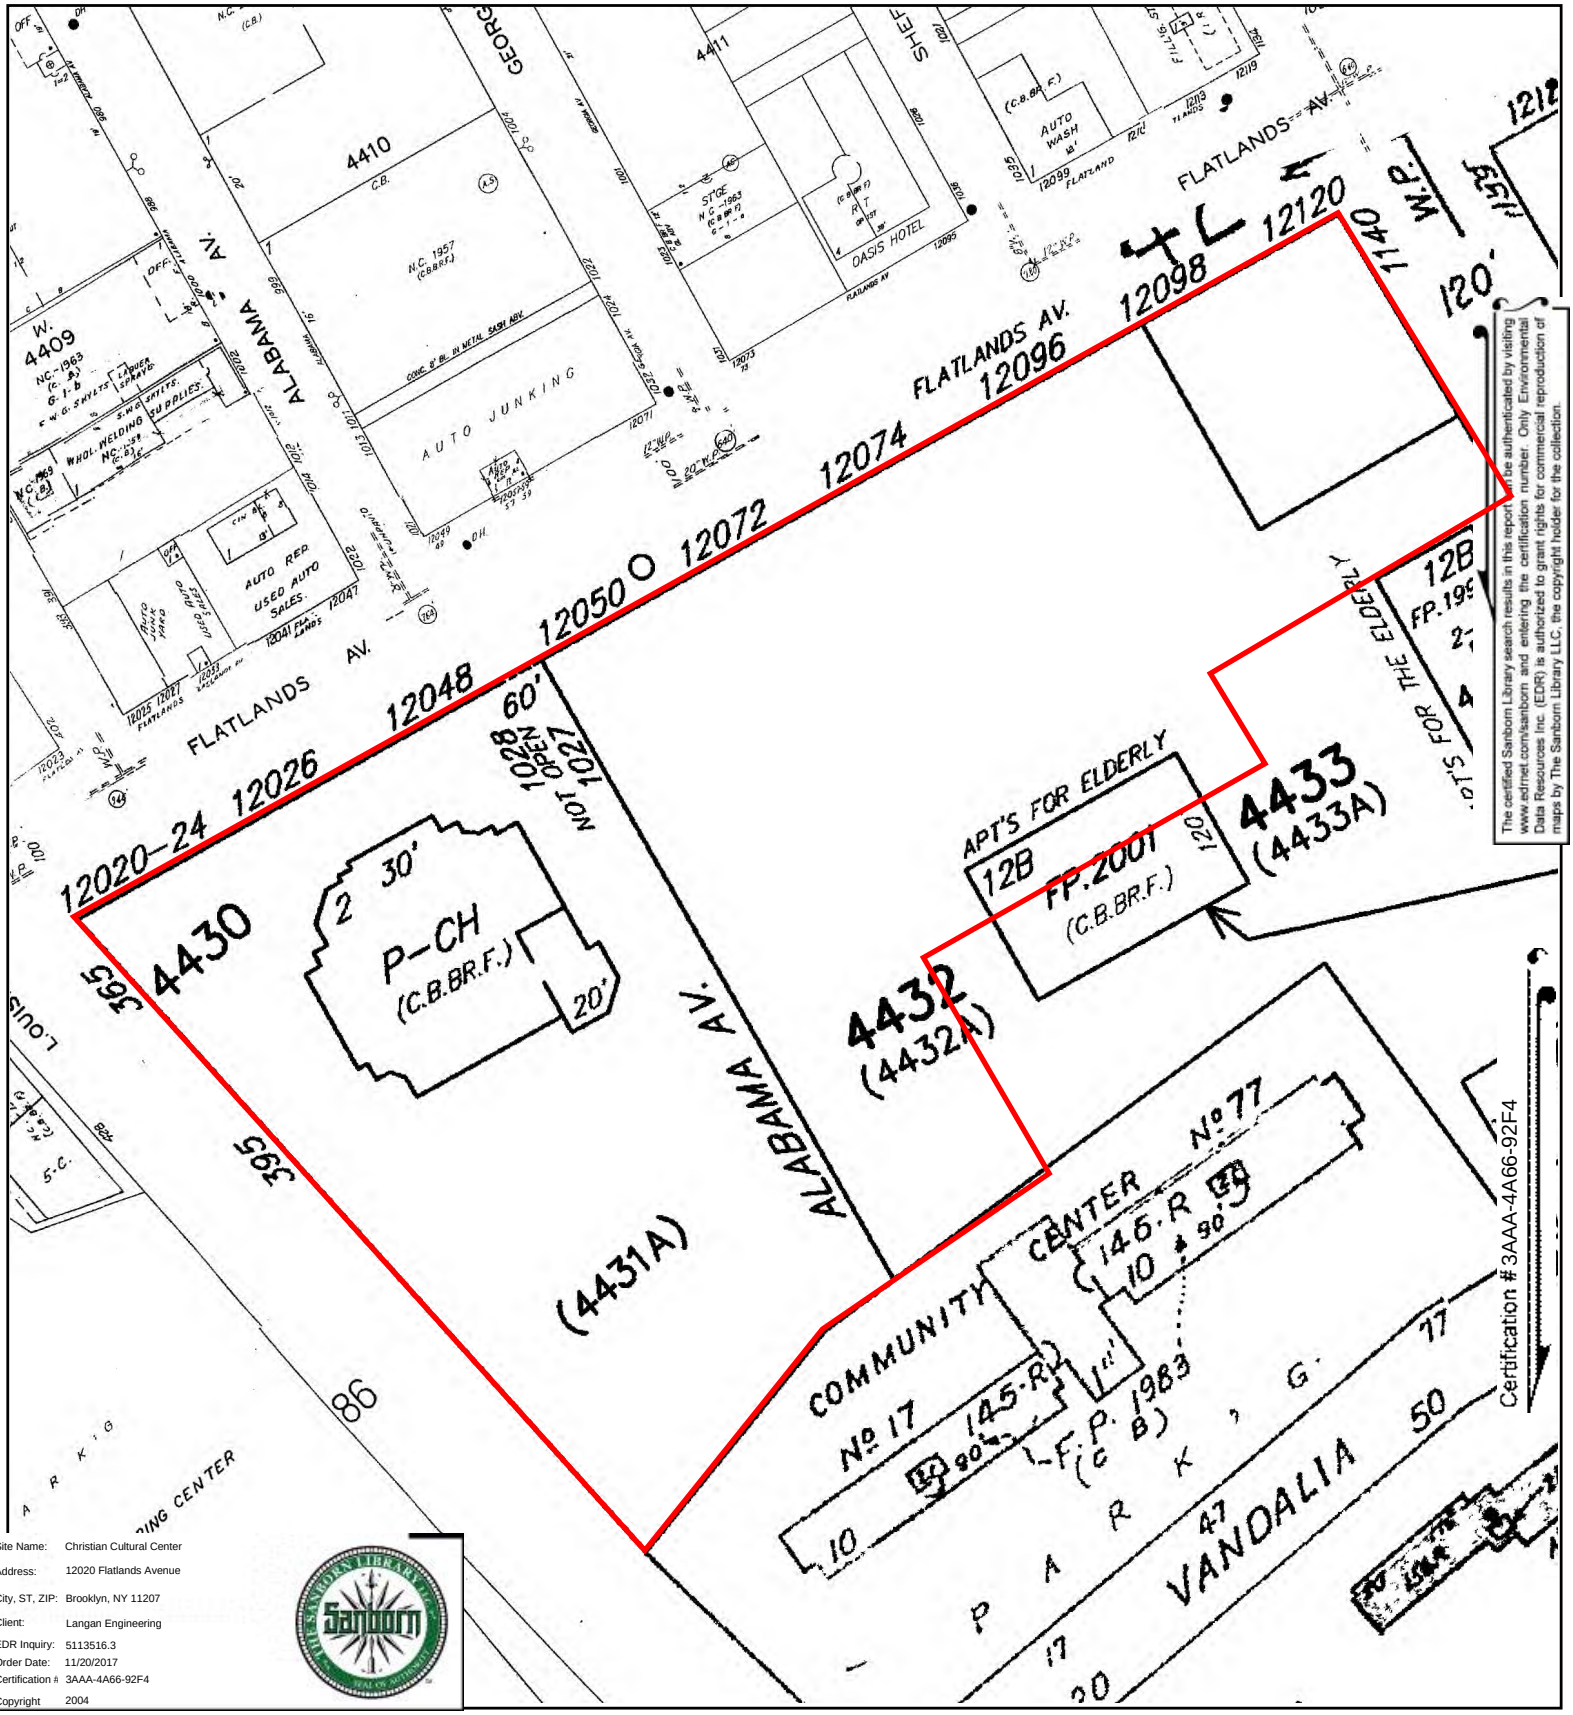


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2004

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600



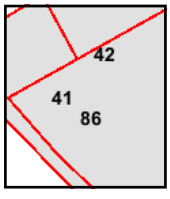

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

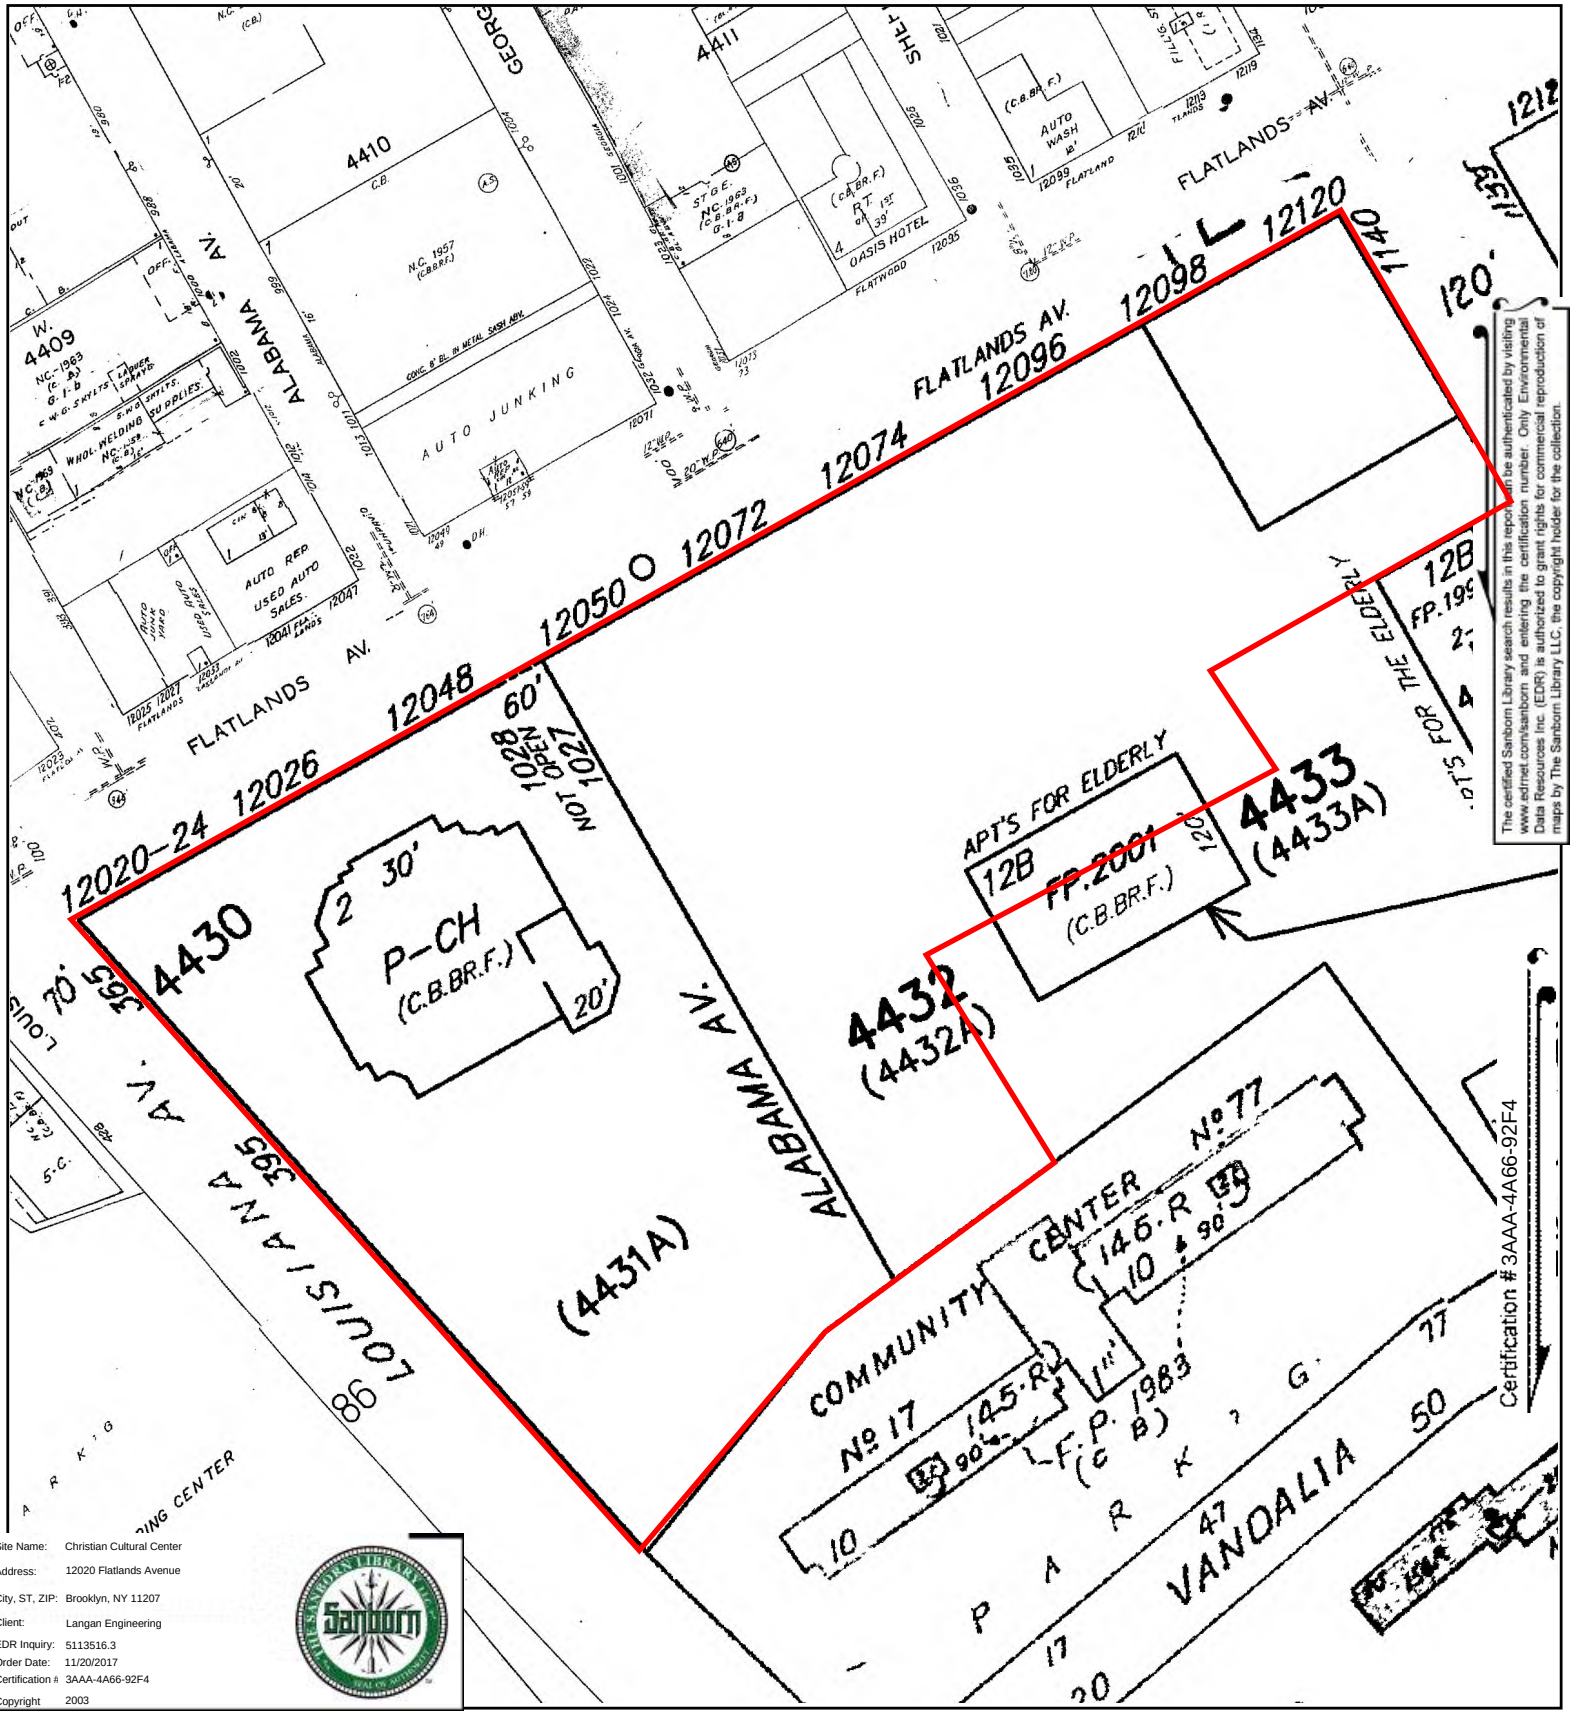


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2003

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600



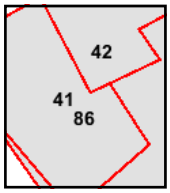

Volume 17, Sheet 42
Volume 17, Sheet 41
Volume 17, Sheet 86

N

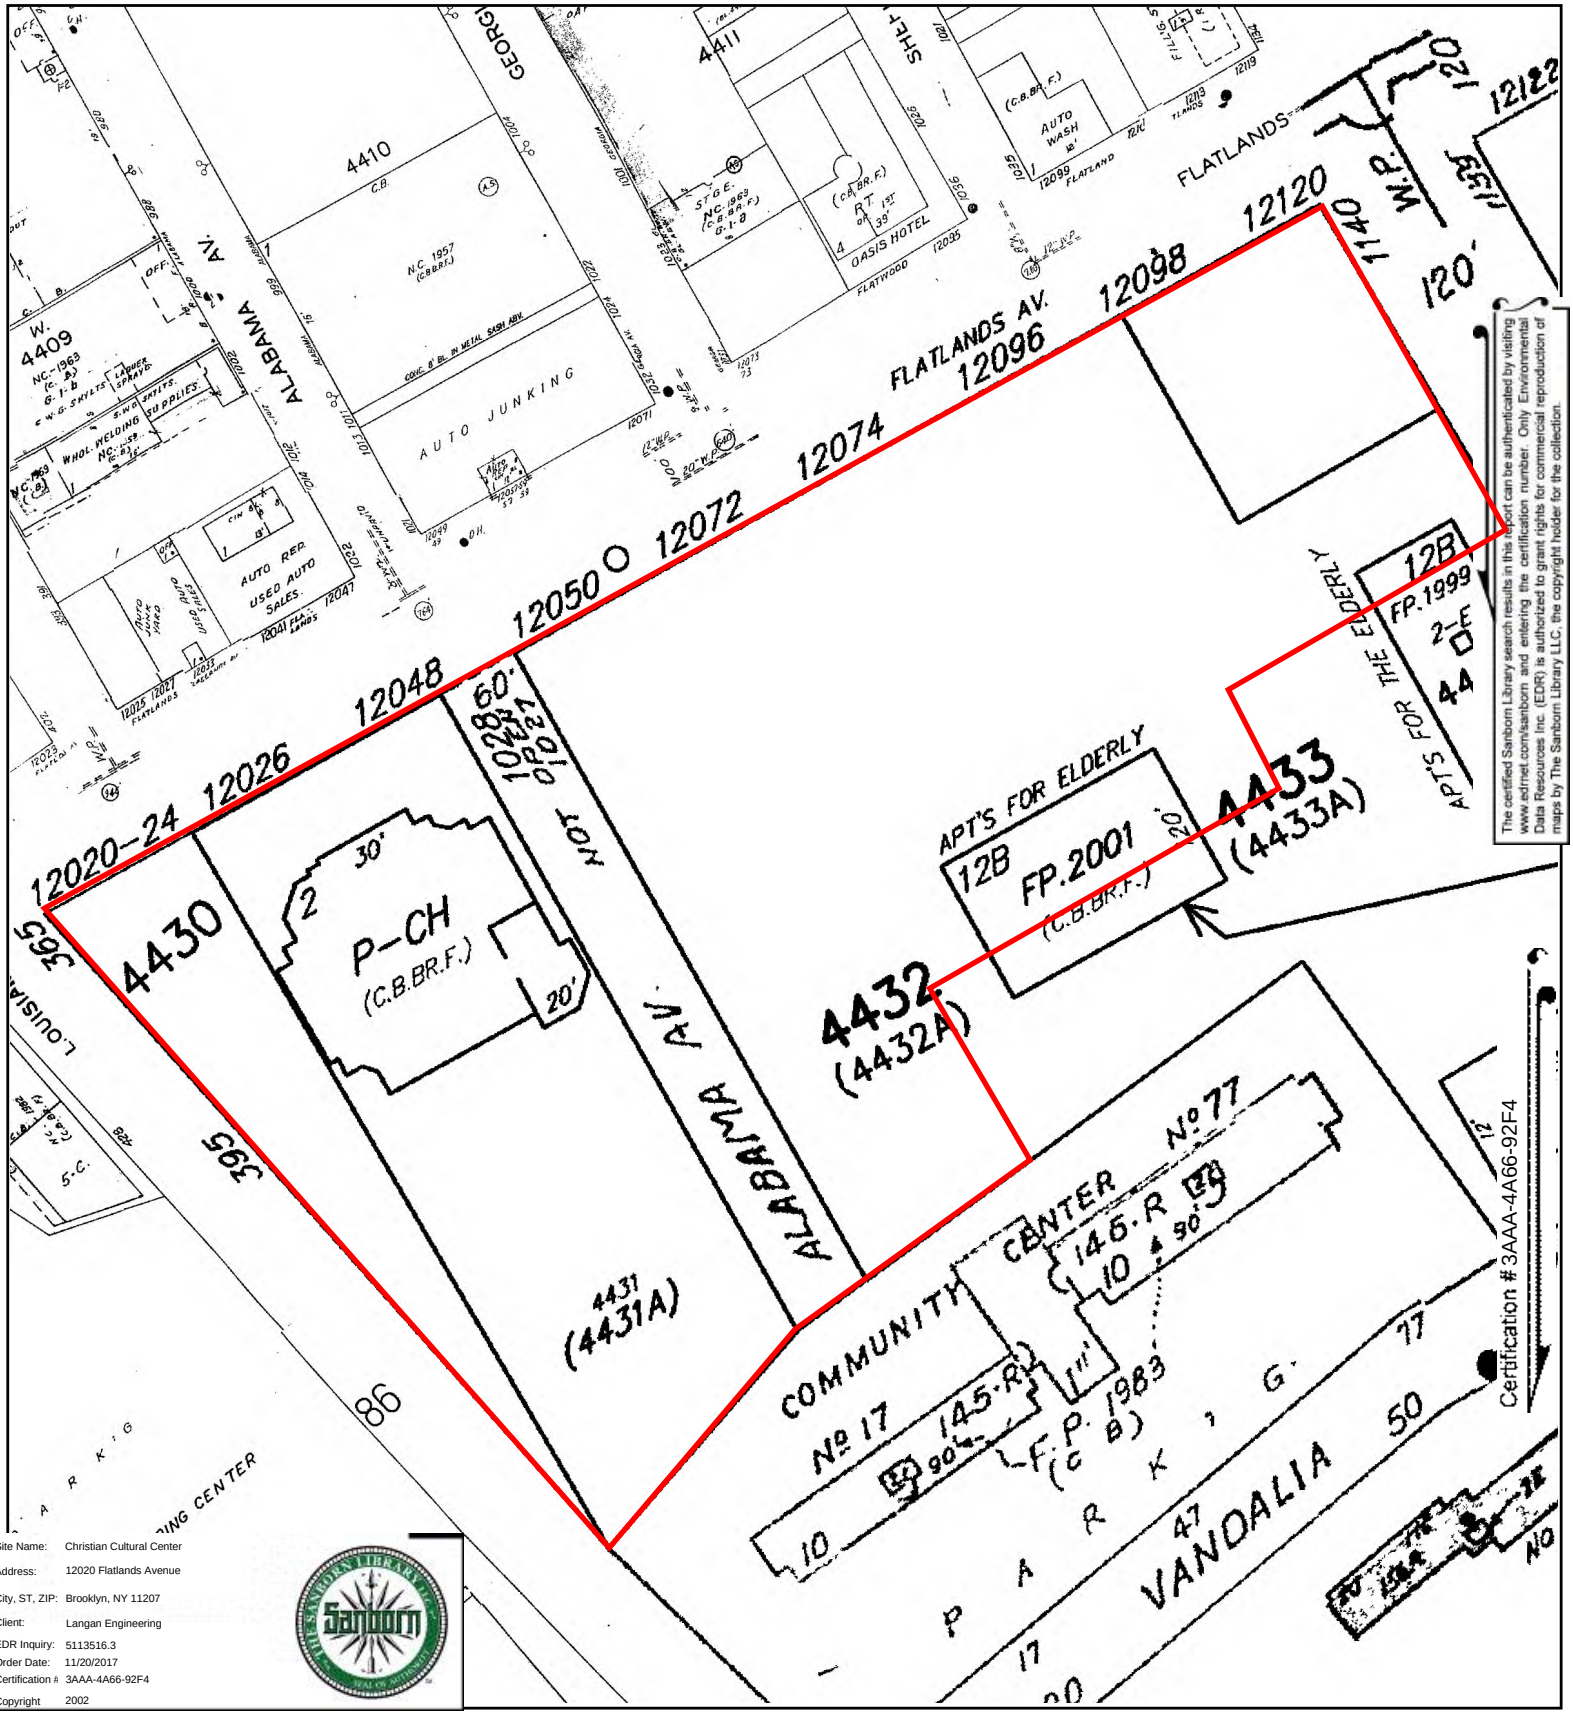


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2002

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600



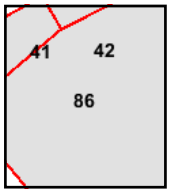

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41


N

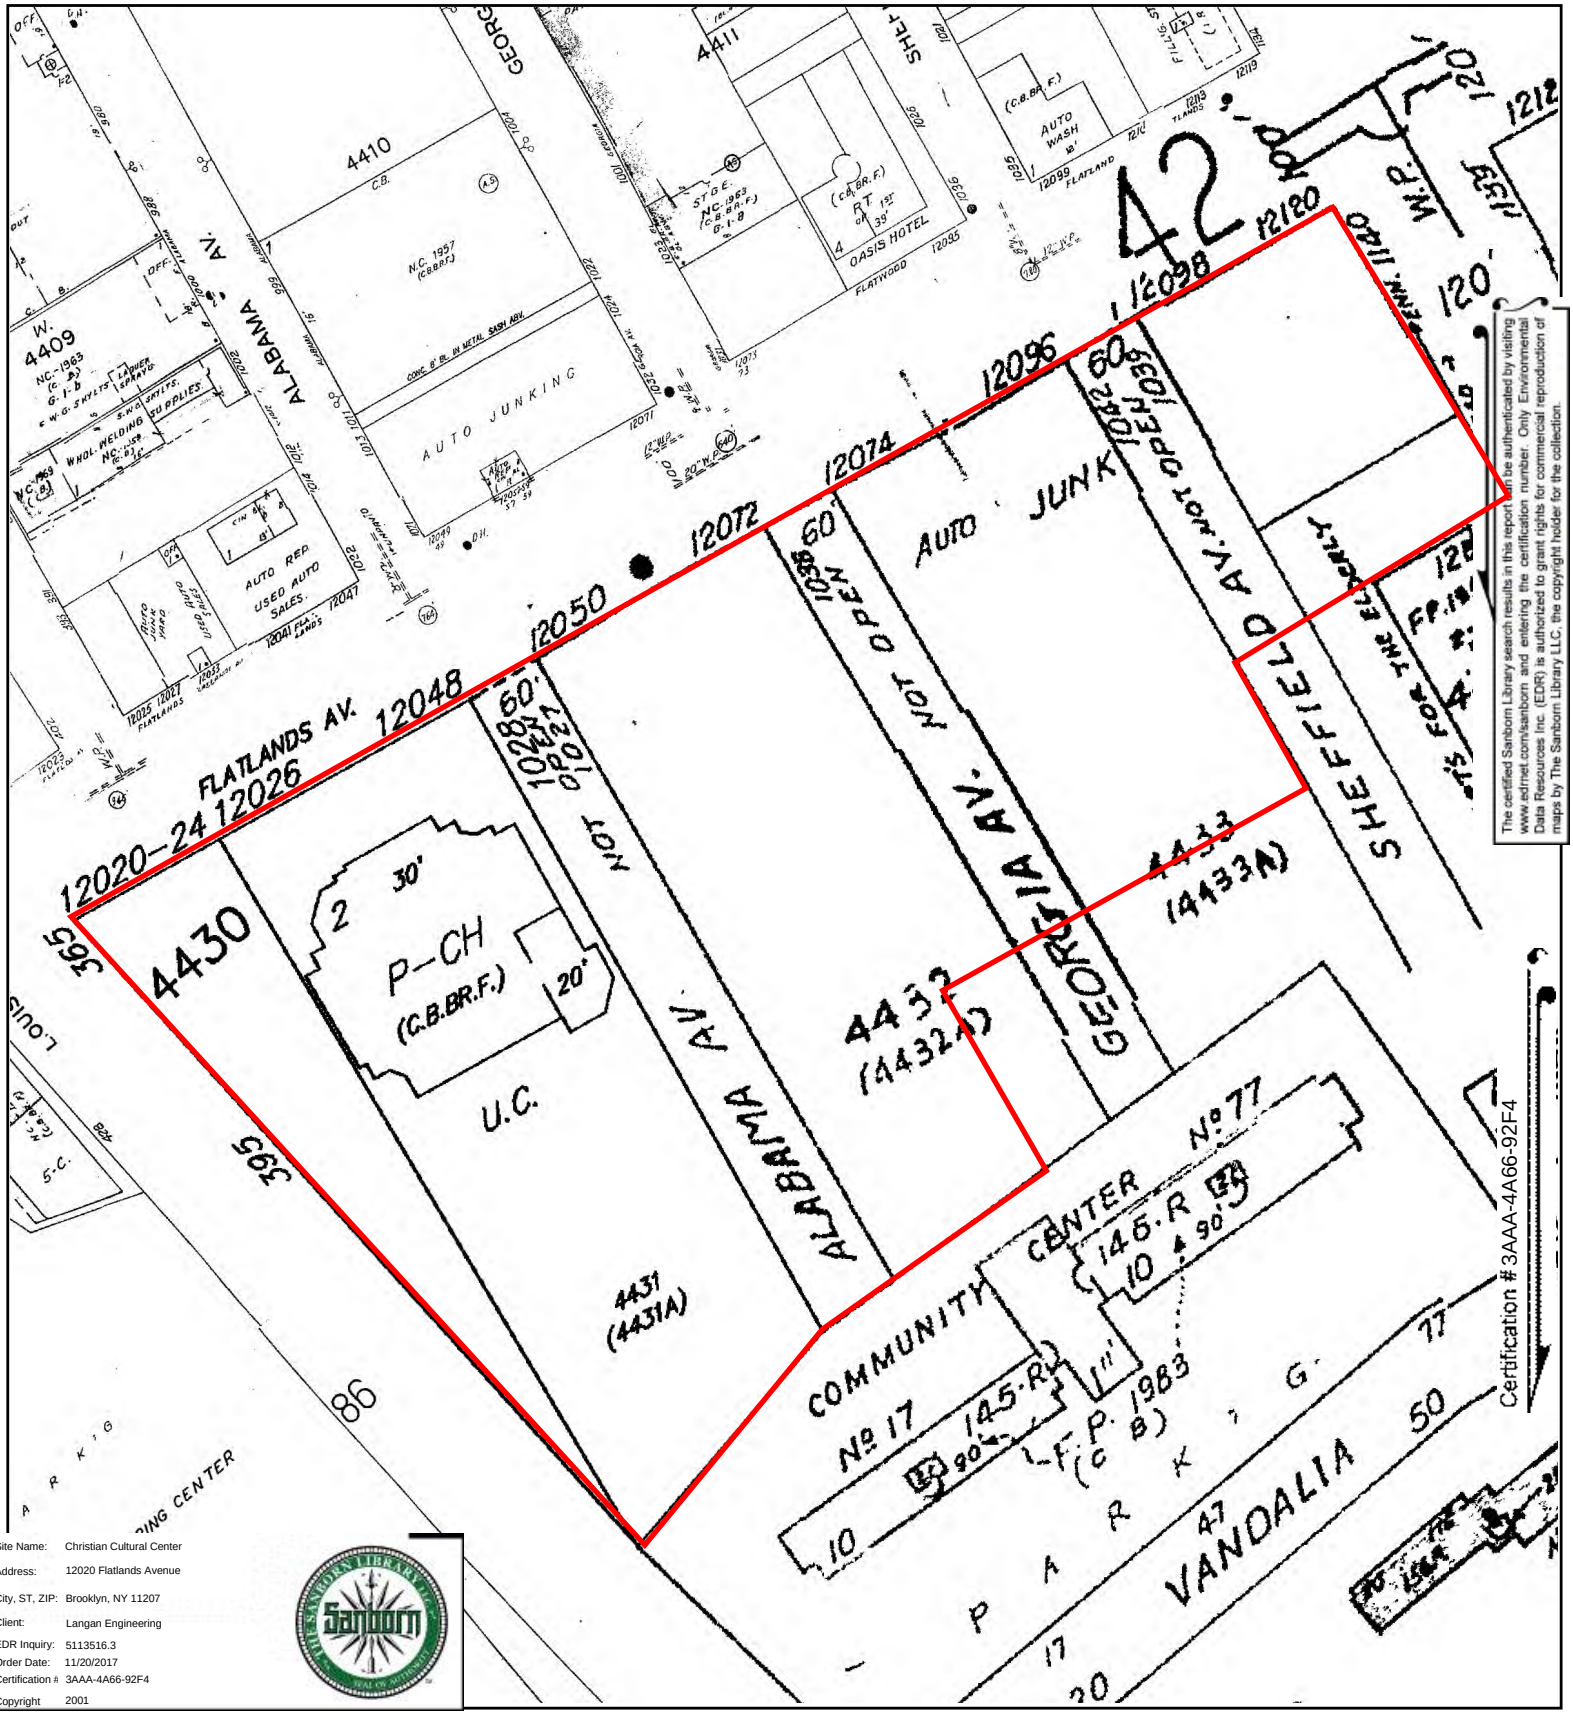


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	2001

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

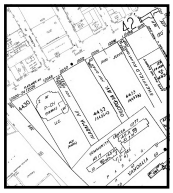


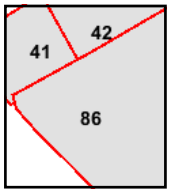

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

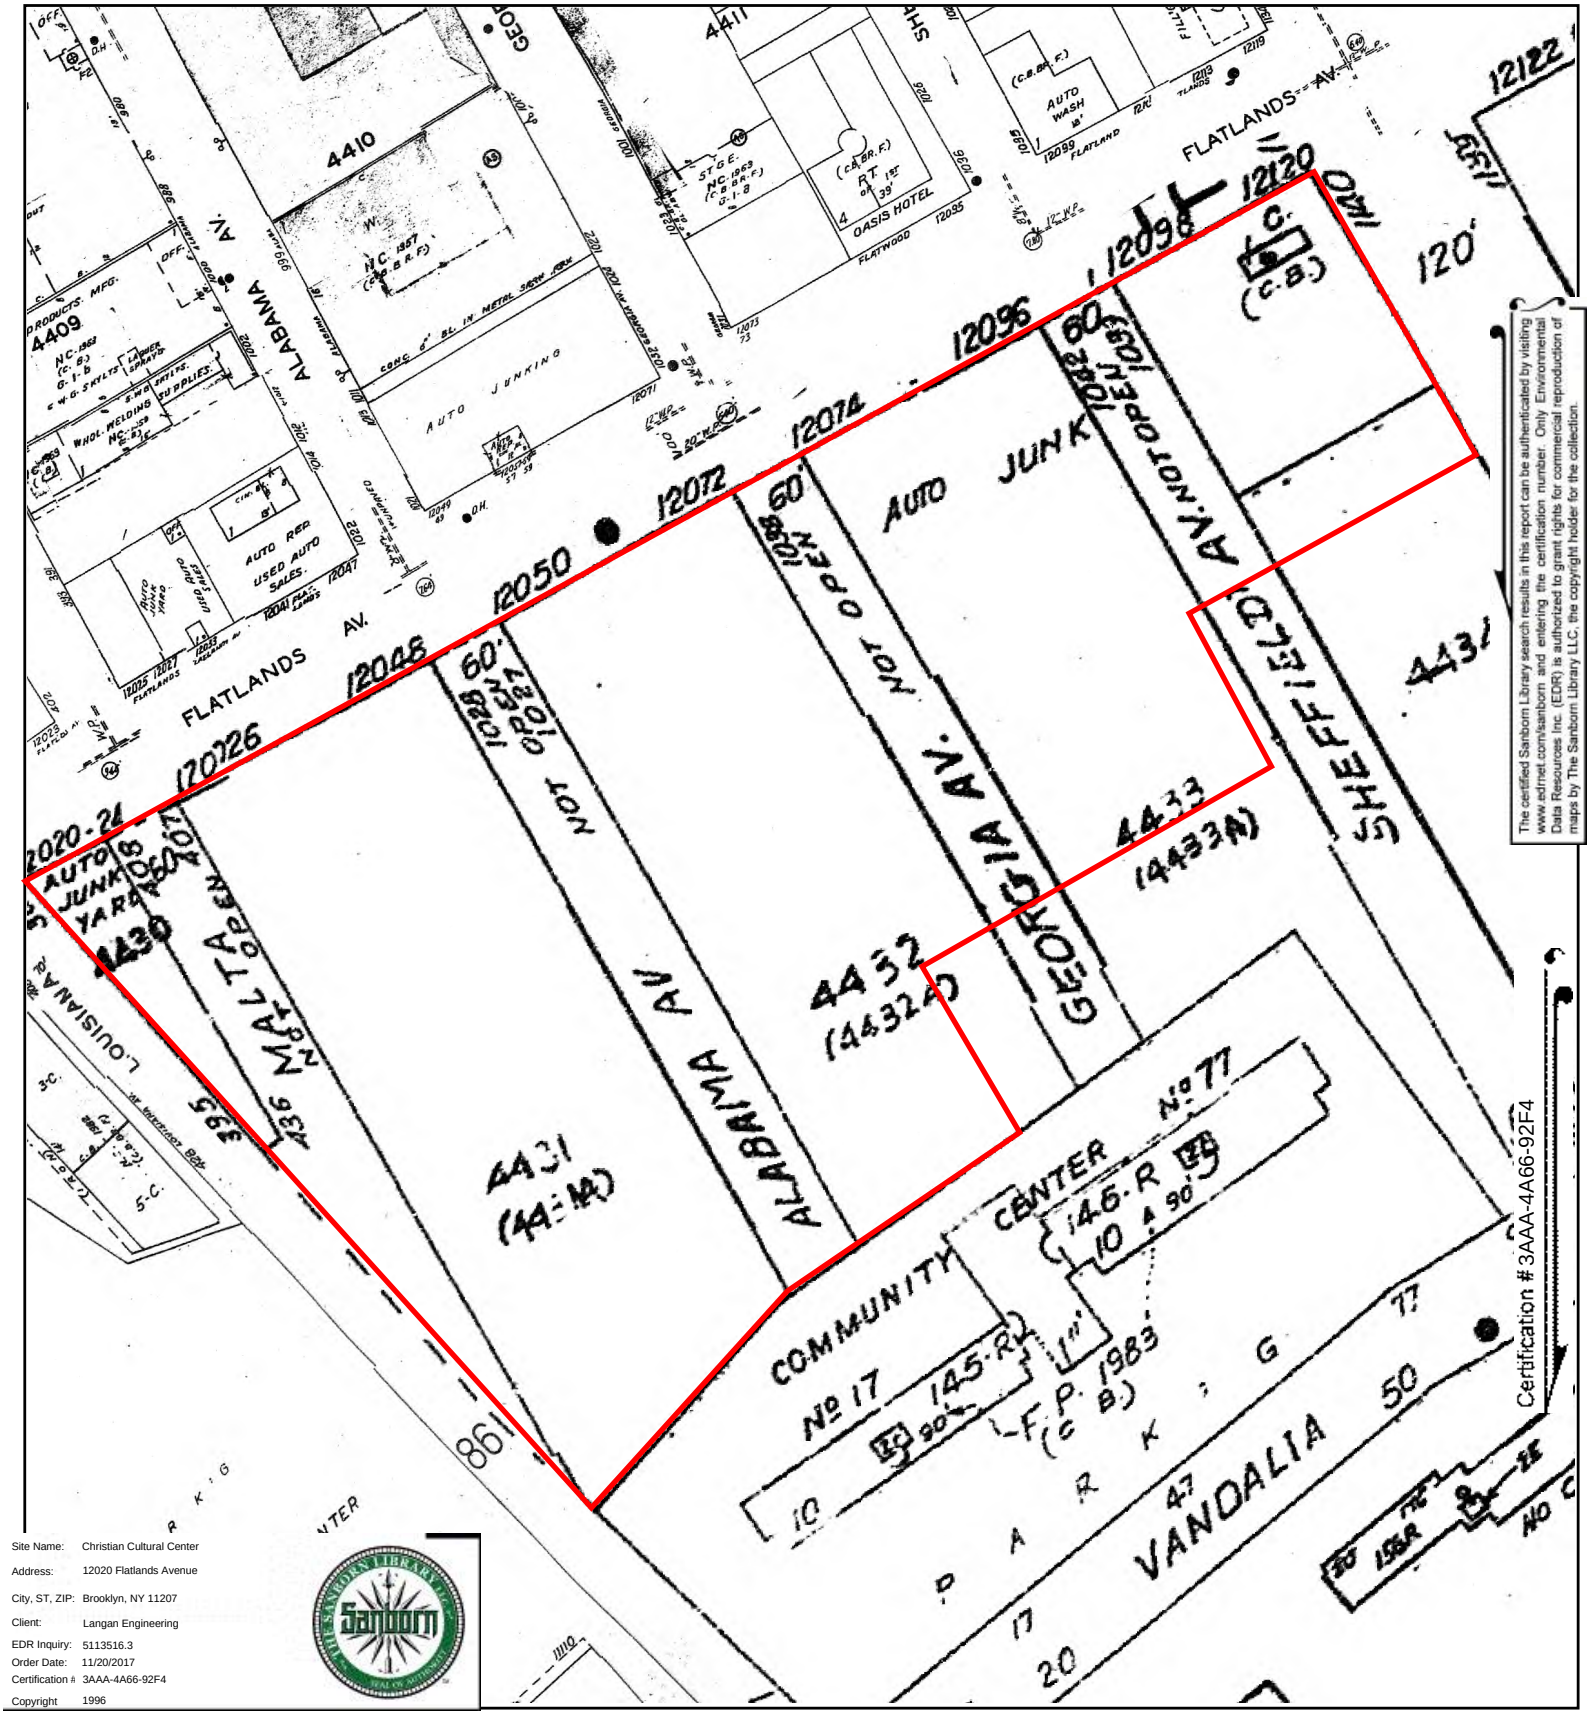


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #	3AAA-4A66-92F4
Copyright	1996


This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

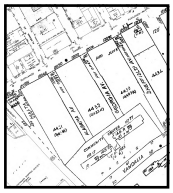


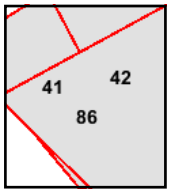

Volume 17, Sheet 86
Volume 17, Sheet 41
Volume 17, Sheet 42

0 Feet 150 300 600

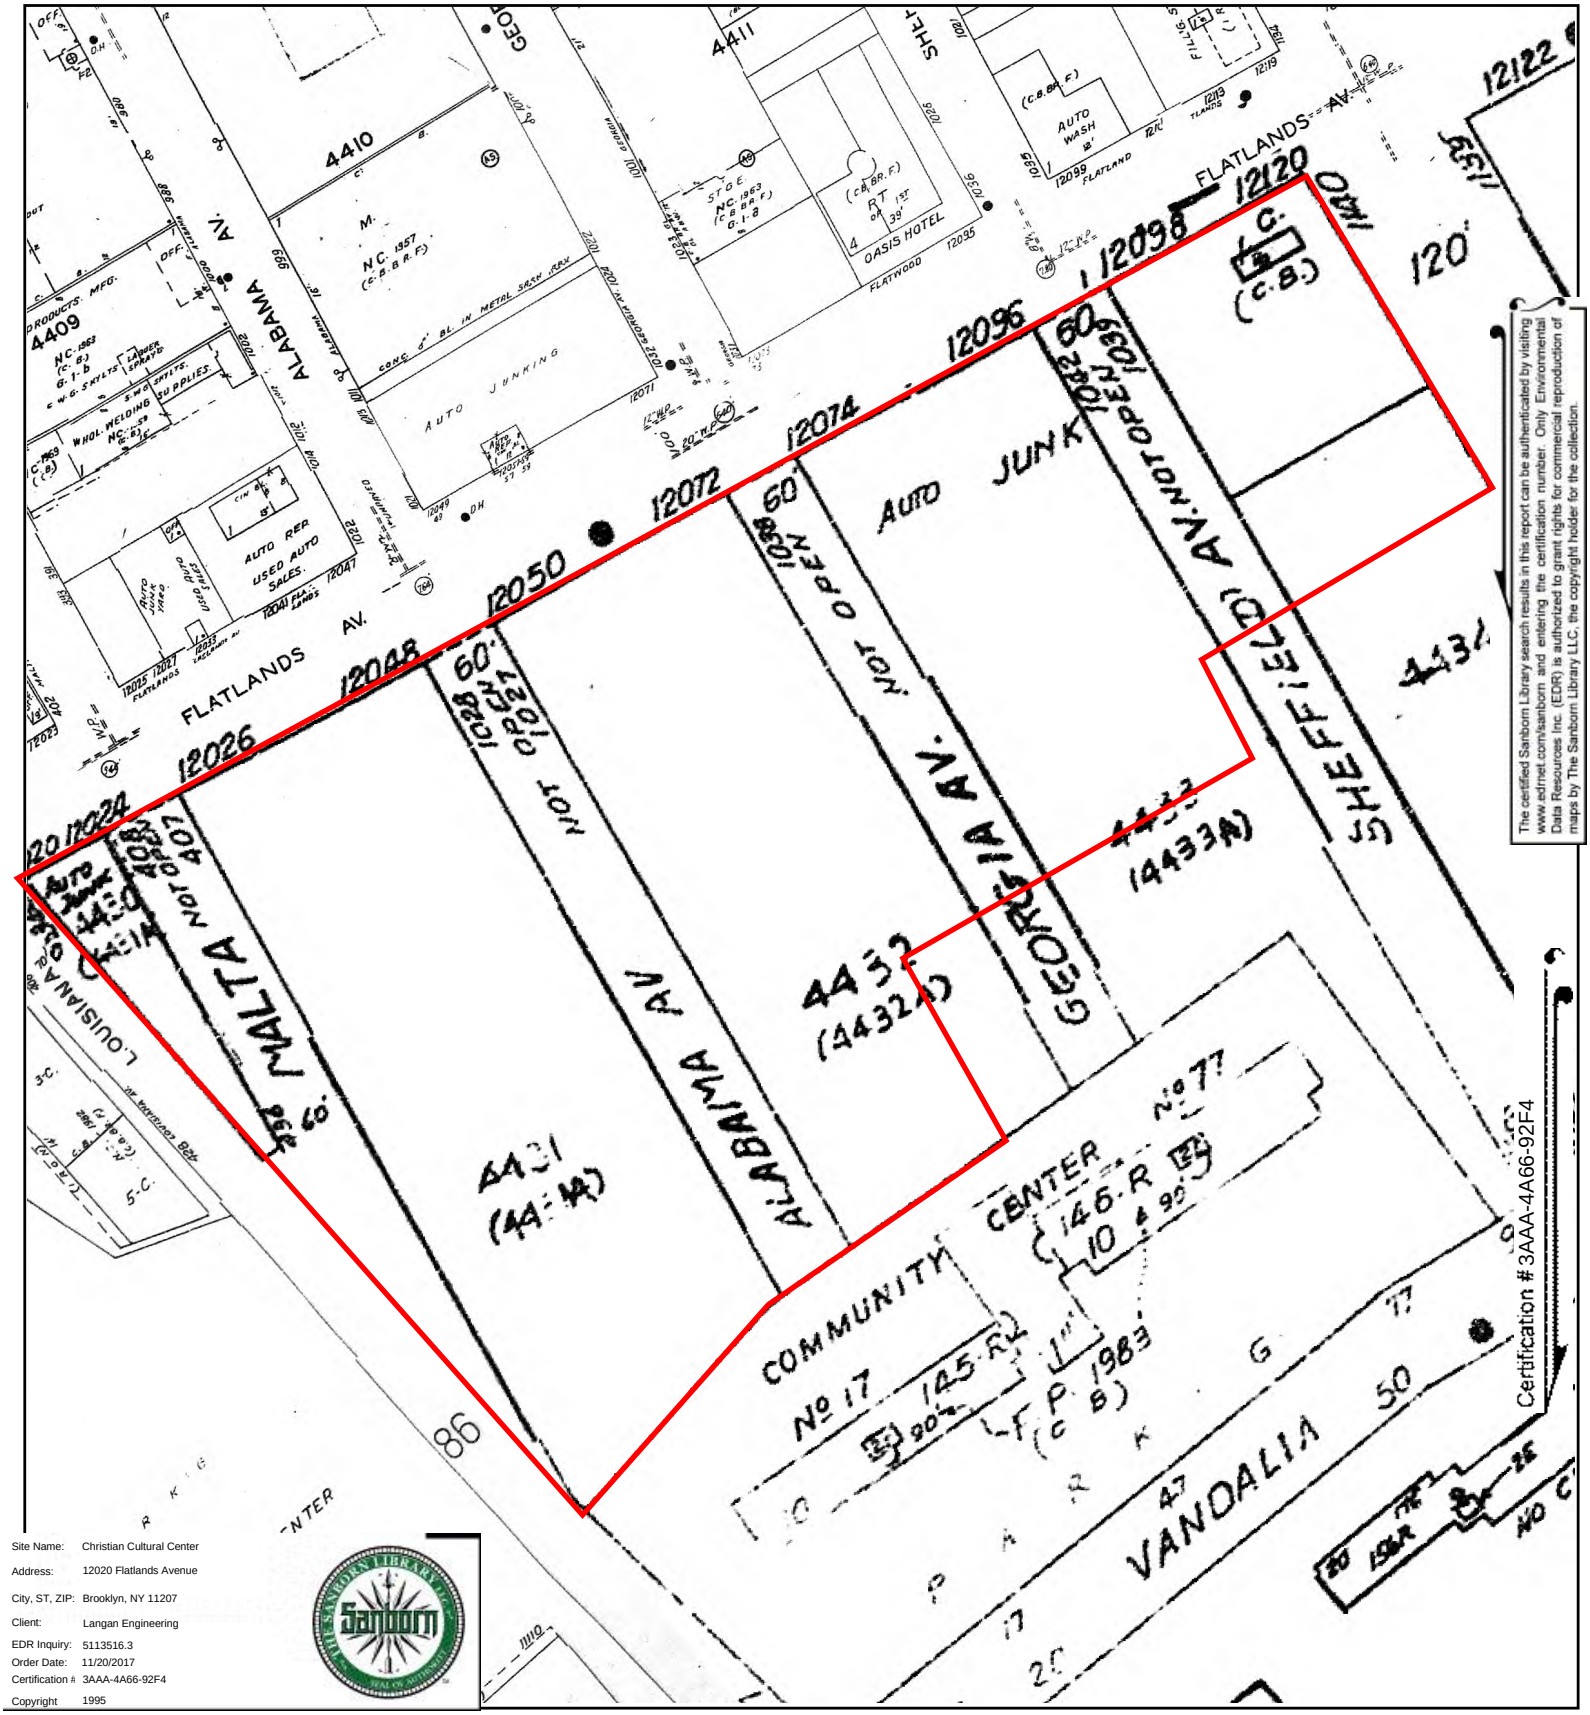
FLATLANDS AV.
ALABAMA AV.
GEORGIA AV.
SHEFFIELD AV.
MALTA AV.
NOT OPENED
AUTO JUNK
AUTO JUNKING
AUTO WASH
OASIS HOTEL
COMMUNITY CENTER
VANDALIA
4410
4411
4409
4407
4431
4432
4433
12120
12098
12096
12074
12072
12050
12048
12026
12024
12022
12020
12018
12016
12014
12012
12010
12008
12006
12004
12002
12000
11998
11996
11994
11992
11990
11988
11986
11984
11982
11980
11978
11976
11974
11972
11970
11968
11966
11964
11962
11960
11958
11956
11954
11952
11950
11948

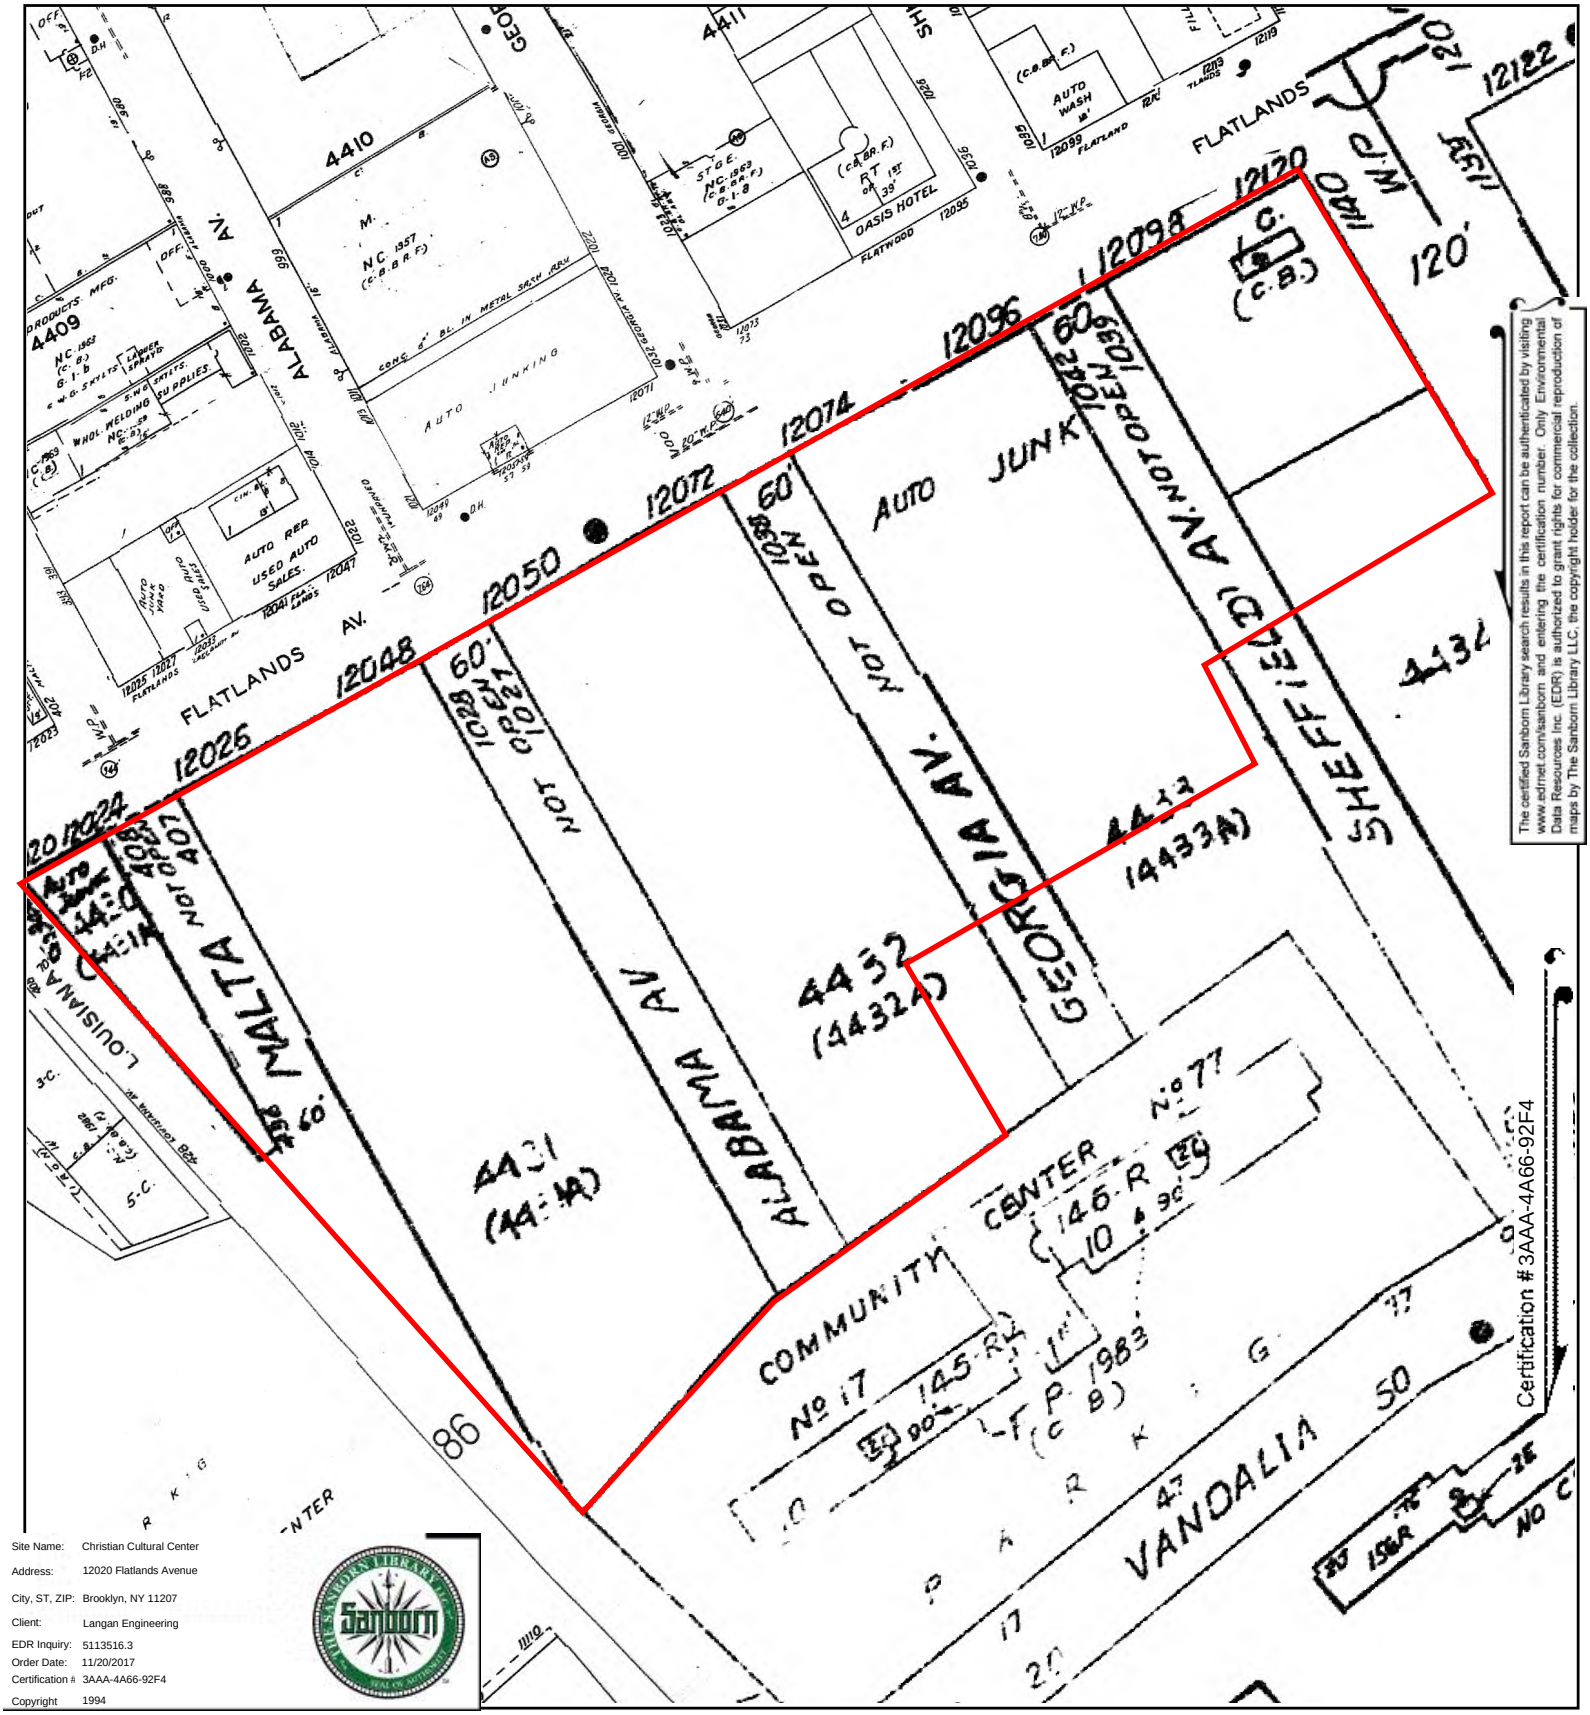



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1994

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

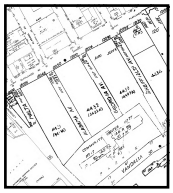

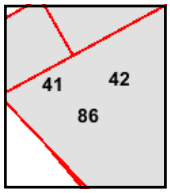

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

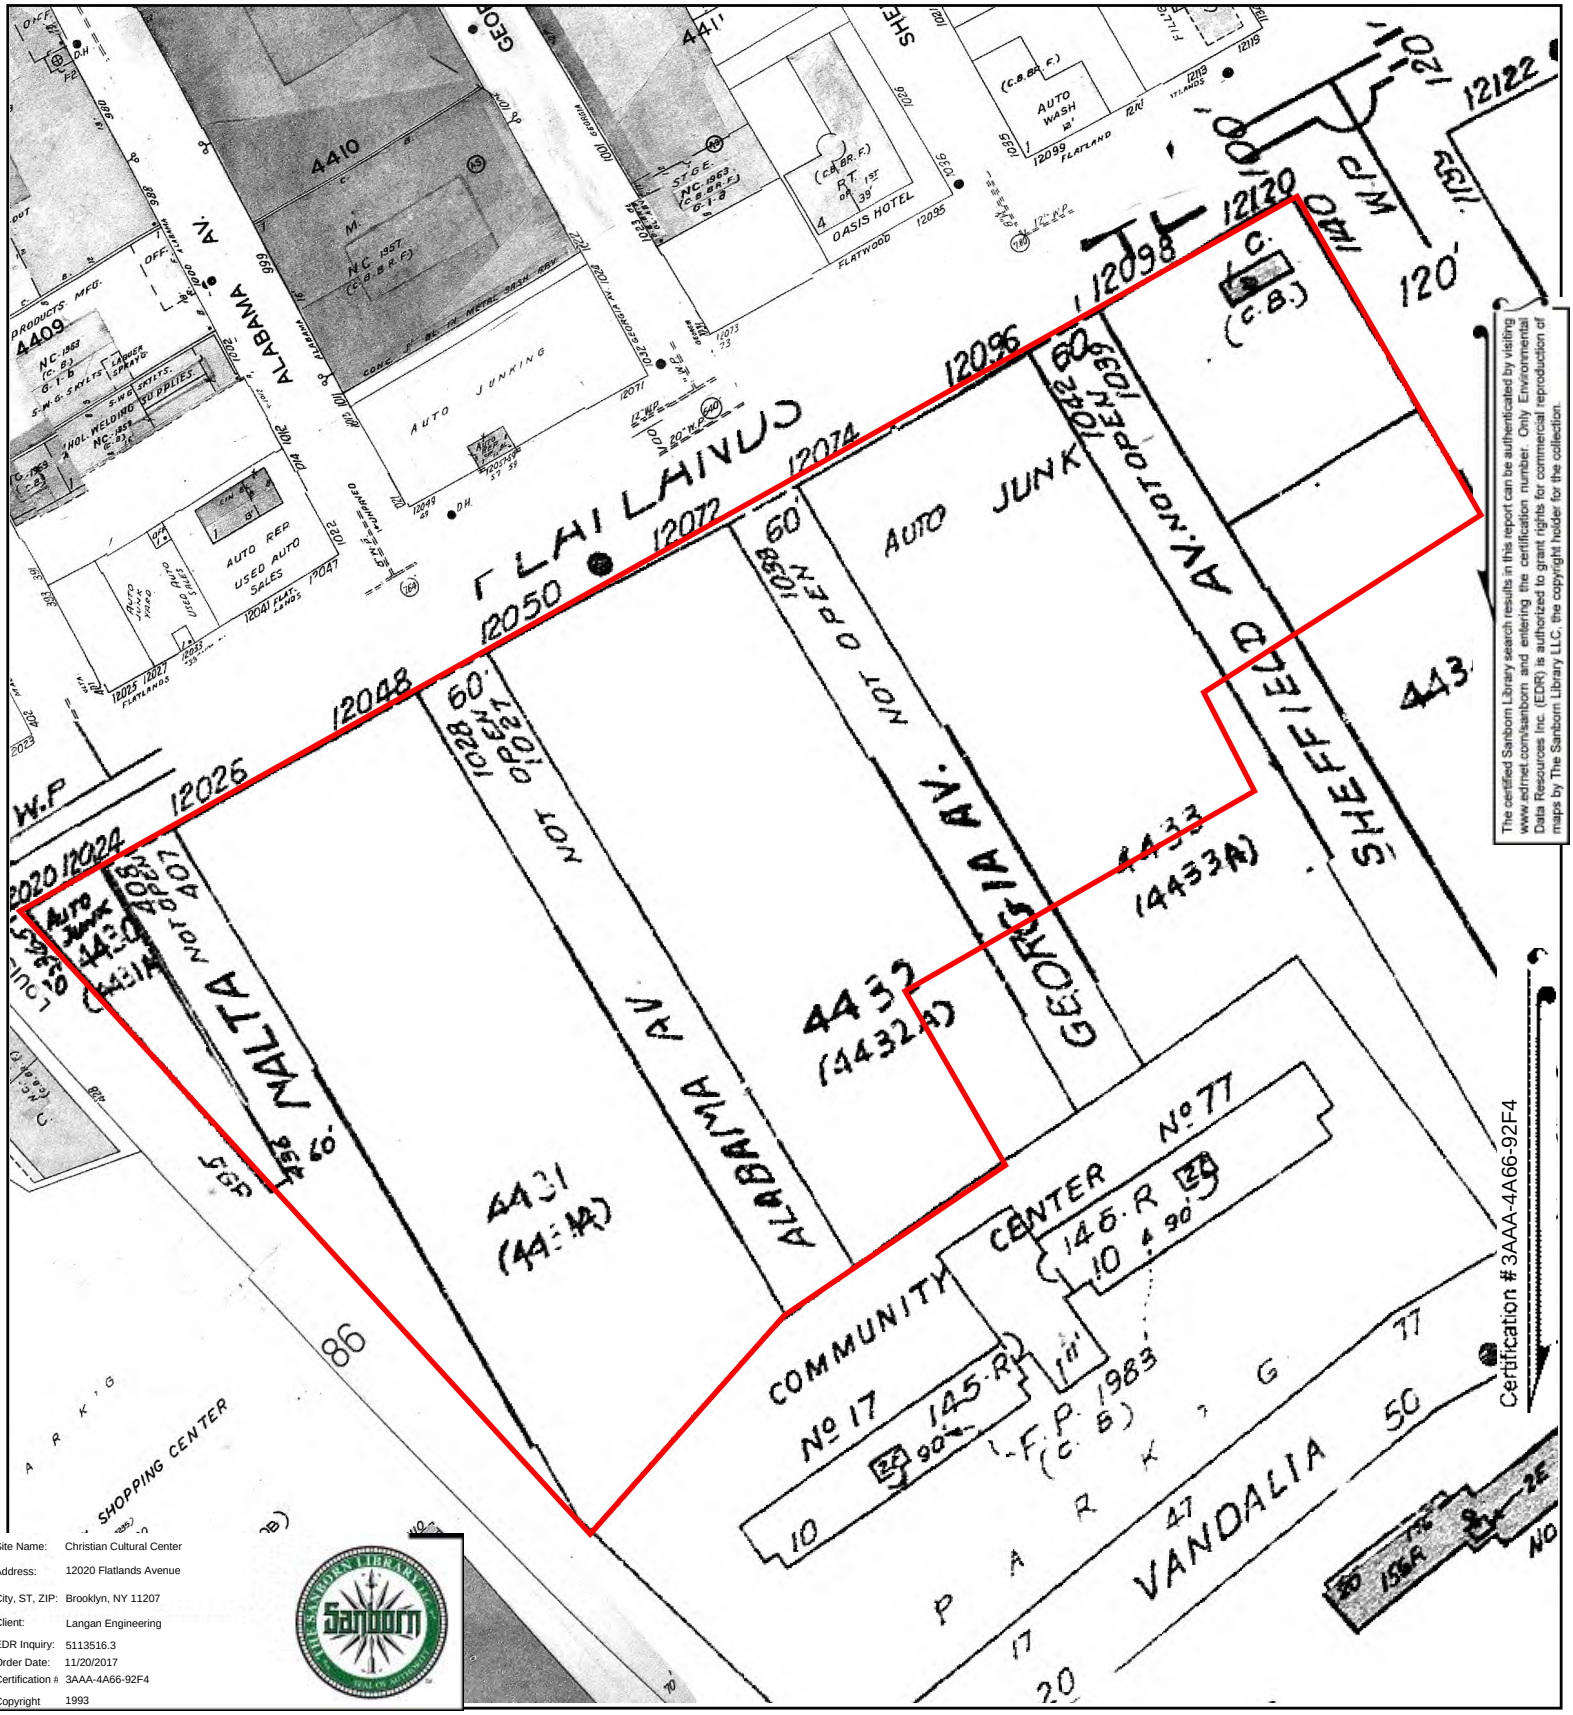


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #3AAA-4A66-92F4

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1993

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

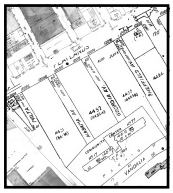

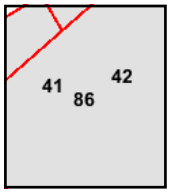

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

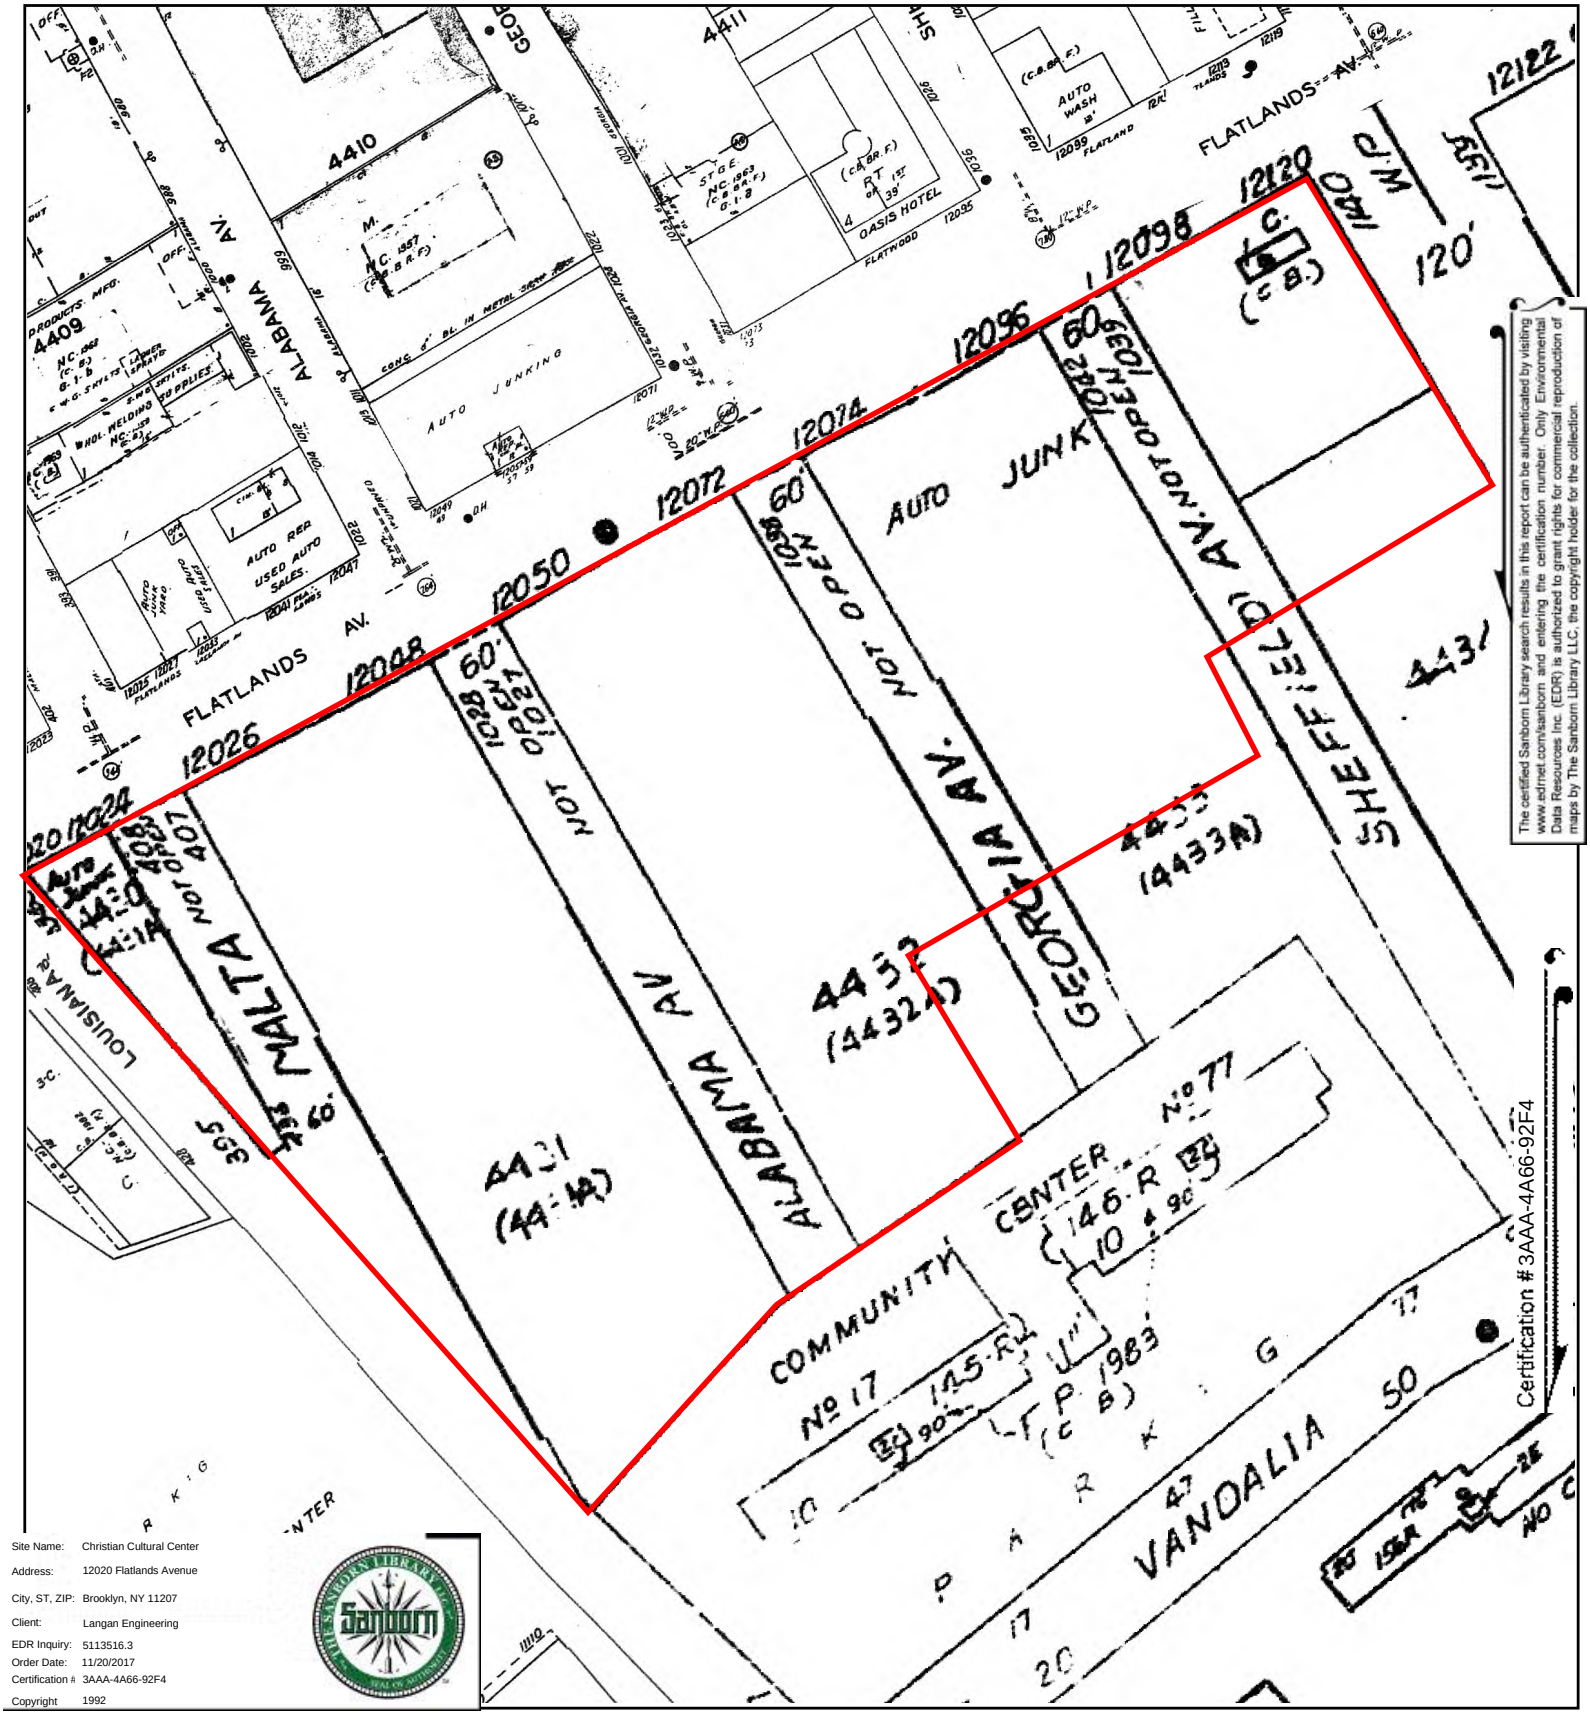


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification #3AAA-4A66-92F4

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1992

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

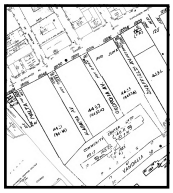

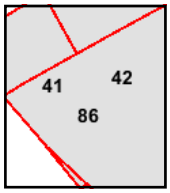

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

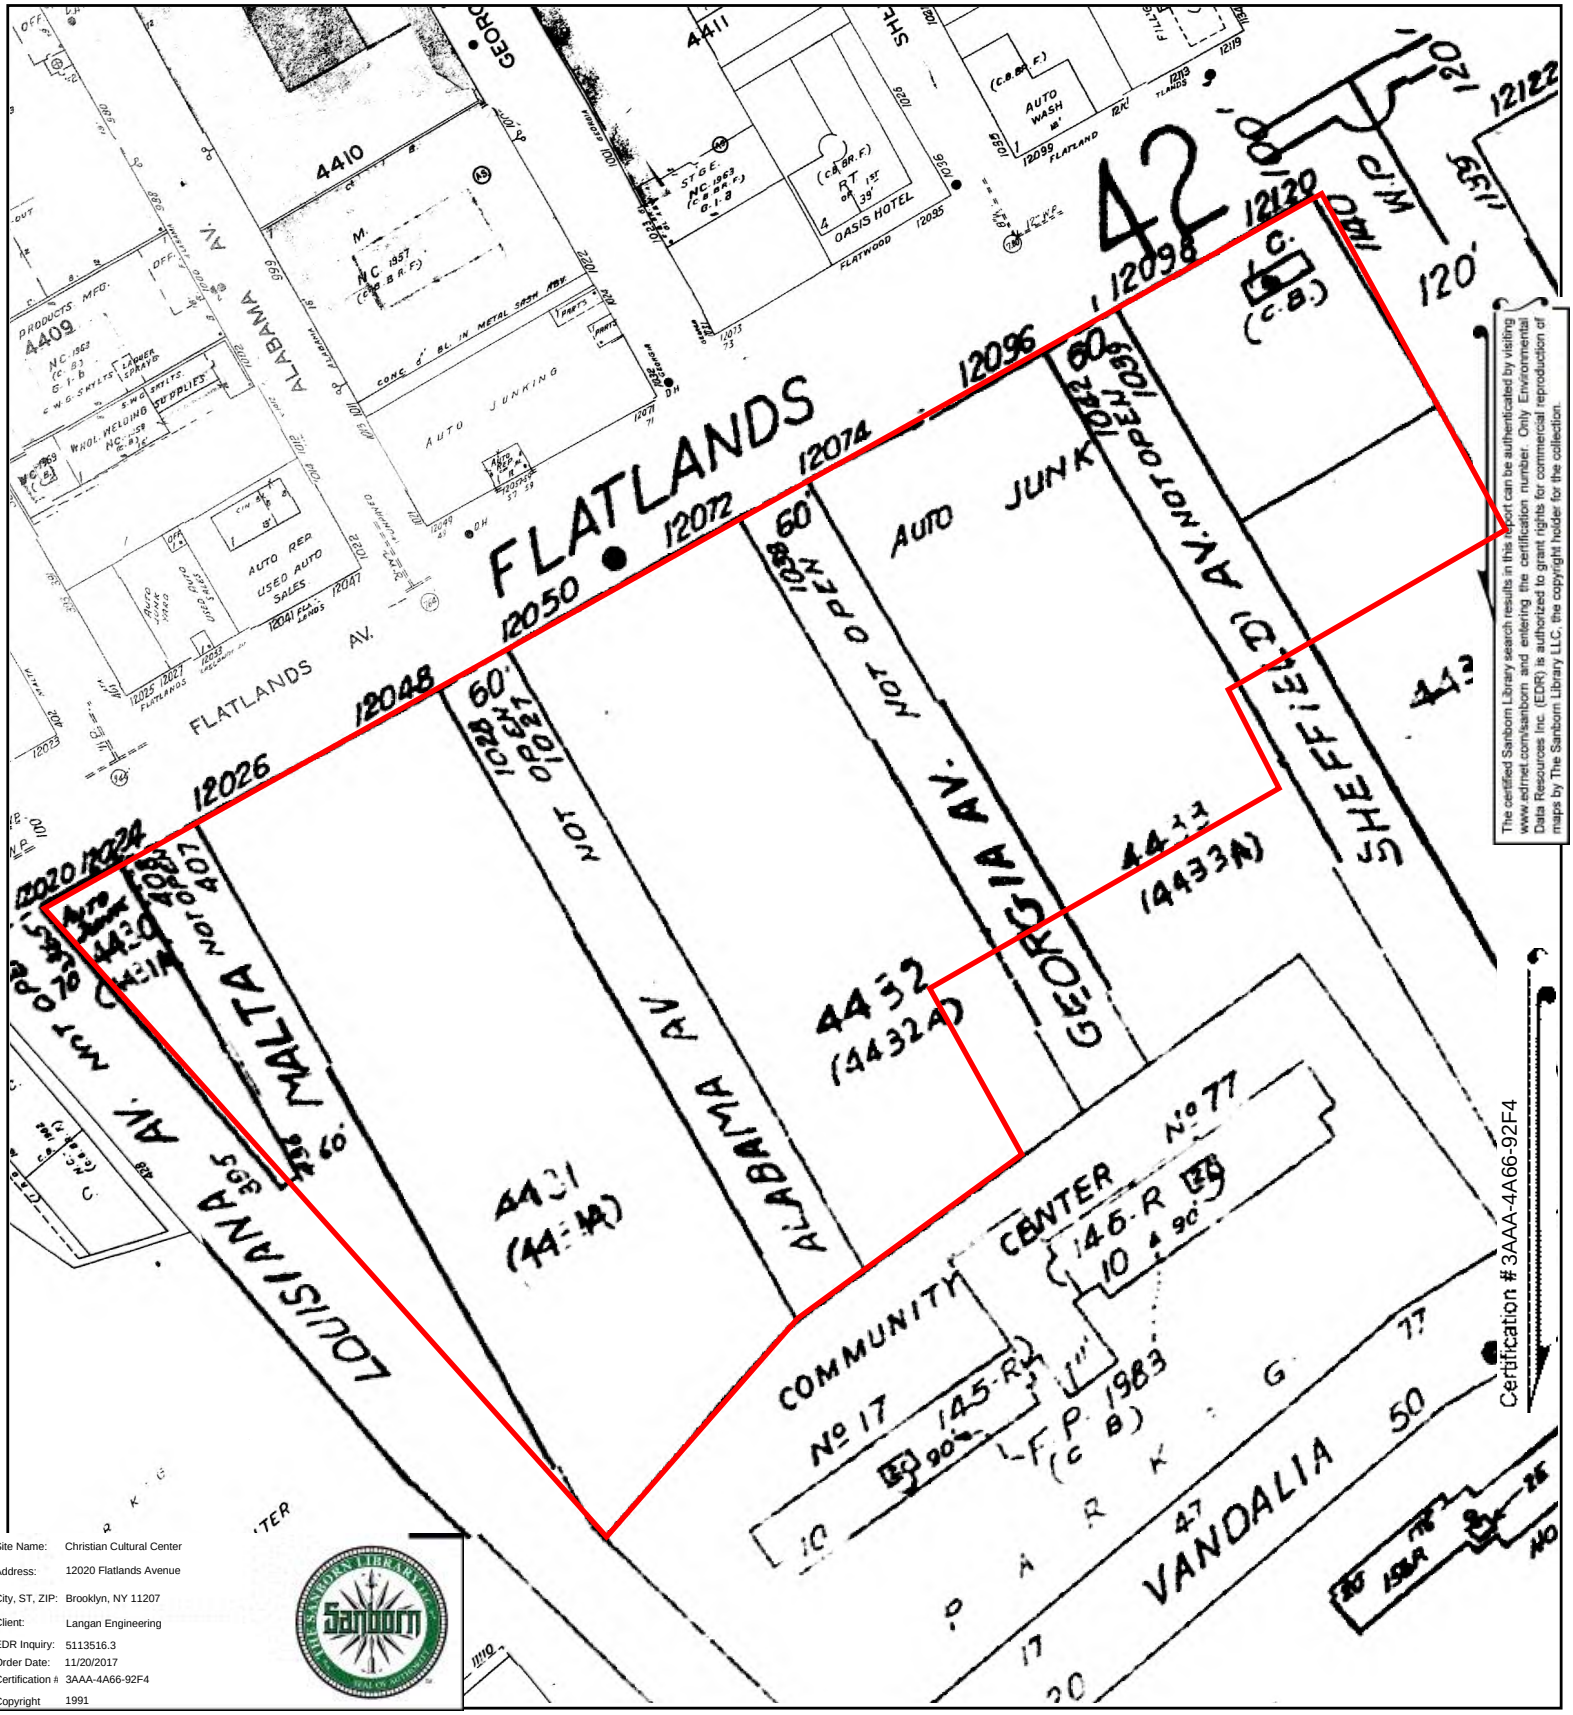



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1991

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

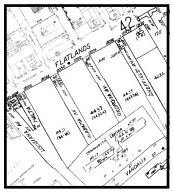


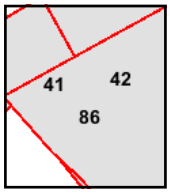

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

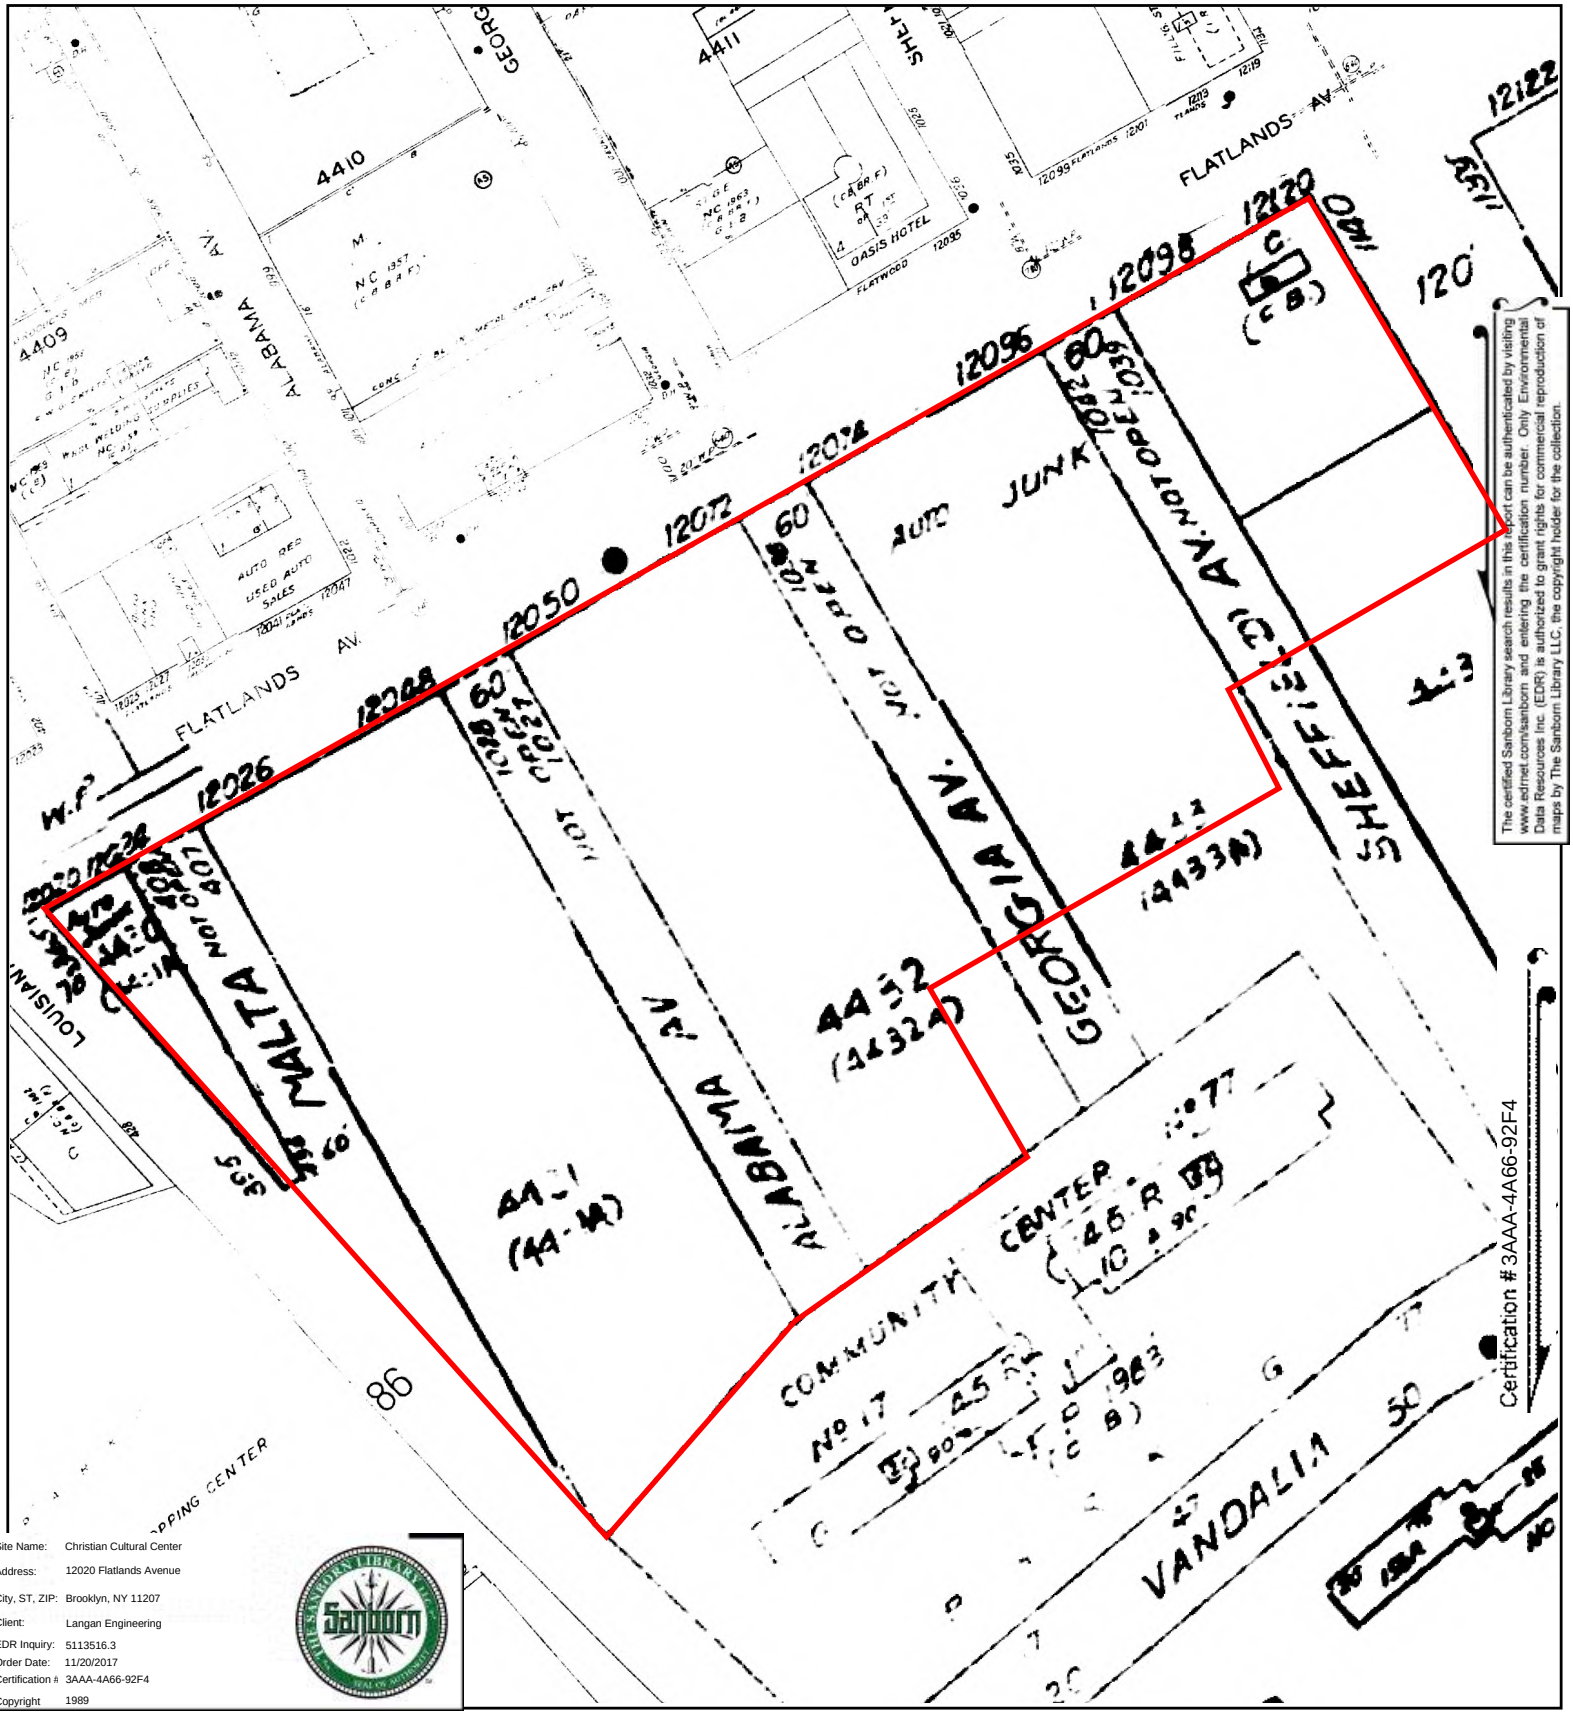
FLATLANDS AV.
ALABAMA AV.
GEORGIA AV.
SHEFFIELD AV.
MALTA AV.
VANDALIA
COMMUNITY CENTER
AUTO JUNK
AUTO REC
USED AUTO SALES
OASIS HOTEL
12098
12096
12074
12072
12050
12048
12026
12020
12030
12120
12122
4410
4409
4411
4432
(44324)
4433
(44334)
4411
(44-14)
4577
4503
4503
4503

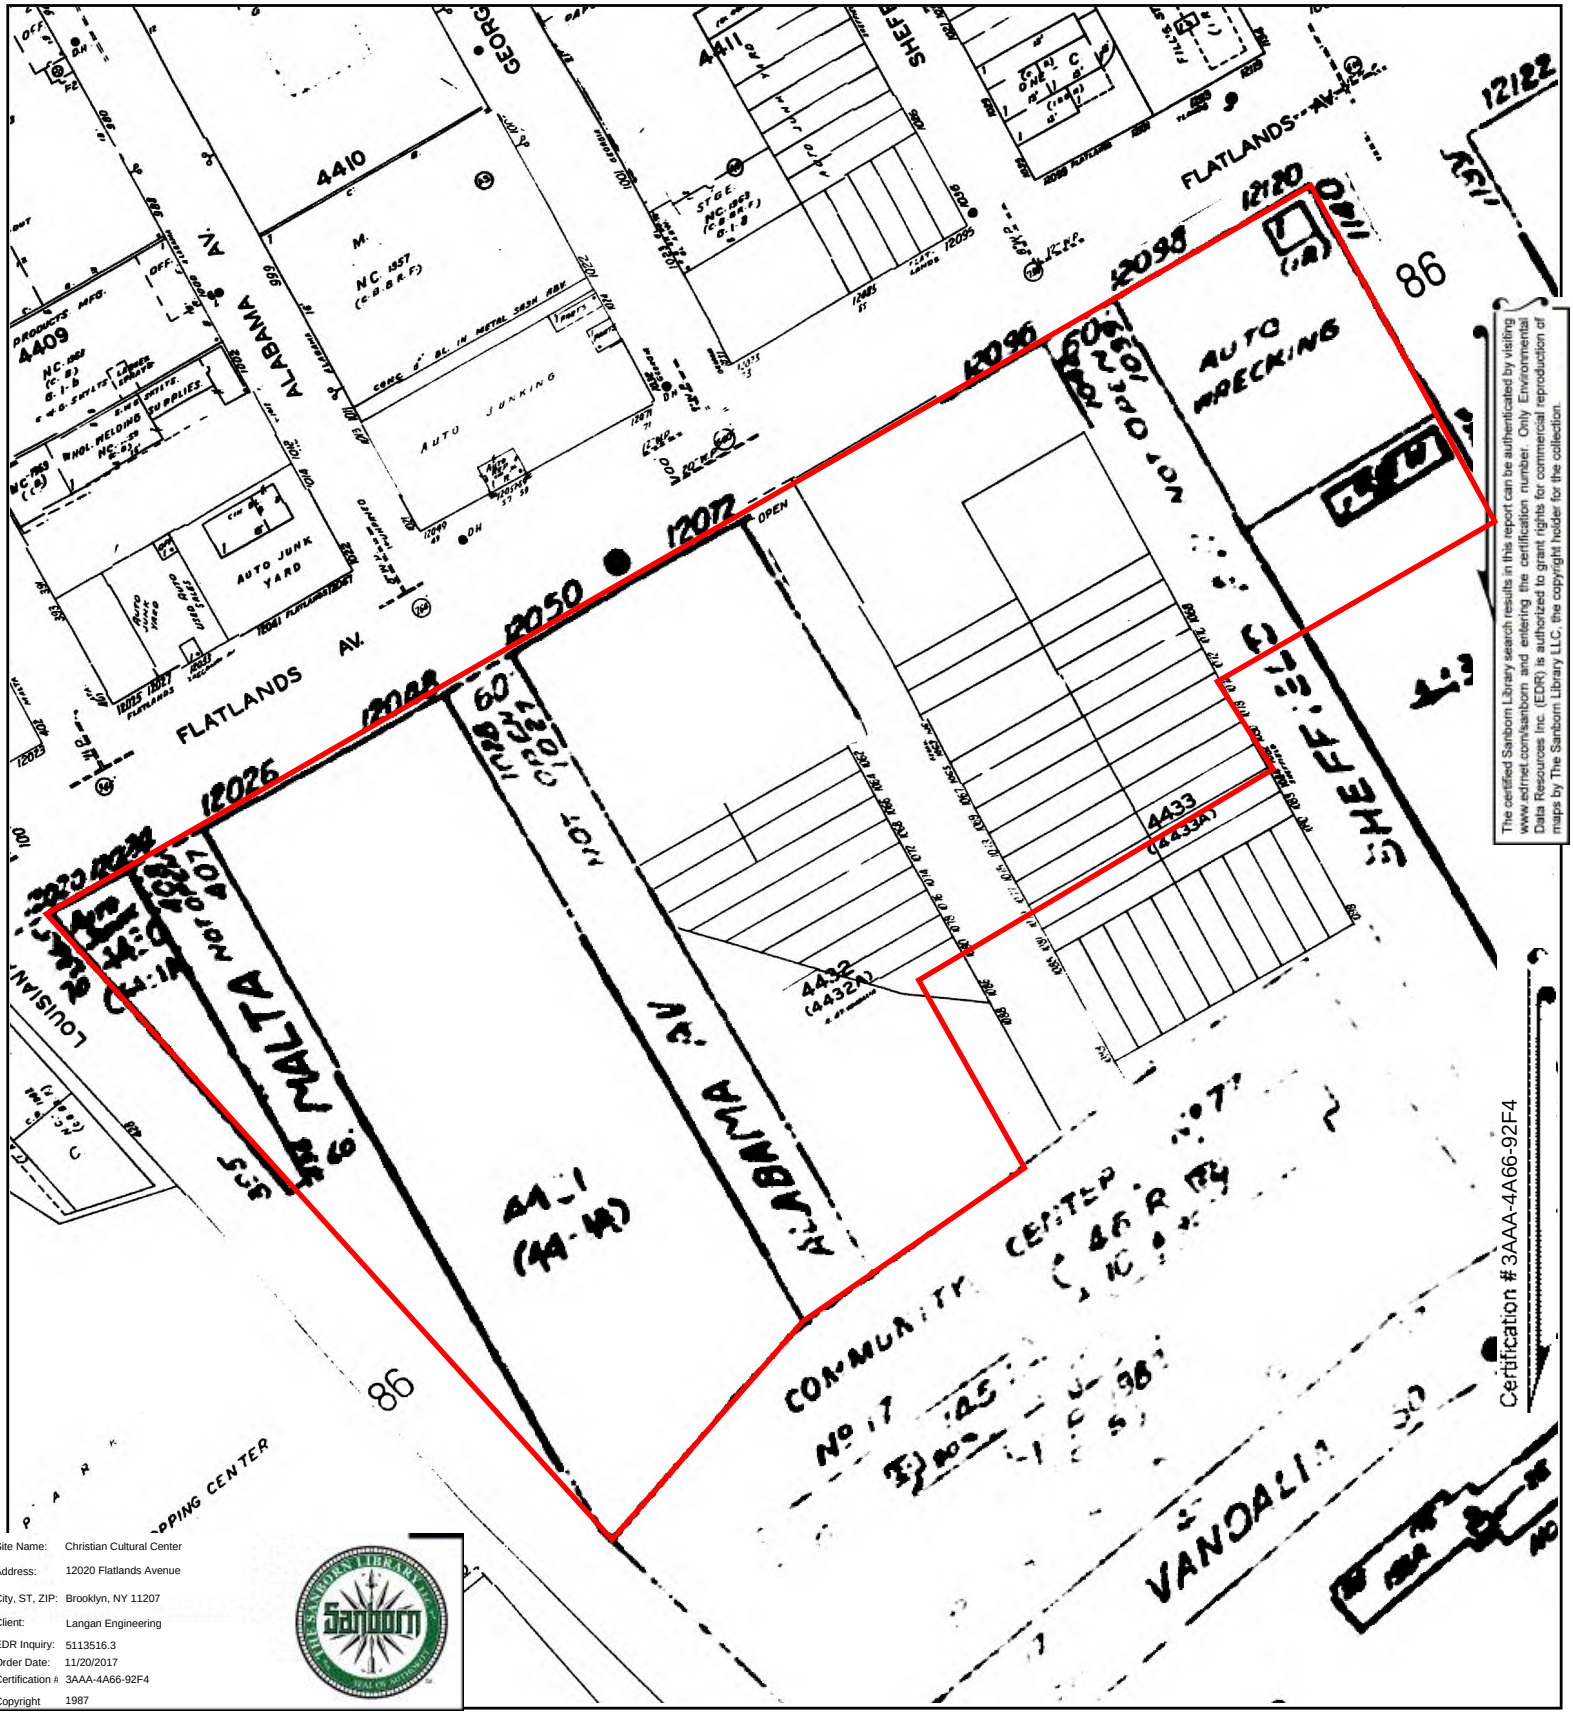



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1987

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

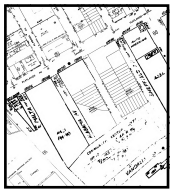

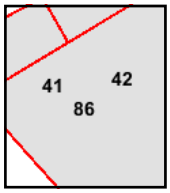

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

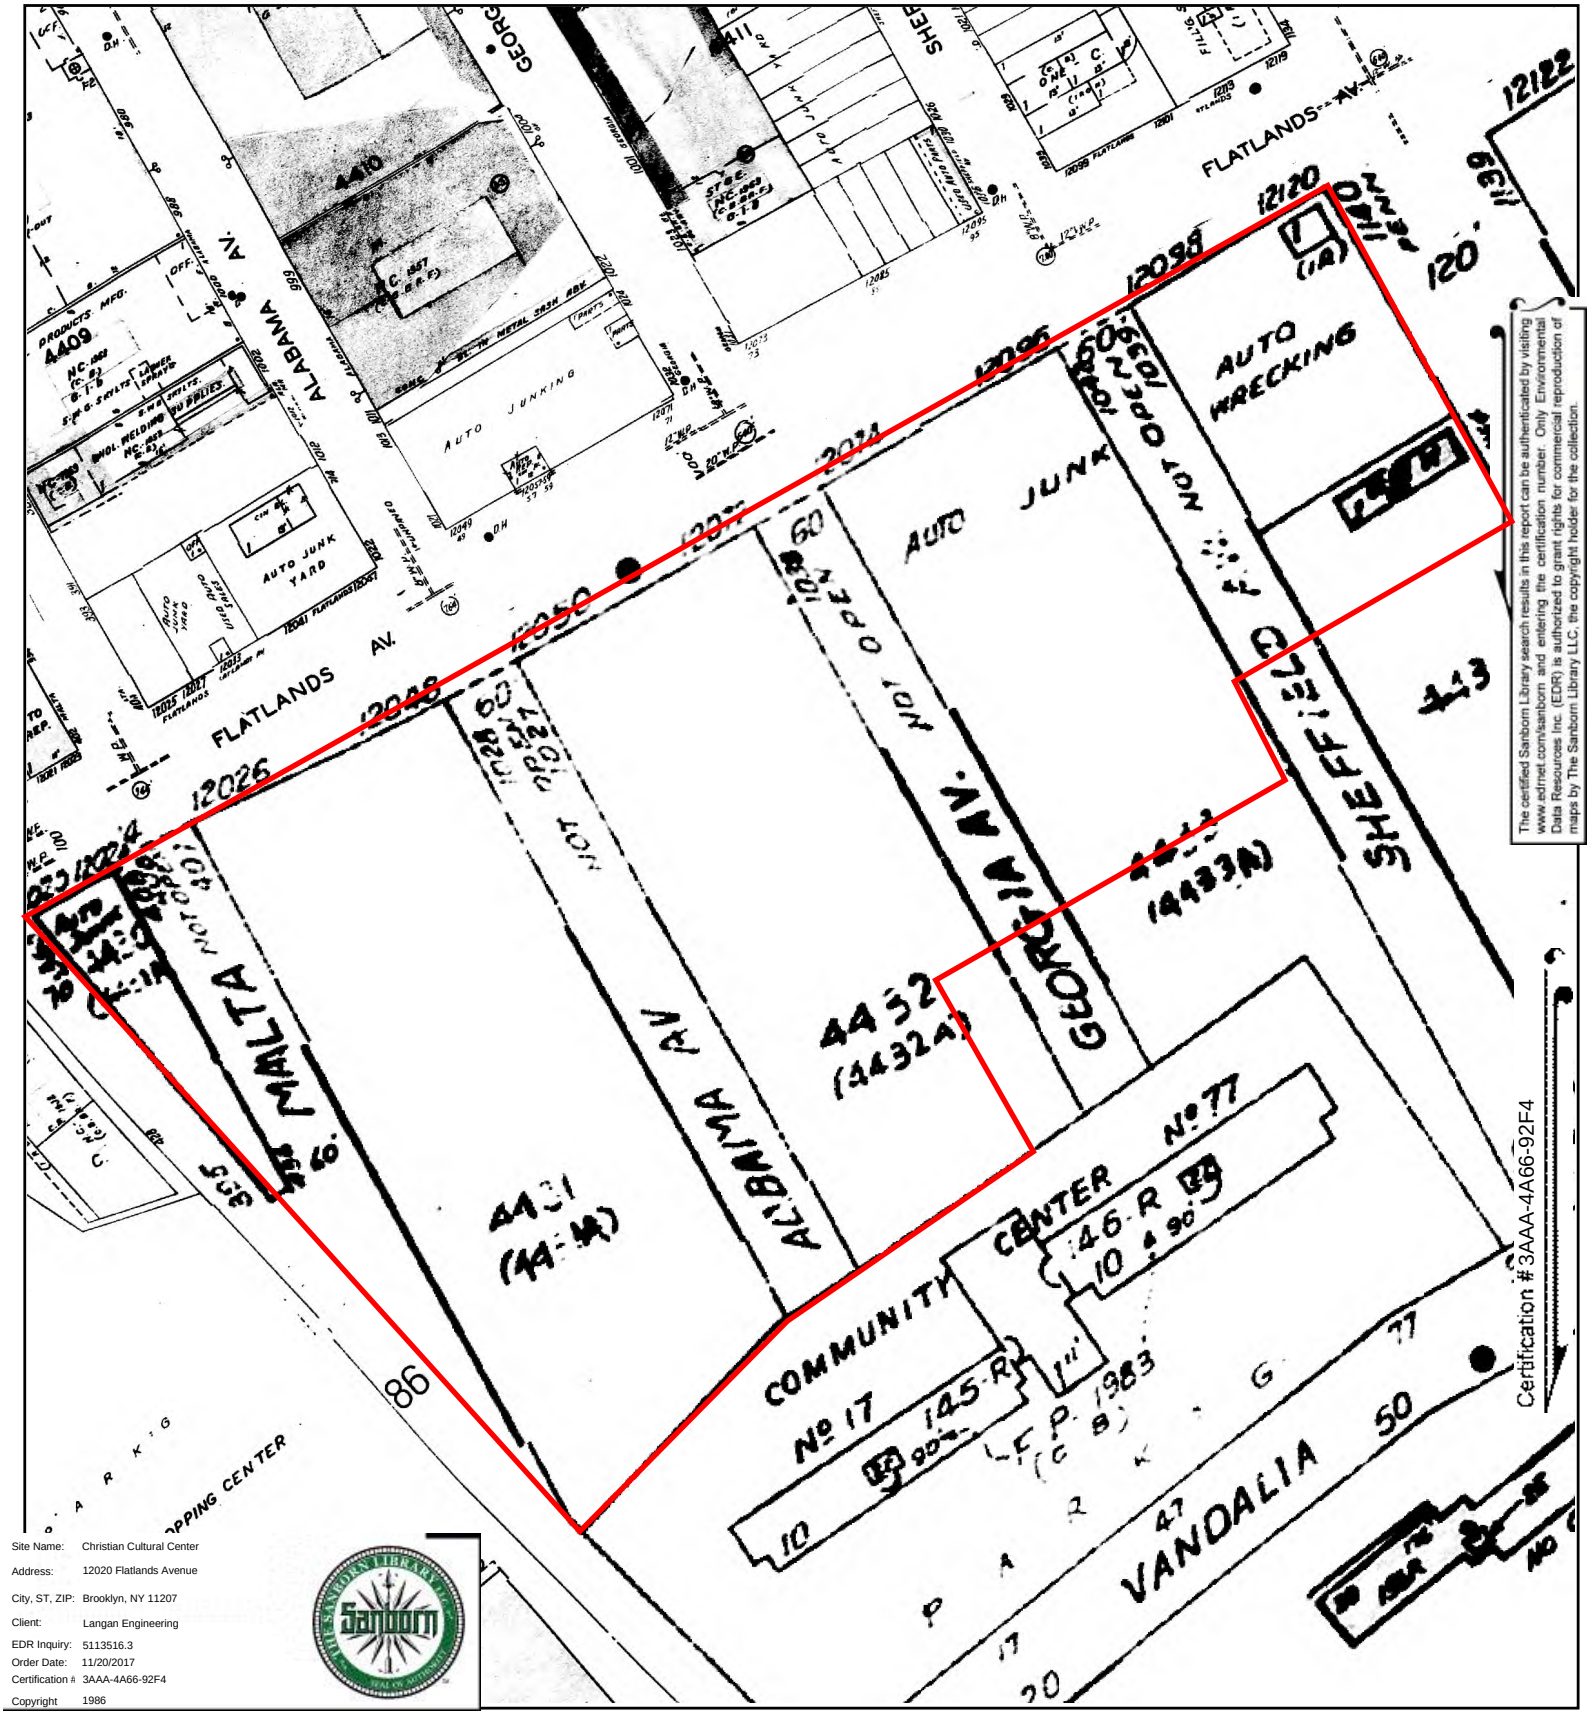



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #	3AAA-4A66-92F4
Copyright	1986

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

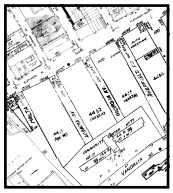


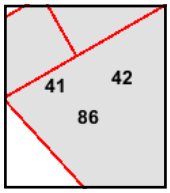


Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

N

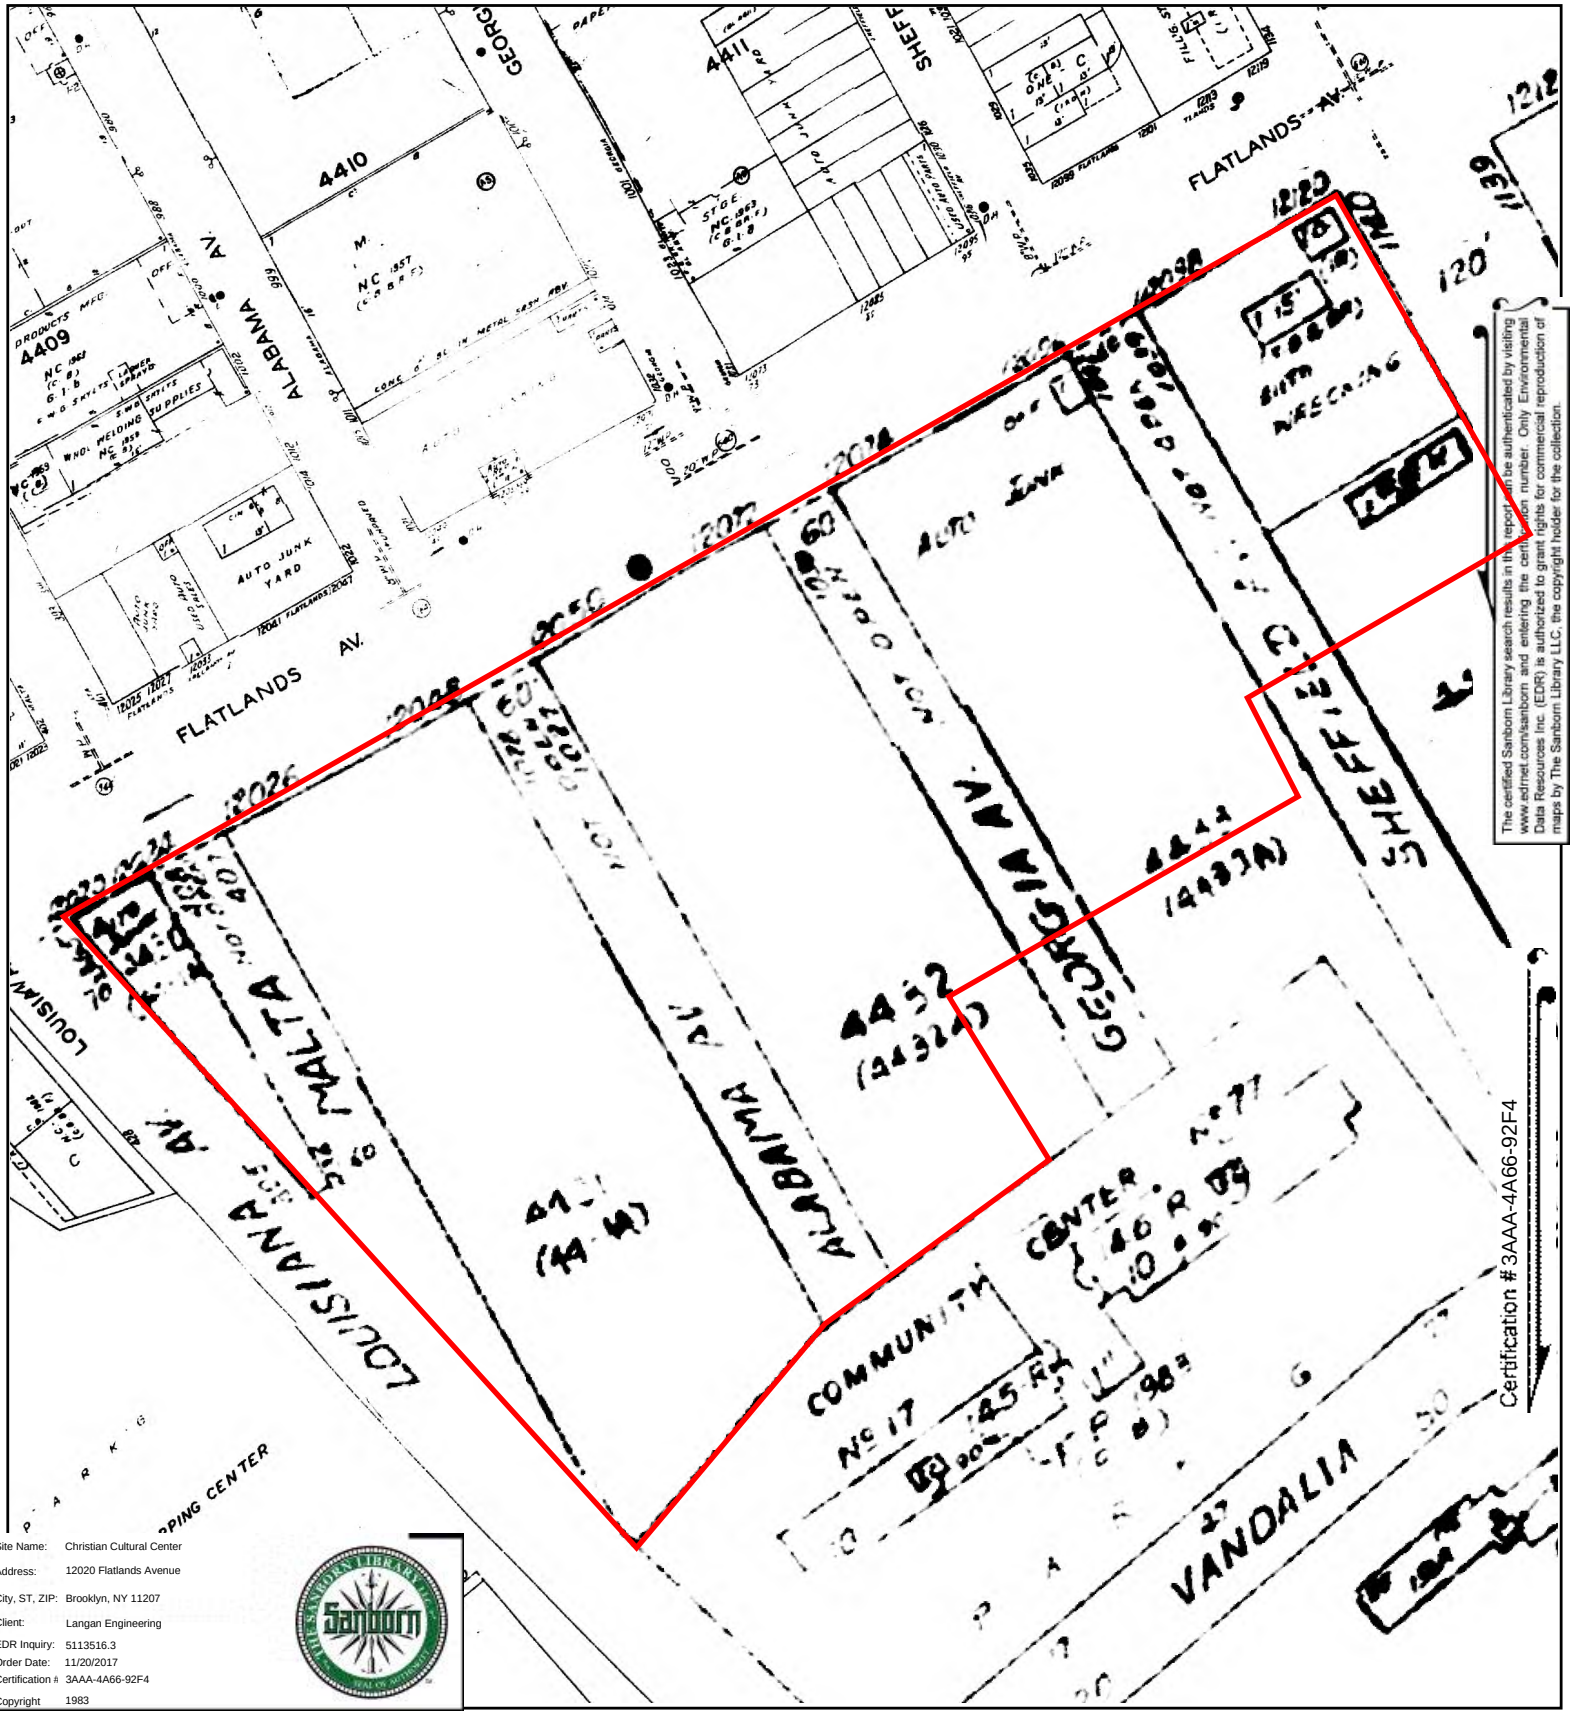
FLATLANDS AV.
ALABAMA AV
LOUISIANA AV
GEORGIA AV
SHEFFIELD AV
4410
4409
4411
4432
4433
4434
AUTO JUNK YARD
COMMUNITY CENTER
VANDALIA
FLATLANDS
12020
12026
12032
12038
12044
12050
12056
12062
12068
12074
12080
12086
12092
12098
12104
12110
12116
12122
12128
12134
12140
12146
12152
12158
12164
12170
12176
12182
12188
12194
12200
12206
12212
12218
12224
12230
12236
12242
12248
12254

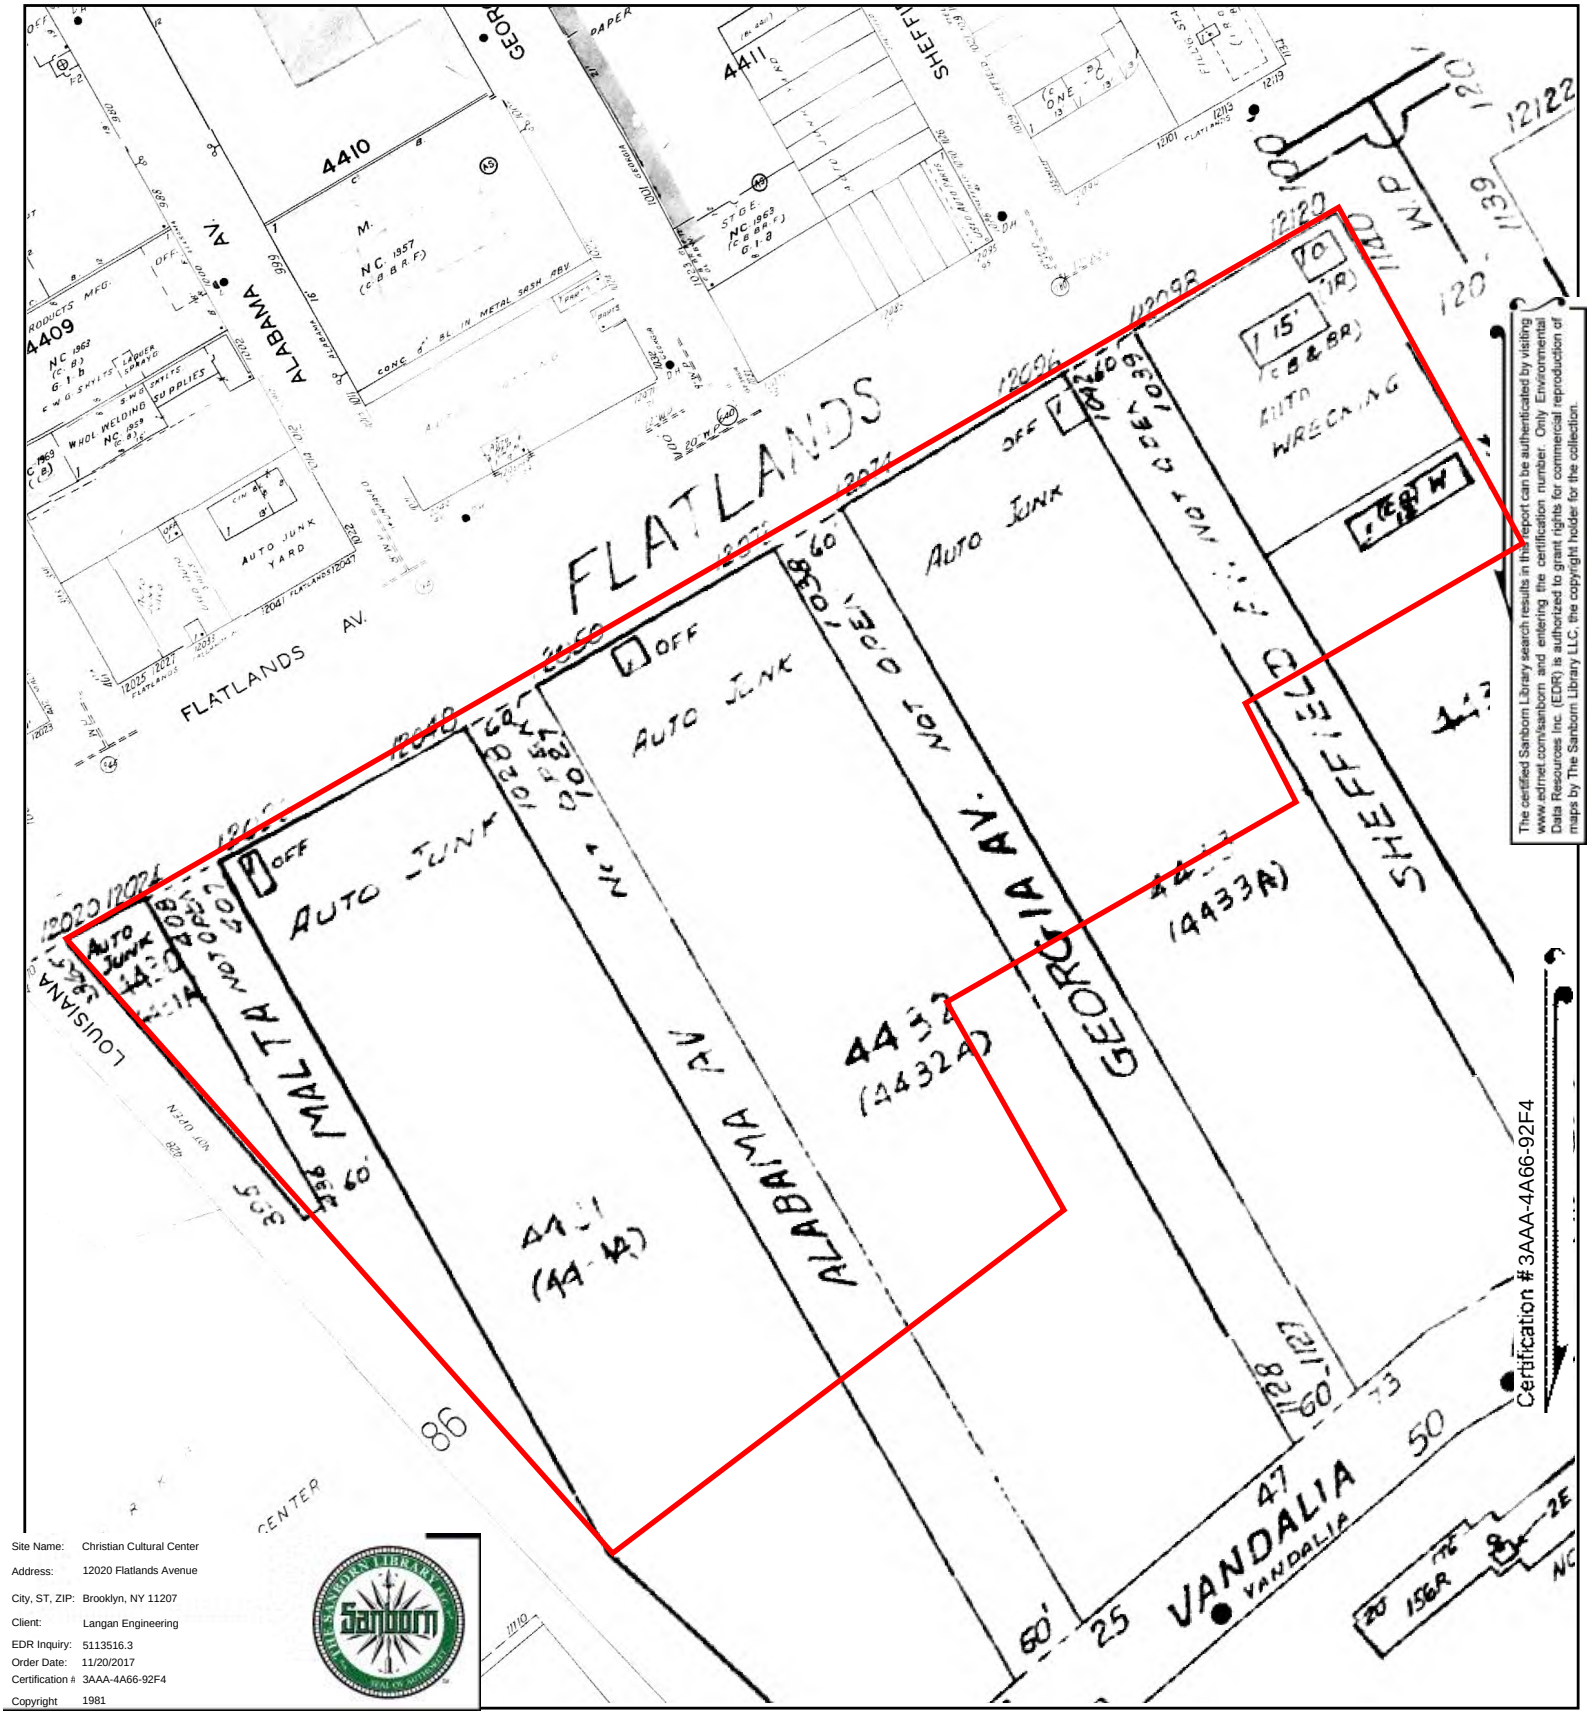

FLATLANDS
FLATLANDS AV.
ALABAMA AV.
GEORGIA AV.
SHEFFIELD
MALTA
LOUISIANA
VANDALIA
AUTO JUNK
AUTO JUNK YARD
AUTO WRECKING
OFF
4410
4411
4409
12020
12022
12024
12025
12027
12028
12029
12030
12032
12033
12034
12035
12036
12037
12038
12039
12040
12041
12042
12043
12044
12045
12046
12047
12048
12049
12050
12051
12052
12053
12054
12055
12056
12057
12058
12059
12060
12061
12062
12063
12064
12065
12066
12067
12068
12069
12070
12071

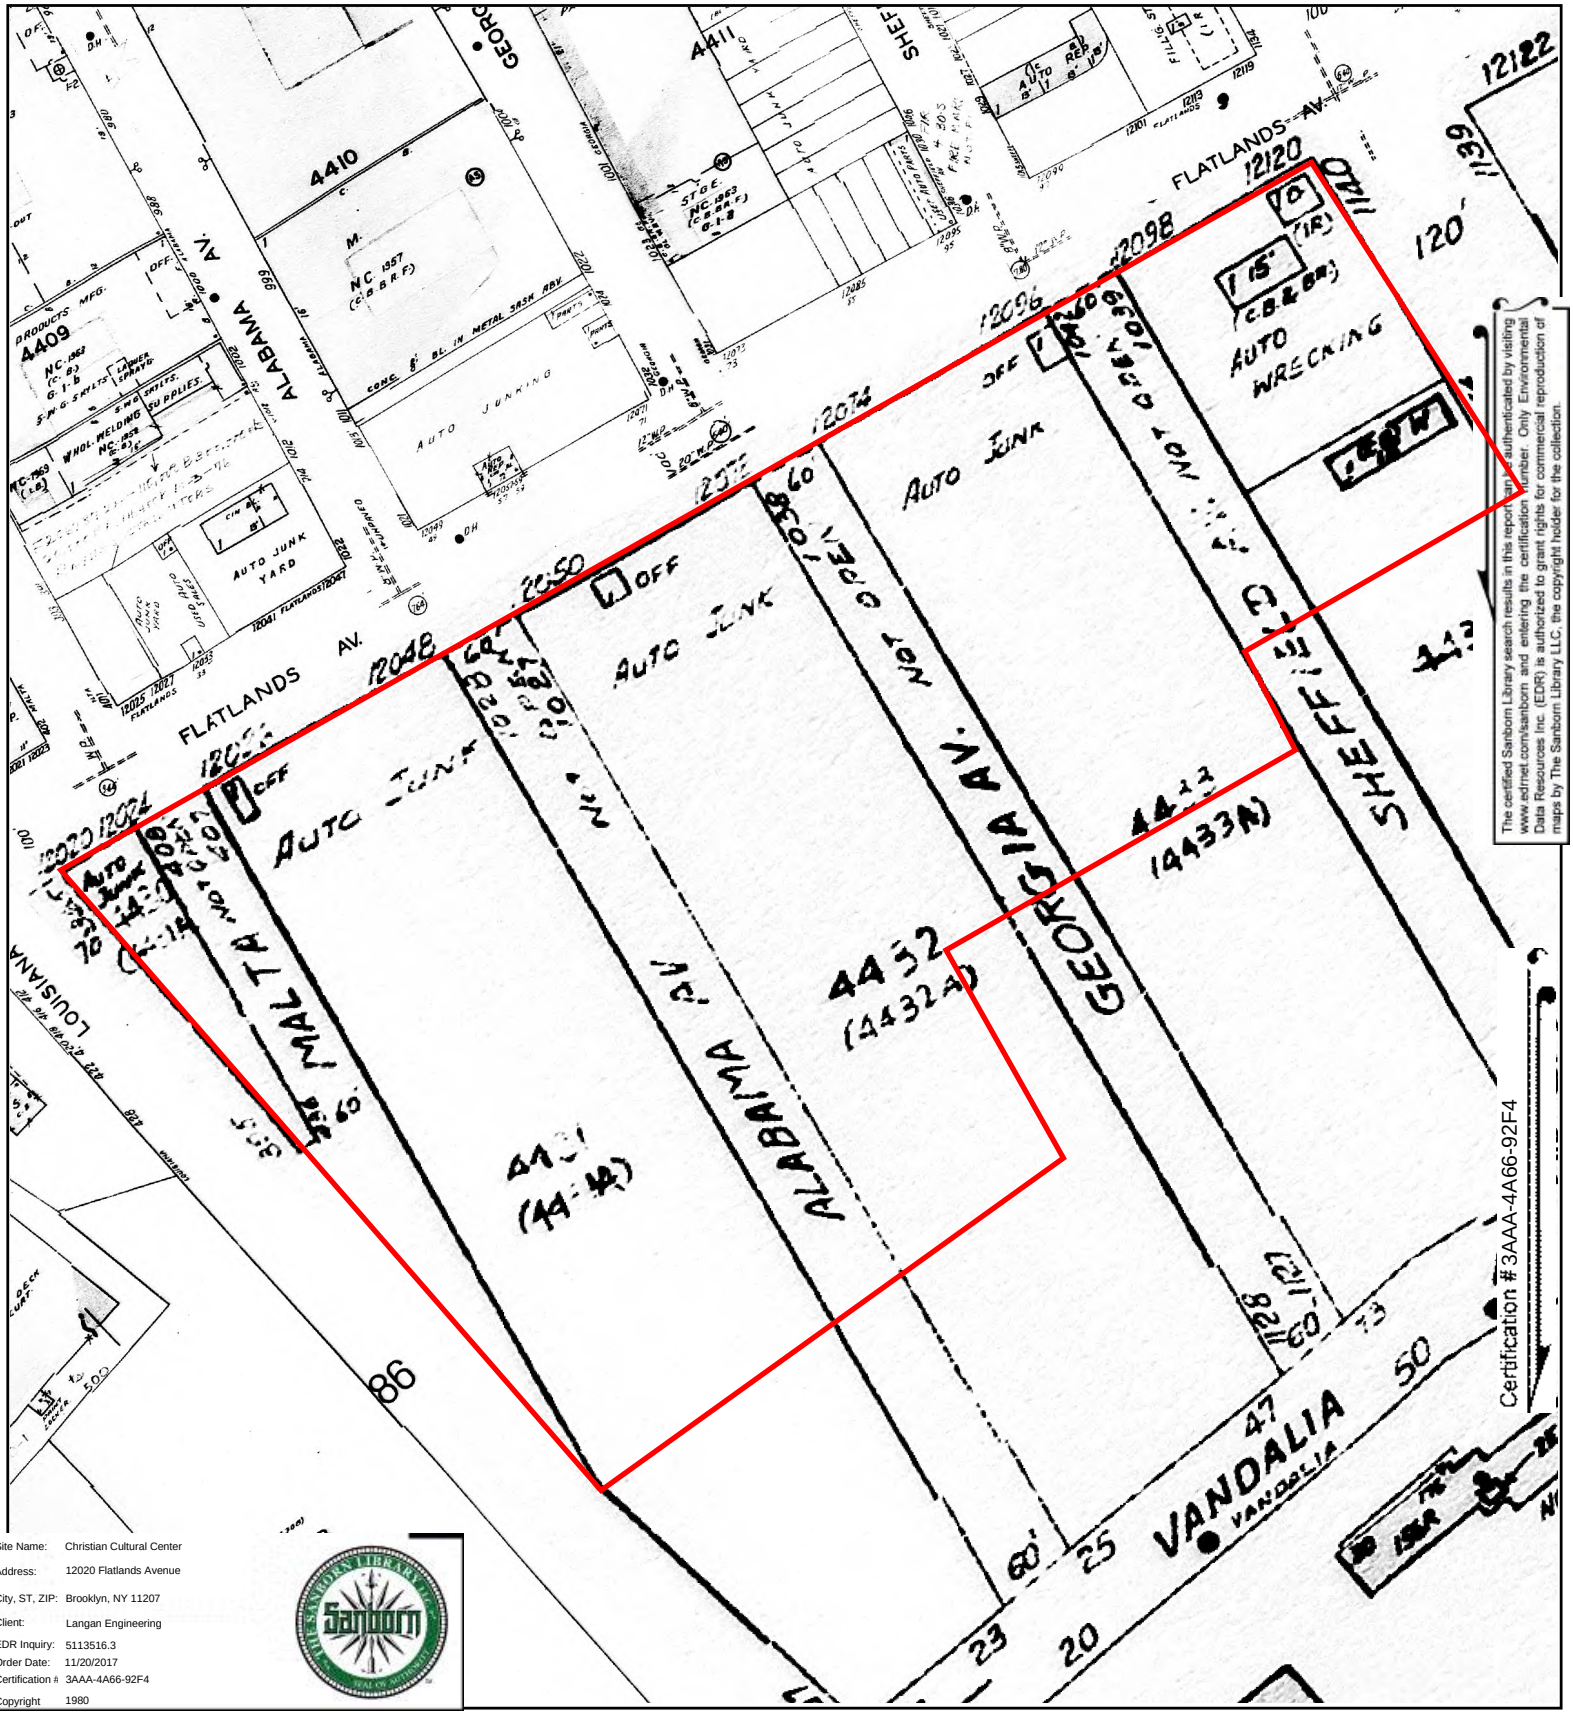


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1980


This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

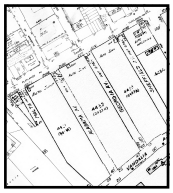

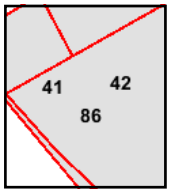

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

0 Feet 150 300 600

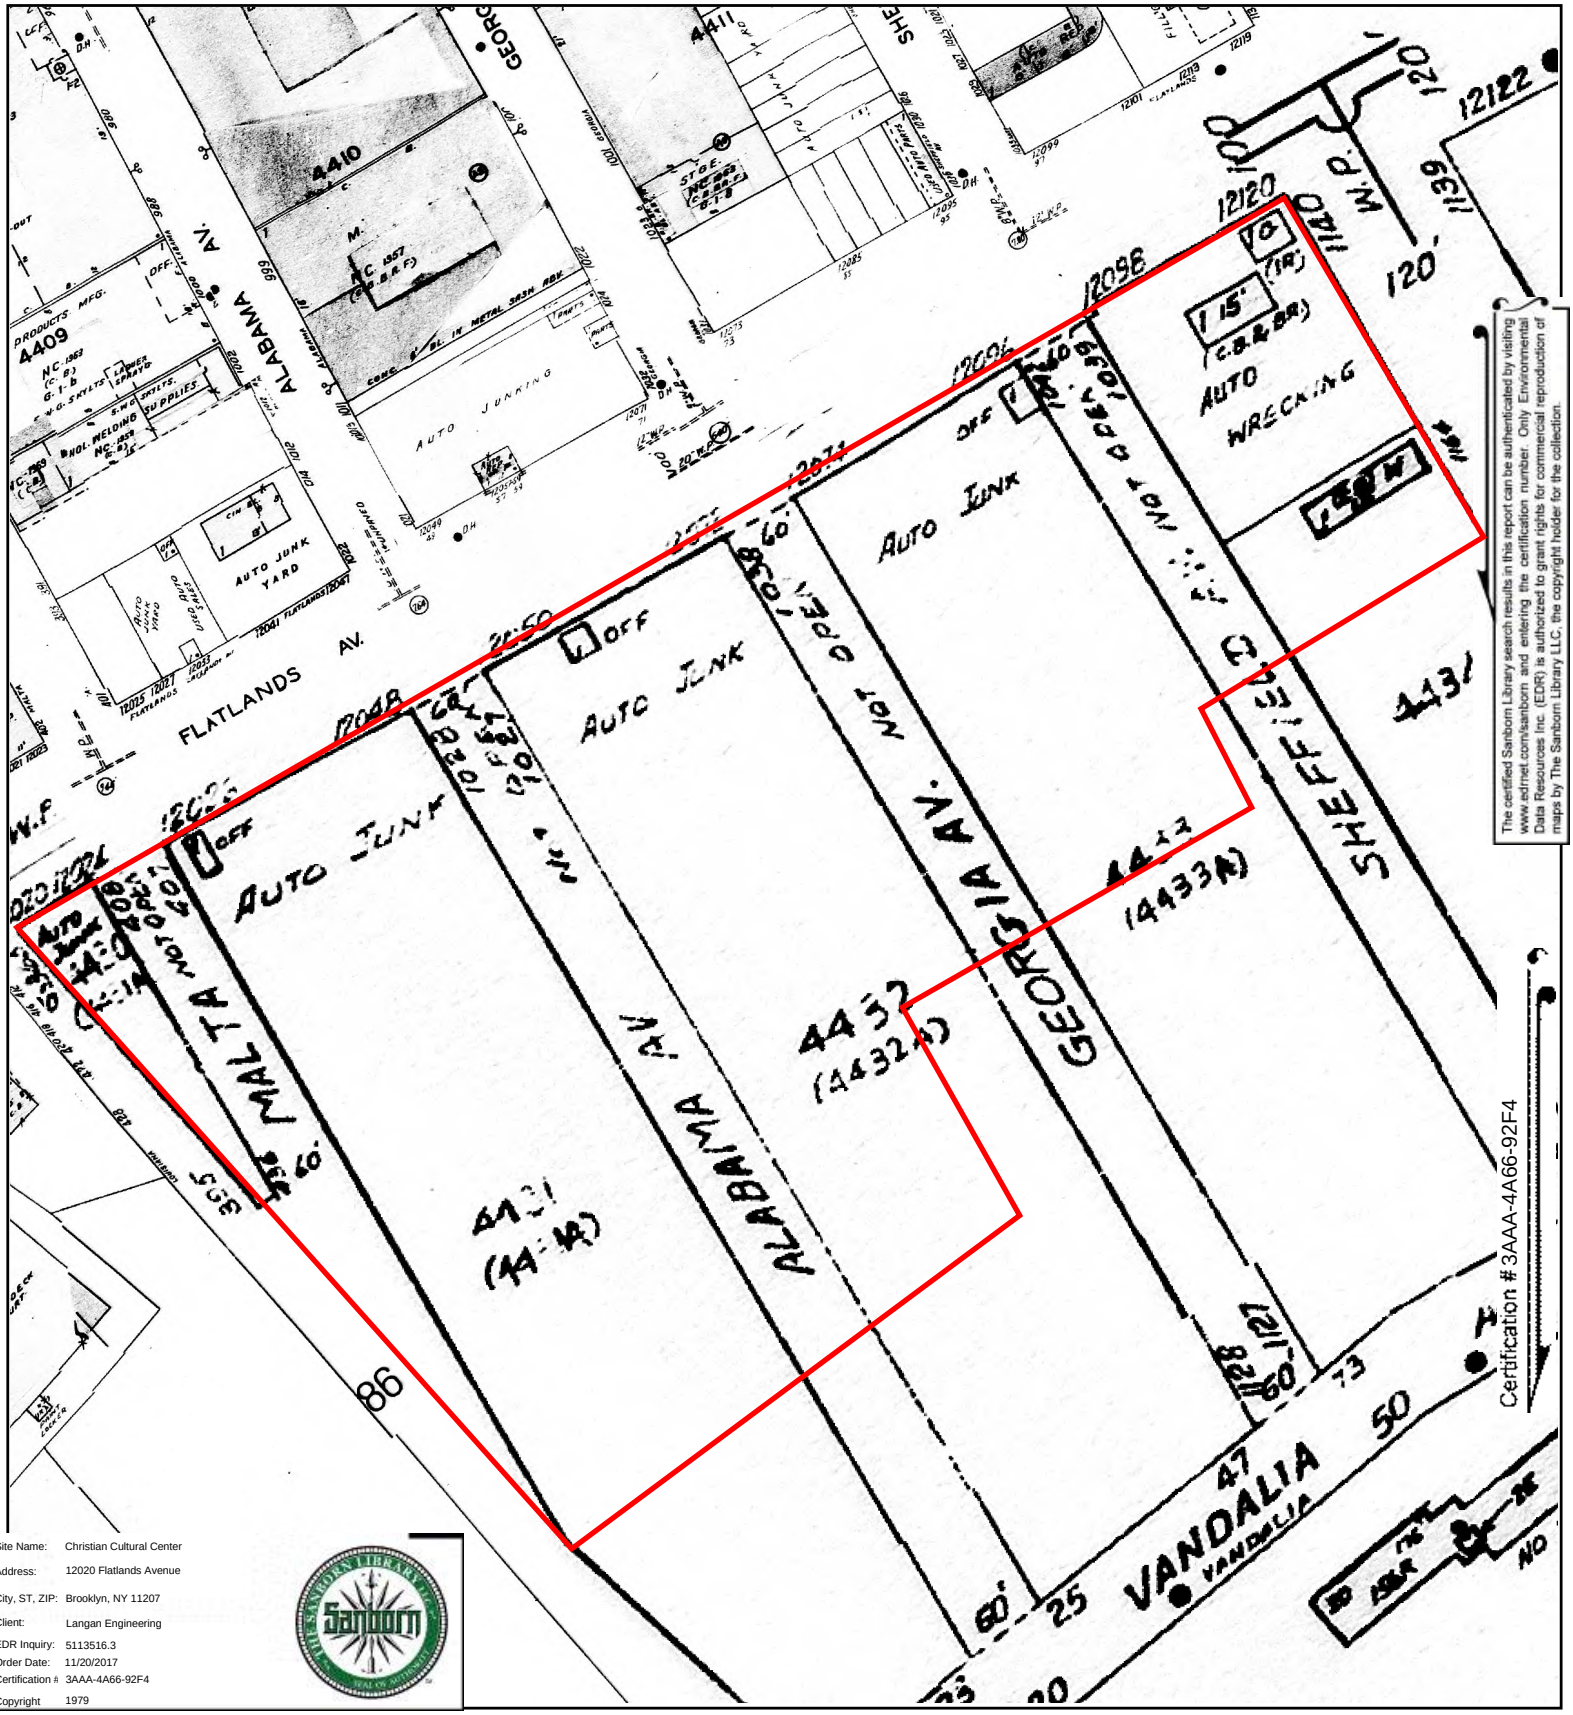



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #	3AAA-4A66-92F4
Copyright	1979


This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

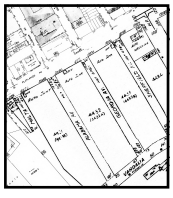

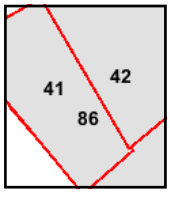

Volume 17, Sheet 42
Volume 17, Sheet 41
Volume 17, Sheet 86

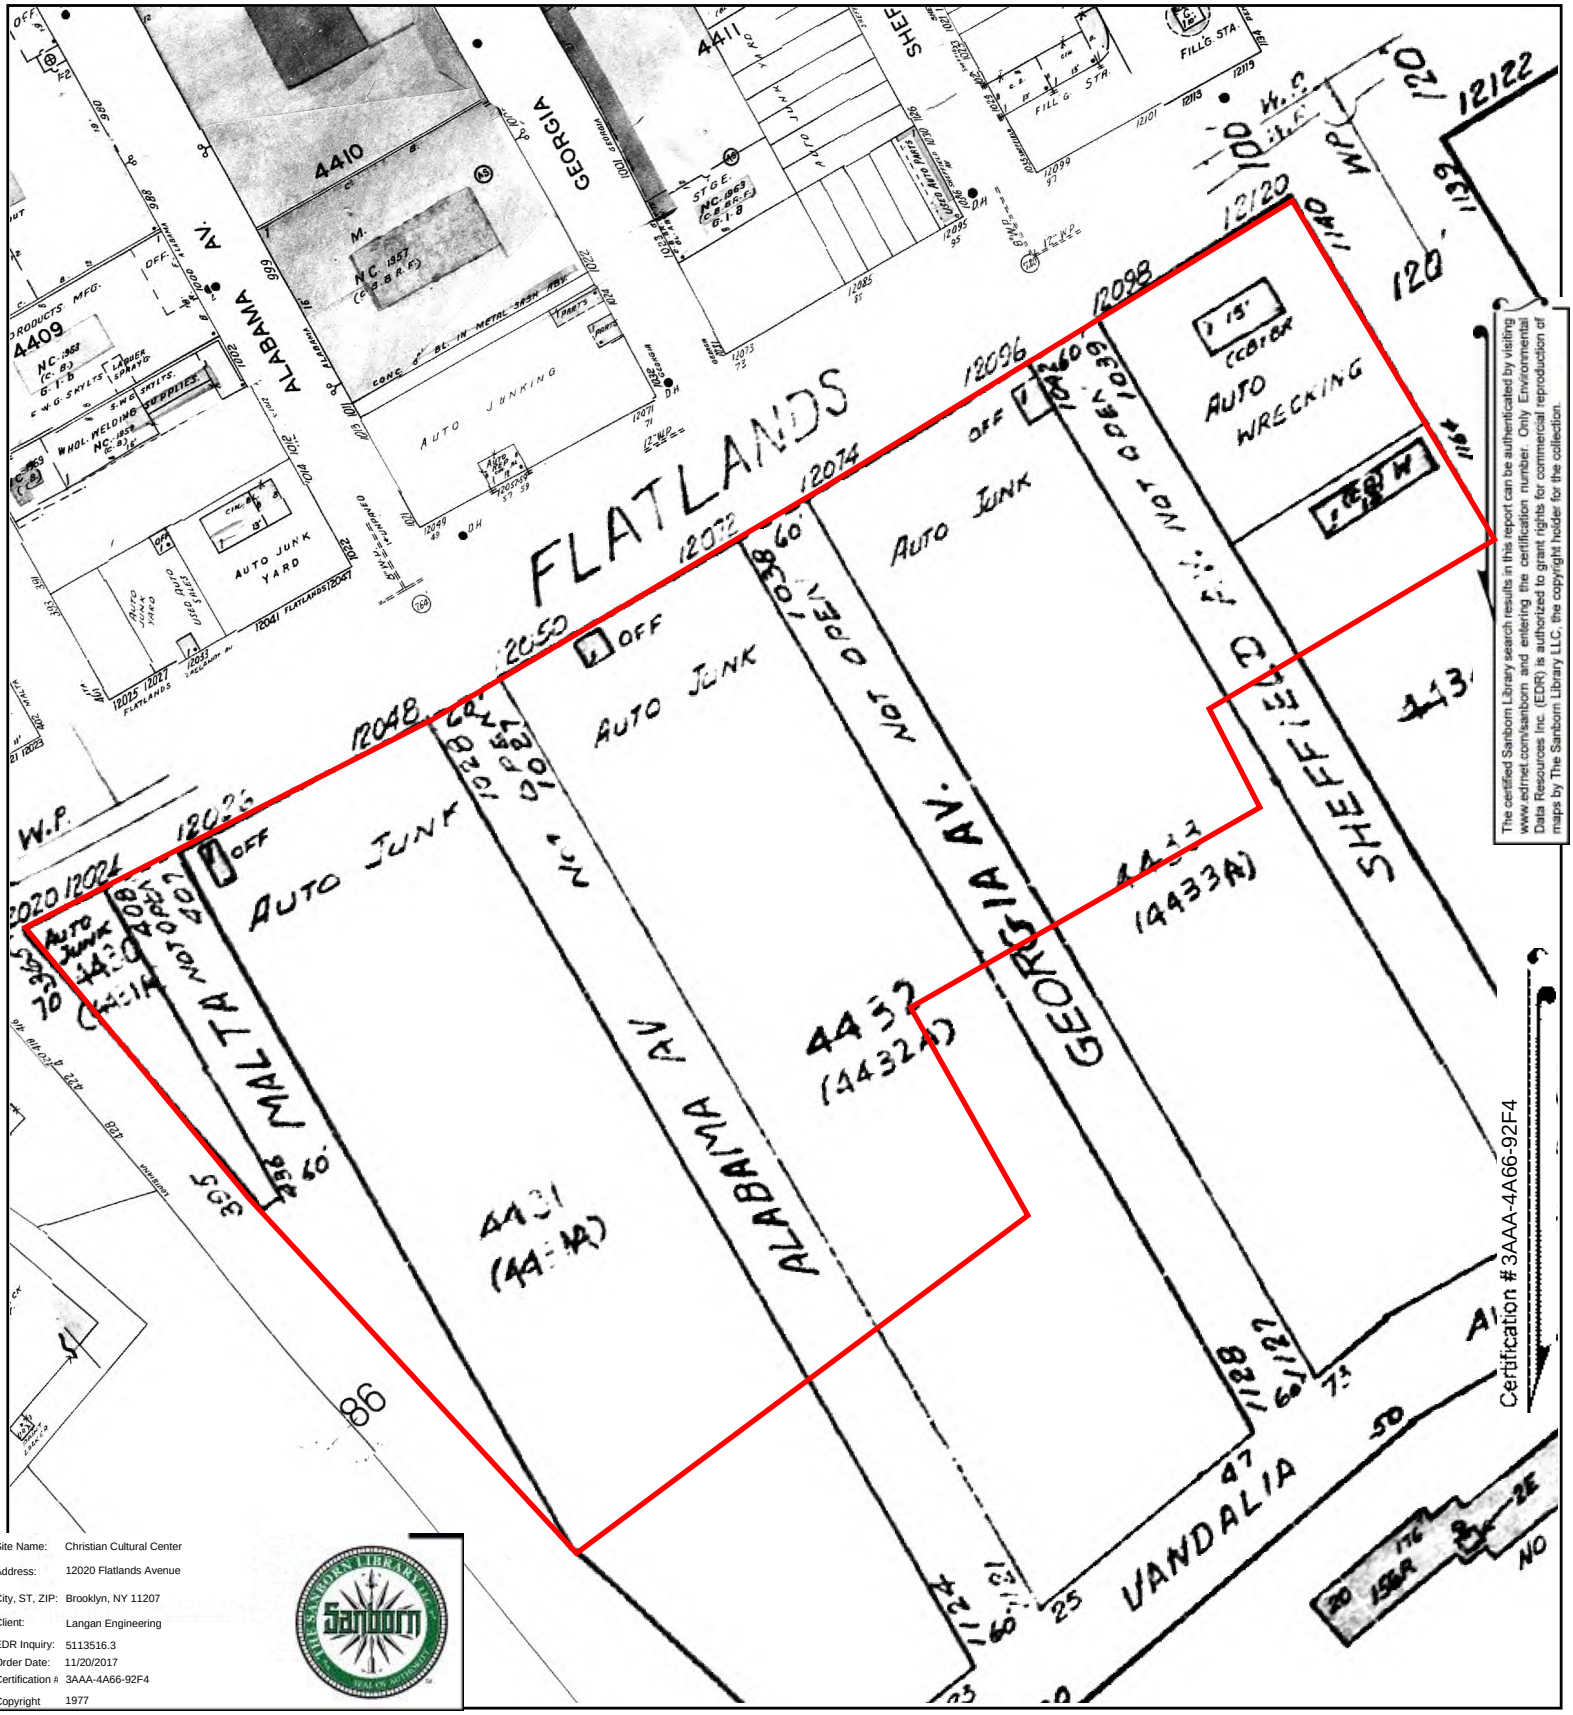



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #3AAA-4A66-92F4

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1977

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

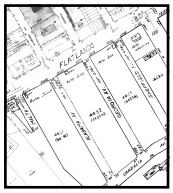


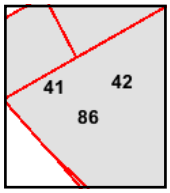

Volume 17, Sheet 86
Volume 17, Sheet 42
Volume 17, Sheet 41

0 Feet 150 300 600

N

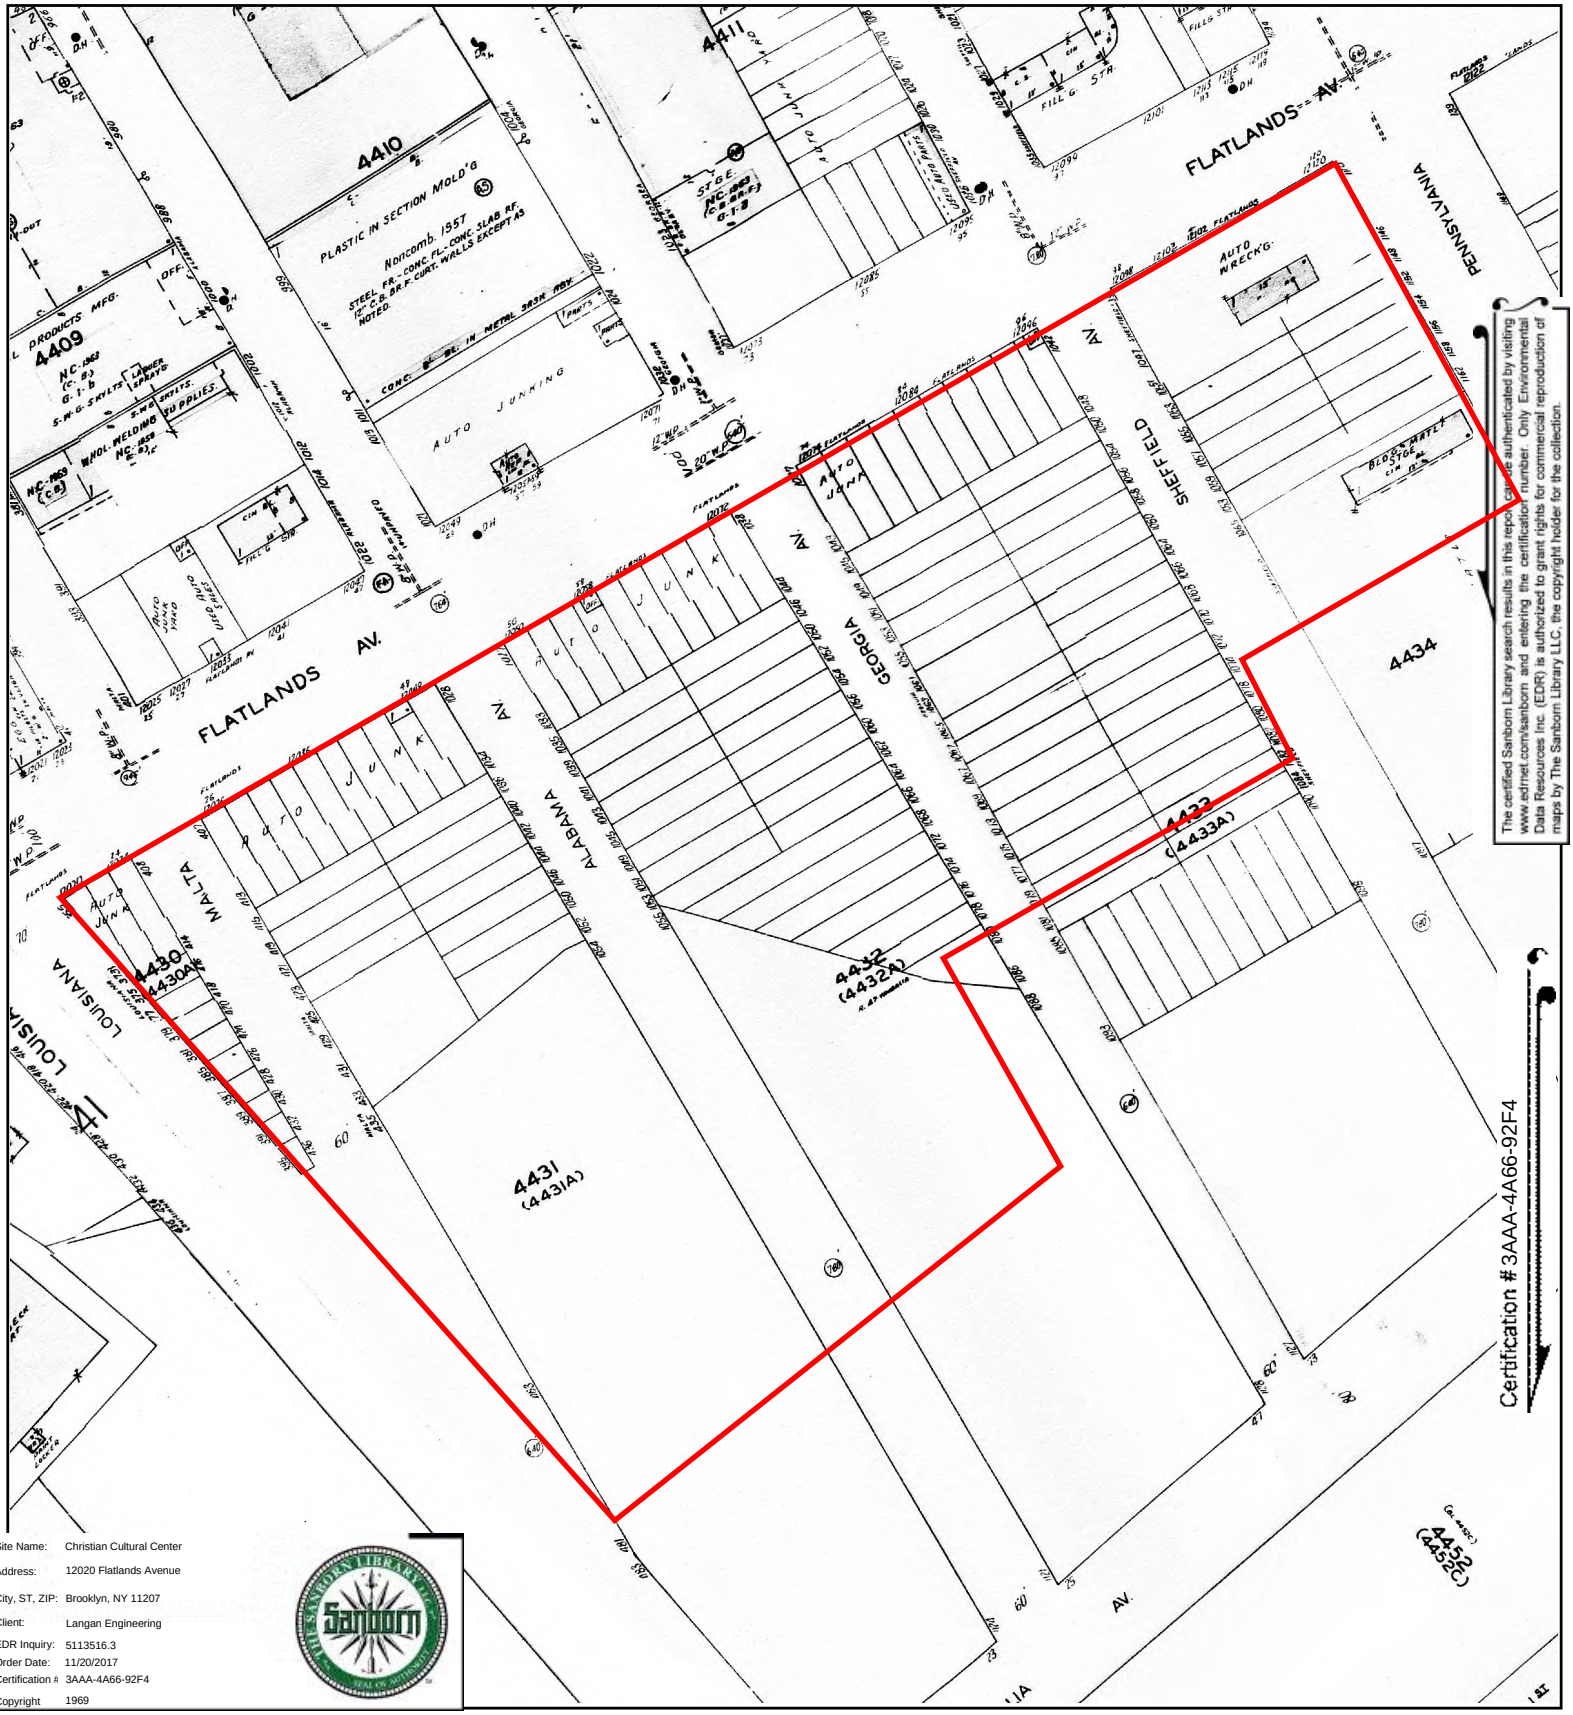



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #	3AAA-4A66-92F4
Copyright	1969

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

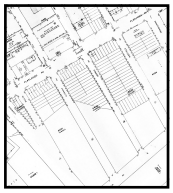

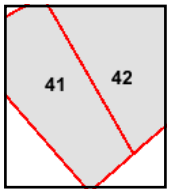

Volume 17, Sheet 42
Volume 17, Sheet 41


N

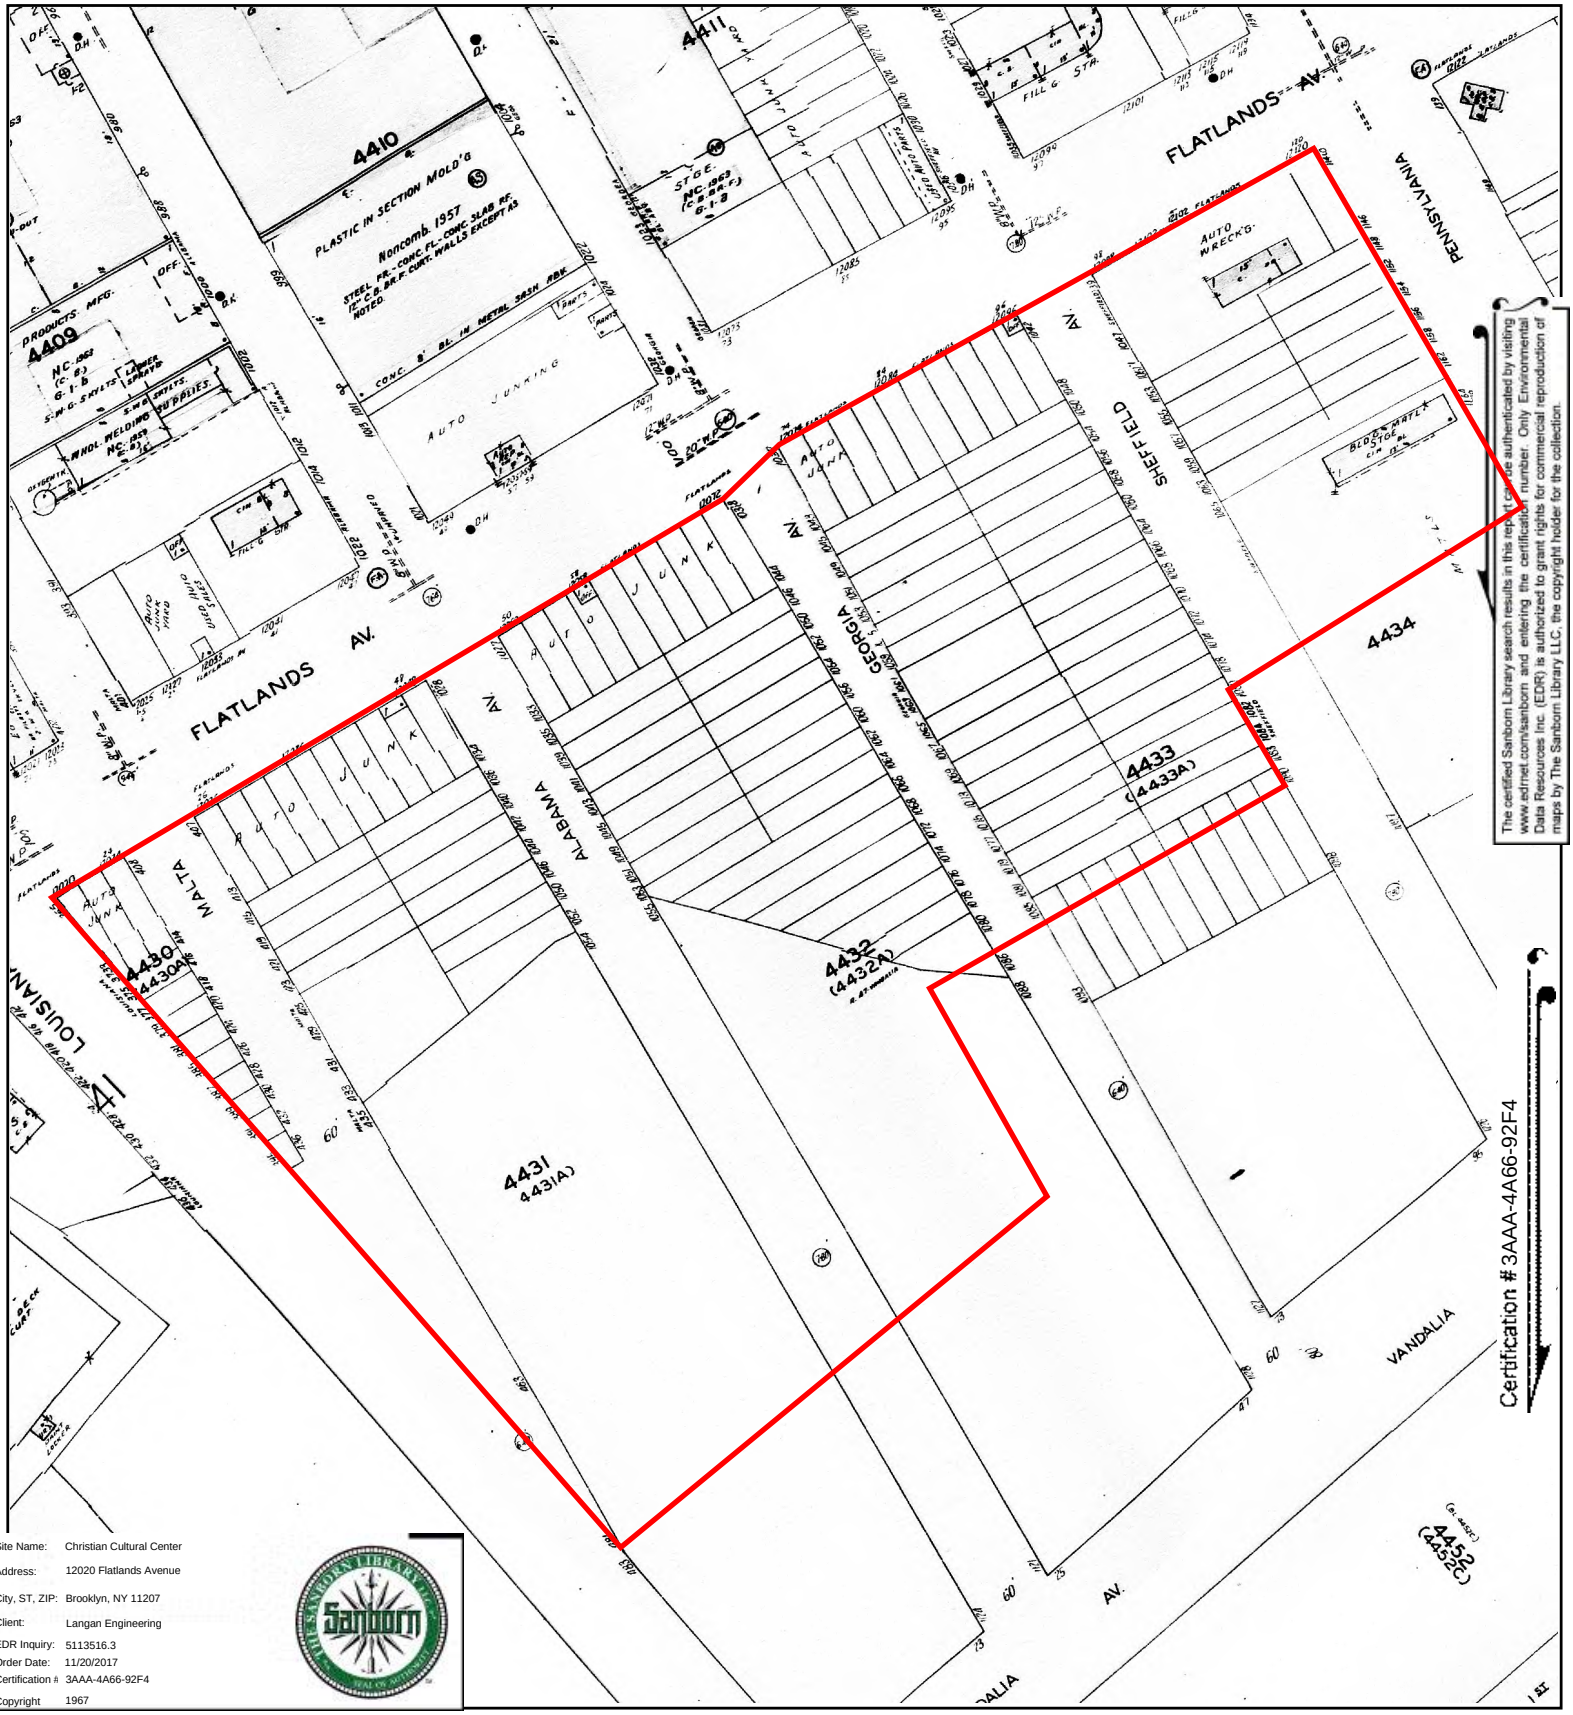


Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1967

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.


0 Feet 150 300 600

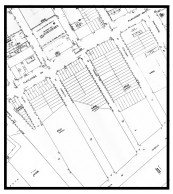

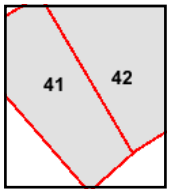

Volume 17, Sheet 42
Volume 17, Sheet 41

N

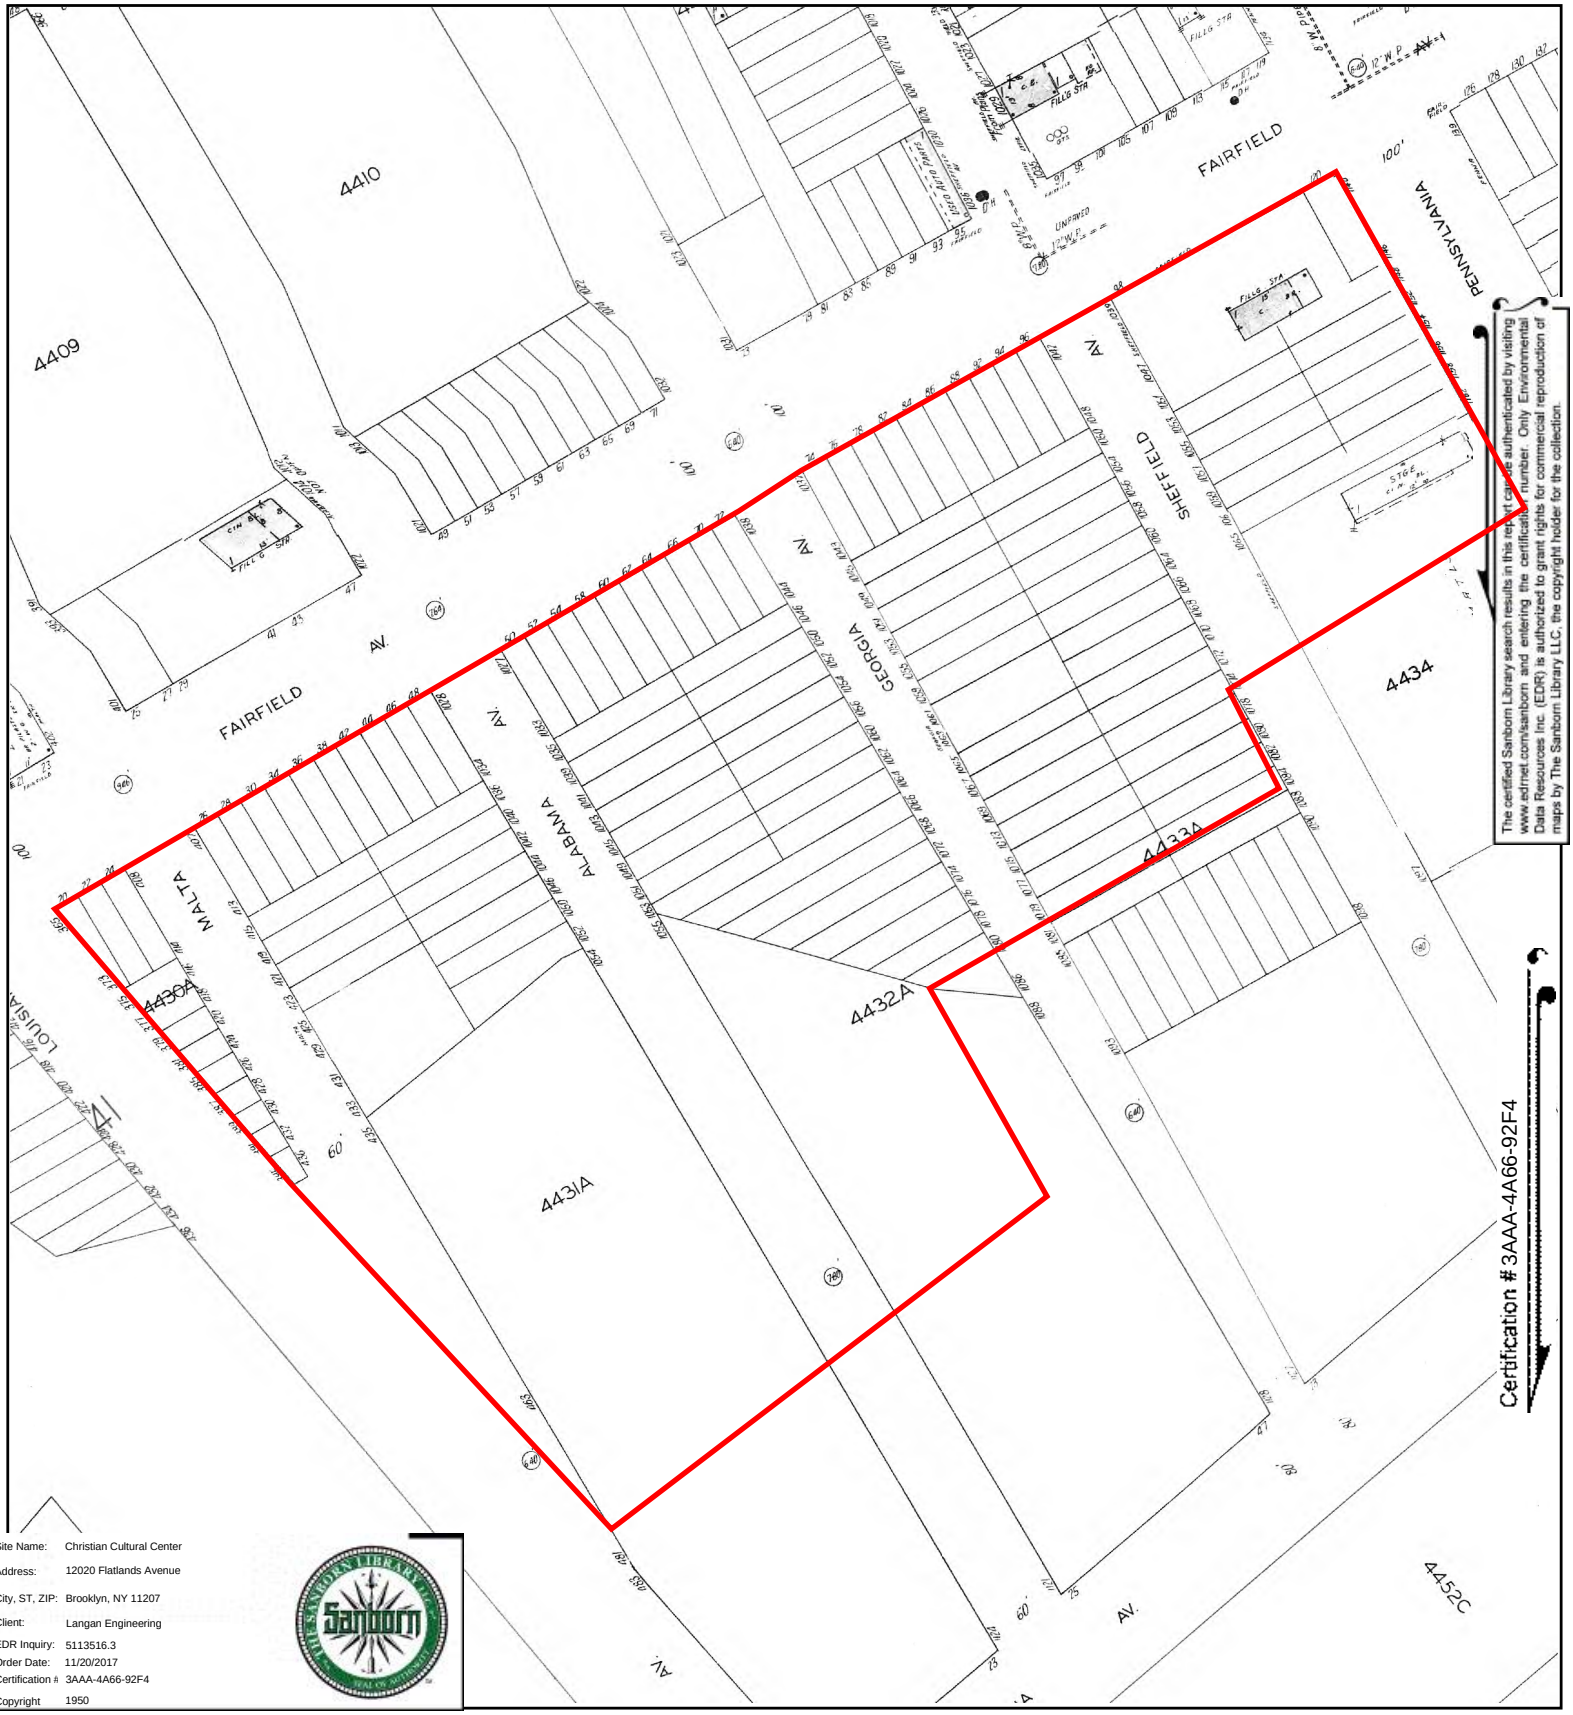


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #	3AAA-4A66-92F4
Copyright	1950

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.



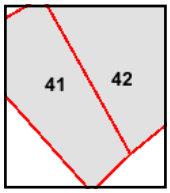

Volume 17, Sheet 42
Volume 17, Sheet 41

0 Feet 150 300 600

N





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1928

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

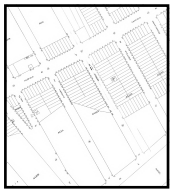

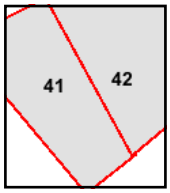

Volume 17, Sheet 42
Volume 17, Sheet 41


N




Site Name:	Christian Cultural Center
Address:	12020 Flatlands Avenue
City, ST, ZIP:	Brooklyn, NY 11207
Client:	Langan Engineering
EDR Inquiry:	5113516.3
Order Date:	11/20/2017
Certification #:	3AAA-4A66-92F4
Copyright	1908

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

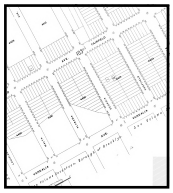

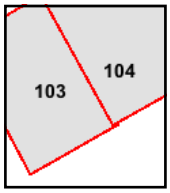

Volume 8, Sheet 104
Volume 8, Sheet 103

APPENDIX D

CITY DIRECTORY SEARCH

Christian Cultural Center
12020 Flatlands Avenue
Brooklyn, NY 11207

Inquiry Number: 5113516.5
November 21, 2017

The EDR-City Directory Abstract

Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1928 through 2014. This report compiles information gathered in this review by geocoding the latitude and longitude of properties identified and gathering information about properties within 200 feet of the target property.

A summary of the information obtained is provided in the text of this report.

RECORD SOURCES

EDR's Digital Archive combines historical directory listings from sources such as Cole Information and Dun & Bradstreet. These standard sources of property information complement and enhance each other to provide a more comprehensive report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

Data by infoUSA®

Copyright©2008
All Rights Reserved

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

Year	Source	TP	Adjoining	Text Abstract	Source Image
2014	EDR Digital Archive	-	X	X	-
	EDR Digital Archive	X	X	X	-
2010	EDR Digital Archive	-	X	X	-
	EDR Digital Archive	X	X	X	-
2005	Hill-Donnelly Corporation	-	-	-	-
2000	Cole Information Services	-	-	-	-
1997	NYNEX	-	X	X	-
1992	NYNEX Informantion Resource Co.	-	X	X	-
1985	NYNEX Information Resources Company	-	X	X	-
1980	New York Telephone	-	-	-	-
1976	New York Telephone	-	X	X	-
	New York Telephone	X	X	X	-

EXECUTIVE SUMMARY

Year	Source	TP	Adjoining	Text Abstract	Source Image
1970	New York Telephone	-	X	X	-
1965	New York Telephone	-	X	X	-
	New York Telephone	X	X	X	-
1949	New York Telephone Company	-	-	-	-
1945	New York Telephone	-	-	-	-
1940	New York Telephone	-	-	-	-
1934	R. L. Polk & Co.	-	-	-	-
1928	New York Telephone	-	-	-	-

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

12020 Flatlands Avenue
Brooklyn, NY 11207

FINDINGS DETAIL

Target Property research detail.

Flatlands Ave

12020 Flatlands Ave

Year	Uses	Source
2014	CCC PUBLICATIONS INC	EDR Digital Archive
	CHRISTIAN CULTURAL CENTER	EDR Digital Archive
	CHRISTIAN LIFE CENTER	EDR Digital Archive
	CLC PUBLICATIONS	EDR Digital Archive
2010	CCC BOOKSTORE	EDR Digital Archive
	CCC ENTERPRISES INC	EDR Digital Archive
	CHARIS FOUNDATION	EDR Digital Archive
	CHRISTIAN CULTURAL CENTER	EDR Digital Archive
	CHRISTIAN LIFE CENTER	EDR Digital Archive
	CLC PUBLICATIONS	EDR Digital Archive
	GREATER NY BLLY GRAHAM CRUSADE	EDR Digital Archive
	WHAT IS CHRISTMAS INC	EDR Digital Archive

FLATLANDS AVE

12026 FLATLANDS AVE

Year	Uses	Source
1976	ISO AUTO WRECKERS	New York Telephone
1965	Iso Auto Wreckrs	New York Telephone
1960	ISO AUTO WRECKRS	New York Telephone
	Iso Auto Wreckrs	New York Telephone Company

FLTLNDS st

12026 FLTLNDS st

Year	Uses	Source
1973	Iso Auto Wreckers	New York Telephone

FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

FLASLANDS AVE

12205 FLASLANDS AVE

Year	Uses	Source
1992	SUTTON JOHN	NYNEX Informantion Resource Co.

FLATLANDN AVE

12320 FLATLANDN AVE

Year	Uses	Source
1976	JOHNSON DEBORAH	New York Telephone

FLATLANDS AVE

12011 FLATLANDS AVE

Year	Uses	Source
1992	ISO AUTO WRECKERS	NYNEX Informantion Resource Co.
1985	ISO AUTO WRECKRS	NYNEX Information Resources Company
	ISO AUTO WRECKERS	NYNEX Information Resources Company

Flatlands Ave

12015 Flatlands Ave

Year	Uses	Source
2014	BUDGET TRUCK	EDR Digital Archive
	SECURE SELF STORAGE	EDR Digital Archive
2010	SECURE SELF STORAGE	EDR Digital Archive
	BUDGET TRUCK	EDR Digital Archive

FLSTLANDS AVE

12205 FLSTLANDS AVE

Year	Uses	Source
1976	BETHAY JAMES	New York Telephone
	JOHNSON J	New York Telephone

FINDINGS

12399 FLSTLANDS AVE

Year	*Uses*	*Source*
1992	OWENS CLARENCE	NYNEX Informantion Resource Co.

FLTLNDS 10 St

11541 FLTLNDS 10 St

Year	*Uses*	*Source*
1965	Smilowitz Irving	New York Telephone

FLTLNDS 9 st

11561 FLTLNDS 9 st

Year	*Uses*	*Source*
1970	Levy Herman	New York Telephone

LICONIA AVE

361 LICONIA AVE

Year	*Uses*	*Source*
1997	GIBSON Edith	NYNEX

FINDINGS

TARGET PROPERTY: ADDRESS NOT IDENTIFIED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not identified in the research source.

Address Researched	Address Not Identified in Research Source
12020 Flatlands Avenue	2005, 2000, 1997, 1992, 1985, 1980, 1970, 1949, 1945, 1940, 1934, 1928

ADJOINING PROPERTY: ADDRESSES NOT IDENTIFIED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not identified in research source.

Address Researched	Address Not Identified in Research Source
11541 FLTLNDS 10 St	2014, 2010, 2005, 2000, 1997, 1992, 1985, 1980, 1976, 1973, 1970, 1960, 1949, 1945, 1940, 1934, 1928
11561 FLTLNDS 9 st	2014, 2010, 2005, 2000, 1997, 1992, 1985, 1980, 1976, 1973, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12011 FLATLANDS AVE	2014, 2010, 2005, 2000, 1997, 1980, 1976, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12015 Flatlands Ave	2005, 2000, 1997, 1992, 1985, 1980, 1976, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12205 FLASLANDS AVE	2014, 2010, 2005, 2000, 1997, 1985, 1980, 1976, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12205 FLSTLANDS AVE	2014, 2010, 2005, 2000, 1997, 1992, 1985, 1980, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12320 FLATLANDN AVE	2014, 2010, 2005, 2000, 1997, 1992, 1985, 1980, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
12399 FLSTLANDS AVE	2014, 2010, 2005, 2000, 1997, 1985, 1980, 1976, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928
361 LICONIA AVE	2014, 2010, 2005, 2000, 1992, 1985, 1980, 1976, 1973, 1970, 1965, 1960, 1949, 1945, 1940, 1934, 1928

APPENDIX E

ENVIRONMENTAL DATABASE RADIUS REPORT

LANGAN

Christian Cultural Center
12020 Flatlands Avenue
Brooklyn, NY 11207

Inquiry Number: 5113516.2s
November 20, 2017

The EDR Radius Map™ Report with GeoCheck®

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	658
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-8
Physical Setting Source Map Findings	A-9
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2017 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

COORDINATES

Latitude (North):	40.6506560 - 40° 39' 2.36''
Longitude (West):	73.8890700 - 73° 53' 20.65''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	593925.9
UTM Y (Meters):	4500359.5
Elevation:	17 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	5940597 BROOKLYN, NY
Version Date:	2013
Northeast Map:	5940539 JAMAICA, NY
Version Date:	2013

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20150522
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	ISO AUTO SERVICE	12026 FLATLANDS AVE	EDR Hist Auto	Lower	27, 0.005, NW
B2	CON EDISON	830 FLATLANDS	NY MANIFEST	Lower	36, 0.007, NE
B3	CON EDISON	830 FLATLANDS AVE	NY MANIFEST	Lower	36, 0.007, NE
A4	FRESH CREEK	FLATLANDS AVE/LOUISI	NY Spills	Lower	64, 0.012, NW
A5	FRESH CREEK OUT POUR	FLAT LANDS & LOUISIA	NY Spills	Lower	64, 0.012, NW
A6	CAR ACCIDENT	MALTA ST & FLATLANDS	NY Spills	Lower	76, 0.014, NNW
C7	EAST NEW YORK AUTO S	73 FLATLANDS AVE	NY SWF/LF	Lower	97, 0.018, NNE
B8	CONSTRUCTION SITE	127-205 FLATLANDS AV	NY Spills	Lower	97, 0.018, NE
B9	U.S.-1 AUTO SALES &	12047 FLATLANDS AVEN	NY AST	Lower	99, 0.019, NE
10	LOT 48,TAXBLOCK 8235	430 LOUISIANA AVENUE	NY RES DECL	Higher	113, 0.021, South
A11	PATHMARK 72634	111-10 FLATLANDS AVE	RCRA NonGen / NLR, FINDS, ECHO	Lower	125, 0.024, West
B12	SINGLE PINE SERVICE	121-09 FLATLANDS AVE	EDR Hist Auto	Lower	131, 0.025, NE
B13	FLAT GAS INC	120-99 FLATLANDS AVE	NY AST	Lower	144, 0.027, NE
B14	FLAT GAS INC	120-99 FLATLANDS AVE	NY UST	Lower	144, 0.027, NE
D15	120-33 FLATLANDS AVE	120-33 FLATLANDS AVE	NY Spills	Lower	150, 0.028, NNW
C16	ULTIMATE USED AUTO P	120-49 FLATLANDS AVE	NY SWF/LF	Lower	150, 0.028, NNE
B17	PENN & FLAT GETTY	1121 PENNSYLVANIA AV	NY UST, FINDS, ECHO	Lower	222, 0.042, NE
B18	JOES ARCHER THRIFTWA	1121 PENNSYLVANIA	EDR Hist Auto	Lower	222, 0.042, NE
B19	PENN & FLAT GETTY	1121 PENNSYLVANIA AV	RCRA NonGen / NLR	Lower	222, 0.042, NE
B20	1121 PENNSYLVANIA AV	1121 PENNSYLVANIA AV	NY Spills	Lower	222, 0.042, NE
B21	FLAT GAS INC	1130 PENNSYLVANIA AV	NY Spills, RCRA NonGen / NLR, US AIRS, FINDS, ECHO	Lower	231, 0.044, NE
B22	FLAT GAS INC	1130 PENNSYLVANIA AV	EDR Hist Auto	Lower	231, 0.044, NE
B23	SPARTAN PETROLEUM IN	1130 PENNSYLVANIA AV	NY MANIFEST	Lower	231, 0.044, NE
B24	FLAT GAS INC.	1130 PENNSYLVANIA AV	NY UST	Lower	231, 0.044, NE
E25	NYC-HA VANDALIA HOUS	47 VANDALIA AVE	RCRA NonGen / NLR, FINDS, ECHO	Higher	251, 0.048, ESE
E26	VANDALIA -NYCHA	17 VANDALIA AVENUE	NY LTANKS, NY Spills	Higher	266, 0.050, SE
E27	VANDALIA AVENUE (PEN	17 VANDALIA AVENUE	NY UST	Higher	266, 0.050, SE
E28	NYCHA - PENN WORTMAN	17 VANDALIA AVE	RCRA NonGen / NLR, FINDS, ECHO	Higher	266, 0.050, SE
E29	GASOLINE DIGITAL INC	50 VANDALIA AVE	EDR Hist Auto	Higher	290, 0.055, ESE
F30	COMMERCIAL - PHASE-I	1118 PENNSYLVANIA AV	NY Spills	Lower	297, 0.056, NNE
F31	PENN MOTOR SALES & S	1118 PENNSYLVANIA AV	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	297, 0.056, NNE
D32	CON EDISON	999 ALABAMA AVE	RCRA NonGen / NLR	Lower	301, 0.057, North
D33	CON EDISON	999 ALABAMA AVE	NJ MANIFEST	Lower	301, 0.057, North
F34	PROFESSIONAL CLEANER	1110 PENNSYLVANIA AV	EDR Hist Cleaner	Lower	308, 0.058, NNE
F35	CON EDISON	1110 PENNSYLVANIA AV	RCRA NonGen / NLR	Lower	308, 0.058, NNE
F36	CON EDISON	1110 PENNSYLVANIA AV	NJ MANIFEST	Lower	308, 0.058, NNE
G37	SPRING CREEK	12143 FLATLANDS AVEN	NY UST	Lower	318, 0.060, NE
F38	1110 PENNSYLVANIA CL	1110 PENNSYLVANIA AV	NY DRYCLEANERS	Lower	338, 0.064, NNE
F39	PROFESSIONAL CLEANER	1110 PENNSYLVANIA AV	RCRA-CESQG, NY MANIFEST	Lower	338, 0.064, NNE

MAPPED SITES SUMMARY

Target Property Address:
12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
G40	FAIRFIELD TOWERS	12149 FLATLANDS AVE	NY AST	Lower	384, 0.073, NE
H41	HOFFINGER INDUSTRIES	980 ALABAMA AVE	RCRA NonGen / NLR, NY MANIFEST	Lower	408, 0.077, NNW
I42	26 WARD PLANT	112-66 FLATLANDS AVE	NY Spills	Lower	423, 0.080, WSW
H43	CROSS KOBRICK CORPOR	1000 ALABAMA AVENUE	NY UST	Lower	431, 0.082, NNW
H44	PIVOT METAL WORKS IN	1000 ALABAMA AVE	RCRA NonGen / NLR, NY MANIFEST	Lower	431, 0.082, NNW
I45	WILLIAMS & FLATLANDS	WILLIAMS & FLATLANDS	NY Spills	Lower	448, 0.085, WSW
H46	966 -988 ALABAMA AVE	966 -988 ALABAMA AVE	NY Spills	Lower	495, 0.094, NNW
I47	KENT DRY CLEANERS	111-18 FLATLANDS AVE	RCRA-CESQG, NY MANIFEST	Lower	496, 0.094, WSW
I48	KENT CLEANERS	111-18 FLATLANDS AVE	NY DRYCLEANERS	Lower	496, 0.094, WSW
I49	KENT CLEANER	11118 FLATLANDS AVE	EDR Hist Cleaner	Lower	496, 0.094, WSW
J50	RITE AID #3526	1111 PENNSYLVANIA AV	RCRA-CESQG, NY MANIFEST	Lower	498, 0.094, NNE
J51	TEN LAND CLEANERS	1111 PENNSYLVANIA AV	EDR Hist Cleaner	Lower	515, 0.098, NNE
H52	980 ALABAMA AVENUE	980 ALABAMA AVENUE	NY UST	Lower	526, 0.100, NNW
I53	WILLIAMS AV FRESH CR	WILLIAMS & FLATLANDS	NY Spills	Lower	568, 0.108, WSW
I54	FRESH CREEK	FLATLANDS AVENUE	NY Spills	Lower	568, 0.108, WSW
I55	US COAST GUARD/NYCDE	FLATLANDS & WILLIAMS	NY MANIFEST	Lower	568, 0.108, WSW
I56	REGULATOR 26 WOODS 0	INTERSECTION WILLIAM	NY Spills	Lower	568, 0.108, WSW
H57	IRON SHOP SOUTH	50 COZINE AVENUE	NY AST	Lower	609, 0.115, NNW
H58	COZINE ISLAND SHOP	50 COZINE AVE	NY Spills	Lower	609, 0.115, NNW
H59	IRON SHOP SOUTH	50 COZINE AVENUE	NY UST	Lower	609, 0.115, NNW
H60	NYCTA COZINE AVENUE	50 COZINE AVE	RCRA-LQG, NY MANIFEST, NJ MANIFEST	Lower	609, 0.115, NNW
H61	DRUM RUN	COZINE AVE & ALABAMA	NY Spills	Lower	630, 0.119, NNW
62	TELE MANHOLES VAPORS	PENNS.AVE & COZINE S	NY Spills	Lower	634, 0.120, NNE
J63	PEP BOYS 483	975 PENNSYLVANIA AVE	RCRA NonGen / NLR, FINDS, ECHO	Lower	635, 0.120, NNE
J64	SPILL NUMBER 9904544	PENNSYLVANIA & COZIN	NY Spills	Lower	637, 0.121, NNE
J65	PROGAS SALES INC	1090 PENNSYLVANIA AV	NY UST	Lower	648, 0.123, NNE
J66	PRO GAS SALES INC	1090 PENNSYLVANIA AV	EDR Hist Auto	Lower	648, 0.123, NNE
H67	960 ALABAMA AVE	960 ALABAMA AVENUE	NY UST	Lower	667, 0.126, NNW
68	MEADOWOOD AT GATEWAY	1065 VERMONT STREET	NY AST	Lower	699, 0.132, NE
K69	CON EDISON	WILLIAMS AVE & GLENW	NJ MANIFEST	Lower	832, 0.158, WNW
K70	CON EDISON	WILLIAMS AVE & GLENW	RCRA NonGen / NLR	Lower	832, 0.158, WNW
K71	CON ED	WILLIAMS AVE & GLENW	NY MANIFEST	Lower	832, 0.158, WNW
K72	CON EDISON	998 WILLIAMS AVE & G	RCRA NonGen / NLR, FINDS, ECHO	Lower	833, 0.158, WNW
73	PARKER HANNIFIN CORP	1000 PENNSYLVANIA AV	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	920, 0.174, North
L74	L&M OPTICAL DISC	303 LOUISIANA AVENUE	NJ MANIFEST	Lower	933, 0.177, NW
L75	L & M OPTICAL DISC	303 LOUISIANA AVE	RCRA-LQG, NY MANIFEST, NJ MANIFEST	Lower	933, 0.177, NW
76	MEADOWOOD AT GATEWAY	12205 FLATLANDS AVEN	NY AST	Lower	983, 0.186, NE
M77	NYC DEPT OF SANITATI	BK-18 922 GEORGIA AV	RCRA NonGen / NLR	Lower	1065, 0.202, North
N78	CON ED	998 WILLIAMS AVE & G	NY MANIFEST	Lower	1066, 0.202, WNW

MAPPED SITES SUMMARY

Target Property Address:
12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
O79	BP SERVICE STATION #	108-04 FLATLANDS AVE	NY UST	Lower	1093, 0.207, SW
O80	EXXON S/S	108-04 FLATLANDS AVE	NY LTANKS, NY Spills	Lower	1093, 0.207, SW
O81	CUMBERLAND FARMS#702	108-04 FLATLANDS AVE	RCRA-SQG, US AIRS, FINDS, ECHO, NY MANIFEST	Lower	1093, 0.207, SW
N82	CON EDISON	992 WILLIAMS AVE	RCRA NonGen / NLR	Lower	1105, 0.209, WNW
N83	CON EDISON	992 WILLIAMS AVE SB5	NJ MANIFEST	Lower	1105, 0.209, WNW
N84	CON EDISON	992 WILLIAMS AVE	NJ MANIFEST	Lower	1105, 0.209, WNW
N85	CON ED	992 WILLIAMS AVE SB5	NY MANIFEST	Lower	1105, 0.209, WNW
N86	CON EDISON	992 WILLIAMS AVE	RCRA NonGen / NLR	Lower	1105, 0.209, WNW
N87	CON ED	992 WILLIAMS AVE SB5	NY MANIFEST	Lower	1105, 0.209, WNW
P88	NYCHA - BREUKELEN	715 E 108TH ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	1148, 0.217, WSW
Q89	RING CLEANERS	941A PENNSYLVANIA AV	RCRA-CESQG, ICIS, US AIRS, NY MANIFEST	Lower	1168, 0.221, North
Q90	J & R/RING DRY CLEAN	941A PENNSYLVANIA AV	NY DRYCLEANERS	Lower	1168, 0.221, North
Q91	MOONS CLEANERS	941-A PENNSYLVANIA A	RCRA NonGen / NLR	Lower	1177, 0.223, North
R92	NYCDEP	ALABAMA & WORTMAN AV	NY MANIFEST	Lower	1200, 0.227, NNW
R93	NYC DEP	WORTMAN & ALABAMA AV	NJ MANIFEST	Lower	1200, 0.227, NNW
R94	CON EDISON	MALTA & WORTMAN	NY MANIFEST	Lower	1201, 0.227, NNW
R95	CON EDISON - VAULT 4	MALTA & WORTMAN	NJ MANIFEST	Lower	1201, 0.227, NNW
R96	CON EDISON	MALTA ST & WORTMAN A	NJ MANIFEST	Lower	1201, 0.227, NNW
R97	CON EDISON	MALTA ST & WORTMAN A	NY MANIFEST	Lower	1201, 0.227, NNW
R98	CON EDISON - VAULT 4	MALTA & WORTMAN	RCRA-LQG	Lower	1201, 0.227, NNW
R99	CON EDISON - MANHOLE	MALTA ST & WORTMAN A	NY MANIFEST	Lower	1201, 0.227, NNW
R100	CON EDISON	MALTA ST & WORTMAN A	RCRA NonGen / NLR	Lower	1201, 0.227, NNW
S101	MEADOWOOD AT GATEWAY	190 COZINE AVENUE	NY AST	Lower	1214, 0.230, NE
M102	DSNY BK 16 GARAGE	922 GEORGIA AVENUE	NY AST	Lower	1229, 0.233, North
M103	DSNY BK 16 GARAGE	922 GEORGIA AVENUE	NY UST	Lower	1229, 0.233, North
M104	BROOKLYN EAST 16 DOS	922 GEORGIA AVENUE	NY LTANKS, NY Spills	Lower	1229, 0.233, North
P105	NYCHA - BREUKELEN HO	650 E 108TH ST	RCRA-CESQG	Lower	1238, 0.234, West
T106	PUBLIC SCHOOL 306K	970 VERMONT ST	RCRA-LQG	Lower	1266, 0.240, NNE
T107	PUBLIC SCHOOL 306 -	970 VERMONT STREET	NY AST	Lower	1266, 0.240, NNE
T108	NYC DEPT OF ED - PUB	970 VERMONT AVE	NY MANIFEST	Lower	1266, 0.240, NNE
M109	K B ELECTRONICS INC	73 WORTMAN AVE	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	1266, 0.240, North
S110	MEADOWOOD AT GATEWAY	200 COZINE AVENUE	NY AST	Lower	1279, 0.242, NE
111	PENN-WORTMAN HOUSES	875 PENNSYLVANIA AVE	NY LTANKS, NY Spills	Lower	1565, 0.296, North
U112	26TH WARD WWTP	122-66 FLATLANDS AVE	NY LTANKS, NY CBS, NY Spills, NY SPDES	Lower	1677, 0.318, ENE
U113	26TH WARD WPCP	12266 FLATLANDS AVEN	NY LTANKS, NY Spills, NY SPDES	Lower	1677, 0.318, ENE
V114	BREUKELEN HOUSES	618 EAST 108TH STREE	NY LTANKS, NY UST, NY Spills	Lower	1703, 0.323, WNW
W115	STANITA SERVICE CORP	LINDEN BLVD & ELTON	NY LTANKS, NY CBS, NY Spills, RCRA NonGen / NLR,...	Lower	1754, 0.332, NNW
W116	400 STANLEY AVE/SUNN	400 STANLEY AVE/SUNN	NY LTANKS	Lower	1754, 0.332, NNW
117	HOWARD BERGER CO.	808 GEORGIA AVE	NY LTANKS	Lower	1793, 0.340, NNW

MAPPED SITES SUMMARY

Target Property Address:
12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
V118	FEDERAL EXPRESS CORP	107-123 FARRAGUT RD	RCRA-CESQG, NY CBS, NY CBS AST, NY INST CONTROL,...	Lower	1796, 0.340, WNW
X119	SPRING CREEK TOWERS	165 ELMIRA LOOP	NY LTANKS, NY MOSF, NY CBS, NY Spills, NY AIRS	Higher	1809, 0.343, East
X120	STARRETT CITY POWER	165 ELMIRA LOOP	RCRA-CESQG, NY MOSF UST, NY CBS AST, NY MOSF AST,...	Higher	1809, 0.343, East
121	WATER POLLUTION CONT	26TH WARD	NY LTANKS	Lower	1820, 0.345, ENE
122	PUBLIC SCHOOL 260 -	875 WILLIAMS AVENUE	NY LTANKS, NY UST	Lower	1999, 0.379, NW
123	HESS/MERIT STATION 3	810 PENNSYLVANIA AVE	NY LTANKS, NY Spills	Lower	2154, 0.408, North
124	REEGAE IMPORTS	1900 LINDEN BLVD	NY LTANKS, NY Spills	Lower	2224, 0.421, NNW
Y125	1868 LINDEN BLVD	1868 LINDEN BLVD	NY LTANKS	Lower	2349, 0.445, NNW
Y126	CLOSED-LACKOF RECENT	1868 LINDEN BLVD	NY LTANKS, NY Spills	Lower	2362, 0.447, NNW
Z127	AMBER COURT OF BROOK	650 EAST 104TH STREE	NY LTANKS	Lower	2388, 0.452, WSW
Z128	NURSING HOME	630 E 104TH ST	NY LTANKS	Lower	2390, 0.453, WSW
129	LINDEN/BOULEVARD HOU	696 STANLEY AVENUE	NY LTANKS, NY Spills	Lower	2408, 0.456, NNE
130	MOBIL S/S	1935 LINDEN BLVD	NY LTANKS, NY Spills	Lower	2602, 0.493, North
131	350 DEWITT AVE	350 DEWITT AVENUE	NY SHWS, NY UST	Lower	2706, 0.512, NW
132	ELTON STREET GW	SE CORNER OF ELTON S	NY SHWS	Lower	3882, 0.735, NE
133	491 WORTMAN AVENUE	491 WORTMAN AVENUE	NY SHWS, NY BROWNFIELDS, NY Spills	Lower	4278, 0.810, NE

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL ---------- National Priority List
Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL ---------- National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY ---------- Federal Facility Site Information listing
SEMS ---------- Superfund Enterprise Management System

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE ---------- Superfund Enterprise Management System Archive

Federal RCRA CORRACTS facilities list

CORRACTS ---------- Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

LUCIS ---------- Land Use Control Information System
US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROL ---------- Sites with Institutional Controls

Federal ERNS list

ERNS ---------- Emergency Response Notification System

State- and tribal - equivalent CERCLIS

NY VAPOR REOPENED ---------- Vapor Intrusion Legacy Site List

EXECUTIVE SUMMARY

State and tribal leaking storage tank lists

INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land
NY HIST LTANKS ---------- Listing of Leaking Storage Tanks

State and tribal registered storage tank lists

FEMA UST ---------- Underground Storage Tank Listing
NY CBS UST ---------- Chemical Bulk Storage Database
INDIAN UST ---------- Underground Storage Tanks on Indian Land
NY TANKS ---------- Storage Tank Faciliy Listing

State and tribal institutional control / engineering control registries

NY ENG CONTROLS ---------- Registry of Engineering Controls

State and tribal voluntary cleanup sites

INDIAN VCP ---------- Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

NY ERP ---------- Environmental Restoration Program Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS ---------- A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

NY SWTIRE ---------- Registered Waste Tire Storage & Facility List
NY SWRCY ---------- Registered Recycling Facility List
INDIAN ODI ---------- Report on the Status of Open Dumps on Indian Lands
DEBRIS REGION 9 ---------- Torres Martinez Reservation Illegal Dump Site Locations
ODI ---------- Open Dump Inventory
IHS OPEN DUMPS ---------- Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL ---------- Delisted National Clandestine Laboratory Register
NY DEL SHWS ---------- Delisted Registry Sites
US CDL ---------- National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

NY HIST UST ---------- Historical Petroleum Bulk Storage Database
NY HIST AST ---------- Historical Petroleum Bulk Storage Database

Local Land Records

NY LIENS ---------- Spill Liens Information

LIENS 2 ---------- CERCLA Lien Information

Records of Emergency Release Reports

HMIRS ---------- Hazardous Materials Information Reporting System
NY Hist Spills ---------- SPILLS Database
NY SPILLS 90 ---------- SPILLS 90 data from FirstSearch
NY SPILLS 80 ---------- SPILLS 80 data from FirstSearch

Other Ascertainable Records

FUDS ---------- Formerly Used Defense Sites
DOD ---------- Department of Defense Sites
SCRD DRYCLEANERS ---------- State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR ---------- Financial Assurance Information
EPA WATCH LIST ---------- EPA WATCH LIST
2020 COR ACTION ---------- 2020 Corrective Action Program List
TSCA ---------- Toxic Substances Control Act
TRIS ---------- Toxic Chemical Release Inventory System
SSTS ---------- Section 7 Tracking Systems
ROD ---------- Records Of Decision
RMP ---------- Risk Management Plans
RAATS ---------- RCRA Administrative Action Tracking System
PRP ---------- Potentially Responsible Parties
PADS ---------- PCB Activity Database System
FTTS ---------- FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS ---------- Material Licensing Tracking System
COAL ASH DOE ---------- Steam-Electric Plant Operation Data
COAL ASH EPA ---------- Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER ---------- PCB Transformer Registration Database
RADINFO ---------- Radiation Information Database
HIST FTTS ---------- FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS ---------- Incident and Accident Data
CONSENT ---------- Superfund (CERCLA) Consent Decrees
INDIAN RESERV ---------- Indian Reservations
FUSRAP ---------- Formerly Utilized Sites Remedial Action Program
UMTRA ---------- Uranium Mill Tailings Sites
LEAD SMELTERS ---------- Lead Smelter Sites
US MINES ---------- Mines Master Index File
ABANDONED MINES ---------- Abandoned Mines
UXO ---------- Unexploded Ordnance Sites
DOCKET HWC ---------- Hazardous Waste Compliance Docket Listing
FUELS PROGRAM ---------- EPA Fuels Program Registered Listing
NY COAL ASH ---------- Coal Ash Disposal Site Listing
NY E DESIGNATION ---------- E DESIGNATION SITE LISTING
NY Financial Assurance ---------- Financial Assurance Information Listing
NY HSWDS ---------- Hazardous Substance Waste Disposal Site Inventory
NY UIC ---------- Underground Injection Control Wells

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP ---------- EDR Proprietary Manufactured Gas Plants

EXECUTIVE SUMMARY

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

NY RGA HWS ---------- Recovered Government Archive State Hazardous Waste Facilities List
NY RGA LF ---------- Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 09/13/2017 has revealed that there are 4 RCRA-LQG sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
NYCTA COZINE AVENUE	***50 COZINE AVE***	***NNW 0 - 1/8 (0.115 mi.)***	***H60***	***123***
L & M OPTICAL DISC	***303 LOUISIANA AVE***	***NW 1/8 - 1/4 (0.177 mi.)***	***L75***	***171***
CON EDISON - VAULT 4	MALTA & WORTMAN	NNW 1/8 - 1/4 (0.227 mi.)	R98	265
PUBLIC SCHOOL 306K	970 VERMONT ST	NNE 1/8 - 1/4 (0.240 mi.)	T106	297

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 09/13/2017 has revealed that there is 1 RCRA-SQG site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CUMBERLAND FARMS#702	***108-04 FLATLANDS AVE***	***SW 1/8 - 1/4 (0.207 mi.)***	***O81***	***231***

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 09/13/2017 has revealed that there are 5 RCRA-CESQG sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
PROFESSIONAL CLEANER	***1110 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.064 mi.)***	***F39***	***80***
KENT DRY CLEANERS	***111-18 FLATLANDS AVE***	***WSW 0 - 1/8 (0.094 mi.)***	***I47***	***100***
RITE AID #3526	***1111 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.094 mi.)***	***J50***	***105***
RING CLEANERS	***941A PENNSYLVANIA AV***	***N 1/8 - 1/4 (0.221 mi.)***	***Q89***	***248***
NYCHA - BREUKELEN HO	650 E 108TH ST	W 1/8 - 1/4 (0.234 mi.)	P105	295

State- and tribal - equivalent CERCLIS

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 08/15/2017 has revealed that there are 3 NY SHWS sites within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
350 DEWITT AVE Site Code: 484571	***350 DEWITT AVENUE***	***NW 1/2 - 1 (0.512 mi.)***	***131***	***641***
ELTON STREET GW Site Code: 537680	SE CORNER OF ELTON S	NE 1/2 - 1 (0.735 mi.)	132	645
491 WORTMAN AVENUE Site Code: 424756	***491 WORTMAN AVENUE***	***NE 1/2 - 1 (0.810 mi.)***	***133***	***647***

State and tribal landfill and/or solid waste disposal site lists

NY SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the NY SWF/LF list, as provided by EDR, and dated 09/25/2017 has revealed that there are 2 NY SWF/LF sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
EAST NEW YORK AUTO S	73 FLATLANDS AVE	NNE 0 - 1/8 (0.018 mi.)	C7	14
ULTIMATE USED AUTO P	120-49 FLATLANDS AVE	NNE 0 - 1/8 (0.028 mi.)	C16	30

State and tribal leaking storage tank lists

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 10/31/2017 has revealed that there are 21 NY LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VANDALIA -NYCHA	***17 VANDALIA AVENUE***	***SE 0 - 1/8 (0.050 mi.)***	***E26***	***59***
Spill Number/Closed Date: 1993-07-06				
Site ID: 214957				
Program Number: 9011231				
SPRING CREEK TOWERS	***165 ELMIRA LOOP***	***E 1/4 - 1/2 (0.343 mi.)***	***X119***	***387***
Spill Number/Closed Date: 2003-05-09				
Site ID: 114886				
Program Number: 0301455				

Lower Elevation	Address	Direction / Distance	Map ID	Page
EXXON S/S	***108-04 FLATLANDS AVE***	***SW 1/8 - 1/4 (0.207 mi.)***	***O80***	***215***
Spill Number/Closed Date: 1993-08-03				
Spill Number/Closed Date: 2003-09-16				
Spill Number/Closed Date: 2003-09-15				
Site ID: 134225				
Site ID: 134227				
Site ID: 134228				
Program Number: 9304648				
Program Number: 9612806				
Program Number: 9913633				
BROOKLYN EAST 16 DOS	***922 GEORGIA AVENUE***	***N 1/8 - 1/4 (0.233 mi.)***	***M104***	***285***
Spill Number/Closed Date: 2006-03-10				
Spill Number/Closed Date: 2003-11-03				
Spill Number/Closed Date: 2003-10-31				
Spill Number/Closed Date: 1995-09-28				
Site ID: 88116				
Site ID: 88119				
Site ID: 271263				
Site ID: 271265				
Site ID: 84249				
Program Number: 0001440				
Program Number: 9403700				
Program Number: 9308251				
Program Number: 9312491				
Program Number: 9309468				
PENN-WORTMAN HOUSES	***875 PENNSYLVANIA AVE***	***N 1/4 - 1/2 (0.296 mi.)***	***111***	***309***

Spill Number/Closed Date: 2014-11-05 Site ID: 136035 Program Number: 9614567				
26TH WARD WWTP Spill Number/Closed Date: 2009-08-07 Spill Number/Closed Date: 2008-06-13 Site ID: 221380 Site ID: 282574 Program Number: 9900503 Program Number: 9608289	***122-66 FLATLANDS AVE***	***ENE 1/4 - 1/2 (0.318 mi.)***	***U112***	***313***
26TH WARD WPCP Spill Number/Closed Date: 2003-07-21 Spill Number/Closed Date: 2007-05-08 Site ID: 144547 Site ID: 371493 Program Number: 0105192 Program Number: 0607689	***12266 FLATLANDS AVEN***	***ENE 1/4 - 1/2 (0.318 mi.)***	***U113***	***336***
BREUKELEN HOUSES Spill Number/Closed Date: 1996-07-08 Spill Number/Closed Date: 1994-08-26 Spill Number/Closed Date: 1995-11-03 Site ID: 271198 Site ID: 271199 Site ID: 271200 Site ID: 304293 Program Number: 9306985 Program Number: 9315459 Program Number: 9406297 Program Number: 9107005	***618 EAST 108TH STREE***	***WNW 1/4 - 1/2 (0.323 mi.)***	***V114***	***344***
STANITA SERVICE CORP Spill Number/Closed Date: 2004-08-18 Spill Number/Closed Date: 1996-03-20 Spill Number/Closed Date: 2006-09-07 Spill Number/Closed Date: 2004-06-30 Spill Number/Closed Date: 1992-08-26 Site ID: 221098 Site ID: 221099 Site ID: 311784 Site ID: 311785 Site ID: 260684 Program Number: 9412264 Program Number: 9516361 Program Number: 0404235 Program Number: 9210189 Program Number: 9206077	***LINDEN BLVD & ELTON***	***NNW 1/4 - 1/2 (0.332 mi.)***	***W115***	***356***
400 STANLEY AVE/SUNN Spill Number/Closed Date: 1991-11-25 Site ID: 250688 Program Number: 9109084	400 STANLEY AVE/SUNN	NNW 1/4 - 1/2 (0.332 mi.)	W116	370
HOWARD BERGER CO. Spill Number/Closed Date: 2005-06-28 Site ID: 117914 Program Number: 9906439	808 GEORGIA AVE	NNW 1/4 - 1/2 (0.340 mi.)	117	371
WATER POLLUTION CONT	26TH WARD	ENE 1/4 - 1/2 (0.345 mi.)	121	577

Spill Number/Closed Date: 2006-07-13 Site ID: 366952 Program Number: 0604069				
PUBLIC SCHOOL 260 - Spill Number/Closed Date: 2014-11-18 Site ID: 63458 Program Number: 9500631	***875 WILLIAMS AVENUE***	***NW 1/4 - 1/2 (0.379 mi.)***	***122***	***578***
HESS/MERIT STATION 3 Spill Number/Closed Date: 1988-09-30 Spill Number/Closed Date: 1994-07-22 Spill Number/Closed Date: 1988-11-02 Spill Number/Closed Date: 1993-05-24 Site ID: 273086 Site ID: 273087 Site ID: 281535 Site ID: 284266 Site ID: 64537 Program Number: 8801521 Program Number: 9010161 Program Number: 8801651 Program Number: 9214515 Program Number: 9301033	***810 PENNSYLVANIA AVE***	***N 1/4 - 1/2 (0.408 mi.)***	***123***	***582***
REEGAE IMPORTS Spill Number/Closed Date: 2000-03-24 Spill Number/Closed Date: 1989-04-25 Site ID: 88916 Site ID: 88917 Program Number: 8808120 Program Number: 8808741	***1900 LINDEN BLVD***	***NNW 1/4 - 1/2 (0.421 mi.)***	***124***	***609***
1868 LINDEN BLVD Spill Number/Closed Date: 2005-11-25 Site ID: 218128 Program Number: 9503273	1868 LINDEN BLVD	NNW 1/4 - 1/2 (0.445 mi.)	Y125	612
CLOSED-LACKOF RECENT Spill Number/Closed Date: 2003-03-04 Site ID: 320909 Site ID: 320910 Program Number: 8800531 Program Number: 9709774	***1868 LINDEN BLVD***	***NNW 1/4 - 1/2 (0.447 mi.)***	***Y126***	***614***
AMBER COURT OF BROOK Site ID: 458205 Program Number: 1110371	650 EAST 104TH STREE	WSW 1/4 - 1/2 (0.452 mi.)	Z127	626
NURSING HOME Spill Number/Closed Date: 2004-11-16 Site ID: 154901 Program Number: 0308584	630 E 104TH ST	WSW 1/4 - 1/2 (0.453 mi.)	Z128	627
LINDEN/BOULEVARD HOU Spill Number/Closed Date: 2005-12-20 Site ID: 150080 Program Number: 9501101	***696 STANLEY AVENUE***	***NNE 1/4 - 1/2 (0.456 mi.)***	***129***	***629***
MOBIL S/S Spill Number/Closed Date: 1991-01-08	***1935 LINDEN BLVD***	***N 1/4 - 1/2 (0.493 mi.)***	***130***	***634***

Spill Number/Closed Date: 1991-08-22
Spill Number/Closed Date: 1993-02-02
Site ID: 67469
Site ID: 67470
Site ID: 67471
Program Number: 9010771
Program Number: 9105582
Program Number: 9212401

State and tribal registered storage tank lists

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, has revealed that there are 12 NY UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VANDALIA AVENUE (PEN Database: UST, Date of Government Version: 09/21/2017	17 VANDALIA AVENUE	SE 0 - 1/8 (0.050 mi.)	E27	63

Lower Elevation	Address	Direction / Distance	Map ID	Page
FLAT GAS INC Database: UST, Date of Government Version: 09/21/2017	120-99 FLATLANDS AVE	NE 0 - 1/8 (0.027 mi.)	B14	26
PENN & FLAT GETTY Database: UST, Date of Government Version: 09/21/2017	***1121 PENNSYLVANIA AV***	***NE 0 - 1/8 (0.042 mi.)***	***B17***	***31***
FLAT GAS INC. Database: UST, Date of Government Version: 09/21/2017	1130 PENNSYLVANIA AV	NE 0 - 1/8 (0.044 mi.)	B24	50
SPRING CREEK Database: UST, Date of Government Version: 09/21/2017	12143 FLATLANDS AVEN	NE 0 - 1/8 (0.060 mi.)	G37	78
CROSS KOBRICK CORPOR Database: UST, Date of Government Version: 09/21/2017	1000 ALABAMA AVENUE	NNW 0 - 1/8 (0.082 mi.)	H43	92
980 ALABAMA AVENUE Database: UST, Date of Government Version: 09/21/2017	980 ALABAMA AVENUE	NNW 0 - 1/8 (0.100 mi.)	H52	110
IRON SHOP SOUTH Database: UST, Date of Government Version: 09/21/2017	50 COZINE AVENUE	NNW 0 - 1/8 (0.115 mi.)	H59	120
PROGAS SALES INC Database: UST, Date of Government Version: 09/21/2017	1090 PENNSYLVANIA AV	NNE 0 - 1/8 (0.123 mi.)	J65	152
960 ALABAMA AVE Database: UST, Date of Government Version: 09/21/2017	960 ALABAMA AVENUE	NNW 1/8 - 1/4 (0.126 mi.)	H67	155
BP SERVICE STATION # Database: UST, Date of Government Version: 09/21/2017	108-04 FLATLANDS AVE	SW 1/8 - 1/4 (0.207 mi.)	O79	203
DSNY BK 16 GARAGE Database: UST, Date of Government Version: 09/21/2017	922 GEORGIA AVENUE	N 1/8 - 1/4 (0.233 mi.)	M103	273

EXECUTIVE SUMMARY

NY MOSF UST: Major Oil Storage Facilities Database. Facilities are licensed pursuant to Article 12 of the Navigation Law, 6 NYCRR Part 610 and 17 NYCRR Part 30. These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater. Includes MOSF's licensed or closed since April 1, 1986, (responsibility was transferred from DOT on October 13, 1985) plus available data obtained from DOT facilities licensed since Article 12 became law on April 1, 1978.

A review of the NY MOSF UST list, as provided by EDR, and dated 01/01/2002 has revealed that there is 1 NY MOSF UST site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
STARRETT CITY POWER	***165 ELMIRA LOOP***	***E 1/4 - 1/2 (0.343 mi.)***	***X120***	***482***

NY MOSF: These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

A review of the NY MOSF list, as provided by EDR, and dated 09/21/2017 has revealed that there is 1 NY MOSF site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SPRING CREEK TOWERS	***165 ELMIRA LOOP***	***E 1/4 - 1/2 (0.343 mi.)***	***X119***	***387***
Tank Status: Active Facility Id: 2-2460				

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, has revealed that there are 10 NY AST sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
U.S.-1 AUTO SALES & Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-610185	12047 FLATLANDS AVEN	NE 0 - 1/8 (0.019 mi.)	B9	16
FLAT GAS INC Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-603120	120-99 FLATLANDS AVE	NE 0 - 1/8 (0.027 mi.)	B13	22
FAIRFIELD TOWERS Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-252654	12149 FLATLANDS AVE	NE 0 - 1/8 (0.073 mi.)	G40	85
IRON SHOP SOUTH Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-608647	50 COZINE AVENUE	NNW 0 - 1/8 (0.115 mi.)	H57	117
MEADOWOOD AT GATEWAY Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-608697	1065 VERMONT STREET	NE 1/8 - 1/4 (0.132 mi.)	68	157
MEADOWOOD AT GATEWAY Database: AST, Date of Government Version: 09/21/2017 Facility Id: 2-608696	12205 FLATLANDS AVEN	NE 1/8 - 1/4 (0.186 mi.)	76	198
MEADOWOOD AT GATEWAY Database: AST, Date of Government Version: 09/21/2017	190 COZINE AVENUE	NE 1/8 - 1/4 (0.230 mi.)	S101	268

Facility Id: 2-608691

DSNY BK 16 GARAGE — 922 GEORGIA AVENUE — N 1/8 - 1/4 (0.233 mi.) — M102 — 270
Database: AST, Date of Government Version: 09/21/2017
Facility Id: 2-456136

PUBLIC SCHOOL 306 - — 970 VERMONT STREET — NNE 1/8 - 1/4 (0.240 mi.) — T107 — 299
Database: AST, Date of Government Version: 09/21/2017
Facility Id: 2-354627

MEADOWOOD AT GATEWAY — 200 COZINE AVENUE — NE 1/8 - 1/4 (0.242 mi.) — S110 — 306
Database: AST, Date of Government Version: 09/21/2017
Facility Id: 2-252301

NY MOSF AST: Major Oil Storage Facilities Database. Facilities are licensed pursuant to Article 12 of the Navigation Law, 6 NYCRR Part 610 and 17 NYCRR Part 30. These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater. Includes MOSF's licensed or closed since April 1, 1986, (responsibility was transferred from DOT on October 13, 1985) plus available data obtained from DOT facilities licensed since Article 12 became law on April 1, 1978.

A review of the NY MOSF AST list, as provided by EDR, and dated 01/01/2002 has revealed that there is 1 NY MOSF AST site within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
STARRETT CITY POWER	***165 ELMIRA LOOP***	***E 1/4 - 1/2 (0.343 mi.)***	***X120***	***482***
Facility Status: 1				
Facility Status: 1				

State and tribal institutional control / engineering control registries

NY RES DECL: A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

A review of the NY RES DECL list, as provided by EDR, has revealed that there is 1 NY RES DECL site within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
LOT 48,TAXBLOCK 8235	430 LOUISIANA AVENUE	S 0 - 1/8 (0.021 mi.)	10	18
Database: RES DECL, Date of Government Version: 11/18/2010				

Environmental Remediation sites that have institutional controls in place.

A review of the NY INST CONTROL list, as provided by EDR, and dated 08/15/2017 has revealed that there is 1 NY INST CONTROL site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FEDERAL EXPRESS CORP	***107-123 FARRAGUT RD***	***WNW 1/4 - 1/2 (0.340 mi.)***	***V118***	***373***

Site Code: 58389

State and tribal voluntary cleanup sites

NY VCP: Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the NY VCP list, as provided by EDR, has revealed that there is 1 NY VCP site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FEDERAL EXPRESS CORP	***107-123 FARRAGUT RD***	***WNW 1/4 - 1/2 (0.340 mi.)***	***V118***	***373***
Database: VCP, Date of Government Version: 08/15/2017				
Site Code: 58389				

ADDITIONAL ENVIRONMENTAL RECORDS

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 10/31/2017 has revealed that there are 19 NY Spills sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VANDALIA -NYCHA	***17 VANDALIA AVENUE***	***SE 0 - 1/8 (0.050 mi.)***	***E26***	***59***
Spill Number/Closed Date: 2003-03-13				
Spill Number/Closed Date: 2006-01-13				
Spill Number/Closed Date: 2005-11-04				
spillno: 0211342				
spillno: 0311656				
spillno: 0210638				
Site ID: 102392				
Site ID: 178920				
Site ID: 148098				

Lower Elevation	Address	Direction / Distance	Map ID	Page
FRESH CREEK	FLATLANDS AVE/LOUISI	NW 0 - 1/8 (0.012 mi.)	A4	11
Spill Number/Closed Date: 2003-03-24				
spillno: 0005213				
Site ID: 190387				
FRESH CREEK OUT POUR	FLAT LANDS & LOUISIA	NW 0 - 1/8 (0.012 mi.)	A5	12
Spill Number/Closed Date: 2007-08-13				

spillno: 0705343 Site ID: 385639				
CAR ACCIDENT Spill Number/Closed Date: 2007-06-11 spillno: 0702669 Site ID: 382428	MALTA ST & FLATLANDS	NNW 0 - 1/8 (0.014 mi.)	A6	13
CONSTRUCTION SITE Spill Number/Closed Date: 2004-01-14 spillno: 0311317 Site ID: 307549	127-205 FLATLANDS AV	NE 0 - 1/8 (0.018 mi.)	B8	15
120-33 FLATLANDS AVE Spill Number/Closed Date: 1998-10-30 spillno: 9808202 Site ID: 294309	120-33 FLATLANDS AVE	NNW 0 - 1/8 (0.028 mi.)	D15	29
1121 PENNSYLVANIA AV Spill Number/Closed Date: 1998-04-23 Spill Number/Closed Date: 2007-03-20 spillno: 9711920 spillno: 9609479 Site ID: 244091 Site ID: 266183	1121 PENNSYLVANIA AV	NE 0 - 1/8 (0.042 mi.)	B20	42
FLAT GAS INC Spill Number/Closed Date: 2003-03-10 spillno: 0210596 Site ID: 278393	***1130 PENNSYLVANIA AV***	***NE 0 - 1/8 (0.044 mi.)***	***B21***	***44***
COMMERCIAL - PHASE-I Spill Number/Closed Date: 2016-03-02 spillno: 1511045 Site ID: 522759	1118 PENNSYLVANIA AV	NNE 0 - 1/8 (0.056 mi.)	F30	68
26 WARD PLANT Spill Number/Closed Date: 2008-05-21 spillno: 0801985 Site ID: 398044	112-66 FLATLANDS AVE	WSW 0 - 1/8 (0.080 mi.)	I42	91
WILLIAMS & FLATLANDS Spill Number/Closed Date: 1992-02-14 spillno: 9111763 Site ID: 285398	WILLIAMS & FLATLANDS	WSW 0 - 1/8 (0.085 mi.)	I45	97
966 -988 ALABAMA AVE Spill Number/Closed Date: 2015-08-24 spillno: 1500053 Site ID: 506186	966 -988 ALABAMA AVE	NNW 0 - 1/8 (0.094 mi.)	H46	98
WILLIAMS AV FRESH CR Spill Number/Closed Date: 2004-01-30 spillno: 0111428 Site ID: 285397	WILLIAMS & FLATLANDS	WSW 0 - 1/8 (0.108 mi.)	I53	112
FRESH CREEK Spill Number/Closed Date: 2003-07-09 spillno: 0112235 Site ID: 198323	FLATLANDS AVENUE	WSW 0 - 1/8 (0.108 mi.)	I54	113
REGULATOR 26 WOODS 0 Spill Number/Closed Date: 2008-10-03	INTERSECTION WILLIAM	WSW 0 - 1/8 (0.108 mi.)	I56	116

spillno: 0807250 Site ID: 404589				
COZINE ISLAND SHOP Spill Number/Closed Date: 2004-04-19 spillno: 0313830 Site ID: 141353	50 COZINE AVE	NNW 0 - 1/8 (0.115 mi.)	H58	119
DRUM RUN Spill Number/Closed Date: 2014-07-16 spillno: 1402352 Site ID: 495674	COZINE AVE & ALABAMA	NNW 0 - 1/8 (0.119 mi.)	H61	147
TELE MANHOLES VAPORS Spill Number/Closed Date: 1987-08-21 spillno: 8602391 Site ID: 100563	PENNS.AVE & COZINE S	NNE 0 - 1/8 (0.120 mi.)	62	148
SPILL NUMBER 9904544 Spill Number/Closed Date: 2002-04-04 spillno: 9904544 Site ID: 267075	PENNSYLVANIA & COZIN	NNE 0 - 1/8 (0.121 mi.)	J64	151

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 09/13/2017 has revealed that there are 21 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NYC-HA VANDALIA HOUS	***47 VANDALIA AVE***	***ESE 0 - 1/8 (0.048 mi.)***	***E25***	***57***
NYCHA - PENN WORTMAN	***17 VANDALIA AVE***	***SE 0 - 1/8 (0.050 mi.)***	***E28***	***66***

Lower Elevation	Address	Direction / Distance	Map ID	Page
PATHMARK 72634	***111-10 FLATLANDS AVE***	***W 0 - 1/8 (0.024 mi.)***	***A11***	***18***
PENN & FLAT GETTY	1121 PENNSYLVANIA AV	NE 0 - 1/8 (0.042 mi.)	B19	41
FLAT GAS INC	***1130 PENNSYLVANIA AV***	***NE 0 - 1/8 (0.044 mi.)***	***B21***	***44***
PENN MOTOR SALES & S	***1118 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.056 mi.)***	***F31***	***70***
CON EDISON	999 ALABAMA AVE	N 0 - 1/8 (0.057 mi.)	D32	73
CON EDISON	1110 PENNSYLVANIA AV	NNE 0 - 1/8 (0.058 mi.)	F35	76
HOFFINGER INDUSTRIES	***980 ALABAMA AVE***	***NNW 0 - 1/8 (0.077 mi.)***	***H41***	***87***
PIVOT METAL WORKS IN	***1000 ALABAMA AVE***	***NNW 0 - 1/8 (0.082 mi.)***	***H44***	***94***
PEP BOYS 483	***975 PENNSYLVANIA AVE***	***NNE 0 - 1/8 (0.120 mi.)***	***J63***	***149***
CON EDISON	WILLIAMS AVE & GLENW	WNW 1/8 - 1/4 (0.158 mi.)	K70	161
CON EDISON	***998 WILLIAMS AVE & G***	***WNW 1/8 - 1/4 (0.158 mi.)***	***K72***	***163***
PARKER HANNIFIN CORP	***1000 PENNSYLVANIA AV***	***N 1/8 - 1/4 (0.174 mi.)***	***73***	***164***
NYC DEPT OF SANITATI	BK-18 922 GEORGIA AV	N 1/8 - 1/4 (0.202 mi.)	M77	200
CON EDISON	992 WILLIAMS AVE	WNW 1/8 - 1/4 (0.209 mi.)	N82	236
CON EDISON	992 WILLIAMS AVE	WNW 1/8 - 1/4 (0.209 mi.)	N86	241
NYCHA - BREUKELEN	***715 E 108TH ST***	***WSW 1/8 - 1/4 (0.217 mi.)***	***P88***	***245***
MOONS CLEANERS	941-A PENNSYLVANIA A	N 1/8 - 1/4 (0.223 mi.)	Q91	254

Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON	MALTA ST & WORTMAN A	NNW 1/8 - 1/4 (0.227 mi.)	R100	267
K B ELECTRONICS INC	***73 WORTMAN AVE***	***N 1/8 - 1/4 (0.240 mi.)***	***M109***	***303***

NY DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the NY DRYCLEANERS list, as provided by EDR, and dated 10/27/2016 has revealed that there are 3 NY DRYCLEANERS sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
1110 PENNSYLVANIA CL Facility Id: 2-6105-00300	1110 PENNSYLVANIA AV	NNE 0 - 1/8 (0.064 mi.)	F38	80
KENT CLEANERS Facility Id: 2-6105-00392	111-18 FLATLANDS AVE	WSW 0 - 1/8 (0.094 mi.)	I48	104
J & R/RING DRY CLEAN Facility Id: 2-6105-00488	941A PENNSYLVANIA AV	N 1/8 - 1/4 (0.221 mi.)	Q90	253

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 10/01/2017 has revealed that there are 26 NY MANIFEST sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON EPA ID: NYP004694030	830 FLATLANDS	NE 0 - 1/8 (0.007 mi.)	B2	8
CON EDISON EPA ID: NYP004694048	830 FLATLANDS AVE	NE 0 - 1/8 (0.007 mi.)	B3	9
SPARTAN PETROLEUM IN EPA ID: NYD986988178	1130 PENNSYLVANIA AV	NE 0 - 1/8 (0.044 mi.)	B23	49
PENN MOTOR SALES & S EPA ID: NYD986976413	***1118 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.056 mi.)***	***F31***	***70***
PROFESSIONAL CLEANER EPA ID: NY0000465468 EPA ID: NYP004817292	***1110 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.064 mi.)***	***F39***	***80***
HOFFINGER INDUSTRIES EPA ID: NYD982729337	***980 ALABAMA AVE***	***NNW 0 - 1/8 (0.077 mi.)***	***H41***	***87***
PIVOT METAL WORKS IN EPA ID: NYD001382746	***1000 ALABAMA AVE***	***NNW 0 - 1/8 (0.082 mi.)***	***H44***	***94***
KENT DRY CLEANERS EPA ID: NY0001419852	***111-18 FLATLANDS AVE***	***WSW 0 - 1/8 (0.094 mi.)***	***I47***	***100***
RITE AID #3526 EPA ID: NYD981082217	***1111 PENNSYLVANIA AV***	***NNE 0 - 1/8 (0.094 mi.)***	***J50***	***105***
US COAST GUARD/NYCDE EPA ID: NYP000952291	FLATLANDS & WILLIAMS	WSW 0 - 1/8 (0.108 mi.)	I55	114
NYCTA COZINE AVENUE	***50 COZINE AVE***	***NNW 0 - 1/8 (0.115 mi.)***	***H60***	***123***

EPA Id: NYD001236942				
CON ED EPA ID: NYP004807681	WILLIAMS AVE & GLENW	WNW 1/8 - 1/4 (0.158 mi.)	K71	161
PARKER HANNIFIN CORP EPA ID: NYD001211267	***1000 PENNSYLVANIA AV***	***N 1/8 - 1/4 (0.174 mi.)***	***73***	***164***
L & M OPTICAL DISC EPA Id: NYR000103259	***303 LOUISIANA AVE***	***NW 1/8 - 1/4 (0.177 mi.)***	***L75***	***171***
CON ED EPA ID: NYP004807673	998 WILLIAMS AVE & G	WNW 1/8 - 1/4 (0.202 mi.)	N78	202
CUMBERLAND FARMS#702 EPA ID: NYD986894160	***108-04 FLATLANDS AVE***	***SW 1/8 - 1/4 (0.207 mi.)***	***O81***	***231***
CON ED EPA ID: NYP004830242	992 WILLIAMS AVE SB5	WNW 1/8 - 1/4 (0.209 mi.)	N85	240
CON ED EPA ID: NYP004830226	992 WILLIAMS AVE SB5	WNW 1/8 - 1/4 (0.209 mi.)	N87	243
NYCHA - BREUKELEN EPA ID: NYR000052746	***715 E 108TH ST***	***WSW 1/8 - 1/4 (0.217 mi.)***	***P88***	***245***
RING CLEANERS EPA ID: NYD982275380	***941A PENNSYLVANIA AV***	***N 1/8 - 1/4 (0.221 mi.)***	***Q89***	***248***
NYCDEP EPA ID: NYP010001915	ALABAMA & WORTMAN AV	NNW 1/8 - 1/4 (0.227 mi.)	R92	255
CON EDISON EPA ID: NYP004672143 EPA ID: NYP004717823	MALTA & WORTMAN	NNW 1/8 - 1/4 (0.227 mi.)	R94	258
CON EDISON EPA ID: NYP004765145	MALTA ST & WORTMAN A	NNW 1/8 - 1/4 (0.227 mi.)	R97	263
CON EDISON - MANHOLE EPA ID: NYP004920110	MALTA ST & WORTMAN A	NNW 1/8 - 1/4 (0.227 mi.)	R99	266
NYC DEPT OF ED - PUB EPA ID: NYR000181370	970 VERMONT AVE	NNE 1/8 - 1/4 (0.240 mi.)	T108	302
K B ELECTRONICS INC EPA ID: NYD043178441	***73 WORTMAN AVE***	***N 1/8 - 1/4 (0.240 mi.)***	***M109***	***303***

NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 12/31/2016 has revealed that there are 11 NJ MANIFEST sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON EPA Id: NYP004878700	999 ALABAMA AVE	N 0 - 1/8 (0.057 mi.)	D33	74
CON EDISON EPA Id: NYP004817292	1110 PENNSYLVANIA AV	NNE 0 - 1/8 (0.058 mi.)	F36	77
NYCTA COZINE AVENUE EPA Id: NYD001236942	***50 COZINE AVE***	***NNW 0 - 1/8 (0.115 mi.)***	***H60***	***123***
CON EDISON	WILLIAMS AVE & GLENW	WNW 1/8 - 1/4 (0.158 mi.)	K69	159

EPA Id: NYP004807681				
L&M OPTICAL DISC EPA Id: NYR000003259	303 LOUISIANA AVENUE	NW 1/8 - 1/4 (0.177 mi.)	L74	170
L & M OPTICAL DISC EPA Id: NYR000103259	***303 LOUISIANA AVE***	***NW 1/8 - 1/4 (0.177 mi.)***	***L75***	***171***
CON EDISON EPA Id: NYP004830226	992 WILLIAMS AVE SB5	WNW 1/8 - 1/4 (0.209 mi.)	N83	238
CON EDISON EPA Id: NYP004830242	992 WILLIAMS AVE	WNW 1/8 - 1/4 (0.209 mi.)	N84	239
NYC DEP EPA Id: NYP003662871	WORTMAN & ALABAMA AV	NNW 1/8 - 1/4 (0.227 mi.)	R93	257
CON EDISON - VAULT 4 EPA Id: NYP004717823	MALTA & WORTMAN	NNW 1/8 - 1/4 (0.227 mi.)	R95	261
CON EDISON EPA Id: NYP004765145	MALTA ST & WORTMAN A	NNW 1/8 - 1/4 (0.227 mi.)	R96	262

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 6 EDR Hist Auto sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GASOLINE DIGITAL INC	50 VANDALIA AVE	ESE 0 - 1/8 (0.055 mi.)	E29	68

Lower Elevation	Address	Direction / Distance	Map ID	Page
ISO AUTO SERVICE	12026 FLATLANDS AVE	NW 0 - 1/8 (0.005 mi.)	A1	8
SINGLE PINE SERVICE	121-09 FLATLANDS AVE	NE 0 - 1/8 (0.025 mi.)	B12	22
JOES ARCHER THRIFTWA	1121 PENNSYLVANIA	NE 0 - 1/8 (0.042 mi.)	B18	40
FLAT GAS INC	1130 PENNSYLVANIA AV	NE 0 - 1/8 (0.044 mi.)	B22	48
PRO GAS SALES INC	1090 PENNSYLVANIA AV	NNE 0 - 1/8 (0.123 mi.)	J66	155

EXECUTIVE SUMMARY

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 3 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.


Lower Elevation	Address	Direction / Distance	Map ID	Page
PROFESSIONAL CLEANER	1110 PENNSYLVANIA AV	NNE 0 - 1/8 (0.058 mi.)	F34	75
KENT CLEANER	11118 FLATLANDS AVE	WSW 0 - 1/8 (0.094 mi.)	I49	104
TEN LAND CLEANERS	1111 PENNSYLVANIA AV	NNE 0 - 1/8 (0.098 mi.)	J51	110

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 4 records.

Site Name	Database(s)
PENNSYLAVANIA AVE MUNICIPAL LANDFI	SEMS-ARCHIVE, RCRA NonGen / NLR
NYCDOS SPRING CREEK COMPOST FACILI	NY SWF/LF, NY Spills
GULF STATION	NY LTANKS
BELMONT STATION	NY VCP

OVERVIEW MAP - 5113516.2S

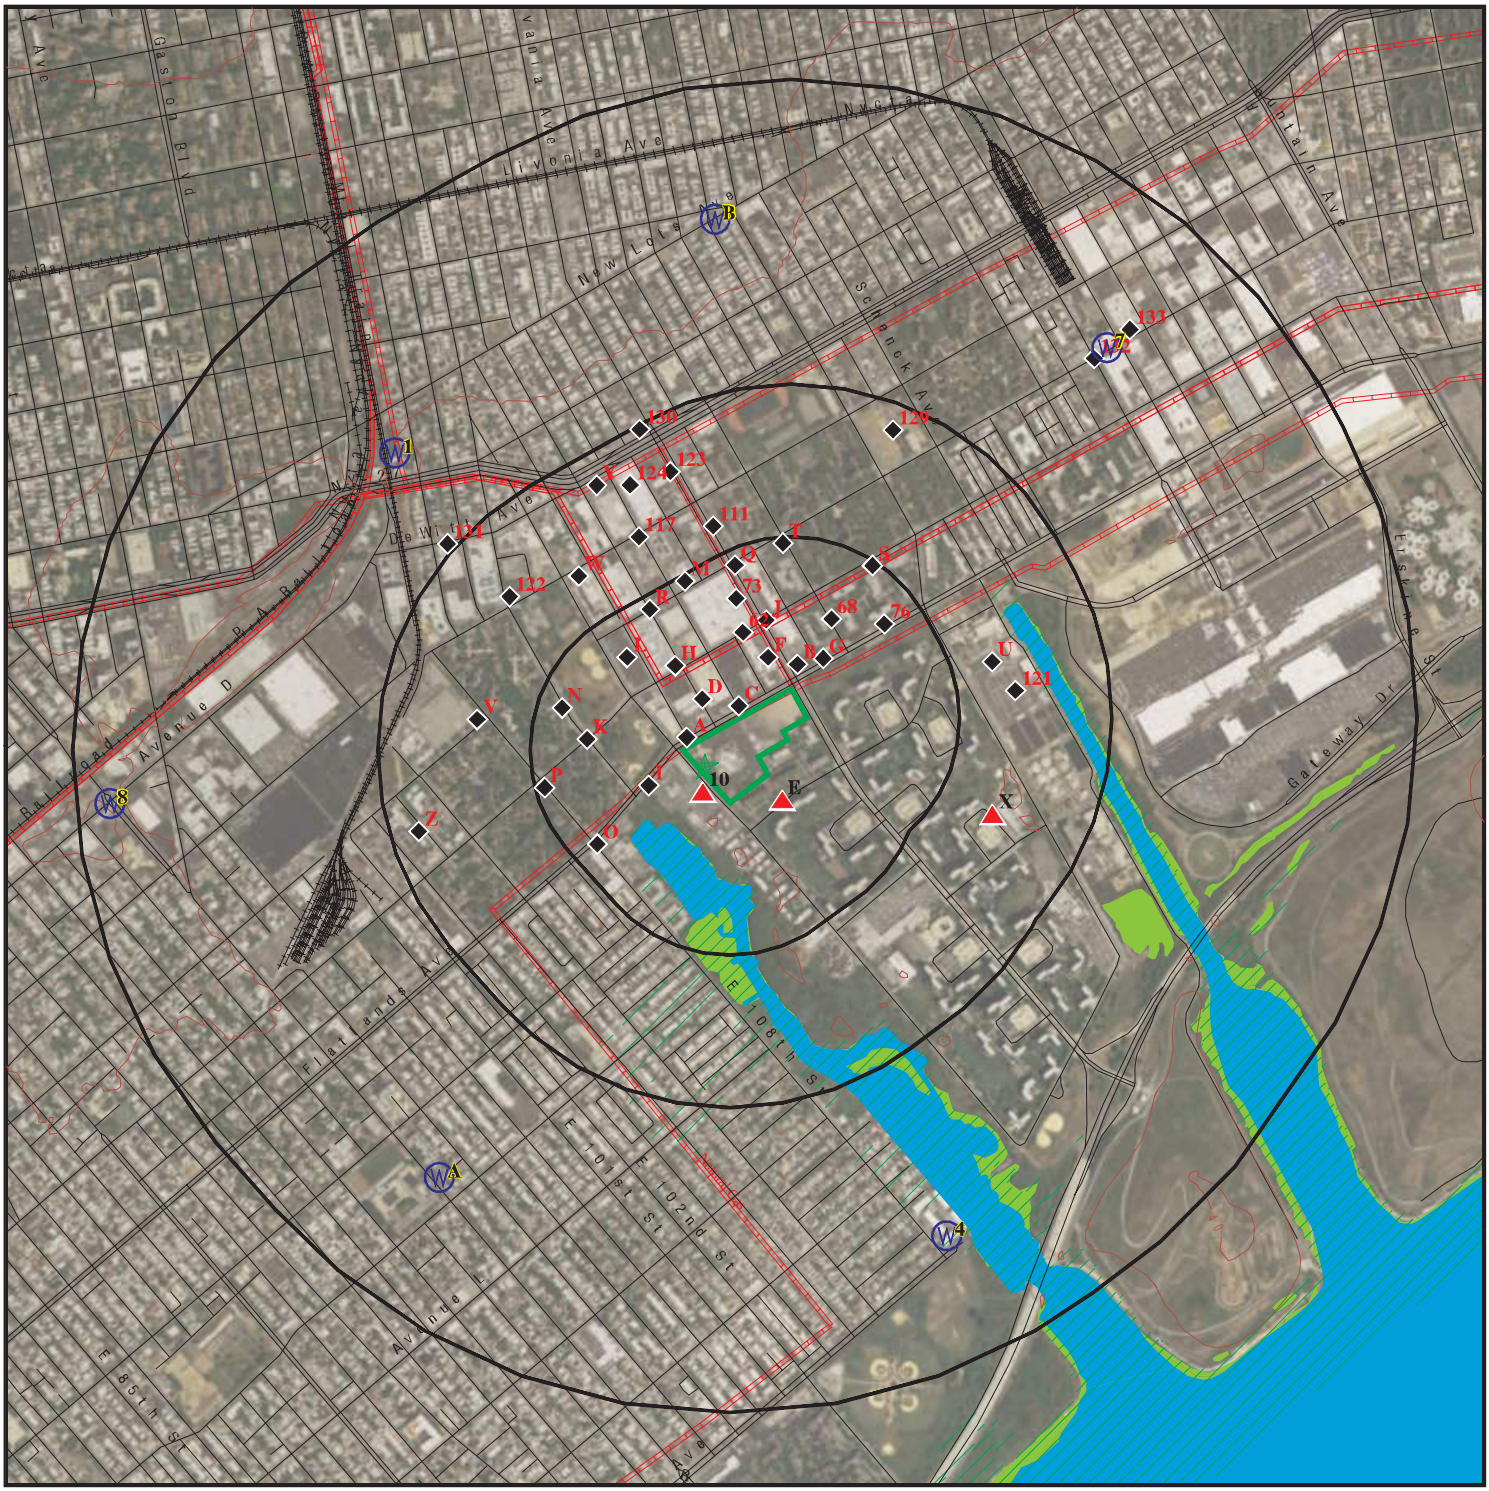

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Christian Cultural Center	CLIENT:	Langan Engineering
ADDRESS:	12020 Flatlands Avenue Brooklyn NY 11207	CONTACT:	Amanda Forsburg
LAT/LONG:	40.650656 / 73.88907	INQUIRY #:	5113516.2s
		DATE:	November 20, 2017 5:42 pm

Copyright © 2017 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 5113516.2S



Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

Indian Reservations BIA

Pipelines

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands

0 1/16 1/8 1/4 Miles

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Christian Cultural Center	CLIENT:	Langan Engineering
ADDRESS:	12020 Flatlands Avenue Brooklyn NY 11207	CONTACT:	Amanda Forsburg
LAT/LONG:	40.650656 / 73.88907	INQUIRY #:	5113516.2s
		DATE:	November 20, 2017 5:46 pm

Copyright © 2017 EDR, Inc. © 2015 TomTom Rel. 2015.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Federal NPL site list								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	0.001		0	NR	NR	NR	NR	0
Federal Delisted NPL site list								
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
Federal CERCLIS NFRAP site list								
SEMS-ARCHIVE	0.500		0	0	0	NR	NR	0
Federal RCRA CORRACTS facilities list								
CORRACTS	1.000		0	0	0	0	NR	0
Federal RCRA non-CORRACTS TSD facilities list								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generators list								
RCRA-LQG	0.250		1	3	NR	NR	NR	4
RCRA-SQG	0.250		0	1	NR	NR	NR	1
RCRA-CESQG	0.250		3	2	NR	NR	NR	5
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROL	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	0.001		0	NR	NR	NR	NR	0
State- and tribal - equivalent CERCLIS								
NY SHWS	1.000		0	0	0	3	NR	3
NY VAPOR REOPENED	1.000		0	0	0	0	NR	0
State and tribal landfill and/or solid waste disposal site lists								
NY SWF/LF	0.500		2	0	0	NR	NR	2
State and tribal leaking storage tank lists								
INDIAN LUST	0.500		0	0	0	NR	NR	0
NY LTANKS	0.500		1	2	18	NR	NR	21
NY HIST LTANKS	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
State and tribal registered storage tank lists								
FEMA UST	0.250		0	0	NR	NR	NR	0
NY UST	0.250		9	3	NR	NR	NR	12
NY CBS UST	0.250		0	0	NR	NR	NR	0
NY MOSF UST	0.500		0	0	1	NR	NR	1
NY CBS	0.250		0	0	NR	NR	NR	0
NY MOSF	0.500		0	0	1	NR	NR	1
NY AST	0.250		4	6	NR	NR	NR	10
NY CBS AST	0.250		0	0	NR	NR	NR	0
NY MOSF AST	0.500		0	0	1	NR	NR	1
INDIAN UST	0.250		0	0	NR	NR	NR	0
NY TANKS	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
NY RES DECL	0.125		1	NR	NR	NR	NR	1
NY ENG CONTROLS	0.500		0	0	0	NR	NR	0
NY INST CONTROL	0.500		0	0	1	NR	NR	1
State and tribal voluntary cleanup sites								
NY VCP	0.500		0	0	1	NR	NR	1
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
NY BROWNFIELDS	0.500		0	0	0	NR	NR	0
NY ERP	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
NY SWTIRE	0.500		0	0	0	NR	NR	0
NY SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
NY DEL SHWS	1.000		0	0	0	0	NR	0
US CDL	0.001		0	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
NY HIST UST	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY HIST AST	0.001		0	NR	NR	NR	NR	0
Local Land Records								
NY LIENS	0.001		0	NR	NR	NR	NR	0
LIENS 2	0.001		0	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
NY Spills	0.125		19	NR	NR	NR	NR	19
NY Hist Spills	0.125		0	NR	NR	NR	NR	0
NY SPILLS 90	0.125		0	NR	NR	NR	NR	0
NY SPILLS 80	0.125		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		11	10	NR	NR	NR	21
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001		0	NR	NR	NR	NR	0
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	0.001		0	NR	NR	NR	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.001		0	NR	NR	NR	NR	0
FINDS	0.001		0	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
DOCKET HWC	0.001		0	NR	NR	NR	NR	0
ECHO	0.001		0	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY AIRS	0.001		0	NR	NR	NR	NR	0
NY COAL ASH	0.500		0	0	0	NR	NR	0
NY DRYCLEANERS	0.250		2	1	NR	NR	NR	3
NY E DESIGNATION	0.125		0	NR	NR	NR	NR	0
NY Financial Assurance	0.001		0	NR	NR	NR	NR	0
NY HSWDS	0.500		0	0	0	NR	NR	0
NY MANIFEST	0.250		11	15	NR	NR	NR	26
RI MANIFEST	0.250		0	0	NR	NR	NR	0
NJ MANIFEST	0.250		3	8	NR	NR	NR	11
NY SPDES	0.001		0	NR	NR	NR	NR	0
NY UIC	0.001		0	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	0	NR	0
EDR Hist Auto	0.125		6	NR	NR	NR	NR	6
EDR Hist Cleaner	0.125		3	NR	NR	NR	NR	3
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
NY RGA HWS	0.001		0	NR	NR	NR	NR	0
NY RGA LF	0.001		0	NR	NR	NR	NR	0
- Totals --		0	76	51	23	3	0	153

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

A1
NW
< 1/8
0.005 mi.
27 ft.

ISO AUTO SERVICE
12026 FLATLANDS AVE
BROOKLYN, NY 11207

Site 1 of 5 in cluster A

EDR Hist Auto **1020465425**
N/A

Relative:
Lower

Actual:
12 ft.

EDR Hist Auto

Year:	Name:	Type:
1969	ISO AUTO SERVICE	Gasoline Service Stations
1970	ISO AUTO SERVICE	Gasoline Service Stations
1971	ISO AUTO SERVICE	Gasoline Service Stations
1972	ISO AUTO SERVICE	Gasoline Service Stations
1973	ISO AUTO SERVICE	Gasoline Service Stations
1974	ISO AUTO SERVICE	Gasoline Service Stations
1975	ISO AUTO SERVICE	Gasoline Service Stations

B2
NE
< 1/8
0.007 mi.
36 ft.

CON EDISON
830 FLATLANDS
BROOKLYN, NY

Site 1 of 15 in cluster B

NY MANIFEST **S117536894**
N/A

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004694030
Facility Status:	Not reported
Location Address 1:	830 FLATLANDS
Code:	BP
Location Address 2:	BC 7565
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	Not reported
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004694030
Mailing Name:	CON EDISON
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PL 15TH FL
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	11/12/2014
Trans1 Recv Date:	11/12/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/17/2014

CON EDISON (Continued) **S117536894**

Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004694030
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	012775080JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	100
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

B3 **CON EDISON** **NY MANIFEST** **S117536895**
NE **830 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.007 mi.
36 ft. **Site 2 of 15 in cluster B**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004694048
Facility Status:	Not reported
Location Address 1:	830 FLATLANDS AVE
Code:	BP
Location Address 2:	V 7872
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY

CON EDISON (Continued) **S117536895**

Location Zip:	Not reported
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004694048
Mailing Name:	CON EDISON
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PL 15TH FL
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	11/12/2014
Trans1 Recv Date:	11/12/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/17/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004694048
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	012775082JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	200
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.

CON EDISON (Continued) **S117536895**

Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

A4 **FRESH CREEK** **NY Spills** **S104787878**
NW **FLATLANDS AVE/LOUISIANA** **N/A**
< 1/8 **BROOKLYN, NY**
0.012 mi.
64 ft. **Site 2 of 5 in cluster A**

Relative:
Lower

Actual:
12 ft.

SPILLS:

Facility ID:	0005213
Facility Type:	ER
Spill Number:	0005213
DER Facility ID:	158815
Site ID:	190387
DEC Region:	2
Spill Number/Closed Date:	2003-03-24
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	2000-08-01
Investigator:	SACCACIO
Referred To:	Not reported
Reported to Dept:	2000-08-01
CID:	281
Water Affected:	FRESH CREEK
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-08-01
Spill Record Last Update:	2003-03-24
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	RUDY FERRO
DEC Memo:	""
Remarks:	"NOTIFIER DISCOVERED ABOVE MATERIAL ON TOP OF ABOVE WATER AT ABOVE LOCATION. NYC DEP HAS CONTACTED S AND D ENVIRONMENTAL TO RESPOND TO LOCATION AND INVESTIGATE THE PROBLEM. NO CALL BACK REQUESTED."

All Materials:

Site ID:	190387
Operable Unit ID:	827804

FRESH CREEK (Continued) **S104787878**

Operable Unit:	01
Material ID:	549944
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

A5 **FRESH CREEK OUT POUR** **NY Spills** **S108763543**
NW **FLAT LANDS & LOUISIANA AV** **N/A**
< 1/8 **BROOKLYN, NY**
0.012 mi.
64 ft. **Site 3 of 5 in cluster A**

Relative:
Lower

Actual:
12 ft.

SPILLS:

Facility ID:	0705343
Facility Type:	ER
Spill Number:	0705343
DER Facility ID:	335019
Site ID:	385639
DEC Region:	2
Spill Number/Closed Date:	2007-08-13
Spill Cause:	Unknown
Spill Class:	D4
SWIS:	2401
Spill Date:	2007-08-09
Investigator:	smsanges
Referred To:	Not reported
Reported to Dept:	2007-08-09
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2007-08-09
Spill Record Last Update:	2007-08-13
Spiller Name:	JOHN CHEN
Spiller Company:	FRESH CREEK OUT POUR
Spiller Address:	FLAT LANDS & LOUISIANA AV
Spiller Company:	999
Contact Name:	JOHN CHEN
DEC Memo:	"contact number did not work - DEP did not have any additional information on the problem. 8/13/2007 No further calls have come in for this site. - closed"
Remarks:	""

All Materials:

Site ID:	385639
Operable Unit ID:	1142903

FRESH CREEK OUT POUR (Continued) **S108763543**

Operable Unit:	01
Material ID:	2133149
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

A6 **CAR ACCIDENT** **NY Spills** **S108637808**
NNW **MALTA ST & FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.014 mi.
76 ft. **Site 4 of 5 in cluster A**

Relative:
Lower

Actual:
13 ft.

SPILLS:

Facility ID:	0702669
Facility Type:	ER
Spill Number:	0702669
DER Facility ID:	331847
Site ID:	382428
DEC Region:	2
Spill Number/Closed Date:	2007-06-11
Spill Cause:	Other
Spill Class:	C4
SWIS:	2401
Spill Date:	2007-06-04
Investigator:	smsanges
Referred To:	Not reported
Reported to Dept:	2007-06-04
CID:	444
Water Affected:	40 GALLONS SEWER
Spill Source:	Commercial Vehicle
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2007-06-04
Spill Record Last Update:	2007-06-11
Spiller Name:	FIREFIGHTER MORRIS
Spiller Company:	Not reported
Spiller Address:	MALTA ST & FLATLANDS AVE
Spiller Company:	001
Contact Name:	FIREFIGHTER MORRIS
DEC Memo:	"Fire dept & DEP dealt with it."
Remarks:	"all went down sewer and frie dept enroute"

All Materials:

Site ID:	382428
Operable Unit ID:	1139826
Operable Unit:	01
Material ID:	2129870

CAR ACCIDENT (Continued) **S108637808**

Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	40.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

C7 **EAST NEW YORK AUTO SALES INC** **NY SWF/LF** **S113492682**
NNE **73 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.018 mi.
97 ft. **Site 1 of 2 in cluster C**

Relative:
Lower

Actual:
12 ft.

SWF/LF:

Flag:	INACTIVE
Region Code:	2
Phone Number:	7186494170
Owner Name:	Not reported
Owner Type:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Contact Name:	Robert Pace
Contact Address:	73 Flatlands Avenue
Contact Addr2:	Not reported
Contact City,St,Zip:	Brooklyn;, NY 11207
Contact Email:	Not reported
Contact Phone:	7186494170
Activity Desc:	Vehicle Dismantling Facility
Activity Number:	Not reported
Active:	No
East Coordinate:	594011
North Coordinate:	4500750
Accuracy Code:	Not reported
Regulatory Status:	Not reported
Waste Type:	Not reported
Authorization #:	Not reported
Authorization Date:	Not reported
Expiration Date:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Laste Date:	Not reported

B8 **CONSTRUCTION SITE** **NY Spills** **S106125164**
NE **127-205 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.018 mi.
97 ft. **Site 3 of 15 in cluster B**

Relative:
Lower

Actual:
10 ft.

SPILLS:

Facility ID:	0311317
Facility Type:	ER
Spill Number:	0311317
DER Facility ID:	248368
Site ID:	307549
DEC Region:	2
Spill Number/Closed Date:	2004-01-14
Spill Cause:	Human Error
Spill Class:	C4
SWIS:	2401
Spill Date:	2004-01-06
Investigator:	MXTIPPLE
Referred To:	Not reported
Reported to Dept:	2004-01-06
CID:	403
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-01-06
Spill Record Last Update:	2004-01-14
Spiller Name:	RAY MESHKATI
Spiller Company:	CONSTRUCTION SITE
Spiller Address:	127-205 FLATLANDS AVE.
Spiller Company:	001
Contact Name:	RAY MESHKATI
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TIPPLE 1/7/04 tipple spoke with Pete Bongiornio from Piccone Construction/(the spiller) Spill was cleaned and drummed. requested a site visit to be scheduled to evaluate petroleum storage area. 1/14/04//SPILL CLEANED//NO FURTHER ACTION NECESSARY"
Remarks:	"less than 5 gallons of hydraulic fluid was spilled at a construction site. they have it all under control."

All Materials:

Site ID:	307549
Operable Unit ID:	878972
Operable Unit:	01
Material ID:	500133
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

B9 **U.S.-1 AUTO SALES & REPAIR, INC.** **NY AST** **A100296480**
NE **12047 FLATLANDS AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.019 mi.
99 ft. **Site 4 of 15 in cluster B**

Relative:
Lower

Actual:
11 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-610185
Program Type:	PBS
UTM X:	594167.86755
UTM Y:	4500829.42034
Expiration Date:	04/18/2011
Site Type:	Other

Affiliation Records:

Site Id:	362756
Affiliation Type:	Facility Owner
Company Name:	ZION RAMI
Contact Type:	MANAGER
Contact Name:	FREDRICH SHOMER
Address1:	120-47 FLATLANDS AVE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(347) 869-1110
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2006-04-18

Site Id:	362756
Affiliation Type:	Mail Contact
Company Name:	U.S.-1 AUTO SALES & REPAIR, INC.
Contact Type:	Not reported
Contact Name:	FREDRICH SHOMER
Address1:	120-47 FLATLANDS AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 257-6492
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2006-04-18

Site Id:	362756
Affiliation Type:	Facility Operator
Company Name:	U.S.-1 AUTO SALES & REPAIR, INC.
Contact Type:	Not reported
Contact Name:	FREDRICH SHOMER
Address1:	Not reported
Address2:	Not reported
City:	Not reported

U.S.-1 AUTO SALES & REPAIR, INC. (Continued) **A100296480**

State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 257-6492
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2006-04-18

Site Id: 362756
Affiliation Type: Emergency Contact
Company Name: ZION RAMI
Contact Type: Not reported
Contact Name: FREDRICH SHOMER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 257-6492
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2006-04-18

Tank Info:

Tank Number: 001
Tank Id: 211242
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Equipment Records:

F06 - Pipe External Protection - Wrapped
J02 - Dispenser - Suction Dispenser
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
E00 - Piping Secondary Containment - None
K01 - Spill Prevention - Catch Basin
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F02 - Pipe External Protection - Original Sacrificial Anode
G01 - Tank Secondary Containment - Diking (Aboveground)
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
A02 - Tank Internal Protection - Rubber Liner

Tank Location: 2
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 01/30/2000
Capacity Gallons: 275
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported

U.S.-1 AUTO SALES & REPAIR, INC. (Continued) **A100296480**

Date Tank Closed:	Not reported
Register:	True
Modified By:	NRLOMBAR
Last Modified:	04/14/2017
Material Name:	Not reported

10
South
< 1/8
0.021 mi.
113 ft.

LOT 48,TAXBLOCK 8235
430 LOUISIANA AVENUE
BROOKLYN, NY 11207

NY RES DECL **S116688208**
N/A

Relative:
Higher

Actual:
18 ft.

RES DECL:

Borough Code:	BK
Tax Block:	8235
Tax Lot:	48
Restrictive Decl. No.:	D-47
Cp ulurp No.:	M770445(A) ZMK
Zoning Map No.:	17d,23c

A11
West
< 1/8
0.024 mi.
125 ft.

PATHMARK 72634
111-10 FLATLANDS AVE
BROOKLYN, NY 11207

RCRA NonGen / NLR **1018159216**
FINDS **NYR000223214**
ECHO

Site 5 of 5 in cluster A

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	04/18/2017
Facility name:	PATHMARK 72634
Facility address:	111-10 FLATLANDS AVE BROOKLYN, NY 11207
EPA ID:	NYR000223214
Mailing address:	PARAGON DR MONTVALE, NJ 07645
Contact:	LISA CARONE
Contact address:	PARAGON DR MONTVALE, NJ 07645
Contact country:	US
Contact telephone:	201-571-8428
Contact email:	CARONEL@APTEA.COM
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	PATHMARK 72634
Owner/operator address:	Not reported Not reported
Owner/operator country:	Not reported
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private

PATHMARK 72634 (Continued) **1018159216**

Owner/Operator Type: Operator
Owner/Op start date: 04/22/1981
Owner/Op end date: Not reported

Owner/operator name: PATHMARK 72634
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/22/1981
Owner/Op end date: Not reported

Owner/operator name: THE GREAT ATLANTIC & PACIFIC TEA CO INC
Owner/operator address: PARAGON DR
MONTVALE, NJ 07645
Owner/operator country: US
Owner/operator telephone: 201-573-9700
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 04/22/1981
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: D003
. Waste name: REACTIVE WASTE

. Waste code: D007

PATHMARK 72634 (Continued) **1018159216**

. Waste name: CHROMIUM

. Waste code: D009
. Waste name: MERCURY

. Waste code: D010
. Waste name: SELENIUM

. Waste code: D011
. Waste name: SILVER

. Waste code: P001
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

. Waste code: P042
. Waste name: 1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE

. Waste code: P075
. Waste name: NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS

. Waste code: P081
. Waste name: 1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)

. Waste code: U035
. Waste name: BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) CHLORAMBUCIL

. Waste code: U122
. Waste name: FORMALDEHYDE

. Waste code: U129
. Waste name: CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)- (OR) LINDANE

. Waste code: U150
. Waste name: L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN

. Waste code: U188
. Waste name: PHENOL

. Waste code: U248
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYL-BUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS

Historical Generators:
Date form received by agency: 10/13/2015
Site name: PATHMARK 72634
Classification: Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002

PATHMARK 72634 (Continued) **1018159216**

. Waste name: CORROSIVE WASTE

. Waste code: D003
. Waste name: REACTIVE WASTE

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D009
. Waste name: MERCURY

. Waste code: D010
. Waste name: SELENIUM

. Waste code: D011
. Waste name: SILVER

. Waste code: P001
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

. Waste code: P042
. Waste name: 1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE

. Waste code: P075
. Waste name: NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS

. Waste code: P081
. Waste name: 1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)

. Waste code: U035
. Waste name: BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) CHLORAMBUCIL

. Waste code: U122
. Waste name: FORMALDEHYDE

. Waste code: U129
. Waste name: CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)- (OR) LINDANE

. Waste code: U150
. Waste name: L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN

. Waste code: U188
. Waste name: PHENOL

. Waste code: U248
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYL-BUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS

Violation Status: No violations found

FINDS:

PATHMARK 72634 (Continued) **1018159216**

Registry ID: 110066948227

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1018159216
Registry ID: 110066948227
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110066948227

B12 **SINGLE PINE SERVICE CENTER INC** **EDR Hist Auto** **1021854268**
NE **121-09 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.025 mi.
131 ft. **Site 5 of 15 in cluster B**

Relative: **Lower**

Actual: **11 ft.**

EDR Hist Auto

Year:	Name:	Type:
1974	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1975	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1976	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1977	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1978	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1979	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1980	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations
1982	SINGLE PINE SERVICE CENTER INC	Gasoline Service Stations

---

B13 **FLAT GAS INC** **NY AST** **U003200575**
NE **120-99 FLATLANDS AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.027 mi.
144 ft. **Site 6 of 15 in cluster B**

Relative: **Lower**

Actual: **11 ft.**

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-603120
Program Type: PBS
UTM X: 586860.14102
UTM Y: 4505700.69917
Expiration Date: 07/21/2020
Site Type: Other Wholesale/Retail Sales

Affiliation Records:
Site Id: 25072

FLAT GAS INC (Continued) **U003200575**

Affiliation Type:	Emergency Contact
Company Name:	DAVID OIL CORP.
Contact Type:	Not reported
Contact Name:	JAY SEMELMACHER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(516) 993-4750
EMail:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	2008-10-28

Site Id:	25072
Affiliation Type:	Mail Contact
Company Name:	SPARTAN PETROLEUM CORP
Contact Type:	Not reported
Contact Name:	JAY SEMELMACHER
Address1:	3333 NEW HYDE PARK ROAD
Address2:	SUITE 201
City:	NEW HYDE PARK
State:	NY
Zip Code:	11042
Country Code:	001
Phone:	(516) 365-8700
EMail:	JZ@SPARTANPETRO.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2015-04-29

Site Id:	25072
Affiliation Type:	Facility Owner
Company Name:	SPARTAN PETROLEUM CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	3333 NEW HYDE PARK ROAD, SUITE 201
Address2:	Not reported
City:	NEW HYDE PARK
State:	NY
Zip Code:	11042
Country Code:	001
Phone:	(516) 365-8700
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-10-14

Site Id:	25072
Affiliation Type:	Facility Operator
Company Name:	FLAT GAS INC
Contact Type:	Not reported
Contact Name:	MICHAEL YARDENI
Address1:	Not reported
Address2:	Not reported

FLAT GAS INC (Continued) **U003200575**

City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 257-3844
EMail:	Not reported
Fax Number:	Not reported
Modified By:	AYLAGATI
Date Last Modified:	2017-02-24

Tank Info:

Tank Number:	4
Tank Id:	58513
Material Code:	0015
Common Name of Substance:	Motor Oil

Equipment Records:

L00 - Piping Leak Detection - None
D00 - Pipe Type - No Piping
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G12 - Tank Secondary Containment - Double-Walled (AG only)
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)

Tank Location:	3
Tank Type:	Equivalent Technology
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NTFREEMA
Last Modified:	04/14/2017
Material Name:	Not reported

Tank Number:	5
Tank Id:	58514
Material Code:	0021
Common Name of Substance:	Transmission Fluid

Equipment Records:

L00 - Piping Leak Detection - None
D00 - Pipe Type - No Piping
A00 - Tank Internal Protection - None
K00 - Spill Prevention - None

FLAT GAS INC (Continued) **U003200575**

E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G12 - Tank Secondary Containment - Double-Walled (AG only)
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)

Tank Location:	3
Tank Type:	Equivalent Technology
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	NTFREEMA
Last Modified:	04/14/2017
Material Name:	Not reported

Tank Number:	6
Tank Id:	63471
Material Code:	0022
Common Name of Substance:	Waste Oil/Used Oil

Equipment Records:

K00 - Spill Prevention - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
E00 - Piping Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
G12 - Tank Secondary Containment - Double-Walled (AG only)
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
C01 - Pipe Location - Aboveground

Tank Location:	3
Tank Type:	Equivalent Technology
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	MXLAY
Last Modified:	04/14/2017
Material Name:	Not reported

B14 **FLAT GAS INC** **NY UST** **U004062739**
NE **120-99 FLATLANDS AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.027 mi.
144 ft. **Site 7 of 15 in cluster B**

Relative:
Lower

Actual:
11 ft.

UST:

Id/Status:	2-603120 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	07/21/2020
UTM X:	586860.14102
UTM Y:	4505700.69917
Site Type:	Other Wholesale/Retail Sales

Affiliation Records:

Site Id:	25072
Affiliation Type:	Emergency Contact
Company Name:	DAVID OIL CORP.
Contact Type:	Not reported
Contact Name:	JAY SEMELMACHER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(516) 993-4750
EMail:	Not reported
Fax Number:	Not reported
Modified By:	dxliving
Date Last Modified:	2008-10-28

Site Id:	25072
Affiliation Type:	Mail Contact
Company Name:	SPARTAN PETROLEUM CORP
Contact Type:	Not reported
Contact Name:	JAY SEMELMACHER
Address1:	3333 NEW HYDE PARK ROAD
Address2:	SUITE 201
City:	NEW HYDE PARK
State:	NY
Zip Code:	11042
Country Code:	001
Phone:	(516) 365-8700
EMail:	JZ@SPARTANPETRO.COM
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2015-04-29

Site Id:	25072
Affiliation Type:	Facility Owner
Company Name:	SPARTAN PETROLEUM CORP
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	3333 NEW HYDE PARK ROAD, SUITE 201
Address2:	Not reported
City:	NEW HYDE PARK
State:	NY

FLAT GAS INC (Continued) **U004062739**

Zip Code:	11042
Country Code:	001
Phone:	(516) 365-8700
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-10-14

Site Id:	25072
Affiliation Type:	Facility Operator
Company Name:	FLAT GAS INC
Contact Type:	Not reported
Contact Name:	MICHAEL YARDENI
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 257-3844
EMail:	Not reported
Fax Number:	Not reported
Modified By:	AYLAGATI
Date Last Modified:	2017-02-24

Tank Info:

Tank Number:	1
Tank ID:	53141
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	1000
Install Date:	01/01/1990
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0015
Common Name of Substance:	Motor Oil

Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	NTFREEMA
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
E04 - Piping Secondary Containment - Double walled UG
C02 - Pipe Location - Underground/On-ground

FLAT GAS INC (Continued) **U004062739**

F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 2
Tank ID: 53142
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 2500
Install Date: 02/01/1990
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NTFREEMA
Last Modified: 04/14/2017

Equipment Records:

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
E04 - Piping Secondary Containment - Double walled UG
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 3
Tank ID: 53143
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 2500
Install Date: 02/01/1990
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0015
Common Name of Substance: Motor Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NTFREEMA

FLAT GAS INC (Continued) **U004062739**

Last Modified: 04/14/2017

Equipment Records:

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
E04 - Piping Secondary Containment - Double walled UG
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
G04 - Tank Secondary Containment - Double-Walled (Underground)

D15 **120-33 FLATLANDS AVE** **NY Spills** **S103484990**
NNW **120-33 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.028 mi.
150 ft. **Site 1 of 3 in cluster D**

Relative:
Lower

Actual:
13 ft.

SPILLS:

Facility ID:	9808202
Facility Type:	ER
Spill Number:	9808202
DER Facility ID:	238182
Site ID:	294309
DEC Region:	2
Spill Number/Closed Date:	1998-10-30
Spill Cause:	Deliberate
Spill Class:	C4
SWIS:	2401
Spill Date:	1998-09-24
Investigator:	SACCACIO
Referred To:	Not reported
Reported to Dept:	1998-10-04
CID:	382
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1998-10-04
Spill Record Last Update:	1998-10-30
Spiller Name:	Not reported
Spiller Company:	R A J AUTO PARTS
Spiller Address:	120-33 FLATLANDS AVE
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	""
Remarks:	"CALLER STATES THAT HE HAS SEEN THIS BUSINESS DUMP OIL ONTO THE ROAD. REFUSED TO OFFER ANYMORE INFORMATION AND ASKED ABOUT CONCRETE FLOORING. UNSURE OF WHY."

120-33 FLATLANDS AVE (Continued) **S103484990**

All Materials:

Site ID:	294309
Operable Unit ID:	1069389
Operable Unit:	01
Material ID:	315724
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

C16 **ULTIMATE USED AUTO PARTS INC** **NY SWF/LF** **S108146177**
NNE **120-49 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.028 mi.
150 ft. **Site 2 of 2 in cluster C**

Relative:
Lower

Actual:
14 ft.

SWF/LF:

Flag:	ACTIVE
Region Code:	2
Phone Number:	7182725700
Owner Name:	Natan Seri
Owner Type:	Private
Owner Address:	135 Grace Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Plainview, NY 11803
Owner Email:	Not reported
Owner Phone:	7182725700
Contact Name:	Natan Seri
Contact Address:	120-49 Flatlands Avenue
Contact Addr2:	Not reported
Contact City,St,Zip:	Brooklyn, NY 11207
Contact Email:	ultimatecarpartsinc@gmail.com
Contact Phone:	7182725700
Activity Desc:	Vehicle Dismantling Facility
Activity Number:	[7095932]
Active:	Yes
East Coordinate:	593992
North Coordinate:	4500739
Accuracy Code:	Not reported
Regulatory Status:	Not reported
Waste Type:	Not reported
Authorization #:	Not reported
Authorization Date:	Not reported
Expiration Date:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Laste Date:	Not reported

B17
NE
< 1/8
0.042 mi.
222 ft.

PENN & FLAT GETTY
1121 PENNSYLVANIA AVE
BROOKLYN, NY 11207

Site 8 of 15 in cluster B

NY UST **1001080182**
FINDS **N/A**
ECHO

Relative:
Lower

Actual:
12 ft.

UST:

Id/Status:	2-203963 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	08/24/2022
UTM X:	594164.44745
UTM Y:	4500849.66681
Site Type:	Retail Gasoline Sales

Affiliation Records:

Site Id:	7067
Affiliation Type:	Facility Owner
Company Name:	SPJ DISTRIBUTORS, INC.
Contact Type:	VICE PRESIDENT
Contact Name:	JON HALPERIN
Address1:	1144 ATLANTIC AVENUE
Address2:	Not reported
City:	BALDWIN
State:	NY
Zip Code:	11510
Country Code:	001
Phone:	(516) 546-8414
EMail:	JONNYHALP@AOL.COM
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-09-06

Site Id:	7067
Affiliation Type:	Mail Contact
Company Name:	SPJ DISTRIBUTORS, INC.
Contact Type:	VICE PRESIDENT
Contact Name:	JON HALPERIN
Address1:	1144 ATLANTIC AVENUE
Address2:	Not reported
City:	BALDWIN
State:	NY
Zip Code:	11510
Country Code:	001
Phone:	(516) 546-8414
EMail:	JONNYHALP@AOL.COM
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-09-06

Site Id:	7067
Affiliation Type:	Emergency Contact
Company Name:	SPJ DISTRIBUTORS, INC.
Contact Type:	Not reported
Contact Name:	JON HALPERIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN

PENN & FLAT GETTY (Continued) **1001080182**

Zip Code:	Not reported
Country Code:	999
Phone:	(516) 546-8414
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-09-06

Site Id:	7067
Affiliation Type:	Facility Operator
Company Name:	PENN & FLAT CITGO
Contact Type:	Not reported
Contact Name:	PETER HALPERIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 272-0874
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-01

Tank Info:

Tank Number:	001
Tank ID:	18541
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	01/01/1978
Date Tank Closed:	10/01/1996
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

Tightness Test Method:	03
Date Test:	12/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MFLEONAR
Last Modified:	09/06/2017

Equipment Records:

A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

PENN & FLAT GETTY (Continued) **1001080182**

Tank Number: 002
Tank ID: 18542
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 01/01/1978
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

Equipment Records:

B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 003
Tank ID: 18543
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1969
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

Equipment Records:

A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground

PENN & FLAT GETTY (Continued) **1001080182**

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 004
Tank ID: 18544
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1969
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

Equipment Records:

A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 005
Tank ID: 18545
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1969
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

PENN & FLAT GETTY (Continued) **1001080182**

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number:	006
Tank ID:	18546
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1969
Date Tank Closed:	10/01/1996
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

Tightness Test Method:	03
Date Test:	12/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MFLEONAR
Last Modified:	09/06/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number:	007
Tank ID:	18547
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	11/01/1969
Date Tank Closed:	10/01/1996
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

PENN & FLAT GETTY (Continued) **1001080182**

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number: 008
Tank ID: 18548
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 11/01/1969
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 12/01/1993
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None

Tank Number: 009
Tank ID: 18549
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 11/01/1969
Date Tank Closed: 10/01/1996

PENN & FLAT GETTY (Continued) **1001080182**

Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	03
Date Test:	12/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number:	010
Tank ID:	52515
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	04/01/1997
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MFLEONAR
Last Modified:	09/06/2017

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

PENN & FLAT GETTY (Continued) **1001080182**

G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 011
Tank ID: 52516
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 04/01/1997
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector

Tank Number: 012
Tank ID: 52517
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 04/01/1997
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MFLEONAR
Last Modified: 09/06/2017

PENN & FLAT GETTY (Continued) **1001080182**

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	013
Tank ID:	52518
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	04/01/1997
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MFLEONAR
Last Modified:	09/06/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)

FINDS:

Registry ID: 110009488241

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource

PENN & FLAT GETTY (Continued) **1001080182**

Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1001080182
Registry ID: 110009488241
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110009488241

B18 **JOES ARCHER THRIFTWAY AUTORAMA** **EDR Hist Auto** **1020431853**
NE **1121 PENNSYLVANIA** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.042 mi.
222 ft. **Site 9 of 15 in cluster B**

Relative: **Lower**

EDR Hist Auto

Actual: **12 ft.**

Year:	Name:	Type:
1969	MI MI & JIMMYS SERVICE CENTER*	Gasoline Service Stations
1971	JOES ARCHER THRIFTWAY AUTORAMA	Gasoline Service Stations
1972	JOES ARCHER THRIFTWAY AUTORAMA	Gasoline Service Stations
1973	JOES ARCHER THRIFTWAY AUTORAMA	Gasoline Service Stations
1974	JOES ARCHER THRIFTWAY AUTORAMA	Gasoline Service Stations
1989	MORGAN AUTO REPAIR	General Automotive Repair Shops
1990	MORGAN AUTO REPAIR	General Automotive Repair Shops
1991	MORGAN AUTO REPAIR	General Automotive Repair Shops
1992	MORGAN AUTO REPAIR	General Automotive Repair Shops
1995	BHI SERVICE CENTER INC	Gasoline Service Stations
2001	CPG DISTRIBUTION CORP	Gasoline Service Stations
2002	CPG DISTRIBUTION CORP	Gasoline Service Stations
2003	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2004	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2005	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2006	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2007	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2008	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2009	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2010	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2011	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2012	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2013	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations
2014	CPG DISTRIBUTION CORPORATION	Gasoline Service Stations

B19
NE
< 1/8
0.042 mi.
222 ft.

PENN & FLAT GETTY
1121 PENNSYLVANIA AVE
BROOKLYN, NY 11207

Site 10 of 15 in cluster B

RCRA NonGen / NLR **1007112672**
NYR000119743

Relative:
Lower

Actual:
12 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	PENN & FLAT GETTY
Facility address:	1121 PENNSYLVANIA AVE BROOKLYN, NY 11207
EPA ID:	NYR000119743
Mailing address:	NOSTRAND AVE BROOKLYN, NY 11510
Contact:	JESSE HALPERIN
Contact address:	NOSTRAND AVE BROOKLYN, NY 11510
Contact country:	US
Contact telephone:	718-826-6740
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	1833 NOSTRAND AVENUE CORP
Owner/operator address:	1833 NOSTRAND AVE BROOKLYN, NY 11510
Owner/operator country:	US
Owner/operator telephone:	718-826-6740
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	1833 NOSTRAND AVENUE CORP
Owner/operator address:	1833 NOSTRAND AVE BROOKLYN, NY 11510
Owner/operator country:	US
Owner/operator telephone:	718-826-6740
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No

PENN & FLAT GETTY (Continued) **1007112672**

On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency:	01/01/2007
Site name:	PENN & FLAT GETTY
Classification:	Not a generator, verified
Date form received by agency:	01/01/2006
Site name:	PENN & FLAT GETTY
Classification:	Not a generator, verified
Date form received by agency:	01/01/2006
Site name:	PENN & FLAT GETTY
Classification:	Not a generator, verified
Date form received by agency:	10/23/2003
Site name:	PENN & FLAT GETTY
Classification:	Conditionally Exempt Small Quantity Generator
. Waste code:	D001
. Waste name:	IGNITABLE WASTE
Date form received by agency:	11/29/1995
Site name:	PENN & FLAT GETTY
Classification:	Not a generator, verified
. Waste code:	NONE
. Waste name:	None
Violation Status:	No violations found

B20 **1121 PENNSYLVANIA AVE** **NY Spills** **S102662703**
NE **1121 PENNSYLVANIA AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.042 mi.
222 ft. **Site 11 of 15 in cluster B**

Relative:
Lower

Actual:
12 ft.

SPILLS:

Facility ID:	9711920
Facility Type:	ER
Spill Number:	9711920
DER Facility ID:	200477
Site ID:	244091
DEC Region:	2
Spill Number/Closed Date:	1998-04-23
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	1998-01-24
Investigator:	O'DOWD

1121 PENNSYLVANIA AVE (Continued) **S102662703**

Referred To:	Not reported
Reported to Dept:	1998-01-24
CID:	365
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Fire Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1998-01-24
Spill Record Last Update:	1998-04-23
Spiller Name:	ANWAR-UL-HASSAN
Spiller Company:	GETTY GAS STATION
Spiller Address:	1121 PENNSYLVANIA
Spiller Company:	001
Contact Name:	ANWAR-UL-HASSAN
DEC Memo:	""
Remarks:	"WORKER CHANGE A PIECE OF EQUIPMENT AND SPILLED GAS - 5 GALLONS WENT INTO SEWER"

All Materials:

Site ID:	244091
Operable Unit ID:	1058286
Operable Unit:	01
Material ID:	326551
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	15.00
Oxygenate:	Not reported

Facility ID:	9609479
Facility Type:	ER
Spill Number:	9609479
DER Facility ID:	7058
Site ID:	266183
DEC Region:	2
Spill Number/Closed Date:	2007-03-20
Spill Cause:	Other
Spill Class:	C4
SWIS:	2401
Spill Date:	1996-10-29
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	1996-10-29
CID:	351
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

1121 PENNSYLVANIA AVE (Continued) **S102662703**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1996-10-29
Spill Record Last Update:	2007-03-20
Spiller Name:	Not reported
Spiller Company:	1883 NORSTROM AVE CORP
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	MURALI SAGAR
DEC Memo:	"3/11/03 - SAMUEL- File available in active unassigned spill files. 4/12/04-Vought-Spill transferred from Tomasello to Rommel as per Rommel. 3/31/06 Diaz - Next steps - verify reports in file verify proper tank closure and removal of contaminated soil. 9/7/06 - Austin - Assigned from Albany to Region 2 staff (Rahman) for review and closure - end Files in cabinet-SR 03/14/07 Rahman-Reviewed the reports prepared by both TONE Tank and Berninger Environmental.In 1996 seven 550 and two 4000 gallon gasoline USTs were removed.Twenty(20) soil samples were collected to delineate the underground contamination.All samples came back with below TAGM level of VOCs and SVOCs except Sample #10, that had slight exceedance of voc/svoc.Disposal manifest for contaminated soil was provided.NFA required."
Remarks:	"CALLER WAS REMOVING TANKS FROM SITE AND FOUND CONTAMINATED SOIL"

All Materials:

Site ID:	266183
Operable Unit ID:	1037535
Operable Unit:	01
Material ID:	345204
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

B21 **FLAT GAS INC** **NY Spills** **1000556257**
NE **1130 PENNSYLVANIA AVE** **RCRA NonGen / NLR** **NYD986988178**
< 1/8 **BROOKLYN, NY 11207** **US AIRS**
0.044 mi. **FINDS**
231 ft. **Site 12 of 15 in cluster B** **ECHO**

Relative:
Lower

Actual:
10 ft.

SPILLS:

Facility ID:	0210596
Facility Type:	ER
Spill Number:	0210596
DER Facility ID:	226047
Site ID:	278393
DEC Region:	2
Spill Number/Closed Date:	2003-03-10
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401

FLAT GAS INC (Continued) **1000556257**

Spill Date:	2003-01-21
Investigator:	SAMUEL
Referred To:	Not reported
Reported to Dept:	2003-01-21
CID:	397
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	2003-01-21
Spill Record Last Update:	2004-06-30
Spiller Name:	Not reported
Spiller Company:	DAVID OIL/FLAT GAS INC
Spiller Address:	1360 BRUCKNER AVE
Spiller Company:	001
Contact Name:	JAY SEMMELMACHER
DEC Memo:	""
Remarks:	"leak in flex hose 1/4 gallon all cleaned"

All Materials:

Site ID:	278393
Operable Unit ID:	863971
Operable Unit:	01
Material ID:	513977
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	1.00
Oxygenate:	Not reported

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	FLAT GAS INC
Facility address:	1130 PENNSYLVANIA AVE BROOKLYN, NY 11207-9008
EPA ID:	NYD986988178
Mailing address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact:	Not reported
Contact address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

FLAT GAS INC (Continued) **1000556257**

Owner/Operator Summary:
Owner/operator name: AMOCO OIL CO
Owner/operator address: 555 LONG WHARF DR
NEW HAVEN, CT 06511
Owner/operator country: US
Owner/operator telephone: 203-865-1910
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: AMOCO OIL CO
Owner/operator address: 555 LONG WHARF DR
NEW HAVEN, CT 06511
Owner/operator country: US
Owner/operator telephone: 203-865-1910
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: FLAT GAS INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: FLAT GAS INC
Classification: Not a generator, verified

Date form received by agency: 12/13/1991
Site name: FLAT GAS INC
Classification: Large Quantity Generator

FLAT GAS INC (Continued) **1000556257**

. Waste code: D000
. Waste name: Not Defined

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D008
. Waste name: LEAD

. Waste code: D018
. Waste name: BENZENE

Violation Status: No violations found

US AIRS MINOR:
Envid: 1000556257
Region Code: 02
Programmatic ID: AIR NY0000002610500147
Facility Registry ID: 110001572414
D and B Number: Not reported
Primary SIC Code: 5541
NAICS Code: 999999
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:
Region Code: 02
Programmatic ID: AIR NY0000002610500147
Facility Registry ID: 110001572414
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-04-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:

Registry ID: 110001572414

Environmental Interest/Information System
AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FLAT GAS INC (Continued) **1000556257**

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000556257
Registry ID:	110001572414
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110001572414

B22 **FLAT GAS INC** **EDR Hist Auto** **1020719404**
NE **1130 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.044 mi.
231 ft. **Site 13 of 15 in cluster B**

Relative: **Lower**

Actual: **10 ft.**

EDR Hist Auto

Year:	Name:	Type:
1996	FLAT GAS INC	Gasoline Service Stations, NEC
1996	BERENBLAT REUBEN	Gasoline Service Stations
1997	FLAT GAS INC	Gasoline Service Stations, NEC
1997	BERENBLAT REUBEN	Gasoline Service Stations
1998	FLAT GAS INC	Gasoline Service Stations, NEC
1999	FLAT GAS INC	Gasoline Service Stations, NEC
1999	FLAT GAS INC	Gasoline Service Stations
2000	FLAT GAS INC	Gasoline Service Stations, NEC
2001	FLAT GAS INC	Gasoline Service Stations, NEC
2002	FLAT GAS INC	Gasoline Service Stations, NEC
2003	FLAT GAS INC	Gasoline Service Stations, NEC
2004	FLAT GAS INC	Gasoline Service Stations, NEC
2005	FLAT GAS INC	Gasoline Service Stations, NEC
2006	FLAT GAS INC	Gasoline Service Stations, NEC
2007	FLAT GAS INC	Gasoline Service Stations, NEC
2008	FLAT GAS INC	Gasoline Service Stations, NEC
2009	FLAT GAS INC	Gasoline Service Stations, NEC
2010	FLAT GAS INC	Gasoline Service Stations, NEC
2011	FLAT GAS INC	Gasoline Service Stations, NEC
2012	FLAT GAS INC	Gasoline Service Stations, NEC
2013	FLAT GAS INC	Gasoline Service Stations, NEC
2014	FLAT GAS INC	Gasoline Service Stations, NEC

B23
NE
< 1/8
0.044 mi.
231 ft.

SPARTAN PETROLEUM INC/ FMR FLAT GAS
1130 PENNSYLVANIA AVE
BROOKLYN, NY 11207

Site 14 of 15 in cluster B

NY MANIFEST **S117735975**
N/A

Relative:
Lower

Actual:
10 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYD986988178
Facility Status:	Not reported
Location Address 1:	1130 PENNSYLVANIA AVENUE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD986988178
Mailing Name:	SPARTAN PETROLEUM INC/ FMR FLAT GAS
Mailing Contact:	SPARTAN PETROLEUM INC/ FMR FLAT GAS
Mailing Address 1:	333 NEW HYDE PARK RD
Mailing Address 2:	Not reported
Mailing City:	NEW HYDE PARK
Mailing State:	NY
Mailing Zip:	11042
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	5163658700

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NJR000029967
Trans2 State ID:	Not reported
Generator Ship Date:	11/17/2014
Trans1 Recv Date:	11/17/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/17/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986988178
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported
Manifest Tracking Number:	013915645JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	Y
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported

SPARTAN PETROLEUM INC/ FMR FLAT GAS (Continued) **S117735975**

Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	48860
Units:	P - Pounds
Number of Containers:	1
Container Type:	DT - Dump trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
6 additional NY_MANIFEST: record(s) in the EDR Site Report.

B24 **FLAT GAS INC.** **NY UST** **U001839103**
NE **1130 PENNSYLVANIA AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.044 mi.
231 ft. **Site 15 of 15 in cluster B**

Relative:
Lower

Actual:
10 ft.

UST:

Id/Status:	2-337749 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	02/18/2019
UTM X:	594114.17681
UTM Y:	4500821.97436
Site Type:	Retail Gasoline Sales

Affiliation Records:

Site Id:	16204
Affiliation Type:	Emergency Contact
Company Name:	SPARTAN PETROLEUM CORP
Contact Type:	Not reported
Contact Name:	JAY SEMELMACHER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(516) 993-4750
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MFLEONAR

FLAT GAS INC. (Continued) **U001839103**

Date Last Modified: 2017-05-18

Site Id: 16204
Affiliation Type: Mail Contact
Company Name: SPARTAN PETROLEUM CORP
Contact Type: Not reported
Contact Name: JAY SEMELMACHER
Address1: 3333 NEW HYDE PARK ROAD
Address2: SUITE 201
City: NEW HYDE PARK
State: NY
Zip Code: 11042
Country Code: 001
Phone: (516) 365-8700
EMail: JZ@SPARTANPETRO.COM
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2015-04-29

Site Id: 16204
Affiliation Type: Facility Owner
Company Name: SPARTAN PETROLEUM CORP
Contact Type: Not reported
Contact Name: Not reported
Address1: 3333 NEW HYDE PARK ROAD, SUITE 201
Address2: Not reported
City: NEW HYDE PARK
State: NY
Zip Code: 11042
Country Code: 001
Phone: (516) 365-8700
EMail: Not reported
Fax Number: Not reported
Modified By: DAFRANCI
Date Last Modified: 2016-10-14

Site Id: 16204
Affiliation Type: Facility Operator
Company Name: FLAT GAS INC.
Contact Type: Not reported
Contact Name: MICHAEL YARDENI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 257-3844
EMail: Not reported
Fax Number: Not reported
Modified By: MXLAY
Date Last Modified: 2016-09-07

Tank Info:

Tank Number: 001
Tank ID: 28830

FLAT GAS INC. (Continued) **U001839103**

Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 4000
Install Date: 12/01/1972
Date Tank Closed: 06/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None

Tank Number: 002
Tank ID: 28831
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 4000
Install Date: 12/01/1972
Date Tank Closed: 06/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None

FLAT GAS INC. (Continued) **U001839103**

I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number:	003
Tank ID:	28832
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	12/01/1978
Date Tank Closed:	06/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number:	004
Tank ID:	28833
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	12/01/1978
Date Tank Closed:	06/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None

FLAT GAS INC. (Continued) **U001839103**

I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None

Tank Number:	005
Tank ID:	28834
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	12/01/1978
Date Tank Closed:	06/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number:	01
Tank ID:	46477
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/01/1993
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	21
Date Test:	01/20/2005
Next Test Date:	Not reported

FLAT GAS INC. (Continued) **U001839103**

Pipe Model: Not reported
Modified By: MXLAY
Last Modified: 04/14/2017

Equipment Records:

K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
B04 - Tank External Protection - Fiberglass
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
E04 - Piping Secondary Containment - Double walled UG
J02 - Dispenser - Suction Dispenser
F04 - Pipe External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 02
Tank ID: 46478
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 4000
Install Date: 06/01/1993
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 19
Date Test: 06/28/2000
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MXLAY
Last Modified: 04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L99 - Piping Leak Detection - Other
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 03
Tank ID: 46479
Tank Status: In Service

FLAT GAS INC. (Continued) **U001839103**

Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/01/1993
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	19
Date Test:	06/28/2000
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MXLAY
Last Modified:	04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
L99 - Piping Leak Detection - Other
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	04
Tank ID:	46480
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/01/1993
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	19
Date Test:	06/28/2000
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MXLAY
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass

FLAT GAS INC. (Continued) **U001839103**

J02 - Dispenser - Suction Dispenser
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
E04 - Piping Secondary Containment - Double walled UG
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	05
Tank ID:	46481
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	06/01/1993
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	21
Date Test:	01/20/2005
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MXLAY
Last Modified:	04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
E04 - Piping Secondary Containment - Double walled UG
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)

E25 **NYC-HA VANDALIA HOUSE** **RCRA NonGen / NLR** **1001493636**
ESE **47 VANDALIA AVE** **FINDS** **NYR000075275**
< 1/8 **BROOKLYN, NY 11239** **ECHO**
0.048 mi.
251 ft. **Site 1 of 5 in cluster E**

Relative:
Higher

Actual:
19 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYCHA - VANDALIA AVENUE HOUSES
Facility address:	47 VANDALIA AVE BROOKLYN, NY 11239-2516
EPA ID:	NYR000075275
Mailing address:	BROADWAY NEW YORK, NY 10007-2516

NYC-HA VANDALIA HOUSE (Continued) **1001493636**

Contact: FRANK OCELLO
Contact address: BROADWAY
NEW YORK, NY 10007-2516
Contact country: US
Contact telephone: 212-306-3229
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: NYCHA
Owner/operator address: 250 BROADWAY
NEW YORK, NY 10007
Owner/operator country: US
Owner/operator telephone: 212-306-3229
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYCHA
Owner/operator address: 250 BROADWAY
NEW YORK, NY 10007
Owner/operator country: US
Owner/operator telephone: 212-306-3229
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006

NYC-HA VANDALIA HOUSE (Continued) **1001493636**

Site name: NYCHA - VANDALIA AVENUE HOUSES
Classification: Not a generator, verified

Date form received by agency: 08/12/1999
Site name: NYCHA - VANDALIA AVENUE HOUSES
Classification: Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

Violation Status: No violations found

FINDS:

Registry ID: 110004555561

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1001493636
Registry ID: 110004555561
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004555561

E26 **VANDALIA -NYCHA** **NY LTANKS** **S106125372**
SE **17 VANDALIA AVENUE** **NY Spills** **N/A**
< 1/8 **BROOKLYN, NY**
0.050 mi.
266 ft. **Site 2 of 5 in cluster E**

Relative:
Higher

Actual:
19 ft.

LTANKS:
Facility ID: 9011231
Site ID: 214957
Spill Number/Closed Date: 1993-07-06
Spill Date: 1991-01-23
Spill Cause: Tank Overfill
Spill Source: Tank Truck
Spill Class: C3
Cleanup Ceased: 1993-07-06
SWIS: 2401
Investigator: HEALY
Referred To: Not reported
Reported to Dept: 1991-01-23
CID: Not reported
Water Affected: Not reported

VANDALIA -NYCHA (Continued) **S106125372**

Spill Notifier:	Affected Persons
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1991-01-29
Spill Record Last Update:	2006-01-11
Spiller Name:	Not reported
Spiller Company:	NYCHA/RAD OIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	178091
DEC Memo:	""
Remarks:	"SPILLAGE CAME OUT OF VENT ONTO SOIL, NYCHA PERSONNEL TO PICK UP & DISPOSE."

All TTF:

Facility ID:	9011231
Spill Number:	9011231
Spill Tank Test:	1538177
Site ID:	214957
Tank Number:	Not reported
Tank Size:	0
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	02
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	214957
Operable Unit ID:	948242
Operable Unit:	01
Material ID:	427782
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	0211342

VANDALIA -NYCHA (Continued) **S106125372**

Facility Type:	ER
Spill Number:	0211342
DER Facility ID:	178091
Site ID:	102392
DEC Region:	2
Spill Number/Closed Date:	2003-03-13
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2003-02-13
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2003-02-13
CID:	257
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-02-13
Spill Record Last Update:	2006-01-13
Spiller Name:	P. ALMENDAREC
Spiller Company:	VANDALIA HOUSES
Spiller Address:	17 VANDALIA ST
Spiller Company:	001
Contact Name:	MARIO MANDALONE
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND CALLED MARIO MANDALONE WHO CONFIRNED THAT CLEAN-UP CREW IS ON THEIR WAY. E.R. MARIO MANDALONE CALLED AT 12.06 PM TO CONFIRMED THAT CLEAN-UP IS COMPLETED. OIL (APPROX. 20 GALS.) WAS CONTAINED IN A PIT. NO SOIL OR WATER WAS IMPACTED. E.R."
Remarks:	"crew on the way to clean up "

All Materials:

Site ID:	102392
Operable Unit ID:	864673
Operable Unit:	01
Material ID:	511134
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0311656
Facility Type:	ER
Spill Number:	0311656
DER Facility ID:	178091
Site ID:	178920
DEC Region:	2

VANDALIA -NYCHA (Continued) **S106125372**

Spill Number/Closed Date:	2006-01-13
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2004-01-16
Investigator:	SWKRASZE
Referred To:	Not reported
Reported to Dept:	2004-01-16
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-01-16
Spill Record Last Update:	2006-01-13
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	MARIO MANDALONE
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was BREEN 01/11/06: This spill transferred from Breen to S.Kraszewski. - SK 01/13/06: Reviewed NYCHA spill report with invoice from Clean Venture who was hired for clean up. Invoice matches spill requirements, ok to close out. - SK"
Remarks:	"equipment failure on boiler number one, clean up crew on way."

All Materials:

Site ID:	178920
Operable Unit ID:	877014
Operable Unit:	01
Material ID:	496908
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	60.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0210638
Facility Type:	ER
Spill Number:	0210638
DER Facility ID:	178091
Site ID:	148098
DEC Region:	2
Spill Number/Closed Date:	2005-11-04
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2003-01-23

VANDALIA -NYCHA (Continued) **S106125372**

Investigator:	SWKRASZE
Referred To:	Not reported
Reported to Dept:	2003-01-23
CID:	257
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-01-23
Spill Record Last Update:	2006-01-13
Spiller Name:	P. ALMENDAREC
Spiller Company:	VANDALIA HOUSES
Spiller Address:	17 VANDALIA ST
Spiller Company:	001
Contact Name:	P. ALMENDAREC
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KOLLEENY ROMMEL DO 1/23/03 Spoke to Steve Sacaccio and Mario Mandalone at NYCHA. Twelve inches of oil in the sump pit (approximately 120 gallons). Oil was found in the vertical check pipe, but not in the house trap. Nevertheless, NYCDEP was notified of potential impact to sewer. NYCHA vac truck en route to site. Mario cell phone 917-923-5659, pager 917-641-8003; Steve Sacaccio 718-707-5722 (office). 11/04/05: This spill tranferred from J.Kolleeny to S.Kraszewski."
Remarks:	"Onto concrete floor in boiler room and cleaned up. "

All Materials:

Site ID:	148098
Operable Unit ID:	863987
Operable Unit:	01
Material ID:	514019
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	3.00
Oxygenate:	Not reported

E27 **VANDALIA AVENUE (PENN WORTMAN)** **NY UST** **U000410721**
SE **17 VANDALIA AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11236**
0.050 mi.
266 ft. **Site 3 of 5 in cluster E**

Relative:
Higher

Actual:
19 ft.

UST:

Id/Status:	2-474088 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	03/28/2019

VANDALIA AVENUE (PENN WORTMAN) (Continued) **U000410721**

UTM X: 594061.14337
UTM Y: 4500489.51641
Site Type: Apartment Building/Office Building

Affiliation Records:

Site Id: 20879
Affiliation Type: Facility Operator
Company Name: VANDALIA AVENUE (PENN WORTMAN)
Contact Type: Not reported
Contact Name: FUEL OIL REMEDIATION UNIT
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 707-5725
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2014-01-30

Site Id: 20879
Affiliation Type: Emergency Contact
Company Name: NYC HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: EMERGENCY SERVICES DEPT.
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: 718-707-5900
EMail: Not reported
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2008-12-31

Site Id: 20879
Affiliation Type: Mail Contact
Company Name: NYC HOUSING AUTHORITY
Contact Type: Not reported
Contact Name: FUEL OIL REMEDIATION COORDINATOR
Address1: 23-02 49TH AVENUE
Address2: TECH SERVS DEPT - 5TH FLOOR
City: LONG ISLAND CITY
State: NY
Zip Code: 11101
Country Code: 001
Phone: (718) 707-5725
EMail: YELENA.TKACH@NYCHA.NYC.GOV
Fax Number: Not reported
Modified By: NRLOMBAR
Date Last Modified: 2015-08-14

Site Id: 20879
Affiliation Type: Facility Owner

VANDALIA AVENUE (PENN WORTMAN) (Continued) **U000410721**

Company Name:	NYC HOUSING AUTHORITY
Contact Type:	\\
Contact Name:	Not reported
Address1:	23-02 49TH AVENUE
Address2:	Not reported
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 707-5806
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-01-17

Tank Info:

Tank Number:	1
Tank ID:	37592
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	15000
Install Date:	05/01/1983
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	21
Date Test:	05/18/2017
Next Test Date:	05/18/2018
Pipe Model:	Not reported
Modified By:	BKFALVEY
Last Modified:	06/05/2017

Equipment Records:

L00 - Piping Leak Detection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None
I04 - Overfill - Product Level Gauge (A/G)

E28 **NYCHA - PENN WORTMAN** **RCRA NonGen / NLR** **1001223885**
SE **17 VANDALIA AVE** **FINDS** **NYR000051011**
< 1/8 **BROOKLYN, NY 11207** **ECHO**
0.050 mi.
266 ft. **Site 4 of 5 in cluster E**

Relative:
Higher

Actual:
19 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYCHA - PENN WORTMAN
Facility address:	17 VANDALIA AVE BROOKLYN, NY 11207
EPA ID:	NYR000051011
Mailing address:	BROADWAY NEW YORK, NY 10007
Contact:	Not reported
Contact address:	BROADWAY NEW YORK, NY 10007
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	NYC HOUSING AUTHORITY
Owner/operator address:	250 BROADAY NEW YORK, NY 10007
Owner/operator country:	US
Owner/operator telephone:	212-306-3229
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	NYC HOUSING AUTHORITY
Owner/operator address:	250 BROADAY NEW YORK, NY 10007
Owner/operator country:	US
Owner/operator telephone:	212-306-3229
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No

NYCHA - PENN WORTMAN (Continued) **1001223885**

On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: NYCHA - PENN WORTMAN
Classification: Not a generator, verified

Date form received by agency: 04/03/1998
Site name: NYCHA - PENN WORTMAN
Classification: Not a generator, verified

. Waste code: NONE
. Waste name: None

Date form received by agency: 02/27/1998
Site name: NYCHA - PENN WORTMAN
Classification: Small Quantity Generator

. Waste code: NONE
. Waste name: None

Violation Status: No violations found

FINDS:

Registry ID: 110004540765

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1001223885
Registry ID: 110004540765
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004540765

E29 **GASOLINE DIGITAL INC** **EDR Hist Auto** **1020966868**
ESE **50 VANDALIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11239**
0.055 mi.
290 ft. **Site 5 of 5 in cluster E**

Relative: EDR Hist Auto
Higher

Year:	Name:	Type:
Actual: 2008	GASOLINE DIGITAL INC	Gasoline Service Stations
19 ft. 2009	GASOLINE DIGITAL INC	Gasoline Service Stations
2010	GASOLINE DIGITAL INC	Gasoline Service Stations

F30 **COMMERCIAL - PHASE-II** **NY Spills** **S118636041**
NNE **1118 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.056 mi.
297 ft. **Site 1 of 7 in cluster F**

Relative: SPILLS:
Lower

Actual: Facility ID:	1511045
10 ft. Facility Type:	ER
Spill Number:	1511045
DER Facility ID:	477017
Site ID:	522759
DEC Region:	2
Spill Number/Closed Date:	2016-03-02
Spill Cause:	Unknown
Spill Class:	C4
SWIS:	2401
Spill Date:	2016-02-02
Investigator:	HRPATEL
Referred To:	Not reported
Reported to Dept:	2016-02-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2016-02-17
Spill Record Last Update:	2016-03-02
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	PETER DERMODY
DEC Memo:	"02/17/16-Hiralkumar Patel. alternate address: 1114-1120 Pennsylvania Ave no PBS or other spills found. Macanian Realty LLC. **property owner** 8:46 AM:- spoke with Peter. they performed Phase II investigation at the site and found minor contamination in groundwater. asked Peter to submit copy of the report for review. 9:12 AM:- received email from Peter including Phase II report. abstract: - three borings were installed to a depth of 20 ft bg - water table occurred at a depth of approx. 12 to 13 ft bg - geology of the area generally consisted of brown medium sand with some fill

COMMERCIAL - PHASE-II (Continued) **S118636041**

material, including brick and concrete fragments, at depths up to 10 ft bg. the intervals from 10 to 20 ft generally contained brown medium sand - less than 10 ppm recorded on PID during installation of three borings - one soil sample was collected from each boring from 12-13 ft depth - groundwater samples were collected from three borings - after sampling, a two (2) inch diameter well was installed at each borehole with ten (10) ft of screen - groundwater flow direction to be to the south-southeast ---------- - no contamination noted in soil samples - some VOC contamination (max. 87 ppb of Chlorobenzene in GW-1) noted in groundwater samples 1:02 PM:- spoke with Peter and asked to submit copy of Phase I report for review. 02/18/16-Hiralkumar Patel. received email from Peter (at 5:11 PM on 02/17/16) including Phase I report. abstract: - Block #: 4412 / Lot #: 20 - property is approx. 7,680 sq. ft. in size and is improved with an approx. 8,640 sq. ft., two-story walk-up commercial/office building with a basement - property existed as undeveloped land until the late 1940s when the northern portion of the lot was occupied by a portion of an auto wrecking yard with an office and auto repair shop ---------- - the southern portion of the building was constructed in 1958 and was expanded to its current size and layout in 1974 with the buildings utilized as an auto parts sales and rebuilding, offices, automobile sales and a Sleepy's - a broken concrete parking lot (utilized for storage) is located to the north of the building, which used as an open flower market in at least the early 2000s - the property was identified as a RCRA Large Quantity Generator in 1991, and a Non-Generator in 1999 and 2006, that reportedly utilized solvents ---------- - certificates of occupancy were issued in 1948 for use of the property as a parking lot and auto wrecking and vehicle repairs; in 1953 for use of a one-story building with basement as sales and display of new and used auto parts and a machine shop; in 1974 for use of a two-story building with a basement as a sales and display of new and used auto parts, a machine shop, and automobile sales and showroom; and on 01/17/2012 for use of the existing structure as a furniture store 3:32 PM:- received email from Peter stating that the building is currently occupied by Sleepy's and plan is to continue on with Sleepy's as the tenant. 03/02/16-Hiralkumar Patel. after discussing with DEC Vought, case closed based on available information (no contamination in soil samples, minor VOC exceedance in groundwater samples and no change in future property use). 1:19 PM:- spoke with Peter and informed him about spill closure. 1:31 PM:- sent email to Peter confirming case closure."

Remarks: "The cleanup is pending ,waiting for DEC to determine if it should be clean. They dont know who is responsible.They don't know the amount of the spill"

All Materials:

Site ID:	522759
Operable Unit ID:	1271765
Operable Unit:	01
Material ID:	2276070
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported

COMMERCIAL - PHASE-II (Continued) **S118636041**

Oxygenate: Not reported

F31 **PENN MOTOR SALES & SERVICE** **RCRA NonGen / NLR** **1000555136**
NNE **1118 PENNSYLVANIA AVE** **FINDS** **NYD986976413**
< 1/8 **BROOKLYN, NY 11207** **ECHO**
0.056 mi. **NY MANIFEST**
297 ft. **Site 2 of 7 in cluster F**

Relative:
Lower

Actual:
10 ft.

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: PENN MOTOR SALES & SERVICE
Facility address: 1118 PENNSYLVANIA AVE
BROOKLYN, NY 11207-9008
EPA ID: NYD986976413
Mailing address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact: Not reported
Contact address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: PENN MOTOR SALES & SERVICES
Owner/operator address: UNKNOWN
UNKNOWN, NY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: PENN MOTOR SALES & SERVICES
Owner/operator address: UNKNOWN
UNKNOWN, NY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No

PENN MOTOR SALES & SERVICE (Continued) **1000555136**

Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: PENN MOTOR SALES & SERVICE
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: PENN MOTOR SALES & SERVICE
Classification: Not a generator, verified

Date form received by agency: 09/23/1991
Site name: PENN MOTOR SALES & SERVICE
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D008
. Waste name: LEAD

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

PENN MOTOR SALES & SERVICE (Continued) **1000555136**

. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

FINDS:

Registry ID: 110006447390

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000555136
Registry ID:	110006447390
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110006447390

NY MANIFEST:

Country:	USA
EPA ID:	NYD986976413
Facility Status:	Not reported
Location Address 1:	1118 PENNSYLVANIA AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD986976413
Mailing Name:	PENN MOTOR SALES
Mailing Contact:	ROBERTO PEREZ
Mailing Address 1:	1118 PENNSYLVANIA AVE
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11207
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2122578150

PENN MOTOR SALES & SERVICE (Continued) **1000555136**

NY MANIFEST:

Document ID:	CTF0348012
Manifest Status:	K
seq:	Not reported
Year:	1994
Trans1 State ID:	AP6277NY
Trans2 State ID:	Not reported
Generator Ship Date:	10/03/1994
Trans1 Recv Date:	10/03/1994
Trans2 Recv Date:	/ /
TSD Site Recv Date:	10/06/1994
Part A Recv Date:	10/14/1994
Part B Recv Date:	10/31/1994
Generator EPA ID:	NYD986976413
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	CTD001156009
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D006 - CADMIUM 1.0 MG/L TCLP
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00020
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

D32 **CON EDISON** **RCRA NonGen / NLR** **1019908889**
North **999 ALABAMA AVE** **NYP004878700**
< 1/8 **BROOKLYN, NY 11207**
0.057 mi.
301 ft. **Site 2 of 3 in cluster D**

Relative:
Lower

Actual:
14 ft.

RCRA NonGen / NLR:

Date form received by agency:	12/12/2015
Facility name:	CON EDISON
Facility address:	999 ALABAMA AVE

CON EDISON (Continued) **1019908889**

BROOKLYN, NY 11207
EPA ID: NYP004878700
Mailing address: IRVING PL 15TH FL NE
NEW YORK, NY 10003
Contact: THOMAS TEELING
Contact address: Not reported
Not reported
Contact country: Not reported
Contact telephone: 212-460-3770
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 12/12/2015
Site name: CON EDISON
Classification: Small Quantity Generator

Violation Status: No violations found

D33 **CON EDISON** **NJ MANIFEST** **S120678111**
North **999 ALABAMA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.057 mi.
301 ft. **Site 3 of 3 in cluster D**

Relative:
Lower

Actual:
14 ft.

NJ MANIFEST:
EPA Id: NYP004878700
Mail Address: IRVING PL 15TH FL NE
Mail City/State/Zip: NEW YORK, NY 10003
Facility Phone: Not reported
Emergency Phone: Not reported
Contact: THOMAS TEELING
Comments: Not reported
SIC Code: Not reported
County: NY047
Municipal: Not reported
Previous EPA Id: Not reported
Gen Flag: Not reported
Trans Flag: Not reported

CON EDISON (Continued) **S120678111**

TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	015320335JJK
EPA ID:	NYP004878700
Date Shipped:	12/12/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

F34 **PROFESSIONAL CLEANERS INC** **EDR Hist Cleaner** **1018556507**
NNE **1110 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.058 mi.
308 ft. **Site 3 of 7 in cluster F**

Relative: EDR Hist Cleaner
Lower

Year:	Name:	Type:
1996	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs

Actual:
10 ft.

PROFESSIONAL CLEANERS INC (Continued) **1018556507**

1997	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
1998	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
1999	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2000	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2001	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2002	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2003	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2004	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2005	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2006	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2007	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2009	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2010	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs
2011	PROFESSIONAL CLEANERS INC	Drycleaning Plants, Except Rugs

---

F35 **CON EDISON** **RCRA NonGen / NLR** **1019906101**
NNE **1110 PENNSYLVANIA AVE** **NYP004817292**
< 1/8 **BROOKLYN, NY 11207**
0.058 mi.
308 ft. **Site 4 of 7 in cluster F**

Relative:
Lower

Actual:
10 ft.

RCRA NonGen / NLR:

Date form received by agency:	08/03/2015
Facility name:	CON EDISON
Facility address:	1110 PENNSYLVANIA AVE BROOKLYN, NY 11207
EPA ID:	NYP004817292
Mailing address:	IRVING PL 15TH FL NE NEW YORK, NY 10003
Contact:	THOMAS TEELING
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	212-460-3770
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

CON EDISON (Continued) **1019906101**

Historical Generators:
Date form received by agency: 08/03/2015
Site name: CON EDISON
Classification: Small Quantity Generator

Violation Status: No violations found

F36 **CON EDISON** **NJ MANIFEST** **S120674856**
NNE **1110 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.058 mi.
308 ft. **Site 5 of 7 in cluster F**

Relative:
Lower

Actual:
10 ft.

NJ MANIFEST:

EPA Id:	NYP004817292
Mail Address:	IRVING PL 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THOMAS TEELING
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	014472960JJK
EPA ID:	NYP004817292
Date Shipped:	8/3/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported

CON EDISON (Continued) **S120674856**

Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

G37 **SPRING CREEK** **NY UST** **U001839486**
NE **12143 FLATLANDS AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.060 mi.
318 ft. **Site 1 of 2 in cluster G**

Relative:
Lower

Actual:
14 ft.

UST:

Id/Status:	2-345075 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	N/A
UTM X:	594219.21763
UTM Y:	4500790.07403
Site Type:	Other

Affiliation Records:

Site Id:	16816
Affiliation Type:	Facility Owner
Company Name:	BROOKLYN PUBLIC LIBRARY
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1 GRAND ARMY PLAZA
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11238
Country Code:	001
Phone:	(718) 780-7707
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	16816
Affiliation Type:	Mail Contact
Company Name:	BROOKLYN PUBLIC LIBRARY
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	1 GRAND ARMY PLAZA
Address2:	Not reported
City:	BROOKLYN

SPRING CREEK (Continued) **U001839486**

State: NY
Zip Code: 11238
Country Code: 001
Phone: (718) 780-7707
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 16816
Affiliation Type: Emergency Contact
Company Name: BROOKLYN PUBLIC LIBRARY
Contact Type: Not reported
Contact Name: BUILDINGS & MAINTENANCE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 780-7707
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 16816
Affiliation Type: Facility Operator
Company Name: SPRING CREEK
Contact Type: Not reported
Contact Name: BROOKLYN PUBLIC LIBRARY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 649-0020
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 32741
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 2000
Install Date: 06/01/1975
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

SPRING CREEK (Continued) **U001839486**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)

F38 **1110 PENNSYLVANIA CLEANERS** **NY DRYCLEANERS** **S110245778**
NNE **1110 PENNSYLVANIA AVE.** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.064 mi.
338 ft. **Site 6 of 7 in cluster F**

Relative:
Lower

Actual:
10 ft.

DRYCLEANERS:
Facility ID: 2-6105-00300
Phone Number: 718-272-2883
Region: Not reported
Registration Effective Date: 6/5/2003 14:17:48:543
Inspection Date: 09SEP28
Install Date: 94/03/09
Drop Shop: Not reported
Shutdown: Y
Alternate Solvent: Not reported
Current Business: Not reported

F39 **PROFESSIONAL CLEANERS INC** **RCRA-CESQG** **1000912135**
NNE **1110 PENNSYLVANIA AVE** **NY MANIFEST** **NY0000465468**
< 1/8 **BROOKLYN, NY 11207**
0.064 mi.
338 ft. **Site 7 of 7 in cluster F**

Relative:
Lower

Actual:
10 ft.

RCRA-CESQG:
Date form received by agency: 01/01/2007
Facility name: PROFESSIONAL CLEANERS INC
Facility address: 1110 PENNSYLVANIA AVE
BROOKLYN, NY 11207
EPA ID: NY0000465468
Mailing address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact: Not reported
Contact address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02

PROFESSIONAL CLEANERS INC (Continued) **1000912135**

Classification: Conditionally Exempt Small Quantity Generator
Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: NBO REALTY
Owner/operator address: 1110 PENNSYLVANIA AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 516-222-1388
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NBO REALTY
Owner/operator address: 1110 PENNSYLVANIA AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 516-222-1388
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No

PROFESSIONAL CLEANERS INC (Continued) **1000912135**

Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: PROFESSIONAL CLEANERS INC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/14/1999
Site name: PROFESSIONAL CLEANERS INC
Classification: Small Quantity Generator

Date form received by agency: 07/19/1994
Site name: PROFESSIONAL CLEANERS INC
Classification: Large Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

NY MANIFEST:
Country: USA
EPA ID: NY0000465468
Facility Status: Not reported
Location Address 1: 1110 PENNSYLVANIA AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NY0000465468
Mailing Name: PROFFESSIONAL CLNRS
Mailing Contact: OLUSINA YEKU
Mailing Address 1: 1110 PENNSYLVANIA AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11207
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7182722883

PROFESSIONAL CLEANERS INC (Continued) **1000912135**

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2007
Trans1 State ID:	NJD000564906
Trans2 State ID:	MIK814262374
Generator Ship Date:	11/09/2007
Trans1 Recv Date:	11/09/2007
Trans2 Recv Date:	11/16/2007
TSD Site Recv Date:	11/16/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0000465468
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	CDX107000000
TSDF ID 2:	Not reported
Manifest Tracking Number:	003366313JJK
Import Indicator:	N
Export Indicator:	Y
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H020
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	390
Units:	P - Pounds
Number of Containers:	3
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1
Waste Code:	F002
Waste Code 1_2:	D039
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
49 additional NY_MANIFEST: record(s) in the EDR Site Report.

Country:	USA
EPA ID:	NYP004817292
Facility Status:	Not reported
Location Address 1:	1110 PENNSYLVANIA AVE

PROFESSIONAL CLEANERS INC (Continued) **1000912135**

Code:	BP
Location Address 2:	SB 71317
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004817292
Mailing Name:	CON ED
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	08/03/2015
Trans1 Recv Date:	08/03/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/06/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004817292
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014472960JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported

PROFESSIONAL CLEANERS INC (Continued) **1000912135**

Quantity:	1000
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

G40 **FAIRFIELD TOWERS** **NY AST** **U004076945**
NE **12149 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.073 mi.
384 ft. **Site 2 of 2 in cluster G**

Relative:
Lower

Actual:
14 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-252654
Program Type:	PBS
UTM X:	594240.07254
UTM Y:	4500802.17218
Expiration Date:	07/10/2018
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	10191
Affiliation Type:	Mail Contact
Company Name:	DOUGLAS ELLIMAN PROPERTY MGT
Contact Type:	Not reported
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVE
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 350-2846
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DMMOLOUG
Date Last Modified:	2013-08-01

Site Id:	10191
Affiliation Type:	Facility Operator
Company Name:	FAIRFIELD TOWERS
Contact Type:	Not reported
Contact Name:	DENNIS LIVERMAN
Address1:	Not reported

FAIRFIELD TOWERS (Continued) **U004076945**

Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 649-9400
EMail: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 2013-08-01

Site Id: 10191
Affiliation Type: Emergency Contact
Company Name: FAIRFIELD TOWERS CONDOMINIUM
Contact Type: Not reported
Contact Name: DENNIS LIVERMAN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 649-9400
EMail: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 2013-08-01

Site Id: 10191
Affiliation Type: Facility Owner
Company Name: FAIRFIELD TOWERS CONDOMINIUM
Contact Type: COMPLIANCE MANAGER
Contact Name: PATRICIA PETTWAY-BROWN
Address1: 12421 FLATLANDS AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11207
Country Code: 001
Phone: (718) 649-9400
EMail: Not reported
Fax Number: Not reported
Modified By: DMMOLOUG
Date Last Modified: 2013-08-01

Tank Info:

Tank Number: 001
Tank Id: 14158
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Equipment Records:

G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping

FAIRFIELD TOWERS (Continued) **U004076945**

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping

Tank Location:	6
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/02/1962
Capacity Gallons:	7500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DMMOLOUG
Last Modified:	04/14/2017
Material Name:	Not reported

H41 **HOFFINGER INDUSTRIES** **RCRA NonGen / NLR** **1000387286**
NNW **980 ALABAMA AVE** **NY MANIFEST** **NYD982729337**
< 1/8 **BROOKLYN, NY 11207**
0.077 mi.
408 ft. **Site 1 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	HOFFINGER INDUSTRIES
Facility address:	980 ALABAMA AVE BROOKLYN, NY 11207-8327
EPA ID:	NYD982729337
Mailing address:	JERSEY BLVD RANCHO CUCAMONGA, NY 91730
Contact:	ISHMAEL GARCIA
Contact address:	JERSEY BLVD RANCHO CUCAMONGA, NY 91730
Contact country:	US
Contact telephone:	718-296-8221
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	MARTIN HOFFINGER CHAIRMAN
Owner/operator address:	10959 JERSEY BLVD RANCHO CUCAMONGA, CA 91730
Owner/operator country:	US
Owner/operator telephone:	909-987-4741
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private

HOFFINGER INDUSTRIES (Continued) **1000387286**

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: MARTIN HOFFINGER CHAIRMAN
Owner/operator address: 10959 JERSEY BLVD
RANCHO CUCAMONGA, CA 91730
Owner/operator country: US
Owner/operator telephone: 909-987-4741
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: HOFFINGER INDUSTRIES
Classification: Not a generator, verified

Date form received by agency: 01/20/1999
Site name: HOFFINGER INDUSTRIES
Classification: Small Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED

HOFFINGER INDUSTRIES (Continued) **1000387286**

SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 05/08/1992
Site name: LOMART/PREST METALS
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/13/1990
Date achieved compliance: 08/13/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 11/11/1998
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 08/13/1990
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 08/13/1990
Evaluation lead agency: State

NY MANIFEST:
Country: USA
EPA ID: NYD982729337
Facility Status: Not reported
Location Address 1: 980 ALABAMA AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD982729337
Mailing Name: PREST METALS INC
Mailing Contact: PREST METALS INC
Mailing Address 1: 980 ALABAMA AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN

HOFFINGER INDUSTRIES (Continued) **1000387286**

Mailing State:	NY
Mailing Zip:	11207
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7182721000

NY MANIFEST:

Document ID:	NYC5062860
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	P284920
Trans2 State ID:	564TUHNJ
Generator Ship Date:	02/05/1999
Trans1 Recv Date:	02/05/1999
Trans2 Recv Date:	02/10/1999
TSD Site Recv Date:	02/18/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982729337
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCD987574647
TSDF ID 1:	KYD053348108
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F001 - UNKNOWN
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	02108
Units:	P - Pounds
Number of Containers:	004
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	F001 - UNKNOWN
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	02748
Units:	P - Pounds
Number of Containers:	006
Container Type:	DM - Metal drums, barrels

HOFFINGER INDUSTRIES (Continued) **1000387286**

Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 01.00

Click this hyperlink while viewing on your computer to access
3 additional NY_MANIFEST: record(s) in the EDR Site Report.

I42 **26 WARD PLANT** **NY Spills** **S109063047**
WSW **112-66 FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.080 mi.
423 ft. **Site 1 of 9 in cluster I**

Relative:
Lower

Actual:
11 ft.

SPILLS:

Facility ID:	0801985
Facility Type:	ER
Spill Number:	0801985
DER Facility ID:	347418
Site ID:	398044
DEC Region:	2
Spill Number/Closed Date:	2008-05-21
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2008-05-20
Investigator:	jbvought
Referred To:	Not reported
Reported to Dept:	2008-05-20
CID:	408
Water Affected:	HENDRIX CREEK
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-05-20
Spill Record Last Update:	2008-05-21
Spiller Name:	JAMES DALY
Spiller Company:	26 WARD PLANT
Spiller Address:	112-66 FLATLANDS AVE
Spiller Company:	001
Contact Name:	JAMES DALY
DEC Memo:	"05/21/08-Vought-Off hours responder. Non-petroleum spill and spill closed and referred to DEC Water Unit Rossan."
Remarks:	"ON GOING; HEAVY RAIN IS CAUSE;"

All Materials:

Site ID:	398044
Operable Unit ID:	1154955
Operable Unit:	01
Material ID:	2145793
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other

26 WARD PLANT (Continued) **S109063047**

Quantity: Not reported
Units: G
Recovered: .00
Oxygenate: Not reported

H43 **CROSS KOBRICK CORPORATION** **NY UST** **U003712129**
NNW **1000 ALABAMA AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.082 mi.
431 ft. **Site 2 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

UST:
Id/Status: 2-604281 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 593913.32487
UTM Y: 4500694.96224
Site Type: Other

Affiliation Records:
Site Id: 26160
Affiliation Type: Facility Owner
Company Name: MARVIN MENDLOWITZ - ELEL REALTY LLC
Contact Type: Not reported
Contact Name: Not reported
Address1: 1000 ALABAMA AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11207
Country Code: 001
Phone: (718) 338-3532
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 26160
Affiliation Type: Mail Contact
Company Name: GKC
Contact Type: Not reported
Contact Name: SY MENDLOWITZ
Address1: 1000 ALABAMA AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11207
Country Code: 001
Phone: (718) 622-8054
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 26160

CROSS KOBRICK CORPORATION (Continued) **U003712129**

Affiliation Type:	Facility Operator
Company Name:	CROSS KOBRICK CORPORATION
Contact Type:	Not reported
Contact Name:	SY MENDLOWITZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 622-8054
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	26160
Affiliation Type:	Emergency Contact
Company Name:	MARVIN MENDLOWITZ - ELEL REALTY LLC
Contact Type:	Not reported
Contact Name:	AKIVA MENDLOWITZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(917) 224-5893
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	57271
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	2500
Install Date:	Not reported
Date Tank Closed:	12/01/1999
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	03
Date Test:	10/01/1999
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None

CROSS KOBRICK CORPORATION (Continued) **U003712129**

C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I05 - Overfill - Vent Whistle

H44 **PIVOT METAL WORKS INC** **RCRA NonGen / NLR** **1000342643**
NNW **1000 ALABAMA AVE** **NY MANIFEST** **NYD001382746**
< 1/8 **BROOKLYN, NY 11207**
0.082 mi.
431 ft. **Site 3 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	PIVOT METAL WORKS INC
Facility address:	1000 ALABAMA AVE BROOKLYN, NY 11207-8391
EPA ID:	NYD001382746
Mailing address:	ALABAMA AVE BROOKLYN, NY 11207
Contact:	Not reported
Contact address:	ALABAMA AVE BROOKLYN, NY 11207
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	PIVOT METAL WORKS INC
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	PIVOT METAL WORKS INC
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner

PIVOT METAL WORKS INC (Continued) **1000342643**

Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: PIVOT METAL WORKS INC
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: PIVOT METAL WORKS INC
Classification: Not a generator, verified

Date form received by agency: 02/26/1992
Site name: PIVOT METAL
Classification: Large Quantity Generator

Date form received by agency: 01/18/1990
Site name: PIVOT METAL WORKS INC
Classification: Small Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 11/14/1991
Date achieved compliance: 03/30/1992
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL

PIVOT METAL WORKS INC (Continued) **1000342643**

Enforcement action date: 11/14/1991
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 10/10/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 03/30/1992
Evaluation lead agency: State

NY MANIFEST:
Country: USA
EPA ID: NYD001382746
Facility Status: Not reported
Location Address 1: 1000 ALABAMA AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD001382746
Mailing Name: PIVOY METAL WORKS INC
Mailing Contact: PIVOY METAL WORKS INC
Mailing Address 1: 1000 ALABAMA AVENUE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11207
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7186495454

NY MANIFEST:
Document ID: PAC5824630
Manifest Status: C
seq: Not reported
Year: 1993
Trans1 State ID: PAAH0067
Trans2 State ID: Not reported
Generator Ship Date: 04/01/1993
Trans1 Recv Date: 04/02/1993
Trans2 Recv Date: / /
TSD Site Recv Date: 04/03/1993
Part A Recv Date: 04/09/1993
Part B Recv Date: 04/20/1993
Generator EPA ID: NYD001382746
Trans1 EPA ID: NJD054126164
Trans2 EPA ID: Not reported

PIVOT METAL WORKS INC (Continued) **1000342643**

TSDF ID 1:	PAD981038227
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F006 - WW TREAT SL FM ELECTROPLATING OPER
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00560
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100

Click this hyperlink while viewing on your computer to access
12 additional NY_MANIFEST: record(s) in the EDR Site Report.

I45 **WILLIAMS & FLATLANDS AVS** **NY Spills** **S102142606**
WSW **WILLIAMS & FLATLANDS AVS** **N/A**
< 1/8 **BROOKLYN, NY**
0.085 mi.
448 ft. **Site 2 of 9 in cluster I**

Relative:
Lower

Actual:
11 ft.

SPILLS:

Facility ID:	9111763
Facility Type:	ER
Spill Number:	9111763
DER Facility ID:	283935
Site ID:	285398
DEC Region:	2
Spill Number/Closed Date:	1992-02-14
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	2401
Spill Date:	1992-02-14
Investigator:	ADELUGBA
Referred To:	Not reported
Reported to Dept:	1992-02-14
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Local Agency
Cleanup Ceased:	1992-02-14
Cleanup Meets Std:	True

WILLIAMS & FLATLANDS AVS (Continued) **S102142606**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-02-20
Spill Record Last Update:	2004-09-30
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	""
Remarks:	"REFERRED TO SPEDES."

All Materials:

Site ID:	285398
Operable Unit ID:	965473
Operable Unit:	01
Material ID:	416780
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	500000.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

H46 **966 -988 ALABAMA AVE** **NY Spills** **S117851771**
NNW **966 -988 ALABAMA AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.094 mi.
495 ft. **Site 4 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

SPILLS:

Facility ID:	1500053
Facility Type:	ER
Spill Number:	1500053
DER Facility ID:	460978
Site ID:	506186
DEC Region:	2
Spill Number/Closed Date:	2015-08-24
Spill Cause:	Unknown
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2015-04-02
Investigator:	vszhune
Referred To:	Not reported
Reported to Dept:	2015-04-02
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False

966 -988 ALABAMA AVE (Continued) **S117851771**

UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2015-04-02
Spill Record Last Update:	2015-08-31
Spiller Name:	CARLA SULLIVAN
Spiller Company:	966 -988 ALABAMA AVE
Spiller Address:	966 -988 ALABAMA AVE
Spiller Company:	999
Contact Name:	CARLA SULLIVAN
DEC Memo:	"4/2/2015 - Feng - Duty Desk. Called Laurel Environmental (631-673-0612) and Carla Sullivan just left for the day. The receptionist said they have received lab results and preparing a report. The report is not ready yet. Carla is the only one who can provide further information. They will return my call tomorrow. 4/3/2015 - Talked to Carla Sullivan of Laurel Environmental (CSullivan@LaurelEnv.com). The property was in real estate transaction. The buyer hired a environmental company to do an investigation and found contamination. the seller did not trust the results and hired another environmental company to do another investigation and found no contamination. Laurel Environmental was brought in to do investigation and to confirm whether there is or no contamination. Laurel Environmental found contamination in soil where VOCs exceeded CP-51. The building was builit in 1963. The tank, i.e. 2,500-gallon fuel oil UST, was beneath the slab of the building and now is noted abandoned. There is no fillport, no vent pipe. They mapped it out in the GPR survey. The soil smell like diesel. She is not sure about the current use of the property nor the future use of the property. The soil borings went to groundwater, but they did not collect any groundwater samples. I advised her that DEC may require groundwater sampling if soil contamination is found. Searched PBS- 1) PBS 2-604377, Alabama Ave Realty Inc 980 Alabama Ave, Brooklyn (1) 2,500-gallon steel #2 fuel oil UST, in service, next test 9/2/2014 2) PBS 2-360643 LADS Associates 960 Alabama Ave, Brooklyn (1) 5,000-gallon steel #2 fuel oil UST, closed-in-place email from Carla Sullivan. The former owner: Mayer Berkovitz mayerberkovitz@gmail.com cell: 917-854-8098 Brief to V.Zhune and transferred the spill to V.Zhune. 6/9/15-Vought-DEC Zhune away from office on extended leave. Vought received call from and spoke to Dotty (ABC Tank) that the tank has been removed and they are installing shoring and soil borings have been performed and results were sent to DEC Zhune. They will begin excavation and send report, including endpoint sample analyses, to DEC Zhune. 6/16/15-Vought-Received call from Donna from ABC Tank and they have reached structural limitations. Donna will send in endpoints results with site and recommendations for further action. Vought discussed need for delineation of soil contamination (such as possible groundwater sample collection to residence) and possible of installation of sub-slab venting system and excavation will be covered with plastic. Donna will send soil endpoint results to DEC and will also send them to a consultant (eg Preferred Envioronmental) for review and further recommendations. 8/14/15-Donna from ABC Tank Repair & Lining Inc. sent the spill closure report. Spill Closed. 8/14/15-Donna emailed the Phase II prepared for Laurel Environmental Associates. Laboratory analysis of soil samples collected from eight(8) borings within the proximity of the 2500 gallon UST found levels of VOC above NYSDEC CP-51 in four of the borings locations (SB-4, SB-5, SB-7 and SB-8). 8/14/15-Donna emailed the spill closure letter and the analytical results. ABC Tank broke up the cement & dug

966 -988 ALABAMA AVE (Continued) **S117851771**

up to expose the top of the buried (1) 2500 gallon tank. The tank was filled with sand & improperly abandoned by others. The top of the tank was cut open and all product (oily sand) was removed from the interior of the tank & placed in (30) drums for proper disposal. All lines on top of the tank has been cut and removed during the abandonment by others. ABC tank cut and removed the existing (1) 2500 gallon buried tank from the site. ABC dug up the contaminated soil from the affected area and placed all the contaminated soil in (16) drums for proper disposal. ABC tank was able to remove the existing contaminated soil from around the footing. ABC tank obtained(4) end-point soil samples labeled North East, North West, South East & South West. Each sample was obtained 10' to 16' below grade level. The soil analytical results were below the NYSDEC CP-51 unrestricted residential soil standard."

Remarks: "soil samples done twice in the past by two different companies, 1st time contamination found, 2nd time no contamination found, today new test doneconfirms contamination. Tank present under slab"

All Materials:

Site ID:	506186
Operable Unit ID:	1255515
Operable Unit:	01
Material ID:	2258269
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

I47 **KENT DRY CLEANERS** **RCRA-CESQG 1004566861**
WSW **111-18 FLATLANDS AVE** **NY MANIFEST NY0001419852**
< 1/8 **BROOKLYN, NY 11236**
0.094 mi.
496 ft. **Site 3 of 9 in cluster I**

Relative:
Lower

Actual:
10 ft.

RCRA-CESQG:

Date form received by agency:	01/01/2007
Facility name:	KENT DRY CLEANERS
Facility address:	111-18 FLATLANDS AVE BROOKLYN, NY 11236
EPA ID:	NY0001419852
Mailing address:	FLATLANDS AVE BROOKLYN, NY 11236
Contact:	JESUS LIZARDO
Contact address:	FLATLANDS AVE BROOKLYN, NY 11236
Contact country:	US
Contact telephone:	718-272-5866
Contact email:	Not reported
EPA Region:	02
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar

KENT DRY CLEANERS (Continued) **1004566861**

month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	SHERILU MANAGEMENT
Owner/operator address:	560 SYLVAN AVE ENGLEWOOD, NJ 07632
Owner/operator country:	US
Owner/operator telephone:	201-816-1118
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	SHERILU MANAGEMENT
Owner/operator address:	560 SYLVAN AVE ENGLEWOOD, NJ 07632
Owner/operator country:	US
Owner/operator telephone:	201-816-1118
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

KENT DRY CLEANERS (Continued) **1004566861**

Historical Generators:
Date form received by agency: 01/01/2006
Site name: KENT DRY CLEANERS
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 04/27/1998
Site name: KENT DRY CLEANERS
Classification: Conditionally Exempt Small Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D039
. Waste name: TETRACHLOROETHYLENE

. Waste code: D040
. Waste name: TRICHLORETHYLENE

Violation Status: No violations found

NY MANIFEST:
Country: USA
EPA ID: NY0001419852
Facility Status: Not reported
Location Address 1: 111-18 FLATLANDS AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11208
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NY0001419852
Mailing Name: KENT FRENCH CLNRS
Mailing Contact: JESUS LIZARDO
Mailing Address 1: 111-18 FLATLANDS AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11208
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7182725866

NY MANIFEST:
Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2015

KENT DRY CLEANERS (Continued) **1004566861**

Trans1 State ID:	TXR000081205
Trans2 State ID:	NJD071629976
Generator Ship Date:	12/22/2015
Trans1 Recv Date:	12/22/2015
Trans2 Recv Date:	01/05/2016
TSD Site Recv Date:	01/15/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NY0001419852
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	004490549SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H020
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	400
Units:	P - Pounds
Number of Containers:	4
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1
Waste Code:	F002
Waste Code 1_2:	D007
Waste Code 1_3:	D039
Waste Code 1_4:	D040
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
42 additional NY_MANIFEST: record(s) in the EDR Site Report.

I48
WSW
< 1/8
0.094 mi.
496 ft.

KENT CLEANERS
111-18 FLATLANDS AVENUE
BROOKLYN, NY 11207

NY DRYCLEANERS **S110247030**
N/A

Site 4 of 9 in cluster I

Relative:
Lower

Actual:
10 ft.

DRYCLEANERS:

Facility ID:	2-6105-00392
Phone Number:	718-272-5866
Region:	Not reported
Registration Effective Date:	5/17/1999
Inspection Date:	07JUN8
Install Date:	98
Drop Shop:	Not reported
Shutdown:	Not reported
Alternate Solvent:	Not reported
Current Business:	Not reported

I49
WSW
< 1/8
0.094 mi.
496 ft.

KENT CLEANER
11118 FLATLANDS AVE
BROOKLYN, NY 11207

EDR Hist Cleaner **1018423417**
N/A

Site 5 of 9 in cluster I

Relative:
Lower

Actual:
10 ft.

EDR Hist Cleaner

Year:	Name:	Type:
1986	KENT CLEANER	Garment Pressing And Cleaners' Agents
1987	KENT CLEANER	Garment Pressing And Cleaners' Agents
1988	KENT CLEANER	Garment Pressing And Cleaners' Agents
1989	KENT CLEANER	Garment Pressing And Cleaners' Agents
1990	KENT CLEANER	Garment Pressing And Cleaners' Agents
1991	KENT CLEANER	Garment Pressing And Cleaners' Agents
1992	KENT CLEANER	Garment Pressing And Cleaners' Agents
1993	KENT CLEANER	Garment Pressing And Cleaners' Agents
1994	KENT CLEANER	Garment Pressing And Cleaners' Agents
1995	KENT CLEANER	Garment Pressing And Cleaners' Agents
1996	KENT CLEANER	Garment Pressing And Cleaners' Agents
1997	KENT CLEANER	Garment Pressing And Cleaners' Agents
1998	KENT CLEANER	Garment Pressing And Cleaners' Agents
1999	KENT CLEANER	Garment Pressing And Cleaners' Agents
2000	KENT CLEANER	Garment Pressing And Cleaners' Agents
2001	KENT CLEANER	Garment Pressing And Cleaners' Agents
2002	KENT CLEANER	Garment Pressing And Cleaners' Agents
2003	KENT CLEANER	Garment Pressing And Cleaners' Agents
2004	KENT CLEANER	Garment Pressing And Cleaners' Agents
2005	KENT CLEANER	Garment Pressing And Cleaners' Agents
2006	KENT CLEANER	Garment Pressing And Cleaners' Agents
2007	KENT CLEANER	Garment Pressing And Cleaners' Agents
2008	KENT CLEANER	Garment Pressing And Cleaners' Agents
2009	KENT CLEANER	Garment Pressing And Cleaners' Agents
2010	KENT CLEANER	Garment Pressing And Cleaners' Agents
2011	KENT CLEANER	Garment Pressing And Cleaners' Agents

J50 **RITE AID #3526** **RCRA-CESQG** **1000305385**
NNE **1111 PENNSYLVANIA AVE** **NY MANIFEST** **NYD981082217**
< 1/8 **BROOKLYN, NY 11207**
0.094 mi.
498 ft. **Site 1 of 6 in cluster J**

Relative:
Lower

Actual:
9 ft.

RCRA-CESQG:

Date form received by agency:	09/14/2015
Facility name:	RITE AID #3526
Facility address:	1111 PENNSYLVANIA AVE BROOKLYN, NY 11207
EPA ID:	NYD981082217
Mailing address:	HUNTER LANE CAMP HILL, PA 17011
Contact:	DAVID W CROZIER
Contact address:	HUNTER LANE CAMP HILL, PA 17011
Contact country:	US
Contact telephone:	717-975-8643
Contact email:	EHS@RITEAID.COM
EPA Region:	02
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	FIRST SHOPPING CENTER LLC
Owner/operator address:	W 36TH ST NEW YORK, NY 10018
Owner/operator country:	US
Owner/operator telephone:	212-226-4020
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	05/23/1994
Owner/Op end date:	Not reported

Owner/operator name:	RITE AID OF NEW YORK INC
Owner/operator address:	Not reported Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported

RITE AID #3526 (Continued) **1000305385**

Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/11/1999
Owner/Op end date: Not reported

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: D007
. Waste name: CHROMIUM

RITE AID #3526 (Continued) **1000305385**

. Waste code: D009
. Waste name: MERCURY

. Waste code: D010
. Waste name: SELENIUM

. Waste code: D011
. Waste name: SILVER

. Waste code: D022
. Waste name: CHLOROFORM

. Waste code: D024
. Waste name: M-CRESOL

. Waste code: D026
. Waste name: CRESOL

. Waste code: P001
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

. Waste code: P075
. Waste name: NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS

. Waste code: U044
. Waste name: CHLOROFORM (OR) METHANE, TRICHLORO-

. Waste code: U122
. Waste name: FORMALDEHYDE

. Waste code: U201
. Waste name: 1,3-BENZENEDIOL (OR) RESORCINOL

. Waste code: U279
. Waste name: CARBARYL (OR) 1-NAPHTHALENOL, METHYLCARBAMATE

Historical Generators:
Date form received by agency: 11/04/2011
Site name: RITE AID #3526
Classification: Conditionally Exempt Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D009
. Waste name: MERCURY

. Waste code: D010

RITE AID #3526 (Continued) **1000305385**

. Waste name: SELENIUM

. Waste code: D024
. Waste name: M-CRESOL

. Waste code: P001
. Waste name: 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%

. Waste code: P075
. Waste name: NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS

Date form received by agency: 01/01/2007
Site name: PENN LAND CLEANERS
Classification: Not a generator, verified

Date form received by agency: 01/01/2006
Site name: PENN LAND CLEANERS
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: PENN LAND CLEANERS
Classification: Not a generator, verified

Date form received by agency: 05/06/1985
Site name: PENN LAND CLEANERS
Classification: Large Quantity Generator

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

NY MANIFEST:
Country: USA
EPA ID: NYD981082217
Facility Status: Not reported
Location Address 1: 1111 PENNSYLVANIA AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD981082217

RITE AID #3526 (Continued) **1000305385**

Mailing Name:	RITE AID #3526
Mailing Contact:	RITE AID #3526
Mailing Address 1:	1111 PENNSYLVANIA AVENUE
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11207
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7182720346

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2017
Trans1 State ID:	MAD084814136
Trans2 State ID:	Not reported
Generator Ship Date:	06/14/2017
Trans1 Recv Date:	06/14/2017
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	06/16/2017
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD981082217
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD010154045
TSDF ID 2:	Not reported
Manifest Tracking Number:	016104643JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	4
Units:	P - Pounds
Number of Containers:	1
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	L Landfill.
Specific Gravity:	1
Waste Code:	U002
Waste Code 1_2:	D001
Waste Code 1_3:	D018
Waste Code 1_4:	D035

RITE AID #3526 (Continued) **1000305385**

Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

Click this hyperlink while viewing on your computer to access
101 additional NY_MANIFEST: record(s) in the EDR Site Report.

J51 **TEN LAND CLEANERS** **EDR Hist Cleaner** **1018559620**
NNE **1111 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.098 mi.
515 ft. **Site 2 of 6 in cluster J**

Relative: EDR Hist Cleaner
Lower

Actual: **9 ft.**

Year:	Name:	Type:
1986	THE TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1987	THE TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1988	THE TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1989	THE TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1990	TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1991	TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1992	TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1993	TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents
1994	TEN LAND CLEANERS	Garment Pressing And Cleaners' Agents

H52 **980 ALABAMA AVENUE** **NY UST** **U003712152**
NNW **980 ALABAMA AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.100 mi.
526 ft. **Site 5 of 11 in cluster H**

Relative: UST:
Lower

Actual: **13 ft.**

Id/Status:	2-604377 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	N/A
UTM X:	593886.93922
UTM Y:	4500738.18910
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	26251
Affiliation Type:	Mail Contact
Company Name:	CHEHEBAR ASSOCIATES, LLC
Contact Type:	Not reported
Contact Name:	MIKE UNGER
Address1:	1000 PENNSYLVANIA AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 360-4238
EMail:	DAVIDMAV@AOL.COM
Fax Number:	Not reported

980 ALABAMA AVENUE (Continued) **U003712152**

Modified By:	NTFREEMA
Date Last Modified:	2015-06-25
Site Id:	26251
Affiliation Type:	Facility Operator
Company Name:	ALABAMA AVENUE REALTY INC
Contact Type:	Not reported
Contact Name:	JOSEPH BERKOVITS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 257-7111
EMail:	Not reported
Fax Number:	Not reported
Modified By:	KXTANG
Date Last Modified:	2004-11-16
Site Id:	26251
Affiliation Type:	Emergency Contact
Company Name:	ALABAMA AVENUE REALTY INC
Contact Type:	Not reported
Contact Name:	JOSEPH BERKOVITS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(212) 226-2740
EMail:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	2014-06-10
Site Id:	26251
Affiliation Type:	Facility Owner
Company Name:	CHEHEBAR ASSOCIATES, LLC
Contact Type:	AUTHORIZED SIGNATURE
Contact Name:	JOSEPH CHEHEBAR
Address1:	1000 PENNSYLVANIA AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 360-4238
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NTFREEMA
Date Last Modified:	2015-06-25

Tank Info:

Tank Number:	001

980 ALABAMA AVENUE (Continued) **U003712152**

Tank ID:	57490
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	2500
Install Date:	01/01/1980
Date Tank Closed:	06/04/2015
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	21
Date Test:	09/02/2009
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	NTFREEMA
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

I53 **WILLIAMS AV FRESH CREEK** **NY Spills** **S106001551**
WSW **WILLIAMS & FLATLANDS AVS** **N/A**
< 1/8 **BROOKLYN, NY**
0.108 mi.
568 ft. **Site 6 of 9 in cluster I**

Relative:
Lower

Actual:
10 ft.

SPILLS:

Facility ID:	0111428
Facility Type:	ER
Spill Number:	0111428
DER Facility ID:	231422
Site ID:	285397
DEC Region:	2
Spill Number/Closed Date:	2004-01-30
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	2002-03-04
Investigator:	CESAWYER
Referred To:	Not reported
Reported to Dept:	2002-03-04
CID:	390
Water Affected:	WILLIAMS AV FRESH CR
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

WILLIAMS AV FRESH CREEK (Continued) **S106001551**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-03-04
Spill Record Last Update:	2004-01-30
Spiller Name:	UNKNOWN
Spiller Company:	Unknown
Spiller Address:	UNKNOWN
Spiller Company:	999
Contact Name:	TASHA GERENA
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAWYER 1/5/04-Vought-Spill transferred from Vought to Austin. 01/27/04 - Sawyer - Spill transferred from Austin to Sawyer. 1/30/04 1525 Hrs - Outfall spill with no background information. Closed."
Remarks:	"unk cause - unk source - spill was to the William's ave fresh creek outfall. "

All Materials:

Site ID:	285397
Operable Unit ID:	850067
Operable Unit:	01
Material ID:	525454
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

I54 **FRESH CREEK** **NY Spills** **S107407404**
WSW **FLATLANDS AVENUE** **N/A**
< 1/8 **BROOKLYN, NY**
0.108 mi.
568 ft. **Site 7 of 9 in cluster I**

Relative:
Lower

Actual:
10 ft.

SPILLS:

Facility ID:	0112235
Facility Type:	ER
Spill Number:	0112235
DER Facility ID:	165059
Site ID:	198323
DEC Region:	2
Spill Number/Closed Date:	2003-07-09
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	2002-03-28
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2002-03-28
CID:	204
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Local Agency

FRESH CREEK (Continued) **S107407404**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-03-28
Spill Record Last Update:	2003-07-09
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	CHERELLE MAYFIELD
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND "
Remarks:	"OIL COMING FROM A BOOM IN A SEWER - DEC TO CONTACT CALLER "

All Materials:

Site ID:	198323
Operable Unit ID:	849187
Operable Unit:	01
Material ID:	526245
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

I55 **US COAST GUARD/NYCDEP FRESH CRK OUTFALL** **NY MANIFEST** **S108934101**
WSW **FLATLANDS & WILLIAMS AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.108 mi.
568 ft. **Site 8 of 9 in cluster I**

Relative:
Lower

Actual:
10 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP000952291
Facility Status:	Not reported
Location Address 1:	FLATLANDS & WILLIAMS AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	Not reported
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP000952291
Mailing Name:	US COAST GUARD/NYCDEP FRESH CRK OUTFALL
Mailing Contact:	JEFF BRAY
Mailing Address 1:	212 COASST GUARD DR
Mailing Address 2:	Not reported
Mailing City:	STATEN ISLAND
Mailing State:	NY

US COAST GUARD/NYCDEP FRESH CRK OUTFALL (Continued) **S108934101**

Mailing Zip:	10305
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7183544136

NY MANIFEST:

Document ID:	NYG1736208
Manifest Status:	Not reported
seq:	01
Year:	2002
Trans1 State ID:	AE63769PA
Trans2 State ID:	Not reported
Generator Ship Date:	05/17/2002
Trans1 Recv Date:	05/17/2002
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/22/2002
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP000952291
Trans1 EPA ID:	PAD146714878
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049836679
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D020 - CHLORDANE 0.03 MG/L TCLP
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	16100
Units:	P - Pounds
Number of Containers:	001
Container Type:	CM - Metal boxes, cases, roll-offs
Handling Method:	L Landfill.
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access
1 additional NY_MANIFEST: record(s) in the EDR Site Report.

I56 **REGULATOR 26 WOODS 02** **NY Spills** **S109371915**
WSW **INTERSECTION WILLIAMS AVE & FLATLANDS AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.108 mi.
568 ft. **Site 9 of 9 in cluster I**

Relative:
Lower

Actual:
9 ft.

SPILLS:

Facility ID:	0807250
Facility Type:	ER
Spill Number:	0807250
DER Facility ID:	353864
Site ID:	404589
DEC Region:	2
Spill Number/Closed Date:	2008-10-03
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	2401
Spill Date:	2008-09-28
Investigator:	smsanges
Referred To:	Not reported
Reported to Dept:	2008-09-28
CID:	Not reported
Water Affected:	FRESH CREEK
Spill Source:	Major Facility (MOSF) > 400,000 gal
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-09-28
Spill Record Last Update:	2008-10-03
Spiller Name:	JIM DALY
Spiller Company:	DEP
Spiller Address:	INTERSECTION WILLIAMS AVE & FLATLANDS AVE
Spiller Company:	999
Contact Name:	JIM DALY
DEC Memo:	""
Remarks:	"Raw sewage discharge caused by clogged regulator; ongoing at this time. Unknown amount - DEP will be calling back when they have an amount. Crew is en route."

All Materials:

Site ID:	404589
Operable Unit ID:	1161237
Operable Unit:	01
Material ID:	2152431
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

H57 **IRON SHOP SOUTH** **NY AST** **A100294500**
NNW **50 COZINE AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.115 mi.
609 ft. **Site 6 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-608647
Program Type:	PBS
UTM X:	593867.35991
UTM Y:	4500835.37841
Expiration Date:	03/20/2018
Site Type:	Trucking/Transportation/Fleet Operation

Affiliation Records:

Site Id:	30499
Affiliation Type:	Facility Owner
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	2 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-10-12

Site Id:	30499
Affiliation Type:	Mail Contact
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	FRANCINE OCAMPO
Address1:	2 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
EMail:	FRANCINE.OCAMPO@NYCT.COM
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-12-07

Site Id:	30499
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	FRANCINE OCAMPO
Address1:	Not reported
Address2:	Not reported
City:	Not reported

IRON SHOP SOUTH (Continued) **A100294500**

State: NN
Zip Code: Not reported
Country Code: 999
Phone: (646) 252-5777
EMail: Not reported
Fax Number: Not reported
Modified By: DAFRANCI
Date Last Modified: 2016-12-07

Site Id: 30499
Affiliation Type: Facility Operator
Company Name: IRON SHOP SOUTH
Contact Type: Not reported
Contact Name: NARDESH SHIWDIN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 243-3449
EMail: Not reported
Fax Number: Not reported
Modified By: DAFRANCI
Date Last Modified: 2016-12-07

Tank Info:

Tank Number: DAY TANK
Tank Id: 65438
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Equipment Records:

J05 - Dispenser - On Site Heating System (Supply/Return)
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I00 - Overfill - None
L09 - Piping Leak Detection - Exempt Suction Piping
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
G04 - Tank Secondary Containment - Double-Walled (Underground)
E01 - Piping Secondary Containment - Diking (AG only)

Tank Location: 1
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 04/01/2002
Capacity Gallons: 100
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported

IRON SHOP SOUTH (Continued) **A100294500**

Register: True
Modified By: DAFRANCI
Last Modified: 04/14/2017
Material Name: Not reported

H58 **COZINE ISLAND SHOP** **NY Spills** **S106383928**
NNW **50 COZINE AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.115 mi.
609 ft. **Site 7 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

SPILLS:
Facility ID: 0313830
Facility Type: ER
Spill Number: 0313830
DER Facility ID: 120680
Site ID: 141353
DEC Region: 2
Spill Number/Closed Date: 2004-04-19
Spill Cause: Unknown
Spill Class: C4
SWIS: 2401
Spill Date: 2004-03-18
Investigator: MCTIBBE
Referred To: Not reported
Reported to Dept: 2004-03-18
CID: 403
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-03-18
Spill Record Last Update: 2005-04-13
Spiller Name: PASHKO CAMAJ
Spiller Company: COZINE ISLAND SHOP
Spiller Address: 50 COZINE AVE
Spiller Company: 001
Contact Name: PASHKO CAMAJ
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was TIBBE 04/19/05: Approx. 1 gallon of product discovered in sump during PBS inspection. Product cleaned and did not return. Franklin Company inspected piping and could find not leaks. Sump was tested and pased."
Not reported
Remarks: "the spill is contained and the spill will be investigated and the repairs will be made to fix the problem"

All Materials:
Site ID: 141353
Operable Unit ID: 879126
Operable Unit: 01
Material ID: 495418
Material Code: 0001A
Material Name: #2 fuel oil

COZINE ISLAND SHOP (Continued) **S106383928**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

H59 **IRON SHOP SOUTH** **NY UST** **U004063189**
NNW **50 COZINE AVENUE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.115 mi.
609 ft. **Site 8 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

UST:

Id/Status:	2-608647 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	03/20/2018
UTM X:	593867.35991
UTM Y:	4500835.37841
Site Type:	Trucking/Transportation/Fleet Operation

Affiliation Records:

Site Id:	30499
Affiliation Type:	Facility Owner
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	2 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-10-12

Site Id:	30499
Affiliation Type:	Mail Contact
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	FRANCINE OCAMPO
Address1:	2 BROADWAY
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10004
Country Code:	001
Phone:	(646) 252-5777
EMail:	FRANCINE.OCAMPO@NYCT.COM
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-12-07

IRON SHOP SOUTH (Continued) **U004063189**

Site Id:	30499
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY TRANSIT
Contact Type:	Not reported
Contact Name:	FRANCINE OCAMPO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 252-5777
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-12-07

Site Id:	30499
Affiliation Type:	Facility Operator
Company Name:	IRON SHOP SOUTH
Contact Type:	Not reported
Contact Name:	NARDESH SHIWDIN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 243-3449
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-12-07

Tank Info:

Tank Number:	T-1
Tank ID:	65436
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	10/01/2001
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0008
Common Name of Substance:	Diesel

Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	DAFRANCI
Last Modified:	04/14/2017

Equipment Records:

IRON SHOP SOUTH (Continued) **U004063189**

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
E04 - Piping Secondary Containment - Double walled UG
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
H05 - Tank Leak Detection - In-Tank System (ATG)

Tank Number:	T-2
Tank ID:	65437
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	8000
Install Date:	08/01/2001
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	-
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	DAFRANCI
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
J05 - Dispenser - On Site Heating System (Supply/Return)
E04 - Piping Secondary Containment - Double walled UG
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
H05 - Tank Leak Detection - In-Tank System (ATG)

H60 **NYCTA COZINE AVENUE IRON SHOP** **RCRA-LQG** **1000219148**
NNW **50 COZINE AVE** **NY MANIFEST** **NYD001236942**
< 1/8 **BROOKLYN, NY 11208** **NJ MANIFEST**
0.115 mi.
609 ft. **Site 9 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

RCRA-LQG:

Date form received by agency:	02/26/2016
Facility name:	NYCTA COZINE AVENUE IRON SHOP
Facility address:	50 COZINE AVE BROOKLYN, NY 11208
EPA ID:	NYD001236942
Mailing address:	BROADWAY A27.63 NEW YORK, NY 10004
Contact:	SHERRY L BULKLEY
Contact address:	BROADWAY 27TH FLOOR, A27.63 NEW YORK, NY 10004
Contact country:	US
Contact telephone:	646-252-5777
Contact email:	SHERRY.BULKLEY@NYCT.COM
EPA Region:	02
Land type:	State
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name:	NEW YORK CITY TRANSIT
Owner/operator address:	COZINE AVE BROOKLYN, NY 11207
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	State
Owner/Operator Type:	Operator
Owner/Op start date:	01/01/1932
Owner/Op end date:	Not reported

Owner/operator name:	NEW YORK CITY TRANSIT
Owner/operator address:	JAY ST - ROOM 819 BROOKLYN, NY 11201
Owner/operator country:	US
Owner/operator telephone:	718-243-4581
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Legal status: Other
Owner/Operator Type: Owner
Owner/Op start date: 12/31/1979
Owner/Op end date: Not reported

Owner/operator name: NYCT - COZINE AVE IRON SHOP
Owner/operator address: COZINE AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 718-243-4581
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Other
Owner/Operator Type: Operator
Owner/Op start date: 12/31/1979
Owner/Op end date: Not reported

Owner/operator name: NEW YORK CITY TRANSIT
Owner/operator address: COZINE AVENUE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 646-252-5777
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: State
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1932
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D008
. Waste name: LEAD

Historical Generators:
Date form received by agency: 03/05/2014
Site name: NYCTA COZINE AVENUE IRON SHOP
Classification: Large Quantity Generator

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

. Waste code: D008
. Waste name: LEAD

Date form received by agency: 03/02/2010
Site name: NYCT-COZINE AVENUE IRON SHOP
Classification: Large Quantity Generator

. Waste code: D008
. Waste name: LEAD

. Waste code: D009
. Waste name: MERCURY

Date form received by agency: 01/01/2007
Site name: NYCT - COZINE AVE IRON SHOP
Classification: Small Quantity Generator

Date form received by agency: 01/01/2006
Site name: NYCT - COZINE AVE IRON SHOP
Classification: Small Quantity Generator

Date form received by agency: 07/01/2003
Site name: NYCT - COZINE AVE IRON SHOP
Classification: Small Quantity Generator

. Waste code: D008
. Waste name: LEAD

Date form received by agency: 07/08/1999
Site name: ROBERT ABBEY INC
Classification: Not a generator, verified

Date form received by agency: 06/29/1984
Site name: ROBERT ABBEY INC
Classification: Large Quantity Generator

. Waste code: F001
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F017
. Waste name: Not Defined

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:
Waste code: D008
Waste name: LEAD
Amount (Lbs): 13400

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 01/15/2015
Date achieved compliance: 01/15/2015
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 03/02/2015
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 01/15/2015
Date achieved compliance: 01/15/2015
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 01/15/2015
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 03/02/2015
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 01/15/2015
Date achieved compliance: 01/23/2015
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 03/02/2015
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 01/15/2015
Date achieved compliance: 01/23/2015

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 01/15/2015
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 03/02/2015
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 01/15/2015
Date achieved compliance: 01/23/2015
Violation lead agency: State
Enforcement action: VERBAL INFORMAL
Enforcement action date: 01/15/2015
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 03/02/2015
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 01/15/2015
Date achieved compliance: 01/23/2015
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 03/02/2015
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 05/24/1989
Date achieved compliance: 05/26/1989
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 05/24/1989
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 01/15/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 01/23/2015

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Evaluation lead agency: State

Evaluation date: 01/15/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 01/23/2015
Evaluation lead agency: State

Evaluation date: 01/15/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 01/15/2015
Evaluation lead agency: State

Evaluation date: 05/24/1989
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - Manifest
Date achieved compliance: 05/26/1989
Evaluation lead agency: State

NY MANIFEST:
Country: USA
EPA ID: NYD001236942
Facility Status: Not reported
Location Address 1: 50 COZINE AVENUE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11208
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD001236942
Mailing Name: NYCTA
Mailing Contact: OLUCHI
Mailing Address 1: 2 BROADWAY 27TH FLOOR
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10004
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 6462525771

NY MANIFEST:
Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2017
Trans1 State ID: NJ0000027193
Trans2 State ID: Not reported
Generator Ship Date: 08/10/2017
Trans1 Recv Date: 08/10/2017
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/10/2017
Part A Recv Date: Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Part B Recv Date:	Not reported
Generator EPA ID:	NYD001236942
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014162503JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	Y
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	1155
Units:	P - Pounds
Number of Containers:	3
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	Not reported
Waste Code 1_2:	Not reported
Waste Code 1_3:	D008
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
218 additional NY_MANIFEST: record(s) in the EDR Site Report.

NJ MANIFEST:

EPA Id:	NYD001236942
Mail Address:	Not reported
Mail City/State/Zip:	Not reported
Facility Phone:	7182725290
Emergency Phone:	Not reported
Contact:	Not reported
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPA Id:	Not reported
Gen Flag:	X
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Change:	Not reported

Manifest:

Manifest Number:	008923419JJK
EPA ID:	NYD001236942
Date Shipped:	11/19/2012
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	1,408.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	420.00 Pounds

Manifest Number:	006874006JJK
EPA ID:	NYD001236942

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Shipped:	07/28/2010
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/28/2010
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/28/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	1152 P

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	1962 P

Manifest Number:	003532563JJK
EPA ID:	NYD001236942
Date Shipped:	3/21/2013
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	595.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	627.00 Pounds

Manifest Number:	003633691JJK
EPA ID:	NYD001236942
Date Shipped:	04/27/2009
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/27/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/27/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	1073 P

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	1489 P

Manifest Number:	001031040JJK
EPA ID:	NYD001236942
Date Shipped:	07/26/2007
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/26/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/26/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H11
Quantity:	1333 P

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H14
Quantity:	375 P

Manifest Number:	014160010JJK
EPA ID:	NYD001236942
Date Shipped:	12/10/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Manifest Number:	008921341JJK
EPA ID:	NYD001236942
Date Shipped:	9/10/2012
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	808.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	1,330.00 Pounds

Manifest Number:	NJA5313683
EPA ID:	NYD001236942
Date Shipped:	02/16/2006
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/16/2006
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/16/2006
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	04100621
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Manifest Number:	NJA5114669
EPA ID:	NYD001236942

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Shipped:	11/05/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	11/05/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/05/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	01180521
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Manifest Number:	014160201JJK
EPA ID:	NYD001236942
Date Shipped:	1/6/2016
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
Generator EPA Facility Name:	ROBERT ABBEY, INC
Transporter-1 EPA Facility Name:	CLEAN VENTURE INC
TSDF EPA Facility Name:	CYCLE CHEM INC
QTY Units:	Pounds
Transporter SEQ ID:	Not reported
Transporter-1 Date:	1/6/2016
Waste SEQ ID:	1
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	1/6/2016
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Manifest Number:	003537002JJK
EPA ID:	NYD001236942
Date Shipped:	4/12/2011
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	1,026.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	357.00 Pounds

Manifest Number:	001031779JJK
EPA ID:	NYD001236942
Date Shipped:	12/13/2007
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	12/13/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	12/13/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported
Manifest Number:	003634941JJK
EPA ID:	NYD001236942
Date Shipped:	04/30/2008
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/30/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/30/2008
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	432 P
Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	731 P
Manifest Number:	000961981GBF

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

EPA ID:	NYD001236942
Date Shipped:	08/25/2009
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	08/25/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	08/25/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	2073 P

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	342 P

Manifest Number:	008922299JJK
EPA ID:	NYD001236942
Date Shipped:	11/20/2013
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	365.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	986.00 Pounds

Manifest Number:	008921234JJK
EPA ID:	NYD001236942
Date Shipped:	7/19/2012
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	606.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	201.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	1,337.00 Pounds

Manifest Number:	001053247GBF
EPA ID:	NYD001236942
Date Shipped:	11/17/2010
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	11/17/2010
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/17/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H141
Quantity:	764 P

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	H111
Quantity:	943 P

Manifest Number:	014168211JJK
EPA ID:	NYD001236942
Date Shipped:	10/20/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Manifest Number:	009205270JJK
EPA ID:	NYD001236942
Date Shipped:	6/4/2012
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	533.00 Pounds

Manifest Year:	Not reported
Waste Code:	D008
Hand Code:	Not reported
Quantity:	987.00 Pounds

Manifest Number:	010918338JJK
EPA ID:	NYD001236942
Date Shipped:	3/7/2016
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
Generator EPA Facility Name:	ROBERT ABBEY, INC
Transporter-1 EPA Facility Name:	CLEAN VENTURE INC
TSDF EPA Facility Name:	CYCLE CHEM INC
QTY Units:	Pounds
Transporter SEQ ID:	Not reported
Transporter-1 Date:	3/7/2016
Waste SEQ ID:	1
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported

NYCTA COZINE AVENUE IRON SHOP (Continued) **1000219148**

Date Accepted:	3/7/2016
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	Not reported
Reason Load Was Rejected:	Not reported

H61 **DRUM RUN** **NY Spills** **S117267312**
NNW **COZINE AVE & ALABAMA AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.119 mi.
630 ft. **Site 10 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

SPILLS:

Facility ID:	1402352
Facility Type:	ER
Spill Number:	1402352
DER Facility ID:	450555
Site ID:	495674
DEC Region:	2
Spill Number/Closed Date:	2014-07-16
Spill Cause:	Abandoned Drums
Spill Class:	C4
SWIS:	2401
Spill Date:	2014-06-03
Investigator:	RMPIPER
Referred To:	Not reported
Reported to Dept:	2014-06-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2014-06-03
Spill Record Last Update:	2014-07-16
Spiller Name:	ANDREW KELLY
Spiller Company:	UNKNOWN
Spiller Address:	COZINE AVE & ALABAMA AVE
Spiller Company:	999
Contact Name:	ANDREW KELLY
DEC Memo:	"drums not found. Closed."
Remarks:	"4 - 55 Gal drums of waste oil. Drums have DEP #185758272 on them."

All Materials:

Site ID:	495674
Operable Unit ID:	1245171
Operable Unit:	01
Material ID:	2246089
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	220.00

DRUM RUN (Continued) **S117267312**

Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

62
NNE
< 1/8
0.120 mi.
634 ft.

TELE MANHOLES VAPORS **NY Spills** **S102144033**
PENNS.AVE & COZINE ST. **N/A**
NEW YORK CITY, NY

Relative:
Lower

Actual:
9 ft.

SPILLS:

Facility ID:	8602391
Facility Type:	ER
Spill Number:	8602391
DER Facility ID:	89261
Site ID:	100563
DEC Region:	2
Spill Number/Closed Date:	1987-08-21
Spill Cause:	Unknown
Spill Class:	Not reported
SWIS:	2401
Spill Date:	1986-07-10
Investigator:	UNASSIGNED
Referred To:	Not reported
Reported to Dept:	1986-07-11
CID:	Not reported
Water Affected:	SEWERS
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	1987-08-21
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1986-07-11
Spill Record Last Update:	1987-08-31
Spiller Name:	Not reported
Spiller Company:	unk.
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was 10/10/95: This is additional information about material spilled from the translation of the old spill file: HYDROCARBON VAPORS."
Remarks:	"CALLED TOREGION (SULLIVAN) BY FRANK SCANDALE NYT CO. (718)330-6179"

All Materials:

Site ID:	100563
Operable Unit ID:	899116
Operable Unit:	01
Material ID:	478837
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00

TELE MANHOLES VAPORS (Continued) **S102144033**

Units: Not reported
Recovered: .00
Oxygenate: Not reported

J63 **PEP BOYS 483** **RCRA NonGen / NLR** **1004760471**
NNE **975 PENNSYLVANIA AVE** **FINDS** **NYR000046177**
< 1/8 **BROOKLYN, NY 11239** **ECHO**
0.120 mi.
635 ft. **Site 3 of 6 in cluster J**

Relative:
Lower

Actual:
9 ft.

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: PEP BOYS 483
Facility address: 975 PENNSYLVANIA AVE
BROOKLYN, NY 11239
EPA ID: NYR000046177
Mailing address: W ALLEGHENY AVE
PHILADELPHIA, NY 19132
Contact: JOHN KERELO
Contact address: W ALLEGHENY AVE
PHILADELPHIA, NY 19132
Contact country: US
Contact telephone: 215-227-9277
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: THE PEP BOYS - MANNY MOE & JACK
Owner/operator address: 3111 W ALLEGHENY AVE
PHILADELPHIA, PA 19132
Owner/operator country: US
Owner/operator telephone: 215-227-9277
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: THE PEP BOYS - MANNY MOE & JACK
Owner/operator address: 3111 W ALLEGHENY AVE
PHILADELPHIA, PA 19132
Owner/operator country: US
Owner/operator telephone: 215-227-9277
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

PEP BOYS 483 (Continued) **1004760471**

Handler Activities Summary:
- U.S. importer of hazardous waste: No
- Mixed waste (haz. and radioactive): No
- Recycler of hazardous waste: No
- Transporter of hazardous waste: No
- Treater, storer or disposer of HW: No
- Underground injection activity: No
- On-site burner exemption: No
- Furnace exemption: No
- Used oil fuel burner: No
- Used oil processor: No
- User oil refiner: No
- Used oil fuel marketer to burner: No
- Used oil Specification marketer: No
- Used oil transfer facility: No
- Used oil transporter: No

Historical Generators:
- Date form received by agency: 01/01/2006
- Site name: PEP BOYS 483
- Classification: Not a generator, verified

- Date form received by agency: 10/22/1997
- Site name: PEP BOYS 483
- Classification: Conditionally Exempt Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

Violation Status: No violations found

FINDS:

Registry ID: 110004538126

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
- Envid: 1004760471
- Registry ID: 110004538126
- DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004538126

J64 **SPILL NUMBER 9904544** **NY Spills** **S104649372**
NNE **PENNSYLVANIA & COZINE AVE** **N/A**
< 1/8 **BROOKLYN, NY**
0.121 mi.
637 ft. **Site 4 of 6 in cluster J**

Relative:
Lower

Actual:
9 ft.

SPILLS:

Facility ID:	9904544
Facility Type:	ER
Spill Number:	9904544
DER Facility ID:	217557
Site ID:	267075
DEC Region:	2
Spill Number/Closed Date:	2002-04-04
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	1999-07-16
Investigator:	CAENGELH
Referred To:	Not reported
Reported to Dept:	1999-07-16
CID:	389
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-07-16
Spill Record Last Update:	2002-04-04
Spiller Name:	Not reported
Spiller Company:	CON EDISON
Spiller Address:	4 IRVING PLACE
Spiller Company:	999
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ENGELHARDT "
Remarks:	"caller states business vehicle leaked about 1 gal of transmission fluid clean up is in the process no callback requested"

All Materials:

Site ID:	267075
Operable Unit ID:	1078976
Operable Unit:	01
Material ID:	304421
Material Code:	0021
Material Name:	transmission fluid
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

J65 **PROGAS SALES INC** **NY UST** **U000408386**
NNE **1090 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.123 mi.
648 ft. **Site 5 of 6 in cluster J**

Relative:
Lower

Actual:
9 ft.

UST:

Id/Status:	2-340049 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	N/A
UTM X:	594087.75485
UTM Y:	4500863.97973
Site Type:	Other

Affiliation Records:

Site Id:	16408
Affiliation Type:	Facility Owner
Company Name:	TEXACO REFINING & MARKETING
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	303 FELLOWSHIP RD -%MF BUTLER
Address2:	Not reported
City:	MOORESTOWN
State:	NJ
Zip Code:	08057-0945
Country Code:	001
Phone:	(609) 778-1400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	2004-12-15

Site Id:	16408
Affiliation Type:	Mail Contact
Company Name:	TEXACO REFINING & MARKETING
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	303 FELLOWSHIP RD -%MF BUTLER
Address2:	Not reported
City:	MOORESTOWN
State:	NJ
Zip Code:	08057-0945
Country Code:	001
Phone:	(609) 778-1400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	CGFREEDM
Date Last Modified:	2004-12-15

Site Id:	16408
Affiliation Type:	Facility Operator
Company Name:	PROGAS SALES INC
Contact Type:	Not reported
Contact Name:	PETER LORETTA
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN

PROGAS SALES INC (Continued) **U000408386**

Zip Code:	Not reported
Country Code:	001
Phone:	(718) 272-4090
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	16408
Affiliation Type:	Emergency Contact
Company Name:	TEXACO REFINING & MARKETING
Contact Type:	Not reported
Contact Name:	TEXACO REFINING & MARKETING
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 647-7443
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	31510
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	4000
Install Date:	07/01/1981
Date Tank Closed:	02/01/1989
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline

Tightness Test Method:	01
Date Test:	12/01/1988
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

D00 - Pipe Type - No Piping
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
I00 - Overfill - None
H99 - Tank Leak Detection - Other

PROGAS SALES INC (Continued) **U000408386**

Tank Number: 002
Tank ID: 31511
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 07/01/1981
Date Tank Closed: 02/01/1989
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 02/01/1989
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H99 - Tank Leak Detection - Other
D00 - Pipe Type - No Piping
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None

Tank Number: 003
Tank ID: 31512
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 07/01/1981
Date Tank Closed: 02/01/1989
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 02/01/1989
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D00 - Pipe Type - No Piping
J01 - Dispenser - Pressurized Dispenser
C00 - Pipe Location - No Piping

PROGAS SALES INC (Continued) **U000408386**

F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I00 - Overfill - None
H99 - Tank Leak Detection - Other

J66 **PRO GAS SALES INC** **EDR Hist Auto** **1020142541**
NNE **1090 PENNSYLVANIA AVE** **N/A**
< 1/8 **BROOKLYN, NY 11207**
0.123 mi.
648 ft. **Site 6 of 6 in cluster J**

Relative:
Lower

Actual:
9 ft.

EDR Hist Auto

Year:	Name:	Type:
1973	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1974	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1975	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1976	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1977	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1978	PENN FLAT SERVICE CENTRE INC	Gasoline Service Stations
1979	PRO GAS SALES INC	Gasoline Service Stations
1980	PRO GAS SALES INC	Gasoline Service Stations
1982	PRO GAS SALES INC	Gasoline Service Stations
1983	PRO GAS SALES INC	Gasoline Service Stations
1985	PRO GAS SALES INC	Gasoline Service Stations
1986	PRO GAS SALES INC	Gasoline Service Stations
1987	PRO GAS SALES INC	Gasoline Service Stations
1988	PRO GAS SALES INC	Gasoline Service Stations
1989	PRO GAS SALES INC	Gasoline Service Stations
1990	PRO GAS SALES INC	Gasoline Service Stations
1991	PRO GAS SALES INC	Gasoline Service Stations
1992	PRO GAS SALES INC	Gasoline Service Stations
1993	PRO GAS SALES INC	Gasoline Service Stations
1994	PRO GAS SALES INC	Gasoline Service Stations
1995	PRO GAS SALES INC	Gasoline Service Stations

H67 **960 ALABAMA AVE** **NY UST** **U000413854**
NNW **960 ALABAMA AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.126 mi.
667 ft. **Site 11 of 11 in cluster H**

Relative:
Lower

Actual:
14 ft.

UST:

Id/Status:	2-360643 / Unregulated/Closed
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	N/A
UTM X:	593857.83965
UTM Y:	4500786.19391
Site Type:	Other

Affiliation Records:

Site Id:	18175
Affiliation Type:	Facility Owner
Company Name:	LADS ASSOCIATES
Contact Type:	Not reported

960 ALABAMA AVE (Continued) **U000413854**

Contact Name:	Not reported
Address1:	960 ALABAMA AVE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 649-1666
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	18175
Affiliation Type:	Mail Contact
Company Name:	LADS ASSOCIATES
Contact Type:	Not reported
Contact Name:	SOLOMON TROPPER
Address1:	960 ALABAMA AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 649-1666
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	18175
Affiliation Type:	Facility Operator
Company Name:	960 ALABAMA AVE
Contact Type:	Not reported
Contact Name:	SOLOMON TROPPER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 649-1666
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	18175
Affiliation Type:	Emergency Contact
Company Name:	LADS ASSOCIATES
Contact Type:	Not reported
Contact Name:	SOLOMON TROPPER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported

960 ALABAMA AVE (Continued) **U000413854**

Country Code:	001
Phone:	(718) 258-1580
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Tank Info:

Tank Number:	001
Tank ID:	25790
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	5000
Install Date:	Not reported
Date Tank Closed:	02/03/1999
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	03
Date Test:	01/01/1999
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I04 - Overfill - Product Level Gauge (A/G)

---

68 **MEADOWOOD AT GATEWAY CONDOMINIUM** **NY AST** **A100293966**
NE **1065 VERMONT STREET** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.132 mi.
699 ft.

Relative:
Lower

Actual:
9 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-608697
Program Type:	PBS
UTM X:	594259.85166
UTM Y:	4500957.14158
Expiration Date:	05/19/2020
Site Type:	Apartment Building/Office Building

Affiliation Records:

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293966**

Site Id:	30549
Affiliation Type:	Facility Operator
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type:	Not reported
Contact Name:	ALFREDO PEREZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30549
Affiliation Type:	Mail Contact
Company Name:	DOUGLAS ELLIMAN PROPERTY MANAGEMENT
Contact Type:	Not reported
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NY
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	PATRICIA.PETTWAY-BROWN@ELLIMANPM.COM
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30549
Affiliation Type:	Facility Owner
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM C/O DOUGLAS ELLIM
Contact Type:	COMPLIANCE MANAGER
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NY
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30549
Affiliation Type:	Emergency Contact
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM C/O DOUGLAS ELLIM
Contact Type:	Not reported
Contact Name:	ANGEL RODRIQUEZ
Address1:	Not reported

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293966**

Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Tank Info:

Tank Number:	001
Tank Id:	65537
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

C01 - Pipe Location - Aboveground
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
B00 - Tank External Protection - None
F00 - Pipe External Protection - None

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	3500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DMPOKRZY
Last Modified:	04/14/2017
Material Name:	Not reported

K69 **CON EDISON** **NJ MANIFEST** **S120673972**
WNW **WILLIAMS AVE & GLENWOOD RD** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.158 mi.
832 ft. **Site 1 of 4 in cluster K**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYP004807681
Mail Address:	IRVING PL 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THOMAS TEELING
Comments:	Not reported
SIC Code:	Not reported

CON EDISON (Continued) **S120673972**

County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	014469066JJK
EPA ID:	NYP004807681
Date Shipped:	7/15/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

K70
WNW
1/8-1/4
0.158 mi.
832 ft.

CON EDISON
WILLIAMS AVE & GLENWOOD RD
BROOKLYN, NY 11236

Site 2 of 4 in cluster K

RCRA NonGen / NLR **1019905262**
NYP004807681

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	07/15/2015
Facility name:	CON EDISON
Facility address:	WILLIAMS AVE & GLENWOOD RD BROOKLYN, NY 11236
EPA ID:	NYP004807681
Mailing address:	IRVING PL 15TH FL NE NEW YORK, NY 10003
Contact:	THOMAS TEELING
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	212-460-3770
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency:	07/15/2015
Site name:	CON EDISON
Classification:	Large Quantity Generator

Violation Status: No violations found

K71
WNW
1/8-1/4
0.158 mi.
832 ft.

CON ED
WILLIAMS AVE & GLENWOOD RD
BROOKLYN, NY 11236

Site 3 of 4 in cluster K

NY MANIFEST **S119076538**
N/A

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004807681
Facility Status:	Not reported
Location Address 1:	998 WILLIAMS AVE
Code:	BP

CON ED (Continued) **S119076538**

Location Address 2:	SB 58230
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11236
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004807681
Mailing Name:	CON ED
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	07/15/2015
Trans1 Recv Date:	07/15/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/16/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004807681
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014469066JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	1000

CON ED (Continued) **S119076538**

Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

K72 **CON EDISON** **RCRA NonGen / NLR** **1019905261**
WNW **998 WILLIAMS AVE & GLENWOOD RD** **FINDS** **NYP004807673**
1/8-1/4 **BROOKLYN, NY 11236** **ECHO**
0.158 mi.
833 ft. **Site 4 of 4 in cluster K**

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	07/15/2015
Facility name:	CON EDISON
Facility address:	998 WILLIAMS AVE & GLENWOOD RD BROOKLYN, NY 11236
EPA ID:	NYP004807673
Mailing address:	IRVING PL 15TH FL NE NEW YORK, NY 10003
Contact:	THOMAS TEELING
Contact address:	Not reported Not reported
Contact country:	Not reported
Contact telephone:	212-460-3770
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

CON EDISON (Continued) **1019905261**

Historical Generators:
Date form received by agency: 07/15/2015
Site name: CON EDISON
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110069674310

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1019905261
Registry ID: 110069674310
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110069674310

73
North
1/8-1/4
0.174 mi.
920 ft.

Relative:
Lower

Actual:
9 ft.

PARKER HANNIFIN CORP IDEAL DIV **RCRA NonGen / NLR** **1000268840**
1000 PENNSYLVANIA AVE **FINDS** **NYD001211267**
BROOKLYN, NY 11207 **ECHO**
NY MANIFEST

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: PARKER HANNIFIN CORP IDEAL DIV
Facility address: 1000 PENNSYLVANIA AVE
BROOKLYN, NY 11207-8417
EPA ID: NYD001211267
Mailing address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact: Not reported
Contact address: PENNSYLVANIA AVE
BROOKLYN, NY 11207
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 02
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: PARKER HANNIFIN CORP
Owner/operator address: 17325 EUCLID AVE
CLEVELAND, OH 44112

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

Owner/operator country: US
Owner/operator telephone: 216-531-3000
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: PARKER HANNIFIN CORP
Owner/operator address: 17325 EUCLID AVENUE
OPERCITY, OH 99999
Owner/operator country: US
Owner/operator telephone: 216-531-3000
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: PARKER HANNIFIN CORP IDEAL DIV
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: PARKER HANNIFIN CORP IDEAL DIV
Classification: Not a generator, verified

Date form received by agency: 03/01/1981
Site name: PARKER HANNIFIN CORP IDEAL DIV
Classification: Not a generator, verified

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM;

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

(2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.

. Waste code: F008
. Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F010
. Waste name: QUENCHING BATH RESIDUES FROM OIL BATHS FROM METAL HEAT TREATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F012
. Waste name: QUENCHING WASTEWATER TREATMENT SLUDGES FROM METAL HEAT TREATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 11/17/1980
Site name: PARKER HANNIFIN CORP IDEAL DIV
Classification: Large Quantity Generator

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.

. Waste code: F008
. Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F010
. Waste name: QUENCHING BATH RESIDUES FROM OIL BATHS FROM METAL HEAT TREATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

. Waste code: F012
. Waste name: QUENCHING WASTEWATER TREATMENT SLUDGES FROM METAL HEAT TREATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 04/07/1987
Date achieved compliance: 08/10/1987
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 05/05/1987
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 04/07/1987
Date achieved compliance: 08/10/1987
Violation lead agency: State
Enforcement action: FINAL 3008(A) COMPLIANCE ORDER
Enforcement action date: 06/23/1987
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/08/1985
Date achieved compliance: 12/31/1985
Violation lead agency: EPA
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/08/1985
Date achieved compliance: 12/31/1985
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 11/01/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 09/21/1983
Date achieved compliance: 04/21/1984
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 04/07/1987
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/10/1987
Evaluation lead agency: State

Evaluation date: 08/08/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 12/31/1985
Evaluation lead agency: State

Evaluation date: 08/08/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 12/31/1985
Evaluation lead agency: EPA

Evaluation date: 07/17/1985
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 09/21/1983
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 04/21/1984
Evaluation lead agency: State

FINDS:

Registry ID: 110004332534

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000268840
Registry ID:	110004332534
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004332534

NY MANIFEST:

Country:	USA
EPA ID:	NYD001211267
Facility Status:	Not reported
Location Address 1:	1000 PENNSYLVANIA AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD001211267
Mailing Name:	PARKER HANNIFIN-IDEAL DIVISION
Mailing Contact:	PARKER HANNIFIN-IDEAL DIVISION
Mailing Address 1:	1000 PENNSYLVANIA AVENUE
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11207
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7184984000

NY MANIFEST:

Document ID:	NJA0295898
Manifest Status:	C
seq:	Not reported
Year:	1987
Trans1 State ID:	NJSWAS103
Trans2 State ID:	Not reported
Generator Ship Date:	05/08/1987
Trans1 Recv Date:	05/08/1987
Trans2 Recv Date:	/ /
TSD Site Recv Date:	05/12/1987
Part A Recv Date:	05/27/1987
Part B Recv Date:	05/20/1987
Generator EPA ID:	NYD001211267
Trans1 EPA ID:	NJD000813477
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046

PARKER HANNIFIN CORP IDEAL DIV (Continued) **1000268840**

TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00100
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100

Click this hyperlink while viewing on your computer to access
19 additional NY_MANIFEST: record(s) in the EDR Site Report.

L74 **L&M OPTICAL DISC** **NJ MANIFEST** **S107909458**
NW **303 LOUISIANA AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11201**
0.177 mi.
933 ft. **Site 1 of 2 in cluster L**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYR000003259
Mail Address:	303 LOUISIANA_AVENUE
Mail City/State/Zip:	BROOKLYN 11201
Facility Phone:	7186493500
Emergency Phone:	Not reported
Contact:	Not reported
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPA Id:	Not reported
Gen Flag:	X
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	NJA5254910
EPA ID:	NYR000003259
Date Shipped:	07/20/2005

L&M OPTICAL DISC (Continued) **S107909458**

TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/20/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/21/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	08250535
Was Load Rejected:	BROOKLYN 11201
Reason Load Was Rejected:	Not reported

L75 **L & M OPTICAL DISC** **RCRA-LQG** **1004763065**
NW **303 LOUISIANA AVE** **NY MANIFEST** **NYR000103259**
1/8-1/4 **BROOKLYN, NY 11207** **NJ MANIFEST**
0.177 mi.
933 ft. **Site 2 of 2 in cluster L**

Relative:
Lower

Actual:
13 ft.

RCRA-LQG:

Date form received by agency:	02/24/2014
Facility name:	L & M OPTICAL DISC
Facility address:	303 LOUISIANA AVE BROOKLYN, NY 11207
EPA ID:	NYR000103259
Mailing address:	W 37TH ST 9TH FLOOR NEW YORK, NY 10018
Contact:	YAFIT SHAHAR
Contact address:	W 37TH ST 9TH FLOOR NEW YORK, NY 10018

L & M OPTICAL DISC (Continued) **1004763065**

Contact country: US
Contact telephone: 718-649-1500
Telephone ext.: 209
Contact email: YAFIT@LMOPTICALDISC.COM
EPA Region: 02
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: COZINE AVE LLC
Owner/operator address: LOUSIANN AVE
BROOMER, NY 11207
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/2000
Owner/Op end date: Not reported

Owner/operator name: COZINE AVE LLC
Owner/operator address: LOUISIANA AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 718-649-1500
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/30/2000
Owner/Op end date: Not reported

Owner/operator name: L AND M OPTICAL DISC
Owner/operator address: LOUISIANN AVE
BROOMER, NY 11207
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator

L & M OPTICAL DISC (Continued) **1004763065**

Owner/Op start date: 01/01/2000
Owner/Op end date: Not reported

Owner/operator name: COZINE AVE LLC
Owner/operator address: LOUISIANA AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/30/2000
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Historical Generators:
Date form received by agency: 05/01/2012
Site name: L AND M OPTICAL DISC
Classification: Large Quantity Generator

. Waste code: D001

L & M OPTICAL DISC (Continued) **1004763065**

. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Date form received by agency: 02/16/2010
Site name: L AND M OPTICAL DISC LLC
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

L & M OPTICAL DISC (Continued) **1004763065**

Date form received by agency: 02/05/2008
Site name: L AND M OPTICAL DISC
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 01/01/2007
Site name: L AND M OPTICAL DISC
Classification: Small Quantity Generator

Date form received by agency: 01/23/2006
Site name: L AND M OPTICAL DISC
Classification: Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 01/22/2006
Site name: L AND M OPTICAL DISC
Classification: Small Quantity Generator

Date form received by agency: 03/01/2004
Site name: L AND M OPTICAL DISC
Classification: Large Quantity Generator

. Waste code: D001

L & M OPTICAL DISC (Continued) **1004763065**

. Waste name: IGNITABLE WASTE

. Waste code: D002
. Waste name: CORROSIVE WASTE

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 01/08/2002
Site name: L & M OPTICAL DISC LLC
Classification: Small Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: TSD IS-Container Use and Management
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 05/06/2010
Date achieved compliance: 05/06/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 05/06/2010
Date achieved compliance: 05/11/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Closure/Post-Closure
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 05/06/2010
Date achieved compliance: 05/06/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-General Facility Standards
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: State Statute or Regulation
Date violation determined: 05/06/2010
Date achieved compliance: 05/10/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Preparedness and Prevention
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Area of violation: Generators - General
Date violation determined: 05/06/2010
Date achieved compliance: 08/31/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - General
Date violation determined: 05/06/2010
Date achieved compliance: 05/19/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/04/2010
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 09/15/2010
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 03/31/2014
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 11/16/2012
Evaluation: COMPLIANCE ASSISTANCE VISIT
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - Pre-transport
Date achieved compliance: 05/06/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 05/10/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 05/19/2010
Evaluation lead agency: State

L & M OPTICAL DISC (Continued) **1004763065**

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 05/06/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Closure/Post-Closure
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: State Statute or Regulation
Date achieved compliance: 05/11/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Container Use and Management
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Contingency Plan and Emergency Procedures
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Preparedness and Prevention
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 05/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-General Facility Standards
Date achieved compliance: 08/31/2010
Evaluation lead agency: State

Evaluation date: 12/21/2004
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

NY MANIFEST:
Country: USA
EPA ID: NYR000103259
Facility Status: Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Location Address 1:	303 LOUISIANA AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYR000103259
Mailing Name:	L&M OPTICAL LLC
Mailing Contact:	STEVE TOPLAN
Mailing Address 1:	303 LOUISIANA AVENUE
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11207
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7186493500

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2013
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	02/15/2013
Trans1 Recv Date:	02/15/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/19/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000103259
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	000960053GBF
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Waste Code:	Not reported
Quantity:	500
Units:	P - Pounds
Number of Containers:	2
Container Type:	CW - Wooden boxes
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D002
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
191 additional NY_MANIFEST: record(s) in the EDR Site Report.

NJ MANIFEST:

EPA Id:	NYR000103259
Mail Address:	303 LOUISIANA AVENUE
Mail City/State/Zip:	BROOKLYN 11207
Facility Phone:	7186493500
Emergency Phone:	Not reported
Contact:	STEVE TOPLAN
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPA Id:	Not reported
Gen Flag:	X
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	NJA5241908
EPA ID:	NYR000103259
Date Shipped:	11/14/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	11/14/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/14/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	12200535
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	NJA5005379
EPA ID:	NYR000103259
Date Shipped:	06/11/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	06/11/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	06/11/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Manifest Discrepancy Type:	Not reported
Data Entry Number:	06220421
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported
Manifest Number:	NJA5209085
EPA ID:	NYR000103259
Date Shipped:	08/16/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	08/16/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	08/16/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	09160421
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported
Manifest Number:	006874043JJK
EPA ID:	NYR000103259
Date Shipped:	07/30/2010
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/30/2010
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/30/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H141
Quantity:	385 G
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H141
Quantity:	220 G
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H141
Quantity:	275 G
Manifest Number:	NJA5253381
EPA ID:	NYR000103259
Date Shipped:	04/04/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/04/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/04/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	05170522
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	001056627GBF
EPA ID:	NYR000103259
Date Shipped:	1/10/2011
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H141
Quantity:	220.00 gallons

Manifest Number:	003531905JJK
EPA ID:	NYR000103259
Date Shipped:	07/16/2008
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/16/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/16/2008
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Data Entry Number: Not reported
Was Load Rejected: BROOKLYN 11207
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D002
Hand Code: H141
Quantity: 385 G

Manifest Number: 001032918JJK
EPA ID: NYR000103259
Date Shipped: 01/25/2007
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJ0000027193
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 01/25/2007
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 01/25/2007
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BROOKLYN 11207
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D002
Hand Code: H14
Quantity: 660 G

L & M OPTICAL DISC (Continued) **1004763065**

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H14
Quantity:	10 G

Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H14
Quantity:	30 G

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H14
Quantity:	50 G

Manifest Number:	001034797JJK
EPA ID:	NYR000103259
Date Shipped:	03/22/2007
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/22/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	03/22/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Waste:

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H14
Quantity:	25 G

Manifest Number:	NJA5009441
EPA ID:	NYR000103259
Date Shipped:	02/02/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/02/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/03/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	03150421
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	001023958JJK
EPA ID:	NYR000103259
Date Shipped:	07/05/2007
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/05/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/05/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H14
Quantity:	55 G

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H14
Quantity:	825 G

Manifest Number:	001033630JJK
EPA ID:	NYR000103259
Date Shipped:	08/16/2007
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Date Trans1 Transported Waste:	08/16/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	08/16/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H14
Quantity:	10 G

Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H11
Quantity:	605 G

Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H14
Quantity:	50 G

Manifest Number:	NJA5114662
EPA ID:	NYR000103259
Date Shipped:	11/05/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Date Trans1 Transported Waste:	11/05/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/05/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	12270421
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported
Manifest Number:	NJA5242491
EPA ID:	NYR000103259
Date Shipped:	04/27/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/27/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/27/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	06160522
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	003536773JJK
EPA ID:	NYR000103259
Date Shipped:	11/21/2008
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	11/21/2008
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	11/21/2008
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	H141
Quantity:	1100 G

L & M OPTICAL DISC (Continued) **1004763065**

Manifest Number:	NJA5243164
EPA ID:	NYR000103259
Date Shipped:	09/14/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	09/14/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	09/14/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	10270521
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	NJA5241687
EPA ID:	NYR000103259
Date Shipped:	12/28/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	12/28/2005
Date Trans2 Transported Waste:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	12/28/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	02150622
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

Manifest Number:	NJA5254909
EPA ID:	NYR000103259
Date Shipped:	07/20/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/20/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/20/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	08290521
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported
Manifest Number:	NJA5212226
EPA ID:	NYR000103259
Date Shipped:	12/29/2004
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	12/29/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	12/29/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	01310521
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported
Manifest Number:	NJA5242484
EPA ID:	NYR000103259
Date Shipped:	04/27/2005
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported

L & M OPTICAL DISC (Continued) **1004763065**

Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/27/2005
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/27/2005
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	06160522
Was Load Rejected:	BROOKLYN 11207
Reason Load Was Rejected:	Not reported

76
NE
1/8-1/4
0.186 mi.
983 ft.

MEADOWOOD AT GATEWAY CONDOMINIUM **NY AST** **A100293968**
12205 FLATLANDS AVENUE **N/A**
BROOKLYN, NY 11207

Relative:
Lower

Actual:
13 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-608696
Program Type:	PBS
UTM X:	594450.48388
UTM Y:	4500993.64551
Expiration Date:	05/19/2020
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	30548
Affiliation Type:	Facility Operator
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type:	Not reported
Contact Name:	ALFREDO PEREZ

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293968**

Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30548
Affiliation Type:	Mail Contact
Company Name:	DOUGLAS ELLIMAN PROPERTY MANAGEMENT
Contact Type:	Not reported
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NY
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	PATRICIA.PETTWAY-BROWN@ELLIMANPM.COM
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30548
Affiliation Type:	Facility Owner
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM C/O DOUGLAS ELLIM
Contact Type:	COMPLIANCE MANAGER
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NY
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	30548
Affiliation Type:	Emergency Contact
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM C/O DOUGLAS ELLIM
Contact Type:	Not reported
Contact Name:	ANGEL RODRIQUEZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293968**

Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Tank Info:

Tank Number:	001
Tank Id:	65536
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
C01 - Pipe Location - Aboveground

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	3500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DMPOKRZY
Last Modified:	04/14/2017
Material Name:	Not reported

M77 **NYC DEPT OF SANITATION** **RCRA NonGen / NLR** **1000446348**
North **BK-18 922 GEORGIA AVE** **NYD986913077**
1/8-1/4 **BROOKLYN, NY 11207**
0.202 mi.
1065 ft. **Site 1 of 5 in cluster M**

Relative:
Lower

Actual:
10 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYC DEPT OF SANITATION
Facility address:	BK-18 922 GEORGIA AVE BROOKLYN, NY 11207
EPA ID:	NYD986913077
Mailing address:	58TH ST RM 404 WOODSIDE, NY 11377
Contact:	Not reported
Contact address:	58TH ST RM 404 WOODSIDE, NY 11377
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported

NYC DEPT OF SANITATION (Continued) **1000446348**

EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: NYC DEPT OF SANITATION
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYC DEPT OF SANITATION
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: NYC DEPT OF SANITATION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: NYC DEPT OF SANITATION
Classification: Not a generator, verified

NYC DEPT OF SANITATION (Continued) **1000446348**

Date form received by agency: 09/18/1990
Site name: NYC DEPT OF SANITATION
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: X001
. Waste name: WASTE OILS

Violation Status: No violations found

N78 **CON ED** **NY MANIFEST** **S118257910**
WNW **998 WILLIAMS AVE & GLENWOOD RD** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.202 mi.
1066 ft. **Site 1 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:
Country: USA
EPA ID: NYP004807673
Facility Status: Not reported
Location Address 1: 992 WILLIAMS AVE
Code: BP
Location Address 2: SB 58229
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11236
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYP004807673
Mailing Name: CON ED
Mailing Contact: TOM TEELING
Mailing Address 1: 4 IRVING PLACE - 15TH FLOOR
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 2124603770

NY MANIFEST:
Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2015
Trans1 State ID: NJ0000027193
Trans2 State ID: Not reported
Generator Ship Date: 07/15/2015
Trans1 Recv Date: 07/15/2015
Trans2 Recv Date: Not reported
TSD Site Recv Date: 07/16/2015
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP004807673
Trans1 EPA ID: Not reported

CON ED (Continued) **S118257910**

Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014469065JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	1500
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

O79 **BP SERVICE STATION # 66349** **NY UST** **U000405864**
SW **108-04 FLATLANDS AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.207 mi.
1093 ft. **Site 1 of 3 in cluster O**

Relative:
Lower

Actual:
10 ft.

UST:

Id/Status:	2-218006 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	12/29/2020
UTM X:	593676.13500
UTM Y:	4500378.79202
Site Type:	Retail Gasoline Sales

Affiliation Records:

Site Id:	8280
Affiliation Type:	Facility Operator
Company Name:	PMG #8532

BP SERVICE STATION # 66349 (Continued) **U000405864**

Contact Type:	Not reported
Contact Name:	GUANGQIANG AO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 272-3506
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-03-24

Site Id:	8280
Affiliation Type:	Mail Contact
Company Name:	BP PRODUCTS NORTH AMERICA, INC.
Contact Type:	Not reported
Contact Name:	JOHN W. MAHONEY
Address1:	P.O. BOX 6038
Address2:	Not reported
City:	ARTESIA
State:	CA
Zip Code:	90702
Country Code:	001
Phone:	(973) 392-6150
EMail:	JOHN.MAHONEY@BP.COM
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-08-30

Site Id:	8280
Affiliation Type:	Emergency Contact
Company Name:	BLUE HILLS FUEL, LLC
Contact Type:	Not reported
Contact Name:	JOHN W. MAHONEY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(973) 392-6150
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-08-30

Site Id:	8280
Affiliation Type:	Facility Owner
Company Name:	BLUE HILLS FUEL, LLC
Contact Type:	RETAIL COMPLIANCE COORDINATOR
Contact Name:	JOHN W. MAHONEY
Address1:	3819 MAPLE AVE
Address2:	Not reported
City:	DALLAS
State:	TX

BP SERVICE STATION # 66349 (Continued) **U000405864**

Zip Code:	75219
Country Code:	001
Phone:	(214) 661-8137
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-08-30

Tank Info:

Tank Number:	006
Tank ID:	23820
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	1000
Install Date:	12/01/1984
Date Tank Closed:	08/01/1994
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	16
Date Test:	08/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	dxliving
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B04 - Tank External Protection - Fiberglass
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number:	007
Tank ID:	23821
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	550
Install Date:	12/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported

BP SERVICE STATION # 66349 (Continued) **U000405864**

Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 008
Tank ID: 23822
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 009
Tank ID: 23823
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground

BP SERVICE STATION # 66349 (Continued) **U000405864**

Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 010
Tank ID: 23824
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None

Tank Number: 011
Tank ID: 23825
Tank Status: Closed Prior to Micro Conversion, 03/91

BP SERVICE STATION # 66349 (Continued) **U000405864**

Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	550
Install Date:	12/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number:	012
Tank ID:	23826
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	550
Install Date:	12/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
J02 - Dispenser - Suction Dispenser

BP SERVICE STATION # 66349 (Continued) **U000405864**

G00 - Tank Secondary Containment - None

Tank Number: 013
Tank ID: 23827
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping

Tank Number: 014
Tank ID: 23828
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

BP SERVICE STATION # 66349 (Continued) **U000405864**

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number:	015
Tank ID:	23829
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	550
Install Date:	12/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None

Tank Number:	016
Tank ID:	23830
Tank Status:	Closed Prior to Micro Conversion, 03/91
Material Name:	Closed Prior to Micro Conversion, 03/91
Capacity Gallons:	550
Install Date:	12/01/1962
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported

BP SERVICE STATION # 66349 (Continued) **U000405864**

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None

Tank Number: 017
Tank ID: 23831
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 018
Tank ID: 23832
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 550
Install Date: 12/01/1962
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999

BP SERVICE STATION # 66349 (Continued) **U000405864**

Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 1
Tank ID: 23815
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 4000
Install Date: 08/01/1978
Date Tank Closed: 06/12/2006
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 20
Date Test: 01/04/2000
Next Test Date: Not reported
Pipe Model: D
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:

H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I03 - Overfill - Automatic Shut-Off
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F04 - Pipe External Protection - Fiberglass
G00 - Tank Secondary Containment - None
C02 - Pipe Location - Underground/On-ground
K01 - Spill Prevention - Catch Basin
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
J01 - Dispenser - Pressurized Dispenser
B02 - Tank External Protection - Original Sacrificial Anode
E04 - Piping Secondary Containment - Double walled UG

Tank Number: 2

BP SERVICE STATION # 66349 (Continued) **U000405864**

Tank ID:	23816
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	8000
Install Date:	02/01/1985
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	20
Date Test:	01/04/2000
Next Test Date:	Not reported
Pipe Model:	D
Modified By:	DAFRANCI
Last Modified:	08/23/2017

Equipment Records:

E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	3
Tank ID:	23817
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	0
Install Date:	02/01/1985
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	20
Date Test:	01/04/2000
Next Test Date:	Not reported
Pipe Model:	D
Modified By:	DAFRANCI
Last Modified:	08/23/2017

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass

BP SERVICE STATION # 66349 (Continued) **U000405864**

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	4
Tank ID:	23818
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	8000
Install Date:	02/01/1985
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	20
Date Test:	01/04/2000
Next Test Date:	Not reported
Pipe Model:	D
Modified By:	DAFRANCI
Last Modified:	08/23/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number:	5
Tank ID:	23819
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	0
Install Date:	02/01/1985
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground

BP SERVICE STATION # 66349 (Continued) **U000405864**

Tank Type:	Fiberglass coated steel
Material Code:	2712
Common Name of Substance:	Gasoline/Ethanol
Tightness Test Method:	20
Date Test:	01/04/2000
Next Test Date:	Not reported
Pipe Model:	D
Modified By:	DAFRANCI
Last Modified:	08/23/2017

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
C02 - Pipe Location - Underground/On-ground
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
E04 - Piping Secondary Containment - Double walled UG
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser
B04 - Tank External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

---

O80 **EXXON S/S** **NY LTANKS** **S104495237**
SW **108-04 FLATLANDS AVE** **NY Spills** **N/A**
1/8-1/4 **BROOKLYN, NY**
0.207 mi.
1093 ft. **Site 2 of 3 in cluster O**

Relative:
Lower

Actual:
10 ft.

LTANKS:

Facility ID:	9304648
Site ID:	134225
Spill Number/Closed Date:	1993-08-03
Spill Date:	1993-07-13
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	1993-08-03
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1993-07-13
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-07-14
Spill Record Last Update:	2003-04-03
Spiller Name:	Not reported
Spiller Company:	EXXONMOBIL
Spiller Address:	Not reported

EXXON S/S (Continued) **S104495237**

Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	115336
DEC Memo:	""
Remarks:	"EX.- INVEST - RETEST"

All TTF:

Facility ID:	9304648
Spill Number:	9304648
Spill Tank Test:	1541762
Site ID:	134225
Tank Number:	Not reported
Tank Size:	0
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	134225
Operable Unit ID:	982936
Operable Unit:	01
Material ID:	398137
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9612806
Site ID:	134227
Spill Number/Closed Date:	2003-09-16
Spill Date:	1997-01-28
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1997-01-28
CID:	267
Water Affected:	Not reported

EXXON S/S (Continued) **S104495237**

Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1997-01-28
Spill Record Last Update:	2003-09-16
Spiller Name:	MONIQUE JOHNSON
Spiller Company:	EXXON SERVICE STATION
Spiller Address:	108-04 FLATLANDS AVE
Spiller County:	001
Spiller Contact:	MONIQUE JOHNSON
Spiller Phone:	(800) 350-0531
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	115336
DEC Memo:	""
Remarks:	"TANK TEST TANK FAILED WITH A RATE OF .6640 GALLONS PER HOUR"

All TTF:

Facility ID:	9612806
Spill Number:	9612806
Spill Tank Test:	1544979
Site ID:	134227
Tank Number:	001
Tank Size:	4000
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	20
Test Method 2:	USTest 2000/P/LL plus USTest 2000/U
Leak Rate:	.66
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	134227
Operable Unit ID:	1044324
Operable Unit:	01
Material ID:	341453
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9913633
Site ID:	134228
Spill Number/Closed Date:	2003-09-15

EXXON S/S (Continued) **S104495237**

Spill Date:	2000-02-15
Spill Cause:	Tank Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	2000-03-03
CID:	205
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	2000-03-03
Spill Record Last Update:	2003-09-16
Spiller Name:	Not reported
Spiller Company:	EXXONMOBIL
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	CALLER
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	115336
DEC Memo:	""
Remarks:	"Caller doing site work for new purchaser, found contamination on old exxon gas station property."

All Materials:

Site ID:	134228
Operable Unit ID:	1088167
Operable Unit:	01
Material ID:	295470
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	9002597
Facility Type:	ER
Spill Number:	9002597
DER Facility ID:	115336
Site ID:	134224
DEC Region:	2
Spill Number/Closed Date:	1991-05-14
Spill Cause:	Equipment Failure
Spill Class:	C3

EXXON S/S (Continued) **S104495237**

SWIS:	2401
Spill Date:	1990-06-06
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1990-06-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Responsible Party
Cleanup Ceased:	1991-05-14
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1990-06-13
Spill Record Last Update:	2003-10-21
Spiller Name:	Not reported
Spiller Company:	EXXONMOBIL
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	""
Remarks:	"WHILE PULLING TANKS CONTRACTOR DAMAGED PRODUCT LINE WILL REMOVE SOIL PICKED UP AND DISPOSED."

All Materials:

Site ID:	134224
Operable Unit ID:	942599
Operable Unit:	01
Material ID:	437338
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9409298
Facility Type:	ER
Spill Number:	9409298
DER Facility ID:	115336
Site ID:	134226
DEC Region:	2
Spill Number/Closed Date:	2015-07-21
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	2401
Spill Date:	1994-10-12
Investigator:	axdorono
Referred To:	Not reported
Reported to Dept:	1994-10-12
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility

EXXON S/S (Continued) **S104495237**

Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1994-11-03
Spill Record Last Update:	2015-07-21
Spiller Name:	Not reported
Spiller Company:	ExxonMobil
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	ANGELA PIMENTAL
DEC Memo:	"This spill case was reassigned from DEC (Sigona) to Rommel on 02/10/2004. This spill site has been consolidated under Spill No. 9409298. RE: Spill Investigation Nos. 9409298, 9612806 & 9913633, Conoco Phillips - Former ExxonMobil S/S,108-04 Flatlands Avenue, Brooklyn, N.Y. - Petroleum Bulk Storage (PBS) No. 2-218006. Reassigned from DEC O'Dowd on March 2000 to Sigona. DEC's comments regarding a site visit on February 24, 2003, to evaluate proposed investigatory work and facility compliance with State and Federal PBS regulations. The DEC has also reviewed the results of the Subsurface Investigation Report (SIR) from Groundwater & Environmental Services (GES), dated September 4, 2002. The results of the PBS inspection were documented by this Department, and a notice regarding those results have been forwarded to Conoco Phillips in a separate letter, dated April 3, 2003. The results of the SIR indicates there are elevated levels of Volatile Organic Compounds (VOCs), which have already impacted the groundwater at this site. This indicates the need for further investigation. In addition, the DEC's records indicate there are at least two (2) additional unresolved spill cases recorded under Spill Nos. 9409298 and 9612806, which require investigation. 03/29/06: Talked with Bill Simmons from ECS about any progress. He said that our request for three additional wells would be implemented in April, and that one well would have to be shifted slightly due to utilities. I said that was fine. - SK Spill No. 9409298 - Soil contamination discovered during removal of former 1,000 gallon Underground Storage Tank (UST) which stored used oil. Spill No. 9612806 - 4,000 gallon double-walled Buffide tank was reported to have a leak in the primary tank, and super unleaded gasoline was pumped from the secondary containment in January 1997. A letter was sent to DEC on January 30, 1997, indicating that Exxon would inform DEC of its actions regarding the disposition of this tank. 10/25/2004: DEC Lead transferred from J. Rommel to D. Harrington. 11/23/2004: Sent letter to Cumberland Farms requiring work plan for additional investigation and an environmental site history. (Harrington) 1/12/2005: Approved SI work plan (installation of four (4) new monitoring wells). Harrington 6/14/05: This spill case transferred from Harrington (Central Office) to J. Kolleeny (Region 2). - JK 6/30/05: Reviewed Site Status Update letter from ECS, dated May 6, 2005. Letter states that ECS completed a subsurface investigation at the site in April 2005, installing 4 monitoring wells. Results of soil and groundwater sampling will be presented in an upcoming Subsurface Investigation Report, and ECS will continue quarterly groundwater monitoring. - J. Kolleeny 11/2/05: Transferred from J.Kolleeny to S.Kraszewski. Reviewed Subsurface Investigation

EXXON S/S (Continued) **S104495237**

Report from ECS for work performed in April and May 2005. 4 MWs were installed in addition to 3 other MWs installed in 2000 by ATC Associates for a subsurface investigation. Soil samples were taken from each of the four borings before they were converted to MWs. PID readings from MW-4 and MW-5 ranged from 496ppm to 2807ppm. Multiple VOCs were detected from the soil sample analyses: MW-4 ranged from 1.6% to 56% concentrations of BTEX and other VOCs. GW samples exhibited elevated levels of VOCs also. ECS will continue quarterly monitoring and reporting. Received and reviewed Site Status Update Report July - Sept 2005 with most recent GW sample analysis on 9/19/05. Presence of VOCs remain in all wells but most concentrations have dropped dramatically. Elevated levels of MTBE, ethylbenzene and benzene remain in several wells suggesting that plume may be still migrating in proximity to residential and educational units. May require several more wells to ensure complete delineation of plume. - SK 12/21/05: DEC sent letter sent to A.Pinmental at Cumberland Farms and W.Simmons at ECS requesting further investigation. Asked for 3 MWs to delineate contamination plume. Investigation report should be submitted with recommendations for remedial action. - SK 03/31/06: Reviewed Oct.2005-Dec.2005 Quarterly Update Report from ECS. 7 MWs were gauged and samples collected for analysis. 5 of the 7 MWs exhibited BTEX and or MTBE in concentrations exceeding TAGM AWQS. GW flow direction is generally north to northeast. Overall, most concentrations have remained consistently elevated for almost all contaminated wells. One noticeable change was the concentration of benzene in MW-6: an increase from 5.3 ppb to 103 ppb since the last quarterly report from September. Also, MW-1 now exhibits benzene whereas in all previous samplings since June 2003 none was ever detected. Based on the data, the dissolved plume seems to be extending East towards 108th Street and North towards Flatlands Avenue. ECS mentions that the Departments request for additional MWs will be implemented in April 2006. ECs recommends continued quarterly gauging, sampling and reporting. - SK 05/16/06: Reviewed Site Status Update Report from ECS prepared on April 30, 2006. Included in this investigation, ECS performed GW flow direction gauging and GW sampling from seven MWs. GW flow direction seems to be heading N - NE towards Flat-lands Avenue. BTEX and MTBE concentrations remain mostly consistent with the past several sampling events. MW-7, which has no previous exceedances now shows MTBE at 11 ppb. MW-7 seemed isolated from the GW plume but more sampling is necessary. ECS recommends continued quarterly gauging, sampling and reporting. - SK 05/25/06: ECS installed 3 on-site wells on 5/11/06 and collected soil data. ECS will sample all GW wells in early June. - SK 08/22/06: Reviewed the On-Site Subsurface Investigation Report submitted on July 10, 2006 by ECS. By request of the department, ECS installed three new MWs, MW-8,9,10 on-site to further delineate the dissolved contamination plume. Boring samples revealed PID hits as high as 623ppm from 10-17 fbg for MW-8. MW-9 and MW-10 had no PID hits. Soil samples from MW-8 show highly elevated VOC levels at the GW. MW-9 showed trace VOC contamination in the soil. MW-10 exhibited only xylene as high as 3ppm in the soil. GW ranges from 9 to 10 fbg on-site. No free product detected from any wells. All MWs including newly installed wells were sampled for GW contamination. MWs 4,5,6,8,9 and 10 all detected elevated BTEX, MTBE or both in GW samples. Based on the historic monitoring data, the dissolved plume seems to be migrating with the GW flow direction. The highest readings are located from the corner of East 108th Street along the sidewalk bordering Flatlands Avenue.

EXXON S/S (Continued) **S104495237**

ECS recommends continued quarterly GW monitoring and reporting from all wells except MW-1,2,3 and 7 due to the continued absence of minor concentration os VOCs. SK discussed the work plan with JK. DEC requests that ECS provide alternatives to the monitoring recommendation, i.e. more active remedial approach. SK sent letter disapproving monitoring and requesting a new remedial proposal. ECS may discontinue quarterly sampling from MW-3 and MW-7. The proposal is due before the next quarterly report. - SK 02/05/2007: This spill is transferred from SK to A. Doronova. - AD. JK sent e-mail to Bill Simmons of ECS regarding current situation on the site. 02/06/07: Received e-mail from B. Simmons saying that they have continued quarterly sampling and monitoring the site, that now they are in a process of preparation of remedial strategy proposal and that there is meeting scheduled with CFI. Sent e-mail to B. Simmons with request to submit all outstanding quarterly reports ASAP and remedial strategy proposal later this month. 02/14/2007: Received Site status update report (09/06-12/06) from ECS. They gauged ten MW and sampled eight MW on September and December 2006. MWs 1, 2, 5, 6 and 9 detected elevated BTEX, MBTE or both in GW samples. Maximum increase of total BTEX from 13,800ug/L to 14,853ug/L was detected in GW sample from MW-8; also there was increase of total BTEX from 276.4ug/L to 916.4ug/L in samples from MW-10. ECS will submit feasibility proposal of more active remedial measures by the end of February 2007. AD 03/01/2007: Spoke to B. Simmons regarding remedial feasibility proposal for this site. He told me that proposal is not ready yet and will be submitted in the end of March. AD 05/10/2007: Received an email from B. Simmons.They still work on Remedial Feasibility Report (RFR). Bill wrote that they will probably need air sparge and soil vapor extraction system to address soil and groundwater contamination at the site. They would like to postpone submittal of RFR till June 2007. AD 05/11/2007: Spoke with B. Simmons regarding RAP submission, he said it will be ready in the beginning of June. AD 06/29/2007: Received RAP from ECS. Soil and groundwater analytical data indicate that elevated VOC concentrations still present in northern and north-western portion of the site. RAP proposes in-situ chemical oxidation in the vicinity of monitoring wells MW-2, MW-4 and MW-8, combined with monitored natural attenuation as a remedial approach at the site. AD 07/16/2007: Sent a letter to Chris Johnson of CFI approving RAP with the request to extend ISCO treatment area in order to include wells MW-5 and MW-10 in the remedial program. AD 08/28/2007: Visited the site to observe application of chemical oxidant (sodium persulfate)via injection wells. Michelle Spilter (chemist of ESC) was at the site with two technicians. Depth of the injection wells - 20 feet. Depth to GW - 10-12 ft. They were mixing sodium persulfate with water in 100 gallons container and injecting 2 full volumes of container in each injection point. The consultant plans to inject a total of 2,000 gallons of the oxidant at 10 temporary well points. Subsequent injection events may be scheduled pending evaluation of quarterly groundwater monitoring data. AD 04/09/2008: Received an email from B. Simmons of ECS saying: Hi Ainura, Please find attached the electronic pdf version of the Remedial Action GW Evaluation Update Report (June 2007-March 2008) for Cumberland Farms Inc. 108-04 Flatlands Avenue, Brooklyn, NY Spill#9409298 that was mailed to you that you should receive shortly. Thank you. William A. Simmons Senior Project Manager/Associate DL the Remedial Action Groundwater Evaluation Update Report to eDocs. Will review. Later received a hard copy of the report. AD 05/14/2008:

EXXON S/S (Continued) **S104495237**

Reviewed the Remedial Action Groundwater Evaluation Update Report submitted on April 9, 2008 by ECS. During August 27-29, 2007, ECS performed chemical oxidation program via injection. Chelated iron complex (Fe-EDTA) catalyzed Sodium Persulfate (Na2S2O8) was mixed and injected in a total of ten borings. On March 5, 2008, all wells were surveyed. Depth to GW ranges from 10 to 12 fbg on-site. A general GW flow direction towards the west to northwesterly across the site. Groundwater monitoring: On September 13, December 13, 2007 and March 13, 2008, EDC gauged and sampled up to 10 monitoring wells. No free product was detected in any of the wells. Groundwater samples results revealed VOCs ranged from 7,269 ppb in well MW-8 to 14,7 ppb in MW-7. GW analytical data show decreasing trend in VOCs concentrations in wells: MW-1, MW-2, MW-5, MW-6, and MW-10. Increase in VOCs level were noted in wells: MW-4 (from 4.2ppm to 2,908ppm), MW-8 (from 7,120ppb to 7269ppb) and MW-9 (from 73.7ppm to 86.1ppm). The highest GW contamination is located on the north, north-west portion of the property, from the corner of East 108th Street along the sidewalk bordering Flatlands Ave. ECS will continue quarterly GW monitoring for all wells except MW-7 due to the absence of concentration of VOCs. April - September Update Report will be prepared and submitted. No response is needed. AD 10/20/2008: Received a Groundwater Evaluation Update report for April-September 2008, prepared by ECS. DL to eDocs. Will review. AD 12/04/2008: Reviewed the report. Groundwater monitoring: On June and September 2008, EDC gauged and sampled nine monitoring wells. No free product was detected in any of the wells. Groundwater samples results revealed VOCs ranged from 11.9 ppb in well MW-1 to 3,952.3 ppb in MW-4 (June 2008) and from 50.9 ppb in well MW-9 to 9,357 ppb in MW-8 9September 2008). GW analytical data for this monitoring period indicated increasing trend in VOCs concentrations in wells: MW-1(11.9-997.13), MW-4(3,952-4091), MW-5(47.3-166.8), MW-6(255.7-1350), MW-8(7,266-9,357), MW-9(11-50.9)and MW-10(745-1353). Decrease in VOCs level were noted in only one well: MW-2(from 42.16ppm to ND. The highest GW contamination appeares to be located on the north, north-west, southwest and westerly portions of the property. ECS suggests that this increasing trend in VOCs may be due to the migration of the dissolved-phase plume. ECS will continue quarterly GW monitoring for all wells except MW-3 due to the absence of concentration of VOCs. Have to speak with B. Simmons of ECS regarding effectiveness of the performed remediation. And also will request ECS to submit historical total VOCs table for all site's wells. ECS calculates BTEX and other VOCs separatly, which makes it difficult to track changes in total VOC concenrations over time. AD 06/19/2009: Received an e-mail from B. Simmons saying: Hi Ainura, Please find attached the Groundwater Evaluation Update Report for period October 2008 through April 2009 for SP No. 9409298 for the Cumberland Farms Inc. property at 108-04 Flatlands Avenue, Brooklyn, NY. The original is in the mail. Thank you. Bill William A. Simmons II DL the pdf copy to eDocs. Will review. AD 07/23/2009: Reviewed the report. On January 8 and April 8, 2009, EDC sampled eight monitoring wells. No free product was detected in any of the wells. Groundwater sampling results revealed VOCs ranged from ND ppb in wells MW-1 to 4,725,9 ppb in MW-4 (April 2009). GW analytical data for this monitoring period indicate decreasing trend in VOCs concentrations in 6 wells: MW-1, MW-2, MW-5, MW-6, MW-8, and MW-10. Significant increase in VOCs level was noted in well MW-4(from 2,529ppb to 4,725ppb). The highest GW contamination appeares to be located on the north of the property in hte vicinity

EXXON S/S (Continued) **S104495237**

of wells MW-4(4,725ppb) and MW-8(3,027ppb). The rest of the wells exhibited low levels of VOCs. ECS will continue quarterly GW monitoring, which will include field analysis for groundwater geochemical parametrs (DO, temperature, redox potential, specific conductivity and pH levels). No response is needed. AD 02/02/2010: Received an e-mai;l from Mr. Simmons of ECS saying: Hi Ainura, Please find attached the electronic pdf version of the Groundwater Update Report and Remedial Action Plan Addendum for the Cumberland Farms Inc Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY for Spill # 94-09298. The hard copy is in the mail. Thank you. Bill William A. Simmons II DL the report to eDocs. AD 09/13/2010: Received an e-mail from B. Simmons: Hi Ainura, Please find attached the electronic pdf version of the Groundwater Update Report and Remedial Action Plan Status for the period January June 2010 for the Cumberland Farms Inc Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY for Spill # 94-09298. The hard copy is in the mail. Thank you. Bill DL the report to eDocs. AD 09/15/2010: Received a hard copy of the Groundwater Update Report and Remedial Action Plan Addendum for the Cumberland Farms Inc Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY for Spill # 94-09298 for a period of January - June 2010. Will review. AD 10/28/2010: Reviewed the report. On February 9, 2010 ORC sock were installed in wells: MW-4, MW-5, MW-6, MW-8 and MW-10. On February 25, 2010 one monitoring well MW-11 was installed across the Flatlands Avenue in the sidewalk, as was required by DEC. On January 18, 2010 EDC sampled eight monitoring wells, and on May 13, 2010 - nine wells were sampled. No free product was detected in any of the wells. Groundwater sampling results revealed VOCs ranged from ND ppb in wells MW-9 and MW-11, to low levels in wells MW-1 (29ppb), MW-2 (12.5ppb) and MW-6 (122ppb)to significant concentrations of VOCs in wells: MW-4 (5364ppb), MW-5 (1595ppb), MW-8 (9719ppb) and MW-10 (1638ppb). GW analytical data for this monitoring period indicate decreasing trend in VOCs concentrations in 3 wells: MW-1, MW-2 and MW-6. Significant increase in VOCs level was noted in well MW-5(from 696ppb in January to 1595ppb in May). The highest GW contamination appeares to be located on the west part of the property in the vicinity of wells MW-4(5364ppb) and MW-8(9719ppb). Newly installed well MW-11 had ND results for VOCs. ECS will continue quarterly GW monitoring, which will include field analysis for groundwater geochemical parametrs (DO, temperature, redox potential, specific conductivity and pH levels). AD 03/21/2011: Received a hard copy and pdf copy of the Groundwater Evaluation Update and Remedial Action Plan Status Report for a period of July-December 2010. DL e-copy to eDocs. Will review. AD 04/29/2011: Reviewed the report. On August 12 and November 8, 2010 ECS gauged and collected GW samples from 8 wells. No free product was detected in any of the wells. Groundwater sampling results revealed TVOCs ranged from ND ppb in wells MW-2, MW-9 and MW-11, to low levels in wells MW-1 (8ppb), and MW-6 (120ppb)to significant concentrations of VOCs in wells: MW-8 (8,737ppb from 9719ppb in May 2010) and MW-10 (885ppb from 1638ppb in May 2010). GW analytical data for this monitoring period indicate decreasing trend in VOCs concentrations in 3 wells: MW-1, MW-4 and MW-5. Significant increase in VOCs level was noted in well MW-8 (from 3,357ppb in August to 8,737ppb in November 2010). The highest GW contamination appeares to be located in the vicinity of wells MW-10(885ppb) and MW-8(8,737ppb). Newly installed well MW-11 had ND results for VOCs. ECS will continue quarterly GW monitoring, which will include field analysis for groundwater

EXXON S/S (Continued) **S104495237**

geochemical parametrs (DO, temperature, redox potential, specific conductivity and pH levels). AD 08/18/2011: Received a Groundwater Evaluation Update and RAP Status Report for period of January - June of 2011. DL pdf copy to eDocs. Will review. AD 09/29/2011: Reviewed the report. On February 8 and May 12 2011 ECS gauged and collected GW samples from 8 wells. No free product was detected in any of the wells. Groundwater sampling results revealed TVOCs ranged from ND ppb in wells MW-1, MW-2, MW-9 and MW-11, to low levels in wells MW-5 (25.68ppb), and MW-6 (7.78ppb) to significant concentrations of VOCs in wells: MW-8 (6,067ppb and 4,726ppb in February and May 2011) and MW-4 (1,327ppb in May 2011 from 164ppb in February 2011). GW analytical data for this monitoring period indicate decreasing trend in VOCs concentrations in 2 wells: MW-1 and MW-5. Significant decrease in VOCs level was noted in well MW-8 (from 8,737ppb in November 2010 to 4,726ppb in May 2011). The highest GW contamination appeares to be located in the vicinity of wells MW-10(444ppb), MW-8(4,726ppb) and well MW-4 (1,327ppb). Newly installed well MW-11 had ND results for VOCs. ECS will continue quarterly GW monitoring, which will include field analysis for groundwater geochemical parametrs (DO, temperature, redox potential, specific conductivity and pH levels). Next semi-annual report is due. AD 03/23/2012: Received a Groundwater Evaluation Update and RAP Status Report for period of July - December of 2011. No pdf copy was submitted. To request its submission. Will review the report. AD 05/03/2012: Received requested PDF copy of the report. DL the report to eDocs. Reviewed the report. It states that on August 9 and December 1, 2011, ECS gauged all Site-related monitoring wells and collected groundwater samples from up to eight (MW-1, MW-2, MW-4, MW-5, MW-6, MW-8, MW-9, MW-10 and off-site well MW-11) and submitted the samples for analysis of VOCs. Samples collected from wells MW-2, MW-4, MW-5, MW-8 and MW-10 were submitted for analysis of dissolved iron, nitrates and sulfates. No free product was detected in any of the wells. Depth to water on August 9, 2011 as measured from grade ranged from approximately 10.32 fbg in MW-4 to 11.79 fbg in well MW-1. Depth to water on December 1, 2011 as measured from grade ranged from approximately 10.04 fbg in well MW-2 to 11.45 fbg in well MW-1. The December 1, 2011 gauging data was used to calculate the groundwater flow direction that was determined to trend towards well MW-4 due to a slight elevation anomaly in the area of well MW-4 as compared to all other on-site wells. If well MW-4 is removed from the calculations, groundwater flow is towards the west. August 2011 sampling: Groundwater sampling results revealed TVOCs ranged from ND ppb in wells MW-9 and MW-11, to low levels in wells MW-1 (51.6ppb), MW-6 (13.1ppb) to moderate levels in MW-2 (182.9ppb), MW-5 (216ppb) and MW-10 (195ppb) to significant concentrations of TVOCs in wells: MW-8 (5, 775ppb from 4,726ppb in May 2011) and MW-4 (2,611ppb from 1,327ppb in May 2011). December 2011 sampling: Groundwater sampling results revealed TVOCs ranged from ND ppb in 4 wells: MW-1, MW-2, MW-6, and MW-9, to low levels in wells MW-4 (29.75ppb), MW-5 (75.47ppb) to moderate levels in MW-10 (263.2ppb), to significant concentrations of TVOCs in well MW-8 (4,709.5ppb from 5, 775ppb in August 2011). Evaluation of the August and December 2011 groundwater data indicate fluctiation trend in VOCs concentrations in 6 wells: MW-1, MW-2, MW-4, MW-5 and MW-6. Fluctuation in VOCs level was noted also in well MW-8 (from 4,726ppb in May 2011 to 5, 775ppb in August 2011 to 4,709.5ppb in December 2011). The highest GW contamination appeares to be located in the vicinity of well MW-8(4,709ppb). Well

EXXON S/S (Continued) **S104495237**

MW-10 indicated slight increase in VOCs concentrations from 195ppb in August 2011 to 263ppb in December 2011. Overall decreasing VOCs levels historical trend noted at the site. ECS will continue to perform quarterly groundwater monitoring that will consist of depth to groundwater gauging of all Site-related wells, field analysis for groundwater geochemical parameters (i.e. DO, ORP, specific conductivity, temperature, and pH levels) of all wells that are sampled, and the collection of groundwater samples from monitoring wells MW-1, MW-2, MW-4, MW-5, MW-6, MW-8, and MW-10 for VOCs according to USEPA Method 8260 NYSDEC STARS gasoline-related compounds. ORC socks will continue to be utilized in wells MW-4, MW-5, MW-6, MW-8 and MW-10 and changed out as necessary. AD 09/26/2012: Received a Groundwater Evaluation Update and RAP Status Report for period of January - June of 2012. DL pdf copy to eDocs. Will review the report. AD 11/07/2012: Reviewed the report. It states that on February 15 and May 2, 2012, ECS gauged all eleven site-related monitoring wells and collected groundwater samples from eight (MW-1, MW-2, MW-4, MW-5, MW-6, MW-8, and MW-10). Samples collected from wells MW-2, MW-4, MW-5, MW-8 and MW-10 on February 15, 2012 were also submitted for analysis of dissolved iron, nitrates and sulfates. Evaluation of the February and May 2012 groundwater data indicates continued decreasing VOC concentrations to the lowest levels since sampling began, with certain various VOCs in wells MW-2, MW-5, MW-6, MW-8, and MW-10 above NYSDEC TOGS Groundwater Quality Standards (GWQS). February 2012 sampling - TVOCs (ppb) - MTBE (ppb): 1. MW-1 - ND - 2; 2. MW-2 - ND - 9; 3. MW-4 - 7 - ND; 4. MW-5 - 143 - 21; 5. MW-6 - 3.3 - 8.7; 6. MW-8 - 4,186 - 2.6; 7. MW-10 - 25 - 14. Groundwater sampling results revealed TVOCs ranged from ND ppb in wells MW-1 and MW-2, to low levels in wells MW-4 (7ppb), MW-6 (3.3ppb) and MW-10 (25ppb) to moderate levels in MW-5 (143ppb) to significant concentrations of TVOCs in well MW-8 (4,186ppb) May 2012 sampling - TVOCs (ppb) - MTBE (ppb): 1. MW-1 - ND - 7; 2. MW-2 - ND - 14; 3. MW-4 - ND - ND; 4. MW-5 - 10.6 - 8.5; 5. MW-6 - 2.3 - 15.4; 6. MW-8 - 1,546 - 3; 7. MW-10 - 97 - 60. May groundwater sampling results revealed TVOCs ranged from ND ppb in 3 wells: MW-1, MW-2 and MW-4, to low levels in wells MW-5 (10.6ppb), MW-6 (2.3ppb) to moderate levels in MW-10 (97ppb), to significant concentrations of TVOCs in well MW-8 (1,546ppb which is a decrease from 4,709.5ppb in February 2012). Depth to water on February 15, 2012 as measured from grade ranged from approximately 10.8 fbg in MW-4 to 12.11 fbg in well MW-1. Depth to water on May 2, 2012 as measured from grade ranged from approximately 10.43 fbg in well MW-2 to 11.93 fbg in well MW-1. The May 2, 2012 gauging data was used to calculate the groundwater flow direction that was determined to trend towards the west. ECS will continue to perform quarterly groundwater monitoring that will consist of depth to groundwater gauging of all Site-related wells, field analysis for groundwater geochemical parameters (i.e. DO, ORP, specific conductivity, temperature, and pH levels) of all wells that are sampled, and the collection of groundwater samples from monitoring wells MW-1, MW-2, MW-4, MW-5, MW-6, MW-8, and MW-10 for VOCs according to USEPA Method 8260 NYSDEC STARS gasoline-related compounds. AD 03/27/2013: Received the following e-mail from B. Simmons: Hi Ainura, Please find attached the electronic pdf version of the Site Status Update and Remedial Action Plan Status Report for SPILL # 94-09298 for period July-December 2012 for the Cumberland Farms. Inc (CFI) Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY. A hard copy and a CD are also being mailed to you.

EXXON S/S (Continued) **S104495237**

Thank you. Bill William Simmons Senior Project Manager/Associate DL the report to eDocs. Will review. AD 04/18/2013: Reviewed the report. It states that ECS visited the site on August 6 and November 28, 2012. Depth to water on August 6, 2012 as measured from grade ranged from approximately 10.34 fbg in RW-2 to 11.26 fbg in well MW-6. Depth to water on November 28, 2012 as measured from grade ranged from approximately 10.43 fbg in well RW-2 to 11.15 fbg in well MW-6. The November 28, 2012 gauging data was used to calculate the groundwater flow direction. The contours indicated a very flat gradient with several flow pattern variations. The August and November 2012 data indicated no VOC concentrations above TOGS GWQS in wells MW-1, MW-4, and MW-6, and only MtBE just above the TOGS GWQS in well MW-2. The highest VOC concentrations continue to be present in well MW-8 but comparison of this current data to the historical high concentrations correlates to an approximate 92-94% decrease in total BTEX concentrations, and an 80-81% decrease in total other VOC concentrations. GW - August - November 2012 sampling - TVOCs (ppb): 1. MW-1 - ND - ND; 2. MW-2 - ND - ND; 3. MW-4 - ND - ND; 4. MW-5 - 40 - 135; 5. MW-6 - ND - ND; 6. MW-8 - 3,379 - 2,848; 7. MW-10 - 40 - 184. ECS will continue to perform quarterly gauging of Site-related wells, and collect groundwater samples from wells MW-2, MW-4, MW-5, MW-8, and MW-10 for VOCs. If evaluation of the next two rounds of groundwater samples collected from on-site wells MW-2 and MW-4 continue to indicate similar VOC concentrations below the TOGS GWQS and/or the absence of VOC concentrations, ECS will propose either eliminating these wells from the quarterly monitoring program or reducing sampling of these wells to semi-annually. ORC socks will continue to be utilized in wells MW-4, MW-5, MW-6, MW-8 and MW-10 and changed out as necessary. AD 09/06/2013: Received the Site Status Update and Remedial Action Plan Status Report for SPILL # 94-09298 for period January - June 2013. DL the report to eDocs. Will review. AD 10/07/2013: Reviewed the report. It states that on February 14 and May 15, 2013, ECS gauged eleven site-related monitoring wells and collected groundwater samples from five (5) wells: MW-2, MW-4, MW-5, MW-8, and MW-10. Evaluation of the February and May 2013 groundwater data indicates continued decreasing VOC concentrations to the lowest levels since sampling began, with certain various VOCs in wells MW-2, MW-5, MW-8, and MW-10 above NYSDEC Technical and Operational Guidance Series (TOGS) Groundwater Quality Standards (GWQS). GW - February - May 2013 sampling - TVOCs (ppb): 1. MW-2 - ND - ND; 2. MW-4 - ND - ND; 4. MW-5 - 64.34 - 127; 5. MW-6 - NS - NS; 6. MW-8 - 954 - 1,252; 7. MW-10 - 332 - 304. Evaluation of groundwater data collected since 2003 indicates the MNA program has been demonstrating biodegradation of petroleum constituents as evidenced by the lowest overall total BTEX and other various VOC concentrations in Site-related wells since monitoring began in June 2003. The current 2013 data indicated only a concentration of MtBE in well MW-2 during the February 2013 sampling event just above the TOGS GWQS, and the continued absence of VOCs above TOGS GWQS in samples collected from well MW-4 for the sixth (6) consecutive sampling event (Table 1). The highest VOC concentrations continue to be present in well MW-8 but are at the lowest concentrations since sampling began in June 2006, and comparison of this current data to the historical high concentrations correlates to an approximate 98% decrease in total BTEX concentrations, and an approximate 83% decrease in total other VOC concentrations. Based on the MNA program that had been demonstrating biodegradation of petroleum constituents, ECS concluded that the continued collection

EXXON S/S (Continued) **S104495237**

of groundwater samples for nitrate, iron, and sulfate analysis was determined to not be critical for future evaluation of the effectiveness of the MNA program and these analyses would no longer be performed. As discussed in previous submittals, the addition of the ORC socks have allowed sustained increased dissolved oxygen concentrations within the aquifer in the vicinity of these wells to allow for aerobic respiration of residual petroleum hydrocarbons present in groundwater. ORC socks were left in well MW-6 even though this well is no longer sampled. ORC socks will continue to be utilized in wells MW-4, MW-5, MW-8 and MW-10, and periodically replaced. based on the continued absence of VOCs in groundwater samples collected from on-site wells MW-2 and MW-4 ECS propose eliminating these wells from the quarterly monitoring program. ECS will continue to to perform quarterly gauging of the site related wells and will sample MW-5, MW-8 and MW-10 for TVOCs. ORC socks will be left in MW-2 and MW-4, even these wells are proposed to no longer be sampled. ORC socks will continue to be utilized in wells MW-5, MW-8 and MW-10 and peridically replaced. AD 04/17/2014: Received the Site Status Update and Remedial Action Plan Status Report for SPILL # 94-09298 for period January - June 2013. DL the report to eDocs. Will review. AD 05/16/2013: Reviewed the report. It states that on August 12, 2013 ECS gauged the eleven (11) Site-related monitoring wells and collected groundwater samples from five (5) (MW-2, MW-4, MW-5, MW-8, and MW-10). On November 1, 2013 ECS gauged the eleven (11) Site-related monitoring wells and collected groundwater samples from three (3) (MW-5, MW-8, and MW-10). Depth to water on August 12, 2013 as measured from approximate surface grade ranged from approximately 9.27 fbg in MW-4 to 11.26 fbg in well MW-1. Depth to water on November 1, 2013 as measured from approximate surface grade ranged from approximately 10.26 fbg in well MW-2 to 11.74 fbg in well MW-1. The November 1, 2013 gauging data was used to update the groundwater flow direction. The contours indicated a very flat gradient with several flow pattern variations similar to historic trends due to slight elevation anomalies in certain on-site wells (MW-4 and MW-5). GW - August - November 2013 sampling - TVOCs (ppb): 1. MW-2 - ND - ND; 2. MW-4 - ND - ND; 4. MW-5 - 41 - 32 5. MW-6 - NS - NS 6. MW-8 - 639 - 869 7. MW-10 - 42 - 45 Evaluation of the August and November 2013 groundwater data indicate certain various VOCs in wells MW-2, MW-5, MW-8, and MW-10 above NYSDEC TOGS GWQS. Most contaminated well MW-08 indicated fluctiating trend in VOC concentrations. Conclusions and recommendations: According to ECS, evaluation of the current 2013 groundwater data indicates the lowest overall total BTEX and other various VOC concentrations in Site-related wells since monitoring began in June 2003. ECS proposes transitioning the quarterly sampling program to semi-annual to include the gauging of all site-related wells and the sampling of wells MW-5, MW-8, and MW-10 for analysis of VOCs according to USEPA Method 8260 NYSDEC STARS gasoline-related compounds. Field analysis for groundwater geochemical parameters (i.e. DO, ORP, specific conductivity, temperature, and pH levels) will also be measured in the wells that are sampled. ORC socks will be left in wells MW-4 and MW-6 even though these wells are no longer sampled. ORC socks will continue to be utilized in wells MW-5, MW-8 and MW-10, and periodically replaced. The data will be evaluated in the subsequent Semi-Annual Site Status Update and RAP Status Reports. AD 03/06/2015: Received the following e-mail from B. Simmons: Hi Ainura, Please find attached the electronic pdf version of the Site Status Update and Remedial Action Plan Status Report for Spill#

EXXON S/S (Continued) **S104495237**

94-09298 for period July-December 2014 for the Cumberland Farms. Inc (CFI) Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY. Based on the small size of this document, we will not mail you a CD unless you require one. If so, please just let us know. Thank you. Bill William Simmons Senior Project Manager/Associate Environmental Compliance Services, Inc. 296 Nonotuck Street Florence, MA 01060 Tel: 413-789-3530 Ext. 339 Fax: 413-789-2776 Cell: 413-519-0769 wsimmons@ecsconsult.com www.ecsconsult.com Will review. AD 04/08/2015: Reviewed the report. It states that historical depth to groundwater ranges from approximately 10 to 11.5 feet below grade (fbg). Groundwater flow direction has historically been determined to have fluctuating flow patterns in certain areas of the Site with predominantly westerly patterns which is evidenced by evaluation of historical groundwater dissolved-phase contaminant migration patterns. On November 13, 2014, ECS gauged the ten (10) on-site wells and collected groundwater samples from three wells (MW-5, MW-8, and MW-10). Evaluation of the 2014 groundwater data indicates continued decreasing VOCs to the lowest levels in wells MW-5, MW-8 and MW-10 since sampling began, with certain various VOCs in all three wells above NYSDEC TOGS Groundwater Quality Standards (GWQS). GW data: May - November 2014 sampling - TVOCs (ppb): 1. MW-2 - NS - NS; 2. MW-4 - NS - NS; 4. MW-5 - ND - 5 5. MW-6 - NS - NS 6. MW-8 - 573 - 707 7. MW-10 - 137 - 31 Evaluation of the current November 2014 groundwater data indicates the lowest overall total BTEX and other various VOC concentrations in on-site wells MW-5, MW-8 and MW-10. ECS proposes continued semi-annual gauging of site-related wells and the sampling of wells MW-5, MW-8, and MW-10 for analysis of VOCs according to USEPA Method 8260 NYSDEC STARS gasoline-related compounds. Field analysis for groundwater geochemical parameters (i.e. DO, ORP, specific conductivity, temperature, and pH levels) will also be measured in the wells that are sampled. ORC socks will be left in wells MW-4 and MW-6 even though these wells are no longer sampled. ORC socks will continue to be utilized in wells MW-5, MW-8 and MW-10, and periodically replaced. The data will be evaluated in the subsequent Semi-Annual Site Status Update and RAP Status Reports. AD 07/13/2015: Received the following e-mail from Bill Simmons: Hi Ainura, Please find attached the electronic pdf version of the Site Status Update Report & Spill No. 94-09298 Closure Request for period January-June 2015 for the Cumberland Farms. Inc (CFI) Facility # 70226 located at 108-04 Flatlands Avenue, Brooklyn, NY. We will be mailing you a CD & a hard copy. Please let me know if you have any questions. Thank you. Bill William Simmons Senior Project Manager/Associate Environmental Compliance Services, Inc. 296 Nonotuck Street Florence, MA 01060 Tel: 413-789-3530 Ext. 339 Fax: 413-789-2776 Cell: 413-519-0769 wsimmons@ecsconsult.com www.ecsconsult.com Will review. AD 07/14/2015: Reviewed the report. It documents a summary of historical response actions performed at the site during 2000-2015 as well as the most recent groundwater sampling results collected on May 22, 2015. GW sampling: On May 22, 2015, ECS gauged the ten (10) on-site monitoring wells (except well MW-3 that was covered by a vehicle) and collected groundwater samples from three (3) (MW-5, MW-8, and MW-10). Samples were submitted to Test America of Nashville, Tennessee, for analysis of VOCs by USEPA Method 8260 NYSDEC STARS List for gasoline-related compounds. Evaluation of the May 2015 groundwater data indicates continued decreasing VOC concentrations to the lowest levels in wells MW-5, MW-8 and MW-10 since sampling began, with certain various VOCs in

EXXON S/S (Continued) **S104495237**

wells MW-8 and MW-10 above NYSDEC TOGS GWQS. GW data: May - 2015 sampling - TVOCs (ppb): 1. MW-2 - NS; 2. MW-4 - NS; 4. MW-5 - ND; 5. MW-6 - NS 6. MW-8 - 408; 7. MW-10 - ND. Based on the historical data evaluation, including the May 2015 groundwater data, it indicate continued decreasing VOC concentrations to the lowest levels in wells MW-5, MW-8 and MW-10 since sampling began, with certain various VOCs in wells MW-8 and MW-10 remaining above the TOGS GWQS. Based on the data presented in this report, ECS does not recommend any additional monitoring and/or remedial actions. ECS respectfully requests closure of Spill No. 94-09298. Will discuss the closure request with J. Kolleeny of DEC. AD 07/21/2015: Discussed the closure request with J. Kolleeny of DEC. Taking into consideration the actions performed at the site, such as: 1. Several site investigation with delineation of contamination plume; 2. In-situ chemical oxidation in 2007; 3. Installation of ORC sock into most contaminated wells in 2010; 4. Quarterly groundwater monitoring and reporting, and most recent data provided which concludes that: 1. There is no off-site migration of contamination; 2. Approximate 98% decrease in total VOCs in groundwater comparing to historical data; 3. Absence of free product, it was decided to approve the spill closure request. Case closed. AD"

Remarks: "REMOVED U/G TANK FOUND CONTAMINATED SOIL POSSIBLE DUE TO OVERFILLS OVER TIME-SAMPLES SENT IN-WILL CONTINUE CLEANUP."

All Materials:

Site ID:	134226
Operable Unit ID:	1003254
Operable Unit:	01
Material ID:	378718
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Site ID:	134226
Operable Unit ID:	1003254
Operable Unit:	01
Material ID:	378719
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

O81 **CUMBERLAND FARMS#70226** **RCRA-SQG** **1000335599**
SW **108-04 FLATLANDS AVENUE** **US AIRS** **NYD986894160**
1/8-1/4 **BROOKLYN, NY 11236** **FINDS**
0.207 mi. **ECHO**
1093 ft. **Site 3 of 3 in cluster O** **NY MANIFEST**

Relative:
Lower

Actual:
10 ft.

RCRA-SQG:

Date form received by agency:	07/11/2017
Facility name:	BP PRODUCTS NORTH AMERICA INC - BP 66349
Facility address:	10804 FLATLANDS AVE BROOKLYN, NY 11236
EPA ID:	NYD986894160
Mailing address:	PO BOX 80249 RANCHO SANTA MARGARITA, CA 92688
Contact:	JOHN MAHONEY
Contact address:	PO BOX 6038 ARTESIA, CA 90702
Contact country:	US
Contact telephone:	973-392-6150
Contact email:	JOHN.MAHONEY@BP.COM
EPA Region:	02
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	BP PRODUCTS NORTH AMERICA INC
Owner/operator address:	Not reported Not reported
Owner/operator country:	Not reported
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	06/19/2017
Owner/Op end date:	Not reported
Owner/operator name:	TOSCO
Owner/operator address:	PO BOX 52085 PHOENIX, AZ 85072
Owner/operator country:	US
Owner/operator telephone:	602-728-8000
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	01/01/2001
Owner/Op end date:	Not reported
Owner/operator name:	NO NAME FOUND
Owner/operator address:	Not reported Not reported
Owner/operator country:	Not reported

CUMBERLAND FARMS#70226 (Continued) **1000335599**

Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 09/10/2003
Owner/Op end date: Not reported

Owner/operator name: NO NAME FOUND
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 09/10/2003
Owner/Op end date: Not reported

Owner/operator name: BP PRODUCTS NORTH AMERICA INC
Owner/operator address: PO BOX 6038
ARTESIA, CA 90702
Owner/operator country: US
Owner/operator telephone: 360-526-3917
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 06/19/2017
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D018
. Waste name: BENZENE

Historical Generators:

CUMBERLAND FARMS#70226 (Continued) **1000335599**

Date form received by agency: 01/01/2007
Site name: EXXON DIV OF CFI #70226
Classification: Not a generator, verified

Date form received by agency: 01/01/2006
Site name: EXXON DIV OF CFI #70226
Classification: Not a generator, verified

Date form received by agency: 10/01/2004
Site name: EXXON DIV OF CFI #70226
Classification: Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D018
. Waste name: BENZENE

Date form received by agency: 08/08/2001
Site name: TOSCO #34770
Classification: Conditionally Exempt Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: D018
. Waste name: BENZENE

Date form received by agency: 07/08/1999
Site name: TOSCO #34770
Classification: Not a generator, verified

Date form received by agency: 02/20/1998
Site name: EXXON #37370
Classification: Large Quantity Generator

Date form received by agency: 04/04/1990
Site name: TOSCO #34770
Classification: Large Quantity Generator

Violation Status: No violations found

US AIRS MINOR:
Envid: 1000335599
Region Code: 02
Programmatic ID: AIR NY0000002610500013
Facility Registry ID: 110000892277
D and B Number: Not reported
Primary SIC Code: 5541
NAICS Code: 999999
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:
Region Code: 02
Programmatic ID: AIR NY0000002610500013

CUMBERLAND FARMS#70226 (Continued) **1000335599**

Facility Registry ID: 110000892277
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-04-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:

Registry ID: 110064187071

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Registry ID: 110000892277

Environmental Interest/Information System
AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000335599
Registry ID: 110000892277
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110000892277

Envid: 1000335599
Registry ID: 110064187071
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110064187071

CUMBERLAND FARMS#70226 (Continued) **1000335599**

NY MANIFEST:

Country:	USA
EPA ID:	NYD986894160
Facility Status:	Not reported
Location Address 1:	108-04 FLATLANDS AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	13775
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD986894160
Mailing Name:	EXXON COMPANY USA
Mailing Contact:	CHRISTINE COLUCCIO
Mailing Address 1:	P O BOX 4415
Mailing Address 2:	Not reported
Mailing City:	HOUSTON
Mailing State:	TX
Mailing Zip:	77210
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	5168641772

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2017
Trans1 State ID:	NJR000023036
Trans2 State ID:	Not reported
Generator Ship Date:	08/01/2017
Trans1 Recv Date:	08/01/2017
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/03/2017
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986894160
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported
Manifest Tracking Number:	012238357JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported

CUMBERLAND FARMS#70226 (Continued) **1000335599**

Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	200
Units:	P - Pounds
Number of Containers:	1
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1
Waste Code:	D018
Waste Code 1_2:	D001
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
10 additional NY_MANIFEST: record(s) in the EDR Site Report.

N82 **CON EDISON** **RCRA NonGen / NLR** **1019325480**
WNW **992 WILLIAMS AVE** **NYP004830242**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 2 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	02/05/2016
Facility name:	CON EDISON
Site name:	CON EDISON - SERVICE BOX 58230
Facility address:	992 WILLIAMS AVE BROOKLYN, NY 11236
EPA ID:	NYP004830242
Mailing address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact:	THERESA BURKARD
Contact address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact country:	US
Contact telephone:	212-460-2262
Contact email:	BURKARDT@CONED.COM
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private

CON EDISON (Continued) **1019325480**

Owner/Operator Type: Owner
Owner/Op start date: 08/26/2015
Owner/Op end date: Not reported

Owner/operator name: CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address: IRVING PLACE
NEW YORK, NY 10003
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 08/26/2015
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D008
. Waste name: LEAD

Historical Generators:
Date form received by agency: 08/26/2015
Site name: CON EDISON
Classification: Not a generator, verified

Date form received by agency: 08/26/2015
Site name: CON EDISON
Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:
Waste code: D008
Waste name: LEAD
Amount (Lbs): 4000

Violation Status: No violations found

N83 **CON EDISON** **NJ MANIFEST** **S120675948**
WNW **992 WILLIAMS AVE SB58229** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 3 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYP004830226
Mail Address:	IRVING PL 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THOMAS TEELING
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	014470703JJK
EPA ID:	NYP004830226
Date Shipped:	8/26/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported

CON EDISON (Continued) **S120675948**

Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

N84 **CON EDISON** **NJ MANIFEST** **S120675950**
WNW **992 WILLIAMS AVE** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 4 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYP004830242
Mail Address:	IRVING PLACE, 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THERESA BURKARD
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	014470704JJK
EPA ID:	NYP004830242
Date Shipped:	8/26/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported

CON EDISON (Continued) **S120675950**

TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

N85 **CON ED** **NY MANIFEST** **S119077423**
WNW **992 WILLIAMS AVE SB58230** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 5 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004830242
Facility Status:	Not reported
Location Address 1:	992 WILLIAMS AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11236
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004830242
Mailing Name:	CON ED
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	08/26/2015

CON ED (Continued) **S119077423**

Trans1 Recv Date:	08/26/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/26/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004830242
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014470704JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	4000
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

N86 **CON EDISON** **RCRA NonGen / NLR** **1019325479**
WNW **992 WILLIAMS AVE** **NYP004830226**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 6 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	02/05/2016
Facility name:	CON EDISON
Site name:	CON EDISON - SERVICE BOX 58229
Facility address:	992 WILLIAMS AVE BROOKLYN, NY 11236
EPA ID:	NYP004830226

CON EDISON (Continued) **1019325479**

Mailing address:	IRVING PLACE, 15TH FL NE
	NEW YORK, NY 10003
Contact:	THERESA BURKARD
Contact address:	IRVING PLACE, 15TH FL NE
	NEW YORK, NY 10003
Contact country:	US
Contact telephone:	212-460-2262
Contact email:	BURKARDT@CONED.COM
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE
	NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	08/26/2015
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE
	NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	08/26/2015
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

CON EDISON (Continued) **1019325479**

. Waste code: D008
. Waste name: LEAD

Historical Generators:
Date form received by agency: 08/26/2015
Site name: CON EDISON
Classification: Not a generator, verified

Date form received by agency: 08/26/2015
Site name: CON EDISON
Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:
Waste code: D008
Waste name: LEAD
Amount (Lbs): 4000

Violation Status: No violations found

N87 **CON ED** **NY MANIFEST** **S119077421**
WNW **992 WILLIAMS AVE SB58229** **N/A**
1/8-1/4 **BROOKLYN, NY 11236**
0.209 mi.
1105 ft. **Site 7 of 7 in cluster N**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:
Country: USA
EPA ID: NYP004830226
Facility Status: Not reported
Location Address 1: 992 WILLIAMS AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11236
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYP004830226
Mailing Name: CON ED
Mailing Contact: TOM TEELING
Mailing Address 1: 4 IRVING PLACE - 15TH FLOOR
Mailing Address 2: Not reported
Mailing City: NEW YORK
Mailing State: NY
Mailing Zip: 10003
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 2124603770

NY MANIFEST:
Document ID: Not reported
Manifest Status: Not reported

CON ED (Continued) **S119077421**

seq:	Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	08/26/2015
Trans1 Recv Date:	08/26/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/26/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004830226
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014470703JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	4000
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

P88 **NYCHA - BREUKELEN** **RCRA NonGen / NLR** **1001224058**
WSW **715 E 108TH ST** **FINDS** **NYR000052746**
1/8-1/4 **BROOKLYN, NY 11236** **ECHO**
0.217 mi. **NY MANIFEST**
1148 ft. **Site 1 of 2 in cluster P**

Relative:
Lower

Actual:
11 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	NYCHA - BREUKELEN
Facility address:	715 E 108TH ST BROOKLYN, NY 11236
EPA ID:	NYR000052746
Mailing address:	BROADWAY NEW YORK, NY 10007
Contact:	FRANK OCELLO
Contact address:	BROADWAY NEW YORK, NY 10007
Contact country:	US
Contact telephone:	212-306-3229
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	NYCHA
Owner/operator address:	250 BROADWAY 16TH FLOOR NEW YORK, NY 10007
Owner/operator country:	US
Owner/operator telephone:	212-306-3229
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	NYCHA
Owner/operator address:	250 BROADWAY 16TH FLOOR NEW YORK, NY 10007
Owner/operator country:	US
Owner/operator telephone:	212-306-3229
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No

NYCHA - BREUKELEN (Continued) **1001224058**

On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: NYCHA - BREUKELEN
Classification: Not a generator, verified

Date form received by agency: 03/30/1998
Site name: NYCHA - BREUKELEN
Classification: Small Quantity Generator

. Waste code: U240
. Waste name: 2,4-D, SALTS & ESTERS (OR) ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS (OR) DICHLOROPHENOXYACETIC ACID 2,4-D

Violation Status: No violations found

FINDS:

Registry ID: 110004541700

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1001224058
Registry ID: 110004541700
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004541700

NY MANIFEST:
Country: USA
EPA ID: NYR000052746
Facility Status: Not reported
Location Address 1: 715 E 108 ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY

NYCHA - BREUKELEN (Continued) **1001224058**

Location Zip:	Not reported
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYR000052746
Mailing Name:	NYCHA BREUKELEN
Mailing Contact:	RAY VALEZ
Mailing Address 1:	250 BROADWAY
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10007
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2123063142

NY MANIFEST:

Document ID:	NJA2787812
Manifest Status:	Not reported
seq:	01
Year:	1998
Trans1 State ID:	NJDEPES58
Trans2 State ID:	Not reported
Generator Ship Date:	04/23/1998
Trans1 Recv Date:	04/23/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/24/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000052746
Trans1 EPA ID:	NJ0000027193
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	U240 - 2,4 D,SALTS + ESTERS
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00080
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.

NYCHA - BREUKELEN (Continued) **1001224058**

Specific Gravity: 01.00

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

Q89 **RING CLEANERS** **RCRA-CESQG** **1000231711**
North **941A PENNSYLVANIA AVE** **ICIS** **NYD982275380**
1/8-1/4 **BROOKLYN, NY 11207** **US AIRS**
0.221 mi. **NY MANIFEST**
1168 ft. **Site 1 of 3 in cluster Q**

Relative:
Lower

Actual:
9 ft.

RCRA-CESQG:

Date form received by agency:	01/01/2007
Facility name:	RING CLEANERS
Facility address:	941A PENNSYLVANIA AVE BROOKLYN, NY 11207
EPA ID:	NYD982275380
Mailing address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact:	Not reported
Contact address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	BYUNG YANG LEE
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

RING CLEANERS (Continued) **1000231711**

Owner/operator name: BYUNG YANG LEE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, WY 99999
Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: RING CLEANERS
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 10/29/1993
Site name: RING CLEANERS
Classification: Small Quantity Generator

Date form received by agency: 09/25/1987
Site name: RING CLEANERS
Classification: Small Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: D001
. Waste name: IGNITABLE WASTE

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE

RING CLEANERS (Continued) **1000231711**

ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

ICIS:

Enforcement Action ID:	NY000A0000261050048800316
FRS ID:	110004418504
Action Name:	MIN'S SISTER CLEANERS 36047R128600316
Facility Name:	MIN'S SISTER CLEANERS
Facility Address:	941A PENNSYLVANIA AVE BROOKLYN, NY 112078416
Enforcement Action Type:	Notice of Violation
Facility County:	KINGS
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	7216
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	40.655356
Longitude in Decimal Degrees:	-73.888089
Permit Type Desc:	Not reported
Program System Acronym:	NY0000002610500488
Facility NAICS Code:	812320
Tribal Land Code:	Not reported

Enforcement Action ID:	NY000A0000261050048800315
FRS ID:	110004418504
Action Name:	MIN'S SISTER CLEANERS 36047R128600315
Facility Name:	MIN'S SISTER CLEANERS
Facility Address:	941A PENNSYLVANIA AVE BROOKLYN, NY 112078416
Enforcement Action Type:	Notice of Violation
Facility County:	KINGS
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	7216
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	40.655356
Longitude in Decimal Degrees:	-73.888089
Permit Type Desc:	Not reported
Program System Acronym:	NY0000002610500488
Facility NAICS Code:	812320
Tribal Land Code:	Not reported

US AIRS MINOR:

Envid:	1000231711
Region Code:	02
Programmatic ID:	AIR NY0000002610500488
Facility Registry ID:	110004418504
D and B Number:	Not reported
Primary SIC Code:	7216
NAICS Code:	812320
Default Air Classification Code:	MIN

RING CLEANERS (Continued) **1000231711**

Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:
Region Code: 02
Programmatic ID: AIR NY0000002610500488
Facility Registry ID: 110004418504
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2000-10-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500488
Facility Registry ID: 110004418504
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2001-12-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500488
Facility Registry ID: 110004418504
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2006-06-27 00:00:00
Activity Status Date: 2006-06-27 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000002610500488
Facility Registry ID: 110004418504
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2000-10-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500488
Facility Registry ID: 110004418504
Air Operating Status Code: OPR
Default Air Classification Code: MIN

RING CLEANERS (Continued) **1000231711**

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2001-12-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

NY MANIFEST:
Country: USA
EPA ID: NYD982275380
Facility Status: Not reported
Location Address 1: 941A PENNSYLVANIA AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD982275380
Mailing Name: RING CLNRS
Mailing Contact: RING CLNRS
Mailing Address 1: 941A PENNSYLVANIA AVENUE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11207
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7186490077

NY MANIFEST:
Document ID: NYC7627307
Manifest Status: Not reported
seq: Not reported
Year: 2005
Trans1 State ID: TXR000050930
Trans2 State ID: NJD071629976
Generator Ship Date: 07/20/2005
Trans1 Recv Date: 07/20/2005
Trans2 Recv Date: 07/22/2005
TSD Site Recv Date: 07/25/2005
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD982275380
Trans1 EPA ID: NY71148JR
Trans2 EPA ID: NJT18L8D
TSDF ID 1: OHD980587364
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported

RING CLEANERS (Continued) **1000231711**

Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00120
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	Not reported
Specific Gravity:	01.00
Waste Code:	Not reported
Quantity:	Not reported
Units:	Not reported
Number of Containers:	Not reported
Container Type:	Not reported
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	Not reported

Click this hyperlink while viewing on your computer to access
96 additional NY_MANIFEST: record(s) in the EDR Site Report.

Q90 **J & R/RING DRY CLEANERS** **NY DRYCLEANERS** **S110246876**
North **941A PENNSYLVANIA AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.221 mi.
1168 ft. **Site 2 of 3 in cluster Q**

Relative:
Lower

Actual:
9 ft.

DRYCLEANERS:

Facility ID:	2-6105-00488
Phone Number:	718-649-0077
Region:	Not reported
Registration Effective Date:	3/25/2003 15:38:42:796
Inspection Date:	09MAR26
Install Date:	91/99/03
Drop Shop:	Not reported
Shutdown:	Not reported
Alternate Solvent:	Not reported

J & R/RING DRY CLEANERS (Continued) **S110246876**

Current Business: Not reported

Q91
North
1/8-1/4
0.223 mi.
1177 ft.

MOONS CLEANERS **RCRA NonGen / NLR** **1000306501**
941-A PENNSYLVANIA AVE **NYD981083462**
BROOKLYN, NY 11207

Site 3 of 3 in cluster Q

Relative:
Lower

Actual:
9 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	MOONS CLEANERS
Facility address:	941-A PENNSYLVANIA AVE BROOKLYN, NY 11207-8416
EPA ID:	NYD981083462
Mailing address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact:	Not reported
Contact address:	PENNSYLVANIA AVE BROOKLYN, NY 11207
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	Not reported
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	Not reported
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No

MOONS CLEANERS (Continued) **1000306501**

Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency: 01/01/2006
Site name: MOONS CLEANERS
Classification: Not a generator, verified

Date form received by agency: 07/08/1999
Site name: MOONS CLEANERS
Classification: Not a generator, verified

Date form received by agency: 05/06/1985
Site name: MOONS CLEANERS
Classification: Large Quantity Generator

. Waste code: F002
. Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

R92 **NYCDEP** **NY MANIFEST** **1009244340**
NNW **ALABAMA & WORTMAN AVE** **N/A**
1/8-1/4 **BROOKLYN, NY**
0.227 mi.
1200 ft. **Site 1 of 9 in cluster R**

Relative:
Lower

Actual:
12 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP010001915
Facility Status:	Not reported
Location Address 1:	ALABAMA & WORTMAN AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	Not reported
Location Zip 4:	Not reported

NYCDEP (Continued) **1009244340**

NY MANIFEST:

EPAID:	NYP010001915
Mailing Name:	NYCDEP
Mailing Contact:	WAI MAN WONG
Mailing Address 1:	59-17 JUNCTION BOUELVARD
Mailing Address 2:	Not reported
Mailing City:	FLUSHING
Mailing State:	NY
Mailing Zip:	11373
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7185954784

NY MANIFEST:

Document ID:	NYB7124076
Manifest Status:	K
seq:	Not reported
Year:	1996
Trans1 State ID:	MA7222NY
Trans2 State ID:	Not reported
Generator Ship Date:	12/05/1996
Trans1 Recv Date:	12/05/1996
Trans2 Recv Date:	/ /
TSD Site Recv Date:	12/05/1996
Part A Recv Date:	12/27/1996
Part B Recv Date:	12/26/1996
Generator EPA ID:	NYP010001915
Trans1 EPA ID:	NYD049178296
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD049178296
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00040
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100

NYCDEP (Continued) **1009244340**

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

R93 **NYC DEP** **NJ MANIFEST** **S108170481**
NNW **WORTMAN & ALABAMA AVES** **N/A**
1/8-1/4 **BROOKLYN, NY 11201**
0.227 mi.
1200 ft. **Site 2 of 9 in cluster R**

Relative:
Lower

Actual:
12 ft.

NJ MANIFEST:

EPA Id:	NYP003662871
Mail Address:	96-05 ORACE HARDING EXPRY
Mail City/State/Zip:	CORONA 11368
Facility Phone:	7185954784
Emergency Phone:	Not reported
Contact:	ELIE SAINT-JEAN
Comments:	Not reported
SIC Code:	Not reported
County:	00
Municipal:	00
Previous EPA Id:	Not reported
Gen Flag:	X
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	NJA5104499
EPA ID:	NYP003662871
Date Shipped:	05/23/2006
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	NYD049178296
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	05/23/2006
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	06/08/2006
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported

NYC DEP (Continued) **S108170481**

Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	07210621
Was Load Rejected:	CORONA 11368
Reason Load Was Rejected:	Not reported

R94 **CON EDISON** **NY MANIFEST** **S117319439**
NNW **MALTA & WORTMAN** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.227 mi.
1201 ft. **Site 3 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004672143
Facility Status:	Not reported
Location Address 1:	MALTA ST & WORTMAN AV
Code:	BP
Location Address 2:	V7844
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11201
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004672143
Mailing Name:	CON EDISON
Mailing Contact:	CON EDISON
Mailing Address 1:	4 IRVING PL
Mailing Address 2:	15TH FL
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	10/03/2014
Trans1 Recv Date:	10/03/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/03/2014
Part A Recv Date:	Not reported

CON EDISON (Continued) **S117319439**

Part B Recv Date:	Not reported
Generator EPA ID:	NYP004672143
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	013244205JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	100
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

Country:	USA
EPA ID:	NYP004717823
Facility Status:	Not reported
Location Address 1:	MALTA & WORTMAN
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004717823
Mailing Name:	CON EDISON
Mailing Contact:	CON EDISON
Mailing Address 1:	4 IRVING PL

CON EDISON (Continued) **S117319439**

Mailing Address 2:	15TH FL
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2015
Trans1 State ID:	NJD003812047
Trans2 State ID:	NJD003812047
Generator Ship Date:	01/22/2015
Trans1 Recv Date:	01/22/2015
Trans2 Recv Date:	01/26/2015
TSD Site Recv Date:	01/26/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004717823
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD991291105
TSDF ID 2:	Not reported
Manifest Tracking Number:	002620612GBF
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	3000
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

CON EDISON (Continued) **S117319439**

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

R95 **CON EDISON - VAULT 4522** **NJ MANIFEST** **S120666408**
NNW **MALTA & WORTMAN** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.227 mi.
1201 ft. **Site 4 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYP004717823
Mail Address:	IRVING PLACE, 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THERESA BURKARD
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	002620612GBF
EPA ID:	NYP004717823
Date Shipped:	1/22/2015
TSDF EPA ID:	NJD991291105
Transporter EPA ID:	NJD003812047
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported

CON EDISON - VAULT 4522 (Continued) **S120666408**

Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

R96 **CON EDISON** **NJ MANIFEST** **S120670233**
NNW **MALTA ST & WORTMAN AVE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.227 mi.
1201 ft. **Site 5 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

NJ MANIFEST:

EPA Id:	NYP004765145
Mail Address:	IRVING PLACE, 15TH FL NE
Mail City/State/Zip:	NEW YORK, NY 10003
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	THERESA BURKARD
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	014085319JJK
EPA ID:	NYP004765145
Date Shipped:	4/8/2015
TSDF EPA ID:	NJD002200046
Transporter EPA ID:	NJ0000027193
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported

CON EDISON (Continued) **S120670233**

Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	NEW YORK, NY 10003
Reason Load Was Rejected:	Not reported

R97 **CON EDISON** **NY MANIFEST** **S118088925**
NNW **MALTA ST & WORTMAN AVE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.227 mi.
1201 ft. **Site 6 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYP004765145
Facility Status:	Not reported
Location Address 1:	MALTA ST & WORTMAN AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYP004765145
Mailing Name:	CON EDISON
Mailing Contact:	DENNIS HUACON
Mailing Address 1:	4 IRVING PL 15TH FL
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770

NY MANIFEST:

Document ID:	Not reported

CON EDISON (Continued) **S118088925**

Manifest Status:	Not reported
seq:	Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	04/08/2015
Trans1 Recv Date:	04/08/2015
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	04/10/2015
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004765145
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	014085319JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	3000
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
2 additional NY_MANIFEST: record(s) in the EDR Site Report.

R98
NNW
1/8-1/4
0.227 mi.
1201 ft.

CON EDISON - VAULT 4522
MALTA & WORTMAN
BROOKLYN, NY 11207

Site 7 of 9 in cluster R

RCRA-LQG **1019324715**
NYP004717823

Relative:
Lower

Actual:
13 ft.

RCRA-LQG:

Date form received by agency:	02/05/2016
Facility name:	CON EDISON - VAULT 4522
Facility address:	MALTA & WORTMAN BROOKLYN, NY 11207
EPA ID:	NYP004717823
Mailing address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact:	THERESA BURKARD
Contact address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact country:	US
Contact telephone:	212-460-2262
Contact email:	BURKARDT@CONED.COM
EPA Region:	02
Classification:	Large Quantity Generator
Description:	Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	01/22/2015
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner

CON EDISON - VAULT 4522 (Continued) **1019324715**

Owner/Op start date: 01/22/2015
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D008
. Waste name: LEAD

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:
Waste code: D008
Waste name: LEAD
Amount (Lbs): 3000

Violation Status: No violations found

R99 **CON EDISON - MANHOLE 67975** **NY MANIFEST** **S120958187**
NNW **MALTA ST & WORTMAN AVE** **N/A**
1/8-1/4 **QUEENS, NY 11207**
0.227 mi.
1201 ft. **Site 8 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

NY MANIFEST:
Country: USA
EPA ID: NYP004920110
Facility Status: Not reported
Location Address 1: MALTA ST & WORTMAN AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: QUEENS
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYP004920110
Mailing Name: CON EDISON - MANHOLE 67975
Mailing Contact: CON EDISON
Mailing Address 1: 4 IRVING PL 15TH FL NE

CON EDISON - MANHOLE 67975 (Continued) **S120958187**

Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported

R100 **CON EDISON** **RCRA NonGen / NLR** **1019324817**
NNW **MALTA ST & WORTMAN AVE** **NYP004765145**
1/8-1/4 **BROOKLYN, NY 11207**
0.227 mi.
1201 ft. **Site 9 of 9 in cluster R**

Relative:
Lower

Actual:
13 ft.

RCRA NonGen / NLR:

Date form received by agency:	02/05/2016
Facility name:	CON EDISON
Site name:	CON EDISON - VAULT 4494
Facility address:	MALTA ST & WORTMAN AVE BROOKLYN, NY 11207
EPA ID:	NYP004765145
Mailing address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact:	THERESA BURKARD
Contact address:	IRVING PLACE, 15TH FL NE NEW YORK, NY 10003
Contact country:	US
Contact telephone:	212-460-2262
Contact email:	BURKARDT@CONED.COM
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	04/08/2015
Owner/Op end date:	Not reported

Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.
Owner/operator address:	IRVING PLACE NEW YORK, NY 10003
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private

CON EDISON (Continued) **1019324817**

Owner/Operator Type: Operator
Owner/Op start date: 04/08/2015
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D008
. Waste name: LEAD

Historical Generators:
Date form received by agency: 04/08/2015
Site name: CON EDISON
Classification: Not a generator, verified

Date form received by agency: 04/08/2015
Site name: CON EDISON
Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:
Waste code: D008
Waste name: LEAD
Amount (Lbs): 3000

Violation Status: No violations found

S101 **MEADOWOOD AT GATEWAY CONDOMINIUM** **NY AST** **A100293970**
NE **190 COZINE AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.230 mi.
1214 ft. **Site 1 of 2 in cluster S**

Relative:
Lower

Actual:
12 ft.

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-608691
Program Type: PBS
UTM X: 594286.52591

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293970**

UTM Y: 4501080.71637
Expiration Date: 05/19/2020
Site Type: Apartment Building/Office Building

Affiliation Records:

Site Id: 30543
Affiliation Type: Facility Operator
Company Name: MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type: Not reported
Contact Name: ALFREDO PEREZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 649-9400
EMail: Not reported
Fax Number: Not reported
Modified By: JAAVERSA
Date Last Modified: 2017-01-24

Site Id: 30543
Affiliation Type: Emergency Contact
Company Name: MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type: Not reported
Contact Name: ANGEL RODRIQUEZ
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (718) 649-9400
EMail: Not reported
Fax Number: Not reported
Modified By: JAAVERSA
Date Last Modified: 2017-01-24

Site Id: 30543
Affiliation Type: Facility Owner
Company Name: MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type: COMPLIANCE MANAGER
Contact Name: PATRICIA PETTWAY-BROWN
Address1: 675 THIRD AVENUE
Address2: Not reported
City: NY
State: NY
Zip Code: 10017
Country Code: 001
Phone: (212) 370-9200
EMail: PATRICIA.PETTWAY-BROWN@ELLIMANPM.COM
Fax Number: Not reported
Modified By: JAAVERSA
Date Last Modified: 2017-01-24

Site Id: 30543
Affiliation Type: Mail Contact

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293970**

Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type:	COMPLIANCE MANAGER
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NY
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	PATRICIA.PETTWAY-BROWN@ELLIMANPM.COM
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Tank Info:

Tank Number:	001
Tank Id:	65529
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G03 - Tank Secondary Containment - Vault (w/o access)
H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
C01 - Pipe Location - Aboveground

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	3500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DMPOKRZY
Last Modified:	04/14/2017
Material Name:	Not reported

M102 **DSNY BK 16 GARAGE** **NY AST** **U003074884**
North **922 GEORGIA AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.233 mi.
1229 ft. **Site 2 of 5 in cluster M**

Relative:
Lower

Actual:
10 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-456136

DSNY BK 16 GARAGE (Continued) **U003074884**

Program Type:	PBS
UTM X:	593851.62270
UTM Y:	4500955.06898
Expiration Date:	12/06/2018
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	20095
Affiliation Type:	Mail Contact
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	FRANK SCARPACI
Address1:	125 WORTH STREET
Address2:	ROOM # 823 B
City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4887
EMail:	FSCARPACI@DSNY.NYC.GOV
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-15

Site Id:	20095
Affiliation Type:	Facility Operator
Company Name:	DSNY BK 16 GARAGE
Contact Type:	Not reported
Contact Name:	ADAM KARP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 257-1520
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-15

Site Id:	20095
Affiliation Type:	Emergency Contact
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	BUREAU OF CLEANING & COLLECTION
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 885-5051
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2013-11-20

DSNY BK 16 GARAGE (Continued) **U003074884**

Site Id:	20095
Affiliation Type:	Facility Owner
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	125 WORTH ST - RM #823B
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4856
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-15

Tank Info:

Tank Number:	003
Tank Id:	6128
Material Code:	0012
Common Name of Substance:	Kerosene [#1 Fuel Oil] (On-Site Consumption)

Equipment Records:

G00 - Tank Secondary Containment - None
L09 - Piping Leak Detection - Exempt Suction Piping
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
C01 - Pipe Location - Aboveground
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I05 - Overfill - Vent Whistle
J03 - Dispenser - Gravity
K00 - Spill Prevention - None
A00 - Tank Internal Protection - None

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/01/1982
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	08/01/2000
Register:	True
Modified By:	dxliving
Last Modified:	04/14/2017
Material Name:	Not reported

Tank Number:	007
Tank Id:	36543
Material Code:	0012

DSNY BK 16 GARAGE (Continued) **U003074884**

Common Name of Substance: Kerosene [#1 Fuel Oil] (On-Site Consumption)

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J03 - Dispenser - Gravity
A00 - Tank Internal Protection - None
G00 - Tank Secondary Containment - None

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - Removed
Pipe Model:	Not reported
Install Date:	12/01/1982
Capacity Gallons:	275
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	12/01/1993
Register:	True
Modified By:	TRANSLAT
Last Modified:	04/14/2017
Material Name:	Not reported

M103 **DSNY BK 16 GARAGE** **NY UST** **U004062537**
North **922 GEORGIA AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.233 mi.
1229 ft. **Site 3 of 5 in cluster M**

Relative:
Lower

Actual:
10 ft.

UST:

Id/Status:	2-456136 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	12/06/2018
UTM X:	593851.62270
UTM Y:	4500955.06898
Site Type:	Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id:	20095
Affiliation Type:	Mail Contact
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	FRANK SCARPACI
Address1:	125 WORTH STREET
Address2:	ROOM # 823 B
City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4887
EMail:	FSCARPACI@DSNY.NYC.GOV
Fax Number:	Not reported

DSNY BK 16 GARAGE (Continued) **U004062537**

Modified By:	DAFRANCI
Date Last Modified:	2016-11-15
Site Id:	20095
Affiliation Type:	Facility Operator
Company Name:	DSNY BK 16 GARAGE
Contact Type:	Not reported
Contact Name:	ADAM KARP
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 257-1520
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-15
Site Id:	20095
Affiliation Type:	Emergency Contact
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	BUREAU OF CLEANING & COLLECTION
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 885-5051
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2013-11-20
Site Id:	20095
Affiliation Type:	Facility Owner
Company Name:	NYC DEPT OF SANITATION
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	125 WORTH ST - RM #823B
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10013
Country Code:	001
Phone:	(646) 885-4856
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2016-11-15

Tank Info:

Tank Number:	001

DSNY BK 16 GARAGE (Continued) **U004062537**

Tank ID:	36540
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1998
Date Tank Closed:	02/01/1999
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0008
Common Name of Substance:	Diesel
Tightness Test Method:	02
Date Test:	10/01/1993
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number:	001G
Tank ID:	36537
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

DSNY BK 16 GARAGE (Continued) **U004062537**

H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Number:	002
Tank ID:	36541
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1998
Date Tank Closed:	02/01/1999
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0008
Common Name of Substance:	Diesel
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
F00 - Pipe External Protection - None

Tank Number:	002G
Tank ID:	36538
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

DSNY BK 16 GARAGE (Continued) **U004062537**

I04 - Overfill - Product Level Gauge (A/G)
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

Tank Number:	003-A
Tank ID:	173339
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0009
Common Name of Substance:	Gasoline
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Number:	004
Tank ID:	36544
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	4000
Install Date:	12/01/1982
Date Tank Closed:	07/01/2000
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0013
Common Name of Substance:	Lube Oil
Tightness Test Method:	NN
Date Test:	Not reported

DSNY BK 16 GARAGE (Continued) **U004062537**

Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 005
Tank ID: 36548
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 12/01/1982
Date Tank Closed: 07/01/2000
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0013
Common Name of Substance: Lube Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None

Tank Number: 006
Tank ID: 36552
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 12/01/1983
Date Tank Closed: 07/01/2010
Registered: True
Tank Location: Underground

DSNY BK 16 GARAGE (Continued) **U004062537**

Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 05/23/2006
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 009
Tank ID: 36545
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 12/01/1982
Date Tank Closed: 12/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

DSNY BK 16 GARAGE (Continued) **U004062537**

Tank Number:	010
Tank ID:	36546
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

Tank Number:	011
Tank ID:	36547
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

DSNY BK 16 GARAGE (Continued) **U004062537**

F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
A00 - Tank Internal Protection - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Number:	013
Tank ID:	36549
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number:	014
Tank ID:	36550
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

DSNY BK 16 GARAGE (Continued) **U004062537**

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number:	015
Tank ID:	36551
Tank Status:	Closed - Removed
Material Name:	Closed - Removed
Capacity Gallons:	550
Install Date:	12/01/1982
Date Tank Closed:	12/01/1993
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	9999
Common Name of Substance:	Other
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	TRANSLAT
Last Modified:	04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None

Tank Number:	016
Tank ID:	56437
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	4000
Install Date:	03/01/1999
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	2710
Common Name of Substance:	Biodiesel

DSNY BK 16 GARAGE (Continued) **U004062537**

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MSBAPTIS
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double walled UG
J01 - Dispenser - Pressurized Dispenser
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring

Tank Number: 016A
Tank ID: 60344
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 550
Install Date: 08/01/2000
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: MSBAPTIS
Last Modified: 04/14/2017

Equipment Records:

E04 - Piping Secondary Containment - Double walled UG
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
J00 - Dispenser - None
L00 - Piping Leak Detection - None
G04 - Tank Secondary Containment - Double-Walled (Underground)

DSNY BK 16 GARAGE (Continued) **U004062537**

Tank Number:	017
Tank ID:	60346
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	2000
Install Date:	08/01/2000
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0015
Common Name of Substance:	Motor Oil
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MSBAPTIS
Last Modified:	04/14/2017

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double walled UG
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

Tank Number:	018
Tank ID:	60347
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	2000
Install Date:	08/01/2000
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0010
Common Name of Substance:	Hydraulic Oil
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MSBAPTIS
Last Modified:	04/14/2017

Equipment Records:

L09 - Piping Leak Detection - Exempt Suction Piping
C03 - Pipe Location - Aboveground/Underground Combination

DSNY BK 16 GARAGE (Continued) **U004062537**

F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double walled UG
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin

Tank Number:	019
Tank ID:	235635
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	10000
Install Date:	07/13/2010
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Equivalent technology
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MSBAPTIS
Last Modified:	04/14/2017

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
E04 - Piping Secondary Containment - Double walled UG
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
C03 - Pipe Location - Aboveground/Underground Combination
F04 - Pipe External Protection - Fiberglass
J02 - Dispenser - Suction Dispenser
L01 - Piping Leak Detection - Interstitial - Electronic Monitoring

---

M104 **BROOKLYN EAST 16 DOS -DDC** **NY LTANKS S104621535**
North **922 GEORGIA AVENUE** **NY Spills N/A**
1/8-1/4 **BROOKLYN, NY**
0.233 mi.
1229 ft. **Site 4 of 5 in cluster M**

Relative:
Lower

Actual:
10 ft.

LTANKS:

Facility ID:	0001440
Site ID:	88116
Spill Number/Closed Date:	2006-03-10

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

Spill Date:	2000-05-04
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JAKOLLEE
Referred To:	Not reported
Reported to Dept:	2000-05-04
CID:	207
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2000-05-04
Spill Record Last Update:	2006-03-10
Spiller Name:	Not reported
Spiller Company:	NYC DEPT. OF SANITATION
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	220795
DEC Memo:	"03/10/06: This site was being cleaned up under NYCDDC Consent Order, under spill #9306849; cleanup was completed and the spill was closed in Nov. 2005, NFA letter issued by I. Islam. The hoist oil tank involved in this spill appears to be located within the area addressed by the remedial action for spill 9306849. Therefore, OK to close this spill. - J. Kolleeny"
Remarks:	"GROSS FAIL TANK CONTAINED HOIST OIL. see also # 0001840"

All TTF:

Facility ID:	0001440
Spill Number:	0001440
Spill Tank Test:	1525554
Site ID:	88116
Tank Number:	1
Tank Size:	4000
Material:	0010A
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	88116

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

Operable Unit ID:	823344
Operable Unit:	01
Material ID:	289668
Material Code:	0010
Material Name:	hydraulic oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9403700
Site ID:	88119
Spill Number/Closed Date:	2003-11-03
Spill Date:	1994-06-15
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1994-06-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1994-09-22
Spill Record Last Update:	2004-12-17
Spiller Name:	Not reported
Spiller Company:	NYC DEPT OF SANITATION
Spiller Address:	922 GEORGIA AVENUE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	220795
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD 10/10/95: This is additional information about material spilled from the translation of the old spill file: TTF. Investigation and remediation under spill # 9306849."
Remarks:	"SEE 9306849"

All TTF:

Facility ID:	9403700
Spill Number:	9403700
Spill Tank Test:	1542868
Site ID:	88119
Tank Number:	Not reported
Tank Size:	0
Material:	0008

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	88119
Operable Unit ID:	997372
Operable Unit:	01
Material ID:	383873
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9308251
Site ID:	271263
Spill Number/Closed Date:	2003-10-31
Spill Date:	1993-10-07
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1993-10-07
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1993-10-08
Spill Record Last Update:	2004-12-17
Spiller Name:	Not reported
Spiller Company:	NYC DEP OF SANITATION
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	220795

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD 10/10/95: This is additional information about material spilled from the translation of the old spill file: TTF."
Remarks: "WILL FIND LEAK - NO CONTAM. FOUND YET. SEE 9306849"

All TTF:
Facility ID: 9308251
Spill Number: 9308251
Spill Tank Test: 1542071
Site ID: 271263
Tank Number: Not reported
Tank Size: 0
Material: 0012
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 271263
Operable Unit ID: 989784
Operable Unit: 01
Material ID: 394486
Material Code: 0012A
Material Name: kerosene
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Facility ID: 9312491
Site ID: 271265
Spill Number/Closed Date: 1995-09-28
Spill Date: 1994-01-22
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: 1995-09-28
SWIS: 2401
Investigator: KSTANG
Referred To: Not reported
Reported to Dept: 1994-01-24
CID: Not reported
Water Affected: Not reported
Spill Notifier: Local Agency
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1994-01-25
Spill Record Last Update:	2005-07-07
Spiller Name:	Not reported
Spiller Company:	UNK
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	220795
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TANG "
Remarks:	"PROB. PROD. INTO WRONG TANK. CLEAN UP. REFER TO 9306849"

All Materials:

Site ID:	271265
Operable Unit ID:	991123
Operable Unit:	01
Material ID:	387922
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	Not reported
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9309468
Site ID:	84249
Spill Number/Closed Date:	2003-10-31
Spill Date:	1993-11-04
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1993-11-04
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1993-11-08
Spill Record Last Update:	2004-12-17
Spiller Name:	Not reported
Spiller Company:	NYC DEPT OF SANITATION
Spiller Address:	Not reported
Spiller County:	999

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	220795
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD 10/10/95: This is additional information about material spilled from the translation of the old spill file: POSSIBLE FUEL OIL."
Remarks:	"SOIL DISCOVERED IN TANKPULL - TO CONTINUE TO EXCAVATE. SEE 9306849"

All Materials:

Site ID:	84249
Operable Unit ID:	991012
Operable Unit:	01
Material ID:	392122
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	0001840
Facility Type:	ER
Spill Number:	0001840
DER Facility ID:	220795
Site ID:	88117
DEC Region:	2
Spill Number/Closed Date:	2003-11-03
Spill Cause:	Human Error
Spill Class:	B3
SWIS:	2401
Spill Date:	2000-05-11
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	2000-05-12
CID:	252
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-05-12
Spill Record Last Update:	2005-07-07
Spiller Name:	RON TRAMPOSCH
Spiller Company:	LIRO-KASSNER ENGINEERING
Spiller Address:	10440 MAIN ST
Spiller Company:	001

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

Contact Name:	UNK
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD Investigation and remediation under spill # 9306849."
Remarks:	"CALLER STATES NYC DEPT OF SANITATION (BROOKLYN EAST 16) WAS HAVING SOIL AND GROUND WATER REMEDIATION BEING DONE WHEN AN UNDERGROUND STORAGE WAS PUNCTURED WITH AN AUGER-PETROLEUM SPILLED INTO SURROUNDING SOIL-ACCORDING TO CALLER THIS INCIDENT WAS NOT REPORTED Also see spill # 0002542."

All Materials:

Site ID:	88117
Operable Unit ID:	823401
Operable Unit:	01
Material ID:	550222
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0002542
Facility Type:	ER
Spill Number:	0002542
DER Facility ID:	220795
Site ID:	88118
DEC Region:	2
Spill Number/Closed Date:	2003-10-31
Spill Cause:	Human Error
Spill Class:	C3
SWIS:	2401
Spill Date:	2000-05-31
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	2000-05-31
CID:	257
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-05-31
Spill Record Last Update:	2005-07-07
Spiller Name:	Not reported
Spiller Company:	DEPT OF SANITATION
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	STEVE FRANK
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD "
Remarks:	"ON 5/11/00 CALLER COMPANY DRILLED INTO A UST AND THAT MIGHT HAVE

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

CAUSED THE SPILL. Same as spill #0001840."

All Materials:

Site ID:	88118
Operable Unit ID:	824473
Operable Unit:	01
Material ID:	550898
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9306849
Facility Type:	ER
Spill Number:	9306849
DER Facility ID:	220795
Site ID:	271262
DEC Region:	2
Spill Number/Closed Date:	2005-11-15
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	2401
Spill Date:	1993-09-03
Investigator:	AIIslam
Referred To:	Not reported
Reported to Dept:	1993-09-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-09-09
Spill Record Last Update:	2005-12-14
Spiller Name:	Not reported
Spiller Company:	NYC DEPT. OF SANITATION
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KOLLEENY TRANSFERRED FROM Y.KRIMGOLD. The spill Lead_DEC Field is I. Islam with effect from 02/02/05. 4/20/05- The site is under remediation by LiRo Engineers. Reviewed quarterly report (Nov./04-Jan./05). Soil remediation ended up. Groundwater contamination persists in 2 wells only. ORC socks installation has been recommeded in those two wells. Quarterly groundwater monitoring to continue. - II 7/11/05- Reviewed the Feb.-Apr./05 monitoring report.Presented data reveal that low level GW contamination persists in two wells (MW-4 and MW-27) only. However ORC socks have been

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

installed in these two wells in Mar/05. Quarterly sampling of these wells is to continue. Installed the report in the eDoc Folder. - II. 10/11/05- Reviewed the May-July/05 monitoring report dt. Sept. 6/05. All of a sudden in June/05, free product was identified in MW-27 and measured at 0.06' on June 1 and 0.03' on June 14. The product was identified through fingerprinting as kerosene/diesel fuel mixture. Most recent (Sept1/05) monitoring revealed a sheen only in this well, and LiRo comments this product as transient. Recent GW results showed low level contamination at well EW-19, and wells MW-4 and MW-14 showed no detections of petroleum compounds. However LiRo recommends continuing GW sampling at wells EW-19, MW-4 and MW-27 and quarterly reporting. Filed the report in the eDoc Folder.-II 11/15/05- Sept/05 GW sampling results were presented by the consultant in the meeting (11/10/05) with DDC and DEC. Most of site wells were eliminated from the monitoring program based on repeated compliances with GW standards. GW sample (Sept/05)from well MW-27 showed TVOCs of 139ppb while historical data from the well show generally lower than 100ppb. Based on these, Koon gave a decision to close the spill, and it is closed today. - II"

Remarks: "LEAK DETECTOR IN TANK MALFUNCTIONED. DURING REPAIR FOUND 1200 GAL, MISSING - SUSPECT BROKEN LINE. 10/7/93-TANK TEST FAILURE. 11/4/93-SOIL FOUND IN TANK PULL. 11/11/93 CONTAMINATED SOIL FOUND. See spill #s 9308251, 9309753, 9309468."

All Materials:

Site ID:	271262
Operable Unit ID:	985019
Operable Unit:	01
Material ID:	396683
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1200.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9309753
Facility Type:	ER
Spill Number:	9309753
DER Facility ID:	220795
Site ID:	271264
DEC Region:	2
Spill Number/Closed Date:	2003-10-31
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	2401
Spill Date:	1993-11-11
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1993-11-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported

BROOKLYN EAST 16 DOS -DDC (Continued) **S104621535**

Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-11-18
Spill Record Last Update:	2004-12-17
Spiller Name:	Not reported
Spiller Company:	NYC DO SANITATION
Spiller Address:	44 BEAVER STREET
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD 10/10/95: This is additional information about material spilled from the translation of the old spill file: LUB OIL - HOIST OIL."
Remarks:	"CONTAMINATED SOIL. REMOVED STOCK PILED AND COVERED. DOING BORINGS FOR SITE ASSESSMENT. Same as spill # 9306849."

All Materials:

Site ID:	271264
Operable Unit ID:	988847
Operable Unit:	01
Material ID:	392406
Material Code:	0012A
Material Name:	kerosene
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

P105 **NYCHA - BREUKELEN HOUSES** **RCRA-CESQG** **1014399916**
West **650 E 108TH ST** **NYR000180067**
1/8-1/4 **BROOKLYN, NY 11236**
0.234 mi.
1238 ft. **Site 2 of 2 in cluster P**

Relative:
Lower

Actual:
11 ft.

RCRA-CESQG:

Date form received by agency:	01/14/2011
Facility name:	NYCHA - BREUKELEN HOUSES
Facility address:	650 E 108TH ST BROOKLYN, NY 11236
EPA ID:	NYR000180067
Mailing address:	49TH AVE 5TH FLOOR LONG ISLAND CITY, NY 11101
Contact:	CEASARE GENTILE
Contact address:	49TH AVE 5TH FLOOR LONG ISLAND CITY, NY 11101
Contact country:	US
Contact telephone:	718-707-5729
Contact email:	CEASARE.GENTILE@NYCHA.NYC.GOV
EPA Region:	02
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time;

NYCHA - BREUKELEN HOUSES (Continued) **1014399916**

or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	NYC HOUSING AUTHORITY
Owner/operator address:	49TH AVE
	LONG ISLAND CITY, NY 11101
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Owner
Owner/Op start date:	11/06/1952
Owner/Op end date:	Not reported

Owner/operator name:	NYC HOUSING AUTHORITY
Owner/operator address:	Not reported
	Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Municipal
Owner/Operator Type:	Operator
Owner/Op start date:	11/06/1952
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

NYCHA - BREUKELEN HOUSES (Continued) **1014399916**

. Waste code: D001
. Waste name: IGNITABLE WASTE

Violation Status: No violations found

T106 **PUBLIC SCHOOL 306K** **RCRA-LQG** **1014473026**
NNE **970 VERMONT ST** **NYR000181370**
1/8-1/4 **BROOKLYN, NY 11207**
0.240 mi.
1266 ft. **Site 1 of 3 in cluster T**

Relative:
Lower

Actual:
10 ft.

RCRA-LQG:
Date form received by agency: 02/17/2012
Facility name: PUBLIC SCHOOL 306K
Facility address: 970 VERMONT ST
BROOKLYN, NY 11207
EPA ID: NYR000181370
Mailing address: THOMSON AVE
LONG ISLAND CITY, NY 11101
Contact: ALEXANDER LEMPERT
Contact address: THOMSON AVE
LONG ISLAND CITY, NY 11101
Contact country: US
Contact telephone: 718-472-8501
Contact email: ALEMPERT@NYCSCA.ORG
EPA Region: 02
Land type: Municipal
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:
Owner/operator name: NYC DEPT OF ED
Owner/operator address: VERNON BLVD
LONG ISLAND CITY, NY 11101
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1965
Owner/Op end date: Not reported

Owner/operator name: NYC DEPT OF ED
Owner/operator address: Not reported
Not reported

PUBLIC SCHOOL 306K (Continued) **1014473026**

Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1965
Owner/Op end date: Not reported

Owner/operator name: NYC DEPT OF EDUCATION
Owner/operator address: THOMSON AVE
LONG ISLAND CITY, NY 11101
Owner/operator country: US
Owner/operator telephone: 718-472-8501
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: 06/07/1966
Owner/Op end date: Not reported

Owner/operator name: NEW YORK CITY DEPT OF SCHOOL FACILITIES
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Operator
Owner/Op start date: 06/07/1966
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: B004
. Waste name: B004

. Waste code: B007

PUBLIC SCHOOL 306K (Continued) **1014473026**

. Waste name: B007

Historical Generators:
Date form received by agency: 03/21/2011
Site name: NYC DEPT OF ED - PUBLIC SCHOOL 306K
Classification: Small Quantity Generator

. Waste code: B004
. Waste name: B004

. Waste code: B007
. Waste name: B007

Violation Status: No violations found

Evaluation Action Summary:
Evaluation date: 02/19/2011
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: EPA

T107 **PUBLIC SCHOOL 306 - BROOKLYN K306** **NY AST** **A100320112**
NNE **970 VERMONT STREET** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.240 mi.
1266 ft. **Site 2 of 3 in cluster T**

Relative:
Lower

Actual:
10 ft.

AST:
Region: STATE
DEC Region: 2
Site Status: Active
Facility Id: 2-354627
Program Type: PBS
UTM X: 594119.86696
UTM Y: 4501128.49573
Expiration Date: 06/28/2018
Site Type: School

Affiliation Records:
Site Id: 17640
Affiliation Type: Facility Operator
Company Name: PUBLIC SCHOOL 306 - BROOKLYN K306
Contact Type: Not reported
Contact Name: ERNEST FUCHS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 714-1461
EMail: Not reported
Fax Number: Not reported
Modified By: DAFRANCI
Date Last Modified: 2016-10-13

Site Id: 17640

PUBLIC SCHOOL 306 - BROOKLYN K306 (Continued) **A100320112**

Affiliation Type:	Mail Contact
Company Name:	NYC DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	MUNENDRA SHARMA
Address1:	FIELD OPERATIONS-FUEL DIVISION
Address2:	44-36 VERNON BOULEVARD
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 349-5752
EMail:	MSHARMA@SCHOOLS.NYC.GOV
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-04-26

Site Id:	17640
Affiliation Type:	Facility Owner
Company Name:	NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	Not reported
Address1:	44-36 VERNON BOULEVARD
Address2:	Not reported
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 349-5752
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-06-08

Site Id:	17640
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	KEN MAHADEO
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(646) 210-7918
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-06-12

Tank Info:

Tank Number:	001
Tank Id:	34534
Material Code:	0003
Common Name of Substance:	#6 Fuel Oil (On-Site Consumption)

PUBLIC SCHOOL 306 - BROOKLYN K306 (Continued) **A100320112**

Equipment Records:
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
L00 - Piping Leak Detection - None
E00 - Piping Secondary Containment - None
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
G02 - Tank Secondary Containment - Vault (w/access)
I05 - Overfill - Vent Whistle

Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 09/30/1965
Capacity Gallons: 7500
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: DAFRANCI
Last Modified: 04/14/2017
Material Name: Not reported

Tank Number: 002
Tank Id: 34535
Material Code: 0003
Common Name of Substance: #6 Fuel Oil (On-Site Consumption)

Equipment Records:
G02 - Tank Secondary Containment - Vault (w/access)
I05 - Overfill - Vent Whistle
L00 - Piping Leak Detection - None
H06 - Tank Leak Detection - Impervious Barrier/Concrete Pad (A/G)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
C03 - Pipe Location - Aboveground/Underground Combination
J02 - Dispenser - Suction Dispenser
E00 - Piping Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)

Tank Location: 3
Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 09/30/1965
Capacity Gallons: 7500
Tightness Test Method: -

PUBLIC SCHOOL 306 - BROOKLYN K306 (Continued) **A100320112**

Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	DAFRANCI
Last Modified:	04/14/2017
Material Name:	Not reported

T108 **NYC DEPT OF ED - PUBLIC SCHOOL 306K** **NY MANIFEST** **U003394233**
NNE **970 VERMONT AVE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.240 mi.
1266 ft. **Site 3 of 3 in cluster T**

Relative:
Lower

Actual:
10 ft.

NY MANIFEST:

Country:	USA
EPA ID:	NYR000181370
Facility Status:	Not reported
Location Address 1:	970 VERMONT STREET
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11207
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYR000181370
Mailing Name:	NYC DEPT OF ED - PUBLIC SCHOOL 306K
Mailing Contact:	NYC SCHOOL CONSTRUCTION AUTHORITY
Mailing Address 1:	30-30 THOMSON AVENUE
Mailing Address 2:	Not reported
Mailing City:	LONG ISLAND CITY
Mailing State:	NY
Mailing Zip:	11101
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7184728501

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2011
Trans1 State ID:	NYR000081661
Trans2 State ID:	NYD080631369
Generator Ship Date:	05/25/2011
Trans1 Recv Date:	05/25/2011
Trans2 Recv Date:	05/27/2011
TSD Site Recv Date:	06/02/2011
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000181370
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD980536593
TSDF ID 2:	Not reported

NYC DEPT OF ED - PUBLIC SCHOOL 306K (Continued) **U003394233**

Manifest Tracking Number:	000097128JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	180.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1.0
Waste Code:	B002
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
17 additional NY_MANIFEST: record(s) in the EDR Site Report.

M109 **K B ELECTRONICS INC** **RCRA NonGen / NLR** **1000111771**
North **73 WORTMAN AVE** **FINDS** **NYD043178441**
1/8-1/4 **BROOKLYN, NY 11207** **ECHO**
0.240 mi. **NY MANIFEST**
1266 ft. **Site 5 of 5 in cluster M**

Relative:
Lower

Actual:
9 ft.

RCRA NonGen / NLR:

Date form received by agency:	01/01/2007
Facility name:	K B ELECTRONICS INC
Facility address:	73 WORTMAN AVE BROOKLYN, NY 11207-8399
EPA ID:	NYD043178441
Mailing address:	WORTMAN AVE BROOKLYN, NY 11207
Contact:	Not reported
Contact address:	WORTMAN AVE BROOKLYN, NY 11207
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

K B ELECTRONICS INC (Continued) **1000111771**

Owner/Operator Summary:
- Owner/operator name: K B ELECTRONICS INC
- Owner/operator address: NOT REQUIRED
  NOT REQUIRED, WY 99999
- Owner/operator country: US
- Owner/operator telephone: 212-555-1212
- Owner/operator email: Not reported
- Owner/operator fax: Not reported
- Owner/operator extension: Not reported
- Legal status: Private
- Owner/Operator Type: Operator
- Owner/Op start date: Not reported
- Owner/Op end date: Not reported

- Owner/operator name: K B ELECTRONICS INC
- Owner/operator address: NOT REQUIRED
  NOT REQUIRED, WY 99999
- Owner/operator country: US
- Owner/operator telephone: 212-555-1212
- Owner/operator email: Not reported
- Owner/operator fax: Not reported
- Owner/operator extension: Not reported
- Legal status: Private
- Owner/Operator Type: Owner
- Owner/Op start date: Not reported
- Owner/Op end date: Not reported

Handler Activities Summary:
- U.S. importer of hazardous waste: No
- Mixed waste (haz. and radioactive): No
- Recycler of hazardous waste: No
- Transporter of hazardous waste: No
- Treater, storer or disposer of HW: No
- Underground injection activity: No
- On-site burner exemption: No
- Furnace exemption: No
- Used oil fuel burner: No
- Used oil processor: No
- User oil refiner: No
- Used oil fuel marketer to burner: No
- Used oil Specification marketer: No
- Used oil transfer facility: No
- Used oil transporter: No

Historical Generators:
- Date form received by agency: 01/01/2006
- Site name: K B ELECTRONICS INC
- Classification: Not a generator, verified

- Date form received by agency: 07/08/1999
- Site name: K B ELECTRONICS INC
- Classification: Not a generator, verified

- Date form received by agency: 09/21/1989
- Site name: K B ELECTRONICS INC
- Classification: Small Quantity Generator

K B ELECTRONICS INC (Continued) **1000111771**

. Waste code: D002
. Waste name: CORROSIVE WASTE

Violation Status: No violations found

FINDS:

Registry ID: 110004355000

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000111771
Registry ID: 110004355000
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004355000

NY MANIFEST:
Country: USA
EPA ID: NYD043178441
Facility Status: Not reported
Location Address 1: 73 WORTHMAN AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYD043178441
Mailing Name: K B ELECTRONICS
Mailing Contact: K B ELECTRONICS
Mailing Address 1: 73 WORTHMAN AVENUE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11207
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7182573300

NY MANIFEST:
Document ID: NJA2086134
Manifest Status: K
seq: Not reported
Year: 1995

K B ELECTRONICS INC (Continued) **1000111771**

Trans1 State ID:	08690
Trans2 State ID:	Not reported
Generator Ship Date:	06/02/1995
Trans1 Recv Date:	06/02/1995
Trans2 Recv Date:	/ /
TSD Site Recv Date:	06/06/1995
Part A Recv Date:	07/28/1995
Part B Recv Date:	07/12/1995
Generator EPA ID:	NYD043178441
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	TXD077603371
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00446
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100

Click this hyperlink while viewing on your computer to access
12 additional NY_MANIFEST: record(s) in the EDR Site Report.

S110 **MEADOWOOD AT GATEWAY CONDOMINIUM** **NY AST** **A100293971**
NE **200 COZINE AVENUE** **N/A**
1/8-1/4 **BROOKLYN, NY 11207**
0.242 mi.
1279 ft. **Site 2 of 2 in cluster S**

Relative:
Lower

Actual:
12 ft.

AST:

Region:	STATE
DEC Region:	2
Site Status:	Active
Facility Id:	2-252301
Program Type:	PBS
UTM X:	594306.10757
UTM Y:	4501050.63330
Expiration Date:	05/19/2020
Site Type:	Apartment Building/Office Building

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293971**

Affiliation Records:

Site Id:	10162
Affiliation Type:	Mail Contact
Company Name:	DOUGLAS ELLIMAN PROPERTY MANAGEMENT
Contact Type:	Not reported
Contact Name:	PATRICIA PETTWAY-BROWN
Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	PATRICIA.PETTWAY-BROWN@ELLIMANPM.COM
Fax Number:	Not reported
Modified By:	MFLEONAR
Date Last Modified:	2017-07-17

Site Id:	10162
Affiliation Type:	Facility Operator
Company Name:	MEADOWOOD AT GATEWAY CONDOMINIUM
Contact Type:	Not reported
Contact Name:	ALFREDO PEREZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Site Id:	10162
Affiliation Type:	Emergency Contact
Company Name:	C/O DOUGLAS ELLIMAN PROPERTY MANAGEMENT
Contact Type:	Not reported
Contact Name:	ANGEL RODRIGUEZ
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 649-9400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DMPOKRZY
Date Last Modified:	2016-10-19

Site Id:	10162
Affiliation Type:	Facility Owner
Company Name:	MEADOWWOOD AT GATEWAY CONDO C/O DOUGLASS ELLIMAN P
Contact Type:	COMPLIANCE MANAGER
Contact Name:	PATRICIA PETTWAY-BROWN

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293971**

Address1:	675 THIRD AVENUE
Address2:	Not reported
City:	NEW YORK
State:	NY
Zip Code:	10017
Country Code:	001
Phone:	(212) 370-9200
EMail:	Not reported
Fax Number:	Not reported
Modified By:	JAAVERSA
Date Last Modified:	2017-01-24

Tank Info:

Tank Number:	001
Tank Id:	65530
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Equipment Records:

C01 - Pipe Location - Aboveground
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
G03 - Tank Secondary Containment - Vault (w/o access)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location:	1
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	In Service
Pipe Model:	Not reported
Install Date:	01/01/1991
Capacity Gallons:	3500
Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Date Tank Closed:	Not reported
Register:	True
Modified By:	JAAVERSA
Last Modified:	04/14/2017
Material Name:	Not reported

Tank Number:	002
Tank Id:	11835
Material Code:	0000
Common Name of Substance:	Empty

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None

MEADOWOOD AT GATEWAY CONDOMINIUM (Continued) **A100293971**

F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location:	6
Tank Type:	Steel/Carbon Steel/Iron
Tank Status:	Closed - In Place
Pipe Model:	Not reported
Install Date:	Not reported
Capacity Gallons:	35000
Tightness Test Method:	03
Date Test:	10/03/1998
Next Test Date:	Not reported
Date Tank Closed:	11/01/1998
Register:	True
Modified By:	TRANSLAT
Last Modified:	04/14/2017
Material Name:	Not reported

---

111 North 1/4-1/2 0.296 mi. 1565 ft. **PENN-WORTMAN HOUSES -NYCHA** **NY LTANKS S102555812**
875 PENNSYLVANIA AVE **NY Spills N/A**
BROOKLYN, NY

Relative: Lower

Actual: 9 ft.

LTANKS:

Facility ID:	9614567
Site ID:	136035
Spill Number/Closed Date:	2014-11-05
Spill Date:	1997-03-18
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	jkkann
Referred To:	Not reported
Reported to Dept:	1997-03-18
CID:	312
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1997-03-18
Spill Record Last Update:	2014-11-05
Spiller Name:	DAVE FORTE
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	ZEKE SEIFU
Spiller Phone:	(718) 257-2717
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	116755
DEC Memo:	"12/09/05: This spill transferred from J.Kolleeny to S.Kraszewksi. 07/28/06: NYCHA update summary states that on 20K UST installed in

PENN-WORTMAN HOUSES -NYCHA (Continued) **S102555812**

1972 and stored #4 and #6 oil currently stores #2 oil. Both as scheduled for a retest in 2008. No recovery system or MWs on site. NYCHA will provide DEC with a site assessment. - SK 06/10/08 : site reassigned to J.Kann. Spill 0207201 closed and consolidated with this spill at the same address. J.Kann 3/1/12: J.Kann - rcvd iwp 2/28/12 and edoced today. 1/23/14: J.Kann - email sent to NYCHA requesting some info on Dec. 30, 2013. Received info on Jan. 9 and reviewed it today. Email approving IWP with mods sent out today and edoced. SIR due July 23, 2014. 11/5/14: J.Kann - visited site during field work on September 4, 2014. Reminded NYCHA to collect a sample in the area of the former mobile boiler. Two young trees and grass were thriving in the area of the former mobile boiler. Observed soil samples collected around the tank. No visible impacts noted. Received the SIR on 10/15/14. Reviewed the report. No exceedences of CP-51 or TOGS 1.1.1 for VOCs in groundwater or soil (with the exception of MTBE in one gw sample at 13 ppb (10ppb standard)). Minor SVOC impacts were detected in three soil locations. SB-4 in area of former mobile boiler contained no VOCs and minor SVOC (1200-1400 ppb of 4 constiuents with guidances of 800-1000 ppb). Location SBFL2 contained slightly higher SVOCs attributed to asphalt in the soil (poor quality fill). Benzo(a)anthracene was detected in gw at two locations with a concentration of 0.06ppb (guidance of 0.002 ppb). Based on the site investigation, no additional investigation is warranted and the spill closed. "

Remarks: ""

All TTF:

Facility ID:	9614567
Spill Number:	9614567
Spill Tank Test:	1545027
Site ID:	136035
Tank Number:	001RED
Tank Size:	20017
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

SPILLS:

Facility ID:	9603017
Facility Type:	ER
Spill Number:	9603017
DER Facility ID:	116755
Site ID:	121332
DEC Region:	2
Spill Number/Closed Date:	1996-06-17
Spill Cause:	Human Error
Spill Class:	C4
SWIS:	2401

PENN-WORTMAN HOUSES -NYCHA (Continued) **S102555812**

Spill Date:	1996-06-03
Investigator:	HEALY
Referred To:	Not reported
Reported to Dept:	1996-06-03
CID:	322
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-06-03
Spill Record Last Update:	2005-12-09
Spiller Name:	FRANK OCELLO
Spiller Company:	NYCHA
Spiller Address:	250 BRAODWAY
Spiller Company:	001
Contact Name:	ZELECK SEIFU
DEC Memo:	""
Remarks:	"subj was cleaning and spilled 1/2 gal of concentrated product - spill being cleaned up "

All Materials:

Site ID:	121332
Operable Unit ID:	1030571
Operable Unit:	01
Material ID:	569693
Material Code:	0057A
Material Name:	pesticides
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Site ID:	121332
Operable Unit ID:	1030571
Operable Unit:	01
Material ID:	569692
Material Code:	0249A
Material Name:	malathion
Case No.:	00121755
Material FA:	Hazardous Material
Quantity:	1.00
Units:	G
Recovered:	1.00
Oxygenate:	Not reported

Facility ID:	0207201
Facility Type:	ER
Spill Number:	0207201
DER Facility ID:	116755
Site ID:	136034

PENN-WORTMAN HOUSES -NYCHA (Continued) **S102555812**

DEC Region:	2
Spill Number/Closed Date:	2008-06-10
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2002-10-11
Investigator:	jkkann
Referred To:	CONSOLIDATED WITH 9614567
Reported to Dept:	2002-10-11
CID:	205
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-10-11
Spill Record Last Update:	2008-06-10
Spiller Name:	Not reported
Spiller Company:	R MERRICK PIPING
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KOLLEENY THE MOBILE BOILER WITH THE LEAKY GAUGE WAS SITUATED ON AN AREA WITH GRASS AND EXPOSED EARTH, OUTSIDE BOILER ROOM. AFTER REMOVAL OF THE BOILER, AN AREA OF STAINED SOIL ABOUT 7 BY 10 FEET WAS REVEALED. ON APRIL 29, 2003, MARIC PIPING OF LONG ISLAND CITY (CONTRACTOR WHO INSTALLED THE MOBILE BOILER WITH FAULTY GAUGE) EXCAVATED CONTAMINATED SOIL, DIGGING OUT AN AREA ABOUT 12 FEET LONG, 8 FEET WIDE, AND FOUR FEET DEEP. PID SCREENDING OF EXCAVATION SIDEWALLS AND BOTTOM SUGGESTED SOME SUBSTANTIAL RESIDUAL CONTAMINATION REMAINS. FIVE END-POINT SAMPLES WERE TAKEN; DEPENDING ON LAB RESULTS, ADDITIONAL WORK MAY BE REQUIRED. - JK 11/04/05: This spill transferred from J.Kolleeny to S.Kraszewski. 07/07/06: NYCHA summary report states that no wells exist on-site. Soil/GW conditions unknown. NYCHA will provide a site assessment to the Department. - SK 02/06/07 - J.Kann - site reassigned from S. Kraszewski to J.Kann. 06/10/08: J.kann - site closed and consolidated with 9614567. "
Remarks:	"broken guage on mobile boiler. cleanup in progress."

All Materials:

Site ID:	136034
Operable Unit ID:	860032
Operable Unit:	01
Material ID:	517780
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

U112 **26TH WARD WWTP** **NY LTANKS** **S102239955**
ENE **122-66 FLATLANDS AVENUE** **NY CBS** **N/A**
1/4-1/2 **BROOKLYN, NY 11207** **NY Spills**
0.318 mi. **NY SPDES**
1677 ft. **Site 1 of 2 in cluster U**

Relative: **Lower**

Actual: **14 ft.**

LTANKS:

Facility ID:	9900503
Site ID:	221380
Spill Number/Closed Date:	2009-08-07
Spill Date:	1998-11-01
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JAKOLLEE
Referred To:	Not reported
Reported to Dept:	1999-04-14
CID:	384
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-04-14
Spill Record Last Update:	2009-08-07
Spiller Name:	Not reported
Spiller Company:	NYC DEPT OF ENV PROTECTIO
Spiller Address:	122-66 FLATLAND AV
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	270890
DEC Memo:	"6/12/2008 Cross ref to #9608289 TTF on Tank #10 06/13/08: Related spill case 9608289 (also for TTF of Tank #10 at this site) closed to consolidate with this spill case. - J. Kolleeny 08/07/09: USTs involved in this spill were removed in 2006; one end-point sample had some high levels of VOCs. Ryan Piper of Spill Response was at site, directed DEP to do addt'l work; they then took 14 addt'l soil samples and 2 GW grab samples (see data in eDocs). [For add'tl info regarding this site, including UST closure rpt, see spill no. 0610043, Ryan Piper, and spill no. 0509695, Sharif Rahman.] In 2008, Takcheun Chan of DEP contacted me about closure of this spill. I asked if any of addt'l 14 soil and/or 2 GW samples were collected near hot end-pt sample, and if any kind of remediation was done. On 8/6/09, Mr. Chan submitted documents via email showing that one of 14 soil samples (sample 3B) was near hot end-pt. sample (G2), but lab result showed much lower levels of VOCs; GW samples showed no significant impact to GW. Also, docs indicated that ORC advanced was applied to open excavation to enhance bioremediation of residual contamination. Mr. Chan's email, with my earlier email to him and all supporting documents are in eDocs. Based on submitted information, no further action is warranted and spill case is closed. - JK"
Remarks:	"caller stated he received a call from dec stating that they never

26TH WARD WWTP (Continued) **S102239955**

got a spill number for this failed tank test. caller is calling it in now per dec."

All TTF:

Facility ID:	9900503
Spill Number:	9900503
Spill Tank Test:	1547066
Site ID:	221380
Tank Number:	010
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	F
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	221380
Operable Unit ID:	1075276
Operable Unit:	01
Material ID:	307634
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9608289
Site ID:	282574
Spill Number/Closed Date:	2008-06-13
Spill Date:	1996-10-02
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JAKOLLEE
Referred To:	Not reported
Reported to Dept:	1996-10-03
CID:	297
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0

26TH WARD WWTP (Continued) **S102239955**

Date Entered In Computer:	1996-10-03
Spill Record Last Update:	2008-06-13
Spiller Name:	SUNIL MODI
Spiller Company:	CITY OF NEW YORK
Spiller Address:	WATER POLLUTION PLANT
Spiller County:	001
Spiller Contact:	SUNIL MODI
Spiller Phone:	(718) 595-4887
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	270890
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KOLLEENY PBS No. is 2-456489. - JK 9/27/05 06/13/08: Received Spill Closure Request dated 6/2/08 from Renee Wong of Roux Assoc. (in eDocs); letter report with attached PBS info notes that a second spill number, 9900503, was issued when the same 10,000-gallon heating oil UST failed another tightness test, so this older spill case should be closed. Also points out that tank was removed in September 2006. [See spill nos. 0509695 and 0610043 for further info regarding UST closure] I concur with Ms. Wong's recommendation; this spill case is closed to consolidate with open spill case 9900503. - J. Kolleeny"
Remarks:	""

All TTF:

Facility ID:	9608289
Spill Number:	9608289
Spill Tank Test:	1544789
Site ID:	282574
Tank Number:	010
Tank Size:	10000
Material:	0002
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	282574
Operable Unit ID:	1039322
Operable Unit:	01
Material ID:	344030
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

26TH WARD WWTP (Continued) **S102239955**

CBS:

CBS Number:	2-000234
Program Type:	CBS
Facility Status:	Active
Expiration Date:	10/22/2017
Dec Region:	2
UTMX:	594837.00000
UTMY:	4500582.00000

SPILLS:

Facility ID:	0514677
Facility Type:	ER
Spill Number:	0514677
DER Facility ID:	270890
Site ID:	361455
DEC Region:	2
Spill Number/Closed Date:	2006-03-23
Spill Cause:	Human Error
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2006-03-23
Investigator:	JBVOUGHT
Referred To:	Not reported
Reported to Dept:	2006-03-23
CID:	77
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-03-23
Spill Record Last Update:	2006-03-23
Spiller Name:	ANGELA METCER
Spiller Company:	QUALITY CARRIERS
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	ORTON,GUY
DEC Memo:	"03/23/06-Vought-Called Orton and spoke to Howard Hanson (718-642-7705) and no sewers or drains affected and spill on asphalt. Response team completed cleanup. Spill closed by Vought. "
Remarks:	"polymer in hose line, when driver disconnected polymer spilled onto ground. Quality Carriers making arrangements for clean-up."

All Materials:

Site ID:	361455
Operable Unit ID:	1119602
Operable Unit:	01
Material ID:	2109050
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	10.00

26TH WARD WWTP (Continued) **S102239955**

Units:	G
Recovered:	.00
Oxygenate:	Not reported
Facility ID:	0511970
Facility Type:	ER
Spill Number:	0511970
DER Facility ID:	270890
Site ID:	358220
DEC Region:	2
Spill Number/Closed Date:	2007-01-29
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	2401
Spill Date:	2006-01-18
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2006-01-18
CID:	74
Water Affected:	JAMAICA BAY
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-01-18
Spill Record Last Update:	2007-01-29
Spiller Name:	MR. MALATOS
Spiller Company:	26TH WARD WPCP
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	001
Contact Name:	MR. MALATOS
DEC Memo:	""
Remarks:	"Due to excessive rain Unable to pump 2 times dry weather flow - because of equipment out of service "

All Materials:

Site ID:	358220
Operable Unit ID:	1115471
Operable Unit:	01
Material ID:	2105538
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	.00
Oxygenate:	Not reported
Facility ID:	0803697
Facility Type:	ER
Spill Number:	0803697

26TH WARD WWTP (Continued) **S102239955**

DER Facility ID:	337784
Site ID:	400470
DEC Region:	2
Spill Number/Closed Date:	2008-06-30
Spill Cause:	Other
Spill Class:	D5
SWIS:	2401
Spill Date:	2008-06-28
Investigator:	vszhune
Referred To:	Not reported
Reported to Dept:	2008-06-28
CID:	78
Water Affected:	JAMACA BAY
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-06-29
Spill Record Last Update:	2008-06-30
Spiller Name:	Not reported
Spiller Company:	NYC DEP
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	HARRY MONCHIK
DEC Memo:	""
Remarks:	"Number 3 channel in opperable and heavy rain causing the noncompliance."

All Materials:

Site ID:	400470
Operable Unit ID:	1157294
Operable Unit:	01
Material ID:	2148315
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0803065
Facility Type:	ER
Spill Number:	0803065
DER Facility ID:	337784
Site ID:	399743
DEC Region:	2
Spill Number/Closed Date:	2008-06-16
Spill Cause:	Other
Spill Class:	C4
SWIS:	2401
Spill Date:	2008-06-14

26TH WARD WWTP (Continued) **S102239955**

Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	2008-06-14
CID:	78
Water Affected:	HENDRIX CREEK
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-06-16
Spill Record Last Update:	2008-06-16
Spiller Name:	Not reported
Spiller Company:	NYC DEP
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	JAMES DALY
DEC Memo:	"Referred to water division.(sr)"
Remarks:	"Ongoing. Caused by the rain."

All Materials:

Site ID:	399743
Operable Unit ID:	1156603
Operable Unit:	01
Material ID:	2147546
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0811430
Facility Type:	ER
Spill Number:	0811430
DER Facility ID:	337784
Site ID:	409006
DEC Region:	2
Spill Number/Closed Date:	2009-01-20
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	2401
Spill Date:	2009-01-17
Investigator:	smsanges
Referred To:	Not reported
Reported to Dept:	2009-01-17
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

26TH WARD WWTP (Continued) **S102239955**

Last Inspection:	Not reported
Recommended Penalty:	Not reported
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-01-17
Spill Record Last Update:	2009-01-20
Spiller Name:	Not reported
Spiller Company:	NYCDEP
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	ORTAN GUY
DEC Memo:	"Chlorine issue - forwarded to DEC Water Group"
Remarks:	"low chlorine res./ restored to normal at 1000hrs"

All Materials:

Site ID:	409006
Operable Unit ID:	1165512
Operable Unit:	01
Material ID:	2156923
Material Code:	0060A
Material Name:	wastewater
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	0406309
Facility Type:	ER
Spill Number:	0406309
DER Facility ID:	270890
Site ID:	188750
DEC Region:	2
Spill Number/Closed Date:	2004-10-27
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2004-09-09
Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	2004-09-09
CID:	73
Water Affected:	HENDRIX CREEK
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-09-09
Spill Record Last Update:	2005-07-07
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported

26TH WARD WWTP (Continued) **S102239955**

Spiller Company:	001
Contact Name:	MICHAEL ZARELLA
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was 10/27/04 TJD Referred to DOW."
Remarks:	"BYPASS DUE TO HEAVY RAIN. SPILL IS ONGOING."

All Materials:

Site ID:	188750
Operable Unit ID:	888935
Operable Unit:	01
Material ID:	487344
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	Not reported
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	1114313
Facility Type:	ER
Spill Number:	1114313
DER Facility ID:	337784
Site ID:	462363
DEC Region:	2
Spill Number/Closed Date:	2012-03-28
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2012-03-25
Investigator:	HRPATEL
Referred To:	Not reported
Reported to Dept:	2012-03-25
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-03-25
Spill Record Last Update:	2012-03-28
Spiller Name:	GREG REARDON
Spiller Company:	NYC DEP
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	999
Contact Name:	GREG REARDON
DEC Memo:	"03/26/12-Hiralkumar Patel. tried Greg's number, but no response and no voice mail setup. 03/28/12-Hiralkumar Patel. 3:03 PM:- spoke with Mark at plant. he mentioned that there was no petroleum spilled, but it is related to raw sewage. case closed. referred to water division."
	Not reported
Remarks:	"Caller reporting a hypo inturuption."

26TH WARD WWTP (Continued) **S102239955**

All Materials:

Site ID:	462363
Operable Unit ID:	1212436
Operable Unit:	01
Material ID:	2210312
Material Code:	9999
Material Name:	other - Hypo Interuption
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	1113879
Facility Type:	ER
Spill Number:	1113879
DER Facility ID:	337784
Site ID:	461903
DEC Region:	2
Spill Number/Closed Date:	2012-03-14
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2012-03-14
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	2012-03-14
CID:	Not reported
Water Affected:	JAMAICA BAY
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-03-14
Spill Record Last Update:	2012-03-14
Spiller Name:	TIM DELACE
Spiller Company:	NYC DEP
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	999
Contact Name:	TIM DELACE
DEC Memo:	"Referred to Water Division."
Remarks:	"Hypo-interruption fell below 0.05g/mL. End time is 0010. amount is unknown."

All Materials:

Site ID:	461903
Operable Unit ID:	1211975
Operable Unit:	01
Material ID:	2209814
Material Code:	0060A
Material Name:	wastewater

26TH WARD WWTP (Continued) **S102239955**

Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	1113762
Facility Type:	ER
Spill Number:	1113762
DER Facility ID:	337784
Site ID:	461774
DEC Region:	2
Spill Number/Closed Date:	2012-03-12
Spill Cause:	Other
Spill Class:	C4
SWIS:	2401
Spill Date:	2012-03-10
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	2012-03-10
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-03-10
Spill Record Last Update:	2012-03-12
Spiller Name:	Not reported
Spiller Company:	NYC DEP
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	LEONARD HARRIS
DEC Memo:	"No action needed from DEC."
Remarks:	"Caller advised pump failure and caused a chlorine interruption. residual seed has been restored."

All Materials:

Site ID:	461774
Operable Unit ID:	1211855
Operable Unit:	01
Material ID:	2209684
Material Code:	0027A
Material Name:	chlorine
Case No.:	07782505
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

26TH WARD WWTP (Continued) **S102239955**

Facility ID:	1202951
Facility Type:	ER
Spill Number:	1202951
DER Facility ID:	337784
Site ID:	465737
DEC Region:	2
Spill Number/Closed Date:	2015-02-06
Spill Cause:	Human Error
Spill Class:	C4
SWIS:	2401
Spill Date:	2012-06-25
Investigator:	RMPIPER
Referred To:	Not reported
Reported to Dept:	2012-06-25
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-06-25
Spill Record Last Update:	2015-02-06
Spiller Name:	Not reported
Spiller Company:	PLANT
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	JOE REDDINGTON
DEC Memo:	"Spill during delivery. Tank is inside a sealed vault and surrounded with pea gravel. 280 gal of oil was spilled into the pea gravel. Contractor (PTC ?) has been hired to suck out all the gravel and clean the vault. 7/19/12- DECPiper spoke with Joe Reddington. Work is progressing though they had to remove the tank. There is anotther tank in the vault which has to be shored off for stability. Once they reach clean gravel, they will call for inspection. 2/6/15- DEC Piper received and reviewed spill closre report. Based on work to date, this spill is closed. See dec docs for report. Closed. "
Remarks:	"PILLED TO CONTAINED GRAVEL, CLEANUP PENDING."

All Materials:

Site ID:	465737
Operable Unit ID:	1215752
Operable Unit:	01
Material ID:	2213894
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	280.00
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	0601596

26TH WARD WWTP (Continued) **S102239955**

Facility Type:	ER
Spill Number:	0601596
DER Facility ID:	270890
Site ID:	363869
DEC Region:	2
Spill Number/Closed Date:	2006-05-12
Spill Cause:	Equipment Failure
Spill Class:	D5
SWIS:	2401
Spill Date:	2006-05-12
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2006-05-12
CID:	77
Water Affected:	Not reported
Spill Source:	Major Facility (MOSF) > 400,000 gal
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-05-12
Spill Record Last Update:	2006-05-12
Spiller Name:	PETE VAVAS
Spiller Company:	WARDS ISLAND
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	001
Contact Name:	PETE VAVAS
DEC Memo:	"05/12/06-Vought-Off hours duty responder. Non-petroluem spill. Spill closed and referred to DEC Southwell."
Remarks:	"BYPASS- EQUIPMENT FAILURE DUE TO BAR SCREENS LOADED WITH DEBRY. NO SPILL"

All Materials:

Site ID:	363869
Operable Unit ID:	1121923
Operable Unit:	01
Material ID:	2111404
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0600273
Facility Type:	ER
Spill Number:	0600273
DER Facility ID:	270890
Site ID:	362244
DEC Region:	2
Spill Number/Closed Date:	2006-04-10
Spill Cause:	Equipment Failure

26TH WARD WWTP (Continued) **S102239955**

Spill Class:	C3
SWIS:	2401
Spill Date:	2006-04-08
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2006-04-08
CID:	74
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-04-08
Spill Record Last Update:	2006-04-10
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	JOSEPH GARIBALDI
DEC Memo:	""
Remarks:	"primary treatment tank is down and unable to pump 2 x design flow Due to heavy rain - had to throttle gates - sewage is backing up - not going into the Jamaica Bay yet "
Facility ID:	0600284
Facility Type:	ER
Spill Number:	0600284
DER Facility ID:	270890
Site ID:	362255
DEC Region:	2
Spill Number/Closed Date:	2006-04-10
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	2401
Spill Date:	2006-04-08
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2006-04-08
CID:	64
Water Affected:	JAMAICA BAY
Spill Source:	Major Facility (MOSF) > 400,000 gal
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-04-08
Spill Record Last Update:	2006-04-10
Spiller Name:	PETE NAVAS
Spiller Company:	26 WARD PLANT
Spiller Address:	122-66 FLATLANDS AVE

26TH WARD WWTP (Continued) **S102239955**

Spiller Company:	001
Contact Name:	PETE NAVAS
DEC Memo:	""
Remarks:	"Could not pump 2x normal flow due to equipment being out of service."
	Not reported

All Materials:

Site ID:	362255
Operable Unit ID:	1120357
Operable Unit:	01
Material ID:	2109852
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0900632
Facility Type:	ER
Spill Number:	0900632
DER Facility ID:	337784
Site ID:	412581
DEC Region:	2
Spill Number/Closed Date:	2009-06-04
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2009-04-16
Investigator:	RMPIPER
Referred To:	Not reported
Reported to Dept:	2009-04-16
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-04-16
Spill Record Last Update:	2009-06-04
Spiller Name:	Not reported
Spiller Company:	26TH WARD TREATMENT PLANT
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	FERRA
DEC Memo:	"Sangesland spoke to Fred Martin (building maint) He said there was a 10 gal spill of #2 oil to the interior of the boiler, some leaked out onto the basement floor. Cleanup was done - no drains. Boiler is being repaired. Fire Dept on site now (4/17 -10AM) to inspect boiler. Based on cleanup and work to date. no further action granted. Spill closed."

26TH WARD WWTP (Continued) **S102239955**

Remarks: "spill is contained, clean up underway"

All Materials:
Site ID: 412581
Operable Unit ID: 1169045
Operable Unit: 01
Material ID: 2160690
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 25.00
Units: G
Recovered: Not reported
Oxygenate: Not reported

Facility ID: 0900645
Facility Type: ER
Spill Number: 0900645
DER Facility ID: 337784
Site ID: 412595
DEC Region: 2
Spill Number/Closed Date: 2009-04-17
Spill Cause: Equipment Failure
Spill Class: C4
SWIS: 2401
Spill Date: 2009-04-16
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 2009-04-17
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: Not reported
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2009-04-17
Spill Record Last Update: 2009-04-20
Spiller Name: Not reported
Spiller Company: BOILER
Spiller Address: Not reported
Spiller Company: 999
Contact Name: FRED MARTIN
DEC Memo: "*** duplicate of 0900632 *** Sangesland spoke to Fred Martin (building maint) He said there was a 10 gal spill of #2 oil to the interior of the boiler, some leaked out onto the basement floor. Cleanup was done - no drains. Boiler is being repaired. Fire Dept on site now (4/17 -10AM) to inspect boiler."
Remarks: "Fuel oil spilled in lower level of bolier room. Clean up has been conducted."

All Materials:
Site ID: 412595

26TH WARD WWTP (Continued) **S102239955**

Operable Unit ID:	1169058
Operable Unit:	01
Material ID:	2160703
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	0301709
Facility Type:	ER
Spill Number:	0301709
DER Facility ID:	270890
Site ID:	206052
DEC Region:	2
Spill Number/Closed Date:	2003-05-19
Spill Cause:	Equipment Failure
Spill Class:	B6
SWIS:	2401
Spill Date:	2003-05-16
Investigator:	MXTIPPLE
Referred To:	Not reported
Reported to Dept:	2003-05-16
CID:	397
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-05-16
Spill Record Last Update:	2003-05-19
Spiller Name:	CALLER
Spiller Company:	NYC DEP
Spiller Address:	9605 HORACE HARDING EXWAY
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TIPPLE 05/19/03 - ROSSAN, DDO - THIS SPILL HAS BEEN REFEFFED TO THE DIVISION OF WATER. DISCUSSED WITH MICHELLE, WHO RECOMMENDS CLOSURE."
Remarks:	"leak in tank. all was contained and is going to be cleaned"

All Materials:

Site ID:	206052
Operable Unit ID:	869731
Operable Unit:	01
Material ID:	506197
Material Code:	0076A
Material Name:	ferric chloride
Case No.:	07705080
Material FA:	Hazardous Material

26TH WARD WWTP (Continued) **S102239955**

Quantity:	400.00
Units:	G
Recovered:	400.00
Oxygenate:	Not reported
Facility ID:	0302341
Facility Type:	ER
Spill Number:	0302341
DER Facility ID:	270890
Site ID:	206053
DEC Region:	2
Spill Number/Closed Date:	2003-06-13
Spill Cause:	Human Error
Spill Class:	C4
SWIS:	2401
Spill Date:	2003-06-04
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2003-06-04
CID:	282
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-06-04
Spill Record Last Update:	2003-06-13
Spiller Name:	SAME
Spiller Company:	NYC DEP PLANT
Spiller Address:	122-66 FLAT LANDS AVE
Spiller Company:	001
Contact Name:	CHRIS MALATOS
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND 6/13/2003 - DEP says the spill was cleaned up by an outside contractor on 6/9"
Remarks:	"A VALVE WAS LEFT OPEN ON A LOAD LINER.SPILL WENT ONTO CONCRETE SPILL WILL BE CLEANED UP TOMMOROW "

All Materials:

Site ID:	206053
Operable Unit ID:	870129
Operable Unit:	01
Material ID:	506824
Material Code:	0038E
Material Name:	white caustic
Case No.:	01310732
Material FA:	Hazardous Material
Quantity:	50.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

26TH WARD WWTP (Continued) **S102239955**

Facility ID:	0409864
Facility Type:	ER
Spill Number:	0409864
DER Facility ID:	270890
Site ID:	334678
DEC Region:	2
Spill Number/Closed Date:	2004-12-06
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	2401
Spill Date:	2004-12-03
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2004-12-03
CID:	409
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-12-03
Spill Record Last Update:	2004-12-27
Spiller Name:	MARK HAIMSON
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	MARK HAIMSON
DEC Memo:	"12/3/2004 Spill sheet forwarded to DEC-Water Group"
Remarks:	"SOIL WAS CONTAMINATED REPAIRING BROKEN LINE. IN THE PROCESS OF BEING CLEANED UP."

All Materials:

Site ID:	334678
Operable Unit ID:	1096802
Operable Unit:	01
Material ID:	576675
Material Code:	0124A
Material Name:	sodium hypochlorite
Case No.:	07681529
Material FA:	Hazardous Material
Quantity:	30.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0106554
Facility Type:	ER
Spill Number:	0106554
DER Facility ID:	270890
Site ID:	171691
DEC Region:	2
Spill Number/Closed Date:	2001-10-02
Spill Cause:	Unknown

26TH WARD WWTP (Continued) **S102239955**

Spill Class:	C4
SWIS:	2401
Spill Date:	2001-09-23
Investigator:	MXTIPPLE
Referred To:	Not reported
Reported to Dept:	2001-09-23
CID:	246
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Federal Government
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2001-09-23
Spill Record Last Update:	2005-06-24
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TIPPLE WATER WAS AWARE OF THE SCHEDULED REPAIRS/ REFERRED TO WATER"
Remarks:	"planned shutdown of water treatment plan for repairs"
Facility ID:	9601988
Facility Type:	ER
Spill Number:	9601988
DER Facility ID:	270890
Site ID:	171692
DEC Region:	2
Spill Number/Closed Date:	2001-12-10
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	2401
Spill Date:	1996-05-09
Investigator:	JAKOLLEE
Referred To:	Not reported
Reported to Dept:	1996-05-09
CID:	233
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-05-09
Spill Record Last Update:	2004-12-27
Spiller Name:	WALTER BROWICZ
Spiller Company:	NYC WATER AUTH
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	001

26TH WARD WWTP (Continued) **S102239955**

Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KOLLEENY SITE INVESTIGATION FOLLOWING TANK CLOSURE FOUND NO SIGNIFICANT SOIL CONTAMINATION IN AREA OF GASOLINE UST, LOW LEVELS MTBE IN ONE MONITORING WELL. OVER SEVERAL MONITORING EVENTS, MTBE LEVEL HAS DECREASED BUT NOT DISAPPEARED. HOWEVER, LEVEL OF MTBE (15 MICROGRAMS PER LITER), WHILE EXCEEDING TOGS GROUNDWATER STANDARD FOR THAT COMPOUND, DOES NOT WARRANT FURTHER INVESTIGATIVE OR REMEDIAL ACTION, OR CONTINUED GW MONITORING."
Remarks:	"SOIL SAMPLES RETURNED TODAY, SHOW CONTAMINATION. GROUNDWATER SHOWS CLEAR."

All Materials:

Site ID:	171692
Operable Unit ID:	1033553
Operable Unit:	01
Material ID:	351783
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9814336
Facility Type:	ER
Spill Number:	9814336
DER Facility ID:	270890
Site ID:	171693
DEC Region:	2
Spill Number/Closed Date:	2005-04-29
Spill Cause:	Equipment Failure
Spill Class:	D3
SWIS:	2401
Spill Date:	1999-03-01
Investigator:	JXZHAO
Referred To:	Not reported
Reported to Dept:	1999-03-01
CID:	257
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-03-01
Spill Record Last Update:	2005-04-29
Spiller Name:	BO BODNIEWICZ
Spiller Company:	26TH WADE TREATMENT PLANT
Spiller Address:	122-66 FLATLANDS AVE
Spiller Company:	001
Contact Name:	BO BODNIEWICZ

26TH WARD WWTP (Continued) **S102239955**

DEC Memo: ""
Remarks: "IN A CONTAINMENT AREA CLEANUP COMPANY ON THE WAY - PRODUCT IS A LIME SLURRY"

All Materials:
Site ID: 171693
Operable Unit ID: 1075371
Operable Unit: 01
Material ID: 557952
Material Code: 0064A
Material Name: unknown material
Case No.: Not reported
Material FA: Other
Quantity: 1200.00
Units: G
Recovered: .00
Oxygenate: Not reported

SPDES:

Permit Number: NY0026212
State-Region: 02
Expiration Date: 10/31/2020
Current Major Minor Status: Major
Primary Facility SIC Code: Not reported
State Water Body Name: HENDRIX ST C
Limit Set Status Flag: Active
Total Actual Average Flow(MGD): Not reported
Total App Design Flow(MGD): 85
UDF1: Not reported
Lat/Long: 40.650639 / -73.87825
DMR Cognizant Official: THERESA NORRIS, PE
UDF2: 001701
UDF3: I
FIPS County Code: NY047

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address
Non-Gov Permit Org Formal Name: NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address: NYCDEP - 26TH WARD WPCP
Non-Gov Permit Supplemental Location: 59 -17 JUNCTION BLVD
Non-Gov Permit City: CORONA
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 11368
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: NYC DEPT OF ENVIR PORTECTION
Non-Gov Facility Street Address: NYCDEP - 26TH WARD WPCP
Non-Gov Facility Supplemental Location: 122-66 FLATLANDS AVENUE
Non-Gov Facility City: BROOKLYN
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 11207
State Water Body: 02030202010

UDF2: 001701
UDF3: I
FIPS County Code: NY047

26TH WARD WWTP (Continued) **S102239955**

Non-Gov Permit Affiliation Type Desc:	DMR Mailing Address
Non-Gov Permit Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address:	NYCDEP - 26TH WARD WPCP
Non-Gov Permit Supplemental Location:	59 -17 JUNCTION BLVD
Non-Gov Permit City:	CORONA
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11368
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address:	NYCDEP - 26TH WARD WPCP
Non-Gov Facility Supplemental Location:	59- 17 JUNCTION BLVD
Non-Gov Facility City:	CORONA
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	11368
State Water Body:	02030202010
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address:	59- 17 JUNCTION BLVD
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	CORONA
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11368
Non-Gov Facility Affiliation Type Desc:	Mailing Address
Non-Gov Facility Org Formal Name:	NYC DEPT OF ENVIR PORTECTION
Non-Gov Facility Street Address:	NYCDEP - 26TH WARD WPCP
Non-Gov Facility Supplemental Location:	122-66 FLATLANDS AVENUE
Non-Gov Facility City:	BROOKLYN
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	11207
State Water Body:	02030202010
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Permit Street Address:	59- 17 JUNCTION BLVD
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	CORONA
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11368
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address:	NYCDEP - 26TH WARD WPCP
Non-Gov Facility Supplemental Location:	59- 17 JUNCTION BLVD
Non-Gov Facility City:	CORONA
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	11368
State Water Body:	02030202010

U113 **26TH WARD WPCP** **NY LTANKS** **S105135339**
ENE **12266 FLATLANDS AVENUE** **NY Spills** **N/A**
1/4-1/2 **BROOKLYN, NY 11207** **NY SPDES**
0.318 mi.
1677 ft. **Site 2 of 2 in cluster U**

Relative:
Lower

Actual:
14 ft.

LTANKS:

Facility ID:	0105192
Site ID:	144547
Spill Number/Closed Date:	2003-07-21
Spill Date:	2001-08-13
Spill Cause:	Tank Overfill
Spill Source:	Unknown
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	2001-08-13
CID:	252
Water Affected:	Not reported
Spill Notifier:	Local Agency
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2001-08-13
Spill Record Last Update:	2003-07-21
Spiller Name:	UNKNOWN
Spiller Company:	Unknown
Spiller Address:	UNKNOWN
Spiller County:	999
Spiller Contact:	CHERELLE MAYFIELD
Spiller Phone:	(718) 595-6777
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	123189
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEMEO 7/21/03 TJD Spill contained and cleaned using absorbents. No further action required."
Remarks:	"SPILL HAS OCCURED IN PARKING LOT AREA OF THE 26TH WARD PLANT WHICH WAS CAUSED BY AN OVERFLOW IN TANK "

All Materials:

Site ID:	144547
Operable Unit ID:	842107
Operable Unit:	01
Material ID:	533669
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0607689

26TH WARD WPCP (Continued) **S105135339**

Site ID:	371493
Spill Number/Closed Date:	2007-05-08
Spill Date:	2006-10-05
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	BKFALVEY
Referred To:	Not reported
Reported to Dept:	2006-10-05
CID:	406
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2006-10-05
Spill Record Last Update:	2007-05-08
Spiller Name:	LAWRENCE ANDERSON
Spiller Company:	WATER TREATMENT PLANT
Spiller Address:	12266 FLATLANDS AVE
Spiller County:	001
Spiller Contact:	LAWRENCE ANDERSON
Spiller Phone:	(718) 652-0200
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	20093
DEC Memo:	"10/6/06 sent ttf letter to: Michael Quinn, Director, Facilities Engineering NYCDEP Bureau of Wastewater 96-05 Horace Harding Expressway Corona, NY 11368 bf 10/25/06 received response to 10/6/06 letter from Jerry Fragias, Chief, Div. of Facilities Planning. Will isolate, excavate, and retest. If any questions, contact Ioannis Iliopoulis (718)595-4845. bf 3/8/07 On 2/22/07, received letter from Tak Cheun Chin, Environmental Engineer Intern, NYCDEP. Letter contains tank tightness test reports for test on 2/8/07 and requests closing of spill. Called Mr. Chan and requested a third party letter explaining what happened. Mr. Chan told me manhole cover was loose causing failure. Cover fitting was tightened and then tank passed. He said he will get letter and send to me. Action Environmental did the repair work. bf 4/4/07 received call from Mr. Chin on 4/3 re:letter response regarding failure. Called him back today. letter was sent certified mail. Could not find. He will email the packege as a pdf file to me today. bf 4/9/07 reviewed letter from Mr. Chin. Tank tested and passed. Manway need new bolts and gasket. No mention of contaminated soil found or not found. Sent email to Mr. Chan requesting a third party letter regarding soil contamination. bf 4/27/07 Received call from Mr. Chin. He will email a copy of leeter from contractor regarding soil contamination. bf 5/7/07 Received phots by email from mr. Chan showing manholes which can be inspected for no petroleumn contamination. NFA. bf"
Remarks:	"Ullage failure. Manway covers are not bolted down properly . Caller can hear air coming from there."

All TTF:

Facility ID:	0607689

26TH WARD WPCP (Continued) **S105135339**

Spill Number:	0607689
Spill Tank Test:	1550334
Site ID:	371493
Tank Number:	1
Tank Size:	30000
Material:	0003
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified Date:	Not reported

All Materials:

Site ID:	371493
Operable Unit ID:	1129252
Operable Unit:	01
Material ID:	2118909
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	0514684
Facility Type:	ER
Spill Number:	0514684
DER Facility ID:	123189
Site ID:	361464
DEC Region:	2
Spill Number/Closed Date:	2006-03-23
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2006-03-23
Investigator:	JBVOUGHT
Referred To:	Not reported
Reported to Dept:	2006-03-23
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False

26TH WARD WPCP (Continued) **S105135339**

Remediation Phase:	0
Date Entered In Computer:	2006-03-23
Spill Record Last Update:	2006-03-23
Spiller Name:	STANLEY BALDWIN
Spiller Company:	SEWER TREATMENT PLANT
Spiller Address:	12266 FLATLANDS AVE
Spiller Company:	001
Contact Name:	STANLEY BALDWIN
DEC Memo:	"3/23/06-Vought-This spill closed by Vought and referred to closed spill #0514677 at same location and time."
Remarks:	"CALLER STATES THAT 'PALAMAR' WAS SPILLED AND BEING CLEANED UP:"
Facility ID:	0810449
Facility Type:	ER
Spill Number:	0810449
DER Facility ID:	123189
Site ID:	407969
DEC Region:	2
Spill Number/Closed Date:	2009-08-25
Spill Cause:	Other
Spill Class:	D5
SWIS:	2401
Spill Date:	2008-12-17
Investigator:	smsanges
Referred To:	Not reported
Reported to Dept:	2008-12-17
CID:	Not reported
Water Affected:	HENDRIX CREEK
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2008-12-17
Spill Record Last Update:	2009-08-25
Spiller Name:	Not reported
Spiller Company:	WATERSFORD CONTROL PLANT
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	JIM DALY
DEC Memo:	""
Remarks:	"unknown volume at this time/ discharge continuing / weather related"

All Materials:

Site ID:	407969
Operable Unit ID:	1164502
Operable Unit:	01
Material ID:	2155881
Material Code:	0060A
Material Name:	wastewater
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported

26TH WARD WPCP (Continued) **S105135339**

Oxygenate: Not reported

Facility ID: 0809162
Facility Type: ER
Spill Number: 0809162
DER Facility ID: 123189
Site ID: 406605
DEC Region: 2
Spill Number/Closed Date: 2008-11-18
Spill Cause: Equipment Failure
Spill Class: D5
SWIS: 2401
Spill Date: 2008-11-13
Investigator: smsanges
Referred To: Not reported
Reported to Dept: 2008-11-13
CID: Not reported
Water Affected: JAMAICA BAY
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2008-11-13
Spill Record Last Update: 2008-11-18
Spiller Name: KEVIN GRANT
Spiller Company: POLUTION CONTROL
Spiller Address: 12266 FLATLANDS AVE
Spiller Company: 999
Contact Name: KEVIN GRANT
DEC Memo: ""
Remarks: "An overflow due to rain, ongoing."

All Materials:
Site ID: 406605
Operable Unit ID: 1163185
Operable Unit: 01
Material ID: 2154494
Material Code: 0062A
Material Name: raw sewage
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Facility ID: 1200359
Facility Type: ER
Spill Number: 1200359
DER Facility ID: 123189
Site ID: 462986
DEC Region: 2

26TH WARD WPCP (Continued) **S105135339**

Spill Number/Closed Date:	2012-09-24
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2012-04-12
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2012-04-12
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-04-12
Spill Record Last Update:	2012-09-24
Spiller Name:	EDDIE WRIGHT
Spiller Company:	NYCDEP
Spiller Address:	12266 FLATLANDS AVE
Spiller Company:	999
Contact Name:	EDDIE WRIGHT
DEC Memo:	"minor spill - cleanup complete"
Remarks:	"Spilled onto concrete & soil. Cleanup is on going."

All Materials:

Site ID:	462986
Operable Unit ID:	1213088
Operable Unit:	01
Material ID:	2210997
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.50
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	0509695
Facility Type:	ER
Spill Number:	0509695
DER Facility ID:	123189
Site ID:	355502
DEC Region:	2
Spill Number/Closed Date:	2007-02-15
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	2401
Spill Date:	2005-11-13
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	2005-11-13
CID:	41

26TH WARD WPCP (Continued) **S105135339**

Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2005-11-13
Spill Record Last Update:	2007-02-15
Spiller Name:	Not reported
Spiller Company:	UNDERGROUND FUEL OIL
Spiller Address:	12266 FLATLANDS AVE
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"need to send CSL to DEP PBS #2-456489 Nov 25, 2005 A Contaminated Soil Letter was sent to: Mr. Gopalakrishnan NYC-DEP Bureau of Watewater 96-05 Horace Harding Expressway Corona, NY 11368 03/06/06 Sharif Rahman- I spoke with Harold Monchik who was the spill caller from DEP. He told me the spill was cleaned up and the line was repaired but he does n't have much information about who did the work/any paper work. He suggested me to contact Paul Adams or Toma, Senior Stationary Engineers@718-642-7705. They are out on field right at this moment. Need to call back later.Later on today, I called again and left messege to Frank Sebastiano. 07/20/06 Rahman- I spoke with Maria Duran@212.860.9315/9350 who works under Joe Reddington of safety division. She will look into it and send DEC the available paper works for review. 08/11/06 Rahman- Spill ocurred due to leak on return line while doing soil borings.Approx. 800 gallons of #4 oil spilled on the ground through the damaged pipe.The spill was confined to the area above the buried encasement.There are no adjacent waterways.A total of 769 tons of oil water mixture were vacuumed to a vac truck and 59 tons of petroleum contaminated soil was removed in the vicinity of the fuel oil supply line to a depth of approx. 10 ft below the grade.One composite end point sample was taken from four locations at 15 ft spacing in the area of the spill.Soil analyticals are non detect for voc and there are slight exceedances for SVOC which do not warranty further remediation.Waste disposal manifest are attached.NFA required. 11/30/2006 Rep from Engineering firm (who?) called to say that they have rediscovered another problem at the site. The prior problem was limited to the fill line. Now they are removing the tank and the area under the old tank is heavily contaminated. They want to install a new tank vault and tank system. They need to come up with a plan as soon as possible to deal withthis problem. The rep will contact Sharif Rahman within next 1-2 days. ****Sangesland reopened this spill.**** Jerry Fragias@(718)595-4968 is the contact at DEP. Spill#0610043 was assigned as tanks were being removed.Hence, spill #0509695 is closed."
Remarks:	"BROKEN LINE ON RETURN LINE"

All Materials:

Site ID:	355502
Operable Unit ID:	1112862
Operable Unit:	01
Material ID:	2102902
Material Code:	0002A
Material Name:	#4 fuel oil

26TH WARD WPCP (Continued) **S105135339**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPDES:

Permit Number:	NY0267678
State-Region:	02
Expiration Date:	12/01/2010
Current Major Minor Status:	Minor
Primary Facility SIC Code:	Not reported
State Water Body Name:	HENDRIX CK
Limit Set Status Flag:	Active
Total Actual Average Flow(MGD):	Not reported
Total App Design Flow(MGD):	Not reported
UDF1:	Not reported
Lat/Long:	40.650556 / -73.874444
DMR Cognizant Official:	THOMAS WALSH, ENGINEER
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	DMR Mailing Address
Non-Gov Permit Org Formal Name:	THOMAS WALSH
Non-Gov Permit Street Address:	26TH WARD WPCP
Non-Gov Permit Supplemental Location:	12266 FLATLANDS AVENUE
Non-Gov Permit City:	BROOKLYN
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11207
Non-Gov Facility Affiliation Type Desc:	Mailing Address
Non-Gov Facility Org Formal Name:	26TH WARD WPCP
Non-Gov Facility Street Address:	26TH WARD WPCP
Non-Gov Facility Supplemental Location:	12266 FLATLANDS AVENUE
Non-Gov Facility City:	BROOKLYN
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	11207
State Water Body:	02030202010
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	DMR Mailing Address
Non-Gov Permit Org Formal Name:	THOMAS WALSH
Non-Gov Permit Street Address:	26TH WARD WPCP
Non-Gov Permit Supplemental Location:	12266 FLATLANDS AVENUE
Non-Gov Permit City:	BROOKLYN
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11207
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address:	26TH WARD WPCP
Non-Gov Facility Supplemental Location:	96-05 HORACE HARDING EXP, 5FL

26TH WARD WPCP (Continued) **S105135339**

Non-Gov Facility City:	CORONA
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	113685107
State Water Body:	02030202010
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	NYC DEP
Non-Gov Permit Street Address:	96-05 HORACE HARDING EXP - 5TH FL
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	CORONA
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11368-5107
Non-Gov Facility Affiliation Type Desc:	Mailing Address
Non-Gov Facility Org Formal Name:	26TH WARD WPCP
Non-Gov Facility Street Address:	26TH WARD WPCP
Non-Gov Facility Supplemental Location:	12266 FLATLANDS AVENUE
Non-Gov Facility City:	BROOKLYN
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	11207
State Water Body:	02030202010
UDF2:	001701
UDF3:	I
FIPS County Code:	NY047
Non-Gov Permit Affiliation Type Desc:	Permittee
Non-Gov Permit Org Formal Name:	NYC DEP
Non-Gov Permit Street Address:	96-05 HORACE HARDING EXP - 5TH FL
Non-Gov Permit Supplemental Location:	Not reported
Non-Gov Permit City:	CORONA
Non-Gov Permit State Code:	NY
Non-Gov Permit Zip Code:	11368-5107
Non-Gov Facility Affiliation Type Desc:	Owner
Non-Gov Facility Org Formal Name:	NYC DEPT OF ENVIR PROTECTION
Non-Gov Facility Street Address:	26TH WARD WPCP
Non-Gov Facility Supplemental Location:	96-05 HORACE HARDING EXP, 5FL
Non-Gov Facility City:	CORONA
Non-Gov Facility State Code:	NY
Non-Gov Facility Zip Code:	113685107
State Water Body:	02030202010

V114 **BREUKELEN HOUSES** **NY LTANKS** **U001840686**
WNW **618 EAST 108TH STREET** **NY UST** **N/A**
1/4-1/2 **BROOKLYN, NY 11236** **NY Spills**
0.323 mi.
1703 ft. **Site 1 of 2 in cluster V**

Relative:
Lower

Actual:
9 ft.

LTANKS:

Facility ID:	9306985
Site ID:	271198
Spill Number/Closed Date:	1996-07-08
Spill Date:	1993-09-08
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	C3

BREUKELEN HOUSES (Continued) **U001840686**

Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JANE HEALY
Referred To:	Not reported
Reported to Dept:	1993-09-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1993-09-08
Spill Record Last Update:	2005-12-07
Spiller Name:	Not reported
Spiller Company:	NYCHA
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	95814
DEC Memo:	""
Remarks:	"EMPTY OUT - CHECK TO SEE IF LEAKING."

All TTF:

Facility ID:	9306985
Spill Number:	9306985
Spill Tank Test:	1541971
Site ID:	271198
Tank Number:	002
Tank Size:	0
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	271198
Operable Unit ID:	985257
Operable Unit:	01
Material ID:	393267
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L

BREUKELEN HOUSES (Continued) **U001840686**

Recovered:	.00
Oxygenate:	Not reported
Facility ID:	9315459
Site ID:	271199
Spill Number/Closed Date:	1996-07-08
Spill Date:	1991-01-15
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	HEALY
Referred To:	Not reported
Reported to Dept:	1994-03-30
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	DEC
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1994-04-05
Spill Record Last Update:	2005-12-07
Spiller Name:	Not reported
Spiller Company:	NYCHA - JOE MONTELLA
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	95814
DEC Memo:	""
Remarks:	"LEAK RATE OF 0.09 GPH - REPORTED AS PASSED BY TESTER."

All TTF:

Facility ID:	9315459
Spill Number:	9315459
Spill Tank Test:	1542564
Site ID:	271199
Tank Number:	001
Tank Size:	0
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

BREUKELEN HOUSES (Continued) **U001840686**

All Materials:

Site ID:	271199
Operable Unit ID:	993565
Operable Unit:	01
Material ID:	387211
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9406297
Site ID:	271200
Spill Number/Closed Date:	1994-08-26
Spill Date:	1994-08-09
Spill Cause:	Tank Overfill
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	1994-08-26
SWIS:	2401
Investigator:	HEALY
Referred To:	Not reported
Reported to Dept:	1994-08-09
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1994-08-09
Spill Record Last Update:	2005-12-07
Spiller Name:	Not reported
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	95814
DEC Memo:	""
Remarks:	"SPILL CONTAINED IN TANK #1 VAULT - WINSTON ENROUTE - TO PUMP OUT. MANHOLE COVER LEFT OFF TANK IN VAULT AREA."

All TTF:

Facility ID:	9406297
Spill Number:	9406297
Spill Tank Test:	1543022
Site ID:	271200
Tank Number:	Not reported
Tank Size:	0

BREUKELEN HOUSES (Continued) **U001840686**

Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	02
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	271200
Operable Unit ID:	1003660
Operable Unit:	01
Material ID:	379346
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	90.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9107005
Site ID:	304293
Spill Number/Closed Date:	1995-11-03
Spill Date:	1991-09-30
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	HEALY
Referred To:	Not reported
Reported to Dept:	1991-09-30
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1991-10-03
Spill Record Last Update:	2005-12-07
Spiller Name:	FRANK OCELLO
Spiller Company:	NYCHA
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2

BREUKELEN HOUSES (Continued) **U001840686**

DER Facility ID: 95814
DEC Memo: ""
Remarks: "E, I & R"

All TTF:
Facility ID: 9107005
Spill Number: 9107005
Spill Tank Test: 1539113
Site ID: 304293
Tank Number: 002
Tank Size: 35000
Material: Not reported
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 03
Test Method 2: Horner EZ Check I or II
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

Facility ID: 9107005
Spill Number: 9107005
Spill Tank Test: 1539114
Site ID: 304293
Tank Number: 003
Tank Size: 35000
Material: Not reported
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 03
Test Method 2: Horner EZ Check I or II
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 304293
Operable Unit ID: 957350
Operable Unit: 01
Material ID: 419241
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: G
Recovered: .00
Oxygenate: Not reported

BREUKELEN HOUSES (Continued) **U001840686**

UST:

Id/Status:	2-473855 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	03/28/2019
UTM X:	593378.97480
UTM Y:	4500614.67727
Site Type:	Apartment Building/Office Building

Affiliation Records:

Site Id:	20859
Affiliation Type:	Facility Operator
Company Name:	BREUKELEN HOUSES
Contact Type:	Not reported
Contact Name:	FUEL OIL REMEDIATION UNIT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 707-5725
EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2014-02-24

Site Id:	20859
Affiliation Type:	Mail Contact
Company Name:	NYC HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	FUEL OIL REMEDIATION COORDINATOR
Address1:	23-02 49TH AVENUE
Address2:	TECH SERVS DEPT - 5TH FLOOR
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 707-5725
EMail:	YELENA.TKACH@NYCHA.NYC.GOV
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2015-08-14

Site Id:	20859
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY HOUSING AUTHORITY
Contact Type:	Not reported
Contact Name:	EMERGENCY SERVICES DEPARTMENT
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(718) 707-5900

BREUKELEN HOUSES (Continued) **U001840686**

EMail:	Not reported
Fax Number:	Not reported
Modified By:	NRLOMBAR
Date Last Modified:	2014-01-30

Site Id:	20859
Affiliation Type:	Facility Owner
Company Name:	NEW YORK CITY HOUSING AUTHORITY
Contact Type:	FUEL OIL REMEDIATION COORDINATOR
Contact Name:	Not reported
Address1:	23-02 49TH AVENUE
Address2:	Not reported
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 707-5806
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MXLAY
Date Last Modified:	2017-03-10

Tank Info:

Tank Number:	1
Tank ID:	55499
Tank Status:	In Service
Material Name:	In Service
Capacity Gallons:	25000
Install Date:	06/01/1998
Date Tank Closed:	Not reported
Registered:	True
Tank Location:	Underground
Tank Type:	Fiberglass coated steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)

Tightness Test Method:	NN
Date Test:	Not reported
Next Test Date:	Not reported
Pipe Model:	E
Modified By:	NRLOMBAR
Last Modified:	04/14/2017

Equipment Records:

C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
E04 - Piping Secondary Containment - Double walled UG
B04 - Tank External Protection - Fiberglass
I02 - Overfill - High Level Alarm
L09 - Piping Leak Detection - Exempt Suction Piping
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
I03 - Overfill - Automatic Shut-Off
K00 - Spill Prevention - None
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)

BREUKELEN HOUSES (Continued) **U001840686**

H05 - Tank Leak Detection - In-Tank System (ATG)
F05 - Pipe External Protection - Jacketed

Tank Number: 2
Tank ID: 55500
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 25000
Install Date: 06/01/1998
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: E
Modified By: NRLOMBAR
Last Modified: 04/14/2017

Equipment Records:

I02 - Overfill - High Level Alarm
L09 - Piping Leak Detection - Exempt Suction Piping
B04 - Tank External Protection - Fiberglass
F05 - Pipe External Protection - Jacketed
I03 - Overfill - Automatic Shut-Off
K00 - Spill Prevention - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
A00 - Tank Internal Protection - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
E04 - Piping Secondary Containment - Double walled UG
H05 - Tank Leak Detection - In-Tank System (ATG)
D11 - Pipe Type - Flexible Piping
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: OLD 1
Tank ID: 37609
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 35000
Install Date: Not reported
Date Tank Closed: 04/01/1998
Registered: True
Tank Location: Underground
Tank Type: Z
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 02/01/1995
Next Test Date: Not reported
Pipe Model: Not reported

BREUKELEN HOUSES (Continued) **U001840686**

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
F06 - Pipe External Protection - Wrapped
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None

Tank Number: OLD 2
Tank ID: 37610
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 35000
Install Date: Not reported
Date Tank Closed: 04/01/1998
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

I04 - Overfill - Product Level Gauge (A/G)
A04 - Tank Internal Protection - Glass Liner
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
B04 - Tank External Protection - Fiberglass
D08 - Pipe Type - Equivalent Technology
I02 - Overfill - High Level Alarm
F99 - Pipe External Protection - Other
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: OLD 3
Tank ID: 37611
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 35000
Install Date: 10/01/1952
Date Tank Closed: 04/01/1998
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel

BREUKELEN HOUSES (Continued) **U001840686**

Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 06/01/1995
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
C02 - Pipe Location - Underground/On-ground
F06 - Pipe External Protection - Wrapped
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

SPILLS:

Facility ID: 9713569
Facility Type: ER
Spill Number: 9713569
DER Facility ID: 95814
Site ID: 109037
DEC Region: 2
Spill Number/Closed Date: Not reported
Spill Cause: Unknown
Spill Class: B3
SWIS: 2401
Spill Date: 1998-03-06
Investigator: AAOBLIGA
Referred To: Not reported
Reported to Dept: 1998-03-06
CID: 312
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 1
Date Entered In Computer: 1998-03-06
Spill Record Last Update: 2017-06-05
Spiller Name: Not reported
Spiller Company: NYC HOUSING AUTHORITY
Spiller Address: 250 BROADWAY
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "12/07/05: This spill transferred from J.Kolleeny to S.Kraszewski. 03/23/06: This spill transferred to K.Tang - SK 08/04/08: J.kann - Spill transferred to J.Kann. Investigative work plan received on 7/29/08. 06/15/09: J.Kann - Investigation Report submitted on

BREUKELEN HOUSES (Continued) **U001840686**

6/10/09. Work performed without DEC approval of work plan. 5/25/12: J.kann - briefly scanned report and noticed NYCHA requests closure. Therefore, I identified the site as a P1. 06/105/17: J.Kann - after file review, some shallow contamination needs to be removed as per the SIR submitted in 2009 prior to closure. NYCHA was informed of that in the 2/14/17 meeting (see notes). Spill reassigned to Andre Obligado."

Remarks: "DURING TANK REMOVAL - CONTAMINATED SOIL FOUND - SOIL BEING STOCKPILED - CONTRACTOR IS AQUA X"

All Materials:

Site ID:	109037
Operable Unit ID:	1059532
Operable Unit:	01
Material ID:	324578
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Site ID:	109037
Operable Unit ID:	1059532
Operable Unit:	01
Material ID:	324579
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9814335
Facility Type:	ER
Spill Number:	9814335
DER Facility ID:	95814
Site ID:	109038
DEC Region:	2
Spill Number/Closed Date:	2007-06-14
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	2401
Spill Date:	1999-03-01
Investigator:	jkkann
Referred To:	CLOSED PER NYCHA INFO
Reported to Dept:	1999-03-01
CID:	257
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

BREUKELEN HOUSES (Continued) **U001840686**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-03-01
Spill Record Last Update:	2007-06-14
Spiller Name:	Not reported
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	250 BROADWAY
Spiller Company:	001
Contact Name:	MARIO MANDALONE
DEC Memo:	"11/30/05: This spill transferred from J.Kolleeny to S.Kraszewski. 02/03/06: This spill transferred from S.Kraszewski to Q.Abidi. 04/04/04: This spill transferred from Q. Abidi to Koon Tang. 06/14/07: This spill was transferred from K. Tang to J.Kann. Information provided by NYCHA indicates that spill was limited to concrete floor and area was properly cleaned. Spill was closed."
Remarks:	"VALUE FAILED ON REFILL OF TANK #1 "

All Materials:

Site ID:	109038
Operable Unit ID:	1075369
Operable Unit:	01
Material ID:	311031
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	G
Recovered:	50.00
Oxygenate:	Not reported

W115 **STANITA SERVICE CORP - VACANT LOT** **NY LTANKS** **1001961664**
NNW **LINDEN BLVD & ELTON ST NE COR** **NY CBS** **NYR000084780**
1/4-1/2 **BROOKLYN, NY 11207** **NY Spills**
0.332 mi. **RCRA NonGen / NLR**
1754 ft. **Site 1 of 2 in cluster W** **NY MANIFEST**

Relative:
Lower

Actual:
12 ft.

LTANKS:

Facility ID:	9412264
Site ID:	221098
Spill Number/Closed Date:	2004-08-18
Spill Date:	1994-12-12
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMROMMEL
Referred To:	Not reported
Reported to Dept:	1994-12-13
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1995-01-30
Spill Record Last Update:	2004-08-18
Spiller Name:	Not reported
Spiller Company:	SUNNYDALE FARMS
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	182858
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ROMMEL This spill was transferred from DEC Sigona to Rommel on 2/2/04. See also 9210189 closed and referenced to 0404235. Rommel."
Remarks:	"EX & INVEST SUSPECT REMOTE FILL- NYCFD WAS AT SITE"

All TTF:

Facility ID:	9412264
Spill Number:	9412264
Spill Tank Test:	1543449
Site ID:	221098
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	221098
Operable Unit ID:	1005979
Operable Unit:	01
Material ID:	374589
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9516361
Site ID:	221099
Spill Number/Closed Date:	1996-03-20
Spill Date:	1996-03-20

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1996-03-20
CID:	266
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1996-03-20
Spill Record Last Update:	1996-04-01
Spiller Name:	Not reported
Spiller Company:	SUNNYDALE FARMS
Spiller Address:	400 STANLEY AVENUE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	(718) 257-7618
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	182858
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD "
Remarks:	"CUSTOMER ORDERED TOO MUCH OIL. ONTO CONCRETE. CLEANED UP."

All Materials:

Site ID:	221099
Operable Unit ID:	1030958
Operable Unit:	01
Material ID:	352876
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	G
Recovered:	2.00
Oxygenate:	Not reported

Facility ID:	0404235
Site ID:	311784
Spill Number/Closed Date:	2006-09-07
Spill Date:	2004-07-20
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SXSCHARF
Referred To:	Not reported
Reported to Dept:	2004-07-20

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

CID:	407
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2004-07-20
Spill Record Last Update:	2006-09-14
Spiller Name:	JAMES VENERUSSO
Spiller Company:	SUNNYDALE FARMS
Spiller Address:	400 STANLEY AVE
Spiller County:	001
Spiller Contact:	JAMES VENERUSSO
Spiller Phone:	(718) 257-7600
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	182858
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD Tank Test Failure letter sent to: Sunnydale Farms Inc. 400 Stanley Ave Brooklyn, NY 11207 Attn: Raymond Kearney 5/10/05. J.Krimgold spoke to Mark Turoff (Energy Tank & Environmental Services) at 917-750-1843. He has done a site assessment at this site. Most likely the site will require spill investigation due to the contamination found so far. He will submit a report this week. Owner wants to have a CO or stip for this site. Owner: Stanley Eisenberg phone 561-414-7221 400 Stanley Ave Brooklyn, NY 11207 08/09/05. - spoke to Mark Turoff. (E-mail address- ENVCOM3@aol.com) there are four 5,000 gallon fuel tanks with some containing diesel. there are are four 10,000 gallon heating oil tanks, mostly no. 2 and was some No. 4. Mark will send me the address of the property owner so that a stipulated agreement can be sent. S. Scharf 08/10/05 - Spoke to Stanley Eisenberg. I sent Stanley a stipulation agreement. Accountant: Daphne Stasco (Email: Dstasco@optline.net DJSpergamentadvisors.com) 115 Quaker ridge Manhasset, NY 11030 08/12/05- Spoke to Stanley Eisenberg. He will sign the stipulation agreement and send it back in to me. He has hired a company called Pro-Test (ENVCOM30@AOL.COM) that will: Submit the required I&R work plan for 400 stanley ave. For 383-389 Stanley ave there are tanks also. they will test, and if fail get new spill nubmer and will address all the tanks at once. 400 stanley Ave has 4-5,000 tanks for gasoline to be removed, and 4-10,000 fuel oil tanks of which three have already been closed ad the 4th on requires closure.- S. scharf 383-389 Stanley Ave will also require remediation. 09/20/05- Called Pro Test to talk to either John or tom (son)Liddy. Not in Told worker that Eisenberg signed the stipulation and we are waiting for the work plan to attache to it.-S.Scharf. John Leddy calls back same day. will submit the required work plan. 09/23/05- John Leddy from Pro-Test called. He will be submitting a work plan. proTest wants to start on the 4-10,000 gallon tanks on the north end. Pro-Test Inc 410 Lexington Ave North Babylon, NY 11704 (631)-321-4670 10/07/05 Several calls with John Leddy. Overall, Pro-Test has removed the concrete cover on the 4-10,000 gallon fuel oil tanks. Three of the four tanks were previously abandoned in place with slurry. removed the fourth tank, washed it and cut it up for removal. Oil contaminated soils on north and south side and under abondoned tanks. So far, Protest has

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

removed 275 yards of soil and are segregating contaminated versus non-contaminated. He will assess the situation monday and make a decision as to whether to pull the abandoned ones in order to complete remediation.- Steven scharf- PM. Thursday and Friday 10/20-1/05 have tested stockpiled soils and will have allied Waste remove this week. Week of 10/31/05- On tuesday took out contaminated soils from a back hoe delivered by Stanley Eisenberg. Work has started on the 5-4,000 gallon gasoline tanks. Four are diesel and one is gasoline. The tank contents have been pumped out by petroleum tanks cleaners. The Gas tanks will be cleaned on monday.- S. Scharf 11/29/05- In the area of the 5-4,000 gallon motor fuel tanks, two additional tanks were identified. All the motor fuel tanks were cleaned, cut up and removed from the site. All the soils from the heating oil tanks were tested, manifiested and removed from the site. Spoke to both John Leddy of Protest and Ray Carney. A status report is coming ASAP and there is a request to fill in the pit around the former 10,000 gallon tanks.- S. Scharf 12/02/05- Spoke with John Leddy. Need to put in two monitoring wells for northern heating oil tank removal. GW is evident at the bottom of the pit and need to confirm that all the heating oil is out. Therefore, put one well on either side and fill in the pit.- S. Scharf 12/05/05- Spoke to Ray Carney of Red Banana Inc. Will approve the monitoring wells so that filling in pits can proceed. Already has soil stockpiled.- S. Scharf 12/07/05-spoke to John leddy of Pro Test. I will get him MW approval letter and he will put it on the work schedule. S. Scharf 12/13/05- Letter sent to ProTest summerizing work ot date, need for wells on north and need for further investigation on south.- S. Scharf January 2006. brought in a cotractor to do a magnetonmetry survey. found eight 550 gallon tanks. Search of NYC records confirmed the eight tanks installed in 1958. Contractor was brought in to remove the eight tanks, that were all empty. confirmatory sampling showed no problems in these areas. Sunnydale made a proposal to offsite dispose of the excavated materials, fill in the excavation and install monitoring wells and insitu injecction wells. approval was granted on this action for the northern tanks 2/06- S. Scharf 2-3/06-The five-4,000 fuel tanks were removed and several hundred yards of dirt. Adjacent tanks, eight-550 gallon tanks were discovered and removed. additional soils were stockpiled. The removed tanks were deconned, cut up and removed for Scrap. All the stockpiled soils were tested, manfiested and properly disposed offsite. I reviewed the proposal to back fill the holes and install monitoring wells and wells that chemox can be injected in. I approve plan and Red Banana will be submitting the remediation plan. S. Scharf 3/06- Holes have been backfilled and wells have been installed. per converartion with Ray Carney.- S. Scharf 6/06- Send letter to Ray Carney that the wells need to be monitored now and in near future for detemination whether to close spill or use chem-ox. 7/06- Mark turo calls as Sunnydale Farms Env. consultant. 917-750-1843. He will sample wells for Stars on 7/11/06.-S. Scharf 9/06- Energy, Tank and Environmental Services Inc. report on the groundwater sampling is approved and the spill is officially closed by correspondence on 9/7/06. S. Scharf "

Remarks: "5 tanks tested all failed Tanks 4 and 5 are also 4000 gallons and were tested with the same test method as the other 3 tanks."

All TTF:

Facility ID: 0404235
Spill Number: 0404235
Spill Tank Test: 1529458

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Site ID:	311784
Tank Number:	00C
Tank Size:	4000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	JMKRIMGO
Last Modified Date:	Not reported

Facility ID:	0404235
Spill Number:	0404235
Spill Tank Test:	1529459
Site ID:	311784
Tank Number:	00D
Tank Size:	4000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	JMKRIMGO
Last Modified Date:	Not reported

Facility ID:	0404235
Spill Number:	0404235
Spill Tank Test:	1529460
Site ID:	311784
Tank Number:	00A
Tank Size:	4000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	JMKRIMGO
Last Modified Date:	Not reported

Facility ID:	0404235
Spill Number:	0404235
Spill Tank Test:	1549000
Site ID:	311784
Tank Number:	0B2
Tank Size:	4000

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	JMKRIMGO
Last Modified Date:	Not reported

Facility ID:	0404235
Spill Number:	0404235
Spill Tank Test:	1549001
Site ID:	311784
Tank Number:	0B1
Tank Size:	4000
Material:	Not reported
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	JMKRIMGO
Last Modified Date:	Not reported

Facility ID:	9210189
Site ID:	311785
Spill Number/Closed Date:	2004-06-30
Spill Date:	1992-12-02
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMROMMEL
Referred To:	Not reported
Reported to Dept:	1992-12-02
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1992-12-03
Spill Record Last Update:	2004-06-30
Spiller Name:	Not reported
Spiller Company:	SUNNYDALE
Spiller Address:	Not reported
Spiller County:	001

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	182858
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ROMMEL This spill case was reassigned from DEC (Sigona) to Rommel on 01/07/2004. 06/30/2004 Site tracked under spill 9412264. See 9412264 for current site status. Rommel."
Remarks:	"EIR "

All TTF:

Facility ID:	9210189
Spill Number:	9210189
Spill Tank Test:	1540917
Site ID:	311785
Tank Number:	Not reported
Tank Size:	0
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	311785
Operable Unit ID:	976654
Operable Unit:	01
Material ID:	407190
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9206077
Site ID:	260684
Spill Number/Closed Date:	1992-08-26
Spill Date:	1992-08-26
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	C4
Cleanup Ceased:	1992-08-26
SWIS:	2401
Investigator:	KSTANG
Referred To:	Not reported
Reported to Dept:	1992-08-26

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1992-09-02
Spill Record Last Update:	2004-09-30
Spiller Name:	Not reported
Spiller Company:	ULCO OIL CO.
Spiller Address:	1 COFFEY ST.
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	182858
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TANG 10/10/95: This is additional information about material spilled from the translation of the old spill file: 4-4K TANK."
Remarks:	"CREW INYARD PICKED UP WITH DRI-SOL"

All Materials:

Site ID:	260684
Operable Unit ID:	973323
Operable Unit:	01
Material ID:	410259
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

CBS:

CBS Number:	2-000012
Program Type:	CBS
Facility Status:	Unregulated/Closed
Expiration Date:	Not reported
Dec Region:	2
UTMX:	593590.00000
UTMY:	4501041.00000

SPILLS:

Facility ID:	9305358
Facility Type:	ER
Spill Number:	9305358
DER Facility ID:	182858
Site ID:	221097
DEC Region:	2
Spill Number/Closed Date:	1993-07-30
Spill Cause:	Equipment Failure

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Spill Class:	C4
SWIS:	2401
Spill Date:	1993-07-30
Investigator:	SJMILLER
Referred To:	Not reported
Reported to Dept:	1993-07-30
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1993-07-30
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-08-02
Spill Record Last Update:	2005-06-14
Spiller Name:	Not reported
Spiller Company:	WHALECO
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was MILLER "
Remarks:	"SPILL ON CONCRETE PAVIMENT - LOAPING DOCK - HOSE DISCONNECTED DUE TOWORN OUT THREHUG ON CONNECT CLEANED UP BY WHALECO."

All Materials:

Site ID:	221097
Operable Unit ID:	986872
Operable Unit:	01
Material ID:	395283
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9212536
Facility Type:	ER
Spill Number:	9212536
DER Facility ID:	182858
Site ID:	311786
DEC Region:	2
Spill Number/Closed Date:	1993-02-05
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	1993-02-05
Investigator:	CAMMISA
Referred To:	Not reported
Reported to Dept:	1993-02-05
CID:	Not reported

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	1993-02-05
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1993-02-08
Spill Record Last Update:	2004-09-30
Spiller Name:	Not reported
Spiller Company:	SUNNYDALE FARMS
Spiller Address:	400 STANLEY AVE
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	""
Remarks:	"TANK WAS AIRBOUND-APPLIED SPEEDI-DRI,P/U & DISPOSED-CLOGGED VENT-SVCMNTO REPAIR VENT -OIL CAME OUT FILL"

All Materials:

Site ID:	311786
Operable Unit ID:	976963
Operable Unit:	01
Material ID:	402377
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	0706859
Facility Type:	ER
Spill Number:	0706859
DER Facility ID:	182858
Site ID:	387456
DEC Region:	2
Spill Number/Closed Date:	2008-01-23
Spill Cause:	Other
Spill Class:	C4
SWIS:	2401
Spill Date:	2007-09-20
Investigator:	SFRAHMAN
Referred To:	Not reported
Reported to Dept:	2007-09-20
CID:	444
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Remediation Phase:	0
Date Entered In Computer:	2007-09-20
Spill Record Last Update:	2008-01-23
Spiller Name:	DAVID GREFFENIUS
Spiller Company:	FORMER SUNNY DALE MILK
Spiller Address:	400 STANLEY AVE
Spiller Company:	001
Contact Name:	DAVID GREFFENIUS
DEC Memo:	"This spill is associated with a former spill from the site #0404235 which was closed out in Sept 2006 by Steve Scharf (DEC Albany). Region 2 just got this new spill report (0706859) for the site at 400 Stanley Ave Brooklyn. Delta Environmental has done some new drilling on the site (Phase 2 ?) and has found problems with soil and water. Since this site already had a spill that was investigated and closed out, we should probably try to compare the previous sample results to the current results and determine what we'll do with this site. 9/21/2007 Steve Scharf - DEC Albany - Forwarded the following response to a request for a hard copy of the Aug 2006 report. All the reports were filed together here in the Central office by spill number and then shipped back to the region. There were a number of 550 gallon tanks and soils removed and sent offsite. Also two of the three 10,000 fuel oil tanks were removed, the other had filled with concrete a while back and was abandoned onsite. Monitoring well data did not show any offsite impacts from the removed source area(s). What part of the site was Delta drilling on when this was found? DEC needs to: 1) Connect with Delta Environmental & determine what work was done, what work they intend to do, etc. 2) Review the old & new sample results to determine what work needs to be done. 01/23/08- Rec'd Phase II Acquisition Subsurface Assessment Report prepared by Delta Consultants.The report was prepared in response to a request by the client(Stanley Realty & Malta Realty,LLC) to assess and document subsurface environmental conditions on the subject site.On July 2007, four borings were advanced on the subject site to a depth of 10 to 19 ft.Soil samples were taken from both above the soil water interface and below the soil water interface.Samples were analyzed for VOCs/SVOCs according to EPA Methods 8260/8270.Three of the four soil borings were converted to temporary monitoring wells for ground water sampling purpose.Delta collected three GW samples from the three wells.Light non aqueous phase liquid(LNAPL) was not detected in any of the temporary wells.Laboratory analysis of soil and ground water showed minor exceedances of one or two VOC/SVCOs which are residual in nature, and do not warrant further remediation.Considering non residential nature of the property,extent of the residual contaminaton,absence of sensitive receptor, this spill case is closed.(SR)"
Remarks:	"SOIL AND GROUNDWATER SHOWED ABOVE NYSDEC GUIDENCE VALUES: FORMER UST SITE: CLOSED SPILL # 04-04235: 9/07/06"

All Materials:

Site ID:	387456
Operable Unit ID:	1144659
Operable Unit:	01
Material ID:	2134968
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Units: G
Recovered: .00
Oxygenate: Not reported

RCRA NonGen / NLR:
Date form received by agency: 01/01/2007
Facility name: STANITA SERVICE CORP - VACANT LOT
Facility address: LINDEN BLVD & ELTON ST NE COR
BROOKLYN, NY 11207
EPA ID: NYR000084780
Mailing address: STANLEY AVE
BROOKLYN, NY 11207
Contact: DAVID RAPOSO
Contact address: STANLEY AVE
BROOKLYN, NY 11207
Contact country: US
Contact telephone: 908-832-0050
Contact email: Not reported
EPA Region: 02
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: STANITA SERVICE CORP
Owner/operator address: 400 STANLEY AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 718-257-7600
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: STANITA SERVICE CORP
Owner/operator address: 400 STANLEY AVE
BROOKLYN, NY 11207
Owner/operator country: US
Owner/operator telephone: 718-257-7600
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: STANITA SERVICE CORP - VACANT LOT
Classification: Not a generator, verified

Date form received by agency: 02/16/2000
Site name: STANITA SERVICE CORP - VACANT LOT
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

Violation Status: No violations found

NY MANIFEST:
Country: USA
EPA ID: NYR000084780
Facility Status: Not reported
Location Address 1: 400 STANLEY AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BROOKLYN
Location State: NY
Location Zip: 11207
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYR000084780
Mailing Name: STANITA SERVICE CORP
Mailing Contact: N/S
Mailing Address 1: 400 STANLEY AVE
Mailing Address 2: Not reported
Mailing City: BROOKLYN
Mailing State: NY
Mailing Zip: 11207
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7182577600

NY MANIFEST:
Document ID: SCA0222000
Manifest Status: Not reported
seq: 01
Year: 2000
Trans1 State ID: NJDEPS500

STANITA SERVICE CORP - VACANT LOT (Continued) **1001961664**

Trans2 State ID:	Not reported
Generator Ship Date:	02/22/2000
Trans1 Recv Date:	02/22/2000
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/24/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000084780
Trans1 EPA ID:	NJD986607380
Trans2 EPA ID:	Not reported
TSDF ID 1:	SCD036275626
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	03693
Units:	P - Pounds
Number of Containers:	009
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00

Click this hyperlink while viewing on your computer to access additional NY_MANIFEST: detail in the EDR Site Report.

W116 **400 STANLEY AVE/SUNNYDALE** **NY LTANKS** **S106703588**
NNW **400 STANLEY AVE/SUNNYDALE** **N/A**
1/4-1/2 **BROOKLYN, NY**
0.332 mi.
1754 ft. **Site 2 of 2 in cluster W**

Relative:
Lower

Actual:
12 ft.

LTANKS:

Facility ID:	9109084
Site ID:	250688
Spill Number/Closed Date:	1991-11-25
Spill Date:	1991-11-25
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1991-11-25
SWIS:	2401
Investigator:	KSTANG

400 STANLEY AVE/SUNNYDALE (Continued) **S106703588**

Referred To:	Not reported
Reported to Dept:	1991-11-25
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1991-11-27
Spill Record Last Update:	2003-11-05
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	205498
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TANG "
Remarks:	"SUSPECT STICK-LINE CLOGGED; FUEL LEAKED FROM VENT ONTO CONCRETE LOAD- ING DOCK. DRIVER APPLIED SPEEDY-DRY. SPILL TEAM ENROUTE TO COMPLETE CLEANUP."

All Materials:

Site ID:	250688
Operable Unit ID:	959261
Operable Unit:	01
Material ID:	417738
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

---

117 NNW 1/4-1/2 0.340 mi. 1793 ft.

HOWARD BERGER CO.
808 GEORGIA AVE
BROOKLYN, NY

NY LTANKS **1001749937**
N/A

Relative: Lower

Actual: 10 ft.

LTANKS:

Facility ID:	9906439
Site ID:	117914
Spill Number/Closed Date:	2005-06-28
Spill Date:	1999-08-30
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401

HOWARD BERGER CO. (Continued) **1001749937**

Investigator:	hmdudek
Referred To:	Not reported
Reported to Dept:	1999-08-30
CID:	233
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1999-08-30
Spill Record Last Update:	2005-06-28
Spiller Name:	TONY FAVALE
Spiller Company:	HOWARD BERGER CO.
Spiller Address:	808 GEORGIA AVE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	102513
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND 6/28/05 - PBS records indicate that the tank was closed in place. There is no documented release. Closed based on guidance in the April 16, 2004 memorandum from Robert Marino to Regional Spill Engineers Spills Backlog Reduction Initiative - Guidance for Closure Decisions ."
Remarks:	"u/g tank failed test property owner has been advised the tank is under a concrete floor caller not sure what they plan to do at this time"

All TTF:

Facility ID:	9906439
Spill Number:	9906439
Spill Tank Test:	1547553
Site ID:	117914
Tank Number:	2
Tank Size:	3000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	117914
Operable Unit ID:	1084872
Operable Unit:	01
Material ID:	302710
Material Code:	0001A

HOWARD BERGER CO. (Continued) **1001749937**

Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

V118 **FEDERAL EXPRESS CORP** **RCRA-CESQG** **1000148573**
WNW **107-123 FARRAGUT RD** **NY CBS** **NYD001236520**
1/4-1/2 **BROOKLYN, NY 11236** **NY CBS AST**
0.340 mi. **NY INST CONTROL**
1796 ft. **Site 2 of 2 in cluster V** **NY VCP**
FINDS
Relative: **ECHO**
Lower **RI MANIFEST**
NY MANIFEST
Actual:
9 ft.

RCRA-CESQG:

Date form received by agency:	01/01/2007
Facility name:	FEDERAL EXPRESS CORP
Facility address:	107-123 FARRAGUT RD BROOKLYN, NY 11236
EPA ID:	NYD001236520
Mailing address:	PO BOX 727 MEMPHIS, NY 38194
Contact:	Not reported
Contact address:	PO BOX 727 MEMPHIS, NY 38194
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	FED EX
Owner/operator address:	1 CENTURY DR PARSIPPANY, NJ 07054
Owner/operator country:	US
Owner/operator telephone:	973-682-3747

FEDERAL EXPRESS CORP (Continued) **1000148573**

Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: FED EX
Owner/operator address: 1 CENTURY DR
PARSIPPANY, NJ 07054
Owner/operator country: US
Owner/operator telephone: 973-682-3747
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: FEDERAL EXPRESS CORP
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/14/1999
Site name: FEDERAL EXPRESS CORP
Classification: Small Quantity Generator

Date form received by agency: 03/06/1998
Site name: FEDERAL EXPRESS CORP
Classification: Large Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: D001
. Waste name: IGNITABLE WASTE

FEDERAL EXPRESS CORP (Continued) **1000148573**

. Waste code: D040
. Waste name: TRICHLORETHYLENE

. Waste code: K078
. Waste name: K078

Date form received by agency: 03/01/1990
Site name: DURALAB EQUIPMENT CORPORATION
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:
Regulation violated: Not reported
Area of violation: Listing - General
Date violation determined: 04/30/2008
Date achieved compliance: 02/06/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 05/22/2008
Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 03/12/2009
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 06/05/1986
Date achieved compliance: 09/25/1986
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/23/1986
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 04/30/2008
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Listing - General
Date achieved compliance: 02/06/2009
Evaluation lead agency: State

Evaluation date: 06/05/1986
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 09/25/1986
Evaluation lead agency: State

CBS:
CBS Number: 2-000081
Program Type: CBS
Facility Status: Inactive
Expiration Date: Not reported

FEDERAL EXPRESS CORP (Continued) **1000148573**

Dec Region: 2
UTMX: 584516.32807
UTMY: 4495153.30541

CBS AST:
CBS Number: 2-000081
ICS Number: 2-126418
PBS Number: Not reported
MOSF Number: Not reported
SPDES Number: Not reported
Facility Status: IN SERVICE
Facility Type: D
Telephone: (718) 649-9600
Facility Town: NEW YORK CITY
Region: STATE
Expiration Date: 07/05/1997
Total Capacity of All Active Tanks(gal): 1000
Operator: JOHN V. MAZZOLA
Emergency Contact: JOHN V. MAZZOLA
Emergency Phone: (718) 649-9600
Owner Name: DURALAB EQUIP. CORP.
Owner Address: 107-23 FARRAGUT RD.
Owner City,St,Zip: BROOKLYN, NY 11236
Owner Telephone: (718) 649-9600
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: DURALAB EQUIP. CORP.
Mail Contact Addr: 107-23 FARRAGUT RD.
Mail Contact Addr2: Not reported
Mail Contact Contact: JOHN V. MAZZOLA
Mail Contact City,St,Zip: BROOKLYN, NY 11236
Mail Phone: (718) 649-9600

Tank Id: 001
CAS Number: 79016
Federal ID: Not reported
Tank Status: In Service
Install Date: 05/89
Tank Closed: Not reported
Capacity (Gal): 1000
Chemical: Trichloroethene
Tank Location: Indoors, Belowground
Tank Type: Steel/carbon steel
Total Tanks: 1
Tank Secret: False
Tank Secondary Containment: Double-Walled Tank
Tank Error Status: No Missing Data
Date Entered: 07/05/1989
Certified Date: 09/28/1995
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None

FEDERAL EXPRESS CORP (Continued) **1000148573**

Leak Detection:	None
Overfill Protection:	Product Level Gauge
Haz Percent:	100
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	6101
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	04/01/93
Is It There:	False
Delinquent:	False
Date Expired:	07/05/95
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	True
Pre-Printed Renewal App Last Printed:	09/01/1998

INST CONTROL:

Site Code:	58389
Control Name:	Deed Restriction
HW Code:	V00192
Control Code:	A
Control Type:	INST
Dt record added:	05/15/2008
Dt rec updated:	07/13/2009
Updated By:	SMMARTIN
Site Code:	58389
Site Description:	Location: The site is located at 107-23 Farragut Rd. in the Canarsie section of Brooklyn, NY, and is known as the former Duralab Equipment Corporation Facility. It is identified on the Kings County Tax Map as Section 24, Block 8156, Lot 1. The 6.6 acre site is bordered on the south by Farragut Rd., on the east by East 108th St., on the north by the Long Island Railroad and on the west by East 105th St. Site Features: The site contains a parking lot and a 165,000 square foot building that was built in 1971, with an addition constructed in 1986. Current Zoning: The property is owned by New York City and subleased by Federal Express through Cargex Corp. The building and parking lot are used by Fed Ex as a shipping facility and major distribution center. The surrounding area is composed of residential, industrial and commercial uses. Institutional controls (deed restrictions) were executed in April 2006 that prohibit residential usage on the property. Historical Use: From 1971 to 1997 a cabinet manufacturer operated on the site and used trichloroethene as a degreaser. Site Geology and Hydrogeology: Approximately 10 feet of fill materials overlay glacial outwash deposits of fine to medium sand with little silt. These deposits extend to a depth of approximately 175 ft bgs and reportedly become coarser with depth. Bedrock occurs at approximately 400 feet bgs. The groundwater table was encountered at approximately 10 ft bgs in the glacial outwash aquifer. Groundwater flow direction is towards the east-northeast.
Env Problem:	Nature and Extent of Contamination: The site was contaminated with trichloroethylene (TCE) which was used as a degreaser at the former Duralab facility located on the site. TCE was detected in groundwater in the range of 100 to 240,000 ppb when the site underwent an investigation in 1998. A Soil Vapor Extraction and Air Sparging (SVE/AS) system was operated for more than two years and remediated a

FEDERAL EXPRESS CORP (Continued) **1000148573**

large portion of the groundwater contamination. The system was shut down after the mass of TCE contamination in groundwater was reduced to asymptotic levels. Post remedial groundwater monitoring was performed and indicated that the residual groundwater contamination is not migrating from the site. After five years of monitoring for natural attenuation, residual contamination remains in the groundwater and is being evaluated.

Health Problem: There are no known human exosure pathways for chemicals in the on-site subsurface soil. Although groundwater is contaminated, public water serves the surrounding community. The NYSDOH and NYSDEC will be evaluating the need to conduct additional investigations to determine the potential for soil vapor intrusion into structures on or near the site.

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1971
Disp Term: 1997
Lat/Long: Not reported
Dell: Not reported
Record Add: 5/31/2011 3:19:00 PM
Record Upd: 5/31/2011 3:19:00 PM
Updated By: SMMARTIN
Own Op: Applicant/Requestor
Sub Type: ZZZ
Owner Name: DAVID JENSEN
Owner Company: Federal Express Corporation
Owner Address: 1980 NONCONNAH BLVD.
Owner Addr2: Not reported
Owner City,St,Zip: MEMPHIS, TN 38132
Owner Country: United States of America
Own Op: Owner
Sub Type: 06
Owner Name: Martin O Hara
Owner Company: NYC Dept. of Citywide Administrative Services
Owner Address: 80 Centre Street
Owner Addr2: Not reported
Owner City,St,Zip: New York, NY 10013
Owner Country: United States of America
Own Op: On-Site Operator
Sub Type: 08
Owner Name: Anthony Argento
Owner Company: Broadway Stages LTD
Owner Address: 203 Meserole Ave
Owner Addr2: Not reported
Owner City,St,Zip: Brooklyn, NY 11222
Owner Country: United States of America
Own Op: Applicant/Requestor
Sub Type: 09
Owner Name: ALLEN BORNHEIMER
Owner Company: CARGEX BROOKLYN LIMITED PARTNERSHIP
Owner Address: 50 MILK STREET, 20TH FLOOR
Owner Addr2: Not reported
Owner City,St,Zip: BOSTON, MA 02109
Owner Country: United States of America

FEDERAL EXPRESS CORP (Continued) **1000148573**

HW Code: V00192
Waste Type: VOLATILE ORGANICS
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: V00192
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: W2-0835-98-10(R
Cross Ref Type Code: 20
Cross Ref Type: Haz. Substance ID
Record Added Date: 11/30/2000 4:07:00 PM
Record Updated: 2/24/2005 3:54:00 PM
Updated By: VCPTRANS

Site Code: 58389
Control Name: Landuse Restriction
HW Code: V00192
Control Code: 25
Control Type: INST
Dt record added: 05/15/2008
Dt rec updated: 07/13/2009
Updated By: SMMARTIN
Site Code: 58389
Site Description: Location: The site is located at 107-23 Farragut Rd. in the Canarsie section of Brooklyn, NY, and is known as the former Duralab Equipment Corporation Facility. It is identified on the Kings County Tax Map as Section 24, Block 8156, Lot 1. The 6.6 acre site is bordered on the south by Farragut Rd., on the east by East 108th St., on the north by the Long Island Railroad and on the west by East 105th St. Site Features: The site contains a parking lot and a 165,000 square foot building that was built in 1971, with an addition constructed in 1986. Current Zoning: The property is owned by New York City and subleased by Federal Express through Cargex Corp. The building and parking lot are used by Fed Ex as a shipping facility and major distribution center. The surrounding area is composed of residential, industrial and commercial uses. Institutional controls (deed restrictions) were executed in April 2006 that prohibit residential usage on the property. Historical Use: From 1971 to 1997 a cabinet manufacturer operated on the site and used trichloroethene as a degreaser. Site Geology and Hydrogeology: Approximately 10 feet of fill materials overlay glacial outwash deposits of fine to medium sand with little silt. These deposits extend to a depth of approximately 175 ft bgs and reportedly become coarser with depth. Bedrock occurs at approximately 400 feet bgs. The groundwater table was encountered at approximately 10 ft bgs in the glacial outwash aquifer. Groundwater flow direction is towards the east-northeast.
Env Problem: Nature and Extent of Contamination: The site was contaminated with trichloroethylene (TCE) which was used as a degreaser at the former Duralab facility located on the site. TCE was detected in groundwater in the range of 100 to 240,000 ppb when the site underwent an investigation in 1998. A Soil Vapor Extraction and Air Sparging (SVE/AS) system was operated for more than two years and remediated a large portion of the groundwater contamination. The system was shut down after the mass of TCE contamination in groundwater was reduced to asymptotic levels. Post remedial groundwater monitoring was performed and indicated that the residual groundwater contamination

FEDERAL EXPRESS CORP (Continued) **1000148573**

	is not migrating from the site. After five years of monitoring for natural attenuation, residual contamination remains in the groundwater and is being evaluated.
Health Problem:	There are no known human exosure pathways for chemicals in the on-site subsurface soil. Although groundwater is contaminated, public water serves the surrounding community. The NYSDOH and NYSDEC will be evaluating the need to conduct additional investigations to determine the potential for soil vapor intrusion into structures on or near the site.
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	1971
Disp Term:	1997
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	5/31/2011 3:19:00 PM
Record Upd:	5/31/2011 3:19:00 PM
Updated By:	SMMARTIN
Own Op:	Applicant/Requestor
Sub Type:	ZZZ
Owner Name:	DAVID JENSEN
Owner Company:	Federal Express Corporation
Owner Address:	1980 NONCONNAH BLVD.
Owner Addr2:	Not reported
Owner City,St,Zip:	MEMPHIS, TN 38132
Owner Country:	United States of America
Own Op:	Owner
Sub Type:	06
Owner Name:	Martin O Hara
Owner Company:	NYC Dept. of Citywide Administrative Services
Owner Address:	80 Centre Street
Owner Addr2:	Not reported
Owner City,St,Zip:	New York, NY 10013
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	08
Owner Name:	Anthony Argento
Owner Company:	Broadway Stages LTD
Owner Address:	203 Meserole Ave
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11222
Owner Country:	United States of America
Own Op:	Applicant/Requestor
Sub Type:	09
Owner Name:	ALLEN BORNHEIMER
Owner Company:	CARGEX BROOKLYN LIMITED PARTNERSHIP
Owner Address:	50 MILK STREET, 20TH FLOOR
Owner Addr2:	Not reported
Owner City,St,Zip:	BOSTON, MA 02109
Owner Country:	United States of America
HW Code:	V00192
Waste Type:	VOLATILE ORGANICS
Waste Quantity:	UNKNOWN
Waste Code:	Not reported

FEDERAL EXPRESS CORP (Continued) **1000148573**

HW Code: V00192
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: W2-0835-98-10(R
Cross Ref Type Code: 20
Cross Ref Type: Haz. Substance ID
Record Added Date: 11/30/2000 4:07:00 PM
Record Updated: 2/24/2005 3:54:00 PM
Updated By: VCPTRANS

VCP:
Program Type: VCP
Site Code: 58389
HW Code: V00192
Site Class: C
SWIS: 2401
Region: 2
Town: New York City
Acres: 6.6
Date Record Added: 11/30/2000
Date Record Updated: 08/02/2011
Updated By: JHOCONNE
Site Description: Location: The site is located at 107-23 Farragut Rd. in the Canarsie section of Brooklyn, NY, and is known as the former Duralab Equipment Corporation Facility. It is identified on the Kings County Tax Map as Section 24, Block 8156, Lot 1. The 6.6 acre site is bordered on the south by Farragut Rd., on the east by East 108th St., on the north by the Long Island Railroad and on the west by East 105th St. Site Features: The site contains a parking lot and a 165,000 square foot building that was built in 1971, with an addition constructed in 1986. Current Zoning: The property is owned by New York City and subleased by Federal Express through Cargex Corp. The building and parking lot are used by Fed Ex as a shipping facility and major distribution center. The surrounding area is composed of residential, industrial and commercial uses. Institutional controls (deed restrictions) were executed in April 2006 that prohibit residential usage on the property. Historical Use: From 1971 to 1997 a cabinet manufacturer operated on the site and used trichloroethene as a degreaser. Site Geology and Hydrogeology: Approximately 10 feet of fill materials overlay glacial outwash deposits of fine to medium sand with little silt. These deposits extend to a depth of approximately 175 ft bgs and reportedly become coarser with depth. Bedrock occurs at approximately 400 feet bgs. The groundwater table was encountered at approximately 10 ft bgs in the glacial outwash aquifer. Groundwater flow direction is towards the east-northeast.
Env Problem: Nature and Extent of Contamination: The site was contaminated with trichloroethylene (TCE) which was used as a degreaser at the former Duralab facility located on the site. TCE was detected in groundwater in the range of 100 to 240,000 ppb when the site underwent an investigation in 1998. A Soil Vapor Extraction and Air Sparging (SVE/AS) system was operated for more than two years and remediated a large portion of the groundwater contamination. The system was shut down after the mass of TCE contamination in groundwater was reduced to asymptotic levels. Post remedial groundwater monitoring was performed and indicated that the residual groundwater contamination is not migrating from the site. After five years of monitoring for

FEDERAL EXPRESS CORP (Continued) **1000148573**

	natural attenuation, residual contamination remains in the groundwater and is being evaluated.
Health Problem:	There are no known human exosure pathways for chemicals in the on-site subsurface soil. Although groundwater is contaminated, public water serves the surrounding community. The NYSDOH and NYSDEC will be evaluating the need to conduct additional investigations to determine the potential for soil vapor intrusion into structures on or near the site.
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	1971
Disp Term:	1997
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	5/31/2011 3:19:00 PM
Record Upd:	5/31/2011 3:19:00 PM
Updated By:	SMMARTIN
Own Op:	Applicant/Requestor
Sub Type:	ZZZ
Owner Name:	DAVID JENSEN
Owner Company:	Federal Express Corporation
Owner Address:	1980 NONCONNAH BLVD.
Owner Addr2:	Not reported
Owner City,St,Zip:	MEMPHIS, TN 38132
Owner Country:	United States of America
Own Op:	Owner
Sub Type:	06
Owner Name:	Martin O Hara
Owner Company:	NYC Dept. of Citywide Administrative Services
Owner Address:	80 Centre Street
Owner Addr2:	Not reported
Owner City,St,Zip:	New York, NY 10013
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	08
Owner Name:	Anthony Argento
Owner Company:	Broadway Stages LTD
Owner Address:	203 Meserole Ave
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11222
Owner Country:	United States of America
Own Op:	Applicant/Requestor
Sub Type:	09
Owner Name:	ALLEN BORNHEIMER
Owner Company:	CARGEX BROOKLYN LIMITED PARTNERSHIP
Owner Address:	50 MILK STREET, 20TH FLOOR
Owner Addr2:	Not reported
Owner City,St,Zip:	BOSTON, MA 02109
Owner Country:	United States of America
HW Code:	V00192
Waste Type:	VOLATILE ORGANICS
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	V00192

FEDERAL EXPRESS CORP (Continued) **1000148573**

Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: W2-0835-98-10(R
Cross Ref Type Code: 20
Cross Ref Type: Haz. Substance ID
Record Added Date: 11/30/2000 4:07:00 PM
Record Updated: 2/24/2005 3:54:00 PM
Updated By: VCPTRANS

FINDS:

Registry ID: 110004332892

Environmental Interest/Information System
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000148573
Registry ID: 110004332892
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110004332892

RI MANIFEST:
EPA Id: NYD001236520
Manifest Document Number: RIS0113614
GEN Cert Date: 1/16/2006
TSDF Id: rid040098352
TSDF Name: Northland Environmental Inc.
TSDF Date: 1/16/2006
Transporter 2 Id: Not reported
Transporter 2 Name: Not reported
Transporter Receipt Date: 1/16/2006
Number Of Containers: Not reported
Container Type: NONE
Waste Code1: Not reported
Waste Code2: Not reported
Waste Code3: Not reported
Fee Exempt Code: Not reported
Comment: Not reported

Details:
EPA ID: NYD001236520
Manifest Docket Number: 002787467SKS
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1

FEDERAL EXPRESS CORP (Continued) **1000148573**

Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 12/12/2011
Transporter Receipt Date: 12/12/2011
Transporter 2 Receipt Date: 12/15/2011
TSDF Receipt Date: 12/15/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 004326412FLE
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1
Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 9/12/2011
Transporter Receipt Date: 9/12/2011
Transporter 2 Receipt Date: 9/19/2011
TSDF Receipt Date: 9/19/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 003582449FLE
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1
Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 4/7/2011
Transporter Receipt Date: 4/7/2011
Transporter 2 Receipt Date: 4/15/2011
TSDF Receipt Date: 4/15/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 003582449FLE
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1
Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 4/7/2011
Transporter Receipt Date: 4/7/2011
Transporter 2 Receipt Date: 4/15/2011
TSDF Receipt Date: 4/15/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 003646339FLE
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1
Transporter Name: SAFETY KLEEN

FEDERAL EXPRESS CORP (Continued) **1000148573**

Transporter EPA ID: TXR000050930
GEN Cert Date: 1/17/2011
Transporter Receipt Date: 1/17/2011
Transporter 2 Receipt Date: 1/24/2011
TSDF Receipt Date: 1/24/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 003646339FLE
Waste Description: HAZARDOUS WASTE LIQUID NOS
Quantity: 5
WT/Vol Units: G
Item Number: 1
Transporter Name: SAFETY KLEEN
Transporter EPA ID: TXR000050930
GEN Cert Date: 1/17/2011
Transporter Receipt Date: 1/17/2011
Transporter 2 Receipt Date: 1/24/2011
TSDF Receipt Date: 1/24/2011
Transporter 2 ID: NJD071629976

EPA ID: NYD001236520
Manifest Docket Number: 004930319JJK
Waste Description: OILY SOLIDS
Quantity: 750
WT/Vol Units: P
Item Number: 9614
Transporter Name: CONSOLIDATED RECYCLING TECH.
Transporter EPA ID: MA5000002261
GEN Cert Date: 6/7/2010
Transporter Receipt Date: 6/7/2010
Transporter 2 Receipt Date: Not reported
TSDF Receipt Date: 6/7/2010
Transporter 2 ID: Not reported

EPA ID: NYD001236520
Manifest Docket Number: 002144046JJK
Waste Description: OILY SOLIDS
Quantity: 750
WT/Vol Units: P
Item Number: 48915021
Transporter Name: CONSOLIDATED RECYCLI
Transporter EPA ID: MA5000002261
GEN Cert Date: 6/8/2007
Transporter Receipt Date: 6/8/2007
Transporter 2 Receipt Date: Not reported
TSDF Receipt Date: 6/8/2007
Transporter 2 ID: Not reported

EPA ID: NYD001236520
Manifest Docket Number: 002144046JJK
Waste Description: OILY SOLIDS
Quantity: 750
WT/Vol Units: P
Item Number: 48915021
Transporter Name: CONSOLIDATED RECYCLI
Transporter EPA ID: MA5000002261

FEDERAL EXPRESS CORP (Continued) **1000148573**

GEN Cert Date:	6/8/2007
Transporter Receipt Date:	6/8/2007
Transporter 2 Receipt Date:	Not reported
TSDF Receipt Date:	6/8/2007
Transporter 2 ID:	Not reported

EPA ID:	NYD001236520
Manifest Docket Number:	RIS0116560
Waste Description:	OILY SOLIDS
Quantity:	750
WT/Vol Units:	P
Item Number:	32409
Transporter Name:	CONSOLIDATED RECYCLI
Transporter EPA ID:	MA5000002261
GEN Cert Date:	4/1/2006
Transporter Receipt Date:	Not reported
Transporter 2 Receipt Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported

Click this hyperlink while viewing on your computer to access
9 additional RI MANIFEST: record(s) in the EDR Site Report.

NY MANIFEST:

Country:	USA
EPA ID:	NYD001236520
Facility Status:	Not reported
Location Address 1:	107-123 FARRAGUT RD
Code:	BP
Location Address 2:	570 E 108TH ST
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	10012
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD001236520
Mailing Name:	FED EXPRESS 256130
Mailing Contact:	UNKNOWN
Mailing Address 1:	570 E 108TH ST
Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11236
Mailing Zip 4:	2216
Mailing Country:	USA
Mailing Phone:	7182402360

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	TXR000081205
Trans2 State ID:	MAD039322250

FEDERAL EXPRESS CORP (Continued) **1000148573**

Generator Ship Date:	06/30/2014
Trans1 Recv Date:	06/30/2014
Trans2 Recv Date:	07/10/2014
TSD Site Recv Date:	07/28/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001236520
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	ARD069748192
TSDF ID 2:	Not reported
Manifest Tracking Number:	004265754SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H040
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	50
Units:	P - Pounds
Number of Containers:	1
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1
Waste Code:	P051
Waste Code 1_2:	P123
Waste Code 1_3:	U002
Waste Code 1_4:	U036
Waste Code 1_5:	U070
Waste Code 1_6:	Not reported

Click this hyperlink while viewing on your computer to access
23 additional NY_MANIFEST: record(s) in the EDR Site Report.

X119 **SPRING CREEK TOWERS POWER PLANT** **NY LTANKS** **S102239579**
East **165 ELMIRA LOOP** **NY MOSF** **N/A**
1/4-1/2 **BROOKLYN, NY 11239** **NY CBS**
0.343 mi. **NY Spills**
1809 ft. **Site 1 of 2 in cluster X** **NY AIRS**

Relative:
Higher

Actual:
19 ft.

LTANKS:

Facility ID:	0301455
Site ID:	114886
Spill Number/Closed Date:	2003-05-09
Spill Date:	2003-05-09
Spill Cause:	Tank Overfill

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Spill Source:	Commercial Vehicle
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2003-05-09
CID:	322
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-05-09
Spill Record Last Update:	2003-05-09
Spiller Name:	TERRENCE BYRNES
Spiller Company:	STARRETT CITY POWER AUTH
Spiller Address:	165 ELMIRA LOOP
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	100167
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND 5/9/03 - ROSSAN, DDO - Called Terrence Byrnes at (631) 735-1688 only to hear fron phone company (virzon) that this is a not working number. Called Virzon for Atlantic States Lubrication #. They replied; this company does not exist. Called Virzon again for Starrett City Power Auth: they replied this company does not exist. Discussed with Steve who recommends closure. END"
Remarks:	"driver was filling tank - the person watching the tank was not paying attention and the wistle didn't work either - spill contaned in a containment area - "

All Materials:

Site ID:	114886
Operable Unit ID:	867845
Operable Unit:	01
Material ID:	568514
Material Code:	0015
Material Name:	motor oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

MOSF:

Facility ID:	2-2460
Program Type:	MOSF
Tank Status:	Active
Expiration Date:	03/31/2019

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Dec Region: 2
UTMX: 594731.34038
UTMY: 4500470.74176

CBS:
CBS Number: 2-000265
Program Type: CBS
Facility Status: Active
Expiration Date: 10/27/2017
Dec Region: 2
UTMX: 594717.39036
UTMY: 4500513.24945

CBS Number: 2-000315
Program Type: CBS
Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 2
UTMX: 594683.68636
UTMY: 4500460.26840

CBS Number: 2-000370
Program Type: CBS
Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 2
UTMX: 594717.39036
UTMY: 4500513.24945

SPILLS:
Facility ID: 9012329
Facility Type: ER
Spill Number: 9012329
DER Facility ID: 100167
Site ID: 114887
DEC Region: 2
Spill Number/Closed Date: 2005-04-12
Spill Cause: Equipment Failure
Spill Class: B3
SWIS: 2401
Spill Date: 1991-02-27
Investigator: JXZHAO
Referred To: Not reported
Reported to Dept: 1991-02-28
CID: Not reported
Water Affected: Not reported
Spill Source: Major Facility (MOSF) > 400,000 gal
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1991-03-01
Spill Record Last Update: 2005-04-12

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Spiller Name:	Not reported
Spiller Company:	STARRETT CITY
Spiller Address:	1310 PENNSYLVANIA AVE
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ZHAO This spill site was reassigned from DEC Sigona to Zhao on May 3, 2004 for follow-up. 4/12/2005 jz: Based on site inspection and groundwater lab analytical results from 1995 to 2004, there is no further action required."
Remarks:	"10 MONITORING WELLS AT SITE,(2) WELLS SHOW PRODUCT, DEC (SIGONA) NOTIFIED."

All Materials:

Site ID:	114887
Operable Unit ID:	949507
Operable Unit:	01
Material ID:	428826
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9516811
Facility Type:	ER
Spill Number:	9516811
DER Facility ID:	100167
Site ID:	114888
DEC Region:	2
Spill Number/Closed Date:	1996-03-29
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	2401
Spill Date:	1996-03-28
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	1996-03-29
CID:	257
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-03-29
Spill Record Last Update:	1997-12-19
Spiller Name:	CHAN
Spiller Company:	STARRETT CITY POWER PLANT
Spiller Address:	165 ELMIRA LOOP
Spiller Company:	001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contact Name:	CHAN
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD ABC TANK CLEANING UP - MR. NASSAN SAYING SPILL CONTAINED IN THE TRANCH."
Remarks:	"crank case oil spilled last night all cleaned up "

All Materials:

Site ID:	114888
Operable Unit ID:	1031362
Operable Unit:	01
Material ID:	564041
Material Code:	0013
Material Name:	lube oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	75.00
Units:	G
Recovered:	75.00
Oxygenate:	Not reported

Facility ID:	9607764
Facility Type:	ER
Spill Number:	9607764
DER Facility ID:	100167
Site ID:	114889
DEC Region:	2
Spill Number/Closed Date:	1996-12-10
Spill Cause:	Human Error
Spill Class:	B3
SWIS:	2401
Spill Date:	1996-09-20
Investigator:	MMMULQUE
Referred To:	Not reported
Reported to Dept:	1996-09-20
CID:	270
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-09-20
Spill Record Last Update:	1996-12-10
Spiller Name:	CALLER
Spiller Company:	STARRETT CITY POWER PLANT
Spiller Address:	165 ELMIRA LOOP
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was MULQUEEN MULQUEEN INSPACETED CLEANUP. SPILL IN BACK OF BLDG, IN AREA WHERE THERE ARE ALREADY EXISTING MONITORING WELLS."
Remarks:	"emp did not slow down pumping procedure"

All Materials:

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Site ID:	114889
Operable Unit ID:	1035878
Operable Unit:	01
Material ID:	347021
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	200.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9812825
Facility Type:	ER
Spill Number:	9812825
DER Facility ID:	100167
Site ID:	114890
DEC Region:	2
Spill Number/Closed Date:	2003-11-03
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	1999-01-18
Investigator:	RWAUSTIN
Referred To:	Not reported
Reported to Dept:	1999-01-19
CID:	205
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-01-19
Spill Record Last Update:	2003-11-03
Spiller Name:	Not reported
Spiller Company:	HESS OIL CO
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was AUSTIN 11/3/03 - AUSTIN - MINOR SURF. SPILL - CLOSED - ORIG. ASSIGNED TO MULQUEEN - END"
Remarks:	"CALLER REPORTED SPILL THAT HAPPEN LAST NIGHT. UNK HOW IT HAPPENED. HESS DIDN'T NOTIFY ANYONE ON SITE. HESS ENROUTE TODAY FOR CLEANUP."

All Materials:

Site ID:	114890
Operable Unit ID:	1070083
Operable Unit:	01
Material ID:	313104
Material Code:	0003A
Material Name:	#6 fuel oil

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported
Facility ID:	9909916
Facility Type:	ER
Spill Number:	9909916
DER Facility ID:	100167
Site ID:	114891
DEC Region:	2
Spill Number/Closed Date:	1999-12-08
Spill Cause:	Equipment Failure
Spill Class:	B3
SWIS:	2401
Spill Date:	1999-11-16
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1999-11-16
CID:	257
Water Affected:	Not reported
Spill Source:	Major Facility (MOSF) > 400,000 gal
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1999-11-16
Spill Record Last Update:	2004-03-29
Spiller Name:	CALLER
Spiller Company:	STTARRETT CITY POWER ST.
Spiller Address:	165 ELMIRA LOOP
Spiller Company:	001
Contact Name:	CALLER
DEC Memo:	""
Remarks:	"Losse fitting was found product is in a containment area"

All Materials:

Site ID:	114891
Operable Unit ID:	1084670
Operable Unit:	01
Material ID:	298979
Material Code:	0513A
Material Name:	corrosion inhibitor
Case No.:	Not reported
Material FA:	Other
Quantity:	10.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported
Facility ID:	1700403

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Facility Type:	ER
Spill Number:	1700403
DER Facility ID:	100167
Site ID:	545400
DEC Region:	2
Spill Number/Closed Date:	2017-04-13
Spill Cause:	Equipment Failure
Spill Class:	C4
SWIS:	2401
Spill Date:	2017-04-12
Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	2017-04-12
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2017-04-12
Spill Record Last Update:	2017-04-13
Spiller Name:	DAVID STONE
Spiller Company:	STARRETT CITY POWER STATION
Spiller Address:	165 ELMIRA LOOP
Spiller Company:	999
Contact Name:	DAVID STONE
DEC Memo:	"4/12/17 TJD Teleconference with John Friel (Director, Power Plant) at Spring Creek Towers (STARRETT CITY POWER STATION). He states the facility is a MOSF, currently undergoing an upgrade and fuel conversion from #6 to #2 FO and is in the testing phase after the retrofit on the first of four boilers was completed. Spill was caused by a leaking union on 2 inch pipe suction line from 1 of 4 20K #2 UST's on site. There is also one 10K #2 UST at this site. Upon discovery of the leak, equipment was secured and an estimated 5 gallons of #2 FO was contained and cleaned from the affected concrete surfaces. No drains or soils were reported to have been affected by petroleum discharge. Mr. Friel ten stated he retained the services of ABC Tank who responded and completed the cleanup. As Mr. Freil stated the spill was cleaned prior to hiring a contractor, DeMeo reviewed all information provided a second time and requested a copy of the internal document summarizing the spill response. An email was received at 7:04PM with the requested information as follows: Mr. DeMeo, I apologize for missing your call. I understand from my Director that you wanted a copy of the e-mail I wrote, recapping the event of this afternoon. That e-mail follows below. Should you have any questions, please do not hesitate to call. Sincerely, David Stone Assistant Director, Power Plant Spring Creek Towers 165 Elmira Loop Brooklyn, NY 11239 (718) 942-0433 (917) 804-3178 Cell From: David Stone Sent: Wednesday, April 12, 2017 17:20 To: A.S. Qureshi Cc: John Friel; James Jaskiewicz; Mark B. Muir; William Fallon Subject: Fuel Oil Spill Salim, At about 3:25 this afternoon, an oil leak was discovered in the fuel oil pit of the Power Plant. #2 fuel oil was found on the floor of the pit. There was evidence of leakage, but no

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

I saw no sign that oil sprayed out under pressure. Staff took immediate measures to secure the source of the leak, which appears at this time to be one or more fittings on the #2 fuel oil lines. The leak looks to be on the new piping that was installed in support of the NOxRACT project. ABC Tank was contacted at approx. 3:45 PM, and they dispatched a vacuum truck to our location. The truck arrived at 4:00 PM, and clean-up began immediately. Oil was vacuumed from the floor the fuel oil pit, and that stage of the clean up was completed by 4:30. ABC then used soap solution to clean the remaining film of oil from the floor, and vacuumed up the used soap solution. By 5:00 PM, all clean up activities were complete. In accordance with NYS DEC regulations, I called this event into the DEC Spill Hotline at about 5PM. Spill #1070403 was assigned. In speaking with the DEC rep on the phone, I stressed that the spill was contained, the source immediately controlled, and clean-up was already completed, all within 2 hours of discovery. Before operating the new fuel oil pumps again, I would request AKS be brought on-site to evaluate and correct the source of the leak. - Dave David Stone Assistant Director, Power Plant Spring Creek Towers 165 Elmira Loop Brooklyn, NY 11239 (718) 942-0433 (917) 804-3178 Cell Based upon the information provided the spill is closed. Last inspection was 5/16/13. Tank #9 is 378,000 gallon #6 oil tank. Informed PBS/MOSF (Zielinski) of reported spill."

Remarks: "Union failed on line and spilled onto concrete. Cleanup is complete."
Not reported

All Materials:

Site ID:	545400
Operable Unit ID:	1293566
Operable Unit:	01
Material ID:	2299481
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	0006298
Facility Type:	ER
Spill Number:	0006298
DER Facility ID:	100167
Site ID:	146190
DEC Region:	2
Spill Number/Closed Date:	2003-11-13
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	2000-08-26
Investigator:	JMROMMEL
Referred To:	Not reported
Reported to Dept:	2000-08-28
CID:	270
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Affected Persons

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-08-28
Spill Record Last Update:	2003-11-14
Spiller Name:	JOE OLDACK
Spiller Company:	STARRETT POWER STATION
Spiller Address:	165 ELMIRE LOOP
Spiller Company:	001
Contact Name:	JOE OLDACK
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ROMMEL site visit confirmed spill was cleaned. "
Remarks:	"caller states that a contractor has put 6 oil into the city drinking water system. oil was coming out of the faucets a a kennel next door also. caller states that the entire water system at plat has been shut down also. caller very concerned and says that dec needs to get there and look into the matter"

All Materials:

Site ID:	146190
Operable Unit ID:	827304
Operable Unit:	01
Material ID:	547414
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

AIRS:

Permit Type:	ATV
Permit Status:	Expired
Issue Date:	11/10/2000
Expiration Date:	11/09/2005
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	7
Latitude:	40.647475517
Longitude:	73.884313541

Permit Type:	ATV
Permit Status:	Expired
Issue Date:	06/16/2011

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	06/15/2016
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	7
Latitude:	40.647475517
Longitude:	73.884313541

Permit Type:	ATV
Permit Status:	Issued
Issue Date:	07/05/2016
Expiration Date:	07/04/2021
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	2
Latitude:	40.647475517
Longitude:	73.884313541

Permit Type:	ATV
Permit Status:	Expired
Issue Date:	09/07/2005
Expiration Date:	11/09/2005
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	7
Latitude:	40.647475517
Longitude:	73.884313541

Permit Type:	ATV
Permit Status:	Expired
Issue Date:	01/26/2006
Expiration Date:	01/25/2011
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	7
Latitude:	40.647475517
Longitude:	73.884313541
Permit Type:	ATV
Permit Status:	Expired
Issue Date:	08/06/2003
Expiration Date:	11/09/2005
County Fips:	Not reported
DEC Id:	2610500263
Emission Unit Id:	Not reported
Process Id:	Not reported
Contaminant Name/cas:	Not reported
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	Not reported
Unit:	Not reported
Auth Type Code:	7
Latitude:	40.647475517
Longitude:	73.884313541
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.47999998
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0042
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	17.5900001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0085
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0043
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	6.786
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.20999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	0.0007
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	110543
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	445.25
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.97015002
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	12.062
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.07
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	14.658
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	110543
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	422.260009
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	01TANK
Process Id:	E01EI
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	5.062

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	22.552
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7439921
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.18
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.1065
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	108883
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	3.76999998
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id:	502FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	10.372
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0041
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.38999998
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	17.8899993
Unit:	LB

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 108883
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.83999997
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 101FP
Contaminant Name/cas: 7440439
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.37999999
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 101FP
Contaminant Name/cas: 191242
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0004
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	50328
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0085
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	180.320007
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas: 191242
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0004
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 129000
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0018
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 302FP
Contaminant Name/cas: NH3
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 428.799987
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 302FP
Contaminant Name/cas: 7440020
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0
Unit: LB
Auth Type Code: Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	22.7800006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.37268499
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.74000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	129000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.17
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	50000

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.04999995
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0005
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.61942999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	2.1400001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.31597311
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.31856946
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	191242
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0092
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	5.51
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.54000002
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	10.4099998
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	18.5499992
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	171.009994
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.73000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.74000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	107028
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.1

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	75070
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.18999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.61459997
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	218019
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0008
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.1104
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.15
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id: 401FP
Contaminant Name/cas: 7440020
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.76999998
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 301FP
Contaminant Name/cas: PM10-PRI
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 1.34123498
Unit: TON
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 102FP
Contaminant Name/cas: 7440473
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 101FP
Contaminant Name/cas: 7782492
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0084
Unit: LB

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	108883
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.61000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0009
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0032
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7439921
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.12999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.0175
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	17.2900009
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	37.66
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0044
Unit:	LB
Auth Type Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.14
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.10469999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.49000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	218019

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	108883
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.79000002
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.311
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	13.07025
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0011
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	1.01631858
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.17960577
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.27582798
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.36026691
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.37303757
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.39035404
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.35715318
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.34123828
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	PM25-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.38914583
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	75070
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.40999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	218019
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0029
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.34
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0022
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7440360
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id: 102FP
Contaminant Name/cas: 7439965
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 101FP
Contaminant Name/cas: NOX
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 48.86
Unit: TON
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 301FP
Contaminant Name/cas: 7440484
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.02
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 71432
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.50999999
Unit: LB

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	14.91
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.3175
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	107028
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.12999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.50295498
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas:	75070
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.33000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.28589001
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.21183999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0047
Unit:	LB
Auth Type Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.00453997
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	129000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0017
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.5
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.29999995
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.12999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	218019

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	12.8299999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.29145001
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.07
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0009
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	11.848
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	421.600006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	22.3899993
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	12.492
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0023
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	49.7
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	173.949996
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id: 000001
Process Id: 102FP
Contaminant Name/cas: 7440439
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 102FP
Contaminant Name/cas: 7440382
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 201FP
Contaminant Name/cas: 110543
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 325.459991
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000002
Process Id: 702FP
Contaminant Name/cas: 50328
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0042

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0011
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.09
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	1330207
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	3.19000005
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	50328
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0035
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id:	301FP
Contaminant Name/cas:	7439921
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.17
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	218019
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0036
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	18.4105
Unit:	TON

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000002
Process Id: 602FP
Contaminant Name/cas: 83329
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.05999999
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000002
Process Id: 602FP
Contaminant Name/cas: 1330207
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 2.58999991
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000002
Process Id: 602FP
Contaminant Name/cas: 129000
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.03999999
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.99000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	191242
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0042
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas: 120127
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0094
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 85018
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0042
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 50328
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0003
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 302FP
Contaminant Name/cas: SO2
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 12.6227998
Unit: TON
Auth Type Code: Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7440360
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	302FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.14
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.45898999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.67000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.4
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7440382

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.07
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.09
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.31856494
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.12999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	7439921
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.17
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440360
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	11.298
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.74277001
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	1.016315
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	131.809997
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0065
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.1
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	50328
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	101FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0008
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.49000001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	702FP
Contaminant Name/cas:	108883
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	4.63999986
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0084
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	50328
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.002

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	1330207
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.47000002
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	444
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0007
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id:	202FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0017
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0005
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7440484
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.37
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	56553
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	5.92000007
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	207089
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0017
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	108883
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	2.1400001
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.3875
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas: 129000
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.0018
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 301FP
Contaminant Name/cas: 108883
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.81
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 401FP
Contaminant Name/cas: 7440473
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 0.50999999
Unit: LB
Auth Type Code: Not reported
Latitude: Not reported
Longitude: Not reported

Permit Type: Not reported
Permit Status: Not reported
Issue Date: Not reported
Expiration Date: Not reported
County Fips: 36047
DEC Id: 2610500263
Emission Unit Id: 000001
Process Id: 402FP
Contaminant Name/cas: 50000
Epa Control Code: Not reported
Contol Eff: Not reported
Emissions: 23.5799999
Unit: LB
Auth Type Code: Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.60000002
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	218019
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.28655499
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	129000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0013
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.96176501
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	191242

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0075
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	129000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440360
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	9.1555
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440473
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	50000
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	13.5600004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	206440
Epa Control Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contol Eff:	Not reported
Emissions:	0.0008
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	602FP
Contaminant Name/cas:	205992
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.01
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	86737
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.09
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	107028
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.05999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440417
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0023
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.12999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.74520001
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	NH3
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	325.600006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.08069999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	91203
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.10999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0031

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.56
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	3.132
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.30177999
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	7782492
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0088
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Process Id:	201FP
Contaminant Name/cas:	7440439
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.28999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	71432
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.37
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	50328
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0002
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	218019
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	85018
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.31
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7440020
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	7439976
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.09
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	102FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	12.4108496
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	191242
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0004
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	VOC
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.22130499
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Contaminant Name/cas:	CO
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	15.456
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000002
Process Id:	502FP
Contaminant Name/cas:	83329
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.02999999
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	191242
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0003
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	SO2
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	9.5848496
Unit:	TON
Auth Type Code:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	301FP
Contaminant Name/cas:	110543
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	429.519989
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	402FP
Contaminant Name/cas:	7439965
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	PM10-PRI
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	1.39034997
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported

SPRING CREEK TOWERS POWER PLANT (Continued) **S102239579**

Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	202FP
Contaminant Name/cas:	7440382
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	201FP
Contaminant Name/cas:	120127
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	0.0006
Unit:	LB
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Permit Type:	Not reported
Permit Status:	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
County Fips:	36047
DEC Id:	2610500263
Emission Unit Id:	000001
Process Id:	401FP
Contaminant Name/cas:	NOX
Epa Control Code:	Not reported
Contol Eff:	Not reported
Emissions:	51.52
Unit:	TON
Auth Type Code:	Not reported
Latitude:	Not reported
Longitude:	Not reported

X120 **STARRETT CITY POWER PLANT** **RCRA-CESQG** **1000368739**
East **165 ELMIRA LOOP** **NY MOSF UST** **NYD982186819**
1/4-1/2 **BROOKLYN, NY 11239** **NY CBS AST**
0.343 mi. **NY MOSF AST**
1809 ft. **Site 2 of 2 in cluster X** **ICIS**
US AIRS
Relative: **FINDS**
Higher **ECHO**
NJ MANIFEST
Actual: **NY MANIFEST**
19 ft.

RCRA-CESQG:

Date form received by agency:	01/01/2007
Facility name:	STARRETT CITY POWER STA CO-GENERATION
Facility address:	165 ELMIRA LOOP BROOKLYN, NY 11239
EPA ID:	NYD982186819
Mailing address:	ELMIRA LOOP BROOKLYN, NY 11239
Contact:	Not reported
Contact address:	ELMIRA LOOP BROOKLYN, NY 11239
Contact country:	US
Contact telephone:	Not reported
Contact email:	Not reported
EPA Region:	02
Classification:	Conditionally Exempt Small Quantity Generator
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name:	STARRETT CITY INC
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	212-555-1212
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported

Owner/operator name:	STARRETT CITY INC
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999

STARRETT CITY POWER PLANT (Continued) **1000368739**

Owner/operator country: US
Owner/operator telephone: 212-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:
Date form received by agency: 01/01/2006
Site name: STARRETT CITY POWER STA CO-GENERATION
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 05/22/1995
Site name: STARRETT CITY POWER STA CO-GENERATION
Classification: Not a generator, verified

. Waste code: NONE
. Waste name: None

Date form received by agency: 05/18/1987
Site name: STARRETT CITY POWER STA CO-GENERATION
Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE WASTE

Violation Status: No violations found

MOSF UST:
Id/Status: 2-2460 / ACTIVE FACILITY
SWIS Code: 61
Facility Town: NEW YORK CITY
Contact Phone: (718) 942-0433
Emergency Contact: CONTROL ROOM
Emergency Telephone: (718) 942-0496
CBS Number: 2-000223
SPDES Num: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Total Tanks:	9
Total Capacity:	470250
Avg Throughput:	35000
License Stat:	1
Facility Type:	APARTMENT BUILDING
Prod Xfer Options:	Tank Truck
Expiration Date:	03/31/2004
Applic Rcvd:	02/24/1999
Operator:	AL NASSAN
Owner Name:	STARRETT CITY AT SPRING CREEK INC
Owner Address:	1310 PENNYSLVANIA AVENUE
Owner City,St,Zip:	BROOKLYN, NY 11239-
Owner Telephone:	(718) 642-8700
Owner Type:	Corporate/Commercial
Owner Status:	1
Owner Mark:	First Owner
Mail To Name:	STARRETT CITY TOTAL ENERGY PLANT
Mail To Address:	165 ELMIRA LOOP
Mail To Address 2:	Not reported
Mail City,St,Zip:	BROOKLYN, NY 11239-
Mail To Contact:	AL NASSAN
Mail To Telephone:	(718) 942-0433
Legal Agent Name:	GRENADIER REALTY
Legal Agent Address:	1310 PENNYSLVANIA AVENUE
Legal Agent City,St,Zip:	BROOKLYN, NY 11239-
Date Filed:	09/86
Latitude:	40|38|30
Longitude:	73|52|45

Tank ID:	TK-10
Tank Location:	UNDERGROUND
Install Date:	12/70
Capacity (Gal):	10000
Product:	NOS 1,2, OR 4 FUEL OIL
Tank Status:	In Service
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	Painted/Asphalt Coating
Pipe Location:	Underground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	56
Second Contain:	None
Leak Detection:	Groundwater Well
Overfill Protection:	Vent Whistle
Dispenser:	Suction
Test Date:	02/92
Date Closed:	Not reported
Status of Data:	Complete
Inspected Date:	06/16/1999
Inspector Initials:	AS
Inspector Status:	Not reported
Pipe Flag:	True
License Issued:	04/01/1999
Vessel Id:	Not reported
Renew Flag:	True
Renew Date:	12/11/1998

STARRETT CITY POWER PLANT (Continued) **1000368739**

Federal Id No: Not reported
COI Date: / /

Tank ID: TK-10X1
Tank Location: UNDERGROUND
Install Date: 10/75
Capacity (Gal): 20000
Product: NOS 1,2, OR 4 FUEL OIL
Tank Status: In Service
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 56
Second Contain: None
Leak Detection: Groundwater Well
Overfill Protection: Vent Whistle
Dispenser: Suction
Test Date: 02/92
Date Closed: Not reported
Status of Data: Complete
Inspected Date: 06/16/1999
Inspector Initials: AS
Inspector Status: Not reported
Pipe Flag: True
License Issued: 04/01/1999
Vessel Id: Not reported
Renew Flag: True
Renew Date: 12/11/1998
Federal Id No: Not reported
COI Date: / /

Tank ID: TK-10X2
Tank Location: UNDERGROUND
Install Date: 10/75
Capacity (Gal): 20000
Product: NOS 1,2, OR 4 FUEL OIL
Tank Status: In Service
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 56
Second Contain: None
Leak Detection: Groundwater Well
Overfill Protection: Vent Whistle
Dispenser: Suction
Test Date: 02/92
Date Closed: Not reported
Status of Data: Complete
Inspected Date: 06/16/1999

STARRETT CITY POWER PLANT (Continued) **1000368739**

Inspector Initials: AS
Inspector Status: Not reported
Pipe Flag: True
License Issued: 04/01/1999
Vessel Id: Not reported
Renew Flag: True
Renew Date: 12/11/1998
Federal Id No: Not reported
COI Date: / /

Tank ID: TK-10X3
Tank Location: UNDERGROUND
Install Date: 10/75
Capacity (Gal): 20000
Product: NOS 1,2, OR 4 FUEL OIL
Tank Status: In Service
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 56
Second Contain: None
Leak Detection: Groundwater Well
Overfill Protection: Vent Whistle
Dispenser: Suction
Test Date: 02/92
Date Closed: Not reported
Status of Data: Complete
Inspected Date: 06/16/1999
Inspector Initials: AS
Inspector Status: Not reported
Pipe Flag: True
License Issued: 04/01/1999
Vessel Id: Not reported
Renew Flag: True
Renew Date: 12/11/1998
Federal Id No: Not reported
COI Date: / /

Tank ID: TK-10X4
Tank Location: UNDERGROUND
Install Date: 10/75
Capacity (Gal): 20000
Product: NOS 1,2, OR 4 FUEL OIL
Tank Status: In Service
Tank Type: Steel/carbon steel
Tank Internal: None
Tank External: Painted/Asphalt Coating
Pipe Location: Underground
Pipe Type: STEEL/IRON
Pipe Internal: None
Pipe External: 56
Second Contain: None

STARRETT CITY POWER PLANT (Continued) **1000368739**

Leak Detection:	Groundwater Well
Overfill Protection:	Vent Whistle
Dispenser:	Suction
Test Date:	02/92
Date Closed:	Not reported
Status of Data:	Complete
Inspected Date:	06/16/1999
Inspector Initials:	AS
Inspector Status:	Not reported
Pipe Flag:	True
License Issued:	04/01/1999
Vessel Id:	Not reported
Renew Flag:	True
Renew Date:	12/11/1998
Federal Id No:	Not reported
COI Date:	/ /

CBS AST:

CBS Number:	2-000370
ICS Number:	Not reported
PBS Number:	Not reported
MOSF Number:	Not reported
SPDES Number:	Not reported
Facility Status:	IN SERVICE
Facility Type:	E
Telephone:	(718) 942-0433
Facility Town:	NEW YORK CITY
Region:	STATE
Expiration Date:	11/21/2002
Total Capacity of All Active Tanks(gal):	400
Operator:	JOSEPH OLDAK
Emergency Contact:	J.ODLAK/R.JOHN
Emergency Phone:	(718) 942-0433
Owner Name:	STARRETT CITY & SPRING CREEK, INC.
Owner Address:	1310 PENNSYLVANIA AVENUE
Owner City,St,Zip:	BROOKLYN, NY 11239
Owner Telephone:	(718) 642-8700
Owner Type:	Corporate/Commercial
Owner Sub Type:	Not reported
Mail Name:	STARRETT & SPRING CREEK TOTAL ENERGY PLANT
Mail Contact Addr:	165 ELMIRA LOOP
Mail Contact Addr2:	Not reported
Mail Contact Contact:	JOSEPH OLDAK
Mail Contact City,St,Zip:	BROOKLYN, NY 11239
Mail Phone:	(718) 942-0433

Tank Id:	98215
CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	10/00
Tank Closed:	Not reported
Capacity (Gal):	200
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	2

STARRETT CITY POWER PLANT (Continued) **1000368739**

Tank Secret:	False
Tank Secondary Containment:	Other
Tank Error Status:	No Missing Data
Date Entered:	11/21/2000
Certified Date:	11/21/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	None
Pipe Flag:	None
Leak Detection:	None
Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	6101
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	False
Pre-Printed Renewal App Last Printed:	/ /

Tank Id:	982516
CAS Number:	1310732
Federal ID:	Not reported
Tank Status:	In Service
Install Date:	10/00
Tank Closed:	Not reported
Capacity (Gal):	200
Chemical:	Sodium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Fiberglass reinforced plastic [FRP]
Total Tanks:	2
Tank Secret:	False
Tank Secondary Containment:	Other
Tank Error Status:	No Missing Data
Date Entered:	11/21/2000
Certified Date:	11/21/2000
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None
Pipe Location:	Aboveground
Pipe Type:	Double Walled Fiberglass
Pipe Internal:	None
Pipe External:	None
Pipe Flag:	None
Leak Detection:	None

STARRETT CITY POWER PLANT (Continued) **1000368739**

Overfill Protection:	Catch Basin
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	6101
Lat/Long:	Not reported
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	False
Fiscal Amt for Registration Fee Correct:	True
Renewal Has Been Printed for Facility:	False
Pre-Printed Renewal App Last Printed:	/ /

Tank Id:	TK F-1
CAS Number:	107211
Federal ID:	Not reported
Tank Status:	0
Install Date:	04/92
Tank Closed:	00/00
Capacity (Gal):	500
Chemical:	Ethylene glycol
Tank Location:	Indoors, Belowground
Tank Type:	Steel/carbon steel
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	None
Tank Error Status:	No Missing Data
Date Entered:	09/09/1996
Certified Date:	06/26/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Pipe Flag:	Painted/Asphalt Coating
Leak Detection:	None
Overfill Protection:	Product Level Gauge
Haz Percent:	10
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	6101
Lat/Long:	40|38|90 / 73|52|45
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	40|38|90 / 73|52|45
Fiscal Amt for Registration Fee Correct:	40|38|90 / 73|52|45

STARRETT CITY POWER PLANT (Continued) **1000368739**

Renewal Has Been Printed for Facility: 40|38|90 / 73|52|45
Pre-Printed Renewal App Last Printed: 40|38|90 / 73|52|45

MOSF AST:

MOSF Number:	2-2460
SWIS Code:	61
Facility Town:	NEW YORK CITY
Facility Phone:	(718) 942-0433
Emergency Contact Name:	CONTROL ROOM
Emergency Contact Phone:	(718) 942-0496
Total Tanks:	9
Total Capacity:	470250
Daily Throughput:	35000
License Status:	1
Facility Type:	APARTMENT BUILDING
Product Transfer Operation:	Tank Truck
Facility Status:	IN SERVICE
Operator Name:	AL NASSAN
Owner Name:	STARRETT CITY AT SPRING CREEK INC
Owner Address:	1310 PENNYSLVANIA AVENUE
Owner City,St,Zip:	BROOKLYN, NY 11239-
Owner Phone:	(718) 642-8700
Owner Type:	Corporate/Commercial
Owner Status:	1
Owner Mark:	First Owner
Mailing Name:	STARRETT CITY TOTAL ENERGY PLANT
Mailing Address:	165 ELMIRA LOOP
Mailing Address 2:	Not reported
Mailing City,St,Zip:	BROOKLYN, NY 11239-
Mailing Contact:	AL NASSAN
Mailing Phone:	(718) 942-0433
Legal Agent Name:	GRENADIER REALTY
Legal Agent Address:	1310 PENNYSLVANIA AVENUE
Legal Agent City,St,Zip:	BROOKLYN, NY 11239-
LIC Expires:	03/31/2004

Tank ID:	TK-09
Tank Location:	ABOVEGROUND
Install Date:	12/70
Product:	NOS 5 OR 6 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	CATHODIC PROTECTION
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	56
Secondary Containment:	Prefabricated Steel Dike
Leak Detection:	03
Overfill Protection:	24
Dispensing Mthd:	Suction
Test Date:	05/92
Date Closed:	Not reported
Status of Data:	Complete
Capacity (gal):	378000
Lat/Long:	40|38|30 / 73|52|45
Federal ID:	Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Inspected Date:	06/16/1999
Inspector:	AS
Renew Date:	12/11/1998
Inspected State:	Not reported
Pipe Flag:	True
Vessel ID:	Not reported
Reserve Flag:	True
Tank Status:	In Service
COI Date:	/ /
Date License Issued:	04/01/1999
Date License Application Received:	02/24/1999
Chemical Bulk Storage Number:	2-000223
Pollution Discharge Elimination System Num:	Not reported
Date Legal Agent Filed with Secretary of State:	09/86

Tank ID:	TK-04
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Install Date:	12/70
Product:	NOS 1,2, OR 4 FUEL OIL
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	CATHODIC PROTECTION
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Secondary Containment:	Concrete Dike
Leak Detection:	00
Overfill Protection:	Vent Whistle
Dispensing Mthd:	Gravity
Test Date:	05/91
Date Closed:	Not reported
Status of Data:	Complete
Capacity (gal):	250
Lat/Long:	40|38|30 / 73|52|45
Federal ID:	Not reported
Inspected Date:	06/16/1999
Inspector:	AS
Renew Date:	12/11/1998
Inspected State:	Not reported
Pipe Flag:	True
Vessel ID:	Not reported
Reserve Flag:	True
Tank Status:	In Service
COI Date:	/ /
Date License Issued:	04/01/1999
Date License Application Received:	02/24/1999
Chemical Bulk Storage Number:	2-000223
Pollution Discharge Elimination System Num:	Not reported
Date Legal Agent Filed with Secretary of State:	09/86

Tank ID:	TK-11
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Install Date:	12/70
Product:	UNKNOWN

STARRETT CITY POWER PLANT (Continued) **1000368739**

Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	CATHODIC PROTECTION
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Secondary Containment:	Concrete Dike
Leak Detection:	00
Overfill Protection:	Product Level Gauge
Dispensing Mthd:	Gravity
Test Date:	07/90
Date Closed:	Not reported
Status of Data:	Complete
Capacity (gal):	1000
Lat/Long:	40|38|30 / 73|52|45
Federal ID:	Not reported
Inspected Date:	06/16/1999
Inspector:	AS
Renew Date:	12/11/1998
Inspected State:	Not reported
Pipe Flag:	True
Vessel ID:	Not reported
Reserve Flag:	True
Tank Status:	In Service
COI Date:	/ /
Date License Issued:	04/01/1999
Date License Application Received:	02/24/1999
Chemical Bulk Storage Number:	2-000223
Pollution Discharge Elimination System Num:	Not reported
Date Legal Agent Filed with Secretary of State:	09/86

Tank ID:	TK-12
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Install Date:	12/70
Product:	UNKNOWN
Tank Type:	Steel/carbon steel
Tank Internal:	None
Tank External:	CATHODIC PROTECTION
Pipe Location:	Aboveground/Underground Combination
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Secondary Containment:	Concrete Dike
Leak Detection:	00
Overfill Protection:	Product Level Gauge
Dispensing Mthd:	Gravity
Test Date:	07/90
Date Closed:	Not reported
Status of Data:	Complete
Capacity (gal):	1000
Lat/Long:	40|38|30 / 73|52|45
Federal ID:	Not reported
Inspected Date:	06/16/1999
Inspector:	AS
Renew Date:	12/11/1998

STARRETT CITY POWER PLANT (Continued) **1000368739**

Inspected State:	Not reported
Pipe Flag:	True
Vessel ID:	Not reported
Reserve Flag:	True
Tank Status:	In Service
COI Date:	/ /
Date License Issued:	04/01/1999
Date License Application Received:	02/24/1999
Chemical Bulk Storage Number:	2-000223
Pollution Discharge Elimination System Num:	Not reported
Date Legal Agent Filed with Secretary of State:	09/86

ICIS:

Enforcement Action ID:	NY000A0000261050026300387
FRS ID:	110001570773
Action Name:	Not reported
Facility Name:	STARRETT CITY POWER PLANT
Facility Address:	165 ELMIRA LOOP BROOKLYN, NY 11239
Enforcement Action Type:	Administrative Order
Facility County:	KINGS
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Formal
EA Type Code:	SCAAAO
Facility SIC Code:	6514
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	40.647476
Longitude in Decimal Degrees:	73.8843135
Permit Type Desc:	Not reported
Program System Acronym:	NY0000002610500263
Facility NAICS Code:	531110
Tribal Land Code:	Not reported

Enforcement Action ID:	NY000A0000261050026300363
FRS ID:	110001570773
Action Name:	Not reported
Facility Name:	STARRETT CITY POWER PLANT
Facility Address:	165 ELMIRA LOOP BROOKLYN, NY 11239
Enforcement Action Type:	Notice of Violation
Facility County:	KINGS
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	6514
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	40.647476
Longitude in Decimal Degrees:	73.8843135
Permit Type Desc:	Not reported
Program System Acronym:	NY0000002610500263
Facility NAICS Code:	531110
Tribal Land Code:	Not reported

Enforcement Action ID:	NY000A0000261050026300308
FRS ID:	110001570773
Action Name:	STARRETT CITY POWER PLANT 360470013500308
Facility Name:	STARRETT CITY POWER PLANT

STARRETT CITY POWER PLANT (Continued) **1000368739**

Facility Address:	165 ELMIRA LOOP BROOKLYN, NY 11239
Enforcement Action Type:	Notice of Violation
Facility County:	KINGS
Program System Acronym:	AIR
Enforcement Action Forum Desc:	Administrative - Informal
EA Type Code:	NOV
Facility SIC Code:	6514
Federal Facility ID:	Not reported
Latitude in Decimal Degrees:	40.647476
Longitude in Decimal Degrees:	73.8843135
Permit Type Desc:	Not reported
Program System Acronym:	NY0000002610500263
Facility NAICS Code:	531110
Tribal Land Code:	Not reported

US AIRS (AFS):

Envid:	1000368739
Region Code:	02
County Code:	NY047
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
D and B Number:	Not reported
Facility Site Name:	STARRETT CITY POWER PLANT
Primary SIC Code:	6514
NAICS Code:	531110
Default Air Classification Code:	MAJ
Facility Type of Ownership Code:	Not reported
Air CMS Category Code:	TVM
HPV Status:	ADDRESSED HPV

US AIRS (AFS):

Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	40 CFR Part 63 Area Sources
Activity Date:	2014-07-31 00:00:00
Activity Status Date:	2016-05-02 13:12:25
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active

Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	40 CFR Part 63 Area Sources
Activity Date:	2014-07-31 00:00:00
Activity Status Date:	2016-05-02 14:07:07
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2015-01-30 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2015-04-06 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: 40 CFR Part 63 Area Sources
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2015-01-30 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2015-04-06 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: MACT Standards (40 CFR Part 63)
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type:	Inspection/Evaluation
Activity Status:	Active
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Prevention of Accidental Release/General Duty Clause
Activity Date:	2014-07-31 00:00:00
Activity Status Date:	2016-05-02 14:07:07
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Prevention of Accidental Release/General Duty Clause
Activity Date:	2015-01-30 00:00:00
Activity Status Date:	2016-05-02 13:12:25
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Prevention of Accidental Release/General Duty Clause
Activity Date:	2015-04-06 00:00:00
Activity Status Date:	2016-05-02 13:12:25
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Prevention of Accidental Release/General Duty Clause
Activity Date:	2015-08-03 00:00:00
Activity Status Date:	2016-05-02 13:12:25
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Active
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Prevention of Accidental Release/General Duty Clause

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-02-25 00:00:00
Activity Status Date: 2011-04-26 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Resolved

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-01-30 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-04-06 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1977-11-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-03-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-10-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-10-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1991-02-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1993-09-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1998-03-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-02-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-04-26 00:00:00
Activity Status Date: 2011-04-26 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Formal
Activity Status: Resolved

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-06-25 00:00:00
Activity Status Date: 2002-06-25 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-02-25 00:00:00
Activity Status Date: 2011-02-25 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-01-30 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-04-06 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-07-31 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-01-30 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2015-04-06 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 13:12:25
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-08-03 00:00:00
Activity Status Date: 2016-05-02 14:07:07
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2016-01-26 00:00:00
Activity Status Date: 2016-06-09 07:01:20
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2016-05-12 00:00:00
Activity Status Date: 2016-06-09 07:01:21
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2016-06-20 00:00:00
Activity Status Date: 2016-07-09 11:05:42
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2000-02-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2001-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-01-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-02-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-06-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-08-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-08-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-12-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-03-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2003-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-08-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-02-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2005-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2005-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-04-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2007-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2007-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-03-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-06-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2009-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date: 2009-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-01-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-04-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-06-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-01-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773

STARRETT CITY POWER PLANT (Continued) **1000368739**

Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-02-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-07-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-09-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-10-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2013-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2013-07-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-04-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-06-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000002610500263
Facility Registry ID: 110001570773
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits

STARRETT CITY POWER PLANT (Continued) **1000368739**

Activity Date:	2011-04-26 00:00:00
Activity Status Date:	2011-04-26 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Formal
Activity Status:	Resolved
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Title V Permits
Activity Date:	2002-06-25 00:00:00
Activity Status Date:	2002-06-25 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	02
Programmatic ID:	AIR NY0000002610500263
Facility Registry ID:	110001570773
Air Operating Status Code:	OPR
Default Air Classification Code:	MAJ
Air Program:	Title V Permits
Activity Date:	2011-02-25 00:00:00
Activity Status Date:	2011-02-25 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved

FINDS:

Registry ID: 110001570773

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

US Emissions & Generation Resource Database (EGRID) contains data on emissions and resource mix for virtually every power plant and company

STARRETT CITY POWER PLANT (Continued) **1000368739**

that generates electricity in the United States.

ELECTRIC GENERATOR

AIR MAJOR

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

GREENHOUSE GAS REPORTER

HAZARDOUS AND CRITERIA AIR POLLUTANT MAJOR

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1000368739
Registry ID:	110001570773
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110001570773

NJ MANIFEST:

EPA Id:	NYD982186819
Mail Address:	ELMIRA LOOP
Mail City/State/Zip:	BROOKLYN, NY 11239
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	Not reported
Comments:	Not reported
SIC Code:	Not reported
County:	NY047
Municipal:	Not reported
Previous EPA Id:	Not reported
Gen Flag:	Not reported
Trans Flag:	Not reported
TSDF Flag:	Not reported
Name Change:	Not reported
Date Change:	Not reported

Manifest:

Manifest Number:	003491731FLE
EPA ID:	NYD982186819
Date Shipped:	07/28/2010
TSDF EPA ID:	NJD980536593
Transporter EPA ID:	NJD054126164
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/28/2010

STARRETT CITY POWER PLANT (Continued) **1000368739**

Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/28/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BROOKLYN, NY 11239
Reason Load Was Rejected:	Not reported

Waste:

Manifest Year:	Not reported
Waste Code:	F002
Hand Code:	H141
Quantity:	800 P

Manifest Year:	Not reported
Waste Code:	F002
Hand Code:	H141
Quantity:	4000 P

NY MANIFEST:

Country:	USA
EPA ID:	NYD982186819
Facility Status:	Not reported
Location Address 1:	1356 PENNSYLVANIA AVENUE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BROOKLYN
Location State:	NY
Location Zip:	11239
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD982186819
Mailing Name:	STARRETT CITY INC TOTAL ENERGY PLANT
Mailing Contact:	ALBERT C NASSAN
Mailing Address 1:	165 ELMIRA LOOP

STARRETT CITY POWER PLANT (Continued) **1000368739**

Mailing Address 2:	Not reported
Mailing City:	BROOKLYN
Mailing State:	NY
Mailing Zip:	11239
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7184627000

NY MANIFEST:

Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2013
Trans1 State ID:	NYD986908085
Trans2 State ID:	NYD082785429
Generator Ship Date:	09/09/2013
Trans1 Recv Date:	09/09/2013
Trans2 Recv Date:	09/10/2013
TSD Site Recv Date:	09/25/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD982186819
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD085690592
TSDF ID 2:	Not reported
Manifest Tracking Number:	000346680JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	227
Units:	P - Pounds
Number of Containers:	3
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	1
Waste Code:	B004
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

STARRETT CITY POWER PLANT (Continued) **1000368739**

Click this hyperlink while viewing on your computer to access
20 additional NY_MANIFEST: record(s) in the EDR Site Report.

121
ENE
1/4-1/2
0.345 mi.
1820 ft.

WATER POLLUTION CONTROL P **NY LTANKS** **S108059464**
26TH WARD **N/A**
BROOKLYN, NY

Relative:
Lower

Actual:
13 ft.

LTANKS:

Facility ID:	0604069
Site ID:	366952
Spill Number/Closed Date:	2006-07-13
Spill Date:	2006-07-12
Spill Cause:	Tank Overfill
Spill Source:	Commercial/Industrial
Spill Class:	D5
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SMSANGES
Referred To:	Not reported
Reported to Dept:	2006-07-12
CID:	41
Water Affected:	HENDRIX CREEK
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2006-07-13
Spill Record Last Update:	2006-07-13
Spiller Name:	Not reported
Spiller Company:	WATER POLLUTION CONTROL P
Spiller Address:	26TH WARD
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	316981
DEC Memo:	""
Remarks:	"#1 PRETANK OUT OF SERVICE - PLANT PUMPING 127 NGD"

All Materials:

Site ID:	366952
Operable Unit ID:	1124878
Operable Unit:	01
Material ID:	2114386
Material Code:	0062A
Material Name:	raw sewage
Case No.:	Not reported
Material FA:	Other
Quantity:	Not reported
Units:	G
Recovered:	.00
Oxygenate:	Not reported

122
NW
1/4-1/2
0.379 mi.
1999 ft.

PUBLIC SCHOOL 260 - BROOKLYN K260
875 WILLIAMS AVENUE
BROOKLYN, NY 11207

NY LTANKS **U000409385**
NY UST **N/A**

Relative:
Lower

Actual:
10 ft.

LTANKS:

Facility ID:	9500631
Site ID:	63458
Spill Number/Closed Date:	2014-11-18
Spill Date:	1995-04-13
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	C3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	TJDEMEO
Referred To:	Not reported
Reported to Dept:	1995-04-17
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1995-05-15
Spill Record Last Update:	2014-11-18
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	61296
DEC Memo:	"6/20/05- Reassigned to Benjamin 1/20/10. J.Krimgold reviewed the case and found that the initialy report address Williams Street does not exists in NYC. Most likely the address is Williams Avenue. This address corresponds with PS 260 and this facility has a UST that stors #4 oil. TTF letter was sent to: Raymond Correa NYC Board of Education 28-11 Queens Plaza North, L.I.C., NY 11101 08/13/12 - LZ As Randy Austin requested, the spill has been reassigned to Tim DeMeo 10/09/14-Hiralkumar Patel. reviewed available documents for DEC DeMeo. alternate address: 857-897 Williams Ave, 342-352 Stanley Ave no other spills found. PBS #: 2-354309. as per PBS record, the site has two (2) 7,500 gal #4 oil USTs, in-service, installed in Aug. 1953. NYC Department of Education Field Operations - Fuel Division 44-36 Vernon Blvd. Long Island City, NY 11101 Attn.: Munendra Sharma Ph. (718) 349-5752 as per tank testing record, on PBC edocs, both #4 oil tanks failed a tightness test on 04/13/1995 (subject spill) and both tanks passed the test on 06/16/1995. 11/18/14 TJD File review - as per above, both tanks failed tightness tests on 4/13/95 and passed subsequent tightness tests on 6/16/95. Test reports uploaded to DECDOCS from PBS EDOCS. No further information available regarding cause of failure or repairs performed. Spill administratively closed."
	Not reported

PUBLIC SCHOOL 260 - BROOKLYN K260 (Continued) **U000409385**

Remarks: "ATTEMPTED TO CONTACT FLOYD LIVERMONE, N/A 4/17/95 1:30 P.M., MIKE GIUSTINIANI - STATE ENVIRONMENT - TANKS TO BE PUMPED OUT -"

All TTF:

Facility ID:	9500631
Spill Number:	9500631
Spill Tank Test:	1543742
Site ID:	63458
Tank Number:	Not reported
Tank Size:	0
Material:	0002
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	63458
Operable Unit ID:	1011526
Operable Unit:	01
Material ID:	369249
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

UST:

Id/Status:	2-354309 / Active
Program Type:	PBS
Region:	STATE
DEC Region:	2
Expiration Date:	06/28/2018
UTM X:	593430.52711
UTM Y:	4500881.71437
Site Type:	School

Affiliation Records:

Site Id:	17611
Affiliation Type:	Emergency Contact
Company Name:	NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	SCHOOL SAFETY
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN

PUBLIC SCHOOL 260 - BROOKLYN K260 (Continued) **U000409385**

Zip Code:	Not reported
Country Code:	999
Phone:	(718) 935-3300
EMail:	Not reported
Fax Number:	Not reported
Modified By:	GDBREEN
Date Last Modified:	2014-09-10

Site Id:	17611
Affiliation Type:	Facility Operator
Company Name:	PUBLIC SCHOOL 260 - BROOKLYN
Contact Type:	Not reported
Contact Name:	PLANT OPERATIONS
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(718) 349-5400
EMail:	Not reported
Fax Number:	Not reported
Modified By:	TRANSLAT
Date Last Modified:	2004-03-04

Site Id:	17611
Affiliation Type:	Mail Contact
Company Name:	NYC DEPARTMENT OF EDUCATION
Contact Type:	Not reported
Contact Name:	MUNENDRA SHARMA
Address1:	FIELD OPERATIONS-FUEL DIVISION
Address2:	44-36 VERNON BOULEVARD
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 349-5752
EMail:	MSHARMA@SCHOOLS.NYC.GOV
Fax Number:	Not reported
Modified By:	DAFRANCI
Date Last Modified:	2017-04-26

Site Id:	17611
Affiliation Type:	Facility Owner
Company Name:	NEW YORK CITY DEPARTMENT OF EDUCATION
Contact Type:	MANAGER, FUEL DIVISION
Contact Name:	MUNENDRA SHARMA
Address1:	44-36 VERNON BOULEVARD
Address2:	Not reported
City:	LONG ISLAND CITY
State:	NY
Zip Code:	11101
Country Code:	001
Phone:	(718) 349-5752
EMail:	Not reported
Fax Number:	Not reported
Modified By:	DAFRANCI

PUBLIC SCHOOL 260 - BROOKLYN K260 (Continued) **U000409385**

Date Last Modified: 2017-05-23

Tank Info:

Tank Number: 001
Tank ID: 34482
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 7500
Install Date: 08/28/1953
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0002
Common Name of Substance: #4 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 06/12/2013
Next Test Date: 10/11/2016
Pipe Model: Not reported
Modified By: GDBREEN
Last Modified: 04/14/2017

Equipment Records:

C03 - Pipe Location - Aboveground/Underground Combination
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
L00 - Piping Leak Detection - None

Tank Number: 002
Tank ID: 34483
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 7500
Install Date: 08/28/1953
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0002
Common Name of Substance: #4 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 06/12/2013
Next Test Date: 10/11/2016
Pipe Model: Not reported
Modified By: GDBREEN

PUBLIC SCHOOL 260 - BROOKLYN K260 (Continued) **U000409385**

Last Modified: 04/14/2017

Equipment Records:

L00 - Piping Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
C03 - Pipe Location - Aboveground/Underground Combination
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron
F01 - Pipe External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None

123
North
1/4-1/2
0.408 mi.
2154 ft.

HESS/MERIT STATION 32STA **NY LTANKS** **S103574868**
810 PENNSYLVANIA AVE **NY Spills** **N/A**
BROOKLYN, NY

Relative:
Lower

Actual:
13 ft.

LTANKS:

Facility ID:	8801521
Site ID:	273086
Spill Number/Closed Date:	1988-09-30
Spill Date:	1988-05-18
Spill Cause:	Tank Overfill
Spill Source:	Tank Truck
Spill Class:	Not reported
Cleanup Ceased:	1988-09-30
SWIS:	2401
Investigator:	SULLIVAN
Referred To:	Not reported
Reported to Dept:	1988-05-19
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1988-05-20
Spill Record Last Update:	2005-06-17
Spiller Name:	Not reported
Spiller Company:	ISLAND TRANSPORTATION COR
Spiller Address:	810 PENNSYLVANIA AVENUE
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	62182
DEC Memo:	""
Remarks:	"SPILLER PERSONNEL UNSEEN, APPEARS TO HAVE FLUSHED INTO SEWER SYSTEM, MARINE POLLUTION IS UNSEEN AND THERE IS NO RESIDUE IN SEWER."

HESS/MERIT STATION 32STA (Continued) **S103574868**

All Materials:

Site ID:	273086
Operable Unit ID:	917003
Operable Unit:	01
Material ID:	460664
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	150.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9010161
Site ID:	273087
Spill Number/Closed Date:	1994-07-22
Spill Date:	1990-12-18
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	A3
Cleanup Ceased:	1994-07-22
SWIS:	2401
Investigator:	MCTIBBE
Referred To:	Not reported
Reported to Dept:	1990-12-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-03-15
Spill Record Last Update:	2005-06-17
Spiller Name:	Not reported
Spiller Company:	MERIT
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	62182
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TIBBE 08/02/94: CROSS REFERENCE TO SPILL 9214515. "
Remarks:	"2K & 4K TANK SYSTEM FAILED PETRO TITE WITH A LEAK RATE OF -.340GPH, WILL EXCAVATE,ISOLATE & RETEST."

All TTF:

Facility ID:	9010161
Spill Number:	9010161
Spill Tank Test:	1538061
Site ID:	273087
Tank Number:	Not reported

HESS/MERIT STATION 32STA (Continued) **S103574868**

Tank Size:	0
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	273087
Operable Unit ID:	947302
Operable Unit:	01
Material ID:	562049
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	8801651
Site ID:	281535
Spill Number/Closed Date:	1988-11-02
Spill Date:	1988-05-23
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Not reported
Cleanup Ceased:	1988-11-02
SWIS:	2401
Investigator:	JCGRATHW
Referred To:	Not reported
Reported to Dept:	1988-05-23
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-05-25
Spill Record Last Update:	2005-06-17
Spiller Name:	Not reported
Spiller Company:	CEREDO(CONTACT)
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported

HESS/MERIT STATION 32STA (Continued) **S103574868**

DEC Region:	2
DER Facility ID:	62182
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GRATHWOL "
Remarks:	"L R = -0.544 GPH."

All TTF:

Facility ID:	8801651
Spill Number:	8801651
Spill Tank Test:	1533954
Site ID:	281535
Tank Number:	Not reported
Tank Size:	0
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	281535
Operable Unit ID:	917141
Operable Unit:	01
Material ID:	570919
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9214515
Site ID:	284266
Spill Number/Closed Date:	Not reported
Spill Date:	1993-03-31
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	RVKETANI
Referred To:	080117 APPRVD 2ND QRTR 2017 RPT
Reported to Dept:	1993-03-31
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False

HESS/MERIT STATION 32STA (Continued) **S103574868**

Meets Standard:	False
UST Involvement:	True
Remediation Phase:	5
Date Entered In Computer:	1993-04-01
Spill Record Last Update:	2017-08-01
Spiller Name:	Not reported
Spiller Company:	HESS/MERIT
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	481406
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SUN 10/08/93: REPLACED ELBOW RETESTED AND PASSED 4/19/93 NO CONTAMINATION FOUND. 04/16/04-File Update by Sun: - TRi-nnual Report-September 2003 through 2004, prepared by William Schaefer of GSC-Twelve (12) wells were gauged and sampled on 12/30/04, including (MW-1 through MW-4, MW-7. MW-9 through MW-14, MW-18, and SVE-1). Groundwater depths ranged from 10.35 feet to 12.82 feet. Groundwater flow direction was towards southwest. MW-10 had the maximum Benzene concentration of 730 ug/l. MW-13 had the maximum MTBE concentration of 77 ug/l. An SVE/AS system is now operating on site. 08/22/05-File Update by Sun: Also refer to Spill #98-10899 at the same location. (Sun) 10/28/05: Project reassigned from Sun to Andersen. Reviewed the triannual report dated 6/2/05. The site is making good progress with the SVE system currently in use. 1/26/06: 1/25/06 meeting with Quantum, NYSDEC, and GSC/Kleinfelder:SVE will be turned off and a remedial action plan developed for peak in MW-8 (may use ORC), there can't be additional release because this station is not an active station). 3/9/06: Reviewed monitoring report dated 2/27/06. Max BTEX 17,770 (MW8), max MTBE 66 (MW2). Depth to water 10 ft. Eleven wells sampled on 12/14/05. SVE will be shut off and bioremediation used in MW8. Request to remove sampling of MW3 was approved. 6/23/06: Received triannual monitoring report dated 6/14/06. SVE/AS shutoff. Max BTEX 17,730ppb (MW8) and max MTBE 40ppb (MW2). RAP required for MW's:1,4,7,8,10,11,14. Discuss during meeting scheduled for 6/28/06. 6/30/06: Meeting on 6/28/06 with Hess, Quantum, NYSDEC, EnviroTrac and GSC. An RAP utilizing regenox will be submitted. An upgradient source in MW-11 is suspected, from Exon or Mobil. 7/11/06: RAP workplan for bioremediation using RegenOx conditionally approved. Workplan proposed RegenOx application only to MW-8. Groundwater sampling showed rebounding in MW-10 and MW-11 following shut down of the SVE/AS system in February 2006. Conditional RAP approval required RegenOx application to MW-10 and MW-11. 9/6/06: Received cc of a letter requesting permission from current property owner to inject regenox. 10/16/06: Received email from Gail Helfrick: Despite several attempts, we have not been able to contact the property owner in order to revise the access agreement to allow for this work scope. Currently, we are trying to obtain contact information through the currrent tenant. 10/20/06: Sent letter to Mr. Karron, current owner, to request access. 11/1/06: Reviewed triannual report dated October 25, 2006. Groundwater sampled on August 10, 2006. Rebounding in MW 1, 4, 10, 11. High residual concentrations in MW 8. Regenox use planned in MW 8, 10, 11, but access is problematic. 11/10/06: Letter to Mr. Karron returned to sender. 11/16/06: Emailed Gail Helfrick to confirm

HESS/MERIT STATION 32STA (Continued) **S103574868**

Mr. Karron's address. 12/11/06: Sent email to Hess to followup on access for implementation. 12/18/06: Received email from Aaron Lapine of Delta: We are not sure of the property owner's address. When Kleinfelder sent (via certified mail) the access letter to the address they had, the letter could not be delivered. Kleinfelder was not sure if it was because the property owner moved or just that no one was home to sign the certified letter receipt. Kleinfelder then dropped off a copy of the access letter and recently the NYSDEC letter to the tenant and requested that the tenant forward the letters to the property owner. Until site access is confirmed with the property owner, the injection event cannot be occur. Delta will work with Kleinfelder to confirm access by obtaining the owner's correct address and confirming with the tenant that the information was delivered to the owner. 1/17/07: Meeting on 1/16/07 with Hess, Delta, and NYSDEC. Mr. Karrons address is still unknown. 2/22/07: Received email from Aaron Lapine : Access has not yet been granted. We have not been able to locate the property owner. We performed a review of NYC tax records and the owner is listed as 810-820 Pennsylvania Avenue Corporation and the mailing address given is the site address. I have called the current tenant (Buddy's Car Wash) numerous times and have only been able to get a hold of the manager once. The manager would not give me the owner's mailing address only his name (Boris Thomas), but stated if I called back the same day after 2pm Boris would be at the car wash. When I called back, I was told they did not know anyone by the name of Boris Thomas. I have been unable to contact the manager since then. Although we were trying to locate the owner's current address, we re-sent the access agreement via FedEx to the car wash property. 3/5/07: Resent access required letter to Mr. Karron at: 70 Curtis Avenue Manasquana, NJ 08736 and 810-820 Pennsylvania Avenue Corp. c/o Soloman and Bernstein 1178 Broadway, 5th Floor New York, NY 10001-5404 3/6/07: Reviewed the Site Status Report. Wells sampled on 12/1/06. Fluctuating concentrations. Max BTEX 13,520 ppb (MW11), max MTBE 40 ppb (MW2). RAP not implemented because of access issues. 3/14/07: Letter to 810-820 Pennsylvania Avenue returned to sender. 3/20/07: Spoke to Mr. Karron (site owner) (914-960-9213, akarron@optonline.net). He will provide access for RAP implementation. 5/24/07: Received email from Aaron Lapine: We are currently working with property owner for access. We have discussed the possibility of mobile AS/SVE treatment event(s) as an alternative to RegenOx, since it is less intrusive than the injections. 7/6/07: Reviewed update report. Groundwater sampled on 4/27/07. Fluctuating groundwater concentrations. Max BTEX 614 (MW8). Mobile short term SVE/AS proposed and approved. The mobile AS/SVE event would utilize air sparge points SP-6, SP-7, SP-9, and SP-9, and SVE wells MW-4, MW-8, MW-10, and MW-11. One 8 hour event will be performed, and used as a pilot test for this technology. 8/3/07: Approved use of method TO3 to analyse air effluent samples. 10/16/07: Spoke to Tim Fisher. Mobile SVE/AS will be conducted on 10/17/07. Effluent air sample will be collected. Report willbe submitted by the end of the month. 12/3/2007 - Feng - Reviewed update report, 10/26/2007. The monitoring wells were gauged and sampled on 8/15/2007. DTW 9.95' to 12.19' bg. Flows to south. No LNAPL. Max BTEX 3,340 ppb (MW-4). Max MTBE 20 ppb (MW-2). Mobile SVE/AS event on 10/17/2007. Next round sampling will be in 12/2007. (RJF) 2/13/08 - Carlson - Reviewed October 2007 - January 2008 Site Status Update Report. A mobile AS/SVE event was conducted on October 17, 2007. The event indicated extractable hydrocarbons are still present in the

HESS/MERIT STATION 32STA (Continued) **S103574868**

subsurface. Hess plans on restarting the existing SVE/AS system. Groundwater sampled on December 21, 2007. Max BTEX 5,050 ppb (MW11), max MTBE 12 ppb (MW2). 5/7/08 - Carlson: May 7th meeting with Hess and Envirotrac. They ordered parts to repair and restart system. Upgradient delineation required. 7/7/08 - Carlson: Reviewed June 2008 Update Report. Wells sampled on 4/9/08. Fluctuating concentration in some wells. Maximum BTEX concentration 12,291 ppb (MW4). Maximum MTBE concentration 8 ppb (MW2). Sent to email to Erin Quell: when will system be restarted, IP required for upgradient well as per may 7th meeting. 10/22/08 - Carlson: Meeting with Hess, NYSDEC, and Envirotrac. Delineation workplan due 2/09. When will system be restarted? Do not connect all wells to system when it is restarted. 11/17/08 - Carlson: Reviewed update report dated October 2008. Wells sampled on 8/21/08. MW4 was not sampled - no reason provided. Maximum BTEX concentration 4,729 ppb (MW11). System has not been restarted yet. 11/19/08 - Carlson: Emailed Ed Russo - When will system be restarted? 12/11/08 - Carlson: Received email from Ed Russo: the system was re-activated on 12/3/08. The SVE system was activated first and PID readings were recorded as a range from ND to 2.5 ppm. The air sparge system was then activated and PID readings increased to 183 ppm. We are evaluating ways to optimize the performance of the system and will do so in order to maximize recovery from the areas of the most impact. We are scheduled for another round of O&M next week and then system O&M will continue on a monthly basis thereafter. Results of system O&M events will be submitted within all future site update reports. 2/20/09 - Carlson: Reviewed January 2009 Update Report. System restarted on 12/3/08. Wells sampled on 11/26/08. Maximum BTEX concentration 3,545 ppb (MW4). 3/18/09 - Carlson: Meeting with Hess and Envirotrac. IP deadline extended to May 2009. Hess notes that there are many potential upgradient sources in the area (Wendys). 5/6/09 - Carlson: Reviewed April 2009 update report. AS/SVE system was restarted. Wells sampled on 2/27/09. Maximum BTEX concentration 5,414 ppb (MW11). Dissolved concentrations are still fluctuating. 8/10/09 - Carlson: Reviewed update report. SVE/AS restarted, low PID, is it effective? Report states hess will propose an investigation plan. 8/19/09 - Carlson: Meeting with Hess. Work plan will be submitted. 10/8/09 - Carlson: Reviewed IP. Hess states that upgradient Mobil spill is off-site source, Mobil should install additional downgradient wells 11/10/09 - Carlson: Emailed DEC Haggerty requesting Mobil install an additional well downgradient of MW15. 11/17/09 - Carlson: Reviewed update report, SVE/AS in operation. only trace PID recovered from SVE/AS system. 1/27/2010 - Carlson: Meeting with Hess. Off-site delineation issue has not been resolved. Review case file and null IP internally. 2/5/2010 - Carlson: Reviewed 4th Quarter 2009 Update Report. SVE/AS in operation. 5/20/2010 - Carlson: Meeting with Hess. NYSDEC to review file and discuss delineation with upgradient exxonmobile site. 5/27/2010 - Carlson: Reviewed update report. SVE to be shut down due to low recovery. 8/13/2010 - Carlson: Reviewed July 2010 Update Report. SVE/AS shutdown. Hess to provide soil data to determine if an off-site plume is affecting property. 11/10/11 - Carlson: Reviewed October 2011 Update Report. SVE/AS shutdown. General increase in dissolved concentrations in several upgradient wells. Need to review case file for potential ugradient sources. 2/6/2012 - Carlson: Spoke to Joseph Rennie. LNAPL in two wells. Weekly bailing to occur. NEED TO REVIEW CASE FILE FOR SOIL POTENTIAL UPGRADIENT SOURCES. Significant soil impact was left after tank removal in 1998.

HESS/MERIT STATION 32STA (Continued) **S103574868**

2/22/2012 - Carlson: Left message for DEC Michael Haggerty 518-402-9768 (Central Office PM for upgradent Mobil Spill 9406497). Recent reports are not in edocs. Spoke to Michael Haggerty - recent Mobil reports were uploaded to edocs. Left message for Joe Rennie - need to ask him: 1) was recent product ID'd, 2) which wells recently had product, and 3) were soil borings completed since SVE/AS was shut down to see if system successfully remediated soil impact? 2/23/2012 - Carlson: Spoke to joe rennie. Product was not sent to a lab for fingerprinting. LNAPL is bring recovered. Recommended installing soil borings to see how much soil impact remains after SVE/AS treatment. 3/14/2012 - case review and discussed with DEC Raphael Ketani and Hassan Hussein. Need proof on whether there are upgradient sources impacting the Hess site. A letter sent to Hess requiring additional delineation in upgradient. Work Plan by 4/13/2012. Wendy's property resident: Penbrow Inc., 1916 Linden Blvd, Brooklyn, NY 11207 Wendy's property owner: Briad Wenco LLC, 30 Vreeland Road, Apt #A, Florham Park, NJ 07932-1904 7/17/2012 - 1Q2012, 4/30/2012, by EnviroTrac. LNAPL in some wells. MW-7, 0.21' on 2/2/2012, 0.21' on 2/7/2012 and 0.17' on 2/14/2012. MW-10, 0.84' on 2/7/2012, 0.72' on 2/14/2012. MW-11, 0.52' on 2/2/2012, 0.39' on 2/7/2012 and 0.28' on 2/14/2012. Groundwater sampled on 2/2/2012. MW-4, 2,239.5 ug/L BTEX, MTBE ND. MW-10, 7,723.9 ug/L BTEX, MTBE ND. MW-1, 2,018 ug/L BTEX, MTBE ND. MW-9, 4,384.7 ug/L BTEX, MTBE ND. MW-18, 18,330 ug/L BTEX, MTBE ND. MW-2, 1,575.9 ug/L BTEX, MTBE ND. Hand bailed LNAPL from the 3 wells MW-7, MW-10 and MW-11 on 2/27/2012 and 2/14/2012. Placed absorbent socks in monitoring wells MW-7 and MW-11 to enhance product recovery. email to Hess/EnviroTrac We reviewed the 1Q2012 report. Product was present in some of the monitoring wells, MW-7, MW-10 and MW-11. I see that the product was hand bailed twice during this quarter. Based on the thickness of the product, you need to have a more aggressive product removal method. I don't find any history of the occurrence of product in the report. Is this the first time product show up in these wells? As I can see from the hydrographs, water table also drops 1-2 feet during this quarter and the product show up. Have the LNAPL sampled? If not, please do so. And according to our notes, we required some work plan for upgradient delineation. How is that going? 10/19/2012 - 2Q2012, 7/31/2012, by EnviroTrac. The groundwater was sampled on 5/8/2012. Gauged on 3/27/2012, LNAPL in MW-10 and MW-11, removed and replaced absorbent socks from MW-7, MW-10 and MW-11. Gauged on 4/5/2012, LNAPL in MW-7, MW-10 and MW-11, removed and replaced an absorbent sock in monitoring well MW-11. Gauged on and 5/8/2012, LNAPL in MW-8, MW-10 and MW-11. DTW 12.51 to 14.94. Flows to southeast. MW-8, 0.35' LNAPL. MW-10, 0.36' LNAPL. MW-11, 0.40' LNAPL. MW-4, 6,469 BTEX, MTBE ND. MW-1, 3,025 BTEX, 7.7 MTBE. MW-9, 543.5 BTEX, 0.69J MTBE. MW-7, 4,619 BTEX, 6.6J MTBE. MW-2, 1,166.3 BTEX, 1.8J MTBE. AS/SVE shutdown due to no recovery. Continue monthly gauging and product bailing and quarterly sampling. The next sampling will be in August 2012. 10/24/2012 - STIP along with a comment letter on case reivew was sent to Hess/EnviroTrac. DEC required: 1) fingerprint the product. 2) more aggressive product removal. 3) provide all previous soil borings/monitoring wells installation information. 4) upgradient delineation. 5) explain the discrepancies in between the PBS record and the reported removed tanks. Need signed STIP by 11/23/2012. 1/18/2013 - 3Q2012, 10/31/2012, by EnviroTrac. 6/6/2012 and 7/12/2012, LNAPL in MW-10, hand bailed. Removed and replaced absorbent socks from MW-7, MW-8, MW-10 and MW-11. Groundwater was sampled on 8/2/2012. No LNAPL in the

HESS/MERIT STATION 32STA (Continued) **S103574868**

August sampling event. DTW 11.67 to 13.92 bg. Flows to southeast. MW-4, 4,695.4 BTEX, MTBE ND. MW-11, 18,053.8 BTEX, MTBE ND. MW-1, 8,440 BTEX, MTBE ND. MW-10, 24,207.7 BTEX, MTBE ND. MW-9, 2,484.7 BTEX, MTBE ND. MW-7, 6,467.5 BTEX, MTBE ND. MW-2, 482.3 BTEX, MTBE ND. 9/23/2013 - 4Q2012, 1/31/2013, by EnviroTrac. Groundwater was sampled on 11/15/2012. DTW 10.74 to 13.11 feet. Flows to south-southeast. NO LNAPL. Removed and replaced absorbent socks from MW-7, MW-8, MW-10 and MW-11 on 9/5/2012. MW-11, 4,140.5 BTEX. MW-4, 1,051.1 BTEX. MW-1, 12,527 BTEX. MW-10, 31,762 BTEX. MW-8, 7,838.2 BTEX. MW-9, 157.3 BTEX, 2.2 MTBE. MW-7, 315.2 BTEX, 4.8 MTBE. MW-2, 299.88J BTEX, 5.8 MTBE. Hess reiterates its request to have Exxon Mobil complete a full delineation of its plume to include the Wendy's property located north of the former Merit Station. 1Q2013, 4/30/2013, by EnviroTrac. Groundwater was sampled on 2/14/2013. DTW 10.13 to 11.33 feet. Flows to south-southeast. NO LNAPL. MW-11, 678.8 BTEX. MW-1, 3,761 BTEX, 7 MTBE. MW-10, 11,024 BTEX. MW-8, 64.4 BTEX. MW-9, 62.4 BTEX, 2.2 MTBE. MW-2, 85.68J BTEX, 7 MTBE. Hess reiterates its request to have Exxon Mobil complete a full delineation of its plume to include the Wendy's property located north of the former Merit Station. 2Q2013, 7/31/2013. Work performed on 5/23/2013. DTW 10.71 to 13.04 feet. Flows to south-southeast. MW-11, 1735.47J BTEX. Mw-4, 3,566 BTEX. MW-10, 4,990.9 BTEX. MW-1, 2,961 BTEX. MW-8, 1,759 BTEX. Mw-9, 55.7 BTEX. MW-2, 272.7 BTEX. 10/30/2013 - DEC K. Hale, J. Vought, S. Mahat and J. Feng conducted site visit. Met with the carwash owners Richie Krause and Mannuel Viegas. The carwash has been there for 30 years and the building has been there for 15 years. According to the owners, there is a pumping well for the carwash operation and the well water has been used for the bathroom. The owners do not know the location of the pumping well and the water from the well has never been sampled. They have agreement with Hess that Hess will take care of the spill. 11/14/2013 - Reviewed the monitoring data trend with R. Austin and J. Vought. DEC will send letter to Wendy's for information. 11/22/2013 - Letter was sent to Wendy's property owner: Pennbrow, Inc, at 181-06 Tudor Road, Jamaica, NY 11432. DEC requires: 1) Submission of a detailed site history including: previous site usage; current and historical petroleum storage (including tank removals and abandonments; location, sizes of tanks removed/abandoned and types of product stored); tightness test results, the number of tanks; associated spill numbers if any; and the Petroleum Bulk Storage (PBS) Registration and Record. 2) Submission of any records or information regarding subsurface investigations that have been done at the property (e.g. a subsurface investigation that would have been done for the purpose of a property transaction). Response by 30 days. 11/5/2014 - 1Q2014, 4/30/2014. Monitoring on 11/13/2013. DTW 11.02 to 13.31 feet. Flows to south-southeast. MW-1, 2,745.2 BTEX. MW-10, 5,841.5 BTEX. MW-2, 64.7 BTEX. 2Q2014, 7/31/2014. Groundwater monitoring on 5/31/2014. DTW 10.12 to 12.48 feet. Flows to south-southeast. AS/SVE shutdown due to non-detected recovery. MW-11, 913 BTEX. MW-4, 29.5 BTEX. Mw-10, 608.8 BTEX. MW-1, 1,601.2 BTEX. MW-8, 1,594 BTEX. Hess reiterates its request to have ExxonMobil complete a full delineation of its plume to include the Wendy's property located north of the former Merit Station. 11/17/2014 - 3Q2014, 11/7/2014. AS/SVE shutdown due to non-detect recovery. 8/31/2014, sampled groundwater. DTW 0.67 to 13.05 feet. Flows to south-southeast. MW-11, 379.12J BTEX. MW-4, 4,218.3 BTEX. MW-10, 5,690.6J BTEX. MW-1, 2,493.5 BTX. MW-8, 4,786 BTEX. 3/30/2016 Feng This spill is transferred from J. Feng to V.

HESS/MERIT STATION 32STA (Continued) **S103574868**

Brevdo as per J. Vought 3/30/16 - Raphael Ketani. This spill case has been assigned to me effective today. According to ACRIS, the owner of the property is 810-820 Pennsylvania Avenue Corp., c/o Solomon & Bernstein, 351 Broadway, Third Floor, NY, NY, 10013. The block and lot are 4346 and 12. PBS case record #2-297372 lists Perrier Auto Wash, Inc. as the owner. Their address is 810 Pennsylvania Avenue. One 275 gallon waste oil tank is in service. One 4000 gallon UST was closed in place. Eight USTs of various sizes were closed and removed on 2/1/98. According to a 10/24/12 case note, a Stipulation was sent to HESS with a return date of 11/23/12. Also, the DEC required that the product be fingerprinted, more aggressive removal take place, provide all prior soil boring and well installation information, upgradient delineation, and explain the discrepancies between the PBS record and the reported tank removals. The Stipulation was never returned. The case notes indicate the following total VOCs concentrations for the groundwater samples: date very high results high results 8/2/12 MW-10, 11 MW-1, 4, 7, 9 11/15/12 MW-1, 10 MW-4, 8, 11 2/14/13 MW-10 MW-1 5/23/13 MW-1, 4, 8, 10, 11 11/13/13 MW-1 and 10 5/31/14 MW-1 and 8 8/31/14 MW-1, 4, 8 10 Speedway/Hess contact: Matthew Butler, (732) 738-2924, MButler1@Speedway.com Consultants: Edward Russo (EnviroTrac), (631) 924-3001, EDR@EnviroTrac.com Joseph Rennie (EnviroTrac), (631) 924-3001, JoeR@EnviroTrac.com Mr. Butler's mailing address is: Speedway, LLC, 500 Speedway Drive, Enon, OH 45323. Other spill cases for the site include: 8801521: name = 810 Penn. Ave., tank overfill, 150 gals. of gas into the sewer, sewer was flushed and there was no sign of gasoline, case closed 9/30/88 8801651: name = Merit, tank test failure (which tank not indicated), closed 11/2/88 9010161: name = 810 Penn. Ave., 2000 gal. and 4000 gal. tanks failed their integrity tests, will excavate, isolate and retest, closed 7/22/94 and referred to spill 9214515 9301033: name = 810 Penn. Ave., tank overfill, contained with Speedi-Dri, closed 5/24/93 9810899: name = Merit Station, digging for a foundation and found contaminated soil, closed 8/22/05 and referred to 9214515 According to a 10/30/13 case note, a site visit was made. As part of the visit, staff asked about the water supply well. Personnel at the site stated that the water was used for the bathroom. However, the location of this well was unknown. An 11/22/13 case note indicates that a letter was sent to the owners of the Wendy's restaurant. In the letter, the owners were asked to provide all historical records and records of any previous investigations. A response date was set by DEC as 12/22/13. - There is no documentation in the case file regarding Wendy's. The 11/5/14 case note regarded the second quarter 2014 report. In the report, it was stated that the AS/SVE system had been turned off because the results were non-detect. 4/11/16 - Raphael Ketani. As there has been no communication nor report submissions by the representatives of Speedway or EnviroTrac since the submission of the third quarter 2014 quarterly report, I sent an email to Mr. Butler, Mr. Russo and Mr. Rennie requesting the latest groundwater report. I also wrote that they were in violation of the Stipulation Agreement as it was never returned. Lastly, I included that they must respond to the DEC requirements as described in the 10/24/12 case note. 4/25/16 - Raphael Ketani. I received the below email from Mr. Russo: This correspondence is in response to your email below regarding the former Hess/Merit station 32STA. Please note that Speedway/EnviroTrac was conducting quarterly sampling, monitoring, and reporting up until October 2014. In October 2014, Speedway LLC (Speedway) purchased the retail assets of Hess

HESS/MERIT STATION 32STA (Continued) **S103574868**

Corporation and is now the responsible party with respect to New York State Department of Environmental Conservation (NYSDEC) Spill # 92-14515. As a result of this sale, we now longer have access to the property. On December 15, 2014, EnviroTrac notified the NYSDEC case manager via email of this situation that site access is pending a new access agreement. An access agreement is currently being pursued between the current property owner and Speedway, and as a result, we cannot conduct any work on the subject property until access is finalized. Quarterly sampling, monitoring, and reporting will resume immediately upon obtaining access. Please be advised that we have consistently been in communication with the NYSDEC regarding updates on the status of NYSDEC s up-gradient investigations, as follows: " 2/6/2012 EnviroTrac/Hess submitted a FOIL request to review NYSDEC case files regarding the up-gradient Mobil spill case and there have been numerous follow up correspondences between NYSDEC and EnviroTrac/Hess on FOIL status. " 4/3/2012 - Speedway emailed NYSDEC case manager to respectfully request that the NYSDEC allow Hess to complete a detailed file review of the NYSDEC's documents prior to moving forward with or committing to any additional actions. " 10/24/2012 NYSDEC letter to Hess. " 11/21/2012 EnviroTrac/Hess response to 10/24/2012 NYSDEC letter. " 1/10/2013 NYSDEC provided reports to EnviroTrac/Hess regarding the Mobil spill case. " 11/22/2013 NYSDEC sent a letter to Pennbrow Inc/Wendy s asking for a detailed site history and a summary of investigations performed on their property. " 8/15/2014 EnviroTrac requested via email with NYSDEC case manager a status of Pennbrow Inc./Wendy's subsurface investigation and followed up with the NYSDEC on 1/29/15, 11/16/15, and 1/4/16. " 12/15/2014 EnviroTrac notified NYSDEC case manager via email that site access is pending new access agreement. " 4/2/2015 - EnviroTrac received email correspondence from NYSDEC noting that they have received a Phase 1 from the adjacent up-gradient Wendy's property (former service station), and that NYSDEC is working on a determination on who will conduct an investigation. " 7/7/2015 - Ed Russo (ETNY) spoke to June Feng (NYSDEC case manager). June stated that she will look into Wendy's progress related to a Phase 2 ESA that the NYSDEC required of Wendy's and she will get back to us re: the status. To our knowledge to date, there has been no up gradient delineation by Mobil or any correspondence from Pennbrow (the Wendy s property owner). Please be advised that Speedway reiterates its request to have Mobil complete a full delineation of its plume to include the Wendy s property located north of the Former Merit Station. Copies of any correspondence can be provided, upon request. Product Removal/Fingerprint Pending site access, and if product is present, Speedway and EnviroTrac will aggressively remove product during future monitoring events. PBS/Tank Removal Discrepancies Speedway/EnviroTrac to research PBS records and tank removal reports and will rectify discrepancies.
****
********** I checked the UIS database for the former service station address at 1916 Linden Boulevard, Brooklyn. However, I did not find a spill case listing, nor a PBS case listing. The NYC Department of Buildings database also lists various alternative addresses for this location. So I checked addresses 1918 to 1938 Linden Boulevard, 786 to 196 Pennsylvania Avenue and 787 to 797 Sheffield Avenue. However, no Spills cases nor any PBS cases were found in the UIS system. The ESA Phase I for the Wendy's property was archived in the DECdocs system. The Phase I was written by Executive

HESS/MERIT STATION 32STA (Continued) **S103574868**

Environmental Group, Inc. at 1373 Coney Island Avenue in Brooklyn, (718) 677-1007. The date of the Phase I is 11/26/03. There is a cover letter attached dated 12/4/13 from Natalie Gurin of Eiseman Levine Lehrhaupt and Kakoyiannis at 805 Third Avenue, NY, 10022, (212) 752-1000. According to the Phase I the present Wendy's property contained dwellings up until 1967. From 1967 to 1981 the property was occupied by a filling station. The Phase II still hasn't been received by the Department. I will write a letter to Ms. Gurin requesting that some type of subsurface investigation take place at the Wendy's property. 4/26/16 - Raphael Ketani. I sent a letter to Ms. Gurin (representing Pennbrow, Inc.)requesting the submission of a Phase II RIWP by June 3, 2016. The latest address in ACRIS for Penbrow, Inc. is 331 Madison Avenue, NY, 10017 - according to a 3/10/11 UCC-1 document. However, there is a deed from the nineteen nineties which shows the address Penbrow, Inc., 181-06 Tudor Road, Jamaica, NY 11432. The property is block and lot 4346 and 6. A UCC-3 Continuation document in ACRIS shows the party Briad Wenco, LLC, c/o The Briad Group, 78 Okner Parkway, Livingston, NJ, 07039. 5/24/16 - Raphael Ketani. Wayne Lehrhaupt (212) 752-1000, the attorney for Norman Bobrow of Penbrow, Inc., called inquiring about the DEC's 4/26/16 letter requesting the Phase II RIWP. He explained that Ms. Gurin had received the letter shortly after 4/26/16, but he hadn't received it until yesterday. He asked how the DEC came to the conclusion that an investigation was necessary. I told him that, based upon my review of the case file and the case notes, information was found that indicated the existence of a source of contamination. I added that the information also suggested the existence of an upgradient source. Lastly, I stated that Ms. Feng (the previous DEC case manager) had requested a Phase II Report. However, the Phase II was never done. Mr. Lehrhaupt said that he understood what I was saying. He asked whether a magnetic survey would be required. I told him that if one hadn't been done before, then one should be done now. Mr. Lehrhaupt mentioned that he was used to working with a private individual out on Long Island who does environmental work. I told Mr. Lehrhaupt that the DEC would require a report with a site map to scale with surveyed locations, surveyed water table elevation data, a groundwater flow map, soil sample descriptions, the full suite of VOC and SVOC analyses and more. I asked whether his environmental person was knowledgeable about what would be included in a Phase II. He said that he wasn't sure. He asked whether the DEC could recommend a company which is familiar with the area. I told him that the DEC doesn't make recommendations, but there are dozens of environmental companies in the metropolitan area from which to choose. Lastly, Mr. Lehrhaupt asked for an extension of the Phase II RIWP submission date. I asked him whether July 11th would be alright. He said he will call me back today with the answer. With that, the conversation ended. 5/25/16 - Raphael Ketani. Today I received the green return card for the 4/26/16 letter I had sent Ms. Gurin. 6/16/16 - Raphael Ketani. Today Dave Yudelson of Sieve Paget and Riesel (law firm; (212) 421-2150/ cell (917) 295-6449) called regarding the DEC's 4/26/16 letter requesting the Phase II investigation for the Wendy's facility. He said that he had been hired by Wendy's (1916 Linden Blvd.) and needed the documents from the case file for the HESS station site. He said that he was aware there was an indication that the groundwater contamination was coming from upgradient. I retrieved the documents from the DECdocs system that I thought would be useful to Mr. Yudelson for his review and put them on my Desktop. However, I

HESS/MERIT STATION 32STA (Continued) **S103574868**

sent him an email that he needed to make a formal FOIL request since this was the DEC policy. Later, I looked through one report for the site and came across two spill case numbers. The first was for a MOBIL station and was #9406497. The second was for an EXXON station and was #9409096. I also found an air photo in the latest report for the site. It showed that the MOBIL station was due north of the site on the north side of Linden Blvd. (1935 Linden Blvd.). The EXXON station was to the northeast and on the other side of Linden Blvd. Its address is 765 Pennsylvania Avenue. The EXXON spill case was closed on 7/27/11. However, the MOBIL station spill case was still active. The latest case notes for the MOBIL case indicated that the air sparge system had been restarted during 2014. A 2011 report for the MOBIL site showed that there still were very high total BTEX concentrations in the groundwater both onsite and off site to the south. 6/28/16 - Raphael Ketani. Mr. Yudelson (212) 421-2150/ cell (917) 295-6449) had made a FOIL request for the reports associated with the site. The request number was W008818-062116. The date of the request was 6/21/16. 7/8/16 - Raphael Ketani. Mr. Yudelson (law firm; (212) 421-2150/ cell (917) 295-6449) sent me an email requesting an extension of the deadline for responding to the Department's requirement that an investigation take place at the Wendy's location. I set the new deadline as August 1, 2016. 8/1/16 - Raphael Ketani. I received the August 2016 P.W. Grosser (PWGC) SIWP for the Wendys property at 1916 Linden Boulevard, Brooklyn. The plan was dated 8/1/16. I began my review. The work plan really takes the form of a historical review of the spills at the MOBIL station (#9406497; 1935 Linden Blvd.), the former EXXON (now Gulf) station (#9409096; 1939 Linden Blvd.) and at the subject former HESS station. In the beginning and the latter parts of the work plan, PWGC stated that much more documentation is needed from the EPA, the State and the City regarding all 3 sites, along with specific documents from the spill files for each site, so that they can create a Preliminary Conceptual Site Model (PCSM) before they undertake an investigation of the Wendy's Restaurant property. The reason for this, they state, is to that a better focused plan of action can be created and so that data gaps can be identified. Even after all of this information is obtained, they intend to further refine their PCSM in order to improve their focus and plan of action. Only after all of this has been done will they initiate an investigation. They did not indicate when this investigation would eventually take place. The notes below form a synopsis of this work plan. PWGC states that the owners of the former HESS station (hereafter referred to as the HESS station) stated that the contamination below their site was coming from the upgradient MOBIL station site and the upgradient former EXXON station site (hereafter referred to as the EXXON station). No investigation will take place by Pennbrow until all of the available documentation regarding the sites can be evaluated. They believe that a review of this documentation will support the conclusion that the sources of the contamination are the HESS station, the MOBIL station and the EXXON station. The depth to groundwater is from 10 to 12 feet below grade. The regional groundwater flow varies from the southeast to the southwest. PWGC performed site visits at all 3 sites on 7/19/16. The MOBIL station had the components of a remedial system, but they were uncertain whether is was operating. The EXXON station had a remedial system, but it appeared to be abandoned. The HESS station remedial system was not operating. The Wendy's property was used as a gas station from 1967 to 1981. After this period, a new building was

HESS/MERIT STATION 32STA (Continued) **S103574868**

constructed as the Wendy's Restaurant. A gas station was present at the HESS location from 1949 to 1988. In 1988, HESS changed from a gas station to an auto repair service and a car wash. A filling station existed at the EXXON location from 1928 to 1950. An EnviroTrac September 2009 report indicated that the HESS pumps, USTs and piping were removed during January and February of 1998. Soil was removed to 5 feet beyond the limits of the tank field and from 2 to 6 feet below the pipes and fills. Residual soil contamination was identified from 5 to 12 feet below grade. LNAPL was present in the HESS MW-7, 8, 10 and 11 wells to July 2012 (the case notes from the previous DEC case manager, June Feng, indicate that there was no NAPL in these wells from 2014 onward). A quarterly report for HESS stated that there was very high groundwater MTBE contamination up to 120,000 ppb. Figure 3 indicated the thickness of the LNAPL at the monitoring wells on the HESS site during 2012 as well as the extent of the residual LNAPL in the soil. The information was presented in the work plan for wells MW-1 to MW-3, 7, 8 and 18 for the period June 1995 to August 2000. The data concerned only the MTBE concentrations. The results were up to 120,000 ppb. Figure 4 presented the dimensions of the core of an MTBE plume that appears to have migrated from the MOBIL site. Historical BTEX concentrations had been greatest at MW-8 (34,200 ppb)during March 2003, at MW-10 ((31,762 ppb) during November 2011 and at MW-11 (34,420 ppb) during April 2002. The available information in the case record included groundwater sampling results through August 2014. EnviroTrac in their September 2009 report indicated their concerns that the contamination was from the MOBIL site. In this report, it was requested that the DEC ask MOBIL to further delineate the contamination. The report also indicted that the DEC requested HESS to investigate the potential upgradient sources. The Stipulation Agreement (Stip) sent to HESS required HESS to have the LNAPL fingerprinted that was found in the wells during 2012, implement a more aggressive LNAPL removal program, provide all previous soil boring/monitoring well installation data and related information, conduct an upgradient delineation and explain the discrepancies between the PBS record and the reported tank removal performed during 1998. According to PWGC, it was not clear whether the Stip was executed or if the requested information had been provided. Correspondences in the DEC case file indicated that HESS requested multiple times that EXXON and MOBIL fully delineate the MTBE plume and include the Wendy's property. It was unknown whether this was done. During January 2013, the DEC provided reports to HESS and EnviroTrac regarding the MOBIL site spill case. In addition, it was discovered that the car wash utilizes a pumping well to supply water. However, the location is not known. MOBIL site spill #9406497 is still active. The ARCADIS November 2011 report indicated that 18 wells had been sampled in connection with the October 1997 Stip. The depth to groundwater was found to be from 11 to 12.5 feet below grade and to be flowing to the southeast. Two non-potable wells were located within 300 meters to the south-southeast. Fifteen USTs had been removed during 1989 and were replaced with five 4000 gallon USTs. During January 2008, the report indicated that LNAPL was found in MW-18 (south of the dispensers) during August 2006. The LNAPL recovery system operated from January 1985 to March 20, 1992. The AS/SVE system operated from April 1995 to October 1998. EFR events took place from August 2005 to June 2008. From May 2009 to February 2010, RegenOx injections took place. On 6/4/08, the DEC approved the removal of MW-12, 14, 17 and 20 from the sampling array. MW-9 and

HESS/MERIT STATION 32STA (Continued) **S103574868**

MW-11 contained MTBE at up to 95,000 ppb from January 1995 to September 1997. According to PWGC, this indicated that the spill had occurred prior to 1995. MTBE was detected in MW-13 during October 1998 at 23,000 ppb. PWGC stated in the work plan that the EXXON site spill case #9409096 was still open. However, this spill case was closed on 7/27/11. A Preliminary Conceptual Site Model (PCSM) had been developed in order to obtain a general understanding of the Wendy's property. The PCSM considered the site history and context, including the fate and transport, potential sources, release mechanisms and the physical and chemical mechanisms controlling fate and transport. PWGC stated that there is ongoing source contamination originating from HESS. They also stated that there is source contamination at MOBIL and that it is affecting HESS. They indicated the location and extent of the MTBE plume from MOBIL in Figure 4 of the work plan. PWGC stated that data gaps were identified through the PCSM in connection with the quality and source of the groundwater that is flowing onto and off of the site (HESS). Before the site investigation is undertaken, the data gaps should be addressed to the extent practicable so that the PCSM can be refined and the site investigation focused. PWGC defined the data gaps as the need to obtain all work plans, reports and documents concerning the HESS site, including the Stipulation Agreement, fingerprint analysis, PBS record discrepancy resolution documentation, pumping well documents, soil boring logs, well installation logs, groundwater results since August 2014, access to all wells, and specific reports in the UIS system from the MOBIL and EXXON case files. The objective of the Site Investigation Work Plan (SIWP) is to reduce the uncertainty regarding the quality and source of the groundwater that is flowing onto and off of the Wendy's site as it relates to known sources of contaminated soil and groundwater. The scope of work includes: sampling up gradient MOBIL site wells MW-12 to MW-16 and HESS downgradient wells MW-4 and MW-11. PWGC will gauge and collect the usual field measurements and collect additional data via the documents for the HESS site, the MOBIL site and the EXXON site for a more comprehensive scope of work. Upon receipt of these documents, PWGC would review them for additional data gaps. A Remedial Investigation Report (RIR) will be sent to the DEC. Figure 3. There is a pool of product in the northeast quarter of the HESS site with the center of the pool being 0.84' of product. Wells MW-7, 8, 10 and 11 (upgradient) had from 0.21' to 0.56' (the data is from 2012 as no product is present in the wells since 2014). However, the figure does not indicate that any USTs were ever in this area. Figure 4. An MTBE plume is depicted as emanating from MOBIL wells MW-9 and MW-11. As drawn, it extends from the MOBIL station, then under the Wendy's location and ends under the HESS site. Groundwater flow is southeast. The Sanborn maps were at the end of the work plan. The 1950 map showed a dairy in the northern part of the future Wendy's property and two filling stations across Linden Boulevard and another one to the east of the future HESS site. A metal products manufacturing building was shown to have existed on other maps for many decades in the northwest quarter of the future HESS site. A 1967 map shows a filling station in the exact location of the future Wendy's Restaurant location (the center of this property). The 1977 map was the first to show the filling station and the auto laundry on the future HESS property. It also showed that the previous filling station building did not exist, but another one was constructed at the southern boundary of this property and was adjacent to the metal

HESS/MERIT STATION 32STA (Continued) **S103574868**

products building. The 1981 map showed the filling station in the south and east parts of the future HESS property with the metal products facility still present. The 1983 map was the first to show the Wendy's building at its present location. The 2001 map showed that the HESS filling station was now a car wash and that the filling station to the east across Pennsylvania Avenue was also now just a car wash. The last map in the work plan was for 2007 and depicted essentially the same conditions as in the 2001 map. I checked Google Earth and viewed a current photo of the HESS site. The property still contains the car wash and the historical metal products manufacturing building is still there. However, from the emptiness of the parking spaces around this building, it is not clear that there is metal products manufacturing taking place at this location.

---------- Case manager's review notes for the August 2016 P.W. Grosser (PWGC) SIWP : Having reviewed the work plan as submitted by P.W. Grosser Corporation, I determined that it did not follow the work plan format typically used by industry and therefore was deficient. There were no descriptions or figures showing where PWGC would install soil borings and wells on the Wendy's property. Also, there were no statements, nor figures regarding the geophysical methods that would be used to locate any structures (e.g. USTs) that may still exist on site. PWGC indicated in their SIWP that they would look for and review documents concerning the other sites, but not documents for the Wendy's property. In all likelihood, New York City agencies (e.g. Fire Department, Department of Design and Construction, the real property department and the taxation department) must have some types of records which may indicate the former presence of USTs. Also, the various historical societies may have their own records of the general area, if not the Wendy's property itself. Still, PWGC does not mention any intent to review possible Wendy's records at these sources. Lastly, the wording of the SIWP takes the form of a very extensive literature search and review and a modeling exercise. Because of the above deficiencies, I disapproved the SIWP. 8/9/16 - Raphael Ketani. I sent an email to Joe Rennie of EnviroTrac (631) 924-3001 asking whether Speedway had signed a new access agreement for continuing the environmental monitoring work. I added that if they hadn't, then the State will take enforcement action against them. I also called him to give him the above information. Mr. Rennie stated that he will pass the information along to Mr. Butler. I told him that Mr. Butler was the main recipient of the email. Speedway/Hess contact: Matthew Butler, (732) 738-2924, MButler1@Speedway.com Consultants: Edward Russo (EnviroTrac), (631) 924-3001, EDR@EnviroTrac.com Joseph Rennie (EnviroTrac), (631) 924-3001, JoeR@EnviroTrac.com Michael Haggerty (518) 402-9688 in the DEC Central Office in Albany is the case manager for the MOBIL spill (#9406497). He sent me the ARCADIS August 2016 Receptor Evaluation Report dated 8/8/16 for the MOBIL station. I reviewed the report. The AS/SVE system was restarted on 8/28/14, but the VOC concentrations temporarily exceeded the capacity of the catalytic oxidizer. In light of this, the AS part of the system was shut down. However, it was restarted on 12/11/14 after the system logics were reprogrammed. A total of 14.71 lbs. of BTEX and 1898 lbs. of total petroleum hydrocarbons were recovered since the system had been restarted on 8/28/14. The system was shut down during February 2016 as per DEC approval in order to check for contaminant rebound. The depth to groundwater varies from 10 to 12 feet bgs and the flow

HESS/MERIT STATION 32STA (Continued) **S103574868**

direction is to the south. The latest groundwater monitoring took place on 6/13/16. Groundwater samples were collected from MW-1 to 7, 9, 11, 13, and 15 to 19. The samples were analyzed for BTEX, MTBE and ethanol. The analytical results for the groundwater samples from well MW-3 had 320 ppb of ethylbenzene and some low hits. The sample from MW-4 had 1100 ppb ethylbenzene and 1300 ppb total xylenes, along with a few low results. Both wells MW-3 and MW-4 are on site in the southeast corner of the MOBIL station. The results for the groundwater samples from the other on site wells were either entirely non-detect or had non-detects and low hits. The samples from off site down gradient wells MW-13, 15 and 16 were entirely non-detect, except for 8 ppb of MTBE in the sample from MW-13. All of the above results suggest that any contamination that is in the groundwater under the Former HESS site IS NOT from the MOBIL site spill. I sent a copy of the ARCADIS August 2016 Receptor Evaluation Report to Mr. Rennie and Mr. Russo at EnviroTrac. Mr. Russo called me up afterwards and stated that HESS is no longer involved in the project. He added that the access issue was between the owner, 810-820 Pennsylvania Avenue Corporation, and Speedway and that I should contact Mr. Butler and send him the report. Hearing this, I sent Mr. Butler at the ARCADIS report. I also asked Mr. Butler to expedite the access agreement. Later, I looked up the ownership of the Speedway property. The CEO is Abraham Karron at 810-820 Pennsylvania Avenue Corp., 70 Curtis Avenue, Manasquan, NJ, 08736. 8/11/16 - Raphael Ketani. I sent a letter and 4 reports by email to Mark Chertok of Sive Paget & Riesel (SPR), Joyce E. Kung of SPR and to Richard T. Kampf of P.W. Grosser Consulting Engineer & Hydrogeologist, PC. The letter explained that the Department was sending the EnviroTrac first to third quarter 2014 groundwater monitoring reports as requested by P.W. Grosser. I added that we were also including the August 2016 groundwater monitoring report for the up gradient MOBIL station. I explained in the letter that the data in the MOBIL report indicated that the contamination at monitoring wells MW-13, 15 and 16 was very low. So, there was little or no contaminated groundwater coming from this site. In addition, I stated, that the data did not provide evidence of an MTBE plume. I also stated that staff at the Department had noticed that the only wells which had high groundwater contamination at the former HESS site were MW-1, 4, 8 and 10, which were located up gradient from the tank field. I mentioned that the groundwater samples from the wells down gradient had very low analyte concentrations. Continuing, I stated that, given the above information, it was the Department's determination that the contaminated groundwater was coming from the Wendy's property. In light of this, the Department was requiring the submission of a new investigation work plan which will include a geophysical survey of the property, soil borings and the installation of groundwater wells. I set a deadline of 9/9/16 for the submission of this work plan. Pennbrow, Inc. latest address is: 488 Madison Avenue, 19th Floor, NY, 10022 Mark Chertok's contact information at SPR Law is: mchertok@sprlaw.com; (212) 421-2150 Ms. Kung's contact information is: 460 Park Avenue, 10th Floor, NY, 10022;jkung@sprlaw.com/(212) 421-2150/(646) 378-7288 Mr. Kampf's contact information is: Richard T. Kampf, PG, Director, rkampf@pwgrosser.com 8/16/16 - Raphael Ketani. Mr. Butler (732) 738-2924/MButler1@Speedway.com sent me an email today stating that Speedway has been granted access to the site. A groundwater monitoring report will be submitted during September. 8/17/16 - Raphael Ketani. Mr. Kampf (212) 786-7420/rkampf@pwgrosser.com called

HESS/MERIT STATION 32STA (Continued) **S103574868**

me today. He said that the geophysical survey of the Wendy's property will take place on 8/23/16. I told him that the DEC would like the footprint of the Wendy's Restaurant to also be investigated. He said that he didn't know how this could be done. I told him that an acoustic instrument survey may work through the restaurant floor. He said that he will see what can be done. I added that the DEC would like a cover letter explaining what will take place and a map showing the where the geophysical transects will be run. Mr. Kampf stated that the transects will just be whatever the width of the instrument is and they will run as many transects as necessary. I told him this would be fine. Additionally, Mr. Kampf asked for any well construction logs from previous EnviroTrac reports and any soil contamination delineation reports. I told him that I will look and see what we have. With that, the conversation ended. 8/18/16 - Raphael Ketani. Mr. Kampf called me earlier today and stated that he could not find a company which could do a geophysical survey within the Wendy's as the tables and chairs are fixed to the floor. I told Mr. Kampf that if he can't find a geophysical service that can do the work, then he should just say so in a cover letter to the geophysical survey plan. Mr. Kampf stated that he would do this. Later, as the soil borings report and the well construction report were not in the electronic archive, I searched for them in the paper file. However, they were not in the paper file, either. As a result, I sent letters to Merit Oil Corporation and HESS Corporation requesting these documents. The letters were sent to the following addresses: Manager, Environmental Management Division, Merit Oil Corporation, 551 West Lancaster Avenue, Haverford, PA, 19041-1419. Dawn M. Coughlin, Manager, Marketing and Refining Remediation, HESS Corporation, 1 HESS Plaza, Woodbridge, NJ, 07095. 8/22/16 - Raphael Ketani. On 8/19/16, I received an email from Mr. Kampf memorializing and adding to our discussion over the phone on 8/17/16 regarding the Wendy's property. In his 8/19/16 email, Mr. Kampf wrote that his client has authorized P.W. Grosser to move ahead with the geophysical survey of the Wendy's property. The owner of the Wendy's has stated that there is no basement and the building is heated by gas. The geophysical survey will be conducted both outside and inside the building. A contractor will be hired to conduct the survey. A Fischer TW-6 metallic locator (type RD8000 pipe and cable locator) will be used to detect buried tanks and other ferrous anomalies. Any detections will be followed up with a GPR survey. A cart mounted GPR device will be used at a 2 to 3 foot spacing in both directions. A mini-GPR will be used inside the restaurant in order to locate objects directly below the building. I approved the geophysical plan. In the latter part of his email, Mr. Kampf again asked for any contamination delineation information and any well construction information for the former HESS site. He also asked for information regarding the MOBIL site. I responded by email and wrote that staff had looked in both our electronic archive and our file cabinets for any records concerning the contamination and the wells at the HESS site. However, we had not found such documentation. I explained that letters had been sent to MERIT and HESS requesting any documents that concerned the soil contamination and well construction. I added that the MOBIL site is managed in our Albany office and that he should make a FOIL request. I sent him the FOIL website address. 8/23/16 - Raphael Ketani. I received a call from Mr. Kampf (212) 786-7420 (rkampf@pwgrosser.com) today. The GPR survey took place as scheduled. However, nothing was found. Mr. Kampf explained that the GRPR was done outside the restaurant and inside

HESS/MERIT STATION 32STA (Continued) **S103574868**

the restaurant. They were able to move the tables and chairs in the dining area. So they were successful in their attempt to look under the slab the restaurant sits on, though the kitchen area was not as well surveyed as it was tight quarters. Mr. Kampf added that it was possible that tanks were still there as the GPR could look only 3 feet down. He commented that he was not sure the geophysical survey would be able to pick up any tanks. He stated that they may try electrical resistivity as a deeper sensing tool. He has been speaking with a contractor for this service and they told him that the signal penetrated as deep as 29 feet at one site. Mr. Kampf added that he thought the restaurant was sitting on historical fill. I told him that I wasn't sure the contractor would be able to get a clear picture regarding whether tanks were underground or not. I added that I thought they would come up with just a lot of interference because of the fill. Mr. Kampf stated that he will have to discuss this with the contractor before trying the method to see under the restaurant. The client stated that if no tanks are found, then he wants the spill case to close. A request was sent to the Fire Department for any records regarding USTs under the property. I asked Mr. Kampf what he would do if the resistivity machine sensed one object her and then one somewhere else, but nothing else. He said he wasn't sure what he would do next. I told him that the best investigative method may be to do a series of soil borings with wide spacing just to see whether any contamination is present underground. Mr. Kampf asked whether he should forego the resistivity testing and just do soil borings. I told him that I wasn't sure. He commented that they would be doing an investigation based on a contamination concentration gradient. He added that he will get back to me regarding the resistivity testing method. With that, the conversation ended. 8/25/16 - Raphael Ketani. Mr. Kampf (212) 786-7420 (rkampf@pwgrosser.com) sent me the below email today with an attachment showing the draft proposed boring plan: As discussed earlier this week, the geophysical survey performed at the above-referenced property on August 23rd did not indicate evidence of the presence of underground storage tanks (USTs). Pursuant to our subsequent discussions, we understand that NYSDEC does not believe that performing an electrical resistivity (ER) survey is likely to provide any additional useful information with regard to locating USTs beneath the building. Based upon discussions with our contractors, we have come to a similar conclusion. As such, we are finalizing a work plan that includes soil sampling, and, if warranted based on the soil sampling results, groundwater sampling. As discussed, the objective of the soil sampling investigation would be to evaluate whether the Wendy's restaurant may be the source of the dissolved-phase petroleum hydrocarbon (gasoline) - related constituents in groundwater observed in monitoring wells at the former Hess property. As previously presented in the August 2016 Subsurface Investigation Work Plan we submitted to NYSDEC, the data indicate that the former Hess property is the source of these dissolved-phase constituents given the presence of residual LNAPL on that property resulting form Hess' failure to characterize and remove contaminated soil in the northern portion of its property during the 1998 UST removal action. As discussed, based on the conceptual site model presented in the August 2016 Subsurface Investigation Work Plan, we have prepared a sampling approach that will evaluate concentration gradients of gasoline-related total petroleum hydrocarbons along two transects (A - A' and A - A'') that extend from the approximate center of the

HESS/MERIT STATION 32STA (Continued) **S103574868**

residual LNAPL mass and former UST locations on the former Hess property and which extend to the north / north west across the Wendy's property. Soil samples would be analyzed for TPH-GRO (total petroleum hydrocarbons - gasoline range organics). Please find attached a figure that presents the proposed sampling locations. Please note that extensive coordination will be required with Wendy's to ensure that there is minimal disruption to their business operations. Please let me know if you agree with this approach or if have any questions or comments and would like to discuss the proposed scope of work in greater detail. We intend to finalize the work plan and re-submit for your approval next week. We intend to perform the work as quickly as possible, pursuant to contractor availability.

---------- I responded to Mr. Kampf's email with the following comments: I have reviewed the draft proposed boring plan. Let me first say that I am not sure whether doing a contaminant concentration gradient analysis will definitively point to one location or the other (former HESS site) as being the source. However, the choice is yours to do this. We will simply review the data and make our own conclusions. Secondly, any initial investigation should include more borings at the Wendy s property than have been depicted. We suggest conducting the additional borings as we have indicated on our revised plan (see attached). We make this suggestion as there is no record regarding where the USTs or the pump islands used to be during the time that the property contained the filling stations. Additionally, all soil and groundwater analyses should conform to methods 8260B and 8270C. We ask for the expanded lists in order to see which volatiles and SVOCs will show up. If only a limited number of VOCs and SVOCs appear in the initial samples, then we would allow the testing to be for a limited suite of analytes the STARS list of 14 VOCs and 16 SVOCs. Lastly, the boring map you have sent me shows old information for the subsurface conditions at the former HESS site. We had sent P.W. Grosser the third quarter 2014 EnviroTrac groundwater monitoring report. In this report, they indicate that there is no NAPL in wells MW-7, 8, 10 and 11. 8/30/16 - Raphael Ketani. Mr. Kampf (212) 786-7420 (rkampf@pwgrosser.com) called me today. He said that P.W. Grosser and the client agreed to the extra borings requested by DEC. He also said that he wanted to have the soil and groundwater samples analyzed just for the STARS list of VOCs since this was a gas station and also since the HESS site was being tested only for VOCs. I told Mr. Kampf that this would be fine and to send the Department a cover letter confirming our agreement about doing only VOC analyses and about conducting the additional borings. He said he would. 8/31/16 - Raphael Ketani. Today I received the letter that I had sent to Merit Oil Corp. in which I had requested copies of any documents they may have regarding the site. The envelope was unopened and marked by the U.S. Post Office Not Deliverable as Addressed. The sticker was dated 8/27/16. The address I used for Merit appeared to be a legitimate one that I had copied from Merit's web page. 9/7/16 - Raphael Ketani. I reviewed the revised investigative boring work plan which was submitted by Mr. Kampf by email on 9/6/16. Eleven soil borings will be performed through the Wendy's property. Eight of these boring locations were chosen by P.W. Grosser. Three were chosen by the DEC. Each borings will be drilled to 20 feet bgs. The soil samples will be analyzed for CP-51 Table 2 VOCs (14 VOCs) and TPH GRO. The work will take place on 9/13/16 and on 9/14/16. I sent Mr. Kampf an email approving the work

HESS/MERIT STATION 32STA (Continued) **S103574868**

plan. 9/12/2016 - Colton McPartland. Scanned paper file for DEC Raphael Ketani and placed on computer desktop for future bulk upload once naming convention is received from DEC Jane Obrecht. 9/13/16 - Raphael Ketani. Mr. Kampf (212) 786-7420/(716) 392-4933 (rkampf@pwgrosser.com) called me early this morning to say that 2 borings situated in the drive-thru lane had been completed to 13.5 and 15.5 feet below grade, respectively. He added that some dark stained soil was collected which had petroleum odors. The samples will be sent to the lab for analysis. 9/19/16 - Raphael Ketani. I received an email from Mr. Kampf on 9/16/16. The email stated the following: Pursuant to the work plan approved by NYSDEC on September 7, 2016 regarding 1916 Linden Blvd, we performed the Subsurface Investigation this week which included advancing a total of 12 soil borings to approximately 20 ft bgs. Please refer to the attached sketch, which shows a site plan, including the location of the 12 soil borings. The groundwater table was present at approx 11.5 to 13 ft bgs. Boring logs indicate the presence of a petroleum hydrocarbon-related smear zone approximately 8 to 10 ft thick (approx. 12 - 13 to 20 - 23 ft bgs) at the three soil borings that were advanced farthest south along the boundary between the Wendy s and former Hess property (SB003, SB008, and SB009). Moving north, on the western side of the restaurant, the smear zone thickness decreased to approximately 5.5 ft (approx. 13.5 to 19 ft bgs) at SB001 and SB002) and to about 5 ft thick at SB012. PID readings also generally decreased with distance from the boundary of the former Hess gas station. SB010 and SB011, located further to the west, did not indicate any evidence of petroleum contamination. On the eastern side of the restaurant, also north of the former Hess property, the smear zone thickness decreased to approximately 6 ft (approx. 11.5 to 17.5 ft bgs) at SB004 and SB007, 3.5 ft at SB005 (approx. 11.5 to 15 ft bgs), and 1ft thick at SB006 (approx.. 13 to 14 ft bgs). PID readings also generally decreased with distance from the boundary of the former Hess gas station. There was no evidence of petroleum hydrocarbon-related constituents compounds above the water table at any boring location, no indication of the presence of any USTs, and no evidence that a petroleum hydrocarbon release has taken place on the Wendy’s property. In summary, a total of 17 samples were collected for analysis from 12 borings. The observed thinning out of the smear zone from south, along the former Hess property boundary, to north, across the Wendy’s property, supports the conclusion that the petroleum hydrocarbon material observed in borings at the Wendy’s property originated from spill(s) that took place at the former Hess property. We will have analytical results next week. I reviewed the Site Plan keeping in mind the text of Mr. Kampf’s associated email. It seemed reasonable that the smear zone should be thickest at the border with the former HESS station. This was because HESS wells MW-8, 10 and 11 did have free product up to 2012. I sent a response email to Mr. Kampf stating that he should send the DEC a report with analytical summary tables, the raw data package, boring logs, a description of the work which had taken place and any other information which is pertinent. 9/27/16 - Raphael Ketani. I reviewed the EnviroTrac 9/27/16 August 2016 Update Report. On 8/17/16, 12 wells were gauged and sampled. The wells gauged and sampled were MW-1, 2, 4, 7 to 14 and 18. Product was not detected in any of the wells. Groundwater was found at 10.71 to 13.04 feet. Flow was southeasterly. The groundwater analytical results for the samples from MW-2, 9, 12 to 14 and 18 were either completely non-detect for

HESS/MERIT STATION 32STA (Continued) **S103574868**

BTEX or were mostly non-detect with only one or a few very low hits. MW-1, 4, 7, 8, 10 and 11 had BTEX concentrations that varied from 737.5 ppb to 5884 ppb. These wells were located either in the former UST area (MW-7) or in the northern part of the site where soil contamination had been extensive and where AS/SVE actions had been concentrated. The benzene results were either low or moderate in concentration for the high BTEX samples. The AS/SVE system remained shut down due to non-detect recovery. Speedway intends to conduct a pilot test during the fourth quarter of 2016 to evaluate the efficiency of the mobile AS/SVE system and the inactive remediation system. Operation and maintenance take place monthly and groundwater sampling takes place quarterly. The next sampling round will take place during November 2016. I approved the report without comment. 11/1/16 - Raphael Ketani. I reviewed the P.W. October 2016 Grosser Site Investigation Report dated 10/28/16 for the Wendy's Restaurant property. A gas station operated at 1916 Linden Boulevard from 1950 to 1967 and then from 1969 to 1977. Between 1981 and 1983, a new commercial building was constructed. The INTRODUCTION section of the report states that, according to the DEC, a lot of contaminated soil was left under the HESS site after the tanks were removed during 1998. It is also stated that the extent of the soil contamination was not fully delineated. Additionally, P.W. Grosser states that the petroleum contamination from HESS had migrated under the Wendy's property. The P.W. Grosser investigation did not find USTs under the property nor petroleum contamination above the water table. The smear that was found decreased in thickness away from the HESS site. Following the INTRODUCTION, the report explains in detail the history of the investigation and remediation work at the HESS site. Information is also provided regarding the environmental monitoring by EnviroTrac. Depth to groundwater is from 11 to 15 feet bgs and flow is to the south. In Section 4.0 - Subsurface Investigation Activities, it is explained that EnviroProbe Services Inc. performed a geophysical survey on 8/23/16. A cart mounted GPR and an RD unit were utilized. The GPR penetration depth was generally 3 feet with a penetration depth of 3.5 feet in the rear (far parking lot) of the property. Tanks, piping, anomalies and utilities were looked for. The survey took place in a grid pattern. Rebar and possible steel mesh were detected at 4 inches below grade. However, no tanks or piping were found. From 9/13/16 to 9/14/16, 12 soil borings were installed from 16 to 24 feet below grade. A Geoprobe machine was used to conduct the borings. Soil samples were generally collected from the interval above the water table, or the interval with the highest PID reading. Nine of the 12 borings showed signs of petroleum contamination. The depth to groundwater was from 11.5 to 13.5 feet bgs. A smear zone was discovered from 7.5 to 10.5 feet in thickness in the 3 borings that were located along the property boundary with the former HESS station (SB003, SB008 and SB009). A Preliminary Conceptual Site Model (PCSM) was incorporated into the Site Investigation Work Plan which was previously submitted. The PCSM considered site history and context, including factors incluencing distribution and fate and transport. The factors included the potential sources, release mechanisms and the physical-chemical mechanisms that control fate and transport. The CSM was refined based upon the information obtained via the site investigation. P.W. Grosser then explained how LNAPL would behave in the subsurface (i.e. how it might migrate) as is typically stated in a hydrogeology textbook and included a typical diagram. Their explanation amounted

HESS/MERIT STATION 32STA (Continued) **S103574868**

to them building a case for the contamination having come from the former HESS site. They used information from the historical reports for the site. In the CONCLUSIION section of the report, they list 16 points to support their claim that the Wendy's property does not have a spill and that the contamination below ground at 1916 Linden Boulevard is entirely from the spill at the former HESS station. Table 1 listed the soil analytical results for the samples that had been collected. The set of analytes were the STARS list of 16 gasoline VOCs. The great majority of the VOC sample results were either very low or had very low to low hits with high exceedences for only total xylenes. The samples from SB004, SB005, SB007, the shallow sample from SB008 and the shallow sample from SB009 had high to very exceedences for one or both trimethylbenzene analytes and total xylenes. Only the samples from SB005 and SB007 had high naphthalene exceedences. Figures 1 to 5 were the same figures as were presented in previous P.W. Grosser reports. Figure 6 showed a cross section of the smear zone from SB003 to SB012. The smear zone was shown to decrease in thickness from 10 feet to 3 feet, respectively. The total BTEX concentrations decreased from 8.59 ppm at SB003 to 0.075 ppm at SB012, with the exception of 142.51 ppm in the deeper sample from SB002. Figure 7 showed that the smear zone decreased in thickness from about 6 feet at SB009 to about 3 feet at SB005. The total BTEX concentrations were 1301.3 ppm in the shallow sample and 1.0201 ppm in the deep sample from SB009, respectively. The lowest concentration was 1.68 ppm at SB006 along this transect. However, the shallow and deep results for the middle location at SB007 were 1158.4 ppm and 1575.5 ppm, respectively. The shallow and deep samples from SB004 (between SB009 and SB007) were 84.02 ppm and 396.3 ppm, respectively. Figure 8 showed the BTEX results for soil samples taken from the 12 borings locations. Most of the results were either entirely non-detect, or had only low hits, or had moderate to high total xylene exceedences with the other analytes being low to moderate in concentration. The shallow soil sample at SB009 had 3 high exceedences. The shallow soil sample at SB007 had 110 ppb of ethylbenzene and 970 ppb of total xylenes. The deep soil sample at SB007 had 210 ppb of ethylbenzene and 1300 ppb of total xylenes. Sanborn maps were included as Attachment 1. No tanks were depicted on the maps for the Wendy's property. Attachment 2 contained NYC PBS search documentation. Attachment 3 showed the extent of the soil excavation at the former HESS site. Attachment 4 showed the soil vapor extraction and air sparge piping layout for the former HESS site. Attachment 5 contained the groundwater gauging and elevation data. Attachment 6 contained the BTEX-MTBE-groundwater elevation graphs. Attachment 7 contained the Enviroprobe Service report dated 8/23/16. The information in this report had been included in the body of the text for the SIR. Attachment 8 contained the borings logs. In general, fill material extended from 0 to 5 feet below grade. Natural sediments consisting of either silty sand, sand or gravelly sand start at depths from 4 to 7 feet below grade. The zone of contamination (smear zone or gray to dark gray sand zone) typically extended from 13 to 17 feet below grade. At some boring locations, the gray zone with petroleum odors extended continuously from 12 or 13 feet below grade to total depth at 20 or 24 feet. The York Analytical Laboratories Inc. 9/21/16 analytical report was Attachment 9. 11/8/16 - Raphael Ketani. The information in the October 2016 P.W. Grosser report appeared to have been generated by methods which are typically used by the environmental industry. The resulting data was

HESS/MERIT STATION 32STA (Continued) **S103574868**

coherent and consistent. So I approved the SIR. However, a deeper penetrating geophysical survey would have been more definitive. 11/9/16 - Raphael Ketani. I contacted Mr. Kampf by phone (212) 786-7420/(716) 392-4933 (rkampf@pwgrosser.com) and discussed whether there were any other geophysical methods which could definitely penetrate deeper below the Wendy's property, given the subsurface conditions. Mr. Kampf stated that he had discussed this issue with several geophysical companies and none could guarantee that their instruments could give results for depths below about several feet (about 3 to 4 feet below grade). As a result of our conversation, I sent a letter to Penbrow, Inc. at 488 Madison Avenue, 19th Floor, Manhattan, New York, 10022. In the letter, I stated that, in consideration of the information in the SIR, the Department has determined that the Wendy's property is not a source of environmental contamination. A pdf file of the letter was sent by email and a hard copy was sent to Penbrow. 2/2/17 - Raphael Ketani. I reviewed the EnviroTrac January 2017 Quarterly Update Report dated 1/31/17. On 11/29/16, 12 wells were gauged and sampled. The wells gauged and sampled were MW-1, 2, 4, 7 to 14 and 18. Product was not detected in any of the wells. Groundwater was found at 10.95 to 13.11 feet. Flow was southeasterly. The groundwater analytical results for the samples from MW-9, 12, 14 and 18 were non-detect for BTEX. The samples from MW-2 and MW-13 had a few low hits. For the other samples, the BTEX concentrations were 2475 ppb (19 ppb benzene) at MW-1, 2834.4 ppb (5.4 ppb benzene) at MW-4, 138.1 ppb at MW-7, 529.8 ppb (234 ppb benzene) at MW-8, 3508.1 ppb (4.1 ppb benzene) at MW-10, and 7130 ppb (non-detect benzene) at MW-11. The AS/SVE system remained shut down due to non-detect recovery. 4/28/17 - Raphael Ketani. Today I received an email from Mr. Butler that he is leaving Speedway. He stated that John Engdahl [jjengdahl@speedway.com (732) 738-2923] will take over his duties. 5/2/17 - Raphael Ketani. I reviewed the EnviroTrac April 2017 Quarterly Update Report dated 4/28/17. On 2/21/17, 12 wells were gauged and sampled. The wells gauged and sampled were MW-1, 2, 4, 7 to 14 and 18. Product was not detected in any of the wells. Groundwater was found at 10.63 to 12.79 feet. Flow was southeasterly. The groundwater analytical results for the samples from MW-9, 12 to 14 and 18 were either entirely non-detect for BTEX or had one very low hit. The sample from MW-2 had 35.5 ppb of BTEX. For the other samples, the BTEX concentrations were 1901.2 ppb (23.2 ppb benzene) at MW-1, 8497.8 ppb (17.8 ppb benzene) at MW-4, 228.3 ppb at MW-7, 6312 ppb (906 ppb benzene) at MW-8, 6639.1 ppb (4.1 ppb benzene) at MW-10, and 141.1 ppb (non-detect benzene) at MW-11. I approved the report without comment. 8/1/17 - Raphael Ketani. I reviewed the EnviroTrac July 2017 Quarterly Update Report dated 7/28/17. On 5/19/17, 12 wells were gauged and sampled. The wells gauged and sampled were MW-1, 2, 4, 7 to 14 and 18. Product was not detected in any of the wells. Groundwater was found at 11.74 to 14.03 feet below grade. Flow was southeasterly. The groundwater analytical results for the samples from MW-2, 9, 12 to 14 and 18 were either entirely non-detect for BTEX or had a low concentration. For the other samples, the BTEX concentrations were 2257.2 ppb (40.2 ppb benzene) at MW-1, 16,130 ppb (110 ppb benzene) at MW-4, 473 ppb at MW-7, 1560.8 ppb (345 ppb benzene) at MW-8, 5222.4 ppb (3.4 ppb benzene) at MW-10, and 3829 ppb (non-detect benzene) at MW-11."

Remarks: "EX ISO RETEST."

All TTF:

Facility ID: 9214515

HESS/MERIT STATION 32STA (Continued) **S103574868**

Spill Number:	9214515
Spill Tank Test:	1541336
Site ID:	284266
Tank Number:	Not reported
Tank Size:	0
Material:	2645A
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	284266
Operable Unit ID:	981804
Operable Unit:	01
Material ID:	2098959
Material Code:	2645A
Material Name:	BTEX
Case No.:	Not reported
Material FA:	Oxygenates
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	True

Site ID:	284266
Operable Unit ID:	981804
Operable Unit:	01
Material ID:	400718
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	L
Recovered:	.00
Oxygenate:	True

Site ID:	284266
Operable Unit ID:	981804
Operable Unit:	01
Material ID:	2098958
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	True

HESS/MERIT STATION 32STA (Continued) **S103574868**

Facility ID:	9301033
Site ID:	64537
Spill Number/Closed Date:	1993-05-24
Spill Date:	1993-04-21
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C4
Cleanup Ceased:	1993-05-24
SWIS:	2401
Investigator:	SULLIVAN
Referred To:	Not reported
Reported to Dept:	1993-04-21
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-04-27
Spill Record Last Update:	1993-07-20
Spiller Name:	Not reported
Spiller Company:	IS TRANSPORTATION
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	62182
DEC Memo:	""
Remarks:	"DELIV DRIVER CONNECTED SPPEDI-DRI USED TO CONTAIN SPILL-MR SCEIWINGER-MERIT CO-SENDING CREW TO CLEAN SPILL"

All Materials:

Site ID:	64537
Operable Unit ID:	979635
Operable Unit:	01
Material ID:	401766
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	200.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	9810899
Facility Type:	ER
Spill Number:	9810899
DER Facility ID:	62182
Site ID:	281536
DEC Region:	2

HESS/MERIT STATION 32STA (Continued) **S103574868**

Spill Number/Closed Date:	2005-08-22
Spill Cause:	Unknown
Spill Class:	B3
SWIS:	2401
Spill Date:	1998-11-30
Investigator:	WXSUN
Referred To:	Not reported
Reported to Dept:	1998-11-30
CID:	323
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1998-11-30
Spill Record Last Update:	2005-08-22
Spiller Name:	STEVE CAPONE
Spiller Company:	MERITT STATION
Spiller Address:	810 PENNSYLVANIA AV
Spiller Company:	001
Contact Name:	STEVE CAPONE
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SUN 08/22/05-File Update by Sun- This spill is closed and refer to open spill #92-14515 at the same location.(Sun) "
Remarks:	"WHILE DIGGING FOR A FOUNDATION, CONTAMINATED SOIL WAS DISCOVERED. SOIL IS BEING STOCK PILED."

All Materials:

Site ID:	281536
Operable Unit ID:	1068294
Operable Unit:	01
Material ID:	2098957
Material Code:	2645A
Material Name:	BTEX
Case No.:	Not reported
Material FA:	Oxygenates
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	True

Site ID:	281536
Operable Unit ID:	1068294
Operable Unit:	01
Material ID:	314757
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	True

HESS/MERIT STATION 32STA (Continued) **S103574868**

Site ID:	281536
Operable Unit ID:	1068294
Operable Unit:	01
Material ID:	2098956
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	True

124
NNW
1/4-1/2
0.421 mi.
2224 ft.

REEGAE IMPORTS **NY LTANKS** **S103238196**
1900 LINDEN BLVD **NY Spills** **N/A**
BROOKLYN, NY

Relative:
Lower

Actual:
15 ft.

LTANKS:

Facility ID:	8808120
Site ID:	88916
Spill Number/Closed Date:	2000-03-24
Spill Date:	1989-01-11
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	A3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SMMARTIN
Referred To:	Not reported
Reported to Dept:	1989-01-11
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1989-01-19
Spill Record Last Update:	2000-03-27
Spiller Name:	Not reported
Spiller Company:	COCA COLA
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	81275
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was MARTINKAT SEE SPILL NUMBER 8808741."
Remarks:	"(4) 550 GALLON TANK SYSTEM FAILED PETRO TITE, AFTER FILLING TANKS, DISCOVERED SYPHON PIPE LEAKING IN FILL BOX, SO TEST WAS HALTED, WILL FIX PIPING TOMORROW."

REEGAE IMPORTS (Continued) **S103238196**

All TTF:

Facility ID:	8808120
Spill Number:	8808120
Spill Tank Test:	1535072
Site ID:	88916
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	88916
Operable Unit ID:	923594
Operable Unit:	01
Material ID:	567928
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	8808741
Site ID:	88917
Spill Number/Closed Date:	1989-04-25
Spill Date:	1989-02-07
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1989-04-25
SWIS:	2401
Investigator:	SULLIVAN
Referred To:	Not reported
Reported to Dept:	1989-02-07
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1989-02-08
Spill Record Last Update:	1998-05-06

REEGAE IMPORTS (Continued) **S103238196**

Spiller Name: Not reported
Spiller Company: COCA COLA PLANT
Spiller Address: 1900 LINDEN BLVD
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 2
DER Facility ID: 81275
DEC Memo: ""
Remarks: "(4) 550 GALLON TANK SYSTEM FAILED PRECISION TEST. L R =.121GPH, WILL EXCAVATE, ISOLATE & RETEST. TANKS TO BE ABANDONED, MAY BE REPLACED AFTER MAY 1ST."

All TTF:
Facility ID: 8808741
Spill Number: 8808741
Spill Tank Test: 1535152
Site ID: 88917
Tank Number: Not reported
Tank Size: 0
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:
Site ID: 88917
Operable Unit ID: 924654
Operable Unit: 01
Material ID: 453508
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: -1.00
Units: L
Recovered: .00
Oxygenate: Not reported

SPILLS:
Facility ID: 9606844
Facility Type: ER
Spill Number: 9606844
DER Facility ID: 81275
Site ID: 184643
DEC Region: 2
Spill Number/Closed Date: 1996-08-28
Spill Cause: Human Error

REEGAE IMPORTS (Continued) **S103238196**

Spill Class:	C4
SWIS:	2401
Spill Date:	1996-08-28
Investigator:	SMMARTIN
Referred To:	Not reported
Reported to Dept:	1996-08-28
CID:	349
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-08-28
Spill Record Last Update:	2003-11-20
Spiller Name:	JEFF JAGER
Spiller Company:	SAFETY KLEEN
Spiller Address:	58-05 52ND AV
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was MARTINKAT SPOKE TO JEFF AT 2:55 - SPILL IN DRIVEWAY, NONE IN SEWER - DRIVER CLEANED UP"
Remarks:	"hatch was not closed - truck went up incline spilling product"

All Materials:

Site ID:	184643
Operable Unit ID:	1037982
Operable Unit:	01
Material ID:	346115
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	20.00
Oxygenate:	Not reported

Y125 **1868 LINDEN BLVD** **NY LTANKS** **S101658363**
NNW **1868 LINDEN BLVD** **N/A**
1/4-1/2 **QUEENS, NY**
0.445 mi.
2349 ft. **Site 1 of 2 in cluster Y**

Relative:
Lower

Actual:
15 ft.

LTANKS:

Facility ID:	9503273
Site ID:	218128
Spill Number/Closed Date:	2005-11-25
Spill Date:	1995-06-15
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	Not reported

1868 LINDEN BLVD (Continued) **S101658363**

SWIS:	4101
Investigator:	RXMUSTIC
Referred To:	Not reported
Reported to Dept:	1995-06-15
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1995-06-21
Spill Record Last Update:	2005-11-25
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	180463
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was ROMMEL This Spill cleanup project has been reassigned from DEC (Sigona) to Rommel on 2/2/2004. 07/28/95: PASSED FROM ENGELHARDT TO SIGONA ON 07/28/95. "
Remarks:	"TANK #1 (2000 GAL) AIR TEST FAILURE."

All TTF:

Facility ID:	9503273
Spill Number:	9503273
Spill Tank Test:	1543916
Site ID:	218128
Tank Number:	Not reported
Tank Size:	0
Material:	0008
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	218128
Operable Unit ID:	1017762
Operable Unit:	01
Material ID:	368321
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum

1868 LINDEN BLVD (Continued) **S101658363**

Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Y126 **CLOSED-LACKOF RECENT INFO** **NY LTANKS** **S102959961**
NNW **1868 LINDEN BLVD** **NY Spills** **N/A**
1/4-1/2 **BROOKLYN, NY**
0.447 mi.
2362 ft. **Site 2 of 2 in cluster Y**

Relative:
Lower

Actual:
15 ft.

LTANKS:

Facility ID:	8800531
Site ID:	320909
Spill Number/Closed Date:	2003-03-04
Spill Date:	1988-04-16
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	a3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	ADMIN. CLOSED
Referred To:	Not reported
Reported to Dept:	1988-04-16
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1988-04-22
Spill Record Last Update:	2003-03-04
Spiller Name:	Not reported
Spiller Company:	ANAR SERVICE STATION
Spiller Address:	1868 LINDEN BLVD
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	258530
DEC Memo:	""
Remarks:	"TANK #4 FAILED WITH A LEAK RATE -.129GPH, WILL EXCAVATE, ISOLATE AND RETEST. CONTACT: MARIO TERRANA (718)-649-0045. CLOSED DUE TO LACK OF ANY RECENT INFO - DOES NOT MEET ANY CLEANUP REQUIREMENTS. "

All TTF:

Facility ID:	8800531
Spill Number:	8800531
Spill Tank Test:	1533673
Site ID:	320909
Tank Number:	Not reported
Tank Size:	0
Material:	0009
EPA UST:	Not reported

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	00
Test Method 2:	Unknown
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	320909
Operable Unit ID:	916137
Operable Unit:	01
Material ID:	459718
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	L
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9709774
Site ID:	320910
Spill Number/Closed Date:	Not reported
Spill Date:	1997-11-21
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	AXDORONO
Referred To:	GW REPORT REVIEWED
Reported to Dept:	1997-11-21
CID:	252
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	1
Date Entered In Computer:	1997-11-21
Spill Record Last Update:	2017-06-29
Spiller Name:	MARIO TERRANA
Spiller Company:	TEXACO GAS STATION
Spiller Address:	1868 LINDEN BLVD
Spiller County:	001
Spiller Contact:	ALVIN PETROLEUM
Spiller Phone:	(718) 461-5400
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	258530
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

SUN 11/25/97 mmm:PBS RECORDS INDECATE THAT TANKS OVERDUE FOR TESTING BY 3 YEARS. SPILL # 88-00531 ALSO ACTIVE FOR THE SITE, FOR TANK #4 FAILING TT ON 4/16/88 (SULLIVAN). SULLIVAN SPILL WILL BE CLOSED AND THIS SPILL NUMBER WILL REMAIN ACTIVE FOR THE SITE. 1/2/2004 Reassigned from Mulqueen to Sun. 12/16/2005 - Feng - Reassigned from Sun to Feng as per Sun. (RJF) 10/30/06 Reassigned from Tang to Sun. (MS) 11/16/06 Sun sent Outstanding Violation/Tank Test Failure letter to Eric S. Miller, owner of Arnold's Service Station at 1868 Linden Blvd on 11/09/06, requiring the following to be received by December 9, 2006: 1. An explanation of the cause of the tank system failure; 2. Either a description of the work performed to restore the integrity of the tank system (including retesting results), or a description of the work performed to close (decommission) the tank; 3. Information regarding petroleum contamination found at the site and cleanup activities (if any) associated with a release from this tank system; 4. Any available documentation (i.e., invoices, bills, sampling analysis reports, etc.) pertaining to the work performed at this site associated with this violation. (JS/MS) 1/4/07: Above letter was returned (no such name). Found a recent tank renewal application for same address and sent letter (same as above) to Mr. Tzali Hirschler on 1/3/07. (JS/MS) 3/7/07: Received some documents associated with a UST upgrade including invoices and confirmation from tank installation company. Reviewing, however submittal is not pertaing to tank test failure. (JS/MS) 8/1/07: ACRIS search also indicates Mr. Eric Miller as person responsible for satisfaction of morgage. Need to further research current and accurate contact info and telephone number. (JS/MS) 1/24/08: Sol Hirschler at 516.901.1666. 4/24/08: 2nd clean up letter sent to Eric Miller (2x, different addr for Ham II Realty) and Tzali. 2006 tank test report and 1995 soil boring logs + GW data does not address this 1997 spill. (JS/MM) 5/12/08: Sent 2nd letter + SIWP for subsurface investigation report. (JS/MM) 5/14/08: Dean Sommer (518-438-9907 x236) called; representing Tzali Hirschler. Trying to put documents together, not quite sure who is responsible.(JS/MM) 5/20/08: JS received voicemail from Jeff Ruderman, attorney for Eric Miller; Miller bought property but had an agreement with the previous owner. Previous owner would be responsible for all environmental concerns. Sent email to Jeff for clarification. (JS/MM) 5/21/08: Extension granted to Miller/Ruderman. Due 7/23/08. (JS/MM) 7/16/08: Preferred Environmental retained, requesting extension and FOIL request. SIWP due 9/7/08. (JS/MM) 08/05/08: Transferred to Kolleeny/Mandac. - JK 10/8/08: PES late with SIWP. (JK/MM) 12/30/08: Spoke with Jill Haimson. She said they have been trying to get a road opening permit. I told her I didn't have any documents from her and the last correspondence was Preffered's request for an extension for the SIWP. She said she will pull the file and see what documents she has. (JK/KG) 01/06/09: Rec'd following email from Bill Schlageter. SIWP under review. Kathleen: As requested, attached is the Site Investigation Work Plan to be conducted by Preferred Environmental Services at the Citgo Station at 1868 Linden Boulevard, Brooklyn, NY. We are currently obtaining the required sidewalk opening permit and anticipate receipt of same sometime next week. As soon as we have a set schedule, I will update you. In the interim, please do not hesitate to contact me or Jill. Thank You, Bill (JK/KG) 01/07/09: SIWP approved and letter sent to Eric Miller. SIR due 03/31/09. Scope of work includes installation of 6 borings, collection of soil and GW samples, and submission of SIR. DEC approved the work plan with the following modifications: GW

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

samples must be collected from exisitng accessible wells, any damaged wells should be replaced, permanent wells should be installed where contamination is encountered, additional borings/wells should be installed as necessary to fully delineate contamination plume, new and existing wells should be surveyed, and soil and GW samples should be collected at all boring locations. (JK/KG) 01/27/09: Rec'd phone call from Bill concerning modifications requested by DEC to the approved work plan. He stated all of the existing wells are in bad condition and will not be able to collect samples from them. DEC requested wells to be installed where contamination was encountered. Instead of installing permanent wells the day the borings are conducted he would like to first submit the soil and GW samples for lab analysis. Then, based on the lab results, Preferred will submit a report with recommendations for well locations. After the wells are installed they will be surveyed. I told him that was okay. Groundwater and soil samples will be collected from all 6 borings. He expects to get the sidewalk permits this week and anticipates work to commence next week. (JK/KG) 02/09/09: Rec'd email from Bill on 02/06/09 stating that site work is tentatively scheduled for 02/12/09. (JK/KG) 04/08/09: Rec'd email from Bill: I apologize, but the report for 1868 Linden Boulevard, Brooklyn has been delayed between revisions between our office and the client's attorney. We expect to have the report to your office in the next few days. Pleas bear with us and I apologize for the inconvenience. Pdf of report was submitted on 4/8/09; under review. (JK/KG) 04/16/09: Investigation on 2/12/09 included 6 borings and collection of soil and groundwater samples. GW results: GW-1: Total VOCs plus oxygenates - 46,318.4 ug/L GW-2: Total VOCs plus oxygenates - 33,290.0 ug/L GW-3: Total VOCs plus oxygenates - 39,638.4 ug/L GW-4: Total VOCs plus oxygenates - 144.76 ug/L GW-5: Total VOCs plus oxygenates - 427.3 ug/L GW-6: Total VOCs plus oxygenates - 25.74 ug/L Soil: VOCs detected above TAGM RSCOs in SB-2(8-10') and SB-3(8-10'). Preferred has indicated that a RAP is necessary. A letter was sent to the RP requiring a RAP be submitted by 6/5/09. At a minimum the RAP will propose installation of permanent monitoring wells, delineation of the groundwater contaminant plume, a groundwater elevation survey, and installation of a soil and groundwater treatment system. (JK/KG) 06/01/09: Rec'd a call from Bill Schlageter requesting a 2 week extension to submit the RAP. I asked him to send an email requesting an extension. Kathleen: As we discussed, Preferred is respectfully requesting that the NYSDEC grant us an extension on the June 5, 2009 deadline to prepare the NYSDEC-required Remedial Action Plan (RAP) for the above-referenced property. We are in the process of developing a scope of work to address the remaining on-site impacts and need some more time to finalize the specifics of same. I thank you in advance for your patience. Regards, Bill Bill, Your request for an extension is granted. The new deadline for submission of the RAP is June 19, 2009. Feel free to contact me if you have any questions. Thanks, Kathy (JK/KG) 06/22/09: I spoke to Bill Shlageter and he said he sent Mr. Miller a proposal for two different remedial options and is waiting for his approval. (JK/KG) 07/06/09: Rec'd the following email from Jill Haimson: We have been conferring with Mr. Miller relative to the above parcel and have provided him with various remedial options that the NYSDEC would find acceptable. He has indicated that he is having internal meetings and will make a decision by the end of the week. We will reach back out to you early next week to confirm a conceptual scope and overall schedule for implementation. Thanks and we will

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

talk to you shortly. Jill S. Haimson 08/05/09: Sent an email to Jill requesting an update on the status of the RAP. (JK/KG) 08/06/09: Rec'd email from Jill: The client has decided to contract with us for the preparation of the RAP - he has been out of the country for the last two weeks and will be back in 1-2 weeks. At that time, he will execute our contract and we can set a schedule for the submission of the RAP. We're getting there! Jill S. Haimson (JK/KG) 08/31/09: Spoke to Jill Haimson, she said Mr. Miller accepted Preferred's proposal. She will call Mr. Miller and get back to me next week. (JK/KG) 09/30/09: Follow up with Haimson and Miller. RAP is past due. (JK/KG) 11/03/2009: This spill case was transferred to A. Doronova. - AD 12/15/2009: PDF copy of the RAP was submitted. DL to eDocs. AD 12/28/2009: Received a hard copy of the RAP. Will review. Changed site priority from P0 to P1. AD 01/07/2009: Reviewed the RAP. Preferred Env. proposes application of a bioremediation agent. The proposed remediation will consist of the in-situ soil and GW treatment using a bioremediation technology by MicroBac International, Inc. This involves injection of natural bacteria. Scope of work includes: - installation of one injection well and rehabilitation of four existing wells for use in application of MicroBac injection; - installation of three permanent monitoring wells; - application of MicroBac and associated nutrients via 5 injection wells; - monthly sampling of DO, ferrous iron and other relevant parametrs. - quarterly GW sampling for one year with reporting to DEC. The GW contamination is not delineated at the site. Additional wells should be installed. Discussed the RAP with J. Kolleeny of DEC. Called and spoke with Bill Schlageter of Preferred Env. Requested to submit a revised work plan for monitoring wells installation only. Two additional wells should be installed at the site. Off-site wells MW-6 and MW-7 should be sampled if feasible, if not - they should be replaced. After all wells will be installed, surveyed and sampled, RAP can be reviewed by DEC. Response is due January 19, 2010. AD 02/17/2010: Received an e-mail from B. Schlageter of Preferred Env. saying: greater than greater than greater than Bill Schlageter 2/17/2010 6:15 PM greater than greater than greater than Ms. Doronova: We spoke relative to this project a few weeks ago as the NYSDEC has additional requirements other than those set forth in the Remedial Action Work Plan submitted by Preferred on behalf of the property owner. Could you please send a letter or e-mail documenting these additional requirements so that we may pass them on to the property owner as an additional scope specifically required by NYSDEC beyond what was proposed in our RAWP? Thank You Bill William J. Schlageter Operations Manager/Senior Hydrogeologist PREFERRED ENVIRONMENTAL SERVICES Certified Port Authority of New York and New Jersey (PANYNJ), NYS and NYC Women-Owned Business Enterprise (WBE) 323 Merrick Avenue North Merrick, New York 11566 Tel: (516) 546-1100 ext. 22 Fax: (516) 213-8213 Cell: (917) 715-0752 AD 02/18/2010: Sent an e-mail to Mr. Schlageter: Dear Mr. Schlageter: As we discussed it previously, DEC opinion is that the groundwater contamination is not delineated at the site. Additional wells should be installed. A revised work plan for monitoring wells installation only, should be submitted to DEC for review and approval. Two additional wells should be installed at the site. Off-site wells MW-6 and MW-7 should be sampled if feasible, if not - they should be replaced. After all wells will be installed, surveyed and sampled, a investigation summary report with a proposed remedial actions can be reviewed by DEC. Response is time sensitive.

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

06/22/2010: Called and spoke with Bill Schlageter regarding submission of the report. He said that the owner of the site was out of contry, so they were not able to discuss with him new scope of work. he will contact the owner and will send a status update info till July 1, 2010. AD 07/15/2010: Called and left a message to Mr. Schlageter. Later spoke with B. Schlageter. Mr. Schlageter aked for an official letter from DEC with an additional investigation request. Requsted him to send a recent contact info of the owner including his e-mail address. AD 07/21/2010: Received an e-mail from B. Schlageter saying: Ms. Doronova: As you requested, the current property owner information is as follows: Mr. Eric Miller Iberia World Foods 1900 Linden Boulevard Brooklyn, New York 11207 Please copy me on any correspondence with the property owner. Thank you, Bill William J. Schlageter Operations Manager/Senior Hydrogeologist AD 07/26/2010: Issued a letter with a request for additional investigation. Mr. Schlageter does not have e-mail address of the owner. Sent the letter to Mr. Schlageter, so he can forward it to Mr. Miller. DL pdf copy to eDocs. Response is due August 16, 2010. AD 08/13/2010: Received an e-mail from B. Shlageter: Ainura: I am requesting a few more days on the work plan for 1868 Linden Boulevard, Brooklyn, NY. I have spoken to the property owner and provided him with our proposal, but he is not available this afternoon, and I feel that I won t have his authority by Monday to submit our work plan to you. Thank you for your patience and cooperation. Bill William J. Schlageter Operations Manager/Senior Hydrogeologist . AD 08/16/2010: Received an e-mail from Bill: Ainura: As required by the NYSDEC, attached is the investigation work plan for the above-referenced property for your review. Please contact me with any comments. Regards, Bill William J. Schlageter DL the work plan to eDocs. Will review. AD 08/27/2010: Reviewed the work plan. It proposes installation of up to eight (8) two-inch diameter groundwater monitoring wells. If the off-site groundwater monitoring wells MW-6 and MW-7 are located, only six wells will be installed and wells 6 and 7 will be rehabilitated; The investigation work plan also includes: " Collection and laboratory analysis of up to 12 soil samples for VOCs; " Survey, gauging and sampling of all installed groundwater monitoring wells (up to eight) with groundwater samples submitted for VOCs plus fuel oxygenates by USEPA Method 8260. A summary investigation report to be submitted to NYSDEC including boring logs, groundwater flow map, data table and a proposed remedial action. AD 09/01/2010: Issued and sent an approval letter with a comment regarding a soil sampling interval. DL pdf copy to eDocs. AD 06/24/2011: called and spoke with Bill Schlageter of Preferred regarding implementation of the RAP. He said that because the site owner travel a lot, and spends majority of the year outside of the country, it if difficult to get hold of him and schedule a field work at the site. Asked Bill to provide an info for the owner's assistant, to whom I can sent a letter requiring expedition of the site remediation. This info will be submitted shortly. AD 08/2011: Did not receive any information from Preferred. AD 01/12/2012: called and spoke with Bill Shlageter. There was no any changes in the site status. Issued and sent a letter to the owner by certified mail (#7006 0100 0006 2620 3504)with a reqirement to perform site investigation and to submit a summary report by March 8, 2012. DL the pdf copy of the letter to eDocs. AD 02/14/2012: Received a call from B. Schlageter of Preferred. He said that the site owner contacted them to proceed with site investigation. Bill asked for a copy of the letter sent to the owner. Sent him the copy. AD 02/16/2012: Received

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

the following e-mail from Bill saying: Ainura : We have scheduled the field activities for the Thursday and Friday February 23-24, 2012. Please let me know if you will attend the delineation activities. Regards, Bill William J. Schlageter Operations Manager/Senior Hydrogeologist PREFERRED ENVIRONMENTAL SERVICES AD 02/17/2012: Received an e-mail from B. Schlageter saying: Ainura: We are planning on conducting the sampling and well installation activities next week February 23-24, 2012. As we will not receive lab data until March 7, 2012 and need some time to evaluate data and discuss results with the client, we are respectfully requesting that the NYSDEC grant us a three (3) week extension of the deadline to submit the subsurface investigation summary report from March 8, 2012 to March 29, 2012. Please let me know if this request is granted. Thank you, Bill Sent him an e-mail granting deadline extension till March 29, 2012. AD 04/03/2012: Received the following e-mail from Bill: Ms. Doronova: Attached is the report on the soil and groundwater delineation conducted by Preferred Environmental Services on behalf of the Property Owner for 1868 Linden Boulevard, Brooklyn, New York. Please review and feel free to contact me to discuss. An original copy and CD will follow by mail. Regards, Bill DL the report to eDocs. AD 04/09/2012: Received a hard copy of the report. Will review. AD 05/16/2012: Reviewed the Soil and Groundwater Delineation report. It states that the purpose of the February - March 2012 investigatory activities were to further delineate the extent of previous gasoline-related impacts identified in soil and groundwater at the subject property. Additional subsurface investigation was conducted on February 12, 2009 by Preferred which consisted of the following: " Installation of six soil borings at the site via a Geoprobe; " Collection and laboratory analysis of nine soil samples; " Installation of six temporary groundwater monitoring wells utilizing the Geoprobe; " Collection and laboratory analysis of six groundwater samples; and " Completion of an elevation survey and the development of a groundwater flow map. Based on the results of subsurface investigation is was concluded that petroleum-related impacts to soil and groundwater are present at the site and the highest concentrations of gasoline-related organic compounds and gasoline-related fuel oxygenates were identified adjacent to the in-service USTs. Eight monitoring wells were installed at the site. Upon installation, the 8 new groundwater monitoring wells, and 3 existing groundwater monitoring wells (MW-1, MW-2 and MW-4) were gauged for the presence of free-phase product. Upon gauging of the wells, free phase product was present in 5 wells: MW-1, MW-2, MW-13, MW-14 and MW-16/MW-7. All of these wells are located south of and proximate to historic dispensing areas, and/or USTs (such as MW-2). The three out of five wells with the thickest free phase product were identified as: MW-13 (1.41 feet); MW-1 (1.01 feet); MW-2 (0.81 feet). These three wells are located immediately south and adjacent to the historic and current gasoline dispensing areas. The six monitoring wells that did not contain free product (MW-4, MW-9, MW-10, MW-11, W-12 and MW-15/MW-6) were subsequently developed and sampled. TVOCs ranged in concentrations from 10.93 ug/L in MW-12 to 11,820 ug/L in MW-11. With the exception of MTBE at a concentration of 120 ug/L in MW-15/MW-6, no fuel oxygenates were detected above their MDLs in any of the six groundwater samples. Based upon the above, Preferred recommends a product recovery via a Vacuum Enhanced Fluid Recovery (VEFR) program. The VEFR program should consist of the periodic and repeated sustained use of a vacuum truck, exerting a strong vacuum on

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

these wells to remove free phase product. Product recovery testing should be performed in tandem with these efforts, to ascertain the actual product thickness, and to assess the best available and most appropriate technology to address this issue. Additionally, a means to eliminate the continued introduction of gasoline from fueling operations should be developed and implemented in tandem with the VEFR. Upon the successful removal of free phase product to minimal and non-recurring levels, a subsequent remedial program should be designed to address the remainder of residual gasoline related impacts (e.g., dissolved phase) on and off-site. AD 05/17/2012: Called and spoke with B. Schlageter of Preferred. Requested to submit a detailed pilot study work plan for the proposed EFR. he asked for an official letter for RP to get their approval. Will issue a letter. AD 07/02/2012: Issued and sent a recommendation approval letter addressed to Mr. Miller with a request to submit a brief work plan for EFR. DL pdf copy of the letter to eDocs. AD 08/20/2012: Received an IRM work plan for EFR. It states that according to the results of subsurface investigation, petroleum-related impacts to soil and groundwater are present at the site and that the highest concentrations of gasoline-related compounds and LNAPL were identified in the vicinity of the in-service USTs. Preferred proposes a Vacuum Enhanced Fluid Recovery (VEFR) on a weekly basis as an interim remedial measure to remove free product from five site wells. Upon the successful removal of free phase product, remedial action will be proposed to address the remaining residual gasoline related impacts on and off-site. additional delineation of free product plume is needed. AD 08/27/2012: Discussed the IRM work plan with J. Koleeny of DEC. called and talked with B. Shlageter of Preferred. He agreed to additional delineation. Issued and sent a letter which approves the IRM work plan with the following comments: - A brief work plan for delineation of the free product plume should be prepared and submitted to DEC for review and approval; - Groundwater sampling should be performed at the site on a quarterly basis. DL pdf copy of the letter to eDocs. AD 01/24/2013: Called to B. Schlageter of Preferred Env. regarding report submission. He informed me that the report is ready and he will submit it soon. AD 03/05/2013: Received an e-mail from J. Haimson of Preferred with an attached report. DL the report to eDocs. Will review. AD 05/01/2013: Reviewed the report. It is a summary of continued monitoring, and prior pump down tests and product recovery activities conducted by Preferred Environmental Services (Preferred) from August 2012 through February 2013 at the site. From August 2012 through February 2013, Preferred implemented remedial activities including the Vacuum Enhanced Fluid Recovery (VEFR) program, monitoring and a pump down test. On-site and off-site monitoring wells were gauged using an oil-water interface probe, to identify wells needing product recovery. When the VEFR program was initiated, a vacuum truck was utilized to exert a strong vacuum on monitoring wells identified to have free-phase product within them. EFR: The first VEFR event was performed on August 31, 2012. A total of 398 gallons was recovered from groundwater monitoring wells 1, 2, 4, 7, 10, 11, 13, and 14. All monitoring wells had a non-measurable thickness of free floating product with the exception of off-site monitoring well MW-7, which reported a thickness of 0.65 feet. The second VEFR event was performed on October 8, 2012. A total of 95 gallons was recovered from MW-7. Again, MW-7 had the only measurable free floating product, with a thickness of .03 feet. Waste manifests were obtained for each VEFRs and are provided as an attachment.

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

Evaluation of the ongoing monitoring after the VEFRs noted the continued absence or very limited measurable product from Mid October 2012, November - December 2012 (no measurements were done in this time frame due to Tropical Storm Sandy and inability to access wells due to snow piles), and through January 30, 2013. As of January 30, 2013, no measurable free phase product was present at MW-1, MW-2, MW-4, MW-6 to MW-14. Pump Test: During the initial VEFR event on August 31, 2012, a time-rated product recovery test on selected groundwater monitoring wells was performed to ascertain the actual product thickness and associated product and groundwater elevation recovery rate. Monitoring wells 7, 14, 13, 1, 2, and 11 were selected due their specific characteristics and historic product levels. Groundwater monitoring well, MW-7, had the greatest product recovery rate with .01 feet of product recovered at intervals greater than ten (10) minutes. However, no more than a total of .04 feet of product was observed to have been recovered from the MW-7 while Preferred was on-site performing the product recovery test. Conclusions and recommendations: From August 2012 through February 2013, remedial activities and/or continued monitoring efforts were conducted at the site. The results of this effort are summarized below: " An initial scope of multiple VEFR and product recovery test events were completed; " Continued monitoring of the site has proved that a drastic reduction of free-floating product levels had occurred on all on-site monitoring wells to non-measurable levels as of January 30, 2013; " The only groundwater monitoring well to periodically exhibit free floating product is the off-site MW-7 monitoring well. The recovery rate of product within the well is greater than .001 ft of product/minute. No product was measurable as noted in January 30, 2013; " Based upon the removal of free-phase product and the non-resurgence of significant measurable product over the last few months (inclusive of the potential effects from Tropical Storm Sandy flooding), it appears that the product phase was likely trapped and may not re-occur. " Based upon the results of the VEFR, continued monitoring program and absence of free phase product, in order to develop a final remedy for this property, Preferred proposes to conduct an updated round of groundwater sampling, inclusive of those wells that have not been sampled before, wherein product was present. This will enable a determination of what level of remediation is still required, as well as the best available and most appropriate technology to address the remaining dissolved phase impacts present in deep soils and groundwater. If agreeable, a new round of groundwater sampling will be conducted as soon as feasible. AD 06/03/2013: Called and spoke with B. Shlageter of Preferred regarding GW report submission. He said that they sampled the wells few weeks ago and are in a process of preparing the report. It will be submitted to DEC approximately by June 14, 2013. AD 09/09/2013: Received the following e-mai from J. Haimson: Hi Ainura please find attached: Summary Monitoring Report & Update for NYSDEC Spill 97-09774, Service Station - 1868 Linden Blvd, Brooklyn, New York 11207. A hard copy is being sent as well. Thanks and best regards. Jill S. Haimson, CGWP, PG Principal PREFERRED ENVIRONMENTAL SERVICES 323 Merrick Avenue North Merrick, New York 11566 DL the report to eDocs. Will review. AD 10/09/2013: Reviewed the report. It states that from April 2013, remedial activities and/or continued monitoring efforts conducted at the commercial property at 1868 Linden Blvd, Brooklyn, NY. The results of this effort are summarized below: " Continued monitoring of the Subject Property has proved that a

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

drastic reduction of free floating product levels had occurred on all on-site monitoring wells to non-measurable levels as of January 30, 2013; " The only groundwater monitoring well to periodically exhibit free floating product is the off-site MW-7 monitoring well. The recovery rate of product within the well is greater than 0.001 ft of product/minute. No free phase product was measurable as noted in January 30, 2013; " Based upon the removal of free-phase product and the non-resurgence of significant measurable product over the last few months (inclusive of the potential effects from Tropical Storm Sandy flooding), it appears that the product phase was likely trapped and may not re-occur; and " Based upon the results of the VEFR, continued monitoring program and absence of free phase product, in order to develop a final remedy for this property, Preferred proposed to conduct an updated round of groundwater sampling, inclusive of those wells that have not been sampled before, wherein product had formerly been present. This will enable a determination of what level/type of spill remediation is still required, as well as the best available and most appropriate technology to address the remaining dissolved phase impacts present in deep soils and groundwater. As per this recommendation, a new round of groundwater sampling was conducted on April 11, 2013, which is documented in this report. Groundwater samples were collected from ten (10) monitoring wells (MW-1, MW-2, MW-4, MW-6 (MW-15), and MW-9 to MW-14) on April 11, 2013. MW-7 (MW-161) was not sampled due to the presence of an intermittent sheen. Subsequent to the groundwater sampling of the existing wells across the study area, a measurement of water levels were recorded. During January 30, 2013 and April 11, 2013, no free phase floating product was identified in any of the ten (10) monitoring wells (MW-1, 2, 4, 6 (a.k.a. MW-15), MW-7 (a.k.a. MW-16), 9, 10, 11, 12, 13 and 14) evaluated, with the exception of the very limited and intermittent product noted at MW-7 (sheen to 0.01 foot). Depth to water ranged from 10.75 feet below grade surface (bgs) to 12.60+ feet bgs in April 2013. The highest concentrations of residual petroleum impacts to groundwater were detected in samples MW-1 (3,388 u/L), MW-13 (3,361 ug/L), MW-14 (2,509 ug/L), MW-2 (1,046 uL), MW-11 (1,989 u/L), with lower TVOC concentrations reported at the other wells. Preferred concludes that there is a clear correlation with the presence of remaining elevated TVOCs with respect to wells with prior history of free-phase product as measured in March 2, 2012. This specifically includes MW-1, MW-2, MW-13 and MW-14. Three wells are located next to each other and all are hydrogeologically downgradient of the dispenser islands. It is common for wells that previously contained free-phase floating product to continue to demonstrate slightly elevated concentrations due to the propensity for the former product to have coated the interior of the well screen and surface of the sand pack. A comparison of VOC concentrations in groundwater from April 2013 to the prior sampling round in March 2012 noted the following significant information: TVOCs decreased dramatically at MW-4 (from 184 ug/L to 27 ug/L); decreased to non-detect at MW-9; decreased from 1,476 ug/L to 327 ug/L at MW-10 with no oxygenates detected historically; a ten-fold decrease was reported at MW-11 from 11,820 ug/L down to 1,989 ug/L, with a low level new detection MTBE; very slight increase in MW-12 (less than one order of magnitude) of VOCs and oxygenates; decreased from 1,328 ug/L to 628 ug/L at MW-15 (MW-6), including a decrease in oxygenate concentrations. An evaluation of the April 2013 groundwater data with comparison to historical data clearly demonstrates a significant reduction in the

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

presence of any residual floating product coupled with a large decrease in dissolved phase gasoline constituents. Based upon this information, Preferred recommens continuing monitoring of groundwater conditions on a semi-annual basis as an appropriate next step in the remedial process for this property. As free-phase floating product has virtually diminished, and dissolved phase concentrations have also decreased substantially due to the removal of product and continued natural attenuation, the next groundwater sampling round is proposed for October 2013. 07/14/2014: Called and spoke with B. Schlageter regarding site status update. He will contact site owner and get back to us. AD 01/2015: called and left a message to Mr. Schlageter. AD 06/28/2017: called and spoke with B. Schlageter. They did not work for the site for a long time. Will send a letter. AD"

Remarks: "TANK TEST FAILED - TANK TO BE PUMPED OUT AND RE-TESTED."

All TTF:

Facility ID:	9709774
Spill Number:	9709774
Spill Tank Test:	1545480
Site ID:	320910
Tank Number:	001
Tank Size:	4000
Material:	0009
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	20
Test Method 2:	USTest 2000/P/LL plus USTest 2000/U
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	320910
Operable Unit ID:	1056057
Operable Unit:	01
Material ID:	2159405
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	True

Site ID:	320910
Operable Unit ID:	1056057
Operable Unit:	01
Material ID:	2159406
Material Code:	2645A
Material Name:	BTEX
Case No.:	Not reported
Material FA:	Oxygenates
Quantity:	Not reported

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

Units: Not reported
Recovered: Not reported
Oxygenate: True

Site ID: 320910
Operable Unit ID: 1056057
Operable Unit: 01
Material ID: 328103
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: True

SPILLS:
Facility ID: 0200612
Facility Type: ER
Spill Number: 0200612
DER Facility ID: 258530
Site ID: 320908
DEC Region: 2
Spill Number/Closed Date: 2003-07-09
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 2401
Spill Date: 2002-04-17
Investigator: SMSANGES
Referred To: Not reported
Reported to Dept: 2002-04-17
CID: 396
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2002-04-17
Spill Record Last Update: 2003-07-09
Spiller Name: Not reported
Spiller Company: MADISON OIL
Spiller Address: 2125 MILL AVE
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was SANGESLAND "
Remarks: "fitting broke..spill was contained and cleaned up."

All Materials:
Site ID: 320908
Operable Unit ID: 854051

CLOSED-LACKOF RECENT INFO (Continued) **S102959961**

Operable Unit:	01
Material ID:	522050
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Z127 **AMBER COURT OF BROOKLYN** **NY LTANKS** **S111319276**
WSW **650 EAST 104TH STREET** **N/A**
1/4-1/2 **BROOKLYN, NY**
0.452 mi.
2388 ft. **Site 1 of 2 in cluster Z**

Relative:
Lower

Actual:
9 ft.

LTANKS:

Facility ID:	1110371
Site ID:	458205
Spill Number/Closed Date:	Not reported
Spill Date:	2011-11-21
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	VXBREVDO
Referred To:	Not reported
Reported to Dept:	2011-11-21
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	1
Date Entered In Computer:	2011-11-21
Spill Record Last Update:	2013-07-16
Spiller Name:	GEORGE BURGER
Spiller Company:	PROPERTY OWNER
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	JEFF
Spiller Phone:	(973) 229-5897
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	412682
DEC Memo:	"TTF was sent out to Amber Court of Brooklyn 650 E 104TH ST BROOKLYN, NY 11236-2504 Attn: George Berger 11/28/11 Tank test failure report is in e-docs under PBS file (2-611067). bf 07/16/13 - Spill Case is transferred from Brian Falvey (PBS Unit) to V. Brevdo (Section B) as per DER Region 2 decision - Tank Test Failure Spill Case. VB "
Remarks:	"TANK TEST FAIL"

All Materials:

AMBER COURT OF BROOKLYN (Continued) **S111319276**

Site ID:	458205
Operable Unit ID:	1208315
Operable Unit:	01
Material ID:	2205628
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

Z128 **NURSING HOME** **NY LTANKS** **S106124355**
WSW **630 E 104TH ST** **N/A**
1/4-1/2 **BROOKLYN, NY**
0.453 mi.
2390 ft. **Site 2 of 2 in cluster Z**

Relative:
Lower

Actual:
9 ft.

LTANKS:

Facility ID:	0308584
Site ID:	154901
Spill Number/Closed Date:	2004-11-16
Spill Date:	2003-11-13
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	C4
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	JMKRIMGO
Referred To:	Not reported
Reported to Dept:	2003-11-13
CID:	365
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2003-11-13
Spill Record Last Update:	2004-11-16
Spiller Name:	RUDY BILARDI
Spiller Company:	Not reported
Spiller Address:	630 E 104TH ST
Spiller County:	001
Spiller Contact:	RUDY BILARDI
Spiller Phone:	(718) 240-3100
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	131304
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KRIMGOLD Sangesland sent a TTF letter to: Facility Manager River Manor Care Center 630 East 104th St Brooklyn, NY 11236. 2/09/04. J.Krimgold spoke to Empire Fuel (Dave Stern @ 718-627-5100). They are in a contract with River Manor to repair lines and tank. More details - Keny (Empire Fuel). Should call me back. Left massage for Mr.

NURSING HOME (Continued) **S106124355**

Bilardy (River Manor). 2/11/04. J.Krimgold spoke to Ken (Empire Fuel). USA tank will excavate the top of the tank, isolate lines and retest. Ken should call me back with an update on 2/23/04. 2/19/04. Ken from Empire Fuel called and informed that after isolation of piping tank was retested and failed the test. They pumped out the tank and the facility is currently running on gas. They are planning to repair the tank and USA Tank will perform the site assessment. YK. 2/19/04. Contaminated soil letter has been sent to RUDY BILARDI (River Manor Care Center). YK. 6/9/04. J.Krimgold spoke to Mr. Bilardy. He stated that they have a signed contract with Empire Fuel to remediate the site. He should fax to me a letter report with investigation summary today. Subcontractor USA Environ. 6/9/04 J.Krimgold spoke to Ken Reed (Empire) @ (516)643-4910. He stated that a subcontractor USA Environmental performed a site investigation and will submit the report in 2-3 days. 11/01/04. J.Krimgold spoke to Ken Reed and requested the status of this site. Mr. Reed tolled that he was sure that an investigation report has been sent to DEC 2-3 month ago. He will check with USA Env. and get back to me. 11/16/04. The Department has reviewed the report dated July 12, 2004 submitted by ICET (201-933-2121) regarding abovementioned site. Based on the information provided, the petroleum release which was on this site has been satisfactorily cleaned up. NFA letter. "

Remarks: ""

All TTF:

Facility ID:	0308584
Spill Number:	0308584
Spill Tank Test:	1528808
Site ID:	154901
Tank Number:	1
Tank Size:	10000
Material:	0001
EPA UST:	Not reported
UST:	Not reported
Cause:	Not reported
Source:	Not reported
Test Method:	03
Test Method 2:	Horner EZ Check I or II
Leak Rate:	.00
Gross Fail:	F
Modified By:	Spills
Last Modified Date:	Not reported

All Materials:

Site ID:	154901
Operable Unit ID:	877221
Operable Unit:	01
Material ID:	502064
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

129
NNE
1/4-1/2
0.456 mi.
2408 ft.

LINDEN/BOULEVARD HOUSES -NYCHA
696 STANLEY AVENUE
BROOKLYN, NY

NY LTANKS **S102150012**
NY Spills **N/A**

Relative:
Lower

Actual:
14 ft.

LTANKS:

Facility ID:	9501101
Site ID:	150080
Spill Number/Closed Date:	2005-12-20
Spill Date:	1995-04-26
Spill Cause:	Tank Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	B3
Cleanup Ceased:	Not reported
SWIS:	2401
Investigator:	SWKRASZE
Referred To:	Not reported
Reported to Dept:	1995-04-26
CID:	Not reported
Water Affected:	GROUNDWATER
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1995-04-26
Spill Record Last Update:	2005-12-20
Spiller Name:	Not reported
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	127629
DEC Memo:	"12/20/05: This spill transferred from J.Kolleeny to S.Kraszewski. This spill closed to consolidate with open spill #9709877."
Remarks:	"FOUR TANKS OUT OF SERVICE - CONSULTANTS INSTALLING WELLS FOUND CONTAMINATED SOIL AND GROUNDWATER"

All Materials:

Site ID:	150080
Operable Unit ID:	1015501
Operable Unit:	01
Material ID:	369716
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	-1.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

LINDEN/BOULEVARD HOUSES -NYCHA (Continued) **S102150012**

Facility ID:	9501071
Facility Type:	ER
Spill Number:	9501071
DER Facility ID:	127629
Site ID:	117585
DEC Region:	2
Spill Number/Closed Date:	1995-08-16
Spill Cause:	Equipment Failure
Spill Class:	C3
SWIS:	2401
Spill Date:	1995-04-26
Investigator:	HEALY
Referred To:	Not reported
Reported to Dept:	1995-04-26
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	DEC
Cleanup Ceased:	1995-08-16
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1995-04-26
Spill Record Last Update:	2005-12-20
Spiller Name:	Not reported
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	Not reported
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	""
Remarks:	"LEAKAGE FROM ELBOWS AND FILL PORT ON TEMPORARY ABOVE GROUND STORAGE TANKS. PROJECT STAFF CLEANING UP CONTAMINATED SOIL AND PUTTING DOWN DRYZ-ALL."

All Materials:

Site ID:	117585
Operable Unit ID:	1015467
Operable Unit:	01
Material ID:	369683
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9709463
Facility Type:	ER
Spill Number:	9709463
DER Facility ID:	127629
Site ID:	117586
DEC Region:	2
Spill Number/Closed Date:	2003-02-10

LINDEN/BOULEVARD HOUSES -NYCHA (Continued) **S102150012**

Spill Cause:	Human Error
Spill Class:	C4
SWIS:	2401
Spill Date:	1997-11-14
Investigator:	SACCACIO
Referred To:	Not reported
Reported to Dept:	1997-11-14
CID:	369
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1997-11-14
Spill Record Last Update:	2005-12-20
Spiller Name:	DANIEL O'BRIAN
Spiller Company:	KELLY TANK REPLACEMENT
Spiller Address:	4900 GRAND AVE
Spiller Company:	001
Contact Name:	STEVE SACCACIO
DEC Memo:	""
Remarks:	"REMARKS TO FOLLOW FROM REGION 2"

All Materials:

Site ID:	117586
Operable Unit ID:	1055848
Operable Unit:	01
Material ID:	569452
Material Code:	0003A
Material Name:	#6 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9709877
Facility Type:	ER
Spill Number:	9709877
DER Facility ID:	127629
Site ID:	117587
DEC Region:	2
Spill Number/Closed Date:	Not reported
Spill Cause:	Other
Spill Class:	B4
SWIS:	2401
Spill Date:	1997-11-25
Investigator:	AAOBLIGA
Referred To:	'DONUT' SHAPED 6 OIL CONTAMINATION
Reported to Dept:	1997-11-25
CID:	370
Water Affected:	Not reported

LINDEN/BOULEVARD HOUSES -NYCHA (Continued) **S102150012**

Spill Source:	Private Dwelling
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	1
Date Entered In Computer:	1997-11-25
Spill Record Last Update:	2017-08-08
Spiller Name:	Not reported
Spiller Company:	NYC HOUSING AUTHORITY
Spiller Address:	250 BROADWAY
Spiller Company:	001
Contact Name:	VINCENT MARIO
DEC Memo:	"12/08/05: This spill transferred from J.Kolleeny to S.Kraszewski. 01/20/06: Called Anjali Sahni from NYCHA Planning and Development to explain about the possiblity of moving one or more MWs at this site for construction purposes. She had asked if they required any DEC permits, or guidelines that needed to be followed. I explained to her that there are no permits or guidelines for moving MWs on the site. They are the Housing Authority's wells and they can do whatever they want with them. I told her to keep in mind that the contamination still needs to be delineated on that site for future recovery efforts and monitoring. This spill will remain open until the DEC feels that the site poses no threat, and to do that MWs and investigations are necessary. I suggested that she talk to Ralph Trocchio from NYCHA Fuel Oil Remediation about this. She will get back to me next week. - SK 03/22/06: Visited on-site with NYCHA and Gannett Fleming personnel to discuss what possible remedial actions could address this site. Ivy Hidalgo-Olberding: Gannett Fleming Project Manager Cris Sawyer: NYCHA Oil Remediation Luis Ponce: NYCHA Assistant Director Ralph Trocchio: NYCHA Oil Remediation Burton Leon: NYCHA Deputy Director Four former fuel oil tanks wee removed in 1999. Each stored #4 and #6 oil during operation. Currently, two USTs containing #2 oil are in place. In 1995, a subsurface investigation found several feet of heavy oil in the vacinity of the tanks. GF was on-site to assess the area for an up-coming subsurface investigation to delineate the plume and check GW quality. I told NYCHA and GF that since this oil is thick and the smear zone would last a long time the best remediation is excavation of the contaminated soil. Construction is planned on the adjacent lot, but before they begin work the site must be closed or remedial activity performed. Since the two operation tanks were installed in 1999, Ralph and Chris are considering excavating around the tanks. Shoring would be installed around the tanks for protection. They believe that since they were installed with clean fill and lack of oil in the perimeter wells is clean they could avoid removing the tanks. I told them they will have to be certain no heavy contamination exists beneath those tanks. I asked NYCHA to keep me up to speed on the site and to make sure that any work plans or documents submitted by GF reach my desk. GF will start soil borings by the end of the week and will continue on into next week. Expecting soil/GW sample results by April 15. - SK 07/20/06: Staff met with NYCHA personnel and developer staff to talk about remediation options for NYCHA. Since department staff have not been given a chance to review the investigation performed by Gannett Fleming (an investigation soley for the purpose of this development, not the

LINDEN/BOULEVARD HOUSES -NYCHA (Continued) **S102150012**

entire site) it was difficult to narrow down what options are available. Overall, the Department suggested that any development extending into an area of known contamination would require a vapor barrier and sub-slab venting system. Also, NYCHA would have to take remedial step on their property to ensure that the contamination would not migrate any closer to the development. NYCHA is retaining most of the contaminated property but several parcels of the lot, which have contaminated soil, will be developed into housing. Staff would contact NYCHA once we have had a chance to review the investigation report. - SK 11/16/06: J.Kann - Staff met with NYCHA personell (Cris Sawyer) and Ivy Olberding of Gannett Fleming at the site. An ISRP was submitted and reviewed in September 2006. Delineation of the free-phase product plume was not complete. NYCHA was informed that a work plan must be submitted by November 30, 2006 which would include the delineation of the plume. Well locations were identified at the on-site meeting. 02/19/08: J.Kann - Met with HDP and NYCHA. NYCHA was informed that they need to submit a RAWP for the Linden site. They agreed to do this by spring 2008. 06/23/08: J.kann - Discsussed site RAWP in a meeting with NYCHA and GF on 6/5/08. Draft RAWP for the site was submitted via email. 06/30/08: J.Kann - email sent to NYCHA as follows: Ralph - I reviewed the draft Remedial Action Work Plan prepared by Gannett Fleming for Linden Houses. The plan does address some of the items discussed in the meeting held with GF on June 5, but it is not complete. The installation of additional wells and borings were discussed at the meeting and are fine. However, at the meeting it also was discussed that GF was to prepare a proposal for remediation for the site, along with a professional discussion on why the remediation they selected for the site was best suited for the site. It was also my understanding that a fingerprint was going to be collected before preparation of the remedial work plan, because this would aid in selection of the remedial action. Continued product removal with monthly submittals may be adequate if other remedal options are not feasible. However, a discussion on feasibility needs to be included in the work plan. 08/08/08: J.kann. Received revised RAWP on 7/14/08. Comments sent in June 30 email were not addressed. Accepted report as an IRM with an increase of product removal on 7/22/08. Received Phase II report for the development parcel from NYCHA on July 29. Steve Malenowsky of CA Rich (516-746-8844) called on August 7. Questions were asked about DECs role in the development of the parcel and he also had questions about specs that were prepared for the parcel. He wanted to know if DEP was the lead or DEC was the lead. DECs involvement is related to the open spill, and it is not clear what HUD is looking for fron the DEC. It is likely that a meeting will need to be held with NYCHA and DEC to discuss this. 10/21/08: J.Kann - Jacob Krimgold and Jennifer Kann met with NYCHA and Kretchner Developers on 9/08/08. Discussed the contamination on the 696 Stanley Avenue parcel. NYCHA expressed their need for a letter from the Department indicating that the adjacent properties are not affected. NYCHA was informed that a FOIL request should be submitted. A FOIL request was submitted on 9/23 and is being processed by Fawzy Abdelsadek. Recieved a call from Kristin Pagano of techtonic engineering (845)534-5959 and an email. She is performing a phase 1 on 610 Stanley Avenue. Told her NYCHA delineated the plume and based on the information we have it has not migrated. 2/4/15: J.Kann - sent an email to Yelena requesting an update. Have not received a quarterly report in two years. 06/05/2017: J.Kann - Spill reassigned to Andre Obligado. 8/9/17 - Obligado - I reviewed

LINDEN/BOULEVARD HOUSES -NYCHA (Continued) **S102150012**

the Quarterly Status Report for 1Q17. Free product was encountered in MW1, MW2, MW6, MW9, MW18 and MW21. The maximum product thickness was 0.42 ft in MW1 and MW2. DTW is about 10-11 ft. Geology is sandy fill, sand, and peat. 4 VEFR events were performed. Recovery amounts were not recorded. Recommends monthly monitoring and VEFR events and use of absorbent socks."

Remarks: "pulling 25,000 gallon tank found contaminated soil - will excavate contaminated soil - spill contained dec already aware of spill"

All Materials:

Site ID:	117587
Operable Unit ID:	1056242
Operable Unit:	01
Material ID:	328206
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

130
North
1/4-1/2
0.493 mi.
2602 ft.

Relative:
Lower

Actual:
16 ft.

MOBIL S/S **NY LTANKS S102672574**
1935 LINDEN BLVD **NY Spills N/A**
BROOKLYN, NY

LTANKS:

Facility ID:	9010771
Site ID:	67469
Spill Number/Closed Date:	1991-01-08
Spill Date:	1991-01-08
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	1991-01-08
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1991-01-08
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-01-09
Spill Record Last Update:	2003-05-19
Spiller Name:	Not reported
Spiller Company:	ISLAND TRANSPORTATION
Spiller Address:	57-00 47TH STREET
Spiller County:	001
Spiller Contact:	Not reported

MOBIL S/S (Continued) **S102672574**

Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	64465
DEC Memo:	""
Remarks:	"ENGINE 257 RESPONDED,APPROX 100 GALLONS SPILLED,NYCFD ON SCENE, SPILL HAS BEEN CLEANED UP & NO OBVIOUS SIGN OF OIL GETTING INTO SEWER."

All Materials:

Site ID:	67469
Operable Unit ID:	947914
Operable Unit:	01
Material ID:	430889
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	100.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9105582
Site ID:	67470
Spill Number/Closed Date:	1991-08-22
Spill Date:	1991-08-22
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C3
Cleanup Ceased:	1991-08-22
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1991-08-22
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1991-09-17
Spill Record Last Update:	2003-05-19
Spiller Name:	Not reported
Spiller Company:	ISLAND TRANSPORT
Spiller Address:	Not reported
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	64465
DEC Memo:	""
Remarks:	"GAS CAME OUT OF STICK LINE AND SPILLED ON GROUND."

MOBIL S/S (Continued) **S102672574**

All Materials:

Site ID:	67470
Operable Unit ID:	956085
Operable Unit:	01
Material ID:	421370
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	9212401
Site ID:	67471
Spill Number/Closed Date:	1993-02-02
Spill Date:	1993-02-02
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	C4
Cleanup Ceased:	1993-02-02
SWIS:	2401
Investigator:	SIGONA
Referred To:	Not reported
Reported to Dept:	1993-02-02
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-02-03
Spill Record Last Update:	2003-05-19
Spiller Name:	Not reported
Spiller Company:	ISLAND TRANSPORTATION
Spiller Address:	Not reported
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	2
DER Facility ID:	64465
DEC Memo:	""
Remarks:	"DRIVER LEFT STICK LINE OPEN-GAS LEAKED TO PAVED AREA,DRIVER AND STATION MANAGER APPLIED SPEEDI-DRI WILL P/U AND DISPOSE"

All Materials:

Site ID:	67471
Operable Unit ID:	976900
Operable Unit:	01
Material ID:	554167
Material Code:	0009
Material Name:	gasoline

MOBIL S/S (Continued) **S102672574**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

SPILLS:

Facility ID:	9406497
Facility Type:	ER
Spill Number:	9406497
DER Facility ID:	64465
Site ID:	67472
DEC Region:	2
Spill Number/Closed Date:	Not reported
Spill Cause:	Unknown
Spill Class:	C3
SWIS:	2401
Spill Date:	1994-08-12
Investigator:	MJHAGGER
Referred To:	Not reported
Reported to Dept:	1994-08-12
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Responsible Party
Cleanup Ceased:	1994-08-12
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	4
Date Entered In Computer:	1994-10-20
Spill Record Last Update:	2016-04-04
Spiller Name:	MELISSA TACCHINO
Spiller Company:	EXXONMOBIL
Spiller Address:	1545 ROUTE 22 EAST
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Site remediation tracked under spill no. 94-06497. See also spill nos. 90-10771, 91-05582, and 92-12401. 4/16/2004: Site management transferred from Sigona to Rommel. (Rommel) 10/8/2004: Transferred from Rommel to Harrington (central office). (Rommel) 12/2/2004: SI work plan approved. (Harrington) 7/18/2005: Sent letter to Exxon Mobil approving SI report. Requested quarterly EFR events at MW-15, MW-18, and MW-19 until gw remedy is implemented. Also requested additional gw well east of MW-7 in order to further delineate upgradient edge of contaminant plume. (Harrington) 9/23/2005: Sent letter to Exxon Mobil approving supplemental SI work plan. (Harrington) 2/26/2006: Sent e-mail to Exxon Mobil approving the sensitive receptor survey report. (Harrington) 4/7/2006: Sent e-mail to Exxon Mobil approving both the supplemental SI report and the feasibility study work plan. (Harrington) 8/15/2006: Approved the in-situ remedial work plan. Plan calls for the pilot testing of chem-ox technology in the eastern portion of the site. (Harrington) 6/19/2007 - Haggerty - Management transferred from Dave Harrington to

MOBIL S/S (Continued) **S102672574**

Mike Haggerty 9/26/07 - Haggerty - approved moving back sampling one month this quarter. Station upgrade underway during the month of September would have prevented some wells from being sampled. Subsequent quarterly sampling will stay on previous schedule. 6/4/08 - Haggerty: sent approval of -Quarterly EFR events can be discontiued -MW's 12,14,16,17,20 can be removed from the sample network although they should be maintained as viable wells. I would like to continue sampling MW-7 as the sole upgradient well. 8/12/08 - Haggerty: reviewed QMR. Gave the following comments Kleinfelder states on the first page, A review of groundwater quality data indicates a generally decreasing trend in concentrations of both BTEX and MTBE in the MW's included in the sampling network with the exceptions of MW-5 and MW-18, which show fluctuating trends. I believe that MW-1, MW-4, and MW-19 concentrations fluctuate to an equal extent. MW-5 and MW-18 as well as MW-1, MW-4, and MW-19 are all located in the southeast portion of the site. Dating back to the mid-1980's, the south-southeast portion of the site has shown the greastest groundwater impact. Groundwater may be being feed by residual contaminated soil from the old 550gal tanks or a heavily contamination smear zone directly underneath the old 550's/current canopy. These fluctuations in groundwater concentrations lead me to believe this area will not naturally degrade in a reasonable time-frame. Up to this point, ExxonMobil has performed several remedial technologies to reduce contaminate concentrations. 11/20/08 - sent email to ExxonMobil requiring a Remedial Investigation Work Plan/ Feasibilty Study must be submitted within 60 days. Kleinfelder intended to propose MNA. PM stated that MNA will not be sufficient considering the amount of residual contamination. 2/11/09 - Haggerty: approved Remedial Investiation work plan April 2010 Approved RegenOx Pilot Study to address remaining groundwater contamination April 15, 2009. PM on-site May 13, 2009 while injection points were being installed (10 injection points). Feasibility report approved but additional injection of RegenOx is warranted to determine is this technology is viable. Mixed results encountered after the initial Pilot test. Additional injection took place in 2/10. PM reviewed 2nd injection report. Additional groundwater monitoring needed to evaluate effectiveness May 2010 Final determination of whether RegenOx is a viable remedial technology still pending. Addtional groundwater monitoring required August 2010 - Site Status Update/ Feasibility Report under review Oct.2010 - A work plan is due 11/13/10 (SD) January 2011 - site divested to BOLLA EM REALTY February 2011 - SI work plan under review March 2011 - Approved work plan to delineate soil contamination in the eastern portion of the site. RegenOx injections had no effect on dissolved conc June 2011 - reviewed soil investigation report. contamination confirmed to be limited to the saturated zone. Arcadis will evaluate of the feasibility of using the SVE/AS components remaining on-site to determine whether its stall vaible. Feasibility report will be included in the next SSUR Sept. 2011 - Arcadis intends to retrofit the existing SVE/AS infrastructure and install more AS wells in the southeast corner. RAP due in 45days November 2011 - received RAP/CAP for SVE/AS December 2011 - approved RAP/CAP with conditions. Bolla has CO for this site. Water table dropped ~1.5ft causing LNAPL to re-appear. New SPill called in until fingerprinting confirms age of product February 2012 - SSUR due this month. LPH fingerprinting will be included. April 2012 - SSUR and fingerprinting data was not sufficient proof that the product was from a new release. The water table dropped significantly and

MOBIL S/S (Continued) **S102672574**

residual LNAPL trapped within smear zone pore space was liberated June 2012 - SSUR under review. August - installation of new SVE/AS system underway December 2012 - CAP is under review. This is a Bolla site and already has a CO under the global order 1/7/13-spoke with Dave Tracy from Arcadis. he has revised the CAP per my comments and the CAP is with Bolla's attorney. I told him it would be best to have this approved by before I go out on medical leave May 2013 - Arcadis is currently renting a SVE trailer. Plans to improve the system underway October 2013 - trenching for the new SVE/AS system will begin 11/4/13. Additional system wells have already been installed June 2014 - Haggerty: Last update was incorrect. SVE/AS system installed but ConEd is dragging their feet to give the system the final approval to turn the system on. August 2014 - Haggerty: system operational. September 2014 - Haggerty: AS component of the system shutdown until it could be reprogramed. The system couldn't maintain the 0.5lbs/hr effluent limit with the full SVE/AS system operating. The system will be programmed to cycle through the AS wells rather than all operating at once at least until the influent concentration decreases significantly. January 2016 - Haggerty: approved temporary shutdown of system to monitor for rebound."

Remarks: "SPILL ON PAVEMENT & INTO STATION CATCH BASIN-CONTAINED IN CATCH BASIN-UNK CONTRACTOR ENROUTE-TYREE IS PRIMARY CONTACT"

All Materials:

Site ID:	67472
Operable Unit ID:	1003861
Operable Unit:	01
Material ID:	379535
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Facility ID:	1110065
Facility Type:	ER
Spill Number:	1110065
DER Facility ID:	64465
Site ID:	457865
DEC Region:	2
Spill Number/Closed Date:	2011-11-14
Spill Cause:	Equipment Failure
Spill Class:	D4
SWIS:	2401
Spill Date:	2011-11-10
Investigator:	RMPIPER
Referred To:	Not reported
Reported to Dept:	2011-11-10
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False

MOBIL S/S (Continued) **S102672574**

Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-11-10
Spill Record Last Update:	2011-11-14
Spiller Name:	Not reported
Spiller Company:	MOBIL STATION
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	RICHARD
DEC Memo:	"small spill to pavement. Closed."
Remarks:	"CALLER STATES THAT WHILE HIS WIFE WAS PUMPING GASOLINE AT A LOCAL GAS STATION THE NOZZLE LEAKED APPROX 3 CUPS OF FUEL TO THE GROUND AND ONTO HER CLOTHING. WHEN SHE TRIED TO ALERT THE ATTENDENT TO THIS PROBLEM, SHE WAS TOLD THAT IT WAS OPERATOR ERROR. REQUESTING CALL BACK."

All Materials:

Site ID:	457865
Operable Unit ID:	1207982
Operable Unit:	01
Material ID:	2205294
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.10
Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Facility ID:	1111212
Facility Type:	ER
Spill Number:	1111212
DER Facility ID:	64465
Site ID:	459092
DEC Region:	2
Spill Number/Closed Date:	2011-12-20
Spill Cause:	Other
Spill Class:	B3
SWIS:	2401
Spill Date:	2011-12-15
Investigator:	MJHAGGER
Referred To:	Not reported
Reported to Dept:	2011-12-16
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2011-12-16

MOBIL S/S (Continued) **S102672574**

Spill Record Last Update:	2011-12-20
Spiller Name:	Not reported
Spiller Company:	BULLA E.M. REALTY
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	DAVID TRACY
DEC Memo:	"12/16/11-Hiralkumar Patel. 3:24 PM:- spoke with David. he mentioned that old degraded waste oil found in two of the total 18 wells on site. these wells are installed as part of ongoing remediation (spill #: 9406497). product found in most downgradient wells along propert line and these wells are downgradient from the former waste oil UST at the site. David has left message for DEC Haggerty who is handling spill # 9406497. 3:34 PM:- left message for DEC Haggerty. 12/20/11-Hiralkumar Patel. 9:23 AM:- spoke with DEC Haggerty. he knows about the case. he will assign case to his name as part of on-going remediation. 9:32am: Haggerty: spoke with Dave Tracy from Arcadis, RP's consultant. Water table dropped 1+ feet across the site causing residual product in pore space to enter the well. Vac-events scheduled. SVE/AS RAP under review for historic Spill # 9406497. Spill consolidated/closes"
Remarks:	"Caller advised found a historic spill of used oil unknown amount in ground water. Clean up is pending."

All Materials:

Site ID:	459092
Operable Unit ID:	1209196
Operable Unit:	01
Material ID:	2206580
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Oxygenate:	Not reported

---

131 **350 DEWITT AVE** **NY SHWS U000406087**
NW **350 DEWITT AVENUE** **NY UST N/A**
1/2-1 **BROOKLYN, NY 11207**
0.512 mi.
2706 ft.

Relative:
Lower

Actual:
15 ft.

SHWS:

Program:	HW
Site Code:	484571
Classification:	N
Region:	2
Acres:	1.38
HW Code:	224179
Record Add:	07/16/2013
Record Upd:	02/14/2017
Updated By:	MJKOMORO
Site Description:	Location: The 50,000 square foot (1.38 acre) site is located at 350 DeWitt Avenue, Brooklyn, NY in an urban area. The site is bordered by DeWitt Avenue and single-family residential units to the north, by Hinsdale Street to the east, by a one story industrial/manufacturing

350 DEWITT AVE (Continued) **U000406087**

building to the south, and by Snediker Avenue and single- and multi-family residential units to the west. Site Features: The site is occupied by a 1 story manufacturing facility. There is asphalt-oaved parking along the east side of the site building. Current Zoning/Use(s): The site is zoned as M1-1, and is surrounded by industrial, commercial and residential uses. Historical Use(s): The Site is an industrial building that houses manufacturing of plumbing and lighting fixtures, bathroom accessories and hardware for commercial and residential markets. A former employee at Watermark reported that the company was illegally dumping industrial waste into the New York City sewer system. During the metal-plating process, waste water containing metals such as Copper, Zinc, Chromium, and Silver is generated. Proper disposal of the waste water requires a costly, multi-step process that ensures any solid toxic materials be removed by a regulated waste-hauler. Watermark instead disposed of the industrial waste water, which included the hazardous metals, through a hose inserted in a floor drain. NYCDEP obtained water samples from within the floor drain and the results showed high levels of metals including but not limited to Copper, Zinc, Chromium, and Silver. NYCDEP personnel noted that when they went to sample the floor drain, they encountered soil in the drain, suggesting that the drain is physically compromised and partially open to the underlying soil. Site Topography, Geology and Hydrogeology: Fill material is encounted to five feet bgs, underlain by layers of fine to medium silty sand and silt. Groundwater is encountered at about 10-12 feet bgs. In general, groundwwater flow direction is southerly of the site.
Not reported

Env Problem: Nature and Extent of Contamination: Information is based on the results of water samples collected by NYCDEP during the preliminary investigation of the site. TCLP lead was found at concentrations of up to 53.8 ppm and TCLP nickel was found at concentrations of up to 5.5 ppm. Analysis for total metals found cyanide at up to 107 ppm, lead at up to 500 ppm, chromium at up to 327 ppm, selenium at up to 372 ppm, nickel at up to 53.6 ppm, arsenic at up to 4.4 ppm, and barium at up to 124 ppm. The floor drain s discharge line was traced in July 2012 and found to enter the main house trap and discharges to the municipal sewer on the northern side of the site. In September 2013, a preliminary site characterization was completed in accordance with the NYSDEC required scope of work. Work was completed within the time frame specified in the scope of work. Seven borings were completed along the drain line, and soil and groundwater samples were collected to determine subsurface conditions in this portion of the site. All samples were analyzed for VOCs and metals (total and dissolved). In general, fill material was encounted to five feet bgs, underlain by layers of fine to medium silty sand and silt. Groundwater was encountered at 10-12 feet bgs. No VOCs were detected in the soil samples above the 6 NYCRR Part 375 industrial SCOs. Only TCE exceeded the groundwater standard at one location (9.8 ug/l). No metals were detected in the soil samples above the industrial SCOs. Total metals in groundwater were generally above the standards, but dissolved metals were well below the standards. The exception to the groundwater results was iron, manganese and sodium, where results for dissolved metals were above the groundwater standards. This is typical for groundwater in this area. Based on these data results, the site classification was changed from P to N . Significant Threat: Based on the data results discussed above, it was determined that no significant threat exsits at the site and no further action is

350 DEWITT AVE (Continued) **U000406087**

warranted at this time.
Health Problem: Not reported
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: On-Site Operator
Sub Type: 01
Owner Name: Jack Abel
Owner Company: Watermark Designs, Ltd.
Owner Address: 350 DeWitt Ave.
Owner Addr2: Not reported
Owner City,St,Zip: Brooklyn, NY 11207
Owner Country: United States of America
Own Op: Owner
Sub Type: 01
Owner Name: Jack Abel
Owner Company: Abel Realty Holding, LLC
Owner Address: 491 Wortman Ave.
Owner Addr2: Not reported
Owner City,St,Zip: Brooklyn, NY 11208
Owner Country: United States of America
Own Op: Owner
Sub Type: NNN
Owner Name: Jack Abel
Owner Company: Watermark Designs
Owner Address: 350 DeWitt Avenue
Owner Addr2: Not reported
Owner City,St,Zip: Brooklyn, NY 11207
Owner Country: United States of America
HW Code: Not reported
Waste Type: Not reported
Waste Quantity: Not reported
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

UST:
Id/Status: 2-310042 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 2
Expiration Date: N/A
UTM X: 593236.89514
UTM Y: 4501148.18240

350 DEWITT AVE (Continued) **U000406087**

Site Type: Manufacturing (Other than Chemical)/Processing

Affiliation Records:

Site Id: 14157
Affiliation Type: Mail Contact
Company Name: 350 DEWITT AVENUE REALTY
Contact Type: VP
Contact Name: JACK ABEL
Address1: 350 DEWITT AVENUE
Address2: Not reported
City: BROOKLYN
State: NY
Zip Code: 11207
Country Code: 001
Phone: (718) 649-1600
EMail: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 2009-08-10

Site Id: 14157
Affiliation Type: Facility Operator
Company Name: 350 DEWITT AVE
Contact Type: Not reported
Contact Name: JACK ABEL
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (718) 257-2800
EMail: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 2009-08-10

Site Id: 14157
Affiliation Type: Emergency Contact
Company Name: 350 DEWITT AVENUE REALTY
Contact Type: Not reported
Contact Name: JACK ABEL
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (646) 824-7418
EMail: Not reported
Fax Number: Not reported
Modified By: MSBAPTIS
Date Last Modified: 2009-08-10

Site Id: 14157
Affiliation Type: Facility Owner
Company Name: ABEL RREALTY HOLDING LLC
Contact Type: VP

350 DEWITT AVE (Continued) **U000406087**

Contact Name:	JACK ABEL
Address1:	350 DEWITT AVENUE
Address2:	Not reported
City:	BROOKLYN
State:	NY
Zip Code:	11207
Country Code:	001
Phone:	(718) 257-2800
EMail:	Not reported
Fax Number:	Not reported
Modified By:	MSBAPTIS
Date Last Modified:	2009-08-10

Tank Info:

Tank Number:	001
Tank ID:	24347
Tank Status:	Closed - In Place
Material Name:	Closed - In Place
Capacity Gallons:	5000
Install Date:	Not reported
Date Tank Closed:	04/12/2007
Registered:	True
Tank Location:	Underground
Tank Type:	Steel/carbon steel
Material Code:	0001
Common Name of Substance:	#2 Fuel Oil (On-Site Consumption)
Tightness Test Method:	21
Date Test:	08/10/2004
Next Test Date:	Not reported
Pipe Model:	Not reported
Modified By:	MSBAPTIS
Last Modified:	04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I04 - Overfill - Product Level Gauge (A/G)

---

132 **ELTON STREET GW** **NY SHWS S120706234**
NE **SE CORNER OF ELTON STREET AND WORTMAN AVENUE** **N/A**
1/2-1 **BROOKLYN, NY 11208**
0.735 mi.
3882 ft.

Relative:
Lower

Actual:
9 ft.

SHWS:

Program:	HW
Site Code:	537680
Classification:	P
Region:	2

ELTON STREET GW (Continued) **S120706234**

Acres: Not reported
HW Code: 224250
Record Add: 12/20/2016
Record Upd: 08/01/2017
Updated By: SXDEWES
Site Description: Location: The site is located on the southeast corner of Elton Street and Wortman Avenue, Brooklyn, NY 11208. The full extent of the site is unknown. Site Features: The full extent of the site has yet to be identified. Current Zoning and Land Use: The full extent of the site has yet to be identified. The surrounding properties are mixed commercial and industrial, as well as residential properties comprised of single and multi-family homes. Past Use of the Site: The full extent of the site has yet to be identified. The surrounding neighborhood has been developed since the 1900's and utilized for commercial, industrial and residential uses. Site Geology and Hydrogeology: The site is located over the Long Island aquifer system, which underlies all of Nassau, Suffolk, Kings(Brooklyn), and Queens Counties. The unconsolidated aquifer formations form a southward-dipping wedge that attains a maximum thickness in Kings County about 800 feet in the southeast area of Brooklyn. Overlying bedrock is the Lloyd, Magothy, Jameco, and Upper Glacial aquifer systems. The lithologic description of sediments from soil borings identifies the material as fill to approximately five feet below grade, underlain by layers of fine to medium silty sands and silt. Groundwater at the site is encountered at approximately 11 feet below grade. Groundwater beneath the property is class GA denoting potential use as potable water. The site lies within New York City, which utilizes reservoirs from upstate New York as sources of potable water.
Env Problem: Groundwater: Wells were installed in Fall of 2014 to assess the off site plume of Brownfield Cleanup program(BCP) site C224139, Former Watermark Design Facility (FWDF). During baseline sampling in November 2014, monitoring well MW-13S returned concentrations of Chlorinated Volatile Organic Compounds (CVOCs). Among the CVOCs returned within the analysis were dissolved phase Tetracholoethane, 1,1,1-trichloroethane, and 1,1-dichloroethane. Since the aforementioned CVOCs were not characteristic of FWDF and nature of the FWDF plume is sinking prior to MW-13s, this potential site was created. MW-13S was analyzed for CVOCs in April 2016 and October 2016 as well. Each sample collected showed increasing concentrations of Tetracholoethane, 1,1,1-trichloroethane, and 1,1-dichloroethane.
Health Problem: As information for this site becomes available, it will be reviewed by the NYSDOH to determine if site contamination presents public health exposure concerns.
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: Not reported

ELTON STREET GW (Continued) **S120706234**

Sub Type:	Not reported
Owner Name:	Not reported
Owner Company:	Not reported
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	Not reported
Owner Country:	Not reported
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

133
NE
1/2-1
0.810 mi.
4278 ft.

491 WORTMAN AVENUE
491 WORTMAN AVENUE
BROOKLYN, NY 11208

NY SHWS **S109374287**
NY BROWNFIELDS **N/A**
NY Spills

Relative:
Lower

Actual:
10 ft.

SHWS:

Program:	HW
Site Code:	424756
Classification:	N
Region:	2
Acres:	0.44
HW Code:	224139
Record Add:	02/09/2010
Record Upd:	01/11/2013
Updated By:	BXANDERS

Site Description: Location: The site is located at 491 Wortman Ave in the Spring Creek section of Brooklyn, a mixed industrial and manufacturing area. Site Features: The site is occupied by a one story commercial building that occupies the entire lot and is comprised of three warehouse sections referred to as Building 1, Building 2 and Building 3. The building is approximately 19,000 square feet and the site is 0.44 acres in size. Current Zoning: Manufacturing and industrial buildings surround the site to the north, south, east and west. The closest residential units are 0.08 miles to the west-southwest. Historical Uses: The site was formerly utilized as a metal etching company, a steel tube manufacturing company, and a plumbing faucet/fixture company. Since approximately 1985, the site has been owned and operated by Watermark Designs Ltd. to manufacture, store, package, and ship decorative fixtures, bathroom accessories, and hardware. Manufacturing processes on the property included cleaning, painting, plating, etching, polishing, and specific machining of metals and metal products. Cleaning agents such as TCE and PCE were "routinely used" by Watermark Designs to fine clean and polish metals and metal products. The site is currently leased to a religious group that gathers at the site several times per week. Watermark Designs Ltd. relocated to a new location, 350 Dewitt Avenue, Brooklyn in or around 2007. In 2008, the site was put on the "open market" for sale. Site Geology and Hydrogeology: Subsurface geology is comprised of historic fill materials overlying

491 WORTMAN AVENUE (Continued) **S109374287**

native sands. Groundwater is approximately 15 ft below ground surface. The direction of groundwater flow can not be determined after one round of groundwater measurements. Other: One TCE degreasing tank was removed from the site however details including the tank size and dates of removal have not been determined. There are no PBS or CBS registrations for the site. One fuel oil AST of unknown size encased in concrete blocks is also located in the basement of the site. Also, floor drains were observed in the building. The following reports have been submitted to date: Supplemental Subsurface Investigation Report dated December 2008; Limited Subsurface Investigation Report dated February 2009; a Phase II Environmental Site Assessment dated January 2009 and a Environmental Services Report Proposed Corrective Action and Remedial Investigation Work Plan dated July 2009. A final Site Characterization work plan was approved in February of 2011. Draft Site characterization reports have been reviewed. The Department and site owner executed a "P site" investigation Order on Consent and Adminstrative Settlement. For more information, see Site # C2-24-139

Env Problem: A site characterization (SC) was performed in 2011. Results detailed in the draft SC Report indicate soil, groundwater and soil vapor are impacted by chlorinated volatile organic compounds (CVOCs) and, to a much lesser extent, petroleum-related compounds. Concentrations of CVOCs in soil samples collected in 2011 are below commercial soil cleanup objectives (SCOs) but exceed the protection of groundwater SCOs. Concentrations of CVOCs in groundwater samples collected in 2011 significantly exceed groundwater standards with magnitudes greater than 1 ppm in half of the monitoring locations and a maximum concentration of 3.5 ppm for PCE and 2.3 ppm for TCE. Based on concentrations of CVOCs at the site boundaries, contamination likely is migrating off-site. Concentrations of CVOCs (primarily TCE) in multiple subslab soil vapor samples exceed 100,000 ug/m^3. TCE appears to be migrating into the on-site building as results from indoor air samples show detections between 140 and 250 ug/m^3. The magnitude of CVOC concentrations in the groundwater indicate the potential for DNAPL at the site. Previous phase II investigations indicated magnitudes of contamination in soil and groundwater to be an order of magnitude or two higher.
Health Problem: Not reported
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: Owner
Sub Type: 01
Owner Name: Not reported
Owner Company: Watermark Designs Ltd.
Owner Address: 350 Dewitt Avenue
Owner Addr2: Not reported

491 WORTMAN AVENUE (Continued) **S109374287**

Owner City,St,Zip:	Brooklyn, NY 11207
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	01
Owner Name:	Not reported
Owner Company:	Watermark Designs Ltd.
Owner Address:	350 Dewitt Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11207
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

BROWNFIELDS:

Program:	BCP
Site Code:	464693
Acres:	0.44
HW Code:	C224139
SWIS:	2401
Town:	New York City
Record Added Date:	05/29/2012
Record Updated Date:	06/02/2017
Update By:	MJKOMORO
Site Description:	Site Location: The Former Watermark Designs Facility (site) is located at 491 Wortman Avenue in Brooklyn, NY, Kings County. It is identified as block 4384, lots 31 and 36 on the Kings County Tax Maps and is approximately 0.44 acres in size. It is bounded by a one-story building to the north, Wortman Avenue to the south, Essex Street to the east, and Linwood Street to the west. The nearest body of water is Hendrix Creek, which is about 0.5 miles southwest of the site. Site Features: The site consists of a one story brick and steel building, with a partial basement, that occupies the entire area of the property. The majority of the building, except for the partial basement, rests on concrete slab. The interior of the building is divided by a wall into east and west areas. No exposed soil or vegetation is present on the subject property. Current Zoning and Land Use: The vacant site is located in an urban setting characterized by industrial buildings to the north, east, and south and residential buildings to the west. Land use within a half mile of the site is primarily industrial and residential, but also includes public parks, public institutions, day care centers, and school facilities. The site is zoned for industrial/manufacturing uses. There is no current plan for redevelopment of the site. Past Use of the Site: US Tube and Foundry Company, Inc. operated at the site between 1945 and 1973. The National Hanger Company, Inc. operated at the site in 1976. J and H Holding Company, LLC has owned the property since 1983 and manufacturing activities continued until 2007. The site previously manufactured, stored, packaged, and shipped decorative fixtures and hardware for bathrooms and kitchens.

491 WORTMAN AVENUE (Continued) **S109374287**

Processes involved cleaning, painting, plating, etching, polishing, and specific machining of metals and metal products. A cleaning and degreasing area was located along the west side of the building. Chlorinated solvents, specifically trichloroethylene (TCE) and tetrachloroethylene (PCE) were used in the manufacturing process to clean various products. Currently, the western portion of the site building is used as a warehouse to store sound equipment, and the eastern portion is unoccupied. Site Geology and Hydrogeology: The soil profile at the site generally consists of 2 to 5 feet of miscellaneous uncontrolled fill underlain by medium to fine sand with some gravel. The estimated depth to groundwater is about 10 feet below grade surface (bgs). Based on local topography, groundwater is expected to flow to the southwest towards Hendrix Creek.

Env Problem:

For OU1: On-Site Areas Nature and Extent of Contamination: Soil and groundwater were analyzed for volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), metals, polychlorinated biphenyls (PCBs), and pesticides. Based upon investigations and an interim remedial measure (IRM) conducted to date, the primary contaminants of concern include trichloroethene (TCE) and tetrachloroethene (PCE) in groundwater, sub-surface soil and soil vapor at the site and at some near-field off-site locations. An off-site investigation conducted further downgradient of the site determined that VOC contamination in groundwater and soil vapor in the far-field locations is not related to the site. (A characterization of the far-field contamination is currently being conducted by the Department as part of a separate remedial program.) Soil: In 2013, site-wide soil sampling was completed. The maximum concentration of TCE was detected at 12,000 parts per million (ppm) at one location from within the truck scale pit area, at a depth of 0 to 2.5 feet. This exceeded the TCE commercial use soil cleanup objective (SCO) of 200 ppm. Arsenic, lead and mercury also exceeded the commercial use SCOs in samples collected from the pit area samples at 0 to 2 feet deep. All other contaminants were below the commercial use SCOs. No impacts to off-site soils were detected. Groundwater: In 2015, the highest concentrations of TCE (1,800 ppb) and PCE (750 ppb) were detected at two shallow wells near the truck scale pit area. At the near-field off-site wells, which are both shallow wells, the maximum concentration of TCE was 780 ppb and PCE was 710 ppb. Concentrations of PCE and TCE have decreased at all other on-site and near-field monitoring wells since implementation of the AS/SVE system. Adjustments were made to the AS/SVE system to address these concentrations of TCE and PCE at the near-field off-site wells. Soil Vapor, Sub-Slab Vapor and Indoor Air: In 2013, indoor air in the area of the truck scale pit was 2 g/m3 for TCE and 13 g/m3 for PCE. Sub-slab concentrations is this same area were 26,500 g/m3 for TCE and 568 g/m3 for PCE. Indoor air samples were also collected from the east side of the site building (former office and congregation areas). In the congregation areas, TCE in indoor air ranged from 64.5 g/m3 to 214 g/m3 and PCE ranged from 3.8 g/m3 to 8.88 g/m3. In the office area, TCE in indoor air ranged from 83 g/m3 to 138 g/m3 and PCE ranged from 6.98 g/m3 to 10.3 g/m3. In 2014, off-site soil vapor sampling was completed in conjunction with off-site groundwater sampling (access was not granted to any off-site buildings). TCE in soil vapor ranged from 12 to 2900 g/m3 and PCE ranged from 110 to 500 g/m3. The highest concentrations were seen at the same locations where TCE and PCE concentrations were highest in shallow groundwater. In 2015, an IRM was implemented to address soil,

491 WORTMAN AVENUE (Continued) **S109374287**

	groundwater and soil vapor contamination from chlorinated VOCs. The IRM included installation and operation of an air sparge and soil vapor extraction system. To date, the system has effectively decreased concentrations of chlorinated VOCs in groundwater and soil vapor and continues to operate. As of January 2017, the maximum PCE and TCE concentrations in groundwater at the site were 19 ppb and 10 ppb, respectively. Based on initial investigations and data, NYSDEC and NYSDOH determined that the site presented a significant threat to public health and the environment.
Health Problem:	People may contact contaminants in the soil if they dig below the buildings. People are not drinking contaminated groundwater because the area is served by a public water supply that is not affected by this contamination. Volatile organic compounds in the groundwater may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. Actions have been recommended to address soil vapor intrusion in the on-site structure in the event that the building is routinely occupied. Soil vapor intrusion is a concern for off-site structures; however, access to investigate has been denied at off-site structures.
Dump:	False
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	5/29/2012 10:49:00 AM
Record Upd:	3/27/2017 11:28:00 AM
Updated By:	AABARRAZ
Own Op:	Applicant/Requestor
Sub Type:	P02
Owner Name:	Jack Abel
Owner Company:	J&H Holding Company, LLC
Owner Address:	350 Dewitt Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11207
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Brooklyn Public Library-New Lots Branch
Owner Address:	665 New Lots Ave. at Barbey St.
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11207
Owner Country:	United States of America
Own Op:	Owner
Sub Type:	NNN
Owner Name:	Jack Abel
Owner Company:	J&H Holding Company, LLC
Owner Address:	350 Dewitt Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11207

491 WORTMAN AVENUE (Continued) **S109374287**

Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	C01
Owner Name:	AT Mitchell, Chair
Owner Company:	Brooklyn Community Board 5
Owner Address:	404 Pine Street, 3rd Floor
Owner Addr2:	Not reported
Owner City,St,Zip:	Brooklyn, NY 11208
Owner Country:	United States of America
HW Code:	C224139
Waste Type:	TETRACHLOROETHYLENE (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	TRICHLOROETHENE (TCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	MERCURY
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	CHROMIUM
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	LEAD
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	arsenic
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C224139
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C224139
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	4/4/2017 10:57:00 AM
Record Updated:	4/4/2017 10:57:00 AM
Updated By:	AABARRAZ
Crossref ID:	C224139-08-12
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	4/4/2017 10:56:00 AM
Record Updated:	4/4/2017 10:56:00 AM
Updated By:	AABARRAZ

491 WORTMAN AVENUE (Continued) **S109374287**

Crossref ID:	2017000093616
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	3/21/2017 2:07:00 PM
Record Updated:	3/21/2017 2:07:00 PM
Updated By:	MJKOMORO
Crossref ID:	01-11-2013
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	4/4/2017 10:55:00 AM
Record Updated:	4/4/2017 10:55:00 AM
Updated By:	AABARRAZ
Crossref ID:	0809879
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	5/31/2012 1:36:00 PM
Record Updated:	5/31/2012 1:36:00 PM
Updated By:	BRWOLOSE
Crossref ID:	NYD084086537
Cross Ref Type Code:	06
Cross Ref Type:	RCRA EPA ID No.
Record Added Date:	4/11/2016 11:59:00 AM
Record Updated:	4/11/2016 11:59:00 AM
Updated By:	SMWITHER

SPILLS:

Facility ID:	0809879
Facility Type:	ER
Spill Number:	0809879
DER Facility ID:	356620
Site ID:	407376
DEC Region:	2
Spill Number/Closed Date:	Not reported
Spill Cause:	Unknown
Spill Class:	Not reported
SWIS:	2401
Spill Date:	2008-12-03
Investigator:	JHOCONNE
Referred To:	Not reported
Reported to Dept:	2008-12-03
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	1
Date Entered In Computer:	2008-12-03
Spill Record Last Update:	2010-03-17
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller Company:	999
Contact Name:	JOHN EICHLER

491 WORTMAN AVENUE (Continued) **S109374287**

DEC Memo: "08/15/09-HRAHMED- As per PropertyShark records: Street address: 491 Wortman Ave Primary address: 1009 Linwood St Zip 11208 Borough Brooklyn Block & lot 04384-0036 First 3 alt addresses 481-491 Wortman Ave, 1009-1019 Linwood St 1/26/10-Vought-File review by Vought: Supplemental Subsurface Investigation Report (PW Grosser-John Eichler-Ph;631-589-6353)-12/9/08. Sent to: Mr. Jack Abel Watermark Designs 350 Dewitt Avenue Brooklyn, NY 11207 Site has one commercial building that covers entire area of property. Site formerly used as a metal etching company, steel tube manufacturing company and a plumbing faucet/fixture company. Possible plating pit in northwest corner of building. Phase II shows elevated TCE in soil collected from northwest portion of building . Attempts made to dye flush test floor drain in bathroom but drain was blocked but drain appeared to lead to a sewer connection pit which discharges to the municipal sewer . Fuel oil AST encased in concrete block in the basement and soil samples below AST shows that soils were not impacted . Plating pit later discovered to be a loading/bay truck scale. Based on conversations with the current owner of the property, the sources of TCE appears to have been a TCE degreasing tank with was formerly located directly to the south of the former loading bay/truck scale. Report recommends additional soil and groundwater investigation via soil borings. Proposal of soil boring investigation to delineate contamination via Geoprobe collection of soil and groundwater samples. Delineation will also include vertical profile of groundwater contamination to a depth of 50'bg (i.e collection of vertical groundwater samples at 10 foot intervals from 10-50'bg to study DNAPL). Cost estimate included in proposal. EnviroTrac Limited Subsurface Investigation Report (EnviroTrac-David Lorthior-631-924-3001)-2/1/09. Seven soil boring and one well were installed including collection of five groundwater samples. Borings installed via Geoprobe. Fill from 6-8'bg and sand below. Soil analyticals show: 2400ppb TCE (B2 8-10'bg), 20000ppb TCE (B3(0-5'bg), 8800ppb TCE(B4 6'bg), 140000ppb TCE(B7 2-5'bg), 5000ppb PCE(B7 2-5'bg), 4400ppb TCE(B8 3-5'bg), 3300ppb TCE(B8 7-7.5'bg). PCE not used at site and suggests that a possible source associated with the prior usage of he building could be repsonsible for the impacted soil in this area. Depth to groundwater is 12'bg. Groundwater analyticals show:54ppb TCE(B2 15'bg), 91ppb PCE(B2 15'bg), 5700ppb TCE(B5 15'bg), 510ppb PCE(B5 15'bg), 36ppb TCE(B5 25'bg), 97ppb PCE(B5 25'bg), 14ppb TCE(B5 35'bg), 26ppb PCE(B5 35'bg), 18ppb TCE(B5 45'bg), 38ppb PCE(B5 45'bg). Report recommends submission of a Remedial Investigation Work Plan. No petroleum contamination found at site. Phase II Environmental Site Assessment (PW Grosser John Eichler Ph:631-589-6353)-1/13/09. Seven soil borings were installed at site in Nov 2008 via Geoprobe. Groundwater at 10'bg and two samples collected for analysis. Groundwater flow estimated to south. Fuel and vent noted leading to AST in basement. One boring installed adjacent to UST with no petroleum staining observed. Floor drain dye test resulted in determination drain was clogged. Boring B-02 was located in the reported vicinity of a former TCE degreasing tank. Based on this, the degreasing tank appears to be the source of TCE in the soil . Soil analyticals show: 201ppb MTBE (GP2 8-10'bg), 18900ppb TCE(GP-02 0-2'bg), 63100ppb TCE(GP-02 8-10'bg). Groundwater analyticals show: 24000ppb TCE(GP1), 544ppb PCE(GP1) 7ppb DCE(GP1), 78ppb PCE(GP4), 24ppb TCE(GP4). Report recommends further investigation to delineate contaminaton and that indoor air quality be evaluated and that AST be properly closed. Environmental Services

491 WORTMAN AVENUE (Continued) **S109374287**

Report Proposed Corrective Action and Remedial Investigation Work Plan(Impact Environmental-Tony Kloss-Ph:908-534-8820)-7/10/09. Prepared for Watermark Designs. Onsite building has three sections and properly is currently vacant and unoccupied. Building owned by Watermark Designs for past 25 years to manufacture, store, package and ship hardware, bathroom fixtures. Onsite processes included painting, plating, etching, polishing, and machining. Cleaning agents, such as trichloroethylene(TCE) and tetrachlorethylene(PCE) were routinely used by Watermark Designs, Ltd. at the subject property to fine clean and polish metals and metal products. Watermark purchased new property at 350 Dewitt Avenue and moved and looking to sell this site. Proposal to isolate each building section and excavated contaminated soil. It is estimated that a total of approximately 400 tons of chlorinated VOC contaminated soil will be excavated from two designated work areas in Building 1... . Work activities will include the evacuation of as much chlorinated VOC contaminated groundwater as is safe and practical with estimates of removal of 18,000 gallons of contaminated groundwater. Proposal to collect endpoint soil and bottom groundwater samples and submit results report. Email from Abel to DEC Ahmed-12/3/09. I'm following-up on our most recent conversation about the NYSDEC Spill Case No. 0809879 assigned to 491 Wortman Avenue, Brooklyn, NY. Were you able to identify and/or obtain a copy of the NYSDEC correspondence issued to Mr. Jack Abel from Watermark Designs Ltd. for the subject property? Watermark Designs Ltd. received some type of NYSDEC correspondence about the subject property but misplaced the letter. The NYSDEC correspondence would have been dated late October 2009 or early November 2009. Our firm advised Watermark Designs Ltd. that the subject property is the first site assigned to a new program within the NYSDEC system for hazardous TCE and DNAPL type contaminant investigation and corrective action. As a responsible party and environmental steward, Watermark Designs Ltd. is prepared to move forward with the scope of work presented in the Proposed Corrective Action and Remedial Investigation Work Plan prepared by our firm and dated 10 July 2009. Watermark Designs Ltd. would like to start the project as soon as possible. Please provide our firm and/or Mr. Jack Abel at Watermark Designs Ltd. withan update concerning the project at your earliest convenience. I included Jack Abel's contact information below. Thank you for your time and attention to the matter. Mr. Jack Abel Watermark Designs Ltd. (p) 718.257.2800, Ext. 20 (f) 718.257.2144 (e) jabel@watermark-designs.com Email from Impact (Kloss) to DEC Ahmed-1/5/10. We spoke approximately four (4) weeks ago concerning thecorrective action project for Watermark Designs Ltd. at 491 Wortman Avenue, Brooklyn, NY. Did you have an opportunity to issue an update letter or e-mail to Mr. Jack Abel from Watermark Designs Ltd concerning the project? Also, what is the status of the consent order for the project? When last we spoke in early December 2009, you indicated that the consent order would be issued to Mr. Jack Abel within three (3) to four (4) weeks. DEC possibly requires: 1)P-Site letter 2)Check PBS for AST registration 3)delineation of chlorinated solvent soil and groundwater contamination 4)possible approval of proposal to evaluate indoor air (property vacant as per 7/09 report). 1/26/10-Vought-Meeting with DEC Krimgold and Austin. Spill reassigned from Ahmed to Vought. 1/28/10-Vought-Received email from Abel that Good morning. I'm following up on our conversation yesterday morning and the internal NYSDEC meeting you had for the contaminated soil and groundeater project at 491 Wortman Avenue,

491 WORTMAN AVENUE (Continued) **S109374287**

Brooklyn, NY. When you have a moment today (Thursday, 28 January 2010), please provide a brief update for the proposed project at the subject property. The update can be forwarded to me and/or Mr. Jack Abel of Watermark Designs Ltd. Contact information for Mr. Jack Abel is below. 02/2/10-Vought-Received message from Kloss (908-534-8820) and returned call and left message. 02/5/10-Vought-Received message from Impact (Kloss) and returned call and left message to return call. 02/10/10-Vought-DEC O'Connnell preparing Class II package. Site code received from DEC Spath as: Site Remediation Code:224139 T&A Code:65335 2/11/10-Vought-Received message from Impact (Kloss cell:908-623-0310) and returned call and spoke to Kloss and informed him of reclassification of site as Class II site. Vought also provided him contact info for DEC Oliva for further information regarding Class II CO and possibly beginning of soil excavation. Kloss noted that he had suspected the site would be listed as Class II and has already prepared Watermark Designs for such possibilities. Vought to complete Remediation Database so that DEC O'Connell can designate new Section A project manager. Received email from Impact (Kloss) that again, thank you for the phone call concerning the latest administrative information for 491 Wortman Avenue, Brooklyn, NY. The initial information is very much appreciated and will be a great help to our client (Watermark Designs Ltd.). Our firm will be reviewing the information with the client tomorrow morning. 2/12/09-Vought-Obtained Lat and Long from Google Earth as:40deg39min40secN and 73deg52min32sec W. Note Google earth based on same datum as DEC GIS system used by DEC 0'Connell. Area of lot is .44 acres as per Report and .218 acres when using dimensions from 491 Wortman deed only. Vought to use acreage as per Report as site may encompass other addresses in addition to 491 Wortman. Vought spoke to DEC Barrie and provided acreage of .44 acres and she also will transfer E-docs into UIS database. 02/15/10-Vought-Recevied email from Kloss to DEC Oliva that Late last week I spoke with Mr. Jeffery Vought (NYSDEC Liaison at this point) concerning the NYSDEC Remediation Case Site Code 224139 assigned to the hazardous waste site project at 491 Wortman Avenue, Brooklyn, NY. Mr. Vought provided a much anticipated update and NYSDEC agency contact information. During the conversation Mr. Vought requested that the owner/operator of the subject property (Mr. Jack Abel - Watermark Designs Ltd.) contact you to discuss a Stipulation Agreement/Consent Order for the project. I was informed that Mr. Abel is out of his office this week and will return on Monday, 22 February 2010. I'm certain Mr. Abel will contact you shortly after his return to the office. 3/11/10-Vought-DEC Oliva sent draft CO to Kloss and Abel. 3/15/10-Vought-Meeting with DEC O'Connell and DEC Austin and spill manager transferred to DEC O'Connell for further action. "

Remarks: "CALLER STATES THAT THEY RECIEVED SOIL BORING SAMPLES BACK TODAY INDICATING CONTAMINATED SOIL AND GROUND WATER. CLEAN UP IS PENDING."

All Materials:

Site ID:	407376
Operable Unit ID:	1163929
Operable Unit:	01
Material ID:	2155273
Material Code:	2633A
Material Name:	trichloroethene (TCE)
Case No.:	00079016
Material FA:	Hazardous Material
Quantity:	Not reported

491 WORTMAN AVENUE (Continued) **S109374287**

Units:	G
Recovered:	Not reported
Oxygenate:	Not reported

Count: 4 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BROOKLYN	S113922098	BELMONT STATION	BELMONT, WILLIAMS, ALABAMA & S	11207	NY VCP
BROOKLYN	S103573626	NYCDOS SPRING CREEK COMPOST FACILI	FLATLANDS AVENUE	11208	NY SWF/LF, NY Spills
BROOKLYN	S109064325	GULF STATION	2992 LINDEN BLVD		NY LTANKS
BROOKLYN	1015735576	PENNSYLAVANIA AVE MUNICIPAL LANDFI	PENNSYLVANIA AVE - SHORE PKWY	11207	SEMS-ARCHIVE, RCRA NonGen / NL

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 05/30/2017
Date Data Arrived at EDR: 06/08/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 99

Source: EPA
Telephone: N/A
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 05/30/2017
Date Data Arrived at EDR: 06/09/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 98

Source: EPA
Telephone: N/A
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 05/30/2017
Date Data Arrived at EDR: 06/09/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 98

Source: EPA
Telephone: N/A
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/07/2016
Date Data Arrived at EDR: 01/05/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 92

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 10/06/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 07/11/2017
Date Data Arrived at EDR: 07/21/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 77

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/29/2018
Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 07/11/2017
Date Data Arrived at EDR: 07/28/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 70

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/29/2018
Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 05/22/2017
Date Data Arrived at EDR: 06/13/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 94

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 11/08/2017
Next Scheduled EDR Contact: 02/26/2018
Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 08/10/2017
Date Data Arrived at EDR: 08/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 44

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/30/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 08/10/2017
Date Data Arrived at EDR: 08/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 44

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/30/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 09/18/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 22

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Annually

VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 05/01/2017
Date Data Arrived at EDR: 05/18/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 127

Source: Department of Environmenal Conservation
Telephone: 518-402-9814
Last EDR Contact: 11/17/2017
Next Scheduled EDR Contact: 02/26/2018
Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 09/25/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-457-2051
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

State and tribal leaking storage tank lists

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 04/26/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78

Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/07/2016
Date Data Arrived at EDR: 01/26/2017
Date Made Active in Reports: 05/05/2017
Number of Days to Update: 99
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 11/07/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 04/13/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78
Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 05/01/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78
Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 04/14/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 04/24/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71
Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 10/14/2016
Date Data Arrived at EDR: 01/27/2017
Date Made Active in Reports: 05/05/2017
Number of Days to Update: 98
Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Semi-Annually

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/14/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71
Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 10/31/2017
Date Data Arrived at EDR: 10/31/2017
Date Made Active in Reports: 11/02/2017
Number of Days to Update: 2

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/31/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

State and tribal registered storage tank lists

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 05/15/2017
Date Data Arrived at EDR: 05/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 136

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 10/13/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Varies

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 10/24/2005
Next Scheduled EDR Contact: 01/23/2006
Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 04/25/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 05/02/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 10/01/2016
Date Data Arrived at EDR: 01/26/2017
Date Made Active in Reports: 05/05/2017
Number of Days to Update: 99

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Semi-Annually

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 05/01/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 04/13/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 78

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 04/26/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 10/14/2016
Date Data Arrived at EDR: 01/27/2017
Date Made Active in Reports: 05/05/2017
Number of Days to Update: 98

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Semi-Annually

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 04/14/2017
Date Data Arrived at EDR: 07/27/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 71

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: Department of Environmental Conservation
Telephone: 518-402-9543
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

State and tribal institutional control / engineering control registries

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 11/18/2010
Date Data Arrived at EDR: 06/30/2014
Date Made Active in Reports: 07/21/2014
Number of Days to Update: 21

Source: NYC Department of City Planning
Telephone: 212-720-3401
Last EDR Contact: 09/22/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Varies

ENV RES DECL: Environmental Restrictive Declarations

The Environmental Restrictive Declarations (ERD) listed were recorded in connection with a zoning action against the noted Tax Blocks and Tax Lots, or portion thereof, and are available in the property records on file at the Office of the City Register for Bronx, Kings, New York and Queens counties or at the Richmond County Clerk's office. They contain environmental requirements with respect to hazardous materials, air quality and/or noise in accordance with Section 11-15 of this Resolution.

Date of Government Version: 06/27/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: New York City Department of City Planning
Telephone: 212-720-3300
Last EDR Contact: 09/19/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Varies

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9553
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Quarterly

State and tribal voluntary cleanup sites

VCP NYC: Voluntary Cleanup Program Listing NYC
New York City voluntary cleanup program sites.

Date of Government Version: 10/04/2017
Date Data Arrived at EDR: 10/06/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 38

Source: New York City Office of Environmental Protection
Telephone: 212-788-8841
Last EDR Contact: 09/18/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Varies

VCP: Voluntary Cleanup Agreements
New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Semi-Annually

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 09/25/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Varies

State and tribal Brownfields sites

BROWNFIELDS: Brownfields Site List
A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Semi-Annually

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a $200 million Environmental Restoration or Brownfields Fund as part of the $1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 10/24/2017
Number of Days to Update: 68

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Quarterly

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 06/19/2017
Date Data Arrived at EDR: 06/20/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 09/20/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 09/25/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-8705
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 06/14/2017
Date Data Arrived at EDR: 06/16/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 98

Source: Department of Environmental Conservation
Telephone: 518-402-8694
Last EDR Contact: 09/15/2017
Next Scheduled EDR Contact: 12/25/2017
Data Release Frequency: Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 10/30/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations
A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137
Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 10/20/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: No Update Planned

ODI: Open Dump Inventory
An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39
Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land
A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176
Source: Department of Health & Human Serivces, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register
A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 07/13/2017
Date Data Arrived at EDR: 09/06/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 30
Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/30/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: No Update Planned

DEL SHWS: Delisted Registry Sites
A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 08/15/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 36
Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Annually

US CDL: Clandestine Drug Labs
A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 07/13/2017
Date Data Arrived at EDR: 09/06/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 30
Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/30/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database
These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database
These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48
Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS: Spill Liens Information
Lien information from the Oil Spill Fund.

Date of Government Version: 11/06/2017
Date Data Arrived at EDR: 11/07/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 6
Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 11/06/2017
Next Scheduled EDR Contact: 02/19/2018
Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information
A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 07/11/2017
Date Data Arrived at EDR: 07/26/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 79
Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System
Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 09/21/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 22
Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

SPILLS: Spills Information Database
Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 10/31/2017
Date Data Arrived at EDR: 10/31/2017
Date Made Active in Reports: 11/02/2017
Number of Days to Update: 2

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/31/2017
Next Scheduled EDR Contact: 11/27/2017
Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 07/08/2005
Date Made Active in Reports: 07/14/2005
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 07/07/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/12/2013
Number of Days to Update: 40

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 03/07/2013
Number of Days to Update: 63

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 09/13/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/06/2017
Number of Days to Update: 10

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/31/2015
Date Data Arrived at EDR: 07/08/2015
Date Made Active in Reports: 10/13/2015
Number of Days to Update: 97

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 08/25/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 10/13/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 10/11/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017
Date Data Arrived at EDR: 02/03/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 11/17/2017
Next Scheduled EDR Contact: 02/26/2018
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 05/10/2017
Date Data Arrived at EDR: 05/17/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 121

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 11/01/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 11/06/2017
Next Scheduled EDR Contact: 02/19/2018
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 04/22/2013
Date Data Arrived at EDR: 03/03/2015
Date Made Active in Reports: 03/09/2015
Number of Days to Update: 6

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 11/09/2017
Next Scheduled EDR Contact: 02/19/2018
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2012
Date Data Arrived at EDR: 01/15/2015
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 14

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 09/22/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 11/24/2015
Date Made Active in Reports: 04/05/2016
Number of Days to Update: 133

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 08/23/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 10/27/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 09/27/2017
Date Data Arrived at EDR: 10/12/2017
Date Made Active in Reports: 10/20/2017
Number of Days to Update: 8

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 02/01/2017
Date Data Arrived at EDR: 02/09/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 57

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 10/23/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 10/25/2013
Date Data Arrived at EDR: 10/17/2014
Date Made Active in Reports: 10/20/2014
Number of Days to Update: 3

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 02/19/2018
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 06/01/2017
Date Data Arrived at EDR: 06/09/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 126

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 10/13/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016
Date Data Arrived at EDR: 11/23/2016
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 79

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 10/11/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25
Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Quarterly

MLTS: Material Licensing Tracking System
MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 08/30/2016
Date Data Arrived at EDR: 09/08/2016
Date Made Active in Reports: 10/21/2016
Number of Days to Update: 43
Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 10/16/2017
Next Scheduled EDR Contact: 11/20/2017
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data
A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 08/07/2009
Date Made Active in Reports: 10/22/2009
Number of Days to Update: 76
Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 10/03/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 07/01/2014
Date Data Arrived at EDR: 09/10/2014
Date Made Active in Reports: 10/20/2014
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 09/08/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 02/01/2011
Date Data Arrived at EDR: 10/19/2011
Date Made Active in Reports: 01/10/2012
Number of Days to Update: 83
Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 10/26/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Varies

RADINFO: Radiation Information Database
The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 10/02/2017
Date Data Arrived at EDR: 10/05/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 10/05/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 07/31/2012
Date Data Arrived at EDR: 08/07/2012
Date Made Active in Reports: 09/18/2012
Number of Days to Update: 42

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 10/31/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 06/30/2017
Date Data Arrived at EDR: 08/03/2017
Date Made Active in Reports: 10/20/2017
Number of Days to Update: 78

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 09/25/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2015
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 09/28/2017
Number of Days to Update: 218

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 10/11/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 12/23/2016
Date Data Arrived at EDR: 12/27/2016
Date Made Active in Reports: 02/17/2017
Number of Days to Update: 52

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 11/02/2017
Next Scheduled EDR Contact: 02/19/2018
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 06/23/2017
Date Data Arrived at EDR: 10/11/2017
Date Made Active in Reports: 11/03/2017
Number of Days to Update: 23

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 10/10/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 05/30/2017
Date Data Arrived at EDR: 06/09/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 98

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 11/03/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 07/31/2017
Date Data Arrived at EDR: 08/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 44

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 08/30/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 12/05/2005
Date Data Arrived at EDR: 02/29/2008
Date Made Active in Reports: 04/18/2008
Number of Days to Update: 49

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 09/01/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 09/01/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 09/25/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/20/2017
Number of Days to Update: 24

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 09/25/2017
Next Scheduled EDR Contact: 12/25/2017
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/23/2017
Date Data Arrived at EDR: 09/06/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 9

Source: EPA
Telephone: (212) 637-3000
Last EDR Contact: 09/06/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 10/25/2016
Date Data Arrived at EDR: 06/02/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 133

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 10/16/2017
Next Scheduled EDR Contact: 01/29/2018
Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 02/13/2017
Date Data Arrived at EDR: 02/15/2017
Date Made Active in Reports: 11/03/2017
Number of Days to Update: 261

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 12/11/2017
Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 09/02/2017
Date Data Arrived at EDR: 09/06/2017
Date Made Active in Reports: 10/20/2017
Number of Days to Update: 44

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 09/06/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Quarterly

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 08/17/2017
Date Data Arrived at EDR: 08/17/2017
Date Made Active in Reports: 09/15/2017
Number of Days to Update: 29

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 08/17/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: Quarterly

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 11/06/2017
Date Data Arrived at EDR: 11/07/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 6

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 10/23/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COAL ASH: Coal Ash Disposal Site Listing
A listing of coal ash disposal site locations.

Date of Government Version: 09/25/2017
Date Data Arrived at EDR: 09/26/2017
Date Made Active in Reports: 10/12/2017
Number of Days to Update: 16

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

DRYCLEANERS: Registered Drycleaners
A listing of all registered drycleaning facilities.

Date of Government Version: 10/27/2016
Date Data Arrived at EDR: 01/10/2017
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 31

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 09/08/2017
Next Scheduled EDR Contact: 12/25/2017
Data Release Frequency: Varies

E DESIGNATION: E DESIGNATION SITE LISTING
The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 08/22/2017
Date Data Arrived at EDR: 09/21/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 1

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 09/18/2017
Next Scheduled EDR Contact: 01/01/2018
Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing
Financial assurance information.

Date of Government Version: 09/07/2017
Date Data Arrived at EDR: 10/02/2017
Date Made Active in Reports: 10/12/2017
Number of Days to Update: 10

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 09/21/2017
Next Scheduled EDR Contact: 01/15/2018
Data Release Frequency: Quarterly

Financial Assurance 2: Financial Assurance Information Listing
A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 03/09/2017
Date Data Arrived at EDR: 04/12/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 184

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 09/08/2017
Next Scheduled EDR Contact: 12/25/2017
Data Release Frequency: Varies

HSWDS: Hazardous Substance Waste Disposal Site Inventory
The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 10/01/2017
Date Data Arrived at EDR: 11/01/2017
Date Made Active in Reports: 11/13/2017
Number of Days to Update: 12

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 11/01/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Quarterly

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 07/24/2017
Date Data Arrived at EDR: 08/08/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 66

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 10/23/2017
Next Scheduled EDR Contact: 02/05/2018
Data Release Frequency: No Update Planned

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 09/05/2017
Date Data Arrived at EDR: 09/08/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 09/08/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Quarterly

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/10/2014
Number of Days to Update: 193

Source: Department of Environmental Conservation
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 06/26/2017
Date Data Arrived at EDR: 08/18/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 35

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 10/30/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Quarterly

Cortland County Storage Tank Listing
A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 06/26/2017
Date Data Arrived at EDR: 08/18/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 35

Source: Cortland County Health Department
Telephone: 607-753-5035
Last EDR Contact: 10/30/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 11/10/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 10/26/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

Registered Tank Database in Nassau County
A listing of facilities in Nassau County with storage tanks.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Department of Health
Telephone: 516-227-9691
Last EDR Contact: 11/10/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

Registered Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 11/10/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 10/26/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database
A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189
Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 08/31/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Quarterly

Petroleum Bulk Storage Database
A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189
Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 08/31/2017
Next Scheduled EDR Contact: 12/18/2017
Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database
A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 03/03/2015
Date Data Arrived at EDR: 03/10/2015
Date Made Active in Reports: 03/23/2015
Number of Days to Update: 13
Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 10/30/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: No Update Planned

Storage Tank Database
A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 03/03/2015
Date Data Arrived at EDR: 03/10/2015
Date Made Active in Reports: 03/23/2015
Number of Days to Update: 13
Source: Suffolk County Department of Health Services
Telephone: 631-854-2521
Last EDR Contact: 10/30/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

Listing of Storage Tanks
A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 07/03/2017
Date Data Arrived at EDR: 08/15/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 38
Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 10/26/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

Listing of Storage Tanks
A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 07/03/2017
Date Data Arrived at EDR: 08/15/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 38
Source: Westchester County Department of Health
Telephone: 914-813-5161
Last EDR Contact: 10/26/2017
Next Scheduled EDR Contact: 02/12/2018
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 07/28/2017
Date Data Arrived at EDR: 08/18/2017
Date Made Active in Reports: 11/14/2017
Number of Days to Update: 88

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 11/14/2017
Next Scheduled EDR Contact: 02/26/2018
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 04/11/2017
Date Made Active in Reports: 07/27/2017
Number of Days to Update: 107

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 10/05/2017
Next Scheduled EDR Contact: 01/22/2018
Data Release Frequency: Annually

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 07/25/2017
Date Made Active in Reports: 09/25/2017
Number of Days to Update: 62

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 10/16/2017
Next Scheduled EDR Contact: 01/29/2018
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2013
Date Data Arrived at EDR: 06/19/2015
Date Made Active in Reports: 07/15/2015
Number of Days to Update: 26

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 11/16/2017
Next Scheduled EDR Contact: 03/05/2018
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data
Hazardous waste manifest information.

Date of Government Version: 08/29/2017
Date Data Arrived at EDR: 09/08/2017
Date Made Active in Reports: 11/10/2017
Number of Days to Update: 63

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 10/16/2017
Next Scheduled EDR Contact: 01/29/2018
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 04/13/2017
Date Made Active in Reports: 07/14/2017
Number of Days to Update: 92

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 09/11/2017
Next Scheduled EDR Contact: 12/25/2017
Data Release Frequency: Annually

Oil/Gas Pipelines
Source: PennWell Corporation
Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Electric Power Transmission Line Data
Source: PennWell Corporation
This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers
Source: Department of Health
Telephone: 212-676-2444

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

CHRISTIAN CULTURAL CENTER
12020 FLATLANDS AVENUE
BROOKLYN, NY 11207

TARGET PROPERTY COORDINATES

Latitude (North):	40.650656 - 40° 39' 2.36''
Longitude (West):	73.88907 - 73° 53' 20.65''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	593925.9
UTM Y (Meters):	4500359.5
Elevation:	17 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	5940597 BROOKLYN, NY
Version Date:	2013
Northeast Map:	5940539 JAMAICA, NY
Version Date:	2013

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

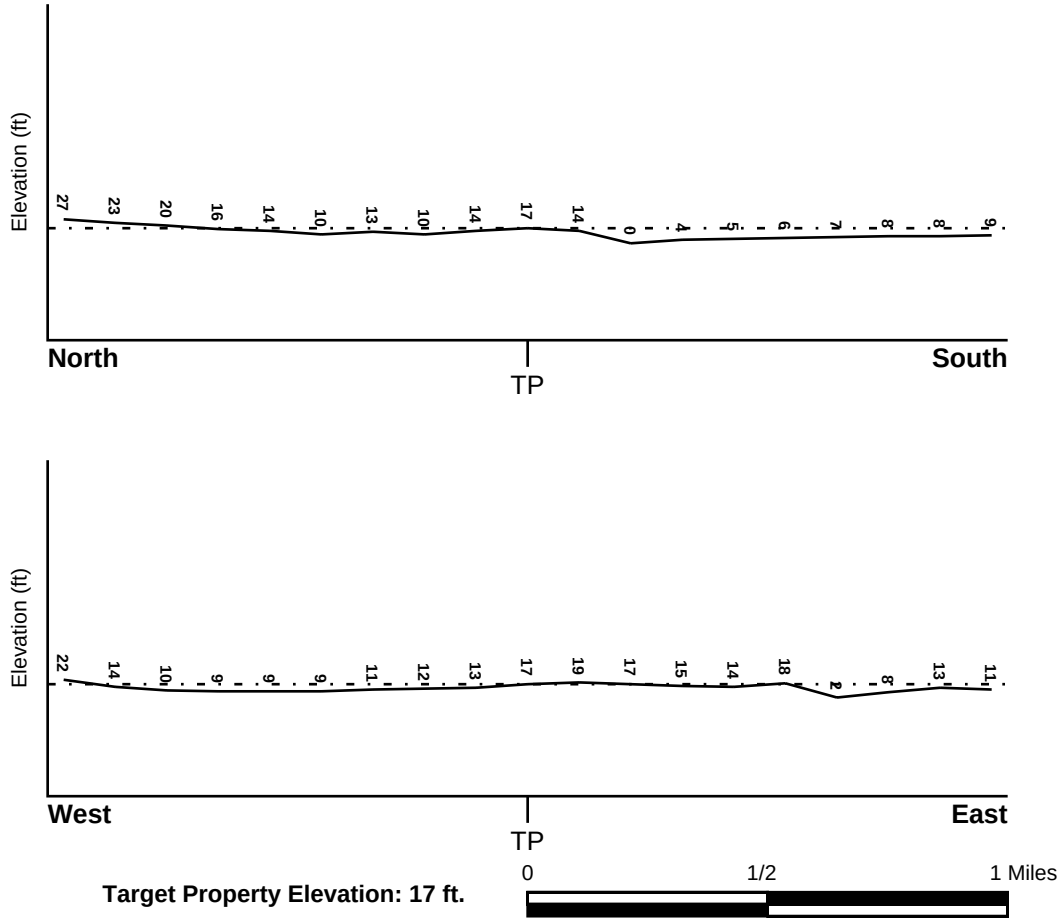

Target Property Elevation: 17 ft.

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
3604970219F	FEMA FIRM Flood data

Additional Panels in search area:	FEMA Source Type
3604970236F	FEMA FIRM Flood data
3604970075C	FEMA Q3 Flood data
3604970218F	FEMA FIRM Flood data
3604970238F	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
BROOKLYN	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Location Relative to TP:	1/2 - 1 Mile SE
Site Name:	PENNSYLVANIA/FOUNTAIN AVE LF
Site EPA ID Number:	NY6141790018
Groundwater Flow Direction:	TOWARD JAMAICA BAY.
Measured Depth to Water:	approximately 5 to 10 feet above mean sea level.
Hydraulic Connection:	Detailed hydraulic connection information is not available. The site is underlain by silt, sand, and gravel to a depth of approximately 55 feet. The Gardiners Clay unit underlies the upper silt, sand, and gravel, and is estimated to be 20 feet thick.
Sole Source Aquifer:	No information about a sole source aquifer is available
Data Quality:	Information based on site-specific subsurface investigations is documented in the CERCLIS investigation report(s)

* ©1996 Site--specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Cenozoic
System:	Quaternary
Series:	Pleistocene
Code:	Qp *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratifed Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam
loamy sand
sandy loam
fine sandy loam

Surficial Soil Types: silt loam
loamy sand
sandy loam
fine sandy loam

Shallow Soil Types: sandy loam

Deeper Soil Types: unweathered bedrock
very gravelly - loamy sand
stratified
sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 0.001 miles
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS40000827160	1/2 - 1 Mile NW
A2	USGS40000826428	1/2 - 1 Mile SSW
A3	USGS40000826429	1/2 - 1 Mile SSW
4	USGS40000826405	1/2 - 1 Mile SSE
B5	USGS40000827670	1/2 - 1 Mile North
B6	USGS40000827671	1/2 - 1 Mile North
7	USGS40000827477	1/2 - 1 Mile NE
8	USGS40000826922	1/2 - 1 Mile West

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 5113516.2s



- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

0 1/4 1/2 1 Miles

- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location
- HD Closest Hydrogeological Data
- Oil, gas or related wells

N

SITE NAME:	Christian Cultural Center	CLIENT:	Langan Engineering
ADDRESS:	12020 Flatlands Avenue Brooklyn NY 11207	CONTACT:	Amanda Forsburg
LAT/LONG:	40.650656 / 73.88907	INQUIRY #:	5113516.2s
		DATE:	November 20, 2017 5:46 pm

Copyright © 2017 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

	Database	EDR ID Number
1 **NW** **1/2 - 1 Mile** **Higher**	**FED USGS**	**USGS40000827160**

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403929073535701		
Monloc name:	K 619. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6581592
Longitude:	-73.8987476	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	25.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Not Reported		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	450
Welldepth units:	ft	Wellholedepth:	451
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 82

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1962-01-03		4.63	1957-12-30		4.63
1957-09-24		4.12	1957-06-27		4.39
1957-03-28		4.65	1956-12-26		4.86
1956-11-29		4.80	1956-10-25		4.69
1956-10-02		4.78	1956-07-10		4.80
1956-06-05		4.88	1956-05-15		5.12
1956-03-06		5.16	1956-02-07		5.15
1955-12-22		4.83	1955-11-15		5.22
1955-10-07		4.81	1955-08-25		4.58
1955-07-26		4.21	1955-06-23		4.68
1955-05-24		4.89	1955-04-28		6.12
1955-03-29		5.37	1955-02-25		5.22
1955-01-26		5.24	1954-12-28		4.92
1954-12-02		5.05	1954-10-29		4.74
1954-09-28		4.46	1954-08-25		4.21
1954-07-29		4.12	1954-06-30		4.43
1954-05-26		4.77	1954-04-29		4.64
1954-03-31		4.44	1954-02-25		4.56
1953-12-21		4.37	1953-12-01		4.48
1953-10-26		4.53	1953-09-24		4.09
1953-08-27		4.43	1953-07-31		4.40
1953-06-23		4.89	1953-05-26		4.99
1953-04-29		4.94	1953-03-24		5.20
1953-02-26		4.77	1953-02-04		4.75

Ground-water levels, continued.

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1952-12-23		4.79	1952-12-04		4.49
1952-11-04		4.00	1952-09-23		4.04
1952-08-26		3.62	1952-07-29		4.17
1952-06-23		4.23	1952-05-26		4.67
1952-04-28		4.58	1952-03-20		4.72
1952-02-19		4.14	1952-01-28		4.14
1951-12-20		3.78	1951-11-29		3.84
1951-09-26		3.57	1951-08-28		3.64
1951-07-24		3.70	1951-06-27		4.14
1951-05-29		4.48	1951-05-01		3.86
1951-03-26		3.94	1951-02-23		4.01
1951-01-30		3.52	1950-12-18		4.04
1950-11-27		4.34	1950-10-30		3.75
1950-09-26		3.41	1950-08-28		3.30
1950-07-26		3.16	1950-06-28		3.17
1950-06-05		3.32	1950-04-27		3.10
1950-03-29		3.03	1950-03-08		2.52

A2
SSW **FED USGS** **USGS40000826428**
1/2 - 1 Mile
Lower

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403827073535201		
Monloc name:	K 3255. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6409373
Longitude:	-73.8973587	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	16.8
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	24
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

A3
SSW **FED USGS** **USGS40000826429**
1/2 - 1 Mile
Lower

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403827073535202		
Monloc name:	K 3255. 2		
Monloc type:	Well		
Monloc desc:	ROCKAWAY PKWY AND AVENUE J		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6409373
Longitude:	-73.8973587	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	17.00
Vert measure units:	feet	Vertacc measure val:	1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Unconfined single aquifer		
Construction date:	19980624	Welldepth:	25
Welldepth units:	ft	Wellholedepth:	25
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

4
SSE **FED USGS** **USGS40000826405**
1/2 - 1 Mile
Lower

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403822073525501		
Monloc name:	K 2860. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6395485
Longitude:	-73.8815249	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	10.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Not Reported		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	Not Reported
Welldepth units:	Not Reported	Wellholedepth:	216
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B5
North
1/2 - 1 Mile
Higher | **FED USGS** | **USGS40000827670**

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403949073532108		
Monloc name:	K 3256. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6637147
Longitude:	-73.8887473	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	27.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	29
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 54

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1999-06-24		6.20	1997-07-23		5.75
1997-06-26		5.81	1997-03-17		5.78
1997-02-26		5.89	1996-07-05		5.40
1996-03-14		5.30	1995-09-29		5.26
1995-06-21		5.31	1995-01-03		5.51
1994-06-29		5.69	1994-03-24		6.01
1993-11-22		5.28	1993-08-24		5.48
1993-07-22		5.46	1993-06-22		5.58
1993-05-24		5.88	1993-04-28		6.13
1993-03-22		5.70	1993-01-19		5.75
1992-12-28		5.93	1992-11-19		5.56
1992-10-27		5.71	1992-09-18		6.02
1992-08-24		6.25	1992-07-16		5.98
1992-06-23		5.77	1992-06-12		5.74
1992-03-17		5.23	1991-03-19		6.11
1990-03-27		5.57	1989-03-08		6.07
1985-10-02		5.45	1985-05-20		4.34
1984-12-18		4.71	1984-10-03		6.26
1984-06-26		6.21	1984-03-27		5.63
1984-03-19		5.63	1984-01-05		5.46
1983-09-28		4.96	1983-06-28		5.86
1983-03-22		5.37	1982-12-21		5.40
1982-10-06		6.16	1982-06-30		6.25
1982-03-26		6.10	1981-12-29		6.30

Ground-water levels, continued.

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1981-09-22		6.15	1981-06-30		6.12
1981-03-19		6.69	1981-02-10		6.66
1980-12-24		6.86	1980-09-23		7.04

B6
North
1/2 - 1 Mile
Higher

FED USGS **USGS40000827671**

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403949073532109		
Monloc name:	K 3256. 2		
Monloc type:	Well		
Monloc desc:	RIVERDALE AVE & MILLER AVE & NEW LOTS AVE		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6637147
Longitude:	-73.8887473	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	27
Vert measure units:	feet	Vertacc measure val:	1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Unconfined single aquifer		
Construction date:	19980624	Welldepth:	40
Welldepth units:	ft	Wellholedepth:	40
Wellholedepth units:	ft		

Ground-water levels, Number of Measurements: 72

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
2005-02-15		5.97	2005-01-21		6.01
2004-12-15		5.99	2004-11-23		5.84
2004-10-21		6.02	2004-09-21		6.04
2004-08-25		5.99	2004-07-19		5.79
2004-06-16		5.67	2004-05-25		5.79
2004-04-29		5.83	2004-03-21		5.61
2004-02-25		5.63	2003-12-18		5.84
2003-11-22		5.72	2003-10-29		5.64
2003-09-24		5.84	2003-08-25		6.05
2003-07-21		6.07	2003-06-25		6.44
2003-05-19		5.75	2003-04-28		5.96
2003-03-18		5.95	2003-02-27		5.88
2002-12-27		5.78	2002-11-26		5.84
2002-10-21		5.88	2002-09-25		5.47
2002-08-27		5.09	2002-07-22		5.22
2002-06-18		5.44	2002-05-29		5.40
2002-04-24		5.15	2002-03-21		5.09
2002-02-27		5.02	2002-01-28		5.10

Ground-water levels, continued.

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
2001-12-28		5.21	2001-11-15		5.29
2001-10-24		5.43	2001-09-26		5.55
2001-08-29		5.65	2001-07-24		5.79
2001-06-28		5.94	2001-05-24		5.92
2001-04-25		6.15	2001-03-20		5.72
2000-12-19		5.58	2000-11-28		5.56
2000-10-24		5.57	2000-09-27		5.76
2000-08-24		5.83	2000-07-27		5.83
2000-06-28		5.82	2000-03-23		5.74
2000-02-29		5.57	1999-12-13		5.55
1999-11-23		5.58	1999-10-19		5.69
1999-09-23		5.91	1999-08-17		5.64
1999-07-16		5.70	1999-06-24		5.76
1999-05-18		5.80	1999-04-28		5.88
1999-03-23		6.05	1999-03-02		6.01
1999-01-27		6.03	1998-11-24		5.63
1998-10-29		5.67	1998-09-29		5.72
1998-09-01		5.86	1998-07-28		6.04

7
NE **FED USGS** **USGS40000827477**
1/2 - 1 Mile
Lower

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403938073523701		
Monloc name:	K 2610. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.6606592
Longitude:	-73.8765247	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	5.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	60
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

8
West **FED USGS** **USGS40000826922**
1/2 - 1 Mile
Higher

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Org. Identifier:	USGS-NY		
Formal name:	USGS New York Water Science Center		
Monloc Identifier:	USGS-403859073542901		
Monloc name:	K 3122. 1		
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030202	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.649826
Longitude:	-73.9076367	Sourcemap scale:	24000
Horiz Acc measure:	1	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	20.0
Vert measure units:	feet	Vertacc measure val:	0.1
Vert accmeasure units:	feet		
Vertcollection method:	Level or other surveying method		
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Northern Atlantic Coastal Plain aquifer system		
Formation type:	Glacial Aquifer, Upper		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	Not Reported
Welldepth units:	Not Reported	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

Federal EPA Radon Zone for KINGS County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for KINGS COUNTY, NY

Number of sites tested: 51

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.750 pCi/L	100%	0%	0%
Basement	1.370 pCi/L	88%	10%	2%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands
Source: Department of Environmental Conservation
Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells
Source: New York Department of Health
Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Department of Environmental Conservation
Telephone: 518-402-8072
These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon
Source: Department of Health
Telephone: 518-402-7556
Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX F

GOVERNMENT CORRESPONDENCE AND RECORDS

Home

Customer Services

- Pay Online
- Ways to Pay Your Bill
- eBilling
- Account Information
- Customer Assistance
- Service Line Protection Program
- Water Rates
- Property Managers & Trade Professionals

Water Utilities

- Drinking Water
- Wastewater
- Stormwater
- Harbor Water
- Long Term Control Plan

The Watershed

- Watershed Protection
- Watershed Recreation

Citywide Initiatives

- Environmental Education
- Conservation Programs
- Air Pollution Control
- Noise Codes & Complaints

Business and Professionals

- Forms & Permits
- Support for Businesses
- Doing Business with DEP
- Asbestos Abatement
- Construction, Demolition & Abatement

About DEP

- Inside DEP
- News
- Capital Projects
- Careers at DEP
- Environmental Reviews
- Interagency MOUs
- A to Z Index
- Contact Us

Dear Sir or Madam

We hereby acknowledge receipt of your Freedom of Information Law ("FOIL") request. Your request is important to us and will be handled as expeditiously as possible. Please be advised however, that because of the large volume of pending complex FOIL requests handled by the Department of Environmental Protection ("DEP"), and the available staffing, your response is anticipated to take between 120-150 days from the date of this acknowledgement.

Please also be advised that for requests that appear to be submitted in connection with a Phase I site assessment of a property, DEP's response will exclude records relating to asbestos, and discharges into the sewers, as non-scope items, unless the FOIL request explicitly asks for those records. To the extent you require this information, please specify so in the FOIL request. In addition, any information on boiler permits filed with DEP is already publicly available at the following website https://a826-web01.nyc.gov/DEP.BoilerInformationExt/. Accordingly, DEP's response assumes you have directly obtained any relevant records from that website, and will exclude those records, as well.

Sincerely,
Records Access Officer

My DEP Account and Online Bill Pay

New Payment Options
Water Charges

Reservoir Levels
Current: 74.4%
Normal: 86.3%

Customer Assistance

- Contact Customer Service
- NYC Lien Sale & Payment Agreements
- Multi-Family Conservation Program
- Dispute Resolution
- Learn About AMR
- Dispose of Grease & Oil Properly
- For Businesses
- More Services…

Copyright 2018 The City of New York

Matthew Oleske

From: Abbott, Patricia <PAbbott@dep.nyc.gov>
Sent: Thursday, February 08, 2018 2:36 PM
To: Matthew Oleske
Subject: Your Foil Request

February 8, 2018

Langan Engineering

Re: 12020 Flatlands Ave Brooklyn, NY

Dear Matthew Oleske:

[ ] We write to inform you that a search of records maintained by The Division of Emergency Response and Technical Assessment, (DERTA) yielded documents responsive to your FOIL request. Your request is granted. Copies of records responsive to your request and to which you are entitled access are enclosed.

[X] Please be advised that a search of records maintained by DERTA was made and records you requested were not found.

In the event that you disagree with this determination, you may appeal it within 30 days, by writing to:

DEP FOIL Appeals Officer
NYC Department of Environmental Protection
59-17 Junction Blvd., 19th Floor
Flushing, NY 11373

FOIL 166628

Sincerely,

P. Abbott

Patricia Abbott
Executive Assistant
Bureau of Police & Security, DERTA
dertafoil@dep.nyc.gov

Request Confirmation

Request Information

Tracking Number : *EPA-R2-2018-003366*

Requester Name : Matthew Oleske

Date Submitted : 01/15/2018

Request Status : Submitted

Description :

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property. Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, ground water sampling, asbestos abatement, radon, hazardous materials, and any other documents that your department may have regarding the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1) The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

U.S. EPA Region 2
290 Broadway, 26th Fl
New York, NY 10007-1866

Matthew Oleske
Langan
300 Kimball Drive
Floor 4
Parsippany, NJ 07054

January 17, 2018

Dear Matthew Oleske,

EPA-R2-2018-003366 has been processed with the following final disposition: Full grant.

This is in response to your Freedom of Information Act (FOIA) request, identified above, dated 01/15/2018, that you submitted to the U.S. Environmental Protection Agency (EPA). Your request seeks to obtain the environmental conditions at the following property:

12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)

The information that you are seeking is publicly available on EPA's *MyPropertyInfo* online database. The database will provide you with information concerning records the EPA has about a specific property, and it can be accessed at the link below:

https://www.epa.gov/enviro/frs-query-page

Because this information is publicly available, your FOIA request for this information is being administratively closed, in accordance with EPA's FOIA regulations. See 40 C.F.R. Part 2, Subpart A. ***Please note you should perform the initial search of a property of interest by visiting the above link. If your search produces results, then proceed with an information request for additional records under FOIA. Your FOIA submittal should be accompanied by these results.***

If you consider this response to be a denial of your request, you may appeal this determination to the National Freedom of Information Office, U.S. EPA, 1200 Pennsylvania Avenue, N.W. (2822T), Washington, DC 20460 (U.S. Postal Service Only). Only items mailed through the United States Postal Service may be delivered to 1200 Pennsylvania Avenue, N.W. If you are submitting your appeal via hand delivery, courier service, or overnight delivery, you must address your correspondence to 1301 Constitution Avenue, N.W., Room 6416J, Washington, DC 20001. Your appeal must be made in writing, and it must be received no later than 90 calendar days from the date of this letter. The Agency will not consider appeals received after the 90 calendar day limit. Appeals received after 5:00 pm EST will be considered received the next business day. The appeal letter should include the FOIA tracking number listed above. For quickest possible handling, the subject line of your email, the appeal letter, and its envelope, if applicable, should be marked "Freedom of Information Act Appeal." Additionally, you may seek assistance from EPA's FOIA Public Liaison at hq.foia@epa.gov or (202)566-1667, or from the Office of Government Information Services (OGIS). You may contact OGIS in any of the following ways: by mail, Office of Government Information Services, National Archives and Records Administration, Room 2510, 8610 Adelphi Road, College Park, MD 20740-6001; e-mail, ogis@nara.gov; telephone, 301-837-1996 or 1-877-684-6448; and facsimile, 301-837-0348.

Please contact Ms. Wanda Calderon of my staff if you have web access difficulties. This letter concludes our response to your request. Thank you for your interest in this information.

Respectfully,

/s/
Mary Mears
Public Affairs Director
U.S. EPA Region 2 (NJ, NY, PR, the US VI and eight Indian Nations)

Matthew Oleske

From: calderon.wanda@epa.gov
Sent: Thursday, January 18, 2018 2:27 PM
To: Matthew Oleske
Subject: Final Disposition, Request EPA-R2-2018-003366
Attachments: Final Disposition, Request EPA-R2-2018-003366.pdf

EPA-R2-2018-003366 has been processed with the following final disposition: Full grant.

This is in response to your Freedom of Information Act (FOIA) request, identified above, dated 01/15/2018, that you submitted to the U.S. Environmental Protection Agency (EPA). Your request seeks to obtain the environmental conditions at the following property:

12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)

The information that you are seeking is publicly available on EPA's *MyPropertyInfo* online database. The database will provide you with information concerning records the EPA has about a specific property, and it can be accessed at the link below:

https://www.epa.gov/enviro/frs-query-page

Because this information is publicly available, your FOIA request for this information is being administratively closed, in accordance with EPA's FOIA regulations. See 40 C.F.R. Part 2, Subpart A. ***Please note you should perform the initial search of a property of interest by visiting the above link. If your search produces results, then proceed with an information request for additional records under FOIA. Your FOIA submittal should be accompanied by these results.***

If you consider this response to be a denial of your request, you may appeal this determination to the National Freedom of Information Office, U.S. EPA, 1200 Pennsylvania Avenue, N.W. (2822T), Washington, DC 20460 (U.S. Postal Service Only). Only items mailed through the United States Postal Service may be delivered to 1200 Pennsylvania Avenue, N.W. If you are submitting your appeal via hand delivery, courier service, or overnight delivery, you must address your correspondence to 1301 Constitution Avenue, N.W., Room 6416J, Washington, DC 20001. Your appeal must be made in writing, and it must be received no later than 90 calendar days from the date of this letter. The Agency will not consider appeals received after the 90 calendar day limit. Appeals received after 5:00 pm EST will be considered received the next business day. The appeal letter should include the FOIA tracking number listed above. For quickest possible handling, the subject line of your email, the appeal letter, and its envelope, if applicable, should be marked "Freedom of Information Act Appeal." Additionally, you may seek assistance from EPA's FOIA Public Liaison at hq.foia@epa.gov or (202)566-1667, or from the Office of Government Information Services (OGIS). You may contact OGIS in any of the following ways: by mail, Office of Government Information Services, National Archives and Records Administration, Room 2510, 8610 Adelphi Road, College Park, MD 20740-6001; e-mail, ogis@nara.gov; telephone, 301-837-1996 or 1-877-684-6448; and facsimile, 301-837-0348.

Please contact Ms. Wanda Calderon of my staff if you have web access difficulties. This letter concludes our response to your request. Thank you for your interest in this information.

Respectfully,

/s/
Mary Mears
Public Affairs Director
U.S. EPA Region 2 (NJ, NY, PR, the US VI and eight Indian Nations)

Mayor's Office of Environmental Coordination

CEQR Access Log In

CEQR Project Search

Keyword			
CEQR Number		**Project Name**	
Community District	--Select--	**Borough / Block / Lot**	Brooklyn / 4430 / 1
Lead Agency	--Select--		

Search for Review Clear Search

Search Result [0 record(s) found]

No result found.

Disclaimer and Notes:

The database contains records of CEQR projects, which were filed with the Mayor's Office of Environmental Coordination from January 1, 2005 to the present. While some older records are available in the database, records that cannot be found on CEQR Access should be requested from the agency that was responsible for preparing it (the "Lead Agency"). If any errors are found in the database, please notify the Mayor's Office of Environmental Coordination (ceqraccess@cityhall.nyc.gov). The Mayor's Office of Environmental Coordination makes no representation as to the accuracy of the information in the database or its suitability for any purpose, and disclaims any liability for errors that may be contained therein.

Copyright 2013 The City of New York

Mayor's Office of Environmental Coordination

CEQR Access Log In

CEQR Project Search

Keyword

CEQR Number

Project Name

Community District --Select--

Borough / Block / Lot Brooklyn / 4431 / 1

Lead Agency --Select--

Search for Review Clear Search

Search Result [0 record(s) found]

No result found.

Disclaimer and Notes:

The database contains records of CEQR projects, which were filed with the Mayor's Office of Environmental Coordination from January 1, 2005 to the present. While some older records are available in the database, records that cannot be found on CEQR Access should be requested from the agency that was responsible for preparing it (the "Lead Agency"). If any errors are found in the database, please notify the Mayor's Office of Environmental Coordination (ceqraccess@cityhall.nyc.gov). The Mayor's Office of Environmental Coordination makes no representation as to the accuracy of the information in the database or its suitability for any purpose, and disclaims any liability for errors that may be contained therein.

Copyright 2013 The City of New York

CEQR Project Search

Keyword			
CEQR Number		**Project Name**	
Community District	--Select--	**Borough / Block / Lot**	Brooklyn / 4431 / 200
Lead Agency	--Select--		

Search for Review Clear Search

Search Result [0 record(s) found]

No result found.

Disclaimer and Notes:

The database contains records of CEQR projects, which were filed with the Mayor's Office of Environmental Coordination from January 1, 2005 to the present. While some older records are available in the database, records that cannot be found on CEQR Access should be requested from the agency that was responsible for preparing it (the "Lead Agency"). If any errors are found in the database, please notify the Mayor's Office of Environmental Coordination (ceqraccess@cityhall.nyc.gov). The Mayor's Office of Environmental Coordination makes no representation as to the accuracy of the information in the database or its suitability for any purpose, and disclaims any liability for errors that may be contained therein.

Copyright 2013 The City of New York

CEQR Project Search

Keyword			
CEQR Number		**Project Name**	
Community District	--Select--	**Borough / Block / Lot**	Brooklyn / 4432 / 1
Lead Agency	--Select--		

Search for Review Clear Search

Search Result [0 record(s) found]

No result found.

Disclaimer and Notes:

The database contains records of CEQR projects, which were filed with the Mayor's Office of Environmental Coordination from January 1, 2005 to the present. While some older records are available in the database, records that cannot be found on CEQR Access should be requested from the agency that was responsible for preparing it (the "Lead Agency"). If any errors are found in the database, please notify the Mayor's Office of Environmental Coordination (ceqraccess@cityhall.nyc.gov). The Mayor's Office of Environmental Coordination makes no representation as to the accuracy of the information in the database or its suitability for any purpose, and disclaims any liability for errors that may be contained therein.

Copyright 2013 The City of New York

Mayor's Office of Environmental Coordination

CEQR Access Log In

CEQR Project Search

Keyword

CEQR Number

Project Name

Community District --Select--

Borough / Block / Lot Brooklyn / 4434 / 1

Lead Agency --Select--

Search for Review Clear Search

Search Result [0 record(s) found]

No result found.

Disclaimer and Notes:

The database contains records of CEQR projects, which were filed with the Mayor's Office of Environmental Coordination from January 1, 2005 to the present. While some older records are available in the database, records that cannot be found on CEQR Access should be requested from the agency that was responsible for preparing it (the "Lead Agency"). If any errors are found in the database, please notify the Mayor's Office of Environmental Coordination (ceqraccess@cityhall.nyc.gov). The Mayor's Office of Environmental Coordination makes no representation as to the accuracy of the information in the database or its suitability for any purpose, and disclaims any liability for errors that may be contained therein.

Copyright 2013 The City of New York

Menu

FOIL Request Main Page (SupportHome.aspx)

I want to...

Reference No: W031340-011518

Contact E-Mail: akritzer@langan.com

Dear Allyson:

Thank you for your Freedom of Information Law (FOIL) request. Your request has been received and is being processed. Your request was received in this office on 1/15/2018 and given the reference number FOIL #**W031340-011518** for tracking purposes. You may expect the Department's response to your request no later than **2/13/2018**.

Record Requested: **Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, groundwater sampling, asbestos abatement, radon, hazardous materials and any other documents that your department may have regarding the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)**

You can monitor the progress of your request at the link below and you'll receive an email when your request has been completed. Again, thank you for using the FOIL Center.

https://mycusthelp.com/NEWYORKDEC/_rs/RequestLogin.aspx
(https://mycusthelp.com/NEWYORKDEC/_rs/RequestLogin.aspx)

New York State Department of Environmental Conservation, Record Access Office

Powered by GovQA

Allyson Kritzer

From: New York DEC Support <newyorkdec@mycusthelp.net>
Sent: Monday, January 15, 2018 12:58 PM
To: Allyson Kritzer
Subject: FOIL Request :: W031340-011518

Dear Allyson:

Thank you for your Freedom of Information Law (FOIL) request. Your request has been received and is being processed. Your request was received in this office on 1/15/2018 and given the reference number FOIL #W031340-011518 for tracking purposes. You may expect the Department's response to your request no later than **2/13/2018**.

Record Requested: **Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, groundwater sampling, asbestos abatement, radon, hazardous materials and any other documents that your department may have regarding the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)**

You can monitor the progress of your request at the link below and you'll receive an email when your request has been completed. Again, thank you for using the FOIL Center.

https://mycusthelp.com/NEWYORKDEC/_rs/RequestLogin.aspx

New York State Department of Environmental Conservation, Record Access Office

---

Track the issue status and respond at:
https://mycusthelp.com/NEWYORKDEC//_rs/RequestEdit.aspx?rid=31340

NEW YORK
STATE OF
OPPORTUNITY.
Department
of Health

ANDREW M. CUOMO
Governor

HOWARD A. ZUCKER, M.D., J.D.
Commissioner

SALLY DRESLIN, M.S., R.N.
Executive Deputy Commissioner

January 18, 2018

Matthew Oleske
Langan
300 Kimball Drive
Parsippany, NJ 07054

FOIL # 18-01-193
Your File # 100688801

Dear Mr. Oleske:

This will acknowledge receipt of your request for records under the Freedom of Information Law, received by this office on January 15, 2018.

Your request has been forwarded to the appropriate Department program area(s) to identify documents that are responsive to your request and which may be made available pursuant to all applicable provisions of the Freedom of Information Law.

A determination as to whether your request is granted or denied will be reached in approximately 20 business days or we will notify you in writing if the responsible program area(s) should require additional time to locate, assemble, and review documents that may be responsive to your request.

Please note that, pursuant to Article 6 of the Public Officers Law, a charge may be applied to your request, including the actual cost of the medium used to respond to your Freedom of Information Law request and/or other related costs. When responsive records have been identified, you will be informed of any cost and how payment should be made.

Sincerely,

Rosemarie Hewig, Esq.
Records Access Officer

RH/sjp

Project Screening Request Form

New York Natural Heritage has received your request. Please expect a response within 3 weeks.

Go back to the form

© 2004-2017 New York Natural Heritage Program. Questions, Comments, Queries.

NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION

Division of Fish and Wildlife, New York Natural Heritage Program
625 Broadway, Fifth Floor, Albany, NY 12233-4757
P: (518) 402-8935 | F: (518) 402-8925
www.dec.ny.gov

January 19, 2018

Matthew Oleske
Langan
300 Kimball Drive, Floor 4
Parsippany, NJ 07054

Re: Christian Cultural Center
County: Kings Town/City: Kings

Dear Mr. Oleske:

In response to your recent request, we have reviewed the New York Natural Heritage Program database with respect to the above project.

We have no records of rare or state-listed animals or plants, or significant natural communities at the project site or in its immediate vicinity.

The absence of data does not necessarily mean that rare or state-listed species, significant natural communities, or other significant habitats do not exist on or adjacent to the proposed site. Rather, our files currently do not contain information that indicates their presence. For most sites, comprehensive field surveys have not been conducted. We cannot provide a definitive statement on the presence or absence of all rare or state-listed species or significant natural communities. Depending on the nature of the project and the conditions at the project site, further information from on-site surveys or other resources may be required to fully assess impacts on biological resources.

This response applies only to known occurrences of rare or state-listed animals and plants, significant natural communities, and other significant habitats maintained in the Natural Heritage database. Your project may require additional review or permits; for information regarding other permits that may be required under state law for regulated areas or activities (e.g., regulated wetlands), please contact the NYS DEC Region 2 Office, Division of Environmental Permits, as listed at www.dec.ny.gov/about/39381.html.

Sincerely,

Colleen Lutz
Assistant Biologist
New York Natural Heritage Program

United States Department of the Interior

FISH AND WILDLIFE SERVICE
Long Island Ecological Services Field Office
340 Smith Road
Shirley, NY 11967
Phone: (631) 286-0485 Fax: (631) 286-4003

In Reply Refer To:
Consultation Code: 05E1LI00-2018-SLI-0200
Event Code: 05E1LI00-2018-E-00437
Project Name: CCC

January 15, 2018

Subject: List of threatened and endangered species that may occur in your proposed project location, and/or may be affected by your proposed project

To Whom It May Concern:

The enclosed species list identifies threatened, endangered, proposed and candidate species, as well as proposed and final designated critical habitat, that may occur within the boundary of your proposed project and/or may be affected by your proposed project. The species list fulfills the requirements of the U.S. Fish and Wildlife Service (Service) under section 7(c) of the Endangered Species Act (Act) of 1973, as amended (16 U.S.C. 1531 *et seq.*).

New information based on updated surveys, changes in the abundance and distribution of species, changed habitat conditions, or other factors could change this list. Please feel free to contact us if you need more current information or assistance regarding the potential impacts to federally proposed, listed, and candidate species and federally designated and proposed critical habitat. Please note that under 50 CFR 402.12(e) of the regulations implementing section 7 of the Act, the accuracy of this species list should be verified after 90 days. This verification can be completed formally or informally as desired. The Service recommends that verification be completed by visiting the ECOS-IPaC website at regular intervals during project planning and implementation for updates to species lists and information. An updated list may be requested through the ECOS-IPaC system by completing the same process used to receive the enclosed list.

The purpose of the Act is to provide a means whereby threatened and endangered species and the ecosystems upon which they depend may be conserved. Under sections 7(a)(1) and 7(a)(2) of the Act and its implementing regulations (50 CFR 402 *et seq.*), Federal agencies are required to utilize their authorities to carry out programs for the conservation of threatened and endangered species and to determine whether projects may affect threatened and endangered species and/or designated critical habitat.

A Biological Assessment is required for construction projects (or other undertakings having similar physical impacts) that are major Federal actions significantly affecting the quality of the human environment as defined in the National Environmental Policy Act (42 U.S.C. 4332(2)(c)). For projects other than major construction activities, the Service suggests that a biological evaluation similar to a Biological Assessment be prepared to determine whether the project may affect listed or proposed species and/or designated or proposed critical habitat. Recommended contents of a Biological Assessment are described at 50 CFR 402.12.

If a Federal agency determines, based on the Biological Assessment or biological evaluation, that listed species and/or designated critical habitat may be affected by the proposed project, the agency is required to consult with the Service pursuant to 50 CFR 402. In addition, the Service recommends that candidate species, proposed species and proposed critical habitat be addressed within the consultation. More information on the regulations and procedures for section 7 consultation, including the role of permit or license applicants, can be found in the "Endangered Species Consultation Handbook" at:

http://www.fws.gov/endangered/esa-library/pdf/TOC-GLOS.PDF

Please be aware that bald and golden eagles are protected under the Bald and Golden Eagle Protection Act (16 U.S.C. 668 *et seq.*), and projects affecting these species may require development of an eagle conservation plan (http://www.fws.gov/windenergy/eagle_guidance.html). Additionally, wind energy projects should follow the wind energy guidelines (http://www.fws.gov/windenergy/) for minimizing impacts to migratory birds and bats.

Guidance for minimizing impacts to migratory birds for projects including communications towers (e.g., cellular, digital television, radio, and emergency broadcast) can be found at: http://www.fws.gov/migratorybirds/CurrentBirdIssues/Hazards/towers/towers.htm; http://www.towerkill.com; and http://www.fws.gov/migratorybirds/CurrentBirdIssues/Hazards/towers/comtow.html.

We appreciate your concern for threatened and endangered species. The Service encourages Federal agencies to include conservation of threatened and endangered species into their project planning to further the purposes of the Act. Please include the Consultation Tracking Number in the header of this letter with any request for consultation or correspondence about your project that you submit to our office.

Attachment(s):

- Official Species List

Official Species List

This list is provided pursuant to Section 7 of the Endangered Species Act, and fulfills the requirement for Federal agencies to "request of the Secretary of the Interior information whether any species which is listed or proposed to be listed may be present in the area of a proposed action".

This species list is provided by:

Long Island Ecological Services Field Office
340 Smith Road
Shirley, NY 11967
(631) 286-0485

Project Summary

Consultation Code: 05E1LI00-2018-SLI-0200

Event Code: 05E1LI00-2018-E-00437

Project Name: CCC

Project Type: ** OTHER **

Project Description: Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)

The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

Project Location:

Approximate location of the project can be viewed in Google Maps: https://www.google.com/maps/place/40.65121791360481N73.88799969698621W



Counties: Kings, NY

Endangered Species Act Species

There is a total of 4 threatened, endangered, or candidate species on this species list. Species on this list should be considered in an effects analysis for your project and could include species that exist in another geographic area. For example, certain fish may appear on the species list because a project could affect downstream species. See the "Critical habitats" section below for those critical habitats that lie wholly or partially within your project area under this office's jurisdiction. Please contact the designated FWS office if you have questions.

Birds

NAME	STATUS
Piping Plover *Charadrius melodus* Population: [Atlantic Coast and Northern Great Plains populations] - Wherever found, except those areas where listed as endangered. There is **final** critical habitat for this species. Your location is outside the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/6039	Threatened
Red Knot *Calidris canutus rufa* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/1864	Threatened
Roseate Tern *Sterna dougallii dougallii* Population: northeast U.S. nesting pop. No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/2083	Endangered

Flowering Plants

NAME	STATUS
Seabeach Amaranth *Amaranthus pumilus* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/8549	Threatened

Critical habitats

THERE ARE NO CRITICAL HABITATS WITHIN YOUR PROJECT AREA UNDER THIS OFFICE'S JURISDICTION.

Preview Request

Agency Selection

Agency : U.S Environmental Protection Agency
Sub-Agency : Region 2

Request Type Selection

Request Type : FOIA

Contact Information

Prefix :
First Name : Matthew
Middle Initial :
Last Name : Oleske
Organization : Langan
Email Address : moleske@langan.com
Phone Number : 973-560-4273
Fax Number : 973-560-4901

Mailing Address Location : United States/U.S. Territories
Address Line 1 : 300 Kimball Drive
Address Line 2 : Floor 4
City : Parsippany
State/Province : New Jersey
Zip Code/Postal Code : 07054

Processing Fees

Will Pay Up To : $ 25.00

Description :

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property. Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, ground water sampling, asbestos abatement, radon, hazardous materials, and any other documents that your department may have regarding the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1) The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

Request a Fee Waiver

Make Request ? No

Request Expedited Handling

Make Request ? No

Attach Supporting Files

Attached File	Type	Size (MB)
Site Location Map.pdf	PDF	1.97

☐ Agree to Privacy Act Statement. I have read the Privacy Act Statement and agree to the terms set forth.

☐ Affirmation. Pursuant to 28 USC § 1746, I declare and affirm that under penalty of perjury under the laws of the United States of America that all of the foregoing information, statements, and signatures submitted in connection with this request and in any supporting documents are true and correct to the best of my knowledge.

LANGAN

Technical Excellence
Practical Experience
Client Responsiveness

15 January 2018

Leslie Ifill
Fire Department of New York City
FDNY Bureau of Legal Affairs
Public Records Unit
9 MetroTech Center, IS-8C
Brooklyn, New York 11201

Re: Request for Review of Information
12020 Flatlands Avenue
Brooklyn, New York
Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and,
Block 4434, Lot 1
Langan Project No.: 100688801

Dear Ms. Ifill:

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property. Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, ground water sampling, asbestos abatement, radon, hazardous materials, and any other documents that your department may have regarding the above-referenced property.


The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

If possible, please email (moleske@langan.com) or fax a response to (973) 560-4901 and/or send a hard-copy response to my attention. Please contact me at (973) 560-4273 if there are any questions regarding this request. Thank you in advance for your assistance.

Sincerely,
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.

Matthew Oleske
Senior Staff Engineer

Enclosure(s): Site Location Map, Record Search Request Forms, Check
\\langan.com\data\PAR\data8\100688801\Project Data\Correspondence\FOILs\FDNY.docx

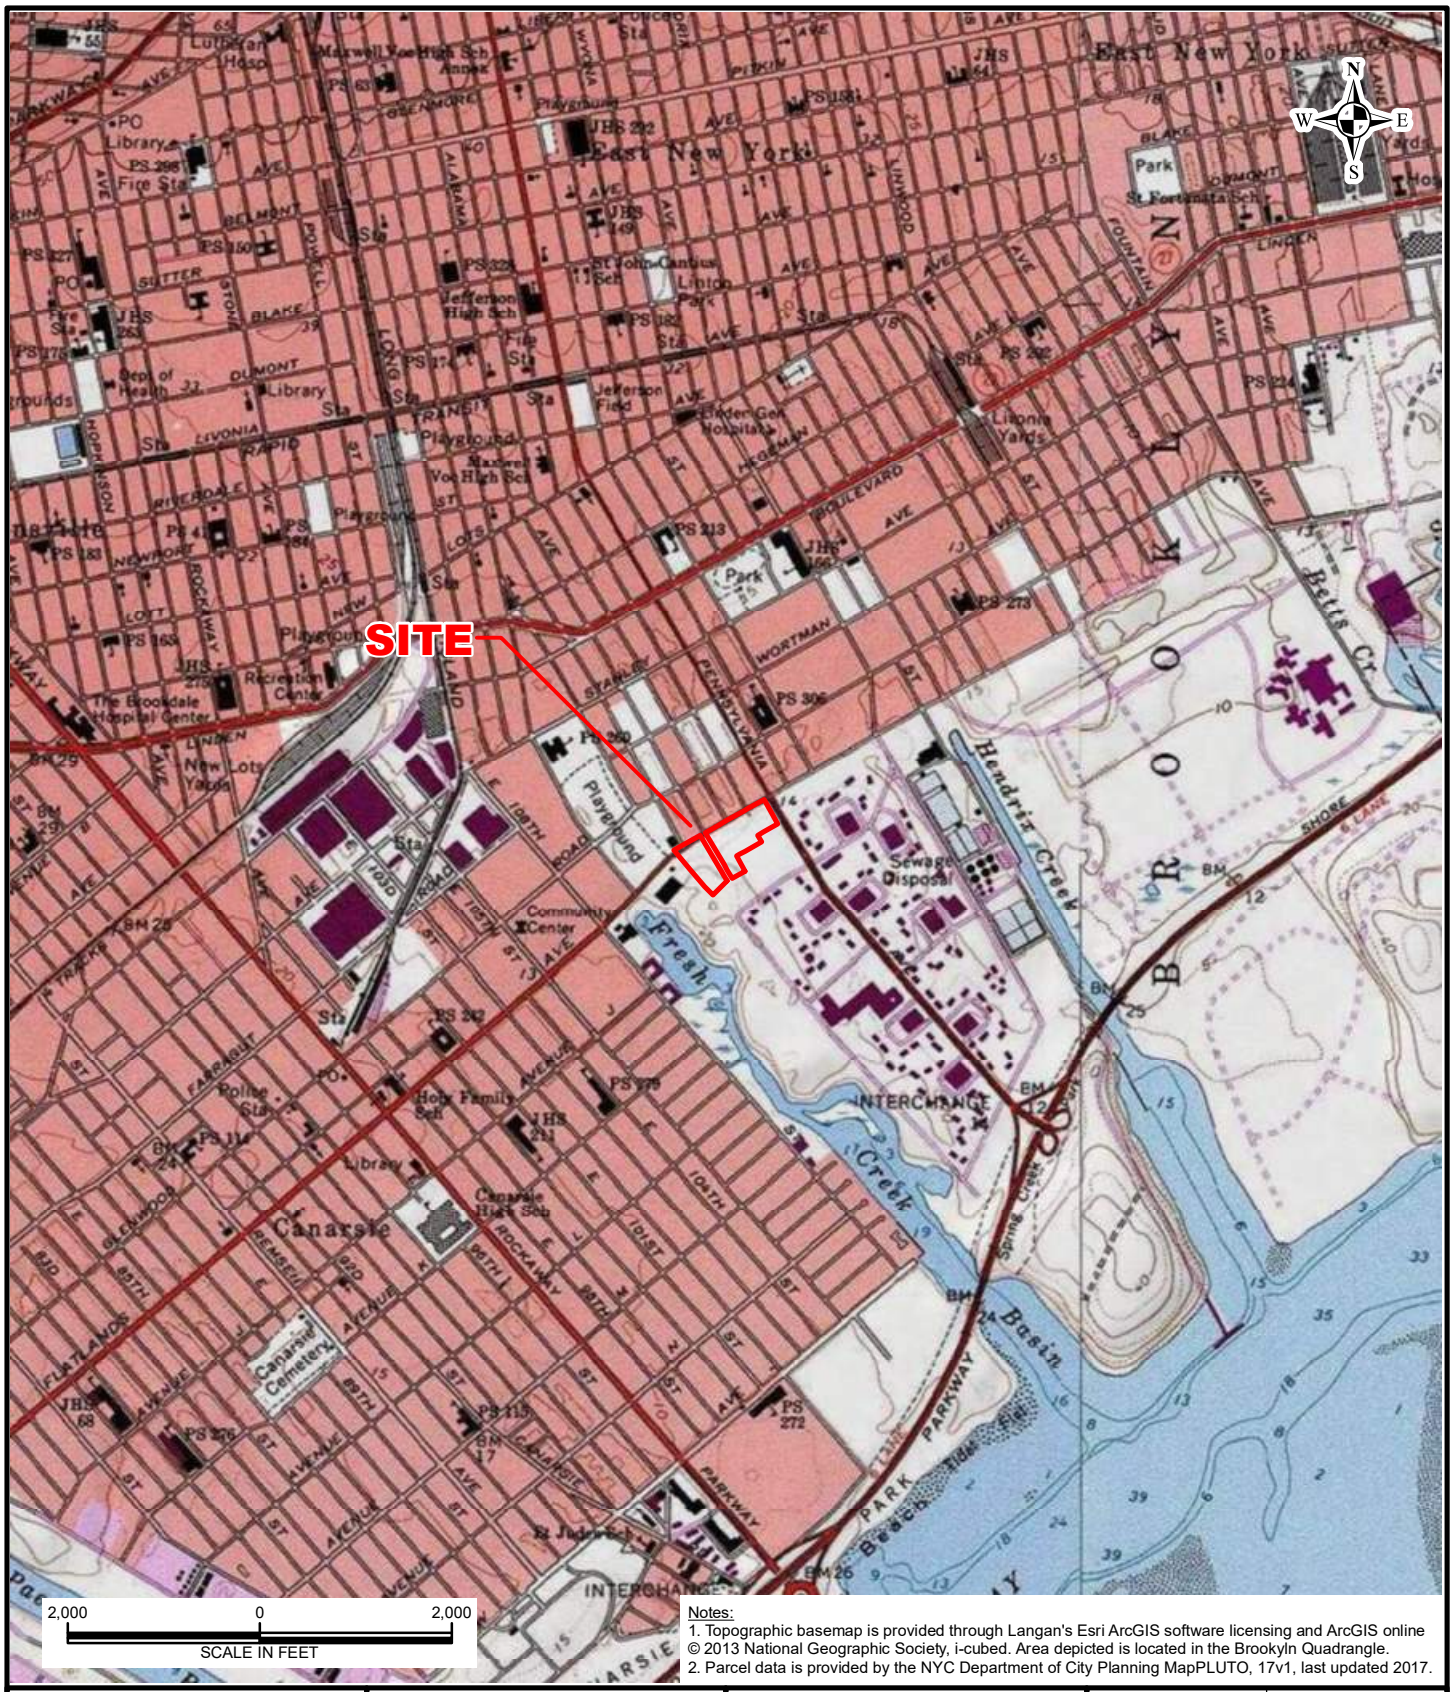

Notes:
1. Topographic basemap is provided through Langan's Esri ArcGIS software licensing and ArcGIS online © 2013 National Geographic Society, i-cubed. Area depicted is located in the Brookyln Quadrangle.
2. Parcel data is provided by the NYC Department of City Planning MapPLUTO, 17v1, last updated 2017.

LANGAN
300 Kimball Drive
Parsippany, NJ 07054
T: 973.560.4900 F: 973.560.4901 www.langan.com

Langan Engineering & Environmental Services, Inc.
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
Langan International LLC
Collectively known as Langan

NJ CERTIFICATE OF AUTHORIZATION No. 24GA27996400

Project
12020 FLATLANDS AVENUE
BLOCK No. 4430, LOT No. 1
BLOCK No. 4431, LOT No. 1, 200
BLOCK No. 4432, LOT No. 1
BLOCK No. 4434, LOT No. 1
BROOKLYN
KINGS COUNTY NEW YORK

Drawing Title
SITE LOCATION MAP

Project No.	100688801
Date	01/15/2018
Scale	1 " = 2,000 '
Drawn By	AB
Last Revised	01/15/2018
Figure	1

© 2018 Langan

Path: \\langan.com\data\PAR\data8\100688801\Project Data\ArcGIS\MXD\Environmental_Figures\2018-01 - FOIL\Site Location Map.mxd Date: 01/15/2018 User: abakhtin Time: 11:40:48 AM

FIRE DEPARTMENT – CITY OF NEW YORK

Public Records Unit / Tanks Section

9 MetroTech Center
Brooklyn, New York 11201-3857
(718) 999-2441 or 2442

Fuel Tank Special Report Request Form

SECTION A CUSTOMER INFORMATION

Please print the required information below.

Langan - Matt Oleske
Name

300 Kimball Drive, Floor 4, Parsippany
Address

NJ — State
07054 — Zip Code

973-560-4900
Telephone Number

OFFICE USE ONLY

_____
Cashier / Search No.

PRU Staff
Accepted By/Initials:_____

Searched By:_____

Total Amount:_____

Note: Please make sure you complete this form and attach all required documents. Enclose a check or money order made payable to the NYC Fire Department and a stamped self-addressed envelope (with postage). Mail checks or money orders directly to the address and unit listed above. DO NOT MAIL CASH.

SECTION B FUEL TANK REPORT - FEE $10.00 / PER REPORT

12020 Flatlands Avenue — House Number / Street Name
Brooklyn — Borough

Block 4430 Lot 1, Block 4431 Lot 1, Block 4431 Lot 200, Block 4432 Lot 1, Block 4434 Lot 1

- [X] **THE TOTAL AMOUNT AND SIZE OF EXISTING FUEL OIL / HEATING TANKS**
- [X] **THE TOTAL AMOUNT AND SIZE OF REMOVED OR SEALED FUEL OIL / HEATING TANKS**
- [X] **THE TOTAL AMOUNT AND SIZE OF EXISTING BURIED MOTOR VEHICLE TANKS**
- [X] **THE TOTAL AMOUNT AND SIZE OF REMOVED OR SEALED BURIED MOTOR VEHICLE TANKS**
- [X] **MOST RECENT TANK / PIPING TEST RESULTS**
- [X] **HISTORY OF BURIED TANKS LEAKS**

Note: Requests will be responded to within 10 business days.

FIRE DEPARTMENT – CITY OF NEW YORK
Public Records Unit / Fire Records Section
9 MetroTech Center
Brooklyn, New York 11201-3857
(718) 999-2681 or 2682

Violation Special Report Request Form

SECTION A CUSTOMER INFORMATION

Please print the required information below.

OFFICE USE ONLY

_____
Cashier / Search No.

PRU Staff
Accepted By/Initials:_____

Searched By:_____

Total Amount:_____

1/15/2018
Date

Langan - Matt Oleske
Name

300 Kimball Drive, Floor 4
Address

Parsippany, NJ 07054
Borough, State Zip Code

973-560-4900
Telephone Number

Note: Please make sure you complete this form and attach all required documents. Enclose a check or money order made payable to the NYC Fire Department and a stamped self-addressed envelope (with postage). Mail checks or money orders directly to the address and unit listed above. DO NOT MAIL CASH.

SECTION B REQUEST VIOLATION REPORT FEE $10.00 / PER REPORT

Please print the required information below.

12020 Flatlands Avenue
House No Street Name

Brooklyn
Borough

Block 4430 Lot 1, Block 4431 Lot 1, Block 4431 Lot 200, Block 4432 Lot 1, Block 4434 Lot 1

☒ **EXISTING- ALL NOTICES OF VIOLATION AND VIOLATION ORDERS ISSUED BY THE FIRE PREVENTION**

☐ **EXISTING- ALL SUMMONSES**

Note: This search is limited to outstanding Summonses, Notices of Violation and Violation Orders (VOs) that are reported to be related to a specific address. With respect to VOs this search is limited to VOs issued on January 1, 2008 or thereafter. This search does not contain information on VOs issued by fire companies, unless they were forwarded to the Bureau of Fire Prevention. A requested report will only list the violation numbers. After you have received the Report, you can obtain a copy of any record available for an additional fee of $0.25 (cents) / per page by filling out the copy of violation request form.

Note: Requests will be responded to within 10 business days.

THIS DOCUMENT HAS INVISIBLE FLUORESCENT FIBERS - VIEW UNDER BLACK LIGHT

JPMorgan Chase Bank, N.A.
Syracuse, NY

009928

50-937
213

CHECK DATE January 15, 2018

LANGAN
ENGINEERING, ENVIRONMENTAL, SURVEYING AND LANDSCAPE ARCHITECTURE, D.P.C.
300 Kimball Drive, Parsippany, NJ 07054
Tel: 973.560.4900

PAY Seventy and 00/100 Dollars

AMOUNT 70.00

TO NY City Fire Department

MP

Michael A Sansone

MP

⑈009928⑈ ⑆021309379⑆ 527586338⑈

MICRO-PRINT SIGNATURE LINE (MAGNIFY TO VIEW)

LANGAN ENGINEERING, ENVIRONMENTAL, SURVEYING & LANDSCAPE ARCHITECTURE, D.P.C. 009928

Check Date: 1/15/2018

Invoice Number	Date	Voucher	Amount	Discounts	Previous Pay	Net Amount
5216 - CCC	1/15/2018	0632924	70.00			70.00
NY City Fire Department		TOTAL	70.00			70.00
DPC (PAR) CDA - JP	3	02192				

Allyson Kritzer

From: Allyson Kritzer
Sent: Monday, January 15, 2018 1:25 PM
To: recordsaccess@health.nyc.gov
Cc: Matthew Oleske
Subject: FOIL Request - 12020 Flatlands Avenue Brooklyn NY
Attachments: NYC DOHMH.pdf

Good Afternoon,

Please find the attached FOIL request, on behalf of Matthew Oleske

Thanks in advance for your quick response!

Regards,
Allyson Kritzer

Allyson Kritzer
Staff Engineer
Direct: 973.560.4289
Mobile: 201.755.6973
File Sharing Link

LANGAN
Phone: 973.560.4900 Fax: 973.560.4901
300 Kimball Drive, 4th Floor
Parsippany, NJ 07054-2172
www.langan.com

NEW JERSEY NEW YORK CONNECTICUT PENNSYLVANIA WASHINGTON, DC
VIRGINIA WEST VIRGINIA OHIO FLORIDA TEXAS ARIZONA CALIFORNIA
ABU DHABI ATHENS DOHA DUBAI ISTANBUL LONDON PANAMA

Langan's goal is to be SAFE (Stay Accident Free Everyday)

LANGAN

Technical Excellence
Practical Experience
Client Responsiveness

15 January 2018

Via Email (recordsaccess@health.nyc.gov)

Rene Bryant
Records Access Officer
Department of Health and Mental Hygiene
Gotham Center
42-09 28th St., Floor 14th, CN31
Long Island City, NY 11101

Re: Request for Review of Information
12020 Flatlands Avenue
Brooklyn, New York
Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and,
Block 4434, Lot 1
Langan Project No.: 100688801

Dear Ms. Bryant:

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property. Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, ground water sampling, asbestos abatement, radon, hazardous materials, and any other documents that your department may have regarding the above-referenced property.


The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

If possible, please email (moleske@langan.com) or fax a response to (973) 560-4901 and/or send a hard-copy response to my attention. Please contact me at (973) 560-4273 if there are any questions regarding this request. Thank you in advance for your assistance.

Sincerely,
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.

Matthew Oleske
Senior Staff Engineer

Enclosure(s): Site Location Map
\\langan.com\data\PAR\data8\100688801\Project Data\Correspondence\FOILs\NYC DOHMH.docx

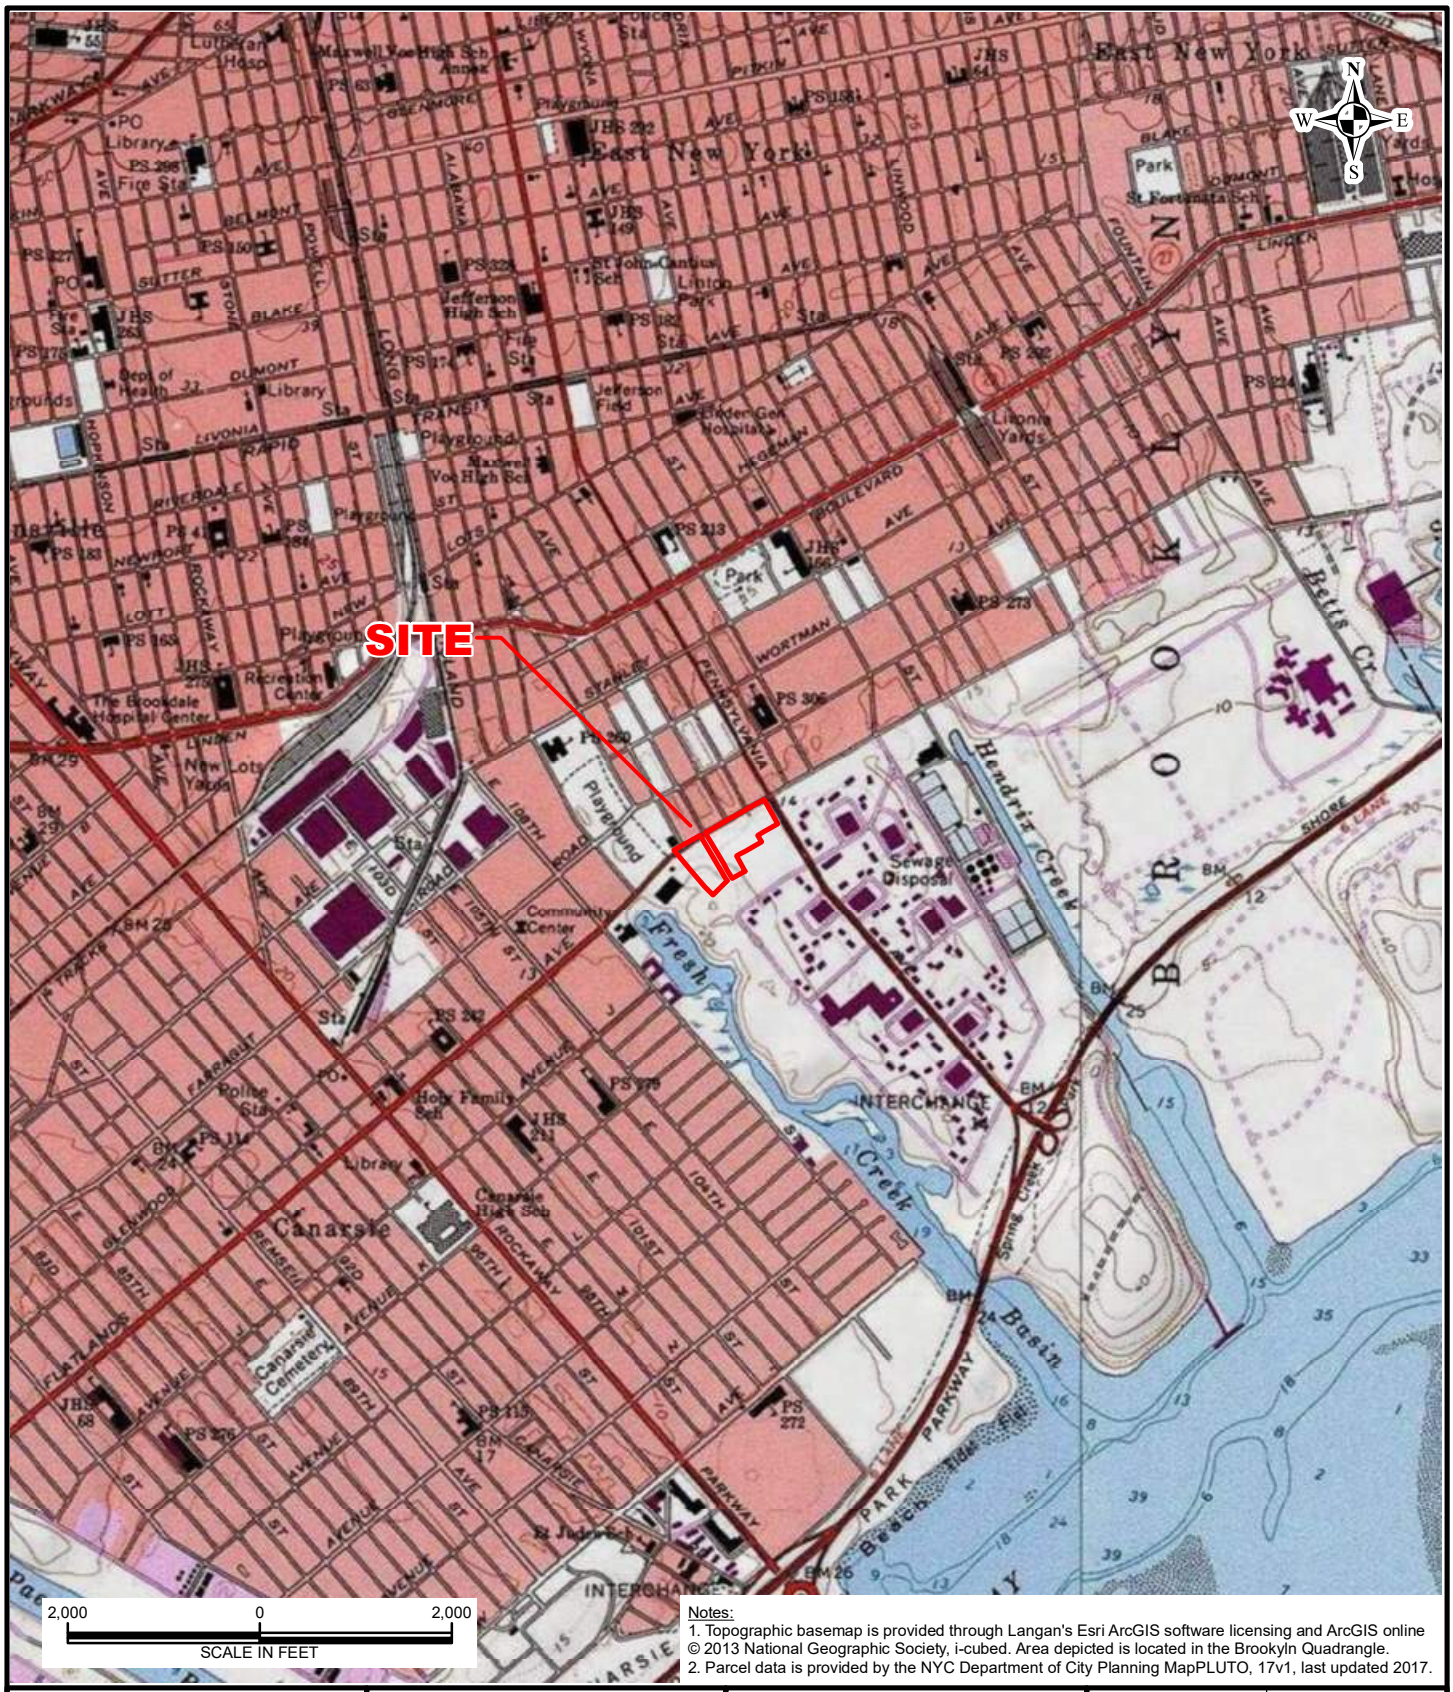

Notes:
1. Topographic basemap is provided through Langan's Esri ArcGIS software licensing and ArcGIS online © 2013 National Geographic Society, i-cubed. Area depicted is located in the Brookyln Quadrangle.
2. Parcel data is provided by the NYC Department of City Planning MapPLUTO, 17v1, last updated 2017.

LANGAN
300 Kimball Drive
Parsippany, NJ 07054
T: 973.560.4900 F: 973.560.4901 www.langan.com

Langan Engineering & Environmental Services, Inc.
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
Langan International LLC
Collectively known as Langan

NJ CERTIFICATE OF AUTHORIZATION No. 24GA27996400

Project
12020 FLATLANDS AVENUE
BLOCK No. 4430, LOT No. 1
BLOCK No. 4431, LOT No. 1, 200
BLOCK No. 4432, LOT No. 1
BLOCK No. 4434, LOT No. 1
BROOKLYN
KINGS COUNTY NEW YORK

Drawing Title
SITE LOCATION MAP

Project No.	100688801
Date	01/15/2018
Scale	1 " = 2,000 '
Drawn By	AB
Last Revised	01/15/2018
Figure	1

© 2018 Langan

Path: \\langan.com\data\PAR\data8\100688801\Project Data\ArcGIS\MXD\Environmental_Figures\2018-01 - FOIL\Site Location Map.mxd Date: 01/15/2018 User: abakhtin Time: 11:40:48 AM

Home

Customer Services
- Pay Online
- Ways to Pay Your Bill
- eBilling
- Account Information
- Customer Assistance
- Service Line Protection Program
- Water Rates
- Property Managers & Trade Professionals

Water Utilities
- Drinking Water
- Wastewater
- Stormwater
- Harbor Water
- Long Term Control Plan

The Watershed
- Watershed Protection
- Watershed Recreation

Citywide Initiatives
- Environmental Education
- Conservation Programs
- Air Pollution Control
- Noise Codes & Complaints

Business and Professionals
- Forms & Permits
- Support for Businesses
- Doing Business with DEP
- Asbestos Abatement
- Construction, Demolition & Abatement

About DEP
- Inside DEP
- News
- Capital Projects
- Careers at DEP
- Environmental Reviews
- Interagency MOUs
- A to Z Index
- Contact Us

Application for Records Under FOIL

FOIL Request Form

Please complete the form below. If responsive records are located, you will be notified and informed of the required payment. Advance payment is required in check or money order payable to the NYC DEP at a cost of $.25 per page, or actual cost of reproduction before documents will be released. Before you submit the request, please save a copy of your completed request for your records.

Please read this before submitting a FOIL Request

- DEP FOIL Frequently Requested Records

Check one: Under Article 6 of the New York State Public Officers Law ("FOIL"), I hereby apply to:

(●) Inspect copies; or
( ) Receive copies of the following records.

Check one: Is this FOIL request the subject of ongoing litigation against New York City?

( ) Yes
(●) No

Specify/Describe the records you are requesting in detail. Include any relevant location, address, permit #, complaint #, court index #, incident date, etc. If applicable, please submit separate requests for multiple locations, account #'s or incidents.

Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, groundwater sampling, radon, hazardous materials and any other documents that your department may have regarding the property at 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431,Lot 1 and Lot 200; Block 4432, Lot 1; Block 4434, Lot 1)

Location: (If possible, list full street address, including borough)

12020 Flatlands Avenue Brooklyn NY

Time frame/Date of Records:

All

Requestor's Name:

Matthew Oleske

Email:

moleske@langan.com

Organization/Firm:

Langan

Phone:

973-560-4273

My DEP Account and Online Bill Pay

New Payment Options
Water Charges

Reservoir Levels
Current: 74.4%
Normal: 86.3%

Customer Assistance
- Contact Customer Service
- NYC Lien Sale & Payment Agreements
- Multi-Family Conservation Program
- Dispute Resolution
- Learn About AMR
- Dispose of Grease & Oil Properly
- For Businesses
- More Services…

Address:
300 Kimball Drive, Floor 4

Address Line 2 (optional):
Parsippany NJ 07054

Date:
1/15/2018

Please enter the letters you see in the graphic below (required),
or click the listen button to the right to hear the audio alternative:



Kumala Jacquard

Privacy & Terms

Submit

Copyright 2018 The City of New York

Allyson Kritzer

From: Allyson Kritzer
Sent: Monday, January 15, 2018 1:30 PM
To: foil@health.ny.gov
Cc: Matthew Oleske
Subject: RE: FOIL Request - 12020 Flatlands Avenue Brooklyn NY
Attachments: NYS DOH.pdf

Apologies, the attachments in the document did not attach properly. Please find the updated version attached to this email.

Regards,
Allyson Kritzer

Allyson Kritzer
Staff Engineer
Direct: 973.560.4289
Mobile: 201.755.6973
File Sharing Link

LANGAN
www.langan.com

NEW JERSEY NEW YORK CONNECTICUT PENNSYLVANIA WASHINGTON, DC
VIRGINIA WEST VIRGINIA OHIO FLORIDA TEXAS ARIZONA CALIFORNIA
ABU DHABI ATHENS DOHA DUBAI ISTANBUL LONDON PANAMA

Langan's goal is to be SAFE (Stay Accident Free Everyday)

From: Allyson Kritzer
Sent: Monday, January 15, 2018 1:25 PM
To: foil@health.ny.gov
Cc: Matthew Oleske
Subject: FOIL Request - 12020 Flatlands Avenue Brooklyn NY

Good Afternoon,

Please find the attached FOIL request, on behalf of Matthew Oleske

Thanks in advance for your quick response!

Regards,
Allyson Kritzer

Allyson Kritzer
Staff Engineer
Direct: 973.560.4289
Mobile: 201.755.6973
File Sharing Link

LANGAN
Phone: 973.560.4900 Fax: 973.560.4901
300 Kimball Drive, 4th Floor
Parsippany, NJ 07054-2172
www.langan.com

NEW JERSEY NEW YORK CONNECTICUT PENNSYLVANIA WASHINGTON, DC
VIRGINIA WEST VIRGINIA OHIO FLORIDA TEXAS ARIZONA CALIFORNIA
ABU DHABI ATHENS DOHA DUBAI ISTANBUL LONDON PANAMA

Langan's goal is to be SAFE (Stay Accident Free Everyday)

LANGAN

Technical Excellence
Practical Experience
Client Responsiveness

15 January 2018

Via Email (foil@health.ny.gov)

Records Access Office
New York State Department of Health
Corning Tower, Room 2364
Albany, New York 12237-0044

Re: Request for Review of Information
12020 Flatlands Avenue
Brooklyn, New York
Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and,
Block 4434, Lot 1
Langan Project No.: 100688801

To Whom It May Concern,

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property. Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, ground water sampling, asbestos abatement, radon, hazardous materials, and any other documents that your department may have regarding the above-referenced property.


The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at this time, the site is currently occupied by the two-story Christian Cultural Center building constructed in 1997, and surrounding parking lot at street level. Block 4434, Lot 1 remains an undeveloped vacant lot. Based on records maintained online by the City Planning Commission, the subject property is zoned for residential use (R5). According to the New York City Depart of Finance (NYC DOF), the site is currently owned by Christian Cultural Center Inc.

If possible, please email (moleske@langan.com) or fax a response to (973) 560-4901 and/or send a hard-copy response to my attention. Please contact me at (973) 560-4574 if there are any questions regarding this request. Thank you in advance for your assistance.

Sincerely,
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.

Matthew Oleske
Senior Staff Engineer

Enclosure(s): Site Location Map, FOIL Request Form
\\langan.com\data\PAR\data8\100688801\Project Data\Correspondence\FOILs\NYS DOH.docx

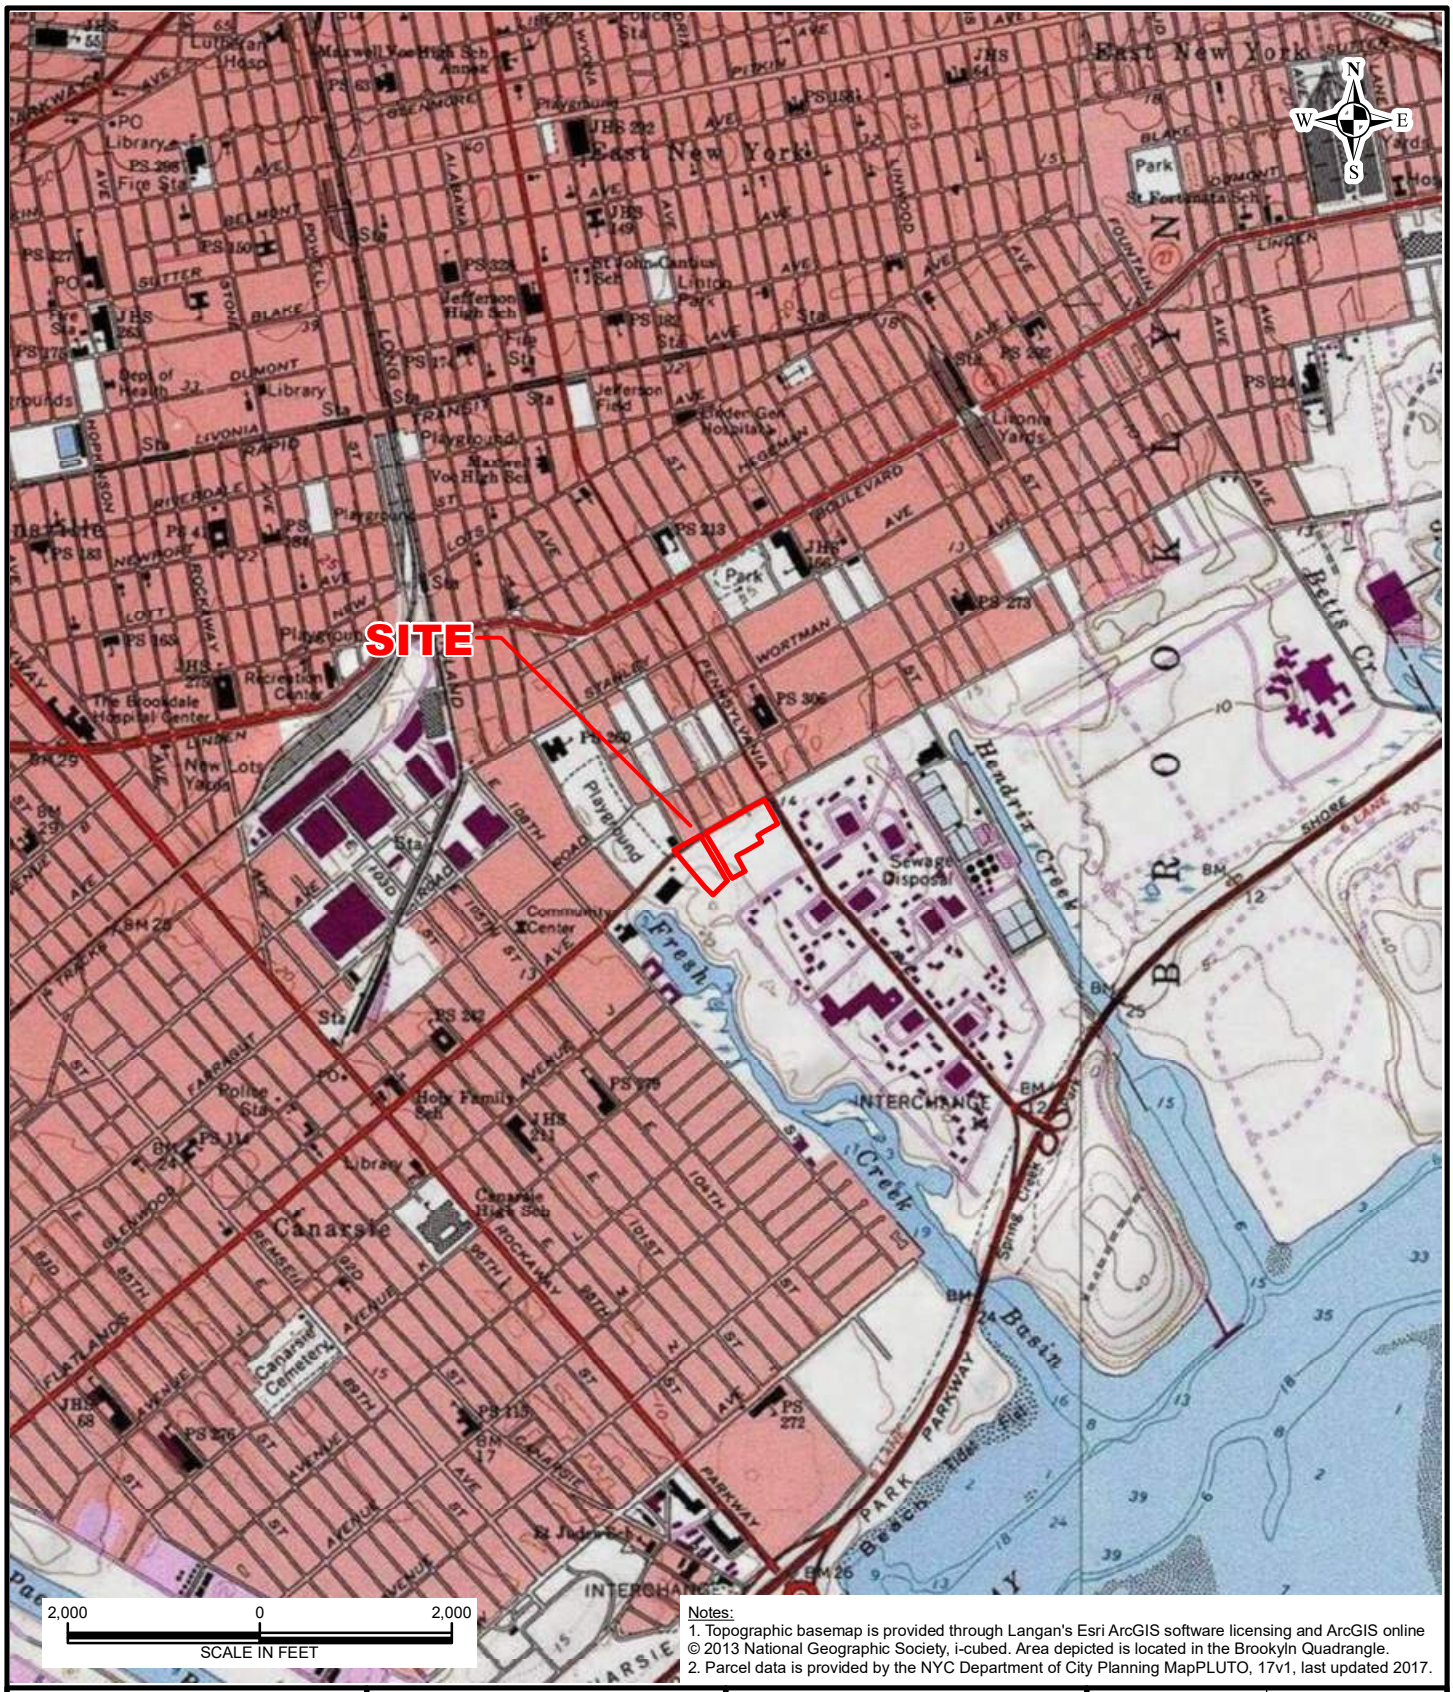

Notes:
1. Topographic basemap is provided through Langan's Esri ArcGIS software licensing and ArcGIS online © 2013 National Geographic Society, i-cubed. Area depicted is located in the Brookyln Quadrangle.
2. Parcel data is provided by the NYC Department of City Planning MapPLUTO, 17v1, last updated 2017.

LANGAN
300 Kimball Drive
Parsippany, NJ 07054
T: 973.560.4900 F: 973.560.4901 www.langan.com

Langan Engineering & Environmental Services, Inc.
Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C.
Langan International LLC
Collectively known as Langan

NJ CERTIFICATE OF AUTHORIZATION No. 24GA27996400

Project
12020 FLATLANDS AVENUE
BLOCK No. 4430, LOT No. 1
BLOCK No. 4431, LOT No. 1, 200
BLOCK No. 4432, LOT No. 1
BLOCK No. 4434, LOT No. 1
BROOKLYN
KINGS COUNTY NEW YORK

Drawing Title
SITE LOCATION MAP

Project No.	100688801
Date	01/15/2018
Scale	1 " = 2,000 '
Drawn By	AB
Last Revised	01/15/2018
Figure	1

© 2018 Langan

Path: \\langan.com\data\PAR\data8\100688801\Project Data\ArcGIS\MXD\Environmental_Figures\2018-01 - FOIL\Site Location Map.mxd Date: 01/15/2018 User: abakhtin Time: 11:40:48 AM

STATE OF NEW YORK
DEPARTMENT OF HEALTH

2364 Corning Tower Governor Nelson A. Rockefeller Empire State Plaza Albany, New York 12237

1. TO THE NEW YORK STATE DEPARTMENT OF HEALTH:

I hereby apply to **Inspect** □ or **Receive Copies** ☒ of the following records (use additional sheets as needed and attach)

Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, groundwater sampling, asbestos abatement, radon, hazardous materials and any other documents that your department may have regarding 12020 Flatlands Avenue Brooklyn NY (Block 4430, Lot 1; Block 4431, Lots 1 and 200; Block 4432, Lot 1; and, Block 4434, Lot 1)

NAME: Matthew Oleske PHONE: 973-560-4273 EMAIL: moleske@langan.com

FIRM: Langan

ADDRESS: 300 Kimball Drive, Floor 4, Parsippany NJ 07054

SIGNATURE: Matthew L. Oleske DATE: 1-15-2018

2. TO THE APPLICANT:

-Records Provided

☐ The reproduction costs for the records are $_____. Please forward a check payable to the New York State Department of Health to the address listed above. If we do not receive your payment within **60** days, we will assume that you no longer wish to receive the materials, and they will be sent back to the originating unit. Accordingly, any future requests for information will require an initial deposit before processing.

☐ Records have been (partially, fully) provided. (If not fully provided, date when records are expected to be fully provided:_____).

-Records Not Available

☐ Records cannot be found after a diligent search.

☐ The Department does not maintain records indicated, please contact:_____

-Records Denied or Redacted

I hereby certify that access to the records—or part of the records—have been denied to the applicant for the reason(s) checked below (You may appeal this denial of access in writing within 30 days to the Records Access Appeals Officer, Empire State Plaza, 1455 Corning Tower, Albany New York 12237):

☐ Specifically exempt by other statute(s).

☐ Unwarranted invasion of personal privacy.

☐ Would impair present or imminent contract awards or collective bargaining negotiations.

☐ Are examination questions or answers.
Are inter-agency or intra-agency materials that are not: -statistical or factual tabulations or data
-instructions to staff that affect the public
-final agency policy or determinations; or
-external audits, including but not limited to audits performed by the comptroller and the federal government.

☐ Are trade secrets.

☐ Could, if disclosed endanger the life of any person.

☐ Are compiled for law enforcement purposes and which, if disclosed would:
-interfere with law enforcement investigations or judicial proceedings
-deprive a person of the right to a fair trial or impartial adjudication
-identify a confidential source or disclose confidential information relating to a criminal investigation, or
-reveal criminal investigative techniques and procedures

☐ Would jeopardize an agency's capacity to guarantee the security of its information technology assets, such assets encompassing both electronic information systems and infrastructures.

Department Representative_____ Date:_____

Menu

FOIL Request Main Page (SupportHome.aspx)

I want to...

Contact E-Mail: akritzer@langan.com

Type of Record(s) Requested:* Other

Description of Record(s) Requested:*

Please consider this a formal Freedom of Information Law (FOIL) request for records regarding buildings, construction, chemical spills, underground storage tanks (USTs), monitoring wells, groundwater sampling, asbestos abatement, radon, hazardous materials and any other

NYSDEC Office processing the Request:*

- Central Office (Albany) Covers the entire state
- Region 1: (Long Island) Covers the counties of: Nassau and Suffolk
- Region 2: (New York City) Covers the counties of: Brooklyn, Bronx, Manhattan, Queens and Staten Island
- Region 3: (Lower Hudson Valley) Covers the counties of: Dutchess, Orange, Putnam, Rockland, Sullivan, Ulster and Westchester
- Region 4: (Capital Region/Northern Catskills) Covers the counties of: Albany, Columbia, Delaware, Greene,

Montgomery, Otsego, Rensselaer, Schenectady and Schoharie

Region 5: (Eastern Adirondacks/Lake Champlain) Covers the counties of: Clinton, Essex, Franklin, Fulton, Hamilton, Saratoga, Warren and Washington

Region 6: (Western Adirondacks/Eastern Lake Ontario) Covers the counties of: Herkimer, Jefferson, Lewis, Oneida and St. Lawrence

Region 7: (Central New York) Covers the counties of: Broome, Cayuga, Chenango, Cortland, Madison, Onondaga, Oswego, Tioga and Tompkins

Region 8: (Western Finger Lakes) Covers the counties of: Chemung, Genesee, Livingston, Monroe, Ontario, Orleans, Schuyler, Seneca, Steuben, Wayne and Yates

Region 9: (Western New York) Covers the counties of: Allegany, Chautauqua, Cattaraugus, Erie, Niagara and Wyoming counties

If your request pertains to just one Region, select that Region. If your request pertains to more than one Region, select Central Office. If you're unsure which Region your request pertains to, select Central Office. The Department will route your request to the appropriate Region(s)

Preferred Method to Receive Records:*

Electronic copies

Pick-up Copies

Inspect in Office

- [ ] Copies by Fax
- [ ] Express Mail (UPS)
- [ ] Regular Surface Mail (USPS)

NYSDEC will use its best efforts to provide records via the method you select. However, in some cases a particular delivery method is not feasible. In such cases NYSDEC will deliver the records via an alternative method

Please note not all public documents are available in electronic format. If the document(s) requested are not available electronically, we will make them available for inspection or by paper copy in accordance with the Public Records Law.

Note: The maximum total file size per attachment is 80MB.

Attach a File: Site Location Map.pdf Remove

Submit Cancel

Powered by GovQA

Project Screening Request Form

The New York Natural Heritage Program will review locations of proposed projects, activities, and SEQR-subject actions for any records of rare species or significant natural communities in our database. We will report records which are in the vicinity of the location and for which impacts from the project or action may need to be assessed.

To request a review of a specific project site, please complete and submit this form.
We recommend that you submit a map of your project site as a .pdf file as part of this form.
If you do not have a map in .pdf format, you must provide at least two of the following: tax parcel number, latitude/longitude, and street address.

Do not use this form if your project
• is more than 1000 acres in size
• is a linear project such as a transmission line or pipeline more than 2 miles in length
• is a wind farm project of more than two turbines
• includes parts of three or more counties.
For these types of projects, please send a request and map or GIS file of your project site directly to the New York Natural Heritage Program.

If you have any questions or need further information, please contact the New York Natural Heritage Program at NatualHeritage@dec.ny.gov.

Required fields are indicated with *.

Company, Organization, or Agency
Langan

Requestor Name *
Matthew Oleske

Requestor Address (Street/PO Box) *
300 Kimball Drive, Floor 4

Requestor City *
Parsippany

Requestor State * New Jersey

Requestor Zip Code *
07054

Requestor Telephone # *

973-560-4273

Requestor Email *

moleske@langan.com

Project Type Project Type *

religious facility/building

Project Name *

Christian Cultural Center

Project Applicant

If your company, organization, or agency is not the project sponsor or applicant, and you are submitting this request on behalf of the project applicant (e.g., a consulting firm submitting on behalf of a client), you may enter the name of the project applicant here.

Project County

Albany
Allegany
Bronx
Broome

Use Ctrl to select more than one county and/or more than one town that appears in the dropdown boxes below.

Town (Kings County)

City Of New York|City Of New York

Project Summary *

Langan Engineering, Environmental, Surveying and Landscape Architecture, D.P.C. (Langan) is currently conducting a Phase I Environmental Assessment of the above-referenced property. As part of the assessment, we are requesting a general records search for the above-referenced property.

Briefly describe the proposed project or activity, including why you need information (e.g., SEQR review, environmental assessment for permit, planning board approval, management plan). If the proposed action is undergoing SEQR review, also include the name of the lead agency. Example: "A 25 unit residential single-family housing development is proposed for an 150-acre parcel. The development will occupy 100 acres; the remaining 50 acres will be left undisturbed. We have been contracted to review the environmental impacts of the project and prepare the Environmental Assessment Form under SEQR, to be reviewed by the Town of Red Hook acting as Lead Agency. In order to complete the EAF, we will need to know whether the proposed project would likely impact any ecologically significant areas or rare species of plants or animals."

Current Land Use

The property is bordered by Flatlands Avenue to the north, Pennsylvania Avenue to the east, an active construction site to the south, and Louisiana Avenue to the west on the land parcels identified by the above New York City tax map lot numbers. According to the information we have available at

Briefly describe the current land use and habitats at the project site (e.g., wooded, agricultural, developed commercial). Example: "The site is currently undeveloped, and mostly wooded with some former agricultural fields."

PDF Map Browse...

Please attach one or two maps of your project site as .pdf files. The map should include names of nearby roads and other landmarks, and the boundary of the proposed project site should be clearly labeled, marked or highlighted. You may submit more than one map if they show the project site at different scales or with different backgrounds. Please do not send architectural

or engineering drawings or photographs. If you are not submitting a map, you must complete at least two of the following: Tax parcel number, Latitude/Longitude, and Street Address of Project Site.

PDF Map 2 Browse...
Same directions as above.

Tax parcel number
If you are submitting a map, this field is optional.

Latitude If you are submitting a map, this field is optional.

Longitude If you are submitting a map, this field is optional.

Street Address of Project
If you are submitting a map, this field is optional.

Project Notes
Any other information regarding this request not addressed in the previous fields.

Submit Form to NYNHP

© 2004-2017 New York Natural Heritage Program. Questions, Comments, Queries.

IPaC Information for Planning and Consultation **U.S. Fish & Wildlife Service**

IPaC resource list

This report is an automatically generated list of species and other resources such as critical habitat (collectively referred to as *trust resources*) under the U.S. Fish and Wildlife Service's (USFWS) jurisdiction that are known or expected to be on or near the project area referenced below. The list may also include trust resources that occur outside of the project area, but that could potentially be directly or indirectly affected by activities in the project area. However, determining the likelihood and extent of effects a project may have on trust resources typically requires gathering additional site-specific (e.g., vegetation/species surveys) and project-specific (e.g., magnitude and timing of proposed activities) information.

Below is a summary of the project information you provided and contact information for the USFWS office(s) with jurisdiction in the defined project area. Please read the introduction to each section that follows (Endangered Species, Migratory Birds, USFWS Facilities, and NWI Wetlands) for additional information applicable to the trust resources addressed in that section.

NOT FOR CONSULTATION

Location

Kings County, New York



Local office

Long Island Ecological Services Field Office

(631) 286-0485
(631) 286-4003

340 Smith Road
Shirley, NY 11967

Endangered species

This resource list is for informational purposes only and does not constitute an analysis of project level impacts.

The primary information used to generate this list is the known or expected range of each species. Additional areas of influence (AOI) for species are also considered. An AOI includes areas outside of the species range if the species could be indirectly affected by activities in that area (e.g., placing a dam upstream of a fish population, even if that fish does not occur at the dam site, may indirectly impact the species by reducing or eliminating water flow downstream). Because species can move, and site conditions can change, the species on this list are not guaranteed to be found on or near the project area. To fully determine any potential effects to species, additional site-specific and project-specific information is often required.

Section 7 of the Endangered Species Act **requires** Federal agencies to "request of the Secretary information whether any species which is listed or proposed to be listed may be present in the area of such proposed action" for any project that is conducted, permitted, funded, or licensed by any Federal agency. A letter from the local office and a species list which fulfills this requirement can **only** be obtained by requesting an official species list from either the Regulatory Review section in IPaC (see directions below) or from the local field office directly.

For project evaluations that require USFWS concurrence/review, please return to the IPaC website and request an official species list by doing the following:

1. Draw the project location and click CONTINUE.
2. Click DEFINE PROJECT.
3. Log in (if directed to do so).
4. Provide a name and description for your project.
5. Click REQUEST SPECIES LIST.

Listed species

[1] are managed by the Ecological Services Program of the U.S. Fish and Wildlife Service.

1. Species listed under the Endangered Species Act are threatened or endangered; IPaC also shows species that are candidates, or proposed, for listing. See the listing status page for more information.

NOT FOR CONSULTATION

The following species are potentially affected by activities in this location:

Birds

NAME	STATUS
Piping Plover Charadrius melodus There is **final** critical habitat for this species. Your location is outside the critical habitat. https://ecos.fws.gov/ecp/species/6039	Threatened

Red Knot Calidris canutus rufa No critical habitat has been designated for this species. https://ecos.fws.gov/ecp/species/1864	Threatened
Roseate Tern Sterna dougallii dougallii No critical habitat has been designated for this species. https://ecos.fws.gov/ecp/species/2083	Endangered

Flowering Plants

NAME	STATUS
Seabeach Amaranth Amaranthus pumilus No critical habitat has been designated for this species. https://ecos.fws.gov/ecp/species/8549	Threatened

Critical habitats

Potential effects to critical habitat(s) in this location must be analyzed along with the endangered species themselves.

THERE ARE NO CRITICAL HABITATS AT THIS LOCATION.

NOT FOR CONSULTATION

Migratory birds

Certain birds are protected under the Migratory Bird Treaty Act[1] and the Bald and Golden Eagle Protection Act[2].

Any person or organization who plans or conducts activities that may result in impacts to migratory birds, eagles, and their habitats should follow appropriate regulations and consider implementing appropriate conservation measures, as described below.

1. The Migratory Birds Treaty Act of 1918.
2. The Bald and Golden Eagle Protection Act of 1940.

Additional information can be found using the following links:

- Birds of Conservation Concern http://www.fws.gov/birds/management/managed-species/birds-of-conservation-concern.php
- Measures for avoiding and minimizing impacts to birds http://www.fws.gov/birds/management/project-assessment-tools-and-guidance/conservation-measures.php
- Nationwide conservation measures for birds http://www.fws.gov/migratorybirds/pdf/management/nationwidestandardconservationmeasures.pdf

The birds listed below are birds of particular concern either because they occur on the USFWS Birds of Conservation Concern (BCC) list or warrant special attention in your project location. To learn more about the levels of concern for birds on your list and how this list is generated, see the FAQ below. This is not a list of every bird you may find in this location, nor a guarantee that every bird on this list will be found in your project area. To see maps of where birders and the general public have sighted birds in and around your project area, visit E-bird tools such as the E-bird data mapping tool (search for the name of a bird on your list to see specific locations where that bird has been reported to occur within your project area over a certain timeframe) and the E-bird Explore Data Tool (perform a query to see a list of all birds sighted in your county or region and within a certain timeframe). For projects that occur off the Atlantic Coast, additional maps and models detailing the relative occurrence and abundance of bird species on your list are available. Links to additional information about Atlantic Coast birds, and other important information about your migratory bird list can be found below.

For guidance on when to schedule activities or implement avoidance and minimization measures to reduce impacts to migratory birds on your list, click on the PROBABILITY OF PRESENCE SUMMARY at the top of your list to see when these birds are most likely to be present and breeding in your project area.

NOT FOR CONSULTATION

NAME	BREEDING SEASON (IF A BREEDING SEASON IS INDICATED FOR A BIRD ON YOUR LIST, THE BIRD MAY BREED IN YOUR PROJECT AREA SOMETIME WITHIN THE TIMEFRAME SPECIFIED, WHICH IS A VERY LIBERAL ESTIMATE OF THE DATES INSIDE WHICH THE BIRD BREEDS ACROSS ITS ENTIRE RANGE. "BREEDS ELSEWHERE" INDICATES THAT THE BIRD DOES NOT LIKELY BREED IN YOUR PROJECT AREA.)
American Oystercatcher Haematopus palliatus This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/8935	Breeds Apr 15 to Aug 31
Bald Eagle Haliaeetus leucocephalus This is not a Bird of Conservation Concern (BCC) in this area, but warrants attention because of the Eagle Act or for potential susceptibilities in offshore areas from certain types of development or activities. https://ecos.fws.gov/ecp/species/1626	Breeds Oct 15 to Aug 31
Black Skimmer Rynchops niger This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/5234	Breeds May 20 to Sep 15

Black-billed Cuckoo Coccyzus erythropthalmus — Breeds May 15 to Oct 10
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.
https://ecos.fws.gov/ecp/species/9399

Bobolink Dolichonyx oryzivorus — Breeds May 20 to Jul 31
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.

Buff-breasted Sandpiper Calidris subruficollis — Breeds elsewhere
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.
https://ecos.fws.gov/ecp/species/9488

Cerulean Warbler Dendroica cerulea — Breeds Apr 29 to Jul 20
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.
https://ecos.fws.gov/ecp/species/2974

Clapper Rail Rallus crepitans — Breeds Apr 10 to Oct 31
This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA

Eastern Whip-poor-will Antrostomus vociferus — Breeds May 1 to Aug 20
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.

Evening Grosbeak Coccothraustes vespertinus — Breeds elsewhere
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.

Golden-winged Warbler Vermivora chrysoptera — Breeds May 1 to Jul 20
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.
https://ecos.fws.gov/ecp/species/8745

Gull-billed Tern Gelochelidon nilotica — Breeds May 1 to Jul 31
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.
https://ecos.fws.gov/ecp/species/9501

Hudsonian Godwit Limosa haemastica — Breeds elsewhere
This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.

NOT FOR CONSULTATION

Kentucky Warbler Oporornis formosus This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds Apr 20 to Aug 20
Least Tern Sterna antillarum This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA	Breeds Apr 20 to Sep 10
Lesser Yellowlegs Tringa flavipes This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/9679	Breeds elsewhere
Long-eared Owl asio otus This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/3631	Breeds elsewhere
Nelson's Sparrow Ammodramus nelsoni This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds May 15 to Sep 5
Prairie Warbler Dendroica discolor This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds May 1 to Jul 31
Prothonotary Warbler Protonotaria citrea This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds Apr 1 to Jul 31
Purple Sandpiper Calidris maritima This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds elsewhere
Red-headed Woodpecker Melanerpes erythrocephalus This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds May 10 to Sep 10
Red-throated Loon Gavia stellata This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds elsewhere
Rusty Blackbird Euphagus carolinus This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds elsewhere

NOT FOR CONSULTATION

Seaside Sparrow *Ammodramus maritimus* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds May 10 to Aug 20
Semipalmated Sandpiper *Calidris pusilla* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds elsewhere
Short-billed Dowitcher *Limnodromus griseus* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/9480	Breeds elsewhere
Snowy Owl *Bubo scandiacus* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds elsewhere
Whimbrel *Numenius phaeopus* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/9483	Breeds elsewhere
Willet *Tringa semipalmata* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds Apr 20 to Aug 5
Wood Thrush *Hylocichla mustelina* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.	Breeds May 10 to Aug 31

NOT FOR CONSULTATION

Probability of Presence Summary

The graphs below provide our best understanding of when birds of concern are most likely to be present in your project area. This information can be used to tailor and schedule your project activities to avoid or minimize impacts to birds.

Probability of Presence (■)

Each green bar represents the bird's relative probability of presence in your project's counties during a particular week of the year. (A year is represented as 12 4-week months.) A taller bar indicates a higher probability of species presence. The survey effort (see below) can be used to establish a level of confidence in the presence score. One can have higher confidence in the presence score if the corresponding survey effort is also high.

How is the probability of presence score calculated? The calculation is done in three steps:

1. The probability of presence for each week is calculated as the number of survey events in the week where the species was detected divided by the total number of survey events for that week. For

example, if in week 12 there were 20 survey events and the Spotted Towhee was found in 5 of them, the probability of presence of the Spotted Towhee in week 12 is 0.25.

2. To properly present the pattern of presence across the year, the relative probability of presence is calculated. This is the probability of presence divided by the maximum probability of presence across all weeks. For example, imagine the probability of presence in week 20 for the Spotted Towhee is 0.05, and that the probability of presence at week 12 (0.25) is the maximum of any week of the year. The relative probability of presence on week 12 is 0.25/0.25 = 1; at week 20 it is 0.05/0.25 = 0.2.
3. The relative probability of presence calculated in the previous step undergoes a statistical conversion so that all possible values fall between 0 and 10, inclusive. This is the probability of presence score.

To see a bar's probability of presence score, simply hover your mouse cursor over the bar.

Breeding Season (■)
Yellow bars denote a very liberal estimate of the time-frame inside which the bird breeds across its entire range. If there are no yellow bars shown for a bird, it does not breed in your project area.


Survey Effort (|)
Vertical black lines superimposed on probability of presence bars indicate the number of surveys performed for that species in the counties of your project area. The number of surveys is expressed as a range, for example, 33 to 64 surveys.

To see a bar's survey effort range, simply hover your mouse cursor over the bar.

No Data (–)
A week is marked as having no data if there were no survey events for that week.

Survey Timeframe
Surveys from only the last 10 years are used in order to ensure delivery of currently relevant information.

NOT FOR CONSULTATION

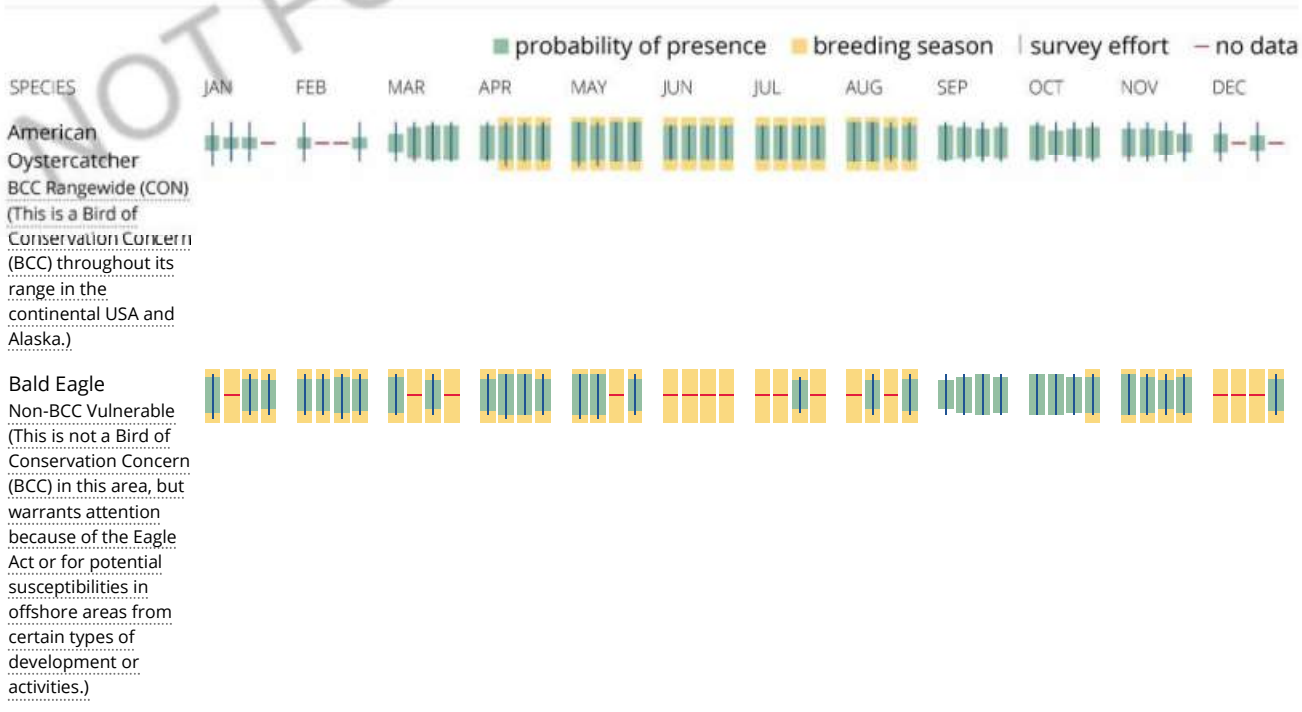



Black Skimmer
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Black-billed Cuckoo
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Bobolink
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)


Buff-breasted Sandpiper
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Cerulean Warbler
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Clapper Rail
BCC - BCR (This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA)

Eastern Whip-poor-will
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

NOT FOR CONSULTATION

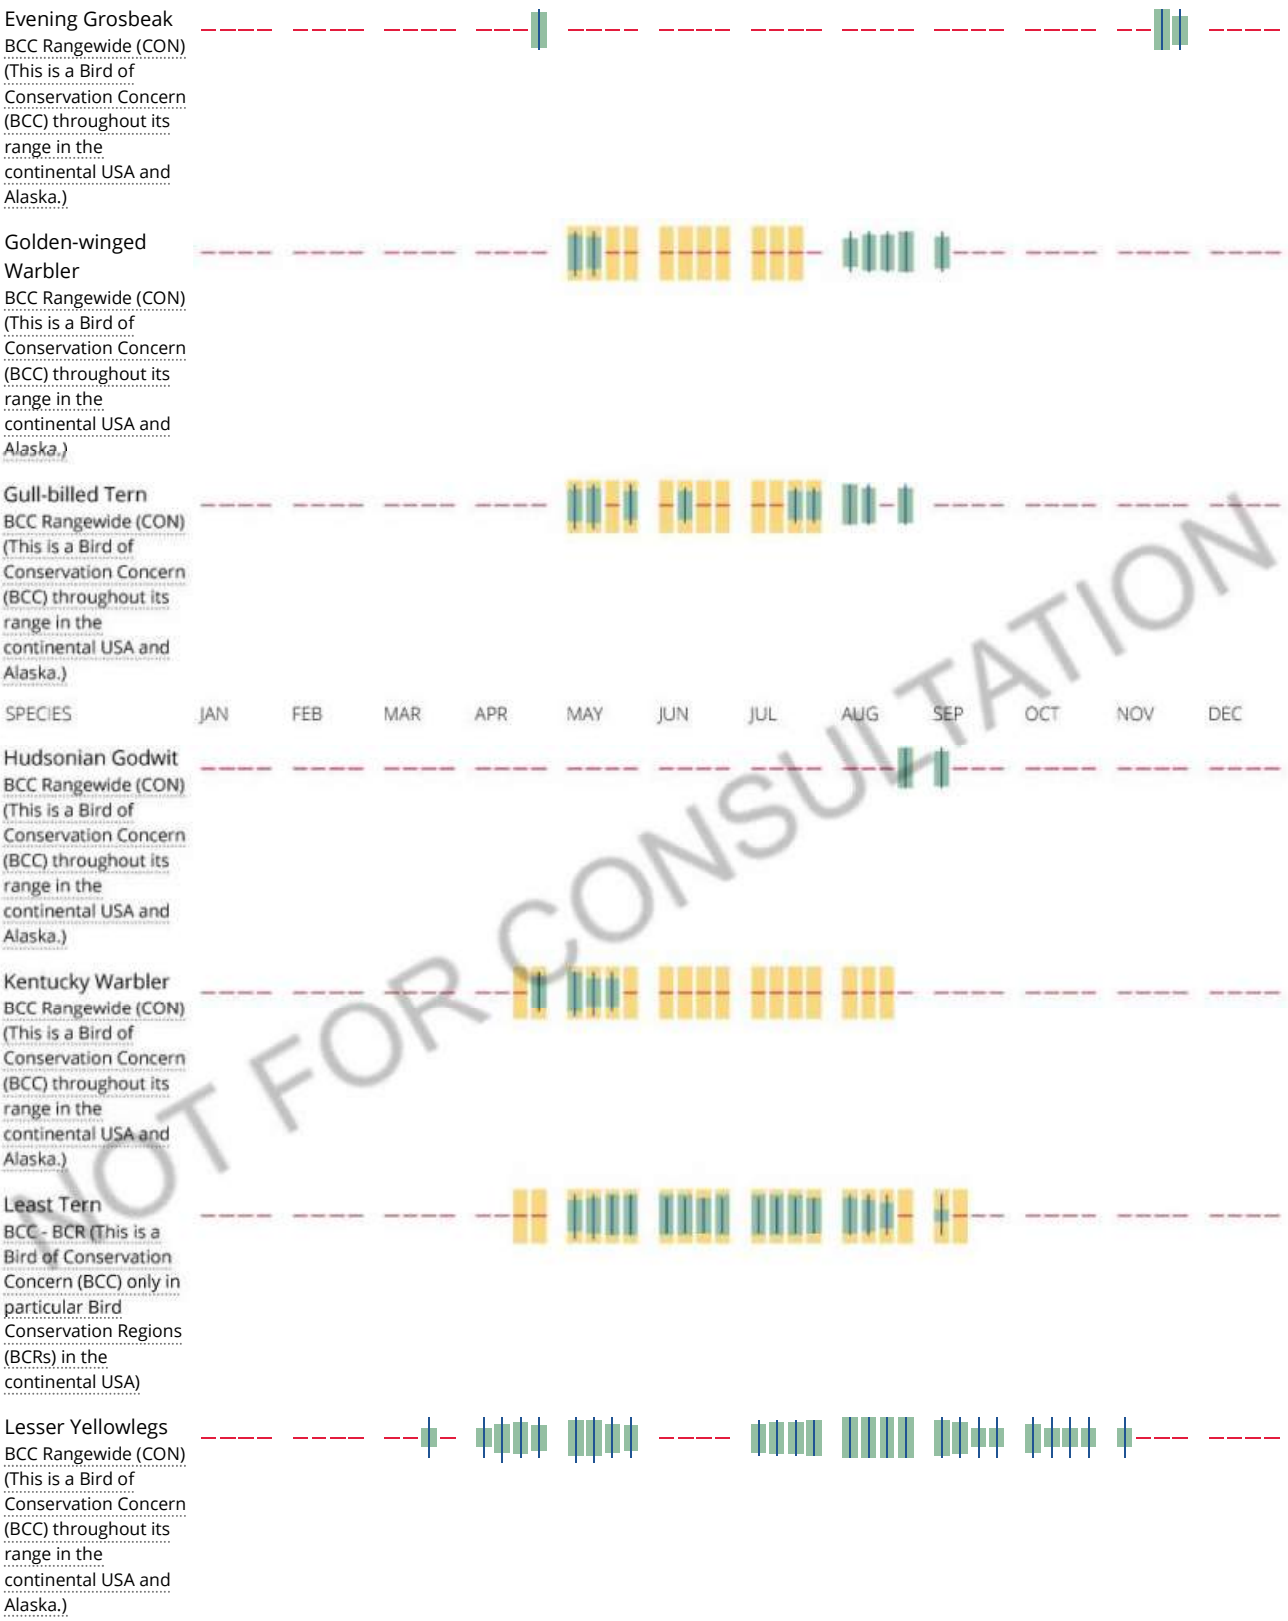

NOT FOR CONSULTATION



Long-eared Owl
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Nelson's Sparrow
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Prairie Warbler
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)


Prothonotary Warbler
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Purple Sandpiper
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

Red-headed Woodpecker
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)


Red-throated Loon
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)

NOT FOR CONSULTATION

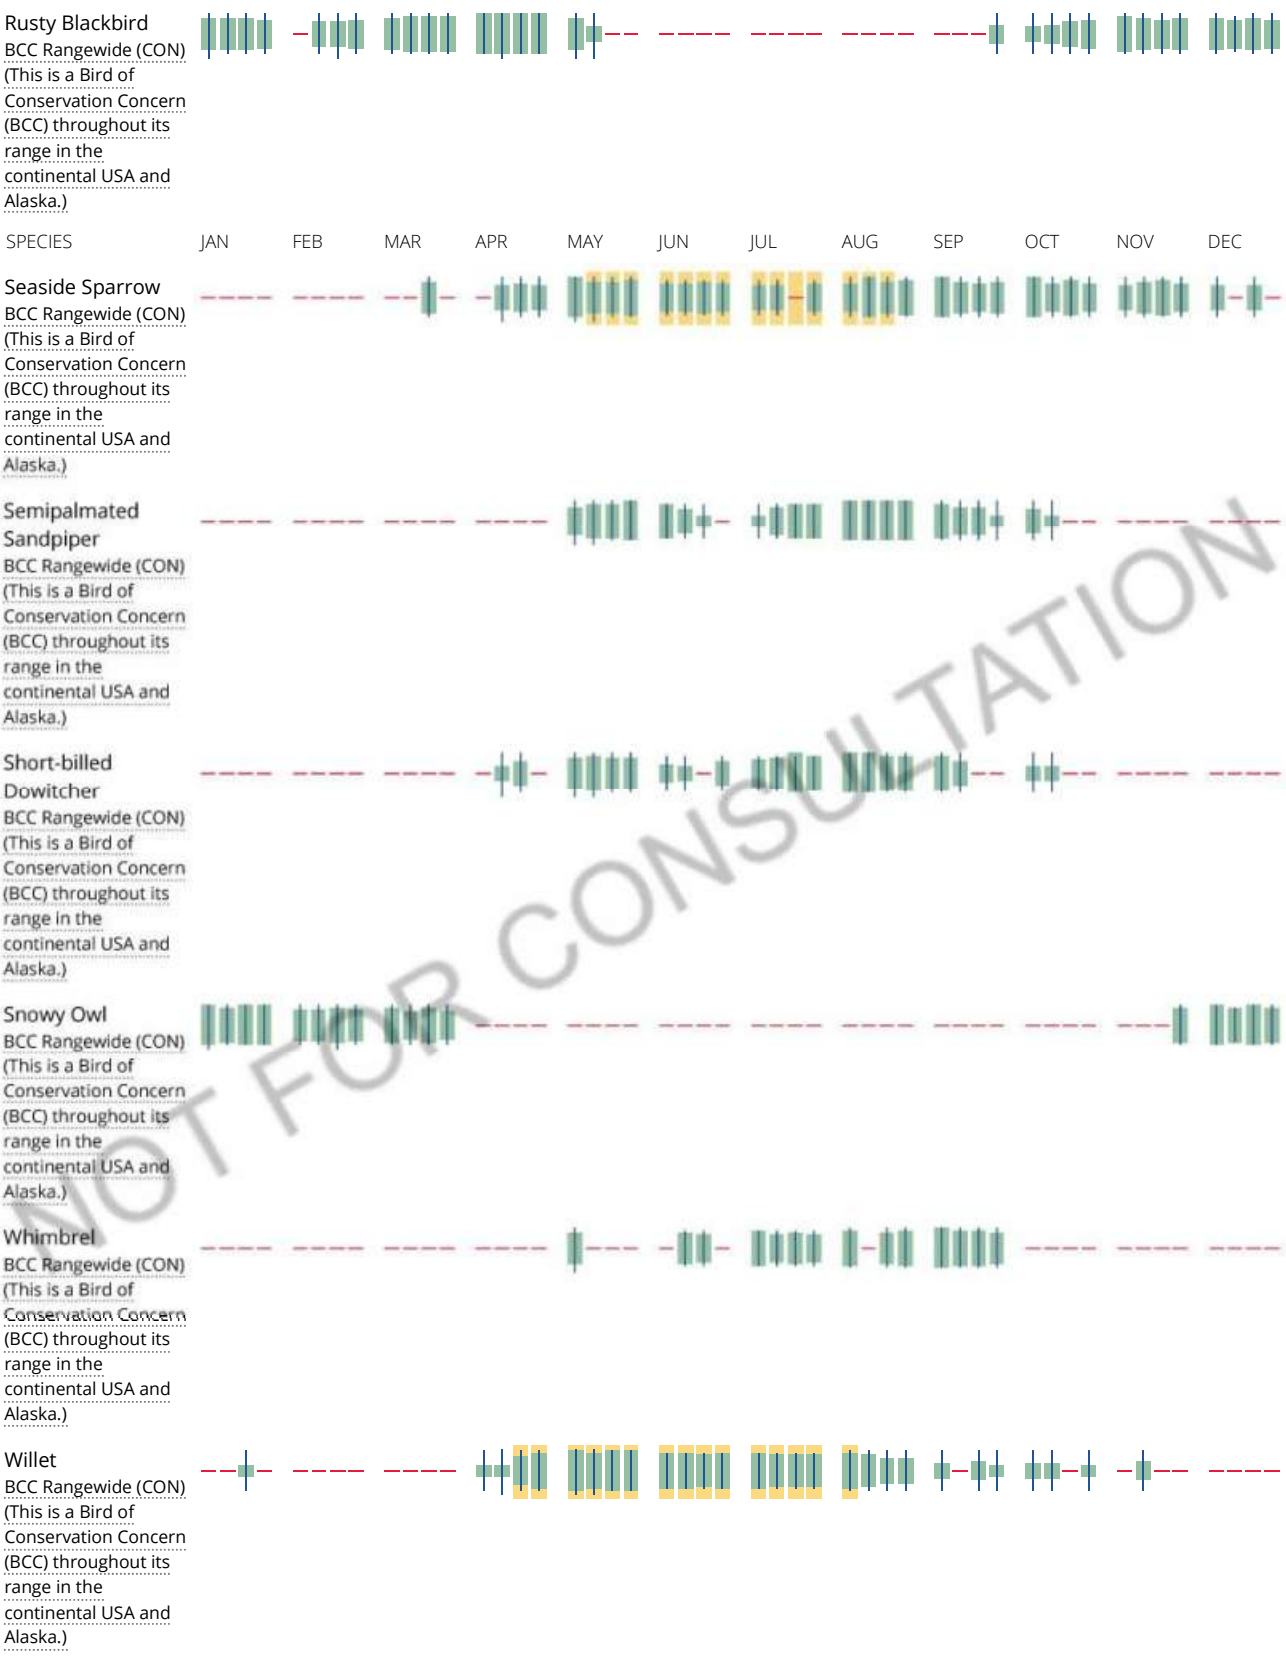

NOT FOR CONSULTATION

Wood Thrush
BCC Rangewide (CON) (This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska.)



Tell me more about conservation measures I can implement to avoid or minimize impacts to migratory birds.

Nationwide Conservation Measures describes measures that can help avoid and minimize impacts to all birds at any location year round. Implementation of these measures is particularly important when birds are most likely to occur in the project area. When birds may be breeding in the area, identifying the locations of any active nests and avoiding their destruction is a very helpful impact minimization measure. To see when birds are most likely to occur and be breeding in your project area, view the Probability of Presence Summary. Additional measures and/or permits may be advisable depending on the type of activity you are conducting and the type of infrastructure or bird species present on your project site.

What does IPaC use to generate the migratory birds potentially occurring in my specified location?

The Migratory Bird Resource List is comprised of USFWS Birds of Conservation Concern (BCC) and other species that may warrant special attention in your project location.

The migratory bird list generated for your project is derived from data provided by the Avian Knowledge Network (AKN). The AKN data is based on a growing collection of survey, banding, and citizen science datasets and is queried and filtered to return a list of those birds reported as occurring in the counties which your project intersects, and that have been identified as warranting special attention because they are a BCC species in that area, an eagle (Eagle Act requirements may apply), or a species that has a particular vulnerability to offshore activities or development.

Again, the Migratory Bird Resource list includes only a subset of birds that may occur in your project area. It is not representative of all birds that may occur in your project area. To get a list of all birds potentially present in your project area, please visit the E-bird Explore Data Tool.

What does IPaC use to generate the probability of presence graphs for the migratory birds potentially occurring in my specified location?

The probability of presence graphs associated with your migratory bird list are based on data provided by the Avian Knowledge Network (AKN). This data is derived from a growing collection of survey, banding, and citizen science datasets .

Probability of presence data is continuously being updated as new and better information becomes available. To learn more about how the probability of presence graphs are produced and how to interpret them, go the Probability of Presence Summary and then click on the "Tell me about these graphs" link.

How do I know if a bird is breeding, wintering, migrating or present year-round in my project area?

To see what part of a particular bird's range your project area falls within (i.e. breeding, wintering, migrating or year-round), you may refer to the following resources: The The Cornell Lab of Ornithology All About Birds Bird Guide, or (if you are unsuccessful in locating the bird of interest there), the Cornell Lab of Ornithology Neotropical Birds guide. If a bird entry on your migratory bird species list indicates a breeding season, it is probable that the bird breeds in your project's counties at some point within the timeframe specified. If "Breeds elsewhere" is indicated, then the bird likely does not breed in your project area.

What are the levels of concern for migratory birds?

Migratory birds delivered through IPaC fall into the following distinct categories of concern:

NOT FOR CONSULTATION

1. "BCC Rangewide" birds are Birds of Conservation Concern (BCC) that are of concern throughout their range anywhere within the USA (including Hawaii, the Pacific Islands, Puerto Rico, and the Virgin Islands);
2. "BCC - BCR" birds are BCCs that are of concern only in particular Bird Conservation Regions (BCRs) in the continental USA; and
3. "Non-BCC - Vulnerable" birds are not BCC species in your project area, but appear on your list either because of the Eagle Act requirements (for eagles) or (for non-eagles) potential susceptibilities in offshore areas from certain types of development or activities (e.g. offshore energy development or longline fishing).

Although it is important to try to avoid and minimize impacts to all birds, efforts should be made, in particular, to avoid and minimize impacts to the birds on this list, especially eagles and BCC species of rangewide concern. For more information on conservation measures you can implement to help avoid and minimize migratory bird impacts and requirements for eagles, please see the FAQs for these topics.

Details about birds that are potentially affected by offshore projects

For additional details about the relative occurrence and abundance of both individual bird species and groups of bird species within your project area off the Atlantic Coast, please visit the Northeast Ocean Data Portal. The Portal also offers data and information about other taxa besides birds that may be helpful to you in your project review. Alternately, you may download the bird model results files underlying the portal maps through the NOAA NCCOS Integrative Statistical Modeling and Predictive Mapping of Marine Bird Distributions and Abundance on the Atlantic Outer Continental Shelf project webpage.

Bird tracking data can also provide additional details about occurrence and habitat use throughout the year, including migration. Models relying on survey data may not include this information. For additional information on marine bird tracking data, see the Diving Bird Study and the nanotag studies or contact Caleb Spiegel or Pam Loring.

What if I have eagles on my list?

If your project has the potential to disturb or kill eagles, you may need to obtain a permit to avoid violating the BGEPA should such impacts occur.

NOT FOR CONSULTATION

Facilities

National Wildlife Refuge lands

Any activity proposed on lands managed by the National Wildlife Refuge system must undergo a 'Compatibility Determination' conducted by the Refuge. Please contact the individual Refuges to discuss any questions or concerns.

THERE ARE NO REFUGE LANDS AT THIS LOCATION.

Fish hatcheries

THERE ARE NO FISH HATCHERIES AT THIS LOCATION.

Wetlands in the National Wetlands Inventory

Impacts to NWI wetlands and other aquatic habitats may be subject to regulation under Section 404 of the Clean Water Act, or other State/Federal statutes.

For more information please contact the Regulatory Program of the local U.S. Army Corps of Engineers District.

THERE ARE NO KNOWN WETLANDS AT THIS LOCATION.

Data limitations

The Service's objective of mapping wetlands and deepwater habitats is to produce reconnaissance level information on the location, type and size of these resources. The maps are prepared from the analysis of high altitude imagery. Wetlands are identified based on vegetation, visible hydrology and geography. A margin of error is inherent in the use of imagery; thus, detailed on-the-ground inspection of any particular site may result in revision of the wetland boundaries or classification established through image analysis.

The accuracy of image interpretation depends on the quality of the imagery, the experience of the image analysts, the amount and quality of the collateral data and the amount of ground truth verification work conducted. Metadata should be consulted to determine the date of the source imagery used and any mapping problems.

Wetlands or other mapped features may have changed since the date of the imagery or field work. There may be occasional differences in polygon boundaries or classifications between the information depicted on the map and the actual conditions on site.

Data exclusions

Certain wetland habitats are excluded from the National mapping program because of the limitations of aerial imagery as the primary data source used to detect wetlands. These habitats include seagrasses or submerged aquatic vegetation that are found in the intertidal and subtidal zones of estuaries and nearshore coastal waters. Some deepwater reef communities (coral or tuberficid worm reefs) have also been excluded from the inventory. These habitats, because of their depth, go undetected by aerial imagery.

Data precautions

Federal, state, and local regulatory agencies with jurisdiction over wetlands may define and describe wetlands in a different manner than that used in this inventory. There is no attempt, in either the design or products of this inventory, to define the limits of proprietary jurisdiction of any Federal, state, or local government or to establish the geographical scope of the regulatory programs of government agencies. Persons intending to engage in activities involving modifications within or adjacent to wetland areas should seek the advice of appropriate federal, state, or local agencies concerning specified agency regulatory programs and proprietary jurisdictions that may affect such activities.

NOT FOR CONSULTATION

APPENDIX G

SITE PHOTOGRAPHS

LANGAN

APPENDIX G
Photographic Log
12020 Flatlands Avenue
Brooklyn, New York



Photo 1: Christian Cultural Center building on subject property, facing east from Louisiana Avenue.



Photo 2: Concrete retaining wall along Louisiana Avenue, approximately 3- to 4-feet above street level, facing east.



Photo 3: Recirculating water feature in southwest portion of subject property, facing south.



Photo 4: Asphalt-paved parking lot south of site building, facing south.



Photo 5: Stormwater drainage grate in the parking lot south of site building, facing east.



Photo 6: Main sanctuary and auditorium.

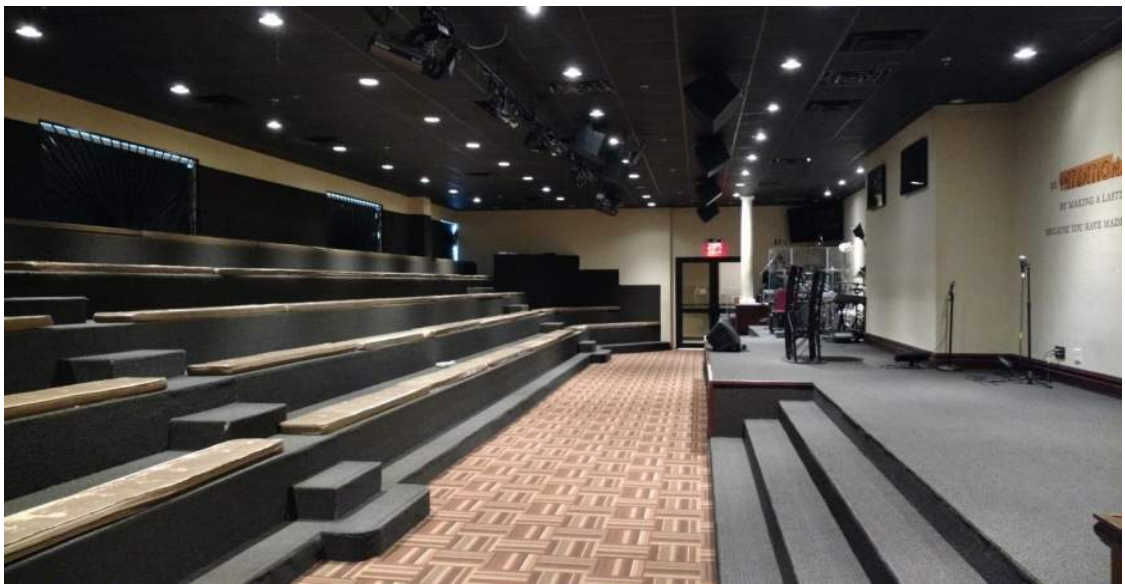


Photo 7: Typical smaller sanctuary room.



Photo 8: Grease trap below kitchen sinks.



Photo 9: Final grease trap prior to discharge to municipal sewer.



Photo 10: Incoming natural gas utility, facing east.



Photo 11: Above-grade hydraulic oil tank and dispenser pump for one of two on-site elevators.

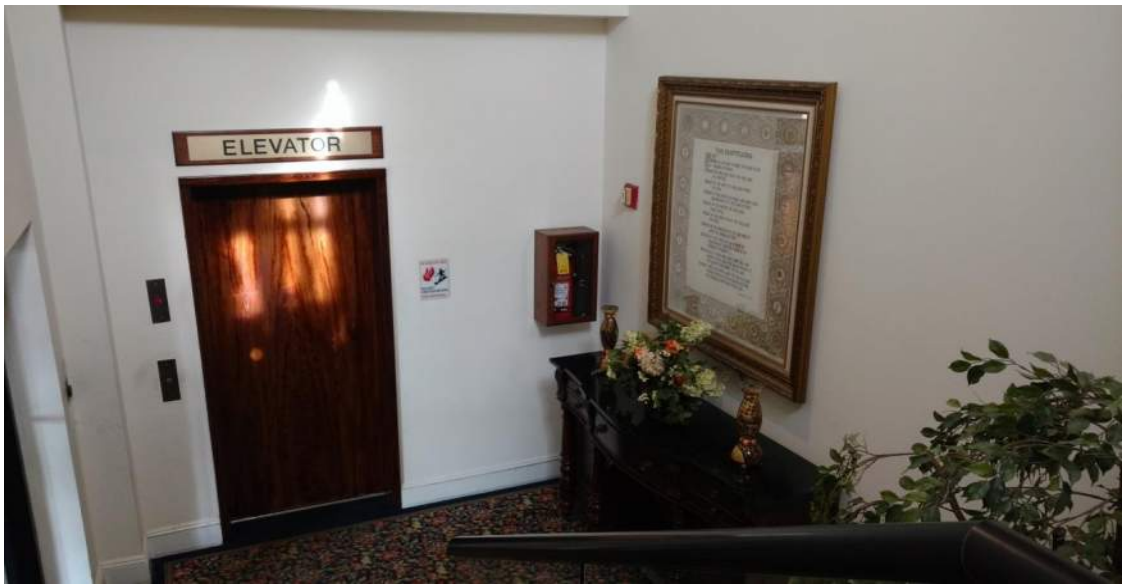


Photo 12: One of two on-site elevators.



Photo 13: Trash compactor and 30-cubic-yard debris container on western boundary of Block 4434, Lot 1, facing west.



Photo 14: Block 4434, Lot 1 covered with compacted RCA used for additional parking, facing northeast.



Photo 15: Roof-mounted exhaust blower reportedly connected to sub-slab methane venting system, according to interviews with on-site personnel.



Photo 16: Automobile dismantling/junking operations adjacent to the north of the subject property, facing north.



Photo 17: Auto dismantling/junking operations adjacent to the north of the subject property, facing north.



Photo 18: Auto repair, car wash, and gasoline filling station adjacent to the north of the subject property, facing north.

LANGAN

APPENDIX G
Photographic Log
12020 Flatlands Avenue
Brooklyn, New York



Photo 19: Residential apartments adjacent to the south of the subject property, facing east.



Photo 20: One of two groundwater monitoring wells installed in the sidewalk adjacent to the north and east of Block 4434, Lot 1.

APPENDIX H

LANGAN RESUMES

Matthew Oleske

Senior Staff Engineer

Environmental Oversight, Environmental Site Assessment, Remedial Investigation, Remedial Action



7 years in the industry ~ 2 year with Langan

Mr. Oleske has over 7 years of experience that includes working on environmental projects, particularly investigation and remediation of environmental contamination. He has assisted in remedial investigations and has been involved in the collection of field data and assisted in the preparation of reports and other environmental regulatory documents for projects in the New York area.

Mr. Oleske's experience includes collection of soil, groundwater, soil-vapor, sub-slab vapor and indoor air samples for environmental analysis, supervision of remedial excavation activities, and air monitoring to ensure compliance with Occupational Safety and Health Standards. Mr. Oleske has also provided oversight for sub-slab depressurization system, soil-vapor extraction system, and composite cover system installations as well as follow up operations and maintenance.

Selected Projects

250 South Street Development, New York, NY
101-111 Murray Street Development, New York, NY
225 East 39th Street Development, New York, NY
525 West 52nd Street Development, New York, NY
2350 Fifth Avenue, New York, NY
Sky View Parc Development, Flushing, NY
Carroll Gardens Development, Brooklyn, NY

Publications

"Effects of Lime Amendment on the pH of Engineered Soil Mix for the Purposes of Bioretention", (2008), ASCE Journal of Irrigation and Drainage Engineering, Vol. 134, Issue No. 5, pages 675-679

Education

B.S., Bioresource Engineering
Rutgers University

Professional Registration

40 Hour, Hazardous Waste Handler

OSHA 10-Hour Training in Construction

LANGAN

Amanda Forsburg, CHMM

Project Scientist

Environmental Oversight, Remedial Investigation, Remedial Action



9 years in the industry ~ 9 years with Langan

Ms. Forsburg has over nine years of experience that includes working on environmental projects, particularly investigation and remediation of environmental contamination. She has assisted in remedial investigations and has been involved in the collection of field data and assisted in the preparation of reports and other environmental regulatory documents for projects in New Jersey and New York.

Ms. Forsburg's field experience includes investigation and remediation of contaminated sites including the collection of soil, groundwater, and air samples for environmental analysis, supervision of injections and remedial excavations, and the completion of air monitoring to ensure OSHA compliance on HAZWOPER sites. Office experience includes management of field investigation and remediation as well as completion of proposals, Phase I Environmental Site Assessments, remedial investigation reports, and remedial closure reports in support of these activities. Ms. Forsburg has worked on projects under regulatory oversight of the New Jersey Department of Environmental Protection (NJDEP), New York State Department of Environmental Conservation (NYSDEC), and New York City Office of Environmental Remediation (NYCOER).

Selected Projects

NYSDEC Brownfield Redevelopment, Remedial Investigation and Remediation Action – 363 and 365 Bond Street, Brooklyn, NY
NYSDEC Brownfield Redevelopment, Remedial Investigation – Fashion Outlets of Niagara Falls, NY
NYSDEC Spills Redevelopment, Remedial Action – 540 West 26th Street, New York, NY
NYSDEC Spills Redevelopment, Remedial Investigation and Remedial Action – 101 Murray Street, New York, NY
NYSDEC Spills Redevelopment, Remedial Investigation and Remedial Action – 110 University Place, New York, NY
NYSDEC Spills Redevelopment, Remedial Action, Lowe's Home Centers, Kings Plaza Site Redevelopment – Brooklyn, NY
NYSDEC Spills Remediation, Con Edison Soil Remediation - Bronx, NY
NYSDEC Spills Remediation, Con Edison NAPL Monitoring and Removal, Various Sites – Manhattan, NY
NYCOER E-Designation Remediation and Volunteer Cleanup Program Redevelopment, Remedial Investigation and Remedial Action – 400 Park Avenue South, New York, NY
NYCOER E-Designation Remediation and Volunteer Cleanup Program Redevelopment, Remedial Investigation and Remedial Action – 540 West 53rd Street, New York, NY
Remedial Action – 508 West 24th Street, New York, NY

Education

B.A., Environmental Studies
Bucknell University

B.A., Environmental Geology
Bucknell University

Professional Registration

Certified Hazardous Materials Manager (CHMM)

OSHA 29 CFR 1910.120 Certification (HAZWOPER)

Professional Affiliations

New Jersey Society of Women Environmental Professionals (NJSWEP)

Association of Environmental and Engineering Geologists – *New York-Philadelphia Chapter Secretary*

Professional Women in Construction - *New York Chapter Program Committee*

Alliance of Hazardous Materials Professionals New Jersey Chapter (AHMPNJ)

LANGAN

NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 505 W 19th Street, New York, NY
NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 53 West 53rd Street (MoMA Expansion), New York, NY
NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 525 West 52nd Street, New York, NY
NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 412 Greenwich Street, New York, NY
NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 508 West 24th Street, New York, NY
NYCOER E-Designation Remediation, Remedial Investigation and Remedial Action – 68 Charlton Street, New York, NY
NYCDEP Remediation, Remedial Investigation and Remedial Action – 225 East 39th Street, New York, NY
Sky View Parc Mixed-Use Construction, Sub-Slab Vapor Ventilation System Construction – Flushing, NY
Liberty Plaza Redevelopment Site, Remedial Investigation and Remedial Action – Randallstown, MD
Former Penick Corporation Facility RCRA Site, Remedial Investigation and Remedial Action – Montville, NJ
Former Pan Graphics Facility, Soil and Groundwater Remediation – Garfield, NJ
Former Pan Graphics Facility, Sediment Investigation and Cap Construction – Lodi, NJ
Former Flintkote Facility, Soil and Groundwater Investigation – East Rutherford, NJ
Interport Site, Impacted Soils Delineation and Remediation – Newark, NJ
Lowe's Home Center Store, Sub-Slab Vapor Ventilation System O&M – Eatontown, NJ
Lowe's Home Center Store, Sub-Slab Methane Gas Ventilation System O&M – Woodbridge, NJ
Lowe's Home Center Store, Sub-Slab Vapor Barrier Construction – Rosedale, NY
Stop & Shop, Groundwater and Indoor Air Monitoring – Emerson, NJ
Stop & Shop, Methane Gas Ventilation System O&M – Raritan, NJ
Stop & Shop, Sub-Slab Vapor Ventilation System O&M – New Paltz, NY
Former First Aviation Services Facility, Groundwater Monitoring and Remediation, Teterboro, NJ
Phase I Environmental Site Assessments and Due Diligence Investigations, Various Sites – NJ and NY

Steven Ciambruschini, PG, LEP

Principal/Vice President
Environmental Site Assessments/Investigations, Brownfield Remediation, UST Management



32 years in the industry ~ 27 years with Langan

Mr. Ciambruschini has over 30 years of experience in hydrogeologic and environmental investigations including management of environmental and geotechnical investigations relating to petroleum and chlorinated solvent spill sites, underground storage tank sites, manufactured gas plant sites, landfills, wastewater treatment facilities and industrial/commercial sites. His experience includes managing environmental compliance audits, remedial investigation, pre-acquisition due diligence and permitting assessment, feasibility studies and design, construction and operation of complex innovative remediation systems to treat, contain and recover contaminated soil and groundwater. These projects are managed under various NJDEP, PADEP, NYDEC, NYCDEP and CTDEP programs. Mr. Ciambruschini provides consultation to a diverse group of clients including private developers, utilities, retail and industrial facilities and is expert in assessing remediation options and funding options under various state and federal grant, loan and tax reimbursement programs including Brownfield programs.

Selected Projects

- Brodson Property, Montville NJ, (RCRA, NJDEP ACO Cleanup)
- Carroll Gardens, Brooklyn, NY (NY Brownfield, EPA Superfund, OER E-designated Site)
- Con Edison Appendix B Spill Sites - Various Locations, NY
- Former MGP Site, Brooklyn, NY (VCP Site)
- Extell Development, Hudson Yards, New York, NY (NYC E-designated, NYS Brownfield Site)
- Pan Graphics, Bergen County, NJ (ISRA, LSRP)
- New Jersey Turnpike General Environmental Services Contract, Various Sites, NJ
- Liberty Science Center, Jersey City, NJ (EO 215)
- Blue Back Square, West Hartford, CT (UST, Transfer Act, Brownfield)
- Hershey, Act II Investigation (PA VCP)
- Hershey, Naugatuck, CT (CT Transfer Act)
- Halby Chemical Sites, Various Sites, DE (CERCLA)
- Unisys, Middletown CT, (CT Transfer Act, Brownfield)
- Ryder Rental, Various Sites in CT (CT Transfer Act)
- St. Marks Avenue, Brooklyn, NY (Vapor Mitigation)
- Pan Graphics, Lodi, NJ (Eco Risk Assessment, LSRP)

Education

M.S., Geology
Montclair State University

M.A., Environmental Science
Montclair University

B.S., Environmental Science
Cook College, Rutgers University

Professional Registration

Professional Geologist (PG) in NY, DE, and KY

Licensed Environmental Professional (LEP) in CT

Underground Storage Tank License in NJ

Affiliations

National Ground Water Association

Association of Ground Water Scientists and Engineers

American Association of Petroleum Geologists

Environmental Professionals of Connecticut

American Bar Association (ABA)

LANGAN