

APPENDIX B
EDR REPORT

PARSONS

APPENDIX C

DATA

Route 9A Reconstruction Project Phase 1B Sampling Program Results

PAHs were detected in many of the samples. The highest PAH levels were detected in surface and subsurface samples at Jane Street (BH-10, 320 ppm and 24 ppm) and subsurface samples at 18th Street (BH-14, 88 ppm, 85 ppm, and 19 ppm).

TPH was detected in all samples from BH-16 and BW-25 and in one sample each from BH-15 and BW-18. However, the TPH concentrations were fairly low, with the highest being 275 ppm in the 4- to 8-foot sample from BH-16.

Elevated levels of the metals arsenic, copper, lead, and zinc were detected in one or more samples. The subsurface samples near Horatio Street (BH-11) had the highest values. The highest lead level was detected in the 4- to 6-foot sample (2,410 ppm).

Low levels of cyanide was detected at West 18th Street (BH-14, surface, 1.1 ppm) and West 23rd Street (BW-18, 4 to 8 feet, 2.3 ppm).

Groundwater Analysis

One groundwater sample was collected from each of the five Phase 1B wells and from the seven Phase 1A wells in this segment. The Phase 1A well samples analyzed for total and dissolved metals.

VOCs were detected in all the groundwater samples. The sample from 16th Street (BW-13) contained 1,000 ppb of BTEX, and the sample from 26th Street (BW-24) had 226 ppb of BTEX. Between 2 to 15 ppb of BTEX were detected in the other samples. The sample from 16th Street (BW-13) also contained 63 ppb of PAHs, but the water had a turbidity value of 300 NTU. No PAHs were detected in the other samples. TPH was detected in three samples, 16th Street (BW-13, 3.7 ppm), 24th Street (BW-22, 3 ppm), and 26th Street (BW-24, 2.5 ppm). The sample from BW-13 was noted to have a strong petroleum odor during the sampling program.

Several metals—primarily iron and manganese, but also arsenic, barium, cadmium, copper, lead, mercury, and zinc—were detected at levels above the Class GA groundwater standards in the unfiltered samples collected from one or more of the new and existing wells. However, only iron and manganese exceeded this level in the filtered samples. Iron and manganese are not toxic and are included in the water standards because of aesthetic reasons.

E. CONVENTION CENTER: 29TH STREET TO 46TH STREET

GEOLOGY

Bedrock rises from about 125 feet beneath the surface at the southern end of the segment to about 50 feet between 40th and 41st Street and to only 15 or 20 feet beneath 46th Street. This is overlain by thin deposits of till and sand. Over the sand and till is organic silt about 10 to 30 feet thick. Miscellaneous fill, comprising dredged river sediments, construction debris, and coal plant ash, lies in thicknesses of 25 to 35 feet across the project corridor. North of 42nd Street, the bedrock is shallow, and the fill is typically 10 to 15 feet deep.

PHASE 1A SAMPLING RESULTS

Ten locations were sampled in this area: soil-gas survey was performed on the two blocks between 42nd and 44th Streets (G-41 and G-41b), surface and subsurface soil samples were collected from eight borings (H-35, H-36, H-37, W-38, W-39, H-40, H-42, and W-43) and groundwater samples were collected from three wells (W-38, W-39, and W-43).

The soil-gas survey did not detect any non-methane VOCs. An elevated level of methane was detected in one bore hole between 43rd and 44th Streets (G-41b) (> 10,000 ppm).

The soil analysis indicated the presence of PAHs in samples collected throughout this segment, particularly those from 41st to 46th Streets (H-40, 131 ppm, H-42, 166 ppm, and W-43, 50 ppm). Additionally, a sample from 40 feet below grade contained BTEX between 41st and 42nd Streets (W-39, 13 ppm). Total VOCs were detected at less than 1 ppm in all other samples. Metals were detected throughout the segment. No sample exceeded the RCRA EP Toxicity limits.

The groundwater analysis detected PAHs in samples collected from W-39 and W-43, but the sample had a turbidity value of 1,035 NTU. The sample from W-39 also contained low levels of BTEX. This area contained a storage system for gasoline and diesel fuel and a garage with buried gasoline tanks.

Several metals were detected at levels above the Class GA groundwater standards in samples collected from all three wells. However, the analysis was performed on only unfiltered samples.

PHASE 1B SAMPLING RESULTS

PROGRAM RATIONALE AND SCOPE

The Phase 1A data suggested the presence of VOCs, primarily BTEX, in the deep subsurface soil and groundwater between 40th and 41st Streets (W-39). The northern extent of this contamination was defined by the absence of any VOCs at 42nd Street (H-40). To better define the southern extent of this contamination, a groundwater monitoring well (BW-25) was installed between 39th and 40th Streets. Soil and groundwater samples were collected from this location and analyzed for TCL volatile and semivolatile organic compounds, TAL metals and cyanide, TPH, and TCLP parameters. Additionally, groundwater samples were collected from the three existing Phase 1A wells (W-38, W-39, and W-43) and analyzed for metals in filtered and unfiltered samples.

PROGRAM RESULTS

Soil Analysis

Four soil samples were collected from depths of 2 to 6 feet, 8 to 10 feet, 15 to 17 feet, and 28 to 32 feet for laboratory analysis from boring BW-25 between 39th and 40th

Route 9A Reconstruction Project Phase 1B Sampling Program Results

Streets. No VOCs were detected in any sample. PAHs were detected at less than 10 ppm total in the 2- to 6-foot and the 8- to 10-foot sample and were undetected in the deeper samples. Additionally, TPH and metals were detected at fairly low levels in all four samples. All TPH values were less than 100 ppm.

Groundwater Analysis

The only organic compounds detected in the groundwater sample was xylene at 3 ppb and bis(2-Ethylhexyl)phthalate at 34 ppb. These two compounds were also detected in the method blank and probably result from laboratory contamination. No PAHs or TPH were detected.

Metals analysis was performed on groundwater samples collected from four wells: well BW-25 and existing wells W-38, W-39, and W-43. Several metals were detected at levels above the Class GA groundwater standard in the unfiltered samples. However, only iron and manganese exceeded their standards in the filtered samples. Iron and manganese are not toxic and are included in the water standards because of aesthetic reasons.

F. CLINTON AREA: 46TH STREET TO 59TH STREET

GEOLOGY

Glacially abraded bedrock surface rises to within 5 feet of the ground surface beneath 51st Street to 54th Street and drops off to a depth of about 40 feet at the segment's northern end. Small pockets of sand are found over the bedrock. The fill beneath this segment comprises dredged river sediment, coal plant refuse, and construction debris and exists in thicknesses of approximately 5 to 25 feet, depending on the depth of the bedrock.

PHASE 1A SAMPLING RESULTS

Nine locations were sampled in this area. soil-gas samples were collected from between 47th and 48th Streets (G-43c), 50th and 51st Streets (G-44), 54th and 55th Streets (G-44b), 55th and 56th Streets (G-45a), and 56th and 57th Streets (G-45). Surface and subsurface soil samples were collected from four borings between 46th and 47th Streets (H-43b), 56th and 57th Streets (H-46), and two from between (58th and 59th Streets W-47, and H-48) as well as groundwater sampling from the one well (W-47).

The soil-gas survey did not detect non-methane VOCs on any of the five blocks. Elevated levels of methane was detected between 55th and 56th Streets (G-45a).

The soil analysis detected metals in some samples. All EP Toxicity metal levels were less than the RCRA limits.

Total VOCs were less than 1 ppm in all samples. Total PAHs were less than 10 ppm in all samples. PCBs were not detected in any samples.



Engineering and Environmental Services, P.C.

Bernard F Langan, P.E.
George E Dernick, P.E.
George P Kelley, P.E.
Michael A. Semeraro, Jr. P.E.
David T Gockel, P.E.
Nicholas De Rose, P.G.
Cabot M Hudson, P.E.

Andrew J. Ciancia, P.E.
Gerard M Coscia, P.E.
William G. Lothian, P.E.
William F. Mercurio, P.E.
Gerald J. Zamorella, C.E.A.

Roger A. Archabal, P.E.
Gregory L. Biesiadecki, P.E.
Rudolph P. Fizzi, P.E.
Ronald A. Fuerst, C.L.A.
Cristina M. Gonzalez, P.E.
Joel B. Landes, P.E.
John J. McEroy, Jr., Ph.D. P.E.
Joseph E. Romano, P.L.S.
Richard H. Zeigler, P.E.

CONSULTANT
Dennis J. Leary, P.E.

March 19, 2001
1568902

Mr. Chi Chu
Silverstein Properties
521 Fifth Avenue
New York, New York 10175

Re: Summary of Environmental Investigation
West 41st Street and Eleventh Avenue
New York, New York

Dear Mr. Chu:

This letter has been prepared to summarize the results of investigations conducted along West 41st Street to characterize environmental conditions that may impact on the construction of a Con Edison utility vault. The utility vault will service the second phase of the two-phase River Place construction program that began in 1995. The project location is approximately the eastern half of the block between 41st and 42nd Streets and 11th and 12th Avenues. Construction of a residential high-rise on the western portion of the property has been completed and planning of the second phase of construction is proceeding. We understand the Con Ed vault is to have a total length of approximately 100 feet and is to be in the sidewalk area fronting West 41st Street.

INVESTIGATION

In March 2000, Langan advanced 6 borings (B-21, 22, 23, 24, 25 and 26) into competent bedrock on the 41st Street side of the property. Boring locations are shown on the attached drawing. During drilling of those borings, Langan observed conditions of the soil and collected 6 samples for chemical analysis from depths up to 27 feet below surface grade. Samples were analyzed for volatile and semi-volatile organic compounds in accordance with EPA Methodologies 8021, 8270 and TCLP metals. The results of the sample analysis are summarized and compared with NYSDEC STARS Guidance Values. STARS Guidance Values are the most stringent of NYS requirements for soil and groundwater.

Groundwater was encountered at a depth of approximately 10 feet below grade. Langan converted one of the borings into a monitoring well (B-22, MW-4) and sampled groundwater from this and one existing monitoring well at the southeast corner of the property near B-26 (MW-2). All sampled wells were properly developed before sampling. Groundwater samples were analyzed by USEPA methodology for parameters required by NYCDEP for discharge into the NYC combined sewer. The results are compared to the NYCDEP discharge criteria as well as NYSDEC STARS Guidance Values.

Logs for the six borings are provided in the Appendix A.



RESULTS


- Stained and odorous material was observed in borings B-25 and B-26.
- No floating product was found in any of the existing or new monitoring wells.
- Four tables are provided showing analytical results for groundwater (Table 1) and Soil (Tables 2-4)

Levels of petroleum-related compounds that exceed NYS Cleanup Objectives and STARS Guidance Values were found in the soil to depth of the deepest boring. Groundwater was found to contain volatile organic compounds, particularly benzene, toluene, ethylbenzene and xylenes, and metals, including copper, lead, mercury and nickel that exceed NYS Ambient Water Quality Standards and STARS Guidance Values. All samples were below TCLP limits for hazardous waste.

We hope that this information is useful but we caution you that the data characterizes the areas where sampled only. Please call if we can be of any assistance.


Very truly yours,

**Langan Engineering and
Environmental Services, PC**



Joel B. Landes, P.E.
Associate

cc. A. Ciancia

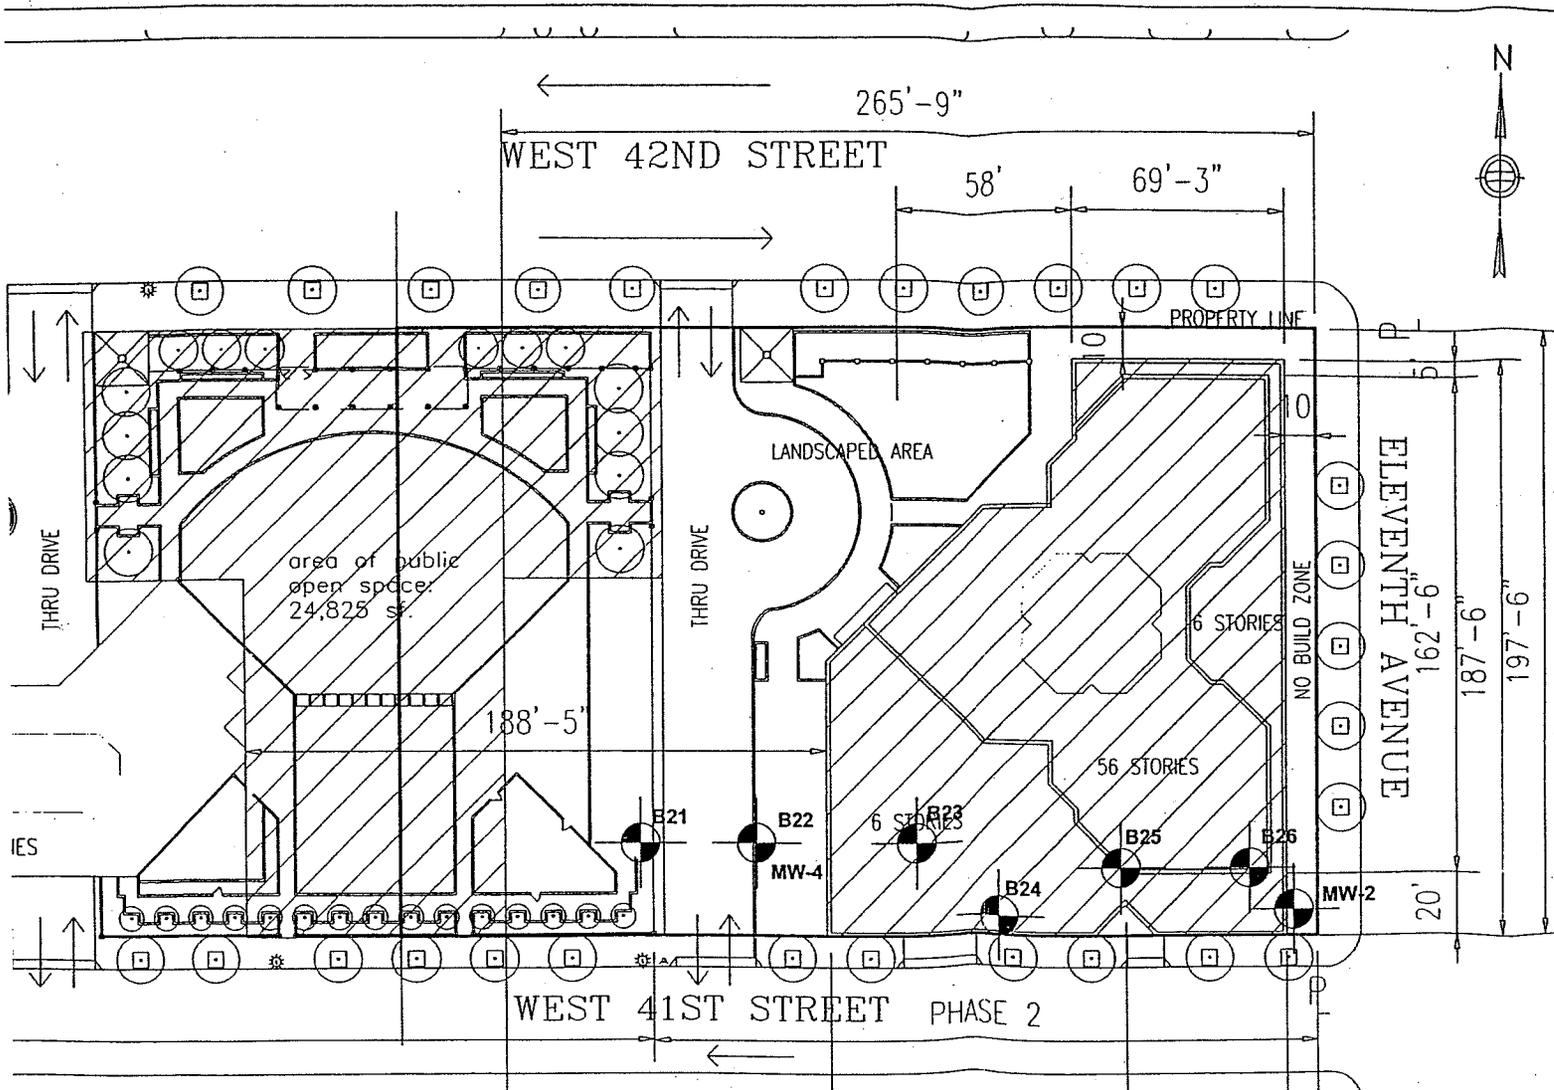

- NOTES:**
1. Boring locations are approximate.
 2. Borings B1 through B26 were drilled by Warren-George, Inc. between 10 March and 14 April 2000 under the Full-Time controlled Inspection of Langan representatives.
 6. Base site plan obtained from Costas Kondylis Architects, P.C.

- Legend:**
- B1 - Boring and Well Location and Identification.
 - MW-2 - Monitoring Well.
 - Approximate Limits of Reference Site.

<p>Langan Engineering and Environmental Services</p> <p><small>New York, NY Elwood Park, NJ New Haven, CT Doylestown, PA Miami, FL</small></p>	RIVER PLACE II			
	BORING LOCATION PLAN			
NEW YORK	SCALE 1" = 40'	DATE 3/19/2001	NEW YORK	
PROJ. NO. 1568902			PIC. 1	

✓

✓

DATE	B6		MW2 MW3		B2		MW4 B22	
	DEPTH (FT)	ELEV (FT)						
03/15/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/15/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/16/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/17/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/20/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/21/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/22/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/23/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/24/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/27/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/28/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/29/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/30/2000	15.6	-3.4	20.4	-6.7	---	---	---	---
03/31/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	---	---
04/03/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	---	---
04/04/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/05/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/06/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/07/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/10/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/11/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/12/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/13/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
04/14/2000	15.6	-3.4	20.4	-6.7	5.6	5.7	9.7	2.8
06/08/2000	14.7	-2.5	19.2	-5.5	4.9	6.4	8.7	3.8

Depth (ft) is below ground surface
 Elev (ft) is Manhattan Borough Datum



Langan
 Engineering and Environmental Services

NEW YORK, NY • ELWOOD PARK, NJ • NEW HAVEN, CT • DOYLESTOWN, PA • MIAMI, FL

RIVER PLACE II

GROUNDWATER LEVELS

MANHATTAN

NEW YORK

PROJ. NO:

1568902

SCALE

N.T.S.

DATE

7/25/00

TABLE 1

Table 1
Riv case II
42nd St. and 11th Ave. NY, NY
Analytical Results for Water Samples

Sample Location	MW-2		MW4		Trip Blank	NYC	NY State
Sampling Depth	25-30 ft		20-25 ft		198393	DEP DISCHARGE AND	DEC Water Quality
Langan Sample Number	021-MW-2-GW1		019-MW-1-GW1		4/12/00	DEWATERING	Regulations
Lab Sample Number	198645		198392		1.0	REQUIREMENTS	Groundwater Standards
Sampling Date	4/17/00		4/14/00		mg/l	mb/l or ppm	(ppm)
Unit	mg/l		mg/l				
<i>Parameters</i>		DF		DF			
Cadmium	0.0011	NA	0.0008 U	NA		< 2	0.005
Copper	0.0359	NA	0.30	NA		< 5	0.2
Lead	0.0285	NA	0.22	NA		< 2	0.025
Mercury	0.0001 U	NA	0.0022	NA		< 0.05	0.0007
Nickel	0.0161	NA	0.08	NA		< 3	0.1
Zinc	0.27	NA	1.22	NA		< 5	NA
Molybdenum	0.0174	NA	0.0065	NA		no limit	NA
Benzene	0.0032	1.0	0.18	50.0	0.0003 U	< 0.01	0.001
Toluene	0.0003 U	1.0	0.24	50.0	0.0003 U	< 0.01	0.005
Ethylbenzene	0.0003 U	1.0	0.38	50.0	0.0003 U	< 0.01	NA
Xylene (total)	0.0003 U	1.0	0.65	50.0	0.0003 U	< 0.01	NA
Total Petroleum Hydrocarbon	1.0 U	NA	1.0 U	1.0		< 50	NA
Total Cyanide	0.01 U	1.0	0.44	2.0		NA	NA
Total Suspended Solid	0.13	1.0	0.445	1.0		no limit	NA
Oil and Grease	10.0 U	NA	10 U	1.0		no limit (15mg/l daily max)	NA
Chromium VI	0.010 U	1.0	0.001 U	1.0		< 5	NA
Cyanide Amenable	0.01 U	1.0	0.02	2.0		< 0.2	NA
pH	7.48	1.0	7.1	1.0		5<pH<11	6.5<pH<8.5
Ignitability (degrees F)	>160	1.0	>160	1.0		> 140 degrees F	NA
Pesticides/PCBs							0.1 ppb
Aroclor-1016	0.30 U	1.0	0.30 U	1.0			
Aroclor-1221	0.30 U	1.0	0.30 U	1.0			
Aroclor-1232	0.30 U	1.0	0.30 U	1.0			
Aroclor-1242	0.20 U	1.0	0.20 U	1.0			
Aroclor-1248	0.30 U	1.0	0.30 U	1.0			
Aroclor-1254	0.20 U	1.0	0.20 U	1.0			
Aroclor-1260	0.40 U	1.0	0.40 U	1.0			
Aroclor-1262	0.20 U	1.0	0.20 U	1.0			
Aroclor-1268	0.20 U	1.0	0.20 U	1.0			

U- The compound was not detected at the indicated concentration.

DF- Dilution Factor

Note_1- Shaded values are those that exceed NY State DEC standards.

Note_3- Lab results were all converted to mg/l to be consistent with the NYCDEP concentration unit.

Note_2- Bolded values are those that exceed NYC DEC Discharge standards.

Note_4- NY State DEC Water Quality Regulation values for groundwater values were all converted to mg/l to be consistent with the lab and NYCDEP concentration unit.

T-11:2

River Place Phase II
42nd St. and 11th Ave.
New York, NY

Analytical Results for Volatile Organic Compounds In Soil Samples

Sample Location	B-21		B-23		B-25		B-25		B-25		B-26		NYS DEC
Sample Depth (ft)	15-17 ft		25-27 ft		5-7 ft		15-17 ft		20-22 ft		21-22 ft		TCLP
Langan Sample Number	008_B-21_SS4		012_B-23_SS6		016_B-25_SS2		010_B-25_SS4		015_B-25_SS5		013_B-26_SS5		Alternative
Laboratory Sample Number	194976		197410		197414		194978		197413		197411		Guidance
Sampling Date	3/29/00		4/6/00		4/11/00		4/3/00		4/11/00		4/7/00		Values
Dilution Factor	1.0		50		50		1.0		5000		50		(ppb)
Units	ug/kg												
<i>Volatile Compounds (GC)</i>													
Benzene	6.2	U	130	U	120	U	12		13000	U	200		14
Toluene	6.2	U	130	U	120	U	6.3	U	20000		200		100
Ethylbenzene	6.2	U	200		120	U	6.3	U	20000		200		100
Isopropylbenzene	6.2	U	200		120	U	6.3	U	13000	U	120	U	100
n - Propylbenzene	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	100
1,3,5-Trimethylbenzene	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	100
tert-Butylbenzene	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	100
1,2,4-Trimethylbenzene	6.2	U	130	U	120	U	6.3	U	20000		200		100
sec-Butylbenzene	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	100
p-Isopropyltoluene	6.2	U	200		120	U	6.3	U	13000	U	120	U	100
n-Butylbenzene	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	100
Naphthalene	42		300		1800		24		20000		3000		200
MTBE	6.2	U	130	U	120	U	6.3	U	13000	U	120	U	1000
Total Xylenes	6.2	U	1500		120	U	6.3	U	20000		1000		100

U- The compound was not detected at the indicated concentration.

J- Data indicates the presence of a compound that meets the identification criteria. The result is less than the quantitation limit but greater than zero. The concentration given is an approximate value.

B- The analyte was found in the laboratory blank as well as the sample. This indicates possible laboratory contamination of the environmental sample.

Notes- Shaded values are those that exceed applicable regulatory limits.

Terr-3

River Place Phase II
42nd St. and 11th Ave. NY, NY

Analytical Results for Semi-Volatile Organic Compounds In Soil Samples

Sample Location	B-21	B-23	B-25	B-25	B-25	B-26	NYS DEC	Human
Sample Depth (ft)	15-17 ft	25-27 ft	5-7 ft	15-17 ft	20-22 ft	21-22 ft	TCLP	Health
Langan Sample Number	008_B-21_SS4	012_B-23_SS6	016_B-25_SS2	010_B-25_SS4	015_B-25_SS5	013_B-26_SS5	Alternative	Guidance
Laboratory Sample Number	194976	197410	197414	194978	197413	197411	Guidance	Values
Sampling Date	3/29/00	4/6/00	4/11/00	4/3/00	4/11/00	4/7/00	Values	ppb
Dilution Factor	1.0	1.0	2.0	1.0	100	5.0	ppb	
Units	ug/kg	ug/kg	ug/kg	ug/kg	ug/kg	ug/kg		
Semivolatle Compounds (GC/MS)								
Naphtalene	1300	430	3000	210	30000	3000	200	300,000
Acenaphtalene	580	430 U	3000	60 J	30000	3000	400	500,000
Fluorene	690	430 U	3000	39 J	30000	3000	1000	300,000
Phenanthrene	2800	29 J	2700	300 J	30000	3000	1000	***
Anthracene	730	430 U	3000	93 J	30000	3000	1000	20,000,000
Fluoranthene	2700	22 J	3000	440	30000	3000	1000	3,000,000
Pyrene	2900	18 J	3000	360 J	30000	3000	1000	2,000,000
Benzo(a)anthracene ⁽¹⁾⁽²⁾	1200	43 J	2200	170	29000	3000	0.04	220
Chrysene ⁽¹⁾	1400	430 U	2200	190	29000	3000	0.04	***
Benzo(b)fluoranthene ⁽¹⁾⁽²⁾	1400	43 J	2600	180	22000	3000	0.04	220
Benzo(k)fluoranthene ⁽¹⁾⁽²⁾	830	43 J	2200	10	11000	3000	0.04	220
Benzo(a)pyrene ⁽¹⁾⁽²⁾	1300	43 J	4000	110	21000	3000	0.04	61
Indeno(1,2,3-cd)pyrene ⁽¹⁾⁽²⁾	830	43 J	3200	61	10000	3000	0.04	***
Dibenz(a,h)anthracene ⁽¹⁾⁽²⁾	200	43 J	1100	23 J	4300 U	3000	1000	14
Benzo(g,h,i)perylene ⁽¹⁾⁽²⁾	830	430 U	2800	73	3000	3000	0.04	***

U- The compound was not detected at the indicated concentration.

J- Data indicates the presence of a compound that meets the identification criteria. The result is less than the quantitation limit but greater than zero. The concentration given is an approximate value.

B- The analyte was found in the laboratory blank as well as the sample. This indicates possible laboratory contamination of the environmental sample.

Notes- Shaded values are those that exceed regulatory guidance limits.

(1) Due to the high detection limit for a solid matrix, the TCLP Extraction Method must be used to demonstrate ground water quality protection for these compounds.

(2) For these 7 compounds Human Health Guidance Value will be the limiting factor for achieving acceptable cleanup levels.


***- No Guidance Value Identified in EPA Heat Report.

Table 4

River Place Phase II
42nd St. and 11th Ave.
New York, NY
Analytical Results for TCLP Metals

Sample Location Sample Depth Langan Sample Number Lab Sample Number Sampling Date Dilution Factor Units	B-21 15-17 ft 008_B-21_SS4 194976 3/29/00 NA mg/l	B-23 25-27 ft 012_B-23_SS6 197410 4/7/00 NA mg/l	B-25 5-7 ft 016_B-25_SS2 197414 4/11/00 NA mg/l	B-25 15-17 ft 010_B-25_SS4 194978 4/3/00 NA mg/l	B-25 20-22 ft 015_B-25_SS5 197413 4/11/00 NA mg/l	B-26 21-22 ft 013_B-26_SS5 197411 4/7/00 NA mg/l	Hazardous Waste Regulatory Levels for Toxicity Characteristic (mg/l)
Compound							
Arsenic	0.35 B	0.018 U	0.018 U	0.20 U	0.018 U	0.018 U	5
Barium	6.5	12.5	9.8	6.5	8.8	11.8	100
Cadmium	0.008 U	0.002 U	0.002 U	0.008 U	0.002 U	0.002 U	1
Chromium	0.017 U	0.008 U	0.008 U	0.017 U	0.008 U	0.008 U	5
Lead	0.25 B	0.011 U	0.01 U	0.36 B	0.011 U	0.011 U	5
Mercury	0.0001 U	0.0001 U	0.0001 U	0.0001 U	0.0001 U	0.0001 U	0.2
Selenium	0.14 U	0.021 U	0.021 U	0.17 B	0.021 U	0.021 U	1
Silver	0.017 U	0.007 U	0.007 U	0.017 U	0.007 U	0.007 U	5

U- The compound was not detected at the indicated concentration.
 J- Data indicates the presence of a compound that meets the identification criteria. The result is less than the quantitation limit but greater than zero. The concentration given is an approximate value.
 B- The analyte was found in the laboratory blank as well as the sample. This indicates possible laboratory contamination of the environmental sample.
 Notes- Shaded values are those that exceed applicable regulatory limits.



Engineering and Environmental Services, Inc.

LOG OF BORING

A-21

SHEET 1 OF 13

PROJECT <i>River Place II</i>		PROJECT NO. <i>1568901</i>	
LOCATION <i>42nd + 11th Ave. NY</i>		ELEVATION AND DATUM <i>12.39</i>	
DRILLING AGENCY <i>Warren George</i>		DATE STARTED <i>3/29/00</i>	DATE FINISHED
DRILLING EQUIPMENT <i>Diedrich D-50</i>		COMPLETION DEPTH <i>49'</i>	ROCK DEPTH <i>39'</i>
SIZE AND TYPE OF BIT <i>4 5/8 Roller Bit</i>		NO. SAMPLES	DIST. <i>8</i> UNDIST. <i>-</i> CORE <i>2</i>
CASING <i>4" Steel</i>		WATER LEVEL	FIRST <i>-</i> COMPL <i>-</i> 24 HR. <i>-</i>
CASING HAMMER	WEIGHT <i>140</i>	DROP <i>30</i>	FOREMAN <i>Vinny Mitchell</i>
SAMPLER	<i>2" OD Split Spoon</i>		
SAMPLER HAMMER	WEIGHT <i>40</i>	DROP <i>30</i>	INSPECTOR <i>Kris Regula</i>

DEPTH SCALE	SAMPLE DESCRIPTION	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
		NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BLOW/IN.	
1	<i>Brown topsoil trace to some gravel, brick (FILL)</i>	<i>5</i>	<i>1</i>	<i>RTN</i>	<i>4</i>	<i>No odors 8:15 Sample was wet Split spoon was hammered through asphalt.</i>
2					<i>24</i>	
3	<i>Dark Gray SILT trace to some fine gravel, brick (FILL)</i>	<i>5</i>	<i>2</i>	<i>RTN</i>	<i>1</i>	<i>No odors 8:50 Sample was wet. Roller bitting down to ten feet</i>
4					<i>2</i>	
5					<i>2</i>	
6					<i>2</i>	
7	<i>Dark Gray SILT trace to some fine-medium sand, coarse-medium gravel</i>	<i>5</i>	<i>3</i>	<i>RTN</i>	<i>5</i>	<i>Sample was wet. 9:00 No odors present.</i>
8					<i>4</i>	
9					<i>4</i>	
10					<i>4</i>	
11						
12						
13						
14						

FILL

11-65

11-65

11-65

JOB NO. 1568901
 DATE 3/20/00

LOG OF BORING NO. B-21

SHEET 3 OF 3

Met. Symbol NYCOC	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
			NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BLG IN.	
A N D 10-65	Dark Gray SAND trace to some silt, Clay	30					Sample was wet 8:15 am No odors present.
		31	55	7	24 IN	1 1 2 26	
		32					
		33					
		34					
DEC. ROCK 4-05	Dark Gray Fine-medium sand trace to some coarse gravel	35				46	hammered hard 8:45 am to drive PID=0 No odors, sample wet Hard drilling
		36	55	8	5 IN	100 6"	
		37					
		38					
		39					
GNEISSIC SCHIST/ GRANITIC BIGNETT 1-65	First 9 inches of Run Gneissic Schist White, light greenish/gray light orange with mixture of little schist and garnets	40					Coring started at 11:15 Speed increased at 11:25 after second foot of run. No fluid loss.
		41					
		42	7	First Run	6.0"	REC: 57.5/60 = 94% RAD = 54/60 = 90%	
		43	6	Nx - Double Barrel	6.0"		
		44					
Granitic Pigmentite 1-65	Light greenish/gray White same as above.	45	6	Second Run	6.0"	REC = 100% RAD = 100%	
		46	7	Nx - Double Barrel	6.0"		
		47	4				

JOB NO. 1568901
DATE 3/30/00

LOG OF BORING NO. B-21

SHEET 4 OF 4

Met'l Symbol	NYCB	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES			REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOG.	TYPE	RECOV. FT.	
GRANITIC PIGMENTITE	1 - 65	Same as above	46	SECOND RUN	Nx - Core Barrel	60"	No fluid loss during coring.
			47				
			48				
			49				
			50				
			51				
			52				
			53				
			54				
			55				
			56				
			57				
			58				
59							
60							
61							
62							
						REC = 100% RAD = 100%	End of coring run

PROJECT <i>River Place II</i>			PROJECT NO. <i>1568901</i>		
LOCATION <i>42nd + 11th Ave. NY</i>			ELEVATION AND DATUM <i>12.52</i>		
DRILLING AGENCY <i>Warren George, Inc</i>			DATE STARTED <i>4/10/00</i>		DATE FINISHED <i>4/4/00</i>
DRILLING EQUIPMENT <i>Falling</i>			COMPLETION DEPTH <i>42.5'</i>		ROCK DEPTH <i>35'</i>
SIZE AND TYPE OF BIT <i>4 5/8" Roller Bit</i>			NO. SAMPLES		DIST. <i>7</i> UNDIST. <i>-</i> CORE <i>2</i>
CASING <i>4" Steel</i>			WATER LEVEL		FIRST <i>-</i> COMPL. <i>-</i> 24 HR. <i>-</i>
CASING HAMMER	WEIGHT <i>140</i>	DROP <i>30</i>	FOREMAN <i>Vinny Mitchell</i>		
SAMPLER <i>2" OD Split Spoon</i>			INSPECTOR <i>Kris Regala</i>		
SAMPLER HAMMER	WEIGHT <i>40</i>	DROP <i>30</i>			

Mat'l Symbol	NYC	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. BL/IN.	
FILL	11-65	Light Brown Sand some coarse gravel (FILL)	1					10130
			2	55	1	12 IN	6 18 15 11	12:25
	3						Roller bitting down	
	4							
	5	11-65	Coarse Gravel trace peat (FILL)	5				Sample was 12:40 wet. No odors present.
	6			55	2	4 IN	10 7 3 2	
	7							
	8							
	9							
	10	11-65	Wood with trace fine Sand (FILL)	10				Sample was 12:50 moist. No odors present
	11			55	3	12 IN	8 14 01	
	12							
	13							
	14							

JOB NO. 1568901
DATE 4/4/00

LOG OF BORING NO. B-22
SHEET 2 OF 3

Mat'l Symbol	NYCOC	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)	
				NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BUR. IN.		
FILL	11-65	Gray fine-medium sand trace to some gravel, brick (FILL)	15	SS	4	6 IN	12	Sample was wet. 11:05 No odors present.	
	16		7						
	17		6						
	18								
	19								
	20	Wood (FILL)							11:55
	21		SS	5	1 IN	100/2"			Hammer bounced continuously.
	22								
	23								
	24								
CLAY DEPOSIT	11-05	Dark Gray CLAY	25	shelby	1	10 IN	NOH	shelby tube with 10:35 a piston push device used.	
		Dark Gray CLAY trace sand, silt, peat fibers	26				NOH	Sample was wet. 10:50 No odors present	
	27	SS	6 IN	2					
	28				2				
	29								
	30								
	31								



Engineering and Environmental Services, Inc.

JOB NO. 1568901

LOG OF BORING NO. B-22

DATE _____

SHEET 3 OF 3

DEPTH SCALE	SAMPLE DESCRIPTION	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
		NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BLU/IN.	
70	Dark Gray CLAY trace to some sand, peat fibers	55	7	18 IN	1 7	
31						
72	Decomposed Mica Schist	55	7	18 IN	17	
33						
34						
35						
76	ROCK	FIRST RUN	Nx - Double Core Barrel	60"	REC = 100% RAD =	
37						
38						
39						
40						
41						
42						
47	END OF BORING @ D = 42.5'					
44						
45						
46						

org. clay
DEC. ROCK

4-65

ROCK

Second Run
Nx - Double Barrel
30"



Engineering and Environmental Services, Inc.

LOG OF BORING

B-23

SHEET 1 OF

4

PROJECT <i>Warren George</i>		PROJECT NO. <i>1568901</i>			
LOCATION <i>42nd + 11th Ave. NY</i>		ELEVATION AND DATUM <i>12.70</i>			
DRILLING AGENCY <i>Warren George</i>		DATE STARTED <i>4/5/00</i>		DATE FINISHED <i>4/5/00</i>	
DRILLING EQUIPMENT <i>L8000</i>		COMPLETION DEPTH <i>50'</i>		ROCK DEPTH <i>35 ft</i>	
SIZE AND TYPE OF BIT <i>4 5/8 Roller Bit</i>		NO. SAMPLES	DIST. <i>7</i>	UNDIST. <i>-</i>	CORE <i>2</i>
CASING <i>4" steel Casings Advancer</i>		WATER LEVEL	FIRST <i>-</i>	COMPL. <i>-</i>	24 HR. <i>-</i>
CASING HAMMER	WEIGHT <i>140</i>	DROP <i>30</i>	FOREMAN <i>Tommy Gregory</i>		
SAMPLER <i>2" OD Split Spoon</i>			INSPECTOR <i>Kris Regak</i>		
SAMPLER HAMMER	WEIGHT <i>140</i>	DROP <i>30</i>			

DEPTH SCALE	SAMPLE DESCRIPTION	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)	
		NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BLU/IN.		
1	Dark Gray Sand Some coarse-fine gravel (FILL)	55	1	15 IN	2	Drilled down to 1 foot. Sample was Dry. 9:00am No odors present.	
2							13
3							18
4	Black Topsoil trace fine gravel (FILL)	55	2	1 IN	1	No odors present 9:20 Sample was wet.	
5							3
6							2
7	Dark Gray/Brown fine sand trace fine gravel (FILL)	55	3	8 IN	3	No odors present Sample was moist. Roller biting down to 25!	
8							7
9							6
10							
11							
12							
13							
14							

FILL

11-85
11-65
11-65

JOB NO. _____

LOG OF BORING NO. 6-23

DATE _____

SHEET 2 OF 4

Mat'l Symbol	NYCB	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES			REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOG.	TYPE	RECOV. FT. PENETR. RESIST. BL/IV.	
FILL	11-65	Dark Gray SAND trace clay	15				Sample was wet No odors present. Roller bitting down to 20.'
			16	5	4	5 7 7 9	
			17				
			18				
			19				
			20				
FILL	11-65	Wood with some gray clay trace sand	21	5	5	10 ¹ / ₅	No odors present Hammer/spoon kept bouncing.
			22				
			23				
			24				
			25				
			26				
Organic Clay	11-65	Dark Gray CLAY trace sand, plant fibers	26	5	6	1 PEN	Sample was moist. Environmental Sample taken
			27			WOB	
			28				
			29				
			30				
			31				

JOB NO. 1568901

LOG OF BORING NO. 8-23

DATE _____

SHEET _____ OF _____

DEPTH SCALE	SAMPLE DESCRIPTION	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
		NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST BLU/IN.	
29						
30						
31	Decomposed black mica schist Decomposed greenish mica schist with some clay	55	A	16 IN	25	Sample was moist easily breakable. Roller biting down to 35'. Rig is chattering
32					37	
33					160	
34					3"	
35	Highly Fractured Mica Schist Changing to Granite trace garnets	6	First Run			Sample was washed away probable decomposed mica schist.
36		6	Nx-Core Barrel	60"		
37		6			REC = 52%	
38		6			RAD = 20%	
39		7				
40	White/pink Granite trace garnets Vertical fracture on section of rock orange staining on joints	6	Second Run			REC = 53/60 = 88% RAD = 84%
41		6	Nx-Core Barrel	60"		
42		7				
43		7				
44		7				
45						
46						

SOFT ROCK
4-65

MICA SCHIST
3-65

GRANITE
2-65

see sketch

JOB NO. 1568901
 DATE 4/6/00

LOG OF BORING NO. B-23

SHEET 4 OF

	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
			NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. BL/IN.	
GRANITE 1-65	White/pink granite trace garnets	45					No fluid loss during coring
		46					
		47					
		48					
		49					
		50					
		51					
		52					
		53					
		54					
		55					
		56				End of Boring.	
		57					
		58					
		59					
		60					
		61					

Third Run
 1/4" Double Core Barrel
 6.0"
 REC = 100%
 RRD = 96%

PROJECT <u>RIVERPLACE</u>		PROJECT NO. <u>1568901</u>	
LOCATION <u>42ND ST & 11TH AVE, MANHATTAN NY</u>		ELEVATION AND DATUM <u>12.917</u>	
DRILLING AGENCY <u>WARREN GEORGE INC.</u>		DATE STARTED <u>04/11/00</u>	DATE FINISHED <u>04/12/00</u>
DRILLING EQUIPMENT <u>FALING 1500 TRUCK MOUNTED DRILL BIT</u>		COMPLETION DEPTH <u>60.0 FT</u>	ROCK DEPTH <u>49.0 FT</u>
SIZE AND TYPE OF BIT <u>3 7/8" 1 1/2" TRICONE ROLLER BIT</u>		NO. SAMPLES	DIST. <u>10</u> UNDET. <u>f</u> CORE <u>2</u>
CASING <u>3 7/8" 1/4" DIA FLUSH JOINT CASING</u>		WATER LEVEL	FIRST <u>-</u> COMPL. <u>-</u> 24 HR. <u>-</u>
CASING HAMMER	WEIGHT	DROP	FOREMAN <u>VINNY MITCHELL / MARTIN</u>
SAMPLER <u>24" SPLIT SPOON</u>	INSPECTOR <u>CYNTHIA BURZYNSKI</u>		
SAMPLER HAMMER	WEIGHT <u>140 #</u>	DROP <u>30" N</u>	

MATERIAL SYMBOL NYC BLDG CODE CL.	SAMPLE DESCRIPTION	CASING BLOWS	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. BL/IN.	
	ROLLER BIT THROUGH 12" CONCRETE SURFACE		1					BEGAN DRILLING AT 7:15 04/11/00
FILL 71-65	S-1 DK GRAY CF SAND Some mf gravel Some clayey silt, fr brick frags fill 11-65		2	S-1	SS	15 IN	7 22 20 11	MIX MUD, ROLLER BIT TO 1 FT, ROLLER BIT (dk. Brown wash)
			3					
			4					
	S-2 TOP 3" GRAY BROWN mf SAND		5				2	ROLLER BIT TO 5 FT (little wood in wash 5-7')
FILL 11-65	MID 3" DK GRAY CINDERS & WOOD LT clayey silt. (same as above)		6	S-2	SS	15 IN	2 2 3 2	
	BOT 4" (SAME AS TOP 3") (FILL), (11-65)		7					
			8					
			9					
			10					ROLLER BIT TO 10 FT
	S-3 GOOD 4" GRAY BROWN mf SAND BOT 10" GRAY mf SAND Some clayey silt fr brick frags, cinders (slight creasine odor) (FILL) (11-65)		11	S-3	SS	18 IN	5 7 9 9	
FILL 11-65			12					
			13					
			14					

JOB NO. <u>1568901</u>		LOG OF BORING NO. <u>B-24</u>						
DATE <u>04/11/00</u>		SHEET <u>2</u> OF <u>4</u>						
MATERIAL SYMBOLS SYMBOLS SYMBOLS SYMBOLS	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)	
			NO. LOG.	TYPE	RECOV. FT.	PENETR. RESIST. BLW. IN.		
FILL 11-65	S-4 Same as above w/ one piece of casing (straight (FILL) (11-65))	14					ROLLER BIT TO 15 FT	
		15	S					
		16	P	S-4	SS	15		1
		17	N					
		18	S					
FILL 11-65	S-5 TOP 3 IN dk Gray Clay & SILT to touch. BOT 12 IN DK Gray of SAND and Cinders, lt Chazy Silt (creosote odor) FILL (11-65)	19					ROLLER BIT TO 20' (Creosote odor from 20 FT TO)	
		20						
		21	S	S-5	SS	15 IN		2
		22	N					
		23	S					
FILL 11-65	S-6 GRAY BROWN CLAY & SILT, lt f SAND & peat fibers (pH = 0.25 - 0.5) Et-1. (Piston Tube) Sample from Bot Same as above (RPV = 0.5 - 0.7 t/sf)	24					SPIN 5" DIA CASING OFF TO 20 FT	
		25						
		26	S	S-6	SS	20 IN		1
		27	P					2
		28	N					
F SAND: 11-65	S-7 TOP 6 IN Same as above BOT 19 IN dk Gray Brown mf SAND	29					ROLLER BIT TO 25'	
		30						
		31	S	S-7	SS	20 IN		3
							blow Piston tube with 12 10 PM U-1 EXTRACT U-1 12 40 PM follow with S-7 SPIN 5" DIA CASING 20 FT TO 2.5 FT	

JOB NO. 1568901
DATE 4/11/00

LOG OF BORING NO. B-24

SHEET 3 OF 4

SYMBOL	SAMPLE DESCRIPTION	CASE BLOWS	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. BLO IN.	
			32					ROLLER BIT to 35' Rig chattering at 34'
			33					
			34					
	S-8 Red Brown		35				24	ROLLER BIT to 40'
	CF SAND, L of		36				26	
	Gravel + clayey		37				25	
	Silt. (7-65)		38				28	
			39					
	S-9 TOP 3 IN SAME AS ABOVE		40					ROLLER BIT to 45'
	Bottom of Gray white +		41				18	
	all red of gravel		42				70	
	lt sand, + silt		43				87	ROLLER BIT to 45'
	(6-65)		44					
			45					
	S-10 Red Brown		46				78	ROLLER BIT and Installed 4" CASING 0 FT - 49 FT
	CF SAND and Silt		47				109 1/2	
	+ clay, + CF gravel		48					
			49					
			50					
	DECOMPOSED		51					VERY HARD DRILLING FROM 49' (approx 2 1/2 in wash)

REV 04/17/00

JOB NO. 1568901
DATE 04/03/00

LOG OF BORING NO. B-25

SHEET 2 OF 4

MATERIAL SYMBOL	SAMPLE DESCRIPTION	CASING BLOWS	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)	
				NO. LOC.	TYPE	REC. FT.	PERI-METER REGIST. BL. IN.		
organic clay 11-65	S-4 Gray SILT & Clay, some f sand, lt wood (vert) tr m gravel	S P I N	14					SPIN 4" DIA CASING & ROLLER BIT TO 15' (WOOD IN WASH FROM 11 FT ±).	
			15				5		
			16	S-4	SS	15 IN	7		
			17				3		
			18						
			19						
			20						
			21	S-5	SS	1/3	100%		
			22						
			23						
			24						
			25	S-6A			WOH		
			26		S-6	SS	2 1/2 IN		3
			27						4
			28						5
organic clay 11-65	S-6B BOT 6 IN Gray cf SAND, lt silt & clay (7-65)	S P I N	29					ENCOUNTERED NEXT WOOD obstruction (possible pile) AT 20.5' ROLLER BIT 20'-25' (END OF WOOD AT 23') Add mud at 23' ROLLER BIT TO 30' Color change in Wash to red brown at 29' ENDED DRILLING AT 04/03/00 3:05 PM	
			30						
			31	S-7	SS	1/2 IN	10		
			32						
			33						
SAND & SILT 11-65	S-7 Red Brown cf SAND, lt clayey silt. tr m gravel (7-65)	S P I N	31						
			32						
			33						

NOTES:
Strong cleavage order in sample S-5
SPIN 4" DIA CASING 20 FT - 20.5' (9" CASING BROKE OFF AT TOP 6 IN.)
ENCOUNTERED NEXT WOOD obstruction (possible pile) AT 20.5'
ROLLER BIT 20'-25' (END OF WOOD AT 23')
Add mud at 23'
ROLLER BIT TO 30'
Color change in Wash to red brown at 29'
ENDED DRILLING AT 04/03/00 3:05 PM

JOB NO. 1568901
DATE 04/04/00

LOG OF BORING NO. B-25

SHEET 3 OF 4

MATERIAL SYMBOL NO. 200 COBBLE CLASS	SAMPLE DESCRIPTION	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
			NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. BL. IN.	
SAND		32					BEGAN DRILLING 04/04/00 at 7:30 AM BEGAN MIXING MWD
Boulder	C-1 34.0 - 35.6 Gray & White Gneissic Schist (Boulder (18" IN)) (6-65)	33-34	C-1 34.0	MX DOBBLE	REC-18"	RD0-NA	
Hardepan	Possible Hardepan	35-39					ROLLER BIT TO 34' RIG CHATTERING Red brown wash continued
Cobble	C-2 39.5 - 40.4 white & Lt gray Granite (Cobble (4" IN)) over dk Red Sandstone (Cobble (5" IN)) (6-65)	40-41	C-2 39.5	MX	REC-9"	RD0-NA	
Hardepan		42-45					ROLLER BIT TO (45' Hard drilling), (red brown wash continued)
		46	5-8	SS		30 6 100 4	
See Pg 5	S-8 Red Brown CF Gravel some of sand, little silt & clay (hardpan) 5-65	47-49					ROLLER BIT TO 47' Hard drilling could not get Core barrel past 34' B-25 Began pulling out

JOB NO. 2568901

LOG OF BORING NO. B-25

DATE 04/05/00

SHEET 4 OF 4

MATERIAL SYMBOL CODE	DESCRIPTION	CORING RATE	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOG.	TYPE	REC'D. FT.	PENETR. RESIST. BUR. IN.	
			46					Began Drilling
			47					04/05/00 8:00 AM
	47.0 - 48.5 white, Gray & Lt gray Granitic PEGMATITE COBBLE (2.1" IN) and		48					FINISHED PULLING OUT 4" Ø CASING & CASING ADVANCED
			49					1040 AM
	DK. GRAY GNEISSIC SCHIST COBBLE (2.1" IN)		50					
			51					DRILLED TO 47 FT with 2 1/8" ROULEE BIT; INSTALLED 5" Ø CASING TO 25 FT; AND 4" Ø CASING TO 45 FT.
			52					135 PM BEGAN CORING ROCK FROM 47 FT
	48.5 - 51.5 white & Lt Gray GRANITE WITH + dk gray SCHIST. (Bedrock) (2.2" IN) (Highly fractured (from 48.5 - 50.0) (2-65)							Core barrel blocked up at 51.5 FT
								EXTRACTED CORE BARREL 2:10 PM
								ENDED DRILLING 04/05/00 2:40 PM
								STARTED DRILLING (extracting casing) 04/06/00 8:30 AM


ENDED BOREHOLE
AT 51.5 FT
04/05/00 8:30 AM
BOREHOLE BACKFILLED
UPON COMPLETION
04/06/00 10:00 AM

Hard
Cobble
Hard
Rock
2-65

C-3
NY
R80 = N/A

PROJECT <u>RIVER PLACE</u>		PROJECT NO. <u>1568901</u>	
LOCATION <u>42ND ST & 11TH AVE, MANHATTAN NY</u>		ELEVATION AND DATUM <u>13.06</u>	
DRILLING AGENCY <u>WARREN GEORGE INC.</u>		DATE STARTED <u>04/06/00</u>	DATE FINISHED <u>04/07/00</u>
DRILLING EQUIPMENT <u>MOBILE TRUCK MOUNTED DRILL RIG</u>		COMPLETION DEPTH <u>27.0'</u>	ROCK DEPTH <u>—</u>
SIZE AND TYPE OF BIT <u>3/8", 1/8" TRILANE ROLLER BITS</u>		NO. SAMPLES	DIST. <u>6</u> UNDET. <u>—</u> CORE <u>—</u>
CASING <u>7 5/8" DIA FLUSH JOINT CASING</u>		WATER LEVEL	FIRST <u>—</u> COMPL. <u>—</u> 24 HR. <u>—</u>
CASING HAMMER	WEIGHT	DROP	FOREMAN <u>YINNY MITCHEL/MARTIN</u>
SAMPLER <u>2 1/2" W SPLIT SPOON</u>	INSPECTOR <u>CYNTHIA BRYAN</u>		
SAMPLER HAMMER	WEIGHT <u>.140 #</u>	DROP <u>30 IN</u>	

MATERIAL SYMBOL	NYC BLD CODE CLASS	SAMPLE DESCRIPTION	CASING BLOW	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
					NO. LOC.	TYPE	RECOV. FT.	PENETR. RESIST. PLUS IN.	
		Roller bit through 12" thick concrete surface		1					BEGAN DRILLING 04/06/00 10:20 AM Wash Gray brown Roller bit to 1 FT
		S-1 Brick, cinders 4" CP Sand (fill) (11-65)		2	1	SS	2	6	
				3			1	2	
		S-2 NO RECOVERY		5					ROLLER BIT TO 5 FT Wood (vertical grain) & bricks in wash
				6	S-2	SS	1	4	
				7					
				8					
				9					ROLLER BIT TO 10'
		S-3 DK Gray CINDERS and CP Sand fill (11-65)		10					
				11					
				12					
				13					ROLLER BIT TO 15' SPIN 5" DIA CASING 0-15 FT.
				14					

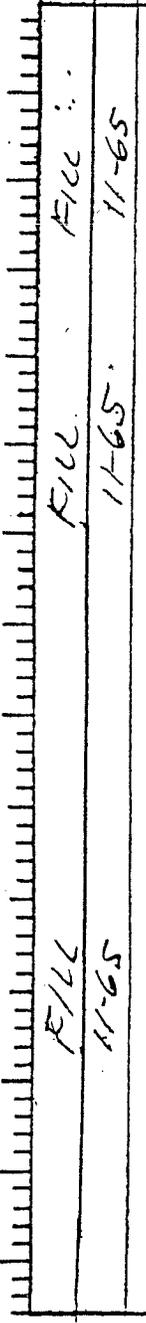

JOB NO. 1568901
DATE 04/10/00


LOG OF BORING NO. B-26A

SHEET 3 OF 3

MATERIAL SYMBOL NYC BLD CODE CLASS	SAMPLE DESCRIPTION	JOINTS Remarks	DEPTH SCALE	SAMPLES				REMARKS (DRILLING FLUID, DEPTH OF CASING, CASING BLOWS, FLUID LOSS, ETC.)
				NO. LOC.	TYPE	RECOV. FT.	PERCENT. RESIST. BL/IN.	
6-65			42					BEGAN DRILLING 7:5 AM 04/10/00
			43					RIG CHATTERING FROM 43 FT
			44					
	S-4 Same as Above		45	54	55	60	100/5W	ROLLER BIT TO 45'
			46					
			47					
			48					Harder drilling from 48'
	Decomposed SCHIST (4-65)		49					(was light gray) ROLLER BIT TO 500
			50					
	C-1 50.0' - 55.0' Medium Gray Schist (moderately fractured 50'-51')		51					BEGAN CORING AT 50.0 FT 10:20 AM
			52					
			53					
			54					
			55					ENDED CORING C-1 11:15 AM
	C-2 55.0' - 60.0' (same as above as for C-1)		56					BEGAN CORING AT 11:25 AM
			57					
			58					
			59					ENDED CORING C-2 12:10 PM PULLED CASING
			60					ENDED DRILLING 04/10/00

END OF BOREHOLE
AT 60.0' 04/10/00
BOREHOLE BACKFILLED

APPENDIX D
TITLE SEARCH REPORT

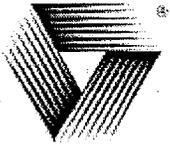

Commonwealth
A LANDAMERICA COMPANY

Special Search No.: SS020418A

DEED CHAINS FOR WEST 42ND STREET WORKS

A. Block 1089 Lot 1:

1. **Grantor:** The Metropolitan Gas Light
Company of the City of New York

Grantee: The Consolidated Gas Company of New York,

Deed dated 11/10/1884 and recorded on 1/30/1885 in Liber 1863 Cp 33.

2. **Grantor:** The Consolidated Gas Company of New York

Grantee: The New York Edison Company

Deed dated 10/13/1923 and recorded on 7/9/1924 in Liber 3427 Cp 474.

3. **Grantor:** The New York Edison Company

Grantee: New York State Realty and
Terminal Company

Deed dated 10/20/1927 and recorded on 10/21/1927 in Liber 3619 Cp 439.

4. **Grantor:** New York State Realty and
Terminal Company

Grantee: The New York Central Railroad Company

Deed dated 12/28/1932 and recorded on 12/29/1932 in Liber 3854 Cp 158.

5. **Grantor:** The New York Central Railroad Company

Grantee: Cola Realty Corp.

Deed dated 6/22/1962 and recorded on 7/6/1962 in Liber 5191 Cp 163.

6. **Grantor:** Cola Realty Corp.
Grantee: Railway Express Agency, Incorporated
Deed dated 7/2/1962 and recorded on 7/6/1962 in Liber 5191 Cp 166.
 7. **Grantor:** Railway Express Agency, Incorporated
Grantee: Joseph D. Keenan and Roger Deed, Trustees
Under Terms Of A Certain Trust Agreement
dated 5/31/1967,
Deed dated 5/31/1967 and recorded on 6/7/1967 in Record Liber 189 Page 108.
 8. **Grantor:** Joseph D. Keenan, Roger Deed, Trustees
Under Terms Of A Certain Trust Agreement
dated 5/31/1967,
Grantee: Chrysler Realty Corporation
Deed dated 6/30/1969 and recorded on 7/18/1969 in Reel 146 Page 1076.
 9. **Grantor:** ABKO Properties, Inc.
f/k/a Chrysler Realty Corporation
Grantee: Ivory Forty-Two Realty Corp.
Deed dated 2/16/1981 and recorded on 3/5/1981 in Reel 557 Page 855.
 10. **Grantor:** Ivory Forty-Two Realty Corp.
Grantee: Silverstein 42nd Associates
Deed dated 7/19/1984 and recorded on 7/24/1984 in Reel 816 Page 759.
 11. **Grantor:** Silverstein 42nd Associates, L.P.
Grantee: River Place I LLC
Deed dated 12/26/1996 and recorded on 12/30/1996 in Reel 2406 Page 2363.
- No further deeds found through March 25, 2002.



Commonwealth
A LANDAMERICA COMPANY

Special Search No.: SS020418A

DEED CHAINS FOR WEST 42ND STREET WORKS

B. Block 1089 Lot 3:

Deeds 1 through 10 same as Block 1089 Lot 1 above, then:

11. **Grantor:** Silverstein 42nd Associates, L.P.

Grantee: River Place II LLC

Deed dated 6/14/1999 and recorded on 7/8/1999 in Reel 2909 Page 1057.

No further deeds found through March 25, 2002.

APPENDIX B
EDR REPORT

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc. (EDR). The report meets the government records search requirements of ASTM Standard Practice for Environmental Site Assessments, E 1527-00. Search distances are per ASTM standard or custom distances requested by the user.

TARGET PROPERTY INFORMATION

ADDRESS

WEST 42ND STREET
MANHATTAN, NY 10036

COORDINATES

Latitude (North): 40.761100 - 40° 45' 40.0"
Longitude (West): 74.000100 - 74° 0' 0.4"
Universal Transverse Mercator: Zone 18
UTM X (Meters): 584398.9
UTM Y (Meters): 4512507.0

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property: 2440074-G1 WEEHAWKEN, NJ NY
Source: USGS 7.5 min quad index

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the ASTM E 1527-00 search radius around the target property for the following databases:

FEDERAL ASTM STANDARD

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System
CERC-NFRAP..... CERCLIS No Further Remedial Action Planned
CORRACTS..... Corrective Action Report
RCRIS-TSD..... Resource Conservation and Recovery Information System
ERNS..... Emergency Response Notification System

STATE ASTM STANDARD

SHWS..... Inactive Hazardous Waste Disposal Sites in New York State
SWF/LF..... Facility Register
MOSF UST..... Major Oil Storage Facilities Database
VCP..... Voluntary Cleanup Agreements
SWTIRE..... Registered Waste Tire Storage & Facility List
SWRCY..... Registered Recycling Facility List

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NYCT GREYHOUND BUS TERMINAL	525 11TH AVE	0 - 1/8 SSE	D13	51
EDISON PARKING LOT	500-516 12TH AVE	1/8 - 1/4 WSW	F24	103
PORT AUTH OF NY NJ 12TH AVE	39TH ST 12TH AVE	1/8 - 1/4 WSW	F26	109
CON EDISON - WEST 42ND ST SUB	571 W 41ST ST	1/8 - 1/4 SE	28	114
PORT AUTH OF NY NJ 11TH AVE	11TH AVE 39TH ST	1/8 - 1/4 S	29	115
TRAILWAYS INC	544 W 41ST ST	1/8 - 1/4 SE	J36	121
MILLER-GERALDI INC	609 11TH AVE	1/8 - 1/4 NE	I41	134
MERCEDES-BENZ MANHATTAN INC	528 W 41ST ST	1/8 - 1/4 SE	J42	134
MARTIN MANHATTAN ACURA	11TH AVE W 46TH ST	1/8 - 1/4 NE	N58	163

RCRIS: The Resource Conservation and Recovery Act database includes selected information on sites that generate, store, treat, or dispose of hazardous waste as defined by the Act. The source of this database is the U.S. EPA.

A review of the RCRIS-SQG list, as provided by EDR, and dated 06/21/2000 has revealed that there are 10 RCRIS-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NEW YORK TELEPHONE CO	605 W 42ND ST	0 - 1/8 E	C6	46
NYCTA - 11TH AVE BUS DEPOT MTA	525 11TH AVE	0 - 1/8 SSE	D15	85
MOBIL OIL CORP SS QDL	561 11TH AVE	0 - 1/8 E	E16	85
NEW YORK TELEPHONE CO	604 W 43RD ST	0 - 1/8 ENE	E22	100
CIRCLE LINE	PIER 83 43RD ST	1/8 - 1/4 NW	31	115
DEMARCO JOSEPH E	595 11TH AVE	1/8 - 1/4 ENE	G32	116
KELLERMANN PAINT CO INC	605 W 45TH ST	1/8 - 1/4 NE	I38	123
MY PRINT CO LIMIT	711 12TH AVE PIER 88	1/8 - 1/4 NNE	L46	140
A G F A DIV OF BAYER CORP	711 12TH AVE PIER 92	1/8 - 1/4 NNE	L47	140
MERCEDES BENZ MANHATTAN INC	528 W 39TH ST	1/8 - 1/4 SSE	55	154

STATE ASTM STANDARD

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 10/01/2001 has revealed that there are 55 LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
643 W 43RD ST/UPS	643 W 43RD ST	0 - 1/8 NNE	B4	10
VERIZON	605 WEST 42ND ST	0 - 1/8 E	C7	47
608 W 40 ST - MAN	608 W 40 ST	0 - 1/8 SSE	10	49
525 N 11TH AVE/MANH/GREYH	525 NORTH 11TH AVENUE	0 - 1/8 SSE	D12	50
MOBIL OIL CORP SS QDL	561 11TH AVE	0 - 1/8 E	E16	85
MOBIL S/S	561 11TH AVENUE	0 - 1/8 E	E17	91
MOBIL GAS STATION	561 11TH AVE	0 - 1/8 E	E18	92
523 11TH AV/GREYHOUND BUS	523 11TH AVENUE	0 - 1/8 SSE	D19	93
SILVERSTEIN 42ND ASSOC.	500-516 12TH AVE	1/8 - 1/4 WSW	F25	108
612 W 45TH ST/UPS	612 W 45TH ST	1/8 - 1/4 NE	I34	118
609-611 11TH ST	611 11TH AVENUE	1/8 - 1/4 NE	I45	139

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NYNEX	615 W 42ND ST	0 - 1/8 E	A3	8
UNITED PARCEL SERVICE	643 W 43RD ST	0 - 1/8 NNE	B5	12
M.J. QUILL DEPOT	525 ELEVENTH AVE	0 - 1/8 SSE	D14	52
MOBIL OIL CORP SS QDL	561 11TH AVE	0 - 1/8 E	E16	85
NEW YORK TELEPHONE	563 11TH AVE	0 - 1/8 E	E20	95
BELL ATLANTIC	604-628 WEST 43RD STREE	0 - 1/8 ENE	E21	97
CONSULATE GENERAL OF P.R.CHINA	520 12TH AVE	1/8 - 1/4 WSW	F23	101
EDISON PARKING LOT	500-516 12TH AVE	1/8 - 1/4 WSW	F24	103
SILVERSTEIN PROPERTIES: YALE B	460 TWELFTH AVENUE	1/8 - 1/4 WSW	F27	109
RIVERBANK WEST	560 WEST 43RD STREET	1/8 - 1/4 E	H33	116
UNITED PARCEL SERVICE	612 WEST 45TH STREET	1/8 - 1/4 NE	I35	119
MERCHANDISING WORKSHOP INC	550 W 43RD ST	1/8 - 1/4 E	H37	122
MERCEDES/BENZ MANHATTAN INC	536 W 41 ST	1/8 - 1/4 SE	J39	123
SWING TIME LLC CORP.	609 11TH AVENUE	1/8 - 1/4 NE	I40	129
43RD PARKING CORP	541 W 43 ST	1/8 - 1/4 E	K43	135
MARVIN MITHELL	541 WEST 43RD STREET	1/8 - 1/4 E	K44	137
F.D.N.Y.-RESCUE CO. 1	530 WEST 43RD STREET	1/8 - 1/4 E	K50	143
AMERICAN RED CROSS EMERGENCY F	515 WEST 41ST STREET	1/8 - 1/4 SE	M52	148
I&G EXPRESS INC.	456 11TH AVENUE	1/8 - 1/4 S	53	149
TRAVEL INN HOTEL	515 WEST 42ND STREET	1/8 - 1/4 ESE	54	153
MERCEDES BENZ MANHATTAN INC	528 W 39TH ST	1/8 - 1/4 SSE	55	154
ANNEX BLDG	521 WEST 43TH STREET	1/8 - 1/4 E	56	156
METROPOLITAN LUMBER COMPANY	617 11TH AVE	1/8 - 1/4 NE	N57	158

CBS UST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the CBS UST list, as provided by EDR, and dated 10/01/2001 has revealed that there is 1 CBS UST site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
M.J. QUILL DEPOT	525 ELEVENTH AVE	0 - 1/8 SSE	D14	52

STATE OR LOCAL ASTM SUPPLEMENTAL

CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the CBS AST list, as provided by EDR, and dated 10/01/2001 has revealed that there are 2 CBS AST sites within approximately 0.25 miles of the target property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
UNITED PARCEL SERVICE	643 W 43RD ST	0 - 1/8 NNE	B5	12
M.J. QUILL DEPOT	525 ELEVENTH AVE	0 - 1/8 SSE	D14	52

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

<u>Site Name</u>	<u>Database(s)</u>
NU METHOD DYEING & PROCESSING	SHWS
NU METHOD DYEING & PROCESSING	SHWS
48TH STREET PARKING LOT	SHWS
UNION CITY DEPARTMEN PUBLIC WORKS	SHWS
WALL STREET AND	LTANKS
57-15 49TH STREET	NY Spills, LTANKS
PIER 79	UST
43 WEST 61ST STREET ASSOCH	RCRIS-SQG, FINDS
WEST 57TH ST. CONCRETE CO.	CBS AST

OVERVIEW MAP - 745748.1s - Con-Edison Company

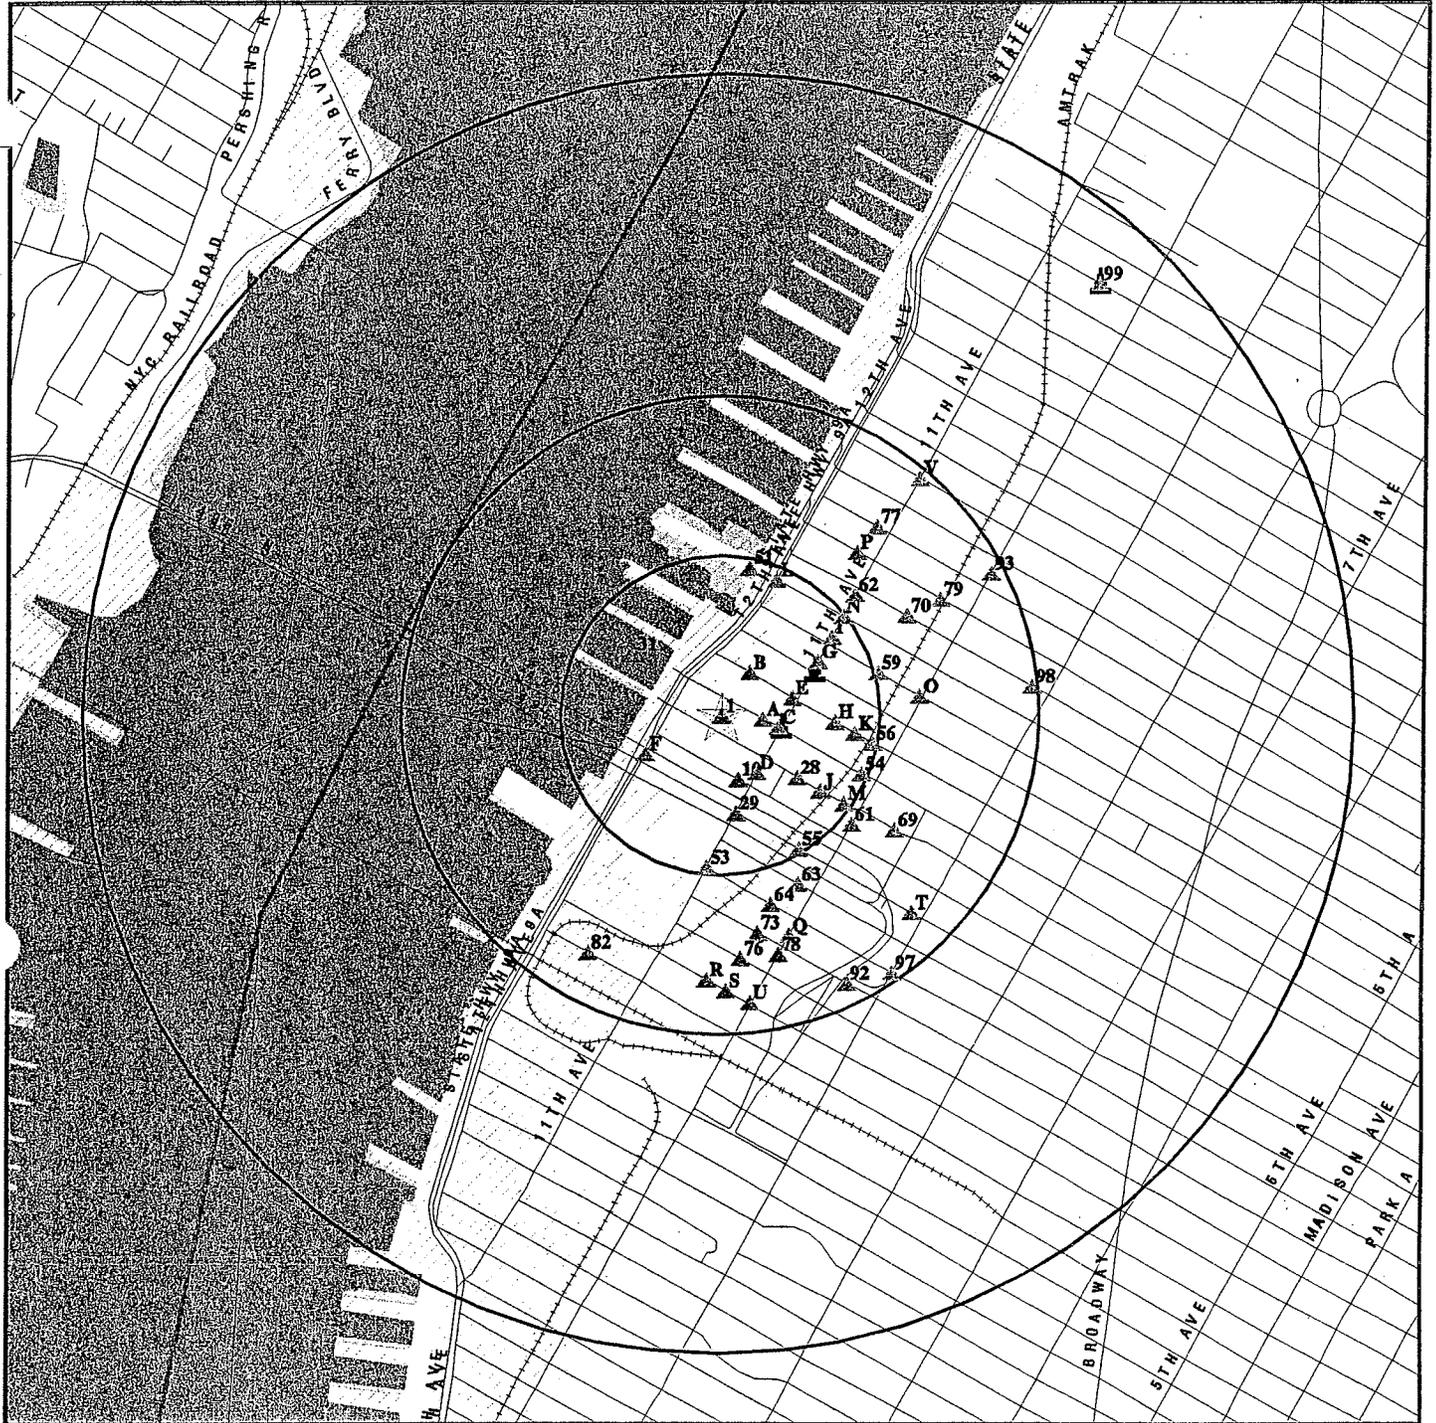


- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- National Priority List Sites
- Landfill Sites

- Power transmission lines
- Oil & Gas pipelines
- 100-year flood zone
- 500-year flood zone
- Wetlands

TARGET PROPERTY: West 42nd Street Works
ADDRESS: West 42nd Street
CITY/STATE/ZIP: Manhattan NY 10036
LAT/LONG: 40.7611 / 74.0001

CUSTOMER: Con-Edison Company
CONTACT: Glen Katz
INQUIRY #: 745748.1s
DATE: March 18, 2002 9:04 am

DETAIL MAP - 745748.1s - Con-Edison Company

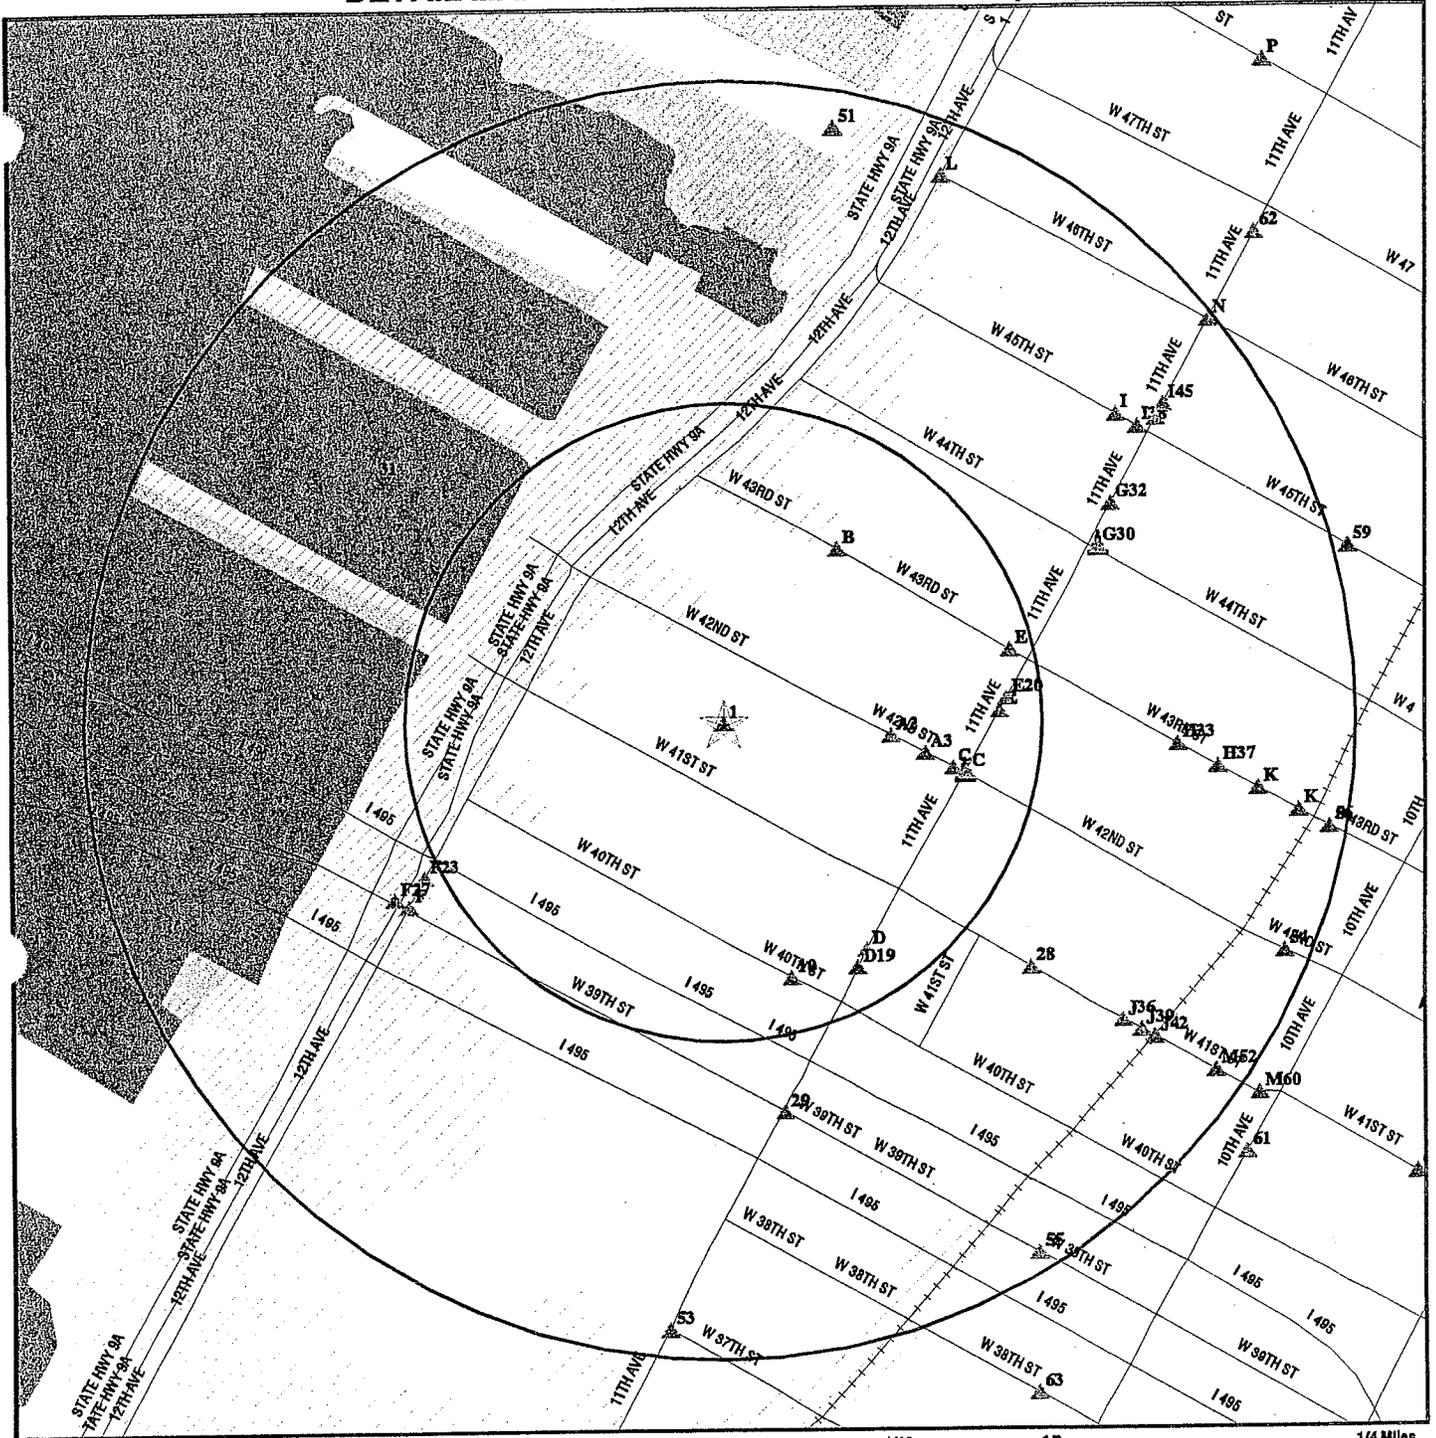

- ☆ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- ✚ Sensitive Receptors
- ▨ National Priority List Sites
- ▩ Landfill Sites
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▩ 500-year flood zone
- ▩ Wetlands

TARGET PROPERTY: ADDRESS: CITY/STATE/ZIP: LAT/LONG:	West 42nd Street Works West 42nd Street Manhattan NY 10036 40.7611 / 74.0001	CUSTOMER: CONTACT: INQUIRY #: DATE:	Con-Edison Company Glen Katz 745748.1s March 18, 2002 9:04 am
---	---	---	--

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	Search Distance					Total Plotted
			< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	
<u>FEDERAL ASTM STANDARD</u>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
CERCLIS		0.500	0	0	0	NR	NR	0
CERC-NFRAP		0.250	0	0	NR	NR	NR	0
CORRACTS		1.000	0	0	0	0	NR	0
RCRIS-TSD		0.500	0	0	0	NR	NR	0
RCRIS Lg. Quan. Gen.		0.250	4	8	NR	NR	NR	12
RCRIS Sm. Quan. Gen.		0.250	4	6	NR	NR	NR	10
ERNS		TP	NR	NR	NR	NR	NR	0
<u>STATE ASTM STANDARD</u>								
State Haz. Waste		1.000	0	0	0	0	NR	0
State Landfill		0.500	0	0	0	NR	NR	0
LTANKS		0.500	8	7	40	NR	NR	55
UST		0.250	7	17	NR	NR	NR	24
CBS UST		0.250	1	0	NR	NR	NR	1
MOSF UST		0.500	0	0	0	NR	NR	0
VCP		0.500	0	0	0	NR	NR	0
SWTIRE		0.500	0	0	0	NR	NR	0
SWRCY		0.500	0	0	0	NR	NR	0
<u>FEDERAL ASTM SUPPLEMENTAL</u>								
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
Delisted NPL		1.000	0	0	0	0	NR	0
FINDS		TP	NR	NR	NR	NR	NR	0
HMIRS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
NPL Liens		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
FTTS		TP	NR	NR	NR	NR	NR	0
<u>STATE OR LOCAL ASTM SUPPLEMENTAL</u>								
HSWDS		0.500	0	0	0	NR	NR	0
AST		TP	NR	NR	NR	NR	NR	0
CBS AST		0.250	2	0	NR	NR	NR	2
MOSF AST		0.500	0	0	0	NR	NR	0
NY Spills		TP	NR	NR	NR	NR	NR	0
<u>EDR PROPRIETARY HISTORICAL DATABASES</u>								
Coal Gas		1.000	1	1	0	1	NR	3

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

1 WEST 42ND ST SUB-STATION NY Spills S103937116
WEST 42ND ST N/A
< 1/8
1
Higher

SPILLS:

Spill Number: 9901561 Region of Spill: 2
Facility Contact: CALLER Facility Tele: () -
Investigator: O'CONNELL SWIS: 62
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: CALLER Spiller Phone: Not reported
Spiller: CON ED
Spiller Address: 4 IRVING PLACE
MANHATTAN, NY 10003
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Equipment Failure Resource Affected: On Land
Water Affected: Not reported Spill Source: Other Commercial/Industrial
Spill Notifier: Responsible Party PBS Number: Not reported
Spill Date: 05/10/1999 14:30 Reported to Dept: 05/10/1999 15:28
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 07/31/2000
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 05/10/1999
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 1
Units: Gallons
Unknown Qty Spilled: Yes
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: TRANSFORMER OIL
Class Type: Petroleum
Chem Abstract Service Number: TRANSFORMER OIL
Last Date: 09/26/1994
Num Times Material Entry In File: 533

Remarks: con ed 124769. cleanup crew responding.
DEC Remarks: DEC INSPECTOR NOTES Stilla waiting info requested 6-22, reply on 7-02

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

MYRON GARFINKEL (Continued)

EDR ID Number
 EPA ID Number

Database(s)

Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2

U003312878

A3
 East
 < 1/8
 422
 Higher

NYNEX
 615 W 42ND ST
 NEW YORK, NY 10036

UST U000417979
 N/A

Site 2 of 2 in cluster A

PBS UST:
 PBS Number: 2-344648 CBS Number: Not reported
 SPDES Number: Not reported SWIS ID: 6201
 Operator: NYNEX
 (718) 330-8383
 Emergency Contact: NYNEX
 (718) 330-8383
 Total Tanks: 0
 Owner: NYNEX
 221 EAST 37TH STREET, 6TH FLOOR
 NEW YORK, NY 10016
 (212) 338-7881
 Owner Type: Not reported
 Owner Mark: First Owner
 Owner Subtype: New York Telephone
 Mailing Address: NYNEX
 ATTN: PETER T INGRASSIA
 221 EAST 37TH STREET, 6TH FLOOR
 NEW YORK, NY 10016
 (212) 338-7881
 Tank Status: Closed - In Place
 Capacity (gals): 550
 Tank Location: UNDERGROUND
 Tank Id: 001 Install Date: Not reported
 Tank Type: Steel/carbon steel Product Stored: UNLEADED GASOLINE
 Tank Internal: Not reported Pipe Internal: Not reported
 Pipe Location: 1 Pipe Type: STEEL/IRON
 Tank External: Not reported
 Missing Data for Tank: Minor Data Missing
 Pipe External: Not reported
 Second Containment: NONE
 Leak Detection: NONE
 Overfill Prot: 2 Dispenser: Suction
 Date Tested: Not reported Next Test Date: Not reported
 Date Closed: 03/01/1992 Test Method: Not reported
 Deleted: False Updated: True
 Dead Letter: False Owner Screen: Minor data missing
 FAMT: Fiscal amount for registration fee is correct
 Total Capacity: 0 Renewal Date: 02/23/1993
 Tank Screen: 0 Federal ID: Not reported
 Renew Flag: Renewal has been printed Facility Screen: Minor data missing
 Certification Flag: False Certification Date: 12/14/1987
 Old PBS Number: Not reported Expiration Date: 12/14/1992
 Inspected Date: Not reported Inspector: Not reported
 Inspection Result: Not reported
 Lat/long: Not reported
 Facility Type: Not reported
 Town or City: NEW YORK CITY

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

NYNEX (Continued)

U000417979

Operator: NYNEX
 (718) 330-8383
 Emergency Contact: NYNEX
 (718) 330-8383
 Total Tanks: 0
 Owner: NYNEX
 221 EAST 37TH STREET, 6TH FLOOR
 NEW YORK, NY 10016
 (212) 338-7881
 Owner Type: Not reported
 Owner Mark: First Owner
 Owner Subtype: New York Telephone
 Mailing Address: NYNEX
 ATTN: PETER T INGRASSIA
 221 EAST 37TH STREET, 6TH FLOOR
 NEW YORK, NY 10016
 (212) 338-7881
 Tank Status: Closed - In Place
 Capacity (gals): 550
 Tank Location: UNDERGROUND
 Tank Id: 003
 Tank Type: Steel/carbon steel
 Tank Internal: Not reported
 Pipe Location: 1
 Tank External: Not reported
 Missing Data for Tank: Minor Data Missing
 Pipe External: Not reported
 Second Containment: NONE
 Leak Detection: NONE
 Overfill Prot: 2
 Date Tested: Not reported
 Date Closed: 03/01/1993
 Deleted: False
 Dead Letter: False
 FAMT: Fiscal amount for registration fee is correct
 Total Capacity: 0
 Tank Screen: 0
 Renew Flag: Renewal has been printed
 Certification Flag: False
 Old PBS Number: Not reported
 Inspected Date: Not reported
 Inspection Result: Not reported
 Lat/long: Not reported
 Facility Type: Not reported
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Install Date: Not reported
 Product Stored: UNLEADED GASOLINE
 Pipe Internal: Not reported
 Pipe Type: STEEL/IRON
 Dispenser: Suction
 Next Test Date: Not reported
 Test Method: Not reported
 Updated: True
 Owner Screen: Minor data missing
 Renewal Date: 02/23/1993
 Federal ID: Not reported
 Facility Screen: Minor data missing
 Certification Date: 12/14/1987
 Expiration Date: 12/14/1992
 Inspector: Not reported

B4
 NNE
 < 1/8
 430
 Higher

643 W 43RD ST/UPS
 643 W 43RD ST
 NYC, NY
 Site 1 of 2 in cluster B

LTANKS S100493387
 N/A

LTANKS:
 Spill Number: 9200470
 Facility Contact: Not reported
 Investigator: AUSTIN
 Region of Spill: 2
 Facility Tele: Not reported
 SWIS: 62

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

643 W 43RD ST/UPS (Continued)

S100493387

Spiller Contact: Not reported Spiller Phone: Not reported
Spiller: Not reported
Spiller Address: Not reported
Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/31/1995
Spill Cause: Tank Failure Resource Affected: On Land
Water Affected: Not reported Spill Source: Other Commercial/Industrial
Spill Notifier: Responsible Party PBS Number: Not reported
Spill Date: 05/22/1992 09:00 Reported to Dept: 05/28/1992 11:23
Cleanup Ceased: 03/31/1995
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 03/31/1995
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 06/02/1992
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Not reported
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: Not reported
Spill Cause: EXCAVATING CONTAMINATED SOIL TO TANK TOP-25 TANKS TO BE CLOSED. STOCKPILING SOIL; WILL SAMPLE TEST DISPOSE. SEE 9200470

B5 UNITED PARCEL SERVICE
NNE 643 W 43RD ST
< 1/8 NEW YORK, NY 10036
430
Higher Site 2 of 2 in cluster B

FINDS 1000398410
RCRIS-LQG NYD006991673
UST
CBS AST
AST

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Mail Name:	UNITED PARCEL SERVICE, INC.	
Mail Contact:	DISTRICT PLANT ENGINEERING 643 WEST 43 STREET NEW YORK, NY 10036	
Mail Phone:	(212) 631-6446	
Tank Secret:	False	Date Entered: 01/31/1997 09:06:59
Last Test:	Not reported	Due Date: Not reported
Pipe Flag:	False	Owner Mark: 1
Renew Date:	Not reported	Date Expired: Not reported
Is it There:	False	Is Updated: False
Owner Status:	F	
Certificate Needs to be Printed:	False	
Fiscal Amt for Registration Fee Correct:	True	
Renewal Has Been Printed for Facility:	True	
Total Capacity of All Active Tanks(gal):	500	
Unique Tank Id Number:	AST-1	
Date Pre-Printed Renewal App Form Was Last Printed:	11/02/2000	
PBS UST:		
PBS Number:	2-600720	CBS Number: Not reported
SPDES Number:	Not reported	SWIS ID: 6201
Operator:	THOMAS J. SAVAGE (212) 631-6446	
Emergency Contact:	PAUL MCDONALD (212) 631-6444	
Total Tanks:	5	
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6446	
Owner Type:	Corporate/Commercial	
Owner Mark:	First Owner	
Owner Subtype:	Not reported	
Mailing Address:	UNITED PARCEL SERVICE ATTN: PLANT ENGINEERING DEPT FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6444	
Tank Status:	In Service	
Capacity (gals):	15000	
Tank Location:	UNDERGROUND	
Tank Id:	3	Install Date: 12/01/1961
Tank Type:	Steel/carbon steel	Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Internal:	FIBERGLASS LINER [FRP]	Pipe Internal: NONE
Pipe Location:	Underground	Pipe Type: FIBERGLASS [FRP]
Tank External:	NONE/IMPRESSED CURRENT	
Missing Data for Tank:	No Missing Data	
Pipe External:	NONE/NONE	
Second Containment:	NONE/DOUBLED-WALLED TANK	
Leak Detection:	INTERSTITIAL MONITORING/IN-TANK SYSTEM	
Overfill Prot:	High Level Alarm	Dispenser: Suction
Date Tested:	Not reported	Next Test Date: Not reported
Date Closed:	Not reported	Test Method: Not reported
Deleted:	False	Updated: True
Dead Letter:	False	Owner Screen: No data missing
FAMT:	Fiscal amount for registration fee is correct	
Total Capacity:	38500	Renewal Date: 01/02/1997

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-600720	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	THOMAS J. SAVAGE (212) 631-6446		
Emergency Contact:	PAUL MCDONALD (212) 631-6444		
Total Tanks:	5		
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6446		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	UNITED PARCEL SERVICE ATTN: PLANT ENGINEERING DEPT FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6444		
Tank Status:	In Service		
Capacity (gals):	4000		
Tank Location:	UNDERGROUND		
Tank Id:	2	Install Date:	09/01/1992
Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Underground	Pipe Type:	FIBERGLASS [FRP]
Tank External:	NONE/SACRIFICIAL ANODE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/DOUBLED-WALLED TANK		
Leak Detection:	INTERSTITIAL MONITORING/IN-TANK SYSTEM		
Overfill Prot:	High Level Alarm	Dispenser:	Submersible
Date Tested:	04/01/1999	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	TANKOLOGY [VACUTECT]
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	38500	Renewal Date:	01/02/1997
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/25/1999
Old PBS Number:	Not reported	Expiration Date:	04/17/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

643 WEST 43 STREET
 NEW YORK, NY 10036
 (212) 631-6446

Facility Status:	Active		
Total Tanks	1		
Tank Status:	In Service		
Tank Error Status:	No Missing Data		
Tank Location:	Aboveground		
Install Date:	09/93		
Capacity (Gal):	500		
Tank Type:	Steel/carbon steel		
Substance:	Single Hazardous Substance on DEC List		
Extrnl Protection:	None		
Intrnl Protection:	None		
Tank Containment:	Double-Walled		
Pipe Type:	STEEL/IRON	Pipe Location:	Aboveground
Pipe Internal:	None		
Pipe External:	None		
Pipe Containment:	None	Haz Percent:	50
Leak Detection:	None		
Overfill Protection:	4/4		
Chemical:	Ethylene glycol	Tank Closed:	Not reported
PBS Number:	2-600720	SWIS Code:	6201
Federal ID:	Not reported		
MOSF Number:	Not reported	CAS Number:	107211
SPDES Number:	Not reported	ICS Number:	Not reported
Facility Type:	Other		
Operator:	TOM SAVAGE	Facility Town:	NEW YORK CITY
Emrgncy Contact:	GENE ASCHOFF	Emrgncy Phone:	(212) 631-6444
Certified Date:	03/27/2001	Expiration Date:	01/31/2003
Owner type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Mail Name:	UNITED PARCEL SERVICE, INC.		
Mail Contact:	DISTRICT PLANT ENGINEERING		
	643 WEST 43 STREET		
	NEW YORK, NY 10036		
Mail Phone:	(212) 631-6446		
Tank Secret:	False	Date Entered:	01/31/1997 09:06:59
Last Test:	Not reported	Due Date:	Not reported
Pipe Flag:	False	Owner Mark:	1
Renew Date:	Not reported	Date Expired:	Not reported
Is it There:	False	Is Updated:	False
Owner Status:	F		
Certificate Needs to be Printed:	False		
Fiscal Amt for Registration Fee Correct:	True		
Renewal Has Been Printed for Facility:	True		
Total Capacity of All Active Tanks(gal):	500		
Unique Tank Id Number:	AST-1		
Date Pre-Printed Renewal App Form Was Last Printed:			11/02/2000

PBS AST:

PBS Number:	2-600720	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	4 - Subpart 360-14 only (active)		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NUBEE INC	
	643 WEST 43RD STREET	
	NEW YORK, NY 10036	
Owner Phone:	(212) 631-6446	
Facility Phone:	(212) 631-6446	
Operator:	THOMAS J. SAVAGE	
Emergency Name:	PAUL MCDONALD	
Emergency Phone:	(212) 631-6444	
Total Tanks:	5	
Total Capacity:	38500	
Tank ID:	002	
Capacity (Gal):	550	
Missing Data for Tank :	Minor data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LEADED GASOLINE	
Tank Type:	Steel/carbon steel	
Install Date:	12/01/1961	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING	
Tank Containment:	EARTHEN DIKE	
Pipe Type:	GALVANIZED STEEL	
Pipe Location:	Not reported	
Pipe Internal:	NONE	
Pipe External:	NONE	
Leak Detection:	DOUBLE BOTTOM	
Overfill Protection:	Vent Whistle	
Dispenser Method:	Suction	
Date Tested:	//	Next Test Date: //
Date Closed:	05/01/1992	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	Not reported	Inspector: Not reported
Result of Inspection:	Not reported	
Mailing Name:	UNITED PARCEL SERVICE	
Mailing Address:	FIFTH FLOOR	
	643 WEST 43RD STREET	
	NEW YORK, NY 10036	
Mailing Contact:	PLANT ENGINEERING DEPT	
Mailing Telephone:	(212) 631-6444	
Owner Mark:	First Owner	Expiration Date: 04/17/2002
Certification Flag:	False	Certification Date: 06/25/1999
Renew Flag:	False	Renew Date: 01/02/1997
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	NEW YORK CITY	
Town or City Code:	01	
County Code:	62	
Region:	2	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	2-600720	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 6201
Federal ID:	Not reported	Previous PBS#: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	4 - Subpart 360-14 only (active)		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036		
Owner Phone:	(212) 631-6446		
Facility Phone:	(212) 631-6446		
Operator:	THOMAS J. SAVAGE		
Emergency Name:	PAUL MCDONALD		
Emergency Phone:	(212) 631-6444		
Total Tanks:	5		
Total Capacity:	38500		
Tank ID:	004		
Capacity (Gal):	550		
Missing Data for Tank :	Minor data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LEADED GASOLINE		
Tank Type:	Steel/carbon steel		
Install Date:	12/01/1961		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING		
Tank Containment:	EARTHEN DIKE		
Pipe Type:	GALVANIZED STEEL		
Pipe Location:	Not reported		
Pipe Internal:	NONE		
Pipe External:	NONE		
Leak Detection:	DOUBLE BOTTOM		
Overfill Protection:	Vent Whistle		
Dispenser Method:	Suction		
Date Tested:	//	Next Test Date:	//
Date Closed:	05/01/1992	Test Method:	Not reported
Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	UNITED PARCEL SERVICE		
Mailing Address:	FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036		
Mailing Contact:	PLANT ENGINEERING DEPT		
Mailing Telephone:	(212) 631-6444	Expiration Date:	04/17/2002
Owner Mark:	First Owner	Certification Date:	06/25/1999
Certification Flag:	False	Renew Date:	01/02/1997
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
Fiscal Amount for Registration Fee is Correct:	True		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Region: 2
 Fiscal Amount for Registration Fee is Correct: True

PBS Number: 2-600720
 SPDES Number: Not reported
 Federal ID: Not reported
 Facility Status: 4 - Subpart 360-14 only (active)
 Facility Type: TRUCKING/TRANSPORTATION
 Owner Type: Corporate/Commercial
 Owner Sub Type: Not reported
 Owner: NUBEE INC
 643 WEST 43RD STREET
 NEW YORK, NY 10036

Owner Phone: (212) 631-6446
 Facility Phone: (212) 631-6446
 Operator: THOMAS J. SAVAGE
 Emergency Name: PAUL MCDONALD
 Emergency Phone: (212) 631-6444
 Total Tanks: 5
 Total Capacity: 38500
 Tank ID: 006
 Capacity (Gal): 550
 Missing Data for Tank: Minor data missing
 Tank Location: ABOVEGROUND
 Product Stored: LEADED GASOLINE
 Tank Type: Steel/carbon steel
 Install Date: 12/01/1961
 Tank Internal: NONE
 Tank External: PAINTED/ASPHALT COATING
 Tank Containment: EARTHEN DIKE
 Pipe Type: GALVANIZED STEEL
 Pipe Location: Not reported
 Pipe Internal: NONE
 Pipe External: NONE
 Leak Detection: DOUBLE BOTTOM
 Overfill Protection: Vent Whistle
 Dispenser Method: Suction
 Date Tested: / /
 Date Closed: 05/01/1992
 Updated: True
 Date Inspected: Not reported
 Result of Inspection: Not reported
 Mailing Name: UNITED PARCEL SERVICE
 Mailing Address: FIFTH FLOOR
 643 WEST 43RD STREET
 NEW YORK, NY 10036
 Mailing Contact: PLANT ENGINEERING DEPT
 Mailing Telephone: (212) 631-6444
 Owner Mark: First Owner
 Certification Flag: False
 Renew Flag: False
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: No data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY

CBS Number: Not reported
 SWIS Code: 6201
 Previous PBS#: Not reported

Next Test Date: / /
 Test Method: Not reported
 Deleted: False
 Inspector: Not reported

Expiration Date: 04/17/2002
 Certification Date: 06/25/1999
 Renew Date: 01/02/1997

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 2-600720
SPDES Number: Not reported
Federal ID: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC

CBS Number: Not reported
SWIS Code: 6201
Previous PBS#: Not reported

643 WEST 43RD STREET
NEW YORK, NY 10036

Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446
Operator: THOMAS J. SAVAGE
Emergency Name: PAUL MCDONALD
Emergency Phone: (212) 631-6444

Total Tanks: 5
Total Capacity: 38500
Tank ID: 008
Capacity (Gal): 550

Missing Data for Tank: Minor data missing
Tank Location: ABOVEGROUND
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING
Tank Containment: EARTHEN DIKE
Pipe Type: GALVANIZED STEEL
Pipe Location: Not reported
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: DOUBLE BOTTOM

Overfill Protection: Vent Whistle
Dispenser Method: Suction

Date Tested: / /
Date Closed: 05/01/1992
Updated: True

Next Test Date: / /
Test Method: Not reported
Deleted: False
Inspector: Not reported

Date Inspected: Not reported
Result of Inspection: Not reported
Mailing Name: UNITED PARCEL SERVICE
Mailing Address: FIFTH FLOOR

643 WEST 43RD STREET
NEW YORK, NY 10036
Mailing Contact: PLANT ENGINEERING DEPT

Mailing Telephone: (212) 631-6444

Owner Mark: First Owner
Certification Flag: False
Renew Flag: False
Lat/Long: Not reported
Dead Letter: False

Expiration Date: 04/17/2002
Certification Date: 06/25/1999
Renew Date: 01/02/1997

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 2-600720 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC
643 WEST 43RD STREET
NEW YORK, NY 10036
Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446
Operator: THOMAS J. SAVAGE
Emergency Name: PAUL MCDONALD
Emergency Phone: (212) 631-6444
Total Tanks: 5
Total Capacity: 38500
Tank ID: 010
Capacity (Gal): 550
Missing Data for Tank : Minor data missing
Tank Location: ABOVEGROUND
Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING
Tank Containment: EARTHEN DIKE
Pipe Type: GALVANIZED STEEL
Pipe Location: Not reported
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: DOUBLE BOTTOM
Overfill Protection: Vent Whistle
Dispenser Method: Suction
Date Tested: / / Next Test Date: / /
Date Closed: 05/01/1992 Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: UNITED PARCEL SERVICE
Mailing Address: FIFTH FLOOR
643 WEST 43RD STREET
NEW YORK, NY 10036
Mailing Contact: PLANT ENGINEERING DEPT
Mailing Telephone: (212) 631-6444
Owner Mark: First Owner Expiration Date: 04/17/2002

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

UNITED PARCEL SERVICE (Continued)

EDR ID Number
 EPA ID Number

Database(s)

1000398410

Mailing Telephone:	(212) 631-6444	Expiration Date:	04/17/2002
Owner Mark:	First Owner	Certification Date:	06/25/1999
Certification Flag:	False	Renew Date:	01/02/1997
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
Fiscal Amount for Registration Fee is Correct: True			
PBS Number:	2-600720	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	4 - Subpart 360-14 only (active)		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036		
Owner Phone:	(212) 631-6446		
Facility Phone:	(212) 631-6446		
Operator:	THOMAS J. SAVAGE		
Emergency Name:	PAUL MCDONALD		
Emergency Phone:	(212) 631-6444		
Total Tanks:	5		
Total Capacity:	38500		
Tank ID:	012		
Capacity (Gal):	550		
Missing Data for Tank :	Minor data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LEADED GASOLINE		
Tank Type:	Steel/carbon steel		
Install Date:	12/01/1961		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING		
Tank Containment:	EARTHEN DIKE		
Pipe Type:	GALVANIZED STEEL		
Pipe Location:	Not reported		
Pipe Internal:	NONE		
Pipe External:	NONE		
Leak Detection:	DOUBLE BOTTOM		
Overfill Protection:	Vent Whistle		
Dispenser Method:	Suction		
Date Tested:	//	Next Test Date:	//
Date Closed:	05/01/1992	Test Method:	Not reported
Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	UNITED PARCEL SERVICE		
Mailing Address:	FIFTH FLOOR 643 WEST 43RD STREET		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Mailing Address: FIFTH FLOOR
643 WEST 43RD STREET
NEW YORK, NY 10036

Mailing Contact: PLANT ENGINEERING DEPT
Mailing Telephone: (212) 631-6444

Owner Mark: First Owner
Certification Flag: False
Renew Flag: False
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 2-600720
SPDES Number: Not reported
Federal ID: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC
643 WEST 43RD STREET
NEW YORK, NY 10036

Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446
Operator: THOMAS J. SAVAGE
Emergency Name: PAUL MCDONALD
Emergency Phone: (212) 631-6444
Total Tanks: 5
Total Capacity: 38500
Tank ID: 014
Capacity (Gal): 550
Missing Data for Tank : Minor data missing
Tank Location: ABOVEGROUND
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING
Tank Containment: EARTHEN DIKE
Pipe Type: GALVANIZED STEEL
Pipe Location: Not reported
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: DOUBLE BOTTOM
Overfill Protection: Vent Whistle
Dispenser Method: Suction
Date Tested: / /
Date Closed: 05/01/1992
Updated: True
Date Inspected: Not reported

Expiration Date: 04/17/2002
Certification Date: 06/25/1999
Renew Date: 01/02/1997

CBS Number: Not reported
SWIS Code: 6201
Previous PBS#: Not reported

Next Test Date: / /
Test Method: Not reported
Deleted: False
Inspector: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	UNITED PARCEL SERVICE		
Mailing Address:	FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036		
Mailing Contact:	PLANT ENGINEERING DEPT		
Mailing Telephone:	(212) 631-6444		
Owner Mark:	First Owner	Expiration Date:	04/17/2002
Certification Flag:	False	Certification Date:	06/25/1999
Renew Flag:	False	Renew Date:	01/02/1997
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
Fiscal Amount for Registration Fee is Correct:	True		
PBS Number:	2-600720	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	4 - Subpart 360-14 only (active)		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036		
Owner Phone:	(212) 631-6446		
Facility Phone:	(212) 631-6446		
Operator:	THOMAS J. SAVAGE		
Emergency Name:	PAUL MCDONALD		
Emergency Phone:	(212) 631-6444		
Total Tanks:	5		
Total Capacity:	38500		
Tank ID:	016		
Capacity (Gal):	550		
Missing Data for Tank :	Minor data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	DIESEL		
Tank Type:	Steel/carbon steel		
Install Date:	12/01/1961		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING		
Tank Containment:	EARTHEN DIKE		
Pipe Type:	GALVANIZED STEEL		
Pipe Location:	Not reported		
Pipe Internal:	NONE		
Pipe External:	NONE		
Leak Detection:	DOUBLE BOTTOM		
Overfill Protection:	Vent Whistle		
Dispenser Method:	Suction		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Overfill Protection: Vent Whistle
Dispenser Method: Suction
Date Tested: / / Next Test Date: / /
Date Closed: 05/01/1992 Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: UNITED PARCEL SERVICE
Mailing Address: FIFTH FLOOR
643 WEST 43RD STREET
NEW YORK, NY 10036
Mailing Contact: PLANT ENGINEERING DEPT
Mailing Telephone: (212) 631-6444
Owner Mark: First Owner Expiration Date: 04/17/2002
Certification Flag: False Certification Date: 06/25/1999
Renew Flag: False Renew Date: 01/02/1997
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True
PBS Number: 2-600720 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC
643 WEST 43RD STREET
NEW YORK, NY 10036
Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446
Operator: THOMAS J. SAVAGE
Emergency Name: PAUL MCDONALD
Emergency Phone: (212) 631-6444
Total Tanks: 5
Total Capacity: 38500
Tank ID: 018
Capacity (Gal): 550
Missing Data for Tank: Minor data missing
Tank Location: ABOVEGROUND
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING
Tank Containment: EARTHEN DIKE
Pipe Type: GALVANIZED STEEL
Pipe Location: Not reported
Pipe Internal: NONE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Pipe Location: Not reported
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: DOUBLE BOTTOM
Overfill Protection: Vent Whistle
Dispenser Method: Suction
Date Tested: / / Next Test Date: / /
Date Closed: 05/01/1992 Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: UNITED PARCEL SERVICE
Mailing Address: FIFTH FLOOR
643 WEST 43RD STREET
NEW YORK, NY 10036
Mailing Contact: PLANT ENGINEERING DEPT
Mailing Telephone: (212) 631-6444
Owner Mark: First Owner Expiration Date: 04/17/2002
Certification Flag: False Certification Date: 06/25/1999
Renew Flag: False Renew Date: 01/02/1997
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True
PBS Number: 2-600720 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC
643 WEST 43RD STREET
NEW YORK, NY 10036
Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446
Operator: THOMAS J. SAVAGE
Emergency Name: PAUL MCDONALD
Emergency Phone: (212) 631-6444
Total Tanks: 5
Total Capacity: 38500
Tank ID: 020
Capacity (Gal): 550
Missing Data for Tank: Minor data missing
Tank Location: ABOVEGROUND
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING		
Tank Containment:	EARTHEN DIKE		
Pipe Type:	GALVANIZED STEEL		
Pipe Location:	Not reported		
Pipe Internal:	NONE		
Pipe External:	NONE		
Leak Detection:	DOUBLE BOTTOM		
Overfill Protection:	Vent Whistle		
Dispenser Method:	Suction		
Date Tested:	//	Next Test Date:	//
Date Closed:	05/01/1992	Test Method:	Not reported
Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	UNITED PARCEL SERVICE		
Mailing Address:	FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036		
Mailing Contact:	PLANT ENGINEERING DEPT		
Mailing Telephone:	(212) 631-6444	Expiration Date:	04/17/2002
Owner Mark:	First Owner	Certification Date:	06/25/1999
Certification Flag:	False	Renew Date:	01/02/1997
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
Fiscal Amount for Registration Fee is Correct: True			
PBS Number:	2-600720	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	4 - Subpart 360-14 only (active)		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036		
Owner Phone:	(212) 631-6446		
Facility Phone:	(212) 631-6446		
Operator:	THOMAS J. SAVAGE		
Emergency Name:	PAUL MCDONALD		
Emergency Phone:	(212) 631-6444		
Total Tanks:	5		
Total Capacity:	38500		
Tank ID:	022		
Capacity (Gal):	550		
Missing Data for Tank :	Minor data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	DIESEL		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Capacity (Gal):	550	
Missing Data for Tank :	Minor data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	DIESEL	
Tank Type:	Steel/carbon steel	
Install Date:	12/01/1961	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING	
Tank Containment:	EARTHEN DIKE	
Pipe Type:	GALVANIZED STEEL	
Pipe Location:	Not reported	
Pipe Internal:	NONE	
Pipe External:	NONE	
Leak Detection:	DOUBLE BOTTOM	
Overfill Protection:	Vent Whistle	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	05/01/1992	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	Not reported	Inspector: Not reported
Result of Inspection:	Not reported	
Mailing Name:	UNITED PARCEL SERVICE	
Mailing Address:	FIFTH FLOOR 643 WEST 43RD STREET NEW YORK, NY 10036	
Mailing Contact:	PLANT ENGINEERING DEPT	
Mailing Telephone:	(212) 631-6444	
Owner Mark:	First Owner	Expiration Date: 04/17/2002
Certification Flag:	False	Certification Date: 06/25/1999
Renew Flag:	False	Renew Date: 01/02/1997
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	NEW YORK CITY	
Town or City Code:	01	
County Code:	62	
Region:	2	
Fiscal Amount for Registration Fee is Correct: True		
PBS Number:	2-600720	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 6201
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	4 - Subpart 360-14 only (active)	
Facility Type:	TRUCKING/TRANSPORTATION	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NUBEE INC 643 WEST 43RD STREET NEW YORK, NY 10036	
Owner Phone:	(212) 631-6446	
Facility Phone:	(212) 631-6446	
Operator:	THOMAS J. SAVAGE	
Emergency Name:	PAUL MCDONALD	
Emergency Phone:	(212) 631-6444	
Total Tanks:	5	

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

Emergency Phone: (212) 631-6444
Total Tanks: 5
Total Capacity: 38500
Tank ID: 025
Capacity (Gal): 550
Missing Data for Tank : Minor data missing
Tank Location: ABOVEGROUND
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Install Date: 12/01/1961
Tank Internal: NONE
Tank External: PAINTED/ASPHALT COATING
Tank Containment: EARTHEN DIKE
Pipe Type: GALVANIZED STEEL
Pipe Location: Not reported
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: DOUBLE BOTTOM
Overfill Protection: Vent Whistle
Dispenser Method: Suction
Date Tested: / / Next Test Date: / /
Date Closed: 05/01/1992 Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: UNITED PARCEL SERVICE
Mailing Address: FIFTH FLOOR
643 WEST 43RD STREET
NEW YORK, NY 10036
Mailing Contact: PLANT ENGINEERING DEPT
Mailing Telephone: (212) 631-6444
Owner Mark: First Owner Expiration Date: 04/17/2002
Certification Flag: False Certification Date: 06/25/1999
Renew Flag: False Renew Date: 01/02/1997
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True
PBS Number: 2-600720 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 4 - Subpart 360-14 only (active)
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: NUBEE INC
643 WEST 43RD STREET
NEW YORK, NY 10036
Owner Phone: (212) 631-6446
Facility Phone: (212) 631-6446

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

1000398410

NEW YORK, NY 10036
 Owner Phone: (212) 631-6446
 Facility Phone: (212) 631-6446
 Operator: THOMAS J. SAVAGE
 Emergency Name: PAUL MCDONALD
 Emergency Phone: (212) 631-6444
 Total Tanks: 5
 Total Capacity: 38500
 Tank ID: 5
 Capacity (Gal): 500
 Missing Data for Tank : No data missing
 Tank Location: ABOVEGROUND
 Product Stored: USED OIL
 Tank Type: Steel/carbon steel
 Install Date: 09/01/1993
 Tank Internal: NONE
 Tank External: NONE/NONE
 Tank Containment: DOUBLED-WALLED TANK
 Pipe Type: STEEL/IRON
 Pipe Location: Aboveground
 Pipe Internal: NONE
 Pipe External: PAINTED/ASPHALT COATING
 Leak Detection: NONE
 Overfill Protection: High Level Alarm
 Dispenser Method: None
 Date Tested: // Next Test Date: //
 Date Closed: // Test Method: Not reported
 Updated: True Deleted: False
 Date Inspected: Not reported Inspector: Not reported
 Result of Inspection: Not reported
 Mailing Name: UNITED PARCEL SERVICE
 Mailing Address: FIFTH FLOOR
 643 WEST 43RD STREET
 NEW YORK, NY 10036
 Mailing Contact: PLANT ENGINEERING DEPT
 Mailing Telephone: (212) 631-6444
 Owner Mark: First Owner Expiration Date: 04/17/2002
 Certification Flag: False Certification Date: 06/25/1999
 Renew Flag: False Renew Date: 01/02/1997
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: No data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

C6 NEW YORK TELEPHONE CO
 East 605 W 42ND ST
 < 1/8 NEW YORK, NY 10036
 485
 Higher Site 1 of 4 in cluster C

RCRIS-SQG 1000791570
 FINDS NYD987030830

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

VERIZON (Continued)

S105055196

Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 20
Units: Gallons
Unknown Qty Spilled: 20
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: Not reported
Spill Cause: SOME PRODUCT WASHED DOWN DRAIN THAT LEADS TO SEWER - TANK FAILED ON VEHICLE - MIROY CONTACTED FOR CLEAN UP

C8
ESE
< 1/8
512
Higher

CONSOLIDATED GAS CO.
600 W. 42ND ST.
NEW YORK, NY 10036

Site 3 of 4 in cluster C

Coal Gas G000000365
N/A

COAL GAS SITE DESCRIPTION:

Site is on the eastern half of the block formed by 42nd St., 11th Ave. and 41st St. Site consisted of Gas Holders and purifying buildings. (B17, 18)

©Copyright 1993 Real Property Scan, Inc.

C9
ESE
< 1/8
515
Higher

MOBIL OIL CORP
42 ST 11TH AVE
NEW YORK, NY 10036

Site 4 of 4 in cluster C

FINDS 1000708510
RCRIS-LQG NYD982719270

RCRIS:

Owner: MOBIL OIL CORP
(212) 555-1212

Contact: ROSEANN PAVARO
(516) 371-0248

Record Date: 12/06/1988
Classification: Large Quantity Generator
Used Oil Recyc: No

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site _____ Database(s) _____ EDR ID Number
EPA ID Number _____

608 W 40 ST - MAN (Continued)

S102671470

Last Date: 12/05/1994
Num Times Material Entry In File: 1751
DEC Remarks: Not reported
Spill Cause: CUSTOMER ORDERED 2K GALS - TK OVERFILL @ 1.2K - ESCAPE FROM VENT - MY-ST
IC SENDS CLEANUP CREW, BUT CUSTOMER HAD ALREADY HOSED DOWN SPILL SPRE
AD OVER LARGE AREA - NY SANIT PUTS DOWN SAND

**D11
SSE
< 1/8
554
Higher**

**UNITED PARCEL SERVICE
525 11TH AVE
NEW YORK, NY 10036
Site 1 of 6 in cluster D**

**FINDS 1000398448
RCRIS-LQG NYD986903003**

RCRIS:
Owner: GREYHOUND CORP
(212) 555-1212
Contact: PAUL IACOBINO
(212) 560-6157
Record Date: 05/30/1990
Classification: Large Quantity Generator
Used Oil Recyc: No
Violation Status: No violations found

NY MANIFEST
Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:
Other Pertinent Environmental Activity Identified at Site:
Resource Conservation and Recovery Act Information system (RCRAINFO)

**D12
SSE
< 1/8
554
Higher**

**525 N 11TH AVE/MANH/GREYH
525 NORTH 11TH AVENUE
NEW YORK CITY, NY
Site 2 of 6 in cluster D**

**LTANKS S104275659
N/A**

LTANKS:
Spill Number: 9101412
Facility Contact: Not reported
Investigator: TANG
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: GREYHOUND
Spiller Address: Not reported
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Notifier: Tank Tester
Spill Date: 05/03/1991 16:30
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: (214) 744-6521
Resource Affected: Groundwater
Spill Source: Other Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 05/03/1991 18:08

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

D14
SSE
< 1/8
554
Higher

M.J. QUILL DEPOT
525 ELEVENTH AVE
NEW YORK, NY 10018

Site 4 of 6 in cluster D

UST
CBS UST
CBS AST
AST

U003107136
N/A

CBS UST:

CBS Number: 2-000311
 PBS No: 2-236144
 Region: STATE
 Operator: NYC TRANSIT
 Emergency Contact: HOWARD MATZA, (718) 243-4581
 Certification Date: 03/10/2000
 Owner: NEW YORK CITY TRANSIT
 Owner Address: 370 JAY STREET ROOM 819
 BROOKLYN, NY 11201
 Owner Phone: (718) 243-4581
 Owner Type: State Government
 Facility Type: MUNICIPALITY
 Mail To: NEW YORK CITY TRANSIT
 Mail Address: 370 JAY STREET
 ROOM 819
 BROOKLYN, NY 11201
 ATTN: MR. HOWARD MATZA
 (718) 243-4581

ICS No: Not reported
 MOSF No: Not reported
 Town: NEW YORK CITY
 Facility Tel: (718) 243-4581
 Expiration Date: 05/21/2002

SPDES No: Not reported
 Owner Subtype: None
 Tank Status: In Service
 Tank Error Status: No Missing Data
 Total Tanks: 1
 Tank Location: Underground
 Install Date: 00/00
 CAS No: 107211
 Substance: Single Hazardous Substance on DEC List
 Tank Type: Steel/carbon steel
 Tank Internal: None
 Tank External: Painted/Asphalt Coating
 Pipe Internal: None
 Pipe External: Painted/Asphalt Coating
 Pipe Containment: None
 Leak Detection: None
 Overfill Protection: 0
 Chemical: Ethylene glycol
 Tank Secret: False
 Last Test: Not reported
 SWIS Code: 6201
 Cert Flag: False
 Case No: Not reported
 Pipe Flag: False
 Is it There: False
 Owner Mark: 1
 Renew Date: Not reported
 Total Capacity: 1500
 Tank Number: 1

Facility Status: NO LONGER A MAJOR FACILITY

Capacity: 5000 Gals

2nd Containmt: None
 Pipe Type: STEEL/IRON

Pipe Location: Aboveground/Underground Combination

Haz Percent: 100

Tank Closed: 04/97
 Date Entered: 05/20/1996 13:15:30
 Due Date: Not reported

Reserve Flag: True
 Federal Amt: True
 Is Updated: False
 Lat/Long: Not reported
 Date Expired: Not reported

CBS Number: 2-000311
 PBS No: 2-236144
 Region: STATE
 Operator: NYC TRANSIT

ICS No: Not reported
 MOSF No: Not reported
 Town: NEW YORK CITY
 Facility Tel: (718) 243-4581

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

M.J. QUILL DEPOT (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U003107136

Substance:	Single Hazardous Substance on DEC List		
Extrnl Protection:	Painted/Asphalt Coating		
Intrnl Protection:	None		
Tank Containment:	Double-Walled		
Pipe Type:	STEEL/IRON	Pipe Location:	Aboveground
Pipe Internal:	None		
Pipe External:	Painted/Asphalt Coating		
Pipe Containment:	None	Haz Percent:	100
Leak Detection:	Electronic/In-tank System		
Overfill Protection:	3/3		
Chemical:	Ethylene glycol	Tank Closed:	Not reported
PBS Number:	2-236144	SWIS Code:	6201
Federal ID:	Not reported		
MOSF Number:	Not reported	CAS Number:	107211
SPDES Number:	Not reported	ICS Number:	Not reported
Facility Type:	Municipality		
Operator:	NYC TRANSIT	Facility Town:	NEW YORK CITY
Emrgncy Contact:	HOWARD MATZA	Emrgncy Phone:	(718) 243-4581
Certified Date:	03/10/2000	Expiration Date:	05/21/2002
Owner type:	State Government		
Owner Sub Type:	None		
Mail Name:	NEW YORK CITY TRANSIT		
Mail Contact:	MR. HOWARD MATZA 370 JAY STREET ROOM 819 BROOKLYN, NY 11201		
Mail Phone:	(718) 243-4581		
Tank Secret:	False	Date Entered:	04/01/1997 13:54:55
Last Test:	Not reported	Due Date:	Not reported
Pipe Flag:	False	Owner Mark:	1
Renew Date:	Not reported	Date Expired:	Not reported
Is it There:	False	Is Updated:	False
Owner Status:	F		
Certificate Needs to be Printed:	False		
Fiscal Amt for Registration Fee Correct:	True		
Renewal Has Been Printed for Facility:	True		
Total Capacity of All Active Tanks(gal):	1500		
Unique Tank Id Number:	CBS-WSD-1		
Date Pre-Printed Renewal App Form Was Last Printed:	02/01/2000		
PBS UST:			
PBS Number:	2-236144	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	NYC TRANSIT AUTHORITY (212) 690-0602		
Emergency Contact:	HOWARD MATZA (718) 243-4581		
Total Tanks:	9		
Owner:	NYC TRANSIT AUTHORITY 370 JAY STREET, ROOM 819 BROOKLYN, NY 11201 (718) 243-4581		
Owner Type:	Local Government		
Owner Mark:	Second Owner		
Owner Subtype:	Not reported		
Mailing Address:	NYC TRANSIT AUTHORITY ATTN: JOSEPHINE BROWN 370 JAY STREET		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

SPDES Number:	Not reported		
Lat/Long :	Not reported		
County Facility:	6201		
Facility Phone :	(212) 971-6386		
Num of Active Tanks :	13		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	P O BOX 660362		
	DALLAS, TX 75266		
Owner Phone:	(214) 698-4673		
Facility Status:	1		
Certificate Needs Printed :	False		
Renewal Printed :	False		
Pre-printed Renewal Form Last Printed :	Not reported		
Fiscal Amt For Registration Fee Pbsrect:	True		
Dt Ownership Transfer Occurr in Computer :	05/31/1996		
Facility Record Updated:	True		
PBS Number:	2-236144	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	NYC TRANSIT AUTHORITY (212) 690-0602		
Emergency Contact:	HOWARD MATZA (718) 243-4581		
Total Tanks:	9		
Owner:	NYC TRANSIT AUTHORITY 370 JAY STREET, ROOM 819 BROOKLYN, NY 11201 (718) 243-4581		
Owner Type:	Local Government		
Owner Mark:	Second Owner		
Owner Subtype:	Not reported		
Mailing Address:	NYC TRANSIT AUTHORITY ATTN: JOSEPHINE BROWN 370 JAY STREET ROOM 819 BROOKLYN, NY 11210 (718) 243-4581		
Tank Status:	Closed - Removed		
Capacity (gals):	17000		
Tank Location:	UNDERGROUND		
Tank Id:	WSD-2	Install Date:	09/01/1969
Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Above/Underground Combination	Pipe Type:	STEEL/IRON
Tank External:	NONE/PAINTED/ASPHALT COATING		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/PAINTED/ASPHALT COATING		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/OTHER		
Overfill Prot:	None	Dispenser:	Submersible
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	10/01/1997	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	87500	Renewal Date:	05/31/2001

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Emergency Contact:	HOWARD MATZA (718) 243-4581		
Total Tanks:	9		
Owner:	NYC TRANSIT AUTHORITY 370 JAY STREET, ROOM 819 BROOKLYN, NY 11201 (718) 243-4581		
Owner Type:	Local Government		
Owner Mark:	Second Owner		
Owner Subtype:	Not reported		
Mailing Address:	NYC TRANSIT AUTHORITY ATTN: JOSEPHINE BROWN 370 JAY STREET ROOM 819 BROOKLYN, NY 11210 (718) 243-4581		
Tank Status:	Closed - Removed		
Capacity (gals):	18000		
Tank Location:	UNDERGROUND		
Tank Id:	WSD-3	Install Date:	09/01/1969
Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Above/Underground Combination	Pipe Type:	STEEL/IRON
Tank External:	NONE/PAINTED/ASPHALT COATING		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/PAINTED/ASPHALT COATING		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/OTHER		
Overfill Prot:	None	Dispenser:	Submersible
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	10/01/1997	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	87500	Renewal Date:	05/31/2001
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/22/2001
Old PBS Number:	Not reported	Expiration Date:	05/31/2006
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS OWNHIST			
Operator:	VICTOR FETTER		
Emergency:	VICTOR FETTER		
Emergency Tel:	(212) 971-6386	Old PBSNO:	Not reported
Facility Type:	OTHER		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	525 ELEVENTH AVE 525 11TH AVE NEW YORK, NY 10018		
Inspector:	Not reported	Inspect Date:	Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Pipe Location:	Above/Underground Combination	Pipe Type:	STEEL/IRON
Tank External:	NONE/PAINTED/ASPHALT COATING		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/PAINTED/ASPHALT COATING		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/OTHER		
Overfill Prot:	None	Dispenser:	Submersible
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	10/01/1997	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	87500	Renewal Date:	05/31/2001
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/22/2001
Old PBS Number:	Not reported	Expiration Date:	05/31/2006
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		

PBS OWNHIST

Operator:	VICTOR FETTER		
Emergency:	VICTOR FETTER		
Emergency Tel:	(212) 971-6386	Old PBSNO:	Not reported
Facility Type:	OTHER		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	525 ELEVENTH AVE 525 11TH AVE NEW YORK, NY 10018		
Inspector:	Not reported	Inspect Date:	Not reported
Insp Result:	Not reported	Federal ID:	86-0572343
Owner:	GREYHOUND LINES, INC		
Owner Tel:	(214) 698-4673	Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported		
Mail Address:	GREYHOUND LINES, INC P O BOX 660362 DALLAS, TX 75266 RITA FELTON (214) 698-4673		
Owner Mark:	First Owner		
Certify Date:	07/07/1997	Expiration:	07/07/1997
Total Capacity (Gal):	157700		
CBS Registration Num :	Not reported		
SPDES Number:	Not reported		
Lat/Long :	Not reported		
County Facility:	6201		
Facility Phone :	(212) 971-6386		
Num of Active Tanks :	13		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	P O BOX 660362 DALLAS, TX 75266		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

M.J. QUILL DEPOT (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U003107136

Town or City Code:	01		
County Code:	62		
Region:	2		
PBS OWNHIST			
Operator:	VICTOR FETTER		
Emergency:	VICTOR FETTER		
Emergency Tel:	(212) 971-6386	Old PBSNO:	Not reported
Facility Type:	OTHER		
Facility Owner:		GREYHOUND LINES, INC	
Facility Address:		525 ELEVENTH AVE	
		525 11TH AVE	
		NEW YORK, NY 10018	
Inspector:	Not reported	Inspect Date:	Not reported
Insp Result:	Not reported	Federal ID:	86-0572343
Owner:	GREYHOUND LINES, INC		
Owner Tel:	(214) 698-4673	Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported		
Mail Address:	GREYHOUND LINES, INC		
	P O BOX 660362		
	DALLAS, TX 75266		
	RITA FELTON		
	(214) 698-4673		
Owner Mark:	First Owner		
Certify Date:	07/07/1997	Expiration:	07/07/1997
Total Capacity (Gal):	157700		
CBS Registration Num :	Not reported		
SPDES Number:	Not reported		
Lat/Long :	Not reported		
County Facility:	6201		
Facility Phone :	(212) 971-6386		
Num of Active Tanks :	13		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	P O BOX 660362		
	DALLAS, TX 75266		
Owner Phone:	(214) 698-4673		
Facility Status:	1		
Certificate Needs Printed :	False		
Renewal Printed :	False		
Pre-printed Renewal Form Last Printed :	Not reported		
Fiscal Amt For Registration Fee Pbsrect:	True		
Dt Ownership Transfer Occurr in Computer :	05/31/1996		
Facility Record Updated:	True		

This is the most recent NY PBS data for this site.
 The NY PBS database contains 9 additional records for this site.
 Please contact your EDR Account Executive for more information.

CBS AST:			
CBS Number:	2-000311	Telephone:	(718) 243-4581
Owner:	NEW YORK CITY TRANSIT		
	370 JAY STREET ROOM 819		
	BROOKLYN, NY 11201		
	(718) 243-4581		
Facility Status:	Active		
Total Tanks	1		
Tank Status:	In Service		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Owner Phone: (718) 243-4581
 Facility Phone: (212) 690-0602
 Operator: NYC TRANSIT AUTHORITY
 Emergency Name: HOWARD MATZA
 Emergency Phone: (718) 243-4581
 Total Tanks: 9
 Total Capacity: 87500
 Tank ID: 004
 Capacity (Gal): 1000
 Missing Data for Tank : No data missing
 Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
 Product Stored: DIESEL
 Tank Type: Steel/carbon steel
 Install Date: 09/01/1969
 Tank Internal: NONE
 Tank External: NONE/PAINTED/ASPHALT COATING
 Tank Containment: NONE/NONE
 Pipe Type: STEEL/IRON
 Pipe Location: Aboveground
 Pipe Internal: NONE
 Pipe External: NONE/PAINTED/ASPHALT COATING
 Leak Detection: NONE/IN-TANK SYSTEM
 Overfill Protection: Product Level Gauge
 Dispenser Method: Suction
 Date Tested: / /
 Date Closed: 08/01/1996
 Updated: True
 Date Inspected: Not reported
 Result of Inspection: Not reported
 Mailing Name: NYC TRANSIT AUTHORITY
 Mailing Address: 370 JAY STREET
 ROOM 819
 BROOKLYN, NY 11210
 Mailing Contact: JOSEPHINE BROWN
 Mailing Telephone: (718) 243-4581
 Owner Mark: Second Owner
 Certification Flag: False
 Renew Flag: False
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

Next Test Date: / /
 Test Method: Not reported
 Deleted: False
 Inspector: Not reported

Expiration Date: 05/31/2006
 Certification Date: 06/22/2001
 Renew Date: 05/31/2001

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018
 Old PBSNO: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Install Date: 09/01/1969
 Tank Internal: NONE
 Tank External: NONE/PAINTED/ASPHALT COATING
 Tank Containment: NONE/NONE
 Pipe Type: STEEL/IRON
 Pipe Location: Aboveground
 Pipe Internal: NONE
 Pipe External: NONE/PAINTED/ASPHALT COATING
 Leak Detection: NONE/IN-TANK SYSTEM
 Overfill Protection: Product Level Gauge
 Dispenser Method: Suction
 Date Tested: / / Next Test Date: / /
 Date Closed: 08/01/1996 Test Method: Not reported
 Updated: True Deleted: False
 Date Inspected: Not reported Inspector: Not reported
 Result of Inspection: Not reported
 Mailing Name: NYC TRANSIT AUTHORITY
 Mailing Address: 370 JAY STREET
 ROOM 819
 BROOKLYN, NY 11210
 Mailing Contact: JOSEPHINE BROWN
 Mailing Telephone: (718) 243-4581
 Owner Mark: Second Owner Expiration Date: 05/31/2006
 Certification Flag: False Certification Date: 06/22/2001
 Renew Flag: False Renew Date: 05/31/2001
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386 Old PBSNO: Not reported
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018
 Inspector: Not reported Inspect Date: Not reported
 Insp Result: Not reported Federal ID: 86-0572343
 Owner: GREYHOUND LINES, INC
 Owner Tel: (214) 698-4673 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mail Address: GREYHOUND LINES, INC
 P O BOX 660362
 DALLAS, TX 75266
 RITA FELTON
 (214) 698-4673
 Owner Mark: First Owner
 Certify Date: 07/07/1997 Expiration: 07/07/1997
 Total Capacity (Gal): 157700

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	NYC TRANSIT AUTHORITY		
Mailing Address:	370 JAY STREET ROOM 819 BROOKLYN, NY 11210		
Mailing Contact:	JOSEPHINE BROWN		
Mailing Telephone:	(718) 243-4581		
Owner Mark:	Second Owner	Expiration Date:	05/31/2006
Certification Flag:	False	Certification Date:	06/22/2001
Renew Flag:	False	Renew Date:	05/31/2001
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	Minor data missing		
Tank Screen:	No data missing		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
Fiscal Amount for Registration Fee is Correct:	True		
PBS OWNHIST			
Operator:	VICTOR FETTER		
Emergency:	VICTOR FETTER		
Emergency Tel:	(212) 971-6386	Old PBSNO:	Not reported
Facility Type:	OTHER		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	525 ELEVENTH AVE 525 11TH AVE NEW YORK, NY 10018		
Inspector:	Not reported	Inspect Date:	Not reported
Insp Result:	Not reported	Federal ID:	86-0572343
Owner:	GREYHOUND LINES, INC		
Owner Tel:	(214) 698-4673	Owner Type:	Corporate/Commercial
Owner Subtype:	Not reported		
Mail Address:	GREYHOUND LINES, INC P O BOX 660362 DALLAS, TX 75266 RITA FELTON (214) 698-4673		
Owner Mark:	First Owner	Expiration:	07/07/1997
Certify Date:	07/07/1997		
Total Capacity (Gal):	157700		
CBS Registration Num :	Not reported		
SPDES Number:	Not reported		
Lat/Long :	Not reported		
County Facility:	6201		
Facility Phone :	(212) 971-6386		
Num of Active Tanks :	13		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	P O BOX 660362 DALLAS, TX 75266		
Owner Phone:	(214) 698-4673		
Facility Status:	1		
Certificate Needs Printed :	False		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386 Old PBSNO: Not reported
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018

Inspector: Not reported Inspect Date: Not reported
 Insp Result: Not reported Federal ID: 86-0572343
 Owner: GREYHOUND LINES, INC
 Owner Tel: (214) 698-4673 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mail Address: GREYHOUND LINES, INC
 P O BOX 660362
 DALLAS, TX 75266
 RITA FELTON
 (214) 698-4673

Owner Mark: First Owner
 Certify Date: 07/07/1997 Expiration: 07/07/1997
 Total Capacity (Gal): 157700

CBS Registration Num : Not reported
 SPDES Number: Not reported
 Lat/Long : Not reported
 County Facility: 6201
 Facility Phone : (212) 971-6386
 Num of Active Tanks : 13
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: P O BOX 660362
 DALLAS, TX 75266

Owner Phone: (214) 698-4673
 Facility Status: 1
 Certificate Needs Printed : False
 Renewal Printed : False
 Pre-printed Renewal Form Last Printed : Not reported
 Fiscal Amt For Registration Fee Pbsrect: True
 Dt Ownership Transfer Occurr in Computer : 05/31/1996
 Facility Record Updated: True

PBS Number: 2-236144 CBS Number: Not reported
 SPDES Number: Not reported SWIS Code: 6201
 Federal ID: Not reported Previous PBS#: Not reported
 Facility Status: 3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).
 Facility Type: TRUCKING/TRANSPORTATION

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Facility Type:	OTHER		
Facility Owner:		GREYHOUND LINES, INC	
Facility Address:		525 ELEVENTH AVE 525 11TH AVE NEW YORK, NY 10018	
Inspector:	Not reported	Inspect Date:	Not reported
Insp Result:	Not reported	Federal ID:	86-0572343
Owner:	GREYHOUND LINES, INC	Owner Type:	Corporate/Commercial
Owner Tel:	(214) 698-4673		
Owner Subtype:	Not reported		
Mail Address:	GREYHOUND LINES, INC P O BOX 660362 DALLAS, TX 75266 RITA FELTON (214) 698-4673		
Owner Mark:	First Owner	Expiration:	07/07/1997
Certify Date:	07/07/1997		
Total Capacity (Gal):	157700		
CBS Registration Num :	Not reported		
SPDES Number:	Not reported		
Lat/Long :	Not reported		
County Facility:	6201		
Facility Phone :	(212) 971-6386		
Num of Active Tanks :	13		
Facility Owner:	GREYHOUND LINES, INC		
Facility Address:	P O BOX 660362 DALLAS, TX 75266		
Owner Phone:	(214) 698-4673		
Facility Status:	1		
Certificate Needs Printed :	False		
Renewal Printed :	False		
Pre-printed Renewal Form Last Printed :	Not reported		
Fiscal Amt For Registration Fee Pbsrect:	True		
Dt Ownership Transfer Occurr in Computer :	05/31/1996		
Facility Record Updated:	True		
PBS Number:	2-236144	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	3 - Administratively closed (reasons include business is closed and/or mail is undeliverable, and staff cannot check if tanks were removed; or a duplicate registration was generated).		
Facility Type:	TRUCKING/TRANSPORTATION		
Owner Type:	Local Government		
Owner Sub Type:	Not reported		
Owner:	NYC TRANSIT AUTHORITY 370 JAY STREET, ROOM 819 BROOKLYN, NY 11201		
Owner Phone:	(718) 243-4581		
Facility Phone:	(212) 690-0602		
Operator:	NYC TRANSIT AUTHORITY		
Emergency Name:	HOWARD MATZA		
Emergency Phone:	(718) 243-4581		
Total Tanks:	9		
Total Capacity:	87500		
Tank ID:	010		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

RITA FELTON
(214) 698-4673
Owner Mark: First Owner
Certify Date: 07/07/1997 Expiration: 07/07/1997
Total Capacity (Gal): 157700
CBS Registration Num : Not reported
SPDES Number: Not reported
Lat/Long : Not reported
County Facility: 6201
Facility Phone : (212) 971-6386
Num of Active Tanks : 13
Facility Owner: GREYHOUND LINES, INC
Facility Address: P O BOX 660362

DALLAS, TX 75266
Owner Phone: (214) 698-4673
Facility Status: 1
Certificate Needs Printed : False
Renewal Printed : False
Pre-printed Renewal Form Last Printed : Not reported
Fiscal Amt For Registration Fee Pbsrect: True
Dt Ownership Transfer Occurr in Computer : 05/31/1996
Facility Record Updated: True

PBS Number: 2-236144 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Local Government
Owner Sub Type: Not reported
Owner: NYC TRANSIT AUTHORITY
370 JAY STREET, ROOM 819
BROOKLYN, NY 11201
Owner Phone: (718) 243-4581
Facility Phone: (212) 690-0602
Operator: NYC TRANSIT AUTHORITY
Emergency Name: HOWARD MATZA
Emergency Phone: (718) 243-4581
Total Tanks: 9
Total Capacity: 87500
Tank ID: WSD-5
Capacity (Gal): 20000
Missing Data for Tank : No data missing
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Install Date: 06/01/1997
Tank Internal: NONE
Tank External: NONE/PAINTED/ASPHALT COATING
Tank Containment: NONE/CONCRETE DIKE
Pipe Type: STEEL/IRON
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE/PAINTED/ASPHALT COATING
Leak Detection: NONE/OTHER

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

DALLAS, TX 75266
Owner Phone: (214) 698-4673
Facility Status: 1
Certificate Needs Printed: False
Renewal Printed: False
Pre-printed Renewal Form Last Printed: Not reported
Fiscal Amt For Registration Fee Pbsrect: True
Dt Ownership Transfer Occurr in Computer: 05/31/1996
Facility Record Updated: True

PBS Number: 2-236144 CBS Number: Not reported
SPDES Number: Not reported SWIS Code: 6201
Federal ID: Not reported Previous PBS#: Not reported
Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) and Subpart 360-14.

Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Local Government
Owner Sub Type: Not reported
Owner: NYC TRANSIT AUTHORITY
370 JAY STREET, ROOM 819
BROOKLYN, NY 11201

Owner Phone: (718) 243-4581
Facility Phone: (212) 690-0602
Operator: NYC TRANSIT AUTHORITY
Emergency Name: HOWARD MATZA
Emergency Phone: (718) 243-4581
Total Tanks: 9
Total Capacity: 87500
Tank ID: WSD-6
Capacity (Gal): 20000
Missing Data for Tank: No data missing
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Steel/carbon steel
Install Date: 06/01/1997
Tank Internal: NONE
Tank External: NONE/PAINTED/ASPHALT COATING
Tank Containment: NONE/CONCRETE DIKE
Pipe Type: STEEL/IRON
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE/PAINTED/ASPHALT COATING
Leak Detection: NONE/OTHER
Overfill Protection: Catch Basin, Product Level Gauge
Dispenser Method: Suction
Date Tested: // Next Test Date: //
Date Closed: // Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: NYC TRANSIT AUTHORITY
Mailing Address: 370 JAY STREET
ROOM 819
BROOKLYN, NY 11210
Mailing Contact: JOSEPHINE BROWN
Mailing Telephone: (718) 243-4581
Owner Mark: Second Owner Expiration Date: 05/31/2006

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
Facility Type: TRUCKING/TRANSPORTATION
Owner Type: Local Government
Owner Sub Type: Not reported
Owner: NYC TRANSIT AUTHORITY
370 JAY STREET, ROOM 819
BROOKLYN, NY 11201
Owner Phone: (718) 243-4581
Facility Phone: (212) 690-0602
Operator: NYC TRANSIT AUTHORITY
Emergency Name: HOWARD MATZA
Emergency Phone: (718) 243-4581
Total Tanks: 9
Total Capacity: 87500
Tank ID: WSD-7
Capacity (Gal): 2000
Missing Data for Tank : No data missing
Tank Location: ABOVEGROUND
Product Stored: USED OIL
Tank Type: Steel/carbon steel
Install Date: 10/01/1997
Tank Internal: NONE
Tank External: NONE/PAINTED/ASPHALT COATING
Tank Containment: NONE/DOUBLED-WALLED TANK
Pipe Type: STEEL/IRON
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE/PAINTED/ASPHALT COATING
Leak Detection: INTERSTITIAL MONITORING/IN-TANK SYSTEM
Overfill Protection: Catch Basin, High Level Alarm
Dispenser Method: Suction
Date Tested: // Next Test Date: //
Date Closed: // Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: NYC TRANSIT AUTHORITY
Mailing Address: 370 JAY STREET
ROOM 819
BROOKLYN, NY 11210
Mailing Contact: JOSEPHINE BROWN
Mailing Telephone: (718) 243-4581
Owner Mark: Second Owner Expiration Date: 05/31/2006
Certification Flag: False Certification Date: 06/22/2001
Renew Flag: False Renew Date: 05/31/2001
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: Minor data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Total Tanks: 9
 Total Capacity: 87500
 Tank ID: WSD-8
 Capacity (Gal): 4000
 Missing Data for Tank : No data missing
 Tank Location: ABOVEGROUND
 Product Stored: LUBE OIL
 Tank Type: Steel/carbon steel
 Install Date: 10/01/1997
 Tank Internal: NONE
 Tank External: NONE/PAINTED/ASPHALT COATING
 Tank Containment: NONE/DOUBLED-WALLED TANK
 Pipe Type: STEEL/IRON
 Pipe Location: Aboveground
 Pipe Internal: NONE
 Pipe External: NONE/PAINTED/ASPHALT COATING
 Leak Detection: INTERSTITIAL MONITORING/IN-TANK SYSTEM
 Overfill Protection: Catch Basin, High Level Alarm
 Dispenser Method: Suction
 Date Tested: // Next Test Date: //
 Date Closed: // Test Method: Not reported
 Updated: True Deleted: False
 Date Inspected: Not reported Inspector: Not reported
 Result of Inspection: Not reported
 Mailing Name: NYC TRANSIT AUTHORITY
 Mailing Address: 370 JAY STREET
 ROOM 819
 BROOKLYN, NY 11210
 Mailing Contact: JOSEPHINE BROWN
 Mailing Telephone: (718) 243-4581
 Owner Mark: Second Owner Expiration Date: 05/31/2006
 Certification Flag: False Certification Date: 06/22/2001
 Renew Flag: False Renew Date: 05/31/2001
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386 Old PBSNO: Not reported
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018
 Inspector: Not reported Inspect Date: Not reported
 Insp Result: Not reported Federal ID: 86-0572343
 Owner: GREYHOUND LINES, INC
 Owner Tel: (214) 698-4673 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

M.J. QUILL DEPOT (Continued)

U003107136

Pipe Internal: NONE
 Pipe External: NONE/PAINTED/ASPHALT COATING
 Leak Detection: INTERSTITIAL MONITORING/IN-TANK SYSTEM
 Overfill Protection: Catch Basin, High Level Alarm
 Dispenser Method: Suction
 Date Tested: // Next Test Date: //
 Date Closed: // Test Method: Not reported
 Updated: True Deleted: False
 Date Inspected: Not reported Inspector: Not reported
 Result of Inspection: Not reported
 Mailing Name: NYC TRANSIT AUTHORITY
 Mailing Address: 370 JAY STREET
 ROOM 819
 BROOKLYN, NY 11210
 Mailing Contact: JOSEPHINE BROWN
 Mailing Telephone: (718) 243-4581
 Owner Mark: Second Owner Expiration Date: 05/31/2006
 Certification Flag: False Certification Date: 06/22/2001
 Renew Flag: False Renew Date: 05/31/2001
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386 Old PBSNO: Not reported
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018
 Inspector: Not reported Inspect Date: Not reported
 Insp Result: Not reported Federal ID: 86-0572343
 Owner: GREYHOUND LINES, INC
 Owner Tel: (214) 698-4673 Owner Type: Corporate/Commercial
 Owner Subtype: Not reported
 Mail Address: GREYHOUND LINES, INC
 P O BOX 660362
 DALLAS, TX 75266
 RITA FELTON
 (214) 698-4673
 Owner Mark: First Owner
 Certify Date: 07/07/1997 Expiration: 07/07/1997
 Total Capacity (Gal): 157700
 CBS Registration Num : Not reported
 SPDES Number: Not reported
 Lat/Long : Not reported
 County Facility: 6201
 Facility Phone : (212) 971-6386
 Num of Active Tanks : 13

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

M.J. QUILL DEPOT (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U003107136

Mailing Telephone: (718) 243-4581
 Owner Mark: Second Owner
 Certification Flag: False
 Renew Flag: False
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: Minor data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2
 Fiscal Amount for Registration Fee is Correct: True

Expiration Date: 05/31/2006
 Certification Date: 06/22/2001
 Renew Date: 05/31/2001

PBS OWNHIST

Operator: VICTOR FETTER
 Emergency: VICTOR FETTER
 Emergency Tel: (212) 971-6386
 Facility Type: OTHER
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: 525 ELEVENTH AVE
 525 11TH AVE
 NEW YORK, NY 10018

Old PBSNO: Not reported

Inspector: Not reported
 Insp Result: Not reported
 Owner: GREYHOUND LINES, INC
 Owner Tel: (214) 698-4673
 Owner Subtype: Not reported
 Mail Address: GREYHOUND LINES, INC
 P O BOX 660362
 DALLAS, TX 75266
 RITA FELTON
 (214) 698-4673

Inspect Date: Not reported
 Federal ID: 86-0572343
 Owner Type: Corporate/Commercial

Owner Mark: First Owner
 Certify Date: 07/07/1997
 Total Capacity (Gal): 157700

Expiration: 07/07/1997

CBS Registration Num : Not reported
 SPDES Number: Not reported
 Lat/Long : Not reported
 County Facility: 6201
 Facility Phone : (212) 971-6386
 Num of Active Tanks : 13
 Facility Owner: GREYHOUND LINES, INC
 Facility Address: P O BOX 660362

Owner Phone: DALLAS, TX 75266
 (214) 698-4673
 Facility Status: 1
 Certificate Needs Printed : False
 Renewal Printed : False
 Pre-printed Renewal Form Last Printed : Not reported
 Fiscal Amt For Registration Fee Pbsrect: True
 Dt Ownership Transfer Occurr in Computer : 05/31/1996
 Facility Record Updated: True

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

MOBIL OIL CORP SS QDL (Continued)

1000253419

Used Oil Recyc: No
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
AIRS Facility System (AIRS/AFS)
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

LTANKS:

Spill Number:	9905507	Region of Spill:	2
Facility Contact:	MARCO	Facility Tele:	Not reported
Investigator:	O'DOWD	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	MARCO	Spiller Phone:	Not reported
Spiller:	MOBIL		
Spiller Address:	561 11 AVE MANHATTAN, NY		
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	Not reported		
Spill Cause:	Tank Test Failure	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Gas Station
Spill Notifier:	Tank Tester	PBS Number:	Not reported
Spill Date:	08/06/1999 13:30	Reported to Dept:	08/06/1999 13:48
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	True		
Spill Record Last Update:	08/09/1999		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	08/06/1999		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Petro-Tite		
Capacity of Failed Tank:	4000		
Leak Rate Failed Tank:	0.00		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	0		
Units:	Gallons		
Unknown Qty Spilled:	No		
Quantity Recovered:	0		
Unknown Qty Recovered:	False		
Material:	GASOLINE		
Class Type:	Petroleum		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

MOBIL OIL CORP SS QDL (Continued)

EDR ID Number
 EPA ID Number

Database(s)

1000253419

PBS Number:	2-157937	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BILL HARAJLI (212) 563-0199		
Emergency Contact:	MOBIL OIL CORP. (800) 662-4567		
Total Tanks:	5		
Owner:	EXXONMOBIL OIL CORPORATION 3225 GALLOWS RD. FAIRFAX, VA 22037 (703) 849-5862		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Mobil Oil Company		
Mailing Address:	EXXONMOBIL OIL CORP ATTN: NORMA E. HILL P. O. BOX 142667 AUSTIN, TX 78714 (800) 800-4133		
Tank Status:	Closed - Removed	Install Date:	12/01/1962
Capacity (gals):	550	Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	002	Pipe Type:	GALVANIZED STEEL
Tank Type:	Steel/carbon steel		
Tank Internal:	Not reported		
Pipe Location:	2		
Tank External:	Not reported	Dispenser:	Gravity
Missing Data for Tank:	Minor Data Missing	Next Test Date:	Not reported
Pipe External:	Not reported	Test Method:	Not reported
Second Containment:	NONE	Updated:	True
Leak Detection:	NONE	Owner Screen:	No data missing
Overfill Prot:	3	Renewal Date:	08/12/1997
Date Tested:	Not reported	Federal ID:	Not reported
Date Closed:	11/01/1986	Facility Screen:	No data missing
Deleted:	False	Certification Date:	10/29/1999
Dead Letter:	False	Expiration Date:	10/29/2002
FAMT:	Fiscal amount for registration fee is correct	Inspector:	Not reported
Total Capacity:	20000		
Tank Screen:	No data missing		
Renew Flag:	Renwal has not been printed		
Certification Flag:	False		
Old PBS Number:	Not reported		
Inspected Date:	Not reported		
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	RETAIL GASOLINE SALES		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-157937	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BILL HARAJLI (212) 563-0199		
Emergency Contact:	MOBIL OIL CORP.		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MOBIL OIL CORP SS QDL (Continued)

1000253419

Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Mobil Oil Company
Mailing Address: EXXONMOBIL OIL CORP
ATTN: NORMA E. HILL
P. O. BOX 142667
AUSTIN, TX 78714
(800) 800-4133

Tank Status: Closed - Removed
Capacity (gals): 550
Tank Location: UNDERGROUND
Tank Id: 004
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Pipe Location: 2
Tank External: Not reported
Missing Data for Tank: Minor Data Missing
Pipe External: Not reported
Second Containment: NONE
Leak Detection: NONE
Overfill Prot: 2
Date Tested: Not reported
Date Closed: 11/01/1986
Deleted: False
Dead Letter: False
FAMT: Fiscal amount for registration fee is correct
Total Capacity: 20000
Tank Screen: No data missing
Renew Flag: Renewal has not been printed
Certification Flag: False
Old PBS Number: Not reported
Inspected Date: Not reported
Inspection Result: Not reported
Lat/long: Not reported
Facility Type: RETAIL GASOLINE SALES
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2

Install Date: 12/01/1962
Product Stored: UNLEADED GASOLINE
Pipe Internal: Not reported
Pipe Type: GALVANIZED STEEL

Dispenser: Suction
Next Test Date: Not reported
Test Method: Not reported
Updated: True
Owner Screen: No data missing

Renewal Date: 08/12/1997
Federal ID: Not reported
Facility Screen: No data missing
Certification Date: 10/29/1999
Expiration Date: 10/29/2002
Inspector: Not reported

PBS Number: 2-157937
SPDES Number: Not reported
Operator: BILL HARAJLI
(212) 563-0199

CBS Number: Not reported
SWIS ID: 6201

Emergency Contact: MOBIL OIL CORP.
(800) 662-4567

Total Tanks: 5
Owner: EXXONMOBIL OIL CORPORATION
3225 GALLOWS RD.
FAIRFAX, VA 22037
(703) 849-5862

Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Mobil Oil Company
Mailing Address: EXXONMOBIL OIL CORP
ATTN: NORMA E. HILL
P. O. BOX 142667

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

MOBIL S/S (Continued)

S100168133

Spill Cause:	Tank Test Failure	Resource Affected:	Groundwater
Water Affected:	Not reported	Spill Source:	Gas Station
Spill Notifier:	Responsible Party	PBS Number:	2-157937
Spill Date:	12/05/1990 13:30	Reported to Dept:	12/05/1990 15:07
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	True		
Spill Record Last Update:	11/06/2000		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	12/12/1990		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	0		
Leak Rate Failed Tank:	0.00		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	0		
Units:	Gallons		
Unknown Qty Spilled:	No		
Quantity Recovered:	0		
Unknown Qty Recovered:	True		
Material:	GASOLINE		
Class Type:	Petroleum		
Chem Abstract Service Number:	GASOLINE		
Last Date:	09/29/1994		
Num Times Material Entry In File:	21329		
DEC Remarks:	reassigned from Sullivan to Sigona on 11/6/00		
Spill Cause:	LINE TEST, FAILED PETRO TITE, LEAK RATE -.26GPH, GASSERVICE TO REPAIR RETEST, TONY KHOURY FIELD ENGINEER) 516-239-0266.		

E18
 East
 < 1/8
 573
 Higher

MOBIL GAS STATION
561 11TH AVE
NEW YORK, NY
 Site 3 of 6 in cluster E

LTANKS S103824901
N/A

LTANKS:

Spill Number:	9900078	Region of Spill:	2
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	SIGONA	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	MIKE MEOLA	Spiller Phone:	Not reported
Spiller:	EXXONMOBIL CORP		
Spiller Address:	464 DOUGHTY BLVD. INWOOD, NY 11096		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

523 11TH AV/GREYHOUND BUS (Continued)

S101340929

Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: Not reported
Spill Cause: Tank Failure Resource Affected: Groundwater
Water Affected: Not reported Spill Source: Non Major Facility > 1,100 gallons
Spill Notifier: Other PBS Number: Not reported
Spill Date: 08/02/1989 12:10 Reported to Dept: 08/02/1989 12:33
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 12/28/2000
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 08/03/1989
Date Region Sent Summary to Central Office: Not reported

Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: 1
Quantity Spilled: 500
Units: Pounds
Unknown Qty Spilled: 500
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: Petroleum
Chem Abstract Service Number: UNKNOWN PETROLEUM
Last Date: 09/29/1994
Num Times Material Entry In File: 16414
Material Class Type: 1
Quantity Spilled: 0
Units: Pounds
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: MOTOR OIL
Class Type: Petroleum
Chem Abstract Service Number: MOTOR OIL
Last Date: 07/28/1994
Num Times Material Entry In File: 508

DEC Remarks: 01/13/95: SPILL REASSIGNED FROM SIGONA TO ZHITOMIRSKY ON 01/13/95. TRA
NSFEREWD FROM HALE TO TIBBE ON 12/28/00. INVESTIGATION ONGOING.
Spill Cause: CONTAINED IN CLAY SOIL. OIL IN GROUNDWATER WINSTON CONTRACTOR HIRED TO P
UMP OIL OUT OF THE CONTAMINATION. FACILITY SOLD TO MATA/NYCTA)

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

NEW YORK TELEPHONE (Continued)

U001831391

PBS AST:
 PBS Number: 2-044563 CBS Number: Not reported
 SPDES Number: Not reported SWIS Code: 6201
 Federal ID: Not reported Previous PBS#: Not reported
 Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
 Facility Type: OTHER
 Owner Type: Corporate/Commercial
 Owner Sub Type: New York Telephone
 Owner: BELL ATLANTIC
 221 EAST 37TH STREET
 NEW YORK, NY 10016
 Owner Phone: (800) 386-9639
 Facility Phone: (800) 696-3973
 Operator: BELL ATLANTIC
 Emergency Name: BELL ATLANTIC
 Emergency Phone: (800) 386-9639
 Total Tanks: 2
 Total Capacity: 5000
 Tank ID: 002
 Capacity (Gal): 2500
 Missing Data for Tank : No data missing
 Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
 Product Stored: NOS 1,2, OR 4 FUEL OIL
 Tank Type: Steel/carbon steel
 Install Date: 07/01/1998
 Tank Internal: NONE
 Tank External: PAINTED/ASPHALT COATING/NONE
 Tank Containment: DOUBLED-WALLED TANK/NONE
 Pipe Type: STEEL/IRON
 Pipe Location: Aboveground
 Pipe Internal: NONE
 Pipe External: NONE/NONE
 Leak Detection: INTERSTITIAL MONITORING/IN-TANK SYSTEM
 Overfill Protection: High Level Alarm, Product Level Gauge
 Dispenser Method: None
 Date Tested: // Next Test Date: //
 Date Closed: // Test Method: Not reported
 Updated: True Deleted: False
 Date Inspected: Not reported Inspector: Not reported
 Result of Inspection: Not reported
 Mailing Name: BELL ATLANTIC
 Mailing Address: 221 EAST 37TH STREET
 4TH FLOOR
 NEW YORK, NY 10016
 Mailing Contact: KETHLEEN TOBIN
 Mailing Telephone: (212) 338-6731
 Owner Mark: First Owner Expiration Date: 12/30/2001
 Certification Flag: False Certification Date: 06/04/1997
 Renew Flag: True Renew Date: 08/08/2001
 Lat/Long: Not reported
 Dead Letter: False
 Facility Screen: No data missing
 Owner Screen: No data missing
 Tank Screen: No data missing
 Town or City: NEW YORK CITY
 Town or City Code: 01

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

BELL ATLANTIC (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U001841980

County Code:	62		
Region:	2		
PBS Number:	2-601561	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BELL ATLANTIC (888) 696-3973		
Emergency Contact:	BELL ATLANTIC (800) 386-9639		
Total Tanks:	4		
Owner:	BELL ATLANTIC 221 E. 37TH ST, 4TH FLOOR NEW YORK, NY 10016 (800) 386-9639		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	BELL ATLANTIC ATTN: KATHLEEN TOBIN 221 EAST 37TH STREET, 4TH FLOOR NEW YORK, NY 10016 (212) 338-7881		
Tank Status:	In Service	Install Date:	09/01/1993
Capacity (gals):	2500	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	NONE
Tank Id:	004	Pipe Type:	FIBERGLASS [FRP]
Tank Type:	Fiberglass reinforced plastic [FRP]		
Tank Internal:	FIBERGLASS LINER [FRP]		
Pipe Location:	Underground		
Tank External:	FIBERGLASS		
Missing Data for Tank:	No Missing Data		
Pipe External:	FIBERGLASS		
Second Containment:	DOUBLED-WALLED TANK		
Leak Detection:	INTERSTITIAL MONITORING/IN-TANK SYSTEM		
Overfill Prot:	High Level Alarm, Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	7775	Renewal Date:	Not reported
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	08/05/1998
Old PBS Number:	Not reported	Expiration Date:	08/06/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	UTILITY		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-601561	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BELL ATLANTIC		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

BELL ATLANTIC (Continued)

U001841980

221 E. 37TH ST, 4TH FLOOR
NEW YORK, NY 10016
Owner Phone: (800) 386-9639
Facility Phone: (888) 696-3973
Operator: BELL ATLANTIC
Emergency Name: BELL ATLANTIC
Emergency Phone: (800) 386-9639
Total Tanks: 4
Total Capacity: 7775
Tank ID: 006
Capacity (Gal): 275
Missing Data for Tank : Minor data missing
Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE
Product Stored: USED OIL
Tank Type: Stainless steel alloy
Install Date: 08/01/1993
Tank Internal: OTHER
Tank External: NONE/JACKETED
Tank Containment: NONE/DOUBLED-WALLED TANK
Pipe Type: STEEL/IRON
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE/NONE
Leak Detection: NONE/NONE
Overfill Protection: Product Level Gauge, Catch Basin
Dispenser Method: Not reported
Date Tested: // Next Test Date: //
Date Closed: // Test Method: Not reported
Updated: True Deleted: False
Date Inspected: Not reported Inspector: Not reported
Result of Inspection: Not reported
Mailing Name: BELL ATLANTIC
Mailing Address: 221 EAST 37TH STREET, 4TH FLOOR
NEW YORK, NY 10016
Mailing Contact: KATHLEEN TOBIN
Mailing Telephone: (212) 338-7881
Owner Mark: First Owner Expiration Date: 08/06/2003
Certification Flag: False Certification Date: 08/05/1998
Renew Flag: False Renew Date: //
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: Minor data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

E22 NEW YORK TELEPHONE CO
ENE 604 W 43RD ST
< 1/8 NEW YORK, NY 10036
612
Higher Site 6 of 6 in cluster E

RCRIS-SQG 1000791572
FINDS NYD987030855

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

CONSULATE GENERAL OF P.R.CHINA (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U002034235

Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	20000	Renewal Date:	06/07/1999
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	07/30/1999
Old PBS Number:	Not reported	Expiration Date:	06/13/2004
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-601887	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	YANG, JING PING (212) 868-7752		
Emergency Contact:	LI, ZHIEN JIANG (212) 330-7401		
Total Tanks:	2		
Owner:	FOREIN MIN. OF P.R. OF CHINA 520 12TH AVE NY, NY 10036 (212) 330-7401		
Owner Type:	Not reported		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	CONSULATE GEN. OF PEOPLES REPUBLIC OF CHINA ATTN: LI,ZHEN JIANG 520 12TH AVE NY, NY 10036 (212) 330-7401		
Tank Status:	In Service		
Capacity (gals):	10000		
Tank Location:	UNDERGROUND		
Tank Id:	002	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Internal:	NONE	Pipe Internal:	Not reported
Pipe Location:	Underground	Pipe Type:	STEEL/IRON
Tank External:	NONE/NONE		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	Not reported		
Leak Detection:	Not reported		
Overfill Prot:	High Level Alarm, Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	20000	Renewal Date:	06/07/1999

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

EDISON PARKING LOT (Continued)

1000990443

Capacity (gals):	550	Install Date:	Not reported
Tank Location:	UNDERGROUND	Product Stored:	LEADED GASOLINE
Tank Id:	001	Pipe Internal:	NONE
Tank Type:	Steel/carbon steel	Pipe Type:	STEEL/IRON
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/VAULT		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	05/01/1995	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	05/02/2000
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/Long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-602201	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BRIAN COLLINS (201) 643-2884		
Emergency Contact:	BRIAN COLLINS (201) 643-2884		
Total Tanks:	0		
Owner:	SILVERSTEIN PROPERTIES, INC. 521 FIFTH AVENUE NEW YORK, NY 10175 (212) 551-7300		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	ROSENMON & COLIN ATTN: MR. RICHARD G. LELAND 575 MADISON AVENUE NEW YORK, NY 10022 (212) 940-8700		
Tank Status:	Closed - Removed		
Capacity (gals):	550	Install Date:	Not reported
Tank Location:	UNDERGROUND	Product Stored:	LEADED GASOLINE
Tank Id:	002	Pipe Internal:	NONE
Tank Type:	Steel/carbon steel	Pipe Type:	STEEL/IRON
Tank Internal:	NONE		
Pipe Location:	Underground		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

EDISON PARKING LOT (Continued)

1000990443

Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	05/01/1995	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renewal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	05/02/2000
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-602201	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BRIAN COLLINS (201) 643-2884		
Emergency Contact:	BRIAN COLLINS (201) 643-2884		
Total Tanks:	0		
Owner:	SILVERSTEIN PROPERTIES, INC. 521 FIFTH AVENUE NEW YORK, NY 10175 (212) 551-7300		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	ROSENMON & COLIN ATTN: MR. RICHARD G. LELAND 575 MADISON AVENUE NEW YORK, NY 10022 (212) 940-8700		
Tank Status:	Closed - Removed		
Capacity (gals):	550		
Tank Location:	UNDERGROUND		
Tank Id:	004	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	LEADED GASOLINE
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Underground	Pipe Type:	STEEL/IRON
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/VAULT		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	05/01/1995	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s)
 EDR ID Number
 EPA ID Number

EDISON PARKING LOT (Continued)

1000990443

Lat/long: Not reported
 Facility Type: OTHER
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2

This is the most recent NY PBS data for this site.
 The NY PBS database contains 11 additional records for this site.
 Please contact your EDR Account Executive for more information.

F25
 WSW
 1/8-1/4
 752
 Higher

SILVERSTEIN 42ND ASSOC.
500-516 12TH AVE
MANHATTAN, NY
 Site 3 of 5 in cluster F

LTANKS S104275739
 N/A

LTANKS:

Spill Number:	9504838	Region of Spill:	2
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MULQUEEN	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(212) 940-8700
Spiller:	ROSENMAN & COLIN		
Spiller Address:	575 MADISON AVE NEW YORK, NY 10022-2585		
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	07/03/1996		
Spill Cause:	Tank Failure	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other	PBS Number:	Not reported
Spill Date:	07/20/1995 16:00	Reported to Dept:	07/20/1995 16:46
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	07/03/1996		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	08/15/1995		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	-1		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SILVERSTEIN PROPERTIES: YALE BUILDING (Continued)

U003065922

PBS UST:
PBS Number: 2-602646 CBS Number: Not reported
SPDES Number: Not reported SWIS ID: 6201
Operator: JACK PIERSON
(212) 695-4463
Emergency Contact: JACK PIERSON
(212) 695-4463
Total Tanks: 0
Owner: SILVERSTEIN PROPERTIES
521 FIFTH AVENUE
NEW YORK, NY 10175
(212) 551-7346
Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: SILVERSTEIN PROPERTIES
ATTN: WILLIAM R. DACUNTO, RPA
521 FIFTH AVENUE
NEW YORK, NY 10175
(212) 551-7346
Tank Status: Closed - Removed
Capacity (gals): 550
Tank Location: UNDERGROUND
Tank Id: 001 Install Date: 12/01/1964
Tank Type: Steel/carbon steel Product Stored: DIESEL
Tank Internal: NONE Pipe Internal: NONE
Pipe Location: Aboveground Pipe Type: NONE
Tank External: NONE/SACRIFICIAL ANODE
Missing Data for Tank: No Missing Data
Pipe External: NONE/NONE
Second Containment: NONE/NONE
Leak Detection: NONE/NONE
Overfill Prot: None Dispenser: Suction
Date Tested: Not reported Next Test Date: Not reported
Date Closed: 03/01/1996 Test Method: Not reported
Deleted: False Updated: True
Dead Letter: False Owner Screen: Minor data missing
FAMT: Fiscal amount for registration fee is correct
Total Capacity: 0 Renewal Date: Not reported
Tank Screen: 0 Federal ID: Not reported
Renew Flag: Renewal has not been printed Facility Screen: No data missing
Certification Flag: False Certification Date: Not reported
Old PBS Number: Not reported Expiration Date: 03/28/2001
Inspected Date: Not reported Inspector: Not reported
Inspection Result: Not reported
Lat/long: Not reported
Facility Type: TRUCKING/TRANSPORTATION
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
PBS Number: 2-602646 CBS Number: Not reported
SPDES Number: Not reported SWIS ID: 6201
Operator: JACK PIERSON
(212) 695-4463
Emergency Contact: JACK PIERSON

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

SILVERSTEIN PROPERTIES: YALE BUILDING (Continued)

U003065922

Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: SILVERSTEIN PROPERTIES
ATTN: WILLIAM R. DACUNTO, RPA
521 FIFTH AVENUE
NEW YORK, NY 10175
(212) 551-7346

Tank Status: Closed - Removed
Capacity (gals): 550
Tank Location: UNDERGROUND
Tank Id: 003
Tank Type: Steel/carbon steel
Tank Internal: NONE
Pipe Location: Aboveground
Tank External: NONE/SACRIFICIAL ANODE
Missing Data for Tank: No Missing Data
Pipe External: NONE/NONE
Second Containment: NONE/NONE
Leak Detection: NONE/NONE
Overfill Prot: None
Date Tested: Not reported
Date Closed: 03/01/1996
Deleted: False
Dead Letter: False
FAMT: Fiscal amount for registration fee is correct
Total Capacity: 0
Tank Screen: 0
Renew Flag: Renewal has not been printed
Certification Flag: False
Old PBS Number: Not reported
Inspected Date: Not reported
Inspection Result: Not reported
Lat/long: Not reported
Facility Type: TRUCKING/TRANSPORTATION
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2

Install Date: 12/01/1964
Product Stored: DIESEL
Pipe Internal: NONE
Pipe Type: NONE
Dispenser: Suction
Next Test Date: Not reported
Test Method: Not reported
Updated: True
Owner Screen: Minor data missing
Renewal Date: Not reported
Federal ID: Not reported
Facility Screen: No data missing
Certification Date: Not reported
Expiration Date: 03/28/2001
Inspector: Not reported

PBS Number: 2-602646
SPDES Number: Not reported
Operator: JACK PIERSON
(212) 695-4463
Emergency Contact: JACK PIERSON
(212) 695-4463
Total Tanks: 0
Owner: SILVERSTEIN PROPERTIES
521 FIFTH AVENUE
NEW YORK, NY 10175
(212) 551-7346
Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: SILVERSTEIN PROPERTIES
ATTN: WILLIAM R. DACUNTO, RPA
521 FIFTH AVENUE

CBS Number: Not reported
SWIS ID: 6201

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

SILVERSTEIN PROPERTIES: YALE BUILDING (Continued)

U003065922

Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Aboveground	Pipe Type:	NONE
Tank External:	NONE/SACRIFICIAL ANODE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	03/01/1996	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	03/28/2001
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		

This is the most recent NY PBS data for this site.
The NY PBS database contains 9 additional records for this site.
Please contact your EDR Account Executive for more information.

28
SE
1/8-1/4
815
Higher

CON EDISON - WEST 42ND ST SUB
571 W 41ST ST
NEW YORK, NY 10036

FINDS 1000833493
RCRIS-LQG NYD987023892

RCRIS:

Owner: CONSOLIDATED EDISON
(212) 555-1212

Contact: ROBERT KEEGAN
(212) 460-4833

Record Date: 12/16/1992
Classification: Large Quantity Generator, Small Quantity Generator
Used Oil Recyc: No

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

CIRCLE LINE (Continued)

1000871471

RCRIS:

Owner: CIRCLE LINE SIGHTSEEING
 (212) 555-1212

Contact: DOUG FEDDER
 (212) 630-8117

Record Date: 11/17/1993
 Classification: Small Quantity Generator
 Used Oil Recyc: No

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Facility Registry System (FRS)
 Resource Conservation and Recovery Act Information system (RCRAINFO)

G32
 ENE
 1/8-1/4
 923
 Higher

DEMARCO JOSEPH E
595 11TH AVE
NEW YORK, NY 10036
 Site 2 of 2 in cluster G

RCRIS-SQG 1000554867
FINDS NYD986973568

RCRIS:

Owner: JOSEPH E DEMARCO
 (212) 315-3350

Contact: JOSEPH E DEMARCO
 (212) 315-3350

Record Date: 10/15/1991
 Classification: Conditionally Exempt Small Quantity Generator, Hazardous Waste Transporter
 Used Oil Recyc: No

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Facility Registry System (FRS)
 Resource Conservation and Recovery Act Information system (RCRAINFO)

H33
 East
 1/8-1/4
 950
 Higher

RIVERBANK WEST
560 WEST 43RD STREET
NEW YORK, NY 10019
 Site 1 of 2 in cluster H

UST U001840846
N/A

PBS UST:

PBS Number: 2-477419

CBS Number: Not reported

SPDES Number: Not reported

SWIS ID: 6201

Operator: MARNI BERK
 (212) 629-5990

Emergency Contact: SCOTT WARSHAW
 (212) 265-5900

Total Tanks: 2

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

RIVERBANK WEST (Continued)

U001840846

Owner Subtype:	Not reported	
Mailing Address:	MANHATTAN PACIFIC MGNT CO, INC. ATTN: SCOTT WARSHAW 142 WEST 57TH STREET - 15TH FL NEW YORK, NY 10019 (212) 265-5990	
Tank Status:	In Service	
Capacity (gals):	15000	
Tank Location:	UNDERGROUND	
Tank Id:	002	Install Date: 08/01/1986
Tank Type:	Fiberglass reinforced plastic [FRP]	Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Internal:	Not reported	Pipe Internal: Not reported
Pipe Location:	1	Pipe Type: STEEL/IRON
Tank External:	Not reported	
Missing Data for Tank:	Minor Data Missing	
Pipe External:	Not reported	
Second Containment:	NONE	
Leak Detection:	NONE	
Overfill Prot:	Product Level Gauge	Dispenser: Suction
Date Tested:	Not reported	Next Test Date: 08/01/2001
Date Closed:	Not reported	Test Method: Not reported
Deleted:	False	Updated: False
Dead Letter:	False	Owner Screen: No data missing
FAMT:	Fiscal amount for registration fee is correct	
Total Capacity:	30000	Renewal Date: 08/12/1999
Tank Screen:	Minor data missing	Federal ID: Not reported
Renew Flag:	Renwal has not been printed	Facility Screen: No data missing
Certification Flag:	False	Certification Date: 10/29/1999
Old PBS Number:	Not reported	Expiration Date: 09/25/2004
Inspected Date:	Not reported	Inspector: Not reported
Inspection Result:	Not reported	
Lat/long:	Not reported	
Facility Type:	APARTMENT BUILDING	
Town or City:	NEW YORK CITY	
Town or City Code:	01	
County Code:	62	
Region:	2	

I34
 NE
 1/8-1/4
 1034
 Higher

612 W 45TH ST/UPS
612 W 45TH ST
NYC, NY
 Site 1 of 6 in cluster I

LTANKS S102671711
N/A

LTANKS:

Spill Number:	9104075	Region of Spill:	2
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	SULLIVAN	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	UPS		
Spiller Address:	643 W 43RD ST NY, NY 10036		
Spill Class:	Known release that creates a file or hazard. (Highly Improbable)		
Spill Closed Dt:	Not reported		
Spill Cause:	Tank Overfill	Resource Affected:	On Land

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

UNITED PARCEL SERVICE (Continued)

U001330111

Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	UNITED PARCEL SERVICE ATTN: FACILITY ENGINEER 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6446		
Tank Status:	In Service	Install Date:	01/01/1992
Capacity (gals):	4000	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	FIBERGLASS LINER [FRP]
Tank Id:	001	Pipe Type:	FIBERGLASS [FRP]
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	SACRIFICIAL ANODE		
Missing Data for Tank:	No Missing Data		
Pipe External:	FIBERGLASS		
Second Containment:	DOUBLED-WALLED TANK		
Leak Detection:	INTERSTITIAL MONITORING		
Overfill Prot:	High Level Alarm	Dispenser:	Submersible
Date Tested:	04/01/1999	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	TANKOLOGY [VACUTECT]
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	8000	Renewal Date:	01/02/1998
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/25/1999
Old PBS Number:	Not reported	Expiration Date:	03/31/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-601418	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	TOM SAVAGE (212) 631-6446		
Emergency Contact:	PAUL MCDONALD (212) 631-6444		
Total Tanks:	2		
Owner:	NUBEE INC. 643 WEST 43RD STREET NEW YORK, NY 10036 (212) 631-6446		
Owner Type:	Not reported		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	UNITED PARCEL SERVICE ATTN: FACILITY ENGINEER 643 WEST 43RD STREET NEW YORK, NY 10036		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

TRAILWAYS INC (Continued)

1000254768

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Facility Registry System (FRS)
 Resource Conservation and Recovery Act Information system (RCRAINFO)

H37
East
1/8-1/4
1036
Higher

MERCHANDISING WORKSHOP INC
550 W 43RD ST
NY, NY 10036

UST U000404667
N/A

Site 2 of 2 in cluster H

PBS UST:

PBS Number:	2-370258	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BARNEY GORGONE (212) 239-4646		
Emergency Contact:	NORMAN ALSHOOLER PRESIDENT (212) 490-1046		
Total Tanks:	1		
Owner:	MERCHANDISING WORKSHOP INC 550 W 43RD ST NY, NY 10036 (212) 239-4646		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	MERCHANDISING WORKSHOP INC 550 W 43RD ST NY, NY 10036 (212) 239-4646		
Tank Status:	In Service		
Capacity (gals):	7500		
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS		
Tank Id:	001	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	1	Pipe Type:	STEEL/IRON
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	VAULT		
Leak Detection:	NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	False
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	7500	Renewal Date:	12/02/1997
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	01/16/1998
Old PBS Number:	Not reported	Expiration Date:	02/03/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

MERCEDES/BENZ MANHATTAN INC (Continued)

U003074760

Database(s) EDR ID Number
 EPA ID Number

Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	2	Pipe Type:	GALVANIZED STEEL
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	VAULT		
Leak Detection:	NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	4500	Renewal Date:	09/29/1997
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	10/15/1999
Old PBS Number:	Not reported	Expiration Date:	12/14/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-426962	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	MR. STEPHAN ALTRICHTER (212) 629-1606		
Emergency Contact:	MR. MICHAEL KEENAN (212) 629-1600		
Total Tanks:	3		
Owner:	MERCEDES/BENZ MANHATTAN INC 536 WEST 41ST STREET NEW YORK, NY 10036 (212) 760-0600		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	MERCEDES/BENZ MANHATTAN INC ATTN: MR. THOM LOPEZ 536 WEST 41ST STREET NEW YORK, NY 10036 (212) 629-1612		
Tank Status:	Closed - Removed		
Capacity (gals):	1100		
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS		
Tank Id:	002	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	OTHER
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	2	Pipe Type:	GALVANIZED STEEL
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

MERCEDES/BENZ MANHATTAN INC (Continued)

U003074760

Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	4500	Renewal Date:	09/29/1997
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	10/15/1999
Old PBS Number:	Not reported	Expiration Date:	12/14/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS AST:			
PBS Number:	2-426962	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	6201
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	OTHER		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	MERCEDES/BENZ MANHATTAN INC 536 WEST 41ST STREET NEW YORK, NY 10036		
Owner Phone:	(212) 760-0600		
Facility Phone:	(212) 629-1606		
Operator:	MR. STEPHAN ALTRICHTER		
Emergency Name:	MR. MICHAEL KEENAN		
Emergency Phone:	(212) 629-1600		
Total Tanks:	3		
Total Capacity:	4500		
Tank ID:	001		
Capacity (Gal):	2000		
Missing Data for Tank :	Minor data missing		
Tank Location:	ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE		
Product Stored:	OTHER		
Tank Type:	Steel/carbon steel		
Install Date:	04/01/1991		
Tank Internal:	Not reported		
Tank External:	Not reported		
Tank Containment:	CONCRETE DIKE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Not reported		
Pipe Internal:	Not reported		
Pipe External:	Not reported		
Leak Detection:	OTHER		
Overfill Protection:	Product Level Gauge		
Dispenser Method:	Submersible		
Date Tested:	//	Next Test Date:	//
Date Closed:	//	Test Method:	Not reported
Updated:	True	Deleted:	False
Date Inspected:	Not reported	Inspector:	Not reported
Result of Inspection:	Not reported		
Mailing Name:	MERCEDES/BENZ MANHATTAN INC		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MERCEDES/BENZ MANHATTAN INC (Continued)

U003074760

Result of Inspection: Not reported
Mailing Name: MERCEDES/BENZ MANHATTAN INC
Mailing Address: 536 WEST 41ST STREET
NEW YORK, NY 10036
Mailing Contact: MR. THOM LOPEZ
Mailing Telephone: (212) 629-1612
Owner Mark: First Owner
Certification Flag: False
Renew Flag: True
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: Minor data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Expiration Date: 12/14/2002
Certification Date: 10/15/1999
Renew Date: 09/29/1997
Fiscal Amount for Registration Fee is Correct: True
PBS Number: 2-426962
SPDES Number: Not reported
Federal ID: Not reported
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.
CBS Number: Not reported
SWIS Code: 6201
Previous PBS#: Not reported
Facility Type: OTHER
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Owner: MERCEDES/BENZ MANHATTAN INC
536 WEST 41ST STREET
NEW YORK, NY 10036
Owner Phone: (212) 760-0600
Facility Phone: (212) 629-1606
Operator: MR. STEPHAN ALTRICHTER
Emergency Name: MR. MICHAEL KEENAN
Emergency Phone: (212) 629-1600
Total Tanks: 3
Total Capacity: 4500
Tank ID: 003
Capacity (Gal): 500
Missing Data for Tank: No data missing
Tank Location: ABOVEGROUND
Product Stored: LUBE OIL
Tank Type: Steel/carbon steel
Install Date: 02/01/1991
Tank Internal: NONE
Tank External: NONE
Tank Containment: NONE/CONCRETE DIKE
Pipe Type: STEEL/IRON
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE
Leak Detection: OTHER
Overfill Protection: Product Level Gauge
Dispenser Method: Suction
Date Tested: //
Date Closed: //
Next Test Date: //
Test Method: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

SWING TIME LLC CORP. (Continued)

U003697798

Leak Detection:	NONE/NONE	Dispenser:	None
Overfill Prot:	None	Next Test Date:	Not reported
Date Tested:	Not reported	Test Method:	Not reported
Date Closed:	07/01/1999	Updated:	True
Deleted:	False	Owner Screen:	Minor data missing
Dead Letter:	True	Fiscal amount for registration fee is correct	
FAMT:	Fiscal amount for registration fee is correct	Renewal Date:	Not reported
Total Capacity:	0	Federal ID:	Not reported
Tank Screen:	0	Facility Screen:	Minor data missing
Renew Flag:	Renwal has not been printed	Certification Date:	Not reported
Certification Flag:	False	Expiration Date:	08/09/2004
Old PBS Number:	Not reported	Inspector:	Not reported
Inspected Date:	Not reported		
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	Not reported		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	61		
Region:	2		
PBS Number:	2-604187	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6101
Operator:	ROBERT GANS (212) 246-9090		
Emergency Contact:	ROBERT GANS (212) 272-9494		
Total Tanks:	0		
Owner:	ROBERT GANS 609 11TH AVENUE NEW YORK, NY 10036 (212) 272-9494		
Owner Type:	Not reported		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	SWING TIME LLC, CORP ATTN: ROBERT GANS 609 11TH AVENUE NEW YORK, NY 10036 (212) 272-9494		
Tank Status:	Closed - Removed	Install Date:	Not reported
Capacity (gals):	550	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	NONE
Tank Id:	002	Pipe Type:	NONE
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	None		
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	None
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	07/01/1999	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	True	Owner Screen:	Minor data missing

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

SWING TIME LLC CORP. (Continued)

U003697798

Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	Not reported		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	61		
Region:	2		
PBS Number:	2-604187	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6101
Operator:	ROBERT GANS (212) 246-9090		
Emergency Contact:	ROBERT GANS (212) 272-9494		
Total Tanks:	0		
Owner:	ROBERT GANS 609 11TH AVENUE NEW YORK, NY 10036 (212) 272-9494		
Owner Type:	Not reported		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	SWING TIME LLC, CORP ATTN: ROBERT GANS 609 11TH AVENUE NEW YORK, NY 10036 (212) 272-9494		
Tank Status:	Closed - Removed		
Capacity (gals):	550		
Tank Location:	UNDERGROUND		
Tank Id:	004	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	UNLEADED GASOLINE
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	None	Pipe Type:	NONE
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	None
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	07/01/1999	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	True	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	Minor data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	08/09/2004
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	Not reported		
Town or City:	NEW YORK CITY		
Town or City Code:	01		

MAP FINDINGS

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

Database(s) EDR ID Number
 EPA ID Number

SWING TIME LLC CORP. (Continued)

U003697798

This is the most recent NY PBS data for this site.
 The NY PBS database contains 5 additional records for this site.
 Please contact your EDR Account Executive for more information.

**I41
 NE
 1/8-1/4
 1097
 Higher**

**MILLER-GERALDI INC
 609 11TH AVE
 NEW YORK, NY 10036**

Site 5 of 6 in cluster I

**FINDS 1000281064
 RCRIS-LQG NYD012149340**

RCRIS:

Owner: SUN OIL COMPANY OF PENNSYLVANIA
 (212) 555-1212

Contact: HOWARD ALGEO
 (215) 688-8200

Record Date: 08/18/1980
 Classification: Large Quantity Generator
 Used Oil Recyc: No

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:
 Facility Registry System (FRS)
 Resource Conservation and Recovery Act Information system (RCRAINFO)

**J42
 SE
 1/8-1/4
 1112
 Higher**

**MERCEDES-BENZ MANHATTAN INC
 528 W 41ST ST
 NEW YORK, NY 10036**

Site 3 of 3 in cluster J

**FINDS 1000168670
 RCRIS-LQG NYD981138472**

RCRIS:

Owner: Not reported

Contact: WILLIE KRAUSE
 (212) 760-0678

Record Date: 10/15/1985
 Classification: Large Quantity Generator, Small Quantity Generator
 Used Oil Recyc: No

Violation Status: Violations exist

Regulation Violated:	Not reported
Area of Violation:	Generator-All Requirements
Date Violation Determined:	08/26/1994
Priority of Violation:	Low
Schedule Date to Achieve Compliance:	09/26/1994
Actual Date Achieved Compliance:	10/11/1994

Enforcement Action:	Written Informal
Enforcement Action Date:	08/26/1994
Proposed Monetary Penalty:	Not reported
Final Monetary Penalty:	Not reported

Regulation Violated:	Not reported
Area of Violation:	Generator-Land Ban Requirements
Date Violation Determined:	08/26/1994

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

43RD PARKING CORP (Continued)

U000399370

Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	12/27/1987
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	8000	Renewal Date:	06/11/1997
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renewal has not been printed	Facility Screen:	Minor data missing
Certification Flag:	False	Certification Date:	12/01/2000
Old PBS Number:	Not reported	Expiration Date:	07/07/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	Not reported		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-296473	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	43-44 MGT (212) 643-2062		
Emergency Contact:	GAUY SPINDLA (212) 643-8631		
Total Tanks:	2		
Owner:	43RD PARKING CORP 541 W 43 ST NY, NY 10036 (212) 643-2062		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	43RD PARKING CORP 541 W 43 ST NY, NY 10036 (212) 643-2062		
Tank Status:	Temporarily Out of Service		
Capacity (gals):	4000		
Tank Location:	UNDERGROUND		
Tank Id:	002	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	LEADED GASOLINE
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	1	Pipe Type:	STEEL/IRON
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	OTHER		
Leak Detection:	NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	12/27/1987
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	8000	Renewal Date:	06/11/1997

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

MARVIN MITHELL (Continued)

U003418632

Renew Flag:	Renwal has not been printed	Facility Screen:	Minor data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	12/29/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	Not reported		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-603858	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	GARY SPINDLER (212) 643-2062		
Emergency Contact:	MARVIN MITCHEL (212) 362-4455		
Total Tanks:	0		
Owner:	MARVIN MITCHELL 157 CONGRESS STREET BROOKLYN, NY 11201 (718) 624-3859		
Owner Type:	Private Resident		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	MARVIN MITCHELL ATTN: MARVIN MITCHELL 2112 BROADWAY #413 NEW YORK, NY 10023 (212) 362-4455		
Tank Status:	Closed - Removed	Install Date:	Not reported
Capacity (gals):	4000	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	NONE
Tank Id:	002	Pipe Type:	GALVANIZED STEEL
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	01/01/1999	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	Minor data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	12/29/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

609-611 11TH ST (Continued)

S101509072

Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
Material Class Type: 1
Quantity Spilled: 0
Units: Not reported
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: WASTE OIL
Class Type: Petroleum
Chem Abstract Service Number: WASTE OIL
Last Date: 09/27/1994
Num Times Material Entry In File: 9509
DEC Remarks: Not reported
Spill Cause: ENVIRONMENTAL SITE STUDY DONE - GROUND CONTAMINATION FOUND RESULTING FROM TANK LEAKING. PROPERTY IS ABANDONED GAS STATION. 10TH AVE CORP. OWNER ISAAC GATWEN, 18 WOODHAVEN, NEW YORK CITY

L46
NNE
1/8-1/4
1213
Higher

**MY PRINT CO LIMIT
711 12TH AVE PIER 88
NEW YORK, NY 10019**

**RCRIS-SQG 1001090372
FINDS NYR000022095**

Site 1 of 3 in cluster L

RCRIS:

Owner: MY PRINT CO
(212) 555-1212
Contact: JEFF DUTZLER
(516) 832-7095
Record Date: 04/11/1996
Classification: Small Quantity Generator
Used Oil Recyc: No
Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Facility Registry System (FRS)
Resource Conservation and Recovery Act Information system (RCRAINFO)

L47
NNE
1/8-1/4
1213
Higher

**A G F A DIV OF BAYER CORP
711 12TH AVE PIER 92
NEW YORK, NY 10019**

**RCRIS-SQG 1001119664
FINDS NYR000029546**

Site 2 of 3 in cluster L

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

711 12TH AVE/MANHATTAN (Continued)

S100167579

Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: 0
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Not reported
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: #4 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #4 FUEL OIL
Last Date: 12/05/1994
Num Times Material Entry In File: 1751
DEC Remarks: Not reported
Spill Cause: 7.5K TANK SYSTEM FAILED HORNER EZY WITH A LEAK RATE OF .07996GPH, LEAKIS POSSIBLY FROM ABOVEGROUND PIPING, TO PUMP TANK AND INVESTIGATE.

K49
East
1/8-1/4
1213
Higher

FDNY RESCUE 1
530 WEST 43RD ST
MANHATTEN, NY
Site 3 of 4 in cluster K

LTANKS S102660118
N/A

LTANKS:

Spill Number: 9706580
Facility Contact: TONY MARINO
Investigator: KRIMGOLD
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: TONY MARINO
Spiller: NYC DEPT OF DESIGN/CONSTR
Spiller Address: 30-30 THOMPSON AV 5TH FL
LONG ISLAND CITY, NY 11101
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/06/1999
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Other
Spill Date: 09/02/1997 14:00
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 08/06/1999
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 09/02/1997
Date Region Sent Summary to Central Office: Not reported
Region of Spill: 2
Facility Tele: (718) 391-1062
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: (718) 391-1062
Resource Affected: On Land
Spill Source: Other Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 09/02/1997 14:36

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

F.D.N.Y.-RESCUE CO. 1 (Continued)

EDR ID Number
 EPA ID Number

Database(s)

U003178521

Overfill Prot:	High Level Alarm, Vent Whistle	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	11/01/1996	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	1100	Renewal Date:	04/25/1997
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renewal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	12/27/1991
Old PBS Number:	Not reported	Expiration Date:	12/27/1996
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	OTHER		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-600574	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	COMPANY OFFICER (212) 570-4204		
Emergency Contact:	F.D.N.Y. (718) 403-1580		
Total Tanks:	2		
Owner:	F.D.N.Y. 250 LIVINGSTON STREET BROOKLYN, NY 11201 (718) 403-1580		
Owner Type:	Local Government		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	F.D.N.Y. 250 LIVINGSTON STREET BROOKLYN, NY 11201 (718) 403-4202		
Tank Status:	Closed - In Place		
Capacity (gals):	500		
Tank Location:	UNDERGROUND		
Tank id:	002	Install Date:	12/01/1989
Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Aboveground	Pipe Type:	GALVANIZED STEEL
Tank External:	NONE/SACRIFICIAL ANODE		
Missing Data for Tank:	No Missing Data		
Pipe External:	FIBERGLASS/JACKETED		
Second Containment:	NONE/VAULT		
Leak Detection:	NONE/IN-TANK SYSTEM		
Overfill Prot:	High Level Alarm	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	11/01/1996	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	1100	Renewal Date:	04/25/1997

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

F.D.N.Y.-RESCUE CO. 1 (Continued)

U003178521

Mailing Telephone: (718) 403-4202
Owner Mark: First Owner
Certification Flag: False
Renew Flag: True
Lat/Long: Not reported
Dead Letter: False
Facility Screen: No data missing
Owner Screen: No data missing
Tank Screen: No data missing
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 2-600574
SPDES Number: Not reported
Federal ID: Not reported
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Type: OTHER
Owner Type: Local Government
Owner Sub Type: Not reported
Owner: F.D.N.Y.
250 LIVINGSTON STREET
BROOKLYN, NY 11201

Owner Phone: (718) 403-1580
Facility Phone: (212) 570-4204
Operator: COMPANY OFFICER
Emergency Name: F.D.N.Y.
Emergency Phone: (718) 403-1580
Total Tanks: 2
Total Capacity: 1100
Tank ID: 004
Capacity (Gal): 550
Missing Data for Tank : No data missing
Tank Location: ABOVEGROUND
Product Stored: DIESEL
Tank Type: Steel/carbon steel
Install Date: 12/01/1996
Tank Internal: NONE
Tank External: NONE/PAINTED/ASPHALT COATING
Tank Containment: NONE/OTHER
Pipe Type: GALVANIZED STEEL
Pipe Location: Aboveground
Pipe Internal: NONE
Pipe External: NONE/PAINTED/ASPHALT COATING
Leak Detection: NONE/INTERSTITIAL MONITORING
Overfill Protection: High Level Alarm
Dispenser Method: Suction
Date Tested: //
Date Closed: //
Updated: True
Date Inspected: Not reported
Result of Inspection: Not reported
Mailing Name: F.D.N.Y.
Mailing Address: 250 LIVINGSTON STREET

Expiration Date: 12/27/1996
Certification Date: 12/27/1991
Renew Date: 04/25/1997

CBS Number: Not reported
SWIS Code: 6201
Previous PBS#: Not reported

Next Test Date: //
Test Method: Not reported
Deleted: False
Inspector: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

PIER 90/MANHATTAN (Continued)

S100145208

Leak Rate Failed Tank: 0.00
 Gross Leak Rate: Not reported
 Material:
 Material Class Type: 1
 Quantity Spilled: -1
 Units: Not reported
 Unknown Qty Spilled: -1
 Quantity Recovered: 0
 Unknown Qty Recovered: False
 Material: #4 FUEL OIL
 Class Type: Petroleum
 Chem Abstract Service Number: #4 FUEL OIL
 Last Date: 12/05/1994
 Num Times Material Entry In File: 1751
 DEC Remarks: Not reported
 Spill Cause: 7.5K TANK FAILED HORNER EZY CHECK WITH A GROSS LEAK.

M52
 SE
 1/8-1/4
 1257
 Higher

AMERICAN RED CROSS EMERGENCY FAM. CENTER
515 WEST 41ST STREET
NEW YORK, NY 10036
 Site 1 of 2 in cluster M

UST U001837881
 N/A

PBS UST:
 PBS Number: 2-407216 CBS Number: Not reported
 SPDES Number: Not reported SWIS ID: 6201
 Operator: AMERICAN RED CROSS
 (212) 714-2870
 Emergency Contact: HERMINE E. BOWENS
 (212) 714-2870
 Total Tanks: 1
 Owner: FICO REALTY
 C/O WELLINGTON HOTEL 871 7TH
 NEW YORK, NY 10019
 (212) 714-2870
 Owner Type: Corporate/Commercial
 Owner Mark: First Owner
 Owner Subtype: Not reported
 Mailing Address: AMERICAN RED CROSS
 ATTN: CHAPTER DIRECTOR
 515 WEST 41ST STREET
 NEW YORK, NY 10019
 (212) 714-2870
 Tank Status: In Service
 Capacity (gals): 10000
 Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
 Tank Id: 001 Install Date: Not reported
 Tank Type: Steel/carbon steel Product Stored: NOS 1,2, OR 4 FUEL OIL
 Tank Internal: Not reported Pipe Internal: Not reported
 Pipe Location: 1 Pipe Type: STEEL/IRON
 Tank External: Not reported
 Missing Data for Tank: Minor Data Missing
 Pipe External: Not reported
 Second Containment: VAULT
 Leak Detection: GROUNDWATER WELL
 Overfill Prot: Product Level Gauge Dispenser: Suction
 Date Tested: Not reported Next Test Date: Not reported
 Date Closed: Not reported Test Method: Not reported
 Deleted: False Updated: True

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

I&G EXPRESS INC. (Continued)

U003749734

FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	10/02/2005
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	RETAIL GASOLINE SALES		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-604710	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	ARI ZUBLI (212) 695-6262		
Emergency Contact:	ARI ZUBLI (212) 695-6262		
Total Tanks:	0		
Owner:	U&I REALTY INC. 456 11TH AVENUE NEW YORK, NY 10018 (212) 695-6262		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	GUARDIAN BROKERAGE ATTN: ARI ZUBLI PO BOX 2009 GREAT NECK, NY 11022 (212) 695-6262		
Tank Status:	Closed - Removed	Install Date:	Not reported
Capacity (gals):	550	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	2	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	Not reported	Dispenser:	Not reported
Leak Detection:	Not reported	Next Test Date:	Not reported
Overfill Prot:	Not reported	Test Method:	Not reported
Date Tested:	Not reported	Updated:	True
Date Closed:	09/01/2000	Owner Screen:	No data missing
Deleted:	False		
Dead Letter:	False		
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	Not reported
Old PBS Number:	Not reported	Expiration Date:	10/02/2005

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

I&G EXPRESS INC. (Continued)

U003749734

County Code: 62
Region: 2

PBS Number: 2-604710
SPDES Number: Not reported
Operator: ARI ZUBLI
(212) 695-6262

Emergency Contact: ARI ZUBLI
(212) 695-6262

Total Tanks: 0
Owner: U&I REALTY INC.
456 11TH AVENUE
NEW YORK, NY 10018
(212) 695-6262

Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: GUARDIAN BROKERAGE
ATTN: ARI ZUBLI
PO BOX 2009
GREAT NECK, NY 11022
(212) 695-6262

Tank Status: Closed - Removed
Capacity (gals): 550
Tank Location: UNDERGROUND
Tank Id: 4
Tank Type: Steel/carbon steel
Tank Internal: NONE
Pipe Location: Underground
Tank External: Not reported
Missing Data for Tank: Minor Data Missing
Pipe External: Not reported
Second Containment: Not reported
Leak Detection: Not reported
Overfill Prot: Not reported
Date Tested: Not reported
Date Closed: 09/01/2000
Deleted: False
Dead Letter: False
FAMT: Fiscal amount for registration fee is correct

Total Capacity: 0
Tank Screen: 0
Renew Flag: Renewal has not been printed
Certification Flag: False
Old PBS Number: Not reported
Inspected Date: Not reported
Inspection Result: Not reported
Lat/long: Not reported
Facility Type: RETAIL GASOLINE SALES
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2

PBS Number: 2-604710
SPDES Number: Not reported
Operator: ARI ZUBLI

CBS Number: Not reported
SWIS ID: 6201

Install Date: Not reported
Product Stored: UNLEADED GASOLINE
Pipe Internal: Not reported
Pipe Type: STEEL/IRON

Dispenser: Not reported
Next Test Date: Not reported
Test Method: Not reported
Updated: True
Owner Screen: No data missing

Renewal Date: Not reported
Federal ID: Not reported
Facility Screen: No data missing
Certification Date: Not reported
Expiration Date: 10/02/2005
Inspector: Not reported

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

TRAVEL INN HOTEL (Continued)

U000393917

PBS UST:
 PBS Number: 2-055239 CBS Number: Not reported
 SPDES Number: Not reported SWIS ID: 6201
 Operator: ALVIN WIDEMAN
 (212) 695-7171
 Emergency Contact: ANTONIO LAHOZ
 (212) 594-4923
 Total Tanks: 1
 Owner: FICO REALTY
 515 WEST 42ND STREET
 NEW YORK, NY 10036
 (212) 695-7171
 Owner Type: Corporate/Commercial
 Owner Mark: First Owner
 Owner Subtype: Not reported
 Mailing Address: FICO REALTY
 ATTN: RONALD DOMB
 515 WEST 42ND STREET
 NEW YORK, NY 10036
 (212) 695-7171
 Tank Status: In Service
 Capacity (gals): 10000
 Tank Location: UNDERGROUND, VAULTED, WITH ACCESS
 Tank Id: 001 Install Date: Not reported
 Tank Type: Steel/carbon steel Product Stored: NOS 5 OR 6 FUEL OIL
 Tank Internal: Not reported Pipe Internal: Not reported
 Pipe Location: 1 Pipe Type: STEEL/IRON
 Tank External: Not reported
 Missing Data for Tank: Minor Data Missing
 Pipe External: Not reported
 Second Containment: VAULT
 Leak Detection: OTHER
 Overfill Prot: Product Level Gauge Dispenser: Suction
 Date Tested: Not reported Next Test Date: Not reported
 Date Closed: Not reported Test Method: Not reported
 Deleted: False Updated: False
 Dead Letter: False Owner Screen: No data missing
 FAMT: Fiscal amount for registration fee is correct
 Total Capacity: 10000 Renewal Date: 08/08/2001
 Tank Screen: Minor data missing Federal ID: Not reported
 Renew Flag: Renewal has not been printed Facility Screen: No data missing
 Certification Flag: True Certification Date: Not reported
 Old PBS Number: Not reported Expiration Date: 12/30/2006
 Inspected Date: Not reported Inspector: Not reported
 Inspection Result: Not reported
 Lat/long: Not reported
 Facility Type: OTHER
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2

55 MERCEDES BENZ MANHATTAN INC
 SSE 528 W 39TH ST
 1/8-1/4 NEW YORK, NY 10036
 1279
 Higher

RCRIS-SQG 1000168671
 UST NYD982739245

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation

MAP FINDINGS

MERCEDES BENZ MANHATTAN INC (Continued)

EDR ID Number
 EPA ID Number

Database(s)

Inspected Date: Not reported Inspector: Not reported
 Inspection Result: Not reported
 Lat/long: Not reported
 Facility Type: OTHER
 Town or City: NEW YORK CITY
 Town or City Code: 01
 County Code: 62
 Region: 2

1000168671

56
 East
 1/8-1/4
 1283
 Higher

ANNEX BLDG
521 WEST 43TH STREET
NEW YORK CITY, NY 10036

UST U001840312
 N/A

PBS UST:

PBS Number:	2-456985	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	N Y P L (212) 714-8519		
Emergency Contact:	SECURITY-N Y P L (212) 930-0513		
Total Tanks:	2		
Owner:	NEW YORK PUBLIC LIBRARY 11 WEST 40TH STREET NEW YORK CITY, NY 10018 (212) 930-0977		
Owner Type:	Local Government		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	NEW YORK PUBLIC LIBRARY 11 WEST 40TH STREET NEW YORK CITY, NY 10018 (212) 930-0977		
Tank Status:	In Service		
Capacity (gals):	1400		
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS		
Tank Id:	001	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	NOS 1,2, OR 4 FUEL OIL
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	1	Pipe Type:	STEEL/IRON
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	VAULT		
Leak Detection:	NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	11400	Renewal Date:	01/18/1994
Tank Screen:	Minor data missing	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	05/15/2000
Old PBS Number:	Not reported	Expiration Date:	12/06/2003
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		

Map ID
Direction
Distance
Distance (ft.)
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

N57 METROPOLITAN LUMBER COMPANY
NE 617 11TH AVE
1/8-1/4 NEW YORK, NY 10036
1308
Higher Site 1 of 2 in cluster N

UST 1000791013
LTANKS N/A

LTANKS:

Spill Number: 9707347
Facility Contact: BOB GANS
Investigator: TOMASELLO
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: BOB GANS
Spiller: METROPOLITAN LUMBER CO
Spiller Address: 617 11TH AV
MANHATTEN, NY

Region of Spill: 2
Facility Tele: (212) 246-9090
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: (212) 246-9090

Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/08/1998
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Other
Spill Date: 09/22/1997 13:30

Resource Affected: On Land
Spill Source: Other Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 09/22/1997 15:08

Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 01/16/1998
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 09/22/1997
Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329

DEC Remarks: VACANT LOT ADJACENT TO METROPOLITAN LUMBER. REMEDIATION PERFORMED BY OW
NER.

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

METROPOLITAN LUMBER COMPANY (Continued)

1000791013

Operator:	BOB GANS (212) 246-9090		
Emergency Contact:	BOB GANS (212) 246-9090		
Total Tanks:	0		
Owner:	METROPOLITAN LUMBER COMPANY 617 11TH AVE NEW YORK, NY 10036 (212) 246-9090		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	METROPOLITAN LUMBER CO. ATTN: BOB GANS 617 11TH AVENUE NEW YORK, NY 10036 (212) 243-9090		
Tank Status:	Closed - Removed		
Capacity (gals):	550		
Tank Location:	UNDERGROUND		
Tank Id:	02	Install Date:	10/01/1992
Tank Type:	Steel/carbon steel	Product Stored:	UNLEADED GASOLINE
Tank Internal:	NONE	Pipe Internal:	NONE
Pipe Location:	Underground	Pipe Type:	STEEL/IRON
Tank External:	NONE/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	None	Dispenser:	Submersible
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	Not reported	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	Minor data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	12/04/1997
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	02/19/1993
Old PBS Number:	Not reported	Expiration Date:	02/19/1998
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	TRUCKING/TRANSPORTATION		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-601335	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	BOB GANS (212) 246-9090		
Emergency Contact:	BOB GANS (212) 246-9090		
Total Tanks:	0		
Owner:	METROPOLITAN LUMBER COMPANY		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

METROPOLITAN LUMBER COMPANY (Continued)

1000791013

Mailing Address: METROPOLITAN LUMBER CO.
ATTN: BOB GANS
617 11TH AVENUE
NEW YORK, NY 10036
(212) 243-9090

Tank Status: Closed - Removed
Capacity (gals): 550
Tank Location: UNDERGROUND
Tank Id: 04
Tank Type: Steel/carbon steel
Tank Internal: NONE
Pipe Location: Underground
Tank External: NONE/NONE
Missing Data for Tank: No Missing Data
Pipe External: NONE/NONE
Second Containment: NONE/NONE
Leak Detection: NONE/NONE
Overfill Prot: None
Date Tested: Not reported
Date Closed: Not reported
Deleted: False
Dead Letter: False
FAMT: Fiscal amount for registration fee is correct
Total Capacity: 0
Tank Screen: 0
Renew Flag: Renewal has not been printed
Certification Flag: False
Old PBS Number: Not reported
Inspected Date: Not reported
Inspection Result: Not reported
Lat/long: Not reported
Facility Type: TRUCKING/TRANSPORTATION
Town or City: NEW YORK CITY
Town or City Code: 01
County Code: 62
Region: 2

Install Date: 10/01/1992
Product Stored: UNLEADED GASOLINE
Pipe Internal: NONE
Pipe Type: STEEL/IRON

Dispenser: Submersible
Next Test Date: Not reported
Test Method: Not reported
Updated: True
Owner Screen: Minor data missing
Renewal Date: 12/04/1997
Federal ID: Not reported
Facility Screen: No data missing
Certification Date: 02/19/1993
Expiration Date: 02/19/1998
Inspector: Not reported

PBS Number: 2-601335
SPDES Number: Not reported
Operator: BOB GANS
(212) 246-9090
Emergency Contact: BOB GANS
(212) 246-9090
Total Tanks: 0
Owner: METROPOLITAN LUMBER COMPANY
617 11TH AVE
NEW YORK, NY 10036
(212) 246-9090
Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: METROPOLITAN LUMBER CO.
ATTN: BOB GANS
617 11TH AVENUE
NEW YORK, NY 10036
(212) 243-9090
Tank Status: Closed - Removed

CBS Number: Not reported
SWIS ID: 6201

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MARTIN MANHATTAN ACURA (Continued)

1000411902

FINDS:

Other Pertinent Environmental Activity Identified at Site:
Resource Conservation and Recovery Act Information system (RCRAINFO)

59
ENE
1/4-1/2
1351
Higher

APT BUILDING
545 WEST 45TH ST
MANHATTEN, NY

LTANKS S102560347
N/A

LTANKS:

Spill Number: 9711326 Region of Spill: 2
Facility Contact: NONE Facility Tele: Not reported
Investigator: MARTINKAT SWIS: 61
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: CHARLIE Spiller Phone: (718) 932-9075
Spiller: MYSTIC OIL
Spiller Address: 19-01 STEINWAY ST
ASTORIA, NT
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/09/1998
Spill Cause: Tank Failure Resource Affected: On Land
Water Affected: Not reported Spill Source: Other Commercial/Industrial
Spill Notifier: Responsible Party PBS Number: Not reported
Spill Date: 01/09/1998 09:50 Reported to Dept: 01/09/1998 10:02
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 01/15/1998
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 01/09/1998
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 5
Units: Gallons
Unknown Qty Spilled: 5
Quantity Recovered: 5
Unknown Qty Recovered: False
Material: #4 FUEL OIL
Class Type: Petroleum

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

(Continued)

S104620828

Material: #2 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #2 FUEL OIL
Last Date: 12/07/1994
Num Times Material Entry In File: 24464
DEC Remarks: Not reported
Spill Cause: Not reported

61
SE
1/4-1/2
1410
Higher

547 10TH AVENUE
547 10TH AVENUE
MANHATTAN, NY

LTANKS S101658388
N/A

LTANKS:

Spill Number: 9503865
Facility Contact: Not reported
Investigator: MULQUEEN
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: UNKNOWN
Spiller Address: Not reported
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Other
Spill Date: 06/29/1995 10:50
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: Not reported
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 08/01/1995
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Gallons
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False

Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported

Resource Affected: On Land
Spill Source: Gas Station
PBS Number: Not reported
Reported to Dept: 06/29/1995 10:50

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

EDR ID Number
EPA ID Number
Database(s)

639 11TH AVE./MAHATTAN (Continued)

S100167441

Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: 09/27/95: WAS A BATTISTA SPILL MULQUEEN TOOK OVER IN REF. TO SPILL 950
4912. TRIED TO CONTACT OWNER NUMEROUS TIMES, NO REPLY. AFTER CONSIDER
ING THE FACT THAT THE SPILL HAS OCCURRED A LONG TIME AGO, AND THE SPILL
REMARKS INDICATE NO LONG-TERM FOLLOW-UP IS NEEDED. THIS SPILL HAS BEEN
CLOSED.
Spill Cause: NYCFD WAS AT SIGHT FOR TEST, MR. GUTMAN TO ARRANGE TO UNCOVER AND REP
AIR LEAK.

63
SSE
1/4-1/2
1535
Higher

509 WEST 38TH ST
509 WEST 38TH ST
MANHATTAN, NY

LTANKS S102672971
N/A

LTANKS:

Spill Number: 9505232
Facility Contact: Not reported
Investigator: MARTINKAT
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: 5 STAR HOSP. INC
Spiller Address: SAME
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 07/28/1995
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Notifier: Affected Persons
Spill Date: 07/27/1995 21:00
Cleanup Ceased: 07/28/1995
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: Not reported
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 08/17/1995
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported
Resource Affected: In Sewer
Spill Source: Other Non Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 07/28/1995 14:34

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

(Continued)

S104877490

Capacity of Failed Tank: Not reported
 Leak Rate Failed Tank: Not reported
 Gross Leak Rate: Not reported

Material:
 Material Class Type: 1
 Quantity Spilled: 0
 Units: Gallons
 Unknown Qty Spilled: No
 Quantity Recovered: 0
 Unknown Qty Recovered: True
 Material: GASOLINE
 Class Type: Petroleum
 Chem Abstract Service Number: GASOLINE
 Last Date: 09/29/1994
 Num Times Material Entry In File: 21329

DEC Remarks: On December 22, 2000, DEC Sigona) observed the excavation and removal of 4 x 550 gallon USTs. The contents of 3 x 550 gallon USTs was found to contain a mixture of gasoline and water. 1 x 550 gallon UST contained water only. The excavation was being performed by Fenely Nicol for Public Parking, Inc. The project was also supervised by DEC contractor EAR under PIN project for Jacob Javits Spill cleanup.

Spill Cause: DURING TANK REMOVAL SOIL CONTAMINATION HAS BEEN DISCOVERED. CONTAMINATION IS ON TOP OF TANKS. AREA TO BE EXCAVATED AND FURTHER SAMPLING/TESTING TO BE DONE. NO CALL BACK REQUESTED. CALLER HAS BEEN IN CONTACT WITH REGION 2 OFFICE.

O65
 East
 1/4-1/2
 1623
 Higher

SERVICE STATION
 624 10TH AVE
 MANHATTEN, NY

LTANKS S103037879
 N/A

Site 1 of 4 in cluster O

LTANKS:

Spill Number:	9713164	Region of Spill:	2
Facility Contact:	FLORA GANDELMAN	Facility Tele:	(212) 582-5790
Investigator:	MULQUEEN	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	JP YOUNG	Spiller Phone:	(212) 629-5890
Spiller:	JP YOUNG		
Spiller Address:	408 8TH AVE SUITE 206 MANHATTEN, NY		

Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt:	12/22/1998	Resource Affected:	Air
Spill Cause:	Tank Failure	Spill Source:	Gas Station
Water Affected:	Not reported	PBS Number:	Not reported
Spill Notifier:	Other	Reported to Dept:	02/25/1998 14:17
Spill Date:	02/25/1998 14:15		
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	True		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

HESS STATION #32215 (Continued)

U003178494

Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 08/04/1995
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 12/21/1988
Date Region Sent Summary to Central Office: Not reported

Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: 0
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Not reported
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: DIESEL
Class Type: Petroleum
Chem Abstract Service Number: DIESEL
Last Date: 07/28/1994
Num Times Material Entry In File: 10625

DEC Remarks: Not reported
Spill Cause: 2 4K TANKS SYPHONED TOGETHER FAILED PETRO. L R = -0.554 GPH. ORIG. INVE
STIGATED BY GRATHWOL

PBS UST:

PBS Number: 2-338613 CBS Number: Not reported
SPDES Number: Not reported SWIS ID: 6201
Operator: SITE MANAGER
(212) 245-6594

Emergency Contact: AMERADA HESS CORPORATION
(732) 750-6000

Total Tanks: 4
Owner: AMERADA HESS CORPORATION
1 HESS PLAZA
WOODBIDGE, NJ 07095
(732) 750-6000

Owner Type: Corporate/Commercial
Owner Mark: First Owner
Owner Subtype: Not reported
Mailing Address: AMERADA HESS CORP
ATTN: JANICE FLAHERTY
1 HESS PLAZA
WOODBIDGE, NJ 07095
(732) 750-6350

Tank Status: Closed - Removed
Capacity (gals): 4000
Tank Location: UNDERGROUND
Tank Id: 001
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Pipe Location: 2
Tank External: Not reported

Install Date: 12/01/1980
Product Stored: UNLEADED GASOLINE
Pipe Internal: Not reported
Pipe Type: GALVANIZED STEEL

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

HESS STATION #32215 (Continued)

U003178494

Date Closed:	04/01/1997	Test Method:	USTest 2000
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	40000	Renewal Date:	08/12/1997
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renewal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	08/31/2000
Old PBS Number:	Not reported	Expiration Date:	10/29/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	RETAIL GASOLINE SALES		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-338613	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	SITE MANAGER (212) 245-6594		
Emergency Contact:	AMERADA HESS CORPORATION (732) 750-6000		
Total Tanks:	4		
Owner:	AMERADA HESS CORPORATION 1 HESS PLAZA WOODBIDGE, NJ 07095 (732) 750-6000		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	AMERADA HESS CORP ATTN: JANICE FLAHERTY 1 HESS PLAZA WOODBIDGE, NJ 07095 (732) 750-6350		
Tank Status:	Closed - Removed	Install Date:	12/01/1980
Capacity (gals):	4000	Product Stored:	UNLEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	003	Pipe Type:	Not reported
Tank Type:	Steel/carbon steel		
Tank Internal:	Not reported		
Pipe Location:	Not reported		
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	VAULT		
Leak Detection:	Not reported	Dispenser:	Gravity
Overfill Prot:	Product Level Gauge	Next Test Date:	Not reported
Date Tested:	11/01/1995	Test Method:	USTest 2000
Date Closed:	04/01/1997	Updated:	True
Deleted:	False	Owner Screen:	No data missing
Dead Letter:	False		
FAMT:	Fiscal amount for registration fee is correct	Renewal Date:	08/12/1997
Total Capacity:	40000	Federal ID:	Not reported
Tank Screen:	No data missing		

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

HESS STATION #32215 (Continued)

U003178494

Facility Type:	RETAIL GASOLINE SALES		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		
PBS Number:	2-338613	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	6201
Operator:	SITE MANAGER (212) 245-6594		
Emergency Contact:	AMERADA HESS CORPORATION (732) 750-6000		
Total Tanks:	4		
Owner:	AMERADA HESS CORPORATION 1 HESS PLAZA WOODBIDGE, NJ 07095 (732) 750-6000		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	AMERADA HESS CORP ATTN: JANICE FLAHERTY 1 HESS PLAZA WOODBIDGE, NJ 07095 (732) 750-6350		
Tank Status:	Closed - Removed		
Capacity (gals):	4000		
Tank Location:	UNDERGROUND		
Tank Id:	005	Install Date:	12/01/1980
Tank Type:	Steel/carbon steel	Product Stored:	DIESEL
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	2	Pipe Type:	GALVANIZED STEEL
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	VAULT		
Leak Detection:	Not reported		
Overfill Prot:	Product Level Gauge	Dispenser:	Submersible
Date Tested:	11/01/1995	Next Test Date:	Not reported
Date Closed:	04/01/1997	Test Method:	USTest 2000
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	40000	Renewal Date:	08/12/1997
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	08/31/2000
Old PBS Number:	Not reported	Expiration Date:	10/29/2002
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	RETAIL GASOLINE SALES		
Town or City:	NEW YORK CITY		
Town or City Code:	01		
County Code:	62		
Region:	2		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

502 WEST 45TH ST/HESS (Continued)

S104275524

Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: Not reported
Spill Cause: Not reported

068
East
1/4-1/2
1676
Higher

WEST 45TH ST & 10TH AVE
WEST 45TH ST / 10TH AVE
NEW YORK CITY, NY

LTANKS S100167849
N/A

Site 4 of 4 in cluster O

LTANKS:

Spill Number: 9000492
Facility Contact: Not reported
Investigator: TOMASELLO
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: HESS
Spiller Address: Not reported
Spill Class: Known release that creates a file or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 08/02/1993
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Local Agency
Spill Date: 04/14/1990 16:40
Cleanup Ceased: 08/02/1993
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 08/02/1993
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered in Computer Data File: 05/11/1990
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Not reported
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum

Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported

Resource Affected: Groundwater
Spill Source: Gas Station
PBS Number: Not reported
Reported to Dept: 04/14/1990 16:00

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

450 W. 41ST STREET (Continued)

S102233197

Unknown Qty Recovered: False
Material: #6 FUEL OIL
Class Type:
Chem Abstract Service Number: #6 FUEL OIL
Last Date: 07/28/1994
Num Times Material Entry In File: 2190
DEC Remarks: Dec Sigona met with Dormitory Authority staff on July 17, 1995. Meeting included David Recino (Dormitory Authority), E. Dowd (Hunter College), Roy Fein (Rose, Beaton Rose), R. Dib (Aqua-X). Investigation found oil leak in tank. product leaked to soil and surrounding water table. Inspection of Con Ed vault outside of the building revealed 6 fuel was seeping into vault. Notified Con Ed who sent personnel to respond and document. Telephone call on 1/3/96 found that Woodward-Clyde was awarded bid to provide investigation of the spill. They will start advancing borings on the week of January 8, 1996. I requested that I could be present to observe the installation of monitoring wells. Roy Fein will be overseeing the work and I asked David Recino to have him call me ASAP to set up the drilling appointment.
Spill Cause: TANK WAS EMPTIED AND CLEANED DURING A TEST TODAY - THEY FOUND AN UNKNOWN AMOUNT OF OIL UNDER TANK. CALLED DAVID KATZEN, PREPARING TO ABANDON TANK - CLEANED OUT HTE TANK - DRILLED INSIDE THE TANK.

70
ENE
1/4-1/2
1749
Higher

BMW
547 WEST 47TH ST
MANHATTEN, NY

LTANKS S102660130
N/A

LTANKS:

Spill Number: 9707785
Facility Contact: ROBERT PORTEESE
Investigator: TOMASELLO
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: QUAKER STATE
Spiller Address: 225 E JOHN CARPENTER FREE WAY IRVING, TX 75062
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 10/01/1997
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Other
Spill Date: 10/01/1997 12:45
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 01/26/1998
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 10/01/1997
Region of Spill: 2
Facility Tele: (212) 586-2269
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported
Resource Affected: On Land
Spill Source: Other Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 10/01/1997 14:38

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

624 WEST 48TH ST (Continued)

S102147958

UST Involvement: False
Spill Record Last Update: 07/18/1996
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 01/26/1988
Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: 0
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: 1
Quantity Spilled: -1
Units: Pounds
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: #2 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #2 FUEL OIL
Last Date: 12/07/1994
Num Times Material Entry In File: 24464

DEC Remarks: 02/25/93: 4X550 GAS PASSED IN9/87 REFER TO SPILL 8709100. 02/25/93: 4X
550 GAS PASSED IN9/87.

Spill Cause: 7.5K TANK ISOLATED FROM PIPING, FAILED PETRO TITE TEST WITH A LEAK RATE
OF -.395GPH.

P72
NE
1/4-1/2
1762
Higher

NYNEX
624 W. 48TH STREET
MANHATTAN, NY
Site 2 of 2 in cluster P

LTANKS S104073408
N/A

LTANKS:

Spill Number:	9408956	Region of Spill:	2
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	TIBBE	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	NYNEX		
Spiller Address:	Not reported		
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	08/06/1996		
Spill Cause:	Tank Test Failure	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other	PBS Number:	Not reported
Spill Date:	10/05/1994 10:07	Reported to Dept:	10/05/1994 11:07
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AD SCHEUMANN LUMBER (Continued)

S102233238

Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 01/16/1998
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 11/20/1995
Date Region Sent Summary to Central Office: Not reported

Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: True
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329

DEC Remarks: 1/16/98 CROSS REFERENCED TO SPILL NUMBER 9610133. O DOWD)
Spill Cause: THE TANK POSSIBLY LEAKED.THE TANK IS IN THE GROUND.THEY ARE DOING TESTS
ON THE TANK TO DETERMINE IF IT IS THE TANK OR THE LINE.

Q74
SSE
1/4-1/2
1901
Higher

475 10TH AVE/MANHATTAN
475 10TH AVENUE
NEW YORK CITY, NY
Site 1 of 2 in cluster Q

LTANKS S100167935
N/A

LTANKS:

Spill Number: 9003992
Facility Contact: Not reported
Investigator: ROMMEL
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: GASETERIA GAS STATION
Spiller Address: 466 10TH AVENUE
NEW YORK, N. Y.

Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported

Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.

Spill Closed Dt: 01/26/1996
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: DEC
Spill Date: 07/11/1990 10:30
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False

Resource Affected: Air
Spill Source: Gas Station
PBS Number: Not reported
Reported to Dept: 07/11/1990 10:50

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

466 10TH AVE/GASETERIA (Continued)

S100167794

Spiller Contact: Not reported Spiller Phone: (718) 361-8811
Spiller: GASETERIA OIL CORP
Spiller Address: Not reported
Spill Class: Known release that creates a file or hazard. DEC Response. Willing
Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Failure Resource Affected: Groundwater
Water Affected: Not reported Spill Source: Gas Station
Spill Notifier: DEC PBS Number: Not reported
Spill Date: 01/04/1990 08:15 Reported to Dept: 01/05/1990 15:24
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 08/08/1995
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 01/17/1990
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Not reported
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: 01/05/90: 6) MONITORING WELLS INSTALLED,OIL TANKS BEING TESTED BY CONTR
ACTORS TRINITY FENLEY NICOL), ALL TANKS PUMPED CLEANED, REPAIRING
WATER MAIN.
Spill Cause: GASOLINE ENTERED BUILDING 478 10TH AVE SEWER SYSTEM, 3) OFFICE BL
DGS 475, 478, 483 10TH AVE) EVACUATED, EXPLOSIVE CONDITIONS IN SEWE
R, DEC LOCAL AGENCIES ON SCENE. SIGONA)

76
South
1/4-1/2
2015
Higher

CONSTRUCTION SITE
529 WEST 35TH ST
MANHATTAN, NY

LTANKS S105055174
N/A

LTANKS:

Spill Number: 0103274 Region of Spill: 2
Facility Contact: GARY ZAID Facility Tele: (212) 736-1626
Investigator: DEMEO SWIS: 62

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

PARKING LOT (Continued)

S104877137

Investigator: SIGONA
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: SAL RUSSO
Spiller: PARKING LOT..
Spiller Address: 618-628 W 49TH ST
NEW YORK, NY
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Local Agency
Spill Date: 11/01/2000 15:30
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 08/15/2001
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 11/02/2000
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: True
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: On Auguts 15, 2001, DEC Sigona received spill closure report from AKRF d
ated August 14, 2001. See file for details and copy of report.
Spill Cause: UNDERGROUND STORAGE TANK FAILED OVER TIME AND CAUSED SOIL CONTAMINATION
- SOIL WILL BE STOCKPILED

78
SSE
1/4-1/2
2031
Higher

460 10TH AVE
460 10TH AVENUE
MANHATTAN, NY

LTANKS S102672733
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

527 W 48TH ST (Continued)

S102662820

LTANKS:

Spill Number: 9612403 Region of Spill: 2
Facility Contact: CHARLIE BOETTIGER Facility Tele: (718) 932-9075
Investigator: MULQUEEN SWIS: 62
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: CHARLIE BOETTIGER Spiller Phone: Not reported
Spiller: MYSTIC OIL
Spiller Address: 19-01 STEINWAY ST
ASTORIA, NY
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 01/21/1997
Spill Cause: Tank Overfill Resource Affected: On Land
Water Affected: Not reported Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party PBS Number: Not reported
Spill Date: 01/17/1997 07:20 Reported to Dept: 01/17/1997 07:30
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 01/21/1997
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 01/17/1997
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 5
Units: Gallons
Unknown Qty Spilled: 5
Quantity Recovered: 5
Unknown Qty Recovered: False
Material: #2 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #2 FUEL OIL
Last Date: 12/07/1994
Num Times Material Entry In File: 24464
DEC Remarks: Not reported
Spill Cause: DRIVER OVERFILLED TANK - SPILL ON CONCRETE BEING CLEANED UP

R80 555 WEST 34TH ST/NYTEL
South 555 WEST 34TH STREET
1/4-1/2 NEW YORK CITY, NY
2185
Higher Site 1 of 3 in cluster R

LTANKS S104275609
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

NYNEX (Continued)

S104073407

SPILLS:

Spill Number: 9614443 Region of Spill: 2
Facility Contact: JAMES FREER Facility Tele: (212) 971-9910
Investigator: TIBBE SWIS: 62
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: JAMES FREER Spiller Phone: (212) 971-9910
Spiller: NYNEX
Spiller Address: 555 W. 34TH ST
NEW YORK, NY
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/13/1997
Spill Cause: Unknown Resource Affected: On Land
Water Affected: Not reported Spill Source: Commercial Vehicle
Spill Notifier: Other PBS Number: Not reported
Spill Date: 03/13/1997 16:30 Reported to Dept: 03/13/1997 17:13
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 03/17/1997
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 03/13/1997
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 1
Units: Gallons
Unknown Qty Spilled: Yes
Quantity Recovered: 1
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
Remarks: NYNEX REPORTED SPILL OF GASOLINE WITH NO CAUSE. CLEANUP COMPLETE.
DEC Remarks: CLOSED, SEND TO TIBBE FOR INF. PURPOSES.

LTANKS:

Spill Number: 9512079 Region of Spill: 2
Facility Contact: ROBERT BALDEZ Facility Tele: (212) 756-9450

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

ROY WEIDENER MOTOR LINE (Continued)

S100142897

Facility Contact: Not reported
Investigator: SIGONA
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: ROY WEIDENER MOTOR LINE
Spiller Address: Not reported
Spill Class: Not reported
Spill Closed Dt: 11/09/1989
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Responsible Party
Spill Date: 11/08/1989 14:00
Cleanup Ceased: 11/09/1989
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 11/29/1989
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 11/13/1989
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 90
Units: Gallons
Unknown Qty Spilled: 90
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: DIESEL
Class Type: Petroleum
Chem Abstract Service Number: DIESEL
Last Date: 07/29/1994
Num Times Material Entry In File: 10625
DEC Remarks: / / : SOIL PLACED ON PLASTIC AND WILL BE REMOVED BY CHEMICAL CONTRACT
ORS,AS APPROVED BY SIGONA.
Spill Cause: 20-30 YARDS OF CONTAMINATED SOIL.

R83 538 WEST 34TH ST/MANH
South 538 WEST 34TH STREET
1/4-1/2 NEW YORK CITY, NY
2243
Higher Site 3 of 3 in cluster R

LTANKS S104275572
N/A

LTANKS:
Spill Number: 9000078

Region of Spill: 2

Map ID
 Direction
 Distance
 Distance (ft.)
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

530 WEST 34TH ST/MANH (Continued)

S104275563

Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	WILSON	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(212) 564-2570
Spiller:	Not reported		
Spiller Address:	Not reported		
Spill Class:	Not reported		
Spill Closed Dt:	02/02/1990		
Spill Cause:	Tank Overfill	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Tank Truck
Spill Notifier:	Responsible Party	PBS Number:	Not reported
Spill Date:	02/02/1990 12:35	Reported to Dept:	02/02/1990 13:20
Cleanup Ceased:	02/02/1990		
Last Inspection:	Not reported		
Cleanup Meets Standard:	True		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	Not reported		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	02/05/1990		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	20		
Units:	Gallons		
Unknown Qty Spilled:	20		
Quantity Recovered:	0		
Unknown Qty Recovered:	False		
Material:	#6 FUEL OIL		
Class Type:			
Chem Abstract Service Number:	#6 FUEL OIL		
Last Date:	07/28/1994		
Num Times Material Entry In File:	2190		
DEC Remarks:	Not reported		
Spill Cause:	INACCURATE GAUGE RESULTING IN OVERFILL ON SIDEWALK, CONTAINED ON SI DEWALK, SPILL CLEANED UP WITH SPEEDY DRY.		

T85 408 WEST 39TH ST
 SE 408 WEST 39TH ST
 1/4-1/2 MANHATTAN, NY
 2278
 Higher Site 1 of 2 in cluster T

LTANKS S102662822
 N/A

LTANKS:
 Spill Number: 9612460 Region of Spill: 2

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

528 W 34TH ST (Continued)

S102672155

LTANKS:

Spill Number: 9300804
Facility Contact: Not reported
Investigator: CAMMISA
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: WHALECO
Spiller Address: Not reported
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Unable/unwilling Responsible Party. Corrective action taken. (ISR)
Spill Closed Dt: 04/16/1993
Spill Cause: Tank Overfill
Water Affected: Not reported
Spill Notifier: Responsible Party
Spill Date: 04/16/1993 12:00
Cleanup Ceased: 04/16/1993
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 07/20/1993
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 04/21/1993
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 5
Units: Gallons
Unknown Qty Spilled: 5
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: #2 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #2 FUEL OIL
Last Date: 12/07/1994
Num Times Material Entry In File: 24464
DEC Remarks: Not reported
Spill Cause: CONTAINED IN SIDEWALK SENDING SPILL TEAM TO CLEANUP

T87
SE
1/4-1/2
2375
Higher
PORT AUTH NY/NJ - MAN
W 39 ST / 9 AVE
MANHATTAN, NY
Site 2 of 2 in cluster T

LTANKS S100145904
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

436 TENTH AVENUE (Continued)

S101658469

LTANKS:

Spill Number: 9506257 Region of Spill: 2
Facility Contact: Not reported Facility Tele: Not reported
Investigator: O'DOWD SWIS: 62
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: Not reported Spiller Phone: Not reported
Spiller: SAME
Spiller Address: Not reported
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Test Failure Resource Affected: On Land
Water Affected: Not reported Spill Source: Other Commercial/Industrial
Spill Notifier: Tank Tester PBS Number: Not reported
Spill Date: 08/21/1995 14:30 Reported to Dept: 08/21/1995 14:59
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: Not reported
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 09/27/1995
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: 0
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: -1
Units: Gallons
Unknown Qty Spilled: -1
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: UNKNOWN PETROLEUM
Class Type: Petroleum
Chem Abstract Service Number: UNKNOWN PETROLEUM
Last Date: 09/29/1994
Num Times Material Entry In File: 16414
DEC Remarks: Not reported
Spill Cause: TANKS WERE OINSPECTED AND BOTH FAILED

U89 AMICO STATION
South 436 10TH AVE/34TH ST
1/4-1/2 MANHATTAN, NY
2384
Higher Site 2 of 4 in cluster U

LTANKS S104191607
N/A

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

AMICO STATION (Continued)

S104191607

Spill Cause: tank was overfilled at location - speedy dry applied - cleanup crew enroute - some material may have flowed into storm drain and street update 0400 hrs - spill only 5-7 gal all cleaned up - none entered waterway

U90
South
1/4-1/2
2408
Higher

34TH ST. & 10TH AVE./AMOC
34TH ST. / 10TH AVE.
NEW YORK CITY, NY
Site 3 of 4 in cluster U

LTANKS S100143829
N/A

LTANKS:

Spill Number:	8705645	Region of Spill:	2
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	Not reported	SWIS:	62
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	AMOCO		
Spiller Address:	Not reported	Resource Affected:	In Sewer
Spill Class:	Not reported	Spill Source:	Tank Truck
Spill Closed Dt:	10/05/1987	PBS Number:	2-337870
Spill Cause:	Tank Failure	Reported to Dept:	10/05/1987 14:35
Water Affected:	Not reported		
Spill Notifier:	Citizen		
Spill Date:	10/05/1987 13:45		
Cleanup Ceased:	10/05/1987		
Last Inspection:	Not reported		
Cleanup Meets Standard:	True		
Recommended Penalty:	No Penalty		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	True		
Spill Record Last Update:	05/02/1989		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	10/07/1987		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	0		
Leak Rate Failed Tank:	0.00		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	50		
Units:	Gallons		
Unknown Qty Spilled:	50		
Quantity Recovered:	0		
Unknown Qty Recovered:	False		
Material:	GASOLINE		
Class Type:	Petroleum		
Chem Abstract Service Number:	GASOLINE		
Last Date:	09/29/1994		
Num Times Material Entry In File:	21329		

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

34TH ST. AND 10TH AVE/JAM (Continued)

S102671194

Num Times Material Entry In File: 21329
DEC Remarks: Not reported
Spill Cause: TANK TRUCK LICENSE PLATE AP7359) INVOLVED IN TANK OVERFILL.

92
SSE
1/4-1/2
2452
Higher

429 WEST 36TH ST
429 WEST 36TH ST
MANHATTEN, NY

LTANKS S102448051
N/A

LTANKS:

Spill Number: 9610098
Facility Contact: Not reported
Investigator: O'DOWD
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: MICHAEL MICHALOFSKY
Spiller: KINNEY PARKING
Spiller Address: 429 WEST 36TH ST
MANHATTEN, NY 10018
Region of Spill: 2
Facility Tele: Not reported
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: (212) 889-4444
Spill Class: Known release that creates potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Failure
Water Affected: Not reported
Spill Notifier: Tank Tester
Spill Date: 11/13/1996 10:00
Resource Affected: On Land
Spill Source: Gas Station
PBS Number: Not reported
Reported to Dept: 11/13/1996 10:58
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: False
Spill Record Last Update: 12/04/1996
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 11/13/1996
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: False
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

725 10TH AVENUE (Continued)

S102672235

Class Type: Petroleum
Chem Abstract Service Number: #4 FUEL OIL
Last Date: 12/05/1994
Num Times Material Entry In File: 1751
DEC Remarks: Not reported
Spill Cause: GUAGE MALFUNCTION - GAVE WRONG ON HANDING - SENT SPILL CREW - WILL APPLY SPEEDY DRY.

V94
NE
1/4-1/2
2560
Higher

MOBIL S/S
718 11TH AVENUE
NEW YORK, NY
Site 1 of 3 in cluster V

LTANKS S101103233
N/A

LTANKS:

Spill Number: 9400944 Region of Spill: 2
Facility Contact: MIKE MEOLA Facility Tele: (516) 371-1527
Investigator: SIGONA SWIS: 62
Caller Name: Not reported Caller Agency: Not reported
Caller Phone: Not reported Caller Extension: Not reported
Notifier Name: Not reported Notifier Agency: Not reported
Notifier Phone: Not reported Notifier Extension: Not reported
Spiller Contact: MIKE MEOLA Spiller Phone: (516) 371-1527
Spiller: EXXONMOBIL
Spiller Address: 464 DOUGHTY BLVD
INWOOD, NY 11096
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.
Willing Responsible Party. Corrective action taken.
Spill Closed Dt: 03/29/1995
Spill Cause: Tank Failure Resource Affected: On Land
Water Affected: Not reported Spill Source: Gas Station
Spill Notifier: Responsible Party PBS Number: 2-157899
Spill Date: 04/19/1994 12:00 Reported to Dept: 04/20/1994 09:20
Cleanup Ceased: 03/29/1995
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 09/25/2000
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 04/29/1994
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MOBIL S/S (Continued)

S100167717

Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: True
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: This spill investigation was reassigned from Sullivan, O Dowd to DEC Sig
ona on Sept 22, 2000. Also, see spill Nos. 0007323, 9009654, 9400944, 9
505594 for further details on this location.
Spill Cause: TANK FAILED PETRO TITE TEST, IN PROCESS OF EXCAVATING TANK TOP, WILL IS
OLATE RETEST,RETESTED ON 1/5/91 .

V96
NE
1/4-1/2
2560
Higher

MOBIL S/S
718 11TH AVENUE
NEW YORK, NY
Site 3 of 3 in cluster V

LTANKS S100168132
N/A

LTANKS:

Spill Number: 9009654
Facility Contact: MIKE MEOLA
Investigator: SIGONA
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: MIKE MEOLA
Spiller: EXXONMOBIL
Spiller Address: 464 DOUGHTY BLVD
INWOOD, NY 11096
Spill Class: Not reported
Spill Closed Dt: 01/29/1991
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Notifier: Responsible Party
Spill Date: 12/05/1990 12:30
Cleanup Ceased: 01/29/1991
Last Inspection: Not reported
Cleanup Meets Standard: True
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 09/25/2000
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 12/12/1990
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported
Tank Number: Not reported
Test Method: Not reported
Region of Spill: 2
Facility Tele: (516) 371-1527
SWIS: 62
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: (516) 371-1527
Resource Affected: Groundwater
Spill Source: Gas Station
PBS Number: Not reported
Reported to Dept: 12/05/1990 15:02

Map ID
Direction
Distance
Distance (ft.)
Elevation

Site

MAP FINDINGS

Database(s) EDR ID Number
EPA ID Number

MOBIL S/S (Continued)

S100168132

Capacity of Failed Tank: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported
Material:
Material Class Type: 1
Quantity Spilled: 20
Units: Gallons
Unknown Qty Spilled: 20
Quantity Recovered: 0
Unknown Qty Recovered: True
Material: GASOLINE
Class Type: Petroleum
Chem Abstract Service Number: GASOLINE
Last Date: 09/29/1994
Num Times Material Entry In File: 21329
DEC Remarks: CLEANED BY RP (COPY TO KERRI). This spill was reassigned to DEC Sigona on Sept 2000. Also see spill nos. 0007323, 9009654, 9400944, and 890493 9.
Spill Cause: OVERFILLED UNDER GROUND TANK - CLEANUP CREW RESPONDING

97
SE
1/4-1/2
2564
Higher

37TH & 9TH ST/BKLYN
37TH / 9TH STREET
NEW YORK CITY, NY

LTANKS S100146830
N/A

LTANKS:

Spill Number: 9012156
Facility Contact: Not reported
Investigator: TIBBE
Caller Name: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Phone: Not reported
Spiller Contact: Not reported
Spiller: NYCTA
Spiller Address: Not reported
Spill Class: Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt: Not reported
Spill Cause: Tank Test Failure
Water Affected: Not reported
Spill Notifier: Tank Tester
Spill Date: 02/21/1991 16:00
Cleanup Ceased: Not reported
Last Inspection: Not reported
Cleanup Meets Standard: False
Recommended Penalty: No Penalty
Spiller Cleanup Date: Not reported
Enforcement Date: Not reported
Investigation Complete: Not reported
UST Involvement: True
Spill Record Last Update: 12/28/2000
Is Updated: False
Corrective Action Plan Submitted: Not reported
Date Spill Entered In Computer Data File: 03/15/1991
Date Region Sent Summary to Central Office: Not reported
Tank Test:
PBS Number: Not reported

Region of Spill: 2
Facility Tele: Not reported
SWIS: 61
Caller Agency: Not reported
Caller Extension: Not reported
Notifier Agency: Not reported
Notifier Extension: Not reported
Spiller Phone: Not reported

Resource Affected: Groundwater
Spill Source: Other Commercial/Industrial
PBS Number: Not reported
Reported to Dept: 02/22/1991 07:14

Map ID
Direction
Distance
Distance (ft.)
Elevation Site

MAP FINDINGS

Database(s)
EDR ID Number
EPA ID Number

416 WEST 47TH STREET (Continued)

S104278720

Tank Test:
PBS Number: Not reported
Tank Number: 1
Test Method: Homer EZ Check
Capacity of Failed Tank: 2500
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Talk Test Failures only pass or fail

Material:
Material Class Type: 1
Quantity Spilled: 0
Units: Gallons
Unknown Qty Spilled: No
Quantity Recovered: 0
Unknown Qty Recovered: True
Material: #4 FUEL OIL
Class Type: Petroleum
Chem Abstract Service Number: #4 FUEL OIL
Last Date: 12/05/1994
Num Times Material Entry In File: 1751

DEC Remarks: DEC Sigona sent letter to GRL Property investors on 11/26/99 requesting that the leaking vent pipe be capped and the existing 1 inch vent line be replaced with a properly sized vent pipe to the front of the building. In addition, the DEC will request that another precision tightness test be performed to confirm that there is no leak in the system.
Spill Cause: DEC Sigona requested that tank testor report this spill to hotline

99
NE
1/2-1
4742
Higher

EQUITABLE GAS CO.
540 W. 59TH ST.
NEW YORK, NY 10019

Coal Gas G000000366
N/A

COAL GAS SITE DESCRIPTION:

Site is between 59th St. and 58th St. and between Amsterdam Ave. and West End Ave. Site consisted of Gas Holders. (B17)

©Copyright 1993 Real Property Scan, Inc.

EPA Waste Codes Addendum

Code	Description
D001	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
D002	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
D005	BARIUM
D007	CHROMIUM
F003	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
F005	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Elapsed ASTM days: Provides confirmation that this EDR report meets or exceeds the 90-day updating requirement of the ASTM standard.

FEDERAL ASTM STANDARD RECORDS

NPL: National Priority List

Source: EPA
Telephone: N/A

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 01/29/02
Date Made Active at EDR: 02/25/02
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 02/04/02
Elapsed ASTM days: 21
Date of Last EDR Contact: 02/04/02

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 8
Telephone: 303-312-6774

EPA Region 4
Telephone 404-562-8033

Proposed NPL: Proposed National Priority List Sites

Source: EPA
Telephone: N/A

Date of Government Version: 01/17/02
Date Made Active at EDR: 02/25/02
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 02/04/02
Elapsed ASTM days: 21
Date of Last EDR Contact: 02/04/02

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

Source: EPA
Telephone: 703-413-0223

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 11/21/01
Date Made Active at EDR: 02/04/02
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 12/26/01
Elapsed ASTM days: 40
Date of Last EDR Contact: 12/26/01

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Source: EPA
Telephone: 703-413-0223

As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not needlessly repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/30/00
Database Release Frequency: Annually

Date of Last EDR Contact: 01/07/02
Date of Next Scheduled EDR Contact: 04/08/02

DELISTED NPL: National Priority List Deletions

Source: EPA
Telephone: N/A

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 01/29/02
Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/04/02
Date of Next Scheduled EDR Contact: 05/06/02

FINDS: Facility Index System/Facility Identification Initiative Program Summary Report

Source: EPA
Telephone: N/A

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 10/29/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/07/02
Date of Next Scheduled EDR Contact: 04/08/02

HMIRS: Hazardous Materials Information Reporting System

Source: U.S. Department of Transportation
Telephone: 202-366-4526

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 09/30/01
Database Release Frequency: Annually

Date of Last EDR Contact: 01/21/02
Date of Next Scheduled EDR Contact: 04/22/02

MLTS: Material Licensing Tracking System

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 10/25/01
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/07/02
Date of Next Scheduled EDR Contact: 04/08/02

MINES: Mines Master Index File

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959

Date of Government Version: 12/14/01
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 01/02/02
Date of Next Scheduled EDR Contact: 04/01/02

NPL LIENS: Federal Superfund Liens

Source: EPA
Telephone: 205-564-4267

Federal Superfund Liens. Under the authority granted the USEPA by the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner receives notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

STATE OF NEW YORK ASTM STANDARD RECORDS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Source: Department of Environmental Conservation

Telephone: 518-402-9553

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 04/01/01

Date Made Active at EDR: 10/31/01

Database Release Frequency: Annually

Date of Data Arrival at EDR: 10/11/01

Elapsed ASTM days: 20

Date of Last EDR Contact: 02/25/02

SWF/LF: Facility Register

Source: Department of Environmental Conservation

Telephone: 518-457-2051

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 12/31/00

Date Made Active at EDR: 03/02/01

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 02/06/01

Elapsed ASTM days: 24

Date of Last EDR Contact: 02/05/02

LTANKS: Spills Information Database

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 10/01/01

Date Made Active at EDR: 12/20/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 11/26/01

Elapsed ASTM days: 24

Date of Last EDR Contact: 01/29/02

UST: Petroleum Bulk Storage (PBS) Database

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 10/01/01

Date Made Active at EDR: 12/12/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 11/26/01

Elapsed ASTM days: 16

Date of Last EDR Contact: 01/29/02

CBS UST: Chemical Bulk Storage Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 10/01/01

Date Made Active at EDR: 12/12/01

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 11/26/01

Elapsed ASTM days: 16

Date of Last EDR Contact: 01/29/02

MOSF UST: Major Oil Storage Facilities Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MOSF AST: Major Oil Storage Facilities Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 10/01/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/29/02

Date of Next Scheduled EDR Contact: 04/29/02

SPILLS: Spills Information Database

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 10/01/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/29/02

Date of Next Scheduled EDR Contact: 04/29/02

LOCAL RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

Source: Cortland County Health Department

Telephone: 607-753-5035

Date of Government Version: 01/02/02

Database Release Frequency: Quarterly

Date of Last EDR Contact: 03/05/02

Date of Next Scheduled EDR Contact: 06/03/02

Cortland County Storage Tank Listing

Source: Cortland County Health Department

Telephone: 607-753-5035

Date of Government Version: 01/02/02

Database Release Frequency: Quarterly

Date of Last EDR Contact: 03/05/02

Date of Next Scheduled EDR Contact: 06/03/02

NASSAU COUNTY:

Registered Tank Database

Source: Nassau County Health Department

Telephone: 516-571-3314

Date of Government Version: 08/28/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/05/02

Date of Next Scheduled EDR Contact: 05/06/02

Registered Tank Database

Source: Nassau County Health Department

Telephone: 516-571-3314

Date of Government Version: 08/28/01

Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/05/02

Date of Next Scheduled EDR Contact: 05/06/02

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

Source: Rockland County Health Department

Telephone: 914-364-2605

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

Oil/Gas Pipelines/Electrical Transmission Lines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines and electrical transmission lines.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 1999 from the U.S. Fish and Wildlife Service.

New York Facility and Manifest Data

Source: NYSDEC

Telephone: 518-457-6585

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

GEOCHECK® - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

WEST 42ND STREET WORKS
WEST 42ND STREET
MANHATTAN, NY 10036

TARGET PROPERTY COORDINATES

Latitude (North):	40.761101 - 40° 45' 40.0"
Longitude (West):	74.000099 - 74° 0' 0.4"
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	584398.9
UTM Y (Meters):	4512507.0

EDR's GeoCheck Physical Setting Source Addendum has been developed to assist the environmental professional with the collection of physical setting source information in accordance with ASTM 1527-00, Section 7.2.3. Section 7.2.3 requires that a current USGS 7.5 Minute Topographic Map (or equivalent, such as the USGS Digital Elevation Model) be reviewed. It also requires that one or more additional physical setting sources be sought when (1) conditions have been identified in which hazardous substances or petroleum products are likely to migrate to or from the property, and (2) more information than is provided in the current USGS 7.5 Minute Topographic Map (or equivalent) is generally obtained, pursuant to local good commercial or customary practice, to assess the impact of migration of recognized environmental conditions in connection with the property. Such additional physical setting sources generally include information about the topographic, hydrologic, hydrogeologic, and geologic characteristics of a site, and wells in the area.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata. EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Site-Specific Hydrogeological Data*:

Search Radius: 2.0 miles
 Location Relative to TP: 1/2 - 1 Mile South
 Site Name: MANHATTAN GENERAL MAIL FACILITY
 Site EPA ID Number: NY6180000352
 Groundwater Flow Direction: NOT AVAILABLE.
 Inferred Depth to Water: not available. Saturated layers impacted by salt water intrusion are present in the overburden. It is generally inferred that the depth to the uppermost 'aquifer' is greater than 70 feet at the surface of the bedrock/sediment interface.
 Hydraulic Connection: Detailed hydraulic connection information is not available. Glacial till and outwash deposit sediments overlie the Manhattan Schist, the uppermost bedrock unit at the site. The surface elevation of bedrock decreases to the southwest of the site.
 Sole Source Aquifer: No information about a sole source aquifer is available
 Data Quality: Information is inferred in the CERCLIS investigation report(s)

AQUIFLOW®

Search Radius: 2.000 Miles.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
2	1 - 2 Miles WNW	Varies

For additional site information, refer to Physical Setting Source Map Findings.

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION

Era:	Paleozoic	Category:	Stratified Sequence
System:	Ordovician		
Series:	Lower Ordovician and Cambrian carbonate rocks		
Code:	OC (decoded above as Era, System & Series)		

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

* ©1996 Site-specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

ADDITIONAL ENVIRONMENTAL RECORD SOURCES

According to ASTM E 1527-00, Section 7.2.2, "one or more additional state or local sources of environmental records may be checked, in the discretion of the environmental professional, to enhance and supplement federal and state sources... Factors to consider in determining which local or additional state records, if any, should be checked include (1) whether they are reasonably ascertainable, (2) whether they are sufficiently useful, accurate, and complete in light of the objective of the records review (see 7.1.1), and (3) whether they are obtained, pursuant to local, good commercial or customary practice." One of the record sources listed in Section 7.2.2 is water well information. Water well information can be used to assist the environmental professional in assessing sources that may impact groundwater flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
1	NY0002714	1/4 - 1/2 Mile North

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 745748.1s



- Major Roads
- Contour Lines
- Water Wells
- Public Water Supply Wells
- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Cluster of Multiple Icons

- Earthquake epicenter, Richter 5 or greater
- Closest Hydrogeological Data

TARGET PROPERTY: West 42nd Street Works
ADDRESS: West 42nd Street
CITY/STATE/ZIP: Manhattan NY 10036
LAT/LONG: 40.7611 / 74.0001

CUSTOMER: Con-Edison Company
CONTACT: Glen Katz
INQUIRY #: 745748.1s
DATE: March 18, 2002 9:05 am

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1
North
1/4 - 1/2 Mile
Higher

FRDS PWS NY0002714

PWS ID: NY0002714 PWS Status: Active
Date Initiated: Not Reported Date Deactivated: Not Reported
PWS Name: CAMP COMANCHE
LIBERTY, NY 12754

Addressee / Facility: System Owner/Responsible Party
BURNS DAVID
C/O DAVID BURNS
424 WEST 51 STREET
NEW YORK, NY 10019

Addressee / Facility: System Owner/Responsible Party
BURNS DAVID
C/O DAVID BURNS
424 WEST 51 STREET
NEW YORK, NY 10019

Facility Latitude: Not Reported Facility Longitude: Not Reported
City Served: LIBERTY (T)
Treatment Class Not Reported Population: Not Reported

PWS currently has or had major violation(s) or enforcement: No

2
WNW
1 - 2 Miles
Higher

Site ID: 88-06-73-1416
Groundwater Flow: Varies
Shallowest Water Table Depth: 3.52
Deepest Water Table Depth: 9.68
Average Water Table Depth: Not Reported
Date: 07/1999

AQUIFLOW 63612

PHYSICAL SETTING SOURCE RECORDS SEARCHED

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 1999 from the U.S. Fish and Wildlife Service.

HYDROGEOLOGIC INFORMATION

AQUIFLOW[®] Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the national Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

ADDITIONAL ENVIRONMENTAL RECORD SOURCES

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-260-2805

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-260-2805

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: In November 1971 the United States Geological Survey (USGS) implemented a national water resource information tracking system. This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on more than 900,000 wells, springs, and other sources of groundwater.

