**Day 169** 



#### SITE OBSERVATION REPORT

**PROJECT No.:** 170381202

CLIENT:

LLC

Thursday, July 27, 2023

PROJECT:

250 Water Street

Sunny, 75 – 91° F

**WEATHER:** 

DATE:

Wind: NW @ 0.2 - 2.8 mph

LOCATION:

New York, NY

TIME:

5:30am - 4:15pm

**BCP SITE ID:** 

C231127

**MONITOR** 

Jack Millman

**EQUIPMENT:** 

CAT 335 Excavator Komatsu PC138 Excavator ABI Mobilram Drill Rig Jerome J505 Mercury Vapor Analyzer RKI GX-6000 Photoionization Detector (PID) Aeroqual ASQ1 Air Monitoring Station

PRESENT AT SITE:

250 Seaport District,

**Hughes Corporation** 

c/o The Howard

Langan (Environmental) Jack Millman, Aron Farber

Suffolk Construction (Suffolk) (General Contractor) Anthony Galu East Coast Drilling, Inc. (ECD) (Foundation Contractor) Danny Rodgers **New York State Department of Environmental Conservation** 

(NYSDEC) Rafi Alam

Earth Efficient (Soil Broker) Yinette Bautista

## **OBSERVATIONS, DISCUSSIONS, TEST RESULTS, ETC.:**

Langan was present to document remediation activities in accordance with the NYSDEC-approved November 2021 Remedial Action Work Plan (RAWP) at the 250 Water Street site (NYSDEC Brownfield Cleanup Program [BCP] Site No C231127).

### Site Activities

- ECD placed imported general fill in an about 90-foot-long by 35-foot-wide area in the northeastern part of the site (Pearl Street and Peck Slip) to create a temporary ramp for equipment access.
- ECD continued constructing wooden formwork in preparation for concrete guide wall installation in the southern part of the site (Water Street). The concrete guide wall will be used to facilitate installation of SOE along the perimeter of the site.

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN



Page 2 of 7

## SITE OBSERVATION REPORT

# Material Tracking

- No material was exported from the site.
- ECD imported ten truckloads (248.75 tons) of general fill from the Impact Reuse & Recovery Center (IRRC) facility, located in Lyndhurst, NJ.

	Material Import Summary							
Facility Name Location Type of Material	Stone Industries, Inc. Haledon, NJ Haledon, NJ 1.5/2.5-inch Virgin Stone Stone Stone		on, NJ h Virgin	Impact Reuse & Recovery Center or Impact Materials Jersey City, Lyndhurst/Jersey City, NJ 1.5-inch Clean Bluestone		Impact Reuse & Recovery Center, Lyndhurst, NJ General Fill		
Quantities	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)
Today	0	0	0	0	0	0	10	248.75
Project Total	8	184.42	0	0	15	339.65	374	9,157.85
NYSDEC Approved:	1,800 tons*			72	20 tons*	19,500	tons*	

<sup>\*0.75-</sup>inch, 1.5-inch, and 2.5-inch virgin stone from the Stone Industries, Inc. facility and 1.5-inch clean bluestone from the Impact Reuse & Recovery Center (IRRC) facility were approved for import of 1,000 cubic yards (CY) and 400 CY, respectively. Assuming a conversion factor of 1.8, each quantity was converted to tons in order to accurately compare with import weight tickets. General fill from the IRRC facility was approved for import of 13,000 CY and a conversion factor of 1.5 is applied.

Material Export Summary (1 of 3)									
Facility Name Location Type of Material	Brook Construction	Allocco Recycling Brooklyn, NY Construction & Demolition (C&D) Debris		Brooklyn, NY  onstruction & Demolition  C&D Debris		Earth Efficient MSM East Stroudsburg, PA C&D Debris		Clean Earth of North Jersey Kearny, NJ Hazardous Lead-Impacted Soil/Fill	
Quantities	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	
Today	0	0	0	0	0	0	0	0	
Project Total	5	85	42	840	14	280	95	1,900	

Material Export Summary (2 of 3)							
Facility Name Location Type of Material	Location East Brunswick, NJ		Keas	oil Management Bbey, NJ mpacted Soil/Fill	Clean Earth of Carteret, NJ Carteret, NJ Non-hazardous Soil/Fill		
Quantities	No. of Loads	Approx. Volume (CY)	No. of Loads	lo. of Loads Approx. Volume (CY)		Approx. Volume (CY)	
Today	0	0	0	0	0	0	
Project Total	263	5,260	267	5,340	66	1,320	

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN



Page 3 of 7

# SITE OBSERVATION REPORT

Material Export Summary (3 of 3)				
Facility Name Clean Earth of North Jersey Location Kearny, NJ Type of Material Non-hazardous Soil/Fill				
Quantities	No. of Loads	Approx. Volume (CY)		
Today	0	0		
Project Total	216	4,320		

# <u>Sampling</u>

<ul> <li>No samples were collected</li> </ul>	₽d.
---	-----

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN



Page 4 of 7

#### SITE OBSERVATION REPORT

#### **CAMP Activities**

Langan performed air monitoring at the perimeter of the site, at the northern sidewalk of Pearl Street, at the western sidewalk of Beekman Street, at the eastern sidewalk of Peck Slip, and at the southern sidewalk of Water Street at eight total locations for mercury vapor, volatile organic compounds (VOCs), and particulate matter less than 10 microns in diameter (PM10) from about 7:00am to 3:21pm. There were no fifteen-minute average concentrations for mercury vapor, VOCs or PM10 that approached or exceeded the action levels established by the CAMP (1.00  $\mu$ g/m³, 5.0 ppm, or 0.100 mg/m³, respectively).

### **Background Concentrations**

Prior to implementation of CAMP, instantaneous background concentrations of mercury vapor and VOCs were recorded using a handheld Jerome® J505 mercury vapor analyzer and a handheld PID, respectively.

- Background concentrations of mercury vapor at each CAMP station were recorded at 0.00 g/m<sup>3</sup>.
- Background concentrations of VOCs at each CAMP station were recorded at 0.0 ppm.

## Perimeter and Work Zone Concentrations

### **Daily Average Concentrations**

Station ID	Particulate (mg/m³)	Organic Vapor (ppm)	Mercury Vapor (µg/m³)
PM-1	0.015	0.00	0.01
PM-2	0.016	0.00	0.01
PM-3	0.014	0.00	0.01
PM-4	0.015	0.00	0.02
WZ-1	0.015	0.00	0.00
WZ-2	0.015	0.00	0.00
WZ-3	0.015	0.20	0.01
WZ-4	0.017	0.00	0.01

#### **Maximum 15-Minute-Average Concentrations**

Station ID	Particulate (mg/m³)	Organic Vapor (ppm)	Mercury Vapor (µg/m³)
PM-1	0.019	0.06	0.11
PM-2	0.022	0.00	0.02
PM-3	0.017	0.01	0.03
PM-4	0.019	0.00	0.16
WZ-1	0.018	0.00	0.01
WZ-2	0.018	0.00	0.01
WZ-3	0.020	0.32	0.02
WZ-4	0.025	0.04	0.02

•mg/m³ = milligrams per cubic meter •ppm = parts per million •µg/m³ = micrograms per cubic meter

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN



Page 5 of 7

#### SITE OBSERVATION REPORT

#### Ambient Air (Handheld Jerome® J505 and Handheld PID)

- The dedicated mobile monitor (Langan) used a handheld Jerome® J505 mercury vapor analyzer to monitor ambient air conditions at various heights throughout the site. Instantaneous mercury vapor concentrations throughout the site ranged from 0.00 µg/m³ to 0.19 µg/m³.
- The dedicated mobile monitor (Langan) used a handheld PID to monitor VOC concentrations throughout the site. Instantaneous VOC concentrations were not detected above background concentrations throughout the workday.

#### Off-site CAMP Stations

- CAMP station WZ-1 was placed on the western sidewalk of Beekman Street from 6:36am to 2:16pm.
- CAMP station WZ-2 was placed on the southern sidewalk of Water Street from 6:39am to 2:21pm.
- CAMP station WZ-3 was placed on the eastern sidewalk of Peck Slip from 6:44am to 3:50pm.
- CAMP station WZ-4 was placed on the northern sidewalk of Pearl Street from 6:47am to 3:39pm.

#### Prior to CAMP Shutdown

Prior to discontinuing CAMP, mercury vapor and VOC concentrations were confirmed to return to background conditions at each perimeter station using the handheld Jerome® J505 mercury vapor analyzer and handheld PID, respectively. Perimeter CAMP stations were discontinued sequentially between 3:21pm and 3:30pm.

- Background concentrations of mercury vapor at each CAMP station were recorded at 0.00 μg/m³.
- Background concentrations of VOCs at each CAMP station were recorded at 0.0 ppm.

#### **Anticipated Activities**


- ECD will continue exporting C&D debris and soil/fill from the western part of the site for off-site disposal.
- ECD will continue constructing wooden formwork in preparation for concrete guide wall installation in the southern part of the site.

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN



Page 6 of 7

#### SITE OBSERVATION REPORT

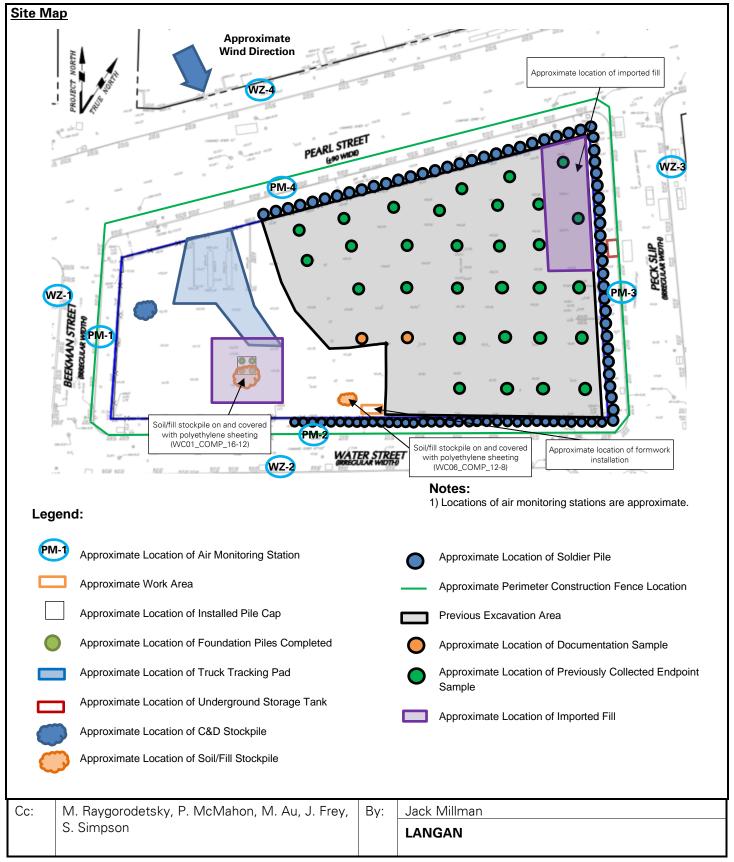



Page 7 of 7

## SITE OBSERVATION REPORT

## **Select Site Photographs:**



Photo 1: ECD using imported general fill to create a temporary ramp in the northeastern corner of the site (facing east)

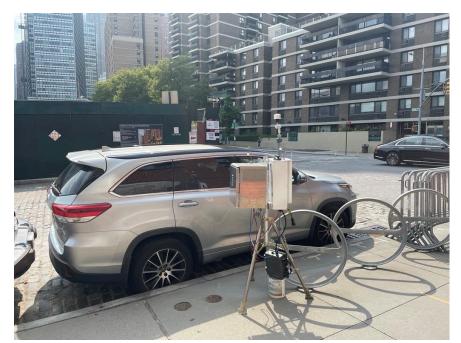


Photo 2: CAMP station WZ-3 on the eastern sidewalk of Peck Slip (facing northwest)

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Jack Millman
	S. Simpson		LANGAN