

Tuesday, November 28, 2023

Page 1 of 7

Day 258

SITE OBSERVATION REPORT

250 Seaport District,

Hughes Corporation

c/o The Howard

PROJECT No.: 170381202

CLIENT:

LLC

DATE: Tuesday, November 28, 2023

PROJECT:

250 Water Street

WEATHER: Sunny, 30

Sunny, 30 – 38 °F

LOCATION:

New York, NY

WEATHER

TIME:

Wind: NE @ 0.2 – 2.2 mph

5:45am - 4:45pm

BCP SITE ID: C231127

MONITOR

Gabriella DeGennaro

EQUIPMENT:

CAT 335 Excavator CAT 328 Excavator Komatsu PC210 Excavator

Delmag Drill Rig Bauer RTG RG 27S Bauer BG 36H Drill Rig Bauer BG45 Drill Rig

Casagrande M6A-1 Tieback Drill Rig Jerome J505 Mercury Vapor Analyzer RKI GX-6000 Photoionization Detector (PID) Aeroqual ASQ1 Air Monitoring Station PRESENT AT SITE:

Langan (Environmental/Geotechnical) Gabriella DeGennaro, Michael Cole, Tom Keane

Suffolk Construction (Suffolk) (General Contractor) Anthony Galu, Wvatt Favia

East Coast Drilling, Inc. (ECD) (Foundation Contractor) Mike Brosnan **New York State Department of Environmental Conservation** (**NYSDEC**) Mike Sollecito

OBSERVATIONS, DISCUSSIONS, TEST RESULTS, ETC.:

Langan was present to document remediation activities in accordance with the NYSDEC-approved November 2021 Remedial Action Work Plan (RAWP) at the 250 Water Street site (NYSDEC Brownfield Cleanup Program [BCP] Site No C231127).

Site Activities

- ECD used a Bauer RTG RG 27S drill rig to pre-drill one borehole in the northwest part of the site to loosen the underlying soil in preparation for soil mix column installation.
- ECD used a Bauer BG45 drill rig to install two deep soil mix columns in the northwest part of the site (along Beekman and Pearl Streets, respectively) for the support-of-excavation (SOE) system. ECD's drill rig advanced a steel rod with two cutter blades at the bottom of the rod, while concurrently injecting grout through the cutting head and spinning and advancing the blades downward to a depth of about 120 feet below graded surface (bgs).
 - o No drilling spoils were generated during installation of the soil mix columns.
 - Excess grout was contained within a temporary containment area in the northern part of the site and will be managed as construction and demolition (C&D) debris at a later date.
- ECD graded soil/fill in an about 50-foot-long by 50-foot-wide area in the central part of the site to stabilize the surface for SOE installation.
 - o Graded soil/fill was screened for odors, staining, organic vapors, and mercury vapor using a handheld photoionization detector (PID) and handheld Jerome® J505 mercury vapor analyzer, respectively. Evidence of impacts was not observed. Excess soil/fill generated from grading was stockpiled in the northwest part of site for future off-site disposal.

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN



Tuesday, November 28, 2023

Page 2 of 7

SITE OBSERVATION REPORT

- ECD graded soil/fill in an about 20-foot-long by 20-foot-wide area in the northern part of the site to prepare a stockpile for off-site disposal.
 - o Graded soil/fill was screened for odors, staining, organic vapors, and mercury vapor using a handheld PID and handheld Jerome[®] J505 mercury vapor analyzer, respectively. Evidence of impacts was not observed.
- ECD continued dewatering to accommodate future excavation in the southern part of the site. Groundwater
 was pumped directly to the dewatering system, consisting of a settling tank, oil-water separator, and filtration
 system, before being discharged to the New York City Department of Environmental Protection (NYCDEP)
 combined sewer beneath Peck Slip in accordance with a NYCDEP temporary discharge permit (Permit No.
 C002547552).

Material Tracking

- No material was imported to the site.
- No material was exported from the site.

	Material Import Summary									
Facility Name Location Type of Material	l Haled 1.5/2.5-i	ndustries, nc. Ion, NJ nch Virgin	l Haled 0.75-in	ndustries, nc. Ion, NJ ch Virgin cone	Impact Reuse & Recovery Center or Impact Materials Jersey City, Lyndhurst/Jersey Cit NJ 1.5-inch Clean Bluestone		ecovery Center or Impact Materials Jersey City, ndhurst/Jersey City, NJ Genera		ter, Wayne, NJ IJ Clean Screened I	
Quantities	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx. Volume (Tons)	No. of Loads	Approx Volume (CY)
Today	0	0	0	0	0	0	0	0	0	0
Project Total	16	382.13	0	0	15	339.65	374	9,157.85	22	440
NYSDEC Approved:	1,800 tons*		720 tons*		19,500 tons*		4,500 tons*			

*0.75-inch, 1.5-inch, and 2.5-inch virgin stone from the Stone Industries, Inc. facility and 1.5-inch clean bluestone from the Impact Reuse & Recovery Center (IRRC) facility were approved for import of 1,000 cubic yards (CY) and 400 CY, respectively. Assuming a conversion factor of 1.8, each quantity was converted to tons in order to accurately compare with import weight tickets. General fill from the IRRC and XRDS facilities were approved for import of 13,000 CY and 3,000 CY, respectively, and a conversion factor of 1.5 is applied.

	Material Export Summary (1 of 3)							
Facility Name Location Type of Material	Allocco Recycling Brooklyn, NY Construction & Demolition (C&D) Debris		IRRC Lyndhurst, NJ C&D Debris		Earth Efficient MSM East Stroudsburg, PA C&D Debris		Clean Earth of North Jersey Kearny, NJ Hazardous Lead-Impacted Soil/Fill	
Quantities	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)
Today	0	0	0	0	0	0	0	0
Project Total	5	85	42	840	303	6,060	142	2,840

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN



Tuesday, November 28, 2023

Page 3 of 7

SITE OBSERVATION REPORT

	Material Export Summary (2 of 3)							
Facility Name Location Type of Material	Location East Brunswick, NJ		Keas	oil Management sbey, NJ mpacted Soil/Fill	Clean Earth of Carteret, NJ Carteret, NJ Non-hazardous Soil/Fill			
Quantities	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)		
Today	0	0	0	0	0	0		
Project Total	407	8,160	267	5,340	66	1,320		

	Material Export Summary (3 of 3)							
Facility Name Location Type of Material Clean Earth of North Jersey Kearny, NJ Non-hazardous Soil/Fill		Eliz	Chem, Inc. abeth, NJ ad-Impacted Soil/Fill	Harmony Foul Rift (HFR) Belvidere, NJ Non-hazardous Soil/Fill				
Quantities	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)	No. of Loads	Approx. Volume (CY)		
Today	0	0	0	0	0	0		
Project Total	201	4,020	17	340	135	2,700		

Sampling

• No samples were collected.

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN



Tuesday, November 28, 2023

Page 4 of 7

SITE OBSERVATION REPORT

CAMP Activities

Langan performed air monitoring at the perimeter of the site, at the northern sidewalk of Pearl Street, at the western sidewalk of Beekman Street, at the eastern sidewalk of Peck Slip, and at the southern sidewalk of Water Street at eight total locations for mercury vapor, volatile organic compounds (VOCs), and particulate matter less than 10 microns in diameter (PM10) from about 6:57am to 4:21pm. There were no fifteen-minute average concentrations for mercury vapor, VOCs or PM10 that approached or exceeded the action levels established by the CAMP (1.00 μ g/m³, 5.0 ppm, or 0.100 mg/m³, respectively).

Background Concentrations

Prior to implementation of CAMP, instantaneous background concentrations of mercury vapor and VOCs were recorded using a handheld Jerome® J505 mercury vapor analyzer and a handheld PID, respectively.

- Background concentrations of mercury vapor at each CAMP station were recorded at 0.00 μg/m³.
- Background concentrations of VOCs at each CAMP station were recorded at 0.0 ppm.

Perimeter and Work Zone Concentrations

Daily Average Concentrations

Station ID	Particulate (mg/m³)	Organic Vapor (ppm)	Mercury Vapor (µg/m³)
PM-1	0.008	0.01	0.02
PM-2	0.005	0.00	0.01
PM-3	0.004	0.00	0.00
PM-4	0.004	0.00	0.02
WZ-1	0.005	0.01	0.00
WZ-2	0.003	0.00	0.00
WZ-3	0.003	0.00	0.01
WZ-4	0.003	0.00	0.01

Maximum 15-Minute-Average Concentrations

Station ID	Particulate (mg/m³)	Organic Vapor (ppm)	Mercury Vapor (µg/m³)
PM-1	0.018	0.05	0.06
PM-2	0.018	0.02	0.30
PM-3	0.005	0.09	0.02
PM-4	0.006	0.02	0.04
WZ-1	0.008	0.01	0.00
WZ-2	0.005	0.00	0.01
WZ-3	0.004	0.01	0.02
WZ-4	0.005	0.01	0.03

•mg/m³ = milligrams per cubic meter •ppm = parts per million •µg/m³ = micrograms per cubic meter

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN



Tuesday, November 28, 2023

Page 5 of 7

SITE OBSERVATION REPORT

Ambient Air (Handheld Jerome® J505 and Handheld PID)

- The dedicated mobile monitor (Langan) used a handheld Jerome® J505 mercury vapor analyzer to monitor ambient air conditions at various heights throughout the site. Instantaneous mercury vapor concentrations throughout the site ranged from 0.00 µg/m³ to 0.08 µg/m³.
- The dedicated mobile monitor (Langan) used a handheld PID to monitor VOC concentrations throughout the site. Instantaneous VOC concentrations were not detected above background concentrations throughout the workday.

Off-site CAMP Stations

- CAMP station WZ-1 was placed on the western sidewalk of Beekman Street from about 6:46am to 3:35pm.
- CAMP station WZ-2 was placed on the southern sidewalk of Water Street from about 6:31am to 4:10pm.
- CAMP station WZ-3 was placed on the eastern sidewalk of Peck Slip from about 6:30am to 4:10pm.
- CAMP station WZ-4 was placed on the northern sidewalk of Pearl Street from about 6:40am to 4:20pm.

Prior to CAMP Shutdown

Prior to discontinuing CAMP, mercury vapor and VOC concentrations were confirmed to return to background conditions at each perimeter station using the handheld Jerome® J505 mercury vapor analyzer and handheld PID, respectively. Perimeter CAMP stations were discontinued sequentially between 4:22pm and 4:29pm.

- Background concentrations of mercury vapor at each CAMP station were recorded at 0.00 μg/m³.
- Background concentrations of VOCs at each CAMP station were recorded at 0.0 ppm.

Anticipated Activities

- ECD will continue exporting soil/fill across the site for off-site disposal.
- ECD will continue installing soil mix columns and/or secant piles for the SOE system along Beekman and Pearl Street.


Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN
	S. Simpson		LANGAN



Tuesday, November 28, 2023

Page 6 of 7

SITE OBSERVATION REPORT

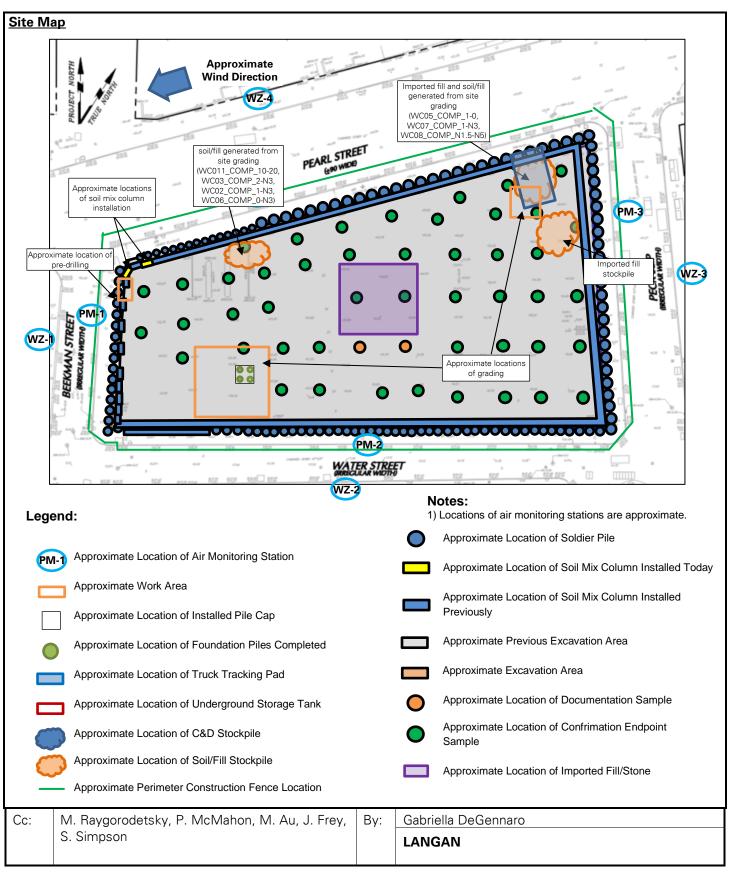



Tuesday, November 28, 2023

Page 7 of 7

SITE OBSERVATION REPORT

Select Site Photographs:

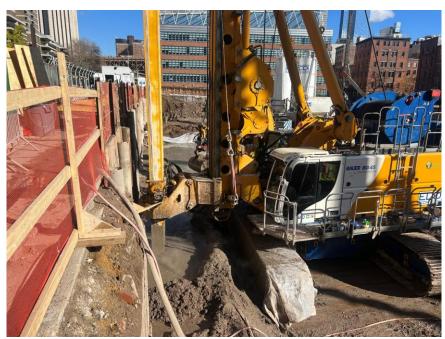


Photo 1: ECD installing a soil mix column in the northern part of site (facing east)

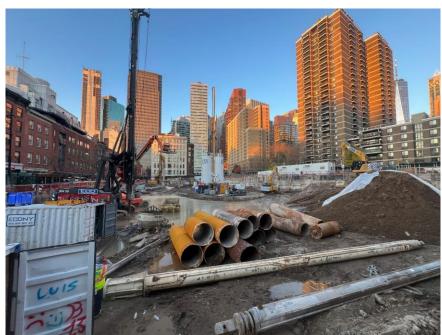


Photo 2: General view of the site (facing west)

Cc:	M. Raygorodetsky, P. McMahon, M. Au, J. Frey,	Ву:	Gabriella DeGennaro
	S. Simpson		LANGAN