


	Daily Activity Report					
	Magnolia Gardens					
	39-03 College Point Boulevard, Queens, NY					
	BCP Site No. C241273					
General Site Information						
Date:	Wednesday, May 1, 2024					
Weather:	51-73°F, Partly Cloudy					
Wind Direction/Speed (towards):	SE @ 6-16 mph					
AKRF Personnel on Site:	D. Kawalek					
AKRF Equipment on Site:	Mini RAE 3000 Photoionization Detectors [(PID) x3] and DustTrak Aerosol Monitors (x3)					
Visitors:	None					
Contractor Information						
Subcontractor						
Archstone Builders LLC				General Contractor (GC)		
Capstone Contracting Corp.				Foundation Contractor		
Description and Location of Work Activities Performed						
Contractor drilled and grouted SOE piles in Grids WC-3, WC-4, WC-5, WC-7, and WC-8.						
Excavation work and grading was performed in WC-3, WC-5, and WC-7.						
Approximately 220 cubic yards of non-hazardous soil was excavated from Grids WC-3, WC-5, and WC-7 and exported to the Bayshore facility located in NJ.						
Continued to install lagging for SOE in Grid WC-5.						
Material Disposal Tracking Information						
Destination Facility/Material Type	Daily Trucks	Total Trucks	Daily Approx. Cubic Yds	Total Approx. Cubic Yds	Total Site Loads	Total Approximate Cubic Yards
Clean Earth of North Jersey (CENJ)/(haz lead soil)	0	7	0	140	124	2,480
Clean Earth of North Jersey (CENJ)/(haz TCE soil)	0	6	0	120		
Bayshore Soil Management, LLC (Bayshore)	11	98	220	1,960		
River Front Recycling (C&D)	0	13	0	260		
Import Material Tracking Information						
Origin Facility	Daily Trucks	Total Trucks	Daily Tonnage	Total Tonnage	Total Site Loads	Total Quantity (tons)
Vulcan, Wantage or Hamburg Quarry	0	5	0.00	112.09	5	112.09
CAMP Air Monitoring Results						
CAMP Station	UPWIND			DOWNWIND		
Odors:	None			None		
VOC Action Level Exceedance(s):	None			None		
Particulate Action Level Exceedance(s):	None			None		
Maximum VOC Level (ppm) 15-min avg:	0.2184			0.0000		
Maximum Particulate Level (mg/m³) 15-min avg:	0.1389			0.0729		
Camp Response Actions: None.						
Additional Information						
Planned Work Activity for Next Day/Week:	Continue SOE installation in Grids WC-3 & WC-7.					
Comments:						

Soil Waste Classification Grid Plan

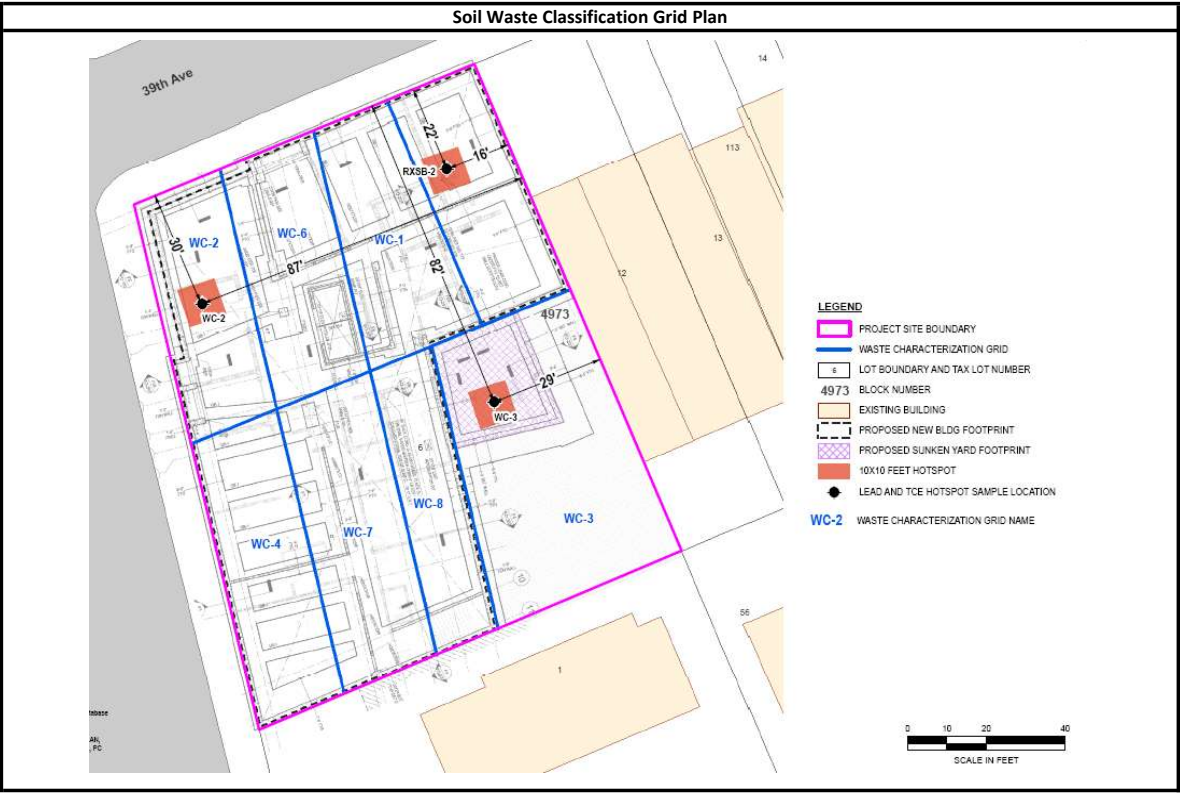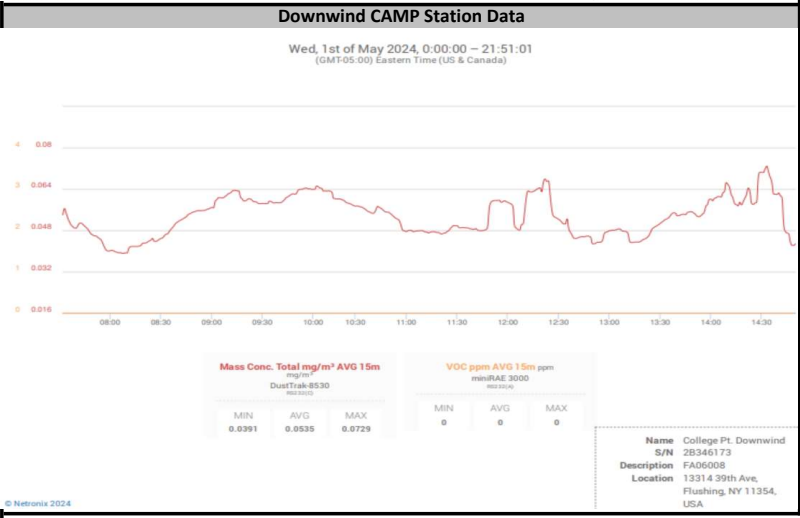

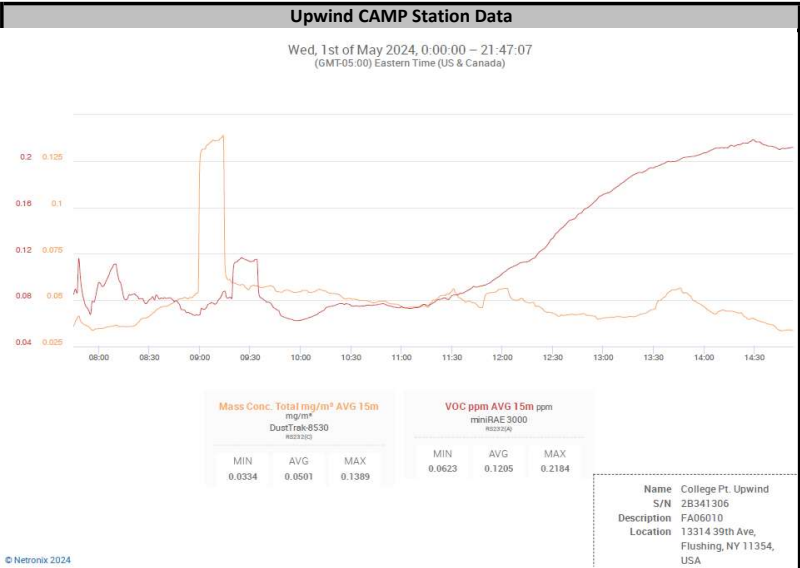

Site Photographs	
Photograph 1 - Loading soil on to trucks for off-site export. View facing east.	 <p>May 1, 2024 at 7:20:13 AM 133-04 39th Ave New York NY 11354 United States</p>
Photograph 2 - SOE pile drilling in WC 03. View facing North.	 <p>May 1, 2024 at 9:25:59 AM 133-04 39th Ave New York NY 11354 United States</p>
Photograph 3 - SOE pile drilling in WC 08, view facing southeast.	 <p>May 1, 2024 at 11:54:57 AM 133-04 39th Ave New York NY 11354 United States</p>