PHASE I

ENVIRONMENTAL SITE ASSESSMENT

SUN CHEMICAL PROPERTIES


WEST SITE 137-145 Alexander Street EAST SITE 80-94 Alexander Street

City of Yonkers Westchester County, New York

Submitted to:

SFC Sun, LLC 115 Stevens Avenue Valhalla, New York 10595

January 2007

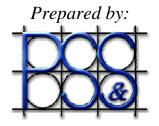

PAULUS, SOKOLOWSKI & SARTOR 470 Nepperhan Avenue, Suite 220 Yonkers, NY 10701

EXECUTIVE SUMMARY

On behalf of SFC Sun, LLC (SFC), Paulus, Sokolowski & Sartor (PS&S) conducted a Phase I Environmental Site Assessment (Phase I ESA) at the Sun Chemical properties located at the intersection of Alexander Street and Ashburton Avenue in the City of Yonkers, Westchester County, New York. The Sites are owned by Sun Chemical Corporation and consists of a mixed use of municipal, commercial and industrial properties. The West Site consists of 3.4 acres, is listed as 137-145 Alexander Street and is designated on the City of Yonkers Tax Map as Section 2, Block 2615 Lots: 1, 23 and 29. The West Site is currently occupied by the Westchester County Department of Social Services with an office building that was formerly utilized by the research and development (R&D) division of Sun Chemical site operations. The East Site is designated on the City of Yonkers Tax Map as Section 2, Block 2608/ Lots: 29, 35 and 37. The East Site consists of 2.2 acres and contains properties listed at 94, 86A, 86 and 80 Alexander Street. Currently, the East Site is utilized for commercial purposes but was originally developed by Sun Chemical as a manufacturing and warehouse facility for lithographic printing which included the handling of large volumes of chemicals associated with the operation. A wholesale business, a former post office garage, and a classified newspaper distributor with associated paved parking areas and appurtenances currently occupy the East Site buildings.

The locations of the Sites are depicted on a United States Geological Survey (USGS) Topographic Map – Yonkers, New York Quadrangle (Figure 1).

The purpose of this ESA was to identify recognized environmental conditions (RECs), as defined by ASTM-1527-05, based on the past and current uses of the Sites, and as limited by our scope of work, that could impact SFC's future plans relative to site development or potential real estate transaction. The results of the Phase I ESA identified six RECs as discussed herein that indicate that environmental contaminants are likely to be present on the East and West Sites.

The Phase I ESA Scope of Work included a review of records made available to PS&S by the client; a review of the February 2001 Phase I Hazardous Waste Assessment Alexander Street Yonkers Brownfield Project (February 2001 Phase I Report), which was an area-wide Phase I study that included the Sun Chemical Sites; a review of the standard environmental record

databases provided by Environmental Data Resources (EDR) of Milford, Connecticut; inquiries to local, county, state and federal agencies; a review of a title abstract report; a site reconnaissance and interviews with site representatives.

PHASE I ESA FINDINGS AND RECOMMENDATIONS

PS&S performed a Phase I ESA in general conformance with the scope and limitations of ASTM E-1527-05 protocols. Exceptions to or deletions from these protocols are described in this Phase I ESA. This assessment revealed RECs on the property that may be addressed during the recommended Phase II Environmental Site Assessment (Phase II ESA) activities.

Recognized Environmental Conditions and Recommendations

- 1. Based on review of a survey prepared by D.L. French (dated 1966 and revised in 1985) that was obtained from the City of Yonkers Department of Housing and Buildings and the February 2001 Phase I Report, the East Site has historically contained hazardous materials and petroleum stored in underground storage tanks (USTs). However, no documentation has been obtained as part of this Phase I ESA to indicate these UST(s) were removed from the East Site. In addition, historic document research revealed evidence of spills on both Sites. Based on the past storage and use of chemicals and petroleum-related materials, it is recommended that further investigation be conducted to determine whether USTs remain on the East Site. If evidence of impacts to the subsurface environment is identified, then a sampling program should be conducted in accordance with all applicable regulations.
- Subsurface testing is also recommended to be performed on both Sites in accordance with all applicable regulations to address the following soil and groundwater contamination issues:

- Significant fines were levied by the United States Environmental Protection Agency (USEPA) against the former operations at the Sites related to Polychrome's storage and handling of hazardous material. As such, an increased potential exists for impacts to underlying soils and groundwater from prior site activities.
- Suspect interior floor drains and exterior trench drains on the East Site were observed during the site reconnaissance. Several small floor drains were located within the vacant building at 86 Alexander Street that was formerly utilized as a vehicle garage for the postal service. Evidence of petroleum staining was observed on the floor and standing liquid within these drains was observed. A floor drain was observed in a loading area of the PennySaver building located at 80 Alexander Street. No evidence of significant staining or spillage was observed in the area near this floor drain. Trench drains were observed within the northern portion of the parking located at 94 Alexander Street. Sediment was observed within the trench drains, and no staining or odors were associated with the trench drain. The outflow destinations of these floor and trench drains were not determined. There is the potential that hazardous materials may have been released and/or disposed into these drains. Verification of the presence of these contaminant materials would require a sampling and analysis program. Research and development work at the R&D facility located at 137-145 Alexander Street likely involved use of chemicals typically associated in the lithographic printing business. In addition, according to the WCDSS personnel, the floor pit located in the southeastern corner of the first floor of this building was reported to lead to stormwater drywells. These floor pits also require further investigation. In the event contamination is found within these floor drains and pits, proper removal of contaminated materials should be performed.
- Due to the proximity of documented and suspected contaminated facilities that are located upgradient and cross-gradient of the Sites in respect to groundwater flow, the migration of off-site contamination via groundwater to

beneath the Sites is possible. A subsurface investigation at the property boundary is recommended to determine the condition of the underlying soil and to evaluate the potential presence of off-site contamination. If evidence of impacts to the subsurface environment is identified at the property boundaries, then a supplemental sampling program is recommended to include the installation of groundwater monitoring wells.

- 3. Because the buildings on the Sites were constructed prior to 1978, it is suspected these buildings may contain lead based paint. A Lead Based Paint (LBP) Survey should be conducted prior to any demolition/construction activity to determine the presence or absence of lead based paint.
- 4. It is likely that asbestos containing asbestos containing building materials (ACBM) are located within the buildings since the structures were constructed prior to 1978. An ACBM Survey should be conducted to determine the presence or absence of ACBM. If it is asbestos-containing (greater than one percent), then abatement (repair, enclosure, encapsulation, or removal and disposal) should be supervised by a licensed asbestos contractor in compliance with state and federal regulations.
- 5. Fluorescent light ballasts were observed at the time of the site reconnaissance of the subject buildings. Based upon the fact that the buildings were constructed prior to 1979, it is likely that some fluorescent light ballasts that are currently in place were manufactured with PCBs. It is recommended that in accordance with NYSDEC and appropriate state and federal regulations, replacement and proper disposal of these ballasts be conducted in order to minimize potential concert with their contents.
- 6. The suspected presence of mold was observed in portions of the interior East Site building located at 94 Alexander Street. Prior to demolition, an environmental mold survey with potential sampling should be conducted by a certified Mold Inspector. Typical analytical parameters associated with mold sampling include, but are not limited to, the following: mold, bacteria, mycotoxins, endotoxins, volatile organic compounds, temperature, and relative humidity moisture.

TABLE OF CONTENTS

1.0	INTRODUCTION1-1				
	1.1 1.2	Scope of Work and Purpose Methodology Used and Limiting Conditions	1-2		
	1.3 1.4	Limitations and Exceptions of Assessment Report Organization			
2.0	SITE DESCRIPTION				
	2.1 Site Location				
	2.2	Site History			
		2.2.1 West Site			
		2.2.2 East Site			
	2.3	General Site Characteristics			
		2.3.1 Zoning			
		2.3.2 Physiography and Topography			
		2.3.3 Geology			
		2.3.4 Surface and Groundwater			
		2.3.5 Wetlands and Floodplains			
3.0	CURRENT CONDITIONS				
	3.1	Site Reconnaissance			
		3.1.1 West Site, 137-145 Alexander Street			
		3.1.2 Interior of 94 Alexander Street (East Site)			
		3.1.3 Interior of 86A Alexander Street (East Site)			
		3.1.4 Interior of 86 Alexander Street (East Site)			
		3.1.5 Interior of 80 Alexander Street (East Site)			
	3.2	Lead Based Paint			
	3.3	Radon			
	3.4	Asbestos			
	3.5	Polychlorinated Biphenyls (PCBs)			
	3.6	Surrounding Properties			
4.0	RECC	ORDS REVIEW			
	4.1	Environmental Database Record Research	4-1		
	4.2	Hazardous Waste Assessment (February 2001)			
	4.3	Historical Records Review			
		4.3.1 Fire Insurance Maps			
		4.3.2 Aerial Photograph Record Review			
		4.3.3 Local Street Directories			
		4.3.4 USGS Topographic Maps			
		4.3.5 USEPA Record Review			
		4.3.6 NYSDEC Record Review			
		4.3.7 Westchester County Department of Health			
		4.3.8 City of Yonkers Fire Department			
		4.3.9 City of Yonkers Department of Housing & Buildings			
		4.3.10 Environmental Lien Search Report			

		4.3.11 Title Abstract Report	4-29
5.0	FINI	DINGS AND CONCLUSIONS	5-1
	5.1 5.2	Recognized Environmental Conditions and Recommendations Results of Phase I Environmental Site Assessment	
6.0	REF	ERENCES	6-1
7.0	DISC	CLAIMERS	7-1

LIST OF FIGURES

Figure 1	USGS Site Location Map
Figure 2	Site Plan

LIST OF APPENDICES

Appendix A	Environmental Site Assessment Photographs – November 2006
Appendix B	Environmental Database Search (EDR Report)
Appendix C	FOIA Requests and Responses
Appendix D	Sanborn Maps
Appendix E	Aerial Photographs
Appendix F	City Directory
Appendix G	USGS Historic Topographic Maps
Appendix H	Environmental Lien Search Report
	Title Alberton of Demonst

Appendix I Title Abstract Report

1.0 INTRODUCTION

1.1 Scope of Work and Purpose

On behalf of SFC Sun, LLC (SFC), Paulus, Sokolowski & Sartor (PS&S) conducted a Phase I Environmental Site Assessment (Phase I ESA) at the Sun Chemical properties located to the southeast and to the northwest of the intersection of Alexander Street and Ashburton Avenue in the City of Yonkers, Westchester County, New York (herein referred to as the "Sites"). The locations of the Sites are depicted on a United States Geographical Survey (USGS) Topographic Map – Yonkers, New York Quadrangle (Figure 1). Figure 2 depicts the Sites with their associated tax block and lot designations.

The purpose of the Phase I ESA was to document Recognized Environmental Conditions (RECs) associated with past and current uses of the Sites that could impact SFC's future plans relative to site development or potential real estate transactions. Consistent with the document, *The Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process* (ASTM E-1527-05), issued by the American Society for Testing and Materials (ASTM), RECs are defined as follows:

"The presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property. The term includes hazardous substances or petroleum products even under conditions in compliance with the laws. The term is not intended to include de minimus conditions that generally do not present a material risk of harm to public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies. Conditions determined to be de minimus are not recognized environmental conditions." (ASTM E-1527-05).

The Phase I ESA Scope of Work included a reconnaissance of the Sites; interviews with representatives of the Sites; a file review and document search regarding the past and current usage of the Sites; a review of available Sanborn Maps, historic aerial

photographs, city directory, and historical topographic maps; a review of the document titled 'Phase I Hazardous Waste Assessment Alexander Street Yonkers Brownfield Project' (February 2001 Phase I HWA Report); a review of USEPA, NYSDEC, county and local health department records; a review of an environmental lien report and a title abstract report. PS&S utilized a commercial environmental information service to obtain data regarding state and federal program records.

Written inquiries requesting information concerning records of storage, disposal, spills, or releases of hazardous substances requiring environmental response action on or adjacent to the Site were made via first class mail, Internet and facsimile, of federal, state, county and local agencies.

1.2 <u>Methodology Used and Limiting Conditions</u>

PS&S performed this Phase I ESA based on the guidelines specified in the Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process E 1527-05, published by the ASTM.

1.3 Limitations and Exceptions of Assessment

The RECs identified in this Phase I ESA report are limited to those PS&S identified in the records review and site reconnaissance documented within this report. Information used to complete this Phase I ESA was reasonably ascertainable, and visually and physically observable. For the purposes of this report, the site reconnaissance was limited to evidence of potential contamination that would generally include readily visible features, such as stains, discolorations, continuing spills or leaks of liquids or solids, discharge pipes, filled or mounded areas, lagoons or bermed areas and stressed vegetation. The site reconnaissance did not include checking for the presence of: 1) materials which are products manufactured or handled on the site for purposes of resale; 2) materials used for routine custodial and maintenance operations; and 3) materials within or under buildings or structures which require invasive investigating techniques or destructive testing for discovery; 4) investigations of asbestos containing materials or lead based paint or mold; or 5) testing or sampling of air, soil, water or building materials.

1.4 <u>Report Organization.</u>

This report consists of the following sections:

- *Executive Summary* provides a summary of the site and the Findings and Recommendations.
- Section 1, *Introduction*, provides the identification of the Sites along with the purpose and components of this Phase I ESA.
- Section 2, *Site Description*, describes the Sites, physical setting, and history of the Sites.
- Section 3, *Current Conditions*, includes information based on PS&S's site reconnaissance observations.
- Section 4, *Records Review*, presents a summary of the documents reviewed by PS&S. This section also includes a summary of an environmental database search and a review of historic and recent aerial photographs.
- Section 5, *Findings and Conclusions*, presents a summary of the RECs identified in connection with the Sites and Recommendations to address the RECs.
- Section 6, *References*, presents a list of the materials used or obtained during the performance of the Phase I ESA.
- Section 7, *Disclaimers*, summarizes the principal assumptions and limitations of the Phase I ESA.
- Figures depicting the site location.
- Appendix A, Environmental Site Assessment Photographs November 2006
- Appendix B, Environmental Database Search (EDR Report)
- Appendix C, FOIA Requests and Responses
- Appendix D, Sanborn Maps
- Appendix E, Aerial Photographs
- Appendix F, City Directory
- Appendix G, USGS Topographic Maps

- Appendix H, Environmental Lien Search Report
- Appendix I, Title Abstract Report

2.0 SITE DESCRIPTION

The Sites consist of two tracts of land located at the northwest ("West Site") and southeast ("East Site") intersection of Alexander Street and Ashburton Avenue in the City of Yonkers, Westchester County, New York. The Sites are owned by Sun Chemical Corporation and consists of a mixed use of municipal, commercial and industrial properties. The West Site consists of 3.4 acres and is listed as 137-145 Alexander Street and there is approximately fifty-percent building The West Site is currently occupied by the Westchester County coverage on the site. Department of Social Services in an office building that was formerly utilized by the Research and Development (R&D) division of Sun Chemical site operations. The East Site consists of 2.2 acres and contains properties listed at 94, 86A, 86 and 80 Alexander Street and there is approximately seventy-percent building coverage on the site. Currently, the East Site is utilized for commercial purposes but was originally developed by Sun Chemical as a manufacturing and warehouse facility for lithographic printing which included the handling of large volumes of chemicals associated with the operation. A wholesale business, a former post office garage, and a classified newspaper distributor with associated paved parking areas and appurtenances currently occupy the East Site buildings. Photographs of the Sites and surrounding area are provided in Appendix A.

2.1 <u>Site Location</u>

On the United States Geologic Survey (USGS) 7.5 minute series topographic map of Yonkers Quadrangle, the Sites are located at the coordinates of Latitude (North) 40.940600 or 40° 56' 26.2" and Longitude (West) -73.901000 or 73° 54' 3.6" (Figure 1). The West Site is designated on the City of Yonkers Tax Map as Section 2, Block 2615 Lots: 1, 23 and 29. The East Site is designated on the City of Yonkers Tax Map as Section 2, Block 2608/ Lots: 29, 35 and 37.

No property surveys were provided to PS&S to confirm the acreage and boundaries of the Sites. Based on recorded tax information and the City of Yonkers tax maps, the West Site area is 3.45 acres and the East Site area is 2.22 acres. The West Site's Lot 29 has a recorded area is 1.02 acres of land; the recorded area of Lot 23 is 1.56 acres of land although the tax map lists 1.57 acres of land and 1.10 acres of water; the

recorded area of Lot 1 is 0.87 acres of water and the tax map also lists 0.87 acres of water. However, approximately 0.3 acres of the West Site's Lot 1 are not underwater and are currently utilized as part of the asphalt paved parking lot. The East Site's Lots 37 and 35 are recorded together with an overall area of 1.32 acres of land. The East Site's Lot 29 has a recorded area of 0.90 acres of land.

Table 1 contains a summary of the existing properties owned by Sun Chemical Corporation that were evaluated as part of this Phase I ESA with tax block and lot identification of each property. Sun Chemical owned the Polychrome Corporation which was the entity that performed the lithographic printing and R&D operations on the East and West Sites.

TABLE 1 CURRENT PROPERTY USES AND TAX IDENTIFICATION								
Address	Occupant	Description	Tax Identification					
<u>West Site</u>	Westchester	Two-story Office building with	Section 2, Block 2615,					
137-145 Alexander St.	County	associated paved parking areas and a	Lots: 1, 23 and 29					
Yonkers, NY	Department of	one-story masonry building used as a						
	Social Services	dispatcher's office space.						
East Site	Former	Two one-story and three two-story	Section 2, Block 2608,					
94 Alexander St	Polychrome Corp.	adjoining buildings formerly used for	Lots: 35 and 37					
(a.k.a. 2 Ashburton Ave)	(vacant)	manufacturing and storage of						
Yonkers, NY		lithographic plates.						
East Site	Stanlou Wholesale	One to two-story, concrete building	Section 2, Block 2608,					
86A Alexander Street		used as a wholesale business.	Lots: 35 and 37					
Yonkers, NY								
<u>East Site</u>	Former Post Office	Two adjoining one-story concrete and	Section 2, Block 2608,					
86 Alexander Street	Garage	brick buildings formerly used as a	Lot 29					
Yonkers, NY	(vacant)	post office garage.						
East Site	PennySaver	Two-story concrete block and brick	Section 2, Block 2608,					
80 Alexander Street		building used as a classified	Lot 29					
Yonkers, NY		newspaper distributor						

2.2 <u>Site History</u>

2.2.1 West Site

The West Site is listed as 137-145 Alexander Street and is designated on the City of Yonkers Tax Map as Section 2, Block 2615, Lots 1, 23 and 29. The Site is currently owned by Sun Chemical Corporation and has been occupied since approximately 1991 by the Westchester County Department of Social Services.

Based on review of available Sanborn Fire Insurance Maps and the Title Abstract Report (refer to Sections 4.3.1 and 4.3.11, respectively), the former uses of the West Site are described as follows:

- From 1978 to 1991 –Research and Development division of Polychrome Corporation Lithographic Supplies (Sanborn Maps)
- 1968 and 1969 Property transferred to Resin Realty Corporation with no known change of site use (Title Abstract Report).
- 1964 to 1969 Polychrome Corporation owned property located at Block
 2615, Lots 1 and 29 (Title Abstract Report).
- 1951 Machine shop with storage buildings and boat construction and repair facility (Sanborn Map).
- 1942 Westchester Lighting Company and J.A. Mahlstedt Lumber Company (Sanborn Map).
- 1917 Gwinzburger & Wiell Fat & Bone Collecting Station and Yerks & Company Lumber and Coal facility (Sanborn Map).
- 1890s– Single-family dwelling and the Barber Asphalt Company (Sanborn Map).
- From 1886 to 1890s West Site was undeveloped (Sanborn Maps).

2.2.2 East Site

The East Site is designated on the City of Yonkers Tax Map as Section 2, Block 2608, Lots 29, 35 and 37. The East Site is listed at 94, 86A, 86 and 80 Alexander Street. The East Site is owned by Sun Chemical Corporation and includes the following current uses: a vacant manufacturing and warehouse facility for lithographic printing; a wholesale business, a vacant former post office garage, and a classified newspaper distributor. The Site is currently owned by Sun Chemical Corporation.

Based on review of available Fire Insurance Maps and the Title Abstract Report (refer to Sections 4.3.1 and 4.3.11, respectively), the former uses of the East Site are described as follows.

- 1978 Polychrome Corporation manufacturing and warehouse buildings (Sanborn Map).
- 1973 Polychrome Realty Corporation acquired the Lot 29 title by deed from Harold T. Garrity and deed from Brehm Realty Corporation (Title Abstract Report).
- 1951 to 1973- Polychrome Corporation Manufacturing Stencil Paper, post office garage, and bakery. (Sanborn Maps).
- 1944 (Lots 35 and 37) Resin Realty Corporation acquired ownership from Socony-Vacuum Oil Company (Title Abstract Report).
- 1942 Standard Oil Company and land (Sanborn Maps).
- 1917 Standard Oil Company of New York and Pierpont and Vanderveer, Hay, Feed Flour and Produce (Sanborn Map).
- 1898 Eastern portion of Archibald Lumber Company, Anchor Brewing Company, Standard Oil Company and Geo Ringler & Company Beer Depot (Sanborn Map).
- 1886 East Site was not developed and was located within the Hudson River waterway (Sanborn Map).

2.3.1 Zoning

According to the City of Yonkers Zoning Map, the Sites are situated within an industrially zoned district. The historic and present uses are consistent with the current zoning. However, Yonkers is in the process of a new planning effort, which is likely to result in flexible mixed use zoning for this waterfront area.

2.3.2 Physiography and Topography

Review of the United States Geologic Survey (USGS) 7.5 minute series topographic map of Yonkers Quadrangle, New York indicates that the topographic gradient for the Sites is generally to the west. Review of topographic maps provided in the Environmental Database Search (EDR Report) indicates that the elevations of the Sites range from approximately 9 feet above mean sea level (msl) to 1 foot above msl. The elevation of the area within a one-mile radius of the Site ranges from approximately 0 feet above msl to approximately 130 feet above msl. A copy of the complete EDR Report is included in Appendix B.

2.3.3 Geology

According to the United States Department of Agriculture (USDA) Soil Conservation Service (SCS), the dominant soil composition in the general vicinity of the Site consists of Urban Land (Uf), which consists of surface areas that are 70 percent covered with asphalt, concrete or other impervious building material, such as, parking lots, shopping centers, industrial parks or institutional.

Review of the EDR Report indicates that the Site and surrounding area is underlain by bedrock consisting of a stratified sequence: Paleozoic, Ordovician and Lower Ordovician and Cambrian carbonate rocks. No bedrock outcrops were observed during the site reconnaissance; the depth to bedrock is not known. Geotechnical drilling on the Sites is required to determine the location of bedrock which varies significantly along the Yonkers waterfront due to both natural history with erosion and deposition from glacial and surface water actions, and urban development with significant filling activities.

2.3.4 Surface and Groundwater

Examination of the USGS Topographic Map, Yonkers Quadrangle, indicates that the elevations of the Sites range from approximately 9 feet to 1 foot above msl. Based on a preliminary groundwater study, conducted by PS&S in November 2006, the depth to groundwater ranges from approximately 4 feet to 7 feet below ground surface (bgs).

Review of the EDR Federal USGS Well database identified 10 private or public supply wells within a 1-mile radius of the Sites (refer to the EDR Report included as Appendix B). As identified in the Federal Reporting Data System (FRDS) Public Water supply system database, there is a public water supply well located between a ¹/₂-mile to 1-mile south of the Sites. No well information was contained in the State Database of the EDR Radius Report.

Local groundwater flow direction, inferred from available topographic mapping of the area and the EDR Radius Report, is generally west toward the Hudson River. However, local variations in the groundwater flow direction may be present.

2.3.5 Wetlands and Floodplains

The West Site (137-145 Alexander Street) is bounded by the Hudson River to the west. The New York State Department Tidal Wetland Map (Index Map No. 1, Map ID No. 592-532 of Inset A) designates the Hudson River as a Littoral Zone (LZ).

Furthermore, according to review of the National Wetlands Index Map of Yonkers, prepared by the United States Fish and Wildlife Services, the Hudson River is designated as a wetland area and is identified as E1UBL (Estuarine, Subtidal, Unconsolidated Bottom, Subtidal). This wetland type is characterized as estuarine and marine deepwater.

Based on the review of the Federal Emergency Management Agency's (FEMA) Flood Insurance Rate Map (Map No. 36103C0680 G), the West Site is situated in the following three zones: Zone X (areas determined to be outside and within the 500-year floodplain); Zone X (areas of 500-year flood; areas of 100-year flood with average depths of less than 1 foot or with drainage areas less than 1 square mile; and areas protected by levees from 100-year flood) and Zone AE (Base flood elevations determined as 8 feet). The East Site is situated in Zone X (areas determined to be outside and within the 500-year floodplain).

3.0 CURRENT CONDITIONS

3.1 <u>Site Reconnaissance</u>

PS&S representatives conducted an escorted reconnaissance of the Sites and adjacent properties on November 7, 2006 with the exception of the vacant building located at 94 Alexander Street. The interior of the building at 94 Alexander Street was visually inspected on December 6, 2006.

Observations of the Sites were documented in the form of field notes and photographs. Selected photographs are presented in Appendix A.

Interviews were conducted during the Site reconnaissance on November 7, 2006 with the occupants of the Sites as identified below:

- Mr. Frank Coppola, Program Specialist with the Westchester County Department of Public Works at the Westchester County Department of Social Services building located on the West Site (137-145 Alexander Street);
- Mr. Joel Iskowitz, owner and the warehouse manager of Stanlou Tobacco at the Stanlou building located on the East Site (86A Alexander Street); and
- Mr. Fred Liebowitz, manager of PennySaver, at the PennySaver building located on the East Site (86 Alexander Street).

In addition, an interview was conducted via telephone on November 15, 2006 with Ms. Kathy Sharpe, a former manager for Polychrome Corporation; however, Ms. Sharpe was not employed at the Sites but was familiar with the nature of their operations. Ms. Sharpe stated that she did not know the structure's date of construction. Ms. Sharpe revealed that prior to the Westchester County Department of Social Services leasing the West Site building, Polychrome Corporation utilized the building for administration and for Research and Development (R&D). Ms. Sharpe confirmed manufacturing was performed on the East Site. Sun Chemical Corporation acquired Polychrome Corporation and currently owns the East and West Sites. It was reported by Ms. Sharpe that environmental audits were performed when Sun Chemical acquired the Sites. However,

no documentation pertaining to the environmental audits were provided by Sun Chemical Corporation or Polychrome Corporation at the time of the writing of this report.

Furthermore, information regarding the number, type and size of underground storage tanks and/or aboveground storage tanks as well as other documentation regarding the Sites was requested from Sun Chemical. However, no information pertaining to this request has been provided at the time of the writing of this report.

The Site buildings are supplied with potable water from the municipal system maintained by the City of Yonkers. Sanitary sewage from the buildings is discharged to the municipal sewer system maintained by the City of Yonkers.

In addition, a stormwater outfall that discharges to the Hudson River was observed at the southwestern border of the West Site. This outfall is further described in Section 3.1.1.

The Sites occupants stated that the existing buildings located at 137-145, 86 and 86A Alexander Street utilize natural gas for heating purposes and electric power for cooling. No information regarding the heating of the buildings at 80 and 94 Alexander Street was made available.

3.1.1 West Site, 137-145 Alexander Street

The West Site is currently occupied by the Westchester County Department of Social Services (WCDSS) and is developed as a two-story office building with two associated paved parking areas and landscaped areas. The WCDSS is bounded by: the Excelsior Package Group to the north; Alexander Street and Greyston Bakery (former MGP site) to the east; ATI Tank Farm Site to the south and the Hudson River to the west.

According to Mr. Frank Coppola, Program Specialist from the Westchester County Department of Public Works, the building was partially occupied by WCDSS in 1992. Renovations of the building were performed and completed in 1993 to allow the WCDSS to fully occupy the building. Prior to this time, Polychrome Corporation occupied the building for R&D purposes. Mr. Coppola also indicated that he was not aware of any aboveground or underground storage tanks present on-site and was not aware of any spills of hazardous materials that had occurred on-site during WCDSS occupation of the building. No documentation was provided by Mr. Coppola pertaining to the environmental conditions of the West Site.

Interior of 137-145 Alexander Street (West Site)

The office building is constructed of concrete blocks and brick walls, vinyl tile flooring, carpet flooring, acoustical ceiling tiles and is equipped with an HVAC system. Observed mounted within/to the ceiling were ceiling vents, fire alarm and sprinkler system, and fluorescent light ballasts. Visual observation of the ceiling of the first and second floors indicated that the ceiling tiles were predominantly in good condition with the exception of some water staining. In addition, several electric panels were observed mounted to walls throughout the first and second floors.

Visual observation of the first floor of the WCDSS revealed the following, but not limited to: a reception area with two reception desks; six bathrooms; several offices and cubicle stations; storage closets; conference rooms; a computer room; a mail room; filing storage rooms; two mechanical rooms; a security room which contains communications equipment and panels; a cafeteria (i.e., seating area, a kitchen counter top with a sink, a vacant kitchen, refrigerators, vending machines, etc.); one passenger elevator and a loading dock with a freight elevator.

Adjacent to the passenger elevator is an elevator equipment storage room that contains a hydraulic generator engine, one five-gallon container of hydraulic oil and associated maintenance supplies. There was no staining observed on the floor of this room.

Observed within one of the storage closets on the first floor were: several containers of paint and paint thinner; boxes of fluorescent light bulbs; one five-gallon container of tar; three bags of concrete mix; one sixty-pound bag of black

top; and miscellaneous office supplies. In addition, an electric panel was observed mounted to the wall. There was no staining observed on the floor of this room.

Miscellaneous equipment associated with the building maintenance operations (i.e., electric powered floor cleaner, a weed/grass trimmer, two gas-powered blowers, etc) were observed in the hallway leading to a mechanical room located in the southeastern portion of the building. Observed within this room were: boxes of miscellaneous office supplies; heavy duty electrical panel boards; telephone circuit panels; a water main with associated piping and water meter; and two electric panels and electric switches mounted to the walls. A floor pit was observed in the southeastern corner of this room and according to WCDSS personnel, this provides access to stormwater drywells. The interior of this floor pit was observed and there was no pooling of liquids or environmental impacts noted in the floor pit. A single two-inch diameter steel pipe was observed within the pit extending into the bottom of the pit. The use and discharge point of this pipe is not known. Evidence of stains on the concrete floor was visible along the eastern wall of this room; however, the floor appeared to be in good condition as no cracks were observed.

The second mechanical room is situated within the northeastern portion of the building and contains the main electric switch and is identified as the power station to the building including the elevators. Observed within this room were: a water main; two five-gallon containers of hydraulic oil; two elevator safety switches; four electric panels; an electric meter; and an alarm system mounted to the wall. In addition, a floor pit was observed in this room; however, access to this floor pit was not feasible as the plates covering the pit could not be removed.

Another floor pit was observed within a carpeted office space in the central portion of the first floor and was reported to provide access to the plumbing fixtures. Access to this floor pit was not available at the time of the reconnaissance as the cubicle structures were atop of the pit.

The second floor contains offices; cubicle pod stations; a kitchen area; and two bathrooms. A closet space on the second floor contains a sink, a 30-gallon water heater and wall-mounted electrical panels.

The bathrooms consisted of typical bathroom fixtures and exhaust vents. In addition, a 30-gallon water heater was observed in five of the bathrooms on the first floor. No floor drains were observed within these bathrooms.

Located in the central portion of the rear parking lot is a detached, one-story masonry building that is utilized as an office for dispatching WCDSS vehicles and for minor vehicle maintenance. This office consisted of vinyl tile flooring and ceiling tiles with fluorescent light ballasts affixed to the ceiling. Visual observation of the ceiling indicated that the ceiling tiles were generally in good condition.

Observed within this building were: containers of windshield fluid, motor oil, washer fluid, and cleansers; one bathroom (i.e., one sink and one toilet) a counter top with a sink; a vacuum; a water heater with a capacity of 2.75 gallons; and office equipment. In addition, an air conditioning unit and an electric panel were mounted to the southern wall. Minor stains were observed on the floor near the containers of car maintenance fluids (i.e., motor fluid, windshield fluid, motor oil, etc.); however, the tile flooring appeared to be in good condition as no severe cracks were observed. No floor drains or floor pits were observed within this structure.

Exterior of 137-145 Alexander Street (West Site)

The West Site building fronts Alexander Street and is flanked by two drive aisles that extend westward to an associated paved parking area that is bounded by the Hudson River. A chain link fence encloses the West Site, with exception of the front of the building which allows for access to the building. In addition, the two security gates are located at the access points of the rear parking area. The front yard of the West Site (eastern portion) includes two landscaped areas (i.e., grass, small shrubs and trees) and a paved parking area that is accessible from Alexander Street and designated for visitors of the WCDSS. The vegetation and ground surface near the building showed no sign of distressed vegetation. A set of double-hinged panels were observed within the concrete paved parking area in the front yard and was reported as a sewer main access pit. The interior of this access pit was not observed during the Site reconnaissance as automobiles were parked on top of the pit.

A wall vent and two fire sprinkler alarm systems with associated fire department connection pipes and valve were observed installed within the eastern exterior wall of the building. Visual inspection of the sidewalk along the eastern portion of the site, adjacent to Alexander Street, revealed several sidewalk fixtures: a fire hydrant, utility valve boxes and steel grates were observed within the sidewalk. These grates were reported as access points to utilities maintained by Con Edison. In addition, a manhole cover is located in the sidewalk area within the southeastern portion of the West Site. The interior of the manhole was not observed during the site reconnaissance as the access cover could not be removed.

The rear parking lot is utilized by employees of the WCDSS and is enclosed by a chain link fence along the northern, southern and western perimeters. One stormwater catch basin and one fire hydrant were observed in the central portion of the parking lot.

The Hudson River bounds the rear parking lot to the west. Rip rap is located along the Hudson River shoreline. Abandoned timber pilings in the Hudson River were observed along the northern portion of the shoreline. No environmental impacts were observed along the shoreline.

A stormwater outfall that discharges to the Hudson River was observed at the southwestern boundary of the Site. A sign on the chain link fence indicated the outfall is a NYS Permitted Discharge Point (SPDES Permit No. NY 0026689,

Outfall No. 010) registered to the Westchester County Department of Environmental Facilities.

3.1.2 Interior of 94 Alexander Street (East Site)

The portion of the East Site at 94 Alexander Street is developed with five adjoining structures comprised of two one-story structures and three two-story structures that are located at the corner of Alexander Street and Ashburton Avenue. Generally the structures are constructed of brick and concrete blocks, with the exception of the easternmost portion which is a two story metal structure. These buildings are currently vacant. In addition, there is an associated paved parking lot situated on the eastern portion of the site. Mr. Frank Coppola provided access to this property; however, visual observation of the interior of the buildings, located at 94 Alexander Street, was limited due to physical hazard conditions within the structure. Mr. Coppola indicated that he did not have any knowledge regarding the prior use of the property.

During the aforementioned interview with Ms. Sharpe she indicated that this portion of the East Site was formerly utilized by Polychrome Corporation as a manufacturing facility of lithographic printing plates. As part of the manufacturing process, hazardous materials were used and disposed off-site. Ms. Sharpe indicated that Hazardous Waste Manifests were maintained, however, she did not have access to the manifests at the time of the interview.

According to Ms. Sharpe, an unknown amount of an unknown material was spilled in the 1990's at the manufacturing facility and the material was cleaned within one week. No additional information pertaining to the type and amount of material spilled or the date of occurrence was provided by Ms. Sharpe. Section 4.0 includes information pertaining to documented spill releases at this Site.

In addition, Ms. Sharpe indicated when manufacturing was active an air sampling program was administered to verify compliance of a regenerative thermal oxidizer pollution control device. Visual observation of the interior of the subject building revealed that the building was constructed with various materials all in poor condition (i.e., metal beams, plaster walls, ceiling tiles, concrete floors, etc.). Specifically, visual inspection of the walls and ceilings of the first and second floors of the building revealed the presence of extensive mold growth and water stains as well as observations of peeling and cracking of wall paint.

In addition, visual inspection of the first floor revealed that the concrete floor of the building was in poor condition with several cracks and depressions. The condition of the flooring on the second level was poor with discontinuous tiles and wood flooring.

The northern portion of the building included a garage door in the eastern wall. Visual observation of the southern wall revealed peeling and cracking of paint from apparent water damage, as well as, some mushroom growth on the walls.

The boiler room, located in the northern portion of the first floor, contained a water heater approximately 1,000-gallons in size and a floor drain. The fuel source of this water heater is not known. The discharge point of this floor drain is not known. No staining was observed in the area of the floor drain.

Access to the second floor was by a steel staircase located in the alleyway between 94 and 86A Alexander Street. The condition of the ceiling and roof on the second floor was in poor condition with portions of the roof collapsed in at least two locations. Inspection of this second floor space revealed that any equipment or materials stored here were removed and all that remains is the building structure.

Exterior of 94 Alexander Street (East Site)

The paved parking lot located adjacent to 94 Alexander Street on the East Site is accessed from Ashburton Avenue. This parking lot extends southward to the

warehouse currently utilized by Stanlou Wholesale and is enclosed by a chain link fence with a double-door gate. Currently, staff and visitors of Stanlou Wholesale utilize this parking lot.

Evidence of minor oil stains apparently from parked cars and trucks was observed in various areas of this parking lot. However, the paved surface areas appeared to be in good condition with no severe cracks observed. In addition, trench drains were observed along the northern portion of the parking lot. Sediment was observed in the trench drain, and standing water and odors were not noted within the trench drains.

3.1.3 Interior of 86A Alexander Street (East Site)

The portion of the East Site at 86A Alexander Street is currently occupied by Stanlou Wholesale which is a distribution business of candy, grocery and tobacco products. Based on review of historical research, this building was formerly part of Polychrome's operations. This property is bounded by the former Polychrome building and associated parking lot at 94 Alexander Street to the north; the Metro North rail road right-of-way to the east; the former post office garage located at 86 Alexander Street to the south; and Alexander Street to the west.

According to Mr. Joel Iskowitz, president of Stanlou Wholesale, the building has been leased by Stanlou Wholesale for approximately eight years. Mr. Iskowitz also indicated that there are no aboveground or underground storage tanks present at the property and he had no knowledge of hazardous material releases. No documentation pertaining to the property was provided.

The building occupied by Stanlou Wholesale consists of a one and two story building that comprises approximately 2,000 square feet of office space and approximately 22,000 square feet of warehouse space. The western portion of the building consists of office space and is constructed of concrete and brick walls, vinyl tile floors and tiled ceiling and is equipped with an HVAC system.

The interior of the office space of Stanlou Wholesale includes: an entry and a small hallway with an alarm system mounted to the wall; a reception area with associated office equipment and a small refrigerator; five offices that contain typical office furniture and equipment; a room utilized for storage of files and a desk; and a boiler room.

The boiler room includes the following, but not limited to: an approximate 2,000gallon disconnected water heater dated 1976; piping associated with the natural gas service and water sprinkler service; a fire alarm system; a disconnected exposed pipe of unknown use; and a telephone utility panel box and wall-mounted electrical panel boxes. The fuel source of the water heater was not known. The associated water and gas piping originate from a concrete pit in the western portion of the room (approximately three to four feet deep) and extends along the eastern and southern walls. There was no staining, sheen or odor observed within this concrete pit.

The warehouse portion of the building is constructed of concrete block walls, steel beams, a concrete paved floor and a prefabricated steel roof. Observed mounted to the ceiling of the warehouse were: overhead space heaters, fluorescent light ballasts, an HVAC system and overhead gas and water piping.

The interior of the warehouse comprises the following, but not limited to: a mechanical room; a small storage area; a main storage area; and two bathrooms (i.e., one men's bathroom and one women's bathroom with typical bathroom fixtures). The mechanical room contains a water meter with associated piping, a rotary positive gas meter blower (manufactured by Walworth); three electric distribution panel boards; two safety switch panels; associated piping and two electric panels. In addition, a floor pit (with a rusted metal cover) approximately four feet deep was observed. No evidence of staining, pooling, sheen or odor was observed within this floor pit.

There is a small storage area in the western portion of the warehouse for miscellaneous items, including the following, but not limited to: several boxes containing invoices or returned merchandise; file cabinets; computer monitors and other miscellaneous office equipment.

The main storage area is adjacent to the east of this small storage area. Observed within the main storage area were two bathrooms (i.e., one men's and one women's); several aisles with shelving of miscellaneous cigarette, candy and grocery products; a stamping area for packaging cigarettes and a shipping area.

The stamping area included two 55-gallon drums that contain glue, which is used for packaging cigarettes. Although stains were observed on the concrete floor near these drums due to apparent spillage of glue, the concrete floor appeared to be in good condition with no severe cracks observed.

In addition, there was peeling and cracking of the painted surface area observed on the northern wall of the warehouse near to the stamping area.

3.1.4 Interior of 86 Alexander Street (East Site)

The East Site structure at 86 Alexander Street consists of a vacant one-story building with associated paved surfaces areas. Based on review of historical Sanborn Maps, this property was formerly utilized as a vehicle service garage for the postal service. During the Site reconnaissance, there was no representative of the property to interview. Mr. Copolla provided access to the property on behalf of Sun Chemical Corporation; however, Mr. Copolla indicated that he did not have any knowledge of the property history. However, based on review of historical research, this building was formerly part of Polychrome's operations.

The property is bounded by: Stanlou Warehouse on the north; the Metro-North rail road right-of-way to the east; PennySaver to the south; and Alexander Street and the ATI Tank Farm Site to the west.

The former garage has vehicular driveway access from Alexander Street. The western wall of this building includes a large garage door.

The building is generally constructed of concrete blocks, bricks and concrete flooring. The ceiling is exposed and contains: skylights, a suspended water heater; overhead fans, vents, fluorescent light ballasts, insulation, and overhead space heaters.

The western and central portions of the building include twenty parking stalls with capped floor drains aligned along the stalls. Evidence of pooling within these floor drains was observed. The use and discharge point of these floor drains is not known. Based on the past use of the property as a garage and Polychrome's past operations, hazardous materials may have been released and/or disposed into these floor drains. Visual observation of the concrete floor in the western and central portions of the building revealed several oil stains; however, the concrete floor appeared to be in good condition as no severe cracks were observed.

An air compressor enclosed by a fence was observed in the southwestern corner of the building. In addition, this enclosed area included: a ventilation fan; a gas meter (observed as active); a water sprinkler and fire protection main with an associated alarm system were observed mounted to the wall. An electric panel and a telephone circuit panel were observed to the north of this area on the western wall.

The northwestern portion of the building includes an office space, two bathrooms, a 40-gallon water heater and two electric panels attached to the wall. The fuel source of the water heater is unknown. The bathrooms were equipped with typical bathroom fixtures. No floor drains were observed in these bathrooms.

An industrial air conditioner and an associated interchange drum were installed within the northeastern portion of the garage. There are two small adjoining rooms situated within the southeastern portion. The first room contained a shelving unit; the concrete flooring included a floor drain and a concrete patch located near it. The discharge point of this floor drain is not known. Based on the past use of the property as a garage and Polychrome's past operations, hazardous materials, may have been released and/or disposed into this floor drain.

The second room, located adjacent to the eastern room, included an exhaust vent, disconnected piping, of unknown use, that extended along the eastern wall thereof; a large, low-pressurized steam boiler that was dismantled, an associated electric powered natural gas engine; and a four-foot deep concrete pit that contained debris and dirt. The use of this pit is not known and there was no visible evidence of stains, pooling of liquids, sheens or odors within the pit.

The eastern portion of the building appears to have been an adjoining building that was renovated in order to expand the garage. Visual inspection of this portion of the building revealed fluorescent light ballasts, piping and overhead space heaters mounted to the ceiling and two garage doors installed in the northern and western walls of this area. Visual inspection of the concrete floor revealed: paint markings of designated parking spaces; a defined concrete patch (square-shaped); a small opening within the concrete floor that contained fill material, and a manhole cover. Although apparent oil stains were observed on the concrete floor of the eastern portion of the building, the concrete floor appeared to be in good condition with no severe cracks observed at or adjacent to the stained areas.

Exterior of 86 Alexander Street (East Site)

The East Site's vacant building at 86 Alexander Street fronts Alexander Street with paved vehicular driveways to the garage doors of the building. A chain link fence with a two gates encloses the front portion of the building.

Visual inspection of the paved asphalt and concrete areas within the front portion of this building revealed several street/sidewalk fixtures: utility valve boxes, a manhole cover and two concrete pads with two steel grates installed within each pad. One valve cover observed within the enclosed portion of the front yard and was labeled Universal Valve Co. and is most likely associated with a valve for the potable water service. The general condition of this area appeared to be poor with several asphalt patches and cracks. In addition, a fire hydrant is located at the western boundary of the Site, adjacent to Alexander Street.

3.1.5 Interior of 80 Alexander Street (East Site)

The East Site structure located at 80 Alexander Street consists of a two-story building with a mezzanine and associated paved surface areas that is leased by the PennySaver Group, a classified newspaper distributor.

The PennySaver Group property is bounded by: the former post office garage to the north; the Metro-North rail road right-of-way to the east; a vacant building to the south; and Alexander Street to the west.

Mr. Fred Liebowitz, manager of the PennySaver Group since 1993, escorted PS&S personnel during the Site reconnaissance and indicated he was not aware of the former uses of the PennySaver building by PolyChrome. Mr. Liebowitz stated that the water main of the PennySaver building is connected to the same water main within the Stanlou Tobacco building. In addition, the following was indicated as unknown by Mr. Liebowitz: the presence of suspect asbestos in the building; the presence of aboveground or underground storage tanks; hazardous materials used or hazardous wastes generated; or if any spills occurred on-site. In addition, no documentation pertaining to the property was provided by Mr. Liebowitz.

The building consists of an entry, several office spaces, a warehouse, a kitchen, three bathrooms, and a newspaper packing area. Bathrooms were equipped with typical bathroom fixtures and no floor drains were observed within the bathrooms. Visual observation of the ceiling of the first and second floors indicated that the ceiling tiles were predominantly in good condition with the exception of a couple water-stained ceiling tiles.

The northwestern portion of the building consists of an entry that leads to an office space. This office space contained typical office furniture and equipment (e.g., desks, file cabinets, photocopiers, etc.). Fluorescent light ballasts and overhead sprinklers were observed affixed to the ceiling. East of this office space, is a hallway that leads to two bathrooms (one men's bathroom and one women's bathroom) and a warehouse. A water main sprinkler system was observed mounted to the western exterior wall of the bathrooms. The bathrooms contained typical bathroom fixtures (i.e., sinks, toilets, etc.) and no floor drains were observed in these bathrooms. The warehouse generally includes storage space; a kitchen and a staircase that leads to the second floor. The kitchen includes the following but not limited to: a file cabinet; a 12-gallon water heater; a propane space heater; a refrigerator; a sink and a dinette set. The warehouse portion of the building mainly occupies the central portion of the building and contains several cardboard boxes of newspapers and other associated stored items, several shelving units; six bags of Halite rock salt; and other associated newspaper and warehouse items. A loading dock was observed in the northwestern portion of the warehouse. In addition, visual inspection of the ceiling of the warehouse revealed six skylights installed therein, associated natural gas piping and water piping, and two ceiling fans.

A loading area adjoins the warehouse to the west and is accessible via the driveway on Alexander Street. This loading area is also utilized for storage of newspaper items and equipment (e.g., cardboard crusher, etc.). A phone system panel, an electric switch panel and an electric meter were observed attached to the southern wall. In addition, a floor drain was observed in the concrete floor, however the interior of this floor drain was not observed as the cover could not be removed. The discharge point of this floor drain is not known.

Adjacent to the warehouse to the east is a newspaper packing area that contains the following, but not limited to: a forklift that is fueled by natural gas; packing equipment; several boxes containing newspapers; associated distribution equipment and supplies; and several piles of packed newspapers. Specifically, the southern portion of this packing room included the following but not limited to: thirteen packing machines with associated equipment (i.e., two blowers, one vacuum pump with an air compressor; a back-up air supply tank, associated panel box switches) and two five-gallon drum containers of oil transmission fluid. No stains were observed on the floor adjacent to these containers. An electric panel was observed affixed to the western wall of the packing room adjacent to this packing area. A garage door is installed within the western wall of the northwestern portion of this room. A second newspaper packing area with associated packing machines was observed in the northeastern portion of this area. Visual observation of the ceiling revealed associated overhead piping and a ventilation fan.

The stairway from the central portion of the warehouse leads to a mezzanine located in western portion of the warehouse that is utilized for office storage.

Observed within the northern portion of the second floor were an office space divided by three partitions; a bathroom; a conference room and a second office space with an exit to the northern yard of the property. General observation of the divided office space revealed the following, but not limited to: several cardboard boxes that contain miscellaneous files and/or office related items, file cabinets, a small lounge area, a water cooler, a small refrigerator and a water cooler.

The bathroom was equipped with typical bathroom fixtures; including an electric water heater mounted to the wall near the sink. The conference room included a large table with chairs and an air condition unit installed within the northern wall. The remaining office space contained typical office furniture, equipment and supplies and circuit panels affixed to the southern wall.

In addition, there was peeling and cracking of the painted surface areas observed throughout the building.

Exterior of 80 Alexander Street (East Site)

The exterior portion of the property consists of paved surface areas that include a loading ramp within the front yard and a driveway on the northern portion of the property that extends from Alexander Street to the warehouse garage and is enclosed by a chain link fence with a set of double-swing gates. A concrete patch and several oil stains were observed on the paved portion of the front yard; however, the condition of the paved surface area appeared to be in good condition as no severe cracks were observed. In addition, a gas utility valve box was observed within the sidewalk along Alexander Street.

Observed along the northwestern exterior wall of the PennySaver building were eight propane cylinders of undetermined size enclosed within a steel cage on a concrete pad. Located adjacent to and underneath this steel cage were four exposed, disconnected pipes within a concrete pad that extends along the northern wall. The former use and destination of these pipes is unknown. Five air conditioning units were observed installed within this wall.

The rear yard consists of a narrow paved surface area that contains discarded storage equipment, handcarts, empty newsstand containers, and two empty fifty-five gallon drums. No staining was observed on the paved surface area adjacent to these drums.

In addition, there was peeling and cracking of the painted surface areas observed on the exterior walls of the building.

3.2 Lead Based Paint

In 1973, the Consumer Product Safety Commission established a maximum lead paint content of 0.5 percent, which was subsequently lowered in 1978 to 0.06 percent. Given the age of the buildings on the Sites, lead paint could present an environmental concern. Since the buildings on the Sites were constructed prior to 1978 and there was no

documentation concerning lead levels, it is possible that buildings contain lead-based paint. No testing for lead was conducted as part of this ESA.

3.3 <u>Radon</u>

The United States Environmental Protection Agency (USEPA) has established an action level of 4 Pico curies/Liter (pCi/L) for residential structures. Review of the NY Radon Database, included in the EDR Report as Appendix B, indicates that the Sites are situated within the Federal EPA Radon Zone 3 for Westchester County, which is defined as an indoor average level less than 2 pCi/L. Review of data compiled by the New York State Department of Health, Westchester County indicates the test results from 130 sites in the City of Yonkers, Westchester County, which revealed an average basement activity level of 2.07 pCi/L. Therefore, radon concentration does not appear to be an environmental concern for the Sites.

3.4 <u>Asbestos</u>

According to Mr. Copolla during the site reconnaissance, asbestos removal was conducted in 1995 at the Westchester County Department of Social Services building located at 137-145 Alexander Street on the West Site. However, no documentation concerning asbestos was provided at the time of the writing of this report. In addition, there is the potential presence of asbestos containing building materials (ACBM) within the buildings located at 94, 86A, 90, 86 and 80 Alexander Street on the East Site since the buildings were constructed prior to 1978 when the use of asbestos containing building materials was ceased. No testing for asbestos was conducted as part of this ESA.

3.5 Polychlorinated Biphenyls (PCBs)

Fluorescent light ballasts were observed at the time of the Site reconnaissance of the subject buildings. Historically fluorescent light ballasts were made with PCBs until the Toxic Substance Control Act (TSCA) banned the production of PCBs in the United States in 1979. Based upon the fact that the buildings were constructed prior to 1979, it is likely that some fluorescent light ballasts that are currently in place were manufactured with PCBs.

In addition, a utility pole with one transformer mounted thereto was observed installed on the sidewalk in front of the Stanlou Tobacco property listed at 86A Alexander Street. No dead or distressed vegetation as well as other indications of leaks or spills were observed at this utility pole.

3.6 <u>Surrounding Properties</u>

During the Site reconnaissance, PS&S observed the area along Alexander Street and adjacent roadways. Examination of the immediate vicinity indicates that the Sites are predominantly situated adjacent to the Hudson River, commercial and industrial uses along Alexander Street and Metro-North rail road right-of way.

Specifically, the West Site is bounded by: the Hudson River to the west; Excelsior Transparent Bag Corporation to the north; Alexander Street beyond which is the Greyston Bakery to the west; and Ashburton Avenue beyond which is the ATI Tank Farm Site to the south. Supertrans Bus is currently parking buses at the ATI Tank Farm Site.

An air pollution control station was observed from the West Site on the western portion of the adjacent property occupied by Excelsior Transparent Bag Corporation.

The East Site is bounded by: Ashburton Avenue followed by Greyston Bakery (a former MGP site) and the Metro North accessory building to the north; the Metro North rail road right-of-way to the east; Alexander Street followed by mixed commercial and industrial uses to the west; and a vacant commercial use to the south.

In addition, residential and commercial uses were also observed beyond the Metro North rail road right-of-way to the north, west and south. In order to better depict the character of the surrounding area, photographs are included in Appendix A. Most of the residential and commercial buildings appeared to be occupied, with the exception of the vacant store situated adjacent to the subject building that is occupied by PennySaver (i.e., 80 Alexander Street) to the south. It is unclear whether natural gas services all or part of the

surrounding areas. Therefore, a potential exists for the mixed use buildings or residences to have fuel oil USTs or other facilities of potential environmental concern.

PS&S requested available federal, state, county and local regulatory information concerning historical land use and potential environmental issues relating to the Site. The responses received from commercial database report, Federal, State and Local agencies are summarized below.

4.1 <u>Environmental Database Record Research</u>

As part of this Phase I ESA, PS&S reviewed an electronic search of the standard environmental record sources provided by Environmental Data Resources (EDR) of Milford, Connecticut. EDR uses *The EDR-Radius Map with GeoCheck* to identify potential environmental issues at or near the property in accordance with ASTM guidelines. EDR provided technical and regulatory data from multiple sources in accordance with standard practices as defined by ASTM E 1527-05. This process allows the identification of facilities of potential environmental concern at distances commensurate with their potential risk to the Sites.

The specific Federal and State databases searched by EDR are listed below. The complete report package is included in Appendix B.

Federal ASTM Standard

NPL	National Priority List				
Proposed NPL	Proposed National Priority List Sites				
CERCLIS	Comprehensive Environmental Response, Compensation and				
	Liability Information System				
CERCLIS NFRAP	CERCLIS No Further Remedial Action Planned				
CORRACTS	Corrective Action Report				
RECRIS	Resource Conservation and Recovery Information System				
ERNS	Emergency Response Notification System				

Federal ASTM Supplemental

BRS	Biennial Report System			
CONSENT	Superfund (CERCLA) Consent Decrees			
ROD	Records of Decision			
Delisted NPL	National Priority List Deletions			
FINDS	Facility Index System			
HMIRS	Hazardous Materials Information Reporting System			
MLTS	Material Licensing Tracking System			
MINES	Mines Master Index File			
NPL Liens	Federal Superfund Liens			
PADS	PCB Activity Database System			
RAATS	RCRA Administrative Action Tracking System			
TRIS	Toxic Chemical Release Inventory System			
TSCA	Toxic Substances Control Act			
SSTS	Section 7 Tracking Systems			
FTTS	FIFRA/TSCA Tracking System			
FIFRA	Federal Insecticide, Fungicide, & Rodenticide Act/TSCA (Toxic			
	Substances Control Act			

State ASTM Standard

SHWS	Inactive Hazardous Waste Disposal Sites in New York State			
SWF/LF	Solid Waste Facilities/Landfill States Register			
LTANKS	Leaking Storage Tank Incident Reports			
UST	Petroleum Bulk Storage Database			
CBS UST	Chemical Bulk Storage Database			
MOSF	Major Oil Storage Facilities Database			
VCP	Voluntary Cleanup Agreements			
SWTIRE	Registered Waste Tire Storage & Facility List			
SWRCY	Registered Recycling Facility List			

State or Local ASTM Supplemental

HSWDS	Hazardous Substance Waste Disposal Site Inventory				
AST	Petroleum Bulk Storage				
CBS AST	Chemical Bulk Storage Database				
MOSF	Major Oil Storage				
SPILLS	Spills Information Database				
NY Facility and Manifest Data					
Former Manufactured Gas (Coal Gas) Sites					
Indian Reserve	Indian Reservations				

The EDR database report indicates that both Sites are identified on the US Brownfields, RCRA-SQG, ERNS, ICIS, FINDS, RAATS, NYCBS AST, NY MANIFEST, NYSPILLS and NY HIST SPILLS databases. Information related to the Sites is discussed further below.

The EDR database search identified 302 sites within the designated Federal, State and/or Local search radii. These sites are situated within 1.0 mile radius from the Sites and consist of the following:

- One (1) CERCLIS site;
- Three (3) sites identified as RCRA Large Quantity Generators (LQG);
- Sixteen (16) sites identified as RCRA Small Quantity Generators (SQG);
- Eight (8) sites identified in the Emergency Response Notification System records (ERNS);
- Ten (10) US Brownfields properties;
- Three (3) FTTS tracks administrative cases and pesticide enforcement actions and compliance activities pertaining to FIFRA, TSCA and EPCRA over the past five years;
- One (1) site identified on the Integrated Compliance Information System database;
- Ten (10) Facility Index System (FINDS) sites;
- One (1) site listed in the RCRA Administration Action Tracing System (RAATS);

- One (1) site identified as a New Jersey State Hazardous Waste Site (NJSHWS);
- Seventy-seven (77) sites listed as having Leaking Storage Tank Incident Reports (NY LTANKS);
- Forty-eight (48) sites listed as Historic NY LTANKS sites;
- Twenty-one (21) sites with registered Underground Storage Tanks (NY USTs);
- One (1) site identified in the Chemical Bulk Storage Database (NY CBS UST);
- Eleven (11) sites with registered Aboveground Storage Tanks (NY ASTs);
- Two (2) sites identified in the Chemical Bulk Storage Database (NY ASTs);
- One (1) Major Oil Storage Facility (MOSF) site;
- Seventeen (17) NY Manifest sites;
- Thirty-one (31) sites listed on the Spills Information Database (NY SPILLs);
- Twenty-four (24) listed as Historic NY SPILLS sites;
- Eight (8) Voluntary Cleanup Agreement sites (NY VCP);
- Four (4) sites identified on the NY Brownfields site list; and
- Three (3) sites identified as Manufactured Gas Plants.

Sites included on the above database lists are situated within the designated ASTM Radii of the Sites, and sufficiently described to be accurately located by EDR, are also plotted by EDR on area maps (refer to the EDR Radius Report included as Appendix B).

Sites Not Mapped in EDR Report

As part of EDR's State and Local database search, 40 sites did not contain enough address information to be accurately mapped by EDR. Of the 40 sites, 15 are at locations that would not have an adverse impact on the East and West Sites.

Review of the remaining 25 sites indicated that one site is identified as Polychrome Corporation at 94 Alexander Street (East Site) and is listed in the NY UST database. The remaining 24 sites are at locations adjacent to or in the immediate vicinity of the East and West Sites and have the potential to impact the Sites. These adjacent sites are as follows:

- Patclin Chemical Company at 66 Alexander Street is listed in the ICIS database.
- The ATI site is included with the following addresses and databases: 79-81 Alexander Street, RCRA-SQG and NY Manifest; 60 Alexander Street (Supertrans NY, Inc.), NY AST and NY UST; Alexander Street, NY Spills and NY Historical Spills; and 79, 85, 91 and 97 Alexander Street, US Brownfields.
- Excelsior Transparent Bag at 159 Alexander Street, ICIS database and 159, 191 Alexander Street, Block/Lots:2615/18, US Brownfields database.
- Altman Stage Lighting at 57 Alexander Street, ICIS database.
- A total of seven utility manholes, vaults and pole with Alexander Street addresses are listed in the following databases: RCRA-SQG, NY Manifest, NJ Manifest, NY Spills, and NY Historical Spills.
- 110 Alexander Street, Block/Lots:2618/2 listed on the US Brownfields database.
- Neperhan AT at Ashburton listed on the NY Spills database.
- Liberty Lines at 17 Babcock Place, Block/Lots 2620/50 listed on the US Brownfields database.
- Woodworth Avenue and Babcock Place listed on the NY Spills and NY Historic Spills databases.
- Two unnamed sites located at Ashburton and Palisades Avenue listed on the NY Spills, NY Historic Spills databases.

One site identified as A.R.J.R. Trucking is listed with a PO Box address and is listed on the NYSWF/LF database, the exact location of this site is not known.

For further details on the records that could not be mapped by EDR due to inadequate address information, refer to the EDR Report in Appendix B.

Summary of Sites Identified in EDR Report

Subject Sites

Based on a review of the data provided in the EDR Report (Appendix B), the Sun Chemical properties, listed as 137 Alexander Street and 94 Alexander Street are listed on the US Brownfields database. This database is the EPA's registry of Brownfields properties addressed by Cooperative Agreement Recipients and Brownfields properties addressed by Targeted Brownfields Assessments. The recipient name provided in this database is the City of Yonkers with an assessment date of March 31, 2001. The City of Yonkers received an EPA \$200,000 grant and performed the February 2001 Area-Wide Site Assessment Report, on which both Sun Chemical Sites were evaluated (Section 4.2).

In addition, individual property addresses that constitute portions of the Sites were listed on additional State/Local databases and are summarized below.

West Site, 137 Alexander Street – Polychrome Corporation

Examination of the EDR RCRA-SQG database indicates that the West Site (identified as Polychrome Corporation) is classified as a RCRA SQG site (EPA ID NYD001833847) with the owner listed as Sun Chemical Corporation. No TSDF Activities are reported and the violation status shows that although five violations exist, compliance was achieved for each violation.

Review of the EDR FINDS database reveals the West Site is also listed on the Integrated Compliance Information System (ICIS) due to the former storing hazardous materials on the Site. ICIS provides a database that, when complete will include integrated Enforcement and Compliance information throughout most of EPA's programs.

Based on review of the EDR NY Manifest database, the West Site is listed as a NY Manifest site in 1985 for generating 2,585 gallons of unknown material contained in 47 metal drums (barrels).

The West Site is identified on the EDR NYSPILLS and EDR NYHIST SPILLS databases. Based on available information provided in the EDR Report, a diesel surface spill (SPILLS Case Number 8905788) occurred on September 12, 1989 and impacted the Hudson River. This spill incident is reported as closed or in compliance with the State, Federal or local regulations. In addition, on July 23,

1997, a caller reported observing from a helicopter a sheen with an approximate area of sixty-by-forty yards on the Hudson River emanating in the area of Yonkers. This spill incident (SPILLS Case Number 9704871) is reported as closed or in compliance with the State, Federal or local regulations.

Review of the EDR NY Chemical Bulk Storage Aboveground Storage Database reveals the West Site was a registered facility storing hazardous substances listed in 6NYCRR part 597, in aboveground storage tanks with capacities of 185 gallons or greater and/or in underground tanks of any size. Based on available information provided in the EDR Report, this address contained: one 3,000-gallon AST that contained sulfuric acid; one 4,000-gallon AST that contained sulfuric acid and two 4,500 gallon ASTs that contained sodium hydroxide. All of these tanks were reported as closed.

East Site, 2 Ashburton Avenue (a/k/a 94 Alexander Street)

The East Site property listed at 2 Ashburton Avenue is currently identified as 94 Alexander Street and is associated with Block 2608, Lot 37.

Examination of the EDR RCRA-SQG database indicates that 2 Ashburton Avenue, identified as Polychrome Corporation is classified as a RCRA SQG site (EPA ID NYD980236152) with the owner listed as Dainppon Ink and Chemicals. No TSDF Activities are reported and the violation status shows that three violations exist. However, compliance was achieved on each violation.

Review of the EDR FINDS database reveals the East Site address of 2 Ashburton Avenue is listed on the AFS Aerometric Information Retrieval System (AIRS) Facility Subsystem, the New York Facility Information System (FIS), the National Compliance Database (NCDB), the RCRA program database and Toxic Release Inventory System (TRIS), and ICIS databases due to the former use of storing hazardous materials. Review of the EDR FTTS database reveals that thirteen inspections were conducted on the East Site at the 94 Alexander Street address. Based on available information provided in the EDR Radius report; one violation was reported for an AHERA, Enforcement, State Conducted investigation for the reason listed as "neutral scheme, state". The violation date was not reported.

Based on review of the EDR ERNS database, the East Site address of 2 Ashburton Avenue reported two emergency releases of sulfuric acid on April 30, 1987 and on July 22, 1988. In addition, a reported emergency release of an unknown amount of #2 fuel oil into groundwater from a 3,000-gallon underground storage tank occurred on December 15, 1988. According to this document, a NYSDEC representative reported that the tanks were being excavated when fuel oil was discovered on the groundwater table. The outcome of this report is not indicated in the EDR report.

Examination of the EDR ICIS database reveals the East Site received an EFA enforcement action (type: RCRA 3008A AO for comp and/or penalty) on June 29, 1995 (Enforcement Action ID 02-1994-0154).

Review of the EDR NY MANIFEST database reveals the East Site address of 2 Ashburton Avenue is listed as a generator in 1993 of: 750 pounds contained in 5 metal drums (barrels) of waste type #F005 – unknown and 650 gallons contained in 13 metal drums (barrels) of a waste type that was not specified.

This East Site address is also listed on the EDR NYSPILLS and EDR NYHist SPILLS databases. Based on available information provided in the EDR Report, spills of #2 fuel oil; unknown petroleum and sulfuric acid occurred on July 26, 1988, August 3, 1988, December 15, 1998, November 28, 1989, and July 2, 1990 at 2 Ashburton Avenue. These incidences were reported as closed or in compliance with the State, Federal or Local regulations.

Review of the EDR NYSPILLS and NY Hist SPILLS databases indicated that a petroleum spill that impacted the sewer occurred at the East Site address of 80 Alexander Street on April 30, 1987 (Spill Case Number 8700879). Based on information provided in the EDR Report, this spill is reported as closed (or in compliance with State, Federal or local regulations).

Surrounding Properties

Examination of the EDR CERCLIS database indicates there is one active CERCLIS site identified as the Patclin Chemical Corporation, Inc. at 66 Alexander Street in Yonkers, approximately 650 feet south of the Sites. According to the CERCLIS information provided, this property is not on the NPL List and the status is reported as a removal only site. Based on the available information, EPA performed a drum removal action at the Site but no subsurface cleanup work was performed. This site is cross-gradient of the subject Sites with respect to groundwater flow.

There are three RCRA Large Quantity Generator (LQG) sites and fourteen RCRA Small Quantity Generator (SQG) sites identified within approximately 0.375 miles from the Sites. However all of the RCRA LQG sites and two of the fourteen RCRA SQG sites were reported with achieving compliance on reported violations. The remaining RCRA SQG sites were reported with no violations.

Review of the EDR ERNS database indicates there are five ERNS records maintained on A. Tarricone or Alexander Street Terminal (ATI Tank Farm) site, located at 79-91 Alexander Street, adjacent south of the West Site. Based on the available information, including that the Eastern Site is upgradient of ATI with respect to groundwater, this ERNS site is unlikely to have a significant environmental impact on the Eastern Site. However, additional investigation would be necessary to determine if there has been impact from the ATI site to the Western Site. There are seven US Brownfields sites identified within a 0.625 mile radius of the Sites; four of these are US Brownfields sites located upgradient of the Sites with respect to groundwater flow. These sites are identified as Liberty Lines at 59 Babcock Place; Hudson View at 104 Ashburton Avenue; Patclin Chemical at 62 Alexander Street; and Altman Lighting at 57, 65, and 71 Alexander Street in Yonkers.

Patclin Chemical is also identified on the FTTS list with 66 Alexander Street as an address. According to the FTTS report on this facility, of the two inspections conducted, one violation (Docket Number EPCRA-97-2004) was reported for failure to report to the EPA on September 26, 1997. The final order is dated December 7, 1997; however no close date is indicated. Based on the available information, these four facilities are proximate to the Sites and/or situated upgradient or cross-gradient to the Sites with respect to groundwater and said facilities may have the potential to have significant environmental impacts on the Sites.

The EDR Radius report identified one active New Jersey State Hazardous Waste site (NJ SHWS) located within approximately one mile west northwest of the Sites on the west side of the Hudson River. Based on the available information, including the location of the site, this NJ SHWS is unlikely to have a significant environmental impact on the Sites.

There are 21 UST sites, 1 NY CBS UST site, 11 AST sites, and 1 NY CBS AST sites located within 0.375 miles of the Sites. Of these sites, 18 UST sites and 10 AST sites are reported as closed (or in compliance with State, Federal or local regulations).

However, the remaining 3 UST sites, 1 NY CBS UST site, 1 AST site and 1 NY CBS ASTs are also included in the LTanks database. Although these sites were reported as taking corrective action, no close date is indicated. Based on the available information, the Sites are downgradient with respect to groundwater

flow of two of the three UST sites identified as Stevens Paint Corporation at 115 Woodworth Avenue and Former Scott Station at 178 Warburton Avenue as well as 237 Owners Corporation at 237 North Broadway in Yonkers. Therefore, these sites may have the potential to have environmental impacts on the Sites and are also described in the following NY LTanks database summary.

There are 77 NY Leaking Storage Tanks (NY LTanks) sites located within a 0.625 mile radius of the Sites, however, 56 of these sites were reported as closed or in compliance with the State, Federal or Local regulations. Of the remaining NY LTanks sites, 17 LTanks sites are reported with no close date. Ten of these active LTanks sites are located within 0.5 mile of the Sites and are situated potentially upgradient of the Sites in respect to groundwater flow. These sites are identified in Table 2.

TABLE 2 ACTIVE LTANKs SITEs SURROUNDING SITE								
	Identification	Address	Distance/Direction from Sites	Facility ID	Map ID/Page			
1	Excelsior Trans Bag Corp.	159 Alexander St	200± feet /N (adjacent to West Site)	9406513	A18/40			
2	ATI Terminal	91 Alexander St	475± feet /S (adjacent to West Site)	0502798	C38/75			
3	Not Reported	115 Woodworth Ave	670± feet /ENE	9610171	E60/123			
4	Former Scott Station	178 Warburton Ave	900± feet /ENE	0508784	H79/165			
5	Church	26 Willow Place	1,155± feet /ENE	0413255	L91/191			
6	Habitat for Humanity	27 Willow Place	1,160± feet /ENE	0508589	L93/193			
7	Armory	127 North Broadway	1,490± feet /ESE	0306124	N103/217			
8	Williams Home	229 Broadway	1,915± feet /ENE	0511619	R122/260			
9	Not Reported	237 North Broadway	1,970± feet /ENE	9810570	U130/270			
10	St. Johns Park Care Pavilion	2 Park Avenue	2,450± feet /E	0208995	AB153/320			

Based on the available information, these ten active LTanks sites potentially may have significant environmental impacts on the Sites.

In addition, there are 31 NY SPILLs sites located within a 0.25 mile radius of the Sites. However, 1 of these NY SPILLs sites is still active. This active NYSPILLs site is listed as Liberty Lines Express, Inc. located at 59 Babcock Place in Yonkers, approximately 525 feet northeast of the Sites. As indicated in the EDR NY SPILLS database, corrective action was taken for this spill incident, however, no closed date is reported. Based on the available information, including that the Sites are located potentially sidegradient from this NYSPILLs site in respect to groundwater, this NY SPILLS site may have a significant environmental impact on the Sites.

There are 8 NY VCP sites located within a 0.625 mile radius of the Sites. The voluntary remedial program utilizes private funds to have contaminated sites remediated to levels allowing for the sites' productive use and covers any kind of site and contamination. These sites are identified as the ATI site; Con Edison; Habirshaw property; Naval Militia Site "Parcel A"; Yonkers Parcels B and C; 49 North Broadway; 104 Ashburton Avenue; and former Teutonic Hall site. The ATI site is also listed on the NY Brownfields site list. The NY Brownfields site list identifies three other registered NY Brownfields sites within a 0.625 mile radius of the Sites.

A review of the EDR Manufactured Gas Plants database (MGP) reveals there are 3 MGP sites identified as Con Edison within 1.125 miles of the Sites. Two of these sites are potentially sidegradient and upgradient from the Sites in respect to groundwater flow.

EDR Database Summary

Based on review of the data provided in the EDR Report, there are several sites situated sidegradient and upgradient to the Sites that are identified and listed as

closed or in compliance with the State, Federal or Local regulations and therefore have less potential to impact on the environmental quality of the Sites.

Four US Brownfields sites (one of which is also identified as a FTTS site); 10 active LTanks sites; and one active NY Spills site were identified proximate to the Site and/or side or upgradient to the Sites in respect to groundwater flow and may have the potential to environmentally impact subsurface conditions (soil and groundwater) conditions underlying the Sites.

4.2 <u>Hazardous Waste Assessment (February 2001)</u>

A Phase I Hazardous Waste Assessment (HWA) was prepared for the subject property as part of the Alexander Street Waterfront Brownfields Project by Edwards and Kelcey, Inc. in February 2001. Based on review of the Phase I HWA, Edwards and Kelcey, Inc. indicated that the potential for contamination at the Subject Sites was moderate with the following findings:

- The Sun Chemical properties were listed on federal and state database records with past violations that pertain to a history of contamination. As such, the past violations refer to a potential for soil and groundwater contamination.
- The West Site was determined from research, site investigation and interviews to have potential soil and water contamination from historic land uses at the time when the property was classified as a large quantity generator (LQG) of hazardous waste. This site previously was referenced as a small quantity generator (SQG) SQG site.

The Phase I HWA recommended a Phase II Investigation throughout the project area. Reasons provided for the Phase II Investigation included aboveground and underground storage of hazardous substances including the subject Sites.

4.3 <u>Historical Records Review</u>

In order to identify any prior use of the Sites and adjacent properties which could lead to the presence of recognized environmental conditions that may pose an environmental concern on the Sites, a review of historical uses was conducted. This review was conducted utilizing information provided by EDR, specifically, fire insurance maps (Sanborn maps), aerial photographs, city directories, and historic topographic maps which are described below. Freedom of Information Act (FOIA) requests were also submitted to local agencies and are provided below in Appendix C.

4.3.1 Fire Insurance Maps

PS&S requested EDR to perform a review of Sanborn maps that include the Site Area and immediate vicinity. Based upon EDR's search results, PS&S reviewed Sanborn Fire Insurance Maps for the following years: 1886, 1898, 1917, 1942, 1951, 1956, 1957, 1973, 1978, 1989, 1990 and 1991. Copies of the Sanborn Maps provided by EDR are included as Appendix D.

1886 Sanborn Map - Based on review of Sheet Number 13 of the 1886 Sanborn Map, the West Site is not depicted; the East Site is illustrated as situated within the Hudson River waterway and is undeveloped. The New York City and Hudson River Rail Road (NYCHRR) right-of-way borders the future East Site. The Yonkers Gas Light Company's MGP site is located on the north side of Ashburton Avenue, opposite the East Site, and includes: oil tanks, gas holder tanks, a purifying house and other associated structures.

1898 Sanborn Map - Review of the 1898 Sanborn Map shows new development on the Sites and within the surrounding area. The 1898 Sanborn Map shows the addition of fill material along the eastern border of the Hudson River and the construction of new structures and roadways, such as Alexander Street and the western extension of Ashburton Avenue to the Hudson River. Alexander Street extends in a north/south direction from Bridge Place to Ashburton Avenue, respectively. The West Site is comprised of four tracts of land; of which, the western and south-central lots are shown as vacant. The southeastern lot of the West Site includes a single family dwelling, a storage shed and an old shed. The northern lot of this area is occupied by the Barber Asphalt Company and is improved with three structures, i.e., a single-family dwelling, a main building and a structure that is labeled as containing two oil tanks. The main building includes a mixing room, an engineering room, and two storage rooms that include sand drums and production tanks.

Four new businesses occupy the land expansion (filled-in portion of the Hudson River) and front the south side of Ashburton Avenue. These businesses are identified as Archibald Lumber Company, Anchor Brewing Company, Standard Oil Company and Geo Ringler & Company Beer Depot (from west to east). Predominantly, the East Site location was occupied by the: the eastern portion of the Archibald Lumber Company, the Standard Oil Company and Geo Ringler & Company Beer Depot. The NYCHRR right-of-way bounds the Geo Ringler & Company Beer Depot to the east.

In addition, new development is depicted on the Yonkers Gas Light Company property (north side of Ashburton Avenue). Specifically, the parcel located north of the East Site includes: two one-story buildings used for storage; a two-story building that contains a lard oil tank; and a two-story building which is identified as a purifying house. A vacant parcel adjoins Yonkers Gas Light Company to the west and is situated at the northeastern corner of the intersection of Alexander Street and Ashburton Avenue.

1917 Sanborn Map - The 1917 Sanborn Map illustrates the redevelopment of the Sites and new construction within the surrounding area, including the southern extension of Alexander Street beyond Ashburton Avenue and the western extension of Ashburton Avenue to the Hudson River. The storage sheds and single-family dwelling on the southeastern portion of the West Site (as shown on the 1898 Sanborn) were demolished and replaced with six buildings used for shipping and storage purposes associated with the Gwinzburger & Wiell Fat &

Bone Collecting Station. A vacant lot adjoins this parcel to west. The Barber Asphalt Company structures depicted on the 1898 Sanborn Map were demolished and replaced with four buildings and a storage yard associated with the Yerks & Company Lumber and Coal facility. In addition, the Yerks & Company Lumber and Coal facility also occupies the lot that was previously shown as vacant on the 1898 Sanborn Map.

Standard Oil Company of New York and a saloon with an adjoining shed occupy the lot located at the southeast corner of the intersection of Ashburton Avenue and the location of the East Site. Most of the labels depicted on the structures of this portion of the 1917 Sanborn Map are illegible. The Standard Oil Company of New York comprises the eastern portion of the former Archibald Lumber Company and is developed with: six buildings generally used for office space, stock rooms and a wagon house; two approximate 25,000-gallon gasoline storage tanks; one approximate 30,000-gallon gasoline storage tank; and one approximate 60,000 gallon kerosene storage tank. The storage tanks are constructed of iron. A 225-gallon underground storage tank is illustrated on Ashburton Avenue, in front of the Standard Oil Company of New York site.

Located to the south of the Standard Oil Company are a three-story warehouse building, two two-story sheds and a one-story shed utilized by the Pierpont and Vanderveer, Hay, Feed, Flour and Produce.

The Westchester Lighting Company occupies the lot located on the northeast corner of the intersection of Ashburton Avenue and Alexander Street.

The Hudson Fuel Company occupies the lot at the southwest corner of the intersection of Ashburton Avenue and Alexander Street. The main structure of the Hudson Fuel Company is labeled as "Coal Pockets" and is situated adjacent to the Hudson River. This lot is followed by William F. Harrigan Coal and Wood and Hart Construction to the south.

1942 Sanborn Map - The 1942 Sanborn Map illustrates new development on the Sites and within the Surrounding Area. The northern lot of the West Site and the lot adjacent to the north of this lot are occupied by J.A. Mahlstedt Lumber Company with associated structures. In addition, two docks extend from this property in the Hudson River. The southern portion of the West Site is labeled as the Westchester Lighting Company.

On the East Site, the property associated with the Standard Oil Company of New York was modified and expanded to include lots 35 and 37 as well as a lot located on the west side of Alexander Street. With the exception of three buildings, all of the structures, including the above ground tanks that were illustrated in the 1917 Sanborn Map, were removed. Five structures occupy Lot 37; one of which was shown in the 1917 Sanborn Map and was expanded into a garage. Three new tanks constructed of iron are located on the southeastern portion of Lot 37. One small structure is shown on Lot 35.

Two vacant lots are located south of the East Site's Standard Oil Company property and are identified only as City of Yonkers.

The lot located at the southwest corner of the intersection of Alexander Street and Ashburton is occupied by the Hudson Fuel Company. Adjoining to the south is the lot owned by the Standard Oil Company of New York. Eight iron tanks; four of which are contained indoors are depicted on the site. In addition, a pier extends from the western border in the Hudson River.

A vacant lot identified as 123 Locust Hill Avenue, Inc is situated to the south of the Standard Oil Company of New York and followed by the Yonkers-Alpine Ferry, Westchester Ferry Corporation which includes two structures and an associated ferry slip.

1951 Sanborn Map - The 1951 Sanborn Map shows redevelopment on the Sites and within the surrounding area. The West Site previously shown as the Westchester Lighting Company and a vacant lot in the 1942 Sanborn Map is

illustrated as one lot that includes three detached buildings, i.e., a machine shop which is L-shaped, a storage building and an associated structure. The lots located north and adjacent to this area have been redeveloped from a lumber facility to a boat construction and repair facility identified as Arthur G. Blair, Inc. Boat Building. The former Yerks & Company sawing and planning building was converted into a machining shop; the large lumber shed is used as the main boat construction/repair building and adjacent buildings are shown for riggings, tools, and offices. In addition, eight one-story buildings comprised of storage sheds, lumber storage, fabricating sheds, a welding house and riggers shed are illustrated.

The East Site that was formerly occupied by the Standard Oil Company of New York on the 1942 Sanborn Map, is identified as Polychrome Corporation Manufacturing Stencil Paper on the 1951 Sanborn Map. All of the structures (including aboveground tanks) depicted in the 1942 Sanborn Map were removed, except for two buildings. The Polychrome Corporation site includes one mixed use building inclusive of office space, manufacturing space and a boiler room; one building used for stock and two storage buildings. The manufacturing/office building is labeled as built in 1920; the stock building is labeled as built in 1915.

Located south adjacent to the Polychrome Corporation is a one-story building utilized as a Post Office Garage. A one-story building used to store bakery supplies is situated immediately south of the Post Office Garage.

The Hudson Fuel Company occupies the lot located on the southwest corner of the intersection of Ashburton Avenue and Alexander Street. The main structure of the Hudson Fuel Company is labeled as "Coal Pockets". In addition, there are four associated structures labeled as cone coal silos. The Hudson Fuel Company is followed by the Standard Oil Company of New York to the south. Standard Oil Company of New York is developed with five iron tanks, four of which are enclosed by a 12-foot high concrete wall with no openings on any side. The Westchester Ferry Company adjoins the Standard Oil Company to the south. **1956 Sanborn Map** - The 1956 Sanborn Map illustrates new improvements on the Sites and within the surrounding area. Specifically, a new storage building is included on the parcel located at the northwest corner of the Ashburton Avenue and Alexander Street. On the East Site, a storage building on the southern portion of the Polychrome Corporation property was replaced with a large storage warehouse building that fronts Alexander Street. The Hudson Fuel Company includes two garages, one office building, two storage buildings, a structure labeled as Coal Pockets and four cone coal silos.

1957 Sanborn Map - The 1956 Sanborn Map generally illustrates the same structures on the Sites as in the 1956 Sanborn Map. However, two fabricating sheds, welding house and the two storage shed buildings that occupied the boat yard on the West Site were removed. In addition, the structures labeled as containing coal were removed from the lot located on the southwest corner of the intersection of Ashburton Avenue and Alexander Street. This lot was formerly shown as occupied by the Hudson Fuel Company and partially by the Standard Oil Company on the 1956 Sanborn Map. The property on the northeast corner of Ashburton Avenue and Alexander Street is labeled as "parking" and is developed with a small structure that is identified as motor oil storage.

1973 Sanborn Map - The West site is not included on the 1973 Sanborn Map. However, the East Site that is occupied by the Polychrome Corporation is depicted with the same structures as shown in the 1957 map along with six storage buildings (along the eastern border of property) and additional one to three story buildings used as storage and office space on the central portion of the property. The lot located at the southwest corner of the intersection of Alexander Street and Ashburton Avenue is developed with a building with two storage areas (one of which is labeled as paint storage), a garage and a boat club. In addition, three circles are drawn on the southern portion of this lot, possibly to show the future installation of the fuel tanks as shown on the 1978 Sanborn Map.

1978 Sanborn Map - The 1978 Sanborn Map depicts redevelopment on the Sites and within the surrounding area. The structures illustrated on the West Site (as

shown in the 1957 Sanborn Map) were removed. The West Site consists of a twolot land division with two adjoining buildings that front Alexander Street. The southernmost lot is occupied by Polychrome Corporation Lithographic Supplies. The northernmost lot of the West Site is developed as a two-story building. The lot adjacent to the West Site is developed with a two-story manufacturing building.

East Site includes the same structures on the lots occupied by Polychrome Corporation as illustrated on the 1973 Sanborn Map. In addition, the two parcels that were occupied by the Post Office Garage and the Bakery Supplies in the 1951 Sanborn Map are both identified as the Polychrome Corporation in the 1978 Sanborn Map.

On the adjacent properties located on the west side of Alexander Street and opposite the East Site, a building formerly labeled paint storage is now labeled Auto Body Repair, and the Standard Oil Co. property is labeled A. Tarricone Inc. Terminal on the 1978 Sanborn Map. In addition, three steel oil tanks have been installed, west of the Auto Body Repair structure.

The adjacent property north of the West Site shows a new structure, yet the only legible label shows that it was built in 1977. This building is currently occupied by the Excelsior Bags Company.

1989, 1990 and 1991 Sanborn Maps - The 1989, 1990 and 1991 Sanborn Maps depict the same structures on the Sites as depicted in the 1978 Sanborn Map.

Review of the 1989 Sanborn map indicates that the property on the northeast corner of the intersection of Ashburton Avenue and Alexander Street has been redeveloped. Specifically, the motor oil storage building, previously shown on the 1978 Sanborn Map, was removed and a one-story narrow building was constructed on the southeastern portion of this lot. In addition, the western and northwestern portions of this property have been improved to include an entrance ramp onto the Babcock Place Bridge.

4.3.2 Aerial Photograph Record Review

PS&S reviewed historical aerial photographs that include the subject Sites dated March 22, 1954; January 12, 1966; October 29, 1976; March 26, 1984; and April 4, 1994. Copies of these aerial photographs are provided in Appendix E.

The 1954 aerial photograph shows buildings on the Sites as well as on adjacent properties, however, Block 2608, Lots 29 and 35 of the East Site appear to be predominantly vacant. The surrounding properties to the north, east and south appear to be improved with buildings. The Hudson River, Metropolitan Transportation Authority rail road right-of-way, Alexander Street, Ashburton Avenue and arterial roadways are visible.

The 1966 aerial photograph is similar to the 1954 aerial, but shows construction activities on the Sites and new building development in the surrounding area. Specifically, the L-shaped building located on Block 2615, Lot 29 of the West Site depicted on the 1954 aerial photograph was removed and replaced with a larger building that extends approximately 250 feet west from Alexander Street. In addition, a large warehouse was constructed on Block 2608, Lots 29 and 35 of the East Site.

The resolution of the 1976 aerial photograph is very poor; but shows redevelopment on the West Site. Specifically, the building on Block 2615, Lot 29 (as shown on the 1966 aerial photograph) was expanded. Due to poor resolution, examination of other buildings and properties makes it difficult to confirm any redevelopment activity and/or improvements.

The resolution of the 1984 aerial photograph is very poor. The Sites and surrounding properties appear to contain building structures; however, due to poor resolution, examination of these buildings and properties is difficult to verify any redevelopment activity and/or improvements.

The resolution of the 1994 aerial photograph is also very poor; however, the Sites appear similar to the 1976 aerial. In addition, the surrounding properties have been redeveloped and/or improved.

4.3.3 Local Street Directories

PS&S requested a City Directory search and abstract report from EDR for the properties listed at 137-145 Alexander Street (West Site) and 80-94 Alexander Street (East Site) in the City of Yonkers, Westchester County, New York. According to the City Directory coverage that is available for the Sites, the following information was provided on current and past uses from 1991 through 2006:

West Site, 137-145 Alexander Street

- 1991- Address not listed in Research Source
- 1996 and 2001- No Return
- 2006 County of Westchester

East Site, 80 Alexander Street

• 1991, 1996, 2001 and 2006- Addresses not listed in Research Source

East Site, 86 Alexander Street

- 1991 Address not listed in Research Source
- 1996 and 2001 New York's Finest Chocolate Company
- 2001 Strip Mall (3 Occupants)

East Site, 94 Alexander Street

• 1991, 1996, 2001 and 2006- Addresses not listed in Research Source

Appendix F contains a copy of the City Directory search information.

4.3.4 USGS Topographic Maps

PS&S reviewed historical USGS Topographic maps (dated 1897, 1947, 1966, 1979 and 1998) that include the subject site.

Based upon review of the 1904 USGS Historic Topographic Map, the Sites and the majority of the surrounding area contain buildings or structures. In addition, arterial roadways and the New York City and Hudson River rail road right-of-way are visible in the vicinity of the Sites.

Review of the 1947 USGS Historic Topographic map reveals new buildings have been constructed on the Sites and along Alexander Street and Ashburton Avenue. In addition, the surrounding area has been improved with roadways with buildings and/or residences.

Review of the 1966 USGS Historic Topographic Map indicates that new buildings were constructed on the Sites and along Alexander Street and Ashburton Avenue. Moreover, the surrounding area has been developed with additional new roadways, buildings and/or residences.

Examination of the 1979 USGS Historic Topographic Map depicts the Sites as the same as depicted in the 1966 USGS Historic Topographic Map. However, the surrounding area is shown as improved with additional roadways and structures (i.e., buildings and/or residences).

Review of the 1998 USGS Historic Topographic Map depicts the Sites and immediate area with the same structures as depicted in the 1979 USGS Historic Topographic Map.

According to review of the 1904, 1947, 1966, 1979 and 1998 USGS Topographic Maps, the elevation of the Sites have generally remained the same in elevation at approximately 9 feet above mean seal level (msl). Copies of the USGS Historic Topographic Maps are included as Appendix G.

4-23

4.3.5 USEPA Record Review

On November 6, 2006, PS&S completed a Freedom of Information Act request form for access to records the United States Environmental Protection Agency (USEPA) may have pertaining to the Sites. PS&S received a letter, dated November 7, 2006, from Ms. Wanda Calderon, FOIA Specialist of the USEPA – Region 2, in response to PS&S's inquiry. The letter stated that program(s) office(s) that have been assigned to PS&S's request will be responding directly and that the Agency has 20 working days to respond to PS&S's request, except when agreed upon to alternate due date or unusual circumstances exist that would require an extension of time under 5 U.S.C.552 (a)(6)(B).

PS&S received a letter, dated November 14, 2006, from Ms. Leslie H. Paterson, Chief of Resource Management/Cost Recovery Section, Emergency and Remedial Response Division of the USEPA –Region 2, in response to PS&S's inquiry. The letter stated that the branch searched their databases as appropriate to PS&S's request; however, the research conducted revealed that Site are not listed on the CERCLIS or NFRAP lists at the present time.

In addition, on November 27, 2006, PS&S received correspondence via email from Mr. David Abrines of the USEPA pertaining to PS&S's inquiry. The email stated that UIC information regarding an inspection that was done in 1999 at 91 Alexander Street, Yonkers, New York, the Alexander Street Terminal and Rockland Fuel Terminal, however, there were no violations found during this inspection. The facility is archived in the USEPA Kansas City, Missouri Repository Center. Furthermore, the correspondence suggested contacting the Groundwater Compliance Section to obtain information on this file. PS&S is making arrangements to review the documents. Any pertinent information received from the USEPA will be provided under separate cover.

Copies of the correspondences received by the USEPA are included in Appendix C.

4.3.6 NYSDEC Record Review

On November 6, 2006, PS&S completed a Freedom of Information Law request for access to records the New York Department of Environmental Conservation (NYSDEC) may have pertaining to the Sites. PS&S received a letter dated November 9, 2006 from the Region 3 Records Access Office of the NYSDEC regarding PS&S's inquiry. The letter stated that the Region 3 Records Access Office had forwarded PS&S' request to T. Ghiosay of the Spill Prevention & Response and B. More of the Hazardous Materials Programs and that response(s) from the regional program(s) shall be received within 20 days. In addition, 14 spill reports from the NYSDEC Region 3 Spill Prevention & Response Program were enclosed in their response. Review of the available information contained in the 14 spill reports, revealed that ten spills were reported as occurring at the East and West Sites.

Specifically, two spill incidences occurred at 86 Alexander Street (reference Spill Numbers 0007788 and 0007916). Spill Number 0007788 occurred on October 2, 2000 and consisted of a release of an unknown oil which resulted in a sheen on 500 gallons of water in the manhole. Spill Number 0007916 occurred on October 5, 2000 and consisted of a release of unknown material on 200 gallons of water. Compliance was achieved in cleanup standards and closed dates were issued for both spill records.

A spill of unknown petroleum was released into the sewer on April 30, 1987 at Polychrome, located at 80 Alexander Street (Spill Number 8700879). Compliance was achieved in cleanup standards and closed date was issued on May 5, 1987. Please refer to Section 4.0 for information pertaining to Spill Number 8700879 that occurred at 80 Alexander Street (East Site).

Three spill occurrences (Spill numbers 8803623, 9003703 and 9003703) were reported at the Polychrome Plant located at 2 Ashburton Avenue. Spill number 8803623 consisted of an unknown amount of commercial/industrial materials released into the Yonkers sewer. Compliance was achieved in cleanup standards

and a closed date was issued on August 3, 1988. Spill Number 8807603 comprised of an unknown amount of #2 petroleum fuel oil due to a leaking tank. Compliance was achieved in cleanup standards and closed date was issued on November 28, 1989. Spill number 9003703 consisted of a release of 40 gallons of an unknown petroleum product that impacted concrete floor and air. Compliance was achieved in cleanup standards and closed date was issued on July 25, 1990. Please refer to Section 4.0 for information pertaining to Spill Number 8700879 that occurred at 2 Ashburton Avenue (East Site aka 94 Alexander Street).

Two spill occurrences (Spill numbers 8905788 and 9704871) were reported at Polychrome located at 137 Alexander Street. Review of the NYSDEC Spill Report for Spill number 8905788 revealed that Polychrome may have discharged material into sewer line which was corroded. The sewer pipe was replaced and the spill material was reported as lime green paint material. This report was stopped and was issued closed in 1991. Spill Number 9704871 consisted of sheen on the Hudson River and is discussed further in Section 4.0, West Site, 137 Alexander Street – Polychrome Corporation.

One spill occurrences (Spill number 9909858) were reported at Polychrome located at Alexander Street and Ashburton Avenue. Review of the NYSDEC Spill Report for Spill Number 9909858 revealed that Polychrome spilled two pints of an unknown petroleum product on 850 gallons of water in Vault 9915 on November 14, 1999. Compliance was achieved in cleanup standards and closed date was issued on November 17, 1999.

A release of an unknown amount of unknown petroleum product, described as a white milky substance, occurred at the Hudson River storm drain located at Ashburton Avenue and Alexander Street (Spill number 8905053) on August 22, 1989. Remarks included in the report stated that no discharge was noticed at time of the inspection. Compliance was achieved in cleanup standards and closed date was issued on August 23, 1989.

Based on review of the remaining four NYSDEC Spill records, all of these spill incidents occurred at locations adjacent to or in the immediate vicinity of the East and West Sites and have the potential to impact the Sites. The locations of these four NYSDEC Spill incidents are listed below.

- Spill Number 9809331 Vault 9915, Alexander Street and Ashburton Avenue;
- Spill Number 9809335 Jacobellis, Alexander Street and Ashburton Avenue;
- Spill Number 9909857 Vault 6478, Alexander Street and Ashburton Avenue; and
- Spill Number 0202084 Vault 9915, Ashburton Avenue and Alexander Street.

All of the above-referenced spill incidents are reported as closed (or in compliance with the State, Federal or Local regulations).

PS&S received a letter dated November 13, 2006 from Ms. Maryanne O'Conner of the NYSDEC Region 3 Solid and Hazardous Materials program in response to PS&S's request. The letter indicated that records are available for review and/or copying. PS&S is making arrangements to review the documents. Any pertinent information received from the NYSDEC Solid and Hazardous Materials program will be provided under separate cover.

Copies of the correspondences received by the NYSDEC and of the NYSDEC spills records are included in Appendix C.

4.3.7 <u>Westchester County Department of Health</u>

On November 6, 2006, PS&S completed a Freedom of Information Law request for access to records the Westchester County Department of Health may have pertaining to the Sites. PS&S received a letter dated November 13, 2006 from Ms. Mary Landrigan, the Freedom of Information Officer of the Westchester County Department of Health in response to PS&S's inquiry. The letter indicated that PS&S's request was forwarded to the appropriate staff for response and it is expected that PS&S will receive a response from the Westchester County Department of Health by December 6, 2006. On December 12 and December 29, 2006, PS&S requested status of inquiry, however, Mr. Norm Shaw of the Westchester County Department of Health indicated via telephone that records (Reference #742) are in the process of being retrieved by Westchester County Department of Health personnel and PS&S will be contacted at time these archived files are obtained. Any pertinent information received from the Westchester County Department of Health will be forwarded under separate cover.

4.3.8 <u>City of Yonkers Fire Department</u>

On November 6, 2006, PS&S completed a Freedom of Information Law request for access to records the City of Yonkers Fire Department may have pertaining to the Sites. To date, PS&S has not received a response from the City of Yonkers Fire Department. Any pertinent information received from the City of Yonkers Fire Department will be forwarded under separate cover.

4.3.9 City of Yonkers Department of Housing & Buildings

On October 11, 2006, PS&S reviewed available records maintained by the City of Yonkers Department of Housing & Buildings that pertain to the Sites. Examination of these municipal records revealed that although no permits pertaining to the installation, use or removal of any underground storage tank (UST) or aboveground storage tank (AST) were found, a survey of the Sites that was prepared by D.L. French (dated 1966 and revised in 1985) was obtained from the Building Department. Review of this survey indicates that the following twelve underground storage tanks (USTs) are/were located on the East Site:

- Three 3,000-gallon USTs that contained oil, trichlorine, and alcohol; one 2,000-gallon UST that contained castor oil; and one 1,000-gallon UST that contained gasoline are located on the northeastern portion of Lot 37.
- One 5,000-gallon UST that contained fuel oil located on the northwestern portion of Lot 35.
- One 3,000-gallon UST that contained naptha (i.e., a flammable liquid mixture of hydrocarbons distilled from petroleum, coal tar, or natural gas and used as solvents and in making various chemicals) and three former 2,000-gallon USTs are located on the eastern portion of Lot 35.
- Two 1,000-gallon USTs that contained gasoline are located on the western portion of Lot 29. Specifically, one UST is located in the front yard of property currently listed at 86 Alexander Street; the other 1,000-gallon UST is located in the front yard of the property currently listed at 80 Alexander Street.

A copy of this survey is included as Appendix C.

4.3.10 Environmental Lien Search Report

PS&S reviewed an Environmental Lien Search Report prepared by EDR. Based on examination of this report, an environmental lien has not been issued for the Sites nor are there any other Activity and Use Limitations (AULs) for the Sites. A copy of the Environmental Lien Search Report is included as Appendix H.

4.3.11 <u>Title Abstract Report</u>

PS&S received a copy of the Title Report (Reference Title Number 06-33086-W) from the client. A review of the title report dated September 26, 2006, identified SFC Sun, LLC a New York Limited Liability Company as the buyer/borrower of the property and Sun Chemical Corporation is listed as the seller.

In addition, the following information was obtained from the Title Abstract Report for the Sites:

Block 2615, Lots 1 and 29- Polychrome Corporation acquired title by deed from Charlese E. Pearsall & Sons, Inc. dated August 31, 1964 and as recorded on September 4, 1964. Resin Realty Corporation acquired title by deed from Polychrome Realty Corporation dated December 4, 1969 and as recorded on December 23, 1969.

Block 2615, Lot 23 – Resin Realty Corporation acquired title by deed from Polychrome Corporation dated May 22, 1968 and as recorded on June 12 1968.

Block 2608, Lots 35 and 37 – Resin Realty Corporation acquired title by deed from Socony-Vacuum Oil Company, Inc. dated December 19, 1944 and as recorded on December 29, 1944.

Block 2608, Lot 29 – Polychrome Realty Corporation acquired title by deed from Harold T. Garrity dated January 4, 1973 and recorded January 5, 1973, and by deed from Brehm Realty Corp. dated November 15, 1973 and recorded November 21, 1973.

A copy of the Title Abstract Report is included as Appendix I.

PS&S performed a Phase I ESA in general conformance with the scope and limitations of ASTM E-1527-05 issued by the ASTM. Exceptions to or deletions from this practice are described in this Phase I ESA. This assessment has revealed the following recognized environmental conditions in connection with the Sites.

5.1 <u>Recognized Environmental Conditions and Recommendations</u>

- 1. Based on review of a survey prepared by D.L. French (dated 1966 and revised in 1985) that was obtained from the City of Yonkers Department of Housing and Buildings and the February 2001 Phase I Report, the East Site has historically contained hazardous materials and petroleum stored in underground storage tanks (USTs). However, no documentation has been obtained as part of this Phase I ESA to indicate these UST(s) were removed from the East Site. In addition, historic document research revealed evidence of spills on both Sites. Based on the past use of chemicals and petroleum-related materials, it is recommended that further investigation be conducted to determine whether USTs remain on the East Site and to determine the condition of the surrounding soil and groundwater on both Sites. If evidence of impacts to the subsurface environment is identified, then a sampling program should be conducted in accordance with all applicable regulations.
- Subsurface testing is also recommended to be performed on both Sites in accordance with all applicable regulations to address the following soil and groundwater contamination issues:
 - Significant fines were levied by the USEPA against the former operations at the Sites related to Polychrome's storage and handling of hazardous material. As such, an increased potential exists for impacts to underlying soils and groundwater from prior site activities.

- Suspect interior floor drains and exterior trench drains on the East Site were observed during the site reconnaissance. Several small floor drains were located within the vacant building at 86 Alexander Street that was formerly utilized as a vehicle garage for the postal service. Evidence of petroleum staining was observed on the floor and standing liquid within these drains was observed. A floor drain was observed in a loading area of the PennySaver building located at 80 Alexander Street. No evidence of significant staining or spillage was observed in the area near this floor drain. Trench drains were observed within the northern portion of the parking located at 94 Alexander Street. Sediment was observed within the trench drains, and no staining or odors were associated with the trench drain. The outflow destinations of these floor and trench drains were not determined. There is the potential that hazardous materials may have been released and/or disposed into these drains. Verification of the presence of these contaminant materials would require a sampling and analysis program. Research and development work at the R&D facility located at 137-145 Alexander Street likely involved use of chemicals typically associated in the lithographic printing business. In addition. according to the WCDSS personnel, the floor pit located in the southeastern corner of the first floor of this building was reported to lead to stormwater drywells. These floor pits also require further investigation. In the event contamination is found within these floor drains and pits, proper removal of contaminated materials should be performed.
- Due to the proximity of documented and suspected contaminated facilities that are located upgradient and cross-gradient of the Sites in respect to groundwater flow, the migration of off-site contamination via groundwater to beneath the Sites is possible. A subsurface investigation at the property boundary is recommended to determine the condition of the underlying soil and to evaluate the potential presence of off-site contamination. If evidence of impacts to the subsurface environment is identified at the property boundaries, then a supplemental sampling program is recommended to include the installation of groundwater monitoring wells.

- Because the Site buildings were constructed prior to 1978, it is suspected these buildings may contain lead based paint. A Lead Based Paint (LBP) Survey should be conducted prior to any demolition/construction activity to determine the presence or absence of lead based paint.
- 4. It is likely that asbestos containing asbestos containing building materials (ACBM) are located within the buildings since the structures were constructed prior to 1978. An ACBM Survey should be conducted to determine the presence or absence of ACBM. If it is asbestos-containing (greater than one percent), then abatement (repair, enclosure, encapsulation, or removal and disposal) should be supervised by a licensed asbestos contractor in compliance with state and federal regulations.
- 5. Fluorescent light ballasts were observed at the time of the site reconnaissance of the subject buildings. Based upon the fact that the buildings were constructed prior to 1979, it is likely that some fluorescent light ballasts that are currently in place were manufactured with PCBs. It is recommended that in accordance with NYSDEC and appropriate state and federal regulations, replacement and proper disposal of these ballasts be conducted in order to minimize potential concert with their contents.
- 6. The suspected presence of mold was observed in portions of the interior East Site building located at 94 Alexander Street. Prior to demolition, an environmental mold survey with potential sampling should be conducted by a certified Mold Inspector. Typical analytical parameters associated with mold sampling include, but are not limited to, the following: mold, bacteria, mycotoxins, endotoxins, volatile organic compounds, temperature, and relative humidity moisture.

5.2 <u>Results of Phase I Environmental Site Assessment</u>

PS&S performed a Phase I ESA in general conformance with the scope and limitations of ASTM E-1527-05. Exceptions to or deletions from this practice are described in this Phase I ESA. This assessment revealed RECs on the property that may be addressed during recommended Phase II Environmental Site Assessment (Phase II ESA) activities.

6.0 <u>REFERENCES</u>

EDR Radius Map Report, November 2, 2006

City of Yonkers Ordinance and Zoning Map.www.ordinance.com

Phase I Hazardous Waste Assessment (February 2001), Alexander Street Waterfront Brownfields Project, by Edwards and Kelcey, Inc.

7.0 **DISCLAIMERS**

The scope of services performed in execution of this ESA were in general accordance with ASTM E-1527-05 and is subject to the limitations identified in this ESA and noted herein. This ESA is partially based on the conditions existing on the date of PS&S's site reconnaissance. The conclusions presented herein are professional opinions based solely on visual observations of the facility and vicinity, interpretation of information provided to PS&S or reasonably available to PS&S, and the results of limited sampling and analysis. Past conditions were considered on the basis of observations, readily available records, interviews, and recollections.

PS&S does not warrant or guarantee the correctness, completeness, and/or most recent date of the information contained in the environmental record sources and recollections used for this assessment. Such information is the product of independent investigation by parties other than PS&S and/or information maintained by government agencies.

This report is based on current environmental regulations. Future regulatory modifications, agency interpretations, and/or policy changes may affect the compliance status of the subject site, which is the subject of this ESA.

This ESA is not an environmental or compliance audit. This ESA makes no conclusion or recommendation regarding compliance with current regulations. Any references to relevant laws and regulations are not intended to be exhaustive, or to provide legal advice or interpretation. The user should seek legal advice and review the applicable laws and their implications as to overall environmental compliance or to any proposed transaction.

PS&S does not warrant or guarantee the property suitable for any particular purpose or certify the property as clean.

Lead paint, occupational health and safety, asbestos, and radon surveys, receptor analysis, sensitive environment analysis, endangered species analysis or other studies, which require specialized expertise, were not requested or included as part of this project.

7-1

FIGURES

APPENDIX A

Environmental Site Assessment Photographs – April 2006



```
Photograph No. 1
```

View looking northwest onto the Westchester County Department of Social Services (WCDSS) from southeast corner of intersection of Alexander Street and Ashburton Avenue.



Photograph No. 2

View looking south onto eastern perimeter of WCDSS and adjoining properties located on Alexander Street (south of Ashburton Avenue)





```
Photograph No. 3
```

View looking northwest onto dispatching office and associated parking lot located on the western portion of WCDSS property. This area is bounded by the Hudson River to the west (left of photo) and Excelsior Packaging Corp to the north (right of photo).



Photograph No. 4

View of the interior of the dispatcher's office located in the rear parking lot of the WCDSS property.





```
Photograph No. 5
```

View of the southwestern portion of the rear parking lot of the WCDSS property with stormwater outfall location into Hudson River as indicated by fence sign.



Photograph No. 6

View of elevator hydraulic motor and associated maintenance supplies contained in room adjacent to the elevator on the first floor of the WCDSS building.






Photograph No. 7 View of water stain on ceiling tile of an office area located on the first floor of the WCDSS building.



View of oil stains on concrete floor of a mechanical room located in the northeastern portion of the WCDSS building.



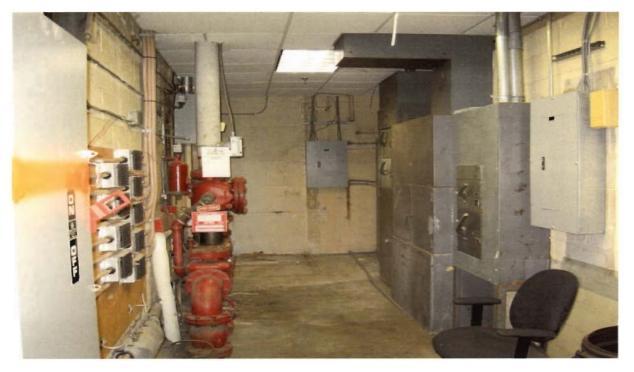

View of a floor access area, water sprinkler main and electrical power switch panels in the mechanical room located in the southeastern portion of the WCDSS building. Apparent water stains are visible on the central portion of concrete floor.




Photograph No. 10

View (from left to right in photo) of Sun Chemical properties located at 94 Alexander Street and 86A Alexander Street from northwest corner of intersection of Alexander Street and Ashburton Avenue.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006



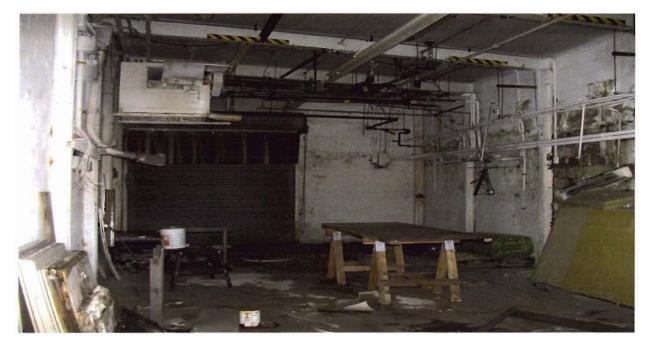

Photograph No. 11 View of northern room of the former Polychrome building located at 94 Alexander Street. Note water stains, peeling paint and mold visible on walls.



Photograph No. 12

View of water stains and cracks within the concrete floor of the northern room of the former Polychrome building located at 94 Alexander Street.






View (from left to right in photo) overlooking Stanlou Wholesale followed the former post office garage and PennySaver building from west side of Alexander Street. building located at 94 Alexander Street.



Photograph No. 14

View of water sprinkler main and associated piping located in the boiler room of the Stanlou Wholesale building.



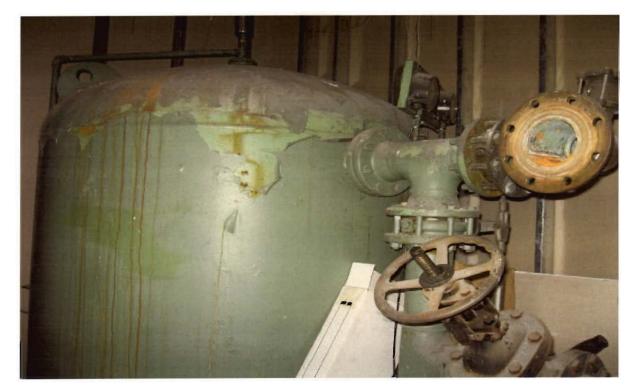

View of an approximate 3,000 gallon boiler that is disconnected and located in the boiler room of the Stanlou Wholesale building.



Photograph No. 16

View of rotary positive gas meter blower located in a mechanical room in the northwestern portion of the Stanlou Wholesale building.





Photograph No. 17 View from west side of Alexander Street looking onto face of property formerly used as a post office garage at 86 Alexander Street.



View facing north onto sidewalk fixtures located on western portion of 86 Alexander Street.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006





View looking southward onto valve cover located on the western portion of the property located at 86 Alexander St.



Photograph No. 20

View of main garage area of 86 Alexander Street from the garage entrance at western side of building.





View of air compressor, water main and floor drain located in the southwestern portion of the building located at 86 Alexander Street.



Photograph No. 22

View of water heaters, electrical panels and entrances to two bathrooms located in the northwestern portion of the building located at 86 Alexander Street.





View of a floor drain with standing water located in the central portion of the building located at 86 Alexander Street.



Photograph No. 24

View of a steam boiler located within the southcentral portion of the building located at 86 Alexander Street.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006





View of southeastern portion of the garage within the building located at 86 Alexander Street.



Photograph No. 26

View of a man hole in the northwestern portion of the garage in the eastern portion of the building listed at 86 Alexander Street.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006





View looking east onto the northern exterior portion of the PennySaver property.



Photograph No. 28

View of propane tanks contained in a metal enclosure and four exposed disconnected pipes within the concrete pad adjacent to the northern wall of the PennySaver building.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006





View facing eastward onto front of the PennySaver building from western perimeter thereof.




Photograph No. 30

View of warehouse storage area and mezzanine located in central portion of the PennySaver building.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006



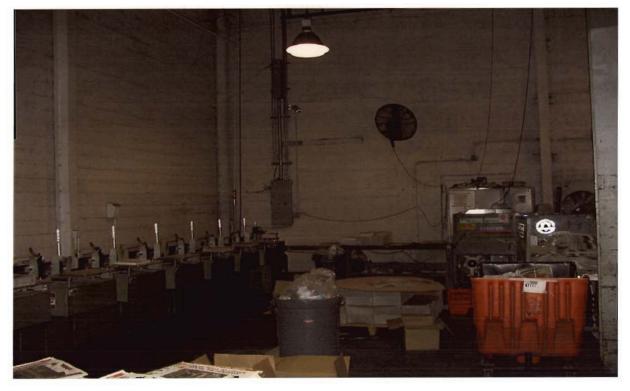

View looking onto one of two newspaper packing areas located in the eastern portion of the PennySaver building.




Photograph No. 32

View of two blowers, one vacuum pump with an air compressor, and associated newspaper packing equipment located in the southeastern corner of PennySaver building.






Photograph No. 33 View of two five-gallon containers of oil transmission oil fluid located in the southeastern portion of the PennySaver building.

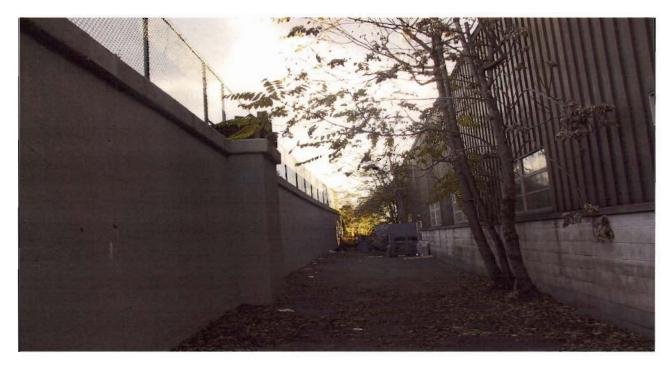

View looking south onto miscellaneous discarded and stored items associated with the PennySaver building on eastern exterior portion of the property. The retaining wall of the Metro North rail road right of way is visible adjacent to this area to the east (left of photo)

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006

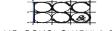



View looking eastward onto paved surface area within the southeastern portion of the PennySaver property.




Photograph No. 36

View looking west onto northern portion of the parking lot and trench drain located at 94 Alexander Street.





View overlooking Greyston Bakery property located at northeast corner of Alexander Street and Ashburton Avenue.

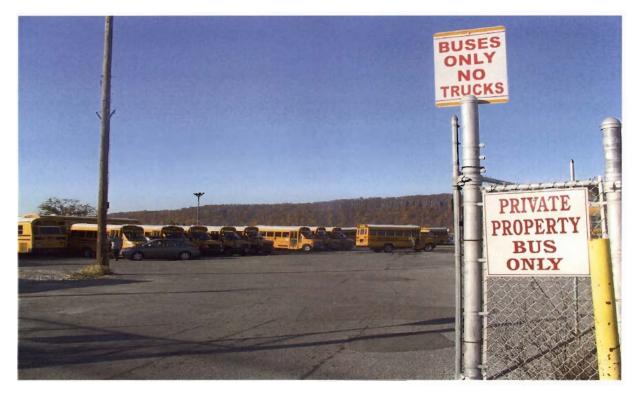

Photograph No. 38

View looking west onto northern portion of the parking lot located at ATI.

Sun Chemical Properties Yonkers, Westchester County, NY DATE: December 2006





View overlooking ATI property from west side of Alexander Street near the PennySaver building.





APPENDIX B

Environmental Database Search (EDR Report)

The EDR Radius Map with GeoCheck[®]

Sun Chemical Corporation Alexander Street/Ashburton Avenue Yonkers, NY 10701

Inquiry Number: 1784877.2s

November 02, 2006

The Standard in Environmental Risk Management Information

EDR[®] Environmental

Data Resources Inc

440 Wheelers Farms Road Milford, Connecticut 06461

Nationwide Customer Service

 Telephone:
 1-800-352-0050

 Fax:
 1-800-231-6802

 Internet:
 www.edrnet.com

TABLE OF CONTENTS

SECTION

PAGE

Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	6
Orphan Summary	408
EPA Waste Codes	EPA-1
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-8
Physical Setting Source Records Searched	A-21

Thank you for your business. Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental St Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

ALEXANDER STREET/ASHBURTON AVENUE YONKERS, NY 10701

COORDINATES

Latitude (North):	40.940600 - 40° 56' 26.2"
Longitude (West):	73.901000 - 73° 54' 3.6"
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	592513.8
UTM Y (Meters):	4532533.0
Elevation:	9 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	40073-H8 YONKERS, NJ
Most Recent Revision:	1998

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following government records. For more information on this property see page 6 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
SUN CHEMICAL 80-94 ALEXANDER STREET, BLOCK/LOTS: 26 YONKERS, NY	US BROWNFIELDS 08/29, 35,3	N/A
SUN CHEMICAL 2 137-145 ALEXANDER STREET, BLOCK/LOTS: YONKERS, NY	US BROWNFIELDS 2615/23 &29	N/A

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

FEDERAL RECORDS

NPL..... National Priority List

Delisted NPL. National Priority List Deletions NPL RECOVERY. Federal Superfund Liens CERC-NFRAP. CERCLIS No Further Remedial Action Planned CORRACTS. Corrective Action Report RCRA-TSDF. Resource Conservation and Recovery Act Information HMIRS. Hazardous Materials Information Reporting System US ENG CONTROLS. Engineering Controls Sites List US INST CONTROL. Sites with Institutional Controls DOD. Department of Defense Sites FUDS. Formerly Used Defense Sites CONSENT. Superfund (CERCLA) Consent Decrees ROD. Records Of Decision UMTRA. Uranium Mill Tailings Sites ODI. Open Dump Inventory TRIS. Toxic Chemical Release Inventory System TSCA. Section 7 Tracking Systems PADS. PCB Activity Database System MLTS. Material Licensing Tracking System MINES. Mines Master Index File
--

STATE AND LOCAL RECORDS

NY SHWS. NY DEL SHWS. NY SWF/LF.	
NY SWRCY	Registered Recycling Facility List
	Registered Waste Tire Storage & Facility List
	Major Oil Storage Facilities Database
	Historical Petroleum Bulk Storage Database
	Historical Petroleum Bulk Storage Database
	Registry of Engineering Controls
	Declaration Environmental Restriction/Deed Notice Sites Registry of Institutional Controls
	Classification Exception Area Sites
	Voluntary Cleanup Program Sites
NY DRYCLEANERS	Registered Drvcleaners
NJ DRYCLEANERS	
NJ BROWNFIELDS	Brownfields Database
	State Pollutant Discharge Elimination System
	New Jersey Pollutant Discharge Elimination System Dischargers
NY AIRS	Air Emissions Data

TRIBAL RECORDS

INDIAN RESERV	Indian Reservations
INDIAN LUST	Leaking Underground Storage Tanks on Indian Land
INDIAN UST	Underground Storage Tanks on Indian Land

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in *bold italics* are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

FEDERAL RECORDS

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 06/19/2006 has revealed that there is 1 CERCLIS site within approximately 0.625 miles of the target property.

Lower Elevation	Address	Dist / Dir	Map ID	Page
PATCLIN CHEMICAL CO INC	66 ALEXANDER ST	0-1/8 S	G56	114

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 3 RCRA-LQG sites within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
EXCELSIOR PACKAGING GROUP YONKERS PUBLIC LIBRARY	159 ALEXANDER ST 38 WELLS AVE	0 - 1/8 NNE 1/4 - 1/2 SSE		56 211
Lower Elevation	Address	Dist / Dir	Map ID	Page
BICC CABLES CORPORATION SITE	FOOT OF POINT ST	1/4 - 1/2N	115	249

RCRAInfo: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store , treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 16 RCRA-SQG sites within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORP	2 ASHBURTON AVE	0 - 1/8 ESE	A7	18
POLYCHROME CORP	137 ALEXANDER ST	0 - 1/8 NNE	A14	34
HUDSON STAGE-KATE&LEOPOLD OTIS	233 ALEXANDER ST	0-1/8 NE	A15	37
C R WARNER INC OF NEW YORK	91 ALEXANDER ST	0-1/8 NE	C26	60
A TARRICONE INC	91 ALEXANDER ST	0-1/8 NE	C27	61
MTA BUS - YONKERS DEPOT	59 BABCOCK PL	0-1/8 NE	E52	105
ALTMAN STAGE LIGHTING	57 ALEXANDER ST	0-1/8 NE	E53	106
STEVENS PAINT CORP	115-119 WOODWORTH AVE	1/8 - 1/4 ENE	E62	131
ALVIN LAST INC	19 BABCOCK PL	1/8 - 1/4 ENE	H72	148
SOUTHERN NEW YORK ENTERPRISES	143-151 WOODWORTH AVE	1/8 - 1/4NE	H77	160
KAWASAKI & NISSHO IWAI	44 WELLS AVE BLDG 9	1/4 - 1/2 S	M96	200
OTIS ELEVATORS CO	44 WELLS AVE	1/4 - 1/2 S	M97	202
PORT AUTH OF NY & NJ - INDUSTR	BUILDING 5 BASEMENT	1/4 - 1/2 S	M98	204
OMS 22HHCIOISIGBN NYARNG	127 N BROADWAY	1/4 - 1/2 ESE	O108	230
WABCO	15 WELLS AVE BLDG 7	1/4 - 1/2 SSE	Q117	252
Lower Elevation	Address	Dist / Dir	Map ID	Page
PATCLIN CHEMICAL CO INC	66 ALEXANDER ST	0-1/8 S	G56	114

ERNS: The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 12/31/2005 has revealed that there are 8 ERNS sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
2 ASHBURTON AVENUE	2 ASHBURTON AVENUE	0 - 1/8 ESE	A9	29
2 ASHBURTON AVE	2 ASHBURTON AVE	0 - 1/8 ESE		29
2 ASHBURTON AVE , POLY CROME F	2 ASHBURTON AVE , POLY	0 - 1/8 ESE		31
Lower Elevation	Address	Dist / Dir	Map ID	Page
A. TERICONE OR ALEXANDER ST TE	A. TERICONE OR ALEXANDE	0 - 1/8 S	B22	53
A.T.I. MAJOR STORAGE TERM 91 A	A.T.I. MAJOR STORAGE TE	0 - 1/8 S	B23	54
ATI	ATI	0 - 1/8 SW	D28	63
ATI	ATI	0 - 1/8 SW	D29	64
ATI	ATI	0 - 1/8 SW	D33	71

US BROWNFIELDS: The EPA's listing of Brownfields properites addressed by Cooperative Agreement Recipients and Brownfields properties addressed by Targeted Brownfields Assessments

A review of the US BROWNFIELDS list, as provided by EDR, and dated 07/10/2006 has revealed that there are 8 US BROWNFIELDS sites within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
LIBERTY LINES BECZAK ENVIRONMENTAL CENTER CITY JAIL YONKERS CITY JAIL HUDSON VIEW GLENWOOD POWER STATION	59 BABCOCK PLACE 35 ALEXANDER STREET, BL 24 ALEXANDER STREET, BL 24 ALEXANDER STREET 104 ASHBURTON AVENUE, B 45 WATER GRANT STREET	0 - 1/8 NE 1/8 - 1/4 ENE 1/8 - 1/4 ENE 1/8 - 1/4 S 1/4 - 1/2 E 1/4 - 1/2 SSW	H67 J89 X148	103 122 141 189 311 329
Lower Elevation PATCLIN ALTMAN	Address 62 ALEXANDER STREET 57,65,71 ALEXANDER STRE	Dist / Dir 0 - 1/8 S 1/8 - 1/4SSW	Map ID B34 88	Page 71 188

FTTS: FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act) over the previous five years. To maintain currency, EDR contacts the Agency on a quarterly basis.

A review of the FTTS list, as provided by EDR, and dated 07/14/2006 has revealed that there are 3 FTTS sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
<i>POLYCHROME CORP</i>	2 ASHBURTON AVE	<i>0 - 1/8 ESE</i>	A7	18
PATCLIN CHEMICAL CO, INC	66 ALEXANDER ST	0 - 1/8 NE	E44	96
PATCLIN CHEMICAL CO INC	66 ALEXANDER STREET	0 - 1/8 NE	E45	97

ICIS: The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

A review of the ICIS list, as provided by EDR, and dated 02/13/2006 has revealed that there is 1 ICIS site within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORPORATION	2 ASHBURTON AVE	0 - 1/8 ESE	A13	34

FINDS: The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 07/21/2006 has revealed that there are 10

FINDS sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORP	2 ASHBURTON AVE	0 - 1/8 ESE	A7	18
POLYCHROME CORP	137 ALEXANDER ST	0 - 1/8 NNE	A14	34
HUDSON STAGE-KATE&LEOPOLD OTIS	233 ALEXANDER ST	0-1/8 NE	A15	37
EXCELSIOR PACKAGING GROUP	159 ALEXANDER ST	0 - 1/8 NNE	C25	56
C R WARNER INC OF NEW YORK	91 ALEXANDER ST	0-1/8 NE	C26	60
A TARRICONE INC	91 ALEXANDER ST	0-1/8 NE	C27	61
FITZPATRICK S AUTO BODY	93 ALEXANDER ST	0 - 1/8 NE	C35	71
MTA BUS - YONKERS DEPOT	59 BABCOCK PL	0-1/8 NE	E52	105
ALTMAN STAGE LIGHTING	57 ALEXANDER ST	0-1/8 NE	E53	106
Lower Elevation	Address	Dist / Dir	Map ID	Page
PATCLIN CHEMICAL CO INC	66 ALEXANDER ST	0-1/8 S	G56	114

RAATS: The RCRA Administration Action Tracking System contains records based on enforcement actions issued under RCRA and pertaining to major violators. It includes administrative and civil actions brought by the United States Environmental Protection Agency. The source of this database is the U.S. EPA.

A review of the RAATS list, as provided by EDR, and dated 04/17/1995 has revealed that there is 1 RAATS site within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORP	137 ALEXANDER ST	0 - 1/8 NNE	A14	34

STATE AND LOCAL RECORDS

NJ SHWS: Known contaminated sites in New Jersey except those associated with Bureau of Underground Storage Sites (BUST)

A review of the NJ SHWS list, as provided by EDR, and dated 08/04/2006 has revealed that there is 1 NJ SHWS site within approximately 1.125 miles of the target property.

Lower Elevation	Address	Dist / Dir Map ID	Page
ALPINE BOAT BASIN & MAINT.YARD Case Status: Active	PALISADE INTERSTATE PAR	1/2 - 1 WNW 191	404

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 07/26/2006 has revealed that there are 77 NY LTANKS sites within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
EXCELSIAR TRANS.BAG CORP. Date Closed: / /	159 ALEXANDER STREET	0 - 1/8 NNE	A18	40
ATI TERMINAL Date Closed: / /	91 ALEXANDER STREET	0 - 1/8 NE	C38	75

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
CITY JAIL Date Closed: 03/19/93	54 ALEXANDER STREET	0 - 1/8 NE	E54	111
Not reported Date Closed: / /	115 WOODWORTH AVE	1/8 - 1/4 <i>ENE</i>	E60	123
CITY JAIL Date Closed: 04/05/93	26 ALEXANDER STREET	1/8 - 1/4ENE	E65	135
YONKERS WATERFRONT DEVEL Date Closed: / /	21 ALEXANDER ST	1/8 - 1/4 <i>ENE</i>	H69	142
FORMER SCOTT STATION Date Closed: / /	178 WARBURTON AVENUE	1/8 - 1/4ENE	H79	165
Not reported Date Closed: 10/12/00	24 ASHBURTON AVE	1/8 - 1/4 <i>E</i>	181	167
DEPAUL BROTHERS Date Closed: 12/02/04 Date Closed: 12/02/93	108 WARBURTON AVE.	1/8 - 1/4SE	K84	172
GAS STATION Date Closed: 04/16/04	104 WARBURTON AVE	1/8 - 1/4SE	K86	183
CHURCH Date Closed: / /	26 WILLOW PLACE	1/8 - 1/4ENE	L91	191
HABITAT FOR HUMANITY Date Closed: / /	27 WILLOW PLACE	1/8 - 1/4ENE	L93	193
PUBLIC SCHOOL #6 Date Closed: 07/30/92	PUBLIC SCHOOL #6	1/8 - 1/4 <i>E</i>	95	197
COMMUNITY BAPTIST CHURCH Date Closed: 04/30/05 Date Closed: 05/12/06	156 NORTH BROADWAY	1/4 - 1/2ESE	N102	213
APT BUILDING Date Closed: 11/30/99	153-155 NORTH BROADWAY	1/4 - 1/2ESE	N103	217
ARMORY Date Closed: / /	127 NORTH BROADWAY	1/4 - 1/2ESE	O106	226
DIV.OF MILIT.& NAVAL AFF. Date Closed: 03/10/92	QUINCY PLACE OFF RT.9	1/4 - 1/2SE	O109	230
+ Date Closed: 03/05/05	87 NORTH BROADWAY	1/4 - 1/2SE	111	234
RESIDENTS Date Closed: 04/06/99	199 NORTH BROADWAY	1/4 - 1/2 E	P118	254
WILLIAMS HOME Date Closed: / /	229 NORTH BROADWAY	1/4 - 1/2ENE	R122	260
CLEAN SWEEP INC Date Closed: 08/17/04	282 WARBURTON AVE	1/4 - 1/2NNE	S125	266
RESIDENCE Date Closed: / /	282 WARBURTAN AVE	1/4 - 1/2NNE	S126	267
NYS OFFICE OF PUBLIC REC Date Closed: 05/03/05	29 WARBURTON AVE	1/4 - 1/2SSE	T129	270
Not reported Date Closed: / /	237 NORTH BROADWAY	1/4 - 1/2 <i>ENE</i>	U130	271
APARTMENT Date Closed: 03/16/06	250 NORTH BROADWAY	1/4 - 1/2ENE	U133	276

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
ATI TERMINAL Date Closed: 02/14/06	ALEXANDER STREET	1/4 - 1/2 SSE	W135	278
UNK,REF TO WCHD Date Closed: 11/28/89	245 NORTH BROADWAY	1/4 - 1/2 ENE	U136	284
ABANDON GAS STATION Date Closed: / /	290 WARBURTON AVE	1/4 - 1/2NNE	S137	287
METRO NORTH Date Closed: 01/15/91	BUENA VISTA STREET	1/4 - 1/2 S	V138	288
Not reported Date Closed: 03/03/03	190 PALASADE AVE	1/4 - 1/2 ESE	X139	290
Not reported Date Closed: 03/23/04	16-18 WARBURTON AVE	1/4 - 1/2SSE	W140	293
Not reported Date Closed: 01/16/02	86 MAIN ST	1/4 - 1/2 S	V141	294
Not reported Date Closed: 07/20/00	265 NORTH BROADWAY	1/4 - 1/2 ENE	142	297
METRO NORTH Date Closed: 05/02/88	BUEANA VISTA AVE	1/4 - 1/2 SSW	V143	299
RESIDENCE Date Closed: 12/10/97	30 LOCUST HILL	1/4 - 1/2 SE	144	302
DAN BERNSTEINE CO. Date Closed: 05/10/04	47 MAIN STREET	1/4 - 1/2 S	Y145	305
NYNEX Date Closed: 02/10/92	40 MAIN ST.	1/4 - 1/2 S	Y146	307
PBS Date Closed: 08/03/05	25 NORTH BROADWAY	1/4 - 1/2SSE	147	310
APT. BUILDING Date Closed: 11/12/97	287 PALLISADES AVE	1/4 - 1/2 ENE	AA151	313
YONKERS GENERAL HOSPITAL Date Closed: 11/30/89	2 PARK AVENUE	1/4 - 1/2 E	AB152	315
ST JOHNS PARK CARE PAVILL Date Closed: / / Date Closed: / /	2 PARK AVE	1/4 - 1/2E	AB153	320
CITY OF YONKERS Date Closed: 11/23/01	55-57 HUDSON ST	1/4 - 1/2 S	Z154	324
APPMAN APT COMPLEX Date Closed: 01/06/89	290 PALISADE AVE	1/4 - 1/2 ENE	AA155	326
GLENWOOD GARDENS Date Closed: 01/17/01	95-117 RAVINE AVE	1/4 - 1/2 NNE	AC158	330
95 RAVINE AVE Date Closed: 03/03/03	95 RAVINE AVE	1/4 - 1/2 NNE	AC159	335
ROADWAY Date Closed: 01/22/05	23 HUDSON STREET	1/4 - 1/2S	160	337
CRYSTAL TRANSPORTATION Date Closed: 12/11/03	127 ASHBURTON AVE	1/2 - 1 E	AB161	338
FAMILY MULTI USE BUILDING Date Closed: / /	45 PALISADE AVE	1/2 - 1 SE	AD162	340

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
APT BUILDING Date Closed: / /	20 SOUTH BROADWAY	1/2 - 1 SSE	AE163	341
NATIONAL WEST MINISTER BK Date Closed: 04/17/05	20 S. BROADWAY	1/2 - 1 SSE	AE164	342
APT. BUILDING Date Closed: 02/05/04 Date Closed: 01/20/95	324 NORTH BROADWAY	1/2 - 1 NE	165	345
MOBIL Date Closed: 02/18/88	60 ELIRA / SCHOOL ST	1/2 - 1 SSE	AD166	352
ENGINE #1 YONKERS FD Date Closed: 07/25/90	5-7 NEW SCHOOL STREET	1/2 - 1 SE	AD167	354
YONKERS FIRE ENGINE CO.#1 Date Closed: 03/08/90	5-7 NEW SCHOOL STREET	1/2 - 1 SE	AD168	357
APARTMENT BLDG. Date Closed: 05/16/05	292 WOODWORTH AVE.	1/2 - 1 NNE	AF169	359
OFFICE BUILDING Date Closed: 08/17/92 Date Closed: 08/07/97	30 SOUTH BROADWAY	1/2 - 1 SSE	AE170	362
CO-OP BLDG Date Closed: 04/21/93	332 PALISADES AVE.	1/2 - 1 NE	171	368
Not reported Date Closed: / /	140 RAVENA AV	1/2 - 1 NNE	172	370
APARTMENT BUILDING Date Closed: 02/04/03	127-129 NEW MAIN STREET	1/2 - 1 SSE	173	373
YONKERS CITY HALL Date Closed: 02/07/91	40 SOUTH BROADWAY	1/2 - 1 S	AG174	374
YONKERS CITY HALL BLDG Date Closed: 10/12/88	40 SOUTH BROADWAY	1/2 - 1 S	AG175	377
YONKERS COMMUNITY CENTER Date Closed: 05/10/06	164 ASHBURTON AVE	1/2 - 1 E	AH176	379
APT HOUSE Date Closed: 10/07/02	7 JONES PL	1/2 - 1 E	AH178	382
RESIDENTS Date Closed: 04/28/04	3 JONES PLACE	1/2 - 1 E	AH179	383
RESIDENCE Date Closed: 11/07/96	312 WOODWORTH AVE	1/2 - 1 NNE	AF180	384
Not reported Date Closed: 11/07/96	312 WOODWORTH AVE	1/2 - 1 NNE	AF181	387
POLICE DEPT. HDQTR.GARAGE Date Closed: 12/16/91	10 ST.CASAMIT AVE.	1/2 - 1 SE	AI182	389
Not reported Date Closed: / /	149 GLENWOOD AVE	1/2 - 1 NE	AJ183	392
COSTA HOME Date Closed: 09/13/05	15 HUDSONVIEW TERRACE	1/2 - 1 NE	184	393
REAL ESATE TRANSACTION Date Closed: / /	59 GLENWOOD AVE	1/2 - 1 NNE	AK185	394
RASO HOME Date Closed: 06/16/06	379 WARBURTON AVE	1/2 - 1 NNE	AK186	396

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
MOBIL Date Closed: 02/11/88	60 ELM ST.	1/2 - 1 SE	AI187	397
Not reported Date Closed: 05/14/04	168 GLENWOOD AVE	1/2 - 1 NE	AJ188	400
383 WARBURTON AV Date Closed: / /	383 WARBURTON AVE	1/2 - 1 NNE	AK189	401
Lower Elevation	Address			Dawa
Lower Lievation	Address	Dist / Dir	Map ID	Page
ATI S/S (FORMER) Date Closed: 12/06/93	CROSS COUNTY MALL	0 - 1/8 SW	<u>Мар ID</u> D31	Page 66
ATI S/S (FORMER)			D31	

NY HIST LTANKS: A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database.

A review of the NY HIST LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there are 48 NY HIST LTANKS sites within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
EXCELSIAR TRANS.BAG CORP.	159 ALEXANDER STREET	0 - 1/8 NNE	A18	40
CITY JAIL	54 ALEXANDER STREET	0-1/8 NE	E54	111
Not reported	115 WOODWORTH AVE	1/8 - 1/4 <i>ENE</i>	E60	123
CITY JAIL	26 ALEXANDER STREET	1/8 - 1/4 <i>ENE</i>	E65	135
YONKERS WATERFRONT DEVEL	21 ALEXANDER ST	1/8 - 1/4 <i>ENE</i>	H69	142
Not reported	24 ASHBURTON AVE	1/8 - 1/4 <i>E</i>	I81	167
DEPAUL BROTHERS	108 WARBURTON AVE.	1/8 - 1/4SE	K84	172
GAS STATION	104 WARBURTON AVE	1/8 - 1/4SE	K86	183
PUBLIC SCHOOL #6	PUBLIC SCHOOL #6	1/8 - 1/4 <i>E</i>	95	197
APT BUILDING	153-155 NORTH BROADWAY	1/4 - 1/2 ESE	N103	217
DIV.OF MILIT.& NAVAL AFF.	QUINCY PLACE OFF RT.9	1/4 - 1/2 SE	O109	230
RESIDENTS	199 NORTH BROADWAY	1/4 - 1/2 E	P118	254
Not reported	237 NORTH BROADWAY	1/4 - 1/2 ENE	U130	271
ATI TERMINAL	ALEXANDER STREET	1/4 - 1/2 SSE	W135	278
UNK,REF TO WCHD	245 NORTH BROADWAY	1/4 - 1/2 ENE	U136	284
METRO NORTH	BUENA VISTA STREET	1/4 - 1/2 S	V138	288
Not reported	190 PALASADE AVE	1/4 - 1/2 ESE	X139	290
Not reported	86 MAIN ST	1/4 - 1/2 S	V141	294
Not reported	265 NORTH BROADWAY	1/4 - 1/2 ENE	142	297
METRO NORTH	BUEANA VISTA AVE	1/4 - 1/2SSW	V143	299
RESIDENCE	30 LOCUST HILL	1/4 - 1/2 SE	144	302
DAN BERNSTEINE CO.	47 MAIN STREET	1/4 - 1/2 S	Y145	305
NYNEX	40 MAIN ST.	1/4 - 1/2 S	Y146	307
APT. BUILDING	287 PALLISADES AVE	1/4 - 1/2 ENE	AA151	313
YONKERS GENERAL HOSPITAL	2 PARK AVENUE	1/4 - 1/2 <i>E</i>	AB152	315

Equal/Higher Elevation

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
CITY OF YONKERS	55-57 HUDSON ST	1/4 - 1/2 S	Z154	324
APPMAN APT COMPLEX	290 PALISADE AVE	1/4 - 1/2 ENE	AA155	326
GLENWOOD GARDENS	95-117 RAVINE AVE	1/4 - 1/2 NNE	AC158	330
95 RAVINE AVE	95 RAVINE AVE	1/4 - 1/2NNE	AC159	335
NATIONAL WEST MINISTER BK	20 S. BROADWAY	1/2 - 1 SSE	AE164	342
APT. BUILDING	324 NORTH BROADWAY	1/2 - 1 NE	165	345
MOBIL	60 ELIRA / SCHOOL ST	1/2 - 1 SSE	AD166	352
ENGINE #1 YONKERS FD	5-7 NEW SCHOOL STREET	1/2 - 1 SE	AD167	354
YONKERS FIRE ENGINE CO.#1	5-7 NEW SCHOOL STREET	1/2 - 1 SE	AD168	357
APARTMENT BLDG.	292 WOODWORTH AVE.	1/2 - 1 NNE	AF169	359
OFFICE BUILDING	30 SOUTH BROADWAY	1/2 - 1 SSE	AE170	362
CO-OP BLDG	332 PALISADES AVE.	1/2 - 1 NE	171	368
Not reported	140 RAVENA AV	1/2 - 1 NNE	172	370
YONKERS CITY HALL	40 SOUTH BROADWAY	1/2 - 1 S	AG174	374
YONKERS CITY HALL BLDG	40 SOUTH BROADWAY	1/2 - 1 S	AG175	377
LENDEGGER	28 GROVE ST	1/2 - 1 NNE	177	380
RESIDENCE	312 WOODWORTH AVE	1/2 - 1 NNE	AF180	384
Not reported	312 WOODWORTH AVE	1/2 - 1 NNE	AF181	387
POLICE DEPT. HDQTR.GARAGE	10 ST.CASAMIT AVE.	1/2 - 1 SE	AI182	389
MOBIL	60 ELM ST.	1/2 - 1 SE	AI187	397
383 WARBURTON AV	383 WARBURTON AVE	1/2 - 1 NNE	AK189	401
Lower Elevation	Address	Dist / Dir	Map ID	Page
ATI S/S (FORMER)	CROSS COUNTY MALL	0-1/8 SW	D31	66
SUPER TRANS	60 ALEXANDER ST	1/8 - 1/4SSW	G57	118

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, and dated 06/14/2006 has revealed that there are 21 NY UST sites within approximately 0.375 miles of the target property.

Address	Dist / Dir	Map ID	Page
159 ALEXANDER STREET	0 - 1/8 NNE	A19	43
59 BABCOCK PLACE	0 - 1/8 NE	E50	104
115-119 WOODWORTH AVENU	1/8 - 1/4 ENE	E61	125
21 ALEXANDER STREET	1/8 - 1/4 ENE	H70	145
19 ALEXANDER STREET	1/8 - 1/4 <i>ENE</i>	H73	149
178 WARBURTON AVE.	1/8 - 1/4 ENE	H78	161
108 WARBURTON AVENUE	1/8 - 1/4 SE	K85	176
33 ASHBURTON AVENUE	1/8 - 1/4 ESE	190	189
38 WELLS AVENUE	1/4 - 1/2SSE	M100	206
156 NORTH BROADWAY	1/4 - 1/2 ESE	N102	213
153-155 NORTH BROADWAY	1/4 - 1/2ESE	N104	219
127 NORTH BROADWAY	1/4 - 1/2ESE	O107	228
190 NORTH BROADWAY	1/4 - 1/2E	P110	233
200 SOUTH BROADWAY	1/4 - 1/2E	P114	241
28 LAMARTINE TERRACE	1/4 - 1/2NE	116	251
222-250 NORTH BROADWAY	1/4 - 1/2ENE	R119	256
115 LOCUST HILL AVE.	1/4 - 1/2ESE	120	258
229 NORTH BROADWAY	1/4 - 1/2ENE	R123	262
282 WARBURTON AVENUE	1/4 - 1/2 NNE	S124	263
	159 ALEXANDER STREET 59 BABCOCK PLACE 115-119 WOODWORTH AVENU 21 ALEXANDER STREET 19 ALEXANDER STREET 178 WARBURTON AVE. 108 WARBURTON AVENUE 33 ASHBURTON AVENUE 33 ASHBURTON AVENUE 38 WELLS AVENUE 156 NORTH BROADWAY 153-155 NORTH BROADWAY 127 NORTH BROADWAY 190 NORTH BROADWAY 200 SOUTH BROADWAY 200 SOUTH BROADWAY 28 LAMARTINE TERRACE 222-250 NORTH BROADWAY 115 LOCUST HILL AVE. 229 NORTH BROADWAY	159 ALEXANDER STREET 0 - 1/8 NNE 59 BABCOCK PLACE 0 - 1/8 NE 115-119 WOODWORTH AVENU 1/8 - 1/4 ENE 21 ALEXANDER STREET 1/8 - 1/4 ENE 19 ALEXANDER STREET 1/8 - 1/4 ENE 178 WARBURTON AVE. 1/8 - 1/4 ENE 108 WARBURTON AVE. 1/8 - 1/4 ENE 108 WARBURTON AVE. 1/8 - 1/4 ENE 108 WARBURTON AVENUE 1/8 - 1/4 ESE 33 ASHBURTON AVENUE 1/8 - 1/4 ESE 38 WELLS AVENUE 1/4 - 1/2 ESE 153 - 155 NORTH BROADWAY 1/4 - 1/2 ESE 190 NORTH BROADWAY 1/4 - 1/2 ESE 200 SOUTH BROADWAY 1/4 - 1/2 ESE 210 NORTH BROADWAY 1/4 - 1/2 ENE 229 NORTH BROADWAY 1/4 -	159 ALEXANDER STREET 0 - 1/8 NNE A19 59 BABCOCK PLACE 0 - 1/8 NE E50 115-119 WOODWORTH AVENU 1/8 - 1/4 ENE E61 21 ALEXANDER STREET 1/8 - 1/4 ENE H70 19 ALEXANDER STREET 1/8 - 1/4 ENE H73 178 WARBURTON AVE. 1/8 - 1/4 ENE H73 178 WARBURTON AVE. 1/8 - 1/4 ENE H78 108 WARBURTON AVENUE 1/8 - 1/4 ENE H78 108 WARBURTON AVENUE 1/8 - 1/4 ESE I90 38 WELLS AVENUE 1/4 - 1/2 SSE M100 156 NORTH BROADWAY 1/4 - 1/2 ESE N102 153-155 NORTH BROADWAY 1/4 - 1/2 ESE 0107 190 NORTH BROADWAY 1/4 - 1/2 ESE 0107 190 NORTH BROADWAY 1/4 - 1/2 ENE R110 200 SOUTH BROADWAY 1/4 - 1/2 ENE R119 115 LOCUST HILL AVE. 1/4 - 1/2 ENE R119 115 LOCUST HILL AVE. 1/4 - 1/2 ENE R119 1229 NORTH BROADWAY 1/4 - 1/2 ENE R123

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
PHILIPSE MANOR HALL STATE HIST	29 WARBURTON AVENUE	1/4 - 1/2SSE	T128	269
Lower Elevation	Address	Dist / Dir	Map ID	Page

NY CBS UST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS UST list, as provided by EDR, and dated 01/01/2002 has revealed that there is 1 NY CBS UST site within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
STEVENS PAINT CORP/INSL-X PROD	115 WOODWORTH AVENUE	1/8 - 1/4ENE	E63	133

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, and dated 06/14/2006 has revealed that there are 11 NY AST sites within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
YONKERS DEPOT	59 BABCOCK PLACE	0 - 1/8 NE	E46	97
NORTH YONKERS PUMP STATION-WCD	19 ALEXANDER STREET	1/8 - 1/4 ENE	H73	149
ELLADOR REALTY	156-58 WOODWORTH AVENUE	1/8 - 1/4 NE	83	171
149 BROADWAY REALTY CORP	149 NORTH BROADWAY	1/4 - 1/2ESE	N99	205
T.K.O. REALTY CORP.	153-155 NORTH BROADWAY	1/4 - 1/2ESE	N105	223
INDUSTRIAL PARK AT YONKERS	28 WELLS AVENUE	1/4 - 1/2SSE	Q112	235
H.V.N.H. REGENCY EXTENDED CARE	65 ASHBURTON AVENUE	1/4 - 1/2ESE	N113	240
GREYSTON FOUNDATION, INC.	55-57 RAVINE AVENUE	1/4 - 1/2NNE	121	259
V & T AUTO REPAIR	282 WARBURTON AVENUE	1/4 - 1/2NNE	S124	263
237 OWNERS CORP	237 NORTH BROADWAY	1/4 - 1/2ENE	U131	274
DIBBINI REALTY, INC.	64 LOCUST HILL AVENUE	1/4 - 1/2SE	132	275

NY CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 2 NY CBS AST sites within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORP.	137 ALEXANDER STREET	0 - 1/8 NNE		46
STEVENS PAINT CORP/INSL-X PROD	115 WOODWORTH AVENUE	1/8 - 1/4 ENE		133

NY MOSF AST: Major Oil Storage Facilities Database. Facilities are licensed pursuant to Article 12 of the Navigation Law, 6 NYCRR Part 610 and 17 NYCRR Part 30. These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater. Includes MOSF's licensed or closed since April 1, 1986, (responsibility was transferred from DOT on October 13, 1985) plus available data obtained from DOT facilities licensed since Article 12 became law on April 1, 1978.

A review of the NY MOSF AST list, as provided by EDR, and dated 01/01/2002 has revealed that there is 1 NY MOSF AST site within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
A.TARRICONE INC.	91 ALEXANDER ST.	0-1/8 NE	C39	78

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 08/01/2006 has revealed that there are 17 NY MANIFEST sites within approximately 0.375 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
POLYCHROME CORP	2 ASHBURTON AVE	0 - 1/8 ESE	A7	18
POLYCHROME CORP	137 ALEXANDER ST	0 - 1/8 NNE	A14	34
HUDSON STAGE-KATE&LEOPOLD OTIS	233 ALEXANDER ST	0-1/8 NE	A15	37
EXCELSIOR PACKAGING GROUP	159 ALEXANDER ST	0 - 1/8 NNE	C25	56
C R WARNER INC OF NEW YORK	91 ALEXANDER ST	0-1/8 NE	C26	60
A TARRICONE INC	91 ALEXANDER ST	0-1/8 NE	C27	61
ALTMAN STAGE LIGHTING	57 ALEXANDER ST	0-1/8 NE	E53	106
STEVENS PAINT CORP	115-119 WOODWORTH AVE	1/8 - 1/4 ENE	E62	131
ALVIN LAST INC	19 BABCOCK PL	1/8 - 1/4 ENE	H72	148
SOUTHERN NEW YORK ENTERPRISES	143-151 WOODWORTH AVE	1/8 - 1/4NE	H77	160
KAWASAKI & NISSHO IWAI	44 WELLS AVE BLDG 9	1/4 - 1/2 S	M96	200
OTIS ELEVATORS CO	44 WELLS AVE	1/4 - 1/2 S	M97	202
PORT AUTH OF NY & NJ - INDUSTR	BUILDING 5 BASEMENT	1/4 - 1/2 S	M98	204
YONKERS PUBLIC LIBRARY	38 WELLS AVE	1/4 - 1/2 SSE	M101	211
WABCO	15 WELLS AVE BLDG 7	1/4 - 1/2 SSE	Q117	252
Lower Elevation	Address	Dist / Dir	Map ID	Page
PATCLIN CHEMICAL CO INC BICC CABLES CORPORATION SITE	66 ALEXANDER ST FOOT OF POINT ST	0 - 1/8 S 1/4 - 1/2N	G56 115	114 249

NY SPILLS: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 07/26/2006 has revealed that there are 31 NY Spills sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
VAULT #6478 Date Closed: 11/07/02 Date Closed: 11/17/99	ALEXANDER ST/ASHBURTON	0 - 1/8	A3	6
POLY CHROME CORP Date Closed: 11/17/99	ALEXANDER ST/ASHBURTON	0 - 1/8	A4	11

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
HUDSON RIVER STORM DRAIN Date Closed: 08/23/89	ASHBURTON / ALEXANDER	0-1/8 ESE	A5	13
MANHOLE #7755 Date Closed: 06/30/99	ALEXANDER / ASHBURTON	0 - 1/8 ESE	A6	16
POLYCHROME CORP Date Closed: 11/28/89	2 ASHBURTON AVE	0 - 1/8 ESE	A7	18
POLYCHROME INC. Date Closed: 07/25/90	2 ASHBURTON AVE.	0 - 1/8 ESE	A10	29
POLY CHROME PLANT Date Closed: 08/03/88	2 ASHBURTON AVE.	0 - 1/8 ESE	A12	32
ON THE STREET Date Closed: 02/17/04	233 ALEXANDER ST	0 - 1/8 NE	A16	38
EXCELSIOR PACKAGING GROUP Date Closed: 12/10/04	159 ALEXANDER ST	0 - 1/8 NNE	A17	39
Not reported Date Closed: 03/11/91	137 ALEXANDER ST.	0 - 1/8 NNE	A20	44
POLYCHROME CORP. Date Closed: 07/24/97	137 ALEXANDER STREET	0 - 1/8 NNE	A21	46
ATI, YONKER Date Closed: 11/28/89	91 ALWXEANDER ST	0 - 1/8 NNE	C24	54
ATI MOSF Date Closed: 02/14/06	91 ALEXANDER ST	0-1/8 NE	C36	71
ATI TERMINAL Date Closed: 02/14/06	91 ALEXANDER STREET	0 - 1/8 NE	C38	75
A.TARRICONE INC. Date Closed: 02/12/05 Date Closed: 01/25/87	91 ALEXANDER ST.	0-1/8 NE	C39	78
VS 6478 Date Closed: 10/05/00	86 ALEXANDER ST	0 - 1/8 NE	C40	88
VAULT 9915 Date Closed: 10/03/00	86 ALEXANDER ST	0 - 1/8 NE	C41	90
POLY-CHROME Date Closed: 05/07/87	80 ALEXANDER ST	0 - 1/8 NE	C42	92
PATCLIN CHEMICAL COMPANY Date Closed: 06/12/00	66 ALEXANDER ST	0 - 1/8 NE	E43	94
LIBERTY LINES EXPRESS INC Date Closed: / / Date Closed: 04/27/05	59 BABCOCK PLACE	0 - 1/8 NE	E47	101
CITY JAIL Date Closed: 12/27/05	26 ALEXANDER STREET	1/8 - 1/4ENE	E65	135
ASHBURTON & WAHBURTON AVE Date Closed: 09/11/91	ASHBURTON / WAHBURTON	1/8 - 1/4ESE	F66	139
SEWER LINE CONSTR. SITE Date Closed: 12/18/90	ASHBURNTANT AVE/WOODWOI	R 1/8 - 1/4E	F71	146
Not reported Date Closed: 04/29/04	WARBURTON/ASHBURTON	1/8 - 1/4E	F74	155
RESIDENTS Date Closed: 10/12/00	150 WARBURTON AVE	1/8 - 1/4ESE	F75	156

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
PARKING LOT Date Closed: 04/29/04	143 WOODWORTH AVE	1/8 - 1/4NE	H76	159
ABANDONED GAS STATION Date Closed: 07/12/04	104 WARBARTON	1/8 - 1/4SE	K87	186
PRIVATE RESIDENCE Date Closed: 02/17/05	26 WILLOW PLACE	1/8 - 1/4ENE	L92	192
OUR LADY OF THE ROSARY SH Date Closed: 10/24/91	226 WARBURTON AVE.	1/8 - 1/4NE	94	195
Lower Elevation	Address	Dist / Dir	Map ID	Page
ATI OIL FACILITY Date Closed: 08/14/90	ALEXANDER STREET	0-1/8 SW	D30	64
ATI LUDLOW MOSF Date Closed: 12/04/95	ΑΤΙ	0-1/8 SW	D32	68

NY HIST SPILLS: This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database.

A review of the NY Hist Spills list, as provided by EDR, and dated 01/01/2002 has revealed that there are 24 NY Hist Spills sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
VAULT #6478	ALEXANDER ST/ASHBURTON	0 - 1/8	A3	6
POLY CHROME CORP	ALEXANDER ST/ASHBURTON	0 - 1/8	A4	11
HUDSON RIVER STORM DRAIN	ASHBURTON / ALEXANDER	0 - 1/8 ESE	A5	13
MANHOLE #7755	ALEXANDER / ASHBURTON	0 - 1/8 ESE	A6	16
POLYCHROME CORP	2 ASHBURTON AVE	0 - 1/8 ESE	A7	18
POLYCHROME INC.	2 ASHBURTON AVE.	0 - 1/8 ESE	A10	29
POLY CHROME PLANT	2 ASHBURTON AVE.	0 - 1/8 ESE	A12	32
Not reported	137 ALEXANDER ST.	0 - 1/8 NNE	A20	44
POLYCHROME CORP.	137 ALEXANDER STREET	0 - 1/8 NNE	A21	46
ATI, YONKER	91 ALWXEANDER ST	0 - 1/8 NNE	C24	54
ATI MOSF	91 ALEXANDER ST	0-1/8 NE	C36	71
ATI TERMINAL	91 ALEXANDER STREET	0-1/8 NE	C38	75
A.TARRICONE INC.	91 ALEXANDER ST.	0-1/8 NE	C39	78
VS 6478	86 ALEXANDER ST	0-1/8 NE	C40	88
VAULT 9915	86 ALEXANDER ST	0-1/8 NE	C41	9 0
POLY-CHROME	80 ALEXANDER ST	0-1/8 NE	C42	92
PATCLIN CHEMICAL COMPANY	66 ALEXANDER ST	0-1/8 NE	E43	94
ASHBURTON & WAHBURTON AVE	ASHBURTON / WAHBURTON	1/8 - 1/4ESE	F66	139
SEWER LINE CONSTR. SITE	ASHBURNTANT AVE/WOODWO	R 1/8 - 1/4E	F71	146
RESIDENTS	150 WARBURTON AVE	1/8 - 1/4ESE	F75	156
ABANDONED GAS STATION	104 WARBARTON	1/8 - 1/4 SE	K87	186
OUR LADY OF THE ROSARY SH	226 WARBURTON AVE.	1/8 - 1/4NE	94	195
Lower Elevation	Address	Dist / Dir	Map ID	Page
ATI OIL FACILITY	ALEXANDER STREET	0-1/8 SW	D30	64

Lower Elevation	Address	Dist / Dir	Map ID	Page
ATI LUDLOW MOSF	ΑΤΙ	0-1/8 SW	D32	68

NY VCP: Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the NY VCP list, as provided by EDR, and dated 08/04/2006 has revealed that there are 8 NY VCP sites within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
HALSTEAD-QUINN/ATI TANK FARM	91 ALEXANDER STREET	0-1/8 NE	C37	74
CE - WOODWORTH AVE. MGP YONKER	WOODWORTH / ASHBURTON	0 - 1/8 E	F55	114
HABIRSHAW PROPERTY	35 ALEXANDER STREET	1/8 - 1/4 ENE	E59	122
NAVAL MILITIA SITE "PARCEL A"	21 ALEXANDER ST.	1/8 - 1/4 ENE	H68	142
YONKERS PARCELS B AND C	1 ALEXANDER STREET	1/8 - 1/4 ENE	H80	166
49 NORTH BROADWAY	49 NORTH BROADWAY	1/4 - 1/2SSE	T127	268
104 ASHBURTON AVE	104 ASHBURTON AVE.	1/4 - 1/2E	X149	311
FORMER TEUTONIA HALL SITE	41-51 BUENA VISTA AVENU	1/4 - 1/2S	Z150	312

NY BROWNFIELDS: Brownfields Site List

A review of the NY BROWNFIELDS list, as provided by EDR, and dated 08/04/2006 has revealed that there are 4 NY BROWNFIELDS sites within approximately 0.625 miles of the target property.

Equal/Higher Elevation	Address	Dist / Dir	Map ID	Page
HALSTEAD-QUINN/ATI TANK FARM	91 ALEXANDER STREET	0-1/8 NE	C37	74
PATCLIN WAREHOUSE SITE	62 ALEXANDER STREET	0 - 1/8 NE	E49	103
LIBERTY LINES BUS DEPOT	59 BOBCOCK PLACE	0 - 1/8 NE	E51	105
GLENWOOD POWER STATION	45 WATER GRANT WAY	1/4 - 1/2SSW	Z156	329

EDR PROPRIETARY RECORDS

EDR Manufactured Gas Plants: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the Manufactured Gas Plants list, as provided by EDR, has revealed that there are 3 Manufactured Gas Plants sites within approximately 1.125 miles of the target property.

Equal/Higher Elevation	Address	Dist / Di	ir	Map ID	Page
CON EDISON - WOODWORTH AVE. WO CON EDISON - NEPPERHAN AVE WOR CON EDISON - LUDLOW ST WORKS-Y	WOODWORTH AND ASHBURTO 7-11 MOQUETTE ROW NORTH KNOWLES STREET	1/2 - 1		F64 190 192	135 403 407

Due to poor or inadequate address information, the following sites were not mapped:

Site Name


NYCDEP PLEASANTVILLE ALUM PLANT MYSTIC TRANSPORT MH7755 YONKERS ALEXANDER ST REDEV INC CONSOLIDATED EDISON CONSOLIDATED EDISON CONSOLIDATED EDISON CO OF NY CONSOLIDATED EDISON ALPINE TEXACO SERVICE STATION INC BICC CABLES

A.R.J.R. TRUCKING POLYCHROME SUPERTRANS NY, INC. SUPERTRANS NY, INC. 110 ALEXANDER STREET, BLOCK/LOTS: 2618/2 ATI EXCELSIOR BAG CORP. LIBERTY LINES 13 TO 15 MULBERRY SR YONKERS TRANSFER STATION STEW LEONARD DR **VAULT 9915** ATI TERMINAL MANHOLE #1024 NEXT TO ATI TERMINAL **VAULT 9915** CON ED MANHOLE#1023 ASHBURTON AVE/PALISADES A NEPERHAN AT ASHBURTON AV / SAW MILL R SAWMILL RIVER ROAD AT POLE # W1 SAW MILL RIVER RD AND WOOD WORTH AVE AND MANHOLE 367- NW CORNER PALISADES AV/ASHBURTON AV CON ED VEHICLE # 901803 PATCLIN CHEMICAL COMPANY INCORPORATED ALTMAN STAGE LIGHTING CO EXCELSIOR TRANSPARENT BAG MFG

Database(s)


RCRA-SQG, NY MANIFEST **CT MANIFEST** RCRA-SQG, NY MANIFEST RCRA-SQG, NY MANIFEST NY MANIFEST NY MANIFEST NJ MANIFEST NY MANIFEST NJ SHWS NY SHWS, NY VCP, NY Spills NY SWF/LF NY UST NY UST NY AST **US BROWNFIELDS US BROWNFIELDS US BROWNFIELDS US BROWNFIELDS** NY Spills, NY Hist Spills NY Spills NY Spills NY Spills, NY Hist Spills NY Spills NY Spills NY Spills, NY Hist Spills NY Spills NY Spills NY Spills, NY Hist Spills NY Spills NY Spills NY Spills NY Spills NY Spills, NY Hist Spills NY Spills, NY Hist Spills NY Spills, NY Hist Spills NY Spills NY Spills ICIS ICIS ICIS

OVERVIEW MAP - 1784877.2s

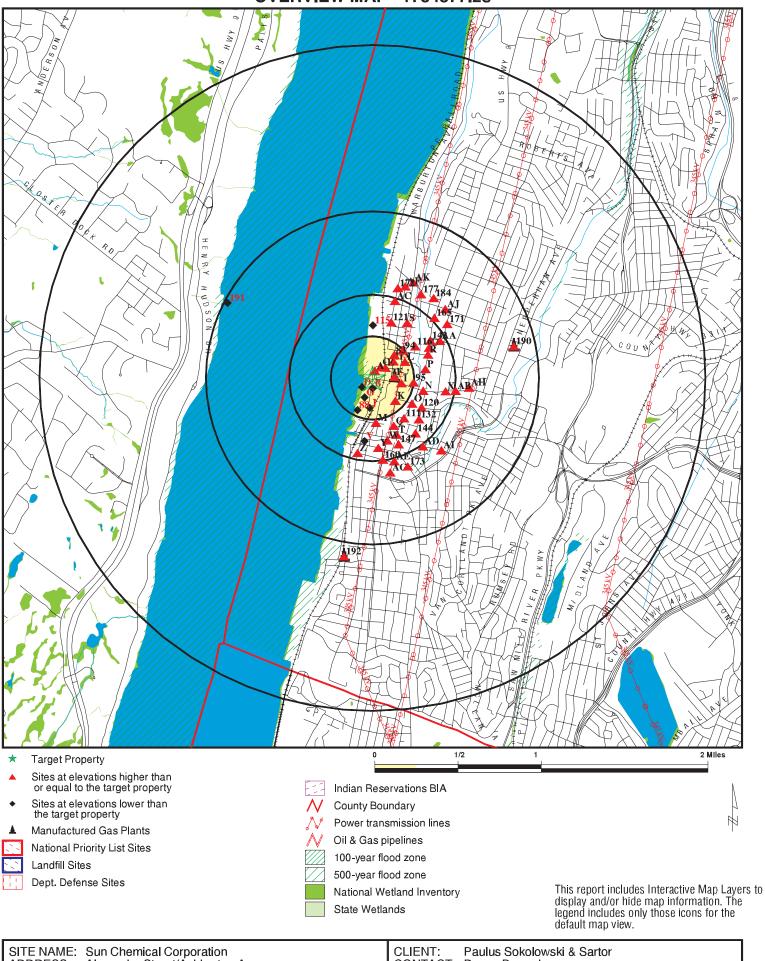

ADDRESS: Alexander Street/Ashburton Avenue Yonkers NY 10701 LAT/LONG: 40.9406 / 73.9010 CLIENT: Paulus Sokolowski & Sartor CONTACT: Dyane Benardos INQUIRY #: 1784877.2s November 02, 2006 1:46 pm Copyright © 2006 EDR, Inc. © 2006 Tele Atlas Rel. 07/2005.

DETAIL MAP - 1784877.2s

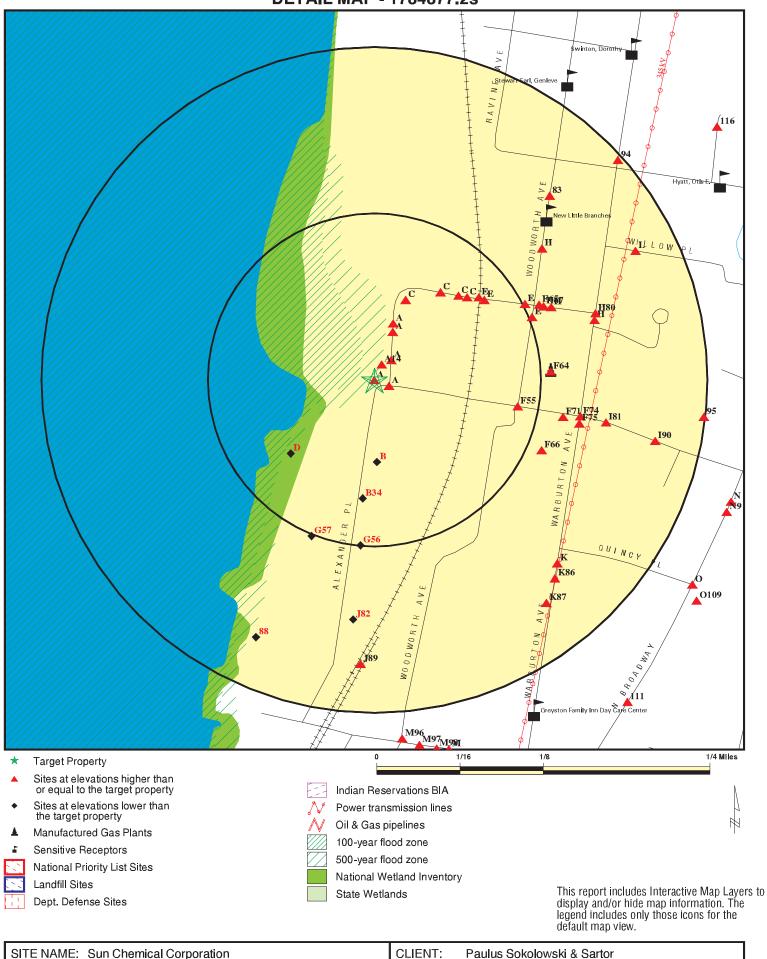

	Paulus Sokolowski & T: Dyane Benardos #: 1784877.2s
LAT/LONG: 40.9406 / 73.9010 DATE:	November 02, 2006

: November 02, 2006 1:46 pm Copyright © 2006 EDR, Inc. © 2006 Tele Atlas Rel. 07/2005.

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FEDERAL RECORDS								
NPL Proposed NPL Delisted NPL NPL RECOVERY CERCLIS CERC-NFRAP CORRACTS RCRA TSD RCRA Lg. Quan. Gen. ERNS HMIRS US ENG CONTROLS US INST CONTROL DOD FUDS US BROWNFIELDS CONSENT ROD UMTRA ODI TRIS TSCA FTTS SSTS ICIS PADS MLTS MINES FINDS RAATS	x	$\begin{array}{c} 1.125\\ 1.125\\ 1.125\\ 0.125\\ 0.625\\ 0.625\\ 1.125\\ 0.625\\ 0.375\\ 0.375\\ 0.375\\ 0.125\\ 0.625\\ 1.125\\ 0.625\\ 1.125\\ 1.125\\ 1.125\\ 1.125\\ 0.625\\ 0.125\\ 0.625\\ 0.125\\ 0.$	$\begin{array}{c} 0 \\ 0 \\ 0 \\ 1 \\ 0 \\ 0 \\ 1 \\ 8 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0$	0 0 0 R 0 0 0 0 3 R R 0 0 0 0 4 0 0 0 0 R R R R R R N 0 R R N N N N N N	0 0 0 R 0 0 0 2 5 R R 0 0 0 0 2 0 0 0 0 R R R R R R N N N N N N N N N N	0 0 0 R 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	0 0 0 RRR 0 R RRR RR R R 0 0 NR	$\begin{array}{c} 0 \\ 0 \\ 0 \\ 0 \\ 1 \\ 0 \\ 0 \\ 3 \\ 16 \\ 8 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0 \\ 0$
STATE AND LOCAL RECO	RDS							
NY HSWDS NY State Haz. Waste NJ State Haz. Waste NY DEL SHWS NY State Landfill NJ State Landfill NY SWRCY NY SWTIRE NJ SWRCY NY LTANKS NY HIST LTANKS NY HIST LTANKS NY UST NJ UST NJ UST		0.625 1.125 1.125 1.625 0.375 0.375	0 0 0 0 0 0 0 0 4 3 2 0 0	0 0 0 0 0 0 0 11 8 7 0 1	0 0 0 0 0 0 0 0 34 20 12 0 0	0 0 1 0 0 0 0 28 17 NR NR NR	NR 0 0 NR NR NR NR NR NR NR NR NR NR	0 0 1 0 0 0 0 0 77 48 21 0 1

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY MOSF UST		0.625	0	0	0	0	NR	0
NY HIST UST		0.375	0	0	0	NR	NR	0
NY AST		0.375	1	2	8	NR	NR	11
NY CBS AST		0.375	1	1	0	NR	NR	2
NY HIST AST NY MOSF AST		0.125	0 1	NR	NR	NR 0	NR NR	0 1
NY MOSE AST		0.625		0	0	0 NR	NR	17
NJ MANIFEST		0.375 0.375	8 1	3 0	6 0	NR	NR	1
NY Spills		0.250	22	9	NR	NR	NR	31
NY Hist Spills		0.250	19	5	NR	NR	NR	24
NY ENG CONTROLS		0.625	0	õ	0	0	NR	0
NJ ENG CONTROLS		0.625	Õ	Ő	Ő	Õ	NR	Õ
NY INST CONTROL		0.625	0	0	0	0	NR	Ō
NJ INST CONTROL		0.625	0	0	0	0	NR	0
NY VCP		0.625	2	3	3	0	NR	8
NJ VCP		0.625	0	0	0	0	NR	0
NY DRYCLEANERS		0.375	0	0	0	NR	NR	0
NJ DRYCLEANERS		0.375	0	0	0	NR	NR	0
NY BROWNFIELDS		0.625	3	0	1	0	NR	4
NJ BROWNFIELDS		0.625	0	0	0	0	NR	0
NY SPDES		0.125	0	NR	NR	NR	NR	0
NJNJPDES		0.125	0	NR	NR	NR	NR	0
NY AIRS		0.125	0	NR	NR	NR	NR	0
TRIBAL RECORDS								
INDIAN RESERV		1.125	0	0	0	0	0	0
INDIAN LUST		0.625	0	0	0	0	NR	0
INDIAN UST		0.375	0	0	0	NR	NR	0
EDR PROPRIETARY RECOR	DS							
Manufactured Gas Plants		1.125	0	1	0	1	1	3

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

			-	
Map ID		MAP FINDINGS		
Direction		ч		
Distance Distance (f	ίt)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
A1	SUN CHEMICAL		US BROWNFIELDS	1007442641
Target		ET, BLOCK/LOTS: 2608/29, 35,3	OO BROWN IEEDO	N/A
Property	YONKERS, NY			
	Site 1 of 21 in cluster A			
Actual:				
9 ft.	US BROWNFIELDS: Recipient Name:	City of Yonkers		
	Project Name:	Yonkers, NY		
	EPA ID:	Not reported		
	Region Number:	2		
	Latitude:	Not reported		
	Longitude: Assessment Date:	Not reported 3/31/2001		
	Clean up Date:	Not reported		
	Entity Type:	Not reported		
A2	SUN CHEMICAL 2		US BROWNFIELDS	1007442642
Target Property		REET, BLOCK/LOTS: 2615/23 &29		N/A
Property	YONKERS, NY			
Actual:	Site 2 of 21 in cluster A			
9 ft.	US BROWNFIELDS:			
	Recipient Name:	City of Yonkers		
	Project Name: EPA ID:	Yonkers, NY		
	Region Number:	Not reported 2		
	Latitude:	Not reported		
	Longitude:	Not reported		
	Assessment Date:	3/31/2001		
	Clean up Date: Entity Type:	Not reported Not reported		
	Entity Type.	Notreponeu		
A3	VAULT #6478		NY Spills	S103573458
< 1/8	ALEXANDER ST/ASHBUF YONKERS, NY	RTON AV	NY Hist Spills	N/A
< 1/0 2 ft.	TONALKO, NT			
	Site 3 of 21 in cluster A			
Relative: Equal	NY Spills:			
-	Site ID:	150443		
Actual: 9 ft.	Facility Addr2:	Not reported		
911.	Facility ID: Spill Number:	9909857 9909857		
	Facility Type:	ER		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	jbodee Not reported		
	Referred To: Spill Date:	Not reported 11/14/99		
	Reported to Dept:	11/14/99		
	CID:	323		
	Spill Cause:	Unknown		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Unknown Affected Persons		
	Cleanup Ceased:			

Map ID Direction Distance Distance (ft.) Elevation Site

VAULT #6478 (Continued)

Database(s)

EDR ID Number EPA ID Number

S103573458

		v
Cleanup Meets Std:	True	
Last Inspection:	//	
Recommended Penalty:	Penalty Not Recommended	
UST Trust:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
Spill Closed Dt:	11/17/99	
Remediation Phase:	0	
Date Entered In Computer:		
Spill Record Last Update:	11/22/99	
Spiller Name:	Not reported	
Spiller Company:	UNKNOWN	
Spiller Address:	Not reported	
Spiller City,St,Zip:	NY	
Spiller Company:	999 National and	
Spiller Phone:	Not reported	
Contact Name:	RICHARD ROACH	
Contact Phone:	(212) 580-6763 3	
DEC Region: Program Number:		
DER Facility ID:	9909857 127927	
Site ID:	150443	
Operable Unit ID:	1088551	
Operable Unit:	01	
Material ID:	298924	
Material Code:	0066A	
Material Name:	UNKNOWN PETROLEUM	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	1.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Soil	
Oxygenate:	False	
DEC Remarks: Start Cal	lerRemark - 9909857 ON 850 GALLONS OF WATER. CON ED#128974 END	
CallerRe	mark - 9909857	
	CRemark - 9909857 Prior to Sept, 2004 data translation this spill Lead	
DEC Fie	ld was "O'DEE" END DECRemark - 9909857	
Site ID:	150442	
Facility Addr2:	Not reported	
Facility ID:	9809335	
Spill Number:	9809335	
Facility Type:	ER	
SWIS:	6018	
Region of Spill:	3	
Investigator:	tdghiosa	
Referred To:	Not reported	
Spill Date:	10/26/98	
Reported to Dept:	10/26/98	
CID:	281	
Spill Cause:	Unknown	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier:	Responsible Party	
Cleanup Ceased:		
Cleanup Meets Std:	False	

EDR ID Number Database(s) EPA ID Number

VAULT #6478 (Continued)

S103573458

/AU	LT #6478 (Continu	ied)		S103573458
	Last Inspection:		11	
	Recommended Per		Penalty Not Recommended	
	UST Trust:	lany.	False	
	Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willir	na
	Opin Olass.		Responsible Party. Corrective action taken.	ig
	Spill Closed Dt:		11/07/02	
	Remediation Phase	. .	0	
	Date Entered In Co	•		
	Spill Record Last U	pdate:		
	Spiller Name:		ERNIE ROWLAND	
	Spiller Company:		CON EDISON	
	Spiller Address:		4 IRVING PLACE	
	Spiller City,St,Zip:		MANHATTEN, NY	
	Spiller Company:		001	
	Spiller Phone:		(212) 580-6763	
	Contact Name:		ERNIE ROWLAND	
	Contact Phone:		(212) 580-6763	
	DEC Region:		3	
	Program Number:		9809335	
	DER Facility ID:		127927	
	Site ID:		150442	
	Operable Unit ID:		1070419	
	Operable Unit:		01	
	Material ID:		316794	
	Material Code:		0064A	
	Material Name:		UNKNOWN MATERIAL	
	Case No.:		Not reported	
	Material FA:		Other	
	Quantity:		1.00	
	Units:		Gallons	
	Recovered:		0.00	
	Resource Affected:		Soil	
	Oxygenate:		False	
	DEC Remarks: S	Start Cal	lerRemark - 9809335 UNKNOWN OIL DISCOVERED IN ABOVE VAULT AT A	ABOVE
	L	OCATIO	ON. MATERIAL HAS BEEN CONTAINED AND CLEAN UP TO BE DONE UF	ON DISCOVERY
	(OF RESI	JLTS. RESPONSABLE PARTY IS UNKNOWN. CON EDISON REFER # 120	0824. THIS
	١	AULT I	S ADJACENTTO VAULT REPORTED IN SPILL # 9809331. NO CALL BACK	REQUESTED.
	E	END Cal	lerRemark - 9809335	
	Remark: S	Start DE	CRemark - 9809335 Prior to Sept, 2004 data translation this spill Lead	
			d was "GHIOSAY" E2MIS ON FILE. NFA TG This spill was updated	
			04 from info in V. McCabe's data files. 'Date:' = 10/26/98, 'Phone' =	
			nsp' =10-27;D.W	
		END		
	0	DECRem	nark - 9809335	
	0	Click this	hyperlink while viewing on your computer to access	
			INY SPILL: detail in the EDR Site Report.	
N	V Llist Chillon			
IN	Y Hist Spills:		2	
	Region of Spill:		3	
	Spill Number:		9909857 O'DEE	
	Investigator:		O'DEE Not reported	
	Caller Name:		Not reported	
	Caller Agency:		Not reported	
	Caller Phone:		Not reported	
	Notifier Name:		Not reported	
	Notifier Agency:		Not reported	

11/14/1999 10:25

11/14/99 12:03

UNKNOWN

Not reported

(212) 580-6763

Not reported

Not reported

Not reported

Not reported

Affected Persons

. Unknown

On Land

12

() -

55

Database(s)

EDR ID Number **EPA ID Number**

S103573458

VAULT #6478 (Continued) Notifier Phone: Not reported

Reported to Dept Date/Time:

Spill Date/Time:

Spiller Name:

Spiller Contact:

Spiller Phone: Spiller Contact:

Spiller Phone:

Spill Cause:

Spiller Address:

Spiller City,St,Zip:

Reported to Dept:

Water Affected:

Spill Source:

Spill Notifier:

PBS Number:

SWIS:

RICHARD ROACH

F DS Number.		Not reported	
Cleanup Ceased:		/ /	
Cleanup Meets Sto	d:	True	
Last Inspection:		//	
Recommended Pe	enalty:	Penalty Not Re	ecommended
Spiller Cleanup Dt	:	//	
Enforcement Date		//	
Invstgn Complete:		//	
UST Involvement:		False	
Spill Class:		Known release	with minimal potential for fire or hazard. DEC Response. Willing
		Responsible P	arty. Corrective action taken.
Spill Closed Dt:		11/17/99	
Corrective Action	Plan Submit	ted:	11
Date Region Sent	Summary to	o Central Office:	11
Date Spill Entered	In Compute	er Data File:	11/14/99
Date Spill Entered	In Compute	er Data File:	Not reported
Update Date:		11/22/99	
Is Updated:		False	
PBS Number:		Not reported	
Tank Number:		Not reported	
Tank Size:		Not reported	
Test Method:		Not reported	
Leak Rate Failed 1	Tank:	Not reported	
Gross Leak Rate:		Not reported	
Material Class Typ	e:	Petroleum	
Quantity Spilled:		1	
Unkonwn Quantity	Spilled:	False	
Units:		Gallons	
Quantity Recovere	ed:	0	
Unkonwn Quantity	Recovered	l:False	
Material:		UNKNOWN PE	ETROLEUM
Class Type:		UNKNOWN PE	ETROLEUM
Times Material En	try In File:	16414	
CAS Number:		Not reported	
Last Date:		19940929	
DEC Remarks:	Not reporte	d	
Remark:	ON 850 GA	LLONS OF WA	TER. CON ED 128974
Region of Spill:		3	
Spill Number:		9809335	
Investigator:		GHIOSAY	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S103573458

VAULT #6478 (Continued)

Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Not reported Notifier Phone: 10/26/1998 14:30 Spill Date/Time: Reported to Dept Date/Time: 10/26/98 15:17 SWIS: 55 Spiller Name: CON EDISON Spiller Contact: **ERNIE ROWLAND** Spiller Phone: (212) 580-6763 Spiller Contact: **ERNIE ROWLAND** Spiller Phone: (212) 580-6763 Spiller Address: **4 IRVING PLACE** Spiller City, St, Zip: MANHATTEN, NY Spill Cause: Unknown Reported to Dept: On Land Water Affected: Not reported Spill Source: 01 Spill Notifier: **Responsible Party** PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Std: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: 11 Enforcement Date: 11 Invstgn Complete: 11 UST Involvement: False Known release with minimal potential for fire or hazard. DEC Response. Willing Spill Class: Responsible Party. Corrective action taken. Spill Closed Dt: Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/26/98 Date Spill Entered In Computer Data File: Not reported Update Date: 11/06/98 Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Raw Sewage Quantity Spilled: 1 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: UNKNOWN MATERIAL UNKNOWN MATERIAL Class Type: Times Material Entry In File: 9140 CAS Number: Not reported 19941109 Last Date: DEC Remarks: Not reported

	MAP FINDINGS	
.) Site		EDR ID Number Database(s) EPA ID Number
VAULT #6478 (Contin	ued)	S103573458
Remark:	UNKNOWN OIL DISCOVERED IN ABOVE VAULT CONTAINED AND CLEAN UP TO BE DONE UPON IS UNKNOWN. CON EDISON REFER 120824. T REPORTED IN SPILL9809331. NO CALL BACK RI	N DISCOVERY OF RESULTS. RESPONSABLE PA THIS VAULT IS ADJACENT TO VAULT
POLY CHROME CORP	SURTON AV	NY Spills S104283996 NY Hist Spills N/A
YONKERS, NY		·
Site 4 of 21 in cluster	A	
	•	
NY Spills: Site ID:	150444	
Facility Addr2:	Not reported	
Facility ID: Spill Number:	9909858 9909858	
Facility Type:	ER	
SWIS:	6018	
Region of Spill:	3 ibadaa	
Investigator: Referred To:	jbodee Not reported	
Spill Date:	11/14/99	
Reported to Dept:	11/14/99	
CID: Spill Cause:	312 Unknown	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier: Cleanup Ceased:	Responsible Party / /	
Cleanup Meets St		
Last Inspection:	/ /	
Recommended Pe UST Trust:	nalty: Penalty Not Recommended False	
Spill Class:	Known release with minimal potential for fi Responsible Party. Corrective action taker	
Spill Closed Dt:	11/17/99	
Remediation Phas		
Date Entered In C Spill Record Last	•	
Spiller Name:	Not reported	
Spiller Company:		
Spiller Address: Spiller City,St,Zip:	4 IRVING PLACE NEW YORK, NY 10003-	
Spiller Company:	001	
Spiller Phone: Contact Name:	Not reported	
Contact Name.	STEVE ROMERO (212) 580-6763	
DEC Region:	3	
Program Number:	9909858	
DER Facility ID: Site ID:	127927 150444	
Operable Unit ID:	1088553	
Operable Unit:	01	
Material ID: Material Code:	298925 0066A	
Material Name:	UNKNOWN PETROLEUM	
Case No.:	Not reported	
Material FA:	Petroleum	

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	POLY CHROME CORP (Continu	ed)		S104283996
	5	.00		
		Gallons		
).00 Soil		
		False		
	DEC Remarks: Start CallerRemark - 9909858 2 PINTS ON 850 GAL OF WATER IN VAULT 9915 - CASE #128975 - JIM HARDY CONTACTED END CallerRemark - 9909858 Remark: Start DECRemark - 9909858 Prior to Sept, 2004 data translation this spill Lead DEC Field was "O'DEE" END DECRemark - 9909858			
	NY Hist Spills:			
	Region of Spill:	3		
	Spill Number:	9909858		
	Investigator:	O'DEE		
	Caller Name:	Not reported		
	Caller Agency:	Not reported		
	Caller Phone:	Not reported		
	Notifier Name: Notifier Agency:	Not reported Not reported		
	Notifier Phone:	Not reported		
	Spill Date/Time:	11/14/1999 10:25		
	Reported to Dept Date/Time	11/14/99 12:11		
	SWIS:	55		
	Spiller Name:	CON EDISON		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Contact:	() - STEVE ROMERO		
	Spiller Phone:	(212) 580-6763		
	Spiller Address:	4 IRVING PLACE		
	Spiller City,St,Zip:	MANHATTAN, NY 10003-		
	Spill Cause:	Unknown		
	Reported to Dept:	On Land		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	01 Responsible Party		
	PBS Number:	Not reported		
	Cleanup Ceased:	/ /		
	Cleanup Meets Std:	True		
	Last Inspection:	//		
	Recommended Penalty:	Penalty Not Recommended		
	Spiller Cleanup Dt: Enforcement Date:	//		
	Invstgn Complete:	//		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard. D	EC Response. V	Villing
		Responsible Party. Corrective action taken.		
	Spill Closed Dt:	11/17/99		
	Corrective Action Plan Subr			
	Date Region Sent Summary Date Spill Entered In Compu			
	Date Spill Entered In Compu			
	Update Date:	11/22/99		
	Is Updated:	False		
	PBS Number:	Not reported		
	Tank Number:	Not reported		
	Tank Size:	Not reported		
	Test Method:	Not reported		

Database(s)

EDR ID Number EPA ID Number

S104283996

Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	1
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered	d: False
Material:	UNKNOWN PETROLEUM
Class Type:	UNKNOWN PETROLEUM
Times Material Entry In File:	16414
CAS Number:	Not reported
Last Date:	19940929
DEC Remarks: Not reporte	d
Remark: 2 PINTS O	N 850 GAL OF WATER IN VAULT 9915 - CASE 128975 - JIM HARDY CONTACTED

A5 HUDSON RIVER STORM DRAIN

ESE ASHBURTON / ALEXANDER ST.

YONKERS, NY < 1/8

61 ft.

Site 5

Relative: Equal Actual:

9 ft.

ite 5 of 21 in cluste	~r A	
NY Spills:	<i>7</i> 1 A	
Site ID:		259249
Facility Addr2:		Not reported
Facility ID:		8905053
Spill Number:		8905053
Facility Type:		ER
SWIS:		6018
Region of Spill:		3
Investigator:		tdghiosa
Referred To:		Not reported
Spill Date:		08/22/89
Reported to De	nt:	08/23/89
CID:	P	Not reported
Spill Cause:		Unknown
Water Affected:		Not reported
Spill Source:		Unknown
Spill Notifier:		Affected Persons
Cleanup Cease	ed:	08/23/89
Cleanup Meets		True
Last Inspection:		//
Recommended	Penalty:	Penalty Not Recommended
UST Trust:	-	False
Spill Class:		Not reported
Spill Closed Dt:		08/23/89
Remediation Ph	nase:	0
Date Entered Ir	Omputer:	08/31/89
Spill Record La	st Update:	10/04/89
Spiller Name:		Not reported
Spiller Compan	y:	Not reported
Spiller Address	:	Not reported
Spiller City,St,Z	lip:	***Update***, ZZ
Spiller Compan	y:	001
Spiller Phone:		Not reported
Contact Name:		Not reported
Contact Phone:		Not reported
DEC Region:		3

NY Spills NY Hist Spills S102153550 N/A

HUDSON RIVER STORM DRAIN (Continued)

8905053

Program Number:

Recommended Penalty:

Spiller Cleanup Dt:

Enforcement Date:

Invstgn Complete:

UST Involvement:

Spill Class:

Database(s)

EDR ID Number EPA ID Number

DER Facility ID: 212103 Site ID: 259249 Operable Unit ID: 932814 **Operable Unit:** 01 Material ID: 445492 Material Code: 0066A UNKNOWN PETROLEUM Material Name: Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 **Resource Affected:** Surface Water Oxygenate: False DEC Remarks: Start CallerRemark - 8905053 FAXED TO TODD GHIOSAY, WILL HANDLE END CallerRemark - 8905053 Remark: Start DECRemark - 8905053 Prior to Sept, 2004 data translation this spill Lead DEC Field was "TODD GHIOSAY" / / : NO DISCHARGE WAS NOTICED AT TIME OF INDPECTION N.F.A. 11/29/95: This is additional information about material spilled from the translation of the old spill file: WHITE MILKY SUBSTAN. END DECRemark - 8905053 NY Hist Spills: 3 Region of Spill: Spill Number: 9708686 Investigator: GHIOSAY Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 10/24/1997 12:00 Reported to Dept Date/Time: 10/24/97 13:20 SWIS: 55 Spiller Name: MONDERN TRANSPORT Spiller Contact: JIM COSIER Spiller Phone: (412) 368-8000 Spiller Address: Not reported Spiller City, St, Zip: PORTERSVILLE, PA Spill Cause: Traffic Accident Reported to Dept: On Land Water Affected: Not reported Spill Source: 07 Spill Notifier: DEC PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Std: False Last Inspection: 11

Penalty Not Recommended

Responsible Party. Corrective action taken.

Known release with minimal potential for fire or hazard. DEC Response. Willing

11

11

11

False

Map ID				MAP FINDIN	IGS			
Direction		Ч						
Distance	\ \							
Distance (ft Elevation	.) Site						Database(s)	EDR ID Number EPA ID Number
	HUDSON RIVER STO	RM DRAIN ((Continued)					S102153550
	Spill Closed Dt:		//					
	Corrective Action			/ /				
	Date Region Sen							
	Date Spill Entere Date Spill Entere			10/24/97 Not report	ed			
	Update Date:		11/19/97	Not report	cu			
	Is Updated:		False					
	PBS Number:		Not reported					
	Tank Number:		Not reported					
	Tank Size:		Not reported					
	Test Method: Leak Rate Failed	Tonk	Not reported Not reported					
	Gross Leak Rate		Not reported					
	Material Class Ty		Petroleum					
	Quantity Spilled:	•	65					
	Unkonwn Quanti	ty Spilled:	False					
	Units:		Gallons					
	Quantity Recover		0 I. Truc					
	Unkonwn Quanti Material:	ty Recovered	DIESEL					
	Class Type:		DIESEL					
	Times Material E	ntry In File:	10625					
	CAS Number:		Not reported					
	Last Date:	/ /	19940728					
	DEC Remarks:				LICE ON SCENE			OTATE
					ROX.30 GAL. O STIMATED FOR		L. ON THE ROA	
		AND SOME				0/1		
	Remark:	DRIVER BA	ACKED INTO	GUARDRAIL	AND RUPTURE	D SADDLE TA	NK - DRIVER T	HEN DROVE
		SEVERAL I	BLOCKS - SPI	ILL BEING C	LEANED UP			
	Region of Spill:		3					
	Spill Number:		8905053					
	Investigator:		TODD GHIO	SAY				
	Caller Name:		Not reported					
	Caller Agency:		Not reported					
	Caller Phone:		Not reported					
	Notifier Name: Notifier Agency:		Not reported Not reported					
	Notifier Phone:		Not reported					
	Spill Date/Time:		08/22/1989 0					
	Reported to Dept	t Date/Time:	08/23/89 12:	59				
	SWIS:		55					
	Spiller Name:		Not reported					
	Spiller Contact: Spiller Phone:		Not reported Not reported					
	Spiller Address:		Not reported					
	Spiller City,St,Zip):	Not reported					
	Spill Cause:		Unknown					
	Reported to Dept	t:	Surface Wate					
	Water Affected:		Not reported					
	Spill Source: Spill Notifier:		12 Affected Pers	sons				
	PBS Number:		Not reported					
	Cleanup Ceased	:	08/23/89					
	Cleanup Meets S		True					
	Last Inspection:		//					

Map ID Direction		MAP FINDINGS		
Distance Distance (ft.) Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	HUDSON RIVER STORM DRAIN	(Continued)		S102153550
	This is add	to Central Office: / / ter Data File: 08/31/89 ter Data File: Not reported 10/04/89 False Not reported Not reported Not reported Not reported Not reported Not reported Petroleum 0 False Gallons 0 d: False UNKNOWN PETROLEUM UNKNOWN PETROLEUM 16414 Not reported 19940929 USCHARGE WAS NOTICED AT TIME OF INDPECTION I litional information about material spilled from the translati		
		II file: WHITE MILKY SUBSTAN.) TODD GHIOSAY, WILL HANDLE		

A6MANHOLE #7755ESEALEXANDER / ASHBURTON AVE< 1/8</td>YONKERS, NY

61 ft.

Site 6 of 21 in cluster A

Relative: Equal

Actual: 9 ft.

NY Spills:	
Site ID:	265872
Facility Addr2:	Not reported
Facility ID:	9903690
Spill Number:	9903690
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	WXWADSWO
Referred To:	Not reported
Spill Date:	06/30/99
Reported to Dept:	06/30/99
CID:	390
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Local Agency

NY Spills S103939040 NY Hist Spills N/A

Database(s)

EDR ID Number **EPA ID Number**

S103939040

MANHOLE #7755 (Continued)

Caller Agency:

Caller Phone:

Notifier Name:

Notifier Agency:

Notifier Phone:

Spill Date/Time:

Spiller Name:

Spiller Contact:

Spiller Phone:

Spiller Contact:

SWIS:

Reported to Dept Date/Time:

Not reported

Not reported

Not reported

Not reported

Not reported 06/30/1999 09:30

55

UNK

UNK

06/30/99 11:08

(000) 000-0000 **STEPHEN CRIBBINS**

/IAI	HOLE #1155 (CON	ilinueu)			510393904
	Cleanup Ceased:		//		
	Cleanup Meets Std:	:	True		
	Last Inspection:		//		
	Recommended Pen	nalty:	Penalty Not Recommended		
	UST Trust:		False		
	Spill Class:		Known release with minimal potential for fire or hazard	I. DEC Response. Willir	ng
			Responsible Party. Corrective action taken.		
	Spill Closed Dt:		06/30/99		
	Remediation Phase	e:	0		
	Date Entered In Cor	mputer:	06/30/99		
	Spill Record Last Up	pdate:	07/01/99		
	Spiller Name:		UNK		
	Spiller Company:		UNK		
	Spiller Address:		UNK		
	Spiller City,St,Zip:		UNK, ZZ		
	Spiller Company:		001		
	Spiller Phone:		(000) 000-0000		
	Contact Name:		STEPHEN CRIBBINS		
	Contact Phone:		(212) 580-6763		
	DEC Region:		3		
	Program Number:		9903690		
	DER Facility ID:		216645		
	Site ID:		265872		
	Operable Unit ID:		1082613		
	Operable Unit:		01		
	Material ID:		303599		
	Material Code:		0066A		
	Material Name:		UNKNOWN PETROLEUM		
	Case No.:		Not reported		
	Material FA:		Petroleum		
	Quantity:		1.00		
	Units:		Gallons		
	Recovered:		0.00		
	Resource Affected:		Soil		
	Oxygenate:		False		
			erRemark - 9903690 CLEAN UP AS TO 50-499PPM	CON ED # 125917 E	ND
			mark - 9903690		
			CRemark - 9903690 Prior to Sept, 2004 data translation	n this spill Lead	
	D	DEC Fiel	d was "WADSWORTH" END DECRemark - 9903690		
N	Y Hist Spills:				
	Region of Spill:		3		
	Spill Number:		9903690		
	Investigator:		WADSWORTH		
	Caller Name:		Not reported		

(212) 580-6763

CLEAN UP AS TO 50-499PPM

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S103939040

Spiller Phone.	(212) 300-0703	
Spiller Address:	UNK	
Spiller City,St,Zip:	UNK, NY	
Spill Cause:	Unknown	
Reported to Dept:	On Land	
Water Affected:	Not reported	
Spill Source:	12	
Spill Notifier:	Local Agency	
PBS Number:	Not reported	
Cleanup Ceased:		
Cleanup Meets Std:	True	
Last Inspection:		
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Dt:		
Enforcement Date:	//	
Invstgn Complete:	//	
UST Involvement:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing	
	Responsible Party. Corrective action taken.	
Spill Closed Dt:	06/30/99	
Corrective Action Plan Submitted: / /		
Date Region Sent Summary t	o Central Office: / /	
Date Spill Entered In Compute		
Date Spill Entered In Comput		
Update Date:	07/01/99	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed Tank:	Not reported	
Gross Leak Rate:	Not reported	
Material Class Type:	Petroleum	
Quantity Spilled:	1	
Unkonwn Quantity Spilled:	False	
Units:	Gallons	
Quantity Recovered:	0	
Unkonwn Quantity Recovered	t: False	
Material:	UNKNOWN PETROLEUM	
Class Type:	UNKNOWN PETROLEUM	
Times Material Entry In File:	16414	
CAS Number:	Not reported	
Last Date:	19940929	
DEC Remarks: Not reporte		

CON ED 125917

MANHOLE #7755 (Continued)

Spiller Phone:

A7 POLYCHROME CORP 2 ASHBURTON AVE ESE

Remark:

< 1/8 YONKERS, NY 10701

65 ft. Site 7 of 21 in cluster A **Relative:**

Equal

Actual: 9 ft.

RCRA-SQG 1000705398 FINDS NYD980236152 FTTS NY Spills NY MANIFEST **NY Hist Spills RI MANIFEST**

Database(s)

EDR ID Number EPA ID Number

DLYCHROME CORP (Continued)			1000705398
RCRAInfo: Owner: DAINPPON INK & CH (212) 555-1212	EMICALS		
EPA ID: NYD980236152			
Contact: Not reported			
Classification: Small Quantity Genera TSDF Activities: Not reported	ator		
Violation Status: Violations exist			
Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:	265.176 GENERATOR-ALL REQUIREI 11/19/1993 12/31/1993	MENTS (OVERSIGHT)	
Enforcement Action: Enforcement Action Date: Penalty Type:	INITIAL 3008(A) COMPLIANC 06/28/1994 Proposed Monetary Penalty	E ORDER	
Enforcement Action: Enforcement Action Date: Penalty Type:	FINAL 3008(A) COMPLIANCE 06/29/1995 Proposed Monetary Penalty	ORDER	
Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:	262.34(a)(2) GENERATOR-ALL REQUIREI 11/19/1993 12/31/1993	MENTS (OVERSIGHT)	
Enforcement Action: Enforcement Action Date: Penalty Type:	INITIAL 3008(A) COMPLIANC 06/28/1994 Proposed Monetary Penalty	E ORDER	
Enforcement Action: Enforcement Action Date: Penalty Type:	FINAL 3008(A) COMPLIANCE 06/29/1995 Proposed Monetary Penalty	ORDER	
Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:	262.34(a)(3) GENERATOR-ALL REQUIRE 11/19/1993 12/31/1993	MENTS (OVERSIGHT)	
Enforcement Action: Enforcement Action Date: Penalty Type:	INITIAL 3008(A) COMPLIANC 06/28/1994 Proposed Monetary Penalty	EORDER	
Enforcement Action: Enforcement Action Date: Penalty Type:	FINAL 3008(A) COMPLIANCE 06/29/1995 Proposed Monetary Penalty	ORDER	
Penalty Summary: Penalty Description	Penalty Date	Penalty Amount	Lead Agency
 Final Monetary Penalty Proposed Monetary Penalty	6/29/1995 6/28/1994	 27000 54999	EPA EPA

		Date of
Evaluation	Area of Violation	Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19931231
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19931231
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19931231

Database(s)

EDR ID Number EPA ID Number

1000705398

POLYCHROME CORP (Continued)

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP (Continued)

1000705398

FTTS INSP: Inspection Number: Region: Inspection Date: Inspector: Violation occurred: Investigation Type: Investigation Reason: Legislation Code: Facility Function:	19920206IN003 1 05 Not reported HEIGHWAY Yes AHERA, Enforcement, State Conducted Neutral Scheme, State TSCA User
Inspection Number:	199307094632 10
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 13 Importer Inspection
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 11
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 12 Export
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 4
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 5 Inspections
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 1
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 5 Premanufacture Notice
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 3
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 5 Significant New Use Rule

POLYCHROME CORP (Continued)

	innaca)
Investigation Reason: Legislation Code:	Neutral Scheme, Region TSCA
Facility Function:	Manufacturer
Inspection Number: Region:	199307094632 2 02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 5 Test Marketing Exemption
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
r donity r driotion.	
Inspection Number:	199307094632 12
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 6 PCB Federal Conducted
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
-	
Inspection Number:	199307094632 5
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 8 Confidential Inspections
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 7
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 8C Records Rule
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 8
Region:	02
Inspection Date:	Not reported
Inspector:	T. ZACHOS, LP
Violation occurred:	No
Investigation Type:	Section 8D Health and Safety Studies
Investigation Reason:	Neutral Scheme, Region
Legislation Code:	TSCA
Facility Function:	Manufacturer
Inspection Number:	199307094632 6
Region:	02
Inspection Date:	Not reported

Database(s)

EDR ID Number EPA ID Number

1000705398

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP (Continued)

OLYCHROME CORP (Cont	inued)
Inspector:	T. ZACHOS, LP
•	No
	Section 8 Inventory Rule
e	Neutral Scheme, Region
•	TSCA
	Manufacturer
Facility Function:	Manufacturer
Inspection Number:	199307094632 9
-	
- 3 -	02 Not reported
	Not reported
•	T. ZACHOS, LP
0 71	Section 8E Substantial Risk
•	Neutral Scheme, Region
5	TSCA
Facility Function:	Manufacturer
NY Spills:	
Site ID:	205766
Facility Addr2:	Not reported
Facility ID:	8807603
Spill Number:	8807603
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	tdghiosa
Referred To:	Not reported
Spill Date:	12/15/88
Reported to Dept:	12/16/88
CID:	17
Spill Cause:	Unknown
Water Affected:	
	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	11/28/89 Taua
Cleanup Meets Std:	True
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Not reported
Spill Closed Dt:	11/28/89
Remediation Phase:	0
Date Entered In Compute	
Spill Record Last Update	
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	001
Spiller Phone:	Not reported
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	3
Program Number:	8807603
DER Facility ID:	170865
Site ID:	205766
Operable Unit ID:	924211

Database(s)

EDR ID Number EPA ID Number

	Continued) 1000705	539
Operable Unit:	01	
Material ID:	455932	
Material Code:	0001	
Material Name:	#2 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affecte	Groundwater	
Oxygenate:	False	
DEC Remarks:	art CallerRemark - 8807603 C&E ENVIROMENTAL PULLING TANKS #2 FUEL SEEPING ITO HOLE TODD GHIOSAY WILL ADVISE ON REMEDIATION. END CallerRemark - 8807603	3
Remark:	art DECRemark - 8807603 Prior to Sept, 2004 data translation this spill Lead	
	EC Field was "GHIOSAY" END DECRemark - 8807603	
IY MANIFEST:		
-	INA0408238	
Document ID: Manifest Status:	INA0498238 K	
Trans1 Status:	K S22654209	
Trans2 State ID:	S22654209 S22654209	
Generator Ship D		
Trans1 Recv Date	930723	
Trans2 Recv Date	930725	
TSD Site Recy Date		
Part A Recv Date	Not reported	
Part B Recv Date	930927	
Generator EPA ID	NYD980236152	
Trans1 EPA ID:	NJD054126164	
Trans2 EPA ID:	NJD054126164	
TSDF ID:	IND000646943	
Waste Code:	F005 - UNKNOWN	
Quantity:	00750	
Units:	P - Pounds	
Number of Contai		
Container Type:	DM - Metal drums, barrels	
Handling Method:	B Incineration, heat recovery, burning.	
Specific Gravity:	100	
Waste Code:	Not reported	
Quantity:	00650	
Units:	G - Gallons (liquids only)* (8.3 pounds)	
Number of Contai		
Container Type:	DM - Metal drums, barrels	
Handling Method:	B Incineration, heat recovery, burning.	
Specific Gravity:	100	
Year:	93	
Facility Type:	Generator	
EPA ID:	NYD980236152	
Facility Name:	POLYCHROME CORPORATION	
Facility Address:	2 ASHBURTON AVENUE	
Facility City:	YONKERS	
Facility Zip 4:	Not reported	
Country:	Not reported	
County:	WESTCHESTER	
Mailing Name:	POLYCHROME CORPORATION	
Mailing Contact:	JACK AZAR	
Manning Contact.		

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP (Continued)

Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone: FT LEE NJ 07024 Not reported Not reported 000-000-0000

<u>Click this hyperlink</u> while viewing on your computer to access 17 additional NY MANIFEST: record(s) in the EDR Site Report.

NY Hist Spills:	2
Region of Spill:	3 8807603
Spill Number:	GHIOSAY
Investigator:	
Caller Name:	Not reported
Caller Agency: Caller Phone:	Not reported
Notifier Name:	Not reported
	Not reported
Notifier Agency: Notifier Phone:	Not reported Not reported
Spill Date/Time:	12/15/1988 12:30
Reported to Dept Date/Time:	12/16/88 09:25
SWIS:	55
Spiller Name:	SAME
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	Groundwater
Water Affected:	Not reported
Spill Source:	01
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	11/28/89
Cleanup Meets Std:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	/ /
Enforcement Date:	/ /
Invstgn Complete:	//
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	11/28/89
Corrective Action Plan Submi	
Date Region Sent Summary t	
Date Spill Entered In Compute	
Date Spill Entered In Compute	•
Update Date:	11/29/89
Is Updated:	False
PBS Number:	Not reported
Tank Number: Tank Size:	Not reported
	Not reported
Test Method: Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported Not reported
Material Class Type:	Petroleum
Material Class Type.	

1000705398

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP (Continue	ed) 1000705398
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovere	d: False
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In File:	24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: Not reporte	
	ROMENTAL PULLING TANKS 2 FUEL SEEPING INTO HOLE TODD GHIOSAY WILL N REMEDIATION.
RI MANIFEST:	
Manifest Docket Number:	RIC0028301
Waste Description:	ACID
Quantity:	90.00
WT/Vol Units:	G
Item Number:	4
Transporter Name:	BECHEM TRANSPORT INC
Transporter EPA ID:	CTD982191942
ID:	373012
GEN Cert Date:	3/29/1994 0:00:00
Transporter Recpt Date:	Not reported
Transporter 2 Recpt Date:	Not reported
TSDF Recpt Date:	Not reported
EPA ID:	NYD980236152
Number Of Containers:	0 Not reported
Container Type: Waste Code1:	Not reported D002
Waste Code1: Waste Code2:	Not reported
Waste Code2: Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND ENVIRONMENTAL INC
TSDF ID:	RID040098352
Data Source:	PATRICE
Date Imported:	4/4/1995 0:00:00
Transporter 2 Name:	Not reported
Transporter 2 ID:	Not reported
Quantity in LBS.:	0
Fee Reported:	Not reported
Manifest Docket Number:	RIC0028301
Waste Description:	ALCOHOL
Quantity:	90.00
WT/Vol Units:	G
Item Number:	1
Transporter Name:	BECHEM TRANSPORT INC
Transporter EPA ID:	CTD982191942
ID:	373009
GEN Cert Date:	3/29/1994 0:00:00
Transporter Recpt Date:	Not reported

Database(s)

EDR ID Number EPA ID Number

1000705398

POLYCHROME CORP (Continued)

Transporter 2 Recpt Date: Not reported TSDF Recpt Date: EPA ID: Number Of Containers: 0 Container Type: Waste Code1: Waste Code2: Waste Code3: Waste Code4: Waste Code5: Waste Code6: Comment: Fee Exempt Code: TSDF Name: TSDF ID: Data Source: Date Imported: Transporter 2 Name: Transporter 2 ID: Quantity in LBS .: 0 Fee Reported: Manifest Docket Number: Waste Description: Quantity: WT/Vol Units: G Item Number: 2 Transporter Name: Transporter EPA ID: ID: GEN Cert Date: Transporter Recpt Date: Transporter 2 Recpt Date: TSDF Recpt Date: EPA ID: Number Of Containers: 0 Container Type: Waste Code1: Waste Code2: Waste Code3: Waste Code4: Waste Code5: Waste Code6: Comment: Fee Exempt Code: TSDF Name: TSDF ID: Data Source: Date Imported: Transporter 2 Name: Transporter 2 ID: Quantity in LBS .: Fee Reported: Manifest Docket Number:

Waste Description:

Quantity:

Not reported NYD980236152 Not reported D001 Not reported NORTHLAND ENVIRONMENTAL INC RID040098352 PATRICE 4/4/1995 0:00:00 Not reported Not reported Not reported RIC0028301 POTASSIUM 50.00 **BECHEM TRANSPORT INC** CTD982191942 373010 3/29/1994 0:00:00 Not reported Not reported Not reported NYD980236152 Not reported D002 Not reported NORTHLAND ENVIRONMENTAL INC RID040098352 PATRICE 4/4/1995 0:00:00 Not reported Not reported Not reported RIC0028301 SOD PERSULFATE 8400.00

Database(s)

EDR ID Number EPA ID Number

1000705398

POLYCHROME CORP (Continued)

WT/Vol Units: Item Number: Transporter Name: Transporter EPA ID: ID: GEN Cert Date: Transporter Recpt Date: Transporter 2 Recpt Date: TSDF Recpt Date: EPA ID: Number Of Containers: Container Type: Waste Code1: Waste Code2: Waste Code3: Waste Code4: Waste Code5: Waste Code6: Comment: Fee Exempt Code: TSDF Name: TSDF ID: Data Source: Date Imported: Transporter 2 Name: Transporter 2 ID: Quantity in LBS .: Fee Reported: Manifest Docket Number: Waste Description: Quantity: WT/Vol Units: Item Number: Transporter Name: Transporter EPA ID: ID: GEN Cert Date: Transporter Recpt Date: Transporter 2 Recpt Date: TSDF Recpt Date: EPA ID: Number Of Containers: Container Type: Waste Code1: Waste Code2: Waste Code3: Waste Code4: Waste Code5: Waste Code6: Comment: Fee Exempt Code: **TSDF** Name: TSDF ID: Data Source: Date Imported:

Transporter 2 Name:

Р 3 BECHEM TRANSPORT INC CTD982191942 373011 3/29/1994 0:00:00 Not reported Not reported Not reported NYD980236152 0 Not reported D001 Not reported NORTHLAND ENVIRONMENTAL INC RID040098352 PATRICE 4/4/1995 0:00:00 Not reported Not reported 0 Not reported RIC0028302 ACID 25.00 G 3 BECHEM TRANSPORT INC CTD982191942 373015 3/29/1994 0:00:00 Not reported Not reported Not reported NYD980236152 0 Not reported D002 Not reported NORTHLAND ENVIRONMENTAL INC RID040098352 PATRICE 4/4/1995 0:00:00 Not reported

.) Site		Database(s)	EDR ID Number
POLYCHROME CORP	(Continued)		1000705398
Transporter 2 ID: Quantity in LBS.: Fee Reported:	Not reported 0 Not reported		
	<u>Click this hyperlink</u> while viewing on your computer to access 6 additional RI MANIFEST: record(s) in the EDR Site Report.		
2 ASHBURTON AVEN		ERNS	8863484 N/A
YONKERS, NY			
Site 8 of 21 in cluster	A		
	<u>Click this hyperlink</u> while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
2 ASHBURTON AVE 2 ASHBURTON AVE YONKERS, NY		ERNS	8871264 N/A
Site 9 of 21 in cluster <i>i</i>	A <u>Click this hyperlink</u> while viewing on your computer to access		
	additional ERNS detail in the EDR Site Report.		
POLYCHROME INC. 2 ASHBURTON AVE. YONKERS, NY		NY Spills NY Hist Spills	S103563556 N/A
Site 10 of 21 in cluster	A		
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets St Last Inspection: Recommended Pet UST Trust: Spill Class:	17 Other Not reported Commercial/Industrial Responsible Party 06/18/53 d: True / /		

Database(s)

EDR ID Number EPA ID Number

POLYCHROME INC. (Continued)

Spill Source:

01

OLYCHROME INC. (Continue	ed) \$103563556
Spill Closed Dt:	07/25/90
Remediation Phase:	0
Date Entered In Computer:	: 07/09/90
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	001
Spiller Phone:	Not reported
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	3
Program Number:	9003703
DER Facility ID:	170865
Site ID:	205767
Operable Unit ID:	941537
Operable Unit:	01
Material ID:	434842
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	40.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Air
Oxygenate:	
CONCR CONTAI Remark: Start DE DEC Fie	IlerRemark - 9003703 DRUM OF PRODUCT OVERHEATED AND BURST RAN ONTO ETE FLOOR AND STREET EMPLOYEES DYKED SPILL PICKED UP AND DRUMED MINATED MATERIAL END CallerRemark - 9003703 CRemark - 9003703 Prior to Sept, 2004 data translation this spill Lead Id was "GHIOSAY" 07/25/90: SPILL REPORTED TO BE CLEANED UP. NO RESONSE . END DECRemark - 9003703
NY Hist Spills:	
Region of Spill:	3
Spill Number:	9003703
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	07/02/1990 14:30
Reported to Dept Date/Tim	
SWIS:	55
Spiller Name:	SAME
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip: Spill Cause:	Not reported Other
Reported to Dept:	Air
Water Affected:	Not reported
Spill Source:	01

Database(s)

EDR ID Number EPA ID Number

POLYCHROME INC. (Continued)

S103563556

0	
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	06/18/53
Cleanup Meets Std:	True
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	
Enforcement Date:	//
Invstgn Complete:	//
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	07/25/90
Corrective Action Plan Submit	
Date Region Sent Summary to	
Date Spill Entered In Compute	
Date Spill Entered In Compute	•
Update Date:	07/25/90
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	40
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered	
Material:	UNKNOWN PETROLEUM
Class Type:	UNKNOWN PETROLEUM
Times Material Entry In File:	16414
CAS Number:	Not reported
Last Date:	19940929
	PILL REPORTED TO BE CLEANED UP. NO RESONSE BY DEC.
	PRODUCT OVERHEATED AND BURST RAN ONTO CONCRETE FLOOR AND STREET
EMPLOYEE	ES DYKED SPILL PICKED UP AND DRUMED CONTAMINATED MATERIAL

A11 2 ASHBURTON AVE , POLY CROME FACILITY ESE 2 ASHBURTON AVE , POLY CROME FACILITY

ERNS 874446 N/A

< 1/8 65 ft.

Site 11 of 21 in cluster A

YONKERS, NY

Relative: Equal

<u>Click this hyperlink</u> while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual: 9 ft.

Database(s)

EDR ID Number EPA ID Number

A12 ESE < 1/8	POLY CHROME PLANT 2 ASHBURTON AVE. YONKERS, NY	NY Spills S102153182 NY Hist Spills N/A
65 ft.	Site 12 of 21 in cluster A	
Relative:		
Equal	NY Spills:	
A	Site ID:	205765
Actual: 9 ft.	Facility Addr2:	Not reported 8803623
011.	Facility ID: Spill Number:	8803623
	Facility Type:	ER
	SWIS:	6018
	Region of Spill:	3
	Investigator:	SLINGERLAND
	Referred To:	Not reported
	Spill Date:	07/26/88
	Reported to Dept:	07/26/88
	CID: Spill Cause:	17 Human Error
	Water Affected:	Not reported
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Responsible Party
	Cleanup Ceased:	08/03/88
	Cleanup Meets Std:	True
	Last Inspection:	
	Recommended Penalty:	Penalty Not Recommended
	UST Trust:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
	Spill Closed Dt:	08/03/88
	Remediation Phase:	0
	Date Entered In Computer:	08/03/88
	Spill Record Last Update:	09/09/03
	Spiller Name:	Not reported
	Spiller Company:	Not reported
	Spiller Address: Spiller City,St,Zip:	Not reported ***Update***, ZZ
	Spiller Company:	001
	Spiller Phone:	Not reported
	Contact Name:	Not reported
	Contact Phone:	Not reported
	DEC Region:	3
	Program Number:	8803623
	DER Facility ID: Site ID:	170865 Not reported
	Operable Unit ID:	Not reported
	Operable Unit:	Not reported
	Material ID:	Not reported
	Material Code:	Not reported
	Material Name:	Not reported
	Case No.:	Not reported
	Material FA:	Not reported
	Quantity: Units:	Not reported Not reported
	Recovered:	Not reported
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	DEC Remarks: Start Ca	lerRemark - 8803623 NO ACTION -HAD GONE INTO YONKERS SEWER SYSTEM

EDR ID Number Database(s) EPA ID Number

POLY CHROME PLANT (Continued)

S102153182

Y CHROME PLANT	ontinued) 51021:	55102
C	ED DOT ANSWERING MACHINE. LEFT MESSAGE 9:05 AM 7/27. CALLED AGAIN ANS	SWERI
N	HINE AGAIN CALLED B. SCHNEIDER OF WCHD. HE WILL SEND SOME ON IT. NFA E	ND
C	rRemark - 8803623	
Remark: N	eported	
IY Hist Spills:		
Region of Spill:	3	
Spill Number:	8803623	
Investigator:	D. SLINGERLAND	
Caller Name:	Not reported	
Caller Agency: Caller Phone:	Not reported	
	Not reported	
Notifier Name:	Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Spill Date/Time:	07/26/1988 15:00	
Reported to Dept Da		
SWIS:	55	
Spiller Name:	Not reported	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Address:	Not reported	
Spiller City,St,Zip:	Not reported	
Spill Cause:	Human Error	
Reported to Dept:	On Land	
Water Affected:	Not reported	
Spill Source:	01	
Spill Notifier:	Responsible Party	
PBS Number:	Not reported	
Cleanup Ceased:	08/03/88	
Cleanup Meets Std:	True	
Last Inspection:	//	
Recommended Pen	: Penalty Not Recommended	
Spiller Cleanup Dt:	//	
Enforcement Date:		
Invstgn Complete:		
UST Involvement:	False	
Spill Class:	Not reported	
Spill Closed Dt:	08/03/88	
Corrective Action Pl		
	mary to Central Office: / /	
Date Spill Entered I		
Date Spill Entered I	•	
Update Date:	12/14/88	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed Ta	1	
Gross Leak Rate:	Not reported	
	•	
Material Class Type	Not reported	
Quantity Spilled:	Not reported	
Unkonwn Quantity S		
Units:	Not reported	
Quantity Recovered	Not reported	
Unkonwn Quantity F	overed: Not reported	

Map ID Direction			MAP FINDINGS		
Distance Distance (ft Elevation	.) Site			Database(s)	EDR ID Number EPA ID Number
	POLY CHROME PL	ANT (Continued)			S102153182
	Material: Class Type: Times Material CAS Number: Last Date: DEC Remarks: Remark:	Not reporte Not reporte Entry In File: Not reporte Not reporte Not reporte 11/29/95: This is additio translation of the old spi NO ACTION -HAD GON LEFT MESSAGE 9:05 A	d d d d onal information about material spilled fro	CALLED DOT ANSWE	RING MACHINE.
A13 ESE < 1/8 65 ft.	POLYCHROME COI 2 ASHBURTON AVE YONKERS, NY 107	Ε		ICIS	1009286503 N/A
	Site 13 of 21 in clus	ter A			
Relative: Equal Actual:	ICIS: EFA Enforceme ICIS Facility ID		-0154		
9 ft.		ent Action Type: RCRA 3 6/29/199	008A AO For Comp And/Or Penalty 95 0:00 HESTER		
A14 NNE < 1/8 69 ft.	POLYCHROME CO 137 ALEXANDER S YONKERS, NY 107	т		RCRA-SQG FINDS RAATS NY MANIFEST	1000441180 NYD001833847
	Site 14 of 21 in cluster A			NT MANIFEST	
Relative: Higher	RCRAInfo: Owner: SUN CHEMICAL CORP				
Actual: 11 ft.	EPA ID:	(212) 555-1212 NYD001833847			
	Contact:	Not reported			
	Classification: TSDF Activities	Small Quantity Generator S: Not reported	r		
	Violation Status	s: Violations exist			
	Regulation Vid Area of Violati Date Violation Actual Date A	ion:	Not reported GENERATOR-ALL REQUIREMENTS 06/15/1990 11/01/1990	(OVERSIGHT)	
	Enforcemen Enforcemen Penalty Typ	at Action Date:	WRITTEN INFORMAL 07/27/1990 Not reported		
	Regulation Vio Area of Violati Date Violation Actual Date A	ion:	Not reported GENERATOR-ALL REQUIREMENTS 09/07/1988 11/29/1988	(OVERSIGHT)	
	Enforcemen Enforcemen Penalty Typ	at Action Date:	WRITTEN INFORMAL 09/30/1988 Not reported		

Database(s)

EDR ID Number EPA ID Number

1000441180

POLYCHROME CORP (Continued)

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type: Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) 03/04/1987 11/29/1988 FINAL 3008(A) COMPLIANCE ORDER

03/25/1988

Final Monetary Penalty

INITIAL 3008(A) COMPLIANCE ORDER 06/30/1987 Final Monetary Penalty

Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) 03/04/1987 11/29/1988

FINAL 3008(A) COMPLIANCE ORDER 03/25/1988 Final Monetary Penalty

Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) 07/26/1984 01/30/1985

WRITTEN INFORMAL 10/05/1984 Not reported

There are 5 violation record(s) reported at this site:

		Date of
Evaluation	Area of Violation	Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19901101
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19881129
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19881129
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19881129
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19850130

FINDS:

Other Pertinent Environmental Activity Identified at Site

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or Date of

Database(s) EPA II

EDR ID Number EPA ID Number

POLYCHROME CORP (Continued)

1000441180

dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST: Document ID: Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Year: Facility Type: EPA ID: Facility Name: Facility Address: Facility City: Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone:

NYA1396485 С PLATE# Not reported 850411 850413 Not reported 850413 850415 850425 NYD001833847 NYD000824334 Not reported NYD000824334 F003 - UNKNOWN 02585 G - Gallons (liquids only)* (8.3 pounds) 047 DM - Metal drums, barrels B Incineration, heat recovery, burning. 100 85 Generator NYD001833847 POLYCHROME CORPORATION **137 ALEXANDER AVE** YONKERS Not reported Not reported WESTCHESTER POLYCHROME CORPORATION JACK AZAR 222 BRIDGE PLAZA SOUTH FT LEE NJ 07024 Not reported Not reported

<u>Click this hyperlink</u> while viewing on your computer to access 151 additional NY MANIFEST: record(s) in the EDR Site Report.

000-000-0000

Database(s)

EDR ID Number EPA ID Number

A15 NE < 1/8	HUDSON STAGE-KATE&LEOPOLD OTIS INC 233 ALEXANDER ST YONKERS, NY 10701		RCRA-SQG FINDS NY MANIFEST	1004761924 NYR000091777
103 ft. Relative:	Site 15 of 21 in cl	uster A		
Higher	RCRAInfo: Owner:	BICC CABLES CORP		

Actual:	e mien	(845) 708-0885
12 ft.	EPA ID:	NYR000091777
	Contact:	Not reported
	Classification: TSDF Activities	Small Quantity Generator : Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID:	NJA3093980
Manifest Status:	Not reported
Trans1 State ID:	NY0001031814
Trans2 State ID:	NJ000027193
Generator Ship Date:	12/01/2000
Trans1 Recv Date:	12/01/2000
Trans2 Recv Date:	12/08/2000
TSD Site Recv Date:	12/11/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000091777
Trans1 EPA ID:	NJD002200046
Trans2 EPA ID:	Not reported
TSDF ID:	40317AENY
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	01200
Units:	P - Pounds
Number of Containers:	003
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	00
Facility Type:	Generator
EPA ID:	NYR000091777
Facility Name:	DELAWARE BLUESTEEL INC
Facility Address:	233 ALEXANDER ST
Facility City:	YONKERS
Facility Zip 4:	Not reported
Country:	USA
-	

Database(s)

EDR ID Number EPA ID Number

1004761924

County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone: WESTCHESTER DELAWARE BLUESTEEL INC KYAN VINIOTTS 110 LEROY ST NEW YORK NY 10014 Not reported USA 914-423-8104

<u>Click this hyperlink</u> while viewing on your computer to access 1 additional NY MANIFEST: record(s) in the EDR Site Report.

A16 NE < 1/8 103 ft.	ON THE STREET 233 ALEXANDER ST YONKERS, NY	NY Spills S	6106382640 N/A
	Site 16 of 21 in cluster A		
Relative: Higher	NY Spills:	249196	
Actual: 12 ft.	Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Spill Class: Spill Class: Spill Class Spill Class Spill Class Spill Class Spill Class Spill Class Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Spiller Phone: Contact Name: Contact Phone: DEC Region:	02/17/04 JOSEPHINE BROWN AMERICAN AMBULETTE CORP 233 ALEXANDER ST YONKERS, NY 001 (917) 848-8734 JOSEPHINE BROWN (917) 848-8734 3	
	Program Number:	0312521	

EDR ID Number EPA ID Number

ON THE STREET	(Continued)
---------------	-------------

-	
DER Facility ID:	203753
Site ID:	248186
Operable Unit ID	: 877770
Operable Unit:	01
Material ID:	497721
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affecte	ed: Surface Water
Oxygenate:	False
DEC Remarks:	Start CallerRemark - 0312521 Material was pumped from a parking lot with bad
	drainage into the Hudson River. All other info is unknown at this time. END
	CallerRemark - 0312521
Remark:	Start DECRemark - 0312521 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "O'DEE" END DECRemark - 0312521

A17 NNE < 1/8 202 ft.	EXCELSIOR PACKAGING GRO 159 ALEXANDER ST YONKERS, NY Site 17 of 21 in cluster A	OUP	NY Spills	S106721377 N/A
Relative:				
Higher	NY Spills:			
	Site ID:	332788		
Actual:	Facility Addr2:	Not reported		
16 ft.	Facility ID:	0408137		
	Spill Number:	0408137		
	Facility Type:	ER		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	JBODee		
	Referred To:	WCHD		
	Spill Date:	10/14/04 10/22/04		
	Reported to Dept: CID:	10/22/04		
	Spill Cause:	Housekeeping		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Fire Department		
	Cleanup Ceased:			
	Cleanup Meets Std:	True		
	Last Inspection:	//		
	Recommended Penalty:	Penalty Not Recommended		
	UST Trust:	False		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Res	soonse Willin	n
		Responsible Party. Corrective action taken.		9
	Spill Closed Dt:	12/10/04		
	Remediation Phase:	0		
	Date Entered In Computer	-		
	Spill Record Last Update:			
	Spiller Name:	ALEX SAHA		
	Spiller Company:	EXCELSIOR PACKAGING GROUP		
	Spiller Address:	159 ALEXANDER ST		
	Spiller City, St, Zip:	YONKERS, NY		

S106382640

Database(s)

Database(s)

EDR ID Number EPA ID Number

CELSIOR PACKAG	ING GROUP (Continued)	S106721377
Spiller Company: Spiller Phone:	() -	
Contact Name:	ALEX SAHA	
Contact Phone:	Not reported	
DEC Region:	3	
Program Number		
DER Facility ID:	268004	
Site ID:	332788	
Operable Unit ID		
Operable Unit:	01	
Material ID:	575129	
Material Code:	0064A	
Material Name:	UNKNOWN MATERIAL	
Case No.:	Not reported	
Material FA:	Other	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affecte	d: Soil	
Oxygenate:	False	
DEC Remarks:	Start CallerRemark - 0408137 Material: N-Propanol, N-Propylacetate. END CallerRemark - 0408137	
Remark:	Start DECRemark - 0408137 12/10/04 Clean up completed. Spill file closed by Fred Beck of the Westchester County Health Dept. No further action is required at this time. jbo END DECRemark - 0408137	

A18 NNE < 1/8 204 ft.	EXCELSIAR TRANS.BAG COR 159 ALEXANDER STREET YONKERS, NY)1341341 /A
204 11.	Site 18 of 21 in cluster A		
Relative: Higher Actual: 16 ft.	Site 18 of 21 in cluster A LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	206496 08/13/94 Not reported 9406513 9406513 6018 3 tdghiosa Not reported 08/13/94 17 Tank Test Failure Not reported Commercial/Industrial Responsible Party / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
	Spill Closed Dt: Remediation Phase: Date Entered In Computer	1	

Database(s)

EDR ID Number EPA ID Number

EXCELSIAR TRANS.BAG COR	P. (Continued) S101341341
Spill Record Last Update:	12/02/03
Spille Namer:	Not reported
Spiller Company:	SAME
Spiller Phone:	(516) 472-4000
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9406513
DER Facility ID:	171437
Site ID:	206496
Operable Unit ID:	1000937
Operable Unit:	01
Material ID:	379549
Material Code:	
Material Name:	UNKNOWN PETROLEUM
Case No.: Material FA:	Not reported Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	206496
Spill Tank Test:	17614
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 9406513 TOP OF TANK IS CORRODED PUMPING TANK WILL REMOVE
Descal	MONDAY END CallerRemark - 9406513
Remark:	Start DECRemark - 9406513 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" 09/27/95: This is additional information about
	material spilled from the translation of the old spill file: TANK TEST. END DECRemark - 9406513
	BEORGHAIK 9400313
HIST LTANKS:	3
Region of Spill: Spill Number:	9406513
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	08/13/1994

Database(s)

EDR ID Number EPA ID Number

S101341341

EXCELSIAR TRANS.BAG CORP. (Continued)

Spill Time: 11:00 Reported to Department Date: 08/13/94 Reported to Department Time: 13:25 SWIS: 55 Spiller Contact: Not reported . Spiller Phone: Not reported Spiller Extention: Not reported SAME Spiller Name: Spiller Address: Not reported Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: (516) 472-4000 Not reported Facility Extention: Spill Cause: Tank Test Failure **Resource Affectd:** Groundwater Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: **Responsible Party** PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 Penalty Not Recommended Recommended Penalty: Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 08/17/94 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: UNKNOWN PETROLEUM UNKNOWN PETROLEUM Class Type: Times Material Entry In File: 16414 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST. TOP OF TANK IS CORRODED PUMPING TANK WILL REMOVE MONDAY Spill Cause:

EDR ID Number Database(s) EPA ID Number

A19 NNE < 1/8 204 ft.	BJ CORPORATION 159 ALEXANDER STREET YONKERS, NY 10701		NY UST	U003994374 N/A
204 ft.	Site 19 of 21 in cluster A			
Relative:				
Higher	UST:	0.000070		
Actual:	PBS Number: Tank Number:	3-028878 1		
Actual. 16 ft.	Tank Status:	Closed-Removed		
	Capacity:	2000 INSTALL DATE 12/01/1981		
	Pipe Location:	Aboveground: 10% or more below ground		
	Pipe Type:	Steel/Iron		
	2nd Containment:	None		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Underground		
	Pipe Internal Protection:	Rubber Liner		
	Pipe External Protection:	None Steel/Carbon Steel		
	Tank Type: Tank Internal Protection:	Rubber Liner		
	Tank External Protection:	None		
	Date Last Tested / Next Test:			
	Date Tank Closed / Category:			
	Leak Detection:	None		
	Overfill Protection:	Product Level Gauge		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	BJ Corp		
	Phone: In-service Capacity:	(914) 968-1300 0		
	Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	0		
	Old Pbs Number:	Not reported		
	Last Inspected: Emergency Name:	Not reported Not reported		
	Emergency Phone:	Not reported		
	Owner Name:	BJ Corporation		
	Owner Address:	159 Alexander Street		
	Owner Phone:	(914) 968-1300		
	Owner Type:	CORPORATE/COMMERCIAL		
	Owner City,St,Zip:	Yonkers, NY 10701		
	Mail Company:	BJ Corporation		
	Mail Address:	159 Alexander Street		
	Mail Address:	Not reported		
	Mail City,St,Zip: Attention:	Yonkers, NY 10701 Not reported		
	Mail Phone:	(914) 968-1300		
	Capacity:	2000		
	Date Last Tested:	Not reported		
	Next Test Date:	Not reported		
	Category:	A		
	Install Date:	12/01/1981		

EDR ID Number Database(s) EPA ID Number

BJ CORPORATION (Continued)	BJ CORPORATION (Continued)		
Date Tank Was Closed: 8/1/1997			
	NY Spills	S104643381	
137 ALEXANDER ST. 3 YONKERS, NY ft.	NY Hist Spills	N/A	
Site 20 of 21 in cluster A			
tive: ner NY Spills:			
Site ID: 127959 al: Facility Addr2: Not reported			
, , , , , , , , , , , , , , , , , , , ,			
Facility ID: 8905788 Spill Number: 8905788			
Facility Type: ER			
SWIS: 6018			
Region of Spill: 3			
Investigator: tdghiosa			
Referred To: Not reported			
Spill Date: 09/12/89			
Reported to Dept: 09/12/89			
CID: 17			
Spill Cause: Unknown Water Affected: HUDSON RIVER			
Spill Source: Unknown			
Spill Notifier: Affected Persons			
Cleanup Ceased: 03/11/91			
Cleanup Meets Std: True			
Last Inspection: 03/11/91			
Recommended Penalty: Penalty Not Recommended			
UST Trust: False			
Spill Class: Possible release with minimal potential for fire or hazard o		vith	
no damage. No DEC Response. No corrective action requ	iired.		
Spill Closed Dt: 03/11/91			
Remediation Phase: 0 Date Entered In Computer: 09/21/89			
Spill Record Last Update: 09/26/03			
Spiller Name: Not reported			
Spiller Company: Not reported			
Spiller Address: Not reported			
Spiller City,St,Zip: ***Update***, ZZ			
Spiller Company: 001			
Spiller Phone: Not reported			
Contact Name: Not reported			
Contact Phone: Not reported			
DEC Region: 3 Program Number: 8905788			
Program Number: 8905788 DER Facility ID: 110427			
Site ID: 127959			
Operable Unit ID: 930979			
Operable Unit: 01			
Material ID: 446192			
Material Code: 0008			
Material Name: Diesel			
Case No.: Not reported			
Material FA: Petroleum			
Quantity: 0.00			
Units: Gallons			
Recovered: 0.00			

(Continued)

Resource Affected:

Oxygenate:

Remark:

NY Hist Spills: Region of Spill:

Spill Number:

Investigator:

Caller Name:

Caller Agency:

Caller Phone:

Notifier Name:

DEC Remarks:

EDR ID Number Database(s) EPA ID Number

		S104643381
ed: S	urface Water	
	alse	
Start Caller AND BELIE CORRODE END Caller Start DECF DEC Field MONITORI additional in	Remark - 8905788 SPOKE W/BILL SCHNEIDER OF WCHD. HE WAS AT EVES THAT POLYCHROME COULD BE DISCHARGING MATERIAL INTO IS THE PIPING. WCHD IS DIE TESTING. WCHD ALSO CONTACT CESA Remark- 8905788 Remark - 8905788 Prior to Sept, 2004 data translation this spill Lead was "GHIOSAY" 03/11/91: SEWER PIPE WAS REPLACED AND DEF IS	SEWER LINE THE
	3	
	8905788	
	TODD GHIOSAY	
	Not reported	
	09/12/1989 11:00	
Date/Time:		
	55	
	Not reported	
:	Not reported	
	Unknown	
	Surface Water	
	HUDSON RIVER	

nouller marile.	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	09/12/1989 11:00
Reported to Dept Date/Time:	09/12/89 15:37
SWIS:	55
Spiller Name:	Not reported
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	Surface Water
Water Affected:	HUDSON RIVER
Spill Source:	12
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	03/11/91
Cleanup Meets Std:	True
Last Inspection:	03/11/91
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	//
Enforcement Date:	//
Invstgn Complete:	//
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	03/11/91
Corrective Action Plan Submit	ted: / /
Date Region Sent Summary to	Central Office: / /
Date Spill Entered In Compute	
Date Spill Entered In Compute	
Update Date:	03/11/91
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported

Map ID Direction			MAP FINDINGS		
Distance Distance (ft Elevation	.) Site			Database(s)	EDR ID Number EPA ID Number
	(Continued)				S104643381
	Gross Leak Rate	e:	Not reported		
	Material Class T	ype:	Petroleum		
	Quantity Spilled:		0		
	Unkonwn Quantity Spilled:		False		
	Units:		Gallons		
	Quantity Recovered:		0		
	Unkonwn Quantity Recovered		d:False		
	Material:		DIESEL		
	Class Type:		DIESEL		
	Times Material E	Entry In File:	10625		
	CAS Number:		Not reported		
	Last Date:		19940728		
	DEC Remarks:		SEWER PIPE WAS REPLACED AND DEF IS MONITO		WAS
			AND CLOSED. 09/27/95: This is additional informa		
		material sp	•	E	
		GREEN	PAINT MAT.		
	Remark:	· · · · · · · · · · · · · · · · · · ·	/BILL SCHNEIDER OF WCHD. HE WAS AT SCENE A E DISCHARGING MATERIAL INTO SEWER LINE THE		

DIE TESTING. WCHD ALSO CONTACT C. MANFREDI.

A21	POLYCHROME CORP.

AZI	PULICHROWE CORP.
NNE	137 ALEXANDER STREET

< 1/8	YONKERS, NY 10702
236 ft.	
	Site 21 of 21 in cluster A
Relative: Higher	CBS AST:

Higher

CBS Number: 3-000181 STATE Actual: Region: 18 ft. ICS Number: 3-178970 PBS Number: Not reported MOSF Number: Not reported Telephone: (201) 224-2400 Facility Town: YONKERS (C) POLYCHROME CORP. Operator: **Emrgncy Contact:** JACK AZAR Emrgncy Phone: (201) 224-2400 Certified Date: 12/02/1994 07/18/1995 Expiration Date: POLYCHROME CORP. Owner Name: Owner Address: 222 BRIDGE PLAZA SOUTH Owner City, St, Zip: FORT LEE, NJ 07024 Owner Telephone: (201) 224-2400 Corporate/Commercial Owner type: Facility Type: MANUFACTURING Mail Name: POLYCHROME CORP. Mail Contact Addr: 222 BRIDGE PLAZA SOUTH Not reported Mail Contact Addr2: JACK AZAR Mail Contact Contact: Mail Contact City, St, Zip: FORT LEE, NJ 07024 Mail Phone: (201) 224-2400 SPDES Number: Not reported Facility Status: ACTIVE FACILITY

Owner Sub Type:

Tank Type:

Install Date: CAS Number:

Substance:

Not reported

Single Hazardous Substance on DEC List

Other 00/00

7664939

NY CBS AST S102153798 **NY Spills** N/A NY Hist Spills

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

	initiada)
Tank Location:	ABOVEGROUND
Intrnl Protection:	Rubber Liner
Extrnl Protection:	Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	STAINLESS STEEL ALLOY
Pipe Internal:	None
	0
Pipe External:	•
Pipe Containment:	None
Tank Containment:	Diking
Leak Detection:	None
Overfill Protection:	Catch Basin
Haz Percent:	100
Chemical:	Sulfuric acid
Tank Closed:	10/94
Capacity (Gal):	3000
Total Tanks:	0
Tank Secret:	False
Date Entered:	07/18/1989
Date Entered:	07:00:09
Last Test:	Not reported
Due Date:	Not reported
Tank Error Status:	No Missing Data
SWIS Code:	5518
Lat/Long:	40 56 01 / 73 54 10
Pipe Flag:	False
Federal ID:	Not reported
Is Updated:	F
Renew Date:	04/01/93
Is it There:	F
Deliquent:	F
Date Expired:	07/18/95
Owner Mark:	1
Tank Status:	0
Certificate Needs to be	Printed: False
Fiscal Amt for Registrat	
Renewal Has Been Prir	
Pre-Printed Renewal Ap	
Total Capacity of All Ac	
Unique Tank Id Number	
CBS Number:	3-000181
Region:	STATE
ICS Number:	3-178970
PBS Number:	Not reported
MOSF Number:	Not reported
Telephone:	(201) 224-2400
Facility Town:	YONKERS (C)
Operator:	POLYCHROME CORP.
Emrgncy Contact:	JACK AZAR
Emrgncy Phone: Certified Date:	(201) 224-2400
	12/02/1994
Expiration Date:	07/18/1995
Owner Name:	POLYCHROME CORP.
Owner Address:	222 BRIDGE PLAZA SOUTH
Owner City,St,Zip:	FORT LEE, NJ 07024
Owner Telephone:	(201) 224-2400
Owner type:	Corporate/Commercial

S102153798

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S102153798

POLYCHROME CORP. (Continued)

ICS Number:

Facility Type: MANUFACTURING Mail Name: POLYCHROME CORP. Mail Contact Addr: 222 BRIDGE PLAZA SOUTH Mail Contact Addr2: Not reported Mail Contact Contact: JACK AZAR Mail Contact City, St, Zip: FORT LEE, NJ 07024 Mail Phone: (201) 224-2400 SPDES Number: Not reported Facility Status: ACTIVE FACILITY Owner Sub Type: Not reported Tank Type: Fiberglass coated steel Install Date: 06/86 7664939 CAS Number: Substance: Single Hazardous Substance on DEC List ABOVEGROUND Tank Location: Intrnl Protection: None Extrnl Protection: Fiberalass Aboveground Pipe Location: Pipe Type: PLASTIC Pipe Internal: None Pipe External: 0 Pipe Containment: None Tank Containment: Dikina Leak Detection: None High Level Alarm **Overfill Protection:** Haz Percent: 24 Chemical: Sulfuric acid Tank Closed: 10/94 4000 Capacity (Gal): Total Tanks: 0 Tank Secret: False Date Entered: 07/18/1989 Date Entered: 07:00:29 Last Test: Not reported Not reported Due Date: Tank Error Status: No Missing Data SWIS Code: 5518 40|56|01 / 73|54|10 Lat/Long: Pipe Flag: False Federal ID: Not reported Is Updated: F Renew Date: 04/01/93 Is it There: F F Deliquent: Date Expired: 07/18/95 Owner Mark: Tank Status: 0 Certificate Needs to be Printed: False Fiscal Amt for Registration Fee Correct: True Renewal Has Been Printed for Facility: True Pre-Printed Renewal App Last Printed: 04/01/1993 Total Capacity of All Active Tanks(gal): 0 Unique Tank Id Number: 00027 **CBS Number:** 3-000181 Region: STATE

3-178970

TC1784877.2s Page 48

Database(s)

EDR ID Number EPA ID Number

S102153798

POLYCHROME CORP. (Continued)

PBS Number: Not reported MOSF Number: Not reported (201) 224-2400 Telephone: Facility Town: YONKERS (C) POLYCHROME CORP. Operator: **Emrgncy Contact:** JACK AZAR Emrgncy Phone: (201) 224-2400 Certified Date: 12/02/1994 Expiration Date: 07/18/1995 **Owner Name:** POLYCHROME CORP. **Owner Address:** 222 BRIDGE PLAZA SOUTH Owner City, St, Zip: FORT LEE, NJ 07024 Owner Telephone: (201) 224-2400 Owner type: Corporate/Commercial Facility Type: MANUFACTURING POLYCHROME CORP. Mail Name: Mail Contact Addr: 222 BRIDGE PLAZA SOUTH Mail Contact Addr2: Not reported Mail Contact Contact: JACK AZAR Mail Contact City, St, Zip: FORT LEE, NJ 07024 Mail Phone: (201) 224-2400 SPDES Number: Not reported Facility Status: ACTIVE FACILITY Owner Sub Type: Not reported Tank Type: Stainless steel alloy Install Date: 06/86 CAS Number: 1310732 Substance: Single Hazardous Substance on DEC List ABOVEGROUND Tank Location: Rubber Liner Intrnl Protection: Jacketed Extrnl Protection: Pipe Location: Aboveground Pipe Type: STAINLESS STEEL ALLOY Pipe Internal: None 0 Pipe External: Pipe Containment: None Tank Containment: None Leak Detection: None **Overfill Protection:** None Haz Percent: 25 Chemical: Sodium hydroxide 00/00 Tank Closed: Capacity (Gal): 4500 Total Tanks: 0 Tank Secret: False 07/18/1989 Date Entered: Date Entered: 07:00:51 Last Test: Not reported Due Date: Not reported No Missing Data Tank Error Status: SWIS Code: 5518 Lat/Long: 40|56|01 / 73|54|10 False Pipe Flag: Federal ID: Not reported Is Updated: F Renew Date: 04/01/93 Is it There: F

TC1784877.2s Page 49

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP. (Continued)

	linueuj	
Deliquent:	F	
Date Expired:	07/18/95	
Owner Mark:	1	
Tank Status:	0	
Certificate Needs to be	-	False
Fiscal Amt for Registrati		
Renewal Has Been Prin		True
Pre-Printed Renewal Ap		04/01/1993
	•	
Total Capacity of All Act		0
Unique Tank Id Number	•	00028
	0.000404	
CBS Number:	3-000181	
Region:	STATE	
ICS Number:	3-178970	
PBS Number:	Not reported	
MOSF Number:	Not reported	
Telephone:	(201) 224-2400	
Facility Town:	YONKERS (C)	
Operator:	POLYCHROME	CORP.
Emrgncy Contact:	JACK AZAR	
Emrgncy Phone:	(201) 224-2400	
Certified Date:	12/02/1994	
Expiration Date:	07/18/1995	
Owner Name:	POLYCHROME	CORP.
Owner Address:	222 BRIDGE PI	LAZA SOUTH
Owner City,St,Zip:	FORT LEE, NJ	07024
Owner Telephone:	(201) 224-2400	
Owner type:	Corporate/Com	mercial
Facility Type:	MANUFACTUR	ING
Mail Name:	POLYCHROME	CORP.
Mail Contact Addr:	222 BRIDGE PI	LAZA SOUTH
Mail Contact Addr2:	Not reported	
Mail Contact Contact:	JACK AZAR	
Mail Contact City, St, Zip:	FORT LEE, NJ	07024
Mail Phone:	(201) 224-2400	
SPDES Number:	Not reported	
Facility Status:	ACTIVE FACILI	ITY
Owner Sub Type:	Not reported	
Tank Type:	Stainless steel a	alloy
Install Date:	06/86	
CAS Number:	1310732	
Substance:	Single Hazardo	us Substance on DEC List
Tank Location:	ABOVEGROUN	1D
Intrnl Protection:	Rubber Liner	
Extrnl Protection:	Jacketed	
Pipe Location:	Aboveground/U	nderground Combination
Pipe Type:	NONE	
Pipe Internal:	None	
Pipe External:	0	
Pipe Containment:	None	
Tank Containment:	None	
Leak Detection:	None	
Overfill Protection:	None	
Haz Percent:	25	
Chemical:	Sodium hydroxi	de
Tank Closed:	02/94	
Capacity (Gal):	4500	
/		

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP. (Continued)

Date Entered:08Date Entered:09	alse /20/1991 :40:35 bt reported
	bt reported
	Dissing Data
	18
Lat/Long: 40	56 01 / 73 54 10
Pipe Flag: Fa	lse
Federal ID: No	ot reported
Is Updated: F	
Renew Date: 04	/01/93
Is it There: F	
Deliquent: F	
•	/18/95
Owner Mark: 1	
Tank Status: 0	
Certificate Needs to be Prin	
Fiscal Amt for Registration	
Renewal Has Been Printed Pre-Printed Renewal App I	
Total Capacity of All Active	
Unique Tank Id Number:	00028
Onique Tank la Number.	00020
NY Spills:	407000
Site ID:	127960
Facility Addr2:	Not reported
Facility ID:	9704871
Spill Number:	9704871
Facility Type: SWIS:	ER 6018
Region of Spill:	3
Investigator:	tdghiosa
Referred To:	Not reported
Spill Date:	07/23/97
Reported to Dept:	07/23/97
CID:	17
Spill Cause:	Unknown
Water Affected:	HUDSON RIVER
Spill Source:	Unknown
Spill Notifier:	Local Agency
Cleanup Ceased:	//
Cleanup Meets Std:	True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	07/24/97
Remediation Phase: Date Entered In Computer:	0
•	
Spill Record Last Update: Spiller Name:	07/31/97 Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY

S102153798

Database(s)

EDR ID Number EPA ID Number

POLYCHROME CORP.	(Continue	d) \$102153798
Spiller Company:	99	9
Spiller Phone:	No	ot reported
Contact Name:		RANK BRADLEY
Contact Phone:		14) 285-3364
DEC Region:	3	
Program Number:	97	04871
DER Facility ID:	11	0427
Site ID:	12	7960
Operable Unit ID:	10	48260
Operable Unit:	01	
Material ID:	33	4109
Material Code:	00	64A
Material Name:	10	NKNOWN MATERIAL
Case No.:	No	ot reported
Material FA:	Ot	her
Quantity:	0.0	
Units:		allons
Recovered:	0.0	
Resource Affected		Irface Water
Oxygenate:		lse
		Remark - 9704871 CALLER WAS FLYIONG OVERHEAD IN HELICOPOTER WHEN
		60 x 40 YARD SHEEN ON RIVER EMENATING IKN AREA-LANDMARKS-ACROSS ST
		NKERS JAIL. BEHIND SOCIAL SERVICES BLDG-CALLER WAS 800 FT IN AIR WHEN
		EEN-MRBRADLEYS PAGER# (914) 284-0850 END CallerRemark - 9704871
		emark - 9704871 Prior to Sept, 2004 data translation this spill Lead
	INDUSTRIA	vas "GHIOSAY" 07/23/97 UNABLE TO ACCESS RIVER ON EVENING OF 7/23/97
		AL AREA LOCKED FENCING ALONG RIVERSIDE; ATI TERMINAL ON R ST. WCHD WILL FOLLOW UP DURING DAYLIGHT HOURS AND
		REPORT TO DEC: 07/24/97 FRANK BRADLEY INVESTIGATED FURTHER AND
	FOUND NC	
	PIPELINE;	END DECRemark - 9704871
NY Hist Spills:		
Region of Spill:		3
Spill Number:		9704871
Investigator:		GHIOSAY
Caller Name:		Not reported
Caller Agency:		Not reported
Caller Phone:		Not reported
Notifier Name:		Not reported
Notifier Agency:		Not reported
Notifier Phone:		Not reported
Spill Date/Time:		07/23/1997 19:33
Reported to Dept [Date/Time:	07/23/97 19:33
SWIS:		55
Spiller Name:		UNKNOWN
Spiller Contact:		Not reported
Spiller Phone:		Not reported
Spiller Contact:		FRANK BRADLEY
Spiller Phone:		(914) 285-3364
Spiller Address:		Not reported
Spiller City,St,Zip:		Not reported
Spill Cause:		Unknown Surface Water
Reported to Dept:		Surface Water
Water Affected: Spill Source:		HUDSON RIVER 12
Spill Notifier:		Local Agency
		Local Ayoney

798

POLYCHROME CORP. (Continued)

PBS Number:

Cleanup Ceased:

Last Inspection:

Cleanup Meets Std:

Spiller Cleanup Dt:

Enforcement Date:

Invstgn Complete:

UST Involvement:

Recommended Penalty:

MAP FINDINGS

Not reported

Penalty Not Recommended

11

11

11

11

11

False

True

Database(s)

EDR ID Number EPA ID Number

S102153798

Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 07/24/97 Spill Closed Dt: Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 07/23/97 Date Spill Entered In Computer Data File: Not reported 07/31/97 Update Date: Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Raw Sewage Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True UNKNOWN MATERIAL Material: Class Type: UNKNOWN MATERIAL Times Material Entry In File: 9140 CAS Number: Not reported Last Date: 19941109 07/23/97 UNABLE TO ACCESS RIVER ON EVENING OF 7/23/97 INDUSTRIAL **DEC Remarks:** AREA LOCKED FENCING ALONG RIVERSIDE; ATI TERMINAL ON ALEXANDER ST. WCHD WILL FOLLOW UP DURING DAYLIGHT HOURS AND FORWARD REPORT TO DEC: 07/24/97FRANK BRADLEY INVESTIGATED FURTHER AND FOUND NOTHING; MAY GO BACK AT LOW TIDE TO CHECK FOR SBMERGED PIPELINE; Remark: CALLER WAS FLYIONG OVERHEAD IN HELICOPOTER WHEN NOTICED A 60 x 40 YARD SHEEN ON RIVER EMENATING IKN AREA-LANDMARKS-ACROSS ST FROM YONKERS JAIL. BEHIND SOCIAL SERVICES BLDG-CALLER WAS 800 FT IN AIR WHEN REPORT SEEN-MR BRADLEYS PAGER 914) 284-0850 B22 A. TERICONE OR ALEXANDER ST TERMINAL 91 ALEXANDER ST YONKERS ERNS 98436739 South A. TERICONE OR ALEXANDER ST TERMINAL 91 ALEXANDER ST YONKERS N/A YONKERS, NY < 1/8 325 ft. Site 1 of 3 in cluster B **Relative:** Lower Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report. Actual: 5 ft.

TC1784877.2s Page 53

Map ID Direction		MAP FINDINGS		
Distance Distance (ft. Elevation) Site		Database(s)	EDR ID Number EPA ID Number
B23 South < 1/8 325 ft.	A.T.I. MAJOR STORAGE TERM A.T.I. MAJOR STORAGE TERM YONKERS, NY		ERNS	98436708 N/A
Relative: Lower	Site 2 of 3 in cluster B	hyperlink while viewing on your computer to access		
Actual: 5 ft.		al ERNS detail in the EDR Site Report.		
C24 NNE < 1/8 341 ft.	ATI,YONKER 91 ALWXEANDER ST YONKERS, NY		NY Spills NY Hist Spills	S102152946 N/A
Relative: Higher	Site 1 of 12 in cluster C NY Spills:			
Actual:	Site ID: Facility Addr2:	269869 Not reported		
Actual: 21 ft.	Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Spill Closed Dt: Remediation Phase:	Not reported 8709628 8709628 ER 6018 3 dxtraver Not reported 02/13/88 02/13/88 17 Equipment Failure Not reported Major Facility > 400,000 gal Other 11/28/89 True / / Penalty Not Recommended False Known release that creates potential for fire or hazard. Responsible Party. Corrective action taken. 11/28/89 0	DEC Response. Willir	ŋġ
	Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address:	02/16/88 02/14/06 Not reported MICK BOMBASE,ATI Not reported		
	Spiller City,St,Zip: Spiller Company: Spiller Phone: Contact Name: Contact Phone: DEC Region: Program Number: DER Facility ID: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name:	ZZ 001 (914) 964-9866 Not reported Not reported 3 8709628 135279 269869 914688 01 461424 0003 #6 Fuel Oil		

Database(s)

EDR ID Number EPA ID Number

946

ATI,YONKER (Continu	ied)		S10215294
Case No.:	N	ot reported	
Material FA:		etroleum	
Quantity:	10	00.00	
Units:	G	allons	
Recovered:	0.	00	
Resource Affected	l: S	oil	
Oxygenate:	F	alse	
DEC Remarks:	Start Caller	Remark - 8709628 SPILL WAS CAONTAINED IN A TANK, TO PUMP TO A	NOTHER
	TANK. LEA	K AT BOTTOM OF FIRST TANK. TANK IS BEING EMPTIED,750K OUT O	F 1 MIL.IN
	TANK.UPD	AT END CallerRemark - 8709628	
Remark:	Start DECF	Remark - 8709628 Prior to Sept, 2004 data translation this spill Lead	
	DEC Field	was "TRAVER" / / : REMARK CONT:ROYAL TANK & EES,JOE	
	MASSALL	ERO-914-948-8076, IN ROUTE. USCG RESPONDING, WCHD NOTIFIED.	END
	DECRema	rk - 8709628	
NV Llist Chillor			
NY Hist Spills:		3	
Region of Spill: Spill Number:		8709628	
Investigator:		TRAVER	
Caller Name:		Not reported	
Caller Agency:		Not reported	
Caller Phone:		Not reported	
Notifier Name:		Not reported	
Notifier Agency:		Not reported	
Notifier Phone:		Not reported	
Spill Date/Time:		02/13/1988 07:50	
Reported to Dept I	Date/Time:	02/13/88 08:43	
SWIS:		55	
Spiller Name:		MICK BOMBASE,ATI	
Spiller Contact:		Not reported	
Spiller Phone:		(914) 964-9866	
Spiller Address:		Not reported	
Spiller City,St,Zip:		Not reported	
Spill Cause:		Equipment Failure	
Reported to Dept:		On Land	
Water Affected:		Not reported	
Spill Source:		01	
Spill Notifier:		Other	
PBS Number:		Not reported	
Cleanup Ceased:		11/28/89	
Cleanup Meets St	J :	True	
Last Inspection:	nolty	/ / Departy Net Recommanded	
Recommended Pe Spiller Cleanup Dt		Penalty Not Recommended / /	
Enforcement Date			
Invstgn Complete:			
UST Involvement:		False	
Spill Class:		Not reported	
Spill Closed Dt:		11/28/89	
Corrective Action I	Plan Submi		
		o Central Office: / /	
Date Spill Entered			
Date Spill Entered			
Update Date:	1	11/29/89	
Is Updated:		False	
PBS Number:		Not reported	
Tank Number:		Not reported	

Database(s)

EDR ID Number EPA ID Number

S102152946

1000457297

NYD002011450

ATI,YONKER (Continued)

Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	1000
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovere	d: False
Material:	#6 FUEL OIL
Class Type:	#6 FUEL OIL
Times Material Entry In File:	2190
CAS Number:	Not reported
Last Date:	19940728
DEC Remarks: / / : REM	ARK CONT:ROYAL TANK EES, JOE MASSALLERO-914-948-8076, IN ROUTE.
USCG RE	SPONDING, WCHD NOTIFIED.
Remark: SPILL WA	S CAONTAINED IN A TANK, TO PUMP TO ANOTHER TANK. LEAK AT BOTTOM OF
FIRST TA	NK. TANK IS BEING EMPTIED,750K OUT OF 1 MIL.IN TANK.UPDAT

C25 EXCELSIOR PACKAGING GROUP FINDS NNE **159 ALEXANDER ST** RCRA-LQG < 1/8 YONKERS, NY 10702 NY MANIFEST 344 ft. **CT MANIFEST** Site 2 of 12 in cluster C **Relative:** FINDS: Higher Other Pertinent Environmental Activity Identified at Site Actual: 21 ft. AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act. FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State. ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and

Compliance Monitoring.

The NEI (National Emissions Inventory) database contains information on

EDR ID Number Database(s)

EPA ID Number

EXCELSIOR PACKAGING GROUP (Continued)

1000457297

stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

RCRAInfo:

Owner: EPA ID: EXCELSIOR TRANSPARENT BAG CO (212) 555-1212 NYD002011450

Contact: Not reported

Classification: Large Quantity Generator TSDF Activities: Not reported

BIENNIAL REPORTS:

Last Biennial Reporting Year: 2003

<u>Waste</u>	Quantity (Lbs)
D001	202272.00

Violation Status: Violations exist

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Regulation Violated: Area of Violation: Date Violation Determined: Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) 05/30/2003 07/29/2003

WRITTEN INFORMAL 06/17/2003 Not reported

WRITTEN INFORMAL 07/29/2003 Not reported

Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) 11/18/2002 07/29/2003

WRITTEN INFORMAL 06/17/2003 Not reported

WRITTEN INFORMAL 07/29/2003 Not reported

Parts372.2/373-3.9 **GENERATOR-ALL REQUIREMENTS (OVERSIGHT)** 08/22/2001

Database(s)

EDR ID Number EPA ID Number

EXCELSIOR PACKAGING GROUP (Continued)

Actual Date Achieved Compliance:	10/05/2001
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	04/07/1999
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	09/07/2001
Penalty Type:	Not reported
Regulation Violated:	6nycrr372.2(a)(8)(i)(a) and 37
Area of Violation:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	04/07/1999
Actual Date Achieved Compliance:	06/10/1999
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	04/07/1999
Penalty Type:	Not reported
Enforcement Action:	WRITTEN INFORMAL
Enforcement Action Date:	09/07/2001
Penalty Type:	Not reported

There are 4 violation record(s) reported at this site:

) reponed at	1113 5110.	
	Evaluation		Area of Violation	Date of Compliance
Compliance Evaluation Inspection		tion	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	20030729
	Compliance Evaluation Inspect	tion	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	20030729
	Compliance Evaluation Inspect	tion	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	20011005
	Compliance Evaluation Inspect	lion	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19990610
	NY MANIFEST:			
	Document ID:	CTF021494	12	
	Manifest Status:	K	12	
	Trans1 State ID:	NJDEPS86	0	
	Trans2 State ID:	Not reporte	-	
	Generator Ship Date:	930826	u	
	Trans1 Recy Date:	930826		
	Trans2 Recy Date:	Not reporte	d	
	TSD Site Recy Date:	930827	u	
	Part A Recy Date:	931008		
	Part B Recv Date:	930924		
	Generator EPA ID:	930924 NYD00201	1450	
	Trans1 EPA ID:	ILD9849082		
	Trans2 EPA ID:	Not reporte	-	
	TSDF ID:	CTD001156		
	Waste Code:		N-LISTED IGNITABLE WASTES	
	Quantity:	03629	-LISTED IGNITABLE WASTES	
	Units:	P - Pounds		
	Number of Containers:	009		
	Container Type:		drums, barrels	
	Handling Method:		on, heat recovery, burning.	
	Specific Gravity:	100	on, neat recovery, burning.	
	Waste Code:	Not reporte	d	
	Quantity:	00692	u	
	Units:	P - Pounds		
	Number of Containers:	001		
	Container Type:		drums, barrels	
	Handling Method:		on, heat recovery, burning.	
	Specific Gravity:	100	on, near recovery, burning.	
	opcome Oravity.	100		

Database(s)

EDR ID Number EPA ID Number

EXCELSIOR PACKAGING GROUP (Continued)

Year: Facility Type: EPA ID: Facility Name: Facility Address: Facility City: Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone:

93 Generator NYD002011450 EXCELSIOR PACKAGING GROUP **159 ALEXANDER STREET** YONKERS Not reported Not reported WESTCHESTER EXCELSIOR PACKAGING GROUP CHARLES LYNCH **159 ALEXANDER STREET** YONKERS NY 10701 Not reported USA 914-968-1300

<u>Click this hyperlink</u> while viewing on your computer to access 118 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST:

1996 Year: CTF0436457 Manifest ID: TSDF EPA ID: CTD001156009 TSDF Name: SAFETY-KLEEN SYSTEMS, INC. **TSDF** Address: 39 COMMUNITY AVE EXT. TSDF City,St,Zip: PLAINFIELD, CT 06374 USA **TSDF** Country: TSDF Telephone: Not reported Transport Date: 01/24/96 Transporter EPA ID: ILD984908202 Transporter Name: SAFETY-KLEEN SYSTEMS, INC. Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: 11 Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: СТ Trans 2 Country: USA Trans 2 Phone: Not reported Generator EPA ID: NYD002011450 Gererator Phone: 9149681300 Generator Address: Not reported Generator City, State, Zip: Not reported Generator Country: Not reported Not reported **Special Handling:** Discrepancies: Not reported Date Shipped: 01/24/96 Date Received: 01/25/96 Last modified date: 04/26/04 Last modified by: IG Comments: Not reported

1000457297

EDR ID Number Database(s) **EPA ID Number EXCELSIOR PACKAGING GROUP (Continued)** 1000457297 Click this hyperlink while viewing on your computer to access 19 additional CT MANIFEST: record(s) in the EDR Site Report. **C R WARNER INC OF NEW YORK** C26 RCRA-SQG 1001028592 91 ALEXANDER ST NE FINDS NYR000008243 < 1/8 YONKERS, NY 10710 NY MANIFEST 435 ft. Site 3 of 12 in cluster C **Relative:** RCRAInfo: Higher HALSTEAD QUINN PROPANE INC Owner: Actual: (914) 666-3200 27 ft. EPA ID: NYR000008243 JAMES MALANOS Contact: (215) 726-4300 Classification: Small Quantity Generator TSDF Activities: Not reported Violation Status: No violations found FINDS: Other Pertinent Environmental Activity Identified at Site RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. NY MANIFEST: Document ID: NJA2276232 Manifest Status: Κ Trans1 S Trans2 S Generate Trans1 F

Trans1 State ID:	S00938
Trans2 State ID:	Not reported
Generator Ship Date:	951028
Trans1 Recv Date:	951028
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	951103
Part A Recv Date:	Not reported
Part B Recv Date:	951117
Generator EPA ID:	NYR000008243
Trans1 EPA ID:	NJD011881174
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002200046
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00900
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	95

Database(s)

RCRA-SQG

NY MANIFEST

CT MANIFEST

FINDS

1001079914

NYR000016212

EDR ID Number **EPA ID Number**

C R WARNER INC OF NEW YORK (Continued)

EPA ID:

Facility City:

Mailing City:

Mailing Zip:

Mailing Zip4:

Mailing City:

Mailing Zip:

Mailing Zip4:

Country:

County:

Both Generator and TSD Facility Type: NYR000008243 Facility Name: C R WARNER INC OF NEW YORK Facility Address: 91 ALEXANDER AVE YONKERS Facility Zip 4: 4230 Not reported WESTCHESTER Mailing Name: CR WARNER INC Mailing Contact: WILLIAM BOWERS Mailing Address: 91 ALEXANDER ST YONKERS Mailing State: NY 10704 4230 Mailing Country: USA Mailing Phone: 908-730-7707 Mailing Name: C R WARNER INC OF NEW YORK Mailing Contact: ROBERT J KRAWIECKI Mailing Address: 91 ALEXANDER AVE YONKERS Mailing State: NY 10704 4230 Mailing Country: USA Mailing Phone: 914-476-7502

> Click this hyperlink while viewing on your computer to access additional NY MANIFEST: detail in the EDR Site Report.

C27 A TARRICONE INC NE **91 ALEXANDER ST** YONKERS, NY 10701 < 1/8 435 ft.

Site 4 of 12 in cluster C

Relative: Higher	RCRAInfo: Owner:	ANTHONY TARRICONE INC
Actual: 27 ft.	EPA ID:	(914) 666-5800 NYR000016212
	Contact:	Not reported
	Classification: TSDF Activities:	Small Quantity Generator Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility

1001028592

TC1784877.2s Page 61

EDR ID Number EPA ID Number

A TARRICONE INC (Continued)

operating permits required under Title V of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:	
Document ID:	CTF0405558
Manifest Status:	С
Trans1 State ID:	T422YA
Trans2 State ID:	Not reported
Generator Ship Date:	951114
Trans1 Recv Date:	951114
Trans2 Recv Date:	Not reported
TSD Site Recy Date:	951114
Part A Recv Date:	Not reported
Part B Recy Date:	951130
Generator EPA ID:	NYR000016212
Trans1 EPA ID:	NJD011881174
Trans2 EPA ID:	Not reported
TSDF ID:	CTD021816889
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Quantity:	04910
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	100
Year:	95
Facility Type:	Generator
EPA ID:	NYR000016212
Facility Name:	A TARRICONE INC
Facility Address:	91 ALEXANDER ST/OIL STOR/AREA
Facility City:	YONKERS
Facility Zip 4:	Not reported
Country:	Not reported
County:	WESTCHESTER
Mailing Name:	A TARRICONE INC
Mailing Contact:	JERRY HERLTHY
Mailing Address:	P O BOX 660
Mailing City:	MOUNT KISCO
Mailing State:	NY
Mailing Zip:	10549
Mailing Zip4:	Not reported
Mailing Country:	Not reported
Mailing Phone:	914-666-5800

Database(s)

EDR ID Number EPA ID Number

A TARRICONE INC (Continued)

1001079914

<u>Click this hyperlink</u> while viewing on your computer to access additional NY MANIFEST: detail in the EDR Site Report.

CT MANIFEST:	
Year:	1995
Manifest ID:	CTF0405558
TSDF EPA ID:	CTD021816889
TSDF Name:	UNITED OIL RECOVERY INC./UIS DBA ADVANCED LIQ. REC
TSDF Address:	136 GRACEY AVE.
TSDF City,St,Zip:	MERIDEN, CT 06451
TSDF Country:	USA
TSDF Telephone:	Not reported
Transport Date:	11/14/95
Transporter EPA ID:	PA0000538827
Transporter Name:	C R WARNER YANKEE POINT TERMINAL
Transporter Country:	USA
Transporter Phone:	Not reported
Trans 2 Date:	//
Trans 2 EPA ID:	Not reported
Trans 2 Name:	Not reported
Trans 2 Address:	Not reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not reported
Generator EPA ID:	NYR000016212
Gererator Phone:	Not reported
Generator Address:	Not reported
Generator City,State,Zip:	Not reported
Generator Country:	Not reported
Special Handling:	Not reported
Discrepancies:	No
Date Shipped:	11/14/95
Date Received:	11/14/95
Last modified date:	04/26/04
Last modified by:	IG
Comments:	Not reported

<u>Click this hyperlink</u> while viewing on your computer to access additional CT MANIFEST: detail in the EDR Site Report.

D28	ΑΤΙ	ER	RNS
SW	ATI		
< 1/8	YONKERS, NY		
441 ft.			
Deletive	Site 1 of 6 in cluster D		
Relative: Lower			
Lowei		perlink while viewing on your computer to access	
Actual:	additional E	RNS detail in the EDR Site Report.	
0 ft.			

ERNS 8861790 N/A

TC1784877.2s Page 63

Map ID Direction	L_	MAP FINDINGS		
Distance				
Distance (ft.	.) Site		Database(s)	EDR ID Number EPA ID Number
Elevation	Sile			
Daa	A T 1		5510	0740000
D29 SW	ATI ATI		ERNS	8712909 N/A
< 1/8	YONKERS, NY			
441 ft.				
Relative:	Site 2 of 6 in cluster D			
Lower	Click this	hyperlink while viewing on your computer to access		
Actual:	additiona	al ERNS detail in the EDR Site Report.		
0 ft.				
D30	ATI OIL FACILITY		NY Spills	S102154008
SW	ALEXANDER STREET		NY Hist Spills	N/A
< 1/8 441 ft.	YONKERS, NY			
	Site 3 of 6 in cluster D			
Relative: Lower	NY Spills:			
	Site ID:	131612		
Actual: 0 ft.	Facility Addr2:	Not reported		
U II.	Facility ID: Spill Number:	9005177 9005177		
	Facility Type:	ER		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator: Referred To:	tdghiosa Not reported		
	Spill Date:	08/09/90		
	Reported to Dept:	08/09/90		
	CID:	Not reported		
	Spill Cause: Water Affected:	Unknown Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Federal Government		
	Cleanup Ceased:	06/18/53		
	Cleanup Meets Std: Last Inspection:	True / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Trust:	False		
	Spill Class: Spill Closed Dt:	Not reported 08/14/90		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:	05/09/91		
	Spiller Name: Spiller Company:	Not reported SAME		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	NY		
	Spiller Company:	001		
	Spiller Phone: Contact Name:	Not reported Not reported		
	Contact Phone:	Not reported		
	DEC Region:	3		
	Program Number:	9005177		
	DER Facility ID: Site ID:	113394 131612		
	Operable Unit ID:	942742		
	Operable Unit:	01		
	Material ID:	436234		
	Material Code: Material Name:	0003 #6 Fuel Oil		
	Case No.:	Not reported		

Database(s)

EDR ID Number EPA ID Number

I OIL FACILITY (Co Material FA:	Petroleum	S10215400
Quantity:	0.00	
Units: Recovered:	Not reported 0.00	
Resource Affected		
	False	
Oxygenate: DEC Remarks:		5177 PRODUCT DISCOVERED DURING ROUTINE INSPECTION 15
		RIVERAT SITE OF RECOVERY SYSTEM END CallerRemark - 9005177
Remark:	Start DECRemark - 9005	Y" END DECRemark - 9005177
NY Hist Spills:		
Region of Spill:	3	
Spill Number:	9005177	
Investigator:	GHIOSAY	
Caller Name:	Not reported	l
Caller Agency:	Not reported	1
Caller Phone:	Not reported	I
Notifier Name:	Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Spill Date/Time:	08/09/1990	11:00
Reported to Dept I	Date/Time: 08/09/90 15	39
SWIS:	55	
Spiller Name:	SAME	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Address:	Not reported	
Spiller City,St,Zip:	Not reported	
Spill Cause:	Unknown	
Reported to Dept:	On Land	
Water Affected:	Not reported	l
Spill Source:	01	
Spill Notifier:	Federal Gov	
PBS Number:	Not reported	
Cleanup Ceased:	06/18/53	
Cleanup Meets St		
Last Inspection:	/ /	
Recommended Pe		Recommended
Spiller Cleanup Dt		
Enforcement Date		
Invstgn Complete:		
UST Involvement:	False	
Spill Class:	Not reported	l
Spill Closed Dt:	08/14/90	
Corrective Action I		
	Summary to Central Offic	
	In Computer Data File:	08/14/90
	In Computer Data File:	Not reported
Update Date:	05/09/91	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed	Fank: Not reported	
Gross Leak Rate:	Not reported	

Map ID Direction		MAP FINDINGS]	
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	ATI OIL FACILITY (Continued)			S102154008
		#6 FUEL OIL #6 FUEL OIL :: 2190 Not reported 19940728	15 FEET FROM HUDSO	DN RIVERAT SITE
D31 SW < 1/8 441 ft.	ATI S/S (FORMER) CROSS COUNTY MALL YONKERS, NY		NY LTANKS NY HIST LTANKS	S100140600 N/A
	Site 4 of 6 in cluster D			
Relative: Lower	LTANKS:			
	Site ID:	61190		
Actual: 0 ft.	Spill Date: Facility Addr2:	08/08/89 Not reported		
0111	Facility ID:	8905103		
	Program Number:	8905103		
	SWIS:	6018		
	Region of Spill:	3 tdahiooo		
	Investigator: Referred To:	tdghiosa Not reported		
	Reported to Dept:	08/22/89		
	CID:	Not reported		
	Spill Cause:	Tank Failure		
	Water Affected: Spill Source:	Not reported Gasoline Station		
	Spill Notifier:	Other		
	Cleanup Ceased:	12/06/93		
	Cleanup Meets Standard:	True		
	Last Inspection: Recommended Penalty:	/ / Depalty Not Recommanded		
	UST Involvement:	Penalty Not Recommended True		
	Spill Class:	Known release with minimal potential for fire or hazar	d. DEC Response. Willi	ng
		Responsible Party. Corrective action taken.		
	Spill Closed Dt: Remediation Phase:	12/06/93 0		
	Date Entered In Computer:	-		
	Spill Record Last Update:	09/02/03		
	Spille Namer:	Not reported		
	Spiller Company:	ATI S/S (FORMER)		
	Spiller Phone: Spiller Extention:	Not reported Not reported		
	Spiller Address:	CROSS COUNTY MALL		
	Spiller City,St,Zip:	YONKERS, NY		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported Not reported		

Database(s)

EDR ID Number EPA ID Number

	nued) \$100140600
DEC Region:	3
Program Number:	8905103
DER Facility ID:	59629
Site ID:	61190
Operable Unit ID:	932855
Operable Unit:	01
Material ID:	445542
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 8905103 5 - 2K GAS 1 - 550 WASTE OIL 1 - 10K GAS, LARRY RICCI WILL INVESTIGATE. TANKS PULLED AND CONTAMINATION FOUND. OWNER WAS TOLD
	CONTACT OFFICE. HE DID NOT. END CallerRemark - 8905103
Remark:	Start DECRemark - 8905103 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" END DECRemark - 8905103
HIST LTANKS:	3
Region of Spill:	
Spill Number:	8905103
Spill Number: Investigator:	8905103 TODD GHIOSAY
Spill Number: Investigator: Caller Name:	8905103 TODD GHIOSAY Not reported
Spill Number: Investigator: Caller Name: Caller Agency:	8905103 TODD GHIOSAY Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone:	8905103 TODD GHIOSAY Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date:	8905103 TODD GHIOSAY Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 12:00
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen	8905103 TODD GHIOSAY Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen Reported to Departmen	8905103 TODD GHIOSAY Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported Not reported
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Extention: Spiller Name:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported Not r
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Extention: Spiller Name: Spiller Name: Spiller Address:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported Not r
Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Extention: Spiller Name:	8905103 TODD GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/08/1989 12:00 nt Date: 08/22/89 nt Time: 16:40 55 Not reported Not r

Database(s)

EDR ID Number EPA ID Number

S100140600

Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Gas Station
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	12/06/93
Cleanup Meets Standard:	True
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	//
Enforcement Date:	
Investigation Complete:	//
UST Involvement:	True
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
•	Responsible Party. Corrective action taken.
Spill Closed Dt:	12/06/93
Date Region Sent Summary	to Central Office: / /
Corrective Action Plan Subm	itted: / /
Date Spill Entered In Compu	ter Data File: 08/31/89
Time Spill Entered In Compu	
Spill Record Last Update:	11/22/94
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovere	d: False
Material:	GASOLINE
Class Type:	GASOLINE
Times Material Entry In File:	21329
CAS Number:	Not reported
Last Date:	19940929
DEC Remarks: Not report	
•	S 1 - 550 WASTE OIL 1 - 10K GAS, LARRY RICCI WILL INVESTIGATE. TANKS
PULLED A	AND CONTAMINATION FOUND. OWNER WAS TOLD TO CONTACT OFFICE. HE DID NOT.

D32 SW < 1/8 441 ft.	ATI LUDLOW MOSF ATI YONKERS, NY	
	Site 5 of 6 in cluster D	
Relative: Lower	NY Spills:	
	Site ID:	163810
Actual:	Facility Addr2:	Not reported
0 ft.	Facility ID:	8312001
	Spill Number:	8312001
	Facility Type:	ER
	SWIS:	6018

NY Spills S102151679 NY Hist Spills N/A ATI LUDLOW MOSF (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Region of Spill:	3
Investigator:	MURTHY
Referred To:	Not reported
Spill Date:	04/01/83
Reported to Dept:	04/01/83
CID:	Not reported
Spill Cause:	Unknown
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Other
Cleanup Ceased:	12/04/95
Cleanup Meets Std:	True
Last Inspection:	
Recommended Penalt	
UST Trust:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
opin oldoo.	Responsible Party. Corrective action taken.
Spill Closed Dt:	12/04/95
Remediation Phase:	0
Date Entered In Comp	
Spill Record Last Upda	
Spiller Name:	
-	Not reported
Spiller Company: Spiller Address:	Not reported Not reported
•	
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001 Not reported
Spiller Phone: Contact Name:	Not reported
	Not reported
Contact Phone:	Not reported
DEC Region:	3
Program Number:	8312001
DER Facility ID:	138158
Site ID:	163810
Operable Unit ID:	893852
Operable Unit:	01
Material ID:	481517
Material Code:	0064A
Material Name:	UNKNOWN MATERIAL
Case No.:	Not reported
Material FA:	Other
Quantity:	0.00
Units:	Pounds
Recovered:	958.00
Resource Affected:	Air
Oxygenate:	False
	reported
Remark: Not	reported
NY Hist Spills:	
Region of Spill:	3
Spill Number:	8312001
Investigator:	MURTHY
Caller Name:	NOR I HY Not reported
	•
Caller Agency:	Not reported
Caller Phone: Notifier Name:	Not reported
	Not reported
Notifier Agency:	Not reported

Database(s)

EDR ID Number EPA ID Number

ATI LUDLOW MOSF (Continued)

Notifier Phone:	Not reported	
Spill Date/Time:	11/11/1911 11:11	
Reported to Dept Date/Time:	//	
SWIS:	55	
Spiller Name:	Not reported	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Address:	Not reported	
Spiller City,St,Zip:	Not reported	
Spill Cause:	Unknown	
Reported to Dept:	Air	
Water Affected:	Not reported	
Spill Source:	12	
Spill Notifier:	Other	
PBS Number:	Not reported	
Cleanup Ceased:	12/04/95	
Cleanup Meets Std:	True	
Last Inspection:		
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Dt:	//	
Enforcement Date:		
Invstgn Complete:		
UST Involvement:	False	
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing	
-F	Responsible Party. Corrective action taken.	
Spill Closed Dt:	12/04/95	
Corrective Action Plan Submit		
Date Region Sent Summary to		
Date Spill Entered In Compute		
Date Spill Entered In Compute		
Update Date:	12/26/95	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed Tank:	Not reported	
Gross Leak Rate:	Not reported	
Material Class Type:	Raw Sewage	
Quantity Spilled:	0	
Unkonwn Quantity Spilled:	False	
Units:	Pounds	
Quantity Recovered:	958	
Unkonwn Quantity Recovered		
Material:	UNKNOWN MATERIAL	
Class Type:	UNKNOWN MATERIAL	
Times Material Entry In File:	9140	
CAS Number:	Not reported	
Last Date:	19941109	
DEC Remarks: Not reported		
Remark: Not reported		
	-	

			L	
Map ID		MAP FINDINGS		
Direction		L		
Distance				
Distance (ft)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
D33	ΑΤΙ		ERNS	8857822
SW	ATI			N/A
< 1/8	YONKERS, NY			
441 ft.				
	Site 6 of 6 in cluster D			
Relative:				
Lower	Clic	<u>k this hyperlink</u> while viewing on your computer to access		
Actual:	ado	litional ERNS detail in the EDR Site Report.		
0 ft.				
011.				
B34	PATCLIN		US BROWNFIELDS	1009400902
South	62 ALEXANDER STREET			N/A
< 1/8	YONKERS, NY 10701			
471 ft.				
	Site 3 of 3 in cluster B			
Relative:				
Lower	US BROWNFIELDS:	Not see estad		
	Recipient Name:	Not reported		
Actual:	Project Name:	Yonkers Indust Dev Agency, NY (A05)		
5 ft.	EPA ID:	Not reported		
	Region Number:	2		
	Latitude:	40.93931		
	Longitude:	-73.90117		
	Assessment Date:	Not reported		
	Clean up Date:	Not reported		
	Entity Type:	Not reported		
C25		עסע	EINIDE	1007000100
C35	FITZPATRICK S AUTO BO	DDY	FINDS	1007809188
NE	93 ALEXANDER ST	DY	FINDS	1007809188 110019717270
NE < 1/8		YDY	FINDS	
NE	93 ALEXANDER ST YONKERS, NY 10701	אַסנ	FINDS	
NE < 1/8	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C	אַסנ	FINDS	
NE < 1/8 472 ft.	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS:		FINDS	
NE < 1/8 472 ft. Relative: Higher	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS:	DDY onmental Activity Identified at Site	FINDS	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro	onmental Activity Identified at Site		
NE < 1/8 472 ft. Relative: Higher	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS	onmental Activity Identified at Site (New York - Facility Information System) is New York's De	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of	
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft.	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of cking environmental	110019717270
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft.	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. C36 NE	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft.	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft.	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Enviro facion ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills:	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac lity information found across the State.	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Enviro faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID:	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac lity information found across the State.	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Enviro faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2:	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac lity information found across the State. 276956 Not reported	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Enviro faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility ID:	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac lity information found across the State. 276956 Not reported 0105383	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Enviro faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number:	onmental Activity Identified at Site (New York - Facility Information System) is New York's De vironmental Conservation (DEC) information system for trac lity information found across the State. 276956 Not reported 0105383 0105383	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type:	276956 Not reported 0105383 0105383 ER	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS:	276956 Not reported 0105383 0105383 ER 6018	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill:	276956 Not reported 0105383 0105383 ER 6018 3	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility Addr2: Facility Type: SWIS: Region of Spill: Investigator:	276956 Not reported 0105383 0105383 ER 6018 3 rdbendel	epartment of cking environmental 	110019717270 S105141621
NE < 1/8 472 ft. Relative: Higher Actual: 31 ft. 31 ft. C36 NE < 1/8 475 ft. Relative: Higher Actual:	93 ALEXANDER ST YONKERS, NY 10701 Site 5 of 12 in cluster C FINDS: Other Pertinent Enviro FIS Env faci ATI MOSF 91 ALEXANDER ST YONKERS, NY Site 6 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill:	276956 Not reported 0105383 0105383 ER 6018 3	epartment of cking environmental 	110019717270 S105141621

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

ATI	MOSF (Continued	d)		S105141621
	Spill Date:		08/17/01	
	Reported to Dept:		08/17/01	
	CID:		17	
	Spill Cause:		Unknown	
	Water Affected:		Not reported	
	Spill Source:		•	
			Major Facility > 400,000 gal Other	
	Spill Notifier: Cleanup Ceased:			
	•		True	
	Cleanup Meets St	lu.	12/28/05	
	Last Inspection: Recommended P	on oltr <i>u</i>	Penalty Not Recommended	
	UST Trust:	enalty.	False	
	Spill Class:		Known release that creates potential for fire or hazard. DEC Response. Willin	~
	Spill Class.			y
	Coll Closed Dt		Responsible Party. Corrective action taken.	
	Spill Closed Dt:		02/14/06	
	Remediation Phas		0	
	Date Entered In C	•		
	Spill Record Last	Update:		
	Spiller Name:		Not reported	
	Spiller Company: Spiller Address:		ATI MOSE	
			91 ALEXANDER ST	
	Spiller City,St,Zip: Spiller Company:		YONKERS, NY 001	
	Spiller Phone:		Not reported	
	Contact Name:		GEORGE KIERNAN	
	Contact Phone:		(845) 353-5727	
	DEC Region:		3	
	Program Number:		0105383	
	DER Facility ID:		135279	
	Site ID:		276956	
	Operable Unit ID:		843738	
	Operable Unit:		01	
	Material ID:		533853	
	Material Code:		0001	
	Material Name:		#2 Fuel Oil	
	Case No.:		Not reported	
	Material FA:		Petroleum	
	Quantity:		0.00	
	Units:		Gallons	
	Recovered:		0.00	
	Resource Affected	d:	Soil	
	Oxygenate:		False	
	DEC Remarks:	Start Cal	lerRemark - 0105383 caller is doing an enviornmental investigation on	
			they believe there is an old abandoned heating oil tank buried on	
			near the garage END CallerRemark - 0105383	
	Remark:		CRemark - 0105383 Prior to Sept, 2004 data translation this spill Lead	
			Id was "BENDELL" 08/17/2001 DT SPOKE WITH CALLER. THEY DRILLED	THRU
		TOP & B	OTTOM OF UNKNOWN SIZE UST WHILE INSTALLING MW'S WITH GEOPF	ROBE. GOERGE
			HAT LIQUID IS BEING PUMPED AT THIS TIME INTO 5 GALLON PAILS WIT	
		PERIST/	ALTIC PUMP AND PUT INTO ANOTHER TANK. HE IS REQUESTING ASSIS	STANCE ON
		WHAT H	E SHOULD DO TO HANDLE THIS SITUATION. CALLED & SPOKE W/JOHN	I O'DEE IN
			OWN. JOHN WILL CONTACT WCDOH TO DETERMINE WHO WILL BE RE	
		SPILL.	2/14/06 FACILITY HAS BEEN DEMOLISHED. CONTAMINATED SOIL WAS	REMOVED
		BY ROY	AL ENVIRONMENTAL DURING WORK UNDER DUPLICATE SPILL NUMBEI	RS. jod END
		DECRen	nark - 0105383	-

Database(s)

EDR ID Number **EPA ID Number**

S105141621

NY Hist Spills: Region of Spill: 3 Spill Number: 0105383 Investigator: Caller Name: Caller Agency: Caller Phone: Notifier Name:

ATI MOSF (Continued)

Not reported Not reported Not reported Not reported Not reported Notifier Agency: Not reported Notifier Phone: Not reported 08/17/2001 14:00 Spill Date/Time: Reported to Dept Date/Time: 08/17/01 15:37 SWIS: 55 Spiller Name: ATI MOSF Spiller Contact: Not reported Spiller Phone: Not reported Spiller Contact: **GEORGE KIERNAN** Spiller Phone: (845) 353-5727 Spiller Address: 91 ALEXANDER ST Spiller City, St, Zip: YONKERS, NY Spill Cause: Unknown Reported to Dept: On Land Water Affected: Not reported Spill Source: 03 Spill Notifier: Other Not reported PBS Number: **Cleanup Ceased:** 11 Cleanup Meets Std: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: 11 Enforcement Date: 11 Invstgn Complete: 11 **UST Involvement:** False Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. (Highly Improbable) Spill Closed Dt: 11 Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/17/01 Date Spill Entered In Computer Data File: Not reported Update Date: 08/27/01 Is Updated: True PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL Class Type: #2 FUEL OIL

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	ATI MOSF (Continued)		S105141621
	Remark:	try In File: 24464 Not reported 19941207 08/17/2001 DT SPOKE WITH CALLER. THEY DRILLED THRU TOP SIZE UST WHILE INSTALLING MW S WITH GEOPROBE. GOERGE PUMPED AT THIS TIME INTO 5 GALLON PAILS WITH PERISTALTIC ANOTHER TANK. HEIS REQUESTING ASSISTANCE ON WHAT HE SITUATION. CALLED SPOKE W/JOHN O DEE IN TARRYTOWN. TO DETERMINE WHO WILL BE REPONDING TO SPILL. caller is doing an enviornmental investigation on the site - they believe there is an old abandoned heating oil tank buried on the site near the g	SAYS THAT LI C PUMP AND P SHOULD DO T JOHN WILL CO	QUID IS BEING UT INTO FO HANDLE THIS
C37 NE < 1/8 475 ft.	HALSTEAD-QUINN/AT 91 ALEXANDER STRE YONKERS (C), NY 107	ET	ROWNFIELDS NY VCP	S105859118 N/A
Relative:	Site 7 of 12 in cluster	;		
Higher Actual: 31 ft.	Site Code:	ERP 57808 blems: Groundwater or surface runoff from the site could impact the H which borders the site on the west. Site contamination has also groundwater resource in the water table aquifer. However, this a sole source aquifer and is unlikely to be used as a source of	o impacted the aquifer is not	
	Site Description:	in the future. This site is an abandoned petroleum tank farm located along the the Alexander Street Waterfront District of the City of Yonkers, County. The Yonkers Alexander Street Redevelopment, Inc. ar in July 2002after Halstead-Quinn Propane, Inc. declared bankr has been used for the storage and transfer of petroleum produce early 1900s. Site structures included 15 aboveground storage four 4,000 square foot buildings and 4 truck fuel fill racks equip vehicle fuel dispensers, as well as a barge dock, a small guard inch diameter pipelines and a walkway extending 280 feet out i River. Several small ASTs and underground storagetanks four removed. The main tank farm was approximately 1-2 feet belo enclosed by concrete containment walls. All of these structures on fill placed on the site in approximately 1898. A number of sp record for the site; two of which were significant and have not I out. All large ASTs and associated piping and structures were 2003. All that remains on site are a dispatch office, storage bui foam suppression house. Site contamination is petroleum relat Remedial Action Plan (PRAP) was prepared for this site in Feb final cleanup plan, defined in a Record of Decision (ROD), was 2006.	Westchester cquired the prop uptcy. This site cts since the tanks (ASTs), ped with house, four 8 nto the Hudson nd on site have 1 w grade and s were located billsare on been closed demolished in ilding, and ted. A Proposer ruary 2006 and	berty been d a
	Assessment:	The site is located in an industrial area with limited public access is served with public water. To reduce potential exposures to con- soil, the Record of Decision for the site proposes the removal of soil, demarcation layer and the construction of a soil cover. To a potential soil vapor intrustion to future on site structures, a site plan will require that any on-site building structure(s) have insta- sub-slab depressurization system.	ontaminated of contaminated ddress management	
	0 71	BCP 365881		

Site Code: 365881

Map ID		MAP FINDINGS		
Direction	4			
Distance Distance (ft.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	HALSTEAD-QUINN/ATI TANK I	FARM (Continued)		S105859118
	Assessment: Not repo	rted		
	Env Problems: Not repo			
	Site Desc: Not repo	rted		
C38	ATI TERMINAL		NY LTANKS	S103274345
NE	91 ALEXANDER STREET		NY Spills	N/A
< 1/8	YONKERS, NY		NY Hist Spills	
475 ft.	Site 8 of 12 in cluster C			
Relative:	LTANKS:			
Higher	Site ID:	347234		
Actual:	Spill Date:	06/08/05		
31 ft.	Facility Addr2:	Not reported		
	Facility ID: Program Number:	0502798 0502798		
	SWIS:	6018		
	Region of Spill:	3 JBODee		
	Investigator: Referred To:	Not reported		
	Reported to Dept:	06/08/05		
	CID: Spill Cause:	17 Tank Failure		
	Water Affected:	Not reported		
	Spill Source:	Major Facility > 400,000 gal		
	Spill Notifier:	Other		
	Cleanup Ceased: Cleanup Meets Standard:	True		
	Last Inspection:	12/28/05		
	Recommended Penalty: UST Involvement:	Penalty Not Recommended False		
	Spill Class:	Known release with minimal potential for fire or hazard. DE	C Response. Willi	na
		Responsible Party. Corrective action taken.		5
	Spill Closed Dt:	//		
	Remediation Phase: Date Entered In Computer:	2 06/08/05		
	Spill Record Last Update:	03/17/06		
	Spille Namer:	BRENDA CUMMINGS		
	Spiller Company: Spiller Phone:	CONSTRUCTION SITE (914) 328-6549		
	Spiller Extention:	Not reported		
	Spiller Address:	91 ALEXANDER STREET		
	Spiller City,St,Zip: Spiller County:	YONKERS, NY 001		
	Spiller Contact:	BRENDA CUMMINGS		
	Spiller Phone:	(914) 328-6549		
	Spiller Extention: DEC Region:	Not reported 3		
	Program Number:	0502798		
	DER Facility ID:	135279		
	Site ID: Operable Unit ID:	347234 1104973		
	Operable Unit:	01		
	Material ID:	1262299		
	Material Code: Material Name:	0001 #2 Fuel Oil		
		Not reported		

Case No.:

Material FA:

Not reported

Petroleum

Database(s)

EDR ID Number EPA ID Number

ATI TERMINAL (Continued)	S103274345
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0502798 TANK REMOVAL AND CONTAMINATION. OLD PROPERTY THAT
DEC Remarks.	IS BEING KNOCKED DOWN. END CallerRemark - 0502798
Remark:	Start DECRemark - 0502798 December 18, 2005: ROYAL ENVIRONMENTAL DISPOSED OF
Remark.	LUST AND 17.56 TONS OF CONTAMINATED SOIL. BASED UPON INFORMATION PROVIDED TO
	DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod 03/17/06 SPILL
	RE-OPENED AT REQUEST OFCONTRACTOR jod END DECRemark - 0502798
	RE-OPENED AT REQUEST OF CONTRACTOR JOU END DECREMAR - 0502750
NY Spills:	
Site ID:	160179
Facility Addr2:	Not reported
Facility ID:	9801901
Spill Number:	9801901
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	JBODee
Referred To:	Not reported
Spill Date:	05/13/98
Reported to Dept:	05/13/98
CID:	17
Spill Cause:	Equipment Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	//
Cleanup Meets Std:	True
Last Inspection:	12/28/05
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible
	Party. Corrective action taken.
Spill Closed Dt:	02/14/06
Remediation Phase:	0
Date Entered In Computer:	05/13/98
Spill Record Last Update:	02/14/06
Spiller Name:	Not reported
Spiller Company:	ATI TERMINAL
Spiller Address:	91 ALEXANDER STREET
Spiller City,St,Zip:	YONKERS, NY
Spiller Company:	001
Spiller Phone:	Not reported
Contact Name:	Not reported

Database(s)

EDR ID Number EPA ID Number

ued)	
N	ot reported
3	
98	301901
	35279
	50179
)62442
-	23810
	001
	2 Fuel Oil
	ot reported
	etroleum
-	allons
-	
	alse
IOTIFIER	Remark - 9801901 SPILLER CALLED NOTIFIER FOR A FUEL LINE LEAK. ON SCENE NOW. NO FURTHER INFORMATION AT THIS TIME. END CallerRemark -
	New and Constants Const. 2004 data translation this shill had
	temark - 9801901 Prior to Sept, 2004 data translation this spill Lead was "BENDELL" 05/13/98 SHEEN ON WATER IN HUDSON RIVER, SOURCE
	I, POSSIBLE LINE LEAKS TO RACKS, PUT IN HARD BOOM IN HUDSON RIVER, EPA
	05-94, NRC# 436708, AND NJDEP # 98-05-13-1605-17 2/14/06 FACILITY
	DEMOLISHED. CONTAMINATED SOIL REMOVED BY ROYAL ENVIRONMENTAL DURING
	DER DUPLICATE SPILL NUMBERS. jod END DECRemark - 9801901
	3
	9801901
	BENDELL
	Not reported
	05/13/1998 14:00
ate/Time:	05/13/98 14:56
	55
	ATI TERMINAL
	Not reported
	() -
	() -
	91 ALEXANDER STREET
	YONKERS, NY
	Equipment Failure
	On Land
	Not reported
	01
	Other
	Not reported
	False
alty:	Penalty Not Recommended
	3 98 13 16 10 10 10 10 10 10 10 10 10 10 10 10 10

Spill Cause:

Spill Source:

Spill Notifier:

Water Affected:

Cleanup Ceased:

Human Error

Not reported

Other

11

Major Facility > 400,000 gal

ATI TERMINAL (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	POSSIBL EPA CAS Remark: SPILLER	y to Central Office: / / uter Data File: 05/13/98 uter Data File: Not reported 11/27/00 True Not reported Not reported Not reported Not reported Not reported Not reported Not reported Petroleum 0 True Gallons 0 ed: True #2 FUEL OIL #2 FUEL OIL	HUDSON RIV -13-1605-17	·
C39 NE < 1/8 475 ft. Relative: Higher Actual: 31 ft.	A.TARRICONE INC. 91 ALEXANDER ST. YONKERS, NY 10705 Site 9 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept:	276957 Not reported 0306169 ER 6018 3 jbodee Not reported 09/10/03 09/10/03 17	NY Spills NY MOSF AST NY Hist Spills	S102153034 N/A

Database(s) EF

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)

	••••••	
Cleanup Meets St Last Inspection:	td:	True
•	onaltur	
Recommended Penalty:		Penalty Not Recommended False
UST Trust:		
Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
Spill Closed Dt:		02/12/05
Remediation Pha		0
Date Entered In C		
Spill Record Last	Update:	
Spiller Name:		TOM DUGAN
Spiller Company:		
Spiller Address:		91 ALEXANDER ST
Spiller City,St,Zip		YONKERS, NY
Spiller Company:		001
Spiller Phone:		(917) 612-6637
Contact Name:		TOM DUGAN (017) 612 6627
Contact Phone:		(917) 612-6637
DEC Region:		3
Program Number		0306169
DER Facility ID: Site ID:		135279
		276957 874736
Operable Unit ID:		01
Operable Unit: Material ID:		503409
Material Code:		0066A
Material Name:		UNKNOWN PETROLEUM
Case No.:		Not reported
Material FA:		Petroleum
Quantity:		20.00
Units:		Gallons
Recovered:		0.00
Resource Affecte	d:	Soil
Oxygenate:		False
DEC Remarks:	Start Ca	llerRemark - 0306169 during a tank removal some pipes still had product
		- the product was collected as pipe were open one of the catch
		vas accidently knocked over causing spill - spill is more than 5 gal
		Id be less than 20 - royal envoirnmental is hired for clean up END
		emark - 0306169
Remark:	Start DE	CRemark - 0306169 ROYAL COMPLETED CLEAN UP. SEE SPILL 05-02798.
	FACILIT	Y HAS BEEN DEMOLISHED. jod END DECRemark - 0306169
Site ID:		276958
Facility Addr2:		Not reported
Facility ID:		8606574
Spill Number:		8606574
Facility Type:		ER
SWIS:		6018
Region of Spill:		3
Investigator:		jeokesso Nationalista
Referred To:		Not reported
Spill Date:		01/25/87
Reported to Dept:		01/25/87
CID: Spill Cause:		17 Human Error
Water Affected:		HUDSON RIVER
Spill Source:		Vessel
opin oource.		

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S102153034

A.TARRICONE INC. (Continued)

1.17	IRRICONE INC. (Continue	u) 3	102
	Spill Notifier:	Responsible Party	
	Cleanup Ceased:	01/25/87	
	Cleanup Meets Std:	True	
	Last Inspection:	01/25/87	
	Recommended Penalty:	Penalty Not Recommended	
	UST Trust:	False	
	Spill Class:	Possible release with minimal potential for fire or hazard or Known release with	
		no damage. No DEC Response. No corrective action required.	
	Spill Closed Dt:	01/25/87	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:	02/14/06	
	Spiller Name:	Not reported	
	Spiller Company:	ATI	
	Spiller Address:	Not reported	
	Spiller City, St, Zip:	ZZ	
	Spiller Company:	001	
	Spiller Phone:	(914) 964-9866	
	Contact Name:	Not reported	
	Contact Phone:	Not reported	
	DEC Region:	3	
	Program Number: DER Facility ID:	8606574 135279	
	Site ID:	276958	
	Operable Unit ID:	903347	
	Operable Unit:	01	
	Material ID:	472136	
	Material Code:	0001	
	Material Name:	#2 Fuel Oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	10.00	
	Units:	Gallons	
	Recovered:	0.00	
	Resource Affected:	Surface Water	
	Oxygenate:	False	
		lerRemark - 8606574 TUG HIT BARGE END CallerRemark - 8606574	
		CRemark - 8606574 Prior to Sept, 2004 data translation this spill Lead	
		Id was "OKESSON" / / : 1/25/87-USCG INVESTIGATED-NO SPILLAGE	
	NOTED-	NFA. END DECRemark - 8606574	
	Click this	s hyperlink while viewing on your computer to access	
		al NY_SPILL: detail in the EDR Site Report.	
IVI	OSF AST:	2 2440	
	MOSF Number: SWIS Code:	3-2440 55	
	Facility Town:	YONKERS	
	Facility Phone:	(914) 964-9866	
	Emergency Contact Name:		
	Emergency Contact Phone		
	Total Tanks:	16	
	Total Capacity:	5093275	
	Daily Throughput:	40000	
	License Status:	MOSF AST	
	Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
	Product Transfer Operation		
	•		

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

A.TARRICONE INC. (Continued)

Facility Status: ACTIVE FACILITY HALSTEAD QIUNN PROPANE, INC. Owner Name: Owner Address: 33 HUBBELLS DRIVE, PO BOX 666 Owner City, St, Zip: MT. KISCO, NY 10549-**Owner Phone:** (914) 666-5800 Corporate/Commercial Owner Type: Mailing Name: A. TARRICONE INC. Mailing Address: 33 HUBBELLS DRIVE Mailing Address 2: Not reported Mailing City, St, Zip: MT. KISCO, NY 10549-Mailing Contact: GLEN D'AMBROSIO Mailing Phone: (914) 666-5800 Legal Agent Name: SECRETARY OF STATE Legal Agent Address: Not reported Legal Agent City, St, Zip: Tank ID: 1 Tank Location: ABOVEGROUND Install Date: 12/83 Product: UNLEADED GASOLINE Tank Type: Steel/carbon steel Tank Internal: None Tank External: 0 Abovearound Pipe Location: Pipe Type: STEEL/IRON Pipe Internal: None Pipe External: Second Contain: 8A Leak Detection: Other **Overfill Protection:** Suction **Dispensing Mthd:** Test Date: 01/91 Date Closed: Not reported Status of Data: Complete Capacity (gal): 1152000 **Operator Name:** 40|53|15 / 73|54|10 Lat/Long: Federal ID: Not reported Tank Status: In Service Inspected Date: 03/14/2000 Inspector: RDB Renew Date: 12/11/1998 Inspected State: Not reported **Owner Status:** 2 Owner Mark: First Owner LIC Expires: 11 Pipe Flag: True Vessel ID: Not reported Reserve Flag: True Tank Status: In Service COI Date: 11 Date License Issued: Date License Application Received: Chemical Bulk Storage Number: Pollution Discharge Elimination System Num: Date Legal Agent Filed with Secretary of State:

Painted/Asphalt Coating Product Level Gauge GLEN D'AMBROSIO 11 03/10/1999

Not reported

0-099538

MOSF Number:

3-2440

Database(s)

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)

ARRICONE INC. (Continued)	
SWIS Code:	55
Facility Town:	YONKERS
Facility Phone:	(914) 964-9866
Emergency Contact Name:	GLEN D'AMBROSIO
Emergency Contact Phone:	(914) 666-5800
Total Tanks:	16
Total Capacity:	5093275
Daily Throughput:	40000
License Status:	In Service
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR
Product Transfer Operation:	AC
Facility Status:	ACTIVE FACILITY
Owner Name:	HALSTEAD QIUNN PROPANE, INC.
Owner Address:	33 HUBBELLS DRIVE, PO BOX 666
Owner City,St,Zip:	MT. KISCO, NY 10549-
Owner Phone:	(914) 666-5800
Owner Type:	Corporate/Commercial
Mailing Name:	A. TARRICONE INC.
Mailing Address:	33 HUBBELLS DRIVE
Mailing Address 2:	Not reported
Mailing City,St,Zip:	MT. KISCO, NY 10549-
Mailing Contact:	GLEN D'AMBROSIO
Mailing Phone:	(914) 666-5800
Legal Agent Name:	SECRETARY OF STATE
Legal Agent Address:	Not reported
Legal Agent City,St,Zip:	-
Tank ID:	
Tank Location:	ABOVEGROUND
Install Date:	
Product:	UNLEADED GASOLINE
Tank Type: Tank Internal:	Steel/carbon steel None
Tank External:	0
Pipe Location:	Aboveground
Pipe Type:	STEEL/IRON
Pipe Internal:	None
Pipe External:	Painted/Asphalt Coating
Second Contain:	8A
Leak Detection:	Other
Overfill Protection:	Product Level Gauge
Dispensing Mthd:	Suction
Test Date:	12/90
Date Closed:	Not reported
Status of Data:	Complete
Capacity (gal):	1152000
Operator Name:	GLEN D'AMBROSIO
Lat/Long:	40 53 15 / 73 54 10
Federal ID:	Not reported
Tank Status:	In Service
Inspected Date:	03/14/2000
Inspector:	RDB
Renew Date:	12/11/1998
Inspected State:	Not reported
Owner Status:	2 First Ourses
Owner Mark:	First Owner
LIC Expires:	/ / True
Pipe Flag:	True

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S102153034

A.TARRICONE INC. (Continued)

Vessel ID: Not reported Reserve Flag: True Tank Status: In Service COI Date: 11 Date License Issued: 11 Date License Application Received: 03/10/1999 Chemical Bulk Storage Number: Not reported Pollution Discharge Elimination System Num: 0-099538 Date Legal Agent Filed with Secretary of State: MOSF Number: 3-2440 SWIS Code: 55 YONKERS Facility Town: Facility Phone: (914) 964-9866 Emergency Contact Name: GLEN D'AMBROSIO **Emergency Contact Phone:** (914) 666-5800 Total Tanks: 16 **Total Capacity:** 5093275 Daily Throughput: 40000 License Status: In Service Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR Product Transfer Operation: AC Facility Status: ACTIVE FACILITY Owner Name: HALSTEAD QIUNN PROPANE, INC. Owner Address: 33 HUBBELLS DRIVE, PO BOX 666 MT. KISCO, NY 10549-Owner City, St, Zip: Owner Phone: (914) 666-5800 Owner Type: Corporate/Commercial Mailing Name: A. TARRICONE INC. 33 HUBBELLS DRIVE Mailing Address: Mailing Address 2: Not reported MT. KISCO, NY 10549-Mailing City,St,Zip: Mailing Contact: GLEN D'AMBROSIO (914) 666-5800 Mailing Phone: SECRETARY OF STATE Legal Agent Name: Legal Agent Address: Not reported Legal Agent City, St, Zip: Tank ID: 4 ABOVEGROUND Tank Location: Install Date: 00/00 NOS 1,2, OR 4 FUEL OIL Product: Steel/carbon steel Tank Type: Tank Internal: None Tank External: 01 Aboveground/Underground Combination Pipe Location: STEEL/IRON Pipe Type: Pipe Internal: None Pipe External: Sacrificial Anode Second Contain: 8A Other Leak Detection: Product Level Gauge **Overfill Protection: Dispensing Mthd:** Suction Test Date: 02/91 Date Closed: Not reported Status of Data: Complete 708000 Capacity (gal): **Operator Name:** GLEN D'AMBROSIO

TC1784877.2s Page 83

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)		
Lat/Long:	40 53 15 / 73 54	10
Federal ID:	Not reported	
Tank Status:	In Service	
Inspected Date:	03/14/2000	
Inspector:	RDB	
Renew Date:	12/11/1998	
Inspected State:	Not reported	
Owner Status:	2	
Owner Mark:	First Owner	
LIC Expires:	/ /	
Pipe Flag:	True	
Vessel ID:	Not reported	
Reserve Flag:	True	
Tank Status:	In Service	
COI Date:	//	
Date License Issued:	- 5	//
Date License Application Rec		03/10/1999
Chemical Bulk Storage Numb		Not reported
Pollution Discharge Eliminatio		0-099538 /
Date Legal Agent Filed with S	becretary of State.	1
MOSF Number:	3-2440	
SWIS Code:	55	
Facility Town:	YONKERS	
Facility Phone:	(914) 964-9866	
Emergency Contact Name:	GLEN D'AMBRO	SIO
Emergency Contact Phone:	(914) 666-5800	
Total Tanks:	16	
Total Capacity:	5093275	
Daily Throughput:	40000	
License Status:	In Service	
Facility Type:		INAL/PETROLEUM DISTRIBUTOR
Product Transfer Operation:	AC	N/
Facility Status:	ACTIVE FACILIT	
Owner Name:		
Owner Address: Owner City,St,Zip:	MT. KISCO, NY	RIVE, PO BOX 666
Owner Phone:	(914) 666-5800	10343-
Owner Type:	Corporate/Comm	ercial
Mailing Name:	A. TARRICONE I	
Mailing Address:	33 HUBBELLS D	
Mailing Address 2:	Not reported	
Mailing City, St, Zip:	MT. KISCO, NY	10549-
Mailing Contact:	GLEN D'AMBRO	SIO
Mailing Phone:	(914) 666-5800	
Legal Agent Name:	SECRETARY OF	STATE
Legal Agent Address:	Not reported	
Legal Agent City,St,Zip:	-	
Tank ID:	5	
Tank Location:	ABOVEGROUNE)
Install Date:	00/00	
Product:	DIESEL	
Tank Type:	Steel/carbon stee	1
Tank Internal:	None	
Tank External:	01	deveryound Combination
Pipe Location:	Aboveground/Un STEEL/IRON	derground Combination
Pipe Type:	STEEL/IKUN	

Database(s)

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)

Pipe Internal: None Sacrificial Anode Pipe External: Second Contain: 8A Leak Detection: Other **Overfill Protection:** Product Level Gauge **Dispensing Mthd:** Suction Test Date: 03/92 Date Closed: Not reported Status of Data: Complete Capacity (gal): 147000 Operator Name: GLEN D'AMBROSIO Lat/Long: 40|53|15 / 73|54|10 Federal ID: Not reported Tank Status: In Service 03/14/2000 Inspected Date: Inspector: RDB 12/11/1998 Renew Date: Inspected State: Not reported **Owner Status:** 2 First Owner Owner Mark: LIC Expires: 11 Pipe Flag: True Vessel ID: Not reported Reserve Flag: True Tank Status: In Service COI Date: 11 Date License Issued: 11 Date License Application Received: 03/10/1999 Chemical Bulk Storage Number: Not reported Pollution Discharge Elimination System Num: 0-099538 Date Legal Agent Filed with Secretary of State: MOSF Number: 3-2440 SWIS Code: 55 Facility Town: YONKERS Facility Phone: (914) 964-9866 Emergency Contact Name: GLEN D'AMBROSIO **Emergency Contact Phone:** (914) 666-5800 Total Tanks: 16 5093275 **Total Capacity:** Daily Throughput: 40000 License Status: In Service Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR Product Transfer Operation: AC Facility Status: ACTIVE FACILITY HALSTEAD QIUNN PROPANE, INC. **Owner Name:** Owner Address: 33 HUBBELLS DRIVE, PO BOX 666 Owner City, St, Zip: MT. KISCO, NY 10549-Owner Phone: (914) 666-5800 Corporate/Commercial Owner Type: A. TARRICONE INC. Mailing Name: Mailing Address: 33 HUBBELLS DRIVE Mailing Address 2: Not reported Mailing City, St, Zip: MT. KISCO, NY 10549-Mailing Contact: GLEN D'AMBROSIO Mailing Phone: (914) 666-5800 Legal Agent Name: SECRETARY OF STATE

Database(s)

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)

Legal Agent Address: Not reported Legal Agent City, St, Zip: Tank ID: 6 Tank Location: ABOVEGROUND Install Date: 00/00 NOS 1,2, OR 4 FUEL OIL Product: Steel/carbon steel Tank Type: Tank Internal: None Tank External: 01 Pipe Location: Aboveground/Underground Combination STEEL/IRON Pipe Type: Pipe Internal: None Pipe External: Sacrificial Anode Second Contain: 8A Leak Detection: Other **Overfill Protection:** Product Level Gauge Suction **Dispensing Mthd:** Test Date: 12/90 Date Closed: Not reported Status of Data: Complete 157000 Capacity (gal): **Operator Name:** GLEN D'AMBROSIO Lat/Long: 40|53|15 / 73|54|10 Federal ID: Not reported Tank Status: In Service Inspected Date: 03/14/2000 Inspector: RDB Renew Date: 12/11/1998 Inspected State: Not reported **Owner Status:** 2 Owner Mark: First Owner LIC Expires: 11 Pipe Flag: True Vessel ID: Not reported Reserve Flag: True Tank Status: In Service COI Date: 11 Date License Issued: 11 Date License Application Received: 03/10/1999 Chemical Bulk Storage Number: Not reported 0-099538 Pollution Discharge Elimination System Num: Date Legal Agent Filed with Secretary of State:

S102153034

<u>Click this hyperlink</u> while viewing on your computer to access 11 additional NY_AST_MOS: record(s) in the EDR Site Report.

NY Hist Spills: Region of Spill: 3 Spill Number: 8606574 OKESSON Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 01/25/1987 04:30 Spill Date/Time:

Database(s)

EDR ID Number EPA ID Number

A.TARRICONE INC. (Continued)

Reported to Dept Date/Time: 01/25/87 09:30 SWIS: 55 Spiller Name: ATI Spiller Contact: Not reported Spiller Phone: (914) 964-9866 Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Traffic Accident Reported to Dept: Surface Water HUDSON RIVER Water Affected: Spill Source: 10 Spill Notifier: **Responsible Party** PBS Number: Not reported Cleanup Ceased: 01/25/87 Cleanup Meets Std: True 01/25/87 Last Inspection: **Recommended Penalty:** Penalty Not Recommended Spiller Cleanup Dt: 11 Enforcement Date: 11 Invstgn Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 01/25/87 Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 02/04/87 Date Spill Entered In Computer Data File: Not reported Update Date: 11 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 10 Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False #2 FUEL OIL Material: Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported 19941207 Last Date: DEC Remarks: / / : 1/25/87-USCG INVESTIGATED-NO SPILLAGE NOTED-NFA. Remark: TUG HIT BARGE

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

C40 NE	VS 6478 86 ALEXANDER ST		NY Spills NY Hist Spills	S104790280 N/A
< 1/8	YONKERS, NY		•	
482 ft.	Site 10 of 12 in cluster C			
Relative: Higher	NY Spills:			
	Site ID:	67144		
Actual:	Facility Addr2:	Not reported		
30 ft.	Facility ID:	0007916		
	Spill Number:	0007916		
	Facility Type:	ER 6018		
	SWIS: Region of Spill:	6018 3		
	Investigator:	DXWEITZ		
	Referred To:	Not reported		
	Spill Date:	10/05/00		
	Reported to Dept:	10/05/00		
	CID:	17		
	Spill Cause:	Unknown		
	Water Affected:	Not reported		
	Spill Source:	Unknown		
	Spill Notifier:	Affected Persons		
	•			
	Cleanup Meets Std:	True		
	Last Inspection:	/ / Denalty Not Decommanded		
	Recommended Penalty: UST Trust:	Penalty Not Recommended False		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	Response Willin	a
	Opin Olass.	Responsible Party. Corrective action taken.	Response. Willing	9
	Spill Closed Dt:	10/05/00		
	Remediation Phase:	0		
	Date Entered In Computer:	10/05/00		
	Spill Record Last Update:	10/23/00		
	Spiller Name:	UNK		
	Spiller Company:	UNK		
	Spiller Address:	UNK		
	Spiller City,St,Zip: Spiller Company:	UNK, ZZ 001		
	Spiller Phone:	(000) 000-0000		
	Contact Name:	CALLER		
	Contact Phone:	Not reported		
	DEC Region:	3		
	Program Number:	0007916		
	DER Facility ID:	64200		
	Site ID:	67144		
	Operable Unit ID:	830406		
	Operable Unit:	01		
	Material ID:	545437		
	Material Code: Material Name:	0066A UNKNOWN PETROLEUM		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	0.00		
	Units:	Gallons		
	Recovered:	0.00		
	Resource Affected:	Soil		
	Oxygenate:	False		
	DEC Remarks: Start Cal	lerRemark - 0007916 caller reporting a spill of unk material it	sa	

EDR ID Number Database(s) EPA ID Number

VS 6478 (Continued)		S104790)280
	sheen clea	in up pending lab results coned#133802 on 200 gal of water no	
		cessary END CallerRemark - 0007916	
Remark:		Remark - 0007916 Prior to Sept, 2004 data translation this spill Lead	
	DEC FIEID V	was "WEITZ" END DECRemark - 0007916	
NV Hist Spille			
NY Hist Spills: Region of Spill:		3	
Spill Number:		0007916	
Investigator:		WEITZ	
Caller Name:		Not reported	
Caller Agency:		Not reported	
Caller Phone:		Not reported	
Notifier Name:		Not reported	
Notifier Agency:		Not reported	
Notifier Phone:		Not reported	
Spill Date/Time:		10/05/2000 09:50	
Reported to Dept	Date/Time:	10/05/00 10:54	
SWIS:		55	
Spiller Name:		UNK	
Spiller Contact:		UNK	
Spiller Phone:			
Spiller Contact: Spiller Phone:		CALLER () -	
Spiller Address:		UNK	
Spiller City,St,Zip		UNK	
Spill Cause:	•	Unknown	
Reported to Dept		On Land	
Water Affected:		Not reported	
Spill Source:		12	
Spill Notifier:		Affected Persons	
PBS Number:		Not reported	
Cleanup Ceased:		//	
Cleanup Meets S	td:	True	
Last Inspection:	11	// Develte Net Development de l	
Recommended P		Penalty Not Recommended	
Spiller Cleanup D Enforcement Date		//	
Invstgn Complete			
UST Involvement		False	
Spill Class:	•	Known release with minimal potential for fire or hazard. DEC Response. Willing	
		Responsible Party. Corrective action taken.	
Spill Closed Dt:		10/05/00	
Corrective Action			
		o Central Office: / /	
Date Spill Entered			
Date Spill Entered	d In Compute		
Update Date:		10/23/00 True	
Is Updated: PBS Number:		True Not reported	
Tank Number:		Not reported	
Tank Size:		Not reported	
Test Method:		Not reported	
Leak Rate Failed	Tank:	Not reported	
Gross Leak Rate:		Not reported	
Material Class Ty		Petroleum	
Quantity Spilled:		0	
Unkonwn Quantit	y Spilled:	True	

Map ID Direction Distance		MAP FINDINGS		
Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
		UNKNOWN PETROLEUM UNKNOWN PETROLEUM E: 16414 Not reported 19940929	b	S104790280
C41 NE < 1/8 482 ft.	VAULT 9915 86 ALEXANDER ST YONKERS, NY		NY Spills NY Hist Spills	S104790191 N/A
Relative: Higher Actual: 30 ft.	Site 11 of 12 in cluster C NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller City,St,Zip: Spiller City,St,Zip: Spiller Company: Spiller Company: Spiller Phone: Contact Name: Contact Phone: Contact Phone: DEC Region: Program Number: DER Facility ID: Site ID:		Response. Willi	ng

Map ID Direction Distance Distance (ft.) Elevation Site

VAULT 9915 (Continued)

Database(s)

EDR ID Number EPA ID Number

AULI 9915 (Continued)		31047
Operable Unit ID:	830283	
Operable Unit:	01	
Material ID:	545314	
Material Code:	0066A	
Material Name:	UNKNOWN PETROLEUM	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Soil	
Oxygenate:	False	
DEC Remarks: Start Cal	llerRemark - 0007788 heavy sheen of unk oil on 500 gals water in the	
manhole	cleanup pendins labs 133732 END CallerRemark - 0007788	
	CRemark - 0007788 Prior to Sept, 2004 data translation this spill Lead	
DEC Fie	Id was "MASTRO" END DECRemark - 0007788	
NY Hist Spills:		
Region of Spill:	3	
Spill Number:	0007788	
Investigator:	MASTRO	
Caller Name:	Not reported	
Caller Agency:	Not reported	
Caller Phone:	Not reported	
Notifier Name:	Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Spill Date/Time:	10/02/2000 17:00	
Reported to Dept Date/Tim		
SWIS:	55	
Spiller Name:	Not reported	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Contact:	STEVE ROMERO	
Spiller Phone:	(212) 580-6763	
Spiller Address:	Not reported	
Spiller City,St,Zip:	Not reported	
Spill Cause:	Unknown	
Reported to Dept:	On Land	
Water Affected:	Not reported	
Spill Source:	12	
Spill Notifier:	Affected Persons	
PBS Number:	Not reported	
Cleanup Ceased:		
Cleanup Meets Std:	True	
Last Inspection:	//	
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Dt:	//	
Enforcement Date:	//	
Invstgn Complete:		
UST Involvement:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	Willing
	Responsible Party. Corrective action taken.	
Spill Closed Dt:	10/03/00	
Corrective Action Plan Sub		
Date Region Sent Summar		
Date Spill Entered In Comp	outer Data File: 10/02/00	

Database(s)

EDR ID Number EPA ID Number

S104790191

VAULT 9915 (Continued)

Spiller Name:

Date Spill Entered In Computer Data File: Not reported Update Date: 10/03/00 Is Updated: True PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum 0 Quantity Spilled: True Unkonwn Quantity Spilled: Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: True UNKNOWN PETROLEUM Material: UNKNOWN PETROLEUM Class Type: Times Material Entry In File: 16414 CAS Number: Not reported 19940929 Last Date: DEC Remarks: Not reported Remark: heavy sheen of unk oil on 500 gals water in the manhole cleanup pendins labs 133732

C42 NE < 1/8 492 ft.	POLY-CHROME 80 ALEXANDER ST YONKERS, NY Site 12 of 12 in cluster C		NY Spills NY Hist Spills	S102152726 N/A
Relative: Higher	NY Spills:	125006		
Actual: 29 ft.	Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer Spill Record Last Update:	125006 Not reported 8700879 ER 6018 3 WEED Not reported 04/30/87 04/30/87 04/30/87 17 Unknown Not reported Unknown Federal Government 05/07/87 True 05/07/87 Penalty Not Recommended False Not reported 05/07/87 0 05/07/87 0 05/01/87 12/16/88		

Not reported

Database(s)

EDR ID Number EPA ID Number

POLY-CHROME (Continued)

Spiller Company:	POLY-CHROME
Spiller Address:	SAME
Spiller City, St, Zip:	ZZ
Spiller Company:	001
Spiller Phone:	Not reported
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Region:	3
Program Number:	8700879
DER Facility ID:	108182
Site ID:	125006
Operable Unit ID:	907365
Operable Unit:	01
Material ID:	470851
Material Code:	0066A
Material Name:	UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
	0.00
Quantity: Units:	
Recovered:	Not reported
Resource Affected:	0.00 Sewer
Oxygenate:	False
	reported reported
Remark. Not	reported
NY Hist Spills:	
Region of Spill:	3
Spill Number:	8700879
Investigator:	WEED
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	04/30/1987 16:40
Reported to Dept Date	/Time: 04/30/87 17:10
SWIS:	55
Spiller Name:	POLY-CHROME
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Address:	SAME
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	In Sewer
Water Affected:	Not reported
Spill Source:	12
Spill Notifier:	Federal Government
PBS Number:	Not reported
Cleanup Ceased:	05/07/87
Cleanup Meets Std:	True
Last Inspection:	05/07/87
Recommended Penalty	
Spiller Cleanup Dt:	
Enforcement Date:	/ /
Invstgn Complete:	/ /
mosign complete.	<i>, ,</i>

Database(s)

EDR ID Number EPA ID Number

S102152726

POLY-CHROME (Continued)

UST Involvement: False Spill Class: Not reported Spill Closed Dt: 05/07/87 Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 05/01/87 Date Spill Entered In Computer Data File: Not reported Update Date: 12/16/88 Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Petroleum Material Class Type: Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False UNKNOWN PETROLEUM Material: Class Type: UNKNOWN PETROLEUM Times Material Entry In File: 16414 CAS Number: Not reported Last Date: 19940929 / / : FD ON SCENE-EPA RESPONDING. / / : 5/7/87-NFA. 11/29/95: This DEC Remarks: is additional information about material spilled from the translation of the old spill file: ACID. Remark: Not reported

E43PATCLIN CHEMICAL COMPANYNE66 ALEXANDER ST< 1/8</td>YONKERS, NY518 ft.

Site 1 of 19 in cluster E

Relative:		
Higher	NY Spills:	
ingilei	Site ID:	290027
Actual:	Facility Addr2:	Not reported
25 ft.	Facility ID:	9714545
	Spill Number:	9714545
	Facility Type:	ER
	SWIS:	6018
	Region of Spill:	3
	Investigator:	jkomara
	Referred To:	Not reported
	Spill Date:	03/31/98
	Reported to Dept:	03/31/98
	CID:	17
	Spill Cause:	Other
	Water Affected:	Not reported
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Fire Department
	Cleanup Ceased:	/ /
	Cleanup Meets Std:	True
	Last Inspection:	/ /
	Recommended Penalty:	Penalty Not Recommended

NY Spills S103571913 NY Hist Spills N/A

EDR ID Number Database(s) EPA ID Number

PATCLIN CHEMICAL COMPANY (Continued)

UST Trust:		False
Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
Spill Closed Dt:		06/12/00
Remediation Phas		0
Date Entered In C Spill Record Last	•	06/12/00
Spiller Name:	opuato.	Not reported
Spiller Company:		PATCLIN CHEMICAL COMPANY
Spiller Address:		66 ALEXANDER ST
Spiller City,St,Zip		YONKERS, NY
Spiller Company:		001
Spiller Phone:		Not reported
Contact Name:		ASST CHIEF RUBEO
Contact Phone:		(914) 377-7559
DEC Region: Program Number:		3 9714545
DER Facility ID:	•	234833
Site ID:		290027
Operable Unit ID:		1060314
Operable Unit:		01
Material ID:		325499
Material Code:		0063A
Material Name:		UNKNOWN HAZARDOUS MATERIAL
Case No.		Not reported
Material FA:		Hazardous Material 0.00
Quantity: Units:		Gallons
Recovered:		0.00
Resource Affecte	d:	Soil
Oxygenate:		False
DEC Remarks:	Start Cal	lerRemark - 9714545 caller reported explosion and fire at above
		several different (unknown) chemicals still burning.fire dept on
		ND CallerRemark - 9714545
Remark:		CRemark - 9714545 Prior to Sept, 2004 data translation this spill Lead
		ld was "O'MARA" 06/12/2000 PER J. O'MARA, CLOSING THIS SPILL OUT. THIS NDLED BY THE USEPA RATHER THAN DEC. END DECRemark - 9714545
NY Hist Spills:		
Region of Spill:		3
Spill Number:		9714545
Investigator:		O'MARA
Caller Name:		Not reported
Caller Agency:		Not reported
Caller Phone: Notifier Name:		Not reported
Notifier Agency:		Not reported Not reported
Notifier Phone:		Not reported
Spill Date/Time:		03/31/1998 09:00
Reported to Dept	Date/Tim	e: 03/31/98 09:41
SWIS:		55
Spiller Name:		PATCLIN CHEMICAL COMPANY
Spiller Contact:		Not reported
Spiller Phone:		
Spiller Contact:		ASST CHIEF RUBEO
Spiller Phone: Spiller Address:		(914) 377-7559 66 ALEXANDER ST
opinor Address.		

Database(s)

EDR ID Number EPA ID Number

S103571913

Spiller City, St, Zip: YONKERS, NY Spill Cause: Other Reported to Dept: On Land Water Affected: Not reported Spill Source: 01 Fire Department Spill Notifier: PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Std: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended Spiller Cleanup Dt: 11 Enforcement Date: 11 Invstgn Complete: 11 **UST Involvement:** False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 06/12/00 Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 03/31/98 Date Spill Entered In Computer Data File: Not reported Update Date: 06/12/00 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Nonpetroleum/Nonhazardous Material Class Type: Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False UNKNOWN HAZARDOUS MATERIAL Material: Class Type: UNKNOWN HAZARDOUS MATERIAL Times Material Entry In File: 2093 CAS Number: Not reported 19940728 Last Date: 06/12/2000 PER J. O MARA, CLOSING THIS SPILL OUT. THIS WAS HANDLED BY THE **DEC Remarks:** USEPA RATHER THAN DEC. caller reported explosion and fire at above location. several different Remark: unknown) chemicals still burning.fire dept on scene.

E44 PATCLIN CHEMICAL CO, INC NE **66 ALEXANDER ST** YONKERS, NY 10701 < 1/8 518 ft. Site 2 of 19 in cluster E Relative: FTTS INSP: Higher Inspection Number: 19990212011 5 Actual: Region: 08 25 ft. Inspection Date: Not reported HARSTON, LEE Inspector:

Violation occurred:

No

FTTS 1007289626 N/A

Map ID Direction		MAP FINDINGS		
Distance Distance (ft. Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	PATCLIN CHEMICAL CO, INC	(Continued)		1007289626
	Investigation Reason: N Legislation Code: T	ead, Section 1018, SEE leutral Scheme, Region SCA Iser		
E45 NE < 1/8 518 ft.	PATCLIN CHEMICAL CO INC 66 ALEXANDER STREET YONKERS, NY 10701		FTTS	1007563880 N/A
	Site 3 of 19 in cluster E			
Relative: Higher	FTTS:			
•		lot reported		
Actual: 25 ft.		PCRA-97-0204 9/26/1997		
	•	.0000		
		0000.0000		
		0000.0000 2/07/1997		
	Close Date: /			
	Violation(s): E	PCRA, Nonreporting/Failure to RPT to EPA		
E46 NE < 1/8 526 ft.	YONKERS DEPOT 59 BABCOCK PLACE YONKERS, NY 10703		NY AST	A100271971 N/A
	Site 4 of 19 in cluster E			
Relative: Higher	AST:			
-	PBS Number:	3-800090		
Actual: 24 ft.	Tank Number: Tank Status:	2 In Service		
2410	Capacity:	1000 INSTALL DATE		
	Pipe Location:	Aboveground		
	Pipe Type: 2nd Containment:	Fiberglass (FRP) Earthen Dike		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Aboveground: 10% or more below ground		
	Pipe Internal Protection: Pipe External Protection:	None None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	None		
	Date Last Tested / Next Test: 1/1/1999 NEXT TEST DATE Date Tank Closed / Category: CATEGORY			
	Leak Detection:	None		
	Overfill Protection: Dispenser Method:	Vent Whistle, Product Level Gauge Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator: Phone:	MTA - Bus (914)376-6331		
	Phone: In-service Capacity:	(914)376-6331 12500		
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart	360-14 tanks exists or	not
	Certification Date:	Not reported		
	Expire Date:	Not reported		

Database(s)

EDR ID Number EPA ID Number

A100271971

YONKERS DEPOT (Continued)

CBS Number: Not reported Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Number Of Active Tanks: 4 Old Pbs Number: Not reported 02/09/2005 Last Inspected: **Emergency Name:** Charles Ennis Emergency Phone: (914) 376-6301 **Owner Name:** MTA - Bus 59 Babcock Place Owner Address: **Owner Phone:** (914) 376-6315 CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: Yonkers, NY 10703 Mail Company: MTA - Bus Yonkers Depot Mail Address: 59 Babcock Place Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10703 Attention: Charles Ennis Mail Phone: (914) 376-6315 1000 Capacity: Date Last Tested: 1/1/1999 Not reported Next Test Date: Category: Not reported Install Date: Not reported Date Tank Was Closed: Not reported PBS Number: 3-800090 Tank Number: 3 In Service Tank Status: 10000 INSTALL DATE 07/01/1999 Capacity: Pipe Location: Aboveground Pipe Type: Steel/Iron 2nd Containment: **Double-Walled Tank** Product: Diesel Tank Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Internal Protection: None Pipe External Protection: Painted/Asphalt Coating Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating NEXT TEST DATE Date Last Tested / Next Test: Date Tank Closed / Category: CATEGORY Leak Detection: In-Tank System **Overfill Protection:** Product Level Gauge, Float Vent Valve Dispenser Method: Submersible Facility Addr2: Not reported Swiscode: 5518 Operator: MTA - Bus Phone: (914)376-6331 In-service Capacity: 12500 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported Not reported CBS Number: Not reported Spdes Number: Lat/Long: Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

YONKERS DEPOT (Continued)

A100271971

v	KERS DEPOT (Continued)		AIU
	Site Type:	Not reported	
	Number Of Active Tanks:	4	
	Old Pbs Number:	Not reported	
	Last Inspected:	02/09/2005	
	Emergency Name:	Charles Ennis	
	Emergency Phone:	(914) 376-6301	
	Owner Name:	MTA - Bus	
	Owner Address:	59 Babcock Place	
	Owner Phone:	(914) 376-6315	
	Owner Type:	CORPORATE/COMMERCIAL	
	Owner City,St,Zip:	Yonkers, NY 10703	
	Mail Company:	MTA - Bus Yonkers Depot	
	Mail Address:	59 Babcock Place	
	Mail Address:	Not reported	
	Mail City,St,Zip:	Yonkers, NY 10703	
	Attention:	Charles Ennis	
	Mail Phone:	(914) 376-6315	
	Capacity:	10000	
	Date Last Tested:	Not reported	
	Next Test Date:	Not reported	
	Category:	Not reported	
	Install Date:	07/01/1999	
	Date Tank Was Closed:	Not reported	
	PBS Number:	3-800090	
	Tank Number:	4a	
	Tank Status:	In Service	
	Capacity:	1000 INSTALL DATE 02/01/2000	
	Pipe Location:	Aboveground	
	Pipe Type:	Steel/Iron	
	2nd Containment:	Double-Walled Tank	
	Product:	Lube	
	Tank Location:	Aboveground on saddles, legs, stilts, rack or cradle	
	Pipe Internal Protection:	None	
	Pipe External Protection:	Painted/Asphalt Coating	
	Tank Type:	Steel/Carbon Steel	
	Tank Internal Protection:	None	
	Tank External Protection:	Painted/Asphalt Coating	
	Date Last Tested / Next Test:	-	
	Date Tank Closed / Category:		
	Leak Detection:	In-Tank System	
	Overfill Protection:	Product Level Gauge, Float Vent Valve	
	Dispenser Method:	Suction	
	Facility Addr2:	Not reported	
	Swiscode:	5518	
	Operator:	MTA - Bus	
	Phone:	(914)376-6331	
	In-service Capacity:	12500	
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or n	ot
	Certification Date:	Not reported	
	Expire Date:	Not reported	
	CBS Number:	Not reported	
	Spdes Number:	Not reported	
	Lat/Long:	Not reported	
	Site Type:	Not reported	
	Number Of Active Tanks:	4 National and	
	Old Pbs Number:	Not reported	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

YONKERS DEPOT (Continued)

A100271971

Last Inspected:	02/09/2005
Emergency Name:	Charles Ennis
Emergency Phone:	(914) 376-6301
Owner Name:	MTA - Bus
Owner Address:	59 Babcock Place
Owner Phone:	(914) 376-6315
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	Yonkers, NY 10703
Mail Company:	MTA - Bus Yonkers Depot
Mail Address:	59 Babcock Place
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10703
Attention:	Charles Ennis
Mail Phone:	(914) 376-6315
Capacity:	1000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	02/01/2000
Date Tank Was Closed:	Not reported
PBS Number:	3-800090
Tank Number:	5a
Tank Status:	In Service
Capacity:	500 INSTALL DATE 02/01/2000
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
2nd Containment:	Double-Walled Tank
Product:	Lube
Tank Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Internal Protection:	Epoxy Liner
Pipe External Protection:	Painted/Asphalt Coating
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	Painted/Asphalt Coating
Date Last Tested / Next Test:	NEXT TEST DATE
Date Tank Closed / Category:	CATEGORY
Leak Detection:	In-Tank System
Overfill Protection:	Product Level Gauge, Float Vent Valve
Dispenser Method:	Submersible
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	MTA - Bus
Phone:	(914)376-6331
In-service Capacity:	12500
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	Not reported
Last Inspected:	02/09/2005
Emergency Name:	Charles Ennis
Emergency Phone:	(914) 376-6301

Map ID Direction Distance Distance (ft.) Elevation Site MAP FINDINGS

Database(s)

NY Spills

EDR ID Number **EPA ID Number**

A100271971

S106737074

N/A

YONKERS DEPOT (Continued)

Owner Name: MTA - Bus Owner Address: Owner Phone: Owner Type: Owner City, St, Zip: Mail Company: Mail Address: Mail Address: Not reported Mail City,St,Zip: Attention: Mail Phone: 500 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported 02/01/2000 Install Date: Not reported Date Tank Was Closed:

E47 LIBERTY LINES EXP NE **59 BABCOCK PLACE** YONKERS, NY < 1/8 526 ft.

Site 5 of 19 in cluster E NY Spills:

Site ID:

SWIS:

Facility Addr2:

Spill Number: Facility Type:

Region of Spill:

Investigator:

Referred To:

Spill Cause:

Spill Source:

Spill Notifier:

UST Trust:

Spill Class:

Water Affected:

Cleanup Ceased: Cleanup Meets Std:

Last Inspection:

Spill Closed Dt:

Spiller Name:

Spiller Company:

Spiller City, St, Zip:

Spiller Company:

Spiller Phone:

Spiller Address:

Remediation Phase:

Date Entered In Computer: 01/31/05 Spill Record Last Update:

Recommended Penalty:

Spill Date: Reported to Dept:

CID:

Facility ID:

Relative: Higher

Actual: 24 ft.

RESS INC E		

336837

0411542 0411542

ER

3

17

Other

Other

False

False

11

11

1

001

02/03/05

MR. GENE LOUIE

YONKERS, NY

(718) 391-3268

59 BABCOCK PLACE

6018

WCHD Not reported

12/22/04

01/27/05

Not reported

Gasoline Station

Penalty Not Recommended

LIBERTY LINES EXPRESS INC

Responsible Party. Corrective action taken.

Known release that creates potential for fire or hazard. DEC Response. Willing

Not reported

59 Babcock Place (914) 376-6315 CORPORATE/COMMERCIAL Yonkers, NY 10703 MTA - Bus Yonkers Depot 59 Babcock Place Yonkers, NY 10703 Charles Ennis (914) 376-6315

Database(s)

EDR ID Number EPA ID Number

LIBERTY LINES EXPRESS INC (Continued)

Contact Name: MR. GENE LOUIE (718) 391-3268 Contact Phone: DEC Region: 3 Program Number: 0411542 **DER Facility ID:** 272180 Site ID: 336837 Operable Unit ID: 1098838 Operable Unit: 01 Material ID: 579043 Material Code: 0009 Material Name: Gasoline Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 **Resource Affected:** Groundwater Oxygenate: False Start CallerRemark - 0411542 CONTAMINATED SOIL, ABOVE TAGAM MATERIAL, & ABOVE DEC Remarks: TOGGS CRITERIA: END CallerRemark - 0411542 Remark: Not reported Site ID: 343269 Facility Addr2: Not reported 0500326 Facility ID: 0500326 Spill Number: Facility Type: ER SWIS: 6000 Region of Spill: 3 WCHD Investigator: Referred To: Not reported Spill Date: 04/07/05 Reported to Dept: 04/07/05 CID: 17 Spill Cause: Unknown Water Affected: Not reported Spill Source: Unknown Spill Notifier: Other Cleanup Ceased: 11 Cleanup Meets Std: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended UST Trust: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 04/27/05 **Remediation Phase:** 0 Date Entered In Computer: 04/07/05 Spill Record Last Update: 05/09/05 Spiller Name: JERRY MOEN Spiller Company: MTA BUS GARAGE Spiller Address: **59 BABCOCK PLACE** Spiller City, St, Zip: YONKERS, NY Spiller Company: 001 Spiller Phone: (914) 976-6301 Contact Name: JERRY MOEN Contact Phone: (914) 976-6301

Database(s)

EDR ID Number EPA ID Number

S106737074

	Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affecter Oxygenate: DEC Remarks: Remark:	0008 Diesel Not reported Petroleum 0.00 Gallons 0.00 d: Soil False Start CallerRemark - 0500326 tank was removed on tuesday g is reporting samples results results say hes at the limits of cont tank was in good condition it was around the dispenser area of time perhapsoverfilling END CallerRemark - 0500326 Start DECRemark - 0500326 PBS 3-800090 5/4/05: Letter to C Bus Yonkers Depot from Karen Magnuson, WCDOH dated 27A NFA at this time. END DECRemark - 0500326 <u>Click this hyperlink</u> while viewing on your computer to access additional NY_SPILL: detail in the EDR Site Report.	amination over a period harles Ennis, MTA	res
E48 NE < 1/8 526 ft. Relative: Higher Actual: 24 ft.	LIBERTY LINES 59 BABCOCK PLACE YONKERS, NY 10701 Site 6 of 19 in cluster US BROWNFIELDS Recipient Name: Project Name: EPA ID: Region Number: Latitude: Longitude: Assessment Date Clean up Date: Entity Type:	City of Yonkers Industrial Development Agency Yonkers Ind Dev Agency, NY (A04) Not reported 2 40.94291 -73.90111	US BROWNFIELDS	1009400884 N/A
E49 NE < 1/8 526 ft. Relative: Higher Actual: 24 ft.	PATCLIN WAREHOUS 62 ALEXANDER STRE YONKERS (C), NY 10 Site 7 of 19 in cluster BROWNFIELDS: Program: Site Code: Environmental Pro Site Description:	ET 710		S106122158 N/A

LIBERTY LINES EXPRESS INC (Continued)

3

0500326

289750

343269 1101953 01

582187

DEC Region:

Program Number:

DER Facility ID:

Site ID: Operable Unit ID: Operable Unit:

Material ID:

TC1784877.2s Page 103

Database(s) EPA ID

EDR ID Number EPA ID Number

S106122158

PATCLIN WAREHOUSE SITE (Continued)

in April, 2004. The site includes a 0.5 acre property that originally had three addresses at 60,62 and 66 Alexander Street, now consolidated into one address at 62 Alexander Street. Located at the former 60 Alexander St. address is a warehouse that was occupied in the early 1990's, by a company named Super Trans NY or Super Trans Bus Company. This portion of the site reportedly contains 6 ASTs and 1 UST all varying in size, and a number of 5 gallon and 55 gallon drums filled with various fluids. The application indicates an open spill at this portion of the site (spill no. 95-11617).A larger building at the former 66 Alexander St. address was built in 1966 for the CI-TEX Corporation. CI-TEX later abandoned the site at which point Patclin Chemical took over and began its solvent mixing operations. An EPA Brownfields Pilot Studyindicated various environmental concerns involving existing chemicals stored on the site, mixing of chemicals over floor drains that lead to the sewer system, former air emission violations, and past spill history. In 1998 there was an explosion and a fire at this facility originating from hazardous materials and a leaking UST (spill no. 97-14545). As a result, the EPA conducted a facility inspection and more recently performed a drum removal action. YASR is in the process of obtaining titleto this property. DOH has insufficient information to evaluate the potential for human exposures.

Assessment:

E50 YONKERS DEPOT NY UST U003995082 NE **59 BABCOCK PLACE** N/A < 1/8 YONKERS, NY 10703 526 ft. Site 8 of 19 in cluster E Relative: UST: Higher PBS Number: 3-800090 Actual: Tank Number: 1 24 ft. Tank Status: Closed-Removed Capacity: 4000 INSTALL DATE Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Steel/Iron 2nd Containment: **Double-Walled Tank** Product: Nos. 1. 2 or 4 Fuel Oil Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: Jacketed Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Jacketed Date Last Tested / Next Test: 12/19/2000 NEXT TEST DATE Date Tank Closed / Category: 4/5/2005 CATEGORY Leak Detection: In-Tank System **Overfill Protection:** Float Vent Valve **Dispenser Method:** Submersible Facility Addr2: Not reported Swiscode: 5518 Operator: MTA - Bus (914)376-6331 Phone: In-service Capacity: 12500 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported

Database(s)

EDR ID Number EPA ID Number

	YONKERS DEPOT (Continued	d)	U003995082
	Number Of Active Tanks: Old Pbs Number: Last Inspected: Emergency Name: Emergency Phone: Owner Name: Owner Address: Owner Phone: Owner Type: Owner City,St,Zip: Mail Company: Mail Address: Mail Address: Mail Address: Mail City,St,Zip: Attention: Mail Phone: Capacity: Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed:	4 Not reported 02/09/2005 Charles Ennis (914) 376-6301 MTA - Bus 59 Babcock Place (914) 376-6315 CORPORATE/COMMERCIAL Yonkers, NY 10703 MTA - Bus Yonkers Depot 59 Babcock Place Not reported Yonkers, NY 10703 Charles Ennis (914) 376-6315 4000 Not reported Not reported	
E51 NE < 1/8 526 ft. Relative: Higher Actual: 24 ft.		Not reported 'This site consists of 3.64 acres located at 59 Babcock Place. In the early 1960's a 18,790 square foot building was erected on this site and used as a distribution center for the City of Yonkers. In 1973 fire destroyed half of the on-site building, resulting in the City demolishing the structure. The City of Yonkers and Yonkers IDA (YIDA) have owned the property on several occasions, however, sometime in or near 1986 YIDA sold the property to Babc Place Associates LLC/Liberty Lines BusCompany. The site is mainly used as a bus storage facility. A Phase I report for this site indicates the presence of 9 ASTs and 1 UST of various sizes with petroleum-based contents. This site is located in close proximity to a rail line as well as other petroleum sites. DOH has insufficient information to evaluate the potential for human exposures	a S
E52 NE < 1/8 528 ft.	MTA BUS - YONKERS DEPOT 59 BABCOCK PL YONKERS, NY 10701	RCRA-SQG FINDS	1004761456 NYR000087056
Relative: Higher	Site 10 of 19 in cluster E		
Actual: 25 ft.			

Database(s)

EDR ID Number EPA ID Number

1004761456

MTA BUS - YONKERS DEPOT (Continued)

RCRAInfo:

Owner: EPA ID:	BABCOCK PLACE ASSOCIATES LLC (914) 376-6448 NYR000087056
Contact:	EDWARD J BROKER (914) 376-6413
Classification: TSDF Activities:	Conditionally Exempt Small Quantity Generator Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

E53 NE < 1/8 539 ft.	ALTMAN STAGE LI 57 ALEXANDER ST YONKERS, NY 107	01		RCRA-SQG FINDS NY MANIFEST NJ MANIFEST	1000295137 NYD001391820
Relative: Higher Actual: 24 ft.	Site 11 of 19 in clus RCRAInfo: Owner: EPA ID:	ROBERT ALTMAN (914) 476-7987 NYD001391820		CT MANIFEST	
Contact: Not reported Classification: Conditionally Exempt TSDF Activities: Not reported Violation Status: Violations exist		Conditionally Exempt Sr Not reported	mall Quantity Generator		
	Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance: Enforcement Action: Enforcement Action Date: Penalty Type:		372.2(a)2 GENERATOR-ALL REQUIREMENTS (OV 07/08/1999 07/27/1999	ERSIGHT)	
			INITIAL 3008(A) COMPLIANCE ORDER 06/30/2000 Proposed Monetary Penalty		
	Enforcemen Enforcemen Penalty Typ	t Action Date:	FINAL 3008(A) COMPLIANCE ORDER 03/02/2001 Proposed Monetary Penalty		
	Regulation Vie	plated:	373-1.2		

07/08/1999

07/27/1999

06/30/2000

03/02/2001

12/29/1987

Not reported

09/24/1987

08/11/1989

6/30/2000

6/30/2000

Database(s)

EDR ID Number **EPA ID Number**

ALTMAN STAGE LIGHTING (Continued)

Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Compliance:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

Enforcement Action: Enforcement Action Date: Penalty Type:

INITIAL 3008(A) COMPLIANCE ORDER 06/30/2000 Proposed Monetary Penalty FINAL 3008(A) COMPLIANCE ORDER 03/02/2001 Proposed Monetary Penalty

TSD-OTHER REQUIREMENTS (OVERSIGHT)

INITIAL 3008(A) COMPLIANCE ORDER

FINAL 3008(A) COMPLIANCE ORDER

INITIAL 3008(A) COMPLIANCE ORDER

GENERATOR-MANIFEST REQUIREMENTS

Proposed Monetary Penalty

Proposed Monetary Penalty

Proposed Monetary Penalty

INITIAL 3008(A) COMPLIANCE ORDER 12/29/1987

Penalty Summary: Penalty Description

> Final Monetary Penalty Proposed Monetary Penalty **Final Monetary Penalty** Proposed Monetary Penalty

Proposed Monetary Penalty Penalty Date 3/2/2001 3/2/2001

Penalty Amount Lead Agency EPA EPA EPA EPA

Date of

69053

116710

69053

116710

There are 3 violation record(s) reported at this site:

Area of Violation	Compliance
GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19990727
TSD-OTHER REQUIREMENTS (OVERSIGHT)	19990727
GENERATOR-MANIFEST REQUIREMENTS	19890811
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT) TSD-OTHER REQUIREMENTS (OVERSIGHT)

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

N

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

ALTMAN STAGE LIGHTING (Continued)

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Y MANIFEST:	
Document ID:	NJA4035422
Manifest Status:	Not reported
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	03/28/2002
Trans1 Recv Date:	03/28/2002
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/28/2002
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD001391820
Trans1 EPA ID:	NJD002200046
Trans2 EPA ID:	Not reported
TSDF ID:	S5811
Waste Code:	F005 - UNKNOWN
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	02
Facility Type:	Generator
EPA ID:	NYD001391820
Facility Name:	ALTMAN STAGE LIGHTING CO. INCORPORATEDAT
Facility Address:	57 ALEXANDER STREET
Facility City:	YONKERS
Facility Zip 4:	Not reported
Country:	Not reported
County:	WESTCHESTER
Mailing Name:	ALTMAN STAGE LIGHTING CO. INCORPORATEDAT

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

ALTMAN STAGE LIGHTING (Continued)

Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone: CHRIS FENNELL 57 ALEXANDER STREET YONKERS NY 10701 Not reported Not reported 914-476-7987

<u>Click this hyperlink</u> while viewing on your computer to access 36 additional NY MANIFEST: record(s) in the EDR Site Report.

NJ MANIFEST:		
Manifest Code:		NJA5107860
EPA ID:		NYD001391820
Date Shipped:		20050329
TSDF EPA ID:		NJD002454544
Transporter EPA I	ID:	NJD002454544
Transporter 2 EPA	A ID:	Not reported
Date Trans1 Tran	sported Waste:	050329
Date Trans2 Trans	sported Waste:	000000
Date TSDF Recei	ved Waste:	050329
Tranporter 1 Deca	al:	Not reported
Tranporter 2 Deca	al:	Not reported
Data Entry Numbe	er:	05090521
Reference Manife	st Number:	Not reported
Was Load Rejecte	ed (Y/N):	No
Reason Load Was	s Rejected:	Not reported
Waste Code:	F003	
Quantity:	50	
Unit:	G	
Hand Code:	T04	

Manifest Code:		NJA5107914
EPA ID:		NYD001391820
Date Shipped:		20050429
TSDF EPA ID:		NJD002454544
Transporter EPA	ID:	NJD002454544
Transporter 2 EP	A ID:	Not reported
Date Trans1 Tran		050429
Date Trans2 Tran	sported Waste:	000000
Date TSDF Rece	ived Waste:	050429
Tranporter 1 Deca	Not reported	
Tranporter 2 Dec	Not reported	
Data Entry Numb	06150522	
Reference Manife	Not reported	
Was Load Reject	No	
Reason Load Was Rejected:		Not reported
Waste Code:	F003	
Quantity:	400	
Unit:	G	
Hand Code:	T04	

Database(s)

EDR ID Number EPA ID Number

1000295137

ALTMAN STAGE LIGHTING (Continued)

Transport Date:

Transporter EPA ID:

Transporter Country:

Transporter Name:

Manifest Code: NJA5034279 NYD001391820 EPA ID: Date Shipped: 20040330 TSDF EPA ID: NJD002454544 Transporter EPA ID: NJD002454544 Transporter 2 EPA ID: Not reported Date Trans1 Transported Waste: 040330 Date Trans2 Transported Waste: 000000 Date TSDF Received Waste: 040330 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: 04280422 Reference Manifest Number: Not reported Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported Waste Code: F003 50 Quantity: Unit: G Hand Code: T04 Manifest Code: NJA5107580 EPA ID: NYD001391820 Date Shipped: 20041109 TSDF EPA ID: NJD002454544 Transporter EPA ID: NJD002454544 Transporter 2 EPA ID: Not reported Date Trans1 Transported Waste: 041109 Date Trans2 Transported Waste: 000000 Date TSDF Received Waste: 041109 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: 12270421 Not reported Reference Manifest Number: Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported Waste Code: F003 50 Quantity: Unit: G T04 Hand Code: CT MANIFEST: 2001 Year: Manifest ID: CTF0834968 TSDF EPA ID: CTD000604488 TSDF Name: CLEAN HARBORS OF CONNECTICUT INC **51 BRODERICK RD TSDF** Address: TSDF City,St,Zip: BRISTOL, CT 06010 **TSDF Country:** USA TSDF Telephone: Not reported

08/31/01

USA

MAD039322250

CLEAN HARBORS ENVIRONMENTAL SERVICES, INC.

Database(s)

EDR ID Number EPA ID Number

ALTMAN STAGE LIGHTING (Continued)

•	,
Transporter Phone:	Not reported
Trans 2 Date:	09/04/01
Trans 2 EPA ID:	Not reported
Trans 2 Name:	Not reported
Trans 2 Address:	Not reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not reported
Generator EPA ID:	NYD001391820
Gererator Phone:	9144767987
Generator Address:	Not reported
Generator City,State,Zip:	Not reported
Generator Country:	Not reported
Special Handling:	Not reported
Discrepancies:	No
Date Shipped:	08/31/01
Date Received:	09/04/01
Last modified date:	04/27/04
Last modified by:	IG
Comments:	Not reported

<u>Click this hyperlink</u> while viewing on your computer to access additional CT MANIFEST: detail in the EDR Site Report.

E54 NE < 1/8 554 ft.	CITY JAIL 54 ALEXANDER STREET YONKERS, NY Site 12 of 19 in cluster E	NY LTANKS S102673968 NY HIST LTANKS N/A
Relative: Higher	LTANKS: Site ID:	400000
Actual:	Spill Date:	189396 01/19/93
25 ft.	Facility Addr2: Facility ID:	Not reported 9211935
	Program Number:	9211935
	SWIS: Region of Spill:	6018 3
	Investigator:	tdghiosa
	Referred To: Reported to Dept:	Not reported 01/19/93
	CID: Spill Cause:	17 Tank Overfill
	Water Affected:	Not reported
	Spill Source:	Tank Truck
	Spill Notifier: Cleanup Ceased:	Fire Department 03/19/93
	Cleanup Meets Standard:	False / /
	Last Inspection: Recommended Penalty:	Penalty Not Recommended
	UST Involvement: Spill Class:	False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
	Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	
	Spille Namer:	Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

\$102673968

TY JAIL (Continued)	S102673968
Spiller Company:	BROOK OIL CO.
Spiller Phone:	(212) 665-7070
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	BRONX, NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9211935
DER Facility ID:	158103
Site ID:	189396
Operable Unit ID:	976506
Operable Unit:	01
Material ID:	405319
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9211935 SPILL ON SOIL AND PAVEMENT SPILLER TO SEND CLEAN UP CREW END CallerRemark - 9211935
Remark:	Start DECRemark - 9211935 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/25/93: TONY MILANESE STATES CLEAN-UP COMPLETED SAME DAY. 02/17/93: OFF. PULICE CALLED - CLEAN UP NOT COMPLETED TO SATISFACTION. INSPECTION -FOUND OIL STAIN 3'X10'VERY SLIGHT SHEEN FROM MELTING SNOW. CONTACTED BROOK OIL REQUESTED ADDITIONAL APPLICATION OF SPEEDI-DR. END DECRemark - 9211935
HIST LTANKS:	
Region of Spill:	3
Spill Number:	9211935
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Name: Notifier Agency:	Not reported Not reported
	•
Notifier Agency:	Not reported

Database(s)

EDR ID Number EPA ID Number

CITY JAIL (Continued)	S10267	3968
Spill Time:	15:00	
Reported to Department Date		
Reported to Department Time		
SWIS:		
	55 Networked	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Extention:	Not reported	
Spiller Name:	BROOK OIL CO.	
Spiller Address:	Not reported	
Spiller City,St,Zip:	BRONX, NY	
Facility Contact:	Not reported	
Facility Phone:	(212) 665-7070	
Facility Extention:	Not reported	
Spill Cause:	Tank Overfill	
Resource Affectd:	On Land	
Water Affected:	Not reported	
Spill Source:	Tank Truck	
Spill Notifier:	Fire Department	
PBS Number:	Not reported	
Cleanup Ceased:	03/19/93	
Cleanup Meets Standard:	False	
Last Inspection:		
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Date:		
Enforcement Date:		
Investigation Complete:		
UST Involvement:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing	
	Responsible Party. Corrective action taken.	
Spill Closed Dt:	03/19/93	
Date Region Sent Summary to	to Central Office: / /	
Corrective Action Plan Submit	itted: / /	
Date Spill Entered In Compute	er Data File: 01/20/93	
Time Spill Entered In Comput		
Spill Record Last Update:	03/19/93	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed Tank:	Not reported	
Gross Leak Rate:	Not reported	
Material Class Type:	Petroleum	
Quantity Spilled:	30	
Unkonwn Quantity Spilled:	False	
Units:	Gallons	
Quantity Recovered:	0	
Unkonwn Quantity Recovered	d: False	
Material:	#2 FUEL OIL	
Class Type:	#2 FUEL OIL	
Times Material Entry In File:	24464	
CAS Number:	Not reported	
Last Date:	19941207	
DEC Remarks: 01/25/93: T PULICE CA	TONY MILANESE STATES CLEAN-UP COMPLETED SAME DAY. 02/17/93: OFF. ALLED - CLEAN UP NOT COMPLETED TO SATISFACTION. INSPECTION - FOUN	-
	10 VERY SLIGHT SHEEN FROM MELTING SNOW. CONTACTED BROOK OIL RE AL APPLICATION OF SPEEDI-DR.	QUESIED

Map ID Direction			MAP FINDINGS		
Distance Distance (ft Elevation	i.) Site			Database(s)	EDR ID Number EPA ID Number
	CITY JAIL (Continue Spill Cause:	-	N SOIL AND PAVEMENT SPILLER TO SEND CLEAN UP CI	REW/	S102673968
		STILL OF	SOLAND TAVEMENT STILLER TO SEND CLEAN OF G		
F55 East < 1/8 577 ft.	CE - WOODWORTH A WOODWORTH / AS YONKERS, NY 10703	HBURTON		NY VCP	S105775548 N/A
	Site 1 of 6 in cluster	F			
Relative: Equal	VCP:				EPA ID Number S102673968 VCP S105775548 N/A ue, LUS 1000990039 NAS EST EST 1000990039 NYD986925790 NDS
•	Program Type:	VCP			
Actual: 9 ft.	Site Code: Assessment:	57100 Not repor	tod		
•	Env Problems:		aracterization is scheduled for 2007.		
	Site Desc:	The site is and Alexa the Greys	s located btween Babcock Place, Ashburton Avenue, Woodv ander St in Yonkers. It is currently occupied by the Metro No ston Bakery (V00361), and commercial properties. A site rization is scheudled for 2007.		
356	PATCLIN CHEMICAL	CO INC		CERCLIS	
South < 1/8 658 ft.	66 ALEXANDER ST YONKERS, NY 1070 ⁴	1		RCRA-SQG FINDS NY MANIFEST	NYD986925790
Relative:	Site 1 of 2 in cluster	G		CT MANIFEST	
Lower	CERCLIS: Site ID:		0203907		
Actual:	Federal Facility:		Not a Federal Facility		
6 ft.	NPL Status: Non NPL Status:		Not on the NPL Removal Only Site (No Site Assessment Work Needed)		
	Site Description:		Request for archiving made by the Removal Program 8/31 pursue Cost Recovery (J. Witkowski/L. Peterson) Remova unarchiving 10/11/02 (J. Witkowski)		not to
	CERCLIS Assessm	ent History:	:		
	Action:		ADMINISTRATIVE ORDER ON CONSENT		
	Date Started: Date Completed:		Not reported 06/30/1994		
	Priority Level:		Not reported		
	Action:		POTENTIALLY RESPONSIBLE PARTY REMOVAL		
	Date Started: Date Completed:		09/22/1994 09/26/1996		
	Priority Level:		Stabilized		
	Action:		REMOVAL ASSESSMENT		
	Date Started:		03/31/1998		
	Date Completed: Priority Level:		03/31/1998 Not reported		
	Action:		REMOVAL		
	Data Ctantad		03/31/1998		
	Date Started:				
	Date Started: Date Completed: Priority Level:	:	05/04/1998 Stabilized		

Database(s)

EDR ID Number EPA ID Number

1000990039

PATCLIN CHEMICAL CO INC (Continued)

Date Completed:	02/21/2002
Priority Level:	Not reported
Action:	REMOVAL
Date Started:	01/15/2002
Date Completed:	03/14/2002
Priority Level:	Stabilized
Action:	Notice Letters Issued
Date Started: Date Completed:	Not reported 03/15/2002
Priority Level:	Not reported
Action:	ISSUE REQUEST LETTERS (104E)
Date Started:	Not reported
Date Completed:	03/15/2002
Priority Level:	Not reported
Action:	ARCHIVE SITE
Date Started:	Not reported
Date Completed:	10/09/2002
Priority Level:	Not reported
Action:	Notice Letters Issued
Date Started:	Not reported
Date Completed:	08/17/2004
Priority Level:	Not reported
Action:	ISSUE REQUEST LETTERS (104E)
Date Started:	Not reported
Date Completed:	08/17/2004
Priority Level:	Not reported
Action:	ISSUE REQUEST LETTERS (104E)
Date Started:	Not reported
Date Completed:	12/02/2004
Priority Level:	Not reported
Action:	Notice Letters Issued
Date Started:	Not reported
Date Completed:	12/02/2004
Priority Level:	Not reported
Action:	ISSUE REQUEST LETTERS (104E)
Date Started:	Not reported
Date Completed:	12/16/2004
Priority Level:	Not reported
Action:	CONSENT AGREEMENT (ADMINISTRATIVE)
Date Started:	Not reported
Date Completed:	09/30/2005
Priority Level:	Not reported

Database(s)

EDR ID Number EPA ID Number

1000990039

PATCLIN CHEMICAL CO INC (Continued)

RCRAInfo:

Owner:	MARK KLEIN
	(212) 555-1212
EPA ID:	NYD986925790
Contact:	Not reported
Classification: TSDF Activities:	Small Quantity Generator Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

The NEI (National Emissions Inventory) database contains information on stationary and mobile sources that emit criteria air pollutants and their precursors, as well as hazardous air pollutants (HAPs).

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

Database(s)

EDR ID Number **EPA ID Number**

PATCLIN CHEMICAL CO INC (Continued)

NY MANIFEST: Document ID: NJA3277683 Manifest Status: Not reported Trans1 State ID: NJD003812047 Trans2 State ID: Not reported 02/26/2002 Generator Ship Date: Trans1 Recv Date: 02/26/2002 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/26/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925790 Trans1 EPA ID: NJD991291105 Trans2 EPA ID: Not reported H10376 Waste Code: D001 - NON-LISTED IGNITABLE WASTES 02100 G - Gallons (liquids only)* (8.3 pounds) Number of Containers: 001 Container Type: TT - Cargo tank, tank trucks Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 02 Facility Type: Generator NYD986925790 Facility Name: PATCLIN CHEMICAL CO Facility Address: 66 ALEXANDER ST Facility City: YONKERS Facility Zip 4: Not reported Not reported WESTCHESTER Mailing Name: PATCLIN CHEMICAL CO Mailing Contact: **CEIL FRANCIS** Mailing Address: 66 ALEXANDER ST Mailing City: YONKERS Mailing State: NY Mailing Zip: 10701 Mailing Zip4: Not reported Mailing Country: USA Mailing Phone: 914-476-7000

> Click this hyperlink while viewing on your computer to access 15 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST: Year:

TSDF ID:

Quantity:

Units:

Year:

EPA ID:

Country: County:

Manifest ID: TSDF EPA ID: TSDF Name: **TSDF** Address: TSDF City,St,Zip: **TSDF** Country: **TSDF** Telephone: Transport Date: Transporter EPA ID: Transporter Name:

1995 CTF0415228 CTD000604488 CLEAN HARBORS OF CONNECTICUT, INC. **51 BRODERICK RD** BRISTOL, CT 06010 USA Not reported 05/11/95 MAD039322250 CLEAN HARBORS ENVIRONMENTAL SERVICES, INC.

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000990039

<u>Click this hyperlink</u> while viewing on your computer to access 1 additional CT MANIFEST: record(s) in the EDR Site Report.

G57 SSW 1/8-1/4 667 ft. Relative:	SUPER TRANS 60 ALEXANDER ST YONKERS, NY Site 2 of 2 in cluster G	NY LTANKS S102232734 NY HIST LTANKS N/A
Lower	LTANKS:	
• • •	Site ID:	279928
Actual: 3 ft.	Spill Date:	04/29/04
511.	Facility Addr2: Facility ID:	Not reported 0401031
	Program Number:	0401031
	SWIS:	6018
	Region of Spill:	3
	Investigator:	WCHD
	Referred To:	Westchester Cnty Health Dept
	Reported to Dept:	04/29/04
	CID:	17
	Spill Cause:	Tank Overfill
	Water Affected:	Not reported
	Spill Source: Spill Notifier:	Commercial/Industrial
	Cleanup Ceased:	Responsible Party
	Cleanup Meets Standard:	True
	Last Inspection:	
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Spill Closed Dt: Remediation Phase: Date Entered In Computer Spill Record Last Update:	
	Spill Record Last Opdate.	

Map ID Direction Distance Distance (ft.) Elevation Site

AF FINDINGS

Database(s)

EDR ID Number EPA ID Number

S102232734

SUPER TRANS (Continued)

Spille Namer: STEVE BRAUM Spiller Company: Not reported Spiller Phone: (718) 444-3400 Spiller Extention: Not reported 60 ALEXANDER ST Spiller Address: Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: STEVE BRAUM Spiller Phone: (718) 444-3400 Spiller Extention: Not reported DEC Region: 3 Program Number: 0401031 DER Facility ID: 227270 Site ID: 279928 Operable Unit ID: 882950 Operable Unit: 01 Material ID: 492258 Material Code: 0008 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 5.00 Units: Gallons Recovered: 0.00 **Resource Affected:** Soil Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Not reported Last Modified: Test Method: Not reported DEC Remarks: Start CallerRemark - 0401031 about 5 gallons of diesel was spilled spill is in the process of being cleaned up END CallerRemark - 0401031 Start DECRemark - 0401031 Prior to Sept, 2004 data translation this spill Lead Remark: DEC Field was "WCHD-LALAK" 07/12/04: Letter to Edward J. Muto, Supertrans NY, Inc., from Karen Magnuson, WCDOH dated 6Jul2004. Spill cleanup report by Castleton Environmental has been reviewed. WCDOH recommends NFA at this time. END DECRemark - 0401031 279929 Site ID: Spill Date: 12/13/95 Facility Addr2: Not reported Facility ID: 9511617 Program Number: 9511617 SWIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported 12/14/95 Reported to Dept: CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported

Database(s)

EDR ID Number EPA ID Number

S102232734

SUPER TRANS (Continued)

	0102232734
Spill Source:	Commercial/Industrial
Spill Notifier:	Tank Tester
Cleanup Ceased:	//
Cleanup Meets Standard:	False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	08/29/02
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	10/06/03
Spille Namer:	ED MUTO
Spiller Company:	SUPER TRANS INC
Spiller Phone:	(914) 968-3300
Spiller Extention:	Not reported
Spiller Address:	60 ALEXANDER ST
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	
Spiller Contact:	ED MUTO
Spiller Phone:	(914) 968-3300
Spiller Extention:	Not reported
DEC Region:	3 9511617
Program Number: DER Facility ID:	227270
Site ID:	279929
Operable Unit ID:	1022279
Operable Unit:	01
Material ID:	358947
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	279929
Spill Tank Test:	18886
Tank Number:	1
Tank Size:	1000
Test Method:	03
Leak Rate:	-0.08
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Horner EZ Check I or II
DEC Remarks:	Start CallerRemark - 9511617 yonkers fd is aware of and is also responsible for
Pomark:	test. tank to be pumped and discarded. END CallerRemark - 9511617
Remark:	Start DECRemark - 9511617 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 7-29-02 SITE INVESTIGATION REPORT RECIEVED FROM TEAM
	ENVIRONMENTAL. BASED ON THE INFORMATION CONTAINED IN THAT REPORT, NO FURTHER
	ACTION IS NEEDED. TG END DECREMARK - 9511617

Database(s)

EDR ID Number EPA ID Number

S102232734

SUPER TRANS (Continued)

HIST LTANKS: Region of Spill: 3 Spill Number: 9511617 Investigator: GHIOSAY Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 12/13/1995 Spill Time: 13:00 Reported to Department Date: 12/14/95 Reported to Department Time: 10:38 SWIS: 55 Spiller Contact: ED MUTO Spiller Phone: (914) 968-3300 Spiller Extention: Not reported Spiller Name: SUPER TRANS Spiller Address: **60 ALEXANDER ST** Spiller City, St, Zip: YONKERS, NY Facility Contact: ED MUTO Facility Phone: (914) 968-3300 Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** On Land Water Affected: Not reported Other Commercial/Industrial Spill Source: Spill Notifier: Tank Tester PBS Number: Not reported **Cleanup Ceased:** 11 Cleanup Meets Standard: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 12/14/95 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 12/26/95 Is Updated: False PBS Number: Not reported Tank Number: 1 Tank Size: 1000 Horner EZ Check Test Method: -0.08 Leak Rate Failed Tank: Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0

Map ID		MAP FINDINGS		
Direction Distance Distance (ft. Elevation) Site	Da	atabase(s)	EDR ID Number EPA ID Number
	SUPER TRANS (Con	tinued)		S102232734
	Unkonwn Quantii Units: Quantity Recover Unkonwn Quantii Material: Class Type: Times Material E CAS Number: Last Date: DEC Remarks: Spill Cause:	Gallons red: 0 y Recovered: False DIESEL DIESEL	and	
E58 ENE 1/8-1/4 668 ft.	BECZAK ENVIRONMI 35 ALEXANDER STR YONKERS, NY	ENTAL CENTER US BROW EET, BLOCK/LOTS: 2605/57	/NFIELDS	1007442635 N/A
Relative: Higher	Site 13 of 19 in cluste US BROWNFIELDS	x		
Actual: 31 ft.	Recipient Name: Project Name: EPA ID: Region Number: Latitude: Longitude: Assessment Date Clean up Date: Entity Type:	City of Yonkers Yonkers, NY Not reported 2 Not reported Not reported Not reported Not reported Not reported Not reported		
E59 ENE 1/8-1/4 668 ft.	HABIRSHAW PROPE 35 ALEXANDER STR YONKERS, NY 10701	EET	NY VCP	S105114422 N/A
Relative:	Site 14 of 19 in cluste	r E		
Higher	VCP: Program Type: Site Code:	VCP		
Actual: 31 ft.	Site Code: Assessment: Env Problems: Site Desc:	57020 Not reported Not reported The site at 35 Alexander Street, was purchased by the County of Westcher order to joined with the 21 Alexander Street site (V00440) to form a waterfr green space and a refurbished home for the Beczak Environmental Educat Center. The site had been contaminated by PCBs and metals, particularly mercury and lead. The remediation of the site, performed in conjunction w the work at 21 Alexander Street was completed in 2004.	ont tion	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

E60 ENE 1/8-1/4	115 WOODWORTH AVE YONKERS, NY		NY LTANKS NY HIST LTANKS	S104619349 N/A
672 ft.	Site 15 of 19 in cluster E			
ENE	YONKERS, NY Site 15 of 19 in cluster E LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reforted to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:		NY HIST LTANKS	N/A
	Spiller Address: Spiller City,St,Zip:	115 WOODWORTH AVE YONKERS, ZZ		
	Spiller Contact: Spiller Phone: Spiller Extention:	BRIAN SCHUG (914) 434-7805 Not reported		
	Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.:	1038089 01 342382 0064A UNKNOWN MATERIAL Not reported		
	Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	Other 0.00 Gallons 0.00 Soil False		

Database(s)

EDR ID Number EPA ID Number

(Continued) S104619349 Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported **DEC Remarks:** Start CallerRemark - 9610171 during tank removal contaminated soil found - END CallerRemark - 9610171 Start DECRemark - 9610171 Prior to Sept, 2004 data translation this spill Lead Remark: DEC Field was "GHIOSAY" END DECRemark - 9610171 HIST LTANKS: Region of Spill: 3 Spill Number: 9610171 Investigator: GHIOSAY Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 11/14/1996 Spill Time: 13:00 Reported to Department Date: 11/14/96 Reported to Department Time: 14:06 SWIS: 55 Spiller Contact: **BRIAN SCHUG** Spiller Phone: (914) 434-7805 Spiller Extention: Not reported INSUL-X Spiller Name: 115 WOODWORTH AVE Spiller Address: Spiller City, St, Zip: YONKERS Facility Contact: **BRIAN SCHUG** Facility Phone: (914) 434-7805 Facility Extention: Not reported Spill Cause: Tank Failure **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: Other PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S104619349

(Continued)

Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 11/14/96 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 12/12/96 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Raw Sewage Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False UNKNOWN MATERIAL Material: UNKNOWN MATERIAL Class Type: Times Material Entry In File: 9140 CAS Number: Not reported Last Date: 19941109 DEC Remarks: Not reported Spill Cause: during tank removal contaminated soil found -

E61 STEVENS PAINT CORP/INSL-X PRODUCTS

ENE 115-119 WOODWORTH AVENUE 1/8-1/4 YONKERS, NY 10701

LICT.

672 ft.

Site 16 of 19 in cluster E

Relative: Higher

Higher	UST:	
•	PBS Number:	3-018929
Actual:	Tank Number:	1
30 ft.	Tank Status:	Closed-Removed
	Capacity:	1500 INSTALL DATE 07/01/1976
	Pipe Location:	Aboveground: 10% or more below ground
	Pipe Type:	Steel/Iron
	2nd Containment:	None
	Product:	Other
	Tank Location:	Underground
	Pipe Internal Protection:	None
	Pipe External Protection:	None
	Tank Type:	Steel/Carbon Steel
	Tank Internal Protection:	None
	Tank External Protection:	None
	Date Last Tested / Next Test:	NEXT TEST DATE
	Date Tank Closed / Category:	4/1/1995 CATEGORY A
	Leak Detection:	None
	Overfill Protection:	Product Level Gauge
	Dispenser Method:	Suction
	Facility Addr2:	Not reported
	Swiscode:	5518
	Operator:	Stevens Paint Corporation
	Phone:	(914) 969-8000
	In-service Capacity:	Not reported

NY UST U003994959 N/A

Database(s)

EDR ID Number EPA ID Number

U003994959

STEVENS PAINT CORP/INSL-X PRODUCTS (Continued)

Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Expire Date: Not reported CBS Number: 3-000119 Spdes Number: Not reported 40 56 12 / 73 53 58 Lat/Long: Not reported Site Type: Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported Richard P. Granito **Emergency Name:** (914) 969-8000 **Emergency Phone: Owner Name:** James A Weil / Insl-x Products Owner Address: 115-119 Woodworth Ave Owner Phone: (914) 969-8000 CORPORATE/COMMERCIAL Owner Type: Owner City,St,Zip: Yonkers, NY 10701 Mail Company: James A Weil Mail Address: 115-119 Woodworth Ave Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701 Attention: Stevens Paint Corp. Mail Phone: (914) 969-8000 Capacity: 1500 Date Last Tested: Not reported Next Test Date: Not reported Category: Α Install Date: 07/01/1976 Date Tank Was Closed: 4/1/1995 PBS Number: 3-018929 Tank Number: 2 Tank Status: Closed-Removed Capacity: 1500 INSTALL DATE 07/01/1976 Aboveground: 10% or more below ground Pipe Location: Steel/Iron Pipe Type: 2nd Containment: None Product: Other Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Steel/Carbon Steel Tank Type: Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/1995 CATEGORY A Leak Detection: None **Overfill Protection:** Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Stevens Paint Corporation (914) 969-8000 Phone: In-service Capacity: Not reported Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported

Not reported

Expire Date:

Database(s)

EDR ID Number EPA ID Number

STEVENS PAINT CORP/INSL-X PRODUCTS (Continued)

CBS Number: 3-000119 Spdes Number: Not reported 40 56 12 / 73 53 58 Lat/Long: Not reported Site Type: Number Of Active Tanks: 0 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name:** Richard P. Granito Emergency Phone: (914) 969-8000 **Owner Name:** James A Weil / Insl-x Products **Owner Address:** 115-119 Woodworth Ave Owner Phone: (914) 969-8000 CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: Yonkers, NY 10701 Mail Company: James A Weil Mail Address: 115-119 Woodworth Ave Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Attention: Stevens Paint Corp. (914) 969-8000 Mail Phone: 1500 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: А 07/01/1976 Install Date: Date Tank Was Closed: 4/1/1995 PBS Number: 3-018929 Tank Number: 3 Tank Status: Closed-Removed Capacity: 3000 INSTALL DATE 08/01/1956 Pipe Location: Aboveground: 10% or more below ground Pipe Type: Steel/Iron 2nd Containment: None Other Product: Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Steel/Carbon Steel Tank Type: Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/1995 CATEGORY A Leak Detection: None **Overfill Protection:** Product Level Gauge Dispenser Method: Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Stevens Paint Corporation Phone: (914) 969-8000 Not reported In-service Capacity: Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Expire Date: Not reported CBS Number: 3-000119 Not reported Spdes Number: Lat/Long: 40 56 12 / 73 53 58

Database(s)

EDR ID Number EPA ID Number

STEVENS PAINT CORP/INSL-X PRODUCTS (Continued)

Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name:** Richard P. Granito **Emergency Phone:** (914) 969-8000 Owner Name: James A Weil / Insl-x Products Owner Address: 115-119 Woodworth Ave Owner Phone: (914) 969-8000 CORPORATE/COMMERCIAL Owner Type: Owner City,St,Zip: Yonkers, NY 10701 Mail Company: James A Weil Mail Address: 115-119 Woodworth Ave Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701 Attention: Stevens Paint Corp. Mail Phone: (914) 969-8000 3000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: А Install Date: 08/01/1956 Date Tank Was Closed: 4/1/1995 PBS Number: 3-018929 Tank Number: 4 Tank Status: Closed-Removed Capacity: 3000 INSTALL DATE 10/01/1985 Pipe Location: Aboveground: 10% or more below ground Steel/Iron Pipe Type: None 2nd Containment: Product: Other Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/1995 CATEGORY A Leak Detection: None **Overfill Protection:** Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Stevens Paint Corporation Operator: Phone: (914) 969-8000 In-service Capacity: Not reported Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Not reported Certification Date: Expire Date: Not reported CBS Number: 3-000119 Spdes Number: Not reported Lat/Long: 40 56 12 / 73 53 58 Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported

Database(s)

EDR ID Number EPA ID Number

STEVENS PAINT CORP/INSL-X PRODUCTS (Continued)

Last Inspected: Not reported Richard P. Granito Emergency Name: Emergency Phone: (914) 969-8000 Owner Name: James A Weil / Insl-x Products **Owner Address:** 115-119 Woodworth Ave **Owner Phone:** (914) 969-8000 CORPORATE/COMMERCIAL Owner Type: Owner City,St,Zip: Yonkers, NY 10701 Mail Company: James A Weil Mail Address: 115-119 Woodworth Ave Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Attention: Stevens Paint Corp. Mail Phone: (914) 969-8000 Capacity: 3000 Date Last Tested: Not reported Next Test Date: Not reported Category: А 10/01/1985 Install Date: Date Tank Was Closed: 4/1/1995 PBS Number: 3-018929 Tank Number: 5 Tank Status: Closed-Removed 3000 INSTALL DATE 10/01/1985 Capacity: Pipe Location: Aboveground: 10% or more below ground Pipe Type: Steel/Iron 2nd Containment: None Product: Other Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE 4/1/1995 CATEGORY A Date Tank Closed / Category: Leak Detection: None Product Level Gauge **Overfill Protection: Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Stevens Paint Corporation (914) 969-8000 Phone: In-service Capacity: Not reported Unregulated; <1101 gal. PBS & no Subpart 360-14 Site Status: Certification Date: Not reported Expire Date: Not reported CBS Number: 3-000119 Not reported Spdes Number: Lat/Long: 40 56 12 / 73 53 58 Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported Richard P. Granito Emergency Name: **Emergency Phone:** (914) 969-8000

Database(s)

EDR ID Number EPA ID Number

STEVENS PAINT CORP/INSL-X PRODUCTS (Continued)

Owner Name: James A Weil / Insl-x Products Owner Address: 115-119 Woodworth Ave Owner Phone: (914) 969-8000 CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: Yonkers, NY 10701 Mail Company: James A Weil Mail Address: 115-119 Woodworth Ave Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Attention: Stevens Paint Corp. Mail Phone: (914) 969-8000 3000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: Install Date: 10/01/1985 Date Tank Was Closed: 4/1/1995 PBS Number: 3-018929 Tank Number: 6 Tank Status: Closed-Removed Capacity: 1500 INSTALL DATE 07/01/1976 Aboveground: 10% or more below ground Pipe Location: Pipe Type: Steel/Iron 2nd Containment: None Product: Other Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/1995 CATEGORY A Leak Detection: None **Overfill Protection:** Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Stevens Paint Corporation Operator: Phone: (914) 969-8000 Not reported In-service Capacity: Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Not reported Expire Date: CBS Number: 3-000119 Spdes Number: Not reported Lat/Long: 40 56 12 / 73 53 58 Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported Richard P. Granito **Emergency Name: Emergency Phone:** (914) 969-8000 Owner Name: James A Weil / Insl-x Products Owner Address: 115-119 Woodworth Ave Owner Phone: (914) 969-8000

Map ID Direction			MAP FINDINGS		
•) Site			Database(s)	EDR ID Number EPA ID Number
	STEVENS PAINT CO	DRP/INSL-X PRODUCTS	(Continued)		U003994959
	Owner Type: Owner City,St,Z Mail Company: Mail Address: Mail Address: Mail Address: Mail City,St,Zip Attention: Mail Phone: Capacity: Date Last Teste Next Test Date: Category: Install Date: Date Tank Was	Zip: Yonkers, N James A W 115-119 W Not reporte : Yonkers, N Stevens Pa (914) 969-8 1500 ed: Not reporte : Not reporte A 07/01/1976	/eil bodworth Ave ed IY 10701 aint Corp. 3000		
ENE 1/8-1/4	STEVENS PAINT CO 115-119 WOODWOF YONKERS, NY 1070	RTH AVE		RCRA-SQG FINDS NY MANIFEST	1000430116 NYD001389261
Deletive	Site 17 of 19 in clus	ter E			
	RCRAInfo:				
Actual:	Owner:	STEVENS PAINT CORP (212) 555-1212			
	EPA ID:	NYD001389261			
	Contact:	Not reported			
	Classification: TSDF Activities	Small Quantity Generato	r		
	Violation Status	: Violations exist			
	Regulation Vic Area of Violati Date Violation Actual Date Ac	on:	Not reported GENERATOR-ALL REQUIREMENTS 03/29/1991 07/30/1991	(OVERSIGHT)	
	Enforcemen Enforcemen Penalty Type	t Action Date:	WRITTEN INFORMAL 03/29/1991 Not reported		
	There are 1 vio	lation record(s) reported at	this site:		
	Evaluation		Area of Violation		Date of Compliance
		luation Inspection	GENERATOR-ALL REQUIREMENTS	(OVERSIGHT)	19910730
	FINDS [.]				

FINDS:

Other Pertinent Environmental Activity Identified at Site

ſ

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Database(s) El

EDR ID Number EPA ID Number

STEVENS PAINT CORP (Continued)

1000430116

TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

NY MANIFEST: Document ID: Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Year: Facility Type: EPA ID: Facility Name: Facility Address: Facility City: Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country:

Mailing Phone:

NYB1995282 Κ TR477-124 Not reported 900522 900522 Not reported 900523 900709 900717 NYD001389261 VAD040159436 Not reported VAD098443443 F003 - UNKNOWN 05162 G - Gallons (liquids only)* (8.3 pounds) 001 TT - Cargo tank, tank trucks B Incineration, heat recovery, burning. 088 90 Generator NYD001389261 STEVENS PAINT CORPORATION 115 WOODWORTH AVENUE YONKERS Not reported Not reported NEW YORK STEVENS PAINT CORPORATION Not reported 50 HOLT DIRVE POB 694 STONY POINT NY 10980 Not reported Not reported 914-969-8000

<u>Click this hyperlink</u> while viewing on your computer to access 25 additional NY MANIFEST: record(s) in the EDR Site Report.

Database(s) El

EDR ID Number EPA ID Number

_				
E63 ENE 1/8-1/4	STEVENS PAINT CORP/INSL-2 115 WOODWORTH AVENUE YONKERS, NY 10701	X PRODUCTS CORP.	NY CBS UST NY CBS AST	S102448100 N/A
672 ft.	Site 18 of 19 in cluster E			
Relative:				
Higher	CBS UST:			
A	CBS Number:	3-000119		
Actual: 30 ft.	Region:	STATE 2 200001		
50 11.	ICS No: PBS No:	3-300901 3-018929		
	MOSF No:	Not reported		
	Facility Tel:	(914) 786-5000		
	Town:	YONKERS (C)		
	Operator:	JOE GUARINO		
	Emergency Contact:	MICHEL GADBOIS, JOE GUARINO		
	Emergency Contact Phone	e: (914) 786-5000		
	Certification Date:	05/30/1995		
	Expiration Date:	06/27/1997		
	Owner Name:	INSL-X PRODUCTS CORPORATION		
	Owner Address:	50 HOLT DRIVE PO BOX 694		
	Owner City,St,Zip:	STONY POINT, NY 10980		
	Owner Tele:	(914) 786-5000		
	Owner Type: Total Tanks:	Corporate/Commercial 0		
	Facility Type:	MANUFACTURING		
	Mail To Name:	INSL-X PRODUCTS CORPORATION		
	Mail To Contact:	MICHEL GADBOIS		
	Mail To Address:	50 HOLT DRIVE		
	Mail To Address 2:	PO BOX 694		
	Mail To City,St,Zip:	STONY POINT, NY 10980		
	Facility Status:	NO LONGER A MAJOR FACILITY		
	Mail To Telephone:	(914) 786-5000		
	SPDES No:	Not reported		
	Owner Subtype:	Not reported		
	Tank Type:	Steel/carbon steel		
	Install Date:	01/68		
	CAS No: Substance:	1330207 Single Hazardous Substance on DEC List		
	Tank Location:	UNDERGROUND		
	Tank Internal:	None		
	Tank External:	None		
	Pipe Location:	Aboveground/Underground Combination		
	Pipe Internal:	None		
	Pipe External:	None		
	Leak Detection:	Other		
	2nd Containmt:	None		
	Overfill Protection:	Catch Basin		
	Haz Percent:	100		
	Chemical: Tank Closed:	Xylene (mixed)		
		00/00 None		
	Pipe Containment: Capacity:	None 1500		
	Tank Error Status:	No Missing Data		
	Tank Secret:	False		
	Date Entered:	12:18:00		
	Last Test:	Not reported		
	Due Date:	Not reported		
	SWIS Code:	5518		

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

Pipe Type:	STEEL/IRON	
Date Entered:	06/27/1989	
Tank Status:	Temporarily Out Of Service	
Cert Flag:	False	
Is it There:	False	
Is Updated:	False	
Owners Mark: Lat/Long:	First Owner	
Renew Date:	40 56 12 / 73 53 58 03/01/93	
Deliquent:	False	
Total Capacity:	0	
Date Expired:	06/27/95	
Tank Number:	002	
Flag:	C	
Case No:	Not reported	
Federal Amt:	True	
Pipe Flag:	False	
Reserve Flag:	True	
CBS AST:		
CBS Number:	3-000119	
Region:	STATE	
ICS Number:	3-300901	
PBS Number:	3-018929	
MOSF Number:	Not reported	
Telephone:	(914) 786-5000 XONKERS (C)	
Facility Town:	YONKERS (C)	
Operator:		
Emrgncy Contact: Emrgncy Phone:	MICHEL GADBOIS, JOE GUARINO (914) 786-5000	
Certified Date:	05/30/1995	
Expiration Date:	06/27/1997	
Owner Name:	INSL-X PRODUCTS CORPORATION	
Owner Address:	50 HOLT DRIVE PO BOX 694	
Owner City,St,Zip:	STONY POINT, NY 10980	
Owner Telephone:	(914) 786-5000	
Owner type:	Corporate/Commercial	
Facility Type:	MANUFACTURING	
Mail Name:	INSL-X PRODUCTS CORPORATION	
Mail Contact Addr:	50 HOLT DRIVE	
Mail Contact Addr2:	PO BOX 694	
Mail Contact Contact:	MICHEL GADBOIS	
	STONY POINT, NY 10980	
Mail Phone: SPDES Number:	(914) 786-5000	
SPDES Number: Facility Status:	Not reported ACTIVE FACILITY	
Owner Sub Type:	Not reported	
Tank Type:	Steel/carbon steel	
Install Date:	01/81	
CAS Number:	1330207	
Substance:	More than one Hazardous Substance on DEC List	
Tank Location:	ABOVEGROUND	
Intrnl Protection:	None	
Extrnl Protection:	None	
Pipe Location:	Aboveground	
Pipe Type:	STEEL/IRON	
Pipe Internal:	None	

S102448100

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

STEVENS PAINT CORP/INSL-X PRODUCTS CORP. (Continued)

Database(s)

EDR ID Number EPA ID Number

S102448100

		tion Fee Correct: True nted for Facility: True pp Last Printed: 03/03/15 tive Tanks(gal): 0	97		
F64 East 1/8-1/4 699 ft.	CON EDISON - WOODWOF WOODWORTH AND ASHB YONKERS, NY 10701		M	anufactured Gas Plants	1008408075 N/A
Relative: Higher	Site 2 of 6 in cluster F				
Actual: 28 ft.					
E65 ENE 1/8-1/4 718 ft.	CITY JAIL 26 ALEXANDER STREET YONKERS, NY			NY LTANKS NY Spills NY HIST LTANKS	S102673979 N/A
Relative:	Site 19 of 19 in cluster E				
Higher	LTANKS: Site ID:	234876			
Actual: 32 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill:	02/09/93 Not reported 9212659 9212659 6018 3			

Database(s)

EDR ID Number EPA ID Number

S102673979

CITY JAIL (Continued)	S102673979
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept:	02/09/93
CID:	17
Spill Cause:	Tank Overfill
Water Affected:	Not reported
Spill Source:	Tank Truck
Spill Notifier:	Affected Persons
Cleanup Ceased:	04/05/93
Cleanup Meets Standard:	False
Last Inspection:	11
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	04/05/93
Remediation Phase:	0
Date Entered In Computer	
Spill Record Last Update:	
Spille Namer:	Not reported
Spiller Company:	BROOK OIL CO.
Spiller Phone:	(212) 665-7070
Spiller Extention:	Not reported
Spiller Address:	163RD STREET
Spiller City,St,Zip:	BRONX, ZZ
Spiller County:	001 Not executed
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention: DEC Region:	Not reported 3
Program Number:	9212659
DER Facility ID:	193473
Site ID:	234876
Operable Unit ID:	977057
Operable Unit:	01
Material ID:	402496
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size: Test Method:	Not reported
	Not reported
Leak Rate: Gross Fail:	Not reported
Modified By:	Not reported Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9212659 SPILL ON BLACKTOP AND ONTO STREET AND CARS IN
DEC Remaine.	PARKING LOT CAME OUT VENT BROOK OIL APPLIED SAND AND LEFT SPILL OCCURED TWO

EDR ID Number Database(s) EPA ID Number

CITY JAIL (Continued)	S102673979
Remark:	WEEKS AGO NO FURTHER CLEAN UP HAS BEEN DONE END CallerRemark - 9212659 Start DECRemark - 9212659 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" // : SAME AS SPILL # 92-11935. END DECRemark - 9212659
NY Spills:	
Site ID:	353459
Facility Addr2:	Not reported
Facility ID:	0507953
Spill Number:	0507953
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	WCHD
Referred To:	Not reported
Spill Date:	10/03/05
Reported to Dept:	10/03/05
CID:	17
Spill Cause:	Other
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	
Cleanup Meets Std:	True
Last Inspection: Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
Spill Class.	Responsible Party. Corrective action taken.
Spill Closed Dt:	12/27/05
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	
Spiller Name:	ALBINA GLAZ
Spiller Company:	CITY OF YONKERS JAIL
Spiller Address:	26 ALEXANDER STREET
Spiller City,St,Zip:	YONKERS, NY
Spiller Company:	001
Spiller Phone:	(914) 377-6735 6352
Contact Name:	ALBINA GLAZ
Contact Phone:	(914) 377-6735 6352
DEC Region:	3
Program Number:	0507953
DER Facility ID:	193473
Site ID:	353459
Operable Unit ID:	1110918
Operable Unit:	01
Material ID: Material Code:	2100959
Material Name:	0001 #2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False

EDR ID Number Database(s) EPA ID Number

CITY JAIL (Continued	I) S102673979
DEC Remarks:	, Start CallerRemark - 0507953 DURING TANK REMOVAL, HOLES FOUND IN TANK, HISTORIC SPILL. TANK WAS SINGLE WALL STEEL. HAS NOT BEEN CLEANED UP. END CallerRemark - 0507953
Remark:	Start DECRemark - 0507953 03/07/06 Letter dated 12/27/05 from Barbara McDonald to Albina Glaz NFA. END DECRemark - 0507953
HIST LTANKS:	
Region of Spill:	3
Spill Number:	9212659
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension	
Spill Date: Spill Time:	02/09/1993 09:00
•	rtment Date: 02/09/93
	rtment Time: 09:44
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	BROOK OIL CO.
Spiller Address:	163RD STREET
Spiller City,St,Zip	
Facility Contact:	Not reported
Facility Phone:	(212) 665-7070
Facility Extention	•
Spill Cause:	Tank Overfill
Resource Affectd Water Affected:	
Spill Source:	Not reported Tank Truck
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	04/05/93
Cleanup Meets S	
Last Inspection:	
Recommended P	enalty: Penalty Not Recommended
Spiller Cleanup D	ate: / /
Enforcement Date	
Investigation Con	•
UST Involvement	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
On the Olympic of Di	Responsible Party. Corrective action taken.
Spill Closed Dt:	04/05/93 Summary to Control Office: / /
Corrective Action	Summary to Central Office: / / Plan Submitted: / /
	I In Computer Data File: 02/17/93
	In Computer Data File: 02/17/93
Spill Record Last	
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported

Database(s)

EDR ID Number EPA ID Number

S102673979

Tank Size:	Not reported
	•
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Not reported
Quantity Recovered:	0
Unkonwn Quantity Recovered	l: False
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In File:	24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: / / : SAME	AS SPILL 92-11935.
Spill Cause: SPILL ON	BLACKTOP AND ONTO STREET AND CARS IN PARKING LOT CAME OUT VENT BROOK
OIL APPLII	ED SAND AND LEFT SPILL OCCURED TWO WEEKS AGO NO FURTHER CLEAN UP HAS
BEEN DOM	IE

F66 ESE 1/8-1/4 718 ft.	ASHBURTON & WAHBURTON ASHBURTON / WAHBURTON YONKERS, NY		NY Spills NY Hist Spills	S102151267 N/A
	Site 3 of 6 in cluster F			
Relative: Higher	NY Spills:	000004		
	Site ID:	202364		
Actual:	Facility Addr2:	Not reported		
20 ft.	Facility ID:	9104198		
	Spill Number:	9104198		
	Facility Type:	ER		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Spill Date:	07/19/91		
	Reported to Dept:	07/19/91		
	CID:	Not reported		
	Spill Cause:	Traffic Accident		
	Water Affected:	Not reported		
	Spill Source:	Commercial Vehicle		
	Spill Notifier:	Health Department		
	Cleanup Ceased:	06/18/53		
	Cleanup Meets Std:	True		
	Last Inspection:	//		
	Recommended Penalty:	Penalty Not Recommended		
	UST Trust:	False		
	Spill Class:	Not reported		
	Spill Closed Dt:	09/11/91		
	Remediation Phase:	0		
	Date Entered In Computer:	07/19/91		
	Spill Record Last Update:	02/12/92		
	Spiller Name:	Not reported		
	Spiller Company:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	***Update***, ZZ		
	Spiller Company:	001		

Database(s)

EDR ID Number EPA ID Number

ASHBURTON & WAHBURTON AVE (Continued)

SHBURION & WAHBUR		E (Continued)	5102151267
Spiller Phone:	No	ot reported	
Contact Name:	No	ot reported	
Contact Phone:	No	ot reported	
DEC Region:	3		
Program Number:	91	04198	
DER Facility ID:		8334	
Site ID:		2364	
Operable Unit ID:		4968	
Operable Unit:	01		
Material ID: Material Code:		3291	
Material Name:		66A NKNOWN PETROLEUM	
Case No.:		of reported	
Material FA:		etroleum	
Quantity:	0.0		
Units:	No	bt reported	
Recovered:	0.0		
Resource Affected:	Sc	,il	
Oxygenate:	Fa	lse	
HIF		Remark - 9104198 CARLOS TORRES ON SITE WCHD TO HAN EPENDENT CHEMICAL CORP OF BROOKLYN TO CLEAN UP	
DE CLI fror	C Field v EANED I	emark - 9104198 Prior to Sept, 2004 data translation this spill Le vas "GHIOSAY" 09/11/91: CARLOS TORRES STATED THAT TH JP. 09/27/95: This is additional information about material spille nslation of the old spill file: SODIUM BISULPHATE. END DECRE	HE SPILL HAD BEEN ed
NY Hist Spills:			
Region of Spill: Spill Number:		3 9104198	
Investigator:		GHIOSAY	
Caller Name:		Not reported	
Caller Agency:		Not reported	
Caller Phone:		Not reported	
Notifier Name:		Not reported	
Notifier Agency:		Not reported	
Notifier Phone:		Not reported	
Spill Date/Time:		07/19/1991 12:15	
Reported to Dept Date	e/Time:	07/19/91 12:25	
SWIS:		55	
Spiller Name:		Not reported	
Spiller Contact:		Not reported	
Spiller Phone:		Not reported	
Spiller Address:		Not reported	
Spiller City,St,Zip:		Not reported Traffic Accident	
Spill Cause: Reported to Dept:		On Land	
Water Affected:		Not reported	
Spill Source:		07	
Spill Notifier:		Health Department	
PBS Number:		Not reported	
Cleanup Ceased:		06/18/53	
Cleanup Meets Std:		True	
Last Inspection:			
Recommended Penal	lty:	Penalty Not Recommended	
Spiller Cleanup Dt:		//	

Map ID Direction			l	MAP FINDINGS	3			
Distance Distance (ft. Elevation) Site						Database(s)	EDR ID Number EPA ID Number
	ASHBURTON & WAH	IBURTON AV	/E (Continued	d)				S102151267
	Enforcement Dat Invstgn Complete UST Involvemen Spill Class: Spill Closed Dt: Corrective Action Date Region Ser Date Spill Entere Date Spill Entere Update Date: Is Updated: PBS Number: Tank Number: Tank Number: Tank Size: Test Method: Leak Rate Failed Gross Leak Rate Material Class Ty Quantity Spilled: Unkonwn Quanti Units: Quantity Recove Unkonwn Quanti Material: Class Type: Times Material E CAS Number: Last Date: DEC Remarks:	te: e: t: n Plan Submit tot Summary to d In Compute ed In Compute d In Compute tot In Compute ty Spilled: red: ty Recovered intry In File: 09/11/91: C This is addi	/ / False Not reported 09/11/91 tted: o Central Office er Data File: 02/12/92 False Not reported Not reported Salse Not reported Not Not Not Not Not Not Not Not Not Not	/ / e: / / 07/19/91 Not reported PETROLEUM PETROLEUM RES STATED Theon about mater	HAT THE SPILL HAE ial spilled from the tra	-	-	09/27/95:
	Remark:	CARLOS T		TE WCHD TO	HANDLECOMPANY	HAS HIRE	ED INDEPENI	DENT CHEMICAL CORP

H67	CITY JAIL		
ENE	24 ALEXANDER STREET,	BLOCK/LOTS: 2608/1	
1/8-1/4	YONKERS, NY		
731 ft.			
	Site 1 of 11 in cluster H		
Relative: Higher	US BROWNFIELDS:	City of Vonkors	

	Recipient Name:	City of Yonkers
Actual:	Project Name:	Yonkers, NY
33 ft.	EPA ID:	Not reported
	Region Number:	2
	Latitude:	Not reported
	Longitude:	Not reported
	Assessment Date:	3/31/2001
	Clean up Date:	Not reported
	Entity Type:	Not reported

US BROWNFIELDS 1007442637

N/A

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
H68 ENE 1/8-1/4 757 ft.	NAVAL MILITIA SITE "PA 21 ALEXANDER ST. YONKERS, NY 10701	CEL A"	NY VCP	S105114421 N/A
	Site 2 of 11 in cluster H			
Relative: Higher	VCP:			
Actual:	Program Type: VC Site Code: 587			
35 ft.		reported		
		reported site at 21 Alexander Street, owner by the County of Westche	aatan badbaan	
	lea lea cor the	ed to the New York Ste Militia for training purposes until 1966 ed to the the City of Yonkers for recreational purposes. The taminated by metals and semivolatile organics (SVOCs). The site was completed in 2004 in conjunction with the remediatio ander Street.	6 when it was site was remedaition of	
H69	YONKERS WATERFRON	DEVEL	NY LTANKS	S103479054
ENE	21 ALEXANDER ST		NY HIST LTANKS	N/A
1/8-1/4 757 ft.	YONKERS, NY			
757 ft.	Site 3 of 11 in cluster H			
Relative: Higher	LTANKS:			
-	Site ID:	249376		
Actual: 35 ft.	Spill Date: Facility Addr2:	08/05/98 Not reported		
	Facility ID:	9805596		
	Program Number:	9805596		
	SWIS: Region of Spill:	6018 3		
	Investigator:	WCHD		
	Referred To:	Westchester Cnty Health Dept		
	Reported to Dept:	08/05/98		
	CID: Spill Cause:	17 Tank Failure		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial Other		
	Spill Notifier: Cleanup Ceased:			
	Cleanup Meets Stand	ard: False		
	Last Inspection: Recommended Penal	/ /		
	UST Involvement:	y: Penalty Not Recommended False		
	Spill Class:	Known release with minimal potential for fire or hazard. Responsible Party. Corrective action taken.	DEC Response. Willi	ng
	Spill Closed Dt:	/ /		
	Remediation Phase:	1		
	Date Entered In Com Spill Record Last Upo			
	Spille Namer:	Not reported		
	Spiller Company:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	***Update***, ZZ		
	Spiller County: Spiller Contact:	001 KEVIN REILLY		
	Spiller Phone:	(914) 949-7836		

Database(s)

EDR ID Number EPA ID Number

NKERS WATERFRONT	DEVEL (Continued) S103479054
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9805596
DER Facility ID:	204487
Site ID:	249376
Operable Unit ID:	1063364
Operable Unit:	01
Material ID:	320337
Material Code:	0002
Material Name:	#4 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9805596 CALLER REPORTING FINDING CONTAMINATED SOIL WHILE
	EXCAVATING A TANK. END CallerRemark - 9805596
Remark:	Start DECRemark - 9805596 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WCHD-MCDONALD" 8/6/98 REMOVAL OF 3000 GAL TANK STORING #4 OR
	#6. TANK LEAKED DURING REMOVAL. AKRF EXCAVATED TO LIMIT OF BACKHOE. PRODUCT
	REMOAINING WHEN BACKFILLED. SITE ASSESSMENT ORDERED. PER TOM GIBBONS - SITE
	ASSESSMENT WILL BEGIN WITHIN 2 WEEKS. 12/10/98 LOCATION IS PART OF YONKERS
	WATERFRONT DEVELOPEMENT PROJECT. FULL SITE ASSESSMENT FOR DEVELOPEMENT PHASE
	BE COMPLETED BY SPRING OF 1999, UST WILL BE ADDRESSED AT THAT TIME. B.
	MACDONALD TO FOLLOW UP. 12/05/03 VOLUNTARYCLEAN UP SITE. END DECRemark -
	9805596
ST LTANKS:	
Region of Spill:	3
Spill Number:	9805596
Investigator:	WCHD
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	08/05/1998
Spill Time:	11:00
Reported to Departmen	
Reported to Departmen	
SWIS:	
Spiller Contact:	KEVIN REILLY

(914) 949-7836

Not reported

Tank Failure

Not reported

Not reported

On Land

Other

False

11

11

11

11

11

False

Database(s)

EDR ID Number **EPA ID Number**

S103479054

YONKERS WATERFRONT DEVEL (Continued)

Spiller Phone:

Spiller Name:

Spiller Address:

Spiller City, St, Zip:

Facility Extention:

Resource Affectd:

Water Affected:

Facility Contact:

Facility Phone:

Spill Cause:

Spill Source: Spill Notifier:

PBS Number:

Cleanup Ceased:

Last Inspection:

Cleanup Meets Standard:

Recommended Penalty:

Investigation Complete:

Spiller Cleanup Date:

Enforcement Date:

UST Involvement:

Spill Class:

Spiller Extention:

Other Commercial/Industrial Penalty Not Recommended

Known release with minimal potential for fire or hazard, DEC Response, Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 08/05/98 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 01/16/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 30 Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #4 FUEL OIL #4 FUEL OIL Class Type: Times Material Entry In File: 1751 CAS Number: Not reported Last Date: 19941205 DEC Remarks: 8/6/98 REMOVAL OF 3000 GAL TANK STORING 4 OR 6. TANK LEAKED DURING REMOVAL. AKRF EXCAVATED TO LIMIT OF BACKHOE, PRODUCT REMOAINING WHEN BACKFILLED. SITE ASSESSMENT ORDERED. PER TOM GIBBONS - SITE ASSESSMENT WILL BEGIN WITHIN 2 WEEKS. 12/10/98 LOCATION IS PART OF YONKERS WATERFRONT DEVELOPEMENT PROJECT. FULL SITE ASSESSMENT FOR DEVELOPEMENT PHASE TO BE COMPLETED BY SPRING OF 1999, UST WILL BE ADDRESSED AT THAT TIME. B. MACDONALD TO FOLLOW UP. Spill Cause: CALLER REPORTING FINDING CONTAMINATED SOIL WHILE EXCAVATING A TANK.

Database(s)

EDR ID Number EPA ID Number

H70	HUDSON RIVER YOUTH CENTER		NY UST	U003856618
ENE	21 ALEXANDER STREET			N/A
1/8-1/4 757 ft.	YONKERS, NY 10701			
	Site 4 of 11 in cluster H			
Relative:	UST:			
Higher	PBS Number:	3-494259		
Actual:	Tank Number:	47		
35 ft.	Tank Status:	Closed-Removed		
	Capacity:	3000 INSTALL DATE		
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:	Steel/Iron		
	2nd Containment:	None		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location: Pipe Internal Protection:	Underground None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	None		
	Date Last Tested / Next Test:	NEXT TEST DATE		
	Date Tank Closed / Category:	10/1/1998 CATEGORY A		
	Leak Detection:	None		
	Overfill Protection:	Vent Whistle		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518 City Of Verslage		
	Operator: Phone:	City Of Yonkers		
	In-service Capacity:	Not reported 0		
	Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	0		
	Old Pbs Number:	Not reported		
	Last Inspected: Emergency Name:	Not reported		
	Emergency Phone:	Mayor's Help Line (914) 377-4357		
	Owner Name:	City Of Yonkers, Dept. of General Services		
	Owner Address:	40 South Broadway		
	Owner Phone:	(914) 377-6912		
	Owner Type:	LOCAL GOVERNMENT		
	Owner City,St,Zip:	Yonkers, NY 10701		
	Mail Company:	City Of Yonkers, Dept. of General Services		
	Mail Address:	40 South Broadway		
	Mail Address:	City Hall - Fifth Floor		
	Mail City,St,Zip:	Yonkers, NY 10701		
	Attention: Mail Phone:	Director of General Services		
	Capacity:	(914) 377-6912 3000		
	Date Last Tested:	Not reported		
	Next Test Date:	Not reported		
	Category:	Not reported		
	Install Date:	Not reported		

Database(s)

NY Spills NY Hist Spills

EDR ID Number EPA ID Number

U003856618

S102154169

N/A

HUDSON RIVER YOUTH CENTER (Continued)

Date Tank Was Closed:

Not reported

F71 SEWER LINE CONSTR. SITE ASHBURNTANT AVE/WOODWORTH East 1/8-1/4 YONKERS, NY 761 ft. Site 4 of 6 in cluster F Re

B I <i>d</i>	Site 4 of 6 in cluster F	
Relative:	NY Spills:	
Higher	Site ID:	304112
Actual:	Facility Addr2:	Not reported
32 ft.	Facility ID:	9009695
	Spill Number:	9009695
	Facility Type:	ER
	SWIS:	6018
	Region of Spill:	3
	Investigator:	tdghiosa
	Referred To:	Not reported
	Spill Date:	12/06/90
	Reported to Dept:	12/06/90
	CID:	Not reported
	Spill Cause:	Unknown
	Water Affected:	Not reported
	Spill Source:	Unknown
	Spill Notifier:	Local Agency
	Cleanup Ceased:	12/18/90
	Cleanup Meets Std:	True
	Last Inspection:	12/18/90
	Recommended Penalty:	Penalty Not Recommended
	UST Trust:	False
	Spill Class:	Not reported 12/18/90
	Spill Closed Dt: Remediation Phase:	0
	Date Entered In Computer:	-
	Spill Record Last Update:	
	Spiller Name:	Not reported
	Spiller Company:	PAINT FACTORY
	Spiller Address:	NEXT TO SITE
	Spiller City,St,Zip:	ZZ
	Spiller Company:	001
	Spiller Phone:	Not reported
	Contact Name:	Not reported
	Contact Phone:	Not reported
	DEC Region:	3
	Program Number:	9009695
	DER Facility ID:	245700
	Site ID:	304112
	Operable Unit ID:	950042
	Operable Unit:	01
	Material ID:	429895
	Material Code:	0056A
	Material Name:	PAINT THINNERS
	Case No.:	Not reported
	Material FA:	Other
	Quantity:	0.00
	Units:	Not reported
	Recovered:	0.00
	Resource Affected:	Soil

lap ID irection			N	IAP FINDINGS			
stance stance (ft.))						EDR ID Numbe
evation	Site					Database(s)	EPA ID Numbe
	SEWER LINE CONST	R. SITE (Co	ntinued)				S102154169
	Oxygenate:		, alse				
	DEC Remarks:	Start Caller NEW SEWE WILL STOC	Remark - 90096 ER LINE WILLS	TOCKPILE ON P	LASTIC USING M	VERED DURING EXCA ETERS AND SAMPLIN SHOULD BE BACK TO	IG TALKED TO R
	Remark:	Start DECR DEC Field v	Remark - 900969		004 data translatic RRED TO SOLID/	on this spill Lead HAZ. WASTE. END	
	NY Hist Spills:						
	Region of Spill:		3				
	Spill Number:		9009695				
	Investigator:		GHIOSAY				
	Caller Name:		Not reported				
	Caller Agency:		Not reported				
	Caller Phone: Notifier Name:		Not reported Not reported				
	Notifier Agency:		Not reported				
	Notifier Phone:		Not reported				
	Spill Date/Time:		12/06/1990 07	:00			
	Reported to Dept SWIS:	Date/Time:	12/06/90 15:07 55				
	Spiller Name:		PAINT FACTO	RY			
	Spiller Contact:		Not reported				
	Spiller Phone:		Not reported	_			
	Spiller Address:		NEXT TO SITE				
	Spiller City,St,Zip Spill Cause:):	Not reported Unknown				
	Reported to Dept		On Land				
	Water Affected:		Not reported				
	Spill Source:		12				
	Spill Notifier:		Local Agency				
	PBS Number:		Not reported				
	Cleanup Ceased	:	12/18/90				
	Cleanup Meets S	Std:	True				
	Last Inspection:		12/18/90				
	Recommended F		Penalty Not Re	ecommended			
	Spiller Cleanup E						
	Enforcement Dat Invstgn Complete						
	UST Involvemen		False				
	Spill Class:		Not reported				
	Spill Closed Dt:		12/18/90				
	Corrective Action	Plan Submit	tted:	//			
	Date Region Ser	t Summary to	o Central Office:	//			
	Date Spill Entere Date Spill Entere			12/14/90 Not reported			
	Update Date:		01/15/91				
	Is Updated:		False				
	PBS Number:		Not reported				
	Tank Number:		Not reported				
	Tank Size:		Not reported				
	Test Method:	- ·	Not reported				
	Leak Rate Failed		Not reported				
	Gross Leak Rate		Not reported	torial			
	Material Class Ty Quantity Spilled	/pe.	Hazardous Ma 0	lella			
	Quantity Spilled:		U				

Map ID Direction		MAP FINDINGS			
Distance					
Distance (ft)				EDR ID Number
Elevation	Site		Da	tabase(s)	EPA ID Number
	SEWER LINE CONSTR. SITE (C	ontinued)			S102154169
	Unkonwn Quantity Spilled:	False			
	Units:	Not reported			
	Quantity Recovered:	0			
	Unkonwn Quantity Recovere	d: False			

PAINT THINNERS

PAINT THINNERS

01/15/91: REFERRED TO SOLID/HAZ. WASTE.

Not reported

19940728

124

		METER AND TEST R	ESULTS SHOULD BE BA	CK TODAY	
H72 ENE 1/8-1/4 773 ft.	ALVIN LAST INC 19 BABCOCK PL YONKERS, NY 1			RCRA-SQG FINDS NY MANIFEST	1001489353 NY0000589044
	Site 5 of 11 in clu	ister H			
Relative: Higher	RCRAInfo: Owner:	ALVIN LAST INC			
Actual: 36 ft.	EPA ID:	(914) 479-0900 NY0000589044			

CONTAMINATED SOIL DISCOVERED DURING EXCAVATION FOR NEW SEWER LINE WILLSTOCKPILE

ON PLASTIC USING METERS AND SAMPLING TALKED TO RON WILL STOCKPILE BY USE OF

		(914) 479-0900
E	EPA ID:	NY0000589044
(Contact:	Not reported
		Small Quantity Generator
1	SDF Activities:	Not reported

Violation Status: No violations found

FINDS:

Material:

Class Type:

Last Date:

Remark:

CAS Number:

DEC Remarks:

Times Material Entry In File:

Other Pertinent Environmental Activity Identified at Site

ſ

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID: Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: PAE9113720 Not reported PAD067098822 Not reported 07/29/1999 07/29/1999 Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

ALVIN LAST INC (Continued)

Units:

Year:

TSD Site Recv Date: 07/30/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NY0000589044 Trans1 EPA ID: PAD067098822 Trans2 EPA ID: Not reported TSDF ID: PAAH0146 Waste Code: F003 - UNKNOWN Quantity: 00470 G - Gallons (liquids only)* (8.3 pounds) Number of Containers: 010 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 99 Facility Type: Generator EPA ID: NY0000589044 ALVIN LAST, INC. Facility Name: Facility Address: 19 BABCOCK PL Facility City: YONKERS Facility Zip 4: Not reported Country: Not reported WESTCHESTER County: Mailing Name: ALVIN LAST, INC. Mailing Contact: ZANE LAST 425 SAW MILL RIVER RD Mailing Address: Mailing City: ARDSLEY Mailing State: NY Mailing Zip: 10502 Mailing Zip4: Not reported Mailing Country: USA Mailing Phone: 914-479-0900

> Click this hyperlink while viewing on your computer to access 2 additional NY MANIFEST: record(s) in the EDR Site Report.

H73 NORTH YONKERS PUMP STATION-WCDEF NY UST **19 ALEXANDER STREET** ENE NY AST 1/8-1/4 YONKERS, NY 10705 773 ft. Site 6 of 11 in cluster H **Relative:** UST: Higher PBS Number: 3-018759 Actual: Tank Number: 3 36 ft. Tank Status: **Closed-In Place** 10000 INSTALL DATE 12/01/1998 Capacity: Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Other 2nd Containment: Double-Walled Tank Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: Other Tank Type: Fiberglass Coated Steel Tank Internal Protection: None Tank External Protection: Fiberglass Date Last Tested / Next Test: NEXT TEST DATE

1001489353

U003884867 N/A

Database(s)

EDR ID Number EPA ID Number

NORTH YONKERS PUMP STATION-WCDEF (Continued)

Date Tank Closed / Category:	
Leak Detection:	Interstitial Monitoring
Overfill Protection:	Automatic Shut-off, High Level Alarm
Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	Joe LaBella
Phone:	(914) 965-5233
In-service Capacity:	16775
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	40 56 13 / 73 54 10
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	Not reported
Last Inspected:	07/22/2004
Emergency Name:	Philip Simonetti
Emergency Phone:	(914) 490-2131
Owner Name:	Westchester County DEF
Owner Address:	270 North Avenue
Owner Phone:	(914) 813-5400
Owner Type:	LOCAL GOVERNMENT
Owner City,St,Zip:	New Rochelle, NY 10801
Mail Company:	Westchester County DEF
Mail Address:	270 North Avenue
Mail Address:	6th Floor
Mail City,St,Zip:	New Rochelle, NY 10801
Attention:	Thomas Lauro, P. E.
Mail Phone:	(914) 813-5400
Capacity:	10000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	12/01/1998
Date Tank Was Closed:	Not reported
PBS Number:	3-018759
Tank Number:	1
Tank Status:	In Service
Capacity:	8000 INSTALL DATE 06/01/2003
Pipe Location:	Aboveground: 10% or more below ground
Pipe Type:	Steel/Iron
2nd Containment:	Double-Walled Tank
Product:	Nos. 1, 2 or 4 Fuel Oil
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	Fiberglass
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	Fiberglass
Date Last Tested / Next Test:	NEXT TEST DATE
Date Tank Closed / Category:	CATEGORY
Leak Detection:	Interstitial Monitoring
Overfill Protection:	Product Level Gauge, High Level Alarm

Database(s)

EDR ID Number EPA ID Number

NORTH YONKERS PUMP STATION-WCDEF (Continued)

Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	Joe LaBella
Phone:	(914) 965-5233
In-service Capacity:	16775
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	40 56 13 / 73 54 10
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	
	Not reported 07/22/2004
Last Inspected:	Philip Simonetti
Emergency Name:	
Emergency Phone:	(914) 490-2131 Westshaster County DEE
Owner Name:	Westchester County DEF
Owner Address:	270 North Avenue
Owner Phone:	(914) 813-5400
Owner Type:	
Owner City,St,Zip:	New Rochelle, NY 10801
Mail Company:	Westchester County DEF
Mail Address:	270 North Avenue
Mail Address:	6th Floor
Mail City,St,Zip:	New Rochelle, NY 10801
Attention:	Thomas Lauro, P. E.
Mail Phone:	(914) 813-5400
Capacity:	8000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	06/01/2003
Date Tank Was Closed:	Not reported
PBS Number:	3-018759
Tank Number:	2
Tank Status:	In Service
Capacity:	8000 INSTALL DATE 06/01/2003
Pipe Location:	Aboveground: 10% or more below ground
Pipe Type:	Fiberglass (FRP)
2nd Containment:	Double-Walled Tank
Product:	Nos. 1, 2 or 4 Fuel Oil
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	Fiberglass
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	
Date Last Tested / Next Test:	Fiberglass
Date Tank Closed / Category:	
Leak Detection:	Interstitial Monitoring
Overfill Protection:	Product Level Gauge, High Level Alarm
Dispenser Method:	Suction Net reported
Facility Addr2: Swiscode:	Not reported
Swiscoue.	5518

Database(s) E

EDR ID Number EPA ID Number

NORTH YONKERS PUMP STATION-WCDEF (Continued)

		/0500
Operator:	Joe LaBella	
Phone:	(914) 965-5233	
In-service Capacity:	16775	
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not	
Certification Date:	Not reported	
Expire Date:	Not reported	
CBS Number:	Not reported	
Spdes Number:	Not reported	
Lat/Long:	40 56 13 / 73 54 10	
Site Type:	Not reported	
Number Of Active Tanks:	4	
Old Pbs Number:	Not reported	
Last Inspected:	07/22/2004	
Emergency Name:	Philip Simonetti	
Emergency Phone:	(914) 490-2131	
Owner Name:	Westchester County DEF	
Owner Address:	270 North Avenue	
Owner Phone:	(914) 813-5400	
Owner Type:	LOCAL GOVERNMENT	
Owner City,St,Zip:	New Rochelle, NY 10801	
Mail Company:	Westchester County DEF	
Mail Address:	270 North Avenue	
Mail Address:	6th Floor	
Mail City,St,Zip:	New Rochelle, NY 10801	
Attention:	Thomas Lauro, P. E.	
Mail Phone:	(914) 813-5400	
Capacity:	8000	
Date Last Tested:	Not reported	
Next Test Date:	Not reported	
Category:	Not reported	
Install Date:	06/01/2003	
Date Tank Was Closed:	Not reported	
PBS Number:	3-018759	
Tank Number:	4	
Tank Status:	Closed-Removed	
Capacity:	750 INSTALL DATE	
Pipe Location:	Not reported	
Pipe Type:	None	
2nd Containment:	Not reported	
Product:	Unleaded Gasoline	
Tank Location:	Underground	
Pipe Internal Protection:	None	
Pipe External Protection:	None	
Tank Type:	Steel/Carbon Steel	
Tank Internal Protection:	None	
Tank External Protection:	None	
Date Last Tested / Next Test:	NEXT TEST DATE	
Date Tank Closed / Category:	2/27/2003 CATEGORY	
Leak Detection:	None	
Overfill Protection:	None	
Dispenser Method:	Not reported	
Facility Addr2:	Not reported	
Swiscode:	5518	
Operator:	Joe LaBella	
Phone:	(914) 965-5233	
In-service Capacity:	16775	
. ,		

AST:

Leak Detection: **Overfill Protection:**

Facility Addr2:

Swiscode:

Operator:

Site Status:

Phone:

Dispenser Method:

In-service Capacity:

Certification Date:

MAP FINDINGS

EDR ID Number Database(s)

EPA ID Number

U003884867

NORTH YONKERS PUMP STATION-WCDEF (Continued)

Site Status: Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported 40 56 13 / 73 54 10 Lat/Long: Not reported Site Type: Number Of Active Tanks: 4 Old Pbs Number: Not reported Last Inspected: 07/22/2004 **Emergency Name:** Philip Simonetti (914) 490-2131 **Emergency Phone: Owner Name:** Westchester County DEF Owner Address: 270 North Avenue Owner Phone: (914) 813-5400 Owner Type: LOCAL GOVERNMENT Owner City, St, Zip: New Rochelle, NY 10801 Mail Company: Westchester County DEF Mail Address: 270 North Avenue Mail Address: 6th Floor Mail City, St, Zip: New Rochelle, NY 10801 Attention: Thomas Lauro, P. E. Mail Phone: (914) 813-5400 Capacity: 750 Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Install Date: Not reported Date Tank Was Closed: Not reported PBS Number: 3-018759 Tank Number: 003 Tank Status: In Service 500 INSTALL DATE 06/01/2003 Capacity: Pipe Location: Aboveground Pipe Type: Steel/Iron 2nd Containment: **Double-Walled Tank** Product: Nos. 1, 2 or 4 Fuel Oil Aboveground Tank Location: Pipe Internal Protection: None Pipe External Protection: Painted/Asphalt Coating Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating 6/1/2004 NEXT TEST DATE Date Last Tested / Next Test: Date Tank Closed / Category: CATEGORY

Interstitial Monitoring

High Level Alarm

Suction

5518

16775

Not reported

Joe LaBella

Not reported

(914) 965-5233

Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not

Database(s)

EDR ID Number EPA ID Number

NORTH YONKERS PUMP STATION-WCDEF (Continued)

Expire Date: Not reported CBS Number: Not reported Not reported Spdes Number: Lat/Long: 40 56 13 / 73 54 10 Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: Not reported Last Inspected: 07/22/2004 Philip Simonetti **Emergency Name: Emergency Phone:** (914) 490-2131 **Owner Name:** Westchester County DEF **Owner Address:** 270 North Avenue Owner Phone: (914) 813-5400 Owner Type: LOCAL GOVERNMENT Owner City, St, Zip: New Rochelle, NY 10801 Mail Company: Westchester County DEF Mail Address: 270 North Avenue Mail Address: 6th Floor Mail City, St, Zip: New Rochelle, NY 10801 Attention: Thomas Lauro, P. E. Mail Phone: (914) 813-5400 Capacity: 500 Date Last Tested: 6/1/2004 Next Test Date: Not reported Category: Not reported Install Date: 06/01/2003 Date Tank Was Closed: Not reported PBS Number: 3-018759 004 Tank Number: Tank Status: In Service Capacity: 275 INSTALL DATE 06/01/1999 Pipe Location: Not reported Pipe Type: None Synthetic Liner 2nd Containment: Used Oil Product: Tank Location: Aboveground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** Catch Basin, Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Joe LaBella Phone: (914) 965-5233 In-service Capacity: 16775 Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Site Status: Certification Date: Not reported Expire Date: Not reported Not reported **CBS Number:** Spdes Number: Not reported

Database(s)

EDR ID Number EPA ID Number

Lat/Long: Site Type: Number Of Active Tanks: Old Pbs Number: Last Inspected: **Emergency Name: Emergency Phone: Owner Name:** Owner Address: Owner Phone: Owner Type: Owner City, St, Zip: Mail Company: Mail Address: Mail Address: Mail City, St, Zip: Attention: Mail Phone: Capacity: Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed:

40 56 13 / 73 54 10 Not reported 4 Not reported 07/22/2004 Philip Simonetti (914) 490-2131 Westchester County DEF 270 North Avenue (914) 813-5400 LOCAL GOVERNMENT New Rochelle, NY 10801 Westchester County DEF 270 North Avenue 6th Floor New Rochelle, NY 10801 Thomas Lauro, P. E. (914) 813-5400 275 Not reported Not reported Not reported 06/01/1999 Not reported

F74

East	WARBURTON/ASHBURTON
1/8-1/4	YONKERS, NY
828 ft.	

Site 5 of 6 in cluster F

Relative: Higher

Actual: 49 ft. NY Spills: 100757 Site ID: Not reported Facility Addr2: 0400919 Facility ID: Spill Number: 0400919 Facility Type: ER SWIS: 6018 Region of Spill: 3 Investigator: jbodee Referred To: Not reported Spill Date: 04/27/04 Reported to Dept: 04/27/04 CID: 444 Spill Cause: Other Water Affected: Not reported Institutional, Educational, Gov., Other Spill Source: Spill Notifier: Citizen Cleanup Ceased: 11 Cleanup Meets Std: True Last Inspection: 04/29/04 **Recommended Penalty:** Penalty Not Recommended UST Trust: False Spill Class: Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required. Spill Closed Dt: 04/29/04 **Remediation Phase:** 0 Date Entered In Computer: 04/27/04

U003884867

NY Spills S106468498 N/A Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

(Continued)		S106468498
Spill Record Last I	Update: 04/29/04	
Spiller Name:	MARK	
Spiller Company:	Not reported	
Spiller Address:	WARBURTON/ASHBURTON	
Spiller City,St,Zip:	: YONKERS, NY	
Spiller Company:	001	
Spiller Phone:	(914) 968-6368	
Contact Name:	MARK	
Contact Phone:	(914) 968-6368	
DEC Region:	3	
Program Number:	. 0400919	
DER Facility ID:	89426	
Site ID:	100757	
Operable Unit ID:	885090	
Operable Unit:	01	
Material ID:	492154	
Material Code:	0066A	
Material Name:	UNKNOWN PETROLEUM	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected	d: Soil	
Oxygenate:	False	
DEC Remarks:	Start CallerRemark - 0400919 OIL COMPANY CAME TO PUMP , AND SCHOOL KI	DS PUSHED
	SOME HOSE AND OIL STARTED TO GO IN STORM DRAIN AND ON STREET: E	ND CallerRemark
	- 0400919	
Remark:	Start DECRemark - 0400919 Prior to Sept, 2004 data translation this spill Lead	
	DEC Field was "O'DEE" 04/29/04 DEC INSPECTED SITE. PETROLEUM STAINING	S NOTED ON
	PAVEMENT. NO DRAINS OR CATCH BASINS IMPACTED. NO PRODUCT RECOV	VERABLE. jbo END
	DECRemark - 0400919	

F75 ESE 1/8-1/4 830 ft.	RESIDENTS 150 WARBURTON AVE YONKERS, NY	
830 ft. Relative: Higher Actual: 49 ft.	Site 6 of 6 in cluster F NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected:	125335 Not reported 9913674 9913674 ER 6018 3 tdghiosa Not reported 03/03/00 03/03/00 17 Equipment Failure Not reported
	Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	Private Dwelling Other / / True

NY Spills S104510471 NY Hist Spills N/A

EDR ID Number Database(s) EPA ID Number

RESIDENTS (Continued)

S104510471

		ω)		
	Last Inspection:		//	
	Recommended Per	nalty:	Penalty Not Recommended	
	UST Trust:		False	
	Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willing	
			Responsible Party. Corrective action taken.	
	Spill Closed Dt:		10/12/00	
	Remediation Phase	e:	0	
	Date Entered In Co	mputer:	03/03/00	
	Spill Record Last U	pdate:	02/26/01	
	Spiller Name:		JOHN KHADER-PRESIDENT	
	Spiller Company:		TOP CLASS LIMO	
	Spiller Address:		24 ASHBURTON AVENUE	
	Spiller City, St, Zip:		YONKERS, NY	
	Spiller Company:		001	
	Spiller Phone:		(914) 423-5466	
	Contact Name:		BRUCE LORD	
	Contact Phone:		(914) 375-0017	
	DEC Region:		3	
	Program Number:		9913674	
	DER Facility ID:		108416	
	Site ID:		125335	
	Operable Unit ID:		1088201	
	Operable Unit:		01	
	Material ID:		295509	
	Material Code:		0001	
	Material Name:		#2 Fuel Oil	
	Case No.:		Not reported	
	Material FA:		Petroleum	
	Quantity:		0.00 Collana	
	Units: Recovered:		Gallons	
	Resource Affected:		0.00 Soil	
	Oxygenate:		False	
		Start Cal	lerRemark - 9913674 THE OIL COMPANY WAS CALLED TO INVESTIGATE A OIL	
			IEV FOUND OIL IN A CRAWL SPACE. THE OIL IS A COUPLE OF INCHES	
			VKNOWN WHERE EXACTLY THE OIL CAME FROM.OIL COMP REP IS AT 914-472-1424	
			RTHER QUESTIONS. ENDCallerRemark - 9913674	
			CRemark - 9913674 Prior to Sept, 2004 data translation this spill Lead	
			d was "GHIOSAY" 03/03/2000 WCHD ON SCENE. NES CONTRACTED TO CLEAN UP,	
			S MAY BE FROM ANOTHER SOURCE. WCHD TO REVISIT ON MONDAY. 03/07/2000	
	I	NVESTI	GATION REVEALED THAT SOURCE OF SPILL WAS A UST LOCATED AT 24 ASHBURTO	N
	A	AVENUE	. THAT UST FILLED WITH WASHWATER, OIL SYPHONED VIA AN UNCAPPED RETURN	1
	L	INE TO	A SUMP. OIL LEAKED THROUGH THE SUMP WALL TO AN OLD PIPE WHICH FORMER	LΥ
	(CARRIE	D ROOF DRAINAGE TOTHE SUBSURFACE STRUCTURE OF 150 WARBURTON AVENUE	Ξ.
	F	PROPER	CLEANUP & TANK ABANDONMENT BEING PERFORMED. 10/12/2000 PROBLEM TA	NK
	F	REMOVE	ED BY NORTHEAST ENVIRONMENTAL. 26.31 TONS OF CONTAMINATED SOIL WAS	
	E	EXCAVA	TED & DISPOSED @ TPS TECHNOLOGIES. SEE OTHER SPILL NUMBER 0008096. NO	1
	F	URTHE	R ACTION. END DECRemark - 9913674	
N	Y Hist Spills:			
	Region of Spill:		3	
	Spill Number:		9913674	
	Investigator:		GHIOSAY	
	Caller Name:		Not reported	
	Caller Agency:		Not reported	
	Caller Phone:		Not reported	
	Notifier Name:		Not reported	

Database(s)

EDR ID Number EPA ID Number

RESIDENTS (Continued)

S104510471

.5	IDENTS (Continued)	5104510471
	Notifier Agency:	Not reported
	Notifier Phone:	Not reported
	Spill Date/Time:	03/03/2000 17:24
	Reported to Dept Date/Time:	03/03/00 18:24
	SWIS:	55
	Spiller Name:	TOP CLASS LIMO
	Spiller Contact:	JOHN KHADER-PRESIDENT
	Spiller Phone:	(914) 423-5466
	Spiller Contact:	BRUCE LORD
	Spiller Phone:	(914) 375-0017
	Spiller Address:	24 ASHBURTON AVENUE
	Spiller City,St,Zip:	YONKERS, NY
	Spill Cause:	Equipment Failure
	Reported to Dept:	On Land
	Water Affected:	Not reported
	Spill Source:	09
	Spill Notifier:	Other
	PBS Number:	Not reported
	Cleanup Ceased:	
	Cleanup Meets Std:	True
	Last Inspection:	/ /
	Recommended Penalty:	Penalty Not Recommended
	Spiller Cleanup Dt: Enforcement Date:	
	Invstgn Complete:	//
	UST Involvement:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	opiii class.	Responsible Party. Corrective action taken.
	Spill Closed Dt:	10/12/00
	Corrective Action Plan Submit	
	Date Region Sent Summary to	
	Date Spill Entered In Compute	
	Date Spill Entered In Compute	
	Update Date:	02/26/01
	Is Updated:	True
	PBS Number:	Not reported
	Tank Number:	Not reported
	Tank Size:	Not reported
	Test Method:	Not reported
	Leak Rate Failed Tank:	Not reported
	Gross Leak Rate:	Not reported
	Material Class Type:	Petroleum
	Quantity Spilled:	0
	Unkonwn Quantity Spilled:	True
	Units:	Gallons
	Quantity Recovered: Unkonwn Quantity Recovered	0
	Material:	#2 FUEL OIL
	Class Type:	#2 FUEL OIL
	Times Material Entry In File:	24464
	CAS Number:	Not reported
	Last Date:	19941207
		WCHD ON SCENE. NES CONTRACTED TO CLEAN UP, APPEARS MAY BE FROM
		SOURCE. WCHD TO REVISIT ON MONDAY. 03/07/2000 INVESTIGATION
		THAT SOURCE OF SPILL WAS A UST LOCATED AT 24 ASHBURTON AVENUE. THAT
		D WITH WASHWATER, OIL SYPHONED VIA AN UNCAPPED RETURN LINE TO A SUMP.
		D THROUGH THE SUMP WALL TO AN OLD PIPE WHICH FORMERLY CARRIED ROOF

Database(s) EPA II

EDR ID Number EPA ID Number

RESIDENTS (Continued)

Remark:

S104510471

DRAINAGE TO THE SUBSURFACE STRUCTURE OF 150 WARBURTON AVENUE. PROPER CLEANUP TANK ABANDONMENT BEING PERFORMED.10/12/2000 PROBLEM TANK REMOVED BY NORTHEAST ENVIRONMENTAL. 26.31 TONS OF CONTAMINATED SOIL WAS EXCAVATED DISPOSED @ TPS TECHNOLOGIES. SEE OTHER SPILL NUMBER 0008096. NO FURTHER ACTION. THE OIL COMPANY WAS CALLED TO INVESTIGATE A OIL LEAK.THEY FOUND OIL IN A CRAWL SPACE.THE OIL IS A COUPLE OF INCHES DEEP.UNKNOWN WHERE EXACTLY THE OIL CAME FROM.OIL COMP REP IS AT 914-472-1424 FOR FURTHER QUESTIONS.

H76 NE 1/8-1/4 845 ft	PARKING LOT 143 WOODWORTH AVE YONKERS, NY		NY Spills	S106468502 N/A
	Site 7 of 11 in cluster H			
Relative: Higher	NY Spills: Site ID:	317186		
845 ft. Relative: Higher Actual: 27 ft.	NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Spill Class: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spill Record Last Update:	Not reported 0400924 0400924 ER 6018 3 jbodee Not reported 04/27/04 04/27/04 17 Abandoned Drums Not reported Institutional, Educational, Gov., Other Citizen / / True 04/29/04 Penalty Not Recommended False No spill occured. No DEC Response. No corrective action require 04/29/04 0 04/27/04 0 04/27/04 Not reported	d.	
	Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Spiller Phone:	UNKNOWN Not reported NY 999 Not reported		
	Contact Name: Contact Phone: DEC Region: Program Number: DER Facility ID: Site ID:	Not reported Not reported 3 0400924 255684 317186		
	Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name:	882899 01 492159 0064A UNKNOWN MATERIAL		

Database(s)

EDR ID Number **EPA ID Number**

S106468502

RCRA-SQG 1007208708 NY MANIFEST NYR000122655

PARKING LOT (Continued)

Case No.:	Not reported
Material FA:	Other
Quantity:	0.00
Units:	Pounds
Recovered:	0.00
Resource Affecte	ed: Soil
Oxygenate:	False
DEC Remarks:	Start CallerRemark - 0400924 PILE OF GREEN LIQUID ON LOT: END CallerRemark -
	0400924
Remark:	Start DECRemark - 0400924 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "O'DEE" 04/29/04 DEC INSPECTED SITE. MATERIAL IS GREEN PAINT
	WHICH WAS SPILLED TO PAVEMENT AND HAS DRIED. PROPERTY OWNER WILL REMOVE. jbo
	END DECRemark - 0400924

H77	SOUTHERN NEW YORK ENTERPRISES LTD
NE	143-151 WOODWORTH AVE
1/8-1/4	YONKERS, NY 10710

845 ft.

Actual: 27 ft.

Site 8 of 11 in cluster H

Relative: Higher

RCRAInfo: Owner:	SOUTHERN NEW YORK ENTERPRISES LTD (914) 530-9000
EPA ID:	NYR000122655
Contact:	CHARLES TRAMANTANO (914) 530-9000

Classification: Small Quantity Generator TSDF Activities: Not reported

Violation Status: No violations found

NY MANIFEST:

Document ID:	NYC7201607
Manifest Status:	Not reported
Trans1 State ID:	NY10827JF
Trans2 State ID:	1212B7NY
Generator Ship Date:	03/11/2004
Trans1 Recv Date:	03/11/2004
Trans2 Recv Date:	03/12/2004
TSD Site Recv Date:	03/23/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000122655
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	Not reported
TSDF ID:	KYD053348
Waste Code:	F003 - UNKNOWN
Quantity:	00500
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Year:	04
Facility Type:	Generator
EPA ID:	NYR000122655
Facility Name:	SOUTHERN NY ENTERPRISES LT

Direction	Ц			
Distance				
Distance (f				EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	SOUTHERN NEW YORK ENTERP	RISES LTD (Continued)		1007208708
	Facility Address:	145 WOODWORTH AVE		
	Facility City:	YONKERS		
	Facility Zip 4:	Not reported		
	Country:	USA		
	County:	WESTCHESTER		
	Mailing Name:	SOUTHERN NY ENTERPRISES LT		
	Mailing Contact:	CHARLES TRAMANTANO		
	Mailing Address:	143 WOODWORTH AVE		
	Mailing City:	YONKERS		
	Mailing State:	NY		
	Mailing Zip:	10701		
	Mailing Zip4:	Not reported		
	Mailing Country:	USA		
	Mailing Phone:	845-279-0263		
	Click this by	perlink while viewing on your computer to access		
	-	IY MANIFEST: detail in the EDR Site Report.		
H78	SAM'S SERVICE STATION		NY UST	U003988561
ENE	178 WARBURTON AVE.			N/A
1/8-1/4	YONKERS, NY 10701			
904 ft.				
Relative:	Site 9 of 11 in cluster H			
Higher	UST:			
-	PBS Number:	3-497606		
Actual:	Tank Number:	1		
52 ft.	Tank Status:	Temporarily Out of Service		
	Capacity:	3000 INSTALL DATE		
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:	Steel/Iron		
	2nd Containment:	Other		
	Product:	Unleaded Gasoline		
	Tank Location:	Underground		
	Pipe Internal Protection:	Epoxy Liner		
	Pipe External Protection:	Painted/Asphalt Coating		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	Other		
	Tank External Protection:	Other		
	Date Last Tested / Next Test:			
	Date Tank Closed / Category:	CATEGORY		

Double Bottom

Not reported 5518

Sam Naber (914) 968-8484

Not reported Not reported

Not reported

Not reported

Not reported

Not reported

3-103845

4

Suction

12000

Float Vent Valve

Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not

Map ID

Leak Detection:

Facility Addr2:

Swiscode: Operator:

Site Status: Certification Date:

Expire Date: CBS Number:

Lat/Long:

Site Type:

Spdes Number:

Old Pbs Number:

Number Of Active Tanks:

Phone:

Overfill Protection:

Dispenser Method:

In-service Capacity:

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

SAM'S SERVICE STATION (Continued)

Last Inspected: Not reported **Emergency Name:** Bassam Naber Emergency Phone: (914) 376-0100 Owner Name: Suleiman Naber **Owner Address:** 2 Victoria Lane (914) 968-8484 **Owner Phone:** Owner Type: Not reported Owner City,St,Zip: Yonkers, NY 10701 Mail Company: Sam's Service Station Mail Address: 178 Warburton Avenue Mail Address: Not reported Yonkers, NY 10701 Mail City, St, Zip: Attention: Suleiman Naber Mail Phone: (914) 968-8484 Capacity: 3000 Date Last Tested: Not reported Next Test Date: 6/1/1999 Category: Not reported Install Date: Not reported Date Tank Was Closed: Not reported PBS Number: 3-497606 Tank Number: 2 Tank Status: Temporarily Out of Service 3000 INSTALL DATE Capacity: Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Steel/Iron 2nd Containment: Other Product: **Unleaded Gasoline** Underground Tank Location: Pipe Internal Protection: **Epoxy Liner** Pipe External Protection: Painted/Asphalt Coating Tank Type: Steel/Carbon Steel Tank Internal Protection: Other Other Tank External Protection: Date Last Tested / Next Test: NEXT TEST DATE 6/1/1999 Date Tank Closed / Category: CATEGORY Leak Detection: Double Bottom **Overfill Protection:** Float Vent Valve **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Sam Naber Phone: (914) 968-8484 In-service Capacity: 12000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Not reported Spdes Number: Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: 3-103845 Last Inspected: Not reported Emergency Name: Bassam Naber **Emergency Phone:** (914) 376-0100

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

U003988561

SAM'S SERVICE STATION (Continued)

Owner Name: Suleiman Naber Owner Address: 2 Victoria Lane Owner Phone: (914) 968-8484 Not reported Owner Type: Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Sam's Service Station Mail Address: 178 Warburton Avenue Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Attention: Suleiman Naber (914) 968-8484 Mail Phone: 3000 Capacity: Date Last Tested: Not reported Next Test Date: 6/1/1999 Category: Not reported Install Date: Not reported Date Tank Was Closed: Not reported PBS Number: 3-497606 Tank Number: 3 Tank Status: Temporarily Out of Service Capacity: 3000 INSTALL DATE Aboveground on saddles, legs, stilts, rack or cradle Pipe Location: Pipe Type: Steel/Iron 2nd Containment: Other Product: **Unleaded Gasoline** Tank Location: Underground Pipe Internal Protection: Epoxy Liner Pipe External Protection: Painted/Asphalt Coating Tank Type: Steel/Carbon Steel Tank Internal Protection: Other Tank External Protection: Other Date Last Tested / Next Test: NEXT TEST DATE 6/1/1999 Date Tank Closed / Category: CATEGORY Leak Detection: **Double Bottom Overfill Protection:** Float Vent Valve **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Sam Naber (914) 968-8484 Phone: In-service Capacity: 12000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: Not reported CBS Number: Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: 3-103845 Last Inspected: Not reported **Emergency Name:** Bassam Naber **Emergency Phone:** (914) 376-0100 Owner Name: Suleiman Naber Owner Address: 2 Victoria Lane Owner Phone: (914) 968-8484

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

SAM'S SERVICE STATION (Continued)

Owner Type:

Owner City,St,Zip:

Not reported Yonkers, NY 10701 Sam's Service Station 178 Warburton Avenue Not reported Yonkers, NY 10701 Suleiman Naber (914) 968-8484 3000 Not reported 6/1/1999 Not reported Not reported Not reported 3-497606 4 Temporarily Out of Service 3000 INSTALL DATE Aboveground on saddles, legs, stilts, rack or cradle Steel/Iron Other Unleaded Gasoline Underground Epoxy Liner Painted/Asphalt Coating Steel/Carbon Steel Other Other **Double Bottom** Float Vent Valve Suction Not reported 5518 Sam Naber (914) 968-8484 12000

U003988561

Mail Company: Mail Address: Mail Address: Mail City, St, Zip: Attention: Mail Phone: Capacity: Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed: PBS Number: Tank Number: Tank Status: Capacity: Pipe Location: Pipe Type: 2nd Containment: Product: Tank Location: Pipe Internal Protection: Pipe External Protection: Tank Type: Tank Internal Protection: Tank External Protection: Date Last Tested / Next Test: NEXT TEST DATE 6/1/1999 Date Tank Closed / Category: CATEGORY Leak Detection: **Overfill Protection: Dispenser Method:** Facility Addr2: Swiscode: Operator: Phone: In-service Capacity: Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Not reported Spdes Number: Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: 3-103845 Last Inspected: Not reported Emergency Name: Bassam Naber **Emergency Phone:** (914) 376-0100 **Owner Name:** Suleiman Naber **Owner Address:** 2 Victoria Lane Owner Phone: (914) 968-8484 Owner Type: Not reported Owner City,St,Zip: Yonkers, NY 10701 Mail Company: Sam's Service Station

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U003988561

SAM'S SERVICE STATION (Continued)

Mail Address:1Mail Address:NMail City,St,Zip:NAttention:SMail Phone:(Capacity:SDate Last Tested:NNext Test Date:GCategory:NInstall Date:NDate Tank Was Closed:N

178 Warburton Avenue Not reported Yonkers, NY 10701 Suleiman Naber (914) 968-8484 3000 Not reported 6/1/1999 Not reported Not reported Not reported Not reported

H79FORMER SCOTT STATIONENE178 WARBURTON AVENUE1/8-1/4YONKERS, NY

Remediation Phase:

Spille Namer:

Spiller Phone:

Spiller Company:

Spiller Extention:

Spiller Address:

Spiller County:

Spiller Contact:

Spiller Phone:

DEC Region:

Spiller Extention:

Program Number:

DER Facility ID:

Spiller City,St,Zip:

Date Entered In Computer: 10/24/05 Spill Record Last Update: 10/26/05

1

ΖZ

001

3

Not reported

Not reported

Not reported

Not reported

Not reported

(516) 369-2891

Not reported

0508784

301774

FELIX SWIERZWSKI

904 ft.

Relative: Higher

Actual: 52 ft.

YONKERS, NY	
Site 10 of 11 in cluster H	
LTANKS:	
Site ID:	354436
Spill Date:	10/22/05
Facility Addr2:	Not reported
Facility ID:	0508784
Program Number:	0508784
SWIS:	6018
Region of Spill:	3
Investigator:	WCHD
Referred To:	WCDOH
Reported to Dept:	10/22/05
CID:	17
Spill Cause:	Tank Test Failure
Water Affected:	Not reported
Spill Source:	Gasoline Station
Spill Notifier:	Tank Tester
Cleanup Ceased:	//
Cleanup Meets Standard:	False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	//

NY LTANKS S107417047 N/A

TC1784877.2s Page 165

Database(s)

EDR ID Number EPA ID Number

FORMER SCOTT STATION (Continued)

Site ID:	Not reported	
Operable Unit ID:	Not reported	
Operable Unit:	Not reported	
Material ID:	Not reported	
Material Code:	Not reported	
Material Name:	Not reported	
Case No.:	Not reported	
Material FA:	Not reported	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Site ID:	354436	
Spill Tank Test:	1103053	
Tank Number:	ALL 4	
Tank Size:	3000	
Test Method:	21	
Leak Rate:	0.00	
Gross Fail:	Not reported	
Modified By:	JBODee	
Last Modified:	10/26/05	
Test Method:	Horner EZY3/EZY3 Locator Plus	
DEC Remarks:	Start CallerRemark - 0508784 PBS No: 3-497606. All 4 3,000-gallon tanks failed END CallerRemark - 0508784	l.
Remark:	Not reported	

H80	YONKERS PARCELS B AND C
ENIE	4 ALEVANDED STREET

H80 ENE 1/8-1/4 915 ft.	YONKERS PARCELS 1 ALEXANDER STRE YONKERS, NY 1070	ET	NY VCP	S106704120 N/A
	Site 11 of 11 in clust	er H		
Relative: Higher	VCP: Program Type:	BCP		
Actual: 52 ft.	Site Code: Assessment:	57460 On-site soil is contaminated with metals and semi-volatile organic compour However, the site is fenced precluding access, therefore, direct contact with contaminated soil is not an exposure pathway. No other potential exposure	h	
	Env Problems:	pathways exist atthis site. In 1998 and 1999, a Site Investigation was conducted on Southern Parcel (AKRF, Inc. and a Record of Decision (ROD) was issued by the NYSDEC in 1999. The investigation showed SVOCs and select metals present on-site a levels above the NYSDEC Recommended Soil Cleanup Objectives, howev comparable to levels in background samples collected near the site. One volatile organic compound (VOC) and one SVOC were detected slightly ab NYSDEC groundwater standards in samples collected from onsite monitori In September 2002, a Phase II Site Investigation Report on Parcel B and northern Parcel C, prepared by Henningson, Durham & amp; Richardson AI & amp; Engineering, P.C. (HDR), showed select metals present on-site at le above the NYSDEC Recommended Soil Cleanup Objective and volatile or compounds (VOCs), SVOCs and metals detected above NYSDEC groundwin in samples collected from on-site monitoring wells.	n October at er, most we ng wells. rchitecture evels ganic water standa	
	Site Desc:	Yonkers Parcels B and C (C360071). See also #C360072, #V00680, and a This Brownfield Cleanup Program (BCP) Application consists of a property accepted into the Voluntary Cleanup Program (VCP) under Site # V00680, the applicant then decided to apply for the BCP. In addition, a portion of this property (Southern Parcel C and D) was in the Environmental Restorat	however,	

Database(s)

EDR ID Number **EPA ID Number**

S106704120

YONKERS PARCELS B AND C (Continued)

(ERP or Brownfields) Program, under Site # B00046, with an investigation completed and Record of Decision (ROD) having been issued in October 1999. Parcel B and Northern Parcel C were the subject of an incomplete Site Investigation under the ERP (Brownfields) Program. Additional site information can be found under the above site numbers. The site is located in downtown Yonkers in Westchester County, along the eastern bank of the Hudson River waterfront in a commercial/ residential area. Metro North Commuter Railroad defines the eastern boundary of the property and the Yonkers Pump Station lies to the north. The site is currently being used for commuter parking. The parcels have a history of industrial use dating back more than 100 years including a lumber yard, coal storage, automotive storage, building supplies, elevator manufacturer, asphalt mixing plant and a sand and stone company. The property is currently used for parking. In 1998 and 1999, a Site Investigation was conducted on Northern Parcel C by AKRF, Inc. and a Record of Decision (ROD) was issued by the NYSDEC in October 1999. In September 2002, a Phase II Site Investigation Report on Parcel B and Northern Parcel C was prepared by Henningson, Durham & amp; Richardson Architecture & amp; Engineering, P.C. (HDR). The subject BCP application was submitted as a single site with two Operable Units; OU-1 includes 2.54 acres described as Southern Parcel C and Parcel D, located at 73&75 Dock Street and OU-2 includes 2.12 acres described as Parcel B and Northern Parcel C located at 1&11 Dock Street. Parcel B is ownedby the City of Yonkers and Parcel C and D are owned by the Yonkers Community Development Agency. The BCA was signed on May 31, 2005. The consultant submitted revised RI and RAWPs on August 24, 2005 and these were approved on October 12, 2005. Fieldwork is expected to begin in February or March, 2006.

> S104782490 NY LTANKS NY HIST LTANKS N/A

181 East 24 ASHBURTON AVE 1/8-1/4 YONKERS, NY 933 ft. Site 1 of 2 in cluster I **Relative:** LTANKS: Higher Site ID: 145817 Actual: Spill Date: 10/02/00 59 ft. Facility Addr2: Not reported Facility ID: 0008096 Program Number: 0008096 SWIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 10/10/00 CID: 17 Spill Cause: Tank Failure Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Fire Department Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 10/12/00 **Remediation Phase:** 0

Map ID Direction Distance Distance (ft.) Elevation Site

(Continued)

Database(s)

EDR ID Number EPA ID Number

S104782490

(
Date Entered In Computer:	: 10/10/00
Spill Record Last Update:	03/27/01
Spille Namer:	N'EAST ENVIRONMENTAL INC
Spiller Company:	Not reported
Spiller Phone:	(914) 777-1930
Spiller Extention:	Not reported
Spiller Address:	24 ASHBURTON AVE
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	001
Spiller Contact:	N'EAST ENVIRONMENTAL INC
Spiller Phone:	(914) 777-1930
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	0008096
DER Facility ID:	124209
Site ID:	145817
Operable Unit ID:	828695
Operable Unit:	01
Material ID:	545619
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID: Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0008096 tank was abandoned - will be excavated tomorrow
DEO Romano.	END CallerRemark - 0008096
Remark:	Start DECRemark - 0008096 Prior to Sept. 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" 10/10/2000 T. GHIOSAY MAY BE AWARE OF SITE. NE
	ENVIRONMENTAL TO REMOVE TANK TOMORROW, 10/11. TRI-STATE ENV. ALREADY PUMPED &
	CLEANED TANK & FOUND HOLES. MAY BE PRE-EXISTING SPILL NUMBER. 10/11/2000
	ALSO SEE SPILL NUMBER 99-13674. UST REMOVED BY NORTHEAST ENVIRONMENTAL.
	NUMEROUS HOLES IN BOTTOM OF TANK. ONLY WATER PRESENT IN TANK PIT.
	CONTAMINATED SOIL TO BE EXCAVATED AND DISPOSED.10/12/2000 DUPLICATE REPORT.
	THIS SPILL NUMBER CLOSED OUT. SEE SPILL NUMBER 99-13674. END DECRemark -
	0008096
HIST LTANKS:	
Region of Spill:	3
Spill Number:	0008096
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported

Database(s)

EDR ID Number EPA ID Number

(Continued)

S104782490

0	ntinued)			S10478
	Caller Extension:	Not reported		
	Notifier Name:	Not reported		
	Notifier Agency:	Not reported		
	Notifier Phone:	Not reported		
	Notifier Extension:	Not reported		
	Spill Date:	10/02/2000		
	Spill Time:	12:00		
	Reported to Department Date:			
	Reported to Department Time:			
	SWIS:	55		
	Spiller Contact:	N'EAST ENVIRON	NMENTAL INC	
	Spiller Phone:	(914) 777-1930		
	Spiller Extention:	Not reported		
	Spiller Name:	Not reported		
	Spiller Address:	24 ASHBURTON	AVE	
	Spiller City,St,Zip:	YONKERS, NY		
	Facility Contact:	N'EAST ENVIRON	NMENTAL INC	
	Facility Phone:	(914) 777-1930		
	Facility Extention:	Not reported		
	Spill Cause:	Tank Failure		
	Resource Affectd:	Groundwater		
	Water Affected:	Not reported		
	Spill Source:	Other Commercial	I/Industrial	
	Spill Notifier:	Fire Department		
	PBS Number:	Not reported		
	Cleanup Ceased:	/ /		
	Cleanup Meets Standard:	True		
	Last Inspection:	/ /		
	Recommended Penalty:	Penalty Not Recor	mmended	
	Spiller Cleanup Date:	/ /		
	Enforcement Date:	/ /		
	Investigation Complete:	/ /		
	UST Involvement:	False		
	Spill Class:		th minimal potential for fire or hazard. DEC Response. Wi	lling
			v. Corrective action taken.	
	Spill Closed Dt:	10/12/00		
	Date Region Sent Summary to			
	Corrective Action Plan Submitt			
	Date Spill Entered In Compute		0/10/00	
	Time Spill Entered In Compute		ot reported	
	Spill Record Last Update:	03/27/01 		
	Is Updated:	True		
	PBS Number:	Not reported		
	Tank Number:	Not reported		
	Tank Size: Test Method:	Not reported		
		Not reported		
	Leak Rate Failed Tank:	Not reported		
	Gross Leak Rate: Material Class Type:	Not reported Petroleum		
	Quantity Spilled:	0		
	Unkonwn Quantity Spilled:	True		
	Units:	Gallons		
	Quantity Recovered:	0		
	Unkonwn Quantity Recovered:			
	Material:	#2 FUEL OIL		
	Class Type:	#2 FUEL OIL		
	Times Material Entry In File:	24464		

Map ID Direction			MAP FINDINGS		
Distance Distance (ft. Elevation) Site			Database(s)	EDR ID Number EPA ID Number
	(Continued)				S104782490
	CAS Number:		Not reported		
	Last Date:		19941207		
	DEC Remarks: Spill Cause:	TOMORRO BE PRE-EX REMOVED WATER PR 10/12/2000 99-13674.	T. GHIOSAY MAY BE AWARE OF SITE. NE ENVIRONM W, 10/11. TRI-STATE ENV. ALREADY PUMPED CLEANE ISTING SPILL NUMBER. 10/11/2000 ALSO SEE SPILL N BY NORTHEAST ENVIRONMENTAL. NUMEROUS HOLE ESENT IN TANK PIT. CONTAMINATED SOIL TO BE EXC DUPLICATE REPORT. THIS SPILL NUMBER CLOSED C andoned - will be excavated tomorrow	ED TANK FOUN UMBER 99-136 ES IN BOTTOM CAVATED AND	ND HOLES. MAY 574. UST I OF TANK. ONLY DISPOSED.
J82 South 1/8-1/4 953 ft.	CITY JAIL ALEXANDER STREET YONKERS, NY 10701			NY UST	U003855836 N/A
Deletive	Site 1 of 2 in cluster J	J			
Relative: Lower	UST:				
	PBS Number:		3-505307		
Actual: 8 ft.	Tank Number: Tank Status:		57 Tomperarily Out of Service		
011.	Capacity:		Temporarily Out of Service 2500 INSTALL DATE		
	Pipe Location:		Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:		Galvanized Steel		
	2nd Containment		None		
	Product: Tank Location:		Empty Underground		
	Pipe Internal Prot	tection:	None		
	Pipe External Pro	otection:	None		
	Tank Type:		Steel/Carbon Steel		
	Tank Internal Pro Tank External Pro		None None		
			6/1/1996 NEXT TEST DATE 6/1/1997		
	Date Tank Closed				
	Leak Detection:		None		
	Overfill Protectior Dispenser Metho		Vent Whistle Suction		
	Facility Addr2:	ч.	Not reported		
	Swiscode:		5518		
	Operator:		City of Yonkers		
	Phone: In-service Capaci	itv-	(914)377-6912 2500		
	Site Status:	ity.	Active PBS; >1100 gal. PBS, regardless if subpart 360-14	tanks exists or	not
	Certification Date	:	5/2/2005		
	Expire Date:		9/27/2009		
	CBS Number: Spdes Number:		Not reported Not reported		
	Lat/Long:		Not reported		
	Site Type:		Not reported		
	Number Of Active		1 Not reported		
	Old Pbs Number: Last Inspected:		Not reported 04/23/2004		
	Emergency Name	e:	Mayor's Help Line		
	Emergency Phon		(914) 377-4357		
	Owner Name:		City of Yonkers, Dept. of General Services		
	Owner Address: Owner Phone:		City Hall, Fifth Floor (914) 377-6912		
	Owner Type:		LOCAL GOVERNMENT		

Map ID MAP FINDINGS		
Direction		
Distance Distance (ft.) Elevation Site	Database(s)	EDR ID Number EPA ID Number
CITY JAIL (Continued)		U003855836
Owner City,St,Zip:Yonkers, NY 10701Mail Company:City of Yonkers, Dept. of General ServicesMail Address:40 South BroadwayMail Address:City Hall, Fifth FloorMail City,St,Zip:Yonkers, NY 10701Attention:Director of General ServicesMail Phone:(914) 377-6912Capacity:2500Date Last Tested:6/1/1996		
Next Test Date:6/1/1997Category:AInstall Date:Not reportedDate Tank Was Closed:Not reported		
83 ELLADOR REALTY NE 156-58 WOODWORTH AVENUE 1/8-1/4 YONKERS, NY 10701 1008 ft.	NY AST	A100204257 N/A
Relative: AST: Higher PBS Number: 3-800757		
Tank Number: 001 Actual: Tank Status: In Service 27 ft. Capacity: 3000 INSTALL DATE		
Pipe Location: Aboveground Pipe Type: Steel/Iron 2nd Containment: Vault Product: Nos. 1, 2 or 4 Fuel Oil		
Tank Location:Aboveground on saddles, legs, stilts, rack or cradlePipe Internal Protection:NonePipe External Protection:Painted/Asphalt Coating		
Tank Type:Steel/Carbon SteelTank Internal Protection:OtherTank External Protection:Jacketed		
Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: Concrete Pad w/ Channels		
Overfill Protection: Vent Whistle, Product Level Gauge Dispenser Method: Gravity Facility Addr2: Not reported		
Swiscode:Not reportedOperator:Juan CabreraPhone:(914) 376-6273		
In-service Capacity: 3000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 Certification Date: Not reported	tanks exists or	not
Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported		
Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 1		
Old Pbs Number: Not reported Last Inspected: Not reported Emergency Name: Mike Bajraktari		
Emergency Phone:(917) 418-7456Owner Name:Ellador Realty Corp.Owner Address:617 E. 188th Street		

Map ID Direction Distance Distance (ft.) Elevation Site MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

A100204257

ELLADOR REALTY (Continued)

Owner Phone: Owner Type: Owner City,St,Zip: Mail Company: Mail Address: Mail Address: Mail City, St, Zip: Attention: Mail Phone: Capacity: 3000 Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed: Not reported

K84 **DEPAUL BROTHERS** SE **108 WARBURTON AVE.** YONKERS, NY

1/8-1/4 1026 ft.

Site 1 of 4 in cluster K

Relative: LTANKS: Higher Site ID: Actual: 49 ft.

(718) 365-4310 CORPORATE/COMMERCIAL Bronx, NY 10458-Ellador Realty Corp. 617 E. 188th Street Not reported Bronx, NY 10458-Mike Bajraktari (718) 365-4310 Not reported Not reported Not reported Not reported

> NY LTANKS S100493683 NY HIST LTANKS N/A

226686 Spill Date: 02/21/03 Facility Addr2: Not reported Facility ID: 0211566 Program Number: 0211566 SWIS: 6018 Region of Spill: 3 Investigator: WCHD WESTCHESTER CNTY HEALTH D Referred To: Reported to Dept: 02/21/03 CID: 17 Spill Cause: Tank Failure Water Affected: Not reported Commercial/Industrial Spill Source: Spill Notifier: Other Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: **Recommended Penalty:** Penalty Not Recommended **UST Involvement:** True Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 12/02/04 **Remediation Phase:** Λ Date Entered In Computer: 02/21/03 Spill Record Last Update: 12/15/04 Spille Namer: JERRY DEPAUL Spiller Company: APT BLDG Spiller Phone: (000) 000-0000 Spiller Extention: Not reported Spiller Address: WARBURTON AVE Spiller City, St, Zip: YONKERS, ZZ Spiller County: 001 JERRY DEPAUL Spiller Contact: Spiller Phone: (000) 000-0000

Database(s)

EDR ID Number EPA ID Number

P	PAUL BROTHERS (Continued) S100493683				
	Spiller Extention:	Not reported			
	DEC Region:	3			
	Program Number:	0211566			
	DER Facility ID:	187108			
	Site ID:	226686			
	Operable Unit ID:	862675			
	Operable Unit:	01			
	Material ID:	565748			
	Material Code:	0009			
	Material Name:	Gasoline			
	Case No.:	Not reported			
	Material FA:	Petroleum			
	Quantity:	0.00			
	Units:	Gallons			
	Recovered:	0.00			
	Resource Affected:	Soil			
	Oxygenate:	False			
	Site ID:	Not reported			
	Spill Tank Test:	Not reported			
	Tank Number:	Not reported			
	Tank Size:	Not reported			
	Test Method: Leak Rate:	Not reported			
	Gross Fail:	Not reported			
	Modified By:	Not reported Not reported			
	Last Modified:	Not reported			
	Test Method:	Not reported			
	DEC Remarks:	Start CallerRemark - 0211566 VACANT PROPERTY WAS A GAS STATION - IT HAS BEEN			
		CLOSED SINCE 1999. END CallerRemark - 0211566			
	Remark:	Start DECRemark - 0211566 Prior to Sept, 2004 data translation this spill Lead			
		DEC Field was "WCHD - GRAZIOLI" 10/6/03: Letter to Gerald DePaul from Stefan			
		Goreau, WCDOH dated 10/01/2003. Site closure report has been reviewed. Further			
		excavation ofcontaminated soil is required and sampling will be required after			
		excavation. Results and report to be submitted by 12/15/2003. 12/15/04:			
		Letter to Gerald DePaul, Estate of Mary DePaul dated 1Dec2004. Spill closed by			
		Stefan Goreau, WCDOH. END DECRemark - 0211566			
	Site ID:	261235			
	Spill Date:	06/24/92			
	Facility Addr2:	Not reported			
	Facility ID:	9203538			
	Program Number:	9203538			
	SWIS:	6018			
	Region of Spill:	3			
	Investigator:	WXWADSWO			
	Referred To:	Not reported			
	Reported to Dept:	06/24/92			
	CID:	17 Taal Taal Failure			
	Spill Cause:	Tank Test Failure			
	Water Affected:	Not reported			
	Spill Source: Spill Notifier:	Gasoline Station Tank Tester			
	Cleanup Ceased:	12/02/93			
	Cleanup Meets Standard:	True			
	Last Inspection:				
	Recommended Penalty:	Penalty Not Recommended			
	UST Involvement:	True			

DEP

EDR ID Number Database(s) EPA ID Number

DEPAUL BROTHERS (Continued)

S100493683

		S 100435005
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
	Spill Closed Dt:	12/02/93
	Remediation Phase:	0
	Date Entered In Computer:	06/26/92
	Spill Record Last Update:	01/28/98
	Spille Namer:	Not reported
	Spiller Company:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	Spiller Address:	Not reported
	Spiller City,St,Zip:	***Update***, ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	9203538
	DER Facility ID:	213338
	Site ID:	261235
	Operable Unit ID:	970921
	Operable Unit:	01
	Material ID:	411329
	Material Code:	0009
	Material Name:	Gasoline
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Pounds
	Recovered:	0.00
	Resource Affected:	Groundwater
	Oxygenate:	False
	Site ID:	261235
	Spill Tank Test:	14722
	Tank Number:	Not reported
	Tank Size:	0
	Test Method:	00
	Leak Rate:	0.00
	Gross Fail:	Not reported
	Modified By:	
	Last Modified:	Spills 10/01/04
	Test Method: DEC Remarks:	Unknown Start CallerRemark - 9203538 TWO TANKS SEPARATE TESTS WILL EIR NOT SURE WHEN 4K
	DEC Remarks.	
	Remark:	SUPER TEST WAS ABORTED AFTER 15 MIN. END CallerRemark - 9203538
	Remark.	Start DECRemark - 9203538 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WADSWORTH" END DECRemark - 9203538
Н	IST LTANKS:	
	Region of Spill:	3
	Spill Number:	9203538
	Investigator:	WADSWORTH
	Caller Name:	Not reported
	Caller Agency:	Not reported
	Caller Phone:	Not reported
	Caller Extension:	Not reported
	Notifier Name:	Not reported
	Notifier Agency:	Not reported

Database(s)

EDR ID Number EPA ID Number

S100493683

DEPAUL BROTHERS (Continued)

Notifier Phone: Not reported Not reported Notifier Extension: Spill Date: 06/24/1992 Spill Time: 14:15 Reported to Department Date: 06/24/92 Reported to Department Time: 14:58 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Not reported Spiller Name: Not reported Spiller Address: Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** Groundwater Water Affected: Not reported Spill Source: Gas Station Spill Notifier: Tank Tester PBS Number: 3-168637 Cleanup Ceased: 12/02/93 Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 12/02/93 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 06/26/92 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 01/28/98 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Pounds Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE GASOLINE Class Type: Times Material Entry In File: 21329 Not reported CAS Number: 19940929 Last Date: DEC Remarks: Not reported

EDR ID Number Database(s) EPA ID Number

DEPAUL BROTHERS (Continued)

S100493683

Spill Cause: TWO TANKS SEPARATE TESTS WILL EIR NOT SURE WHEN 4K SUPER TEST WAS ABORTED AFTER 15 MIN.

K85 SE 1/8-1/4	ESTATE OF MARY DEPAUL 108 WARBURTON AVENUE YONKERS, NY 10701		NY UST	U003885546 N/A
1026 ft.	Site 2 of 4 in cluster K			
Relative:	Site 2 of 4 in cluster K			
Higher	UST:			
•	PBS Number:	3-168637		
Actual:	Tank Number:	1		
49 ft.	Tank Status:	Closed-Removed		
	Capacity:	4000 INSTALL DATE 12/01/1981		
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:	Galvanized Steel		
	2nd Containment: Product:	None		
	Tank Location:	Empty Underground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	Painted/Asphalt Coating		
	Date Last Tested / Next Test:	NEXT TEST DATE 12/1/1991		
	Date Tank Closed / Category:	2/21/2003 CATEGORY A		
	Leak Detection:	None		
	Overfill Protection:	Catch Basin		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	Not reported		
	Phone:	Not reported		
	In-service Capacity:	0 Use substady 1404 and DDC 8 as Subsert 200.44		
	Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14		
	Certification Date: Expire Date:	Not reported Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	0		
	Old Pbs Number:	Not reported		
	Last Inspected:	08/19/2002		
	Emergency Name:	Gerald DePaul		
	Emergency Phone:	(914) 963-3086		
	Owner Name:	Estate of Mary DePaul		
	Owner Address:	108 Warburton Avenue		
	Owner Phone:	Not reported		
	Owner Type:	Not reported		
	Owner City,St,Zip:	Yonkers, NY 10701		
	Mail Company: Mail Address:	Estate of Mary DePaul		
	Mail Address: Mail Address:	482 McLean Avenue Not reported		
	Mail City,St,Zip:	Yonkers, NY 10705		
	Attention:	Gerald DePaul		
	Mail Phone:	(914) 963-3086		
	Capacity:	4000		

Database(s)

EDR ID Number EPA ID Number

U003885546

ESTATE OF MARY DEPAUL (Continued)

Not reported Date Last Tested: Next Test Date: 12/1/1991 Not reported Category: Install Date: 12/01/1981 Date Tank Was Closed: Not reported PBS Number: 3-168637 Tank Number: 2 Tank Status: Closed-Removed 4000 INSTALL DATE 12/01/1981 Capacity: Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Galvanized Steel 2nd Containment: None Product: Empty Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Painted/Asphalt Coating Tank External Protection: Date Last Tested / Next Test: NEXT TEST DATE 12/1/1991 2/21/2003 CATEGORY A Date Tank Closed / Category: Leak Detection: None **Overfill Protection:** Catch Basin **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Not reported Phone: Not reported In-service Capacity: 0 Unregulated; <1101 gal. PBS & no Subpart 360-14 Site Status: Certification Date: Not reported Expire Date: Not reported **CBS Number:** Not reported Not reported Spdes Number: Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: 08/19/2002 **Emergency Name:** Gerald DePaul Emergency Phone: (914) 963-3086 **Owner Name:** Estate of Mary DePaul **Owner Address:** 108 Warburton Avenue Owner Phone: Not reported Owner Type: Not reported Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10705 Attention: Gerald DePaul (914) 963-3086 Mail Phone: 4000 Capacity: Date Last Tested: Not reported Next Test Date: 12/1/1991 Category: Not reported

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

Install Date: 12/01/1981 Date Tank Was Closed: Not reported PBS Number: 3-168637 Tank Number: 3 Tank Status: Closed-Removed Capacity: 2000 INSTALL DATE 12/01/1981 Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Galvanized Steel Pipe Type: 2nd Containment: None Empty Product: Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating NEXT TEST DATE 12/1/1991 Date Last Tested / Next Test: Date Tank Closed / Category: 2/21/2003 CATEGORY A Leak Detection: None **Overfill Protection:** Catch Basin **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Not reported Phone: Not reported In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported 08/19/2002 Last Inspected: **Emergency Name:** Gerald DePaul **Emergency Phone:** (914) 963-3086 **Owner Name:** Estate of Mary DePaul Owner Address: 108 Warburton Avenue Owner Phone: Not reported Owner Type: Not reported Owner City,St,Zip: Yonkers, NY 10701 Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10705 Attention: Gerald DePaul Mail Phone: (914) 963-3086 Capacity: 2000 Date Last Tested: Not reported Next Test Date: 12/1/1991 Category: Not reported 12/01/1981 Install Date: Date Tank Was Closed: Not reported

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

PBS Number: 3-168637 Tank Number: 4 Tank Status: Closed-Removed 550 INSTALL DATE 12/01/1976 Capacity: Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Galvanized Steel 2nd Containment: None Product: Empty Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating Date Last Tested / Next Test: NEXT TEST DATE 2/21/2003 CATEGORY A Date Tank Closed / Category: Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Not reported Facility Addr2: Not reported Swiscode: 5518 Operator: Not reported Not reported Phone: In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Not reported Certification Date: Expire Date: Not reported **CBS Number:** Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: 08/19/2002 **Emergency Name:** Gerald DePaul Emergency Phone: (914) 963-3086 Estate of Mary DePaul **Owner Name: Owner Address:** 108 Warburton Avenue **Owner Phone:** Not reported Owner Type: Not reported Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Yonkers, NY 10705 Mail City, St, Zip: Gerald DePaul Attention: Mail Phone: (914) 963-3086 Capacity: 550 Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Install Date: 12/01/1976 Date Tank Was Closed: Not reported PBS Number: 3-168637 Tank Number: 5 Tank Status: Administratively closed

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

ATE OF MART DEPAUL (CON	itinuea)
Capacity:	3000 INSTALL DATE 12/01/1976
Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Type:	Steel/Iron
2nd Containment:	None
Product:	Unleaded Gasoline
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	None
Date Last Tested / Next Test:	11/1/1987 NEXT TEST DATE
Date Tank Closed / Category:	
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	Not reported
Phone:	Not reported
In-service Capacity:	0
Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	0
Old Pbs Number:	Not reported
Last Inspected:	08/19/2002
Emergency Name:	Gerald DePaul
Emergency Phone:	(914) 963-3086
Owner Name:	Estate of Mary DePaul
Owner Address:	108 Warburton Avenue
Owner Phone:	Not reported
Owner Type:	Not reported
Owner City,St,Zip:	Yonkers, NY 10701
Mail Company:	Estate of Mary DePaul
Mail Address:	482 McLean Avenue
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10705
Attention:	Gerald DePaul
Mail Phone:	(914) 963-3086
Capacity:	3000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	A
Install Date:	12/01/1976
Date Tank Was Closed:	8/1/2002
PBS Number:	3-168637
Tank Number:	6
Tank Status:	Administratively closed
Capacity:	3000 INSTALL DATE 12/01/1976
Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Type:	Steel/Iron

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

2nd Containment: None **Unleaded Gasoline** Product: Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 11/1/1987 NEXT TEST DATE Date Tank Closed / Category: 8/1/2002 CATEGORY A Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Not reported Phone: Not reported In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Not reported Spdes Number: Lat/Long: Not reported Not reported Site Type: Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: 08/19/2002 **Emergency Name:** Gerald DePaul (914) 963-3086 Emergency Phone: Owner Name: Estate of Mary DePaul Owner Address: 108 Warburton Avenue **Owner Phone:** Not reported Owner Type: Not reported Yonkers, NY 10701 Owner City,St,Zip: Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Yonkers, NY 10705 Mail City, St, Zip: Attention: Gerald DePaul Mail Phone: (914) 963-3086 3000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: А 12/01/1976 Install Date: Date Tank Was Closed: 8/1/2002 PBS Number: 3-168637 Tank Number: 7 Tank Status: Closed-Removed Capacity: 2000 INSTALL DATE 12/01/1976 Pipe Location: Not reported Pipe Type: None 2nd Containment: None Product: Empty Tank Location: Underground

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

Pipe Internal Protection: None Pipe External Protection: None Steel/Carbon Steel Tank Type: Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 11/1/1987 NEXT TEST DATE 11/1/1988 Date Tank Closed / Category: 2/21/2003 CATEGORY A Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Not reported Facility Addr2: Not reported Swiscode: 5518 Operator: Not reported Phone: Not reported In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: 08/19/2002 **Emergency Name:** Gerald DePaul **Emergency Phone:** (914) 963-3086 **Owner Name:** Estate of Mary DePaul **Owner Address:** 108 Warburton Avenue Owner Phone: Not reported Owner Type: Not reported Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10705 Gerald DePaul Attention: Mail Phone: (914) 963-3086 Capacity: 2000 Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: Install Date: 12/01/1976 Date Tank Was Closed: Not reported PBS Number: 3-168637 Tank Number: 8 Tank Status: Closed-Removed Capacity: 2000 INSTALL DATE 12/01/1976 Pipe Location: Not reported Pipe Type: None 2nd Containment: None Product: Empty Tank Location: Underground None Pipe Internal Protection: Pipe External Protection: None Tank Type: Steel/Carbon Steel

TC1784877.2s Page 182

Database(s)

EDR ID Number EPA ID Number

ESTATE OF MARY DEPAUL (Continued)

Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 11/1/1987 NEXT TEST DATE 11/1/1988 Date Tank Closed / Category: 2/21/2003 CATEGORY A Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Not reported Not reported Facility Addr2: Swiscode: 5518 Operator: Not reported Phone: Not reported In-service Capacity: 0 Unregulated; <1101 gal. PBS & no Subpart 360-14 Site Status: Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: 08/19/2002 Gerald DePaul **Emergency Name: Emergency Phone:** (914) 963-3086 **Owner Name:** Estate of Mary DePaul Owner Address: 108 Warburton Avenue Owner Phone: Not reported Owner Type: Not reported Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Estate of Mary DePaul Mail Address: 482 McLean Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10705 Attention: Gerald DePaul (914) 963-3086 Mail Phone: Capacity: 2000 Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported Install Date: 12/01/1976 Date Tank Was Closed: Not reported

K86 GAS STATION

SE	104 WARBURTON AVE	
1/8-1/4	YONKERS, NY	
1063 ft.		
	Site 3 of 4 in cluster K	
Relative: Higher	LTANKS:	
5	Site ID:	257932
Actual:	Spill Date:	08/24/99
48 ft.	Facility Addr2:	Not reported
	Facility ID:	0001220
	Program Number:	0001220
	SWIS:	6018
	Region of Spill:	3

Investigator: Referred To: WCHD

Westchester Cnty Health Dept

NY LTANKS S104621497 NY HIST LTANKS N/A

Map ID Direction Distance Distance (ft.) Elevation Site

GAS STATION (Continued)

Reported to Dept:

05/01/00

Database(s)

EDR ID Number **EPA ID Number**

S104621497

CID: 17 Tank Failure Spill Cause: Water Affected: Not reported Spill Source: **Gasoline Station** Spill Notifier: Other Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required. Spill Closed Dt: 04/16/04 **Remediation Phase:** Date Entered In Computer: 05/01/00 Spill Record Last Update: 07/23/04 Spille Namer: UNK Spiller Company: UNK (000) 000-0000 Spiller Phone: Spiller Extention: Not reported Spiller Address: UNK Spiller City, St, Zip: UNK, ZZ Spiller County: 001 Spiller Contact: CALLER Spiller Phone: Not reported Spiller Extention: Not reported **DEC Region:** 3 Program Number: 0001220 DER Facility ID: 211188 Site ID: 257932 **Operable Unit ID:** 823013 **Operable Unit:** 01 Material ID: 289443 Material Code: 0009 Material Name: Gasoline Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 **Resource Affected:** Soil Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported Start CallerRemark - 0001220 caller reporting a spill of material from old gas DEC Remarks: tanks clean up was done however no report number was issued caller was

reporting this for her husband with limited info. she was advised to contact dec regional office END CallerRemark - 0001220

EDR ID Number Database(s) EPA ID Number

GAS STATION (Continued) S104621497 Remark: Start DECRemark - 0001220 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-LALAK" 05/02/00 CHRIS LALAK OF WCHD TO INSPECT. ALSO SEE SPILL 99-06218. 04/16/04 DUPLICATE REPORT. THIS SPILL FILE CLOSED BY CHRIS LALAK OF WESTCHESTER COUNTY HEALTH DEPARTMENT. jbo END DECRemark - 0001220 HIST LTANKS: Region of Spill: 3 Spill Number: 0001220 Investigator: Not reported Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 08/24/1999 Spill Time: 11:33 Reported to Department Date: 05/01/00 Reported to Department Time: 11:10 SWIS: 55 Spiller Contact: CALLER Spiller Phone: () -Spiller Extention: Not reported Spiller Name: UNK Spiller Address: UNK Spiller City, St, Zip: UNK Facility Contact: UNK (000) 000-0000 Facility Phone: Facility Extention: Not reported Spill Cause: Tank Failure Resource Affectd: On Land Water Affected: Not reported Spill Source: Gas Station Spill Notifier: Other PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 11 Investigation Complete: UST Involvement: True Spill Class: Not reported Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 05/01/00 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 05/01/00 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported

Man ID	Γ	MAP FINDINGS		
Map ID Direction	ų	MAP FINDINGS		
Distance				
Distance (ft)		EDR ID N	lumber
Elevation	Site	Di	atabase(s) EPA ID N	
	GAS STATION (Continued)		S1046214	107
			01040214	-57
	Leak Rate Failed Tank:	Not reported		
	Gross Leak Rate:	Not reported		
	Material Class Type: Quantity Spilled:	Petroleum 0		
	Unkonwn Quantity Spilled			
	Units:	Gallons		
	Quantity Recovered:	0		
	Unkonwn Quantity Recove	-		
	Material:	GASOLINE		
	Class Type:	GASOLINE		
	Times Material Entry In Fi	le: 21329		
	CAS Number:	Not reported		
	Last Date:	19940929		
	DEC Remarks: Not rep			
		eporting a spill of material from old gas tanks clean up was done		
		r no report number was issued caller was reporting this for her hu ited info. she was advised to contact dec regional office	Isband	
	with infi	ited into. She was advised to contact dec regional onice		
			_	
K87	ABANDONED GAS STATION		NY Spills S1041943	227
ro <i>i</i>	ADAINDONED GAS STATION		NT 50115 51041943	21
SE	104 WARBARTON	NY	Hist Spills N/A	521
SE 1/8-1/4		NY	•	521
SE	104 WARBARTON YONKERS, NY	NY	•	521
SE 1/8-1/4 1115 ft.	104 WARBARTON	NY	•	521
SE 1/8-1/4	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills:		•	521
SE 1/8-1/4 1115 ft. Relative: Higher	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID:	67067	•	521
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2:	67067 Not reported	•	521
SE 1/8-1/4 1115 ft. Relative: Higher	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID:	67067 Not reported 9906218	•	521
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number:	67067 Not reported 9906218 9906218	•	521
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type:	67067 Not reported 9906218 9906218 ER	•	521
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS:	67067 Not reported 9906218 9906218 ER 6018	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill:	67067 Not reported 9906218 9906218 ER 6018 3	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / /	•	<i>521</i>
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / / True	•	
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / / True / /	•	<i>921</i>
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / / True / / Penalty Not Recommended	•	<i>921</i>
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / / True / / Penalty Not Recommended True	Hist Spills N/A	<i>921</i>
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other // True // Penalty Not Recommended True Known release that creates potential for fire or hazard. DEC Res	Hist Spills N/A	<i>921</i>
SE 1/8-1/4 1115 ft. Relative: Higher Actual:	104 WARBARTON YONKERS, NY Site 4 of 4 in cluster K NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	67067 Not reported 9906218 9906218 ER 6018 3 WCHD Westchester Cnty Health Dept 08/24/99 08/25/99 17 Equipment Failure Not reported Gasoline Station Other / / True / / Penalty Not Recommended True	Hist Spills N/A	

Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	07/12/04
Remediation Phase:	0
Date Entered In Computer:	08/25/99
Spill Record Last Update:	03/17/06
Spiller Name:	Not reported
Spiller Company:	ABANDONED GAS STATION
Spiller Address:	104 WARBARTON
Spiller City,St,Zip:	YONKERS, NY
Spiller Company:	001
Spiller Phone:	Not reported

Database(s)

EDR ID Number EPA ID Number

ABANDONED GAS STATION (Continued)

BANDONED GAS ST	ATION (Co	ntinued)			S10419432
Contact Name:	K	OREWICK			
Contact Phone:	(9	14) 969-7306			
DEC Region:	3	,			
Program Number:	99	906218			
DER Facility ID:		1141			
Site ID:	67	7067			
Operable Unit ID:	10	080657			
Operable Unit:	01	l			
Material ID:	30)2488			
Material Code:	00	009			
Material Name:	G	asoline			
Case No.:	No	ot reported			
Material FA:	Pe	etroleum			
Quantity:	0.	00			
Units:	G	allons			
Recovered:		00			
Resource Affecte	d: So	oil			
Oxygenate:		alse			
DEC Remarks:			Iller on site doing tank rem		
	contaminati	on caller believes th	ere was a problem with ma	anifold END	
		ark - 9906218			
Remark:			or to Sept, 2004 data trans		
				ORTED THAT WCHD WAS	
			EX. SAMPLES & SEND F		5/03 ALSO
			4: Further remarks for this		
			er only. 00-01220 has bee		
			wick, Warburton Realty Ma	e .	-1
	•		004. 7/16/04: Letter to V	is received a request for and	L
	0			issessment report by Elite	
				stime. END DECRemark - 9	906218
	2				0002.0
NY Hist Spills:		0			
Region of Spill:		3			
Spill Number:		9906218 WCHD			
Investigator: Caller Name:		Not reported			
Caller Agency:		Not reported			
Caller Phone:		Not reported			
Notifier Name:		Not reported			
Notifier Agency:		Not reported			
Notifier Phone:		Not reported			
Spill Date/Time:		08/24/1999 15:00			
Reported to Dept	Date/Time:	08/25/99 09:11			
SWIS:		55			
Spiller Name:		ABANDONED GAS	STATION		
Spiller Contact:		Not reported			
Spiller Phone:		() -			
Spiller Contact:		KOREWICK			
Spiller Phone:		(914) 969-7306			
Spiller Address:		104 WARBARTON			
Spiller City,St,Zip		YONKERS, NY			
Spill Cause:		Equipment Failure			
Reported to Dept:		On Land			
Water Affected:		Not reported			
Spill Source:		05			
Spill Notifier:		Other			

ABANONED GAS STATION (Coinced) Statistical PBS Number: Not reported Cieanup Geased: // Cieanup Geased: // Cieanup Geased: // Cieanup Meters: False Last Inspection: // Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: // Invistion Computer: // UST Involvement: True Data Spiller Cleanup Chi: // Corrective Action Plan Stution Meters // Corrective Action Plan Stution // Data Region Sent Summary to Central Office: // Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03/25/99 Data Spill Entered In Computer Data File: 03	Distance Distance (ft. Elevation) Site					Database(s)	EDR ID Numb
Cleanup Ceased: // Cleanup Meets Std: False Last Inspection: // Recommended Penalty: Penalty Not Recommended Spiller Cleanup Ot: // Enforcement Date: // Invstgn Complete: // Invstgn Complete: // Invstgn Complete: // Invstgn Complete: // Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Class Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: // Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 0 Unkonum Quantity Spilled: 0 Unkonum Quantity Spilled: 0 Unkonum Quantity Spilled: 0 Unkonum Quantity Spilled: 0 Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940923 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORT TO WCHD. Remark: caller on site dot gat Rate rowal and found soil contamination caller believes		ABANDONED GAS S	TATION (Co	ontinued)				S104194327
Cleanup Meets Std: False Last Inspection: // Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: // Enforcement Date: // Invstgn Complete: // UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Class Class: // Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: // Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Number: Not reported Task Rate Failed Tank: Not reported Leak Rate Failed Tank: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonvn Quantity Spilled: True Units: Gallons Quantity Recovered: False Material Enters In File: QASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: & 2/5/99 REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORT TO WCHD.				Not reported				
Last Inspection: // Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: // Enforcement Date: // Invstgn Complete: // UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: // Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: 0/25/99 Date Spill Entered In Computer Data File: 0/25/99 Date Spill Entered In Computer Data File: 0/25/99 Date Spill Entered In Computer Data File: 0/25/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Tank Size: Not reported Task Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: Tue Units: Gallons Quantity Recovered: False Material: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Tames Material Entry In File: 21329 CAS Number: Not reported Times Material Entry In File: 21329 CAS Number: Not REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SMAPLES: SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Cleanup Ceased	:	//				
Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: // Enforcement Date: // Invstgn Complete: // UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: // Corrective Action Plan Submitte: // Date Region Sent Summary to Central Office: // Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Date Spill Entered In Computer Data File: Not reported Tank Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Garces Leak Rate: Not reported Material Class Type: Petroleum Quantity Recovered: Gallons Unknown Quantity Spilled: GaSOLINE Class Type: GASOLINE Times Material Entry In File: 1329 CAS Number: Not reported		Cleanup Meets S	Std:	False				
Spiller Cleanup Dt: / / Enforcement Date: / / Invstgn Complete: / / UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Number: Not reported Test Method: Not reported Gates Type: Petroleum Quantity Spilled: 0 Unknown Quantity Spilled: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE		Last Inspection:		//				
Enforcement Date: / / Invstgn Complete: / / UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: // Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: // Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Tank Size: Not reported Task Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Class Type: QASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remark: 25/39 R.ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLE'S SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Recommended F	Penalty:	Penalty Not I	Recommended			
Enforcement Date: / / Invstgn Complete: / / Invstgn Complete: / / UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Number: Not reported Tank Size: Not reported Tast Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: False Materiai: GASOLINE Class Type: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R.ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Spiller Cleanup E	Dt:	11				
UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: // Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Is Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Task Size: Not reported Task Size: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Galions Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes				//				
UST Involvement: True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Is Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unknown Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unknown Quantity Recovered: False Material Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remark		Invstgn Complete	e:	11				
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: // Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 09/07/99 Is Updated 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Number: Not reported Task Kate Failed Tank: Not reported Task Size: Not reported Gross Leak Rate: Not reported Gross Leak Rate: Not reported Quantity Spilled: 0 0 0 Units: Gallons Gallons 0 Quantity Recovered: 0 0 0 Unkonwn Quantity Recovered: GASOLINE Class Type: GASOLINE Class Type: GASOLINE GASOLINE Class Type: GASOLINE Class Type: GASOLINE Class Type: GASOLINE Class Type: GASOLINE Class Type: GASOLINE		•		True				
Responsible Party. Corrective action taken. Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Number: Not reported Test Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Class Type: GASOLINE Class Type: Not reported Last Date: 199409					se with minimal p	otential for fire or ha	zard. DEC Response.	Willina
Spill Closed Dt: / / Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Leak Rate Failed Tank: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Quantity Spilled: 0 Unknown Quantity Spilled: 0 Unknown Quantity Spilled: True Unknown Quantity Recovered: False Material: Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19409029 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX SAMPLES SEND REPORT TO WCHD. Remark:		- F			•			
Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 ls Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Test Method: Not reported Gross Leak Rate: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Spill Closed Dt		•				
Date Region Sent Summary to Central Office: / / 08/25/99 Date Spill Entered In Computer Data File: 08/25/99 Date Spill Entered In Computer Data File: Not reported Updated Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Quantity Spilled: 0 Unknown Quantity Spilled: True Unknown Quantity Recovered: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: 0 Unknown Quantity Recovered: 0 Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remark: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes <td></td> <td></td> <td>Plan Submit</td> <td></td> <td>11</td> <td></td> <td></td> <td></td>			Plan Submit		11			
Date Spill Entered In Computer Data File:08/25/99Date Spill Entered In Computer Data File:Not reportedUpdate Date:09/07/99Is Updated:FalsePBS Number:Not reportedTank Number:Not reportedTank Size:Not reportedTast Method:Not reportedLeak Rate Failed Tank:Not reportedGross Leak Rate:Not reportedMaterial Class Type:PetroleumQuantity Spilled:0Unkonwn Quantity Spilled:TrueUnkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Material Entry In File:21329CAS Number:Not reportedTimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX.SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes								
Date Spill Entered In Computer Data File: Not reported Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Tank Size: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Quantity Spilled: 0 Unknown Quantity Spilled: 0 Unknown Quantity Recovered: 0 Quantity Recovered: 0 Unknown Quantity Recovered: 0 Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remark: 8/25/99 R.ZYTEL REPORT TO WCHD Remark: caller on site doing tank removal and found soil contaminatio								
Update Date: 09/07/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Test Method: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Unkonwn Quantity Spilled: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Class Type: GASOLINE Times Material EASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R.Z								
Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Unkonwn Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		•	a in Comput		Not reported			
PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Unkonwn Quantity Recovered: 0 Class Type: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19340929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes								
Tank Number:Not reportedTank Size:Not reportedTest Method:Not reportedLeak Rate Failed Tank:Not reportedGross Leak Rate:Not reportedMaterial Class Type:PetroleumQuantity Spilled:0Unkonwn Quantity Spilled:TrueUnits:GallonsQuantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Class Type:GASOLINEClass Type:GASOLINETimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes		•						
Tank Size:Not reportedTest Method:Not reportedLeak Rate Failed Tank:Not reportedGross Leak Rate:Not reportedMaterial Class Type:PetroleumQuantity Spilled:0Unkonwn Quantity Spilled:TrueUnits:GallonsQuantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Class Type:GASOLINEClass Type:GASOLINETimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes				•				
Test Method:Not reportedLeak Rate Failed Tank:Not reportedGross Leak Rate:Not reportedMaterial Class Type:PetroleumQuantity Spilled:0Unkonwn Quantity Spilled:TrueUnits:GallonsQuantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:GASOLINEClass Type:GASOLINEClass Type:GASOLINETimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R.ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes				•				
Leak Rate Failed Tank:Not reportedGross Leak Rate:Not reportedMaterial Class Type:PetroleumQuantity Spilled:0Quantity Spilled:TrueUnits:GallonsQuantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:0Unkonwn Quantity Recovered:GASOLINEClass Type:GASOLINEClass Type:GASOLINETimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes				•				
Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes				•				
Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes				•				
Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes				Not reported				
Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Material Class Ty	ype:	Petroleum				
Units:GallonsQuantity Recovered:0Unkonwn Quantity Recovered: FalseMaterial:GASOLINEClass Type:GASOLINETimes Material Entry In File:21329CAS Number:Not reportedLast Date:19940929DEC Remarks:8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD.Remark:caller on site doing tank removal and found soil contamination caller believes		Quantity Spilled:		0				
Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Unkonwn Quanti	ty Spilled:	True				
Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Units:		Gallons				
Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Quantity Recove	red:	0				
Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Unkonwn Quanti	ty Recovered	l:False				
Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes								
Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		Class Type:		GASOLINE				
CAS Number: Not reported Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes		••	ntry In File:	21329				
Last Date: 19940929 DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes								
DEC Remarks: 8/25/99 R. ZYTEL REPORTED THAT WCHD WAS ON SCENE ON 8/24/99. WILL TAKE POST EX. SAMPLES SEND REPORT TO WCHD. Remark: caller on site doing tank removal and found soil contamination caller believes				•				
5				ZYTEL REPC			E ON 8/24/99. WILL T	AKE POST
there was a problem with manifold		Remark:	caller on sit	e doing tank r	emoval and found		caller believes	
			there was a	i problem with	manifold			

SSW 1/8-1/4 1123 ft.	57,65,71 ALEXANDER ST YONKERS, NY	REET,BLOCK/LOTS:2610/50,53,57
Relative: Lower	US BROWNFIELDS: Recipient Name: Project Name:	City of Yonkers Yonkers, NY

	Project Name:	YONKERS, INY	
Actual:	EPA ID:	Not reported	
1 ft.	Region Number:	2	
	Latitude:	Not reported	
	Longitude:	Not reported	
	Assessment Date:	3/31/2001	
	Clean up Date:	Not reported	
	Entity Type:	Not reported	

N/A

Map ID	ſ	MAP FINDINGS		
Direction	L_	MAF T INDINGS		
Distance Distance (ft.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
J89 South 1/8-1/4 1127 ft.	YONKERS CITY JAIL 24 ALEXANDER STREET YONKERS, NY 10701		US BROWNFIELDS	1009400885 N/A
Relative:	Site 2 of 2 in cluster J			
Higher	US BROWNFIELDS:			
Actual: 24 ft.	Project Name:YoEPA ID:NoRegion Number:2Latitude:40Longitude:-7Assessment Date:NoClean up Date:No	ty of Yonkers Industrial Development Agency onkers Ind Dev Agency, NY (A04) ot reported 9.93751 3.90120 ot reported ot reported ot reported edevelopment Agency		
190 ESE 1/8-1/4 1138 ft. Relative:	YONKERS PUBLIC SCHOOL N 33 ASHBURTON AVENUE YONKERS, NY 10701 Site 2 of 2 in cluster I UST:	O. 6	NY UST	U003885710 N/A
Higher	PBS Number:	3-413429		
Actual:	Tank Number:	1		
85 ft.	Tank Status:	Closed-In Place 20000 INSTALL DATE		
	Capacity: Pipe Location:	Aboveground		
	Pipe Type:	Steel/Iron		
	2nd Containment:	None Nos. 1, 2 or 4 Fuel Oil		
	Product: Tank Location:	Underground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection: Tank External Protection:	None Sacrificial Anode		
	Date Last Tested / Next Te			
	Date Tank Closed / Catego	ory: 5/1/1992 CATEGORY B		
	Leak Detection:	None Readerst leaved Oceanie		
	Overfill Protection: Dispenser Method:	Product Level Gauge Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	Dept Of Public Works		
	Phone: In-service Capacity:	(914) 377-6270 0		
	Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number: Lat/Long:	Not reported 40 56 21 / 73 53 49		
	Site Type:	Not reported		
	Number Of Active Tanks:	0		
	Old Pbs Number:	Not reported		
	Last Inspected:	Not reported		
	Emergency Name: Emergency Phone:	Dpw Action Center (914) 377-6000		
	0	、 <i>/</i>		

Database(s)

EDR ID Number EPA ID Number

YONKERS PUBLIC SCHOOL NO. 6 (Continued)

Owner Name: City Of Yonkers, Dept Of Public Works Owner Address: Room 311, City Hall (914) 377-6270 Owner Phone: LOCAL GOVERNMENT Owner Type: Owner City, St, Zip: Yonkers, NY 10701 Mail Company: City Of Yonkers Department Of Public Works Mail Address: Mail Address: Room 311, City Hall Mail City,St,Zip: Yonkers, NY 10701 Attention: Commissioner Of Dpw Mail Phone: (914) 377-6270 20000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: В Install Date: Not reported Date Tank Was Closed: 5/1/1992 PBS Number: 3-413429 Tank Number: 2 Tank Status: Closed-Removed Capacity: 5000 INSTALL DATE Abovearound Pipe Location: Pipe Type: Steel/Iron 2nd Containment: None Product: Nos. 1, 2 or 4 Fuel Oil Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Sacrificial Anode Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 5/1/1992 CATEGORY B Leak Detection: None **Overfill Protection:** Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Dept Of Public Works Operator: Phone: (914) 377-6270 In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Lat/Long: 40 56 21 / 73 53 49 Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name: Dpw Action Center Emergency Phone:** (914) 377-6000 Owner Name: City Of Yonkers, Dept Of Public Works Owner Address: Room 311. City Hall Owner Phone: (914) 377-6270

Map ID Direction		MAP FINDINGS		
Distance Distance (fi Elevation	t.) Site		Database(s)	EDR ID Number EPA ID Number
	YONKERS PUBLIC SCHOOL N	IO. 6 (Continued)		U003885710
	Owner Type: Owner City,St,Zip: Mail Company: Mail Address: Mail Address: Mail City,St,Zip: Attention: Mail Phone: Capacity: Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed:	LOCAL GOVERNMENT Yonkers, NY 10701 City Of Yonkers Department Of Public Works Room 311, City Hall Yonkers, NY 10701 Commissioner Of Dpw (914) 377-6270 5000 Not reported Not reported B Not reported 5/1/1992		
L91 ENE 1/8-1/4 1155 ft.	CHURCH 26 WILLOW PLACE YONKERS, NY		NY LTANKS	S106868941 N/A
1155 IL.	Site 1 of 3 in cluster L			
Relative: Higher	LTANKS:			
Highei	Site ID:	339120		
Actual:	Spill Date:	03/21/05		
69 ft.	Facility Addr2: Facility ID:	Not reported 0413255		
	Program Number:	0413255		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	JBODee		
	Referred To:	Not reported		
	Reported to Dept:	03/21/05		
	CID: Spill Cause:	17 Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Notifier:	Tank Tester		
	Cleanup Ceased:			
	Cleanup Meets Standard:	False		
	Last Inspection: Recommended Penalty:	/ / Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	Response. Willi	ng
		Responsible Party. Corrective action taken.		
	Spill Closed Dt:			
	Remediation Phase: Date Entered In Computer:	1		
	Spille Namer:	CLIFFORD FISCHER		
	Spiller Company:	FISHER HOME		
	Spiller Phone:	(914) 592-5274		
	Spiller Extention:	Not reported		
	Spiller Address:	26 WILLOW PLACE		
	Spiller City,St,Zip: Spiller County:	YONKERS, NY 001		
	Spiller Contact:	CLIFFORD FISCHER		
	Spiller Phone:	(914) 592-5274		
	Spiller Extention:	Not reported		

CHURCH (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106868941

DEC Region:	3
Program Number:	0413255
DER Facility ID:	310486
Site ID:	339120
Operable Unit ID:	1101034
Operable Unit:	01
Material ID:	581180
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	339120
Spill Tank Test:	529634
Tank Number:	Not reported
Tank Size:	0
Test Method:	03
Leak Rate:	0.00
Gross Fail:	0
Modified By:	Watchdog
Last Modified:	03/21/05
Test Method:	Horner EZ Check I or II
Site ID:	339120
Spill Tank Test:	529633
Tank Number:	1
Tank Size:	550
Test Method:	00
Leak Rate:	0.00
Gross Fail:	0
Modified By:	Watchdog
Last Modified:	03/21/05
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 0413255 ISOLATE AND RETEST END CallerRemark - 0413255
Remark:	Start DECRemark - 0413255 ALSO REPORTED AS SPILL 04-12120. jod END DECRemar 0413255

L92 ENE 1/8-1/4 1155 ft.	PRIVATE RESIDENCE 26 WILLOW PLACE YONKERS, NY Site 2 of 3 in cluster L		NY Spills	S106866574 N/A
Relative:	one z or o in cluster E			
Higher	NY Spills:			
ingiloi	Site ID:	337498		
Actual:	Facility Addr2:	Not reported		
69 ft.	Facility ID:	0412120		
	Spill Number:	0412120		
	Facility Type:	ER		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	JBODee		
	Referred To:	Not reported		
	Spill Date:	02/14/05		
	Reported to Dept:	02/14/05		

PRIVATE RESIDENCE (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	ATE REDIBEROE (0		01
	CID:	17	
	Spill Cause:	Other	
Water Affected:		Not reported	
	Spill Source:	Private Dwelling	
	Spill Notifier:	Tank Tester	
	Cleanup Ceased:	/ /	
	Cleanup Meets Std:	False	
	Last Inspection:	/ /	
	Recommended Penal	r: Penalty Not Recommended	
	UST Trust:	False	
	Spill Class:	Possible release with minimal potential for fire or hazard or Known release w	vith
		no damage. No DEC Response. No corrective action required.	
	Spill Closed Dt:	02/17/05	
	Remediation Phase:	0	
	Date Entered In Comp	uter: 02/14/05	
	Spill Record Last Upd	te: 03/02/06	
	Spiller Name:	ALAN MERVIOTCH	
	Spiller Company:	PRIVATE RESIDENCE	
	Spiller Address:	26 WILLOW PALCE	
	Spiller City,St,Zip:	YONKERS, NY	
	Spiller Company:	001	
	Spiller Phone:	(914) 699-6052 208	
	Contact Name:	ALAN MERVIOTCH	
	Contact Phone:	(914) 699-6052 208	
	DEC Region:	3	
	Program Number:	0412120	
	DER Facility ID:	310486	
	Site ID:	337498	
	Operable Unit ID:	1099449	
	Operable Unit:	01	
	Material ID:	579789	
	Material Code:	0001	
	Material Name:	#2 Fuel Oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	0.00	
	Units:	Gallons	
	Recovered:	0.00	
	Resource Affected:	Groundwater	
	Oxygenate:	False	
		CallerRemark - 0412120 MESA TEST: SHOWED A PIPING PROBLEM END	
		rRemark - 0412120	
		DECRemark - 0412120 02/17/05 INVALID TANK TEST METHOD. SEE SPILL	
	04-1	3255. jod END DECRemark - 0412120	

L93 ENE 1/8-1/4 1161 ft.	HABITAT FOR HUMANITY 27 WILLOW PLACE YONKERS, NY	
	Site 3 of 3 in cluster L	
Relative: Higher	LTANKS: Site ID:	354201
Actual:	Spill Date:	10/18/05
70 ft.	Facility Addr2:	25 WILLOW PLACE
	Facility ID:	0508589
	Program Number:	0508589
	SWIS:	6018

NY LTANKS S107416994 N/A

Database(s)

EDR ID Number EPA ID Number

HABITAT FOR HUMANITY (Continued)

Region of Spill: 3 JBODee Investigator: Referred To: Not reported Reported to Dept: 10/18/05 CID: 17 Spill Cause: Tank Failure Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Other Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 10/18/05 **Recommended Penalty:** Penalty Not Recommended **UST Involvement:** False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR) Spill Closed Dt: 11 Remediation Phase: 1 Date Entered In Computer: 10/18/05 Spill Record Last Update: 10/20/05 Spille Namer: JIM KILLORIN Spiller Company: HABITAT FOR HUMANITY Spiller Phone: (914) 4034821 Spiller Extention: Not reported Spiller Address: 27 WILLOW PLACE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: DERECK WILLIAMS Spiller Phone: (914) 943-9402 Spiller Extention: Not reported DEC Region: 3 Program Number: 0508589 **DER Facility ID:** 301533 Site ID: 354201 Operable Unit ID: 1111631 Operable Unit: 01 Material ID: 2101668 Material Code: 0001 #2 Fuel Oil Material Name: Case No.: Not reported Material FA: Petroleum 0.00 Quantity: Units: Gallons 0.00 Recovered: **Resource Affected:** Groundwater Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported DEC Remarks: Start CallerRemark - 0508589 WHILE DIGGING AT ABOVE ADDRESS CAME UPON AN OLD

	[
Map ID		MAP FINDINGS		
Direction	Ч			
Distance Distance (ft.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
				• · · · · · · · · · ·
	HABITAT FOR HUMANITY (Co	ntinued)		S107416994
		TANK AND REMOVED IT AND CAUSED IT TO LEAF		
		OUT AND HAS REFUSED TO CALL DEC AND IS CO	DNTNUING TO FILL IN:	CALLER IS
	Remark:	CONCERNED: END CallerRemark - 0508589 Start DECRemark - 0508589 10/18/05 MULTI-FAMIL	Y HOME BEING RENO	VATED FOR
	Komana	SURVIVORS OF HURRICANE KATRINA THRU HAB		
		AND OTHER CHARITABLE ORGANIZATIONS. DEC		
		PITTED 550 HEATING OIL TANK AT REAR OF PRO		
		OBVIOUS SIGNS OF CONTAMINATION. WORKERS OF WHERE THE TANK CAME FROM. DEC CONTAG		
		BUILDING DEPT HAVE NO RECORD OF TANK REM		
		HANDLED DIRECTLY BY COMMISSIONER JOHN M		
		END DECRemark - 0508589		
94	OUR LADY OF THE ROSARY S	H	NY Spills	S102151386
NE	226 WARBURTON AVE.		NY Hist Spills	N/A
1/8-1/4 1301 ft.	YONKERS, NY			
1301 11.				
Relative:	NY Spills:	052000		
Higher	Site ID: Facility Addr2:	253009 Not reported		
Actual:	Facility ID:	9107641		
69 ft.	Spill Number:	9107641		
	Facility Type:	ER		
	SWIS:	6018 3		
	Region of Spill: Investigator:	tdghiosa		
	Referred To:	Not reported		
	Spill Date:	10/17/91		
	Reported to Dept:	10/17/91		
	CID: Spill Cause:	17 Equipment Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Notifier:	Other		
	Cleanup Ceased:	06/18/53		
	Cleanup Meets Std: Last Inspection:	True / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Trust:	False		
	Spill Class:	Not reported		
	Spill Closed Dt: Remediation Phase:	10/24/91 0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company:	SAME		
	Spiller Address:	Not reported ZZ		
	Spiller City,St,Zip: Spiller Company:	001		
	Spiller Phone:	(914) 963-0806		
	Contact Name:	Not reported		
	Contact Phone:	Not reported		
	DEC Region: Brogram Number:	3 0107641		
	Program Number: DER Facility ID:	9107641 207260		
	Site ID:	253009		
	Operable Unit ID:	961759		
	-			

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

	SARY SH (Continued)	S102151386
Operable Unit:	01	
Material ID:	419836	
Material Code:	0001	
Material Name:	#2 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	40.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affecte		
Oxygenate:	False	
DEC Remarks:	Start CallerRemark - 9107641 FAULTY SKULLY INSERT IN F PAVEMENT SPEEDI-DRY APPLIED SPILL TEAM ENROUTE ED ALLEN END CallerRemark - 9107641	
Remark:	Start DECRemark - 9107641 Prior to Sept, 2004 data translation DEC Field was "GHIOSAY" END DECRemark - 9107641	on this spill Lead
NY Hist Spills:		
Region of Spill:	3	
Spill Number:	9107641	
Investigator:	GHIOSAY	
Caller Name:	Not reported	
Caller Agency:	Not reported	
Caller Phone:	Not reported	
Notifier Name:	Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Spill Date/Time:	10/17/1991 08:30	
Reported to Dept	Date/Time: 10/17/91 08:39	
SWIS:	55	
Spiller Name:	SAME	
Spiller Contact:	Not reported	
Spiller Phone:	(914) 963-0806	
Spiller Address:	Not reported	
Spiller City, St, Zip	Not reported	
Spill Cause:	Equipment Failure	
Reported to Dept:	On Land	
Water Affected:	Not reported	
Spill Source:	02	
Spill Notifier:	Other	
PBS Number:	Not reported	
Cleanup Ceased:	06/18/53	
Cleanup Meets St		
Last Inspection:	//	
Recommended P		
Spiller Cleanup D		
Enforcement Date		
Invstgn Complete	/ /	
UST Involvement	False	
Spill Class:	Not reported	
	10/24/91	
Spill Closed Dt:		
Corrective Action		
5	Summary to Central Office: / /	
-	In Computer Data File: 10/24/91	
•	In Computer Data File: Not reported	
Update Date: Is Updated:	/ / False	

Database(s)

EDR ID Number **EPA ID Number**

S102151386

OUR LADY OF THE ROSARY SH (Continued)

PBS Number:		Not reported
Tank Number:		Not reported
Tank Size:		Not reported
Test Method:		Not reported
Leak Rate Failed Tank:		Not reported
Gross Leak Rate:		Not reported
Material Class Ty	pe:	Petroleum
Quantity Spilled:		40
Unkonwn Quantity	y Spilled:	False
Units:		Gallons
Quantity Recovered:		0
Unkonwn Quantity	y Recovered	:False
Material:		#2 FUEL OIL
Class Type:		#2 FUEL OIL
Times Material Er	ntry In File:	24464
CAS Number:		Not reported
Last Date:		19941207
DEC Remarks:	Not reported	t
Remark:	FAULTY SK	CULLY INSERT IN FILL BOX OIL OIL ON PAVEMENT SPEEDI-DRY APPLIED SPILL
	TEAM ENR	OUTE TO COMPLETE CLEAN UP SPOKE WITH ED ALLEN

115772

PUBLIC SCHOOL #6 PUBLIC SCHOOL #6 East 1/8-1/4 YONKERS, NY

LTANKS:

Site ID:

1313 ft.

95

Relative: Higher

Actual: 107 ft.

S100140578 NY LTANKS NY HIST LTANKS N/A

Spill Date: 07/20/89 Facility Addr2: Not reported Facility ID: 8903954 Program Number: 8903954 SWIS: 6018 Region of Spill: 3 Investigator: UNASSIGNED Referred To: Not reported Reported to Dept: 07/20/89 CID: Not reported Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Institutional, Educational, Gov., Other Spill Notifier: Tank Tester Cleanup Ceased: 07/30/92 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Known release with minimal potential for fire or hazard. DEC Response. Willing Spill Class: Responsible Party. Corrective action taken. Spill Closed Dt: 07/30/92 **Remediation Phase:** 0 Date Entered In Computer: 08/01/89 Spill Record Last Update: 11/22/94 Spille Namer: Not reported Spiller Company: SAME Spiller Phone: Not reported Spiller Extention: Not reported Spiller Address: Not reported

Database(s)

EDR ID Number EPA ID Number

PUBLIC SCHOOL #6 (Continu	ued) \$100140578
Spiller City,St,Zip:	NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
5	5 8903954
Program Number: DER Facility ID:	
Site ID:	100834
Operable Unit ID:	115772 931740
Operable Unit: Material ID:	01 448020
Material Code:	0002
	#4 Fuel Oil
Material Name: Case No.:	
Material FA:	Not reported Petroleum
Quantity:	0.00 Not reported
Units: Recovered:	Not reported 0.00
Recovered: Resource Affected:	0.00 Groundwater
Oxygenate:	False
Site ID:	115772
Spill Tank Test:	10306
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 8903954 20K TANK. HORNER EZY CHECK. HIGH VOL., NO RATE,
DEO Romano.	UNABLE TO READ. TO ISOLATE & RETEST. END CallerRemark - 8903954
Remark:	Start DECRemark - 8903954 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was " " END DECRemark - 8903954
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8903954
Investigator:	Not reported
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	07/20/1989
Spill Time:	18:00
Reported to Department D	
Reported to Department T SWIS:	IME: U9:16 55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	SAME

Database(s)

EDR ID Number EPA ID Number

PUBLIC SCHOOL #6 (Continued)

S100140578

•	
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Cleanup Ceased:	07/30/92
Cleanup Meets Stand	dard: True
Last Inspection:	
Recommended Pena	Ity: Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	
Investigation Comple	te: / /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	07/30/92
Date Region Sent Su	mmary to Central Office: / /
Corrective Action Pla	n Submitted: / /
Date Spill Entered In	Computer Data File: 08/01/89
Time Spill Entered In	Computer Data File: Not reported
Spill Record Last Upo	date: 11/22/94
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	0
Test Method:	Not reported
Leak Rate Failed Tar	ık: 0.00
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Sp	pilled: False
Units:	Not reported
Quantity Recovered:	0
Unkonwn Quantity Re	ecovered: False
Material:	#4 FUEL OIL
Class Type:	#4 FUEL OIL
Times Material Entry	In File: 1751
CAS Number:	Not reported
Last Date:	19941205
DEC Remarks: Not reported	
Spill Cause: 20	K TANK. HORNER EZY CHECK. HIGH VOL., NO RATE, UNABLE TO READ. TO ISOLATE
RE	ITEST.

Database(s)

EDR ID Number EPA ID Number

M96 South 1/4-1/2	KAWASAKI & NISSI 44 WELLS AVE BLD YONKERS, NY 1070)G 9		RCRA-SQG NY MANIFEST CT MANIFEST	1000157869 NYD982278160
1425 ft.	Site 4 of 5 in cluster M				
Relative:	Site 1 of 5 in cluster	r M			
Higher	RCRAInfo: Owner:				
Actual:	Owner.	(212) 555-12			
10 ft.	EPA ID:	NYD982278	160		
	Contact:	Not reported			
	Classification: TSDF Activities		ity Generator		
	Violation Status	: No violations	found		
	NY MANIFEST:		NVC2404224		
	Document ID: Manifest Status		NYC2194334 C		
	Trans1 State ID		NJDEPS869		
	Trans2 State ID		Not reported		
	Generator Ship		930305		
	Trans1 Recv Da		930305		
	Trans2 Recv Da	ate:	Not reported		
	TSD Site Recv	Date:	930314		
	Part A Recv Da	ite:	930318		
	Part B Recv Da		930323		
	Generator EPA		NYD982278160		
	Trans1 EPA ID:		ILD051060408		
	Trans2 EPA ID:		Not reported		
	TSDF ID:		KYD053348108		
	Waste Code:		D001 - NON-LISTED IGNITABLE WASTES		
	Quantity:		00568 D. Deurada		
	Units: Number of Con	tainara	P - Pounds 001		
	Container Type		DM - Metal drums, barrels		
	Handling Metho		B Incineration, heat recovery, burning.		
	Specific Gravity		100		
	Waste Code:	•	Not reported		
	Quantity:		01807		
	Units:		P - Pounds		
	Number of Con	tainers:	003		
	Container Type		DM - Metal drums, barrels		
	Handling Metho		B Incineration, heat recovery, burning.		
	Specific Gravity	/:	100		
	Waste Code:		Not reported		
	Quantity:		01096		
	Units:	toinoro	P - Pounds		
	Number of Con Container Type		002 DM - Metal drums, barrels		
	Handling Metho		B Incineration, heat recovery, burning.		
	Specific Gravity		100		
	Year:	-	93		
	Facility Type:		Generator		
	EPA ID:		NYD982278160		
	Facility Name:		KAWASAKI RAIL CAR INC.		
	Facility Address	3:	44 WELLS AVENUE		
	Facility City:		YONKERS		

Database(s)

EDR ID Number EPA ID Number

KAWASAKI & NISSHO IWAI (Continued)

Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone:

Not reported Not reported WESTCHESTER KAWASAKI RAIL CAR INC. Not reported 44 WELLS AVENUE YONKERS NY 10701 Not reported USA 914-964-1541

<u>Click this hyperlink</u> while viewing on your computer to access 37 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST:

Year:	1996
Manifest ID:	CTF0526166
TSDF EPA ID:	CTD001156009
TSDF Name:	SAFETY-KLEEN SYSTEMS, INC.
TSDF Address:	39 COMMUNITY AVE EXT.
TSDF City,St,Zip:	PLAINFIELD, CT 06374
TSDF Country:	USA
TSDF Telephone:	Not reported
Transport Date:	09/26/96
Transporter EPA ID:	ILD984908202
Transporter Name:	SAFETY-KLEEN SYSTEMS, INC.
Transporter Country:	USA
Transporter Phone:	Not reported
Trans 2 Date:	/ /
Trans 2 EPA ID:	Not reported
Trans 2 Name:	Not reported
Trans 2 Address:	Not reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not reported
Generator EPA ID:	NYD982278160
Gererator Phone:	9143762216
Generator Address:	Not reported
Generator City,State,Zip:	Not reported
Generator Country:	Not reported
Special Handling:	Not reported
Discrepancies:	Not reported
Date Shipped:	09/26/96
Date Received:	10/03/96
Last modified date:	04/26/04
Last modified by:	IG
Comments:	Not reported

Click this hyperlink while viewing on your computer to access 1 additional CT MANIFEST: record(s) in the EDR Site Report.

1000157869

Database(s)

EDR ID Number EPA ID Number

M97 South 1/4-1/2 1457 ft.	OTIS ELEVATORS CO 44 WELLS AVE YONKERS, NY 10701 Site 2 of 5 in cluster M		RCRA-SQG FINDS NY MANIFEST CT MANIFEST	1000374658 NYD001557347
Relative: Higher Actual: 12 ft.	RCRAInfo: Owner: EPA ID:	UNITED TECHNOLOGIES CORP (212) 555-1212 NYD001557347		
	Contact: Classification: TSDF Activities:	J C IWANOWSKI (914) 965-7400 Small Quantity Generator Not reported		
		No violations found		

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

Document ID:	NJA0072317
Manifest Status:	К
Trans1 State ID:	NJLICXDW-
Trans2 State ID:	Not reported
Generator Ship Date:	850415
Trans1 Recv Date:	850415
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	850415
Part A Recv Date:	850514
Part B Recv Date:	850826
Generator EPA ID:	NYD001557347
Trans1 EPA ID:	NJD991291584
Trans2 EPA ID:	Not reported
TSDF ID:	NJD080631369
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	00200
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Waste Code:	Not reported
Quantity:	00040
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100

Database(s)

EDR ID Number EPA ID Number

1000374658

OTIS ELEVATORS CO (Continued)

Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Year: Facility Type: EPA ID: Facility Name: Facility Address: Facility City: Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone:

Not reported 00200 P - Pounds 001 DM - Metal drums, barrels L Landfill. 100 Not reported 00200 P - Pounds 001 DM - Metal drums, barrels L Landfill. 100 85 Generator NYD001557347 OTIS ELEVATORS CO 44 WELLS AVE YONKERS Not reported Not reported WESTCHESTER PORT AUTHORITY OF NEW YORK & NEW JERSEY IWANOWSKI J C PLANT ENGR 44 WELLS AVE YONKERS NY 10701 Not reported Not reported 914-965-7400

<u>Click this hyperlink</u> while viewing on your computer to access 36 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST:

Year: 1985 Manifest ID: CTA0006382 TSDF EPA ID: CTD072138969 TSDF Name: ENVIRONMENTAL WASTE RESCOURCES, INC. **TSDF** Address: **130 FREIGHT STREET** TSDF City,St,Zip: WATERBURY, CT 06702 TSDF Country: USA TSDF Telephone: Not reported Transport Date: 02/12/85 Transporter EPA ID: CTD072138969 ENVIRONMENTAL WASTE RESCOURCES, INC. Transporter Name: Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: 11 Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: СТ Trans 2 Country: USA Trans 2 Phone: Not reported

Map ID	
Direction	
Distance	
Distance (ft	.)
Elevation	Site

Database(s)

EDR ID Number **EPA ID Number**

1000374658

OTIS ELEVATORS CO (Continued)

Generator EPA ID: NYD001557347 Gererator Phone: 9149650054 Generator Address: Not reported Generator City,State,Zip: Not reported Generator Country: Not reported Special Handling: Yes Discrepancies: No Date Shipped: 02/12/85 Date Received: 02/12/85 Last modified date: 04/27/04 Last modified by: IG Comments: Not reported

> Click this hyperlink while viewing on your computer to access additional CT MANIFEST: detail in the EDR Site Report.

PORT AUTH OF NY & NJ - INDUSTRIAL PARK M98 **BUILDING 5 BASEMENT** South 1/4-1/2 YONKERS, NY 10701

Site 3 of 5 in cluster M

1481 ft.

-	Site 5 of 5 in cluster M	
Relative: Higher	RCRAInfo:	
U	Owner:	PORT AUTHORITY - NY&NJ
Actual:		(212) 555-1212
15 ft.	EPA ID:	NYD981873870
	Contact:	Not reported
	Classification: TSDF Activities:	,
	Violation Status:	No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:	
Document ID:	NYA5312421
Manifest Status:	С
Trans1 State ID:	9A025
Trans2 State ID:	Not reported
Generator Ship Date:	870812
Trans1 Recv Date:	870812
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	870813
Part A Recv Date:	870818
Part B Recv Date:	870818
Generator EPA ID:	NYD981873870

FINDS NY MANIFEST

RCRA-SQG 1000390997 NYD981873870

istance istance (ft.) levation) Site		Database(s)	EDR ID Numbe EPA ID Numbe
	PORT AUTH OF NY & NJ - IND	USTRIAL PARK (Continued)		1000390997
	Trans1 EPA ID:	NYD046765574		
	Trans2 EPA ID:	Not reported		
	TSDF ID:	NYD049836679		
	Waste Code:	B007 - OTHER MISCELLANEOUS PCB WASTES		
	Quantity:	00450		
	Units:	P - Pounds		
	Number of Containers:	002		
	Container Type:	DM - Metal drums, barrels		
	Handling Method:	L Landfill.		
	Specific Gravity:	100		
	Year:	87		
	Facility Type:	Generator		
	EPA ID:	NYD981873870		
	Facility Name:	PORT AUTHORITY OF NEW YORK & NEW JERSEY		
	Facility Address:	44 WELLS AVENUE		
	Facility City:	YONKERS		
	Facility Zip 4:	Not reported		
	Country:	Not reported		
	County:	WESTCHESTER		
	Mailing Name:	PORT AUTHORITY OF NEW YORK & NEW JERSEY		
	Mailing Contact:	Not reported		
	Mailing Address:	44 WELLS AVE-INDUSTRIAL PARK		
	Mailing City:	AT YONKERS - YONKERS		
	Mailing State:	NY		
	Mailing Zip:	10701		
	Mailing Zip4:	Not reported		
	Mailing Country:	Not reported		
	Mailing Phone:	914-965-5979		
	Click this	s hyperlink while viewing on your computer to access		
	15 additi	onal NY MANIFEST: record(s) in the EDR Site Report.		

N99 ESE 1/4-1/2 1491 ft.	149 BROADWAY REALTY CORP 149 NORTH BROADWAY YONKERS, NY 10701	
Relative: Higher Actual: 123 ft.	Site 1 of 6 in cluster N AST: PBS Number: Tank Number: Tank Status: Capacity: Pipe Location: Pipe Type: 2nd Containment: Product: Tank Location: Pipe Internal Protection: Pipe External Protection: Tank Type: Tank Internal Protection: Tank External Protection: Tank External Protection: Date Last Tested / Next Test: Date Tank Closed / Category: Leak Detection: Overfill Protection: Dispenser Method:	
	·	·

NY AST A100276557 N/A

Database(s)

EDR ID Number EPA ID Number

149 BROADWAY REALTY CORP (Continued)

A100276557

Facility Addr2: Swiscode:	Not reported Not reported
	Jorge Perez
Operator: Phone:	5
	(914)424-0739
In-service Capacity: Site Status:	2000 Active DBS + 1100 col, DBS recordless if subport 260,14 toples evicts or not
Certification Date:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	1
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Bob Tauber
Emergency Phone:	(914) 906-1170
Owner Name:	149 BWDY Realty Corp.
Owner Address:	5 Ledgewood Lane
Owner Phone:	(914) 763-0768
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	South Salem, NY 10590
Mail Company:	149 BWDY Realty Corp.
Mail Address:	5 Ledgewood Lane
Mail Address:	Not reported
Mail City,St,Zip:	South Salem, NY 10590
Attention:	Bob Tauber
Mail Phone:	(914) 763-0768
Capacity:	2000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	Not reported
Date Tank Was Closed:	Not reported
	•

M100NEW PUBLIC LIBRARY/BOARD OF ED. BLDG.SSE38 WELLS AVENUE1/4-1/2YONKERS, NY 10701

Site 4 of 5 in cluster M

1493 ft.

Relative: Higher

Actual: 17 ft.

3-800760
001
Closed-Removed
2000 INSTALL DATE
Not reported
None
Not reported
Nos. 1, 2 or 4 Fuel Oil
Underground
None
None
Steel/Carbon Steel
None
None
NEXT TEST DATE
4/1/2001 CATEGORY

NY UST U003857271 N/A

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

NEW PUBLIC LIBRARY/BOARD OF ED. BLDG. (Continued)

/ PUBLIC LIBRARY/BOARD OF ED. BLDG. (Continued)		
Leak Detection:	None	
Overfill Protection:	None	
Dispenser Method:	Not reported	
Facility Addr2:	Not reported	
Swiscode:	Not reported	
Operator:	Edward Sheeran	
Phone:	(914) 377-6797	
In-service Capacity:	0	
Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14	
Certification Date:	Not reported	
Expire Date:	Not reported	
CBS Number:	Not reported	
Spdes Number:	Not reported	
Lat/Long:	Not reported	
Site Type:	Not reported	
Number Of Active Tanks:	0	
Old Pbs Number:	Not reported	
Last Inspected:	Not reported	
Emergency Name:	Edward Sheeran	
Emergency Phone:	(914) 377-6797 Venkers Industrial Day: Assas	
Owner Name: Owner Address:	Yonkers Industrial Dev. Assoc.	
Owner Phone:	City Hall - Room 416 (914) 377-6797	
Owner Type:	LOCAL GOVERNMENT	
Owner City,St,Zip:	Yonkers, NY 10701-	
Mail Company:	Yonkers Industrial Dev. Assoc.	
Mail Address:	City Hall - Room 416	
Mail Address:	Not reported	
Mail City,St,Zip:	Yonkers, NY 10701-	
Attention:	Edward Sheeran	
Mail Phone:	(914) 377-6797	
Capacity:	2000	
Date Last Tested:	Not reported	
Next Test Date:	Not reported	
Category:	Not reported	
Install Date:	Not reported	
Date Tank Was Closed:	4/1/2001	
PBS Number:	3-800760	
Tank Number:	002	
Tank Status:	Closed-Removed	
Capacity:	2000 INSTALL DATE	
Pipe Location:	Not reported	
Pipe Type: 2nd Containment:	None Not reported	
Product:	Not reported Nos. 1, 2 or 4 Fuel Oil	
Tank Location:	Underground	
Pipe Internal Protection:	None	
Pipe External Protection:	None	
Tank Type:	Steel/Carbon Steel	
Tank Internal Protection:	None	
Tank External Protection:	None	
Date Last Tested / Next Test:		
Date Tank Closed / Category:		
Leak Detection:	None	
Overfill Protection:	None Not reported	
Dispenser Method:	Not reported	

Database(s)

EDR ID Number EPA ID Number

Facility Addr2: Not reported Swiscode: Not reported Operator: Edward Sheeran (914) 377-6797 Phone: In-service Capacity: 0 Unregulated; <1101 gal. PBS & no Subpart 360-14 Site Status: Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Not reported Site Type: Number Of Active Tanks: 0 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name:** Edward Sheeran (914) 377-6797 Emergency Phone: **Owner Name:** Yonkers Industrial Dev. Assoc. Owner Address: City Hall - Room 416 Owner Phone: (914) 377-6797 LOCAL GOVERNMENT Owner Type: Owner City, St, Zip: Yonkers, NY 10701-Yonkers Industrial Dev. Assoc. Mail Company: Mail Address: City Hall - Room 416 Mail Address: Not reported Yonkers, NY 10701-Mail City,St,Zip: Attention: Edward Sheeran Mail Phone: (914) 377-6797 Capacity: 2000 Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Install Date: Not reported Date Tank Was Closed: 4/1/2001 PBS Number: 3-800760 Tank Number: 003 Tank Status: Closed-Removed 2000 INSTALL DATE Capacity: Pipe Location: Not reported Pipe Type: None 2nd Containment: Not reported Product: Nos. 1, 2 or 4 Fuel Oil Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/2001 CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Not reported Facility Addr2: Not reported Swiscode: Not reported

Edward Sheeran

Operator:

Database(s)

EDR ID Number EPA ID Number

NEW PUBLIC LIBRARY/BOARD OF ED. BLDG. (Continued)

Phone: (914) 377-6797 In-service Capacity: 0 Site Status: Certification Date: Expire Date: CBS Number: Spdes Number: Lat/Long: Site Type: Number Of Active Tanks: 0 Old Pbs Number: Last Inspected: **Emergency Name: Emergency Phone: Owner Name:** Owner Address: **Owner Phone:** Owner Type: Owner City, St, Zip: Mail Company: Mail Address: Mail Address: Mail City, St, Zip: Attention: Mail Phone: Capacity: 2000 Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed: PBS Number: Tank Number: 004 Tank Status: Capacity: Pipe Location: Pipe Type: None 2nd Containment: Product: Empty Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/2001 CATEGORY Leak Detection:

Overfill Protection:

Dispenser Method:

In-service Capacity:

Facility Addr2:

Swiscode:

Operator:

Site Status:

Phone:

Unregulated; <1101 gal. PBS & no Subpart 360-14 Not reported Edward Sheeran (914) 377-6797 Yonkers Industrial Dev. Assoc. City Hall - Room 416 (914) 377-6797 LOCAL GOVERNMENT Yonkers, NY 10701-Yonkers Industrial Dev. Assoc. City Hall - Room 416 Not reported Yonkers. NY 10701-Edward Sheeran (914) 377-6797 Not reported Not reported Not reported Not reported 4/1/2001 3-800760 Closed-Removed 550 INSTALL DATE Not reported Not reported Underground Steel/Carbon Steel None None Submersible Not reported Not reported Edward Sheeran (914) 377-6797 0

Unregulated; <1101 gal. PBS & no Subpart 360-14

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Not reported Site Type: Number Of Active Tanks: 0 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name:** Edward Sheeran **Emergency Phone:** (914) 377-6797 Yonkers Industrial Dev. Assoc. **Owner Name: Owner Address:** City Hall - Room 416 **Owner Phone:** (914) 377-6797 LOCAL GOVERNMENT Owner Type: Owner City, St, Zip: Yonkers, NY 10701-Yonkers Industrial Dev. Assoc. Mail Company: City Hall - Room 416 Mail Address: Mail Address: Not reported Yonkers, NY 10701-Mail City, St, Zip: Edward Sheeran Attention: Mail Phone: (914) 377-6797 550 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported Install Date: Not reported Date Tank Was Closed: 4/1/2001 PBS Number: 3-800760 005 Tank Number: Tank Status: Closed-Removed 550 INSTALL DATE Capacity: Pipe Location: Not reported Pipe Type: None 2nd Containment: Not reported Product: **Unleaded Gasoline** Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/1/2001 CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Submersible Facility Addr2: Not reported Not reported Swiscode: Operator: Edward Sheeran Phone: (914) 377-6797 In-service Capacity: 0 Unregulated; <1101 gal. PBS & no Subpart 360-14 Site Status: Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported

NEW PUBLIC LIBRARY/BOARD OF ED. BLDG. (Continued)

Database(s)

EDR ID Number EPA ID Number

U003857271

	NEW FUBLIC LIBRA		OF ED. BEDG. (Continued)	0003037271
	Spdes Number	:	Not reported	
	Lat/Long:		Not reported	
	Site Type:		Not reported	
	Number Of Acti	ive Tanks:	0	
	Old Pbs Numbe		Not reported	
	Last Inspected:		Not reported	
	Emergency Na		Edward Sheeran	
	Emergency Pho		(914) 377-6797	
	Owner Name:	one.	Yonkers Industrial Dev. Assoc.	
	Owner Address		City Hall - Room 416	
	Owner Phone:		•	
			(914) 377-6797	
	Owner Type:	7:	LOCAL GOVERNMENT	
	Owner City,St,Z		Yonkers, NY 10701-	
	Mail Company:		Yonkers Industrial Dev. Assoc.	
	Mail Address:		City Hall - Room 416	
	Mail Address:		Not reported	
	Mail City,St,Zip		Yonkers, NY 10701-	
	Attention:		Edward Sheeran	
	Mail Phone:		(914) 377-6797	
	Capacity:		550	
	Date Last Teste		Not reported	
	Next Test Date	:	Not reported	
	Category:		Not reported	
	Install Date:		Not reported	
	Date Tank Was	Closed:	4/1/2001	
M101 SSE 1/4-1/2 1493 ft. Relative: Higher Actual: 17 ft.	YONKERS PUBLIC 38 WELLS AVE YONKERS, NY 1070 Site 5 of 5 in cluster FINDS: Other Pertinent	01 r M Environmen RCRAInfo Conserva activities dispose o	FINDS RCRA-LQG NY MANIFEST CT MANIFEST CT MANIFEST tal Activity Identified at Site b is a national information system that supports the Resource tion and Recovery Act (RCRA) program through the tracking of events and related to facilities that generate, transport, and treat, store, or f hazardous waste. RCRAInfo allows RCRA program staff to track the n, permit, compliance, and corrective action activities required RA.	1000181102 NYD002014181
	RCRAInfo: Owner:	VONKEDS	INDUSTRIAL DEV AGENCY	

Map ID Direction Distance Distance (ft)	MAP FINDINGS				
Elevation	Site		Database(s)			
	YONKERS PUBLIC LIBRARY (Co	ontinued)				
	Violation Status: Violations exist					
	Regulation Violated: Area of Violation: Date Violation Determined: Actual Date Achieved Comp	Not reported GENERATOR-ALL REQUIREMENTS (OVERS 07/27/1988 bliance: 10/28/1988	SIGHT)			
	Enforcement Action: Enforcement Action Date: Penalty Type:	FINAL 3008(A) COMPLIANCE ORDER 09/01/1988 Final Monetary Penalty				
	There are 1 violation record(s) reported at this site:					
	Evaluation Compliance Evaluation Inspect	tion GENERATOR-ALL REQUIREMENTS (OVERS	SIGHT)			
	NY MANIFEST: Document ID:	NJA0192766				

Document ID.	113A0192700
Manifest Status:	С
Trans1 State ID:	NJDEPS577
Trans2 State ID:	Not reported
Generator Ship Date:	860403
Trans1 Recv Date:	860403
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	860403
Part A Recv Date:	860411
Part B Recv Date:	860411
Generator EPA ID:	NYD002014181
Trans1 EPA ID:	NJD990720658
Trans2 EPA ID:	Not reported
TSDF ID:	NJD002182897
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Quantity:	03518
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Year:	86
Facility Type:	Generator
EPA ID:	NYD002014181
Facility Name:	YONKERS I.D.A.
Facility Address:	38 WELLS AVENUE
Facility City:	YONKERS
Facility Zip 4:	Not reported
Country:	Not reported
County:	WESTCHESTER
Mailing Name:	YONKERS I.D.A.
Mailing Contact:	EDWARD SHEARAN
Mailing Address:	CITY HALL 416
Mailing City:	YONKERS
Mailing State:	NY
Mailing Zip:	10701
Mailing Zip4:	Not reported
Mailing Country:	USA
Mailing Phone:	914-377-6797

EDR ID Number

EPA ID Number

1000181102

Date of <u>Compliance</u> 19881028

Database(s)

EDR ID Number EPA ID Number

1000181102

YONKERS PUBLIC LIBRARY (Continued)

<u>Click this hyperlink</u> while viewing on your computer to access 13 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST: Year: Manifest ID: TSDF EPA ID: TSDF Address: TSDF Address: TSDF City,St,Zip: TSDF Country: TSDF Telephone: Transporter EPA ID: Transporter PA ID: Transporter Name: Transporter Country: Transporter Phone: Trans 2 Date: Trans 2 Date: Trans 2 PA ID: Trans 2 Name: Trans 2 City,St,Zip: Trans 2 Country: Trans 2 Phone: Generator EPA ID: Gererator Phone: Generator EPA ID: Generator Country: Special Handling: Discrepancies: Date Shipped: Date Received: Last modified date: Last modified by:	2001 CTF0802348 CT5000001495 NORTHEAST LAMP RECYCLING INC 250 MAIN ST EAST WINDSOR, CT 06088 USA Not reported 07/12/01 CTD983896341 WASTE MGMT NEW ENGLAND ENV TRANSPORT INC USA Not reported / / Not reported Not re
Last modified by: Comments:	Not reported

<u>Click this hyperlink</u> while viewing on your computer to access additional CT MANIFEST: detail in the EDR Site Report.

N102 ESE 1/4-1/2 1492 ft.	COMMUNITY BAPTIST CHURCH 156 NORTH BROADWAY YONKERS, NY 10701		NY U NY LTAN
	Site 2 of 6 in cluster N		
Relative: Higher Actual: 124 ft.	UST: PBS Number: Tank Number: Tank Status: Capacity: Pipe Location: Pipe Type: 2nd Containment: Product: Tank Location:	3-800786 1 In Service 1500 INSTALL DATE Not reported None Not reported Nos. 1, 2 or 4 Fuel Oil Underground	

NY UST U003884150 IY LTANKS N/A

Database(s)

EDR ID Number EPA ID Number

U003884150

COMMUNITY BAPTIST CHURCH (Continued)

Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 4/17/2003 NEXT TEST DATE 4/17/2004 Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Not reported Facility Addr2: Not reported Swiscode: Not reported Operator: Community Baptist Church Phone: (914) 969-4223 In-service Capacity: 1500 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 1 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name: Thomas Towles Emergency Phone:** (914) 965-2747 **Owner Name:** Community Baptist Church **Owner Address:** 156 N. Broadway Owner Phone: (914) 969-4223 Not reported Owner Type: Owner City,St,Zip: Yonkers, NY 10701-Mail Company: Community Baptist Church Mail Address: 156 N. Broadway Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701-Attention: Thomas Towles, Treasurer Mail Phone: (914) 969-4223 Capacity: 1500 Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: Install Date: Not reported Date Tank Was Closed: Not reported LTANKS: Site ID: 224304 Spill Date: 11/14/02 Not reported Facility Addr2: Facility ID: 0208451 Program Number: 0208451 SWIS: 6018 Region of Spill: 3 Investigator: WCHD WESTCHESTER CNTY HEALTH D Referred To: Reported to Dept: 11/14/02 CID: 17

Database(s)

EDR ID Number **EPA ID Number**

U003884150

COMMUNITY BAPTIST CHURCH (Continued)

Spill Cause:

Spill Source:

Spill Notifier:

Water Affected:

Cleanup Ceased:

Last Inspection:

UST Involvement:

Spill Closed Dt: Remediation Phase:

Spille Namer:

Spiller Phone:

Spiller Company:

Spiller Extention:

Spiller Address: Spiller City, St, Zip:

Spiller County:

Spiller Contact:

Spiller Extention:

Program Number:

DER Facility ID:

Operable Unit ID:

Operable Unit:

Material Code:

Material Name:

Material ID:

Case No.:

Units:

Material FA: Quantity:

Recovered:

Oxygenate: Site ID:

Spill Tank Test:

Tank Number:

Tank Size: Test Method:

Leak Rate:

Gross Fail:

Modified By:

Last Modified:

Test Method:

Remark:

DEC Remarks:

Resource Affected:

03

0.00

Spills

10/01/04

Not reported

Horner EZ Check I or II

CallerRemark - 0208451

Spiller Phone:

DEC Region:

Site ID:

Spill Class:

Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester 11 Cleanup Meets Standard: True 11 Recommended Penalty: Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 04/30/05 0 Date Entered In Computer: 11/14/02 Spill Record Last Update: 04/30/05 TOM TOWELS COMMUNITY BAPTIST CHURCH (914) 965-2747 Not reported 156 NORTH BROADWAY YONKERS, NY 10701-001 PAULA CORNELL (914) 747-9741 Not reported ٦ 0208451 185387 224304 861446 01 515454 0001 #2 Fuel Oil Not reported Petroleum 0.00 Gallons 0.00 Soil False 224304 2282 1 3000

Start CallerRemark - 0208451 TANK FAILED THE TEST.TOP OF THE TANK FAILED . END

DEC Field was "WCHD-SCHNEIDER" 04/30/05 PBS FACILITY. TANK PASSED A RETEST AFTER PIPING WAS REPAIRED. FILE CLOSED BY DANIELLE JACKSON OF THE WESTCHESTER.

COUNTY HEALTHDEPT. NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod END

Start DECRemark - 0208451 Prior to Sept, 2004 data translation this spill Lead

Database(s)

EDR ID Number EPA ID Number

U003884150

INICIALLY BALLING CHOKE	(Continued)	000
	DECRemark - 0208451	
Site ID:	352894	
Spill Date:	09/21/05	
Facility Addr2:	Not reported	
Facility ID:	0507470	
Program Number:	0507470	
SWIS:	6018	
Region of Spill:	3	
Investigator:	JBODee	
Referred To:	WCDOH	
Reported to Dept:	09/21/05	
CID:	17	
Spill Cause:	Tank Test Failure	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier:	Tank Tester	
Cleanup Ceased:	//	
Cleanup Meets Standard:	True	
Last Inspection:	//	
Recommended Penalty:	Penalty Not Recommended	
UST Involvement:	False	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing	g
	Responsible Party. Corrective action taken.	
Spill Closed Dt:	05/12/06	
Remediation Phase:	0	
Date Entered In Computer:		
Spill Record Last Update:		
Spille Namer:	TOM TOWLES	
Spiller Company:	COMMERCIAL	
Spiller Phone:	(914) 965-2747	
Spiller Extention:	Not reported	
Spiller Address:	156 NORTH BROADWAY	
Spiller City,St,Zip:	YONKERS, NY	
Spiller County:	001	
Spiller Contact:	TOM TOWLES	
Spiller Phone:	(914) 965-2747	
Spiller Extention:	Not reported	
DEC Region:	3	
Program Number: DER Facility ID:	0507470	
Site ID:	185387 352894	
Operable Unit ID:	1110367	
Operable Unit:	01	
Material ID:	2100379	
Material Code:	0001	
Material Name:	#2 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Groundwater	
Oxygenate:	False	
Site ID:	352894	
Spill Tank Test:	1102953	
Tank Number:	1	

Map ID Direction Distance		MAP FINDINGS		
Distance (ft. Elevation) Site		Database(s)	EDR ID Number EPA ID Number
	COMMUNITY BAPTIST CHURC	H (Continued)		U003884150
	Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks: Remark:	1500 03 0.00 0 Watchdog 09/21/05 Horner EZ Check I or II Not reported Start DECRemark - 0507470 May 12, 2006: TANK P. LEAKS DETECTED OR CONTAMINATION PRESEN jod END DECRemark - 0507470		
N103 ESE 1/4-1/2 1493 ft.	APT BUILDING 153-155 NORTH BROADWAY YONKERS, NY		NY LTANKS NY HIST LTANKS	S103941412 N/A
1495 11.	Site 3 of 6 in cluster N			
Relative: Higher	LTANKS:			
Ingliei	Site ID:	199599		
Actual: 125 ft.	Spill Date:	06/17/99 Not reported		
125 11.	Facility Addr2: Facility ID:	Not reported 9903104		
	Program Number:	9903104		
	SWIS:	6018		
	Region of Spill: Investigator:	3 tdghiosa		
	Referred To:	Not reported		
	Reported to Dept:	06/17/99		
	CID: Spill Cause:	17 Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Notifier: Cleanup Ceased:	Tank Tester		
		False		
	Last Inspection:			
	Recommended Penalty: UST Involvement:	Penalty Not Recommended False		
	Spill Class:	Known release with minimal potential for fire or hazard	d. DEC Response. Willin	ng
	Spill Closed Dt	Responsible Party. Corrective action taken. 11/30/99		
	Spill Closed Dt: Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spille Namer:	01/07/00 Not reported		
	Spiller Company:	ROBERT TAUBER		
	Spiller Phone:	(914) 472-1860		
	Spiller Extention:	Not reported		
	Spiller Address: Spiller City,St,Zip:	Not reported ZZ		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported Not reported		
	DEC Region:	3		
	Program Number: DER Facility ID:	9903104 166144		

Database(s)

EDR ID Number EPA ID Number

Site ID:	199599
Operable Unit ID:	1082028
Operable Unit:	01
Material ID:	303027
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	199599
Spill Tank Test:	21848
Tank Number:	Not reported
Tank Size:	2000
Test Method:	03
Leak Rate:	0.00
Gross Fail:	F
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Horner EZ Check I or II
DEC Remarks:	Start CallerRemark - 9903104 test was requested by owner. END CallerRemark - 9903104
Remark:	Start DECRemark - 9903104 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104
	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED.
HIST LTANKS:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104
HIST LTANKS: Region of Spill:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104
HIST LTANKS: Region of Spill: Spill Number:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104
HIST LTANKS: Region of Spill: Spill Number: Investigator:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not Repor
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not Repor
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Date: 06/17/99
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Date: 06/17/99 Time: 12:53
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported O6/17/1999 11:30 Date: 06/17/99 Time: 12:53 55
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Department T Reported to Department T SWIS: Spiller Contact:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Extention:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Phone: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Extention: Spiller Name:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O6/17/1999 11:30 Date: 06/17/99 Time: 12:53 55 Not reported Not REALTY BY WCHD;
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Agency: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O6/17/1999 11:30 Date: 06/17/99 Time: 12:53 55 Not reported Not
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Phone: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O6/17/1999 11:30 Date: 06/17/99 Time: 12:53 55 Not reported Not
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Phone: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O6/17/1999 11:30 Date: 06/17/99 Time: 12:53 55 Not reported Not reported
HIST LTANKS: Region of Spill: Spill Number: Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Phone: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department I Reported to Department I SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip:	DEC Field was "GHIOSAY" 12/27/99 LETTER SENT TO TKO REALTY BY WCHD; PROVIDE A WRITTEN REPORT DETAILING THE WORK PERFORMED. END DECRemark - 9903104 3 9903104 GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O6/17/199 11:30 Date: 06/17/99 Time: 12:53 55 Not reported Not

APT BUILDING (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S103941412

Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	3-800135
Cleanup Ceased:	//
Cleanup Meets Standard	l: False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	//
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	11/30/99
Date Region Sent Summ	ary to Central Office: / /
Corrective Action Plan S	ubmitted: / /
Date Spill Entered In Co	nputer Data File: 06/17/99
Time Spill Entered In Co	mputer Data File: Not reported
Spill Record Last Update	e: 01/07/00
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	2000
Test Method:	Horner EZ Check
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Talk Test Failures only pass or fail
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spille	
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Reco	
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In I	
CAS Number:	Not reported
Last Date:	19941207
	99 LETTER SENT TO TKO REALTY BY WCHD; MUST PROVIDE A WRITTEN REPORT
	ILING THE WORK PERFORMED.
Spill Cause: test w	as requested by owner.

N104 T.K.O. REALTY CORP. ESE 153-155 NORTH BROADWAY 1/4-1/2 YONKERS, NY 10701

1493 ft. Site 4 of 6 in cluster N Relative: UST: Higher PBS Number: 3-800135 Actual: Tank Number: 1 125 ft. Tank Status: Closed-Removed Capacity: 750 INSTALL DATE 07/01/1999 Pipe Location: Not reported Pipe Type: None

None

Empty

2nd Containment:

Product:

NY UST U003994971 N/A

Database(s)

EDR ID Number EPA ID Number

T.K.O. REALTY CORP. (Continued)

U003994971

Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	None
Date Last Tested / Next Test:	
Date Tank Closed / Category:	
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Not reported
Facility Addr2:	Not reported
Swiscode:	Not reported
Operator:	Jorge Perez
Phone:	(914)424-0739
In-service Capacity:	2550
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	3
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Robert Tauber
Emergency Phone:	(914) 906-1170
Owner Name:	T.K.O. Realty Corp.
Owner Address:	5 Ledgewood Lane
Owner Phone:	(914) 763-0768
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	South Salem, NY 10590-
Mail Company:	T.K.O. Realty Corp.
Mail Address:	5 Ledgewood Lane
Mail Address:	Not reported
Mail City,St,Zip:	South Salem, NY 10590-
Attention:	Robert P. Tauber, Jr.
Mail Phone:	(914) 763-0768
Capacity:	750
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	07/01/1999
Date Tank Was Closed:	7/1/1999
PBS Number:	3-800135
Tank Number:	2
Tank Status:	Closed-In Place
Capacity:	500 INSTALL DATE 07/01/1999
Pipe Location:	Not reported
Pipe Type:	None
2nd Containment:	None
Product:	Empty
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None

Database(s)

EDR ID Number EPA ID Number

U003994971

T.K.O. REALTY CORP. (Continued)

Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** None Dispenser Method: Not reported Facility Addr2: Not reported Swiscode: Not reported Operator: Jorge Perez (914)424-0739 Phone: In-service Capacity: 2550 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 3 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name: Robert Tauber** (914) 906-1170 **Emergency Phone:** Owner Name: T.K.O. Realty Corp. **Owner Address:** 5 Ledgewood Lane **Owner Phone:** (914) 763-0768 CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: South Salem, NY 10590-T.K.O. Realty Corp. Mail Company: Mail Address: 5 Ledgewood Lane Mail Address: Not reported Mail City, St, Zip: South Salem, NY 10590-Robert P. Tauber, Jr. Attention: (914) 763-0768 Mail Phone: 500 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported Install Date: 07/01/1999 Date Tank Was Closed: Not reported PBS Number: 3-800135 Tank Number: 3 **Closed-In Place** Tank Status: Capacity: 750 INSTALL DATE 07/01/1999 Pipe Location: Not reported Pipe Type: None 2nd Containment: None Product: Empty Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

T.K.O. REALTY CORP. (Continued)

U003994971

Date Last Tested / Next Test: Date Tank Closed / Category: Leak Detection: Overfill Protection: Dispenser Method: Facility Addr2: Swiscode: Operator: Phone: In-service Capacity: Site Status: Certification Date: Expire Date: CBS Number:	
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	3
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Robert Tauber
Emergency Phone:	(914) 906-1170
Owner Name:	T.K.O. Realty Corp.
Owner Address:	5 Ledgewood Lane
Owner Phone:	(914) 763-0768
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	South Salem, NY 10590-
Mail Company:	T.K.O. Realty Corp.
Mail Address:	5 Ledgewood Lane
Mail Address:	Not reported
Mail City,St,Zip:	South Salem, NY 10590-
Attention:	Robert P. Tauber, Jr.
Mail Phone:	(914) 763-0768
Capacity:	750
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	07/01/1999
Date Tank Was Closed:	Not reported
PBS Number:	3-800135
Tank Number:	4
Tank Status:	Closed-Removed
Capacity:	2000 INSTALL DATE
Pipe Location:	Not reported
Pipe Type:	None
2nd Containment:	None
Product:	Nos. 1, 2 or 4 Fuel Oil
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	None
Date Last Tested / Next Test:	NEXT TEST DATE 6/1/1999
Date Tank Closed / Category:	7/1/1999 CATEGORY
Leak Detection:	None

Database(s)

EDR ID Number EPA ID Number

T.K.O. REALTY CORP. (Continued)

U003994971

O. REALTY CORP.	NY AST	A10
Date Tank Was Closed:	7/1/1999	
Install Date:	Not reported	
Category:	Not reported	
Next Test Date:	Not reported 6/1/1999	
Capacity: Date Last Tested:		
Mail Phone:	(914) 763-0768 2000	
Attention:	Robert P. Tauber, Jr.	
Mail City,St,Zip:	South Salem, NY 10590-	
Mail Address:	Not reported	
	5 Ledgewood Lane	
Mail Company: Mail Address:	T.K.O. Realty Corp.	
Owner City,St,Zip:	South Salem, NY 10590-	
Owner Type:		
	(914) 763-0768 CORPORATE/COMMERCIAL	
Owner Address: Owner Phone:	5 Leagewood Lane (914) 763-0768	
Owner Name: Owner Address:	5 Ledgewood Lane	
Owner Name:	(914) 906-1170 T.K.O. Realty Corp.	
Emergency Name. Emergency Phone:	(914) 906-1170	
Emergency Name:	Robert Tauber	
Last Inspected:	Not reported	
Old Pbs Number:	S Not reported	
Number Of Active Tanks:	3	
Site Type:	Not reported	
Lat/Long:	Not reported	
Spdes Number:	Not reported	
CBS Number:	Not reported	
Expire Date:	Not reported Not reported	
Certification Date:		οι
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or n	ot
In-service Capacity:	2550	
Phone:	(914)424-0739	
Operator:	Jorge Perez	
Swiscode:	Not reported	
Facility Addr2:	Not reported	
Dispenser Method:	Not reported	
Overfill Protection:	None	

N105 T.K.O. REALTY CORP. ESE 153-155 NORTH BROADWAY

_

1/4-1/2 YONKERS, NY 10701

AST:

1493 ft.

Site 5 of 6 in cluster N

Relative: Higher

-	PBS Number:	3-800135
Actual:	Tank Number:	4
125 ft.	Tank Status:	In Service
	Capacity:	275 INSTALL DATE 07/01/1997
	Pipe Location:	Aboveground
	Pipe Type:	None
	2nd Containment:	None
	Product:	Nos. 1, 2 or 4 Fuel Oil
	Tank Location:	Aboveground
	Pipe Internal Protection:	None
	Pipe External Protection:	None
	Tank Type:	Steel/Carbon Steel
	Tank Internal Protection:	None
	Tank External Protection:	Painted/Asphalt Coating

NY AST A100276888 N/A

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

A100276888

Date Last Tested / Next Test:	NEXT TEST DATE
Date Tank Closed / Category:	CATEGORY
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Not reported
Facility Addr2:	Not reported
Swiscode:	Not reported
Operator:	Jorge Perez
Phone:	(914)424-0739
In-service Capacity:	2550
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	3
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Robert Tauber
Emergency Phone:	(914) 906-1170
Owner Name:	T.K.O. Realty Corp.
Owner Address:	5 Ledgewood Lane
Owner Phone:	(914) 763-0768
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	South Salem, NY 10590-
Mail Company:	T.K.O. Realty Corp.
Mail Address:	5 Ledgewood Lane
Mail Address:	Not reported
Mail City,St,Zip:	South Salem, NY 10590-
Attention:	Robert P. Tauber, Jr.
Mail Phone:	(914) 763-0768
Capacity:	275
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	07/01/1997
Date Tank Was Closed:	Not reported
	0.000405
PBS Number:	3-800135
Tank Number:	6
Tank Status:	
Capacity:	275 INSTALL DATE 07/01/1997
Pipe Location:	Aboveground
Pipe Type:	None
2nd Containment:	None
Product:	Nos. 1, 2 or 4 Fuel Oil
Tank Location:	Aboveground
Pipe Internal Protection:	None None
Pipe External Protection:	Steel/Carbon Steel
Tank Type: Tank Internal Protection:	None
Tank Internal Protection: Tank External Protection:	Painted/Asphalt Coating
Date Last Tested / Next Test:	1 6
Date Tank Closed / Category:	
Leak Detection:	None
Loui Dotodion.	

Database(s)

EDR ID Number EPA ID Number

T.K.O. REALTY CORP. (Continued)

A100276888

Overfill Protection:	None	
Dispenser Method:	Not reported	
Facility Addr2:	Not reported	
Swiscode:	Not reported	
Operator:	Jorge Perez	
Phone:	(914)424-0739	
In-service Capacity:	2550	
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or r	not
Certification Date:	Not reported	
Expire Date:	Not reported	
CBS Number:	Not reported	
Spdes Number:	Not reported	
Lat/Long:	Not reported	
Site Type:	Not reported	
Number Of Active Tanks:	3	
Old Pbs Number:	Not reported	
Last Inspected:	Not reported	
Emergency Name:	Robert Tauber	
Emergency Phone:	(914) 906-1170	
Owner Name:	T.K.O. Realty Corp.	
Owner Address:	5 Ledgewood Lane	
Owner Phone:	(914) 763-0768	
Owner Type:	CORPORATE/COMMERCIAL	
Owner City,St,Zip:	South Salem, NY 10590-	
Mail Company:	T.K.O. Realty Corp.	
Mail Address:	5 Ledgewood Lane	
Mail Address:	Not reported	
Mail City,St,Zip:	South Salem, NY 10590-	
Attention:	Robert P. Tauber, Jr.	
Mail Phone:	(914) 763-0768	
Capacity:	275	
Date Last Tested:	Not reported	
Next Test Date:	Not reported	
Category:	Not reported	
Install Date:	07/01/1997	
Date Tank Was Closed:	Not reported	
PBS Number:	3-800135	
Tank Number:	5	
Tank Status:	In Service	
Capacity:	2000 INSTALL DATE 11/01/1999	
Pipe Location:	Not reported	
Pipe Type:	None	
2nd Containment:	Not reported	
Product:	Unleaded Gasoline	
Tank Location:	Aboveground	
Pipe Internal Protection:	None	
Pipe External Protection:	None	
Tank Type:	Steel/Carbon Steel	
Tank Internal Protection:	None	
Tank External Protection:	None	
Date Last Tested / Next Test:		
Date Tank Closed / Category:		
Leak Detection:	None	
Overfill Protection:	None	
Dispenser Method:	Not reported	
Facility Addr2:	Not reported	

EDR ID N Database(s) EPA ID N

EDR ID Number EPA ID Number

T.K.O. REALTY CORP. (Continued)

A100276888

Swiscode: Not reported Operator: Jorge Perez Phone: (914)424-0739 In-service Capacity: 2550 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exist Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Site Type: Not reported Sumbor: Not reported Number Of Active Tanks: 3 Old Pbs Number: Not reported Last Inspected: Not reported Emergency Name: T.K.O. Realty Corp. Owner Name: T.K.O. Realty Corp. Owner Address: 5 Ledgewood Lane Owner City, St, Zip: South Salem, NY 10590- Mail Address: Not reported Mail Address: Not reported </th <th>-</th> <th>-</th>	-	-
Phone:(914)424-0739In-service Capacity:2550Site Status:Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exisCertification Date:Not reportedExpire Date:Not reportedCBS Number:Not reportedSydes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Name:S Ledgewood LaneOwner Name:CRPORATE/COMMERCIALOwner Type:CORPORATE/COMMERCIALOwner Type:CORPORATE/COMMERCIALOwner Type:South Salem, NY 10590-Mail Address:5 Ledgewood LaneMail Address:Not reportedMail Address:Not reportedMail Address:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNot reportedNot reportedCapacity:2000Date Last Tested:Not reportedNot reportedNot reportedNot reportedNot reportedIstall Date:11/01/1999	Swiscode:	Not reported
In-service Capacity:2550Site Status:Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exisCertification Date:Not reportedExpire Date:Not reportedCBS Number:Not reportedSpdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Type:CORPORATE/COMMERCIALOwner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Address:Not reportedMail Address:S Ledgewood LaneMail Address:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNot reportedNot reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Operator:	Jorge Perez
Site Status:Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks existCertification Date:Not reportedExpire Date:Not reportedCBS Number:Not reportedSpdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Type:CORPORATE/COMMERCIALOwner Type:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:Not reportedMail Address:S Ledgewood LaneMail Address:Not reportedMail Address:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNot reportedNot reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Phone:	(914)424-0739
Certification Date:Not reportedExpire Date:Not reportedCBS Number:Not reportedSpdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Address:S Ledgewood LaneMail Address:Not reportedMail Phone:(914) 763-0768Capacity:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	In-service Capacity:	2550
Expire Date:Not reportedCBS Number:Not reportedSpdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner City,St,Zip:South Salem, NY 10590-Mail Address:5 Ledgewood LaneMail Address:1 (14) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exist
CBS Number:Not reportedSpdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Name:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner City, St, Zip:South Salem, NY 10590-Mail Address:5 Ledgewood LaneMail Address:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Certification Date:	Not reported
Spdes Number:Not reportedLat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Type:CORPORATE/COMMERCIALOwner Type:CORPORATE/COMMERCIALOwner City, St, Zip:South Salem, NY 10590-Mail Address:5 Ledgewood LaneMail Address:9 Ledgewood LaneMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedMail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Expire Date:	Not reported
Lat/Long:Not reportedSite Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City, St, Zip:South Salem, NY 10590-Mail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:Not reportedMail Address:Not reportedMail Phone:(914) 763-0768Capacity:South Salem, NY 10590-Mail Phone:914) 763-0768Capacity:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	CBS Number:	Not reported
Site Type:Not reportedNumber Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Name:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Spdes Number:	Not reported
Number Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:S Ledgewood LaneMail Address:Not reportedMail Address:South Salem, NY 10590-Mail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Lat/Long:	Not reported
Number Of Active Tanks:3Old Pbs Number:Not reportedLast Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:S Ledgewood LaneMail Address:Not reportedMail Address:South Salem, NY 10590-Mail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Site Type:	Not reported
Last Inspected:Not reportedEmergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:Not reportedMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	51	•
Emergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Old Pbs Number:	Not reported
Emergency Name:Robert TauberEmergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Last Inspected:	•
Emergency Phone:(914) 906-1170Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	•	•
Owner Name:T.K.O. Realty Corp.Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999		(914) 906-1170
Owner Address:5 Ledgewood LaneOwner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999		T.K.O. Realty Corp.
Owner Phone:(914) 763-0768Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedInstall Date:11/01/1999	Owner Address:	
Owner Type:CORPORATE/COMMERCIALOwner City,St,Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Owner Phone:	
Owner City, St, Zip:South Salem, NY 10590-Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City, St, Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Owner Type:	
Mail Company:T.K.O. Realty Corp.Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	51	South Salem. NY 10590-
Mail Address:5 Ledgewood LaneMail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999		
Mail Address:Not reportedMail City,St,Zip:South Salem, NY 10590-Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999		
Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Mail Address:	
Attention:Robert P. Tauber, Jr.Mail Phone:(914) 763-0768Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Mail City,St,Zip:	South Salem, NY 10590-
Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999		Robert P. Tauber, Jr.
Capacity:2000Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Mail Phone:	(914) 763-0768
Date Last Tested:Not reportedNext Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999	Capacity:	
Next Test Date:Not reportedCategory:Not reportedInstall Date:11/01/1999		Not reported
Category: Not reported Install Date: 11/01/1999	Next Test Date:	•
Install Date: 11/01/1999	Category:	•
	• •	•
		•

0106 ARMORY ESE 127 NORTH BROADWAY 1/4-1/2 YONKERS, NY

1498 ft.

Relative:

Higher

Actual: 105 ft.

Site 1 of 4 in cluster O	
LTANKS:	
Site ID:	202057
Spill Date:	09/09/03
Facility Addr2:	Not reported
Facility ID:	0306124
Program Number:	0306124
SWIS:	6018
Region of Spill:	3
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	09/09/03
CID:	17
Spill Cause:	Tank Test Failure
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Tank Tester
Cleanup Ceased:	/ /
Cleanup Meets Standard:	False

NY LTANKS S105999835 N/A

EDR ID Number Database(s) EPA ID Number

ARMORY (Continued)

S105999835

Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	
Remediation Phase:	1
Date Entered In Computer:	09/09/03
Spill Record Last Update:	12/12/03
Spille Namer:	JOE KELLY
Spiller Company:	ARMORY
Spiller Phone:	(914) 377-6912
Spiller Extention:	
•	
Spiller Address:	127 NORTH BROADWAY
Spiller City,St,Zip:	YONKERS, ZZ
Spiller County:	001
Spiller Contact:	JOE KELLY
Spiller Phone:	(914) 377-6912
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	0306124
DER Facility ID:	168082
Site ID:	202057
Operable Unit ID:	872721
Operable Unit:	01
Material ID:	503361
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	202057
Spill Tank Test:	3218
Tank Number:	Not reported
Tank Size:	5000
Test Method:	03
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Horner EZ Check I or II
DEC Remarks:	Start CallerRemark - 0306124 NO COMMENTS MADE END CallerRemark - 0306124
Remark:	Start DECRemark - 0306124 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WCHD-JACKSON" END DECRemark - 0306124

Database(s) E

EDR ID Number EPA ID Number

1/4-1/2 YONKERS, NY 10701 1498 ft. Site 2 of 4 in cluster O Relative: Higher UST: PBS Number: 3-494003 Actual: Tank Number: 40 105 ft. Tank Status: In Service Capacity: 5000 INSTALL DATE Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Steel/Iron 2 nd Containment: None Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Date Last Tested / Next Test: 8/1/1997 NEXT TEST DATE 8/1/1998 Date Tank Closed / Category: CATEGORY A Leak Detection: Vent Whistle Dispenser Method: Suction Facility Addr2: Not reported Swiscode: 5518 Operator: City of Yonkers Phone: (914)377-6912	949345
Site 2 of 4 in cluster 0 Relative: UST: PBS Number: 3-494003 Actual: Tank Number: 40 105 ft. Tank Status: In Service Capacity: 5000 INSTALL DATE Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Steel/Iron 2nd Containment: None Product: None Pipe Internal Protection: None Pipe External Protection: None Pipe External Protection: None Tank Internal Protection: None Tank Internal Protection: None Tank Internal Protection: None Tank Internal Protection: None Date Last Tested / Next Test: 8/1/1997 NEXT TEST DATE 8/1/1998 Date Tank Closed / Category: CATEGORY A Leak Detection: None Overfill Protection: Vont reported Swiscode: Sotian Operator: City of Yonkers Phone: (914)377-6912	
Relative: Higher UST: 3-494003 Actual: Tank Number: 40 105 ft. Tank Number: 40 105 ft. Tank Status: In Service Capacity: 5000 INSTALL DATE Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Steel/Iron 2nd Containment: None Product: None Pipe Internal Protection: None Pipe External Protection: None Pipe External Protection: None Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 8/1/1997 NEXT TEST DATE 8/1/1998 Date Last Tested / Category: CATEGORY A Leak Detection: None Overfill Protection: Vent Whistle Dispenser Method: Suction Facility Addr2: Not reported Swisode: 5518 Operator: City of Yonkers Phone: (914)377-6912	
NgintPBS Number:3-494003Actual:Tank Number:40105 ft.Tank Status:In ServiceCapacity:5000 INSTALL DATEPipe Location:Aboveground on saddles, legs, stilts, rack or cradlePipe Type:Steel/Iron2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe Internal Protection:NonePipe External Protection:NoneTank Internal Protection:NoneTank External Protection:NoneTank External Protection:NoneTank External Protection:NoneDate Last Tested / Next Test8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:VoneOverfill Protection:Vont reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Actual:Tank Number:40105 ft.Tank Status:In ServiceCapacity:5000 INSTALL DATEPipe Location:Aboveground on saddles, legs, stilts, rack or cradlePipe Type:Steel/Iron2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NonePipe External Protection:NoneTank Internal Protection:NoneTank Internal Protection:NoneTank Internal Protection:NoneTank Internal Protection:NoneTank Internal Protection:NoneDate Last Tested / Next Test8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
105 ft.Tank Status:In ServiceCapacity:5000 INSTALL DATEPipe Location:Aboveground on saddles, legs, stilts, rack or cradlePipe Type:Stel/Iron2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NoneTank Type:Stel/Carbon SteelTank Internal Protection:NoneTank Location:NoneTank Location:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SucionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Pipe Location:Aboveground on saddles, legs, stilts, rack or cradlePipe Type:Steel/Iron2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneTank External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Pipe Type:Steel/Iron2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank Internal Protection:NoneTank External Protection:NoneTank Internal Protection:NoneDate Last Tested / Next Test8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
2nd Containment:NoneProduct:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank Internal Protection:NoneTank Internal Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Product:Nos. 1, 2 or 4 Fuel OilTank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Tank Location:UndergroundPipe Internal Protection:NonePipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Pipe Internal Protection:NonePipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Pipe External Protection:NoneTank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Tank Type:Steel/Carbon SteelTank Internal Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Tank Internal Protection:NoneTank External Protection:NoneDate Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Date Last Tested / Next Test:8/1/1997 NEXT TEST DATE 8/1/1998Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Date Tank Closed / Category:CATEGORY ALeak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Leak Detection:NoneOverfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Overfill Protection:Vent WhistleDispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Dispenser Method:SuctionFacility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Facility Addr2:Not reportedSwiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Swiscode:5518Operator:City of YonkersPhone:(914)377-6912	
Operator:City of YonkersPhone:(914)377-6912	
Phone: (914)377-6912	
In-service Capacity: 5000	
Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not	
Certification Date: 5/2/2005	
Expire Date: 9/27/2009	
CBS Number: Not reported	
Spdes Number: Not reported	
Lat/Long: Not reported Site Type: Not reported	
Number Of Active Tanks: 1	
Old Pbs Number: Not reported	
Last Inspected: 04/13/2004	
Emergency Name: Mayor's Help Line	
Emergency Phone: (914) 377-4357	
Owner Name: City of Yonkers, Dept. of General Services	
Owner Address: City Hall, Fifth Floor	
Owner Phone: (914) 377-6912 Owner Type: LOCAL GOVERNMENT	
Owner Type: LOCAL GOVERNMENT Owner City,St,Zip: Yonkers, NY 10701	
Mail Company: City of Yonkers, Dept. of General Services	
Mail Address: 40 South Broadway	
Mail Address: City Hall, Fifth Floor	
Mail City, St, Zip: Yonkers, NY 10701	
Attention: Director of General Services	
Mail Phone: (914) 377-6912	
Capacity: 5000	
Date Last Tested: 8/1/1997	
Next Test Date: 8/1/1998	
Category: A Install Date: Not reported	

Database(s)

EDR ID Number EPA ID Number

ARMORY (Continued)

U003949345

VI	ORT (Continued)	UU
	Date Tank Was Closed:	Not reported
	PBS Number:	3-494003
	Tank Number:	2
	Tank Status:	Closed-Removed
	Capacity:	1000 INSTALL DATE
	Pipe Location:	Not reported
	Pipe Type:	Steel/Iron
	2nd Containment:	None
	Product:	Leaded Gasoline
	Tank Location:	Underground
	Pipe Internal Protection:	None
	Pipe External Protection:	None
	Tank Type:	Steel/Carbon Steel
	Tank Internal Protection:	None
	Tank External Protection:	None
	Date Last Tested / Next Test:	NEXT TEST DATE
	Date Tank Closed / Category:	CATEGORY A
	Leak Detection:	None
	Overfill Protection:	None
	Dispenser Method:	Suction
	Facility Addr2:	Not reported
	Swiscode:	5518
	Operator:	City of Yonkers
	Phone:	(914)377-6912
	In-service Capacity:	5000
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
	Certification Date:	5/2/2005
	Expire Date:	9/27/2009
	CBS Number:	Not reported
	Spdes Number:	Not reported
	Lat/Long:	Not reported
	Site Type:	Not reported
	Number Of Active Tanks:	1
	Old Pbs Number:	Not reported
	Last Inspected:	04/13/2004
	Emergency Name:	Mayor's Help Line
	Emergency Phone:	(914) 377-4357
	Owner Name:	City of Yonkers, Dept. of General Services
	Owner Address:	City Hall, Fifth Floor
	Owner Phone:	(914) 377-6912
	Owner Type:	LOCAL GOVERNMENT
	Owner City,St,Zip:	Yonkers, NY 10701
	Mail Company:	City of Yonkers, Dept. of General Services
	Mail Address:	40 South Broadway
	Mail Address:	City Hall, Fifth Floor
	Mail City,St,Zip:	Yonkers, NY 10701
	Attention:	Director of General Services
	Mail Phone:	(914) 377-6912
	Capacity:	1000
	Date Last Tested:	Not reported
	Next Test Date:	Not reported
	Category:	A
	Install Date:	Not reported
	Date Tank Was Closed:	Not reported
		'

Database(s)

EDR ID Number EPA ID Number

O108 ESE 1/4-1/2	OMS 22HHCIOISI 127 N BROADWA YONKERS, NY 10	· · · · · · · · · · · · · · · · · · ·	RCRA-SQG FINDS	1000100793 NYD981085632
1498 ft.				
Relative:	Site 3 of 4 in clust	er O		
Higher	RCRAInfo: Owner:	Not reported		

Actual:	EPA ID:	NYD981085632
105 ft.	Contact:	ROBERT CECCARELLI (914) 963-6670

Classification: Small Quantity Generator TSDF Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

O109 SE 1/4-1/2 1547 ft.	DIV.OF MILIT.& NAVAL AFF. QUINCY PLACE OFF RT.9 YONKERS, NY		NY LTANKS NY HIST LTANKS	S100177905 N/A
	Site 4 of 4 in cluster O			
Relative: Higher	LTANKS: Site ID:	280930		
Actual:	Spill Date:	02/19/92		
105 ft.	Facility Addr2:	Not reported		
	Facility ID:	9111897		
	Program Number:	9111897		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept:	02/19/92		
	CID:	Not reported		
	Spill Cause:	Tank Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Notifier:	Other		
	Cleanup Ceased:	02/21/92		
	Cleanup Meets Standard:			
	Last Inspection:	02/21/92		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Not reported		
	Spill Closed Dt:	03/10/92		
	Remediation Phase:	0		
	Date Entered In Computer	: 02/25/92		

Database(s)

EDR ID Number EPA ID Number

DIV.OF MILIT.& NAVAL AFF. (Continued)

Spill Record Last Update: 03/10/92 Not reported Spille Namer: Spiller Company: SAME () 963-6670 Spiller Phone: Spiller Extention: Not reported Spiller Address: Not reported Spiller City, St, Zip: ΖZ Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 Program Number: 9111897 **DER Facility ID:** 228124 Site ID: 280930 Operable Unit ID: 965532 Operable Unit: 01 Material ID: 416901 Material Code: 0001 #2 Fuel Oil Material Name: Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Not reported Recovered: 0.00 **Resource Affected:** Soil Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported Start CallerRemark - 9111897 DISCOVERED SOIL WHILE REMOVING 1K U/G TANK PLAN TO **DEC Remarks:** STOCKPILE SOIL END CallerRemark - 9111897 Start DECRemark - 9111897 Prior to Sept, 2004 data translation this spill Lead Remark: DEC Field was "GHIOSAY" END DECRemark - 9111897 HIST LTANKS: Region of Spill: 3 Spill Number: 9111897 GHIOSAY Investigator: Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 02/19/1992 Spill Time: 15:50 Reported to Department Date: 02/19/92

Database(s)

EDR ID Number EPA ID Number

Reported to Department Time: 16:03 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: SAME Spiller Address: Not reported Spiller City,St,Zip: Not reported Facility Contact: Not reported Facility Phone: () 963-6670 Facility Extention: Not reported Spill Cause: Tank Failure **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Other Non Commercial/Industrial Spill Notifier: Other PBS Number: Not reported **Cleanup Ceased:** 02/21/92 Cleanup Meets Standard: True 02/21/92 Last Inspection: Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 03/10/92 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 02/25/92 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 03/10/92 Is Updated: False PBS Number: Not reported Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207 DEC Remarks: Not reported Spill Cause: DISCOVERED SOIL WHILE REMOVING 1K U/G TANK PLAN TO STOCKPILE SOIL

S100177905

Database(s)

EDR ID Number EPA ID Number

P110	COMMERCE MIDDLE SCHOOL		NY UST	U003884148
East	190 NORTH BROADWAY			N/A
1/4-1/2	YONKERS, NY 10701			
1619 ft.				
	Site 1 of 3 in cluster P			
Relative:	UST:			
Higher	PBS Number:	3-800880		
Actual:	Tank Number:	02		
137 ft.	Tank Status:	In Service		
	Capacity:	10000 INSTALL DATE 08/01/2000		
	Pipe Location:	Not reported		
	Pipe Type:	Steel/Iron		
	2nd Containment:	Vault		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Underground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	Fiberglass Liner (RFP)		
	Tank External Protection:	None		
	Date Last Tested / Next Test:			
	Date Tank Closed / Category:			
	Leak Detection:	In-Tank System		
	Overfill Protection:	Product Level Gauge		
	Dispenser Method:	Suction Not reported		
	Facility Addr2: Swiscode:	Not reported		
	Operator:	Not reported Yonkers Public Schools		
	Phone:	(914) 376-8010		
	In-service Capacity:	10000		
	Site Status:	Administratively Closed		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	1		
	Old Pbs Number:	3-494011		
	Last Inspected:	02/01/2005		
	Emergency Name:	Sonitrol		
	Emergency Phone:	(914) 667-4900		
	Owner Name: Owner Address:	Yonkers Public Schools One Larkin Plaza		
	Owner Phone:	(914) 376-8010		
	Owner Type:	LOCAL GOVERNMENT		
	Owner City,St,Zip:	Yonkers, NY 10701-		
	Mail Company:	Yonkers Public Schools		
	Mail Address:	One Larkin Plaza		
	Mail Address:	Not reported		
	Mail City,St,Zip:	Yonkers, NY 10701-		
	Attention:	Paul E Houle		
	Mail Phone:	(914) 376-8010		
	Capacity:	10000		
	Date Last Tested:	Not reported		
	Next Test Date:	8/1/2010		
	Category:	Not reported		
	Install Date:	08/01/2000		

Database(s)

EDR ID Number EPA ID Number

Lievation	Sile		Dalabase(s)	
	COMMERCE MIDDLE SCHOOL	(Continued)		U003884148
		. ,		0003004140
	Date Tank Was Closed:	Not reported		
111	+		NY LTANKS	S106971548
SE	87 NORTH BROADWAY			N/A
1/4-1/2 1623 ft.	YONKERS, NY			
1023 11.				
Relative:	LTANKS:			
Higher	Site ID:	333537		
A	Spill Date:	11/05/04		
Actual: 84 ft.	Facility Addr2:	Not reported		
04 11.	Facility ID:	0408646		
	Program Number: SWIS:	0408646 6018		
	Region of Spill:	3		
	Investigator:	JBODee		
	Referred To:	Not reported		
	Reported to Dept:	11/05/04		
	CID:	17		
	Spill Cause:	Tank Overfill		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Other		
	Cleanup Ceased:			
	Cleanup Meets Standard:	True		
	Last Inspection:			
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement: Spill Class:	False Known release with minimal potential for fire or hazard. DE	C Boononao Willi	ina
	Spill Class.	Responsible Party. Corrective action taken.	.c Response. will	ing
	Spill Closed Dt:	03/05/05		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spille Namer:	REALTY OFFICE		
	Spiller Company:	Not reported		
	Spiller Phone:	(516) 766-7676		
	Spiller Extention:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	***Update***, ZZ		
	Spiller County:			
	Spiller Contact:	REALTY OFFICE		
	Spiller Phone:	(516) 766-7676		
	Spiller Extention: DEC Region:	Not reported 3		
	Program Number:	0408646		
	DER Facility ID:	268766		
	Site ID:	333537		
	Operable Unit ID:	1095691		
	Operable Unit:	01		
	Material ID:	575818		
	Material Code:	0001		
	Material Name:	#2 Fuel Oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	3.00		
	Units:	Gallons		
	Recovered:	0.00		

Map ID		MAP FINDINGS		
Direction Distance Distance (ft. Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	+ (Continued)			S106971548
	Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks:	Soil False Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Start CallerRemark - 0408646 THE FILL BOX JUMPE WAS PLACED DOWN AND IT ALSO WENT IN A PA CallerRemark - 0408646		
	Remark:	Start DECRemark - 0408646 3/5/05 overfill to surface 0408646	eclose END DECRema	ark -
Q112	INDUSTRIAL PARK AT YO	NKERS	NY AST	A100252327
SSE	28 WELLS AVENUE			N/A

L.

SSE 1/4-1/2 1660 ft.	28 WELLS AVENUE YONKERS, NY 10701			N/A	
	Site 1 of 2 in cluster Q				
Relative: Higher	AST:	0.407400			
Relative: Higher Actual: 39 ft.		9/30/2002 CATEGORY None Product Level Gauge Suction Not reported 5518 Adam Inglis (914)403-4241 8000 Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks	s exists or r	not	
	Expire Date: CBS Number: Spdes Number:	Not reported Not reported Not reported Not reported			
	Lat/Long: Site Type: Number Of Active Tanks: Old Pbs Number:	Not reported Not reported 1 Not reported			

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Last Inspected: Not reported **Emergency Name:** Adam Inglis Emergency Phone: (914) 403-4241 Owner Name: Hudson View Associates LLC **Owner Address:** 485 West Putnam Avenue **Owner Phone:** (203) 661-0055 CORPORATE/COMMERCIAL Owner Type: Owner City,St,Zip: Greenwich, CT 06830 Mail Company: Hudson View Associates LLC Mail Address: 28 Wells Avenue Mail Address: Not reported Yonkers, NY 10701 Mail City, St, Zip: Attention: Adam Inglis Mail Phone: (914) 403-4241 Capacity: 75000 Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Install Date: 01/01/1972 Date Tank Was Closed: Not reported PBS Number: 3-487163 Tank Number: 3 Tank Status: Closed prior to 04/91 (it is either in place or removed) Capacity: 600 INSTALL DATE 01/02/1999 Pipe Location: Not reported Pipe Type: Steel/Iron 2nd Containment: None Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Aboveground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE CATEGORY Date Tank Closed / Category: Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Adam Inglis Phone: (914)403-4241 In-service Capacity: 8000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Not reported Spdes Number: Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: Old Pbs Number: Not reported Last Inspected: Not reported Emergency Name: Adam Inglis **Emergency Phone:** (914) 403-4241

A100252327

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

A100252327 **Owner Name:** Hudson View Associates LLC Owner Address: 485 West Putnam Avenue (203) 661-0055 Owner Phone: CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: Greenwich, CT 06830 Mail Company: Hudson View Associates LLC Mail Address: 28 Wells Avenue Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Attention: Adam Inglis Mail Phone: (914) 403-4241 600 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported Install Date: 01/02/1999 Date Tank Was Closed: Not reported PBS Number: 3-487163 Tank Number: 4 Tank Status: Closed prior to 04/91 (it is either in place or removed) 1100 INSTALL DATE 01/07/1999 Capacity: Not reported Pipe Location: Pipe Type: Steel/Iron 2nd Containment: None Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Aboveground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: Adam Inglis Phone: (914)403-4241 8000 In-service Capacity: Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: Not reported CBS Number: Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 1 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name:** Adam Inglis **Emergency Phone:** (914) 403-4241 Owner Name: Hudson View Associates LLC Owner Address: 485 West Putnam Avenue Owner Phone: (203) 661-0055

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Owner Type: CORPORATE/COMMERCIAL Owner City,St,Zip: Greenwich, CT 06830 Mail Company: Hudson View Associates LLC Mail Address: 28 Wells Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701 Adam Inglis Attention: Mail Phone: (914) 403-4241 1100 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: 01/07/1999 Install Date: Date Tank Was Closed: Not reported PBS Number: 3-487163 Tank Number: 5 Closed prior to 04/91 (it is either in place or removed) Tank Status: Capacity: 1300 INSTALL DATE 01/07/1999 Pipe Location: Not reported Pipe Type: Steel/Iron 2nd Containment: None Product: Nos. 1. 2 or 4 Fuel Oil Tank Location: Aboveground: 10% or more below ground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Adam Inglis Operator: Phone: (914)403-4241 In-service Capacity: 8000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 1 Old Pbs Number: Not reported Last Inspected: Not reported Adam Inglis **Emergency Name: Emergency Phone:** (914) 403-4241 **Owner Name:** Hudson View Associates LLC **Owner Address:** 485 West Putnam Avenue **Owner Phone:** (203) 661-0055 CORPORATE/COMMERCIAL Owner Type: Owner City,St,Zip: Greenwich, CT 06830 Mail Company: Hudson View Associates LLC

A100252327

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

Mail Address: 28 Wells Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701 Attention: Adam Inglis Mail Phone: (914) 403-4241 1300 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: Install Date: 01/07/1999 Date Tank Was Closed: Not reported PBS Number: 3-487163 Tank Number: 003 Tank Status: In Service Capacity: 8000 INSTALL DATE 06/01/2002 Aboveground Pipe Location: Pipe Type: Steel/Iron 2nd Containment: Vault Nos. 1, 2 or 4 Fuel Oil Product: Tank Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: Concrete Pad w/ Channels **Overfill Protection:** Vent Whistle Suction **Dispenser Method:** Facility Addr2: Not reported Swiscode: 5518 Operator: Adam Inglis (914)403-4241 Phone: 8000 In-service Capacity: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Site Status: Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 1 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name:** Adam Inglis **Emergency Phone:** (914) 403-4241 **Owner Name:** Hudson View Associates LLC Owner Address: 485 West Putnam Avenue **Owner Phone:** (203) 661-0055 CORPORATE/COMMERCIAL Owner Type: Owner City, St, Zip: Greenwich, CT 06830 Mail Company: Hudson View Associates LLC Mail Address: 28 Wells Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701

A100252327

Map ID	
Direction	
Distance	
Distance (f	t.)
Elevation	Site

Database(s)

EDR ID Number EPA ID Number

A100252327

NY AST A100252323

N/A

Capacity: 8000 Date Last Tested: Not reported Next Test Date: Not reported Category: Not reported

INDUSTRIAL PARK AT YONKERS (Continued)

Adam Inglis (914) 403-4241

06/01/2002

Not reported

Category: Install Date: Date Tank Was Closed:

Attention:

Mail Phone:

N113H.V.N.H. REGENCY EXTENDED CARE CENTERESE65 ASHBURTON AVENUE1/4-1/2YONKERS, NY 10701

1/4-1/2 YON 1661 ft.

Relative: Higher

•	
Actual:	

143 ft.

Site 6 of 6 in cluster N	
AST:	
PBS Number:	3-600679
Tank Number:	001
Tank Status:	In Service
Capacity:	20000 INSTALL DATE
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
2nd Containment:	Vault
Product:	Nos. 1. 2 or 4 Fuel Oil
Tank Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Internal Protection:	None
Pipe External Protection:	Painted/Asphalt Coating
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	Painted/Asphalt Coating
Date Last Tested / Next Test:	
Date Tank Closed / Category:	
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	Alex Kotlyar
Phone:	(914) 963-4000
In-service Capacity:	20000
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	1
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	E. Chaskelson
Emergency Phone:	(718) 436-9193
Owner Name:	Michael Melnicke
Owner Address:	1632 51st Street
Owner Phone:	(718) 436-9198
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	Brooklyn, NY 11219
Mail Company:	Regency Extended Care Center

H.V.N.H. REGENCY EXTENDED CARE CENTER (Continued)

Mail Address: Mail Address: Mail City,St,Zip: Attention: Mail Phone: Capacity: Date Last Tested: Next Test Date: Category: Install Date: Date Tank Was Closed: 65 Ashburton Avenue Not reported Yonkers, NY 10701 Eli Chaskelson (914) 963-4000 20000 Not reported Not reported Not reported Not reported Not reported

P114 **DINO'S GAS CENTER INC.** East 200 SOUTH BROADWAY

1/4-1/2 YONKERS, NY 10701

1668 ft.

Relative: Higher

Actual: 144 ft.

UST:	
PBS Number:	3-502308
Tank Number:	1
Tank Status:	Closed-Removed
Capacity:	4000 INSTALL DATE 01/01/1975
Pipe Location:	Not reported
Pipe Type:	Galvanized Steel
2nd Containment:	None
Product:	Unleaded Gasoline
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	None
Date Last Tested / Next Test:	10/1/1994 NEXT TEST DATE
Date Tank Closed / Category:	7/27/1999 CATEGORY A
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	T&S Gas Center, Inc.
Phone:	(914)375-1327
In-service Capacity:	12000
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Tony Chousa
Emergency Phone:	(914) 589-1795
Owner Name:	Not reported
Owner Address:	Not reported
Owner Phone:	Not reported

Database(s)

A100252323

EDR ID Number

EPA ID Number

NY UST U003884222 N/A

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

U003884222

TC1784877.2s Page 242

DINO'S GAS CENTER INC. (Continued)

Owner Type: Not reported Owner City,St,Zip: Not reported Mail Company: Gasway Mail Address: 200 South Broadway Mail Address: Not reported Yonkers, NY 10701 Mail City, St, Zip: Attention: Tony/Scott (914) 375-1327 Mail Phone: 4000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: 01/01/1975 Install Date: Date Tank Was Closed: Not reported PBS Number: 3-502308 Tank Number: 2 Tank Status: Closed-Removed Capacity: 4000 INSTALL DATE 01/01/1975 Pipe Location: Not reported Pipe Type: Galvanized Steel 2nd Containment: None Product: Unleaded Gasoline Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 10/1/1994 NEXT TEST DATE Date Tank Closed / Category: 7/27/1999 CATEGORY A Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Facility Addr2: Not reported Swiscode: 5518 Operator: T&S Gas Center, Inc. Phone: (914)375-1327 In-service Capacity: 12000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Not reported Spdes Number: Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: Not reported Last Inspected: Not reported Emergency Name: Tony Chousa (914) 589-1795 **Emergency Phone: Owner Name:** Not reported **Owner Address:** Not reported Owner Phone: Not reported Owner Type: Not reported Owner City,St,Zip: Not reported Mail Company: Gasway

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

DINO'S GAS CENTER INC. (Continued)

Mail Address: 200 South Broadway Mail Address: Not reported Yonkers, NY 10701 Mail City,St,Zip: Attention: Tony/Scott Mail Phone: (914) 375-1327 4000 Capacity: Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: Install Date: 01/01/1975 Date Tank Was Closed: Not reported PBS Number: 3-502308 Tank Number: 3 Tank Status: Closed-Removed Capacity: 2000 INSTALL DATE 01/01/1975 Pipe Location: Not reported Pipe Type: Galvanized Steel 2nd Containment: None Product: Diesel Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 10/1/1994 NEXT TEST DATE Date Tank Closed / Category: 7/27/1999 CATEGORY A Leak Detection: None **Overfill Protection:** None Dispenser Method: Suction Facility Addr2: Not reported Swiscode: 5518 Operator: T&S Gas Center, Inc. (914)375-1327 Phone: 12000 In-service Capacity: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Site Status: Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name:** Tony Chousa (914) 589-1795 **Emergency Phone: Owner Name:** Not reported Owner Address: Not reported **Owner Phone:** Not reported Owner Type: Not reported Owner City, St, Zip: Not reported Mail Company: Gasway Mail Address: 200 South Broadway Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701

Database(s)

EDR ID Number EPA ID Number

U003884222

Attention:	Tony/Scott
Mail Phone:	(914) 375-1327
Capacity:	2000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	01/01/1975
Date Tank Was Closed:	Not reported
PBS Number:	3-502308
Tank Number:	4
Tank Status:	Closed-Removed
Capacity:	1000 INSTALL DATE 01/01/1975
Pipe Location:	Not reported
Pipe Type:	Galvanized Steel
2nd Containment:	None
Product:	Diesel
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	None
Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	None
Tank External Protection:	None
Date Last Tested / Next Test:	11/1/1989 NEXT TEST DATE
Date Tank Closed / Category:	7/27/1999 CATEGORY A
Leak Detection:	None
Overfill Protection:	None
Dispenser Method:	Suction
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	T&S Gas Center, Inc.
Phone:	(914)375-1327
In-service Capacity:	12000
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Tony Chousa
Emergency Phone:	(914) 589-1795
Owner Name:	Not reported
Owner Address:	Not reported
Owner Phone:	Not reported
Owner Type:	Not reported
Owner City,St,Zip:	Not reported
Mail Company:	Gasway
Mail Address:	200 South Broadway
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10701
Attention:	Tony/Scott
Mail Phone:	(914) 375-1327
Capacity:	1000

Database(s)

EDR ID Number EPA ID Number

U003884222

DINO'S GAS CENTER INC. (Continued)

C	O'S GAS CENTER INC. (Conti	inued)	U0
	Date Last Tested:	Not reported	
	Next Test Date:	Not reported	
	Category:	Not reported	
	Install Date:	01/01/1975	
	Date Tank Was Closed:	Not reported	
	PBS Number:	3-502308	
	Tank Number:	5	
	Tank Status:	In Service	
	Capacity:	4000 INSTALL DATE 07/01/1999	
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle	
	Pipe Type:	Fiberglass (FRP)	
	2nd Containment:	Double-Walled Tank	
	Product:	Leaded Gasoline	
	Tank Location:	Underground	
	Pipe Internal Protection:	None	
	Pipe External Protection:	Other, Fiberglass	
	Tank Type:	Fiberglass Coated Steel	
	Tank Internal Protection:	None	
	Tank External Protection:	Fiberglass	
	Date Last Tested / Next Test:		
	Date Tank Closed / Category:		
	Leak Detection:	Interstitial Monitoring	
	Overfill Protection:	Catch Basin, Automatic Shut-off	
	Dispenser Method:	Submersible	
	Facility Addr2:	Not reported	
	Swiscode:	5518 TRS Con Contor Inc.	
	Operator:	T&S Gas Center, Inc.	
	Phone:	(914)375-1327	
	In-service Capacity: Site Status:	12000 Active PPS: > 1100 col PPS, regardless if subpart 260, 14 tanks eviate or a	aat
	Certification Date:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or n Not reported	iot
	Expire Date:	Not reported	
	CBS Number:	Not reported	
	Spdes Number:	Not reported	
	Lat/Long:	Not reported	
	Site Type:	Not reported	
	Number Of Active Tanks:	4	
	Old Pbs Number:	Not reported	
	Last Inspected:	Not reported	
	Emergency Name:	Tony Chousa	
	Emergency Phone:	(914) 589-1795	
	Owner Name:	Not reported	
	Owner Address:	Not reported	
	Owner Phone:	Not reported	
	Owner Type:	Not reported	
	Owner City,St,Zip:	Not reported	
	Mail Company:	Gasway	
	Mail Address:	200 South Broadway	
	Mail Address:	Not reported	
	Mail City,St,Zip:	Yonkers, NY 10701	
	Attention:	Tony/Scott	
	Mail Phone:	(914) 375-1327	
	Capacity:	4000	
	Date Last Tested:	7/1/1999	
	Next Test Date:	Not reported	
	Category:	Not reported	

Database(s)

EDR ID Number EPA ID Number

U003884222

DINO'S GAS CENTER INC. (Continued)

Install Date: 07/01/1999 Date Tank Was Closed: Not reported PBS Number: 3-502308 Tank Number: 6 Tank Status: In Service Capacity: 4000 INSTALL DATE 07/01/1999 Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Fiberglass (FRP) Pipe Type: 2nd Containment: Double-Walled Tank Product: Leaded Gasoline Underground Tank Location: Pipe Internal Protection: None Pipe External Protection: Other, Fiberglass Tank Type: Fiberglass Coated Steel Tank Internal Protection: None Tank External Protection: Fiberglass Date Last Tested / Next Test: 7/1/1999 NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: Interstitial Monitoring **Overfill Protection:** Catch Basin, Automatic Shut-off Dispenser Method: Submersible Facility Addr2: Not reported Swiscode: 5518 Operator: T&S Gas Center, Inc. Phone: (914)375-1327 12000 In-service Capacity: Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 4 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name: Tony Chousa** (914) 589-1795 **Emergency Phone: Owner Name:** Not reported Owner Address: Not reported Not reported **Owner Phone:** Owner Type: Not reported Not reported Owner City, St, Zip: Mail Company: Gasway Mail Address: 200 South Broadway Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10701 Attention: Tony/Scott Mail Phone: (914) 375-1327 4000 Capacity: Date Last Tested: 7/1/1999 Not reported Next Test Date: Category: Not reported 07/01/1999 Install Date: Date Tank Was Closed: Not reported

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

DINO'S GAS CENTER INC. (Continued)

U003884222

, ,	
PBS Number:	3-502308
Tank Number:	7
Tank Status:	In Service
Capacity:	2000 INSTALL DATE 07/01/1999
Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Type:	Fiberglass (FRP)
2nd Containment:	Double-Walled Tank
Product:	Leaded Gasoline
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	Other, Fiberglass
Tank Type:	Fiberglass Coated Steel
Tank Internal Protection:	None
Tank External Protection:	
Date Last Tested / Next Test:	
Date Tank Closed / Category:	
Leak Detection:	Interstitial Monitoring
Overfill Protection:	Catch Basin, Automatic Shut-off
Dispenser Method:	Submersible
Facility Addr2:	Not reported
Swiscode:	5518 TRS Con Conter Inc.
Operator:	T&S Gas Center, Inc.
Phone:	(914)375-1327
In-service Capacity: Site Status:	12000 Active PRS: > 1100 col, PRS, regardless if subpart 260, 14 tanks eviate or pot
Certification Date:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
	Not reported
Expire Date: CBS Number:	Not reported
	Not reported
Spdes Number:	Not reported
Lat/Long: Site Type:	Not reported
Site Type: Number Of Active Tanks:	Not reported 4
Old Pbs Number:	A Not reported
Last Inspected:	Not reported
Emergency Name:	Tony Chousa
Emergency Phone:	(914) 589-1795
Owner Name:	Not reported
Owner Address:	Not reported
Owner Phone:	Not reported
Owner Type:	Not reported
Owner City,St,Zip:	Not reported
Mail Company:	Gasway
Mail Address:	200 South Broadway
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10701
Attention:	Tony/Scott
Mail Phone:	(914) 375-1327
Capacity:	2000
Date Last Tested:	7/1/1999
Next Test Date:	Not reported
Category:	Not reported
Install Date:	07/01/1999
Date Tank Was Closed:	Not reported
PBS Number:	3-502308
Tank Number:	8
Tank Status:	In Service

Database(s)

EDR ID Number EPA ID Number

DINO'S GAS CENTER INC. (Continued)

U003884222

•	
Capacity:	2000 INSTALL DATE 07/01/1999
Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle
Pipe Type:	Fiberglass (FRP)
2nd Containment:	Double-Walled Tank
Product:	Diesel
Tank Location:	Underground
Pipe Internal Protection:	None
Pipe External Protection:	Other, Fiberglass
Tank Type:	Fiberglass Coated Steel
Tank Internal Protection:	None
Tank External Protection:	Fiberglass
Date Last Tested / Next Test:	-
Date Tank Closed / Category:	
Leak Detection:	Interstitial Monitoring
Overfill Protection:	Catch Basin, Automatic Shut-off
Dispenser Method:	Submersible
Facility Addr2:	Not reported
Swiscode:	5518
Operator:	T&S Gas Center, Inc.
Phone:	(914)375-1327
In-service Capacity:	12000
Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
Certification Date:	Not reported
Expire Date:	Not reported
CBS Number:	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type:	Not reported
Number Of Active Tanks:	4
Old Pbs Number:	Not reported
Last Inspected:	Not reported
Emergency Name:	Tony Chousa
Emergency Phone:	(914) 589-1795
Owner Name:	Not reported
Owner Address:	Not reported
Owner Phone:	Not reported
Owner Type:	Not reported
Owner City,St,Zip:	Not reported
Mail Company:	Gasway
Mail Address:	200 South Broadway
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10701
Attention:	Tony/Scott
Mail Phone:	(914) 375-1327
Capacity:	2000
Date Last Tested:	7/1/1999
Next Test Date:	Not reported
Category:	Not reported
Install Date:	07/01/1999
Date Tank Was Closed:	Not reported

EDR ID Number Database(s) **EPA ID Number** 115 **BICC CABLES CORPORATION SITE** RCRA-LQG 1000279734 North FOOT OF POINT ST NY MANIFEST NYD064308240 YONKERS, NY 10701 **CT MANIFEST** 1/4-1/2 1670 ft. RCRAInfo: **Relative:** Owner: DIVISION OF PHELPS DODGE INDUSTRIES Lower (212) 555-1212 EPA ID: Actual: NYD064308240 6 ft. Contact: Not reported Classification: Large Quantity Generator **TSDF** Activities: Not reported Violation Status: Violations exist **Regulation Violated:** Not reported GENERATOR-ALL REQUIREMENTS (OVERSIGHT) Area of Violation: Date Violation Determined: 03/11/1986 Actual Date Achieved Compliance: 06/09/1986 **Enforcement Action:** WRITTEN INFORMAL Enforcement Action Date: 04/15/1986 Penalty Type: Not reported There are 1 violation record(s) reported at this site: Date of Evaluation Area of Violation Compliance GENERATOR-ALL REQUIREMENTS (OVERSIGHT) **Compliance Evaluation Inspection** 19860609 NY MANIFEST: Document ID: NYG4718826 Manifest Status: Not reported NY0000182675 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 02/10/2006 Trans1 Recv Date: 02/10/2006 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/15/2006 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD064308240 Trans1 EPA ID: NY68492JR Trans2 EPA ID: Not reported TSDF ID: NYD082785429 Waste Code: D001 - NON-LISTED IGNITABLE WASTES Quantity: 00020 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. 01.00 Specific Gravity: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Quantity: 00125 Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Waste Code: D002 - NON-LISTED CORROSIVE WASTES Quantity: 00022

Units:

Units:

Year:

EPA ID:

Country:

County:

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

BICC CABLES CORPORATION SITE (Continued)

P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Waste Code: D002 - NON-LISTED CORROSIVE WASTES 00001 Quantity: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) T Chemical, physical, or biological treatment. Handling Method: Specific Gravity: 01.00 06 Facility Type: Generator NYD064308240 Facility Name: BICCCABLES Facility Address: **1 POINT STREET** Facility City: YONKERS Facility Zip 4: Not reported Not reported WESTCHESTER Mailing Name: BLACKACRES PARTNERS OPS LLC Mailing Contact: DEBRA ROTHBERG Mailing Address: **1 POINT STREET** Mailing City: YONKERS Mailing State: NY Mailing Zip: 10701 Mailing Zip4: Not reported Mailing Country: USA Mailing Phone: 914-963-8200

Click this hyperlink while viewing on your computer to access 70 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST: Year:

2001 Manifest ID: CTF0824008 CT5000001495 TSDF EPA ID: NORTHEAST LAMP RECYCLING INC TSDF Name: **TSDF** Address: 250 MAIN ST TSDF City,St,Zip: EAST WINDSOR, CT 06088 **TSDF** Country: USA **TSDF** Telephone: Not reported Transport Date: 09/28/01 Transporter EPA ID: CTD983896341 WASTE MGMT NEW ENGLAND ENV TRANSPORT INC Transporter Name: Transporter Country: USA Not reported Transporter Phone: Trans 2 Date: 11 Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: СТ Trans 2 Country: USA Trans 2 Phone: Not reported Generator EPA ID: NYD064308240 9149638200 Gererator Phone:

1000279734

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000279734

BICC CABLES CORPORATION SITE (Continued)

Generator Address: Not reported Generator City,State,Zip: Not reported Generator Country: Not reported Special Handling: Not reported Discrepancies: Yes Date Shipped: 09/28/01 Date Received: 10/02/01 Last modified date: 04/27/04 Last modified by: IG Comments: Not reported

Click this hyperlink while viewing on your computer to access 3 additional CT MANIFEST: record(s) in the EDR Site Report.

116 NE 1/4-1/2 1689 ft.	WATERVIEW 28 LAMARTINE TERRACE YONKERS, NY 10701	N	IY UST	U003995044 N/A
	UST:			
Relative:	PBS Number:	3-600464		
Higher	Tank Number:	1		
Actual:	Tank Status:	In Service		
113 ft.	Capacity:	7500 INSTALL DATE 01/01/1963		
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:	Steel/Iron		
	2nd Containment:	Vault		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Underground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	None		
		9/16/2004 NEXT TEST DATE 9/16/2005		
	Date Tank Closed / Category:			
	Leak Detection:	None		
	Overfill Protection:	Product Level Gauge		
	Dispenser Method:	Not reported		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	Rafael Jose		
	Phone:	(914)968-3277		
	In-service Capacity:	7500		
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks e	exists or no	ot
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number: Lat/Long:	Not reported Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	1		
	Old Pbs Number:	Not reported		
	Last Inspected:	06/15/2004		
	Emergency Name:	Stephen Bolduc		
	Emergency Phone:	(914) 232-7898		
	Owner Name:	Not reported		
	Owner Address:	Not reported		

Map ID Direction Distance Distance (ft.) Elevation Site MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number**

U003995044

WATERVIEW (Continued)

Owner Phone: Not reported Not reported Owner Type: Owner City,St,Zip: Not reported Mail Company: JZG Resources Inc Mail Address: 84 Business Park Drive, Suite 103 Mail Address: Not reported Mail City, St, Zip: Armonk, NY 10504 Jerome Z. Ginsburg Attention: Mail Phone: (914) 273-5800 Capacity: 7500 Date Last Tested: Not reported Not reported Next Test Date: Category: А Install Date: 01/01/1963 Date Tank Was Closed: Not reported

WABCO Q117

SSE	15 WELLS AVE BLDG 7
1/4-1/2	YONKERS, NY 10701
1693 ft.	

Site 2 of 2 in cluster Q

Deletium			
Relative: Higher	RCRAInfo:		
0	Owner:	WABCO	
Actual:		(803) 439-5400	
36 ft.	EPA ID:	NYD982276925	
	Contact:	GARRICK MUNDY (914) 964-8422	
	Classification: TSDF Activities:	Small Quantity Generator Not reported	

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST: Document ID:

Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date:

CTF0436549 κ ILP188420 Not reported 960926 960926 Not reported 961003 961008 961022

FINDS NY MANIFEST **CT MANIFEST**

RCRA-SQG 1000418294 NYD982276925

Database(s)

EDR ID Number EPA ID Number

1000418294

WABCO (Continued)

Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Year: Facility Type: EPA ID: Facility Name: Facility Address: Facility City: Facility Zip 4: Country: County: Mailing Name: Mailing Contact: Mailing Address: Mailing City: Mailing State: Mailing Zip: Mailing Zip4: Mailing Country: Mailing Phone:

NYD982276925 ILD984908202 Not reported CTD001156009 D007 - CHROMIUM 5.0 MG/L TCLP 00230 P - Pounds 001 DM - Metal drums, barrels L Landfill. 100 96 Generator NYD982276925 WABCO 15 WELLS AVE YONKERS Not reported Not reported QUEENS WABCO GARRICK MUNDY 15 WELLS AVE YONKERS NY 10701 Not reported Not reported 914-964-6557

<u>Click this hyperlink</u> while viewing on your computer to access 13 additional NY MANIFEST: record(s) in the EDR Site Report.

CT MANIFEST:

1996 Year: Manifest ID: TSDF EPA ID: TSDF Name: **TSDF** Address: TSDF City,St,Zip: TSDF Country: USA **TSDF** Telephone: Transport Date: Transporter EPA ID: Transporter Name: Transporter Country: USA Transporter Phone: Trans 2 Date: 11 Trans 2 EPA ID: Trans 2 Name: Trans 2 Address: Trans 2 City, St, Zip: СТ USA Trans 2 Country: Trans 2 Phone: Generator EPA ID: Gererator Phone: Generator Address:

CTF0436467 CTD001156009 SAFETY-KLEEN SYSTEMS, INC. 39 COMMUNITY AVE EXT. PLAINFIELD, CT 06374 Not reported 04/09/96 ILD984908202 SAFETY-KLEEN SYSTEMS, INC. Not reported Not reported Not reported Not reported Not reported NYD982276925 9149648422 Not reported

Map ID	ſ	MAP FINDINGS		
Direction Distance	1			
Distance (ft.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	WABCO (Continued)			1000418294
	Generator City,State,Zip:	Not reported		
	Generator Country:	Not reported		
	Special Handling: Discrepancies:	Not reported Not reported		
	Date Shipped:	04/09/96		
	Date Received:	04/11/96		
	Last modified date:	04/26/04		
	Last modified by:	IG National and		
	Comments:	Not reported		
		is hyperlink while viewing on your computer to access onal CT MANIFEST: record(s) in the EDR Site Report.		
P118	RESIDENTS		NY LTANKS	S104515444
East 1/4-1/2	199 NORTH BROADWAY YONKERS, NY		NY HIST LTANKS	N/A
1701 ft.	TONKERS, NT			
Relative:	Site 3 of 3 in cluster P			
Higher	LTANKS:			
-	Site ID:	124898		
Actual: 147 ft.	Spill Date:	04/05/99		
147 11.	Facility Addr2: Facility ID:	Not reported 9900167		
	Program Number:	9900167		
	SWIS:	6000		
	Region of Spill:	3		
	Investigator:	jbodee		
	Referred To: Reported to Dept:	Not reported 04/05/99		
	CID:	17		
	Spill Cause:	Tank Failure		
	Water Affected:	Not reported		
	Spill Source:	Private Dwelling		
	Spill Notifier: Cleanup Ceased:	Other / /		
	Cleanup Ceased. Cleanup Meets Standard:	7 7 True		
	Last Inspection:	//		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard Responsible Party. Corrective action taken. 04/06/99	d. DEC Response. Willin	ng
	Spill Closed Dt: Remediation Phase:	04/08/99		
	Date Entered In Computer			
	Spill Record Last Update:			
	Spille Namer:	N/A		
	Spiller Company:	GOSPEL MISSION HOME		
	Spiller Phone:	(914) 968-6577 Not reported		
	Spiller Extention: Spiller Address:	Not reported 100 NORTH BROADWAY		
	Spiller City,St,Zip:	YONKERS, NY 10701-		
	Spiller County:	001		
	Spiller Contact:	N/A		
	Spiller Phone:	(914) 968-6577		
	Spiller Extention:	Not reported		
	DEC Region: Program Number:	3 9900167		

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

RESIDENTS (Continued)		S104515444
DER Facility ID:	279591	
Site ID:	124898	
Operable Unit ID:	1075027	
Operable Unit:	01	
Material ID:	307309	
Material Code:	0001	
Material Name:	#2 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	5.00	
Units:	Gallons 5.00	
Recovered: Resource Affected:	Soil	
Oxygenate:	False	
Site ID:	Not reported	
Spill Tank Test:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate:	Not reported	
Gross Fail:	Not reported	
Modified By:	Not reported	
Last Modified:	Not reported	
Test Method:	Not reported	
DEC Remarks:	Start CallerRemark - 9900167 TANK FAILED 275 GALLON IN SIZE.THE	
	BOARDING HOUSE. DRY ALL PUT DOWN AND TANK WAS DECOMM	ISSIONED. END CallerRemark
Remark:	- 9900167 Start DECRemark - 9900167 Prior to Sept, 2004 data translation this spill	Lood
Remark.	DEC Field was "O'DEE" END DECRemark - 9900167	Leau
HIST LTANKS:		
Region of Spill:	3	
Spill Number:	9900167	
Investigator:	O'DEE	
Caller Name:	Not reported	
Caller Agency:	Not reported	
Caller Phone: Caller Extension:	Not reported	
Notifier Name:	Not reported Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Notifier Extension:	Not reported	
Spill Date:	04/05/1999	
Spill Time:	16:30	
Reported to Department	Date: 04/05/99	
Reported to Department	: Time: 17:56	
SWIS:	55	
Spiller Contact:	N/A	
Spiller Phone:	(914) 968-6577	
Spiller Extention:	Not reported	
Spiller Name:	GOSPEL MISSION HOME	
Spiller Address:		
Spiller City,St,Zip:	YONKERS, NY 10701- N/A	
Facility Contact: Facility Phone:	N/A (914) 968-6577	
Facility Extention:	Not reported	
Spill Cause:	Tank Failure	
ep 00000.		

RESIDENTS (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S104515444

Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard	True
Last Inspection:	11
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	11
Investigation Complete:	11
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	04/06/99
Date Region Sent Summa	ary to Central Office: / /
Corrective Action Plan Su	ibmitted: / /
Date Spill Entered In Con	nputer Data File: 04/05/99
Time Spill Entered In Cor	nputer Data File: Not reported
Spill Record Last Update	05/03/99
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	5
Unkonwn Quantity Spilled	I: False
Units:	Gallons
Quantity Recovered:	5
Unkonwn Quantity Recov	
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In F	
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: Not rep	
	FAILED 275 GALLON IN SIZE. THE PLACE IS A BOARDING HOUSE. DRY ALL PUT DOWN
AND T	ANK WAS DECOMMISSIONED.

R119 ENE 1/4-1/2 1787 ft.	HUDSON HILLS 222-250 NORTH BROADWAY YONKERS, NY 10701		NY UST	U003949605 N/A
	Site 1 of 3 in cluster R			
Relative: Higher	UST: PBS Number:	3-600029		
Actual: 149 ft.	Tank Number: Tank Status: Capacity: Pipe Location: Pipe Type: 2nd Containment: Product:	1 In Service 5000 INSTALL DATE Aboveground on saddles, legs, stilts, rack or cradle Copper None Nos. 1, 2 or 4 Fuel Oil		

Database(s)

EDR ID Number EPA ID Number

HUDSON HILLS (Continued)

U003949605

Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None 3/14/2004 NEXT TEST DATE 3/14/2005 Date Last Tested / Next Test: Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** Vent Whistle **Dispenser Method:** Gravity Facility Addr2: Not reported Swiscode: 5518 Operator: Ruben Berrios Phone: (914) 476-1298 11000 In-service Capacity: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Site Status: Certification Date: Not reported Expire Date: Not reported Not reported CBS Number: Spdes Number: Not reported Lat/Long: Not reported Not reported Site Type: Number Of Active Tanks: 2 Old Pbs Number: Not reported Last Inspected: 04/29/2005 **Emergency Name:** Annette Chisolm **Emergency Phone:** (914) 963-7400 **Owner Name:** Hudson Hills Tenants Corp. Owner Address: 222-250 North Broadway Owner Phone: (914) 963-7400 Owner Type: CORPORATE/COMMERCIAL Owner City, St, Zip: Yonkers, NY 10701 Mail Company: Prime Locations, Inc. Mail Address: 733 Yonkers Avenue Mail Address: Not reported Yonkers, NY 10704 Mail City, St, Zip: Attention: Annette Chisolm Mail Phone: (914) 963-7400 Capacity: 5000 Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Not reported Install Date: Date Tank Was Closed: Not reported PBS Number: 3-600029 Tank Number: 2 Tank Status: In Service 6000 INSTALL DATE Capacity: Pipe Location: Aboveground on saddles, legs, stilts, rack or cradle Pipe Type: Copper 2nd Containment: Not reported Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Underground Pipe Internal Protection: None Pipe External Protection: None

Database(s)

EDR ID Number EPA ID Number

HUDSON HILLS (Continued)

U003949605

Tank Type:	Steel/Carbon Steel
Tank Internal Protection:	Other
Tank External Protection:	Wrapped(Piping)
Date Last Tested / Next Test:	
Date Tank Closed / Category:	
Leak Detection:	Other
Overfill Protection:	Vent Whistle
Dispenser Method:	
Facility Addr2:	Gravity Not reported
Swiscode:	5518
Operator:	Ruben Berrios
Phone:	(914) 476-1298
	11000
In-service Capacity: Site Status:	
Certification Date:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not
	Not reported
Expire Date: CBS Number:	Not reported
	Not reported
Spdes Number:	Not reported
Lat/Long:	Not reported
Site Type: Number Of Active Tanks:	Not reported 2
Old Pbs Number:	Not reported
Last Inspected:	04/29/2005
Emergency Name:	Annette Chisolm
Emergency Phone:	(914) 963-7400
Owner Name:	Hudson Hills Tenants Corp.
Owner Address:	222-250 North Broadway
Owner Phone:	(914) 963-7400
Owner Type:	CORPORATE/COMMERCIAL
Owner City,St,Zip:	Yonkers, NY 10701
Mail Company:	Prime Locations, Inc.
Mail Address:	733 Yonkers Avenue
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10704
Attention:	Annette Chisolm
Mail Phone:	(914) 963-7400
Capacity:	6000
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	Not reported
Date Tank Was Closed:	Not reported

120 MARTIN LUTHER KING SCHOOL ESE 115 LOCUST HILL AVE. 1/4-1/2 YONKERS, NY 10701

1818 ft.

Relative:	UST:	
Higher	PBS Number:	3-413445
5	Tank Number:	1
Actual:	Tank Status:	In Service
161 ft.	Capacity:	15000 INSTALL DATE 12/01/1968
	Pipe Location:	Not reported
	Pipe Type:	Steel/Iron
	2nd Containment:	None
	Product:	Nos. 1, 2 or 4 Fuel Oil
	Tank Location:	Underground

NY UST U003857021 N/A

Database(s)

EDR ID Number EPA ID Number

U003857021

Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: 11/5/2004 NEXT TEST DATE 11/5/2005 Date Tank Closed / Category: CATEGORY A Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Suction Not reported Facility Addr2: Swiscode: 5518 Yonkers Public Schools Operator: Phone: (914) 376-8008 In-service Capacity: 15000 Site Status: Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks exists or not Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 1 Old Pbs Number: Not reported Last Inspected: Not reported **Emergency Name:** Sonitrol **Emergency Phone:** (914) 667-4900 **Owner Name:** Yonkers Public Schools **Owner Address:** One Larkin Center Owner Phone: (914) 376-8008 LOCAL GOVERNMENT Owner Type: Owner City,St,Zip: Yonkers, NY 10701 Mail Company: Yonkers Public Schools Mail Address: One Larkin Center Mail Address: Not reported Mail City,St,Zip: Yonkers, NY 10701 Robert J. Comizio, Sr Attention: Mail Phone: (914) 376-8008 Capacity: 15000 Date Last Tested: Not reported Next Test Date: Not reported Category: А Install Date: 12/01/1968 Date Tank Was Closed: Not reported

121	GREYSTON FOUNDATION, INC.
NNE	55-57 RAVINE AVENUE
1/4-1/2	YONKERS, NY 10703
1864 ft.	

 Relative:
 AST:

 Higher
 PBS Number:

 Tank Number:
 Tank Number:

 Actual:
 Tank Status:

 36 ft.
 Capacity:

 Pipe Location:
 Pipe Type:

 2nd Containment:
 Participation

3-800433 001 Closed-Removed 2000 INSTALL DATE Aboveground: 10% or more below ground Copper Cut-off Walls NY AST A100276714 N/A

TC1784877.2s Page 259

Database(s)

EDR ID Number EPA ID Number

Product: Nos. 1, 2 or 4 Fuel Oil Aboveground: 10% or more below ground Tank Location: Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 3/29/2004 CATEGORY Leak Detection: None **Overfill Protection:** None **Dispenser Method:** Gravity Not reported Facility Addr2: Swiscode: Not reported Operator: Charles Lief Phone: (914) 376-3900 In-service Capacity: 0 Site Status: Unregulated; <1101 gal. PBS & no Subpart 360-14 Certification Date: Not reported Not reported Expire Date: CBS Number: Not reported Spdes Number: Not reported Not reported Lat/Long: Site Type: Not reported Number Of Active Tanks: 0 Old Pbs Number: Not reported Not reported Last Inspected: **Emergency Name:** Jim Beddia (914) 376-3903 Emergency Phone: **Owner Name:** Greyston Foundation Owner Address: 23 Park Avenue Owner Phone: (914) 376-3900 Owner Type: CORPORATE/COMMERCIAL Owner City, St, Zip: Yonkers, NY 10703-**Greyston Foundation** Mail Company: Mail Address: 23 Park Avenue Mail Address: Not reported Mail City, St, Zip: Yonkers, NY 10703-Attention: Not reported (914) 376-3903 Mail Phone: Capacity: 2000 Date Last Tested: Not reported Next Test Date: Not reported Not reported Category: Install Date: Not reported Date Tank Was Closed: Not reported

R122 WILLIAMS HOME ENE 229 NORTH BROADWAY 1/4-1/2 YONKERS, NY 1914 ft. Site 2 of 3 in cluster R Relative: LTANKS:

Higher	LIANKS.	
5	Site ID:	357809
Actual:	Spill Date:	01/09/06
157 ft.	Facility Addr2:	Not reported
	Facility ID:	0511619

NY LTANKS S107523337 N/A

A100276714

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S107523337

WILLIAMS HOME (Continued)

Program Number: 0511619 SWIS: 6018 Region of Spill: 3 Investigator: WCHD Referred To: WCDOH Reported to Dept: 01/09/06 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Tank Tester Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 **Remediation Phase:** 1 Date Entered In Computer: 01/09/06 Spill Record Last Update: 01/20/06 Spille Namer: MR JAMES WILLIAMS Spiller Company: WILLIAMS HOME Spiller Phone: (914) 963-9277 Not reported Spiller Extention: 229 NORTH BROADWAY Spiller Address: Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: MR JAMES WILLIAMS Spiller Phone: (914) 963-9277 Spiller Extention: Not reported DEC Region: 3 Program Number: 0511619 DER Facility ID: 307839 Site ID: 357809 Operable Unit ID: 1115082 **Operable Unit:** 01 2105131 Material ID: Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0.00 Gallons Units: 0.00 Recovered: **Resource Affected:** Groundwater Oxygenate: False Site ID: 357809 Spill Tank Test: 1103252 Tank Number: 1 Tank Size: 2000 Test Method: 03 Leak Rate: 0.00 Gross Fail: 0 Modified By: Watchdog Last Modified: 01/09/06

EDR ID Number Database(s) EPA ID Number

WILLIAMS HOME (Continued)

S107523337

 Test Method:
 Horner EZ Check I or II

 DEC Remarks:
 Start CallerRemark - 0511619 ISOLATION AND RETEST END CallerRemark - 0511619

 Remark:
 Start DECRemark - 0511619 YONKERS - IS CHRISTIAN ASSEMBLY SCHOOL. JAMES

 WILLIAMS MANAGER OF PROPERTY. FAILED TEST DONE AS A PART OF PBS REQUIREMENT; NO

 KNOWN IMPACTS AT THIS TIME; PLAN TO ISOLATE AND RETEST HOPEFULLY IN A WEEK OR

 SO. END DECRemark -0511619

R123 ENE 1/4-1/2 1914 ft.	YONKERS CHRISTIAN ASSEMBL 229 NORTH BROADWAY YONKERS, NY 10701	Y I	NY UST	U003995081 N/A
	Site 3 of 3 in cluster R			
Relative: Higher	UST:			
5	PBS Number:	3-800490		
Actual:	Tank Number:	001		
157 ft.	Tank Status:	In Service		
	Capacity:	2000 INSTALL DATE		
	Pipe Location:	Aboveground on saddles, legs, stilts, rack or cradle		
	Pipe Type:	Steel/Iron		
	2nd Containment:	None		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Underground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection: Tank External Protection:	None		
		1/10/2005 NEXT TEST DATE 1/10/2006		
	Date Tank Closed / Category:			
	Leak Detection:	None		
	Overfill Protection:	Product Level Gauge		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	Not reported		
	Operator:	James A. Williams		
	Phone:	(914) 963-9277		
	In-service Capacity:	2000		
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 tanks	exists or r	ot
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	1		
	Old Pbs Number:	Not reported		
	Last Inspected:	10/25/2004		
	Emergency Name:	James A Williams		
	Emergency Phone:	(914) 476-3166		
	Owner Name:	Yonkers Christian Assembly		
	Owner Address:	229 N. Broadway		
	Owner Phone:	(914) 963-9277 CORDODATE/COMMERCIAL		
	Owner Type:	CORPORATE/COMMERCIAL		
	Owner City,St,Zip:	Yonkers, NY 10701-		
	Mail Company: Mail Address:	Yonkers Christian Assembly 229 N. Broadway		
	Mail Address:	Not reported		
	Wait / Galegos.			

Map ID Direction		MAP FINDINGS		
Distance				
Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	YONKERS CHRISTIAN ASSEMBL	Y (Continued)		U003995081
	Mail City,St,Zip:	Yonkers, NY 10701-		
	Attention: Mail Phone:	Rev. James A. Williams (914) 963-9277		
	Capacity:	2000		
	Date Last Tested: Next Test Date:	Not reported Not reported		
	Category:	Not reported		
	Install Date:	Not reported		
	Date Tank Was Closed:	Not reported		
S124	V & T AUTO REPAIR		NY UST	U003858271
NNE 1/4-1/2	282 WARBURTON AVENUE YONKERS, NY 10701		NY AST	N/A
1952 ft.	TONKERS, NT TOTOT			
Relative:	Site 1 of 4 in cluster S			
Higher	UST: PBS Number:	3-800911		
Actual:	Tank Number:	1		
84 ft.	Tank Status:			
	Capacity: Pipe Location:	500 INSTALL DATE Aboveground		
	Pipe Type:	Copper		
	2nd Containment:	None		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location: Pipe Internal Protection:	Underground None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None Delate d'Asselutions		
	Tank External Protection: Date Last Tested / Next Test:	Painted/Asphalt Coating		
	Date Tank Closed / Category:			
	Leak Detection:	None		
	Overfill Protection:	Vent Whistle		
	Dispenser Method: Facility Addr2:	Suction Not reported		
	Swiscode:	Not reported		
	Operator:	V & T Auto Repair		
	Phone: In-service Capacity:	(914) 403-7124 1775		
	Site Status:	Subpart 360-14 only (active)		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number: Spdes Number:	Not reported Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	2 Not reported		
	Old Pbs Number: Last Inspected:	Not reported 06/10/2004		
	Emergency Name:	Hoyt Rogers		
	Emergency Phone:	(914) 403-7124		
	Owner Name: Owner Address:	Hoyt Rogers		
	Owner Address: Owner Phone:	28 Hughes Terrace (914) 423-6225		
	Owner Type:	Not reported		
	Owner City,St,Zip:	Yonkers, NY 10701-		

V & T AUTO REPAIR (Continued)

Mail Company:	Not reported
Mail Address:	28 Hughes Terrace
Mail Address:	Not reported
Mail City,St,Zip:	Yonkers, NY 10701-
Attention:	Hoyt Rogers
Mail Phone:	(914) 423-6225
Capacity:	500
Date Last Tested:	Not reported
Next Test Date:	Not reported
Category:	Not reported
Install Date:	Not reported
Date Tank Was Closed:	Not reported

AST:

PBS Number: 3-800911 Tank Number: 2 Tank Status: In Service Capacity: 275 INSTALL DATE Pipe Location: Aboveground Copper Pipe Type: 2nd Containment: None Product: Used Oil Tank Location: Aboveground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: Painted/Asphalt Coating Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: CATEGORY Leak Detection: None **Overfill Protection:** Product Level Gauge **Dispenser Method:** Suction Facility Addr2: Not reported Not reported Swiscode: Operator: V & T Auto Repair Phone: (914) 403-7124 In-service Capacity: 1775 Site Status: Subpart 360-14 only (active) Not reported Certification Date: Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Site Type: Not reported Number Of Active Tanks: 2 Old Pbs Number: Not reported 06/10/2004 Last Inspected: Hoyt Rogers **Emergency Name:** (914) 403-7124 **Emergency Phone: Owner Name:** Hoyt Rogers Owner Address: 28 Hughes Terrace Owner Phone: (914) 423-6225 Owner Type: Not reported Owner City,St,Zip: Yonkers, NY 10701-Mail Company: Not reported Mail Address: 28 Hughes Terrace

Database(s)

EDR ID Number EPA ID Number

U003858271

Database(s)

EDR ID Number EPA ID Number

V & T AUTO REPAIR (Continued)

Mail Address: Not reported Yonkers, NY 10701-Mail City, St, Zip: Attention: Hoyt Rogers Mail Phone: (914) 423-6225 275 Capacity: Date Last Tested: Not reported Not reported Next Test Date: Category: Not reported Install Date: Not reported Date Tank Was Closed: Not reported PBS Number: 3-800911 Tank Number: 3 Tank Status: Closed-Removed Capacity: 1000 INSTALL DATE Pipe Location: Not reported Pipe Type: None Not reported 2nd Containment: Product: Nos. 1, 2 or 4 Fuel Oil Tank Location: Aboveground Pipe Internal Protection: None Pipe External Protection: None Tank Type: Steel/Carbon Steel Tank Internal Protection: None Tank External Protection: None Date Last Tested / Next Test: NEXT TEST DATE Date Tank Closed / Category: 4/15/2005 CATEGORY Leak Detection: None **Overfill Protection:** None Not reported **Dispenser Method:** Not reported Facility Addr2: Swiscode: Not reported Operator: V & T Auto Repair Phone: (914) 403-7124 In-service Capacity: 1775 Subpart 360-14 only (active) Site Status: Certification Date: Not reported Expire Date: Not reported CBS Number: Not reported Spdes Number: Not reported Lat/Long: Not reported Not reported Site Type: Number Of Active Tanks: 2 Old Pbs Number: Not reported Last Inspected: 06/10/2004 **Emergency Name:** Hoyt Rogers Emergency Phone: (914) 403-7124 **Owner Name:** Hoyt Rogers Owner Address: 28 Hughes Terrace Owner Phone: (914) 423-6225 Owner Type: Not reported Owner City, St, Zip: Yonkers, NY 10701-Mail Company: Not reported Mail Address: 28 Hughes Terrace Mail Address: Not reported Yonkers, NY 10701-Mail City, St, Zip: Attention: Hoyt Rogers

U003858271

Operable Unit ID:

Operable Unit:

Material ID:

886195

490085

01

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	V & T AUTO REPAIR (Continu	ed) U003858271
	Mail Phone:	(914) 423-6225
	Capacity:	1000
	Date Last Tested:	Not reported
	Next Test Date:	Not reported
	Category:	Not reported
	Install Date: Date Tank Was Closed:	Not reported
	Date Talik was closed.	Not reported
S125	CLEAN SWEEP INC	NY LTANKS S106471842
NNE	282 WARBURTON AVE	N/A
1/4-1/2 1952 ft.	YONKERS, NY	
1992 11.	Site 2 of 4 in cluster S	
Relative:		
Higher	LTANKS:	194065
Actual:	Site ID: Spill Date:	184965 06/07/04
84 ft.	Facility Addr2:	Not reported
••••	Facility ID:	0402469
	Program Number:	0402469
	SWIS:	6018
	Region of Spill:	3
	Investigator:	WCHD
	Referred To:	Westchester Cnty Health Dept
	Reported to Dept:	06/07/04
	CID:	17
	Spill Cause:	Tank Failure
	Water Affected:	Not reported
	Spill Source:	Institutional, Educational, Gov., Other
	Spill Notifier: Cleanup Ceased:	Other
	Cleanup Meets Standard:	
	Last Inspection:	
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	True
	Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
	Spill Closed Dt:	08/17/04
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update: Spille Namer:	
	Spiller Company:	HOYT ROGERS CLEAN SWEEP INC
	Spiller Phone:	(914) 423-6225
	Spiller Extention:	Not reported
	Spiller Address:	282 WARBURTON AVE
	Spiller City, St, Zip:	YONKERS, NY
	Spiller County:	001
	Spiller Contact:	HOYT ROGERS
	Spiller Phone:	(914) 423-6225
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	0402469
	DER Facility ID:	154737
	Site ID:	184965

CLEAN SWEEP INC (Continued)

Material Code: Material Name: 0009

Gasoline

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S106471842

	Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks: Remark:	Gasoline Not reported Petroleum 0.00 Gallons 0.00 Groundwater False Not reported Not reported Start CallerRemark - 0402469 FOUND SMALL AMOUNT OF CONTAMINATED SOIL: END CallerRemark - 0402469 Start DECRemark - 0402469 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-MAGNUSON" 9/01/04: Letter to Hoyt Rogers. Spill closed by Karen Magnuson, WCDOH 17Aug2004. END DECRemark - 0402469
S126 NNE 1/4-1/2 1952 ft.	RESIDENCE 282 WARBURTAN AVE YONKERS, NY	NY LTANKS S106738025 N/A
	Site 3 of 4 in cluster S	
Relative: Higher	LTANKS:	
nigher	Site ID:	337373
Actual:	Spill Date:	02/09/05
84 ft.	Facility Addr2:	Not reported
	Facility ID:	0412019
	Program Number:	0412019
	SWIS:	6000
	Region of Spill:	3
	Investigator:	WCHD
	Referred To:	Not reported
	Reported to Dept:	02/10/05
	CID: Spill Cause:	17 Tank Test Failure
	Water Affected:	Not reported
	Spill Source:	Unknown
	Spill Notifier:	Tank Tester
	Cleanup Ceased:	11
	Cleanup Meets Standard:	False
	Last Inspection:	11
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Spill Closed Dt	Responsible Party. Corrective action taken.
	Spill Closed Dt: Remediation Phase:	/ / 1
	Date Entered In Computer	
	Spill Record Last Update:	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S106738025

RESIDENCE	(Continued)
-----------	-------------

Spille Namer:	PLINHIO BATISTA
Spiller Company:	RESIDENCE
Spiller Phone:	(914) 384-0785
Spiller Extention:	Not reported
Spiller Address:	282 WARBURTAN AVE
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	001
Spiller Contact:	PLINHIO BATISTA
Spiller Phone:	(914) 384-0785
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	0412019
DER Facility ID:	272716
Site ID:	337373
Operable Unit ID:	1099338
Operable Unit:	01
Material ID:	579676
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	337373
Spill Tank Test:	307801
Tank Number:	1
Tank Size:	1000
Test Method:	99
Leak Rate:	0.00
Gross Fail:	0
Modified By:	Watchdog
Last Modified:	02/10/05
Test Method:	Alternate Test per 613.5a2v
DEC Remarks:	Start CallerRemark - 0412019 TEST THAT WAS USED WAS MESA. HAVEN'T TAKEN A SOIL
	SAMPLE YET. END CallerRemark - 0412019
Remark:	Not reported

T127 SSE 1/4-1/2 1958 ft.	49 NORTH BROADW 49 NORTH BROADW YONKERS, NY 10701	AY	IY VCP	S106906521 N/A
Deletive	Site 1 of 3 in cluster	Г		
Relative: Higher Actual: 38 ft.	VCP: Program Type: Site Code: Assessment: Env Problems: Site Desc:	BCP 343670 DOH has insufficient information to evaluate the potential for human exposure Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available. This BCP application pertains to .26 acre parcel located at 49 North Broadway	9	
		Yonkers, Westchester County. Currently this property is a vacant parking lot and it is intended to become residential. Submitted with the BCP application was a RemedialInvestigation Work Plan, Interim Remedial Measure Work Plan Citizen Participation Plan. The application was determined to be complete and		

Database(s)

EDR ID Number EPA ID Number

S106906521

49 NORTH BROADWAY (Continued)

is currently under review for eligibility.

T128 SSE 1/4-1/2	PHILIPSE MANOR HALL STATE F 29 WARBURTON AVENUE YONKERS, NY 10702	IISTORIC SITE	NY UST	U003994819 N/A
1969 ft.				
Relative:	Site 2 of 3 in cluster T			
Higher	UST:			
-	PBS Number:	3-264261		
Actual:	Tank Number:	1		
28 ft.	Tank Status:	Closed-Removed		
	Capacity:	1500 INSTALL DATE		
	Pipe Location:	Not reported		
	Pipe Type: 2nd Containment:	Galvanized Steel		
	Product:	None		
	Tank Location:	Nos. 1, 2 or 4 Fuel Oil		
	Pipe Internal Protection:	Underground None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	None		
		2/4/2004 NEXT TEST DATE 2/4/2005		
	Date Tank Closed / Category:			
	Leak Detection:	None		
	Overfill Protection:	None		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	Heather Vaughn		
	Phone:	(914)965-4027		
	In-service Capacity:	0		
	Site Status:	Unregulated; <1101 gal. PBS & no Subpart 360-14		
	Certification Date:	Not reported		
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	0 Not reported		
	Old Pbs Number: Last Inspected:	Not reported		
	Emergency Name:	Not reported Dispatcher NYS		
	Emergency Phone:	(845) 889-4100		
	Owner Name:	NYS Office of Parks, Rec. 8 Hist. Pres.		
	Owner Address:	Taconic Region		
	Owner Phone:	(845) 889-4100		
	Owner Type:	STATE GOVERNMENT		
	Owner City,St,Zip:	Staatsburg, NY 12580		
	Mail Company:	NYS Office of Parks, Rec 8 His. Pres.		
	Mail Address:	Agency Building 1 - 19th Floor		
	Mail Address:	Empire State Plaza		
	Mail City,St,Zip:	Albany, NY 12238		
	Attention:	John Eberhard		
	Mail Phone:	(518) 402-5533		
	Capacity:	1500		
	Date Last Tested:	2/4/2004		

Map ID Direction		MAP FINDINGS	
Distance Distance (ft	t.)		
Elevation	Site		
	PHILIPSE MANOR HALL ST	ATE HISTORIC SITE (Continued)	

Material Code:

Material Name: Case No .:

Material FA:

0001 #2 Fuel Oil

Not reported Petroleum

U003994819

Database(s)

Next Test Date: 2/4/2005 Not reported Category: Install Date: Not reported Date Tank Was Closed: Not reported T129 NYS OFFICE OF PUBLIC REC NY LTANKS S106868678 SSE **29 WARBURTON AVE** N/A 1/4-1/2 YONKERS, NY 1969 ft. Site 3 of 3 in cluster T **Relative:** LTANKS: Higher 337503 Site ID: Actual: Spill Date: 02/14/05 28 ft. Facility Addr2: Not reported Facility ID: 0412125 Program Number: 0412125 SWIS: 6000 Region of Spill: 3 Investigator: WCHD Referred To: Not reported Reported to Dept: 02/14/05 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Institutional, Educational, Gov., Other Spill Notifier: Tank Tester Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended **UST Involvement:** False Spill Class: Not reported Spill Closed Dt: 05/03/05 Remediation Phase: 0 Date Entered In Computer: 02/14/05 Spill Record Last Update: 05/06/05 Spille Namer: ROBERT FREY Spiller Company: NYS OFFICE OF PUBLIC REC Spiller Phone: (845) 889-4100 Spiller Extention: 324 Spiller Address: 29 WARBURTON AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: ROBERT FREY Spiller Phone: (845) 889-4100 Spiller Extention: 324 DEC Region: 3 0412125 Program Number: DER Facility ID: 272840 Site ID: 337503 Operable Unit ID: 1099454 Operable Unit: 01 Material ID: 579794

Database(s)

EDR ID Number **EPA ID Number**

S106868678

Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	337503
Spill Tank Test:	403704
Tank Number:	1
Tank Size:	1500
Test Method:	03
Leak Rate:	0.00
Gross Fail:	0
Modified By:	Watchdog
Last Modified:	02/14/05
Test Method:	Horner EZ Check I or II
DEC Remarks:	Start CallerRemark - 0412125 PBS No: 3-264261 END CallerRemark - 0412125
Remark:	Start DECRemark - 0412125 PBS 3-264261 5/6/05: Letter to John Eberhard, NYS
	Office of Parks, Rec & His. Pres. from Wayne Schneider, WCDOH dated 3May2005.
	WCDOH requires NFA at this time. END DECRemark - 0412125

U130 ENE 1/4-1/2 1973 ft.	237 NORTH BROADWAY YONKERS, NY	NY LTANKS S104 NY HIST LTANKS N/A	619826
	Site 1 of 4 in cluster U		
Relative:	LTANKS:		
Higher	Site ID:	64662	
Actual:	Spill Date:	11/20/98	
161 ft.	Facility Addr2:	Not reported	
	Facility ID:	9810570	
	Program Number:	9810570	
	SWIS:	6018	
	Region of Spill:	3	
	Investigator:	tdghiosa	
	Referred To:	Not reported	
	Reported to Dept:	11/20/98	
	CID:	17	
	Spill Cause:	Tank Test Failure	
	Water Affected:	Not reported	
	Spill Source:	Private Dwelling	
	Spill Notifier:	Tank Tester	
	Cleanup Ceased:	//	
	Cleanup Meets Standard:		
	Last Inspection:		
	Recommended Penalty:	Penalty Not Recommended	
	UST Involvement:	False	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
	Spill Closed Dt:		
	Remediation Phase:	1	
	Date Entered In Computer:	: 11/20/98	
	Spill Record Last Update:	12/14/98	
	Spille Namer:	Not reported	
	Spiller Company:	RIVERVIEW APTS	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	Spiller Address:	237 NORTH BROADWAY	

Database(s)

EDR ID Number EPA ID Number

S104619826

(Continued)		S104
Spiller City,St,Zip:	YONKERS, NY	
Spiller County:	001	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Extention:	Not reported	
DEC Region:	3	
Program Number:	9810570	
DER Facility ID:	62265	
Site ID:	64662	
Operable Unit ID:	1067793	
Operable Unit:	01	
Material ID:	314437	
Material Code:	0002	
Material Name:	#4 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Soil	
Oxygenate:	False	
Site ID:	64662	
Spill Tank Test:	21124	
Tank Number:	1	
Tank Size:	5000	
Test Method:	99	
Leak Rate:	0.00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	10/01/04 Alternate Test per 612 Fe2:	
Test Method: DEC Remarks:	Alternate Test per 613.5a2v Start CallerRemark - 9810570 caller states that the tank itself passed but the	
DEC Remarks.	piping of the tank failed. The super was notified and a bid on the service job	;
	is underway to see who will repair tank. END CallerRemark - 9810570	
Remark:	Start DECRemark - 9810570 Prior to Sept, 2004 data translation this spill Le	ad
Romana	DEC Field was "GHIOSAY" END DECRemark - 9810570	uu
HIST LTANKS:		
Region of Spill:	3	
Spill Number:	9810570	
Investigator:	GHIOSAY	
Caller Name:	Not reported	
Caller Agency:	Not reported	
Caller Phone:	Not reported	
Caller Extension:	Not reported	
Notifier Name:	Not reported	
Notifier Agency:	Not reported	
Notifier Phone:	Not reported	
Notifier Extension:	Not reported	
Spill Date:	11/20/1998 11:30	
Spill Time: Reported to Department D		
Reported to Department L		
SWIS:	55	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Extention:	Not reported	

Database(s)

EDR ID Number EPA ID Number

S104619826

(Continued) Spiller Name: **RIVERVIEW APTS** Spiller Address: 237 NORTH BROADWAY Spiller City, St, Zip: YONKERS, NY Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Test Failure Resource Affectd: On Land Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Tank Tester PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 11/20/98 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 12/14/98 Is Updated: False PBS Number: Not reported Tank Number: 1 Tank Size: 5000 Test Method: Alternate Test per 613.5a2v (PBS Regulations) Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False #4 FUEL OIL Material: Class Type: #4 FUEL OIL Times Material Entry In File: 1751 CAS Number: Not reported 19941205 Last Date: DEC Remarks: Not reported Spill Cause: caller states that the tank itself passed but the piping of the tank failed. The super was notified and a bid on the service job is underway to see who will repair tank.

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

131 NE /4-1/2	237 OWNERS CORP 237 NORTH BROADWAY YONKERS, NY 10701		NY AST	A100204123 N/A
973 ft.	TONKERS, NT 10/01			
	Site 2 of 4 in cluster U			
elative:	AST:			
igher	PBS Number:	3-026646		
ctual:	Tank Number:	1		
51 ft.	Tank Status:	In Service		
	Capacity:	5000 INSTALL DATE 12/01/1947		
	Pipe Location:	Aboveground: 10% or more below ground		
	Pipe Type:	Steel/Iron		
	2nd Containment:	Vault		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Aboveground: 10% or more below ground		
	Pipe Internal Protection:	None		
	Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	None		
	Date Last Tested / Next Test:			
	Date Tank Closed / Category:	CATEGORY		
	Leak Detection:	None		
	Overfill Protection:	Vent Whistle, Product Level Gauge		
	Dispenser Method:	Suction		
	Facility Addr2:	Not reported		
	Swiscode:	5518		
	Operator:	Robert Colon		
	Phone:	(914) 375-1199		
	In-service Capacity:	5000		
	Site Status:	Active PBS; >1100 gal. PBS, regardless if subpart 360-14 ta	anks exists or	not
	Certification Date:	9/6/2001		
	Expire Date:	9/19/2006		
	CBS Number:	Not reported		
	Spdes Number: Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	Not reported 1		
	Old Pbs Number:	Not reported		
	Last Inspected:	03/03/2004		
	Emergency Name:	Not reported		
	Emergency Phone:	Not reported		
	Owner Name:	Not reported		
	Owner Address:	Not reported		
	Owner Phone:	Not reported		
	Owner Type:	Not reported		
	Owner City,St,Zip:	Not reported		
	Mail Company:	Key Managemnet		
	Mail Address:	24 Runyon Avenue		
	Mail Address:	Not reported		
	Mail City,St,Zip:	Yonkers, NY 10710		
	Attention:	237 Owners Corp.		
	Mail Phone:	(914) 476-2434		
	Capacity:	5000		
	Date Last Tested:	Not reported		
	Next Test Date:	Not reported		
	Category:	Not reported		
	Install Date:	12/01/1947		

Database(s)

EDR ID Number EPA ID Number

	237 OWNERS CORP (Continued)			A100204123
	Date Tank Was Closed:	Not reported		
132 SE 1/4-1/2 1978 ft.	DIBBINI REALTY, INC. 64 LOCUST HILL AVENUE YONKERS, NY 10701		NY AST	A100204246 N/A
Detection	AST:			
Relative: Higher	PBS Number:	3-800753		
	Tank Number:	1		
Actual:	Tank Status:	In Service		
162 ft.	Capacity:	3000 INSTALL DATE		
	Pipe Location:	Aboveground		
	Pipe Type:	Steel/Iron		
	2nd Containment:	Concrete Dike		
	Product:	Nos. 1, 2 or 4 Fuel Oil		
	Tank Location:	Aboveground None		
	Pipe Internal Protection: Pipe External Protection:	None		
	Tank Type:	Steel/Carbon Steel		
	Tank Internal Protection:	None		
	Tank External Protection:	Painted/Asphalt Coating		
	Date Last Tested / Next Test:			
	Date Tank Closed / Category:	CATEGORY		
	Leak Detection:	None		
	Overfill Protection:	Vent Whistle, Catch Basin		
	Dispenser Method:	Gravity		
	Facility Addr2:	Not reported		
	Swiscode:	Not reported		
	Operator:	Dibbini Realty Inc		
	Phone:	(914)287-0700		
	In-service Capacity: Site Status:	3000 Active PBS; >1100 gal. PBS, regardless if subpart 360-14 ta	nke oviete or i	hot
	Certification Date:	Not reported		101
	Expire Date:	Not reported		
	CBS Number:	Not reported		
	Spdes Number:	Not reported		
	Lat/Long:	Not reported		
	Site Type:	Not reported		
	Number Of Active Tanks:	1		
	Old Pbs Number:	Not reported		
	Last Inspected:	Not reported		
	Emergency Name:	James Dibbini		
	Emergency Phone:	(914) 287-0700 Dithetic Deaths has		
	Owner Name:	Dibbini Realty, Inc.		
	Owner Address: Owner Phone:	PO Box 785 (914) 337-9759		
	Owner Type:	CORPORATE/COMMERCIAL		
	Owner City,St,Zip:	Yonkers, NY 10703-		
	Mail Company:	Dibbini Realty, Inc.		
	Mail Address:	PO Box 785		
	Mail Address:	Not reported		
	Mail City,St,Zip:	Yonkers, NY 10703-		
	Attention:	James Dibbini		
	Mail Phone:	(914) 287-0700		
	Capacity:	3000		
	Date Last Tested:	Not reported		
	Next Test Date:	Not reported		

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	DIBBINI REALTY, INC. (Contin	nued)		A100204246
	Category: Install Date: Date Tank Was Closed:	Not reported Not reported Not reported		
U133 ENE 1/4-1/2 1981 ft.	APARTMENT 250 NORTH BROADWAY YONKERS, NY		NY LTANKS	S106869269 N/A
	Site 3 of 4 in cluster U			
Relative: Higher	LTANKS:			
Actual: 161 ft.	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty:	344206 04/26/05 Not reported 0501070 6018 3 WCHD Not reported 04/26/05 17 Tank Failure Not reported Private Dwelling Other / / True / / Penalty Not Recommended		
	UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company: Spiller Company: Spiller Phone: Spiller Extention: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact:	03/16/06 LEONARD BARISH-AGENT APARTMENT (914) 963-7400 229 250 NORTH BROADWAY YONKERS, NY 001 LEONARD BARISH-AGENT	Response. Willir	ng
	Spiller Phone: Spiller Extention:	(914) 963-7400 229 3		

DEC Region:

Operable Unit:

Material Name: Case No.:

Material ID: Material Code:

Material FA:

Program Number: DER Facility ID: Site ID: Operable Unit ID:

3 0501070

01 583080 0001

290844 344206 1102860

#2 Fuel Oil

Petroleum

Not reported

Map ID Direction		MAP FINDINGS		
Distance Distance (ft. Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	APARTMENT (Continued)			S106869269
	Quantity: Units: Recovered: Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks:	0.00 Gallons 0.00 Groundwater False Not reported Not reported Start CallerRemark - 0501070 BURIED TANK, IT IS ON A S LOOK AT BOILER AND STUCK TANK AND NOTICED IT V FILLED TWO WEEKD AGO; IS A 5000 GALLON TANK; EI Start DECRemark - 0501070 03/16/06: letter dated 03/02/00 Jr.,WCDOH, to Leonard Barish states NFA. However, an up with the new tank info. must be submitted to complete the fi 1,2006. END DECRemark - 0501070	VAS EMPTY, SU ND CallerRemark 6 From Frederick odated PBS Appli	PER SAID IT WAS c - 0501070 Beck,
V134 South 1/4-1/2 2019 ft.	POST OFFICE 79 MAIN ST YONKERS, NY		NY LTANKS	S106124341 N/A
Relative:	Site 1 of 4 in cluster V			
Lower	LTANKS: Site ID:	198961		
Actual: 8 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spill Record Last Update: Spille Namer: Spiller Company:	/ / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. 11/13/03 0 : 11/12/03	C Response. Will	ng

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

POST OFFICE (Continued)

Spiller Phone: Spiller Extention: Spiller Address: Spiller City, St, Zip: Spiller County: 001 Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: 3 Program Number: DER Facility ID: Site ID: Operable Unit ID: Operable Unit: 01 Material ID: Material Code: 0001 Material Name: Case No .: Material FA: Quantity: 0.00 Units: Recovered: 0.00 **Resource Affected:** Soil Oxygenate: False Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks: Remark:

Not reported Not reported 100 WESTCHESTER AVE WHITE PLAINS, NY JOANNE KUNNEY (914) 697-7074 Not reported 0308550 165589 198961 877051 502037 #2 Fuel Oil Not reported Petroleum Gallons Not reported Not reported

Start CallerRemark - 0308550 cleanup in progress END CallerRemark - 0308550 Start DECRemark - 0308550 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-SCHNEIDER" 11/13/03: Spill on concrete floor. No drains affected. Cleanup complete. NFA at this time. END DECRemark - 0308550

W135 SSE 1/4-1/2 2036 ft.	ATI TERMINAL ALEXANDER STREET YONKERS, NY Site 1 of 2 in cluster W			NY LTANKS NY Spills NY Hist Spills NY HIST LTANKS	S100140820 N/A
Relative: Higher	LTANKS: Site ID:	131611			
Actual: 22 ft.	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To:	131611 03/14/90 Not reported 8912251 8912251 6018 3 tdghiosa Not reported			
	Reported to Dept: CID: Spill Cause:	03/19/90 17 Tank Failure			

S106124341

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

ATI TERMINAL (Continued)

S100140820

ERMINAL (Continued)	5100140820
Water Affected:	HUDSON RIVER
Spill Source:	Major Facility > 400,000 gal
Spill Notifier:	Responsible Party
Cleanup Ceased:	
	True
Last Inspection:	12/28/05
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	02/14/06
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	02/14/06
Spille Namer:	Not reported
Spiller Company:	SAME
Spiller Phone:	(914) 478-5970
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001 Not expected
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region: Program Number:	3 8012251
Program Number:	8912251
DER Facility ID: Site ID:	135279 131611
Operable Unit ID:	939086
Operable Unit:	01
Material ID:	441722
Material Code:	0003
Material Name:	#6 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	4070.00
Resource Affected:	Surface Water
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 8912251 NOTIFICATION OF SPILL RECEIVED VIA LETTER FROM ATI TO CESARE MANFREDT LETTER STATED THAT THE COMPANY IS REMOVING PRODUCT FROM THE
	WATER TABLE HISTORY OF OIL SHEEN IN THAT AREA OF HUDSON RIVER END CallerRemark
	- 8912251
Remark:	Start DECRemark - 8912251 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" 2/14/06 FACILITY HAS BEEN DEMOLISHED. CONTAMINATED
	SOIL REMOVED BY ROYAL ENVIRONMENTAL DURING WORK UNDER DUPLICATE SPILL NUMBERS.

Database(s)

EDR ID Number EPA ID Number

S100140820

ATI TERMINAL (Continued)

jod END DECRemark - 8912251

NY Spills:	
Site ID:	87780
Facility Addr2:	Not reported
Facility ID:	9608841
Spill Number:	9608841
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	tdghiosa
Referred To:	Not reported
Spill Date:	10/16/96
Reported to Dept:	10/16/96
CID:	270
Spill Cause:	Unknown
Water Affected:	HUDSON RIVER
Spill Source:	Unknown
Spill Notifier:	Federal Government
Cleanup Ceased:	//
Cleanup Meets Std:	True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No
	corrective action required.
Spill Closed Dt:	10/23/96
Remediation Phase:	0
Date Entered In Compute	
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Spiller Phone:	Not reported
Contact Name:	COAST GUARD
Contact Phone:	Not reported
DEC Region:	3
Program Number:	9608841
DER Facility ID:	80395
Site ID:	87780
Operable Unit ID:	1040051
Operable Unit:	01
Material ID:	344578
Material Code: Material Name:	0066A UNKNOWN PETROLEUM
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	1.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Surface Water
Oxygenate:	False
	allerRemark - 9608841 approx 30 x 200 ft sheen team on the way END
	emark - 9608841
	ECRemark - 9608841 Prior to Sept, 2004 data translation this spill Lead
Curre Curre	

EDR ID Number EPA ID Number

Database(s)

ATI TERMINAL (Continued)

S100140820

DEC Field was "GHIOSAY" 10/16/96 COAST GUARD RESPONDING 10/23/96 MINAMAL AMOUNT, ONE GAL., SHEEN ON HUDSON END DECRemark - 9608841

NY Hist Spills:	
Region of Spill:	3
Spill Number:	9608841
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Spill Date/Time:	10/16/1996 12:26
Reported to Dept Date/Time:	10/16/96 14:24
SWIS:	55
Spiller Name:	UNKNOWN
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Contact:	COAST GUARD
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Spill Cause:	Unknown
Reported to Dept:	Surface Water
Water Affected:	HUDSON RIVER
Spill Source:	12
Spill Notifier:	Federal Government
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Std:	True
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Dt:	
Enforcement Date:	
Invstgn Complete:	
UST Involvement:	False
Spill Class:	
Spill Class.	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
Spill Closed Dt:	10/23/96
Corrective Action Plan Submi	
Date Region Sent Summary t	
Date Spill Entered In Comput	
Date Spill Entered In Comput	
Update Date:	12/12/96
Is Updated:	False
PBS Number:	
Tank Number:	Not reported Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	1
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered	
	A. TTMO

	Г	
Map ID Direction		MAP FINDINGS
Distance		
Distance (ft	,	EDR ID Numbe
Elevation	Site	Database(s) EPA ID Numbe
	ATI TERMINAL (Continued)	S100140820
	Material:	UNKNOWN PETROLEUM
	Class Type:	
	Times Material Entry In F CAS Number:	
	Last Date:	Not reported 19940929
		/96 COAST GUARD RESPONDING 10/23/96 MINAMAL AMOUNT, ONE GAL., SHEEN
		UDSON
		x 30 x 200 ft sheen team on the way
	Region of Spill:	3
	Spill Number:	9103652
	Investigator:	GHIOSAY
	Caller Name:	Not reported
	Caller Agency:	Not reported
	Caller Phone:	Not reported
	Notifier Name:	Not reported
	Notifier Agency:	Not reported
	Notifier Phone:	Not reported
	Spill Date/Time:	07/02/1991 23:00
	Reported to Dept Date/T SWIS:	
	Spiller Name:	55 A.TARRICONE
	Spiller Contact:	Not reported
	Spiller Phone:	(914) 478-2220
	Spiller Address:	SAW MILL RIVER RD.
	Spiller City,St,Zip:	YONKERS
	Spill Cause:	Deliberate
	Reported to Dept:	Surface Water
	Water Affected:	HUDSON RIVER
	Spill Source:	03 Faderal Coursement
	Spill Notifier: PBS Number:	Federal Government Not reported
	Cleanup Ceased:	06/18/53
	Cleanup Meets Std:	True
	Last Inspection:	
	Recommended Penalty:	Penalty Not Recommended
	Spiller Cleanup Dt:	//
	Enforcement Date:	//
	Invstgn Complete:	
	UST Involvement:	True
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Spill Closed Dt:	Responsible Party. Corrective action taken. 07/31/91
	Corrective Action Plan S	
		nary to Central Office: / /
	Date Spill Entered In Co	
	Date Spill Entered In Co	•
	Update Date:	02/12/92
	Is Updated:	False
	PBS Number:	Not reported
	Tank Number:	Not reported
	Tank Size:	Not reported
	Test Method:	Not reported
	Leak Rate Failed Tank: Gross Leak Rate:	Not reported Not reported
	Material Class Type:	Petroleum
	Quantity Spilled:	0
	www.mity opiniou.	-

Leak Rate Failed Tank: Gross Leak Rate: Material Class Type: Quantity Spilled:

Map ID Direction	L	MAP FINDINGS		
Distance Distance (ft)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	ATI TERMINAL (Continued)			S100140820
	Unkonwn Quantity Spilled: Units:	False Not reported		
	Quantity Recovered:	0		
	Unkonwn Quantity Recovered			
	Material:	GASOLINE		
	Class Type: Times Material Entry In File:	GASOLINE 21329		
	CAS Number:	Not reported		
	Last Date:	19940929		
		O OIL WAS NOTED AND NO PIPE WAS FOUND. EPA		D AND HAD
		ED THE CALL TO BE FALSE. 09/27/95: This is additional and the second sec		
		rial spilled from the translation of the old spill file: ODOR. N NOTICED 2 HOSE PUMPING OFF OF TERMINAL P		HUDSON RIVER
		DORS USCG PETTY OFFICER SCHOENSTEIN) ALS		
	HIST LTANKS:			
	Region of Spill:	3		
	Spill Number:	8912251		
	Investigator:	GHIOSAY		
	Caller Name: Caller Agency:	Not reported Not reported		
	Caller Phone:	Not reported		
	Caller Extension:	Not reported		
	Notifier Name:	Not reported		
	Notifier Agency:	Not reported		
	Notifier Phone:	Not reported		
	Notifier Extension: Spill Date:	Not reported 03/14/1990		
	Spill Time:	12:00		
	Reported to Department Date:			
	Reported to Department Time	: 12:00		
	SWIS:	55		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported Not reported		
	Spiller Name:	SAME		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	Not reported		
	Facility Contact: Facility Phone:	Not reported		
	Facility Extention:	(914) 478-5970 Not reported		
	Spill Cause:	Tank Failure		
	Resource Affectd:	Surface Water		
	Water Affected:	HUDSON RIVER		
	Spill Source:	Major Facility 400,000 gallons		
	Spill Notifier: PBS Number:	Responsible Party Not reported		
	Cleanup Ceased:	//		
	Cleanup Meets Standard:	False		
	Last Inspection:			
	Recommended Penalty:	Penalty Not Recommended		
	Spiller Cleanup Date: Enforcement Date:	//		
	Investigation Complete:	//		
	UST Involvement:	False		
	Spill Class:	Known release that creates potential for fire or hazard.	DEC Response. W	/illing
		Responsible Party. Corrective action taken.		

Map ID Direction	MAP FINDINGS	
Distance		
Distance (ft.)		
Elevation Site		Database(s)
ATI TERMINAL (Continued)		

	ATI TERMINAL (Continued)			S100140820
	STATE	mitted: puter Data File: 12/03/93 False Not reported Not reported Not reported Not reported Not reported Not reported Not reported Petroleum 0 False Not reported 4070 red: False #6 FUEL OIL #6 FUEL OIL #6 FUEL OIL #6 FUEL OIL 2190 Not reported 19940728 pted CATION OF SPILL D THAT THE COM	RECEIVED VIA LETTER FROM ATI TO CESARE PANY IS REMOVING PRODUCT FROM THE WAT F HUDSON RIVER	
U136 ENE 1/4-1/2 2038 ft.	UNK,REF TO WCHD 245 NORTH BROADWAY YONKERS, NY		NY L' NY HIST L'	TANKS S100140084 TANKS N/A
Relative:	Site 4 of 4 in cluster U			
Higher	LTANKS:			
-	Site ID:	256277		
Actual: 167 ft.	Spill Date: Facility Addr2:	03/21/88 Not reported		
107 10.	Facility ID:	8710635		
	Program Number:	8710635		
	SWIS:	6018		
	Region of Spill: Investigator:	3 dxtraver		
	Referred To:	Not reported		
	Reported to Dept:	03/21/88		
	CID:	17		
	Spill Cause: Water Affected:	Tank Failure Not reported		
	Spill Source:	Private Dwelling		
	Spill Notifier:	DEC		
	Cleanup Ceased:	11/28/89		
	Cleanup Meets Standard:	True		
	Last Inspection: Recommended Penalty:	03/21/88 Penalty Not Reco	ommended	
	UST Involvement:	False	Junchaga	
	Spill Class:		ith minimal potential for fire or hazard. DEC Respo	nse. Willing
			ty. Corrective action taken.	

Database(s)

EDR ID Number EPA ID Number

S100140084

JNK, REF TO WCHD (Continue	ea) 5100140084
Spill Closed Dt:	11/28/89
Remediation Phase:	0
Date Entered In Computer:	04/01/88
Spill Record Last Update:	
Spille Namer:	Not reported
Spiller Company:	UNK
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	8710635
DER Facility ID:	209880
Site ID:	256277
Operable Unit ID:	916502
Operable Unit:	01
Material ID:	462398
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units: Recovered:	Gallons 0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 8710635 LEAKING UNDERGROUND OIL TANK 5K 3" PER HR.
	NOTIFIED BY ANTHONY SIGONA NYS DEC REG 2, 718-482-4900/4933. UPDATE: REFERED TO
	WCHD TO INVESTIGATE & HANDLE. END CallerRemark - 8710635
Remark:	Start DECRemark - 8710635 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "TRAVER" END DECRemark - 8710635
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8710635
Investigator:	TRAVER
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency: Notifier Phone:	Not reported Not reported
NUMELT NUME.	

Not reported

DEC

True

11

11

11

Date Region Sent Summary to Central Office: / /

False

11/28/89

04/28/98

Not reported

Not reported

Not reported Not reported

Not reported Not reported

Petroleum

0

0

False

Gallons

24464

#2 FUEL OIL

#2 FUEL OIL

Not reported

19941207

False

Not reported

Penalty Not Recommended

Responsible Party. Corrective action taken.

11

04/01/88

Not reported

11/28/89

03/21/88

Database(s)

EDR ID Number **EPA ID Number**

S100140084

NOUMER EXTENSION.	Not reported
Spill Date:	03/21/1988
Spill Time:	08:55
Reported to Department D	Date: 03/21/88
Reported to Department T	Time: 11:58
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	UNK.
Spiller Address:	Not reported
Spiller City, St, Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Private Dwelling

Known release with minimal potential for fire or hazard. DEC Response. Willing

UNK,REF TO WCHD (Continued)

Notifier Extension:

Spill Notifier:

PBS Number:

Cleanup Ceased:

Last Inspection:

Cleanup Meets Standard:

Recommended Penalty:

Investigation Complete:

Corrective Action Plan Submitted:

Spill Record Last Update:

Leak Rate Failed Tank:

Unkonwn Quantity Spilled:

Times Material Entry In File:

Unkonwn Quantity Recovered: False

Date Spill Entered In Computer Data File:

Time Spill Entered In Computer Data File:

Spiller Cleanup Date:

Enforcement Date:

UST Involvement:

Spill Closed Dt:

Spill Class:

Is Updated:

Tank Size:

Units:

Material:

Class Type:

Last Date:

Spill Cause:

CAS Number:

PBS Number:

Tank Number:

Test Method:

Gross Leak Rate:

Material Class Type: Quantity Spilled:

Quantity Recovered:

DEC Remarks:	Not reported	
Spill Cause:	LEAKING UNDERGROUND OIL TANK 5K 3 PER HR. NOTIFIED BY ANTHONY SIGONA NYS DEC	

Map ID Direction Distance Distance (ft.) Elevation Site

EDR ID Number EPA ID Number

Database(s)

UNK,REF TO WCHD (Continued)

S100140084

REG 2, 718-482-4900/4933. UPDATE: REFERED TO WCHD TO INVESTIGATE HANDLE.

S137 NNE 1/4-1/2	ABANDON GAS STATION 290 WARBURTON AVE YONKERS, NY		NY LTANKS	S106971345 N/A
2063 ft.	Site 4 of 4 in cluster S			
Relative: Higher	LTANKS: Site ID:	332338		
	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	10/14/04 Not reported 0407795 0407795 6018 3 JBODee DER - CENTRAL OFFICE 10/14/04 17 Tank Failure Not reported Gasoline Station Other / / False / / Penalty Not Recommended True Known release that creates potential for fire or hazard. DEC F Responsible Party. Corrective action taken. / / 1 10/14/04	Response. Willin	9
	Material FA:	Petroleum		
	Quantity: Units:	0.00 Gallons		

Database(s)

EDR ID Number EPA ID Number

S106971345

ABANDON GAS STATION (Continued)

Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0407795 CONTAMNATED SOIL FOUND AT THIS LOCATION: DOING IT
	AT BROWNFIELD CLEAN UP SITE: END CallerRemark - 0407795
Remark:	Start DECRemark - 0407795 10/18/04 EPA Grant program being handled by Albany.
	jbo END DECRemark - 0407795

V138 South 1/4-1/2 2108 ft.	METRO NORTH BUENA VISTA STREET YONKERS, NY	
Relative:	Site 2 of 4 in cluster V	
Higher	LTANKS: Site ID:	174624
Actual:	Spill Date:	12/28/90
11 ft.	Facility Addr2:	Not reported
	Facility ID:	9010500
	Program Number:	9010500
	SWIS:	6018
	Region of Spill:	3
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept:	12/28/90
	CID: Spill Cause:	Not reported Tank Overfill
	Water Affected:	Not reported
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Other
	Cleanup Ceased:	01/15/91
	Cleanup Meets Standard:	True
	Last Inspection:	01/15/91
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Not reported
	Spill Closed Dt:	01/15/91
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update: Spille Namer:	01/15/91 Not reported
	Spiller Company:	RAD OIL
	Spiller Phone:	(914) 678-8098
	Spiller Extention:	Not reported
	Spiller Address:	Not reported
	Spiller City,St,Zip:	ZZ
	Spiller County:	001
	Calles Contacts	Nature estad

Not reported

Spiller Contact:

NY LTANKS S102673633 NY HIST LTANKS N/A

Database(s)

TRO NORTH (Continued)	S102673633
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9010500 146846
DER Facility ID: Site ID:	174624
Operable Unit ID:	950818
Operable Unit:	01
Material ID:	430651
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	25.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9010500 TANK OVERFILL DURING FILLING PROCESS TYRE CO. WA
Remark:	Start DECRemark - 9010500 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/15/91: NO DEC INSPECTION PERFORMED. END DECRer - 9010500
HIST LTANKS:	
Region of Spill:	3
Spill Number:	9010500
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	12/28/1990
Spill Time:	16:00
Reported to Department	Date: 12/28/90
Reported to Department L	
Reported to Department 1	line. 10.25
	55
Reported to Department T SWIS:	
Reported to Department T	55
Reported to Department T SWIS: Spiller Contact:	55 Not reported
Reported to Department T SWIS: Spiller Contact: Spiller Phone:	55 Not reported Not reported
Reported to Department T SWIS: Spiller Contact: Spiller Phone: Spiller Extention:	55 Not reported Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

METRO NORTH (Continued)

S102673633

Facility Contact:	Not reported
Facility Phone:	(914) 678-8098
Facility Extention:	Not reported
Spill Cause:	Tank Överfill
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	01/15/91
Cleanup Meets Standard	l: True
Last Inspection:	01/15/91
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	/ /
Investigation Complete:	
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	01/15/91
Date Region Sent Summ	arv to Central Office: / /
Corrective Action Plan Su	•
Date Spill Entered In Cor	mputer Data File: 01/03/91
Time Spill Entered In Cor	mputer Data File: Not reported
Spill Record Last Update	
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	25
Unkonwn Quantity Spille	d: False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recov	vered: False
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In F	File: 24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: 01/15/	91: NO DEC INSPECTION PERFORMED.
	OVERFILL DURING FILLING PROCESS TYRE CO. WAS HIRED BY METRO NORTH TO CLEAN

X139 ESE 1/4-1/2 2124 ft.	190 PALASADE AVE YONKERS, NY	
	Site 1 of 3 in cluster X	
Relative: Higher	LTANKS: Site ID:	169687
Actual:	Spill Date:	06/26/98
174 ft.	Facility Addr2:	Not reported
	Facility ID:	9803957
	Program Number:	9803957

NY LTANKS S104619581 NY HIST LTANKS N/A (Continued)

Last Modified:

Test Method:

10/01/04

Horner EZ Check I or II

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S104619581

SWIS: 6018 Region of Spill: 3 Investigator: jbodee Referred To: Not reported 06/29/98 Reported to Dept: CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Tank Tester Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required. Spill Closed Dt: 03/03/03 **Remediation Phase:** 0 Date Entered In Computer: 06/29/98 Spill Record Last Update: 05/28/03 **KEN NILSEN** Spille Namer: Spiller Company: **KEN NILSEN** Spiller Phone: (914) 738-4331 Spiller Extention: Not reported Spiller Address: 190 PALISADE AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: KEN NILSEN Spiller Phone: (914) 738-4331 Spiller Extention: Not reported DEC Region: 3 Program Number: 9803957 **DER Facility ID:** 142855 Site ID: 169687 Operable Unit ID: 1064817 Operable Unit: 01 Material ID: 322279 Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons 0.00 Recovered: **Resource Affected:** Soil Oxygenate: False Site ID: 169687 Spill Tank Test: 20609 Tank Number: 1 3000 Tank Size: Test Method: 03 Leak Rate: 0.00 Gross Fail: Not reported Modified By: Spills

EDR ID Number Database(s) EPA ID Number

(Continued)		S104619581
DEC Remarks: Remark:	Not reported Start DECRemark - 9803957 Prior to Sept, 2004 data translation this spill Lea DEC Field was "O'DEE" SEE SPILL 02-07962 Administratively Closed. jbo DECRemark - 9803957	
HIST LTANKS:	2	
Region of Spill:	3	
Spill Number:	9803957 WCHD	
Investigator: Caller Name:	WCHD	
	Not reported	
Caller Agency:	Not reported	
Caller Phone:	Not reported	
Caller Extension:	Not reported	
Notifier Name:	Not reported	
Notifier Agency: Notifier Phone:	Not reported	
Notifier Extension:	Not reported	
	Not reported	
Spill Date:	06/26/1998	
Spill Time:	09:30	
Reported to Department Da Reported to Department Ti		
SWIS:	55	
Spiller Contact:	KEN NILSEN	
Spiller Phone:	(914) 738-4331	
Spiller Extention:	Not reported	
Spiller Name:	KEN NILSEN	
Spiller Address:	190 PALASADE AVE	
Spiller City,St,Zip:	YONKERS, NY	
Facility Contact:	KEN NILSEN	
Facility Phone:	(914) 738-4331	
Facility Extention:	Not reported	
Spill Cause:	Tank Test Failure	
Resource Affectd:	On Land	
Water Affected:	Not reported	
Spill Source:	Private Dwelling	
Spill Notifier:	Tank Tester	
PBS Number:	Not reported	
Cleanup Ceased:	//	
Cleanup Meets Standard:	False	
Last Inspection:		
Recommended Penalty:	Penalty Not Recommended	
Spiller Cleanup Date:		
Enforcement Date:		
Investigation Complete:	//	
UST Involvement:	False	
Spill Class:	Not reported	
Spill Closed Dt:		
Date Region Sent Summar		
Corrective Action Plan Sub		
Date Spill Entered In Comp		
Time Spill Entered In Com		
Spill Record Last Update:	06/06/99 Falsa	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number: Tank Size:	1 3000	
Test Method:	3000 Horner EZ Check	
	HUMELLZ ONEUK	

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	(Continued)			S104619581
	Leak Rate Failed Tank: Gross Leak Rate: Material Class Type: Quantity Spilled: Unkonwn Quantity Spilled: Units: Quantity Recovered: Unkonwn Quantity Recover Material: Class Type: Times Material Entry In File CAS Number: Last Date: DEC Remarks: Not repo Spill Cause: Not repo	#2 FUEL OIL #2 FUEL OIL :: 24464 Not reported 19941207 rted		
W140 SSE 1/4-1/2 2132 ft.	16-18 WARBURTON AVE YONKERS, NY		NY LTANKS	S105999983 N/A
Relative:	Site 2 of 2 in cluster W			
Higher	LTANKS: Site ID:	203976		
Actual: 21 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Class: Spill Class: Spill Class: Spill Class: Spill Class: Date Entered In Computer: Spill Record Last Update: Spiller Company: Spiller Company: Spiller Address: Spiller County: Spiller County: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Phone: Spiller Contact: Spiller Phone: Spiller Contact: Spiller Phone: Spiller Extention:	09/22/03 Not reported 0306607 6018 3 jbodee Not reported 09/22/03 17 Tank Failure Not reported Commercial/Industrial Other // True // Penalty Not Recommended False Known release that creates potential for fire or hazard. 03/23/04 0 09/22/03 03/23/04 CLIFFORD COOK Not reported (914) 968-2288 Not reported Not reported Not reported Not reported ZZ 001 CHARLES TALLINGER (914) 694-9600 Not reported	(Highly Improbable)	

Database(s)

EDR ID Number EPA ID Number

(Continued)	S105999983	
DEC Region:	3	
Program Number:	0306607	
DER Facility ID:	169617	
Site ID:	203976	
Operable Unit ID:	875353	
Operable Unit:	01	
Material ID:	503814	
Material Code:	0001	
Material Name:	#2 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Soil	
Oxygenate:	False	
Site ID:	Not reported	
Spill Tank Test:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate:	Not reported	
Gross Fail:	Not reported	
Modified By:	Not reported	
Last Modified:	Not reported	
Test Method:	Not reported	
DEC Remarks:	Start CallerRemark - 0306607 CALLER WOULD LIKE DEC TO CONTACT HIM REGARDING	
	THIS INCIDENT SPILL WAS CAUSED BY A HOLE IN A TANK THAT THEY WERE REMOVING.	
	THEY HAVE LINED THE EXCAVATION WITH PLASTIC, BACK FILLED WITH CLEAN FILL AND	
	WILL BE BACK AT A LATER DATE TO RESUME CLEANUP END CallerRemark - 0306607	
Remark:	Start DECRemark - 0306607 Prior to Sept, 2004 data translation this spill Lead	
	DEC Field was "O'DEE" 03/23/04 IVI ENVIRONMENTAL DISPOSED OF LUST AND 55.45	
	TONS OF CONTAMINATED SOIL. SOME RESIDUAL CONTAMINATION AT OR BELOW TAGM LIMIT	S
	COULD NOT BE EXCAVATED DUE TO STRUCTURAL CONSIDERATIONS. NO FURTHER ACTION	
	REQUIRED AT THIS TIME. END DECRemark - 0306607	

V141 South 1/4-1/2 2147 ft.	86 MAIN ST YONKERS, NY Site 3 of 4 in cluster V		NY LTANKS NY HIST LTANKS	S105135068 N/A
Relative: Higher	LTANKS: Site ID:	67076		
Actual: 14 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier:	08/07/01 Not reported 0104928 0104928 6018 3 jbodee Not reported 08/07/01 17 Tank Failure Not reported Private Dwelling Other		

TC1784877.2s Page 294

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

(Continued)

S105135068

	· · · · · · · · · · · · · · · · · · ·	
	Cleanup Ceased:	11
	Cleanup Meets Standard:	True
	Last Inspection:	//
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
	Spill Closed Dt:	01/16/02
	Remediation Phase:	0
	Date Entered In Computer:	08/07/01
	Spill Record Last Update:	06/05/02
	Spille Namer:	UNKNOWN
	Spiller Company:	CITY OF YONKERS
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	Spiller Address:	86 MAIN ST
	Spiller City,St,Zip:	YONKERS, NY
	Spiller County:	001
	Spiller Contact:	TAKE PRIDE ENVIORNMENTAL
	Spiller Phone:	(914) 969-1006
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	0104928
	DER Facility ID:	64148
	Site ID:	67076
	Operable Unit ID:	843436
	Operable Unit:	01
	Material ID:	533406
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Gallons
	Recovered:	0.00
	Resource Affected:	Soil
	Oxygenate:	False
	Site ID:	Not reported
	Spill Tank Test: Tank Number:	Not reported
	Tank Number. Tank Size:	Not reported Not reported
	Test Method:	Not reported
	Leak Rate:	Not reported
	Gross Fail:	Not reported
	Modified By:	Not reported
	Last Modified:	Not reported
	Test Method:	Not reported
	DEC Remarks:	Start CallerRemark - 0104928 DURING TANK REMOVAL SOIL CONTAMINATION HAS BEEN
		DISCOVERED AT ABOVE LOCATION. INFORMATION FROM CALLER IS VERY LIMITED. END
		CallerRemark - 0104928
	Remark:	Start DECRemark - 0104928 Prior to Sept, 2004 data translation this spill Lead
		DEC Field was "O'DEE" 01/16/02 NFA REQUIRED BY WCHD (DANIELLE JACKSON) END
		DECRemark - 0104928
ц	ST LTANKS:	
П	Region of Spill:	3
	Spill Number:	0104928
	opin Humber.	

Database(s)

EDR ID Number EPA ID Number

S105135068

(Conti	nued)
--------	-------

Investigator:	O'DEE
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	08/07/2001
Spill Time:	14:00
Reported to Department Date	
Reported to Department Time	
SWIS:	55
Spiller Contact:	TAKE PRIDE ENVIORNMENTAL
Spiller Phone:	(914) 969-1006
Spiller Extention:	Not reported
Spiller Name:	CITY OF YONKERS
Spiller Address:	86 MAIN ST
Spiller City,St,Zip:	YONKERS, NY
Facility Contact:	UNKNOWN
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard:	False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	
Investigation Complete:	
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	//
Date Region Sent Summary t	o Central Office: / /
Corrective Action Plan Submi	tted: / /
Date Spill Entered In Comput	er Data File: 08/07/01
Time Spill Entered In Comput	•
Spill Record Last Update:	08/17/01
Is Updated:	True
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	True
Units:	Gallons
Quantity Recovered:	0

Map ID		MAP FINDINGS		
Direction Distance	Ч			
Distance (ft. Elevation) Site		Database(s)	EDR ID Number EPA ID Number
	(Continued)			S105135068
	Unkonwn Quantity Recove			
	Material: Class Type:	#2 FUEL OIL #2 FUEL OIL		
	Times Material Entry In File	e: 24464		
	CAS Number: Last Date:	Not reported 19941207		
	DEC Remarks: Not repo	rted 5 TANK REMOVAL SOIL CONTAMINATION HAS BEE		
		IANK REMOVAL SOIL CONTAMINATION HAS BEEN IATION FROM CALLER IS VERY LIMITED.	N DISCOVERED AT A	BOVE LOCATION.
440				6404004005
142 ENE	265 NORTH BROADWAY		NY LTANKS NY HIST LTANKS	S104621005 N/A
1/4-1/2 2186 ft.	YONKERS, NY			
	LTANKS:			
Relative: Higher	Site ID:	220476		
	Spill Date:	04/14/00		
Actual: 182 ft.	Facility Addr2:	Not reported		
102 11.	Facility ID: Program Number:	0000582 0000582		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	WethD		
	Referred To: Reported to Dept:	Westchester Cnty Health Dept 04/14/00		
	CID:	17		
	Spill Cause:	Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Private Dwelling Tank Tester		
	Cleanup Ceased:	//		
	Cleanup Meets Standard:			
	Last Inspection: Recommended Penalty:	/ / Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Possible release with minimal potential for fire or haza	rd or Known release w	ith
		no damage. DEC Response. Willing Responsible Part	y. Corrective action tak	en.
	Spill Closed Dt: Remediation Phase:	07/20/00 0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spille Namer:			
	Spiller Company: Spiller Phone:	CHARLES COUTINHO (914) 964-0280		
	Spiller Extention:	Not reported		
	Spiller Address:	265 NORTH BROADWAY		
	Spiller City,St,Zip: Spiller County:	YONKERS, NY 001		
	Spiller Contact:	CHARLES COUTINHO		
	Spiller Phone:	(914) 964-0280		
	Spiller Extention:	Not reported		
	DEC Region: Program Number:	3 0000582		
	DER Facility ID:	182360		
	Site ID:	220476		
	Operable Unit ID:	822358		
	Operable Unit:	01		

Database(s)

	S104621005
Material ID:	288825
Material Code:	0003
Material Name:	#6 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	220476
Spill Tank Test:	55
Tank Number:	1
Tank Size:	5000
Test Method:	03
Leak Rate:	0.00
Gross Fail:	F
Modified By:	Spills
Last Modified:	10/01/04
Test Method: DEC Remarks:	Horner EZ Check I or II
DEC Remarks.	Start CallerRemark - 0000582 TANK TEST FAILURE AT ABOVE LOCAITON. PROPERTY OWNER ADVISED OF TEST RESULTS. NO CALL BACK REQUESTED. END CallerRemark
Remark:	0000582 Not reported
IST LTANKS:	
Region of Spill:	3
Spill Number:	0000582
Investigator:	WCHD
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
	Not reported
	04/14/2000
Spill Date: Spill Time:	1
Spill Date:	04/14/2000 12:00
Spill Date: Spill Time:	04/14/2000 12:00 nt Date: 04/14/00
Spill Date: Spill Time: Reported to Departmer	04/14/2000 12:00 nt Date: 04/14/00
Spill Date: Spill Time: Reported to Departmen Reported to Departmen	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO
Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO
Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name: Spiller Address:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported
Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name: Spiller Address: Spiller City,St,Zip:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Extention: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280
Spill Date: Spill Date: Spill Time: Reported to Departmer SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported
Spill Date: Spill Date: Spill Time: Reported to Departmer SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported Tank Test Failure
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause: Resource Affectd:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported Tank Test Failure On Land
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause: Resource Affectd: Water Affected:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported Tank Test Failure On Land Not reported
Spill Date: Spill Date: Spill Time: Reported to Departmer Reported to Departmer SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Address: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Phone: Facility Extention: Spill Cause: Resource Affectd: Water Affected: Spill Source:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported Tank Test Failure On Land Not reported Private Dwelling
Spill Date: Spill Time: Reported to Departmen Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause: Resource Affectd: Water Affected:	04/14/2000 12:00 nt Date: 04/14/00 nt Time: 14:37 55 CHARLES COUTINHO (914) 964-0280 Not reported CHARLES COUTINHO 265 NORTH BROADWAY YONKERS, NY SAME (914) 964-0280 Not reported Tank Test Failure On Land Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

(Continued)

Database(s)

EDR ID Number EPA ID Number

Ceased: / /

Cleanup Ceased		
Cleanup Meets S		True
Last Inspection:		
Recommended P	enalty:	Penalty Not Recommended
Spiller Cleanup D	,	// · · · · · · · · · · · · · · · · · ·
Enforcement Dat	e:	
Investigation Con	nplete:	
UST Involvement		False
Spill Class:		Possible release with minimal potential for fire or hazard or Known release with
		no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:		07/20/00
Date Region Sen	t Summary t	to Central Office: / /
Corrective Action	Plan Submi	itted: / /
Date Spill Entere	d In Comput	er Data File: 04/14/00
Time Spill Entere		ter Data File: Not reported
Spill Record Last	Update:	08/01/00
Is Updated:		False
PBS Number:		Not reported
Tank Number:		1
Tank Size:		5000
Test Method:		Horner EZ Check
Leak Rate Failed		0.00
Gross Leak Rate	-	Talk Test Failures only pass or fail
Material Class Ty	vpe:	Petroleum
Quantity Spilled:		0
Unkonwn Quantit	ty Spilled:	False
Units:		Gallons
Quantity Recover		
Unkonwn Quantit Material:	y Recovered	
		#6 FUEL OIL #6 FUEL OIL
Class Type: Times Material E	ntry In Filo:	2190
CAS Number:	nuy in File.	Not reported
Last Date:		19940728
DEC Remarks:	Not reporte	
Spill Cause:	•	T FAILURE AT ABOVE LOCAITON, PROPERTY OWNER ADVISED OF TEST RESULTS.
opin oddoo.	-	BACK REQUESTED.

V143 SSW 1/4-1/2 2196 ft.	METRO NORTH BUEANA VISTA AVE YONKERS, NY Site 4 of 4 in cluster V			NY LTANKS NY HIST LTANKS	S102674692 N/A
Relative: Higher Actual: 16 ft.	LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected:	76946 06/01/87 Not reported 8701720 8701720 6018 3 dxtraver Not reported 06/01/87 Not reported Tank Overfill SAWMILL RIVER			

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S102674692

METRO NORTH (Continued)

Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Ceased: 05/02/88 Cleanup Meets Standard: True Last Inspection: 06/02/87 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Spill Class: Not reported Spill Closed Dt: 05/02/88 **Remediation Phase:** 0 Date Entered In Computer: 06/08/87 Spill Record Last Update: 05/02/88 Spille Namer: Not reported Spiller Company: CASTLE COAL&OIL Spiller Phone: (212) 823-8800 Spiller Extention: Not reported Spiller Address: Not reported Spiller City,St,Zip: ΖZ Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 Program Number: 8701720 DER Facility ID: 71855 Site ID: 76946 **Operable Unit ID:** 906190 **Operable Unit:** 01 Material ID: 471634 Material Code: 0066A UNKNOWN PETROLEUM Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 0.00 Units: Not reported Recovered: 0.00 Resource Affected: Surface Water Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Not reported Leak Rate: Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported DEC Remarks: Start CallerRemark - 8701720 SAME AS SPILL NO. 8604905 NFA END CallerRemark -8701720 Start DECRemark - 8701720 Prior to Sept, 2004 data translation this spill Lead Remark: DEC Field was "TRAVER WC" / / : WCHD INVESTIGATED. / / : 7/7/87-WCHD INVESTIGATING. / / : 6/2/87-WCHD TO INSPECT CLEAN UP. END DECRemark -8701720 HIST LTANKS:

Region of Spill:

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

METRO NORTH (Continued)

Spill Number: 8701720 TRAVER WC Investigator: Not reported Caller Name: Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported 06/01/1987 Spill Date: Spill Time: 10:00 Reported to Department Date: 06/01/87 Reported to Department Time: 11:51 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: CASTLE COAL&OIL Spiller Address: Not reported Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: (212) 823-8800 Facility Extention: Not reported Spill Cause: Tank Overfill **Resource Affectd:** Surface Water Water Affected: SAWMILL RIVER Spill Source: Other Commercial/Industrial Spill Notifier: Other PBS Number: Not reported 05/02/88 Cleanup Ceased: Cleanup Meets Standard: True Last Inspection: 06/02/87 **Recommended Penalty:** Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 05/02/88 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 06/08/87 Time Spill Entered In Computer Data File: Not reported 05/02/88 Spill Record Last Update: Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Not reported Leak Rate Failed Tank: Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0

S102674692

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	t.) Site		Database(s)	EDR ID Number EPA ID Number
	METRO NORTH (Continued)			S102674692
	Unkonwn Quantity Recove	red: False		
	Material: Class Type:	UNKNOWN PETROLEUM UNKNOWN PETROLEUM		
	Times Material Entry In File			
	CAS Number:	Not reported		
	Last Date: DEC Remarks: / / : WC	19940929 CHD INVESTIGATED. / / : 7/7/87-WCHD INVESTIGATING	.//:	
	6/2/87-W	VCHD TO INSPECT CLEAN UP.		
	Spill Cause: SAME A	S SPILL NO. 8604905 NFA		
144	RESIDENCE		NY LTANKS	S102619369
SE	30 LOCUST HILL	Ν	Y HIST LTANKS	N/A
1/4-1/2 2220 ft.	YONKERS, NY			
Relative:	LTANKS:			
Higher	Site ID:	119934		
Actual:	Spill Date: Facility Addr2:	07/05/97 Not reported		
135 ft.	Facility ID:	9704098		
	Program Number: SWIS:	9704098		
	Region of Spill:	6018 3		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept: CID:	07/07/97 17		
	Spill Cause:	Tank Failure		
	Water Affected: Spill Source:	Not reported Private Dwelling		
	Spill Notifier:	Other		
	Cleanup Ceased:	/ /		
	Cleanup Meets Standard: Last Inspection:	True / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release that creates potential for fire or hazard. DE Responsible Party. Corrective action taken.	C Response. Willing	ig
	Spill Closed Dt:	12/10/97		
	Remediation Phase: Date Entered In Computer:	0		
	Spill Record Last Update:			
	Spille Namer:	Not reported		
	Spiller Company: Spiller Phone:	ZEF BALAJ (718) 654 1310		
	Spiller Extention:	(718) 654-1319 Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip: Spiller County:	NY 001		
	Spiller Contact:	Not reported		
	Spiller Phone:	(914) 738-0266		
	Spiller Extention: DEC Region:	Not reported 3		
	Program Number:	9704098		
	DER Facility ID:	104160		
	Site ID: Operable Unit ID:	119934 1049964		
	Operable Unit:	01		

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

RESIDENCE (Continued)	S102619369
Material ID:	333358
Material Code:	0003
Material Name:	#6 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9704098 NOTIFIER NOTICED OIL SEEPING THROUGH BASEMENT WALL. PERSONNEL FROM PETROLEUM TANK CLEANERS RESPONDED AND DISCOVERED THAT TANK WAS LEAKING. TANK EVACUATED. REMEDIATION TO FOLLOW AS NECESSARY. END CallerRemark - 9704098
Remark:	Start DECRemark - 9704098 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 07/07/97 INSPECTED SITE & ISSUED VIOLATIONS 873.2206 (1) (2) (3) OF SANITARY CODE; DEC TO HANDLE CLEAN UP; 07/08/97 DRAINS VACCEDOUT BUT RESIDUAL REMAINS; MORE CLEAN UP IS NECESSARY; DEC HANDLING ? 12/10/97 # 6 FUEL OIL CEASED DRAINING THROUGH RETAINING WALL; TANK IS IN LOCATION WHERE REMOVAL WOULD JEOPORDIZE THE BUILDING OR THE RETAININGWALL; PERMISSION GIVEN TO ABANDONED IN PLACE; END DECRemark - 9704098
HIST LTANKS:	
Region of Spill:	3
Spill Number:	9704098
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	07/05/1997
Spill Time:	14:00
Reported to Department	
Reported to Department	
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	(914) 738-0266
Spiller Extention:	Not reported
Spiller Name:	ZEF BALAJ
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Facility Contact:	Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S102619369

RESIDENCE (Continued)

Facility Phone: (718) 654-1319 Not reported Facility Extention: Spill Cause: Tank Failure Resource Affectd: On Land Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Other PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 12/10/97 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 07/07/97 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 03/09/98 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True Material: #6 FUEL OIL Class Type: #6 FUEL OIL Times Material Entry In File: 2190 CAS Number: Not reported 19940728 Last Date: DEC Remarks: 07/07/97 INSPECTED SITE ISSUED VIOLATIONS 873.2206 1) 2) 3) OF SANITARY CODE; DEC TO HANDLE CLEAN UP; 07/08/97 DRAINS VACCED OUT BUT RESIDUAL REMAINS; MORE CLEAN UP IS NECESSARY; DEC HANDLING ? 12/10/97 6 FUEL OIL CEASED DRAINING THROUGH RETAINING WALL; TANK IS IN LOCATION WHERE REMOVAL WOULD JEOPORDIZE THE BUILDING OR THE RETAINING WALL; PERMISSION GIVEN TO ABANDONED IN PLACE; Spill Cause: NOTIFIER NOTICED OIL SEEPING THROUGH BASEMENT WALL. PERSONNEL FROM PETROLEUM TANK CLEANERS RESPONDED AND DISCOVERED THAT TANK WAS LEAKING. TANK EVACUATED. REMEDIATION TO FOLLOW AS NECESSARY.

Database(s)

Y145 South	DAN BERNSTEINE CO. 47 MAIN STREET	NY LTANKS S100140713 NY HIST LTANKS N/A
1/4-1/2	YONKERS, NY	
2223 ft.	Site 1 of 2 in cluster Y	
Relative: Higher	LTANKS:	
Actual:	Site ID: Spill Date:	144489 12/27/89
15 ft.	Facility Addr2:	Not reported
	Facility ID: Program Number:	8909519 8909519
	SWIS:	6018
	Region of Spill:	3
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept: CID:	01/03/90 17
	Spill Cause:	Tank Failure
	Water Affected:	NEPPERHEIM CREEK
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Health Department
	Cleanup Ceased:	
	Cleanup Meets Standard:	False / /
	Last Inspection: Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Possible release with minimal potential for fire or hazard or Known release with
		no damage. (Highly Improbable)
	Spill Closed Dt:	05/10/04
	Remediation Phase:	0
	Date Entered In Computer: Spill Record Last Update:	
	Spille Namer:	Not reported
	Spiller Company:	SAME
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	Spiller Address:	Not reported
	Spiller City,St,Zip: Spiller County:	NY 001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	8909519
	DER Facility ID: Site ID:	123154 144489
	Operable Unit ID:	934452
	Operable Unit:	01
	Material ID:	442679
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.: Material FA:	Not reported Petroleum
	Quantity:	0.00
	Units:	Pounds
	Recovered:	0.00
	Resource Affected:	Soil
	Oxygenate:	False

Map ID Direction Distance Distance (ft.) Elevation Site MAP FINDINGS

Database(s)

•	-
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 8909519 NEIGHBOR AT 51 MAIN ST. COMPLAINED OF GAS FUMES CAUER FOUND #2 OR FUMES EMANATING FROM 47 ST. UG TANK SUSPECT LEAKING BERNSTEINE CONTACTING TYREE TO CLEAN UP AND RELINE END CallerRemark - 89
Remark:	Start DECRemark - 8909519 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" END DECRemark - 8909519
IST LTANKS:	
Region of Spill:	3
Spill Number:	8909519
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	12/27/1989
Spill Time:	12:00
Reported to Department	
Reported to Department 1	
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	
Water Affected:	NEPPERHEIM CREEK
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Health Department
PBS Number:	Not reported
Cleanup Ceased:	/ / False
Cleanup Meets Standard:	
Last Inspection: Recommended Penalty:	
Spiller Cleanup Date:	Penalty Not Recommended / /
Enforcement Date:	
Investigation Complete:	
UST Involvement:	False

Database(s)

EDR ID Number EPA ID Number

S100140713

DAN BERNSTEINE CO. (Continued)

Spill Class:

no damage. (Highly Improbable) Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 01/05/90 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 05/18/93 Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL #2 FUEL OIL Class Type: Times Material Entry In File: 24464 CAS Number: Not reported 19941207 Last Date: DEC Remarks: Not reported NEIGHBOR AT 51 MAIN ST. COMPLAINED OF GAS FUMES CAUER FOUND 2 OR FUMES Spill Cause: EMANATING FROM 47 ST. UG TANK SUSPECT LEAKING MR. BERNSTEINE CONTACTING TYREE TO CLEAN UP AND RELINE

Y146 South 1/4-1/2 2241 ft.	NYNEX 40 MAIN ST. YONKERS, NY		NY LTANKS NY HIST LTANKS	U003075492 N/A
	Site 2 of 2 in cluster Y			
Relative: Higher Actual: 17 ft.	LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept:	78203 09/23/88 Not reported 8805747 8805747 6018 3 UNASSIGNED Not reported 10/06/88		
	CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement:	17 Tank Test Failure Not reported Commercial/Industrial Tank Tester 06/18/53 True / / Penalty Not Recommended False		

Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U003075492

	(0001111000)	
	Spill Closed Dt:	02/10/92
	Remediation Phase:	0
	Date Entered In Computer:	10/17/88
	Spill Record Last Update:	
	Spille Namer:	Not reported
	Spiller Company:	NYNEX
	Spiller Phone:	(516) 747-3841
	Spiller Extention:	Not reported
	Spiller Address:	JOHN ALBARANO
	Spiller City,St,Zip:	ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	8805747
	DER Facility ID:	72795
	Site ID:	78203
	Operable Unit ID:	920910
	Operable Unit:	01
	Material ID:	457656
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Not reported
	Recovered:	0.00
	Resource Affected:	Groundwater
	Oxygenate:	False
	Site ID:	78203
	Spill Tank Test:	9291
	Tank Number:	Not reported
	Tank Size:	0
	Test Method:	00
	Leak Rate:	0.00
	Gross Fail:	Not reported
	Modified By:	Spills
	Last Modified:	10/01/04
	Test Method:	Unknown
	DEC Remarks:	Start CallerRemark - 8805747 EXCAVATED. PIPING WILL BE REPAIRED. WILL BE
	DEC Remaine.	RETESTED. PETRO TITE, LEAK RATE UNDETERMINABLE. 10,000 GAL TANK. PLAN TO
		REPAIR. WILL CONTACT J. OKESSON WITH TIGHT RETEST OR PLAN TO PULL TANK. SEE
		HISTORY END CallerRemark -8805747
	Remark:	Start DECRemark - 8805747 Prior to Sept, 2004 data translation this spill Lead
	Remark.	DEC Field was " " 11/03/88: 10000 TANK FAILED PETRO-TITE RETEST AT785 GPH.
		TESTED BY TANK TECH CORP, AS PER TANK TEST REPORT. END DECRemark
		- 8805747
ц	IST LTANKS:	
П	Region of Spill:	3
	Spill Number:	8805747
	Investigator:	Not reported
	Caller Name:	Not reported
		Not reported
	Caller Agency: Caller Phone:	Not reported
	Caller Extension:	•
	Caller Extension:	Not reported

Database(s)

EDR ID Number EPA ID Number

NYNEX (Continued)

Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 09/23/1988 Spill Time: 14:00 Reported to Department Date: 10/06/88 Reported to Department Time: 10:46 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: NYNEX Spiller Address: JOHN ALBARANO Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: (516) 747-3841 Facility Extention: Not reported Spill Cause: Tank Test Failure Resource Affectd: Groundwater Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: Tank Tester PBS Number: Not reported Cleanup Ceased: 06/18/53 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 02/10/92 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 10/17/88 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 02/10/92 Is Updated: False PBS Number: Not reported Not reported Tank Number: Tank Size: 0 Not reported Test Method: Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False #2 FUEL OIL Material: #2 FUEL OIL Class Type: Times Material Entry In File: 24464 Not reported CAS Number: Last Date: 19941207

U003075492

Map ID Direction		MAP FINDINGS		
Distance	`			
Distance (ft				EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	NYNEX (Continued)			U003075492

CORP, AS PER TANK TEST REPORT.

11/03/88: 10000 TANK FAILED PETRO-TITE RETEST AT -.785 GPH. TESTED BY TANK TECH

DEC Remarks:

Material Code:

Material Name:

Case No.:

0001

#2 Fuel Oil

Not reported

	CORP, AS PER TANK TEST REPORT. Spill Cause: EXCAVATED. PIPING WILL BE REPAIRED. WILL BE RETESTED. PETRO TITE, LEAK R/ UNDETERMINABLE. 10,000 GAL TANK. PLAN TO REPAIR. WILL CONTACT J. OKESSO TIGHT RETEST OR PLAN TO PULL TANK. SEE HISTORY				
147 SSE 1/4-1/2 2256 ft.	PBS 25 NORTH BROADWAY YONKERS, NY	NY LTANKS S105999630 N/A			
Relative: Higher	LTANKS: Site ID:	181457			
Ingliei	Spill Date:	08/14/03			
Actual:	Facility Addr2:	Not reported			
41 ft.	Facility ID:	0305128			
	Program Number:	0305128			
	SWIS:	6018			
	Region of Spill:	3			
	Investigator:	JBODee			
	Referred To:	WESTCHESTER CNTY HEALTH D			
	Reported to Dept:	08/14/03			
	CID:	17 Tank Test Feilure			
	Spill Cause: Water Affected:	Tank Test Failure			
	Spill Source:	Not reported Private Dwelling			
	Spill Notifier:	Tank Tester			
	Cleanup Ceased:				
	Cleanup Meets Standard:				
	Last Inspection:				
	Recommended Penalty:	Penalty Not Recommended			
	UST Involvement:	False			
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.			
	Spill Closed Dt:	08/03/05			
	Remediation Phase:	0			
	Date Entered In Computer:				
	Spill Record Last Update:				
	Spille Namer:	TREACY SAYERES			
	Spiller Company:	Not reported			
	Spiller Phone:	(914) 965-9127			
	Spiller Extention:				
	Spiller Address: Spiller City,St,Zip:	25 NORTH BROADWAY YONKERS, NY 10701-			
	Spiller County:	001			
	Spiller Contact:	TREACY SAYERES			
	Spiller Phone:	(914) 965-9127			
	Spiller Extention:	Not reported			
	DEC Region:	3			
	Program Number:	0305128			
	DER Facility ID:	152162			
	Site ID:	181457			
	Operable Unit ID:	873412			
	Operable Unit:	01			
	Material ID:	502394			
	Material Carles	0001			

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	PBS (Continued)	Potroloum		S105999630
	Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks:	Petroleum 0.00 Gallons 0.00 Soil False Not reported Not reported Start CallerRemark - 0305128 IT IS VAULTED TANK IN REMOVE THE TANK END CallerRemark - 0305128 Start DECRemark - 0305128 Prior to Sept, 2004 data tra DEC Field was "WCHD-JACKSON" August 3, 2005: T	anslation this spill Lea	ad
X148 East 1/4-1/2	HUDSON VIEW 104 ASHBURTON AVEN YONKERS, NY	PIPING WAS REPAIRED. BASED UPON INFORMATIC IS REQUIRED AT THIS TIME. jod END DECRemark - 0	ON PROVIDED TO D	
2358 ft.	Site 2 of 3 in cluster X			
Relative: Higher Actual: 177 ft.	US BROWNFIELDS: Recipient Name: Project Name: EPA ID: Region Number: Latitude: Longitude: Assessment Date: Clean up Date: Entity Type:	City of Yonkers Yonkers, NY Not reported 2 Not reported Not reported Not reported Not reported Not reported		
X149 East 1/4-1/2 2358 ft.	104 ASHBURTON AVE 104 ASHBURTON AVE. YONKERS, NY 10701		NY VCP	S104825356 N/A
Relative: Higher Actual: 177 ft.	Site Code: 55 Assessment: N Env Problems: T ta S ex co	CP 7982 ot reported he primary contaminants of concern at this site are SVOCs relati rr, petroleum, ash, and coal cinders. Soil beneath the cover syst CGs for polycyclic aromatic hydrocarbons (PAHs). Groundwate xceeds water quality standards for benzene and ethyl benzene. ontamination appears to be coming from an upgradient source. he site is located at the corner of Ashburton Avenue and Alexand	tem exceeds r beneath the site However this	

Database(s)

EDR ID Number EPA ID Number

104 ASHBURTON AVE (Continued)

the City of Yonkers, Westchester County. Land use surrounding the site is industrial, commercial and institutional. The site is currently a commercial bakery operated bythe Greyston Foundation for homeless and hard-to-employ people. The site was formerly a portion of a manufactured gas plant. Raw materials were stored on this parcel, and gas purification may have been performed here. A LNAPL and DNAPL recovery system was installed, consisting of a funnel and gate system and collection sump. A soil cap was installed over contaminated soil, and a subslab venting system was constructed under the bakery building. The remedy was completed in March 2004, and the project is in the Operation, Monitoring and Maintenance phase.

Z150 South 1/4-1/2 2427 ft.	FORMER TEUTONIA HALL SITE N 41-51 BUENA VISTA AVENUE YONKERS, NY 10701		NY VCP	S107787028 N/A
	Site 1 of 4 in cluster 2	Ζ		
Relative: Higher	VCP: Program Type:	BCP		
Actual: 37 ft.	Site Code: Assessment:	351168 On-site soil vapor is contaminated with volatile organic compounds from an unidentified source. However, the site is vacant and therefore, exposures not expected. Additional investigations in to the source of the VOCs will be conducted. Several areas of metal and semi-volatile organic compound contamination have been identified in on-site soil. However, the site is vacant and access is restricted therefore, exposures are not expected.	are	
	Env Problems:	Information submitted with the BCP application indicated perchloroethene contamination in soil vapor.	(PCE)	
	Site Desc:	The investigation of this site is currently being proposed under the Brownfi Cleanup Program (BCP). The site is .5 acre, consisting of 3 adjacent tax le and is located at 41-51 Buena Vista Avenue in the City of Yonkers, Westch County. The site is located in downtown Yonkers and currently consists of vacant buildings on two-thirds of the site which were formerly used as industrial buildings. There are two vacant three-story buildings, a vacant the story building with an ajoining one-story addition and a parking area. This site is bounded to the west by the Metro North/Amtrack active railroad line, the north by an old railroad repair shop known as the "trolley barn&qu building, to the east by Buena Vista Avenue and several parking/vacant lot one apartment building east of the street, and to the south by an automobi repair garage. Historically this site has been used for a variety of industrial and petroleum-related commercial purposes, includingbut not lim to, auto repair, a garage with underground storage tanks, a knitting mill, a dry cleaner, ad toy manufacturer, a jewelry manufacturer and a printing facility. Contaminenets which known or suspected to affect the soil, sediment andor soil gas are petroleum, chlorinated solvents, SVOC's and This BCP application was approved and a Citizen Participation Plan is und review. A Remedial Investigation Work plan is expected in 2006.	ots nester four wo to uot; s and le nited metals.	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

AA151 ENE 1/4-1/2 2441 ft.	APT. BUILDING 287 PALLISADES AVE YONKERS, NY	NY LTANKS S100782269 NY HIST LTANKS N/A
2441 11.	Site 1 of 2 in cluster AA	
Relative:		
Higher	LTANKS:	
	Site ID:	286211
Actual:	Spill Date:	12/17/93
226 ft.	Facility Addr2:	Not reported
	Facility ID:	9311286
	Program Number:	9311286
	SWIS: Region of Spill:	6018 3
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept:	12/17/93
	CID:	Not reported
	Spill Cause:	Tank Failure
	Water Affected:	Not reported
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Tank Tester
	Cleanup Ceased:	11
	Cleanup Meets Standard:	True
	Last Inspection:	//
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Spill Classed Dt	Responsible Party. Corrective action taken.
	Spill Closed Dt: Remediation Phase:	11/12/97 0
	Date Entered In Computer:	
		02/25/99
	Spille Namer:	Not reported
	Spiller Company:	ABE MARGI
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	Spiller Address:	287 PALISADES AVE.
	Spiller City,St,Zip:	YONKERS WEST., ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	9311286
	DER Facility ID:	231965
	Site ID:	286211 993162
	Operable Unit ID: Operable Unit:	01
	Material ID:	567243
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Pounds
	Recovered:	0.00
	Resource Affected:	Soil
	Oxygenate:	False

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S100782269

APT. BUILDING (Continued) Not reported Start CallerRemark - 9311286 NONE END CallerRemark - 9311286

Start DECRemark - 9311286 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST. END DECRemark - 9311286

HIST LTANKS: F

Site ID:

Spill Tank Test:

Tank Number:

Test Method:

Tank Size:

Leak Rate:

Gross Fail: Modified By:

Last Modified:

Test Method:

Remark:

DEC Remarks:

IST LTANKS:	
Region of Spill:	3
Spill Number:	9311286
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	12/17/1993
Spill Time:	15:58
Reported to Department Date	: 12/17/93
Reported to Department Time	: 15:57
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	ABE MARGI
Spiller Address:	287 PALISADES AVE.
Spiller City,St,Zip:	YONKERS WEST.
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard:	True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing

Database(s)

EDR ID Number EPA ID Number

S100782269

U003645241

N/A

APT. BUILDING (Continued)

Responsible Party. Corrective action taken. Spill Closed Dt: 11/12/97 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 01/10/94 Time Spill Entered In Computer Data File: Not reported 02/25/99 Spill Record Last Update: Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Pounds Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported 19941207 Last Date: 09/27/95: This is additional information about material spilled from the DEC Remarks: translation of the old spill file: TANK TEST. Spill Cause: NONE

AB152 East 1/4-1/2 2449 ft.	YONKERS GENERAL HOSPIT 2 PARK AVENUE YONKERS, NY	AL NY LTANKS NY Spills NY MANIFEST NY Hist Spills	0U 1
Relative:	Site 1 of 3 in cluster AB	NY HIST LTANKS	
Higher Actual:	LTANKS: Site ID: Spill Date:	107862 08/15/88	
182 ft.	Facility Addr2:	Not reported	
	Facility ID:	8804274	
	Program Number:	8804274	
	SWIS: Region of Spill:	6018 3	
	Investigator:	S SLINGERLAND	
	Referred To:	Not reported	
	Reported to Dept:	08/15/88	
	CID:	17	
	Spill Cause:	Tank Test Failure	
	Water Affected:	Not reported	
	Spill Source:	Institutional, Educational, Gov., Other	
	Spill Notifier:	Tank Tester	
	Cleanup Ceased:	11/30/89	
	Cleanup Meets Standard:	True	
	Last Inspection:	/ / Departure Nat Decommended	
	Recommended Penalty: UST Involvement:	Penalty Not Recommended False	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willin Responsible Party. Corrective action taken.	ng

Database(s)

EDR ID Number EPA ID Number

U003645241

YONKERS GENERAL HOSPITAL (Continued)

Spill Closed Dt: 11/30/89 0 **Remediation Phase:** Date Entered In Computer: 08/16/88 Spill Record Last Update: 12/12/03 Spille Namer: Not reported YONKERS GENERAL HOSPITAL Spiller Company: Spiller Phone: (914) 964-7566 Spiller Extention: Not reported Spiller Address: Not reported Spiller City, St, Zip: ΖZ 001 Spiller County: Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 Program Number: 8804274 DER Facility ID: 94824 107862 Site ID: Operable Unit ID: 921434 Operable Unit: 01 Material ID: 456227 Material Code: 0002 Material Name: #4 Fuel Oil Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 Groundwater **Resource Affected:** Oxygenate: False Site ID: 107862 Spill Tank Test: 9019 Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: 0.00 Gross Fail: Not reported Modified By: Spills Last Modified: 10/01/04 Test Method: Unknown Start CallerRemark - 8804274 LEAK IN VENT LINE (VISIBLE HOLE) TO REPAIR AND DEC Remarks: RETEST. 20K. LEAK BEING REPAIRED. TESTING WAS STOPPED WHEN LEAK WAS NOTICED. WILL BE RETESTED 8/22 WILL CALL BACK WITH UPDATES END CallerRemark - 8804274 Remark: Not reported NY Spills: Site ID: 324199 Facility Addr2: Not reported Facility ID: 9811236 Spill Number: 9811236 Facility Type: ER SWIS: 6018 Region of Spill: 3 Investigator: WCHD Referred To: Westchester Cnty Health Dept Spill Date: 12/07/98 Reported to Dept: 12/07/98

Database(s)

EDR ID Number EPA ID Number

U003645241

YONKERS GENERAL H	IOSPITA	L (Continued)	U003645241
		17	
CID:			
Spill Cause:		Equipment Failure	
Water Affected:		Not reported	
Spill Source:		Commercial/Industrial	
Spill Notifier:		Responsible Party	
Cleanup Ceased:			
Cleanup Meets Std	1:	True	
Last Inspection:	10	/ /	
Recommended Per	nalty:	Penalty Not Recommended	
UST Trust:		False	
Spill Class:		Known release that creates potential for fire or hazard. DEC Re Responsible Party. Corrective action taken.	sponse. Willing
Spill Closed Dt:		12/07/98	
Remediation Phase:		0	
Date Entered In Co	mputer:	12/07/98	
Spill Record Last U			
Spiller Name:		GREG DOERR	
Spiller Company:		YONKERS GENERAL HOSPITAL	
Spiller Address:		2 PARK AVENUE	
Spiller City,St,Zip:		YONKERS, NY 10703-	
Spiller Company:		001	
Spiller Phone:		(914) 964-7518	
Contact Name:		GREG DOERR	
Contact Phone:		(914) 964-7518	
DEC Region:		3	
Program Number:		9811236	
DER Facility ID:		261146	
Site ID:		324199	
Operable Unit ID:		1068628	
Operable Unit:		01	
Material ID:		315082	
Material Code:		0002	
Material Name:		#4 Fuel Oil	
Case No.:		Not reported	
Material FA:		Petroleum	
		50.00	
Quantity: Units:		Gallons	
Recovered:		0.00	
Recovered: Resource Affected:		Soil	
Oxygenate:		False	
	Start Col	erRemark - 9811236 FUEL OIL SUPPLY WAS SWITCHED FR	ΟΜ ΟΝΕ ΤΔΝΚ ΤΟ
		R. A SHORT TIME LATER, FUEL OIL WAS DISCOVERED SF	
		INTO EMERGENCY ROOM PARKING LOT. SOME INTO STO	
		IT WAS EQUIPMENT FAILURE OR HUMAN ERROR. WEST	
		MENT IS ON SCENE. FIRE DEPARTMENT WAS ON THE SC	
		WAS SHUT DOWN. EASTMAN BIO IS ON SCENE PERFORI	
		ECTED AND REPAIRED IF NECESSARY. END CallerRemark	
			- 3011230
Remark. I	Not repo		
NY MANIFEST:			
Ν	No Manif	est Records Available	
NY Hist Spills:			
Region of Spill:		3	
Spill Number:		9811236	
Investigator:		WCHD	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

YONKERS GENERAL HOSPITAL (Continued)

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 12/07/1998 12:30 Reported to Dept Date/Time: 12/07/98 14:14 SWIS: 55 Spiller Name: YONKERS GENERAL HOSPITAL Spiller Contact: GREG DOERR Spiller Phone: (914) 964-7518 GREG DOERR Spiller Contact: Spiller Phone: (914) 964-7518 Spiller Address: 2 PARK AVENUE Spiller City, St, Zip: YONKERS, NY 10703-Spill Cause: Equipment Failure Reported to Dept: On Land Water Affected: Not reported Spill Source: 01 Spill Notifier: **Responsible Party** PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Std: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Dt: 11 Enforcement Date: 11 Invstgn Complete: 11 UST Involvement: False Known release that creates potential for fire or hazard. DEC Response. Willing Spill Class: Responsible Party. Corrective action taken. 12/07/98 Spill Closed Dt: Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 12/07/98 Date Spill Entered In Computer Data File: Not reported Update Date: 08/18/99 Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 50 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True Material: #4 FUEL OIL Class Type: #4 FUEL OIL Times Material Entry In File: 1751 CAS Number: Not reported Last Date: 19941205 12/7/98 OIL SPILL CLEANED BY BY EASTMOND. S. GOREAU WCHD INSPECTED SITE. DEC Remarks:

U003645241

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

YONKERS GENERAL HOSPITAL (Continued)

U003645241

Remark: FUEL OIL SUPPLY WAS SWITCHED FROM ONE TANK TO ANOTHER. A SHORT TIME LATER, FUEL OIL WAS DISCOVERED SPILLING FROM VENT. SPILLED INTO EMERGENCY ROOM PARKING LOT. SOME INTO STORM DRAINS. UNKNOWN FOR SURE IF IT WAS EQUIPMENT FAILURE OR HUMAN ERROR.WESTCHESTER COUNTY HEALTH DEPARTMENT IS ON SCENE. FIRE DEPARTMENT WAS ON THE SCENE AND LEFT. FUEL OIL SYSTEM WAS SHUT DOWN. EASTMAN BIO IS ON SCENE PERFORMING CLEAN UP. SYSTEM TO BE INSPECTED AND REPAIRED IF NECESSARY.

HIST LTANKS:	
Region of Spill:	3
Spill Number:	8804274
Investigator:	D. SLINGERLAND
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	08/15/1988
Spill Time:	12:00
Reported to Department Date	
Reported to Department Time	
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	YONKERS GENERAL HOSPITAL
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	(914) 964-7566
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Cleanup Ceased:	11/30/89
Cleanup Meets Standard:	True
Last Inspection:	/ /
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	/ /
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	False
Spill Class:	Not reported
Spill Closed Dt:	11/30/89
Date Region Sent Summary to	
Corrective Action Plan Submi	
Date Spill Entered In Compute	
Time Spill Entered In Comput	
Spill Record Last Update:	11/30/89
Is Updated:	False
PBS Number:	Not reported
i be inditibet.	

Map ID Direction		MAP FINDINGS		
Distance Distance (fi Elevation	.) Site		Database(s)	EDR ID Number EPA ID Number
	YONKERS GENERAL HOSPIT	AL (Continued)		U003645241
	Tank Number:	Not reported		
	Tank Size:	0		
	Test Method:	Not reported		
	Leak Rate Failed Tank: Gross Leak Rate:	0.00 Not reported		
	Material Class Type:	Petroleum		
	Quantity Spilled:	0		
	Unkonwn Quantity Spilled:			
	Units:	Gallons		
	Quantity Recovered: Unkonwn Quantity Recove	0 red: False		
	Material:	#4 FUEL OIL		
	Class Type:	#4 FUEL OIL		
	Times Material Entry In File	e: 1751		
	CAS Number:	Not reported		
	Last Date:	19941205		
		5: This is additional information about material spilled from the on of the old spill file: TOPPED WITH 2 FUEL.		
		I VENT LINE VISIBLE HOLE) TO REPAIR AND RETEST. 201	K. LEAK BEING	3
		ED. TESTING WAS STOPPED WHEN LEAK WAS NOTICED		
	CALL BA	ACK WITH UPDATES		
AB153 Fast	ST JOHNS PARK CARE PAVIL	L	NY LTANKS	S105455685
East 1/4-1/2 2449 ft. Relative: Higher	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID:	120252	NY LTANKS	S105455685 N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date:	120252 12/02/02	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2:	120252 12/02/02 Not reported	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID:	120252 12/02/02 Not reported 0208995	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2:	120252 12/02/02 Not reported	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill:	120252 12/02/02 Not reported 0208995 0208995 6018 3	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reforted to Dept: CID: Spill Cause: Water Affected:	120252 12/02/02 Not reported 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reforted to Dept: CID: Spill Cause: Water Affected: Spill Source:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reforted to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Referred To: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / /	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Referred To: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Referred To: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / /	NY LTANKS	
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reforted to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken.		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. / /		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. / /		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. / / 1 12/02/02		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Nourfier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spill Record Last Update:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. / / 1 12/02/02 09/08/03 SAME		N/A
East 1/4-1/2 2449 ft. Relative: Higher Actual:	2 PARK AVE YONKERS, NY Site 2 of 3 in cluster AB LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	120252 12/02/02 Not reported 0208995 0208995 6018 3 WCHD Westchester Cnty Health Dept 12/02/02 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester // False // Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Responsible Party. Corrective action taken. // 1 12/02/02 09/08/03		N/A

Database(s)

EDR ID Number EPA ID Number

S105455685

		0103
Spiller Extention:	Not reported	
Spiller Address:	Not reported	
Spiller City,St,Zip:	***Update***, ZZ	
Spiller County:	001	
Spiller Contact:	LEE VIVARES	
Spiller Phone:	(914) 964-7565	
Spiller Extention:	Not reported	
DEC Region:	3	
Program Number:	0208995	
DER Facility ID:	104423	
Site ID:	120252	
Operable Unit ID:	860419	
Operable Unit:	01	
Material ID:	515983	
Material Code:	0002	
Material Name:	#4 Fuel Oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Soil	
Oxygenate:	False	
Site ID:	120252	
Spill Tank Test:	2332	
Tank Number:	2	
Tank Size:	20000	
Test Method:	03	
Leak Rate:	0.00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified: Test Method:	10/01/04	
DEC Remarks:	Horner EZ Check I or II Start CallerBarnark 0208005 fail, plumbing will be isolated and tapk will be	
DEC Remarks.	Start CallerRemark - 0208995 fail - plumbing will be isolated and tank will be retested. END CallerRemark - 0208995	
Remark:	Start DECRemark - 0208995 Prior to Sept, 2004 data translation this spill Lead	4
Remark.	DEC Field was "WCHD - SCHNEIDER" END DECRemark - 0208995	•
Site ID:	107860	
Spill Date:	12/16/03	
Facility Addr2:	Not reported	
Facility ID:	0310684	
Program Number:	0310684	
SWIS:	6018	
Region of Spill:	3	
Investigator:	WCHD	
Referred To:	Westchester Cnty Health Dept	
Reported to Dept:	12/16/03	
CID:	17	
Spill Cause:	Tank Test Failure	
Water Affected:	Not reported	
Spill Source:	Institutional, Educational, Gov., Other	
Spill Notifier:	Tank Tester	
Cleanup Ceased:		
Cleanup Meets Standard:	False	
Last Inspection:		
Recommended Penalty:	Penalty Not Recommended	

EDR ID Number Database(s) EPA ID Number

ST JOHNS PARK CARE PAVILL (Continued)

S105455685

UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
Opin Olass.	Responsible Party. Corrective action taken.
Spill Closed Dt:	
Remediation Phase:	1
Date Entered In Computer	
Spill Record Last Update:	12/26/03
Spille Namer:	Not reported
Spiller Company:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City, St, Zip:	***Update***, ZZ
Spiller County:	001
Spiller Contact:	LEE VIVARES
Spiller Phone:	(914) 964-7565
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	0310684
DER Facility ID:	94824
Site ID:	Not reported
Operable Unit ID:	Not reported
Operable Unit:	Not reported
Material ID:	Not reported
Material Code:	Not reported
Material Name:	Not reported
Case No.:	Not reported
Material FA:	Not reported
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Site ID:	107860
Spill Tank Test:	3435
Tank Number:	1
Tank Size:	20000
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 0310684 TEST METHOD IS EZY 3 LOCATOR PLUS. TEST FAILED.
	END CallerRemark - 0310684
Remark:	Start DECRemark - 0310684 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WCHD - JACKSON" END DECRemark - 0310684
Site ID:	407064
Site ID:	107861
Spill Date:	01/19/04
Facility Addr2:	Not reported
Facility ID: Brogram Number:	0311754
Program Number: SWIS:	0311754
	6018 3
Region of Spill: Investigator:	S WCHD
Referred To:	WESTCHESTER CNTY HEALTH D
Nelelleu IV.	

Database(s)

EDR ID Number EPA ID Number

S105455685

ST JOHNS PARK CARE PAVILL (Continued)

01/19/04 Reported to Dept: CID: 17 Tank Test Failure Spill Cause: Water Affected: Not reported Spill Source: Institutional, Educational, Gov., Other Spill Notifier: Tank Tester Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended **UST Involvement:** False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11/16/04 **Remediation Phase:** Date Entered In Computer: 01/19/04 Spill Record Last Update: 11/26/04 Spille Namer: Not reported Spiller Company: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Address: Not reported Spiller City, St, Zip: ***Update***, ZZ Spiller County: 001 Spiller Contact: LEE VIVARES Spiller Phone: (914) 964-7716 Spiller Extention: Not reported **DEC Region:** 3 Program Number: 0311754 DER Facility ID: 94824 Site ID: Not reported **Operable Unit ID:** Not reported **Operable Unit:** Not reported Material ID: Not reported Not reported Material Code: Not reported Material Name: Case No .: Not reported Material FA: Not reported Quantity: Not reported Not reported Units: Recovered: Not reported Not reported **Resource Affected:** Oxygenate: Not reported Site ID: 107861 Spill Tank Test: 3488 Tank Number: 1 Tank Size: 20000 Test Method: 03 Leak Rate: 0.00 Not reported Gross Fail: Modified By: Spills Last Modified: 10/01/04 Horner EZ Check I or II Test Method: DEC Remarks: Start CallerRemark - 0311754 TANK TEST FAILED END CallerRemark - 0311754 Remark: Start DECRemark - 0311754 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 11/22/04: Letter to Greg Doerr. St. John's Riverside Hospital, dated 16Nov2004. Spill closed by Frederick Beck, Jr.,

Map ID Direction		MAP FINDINGS		
Distance Distance (ft. Elevation	.) Site		Database(s)	EDR ID Number
	ST JOHNS PARK CARE PAVIL	L (Continued)		S105455685
		WCDOH. END DECRemark- 0311754		
154	CITY OF YONKERS		NY LTANKS	S105230219
South /4-1/2 2450 ft.	55-57 HUDSON ST YONKERS, NY		NY HIST LTANKS	N/A
	Site 2 of 4 in cluster Z			
Relative: ligher	LTANKS:			
lighei	Site ID:	59525		
ctual:	Spill Date:	10/08/01		
0 ft.	Facility Addr2:	Not reported		
	Facility ID:	0107061		
	Program Number:	0107061		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	WCHD		
	Referred To:	Westchester Cnty Health Dept		
	Reported to Dept: CID:	10/08/01 17		
	Spill Cause:	Tank Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Notifier:	Other		
	Cleanup Ceased:	/ /		
	Cleanup Meets Standard:	True		
	Last Inspection:	//		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard Responsible Party. Corrective action taken.	. DEC Response. Willi	ng
	Spill Closed Dt:	11/23/01		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:	04/29/02		
	Spille Namer:	MR HANIGAN		
	Spiller Company:	CITY OF YONKERS		
	Spiller Phone: Spiller Extention:	(914) 377-6500 Not reported		
	Spiller Address:	86 MAIN ST		
	Spiller City,St,Zip:	YONKERS, NY		
	Spiller County:	001		
	Spiller Contact:	MARISOL PITTS		
	Spiller Phone:	(914) 969-1006		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	Program Number:	0107061		
	DER Facility ID:	58264		
	Site ID:	59525		
	Operable Unit ID:	845256		
	Operable Unit:	01		
	Material ID:	531898		
	Material Code:	0001		
	Material Name:	#2 Fuel Oil		
		Not reported		
	Material FA:	Petroleum		
	Quantity:	0.00		
	Units:	Gallons		

Database(s)

CITY OF YONKERS (Continue	ed) S105230219
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0107061 DURING TANK REMOVAL AT ABOVE LOCATION SOIL
DEC Remains.	CONTAMINATION HAS BEEN DISCOVERED. TANK REMOVAL AT ABOVE LOCATION SOIL CONTAMINATION HAS BEEN DISCOVERED. TANKS HAVE BEEN REMOVED AND STORED ON SITE. AREA TO BE EXCAVATED AND FURHTER REMEDIATION IS PENDING. END CallerRemark - 0107061
Remark:	Start DECRemark - 0107061 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WCDOH" 10/08/2001 TAKE PRIDE ADVISED NEED TO NOTIFY WCDOH. 11/23/2001 LETTER SENT TO CITY OF YONKERS BY F. BECK (WCDOH); BASED ON REVIEW OF CLOSURE REPORT, WCDOH REQUIRES NO FURTHER ACTION. END DECRemark - 0107061
HIST LTANKS:	
Region of Spill:	3
Spill Number:	0107061
Investigator:	WCDOH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	10/08/2001
Spill Time:	12:35
Reported to Department D	
Reported to Department T	
SWIS:	55
Spiller Contact:	MARISOL PITTS
Spiller Phone:	(914) 969-1006
Spiller Extention:	Not reported
Spiller Name:	CITY OF YONKERS
Spiller Address:	86 MAIN ST
Spiller City,St,Zip:	YONKERS, NY
Facility Contact:	MR HANIGAN
Facility Phone:	(914) 377-6500
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard:	False
Last Inspection:	

Map ID	
Direction	
Distance	
Distance (ft	.)
Elevation	Site

Database(s) EDR ID Number EPA ID Number

S105230219

CITY OF YONKERS (Continued)

Recommended P	enalty:	Penalty Not Recommended
Spiller Cleanup D		
Enforcement Date		
Investigation Con		
UST Involvement	•	False
Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willing
Opini Cidos.		Responsible Party. Corrective action taken.
Spill Closed Dt:		
	t Summary t	o Central Office: / /
Corrective Action		
Date Spill Entered		
Time Spill Entered	•	
Spill Record Last		10/23/01
Is Updated:	-	True
PBS Number:		Not reported
Tank Number:		Not reported
Tank Size:		Not reported
Test Method:		Not reported
Leak Rate Failed	Tank:	Not reported
Gross Leak Rate:	:	Not reported
Material Class Ty	vpe:	Petroleum
Quantity Spilled:		0
Unkonwn Quantit	y Spilled:	True
Units:		Gallons
Quantity Recover	ed:	0
Unkonwn Quantit	y Recovered	d: True
Material:		#2 FUEL OIL
Class Type:		#2 FUEL OIL
Times Material Er	ntry In File:	24464
CAS Number:		Not reported
Last Date:		19941207
DEC Remarks:		TAKE PRIDE ADVISED NEED TO NOTIFY WCDOH.
Spill Cause:		ANK REMOVAL AT ABOVE LOCATION SOIL CONTAMINATION HAS BEEN DISCOVERED.
		VE BEEN REMOVED AND STORED ON SITE. AREA TO BE EXCAVATED AND FURHTER
	REMEDIAT	FION IS PENDING.

AA155 ENE 1/4-1/2 2495 ft.	APPMAN APT COMPLEX 290 PALISADE AVE YONKERS, NY Site 2 of 2 in cluster AA		NY LTANKS NY HIST LTANKS	S100140262 N/A
Relative: Higher	LTANKS:			
	Site ID:	300277		
Actual:	Spill Date:	01/07/88		
256 ft.	Facility Addr2:	Not reported		
	Facility ID:	8708582		
	Program Number:	8708582		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	jeokesso		
	Referred To:	Not reported		
	Reported to Dept:	01/07/88		
	CID:	17		
	Spill Cause:	Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Tank Tester		

Database(s)

EDR ID Number EPA ID Number

APPMAN APT COMPLEX (Continued)

Cleanup Ceased: 01/06/89 Cleanup Meets Standard: True Last Inspection: 01/06/89 Recommended Penalty: Penalty Not Recommended **UST Involvement:** False Spill Class: Not reported Spill Closed Dt: 01/06/89 Remediation Phase: 0 Date Entered In Computer: 01/26/88 Spill Record Last Update: 02/07/89 Spille Namer: Not reported Spiller Company: APPMAN APT COMPLEX Spiller Phone: (914) 237-8248 Spiller Extention: Not reported Spiller Address: Not reported Spiller City,St,Zip: ΖZ Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 Program Number: 8708582 DER Facility ID: 242902 Site ID: 300277 Operable Unit ID: 913254 **Operable Unit:** 01 Material ID: 463962 Material Code: 0001 #2 Fuel Oil Material Name: Not reported Case No .: Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 Groundwater **Resource Affected:** Oxygenate: False Site ID: 300277 Spill Tank Test: 7507 Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: 0.00 Gross Fail: Not reported Modified By: Spills Last Modified: 10/01/04 Test Method: Unknown DEC Remarks: Start CallerRemark - 8708582 5K TANK ISOLATED WAS OK PIPING FAILED AT -.97GPH TEST DONE WITH AES BROCKMAN TEST. READING. PBS TO FOLLOW.PIPIONG NEEDS RETEST. END CallerRemark - 8708582 Remark: Start DECRemark - 8708582 Prior to Sept, 2004 data translation this spill Lead DEC Field was "OKESSON" 02/18/88: WILL RETEST ASAP. LR 02-18-88. END DECRemark - 8708582 HIST LTANKS: Region of Spill: 3 Spill Number: 8708582

OKESSON

Investigator:

S100140262

Database(s)

EDR ID Number EPA ID Number

S100140262

APPMAN APT COMPLEX (Continued)

Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 01/07/1988 Spill Time: 14:00 Reported to Department Date: 01/07/88 Reported to Department Time: 15:56 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: APPMAN APT COMPLEX Spiller Address: Not reported Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: (914) 237-8248 Facility Extention: Not reported Spill Cause: Tank Test Failure Resource Affectd: Groundwater Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: Tank Tester PBS Number: 3-168688 **Cleanup Ceased:** 01/06/89 Cleanup Meets Standard: True 01/06/89 Last Inspection: Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 01/06/89 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 01/26/88 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 02/07/89 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL

Map ID Direction			I	MAP FINDINGS			
Distance							
Distance (ft.)						EDR ID Number
Elevation	Site					Database(s)	EPA ID Number
	APPMAN APT COMPLEX (Continued)				S100140262		
	Class Type:		, #2 FUEL OIL				
	Times Material E	Entry In File:	24464				
	CAS Number:		Not reported				
	Last Date:		19941207				
	DEC Remarks:	02/18/88: V	VILL RETEST A	ASAP. LR 02-18-88.			
	Spill Cause:			S OK PIPING FAILED FOLLOW.PIPIONG		EST DONE WITH AES ST.	BROCKMAN

Z156 SSW 1/4-1/2 2540 ft.	GLENWOOD POWER STA 45 WATER GRANT WAY YONKERS (C), NY 10701 Site 3 of 4 in cluster Z	ION	NY BROWNFIELDS	S106122161 N/A
Relative: Higher	BROWNFIELDS: Program: ERI			
Actual: 13 ft.	Site Code: 572 Environmental Problem Site Description:	1 is: Not reported 'This site is approximately 2.3 acres in size, with 1.8 ar and is located at 45 Water Grant Way. From approxim this site was used as a power plant providing electrical Edison and thenearby railroad. Available information s may have occurred at this site. The site was later com site and in 1978 Consolidated Edison sold the site to C Ltd., and the site has remained undeveloped since tha believes possible contamination at this site may includ aromatic hydrocarbons associated with MGP sites, her petroleum.	nately 1905 through 1964 I power for Consolidated suggests MGP operations verted into a coal plant Glen Place Equities, It time. The Yonkers IDA le semi-volatile and poly avy metals, inorganics ar	s
	Assessment:	DOH has insufficient information to evaluate the poten	tial for human exposures	i.

Z157GLENWOOD POWER STATIONSSW45 WATER GRANT STREET1/4-1/2YONKERS, NY 107012540 ft.

US BROWNFIELDS 1009400883

N/A

Site 4 of 4 in cluster Z

Higher	US BROWNFIELDS: Recipient Name:	City of Yonkers Industrial Development Agency
Actual:	Project Name:	Yonkers Ind Dev Agency, NY (A04)
13 ft.	EPA ID:	Not reported
	Region Number:	2
	Latitude:	40.93393
	Longitude:	-73.90363
	Assessment Date:	Not reported
	Clean up Date:	Not reported
	Entity Type:	Redevelopment Agency

ſ

Database(s)

AC158 NNE 1/4-1/2	GLENWOOD GARDENS 95-117 RAVINE AVE YONKERS, NY	NY Spills NY Hist Spills	104789822 N/A
2544 ft.	Site 1 of 2 in cluster AC	NY HIST LTANKS	
Relative: Higher	LTANKS:		
Ingliei	Site ID:	62852	
Actual:	Spill Date:	01/15/01	
44 ft.	Facility Addr2:	Not reported	
	Facility ID: Program Number:	0011248 0011248	
	SWIS:	6018	
	Region of Spill:	3	
	Investigator:	tdghiosa	
	Referred To:	Not reported	
	Reported to Dept:	01/15/01	
	CID: Spill Cause:	17 Tank Overfill	
	Water Affected:	Not reported	
	Spill Source:	Private Dwelling	
	Spill Notifier:	Fire Department	
	Cleanup Ceased:		
	Cleanup Meets Standard:		
	Last Inspection: Recommended Penalty:	/ / Penalty Not Recommended	
	UST Involvement:	False	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing	
		Responsible Party. Corrective action taken.	
	Spill Closed Dt:	01/17/01	
	Remediation Phase:	0	
	Date Entered In Computer Spill Record Last Update:		
	Spille Namer:	WAYNE JACOBS	
	Spiller Company:	AMERADA HESS	
	Spiller Phone:	(201) 489-5100	
	Spiller Extention:	Not reported	
	Spiller Address:	238 WEST FORT LEE ROAD	
	Spiller City,St,Zip: Spiller County:	BOGOTA, NJ 07603- 001	
	Spiller Contact:	Not reported	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	Program Number:	0011248	
	DER Facility ID: Site ID:	60859 62852	
	Operable Unit ID:	832634	
	Operable Unit:	01	
	Material ID:	541570	
	Material Code:	0003	
	Material Name:	#6 Fuel Oil	
	Case No.: Material FA:	Not reported Petroleum	
	Quantity:	100.00	
	Units:	Gallons	
	Recovered:	0.00	
	Resource Affected:	Soil	
	Oxygenate:	False	

Database(s)

	nued) \$104789822
Site ID:	Not reported
Spill Tank Test:	Not reported
•	Not reported
	Not reported
2	Not reported
	Not reported
DEC Remarks:	Start CallerRemark - 0011248 TANK OVERFILL. UNKNOWN FURTHER ON THE CAUSE. 1 OR SO GALLONS SPILLED INTO THE BASEMENT. 2-3 GALLONS SPILLED OUTSIDE. NOTIFIER IS ON SCENE AND WOULD LIKE A CALL BACK. AMERADA HESS CALLED AT THEY MADE A DELIVERY EARLIER TODAY. AT THAT TIME THEY WEREN'T AWARE TH. SPILL HAD OCCURRED. CALLER FROM HESS SAID THAT THE CUSTOMER HAS A NEW STILL UNKNOWN EXACT CAUSE OF SPILL. END CallerRemark - 0011248
Remark:	Start DECRemark - 0011248 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" SEE ONE PAGE UPDATE BY V. MCCABE 01/17/2001 LT. TO CAVALLO OF YONKERS F.D. REPORTED THAT HE INSPECTED THE SITE AND THAT TH CLEANUP WAS COMPLETE. NO FURTHER ACTION. END DECRemark - 0011248
NY Spills:	
•	113910
	Not reported
-	0007333
5	0007333
	ER
	6018
	3
	jbodee
0	
	Not reported 09/22/00
•	
	09/22/00
-	17
	Unknown
	Not reported
•	Commercial/Industrial
	Other
•	True
-	Penalty Not Recommended
	False
	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
•	03/03/03
Remediation Phase:	0
Date Entered In Computer:	09/22/00
	08/20/03
Spiller Name:	RALPH DELLA CAVA
1 1 2	GLENWOOD GARDENS MGT
Spiller Address:	95-117 RAVINE AV
Spiller City,St,Zip:	YONKERS, NY
Spiller Company:	001
Spiller Phone:	(212) 362-4772 106
Contact Name:	RALPH DELLA CAVA

Database(s)

GLENWOOD GARDEN	IS (Continu	ued) \$104789822	
DEC Region:	3		
Program Number	-	007333	
DER Facility ID:		9386	
Site ID:		13910	
Operable Unit ID:		30006	
Operable Unit:	01		
Material ID:		44878	
Material Code:	-	003	
Material Name:		6 Fuel Oil	
Case No.:		ot reported	
Material FA:		etroleum	
Quantity:		00	
Units:	-	allons	
Recovered:		00	
Resource Affecte		oil	
Oxygenate:		alse	
DEC Remarks:		Remark - 0007333 CALLER RESPONDED TO ABOVE LOCATION FOR TANK	
DEC Nelliains.		. SOIL CONTAMINATION HAS BEEN DISCOVERED. MANAGMENT HAS BEEN ADVISED	
		BE REMOVED ON 9/25/00 AND FURTHER EXCAVATION TO BE DONE. CALLER IS	•
		ING CALL BACK FROM DEC REGIONAL OFFICE IN REFERENCE TO SITUATION. END	
		ark - 0007333	
Remark:		Remark - 0007333 Prior to Sept, 2004 data translation this spill Lead	
Remark.		was "O'DEE" 09/22/2000 SPOKE W/STAN @ FENLEY & NICHOL. WCHD WILL BE	
		OR TANK REMOVAL. 2 TANKS ARE SCHEDULED FOR REMOVAL. 03/03/03	
		REPORT FROM FENLEY & NICHOL SUBMITTED TO WCHD AND DEC. NFA REQUIRED.	
		L 00-08308. END DECRemark - 0007333	
NY Hist Spills:			
Region of Spill:		3	
Spill Number:		0007333	
Investigator:		WCHD	
Caller Name:		Not reported	
Caller Agency:		Not reported	
Caller Phone:		Not reported	
Notifier Name:		Not reported	
Notifier Agency:		Not reported	
Notifier Phone:		Not reported	
Spill Date/Time:		09/22/2000 11:45	
Reported to Dept	Date/Time:		
SWIS:		55	
Spiller Name:		GLENWOOD GARDENS MGT	
Spiller Contact:		RALPH DELLA CAVA	
Spiller Phone:		(212) 362-4772 106	
Spiller Contact:		RALPH DELLA CAVA	
Spiller Phone:		(212) 362-4772 106	
Spiller Address:		95-117 RAVINE AV	
Spiller City,St,Zip		YONKERS, NY	
Spill Cause:		Unknown	
Reported to Dept:		On Land	
Water Affected:		Not reported	
Spill Source:		01	
Spill Notifier:		Other	
PBS Number:		Not reported	
Cleanup Ceased:			
Cleanup Meets S	id:	False	
Last Inspection:			
Recommended P	enalty:	Penalty Not Recommended	
	-		

Map ID Direction		MAP FINDINGS		
Distance Distance (ft.	١			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	GLENWOOD GARDENS (Continu	ed)		S104789822
	Spiller Cleanup Dt:	11		
	Enforcement Date:	//		
	Invstgn Complete: UST Involvement:	/ / False		
	Spill Class:	Known release with minimal potential for fire or hazard	I DEC Response \	Milling
		Responsible Party. Corrective action taken.		, while it is a second s
	Spill Closed Dt:	//		
	Corrective Action Plan Submitt			
	Date Region Sent Summary to			
	Date Spill Entered In Compute Date Spill Entered In Compute			
	Update Date:	r Data File: Not reported 09/26/00		
	Is Updated:	True		
	PBS Number:	Not reported		
	Tank Number:	Not reported		
	Tank Size:	Not reported		
	Test Method:	Not reported		
	Leak Rate Failed Tank:	Not reported		
	Gross Leak Rate: Material Class Type:	Not reported Petroleum		
	Quantity Spilled:	0		
	Unkonwn Quantity Spilled:	True		
	Units:	Gallons		
	Quantity Recovered:	0		
	Unkonwn Quantity Recovered:			
	Material: Class Type:	#6 FUEL OIL		
	Times Material Entry In File:	#6 FUEL OIL 2190		
	CAS Number:	Not reported		
	Last Date:	19940728		
		SPOKE W/STAN @ FENLEY NICHOL. WCHD WILL	L BE ON SITE FOR	TANK
		2 TANKS ARE SCHEDULED FOR REMOVAL.		
		SPONDED TO ABOVE LOCATION FOR TANK REMO OVERED. MANAGMENT HAS BEEN ADVISED. TAN		
		HER EXCAVATION TO BE DONE. CALLER IS REQU		
		OFFICE INREFERENCE TO SITUATION.		
	HIST LTANKS:			
	Region of Spill:	3		
	Spill Number:	0011248		
	Investigator:	GHIOSAY		
	Caller Name:	Not reported		
	Caller Agency:	Not reported		
	Caller Phone:	Not reported		
	Caller Extension: Notifier Name:	Not reported		
	Notifier Agency:	Not reported Not reported		
	Notifier Phone:	Not reported		
	Notifier Extension:	Not reported		
	Spill Date:	01/15/2001		
	Spill Time:	17:52		
	Reported to Department Date:			
	Reported to Department Time: SWIS:			
	SWIS: Spiller Contact:	55 Not reported		

Spiller Contact: Spiller Phone: Spiller Extention:

Not reported () -Not reported

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

GLENWOOD GARDENS (Continued)

S104789822

		310470302	.2
Spiller Name:		AMERADA HESS	
Spiller Address:		238 WEST FORT LEE ROAD	
Spiller City,St,Zip):	BOGOTA, NJ 07603-	
Facility Contact:		WAYNE JACOBS	
Facility Phone:		(201) 489-5100	
Facility Extention	c.	Not reported	
Spill Cause:		Tank Overfill	
Resource Affecto	1:	On Land	
Water Affected:		Not reported	
Spill Source:		Private Dwelling	
Spill Notifier:		Fire Department	
PBS Number:		Not reported	
Cleanup Ceased	:	//	
Cleanup Meets S		True	
Last Inspection:			
Recommended F	Penalty:	Penalty Not Recommended	
Spiller Cleanup D	Date:		
Enforcement Dat	e:		
Investigation Con	nplete:		
UST Involvement	t:	False	
Spill Class:		Known release with minimal potential for fire or hazard. DEC Response. Willing	
		Responsible Party. Corrective action taken.	
Spill Closed Dt:		01/17/01	
Date Region Sen	it Summary t	to Central Office: / /	
Corrective Action	ı Plan Submi	itted: //	
Date Spill Entere	d In Comput	er Data File: 01/15/01	
Time Spill Entere	ed In Comput	ter Data File: Not reported	
Spill Record Last	Update:	02/23/01	
Is Updated:		True	
PBS Number:		Not reported	
Tank Number:		Not reported	
Tank Size:		Not reported	
Test Method:		Not reported	
Leak Rate Failed		Not reported	
Gross Leak Rate		Not reported	
Material Class Ty	/pe:	Petroleum	
Quantity Spilled:		100	
Unkonwn Quanti	ty Spilled:	False	
Units:		Gallons	
Quantity Recover			
Unkonwn Quantii	ty Recovered		
Material:		#6 FUEL OIL	
Class Type:		#6 FUEL OIL	
Times Material E	ntry in File:	2190	
CAS Number:		Not reported	
Last Date:			
DEC Remarks:		PAGE UPDATE BY V. MCCABE 01/17/2001 LT. TOM CAVALLO OF YONKERS F.D. D THAT HE INSPECTED THE SITE AND THAT THE CLEANUP WAS COMPLETE. NO	`
	FURTHER)
Coill Course		ERFILL. UNKNOWN FURTHER ON THE CAUSE. 100 OR SO GALLONS SPILLED INT	r0
Spill Cause:		ERFILL. UNKNOWN FURTHER ON THE CAUSE. 100 OR SO GALLONS SPILLED INT IMENT. 2-3 GALLONS SPILLED OUTSIDE. NOTIFIER IS ON SCENE AND WOULD	0
		LL BACK. AMERADA HESS CALLED AT 1836. THEY MADE A DELIVERY EARLIER	
	-	IT THAT TIME THEY WEREN T AWARE THAT A SPILL HAD OCCURRED. CALLER F	ROM
		D THAT THE CUSTOMER HAS A NEW TANK. STILL UNKNOWN EXACT CAUSE OF	

Database(s)

1/4-1/2 YONKERS, NY 2544 ft. Site 2 of 2 in cluster AC Relative: Higher LTANKS:	
Relative: Higher LTANKS:	
Higher LTANKS:	
Site ID: 327080	
Actual: Spill Date: 10/16/00 44 ft. Facility Addr2: Not reported	
Facility ID: 0008308	
Program Number: 0008308	
SWIS: 6018	
Region of Spill: 3	
Investigator: jbodee	
Referred To: Not reported	
Reported to Dept: 10/16/00 CID: 389	
Spill Cause: Tank Failure	
Water Affected: Not reported	
Spill Source: Private Dwelling	
Spill Notifier: Other	
Cleanup Ceased: / /	
Cleanup Meets Standard: True	
Last Inspection: / /	
Recommended Penalty: Penalty Not Recommended UST Involvement: False	
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing	
Responsible Party. Corrective action taken.	
Spill Closed Dt: 03/03/03	
Remediation Phase: 0	
Date Entered In Computer: 10/16/00	
Spill Record Last Update: 08/20/03	
Spille Namer: Not reported	
Spiller Company: GLENWOOD GARDENS MGMT INC Spiller Phone: Not reported	
Spiller Extention: Not reported	
Spiller Address: 60 EAST 42ND ST	
Spiller City,St,Zip: NEW YORK CITY, NY	
Spiller County: 001	
Spiller Contact: RALPH DELACARVA	
Spiller Phone: (917) 757-9510	
Spiller Extention: Not reported	
DEC Region: 3 Program Number: 0008308	
DER Facility ID: 263317	
Site ID: 327080	
Operable Unit ID: 830641	
Operable Unit: 01	
Material ID: 545819	
Material Code: 0003	
Material Name: #6 Fuel Oil Case No.: Not reported	
Case No.: Not reported Material FA: Petroleum	
Quantity: 0.00	
Units: Gallons	
Recovered: 0.00	
Resource Affected: Soil	
Oxygenate: False	

Cleanup Ceased:

Last Inspection:

Cleanup Meets Standard:

Recommended Penalty:

Investigation Complete:

Spiller Cleanup Date:

Enforcement Date:

UST Involvement:

Spill Class:

11

11

11

11

11

False

Not reported

False

Penalty Not Recommended

Database(s)

EDR ID Number EPA ID Number

95 RAVINE AVE (Continued) S104782528 Site ID: Not reported Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Test Method: Not reported Not reported Leak Rate: Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported **DEC Remarks:** Start CallerRemark - 0008308 caller reporting a spill of material from a leaky tank material is being stock piled and no callck is necessary END CallerRemark - 0008308 Remark: Start DECRemark - 0008308 Prior to Sept, 2004 data translation this spill Lead DEC Field was "O'DEE" 03/03/03 SEE SPILL 00-07333. END DECRemark - 0008308 HIST LTANKS: Region of Spill: 3 0008308 Spill Number: O'DEE Investigator: Not reported Caller Name: Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 10/16/2000 Spill Time: 11:00 Reported to Department Date: 10/16/00 Reported to Department Time: 13:42 SWIS: 55 Spiller Contact: RALPH DELACARVA Spiller Phone: (917) 757-9510 Spiller Extention: Not reported Spiller Name: GLENWOOD GARDENS MGMT INC Spiller Address: 60 EAST 42ND ST NEW YORK CITY, NY Spiller City, St, Zip: Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Failure **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Other PBS Number: Not reported

Map ID Direction		MAP FINDINGS
Distance		
Distance		
Distance (f	t.)	
Elevation	Site	
	95 RAVINE AVE (Continued)	
	Spill Closed Dt:	/ /

Date Region Sent Summary to Central Office: / /

Corrective Action Plan Submitted:

Remediation Phase:

0

Date Spill Entered In Computer Data File: 10/16/00 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 10/23/00 Is Updated: True PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True #6 FUEL OIL Material: Class Type: #6 FUEL OIL Times Material Entry In File: 2190 CAS Number: Not reported 19940728 Last Date: DEC Remarks: Not reported Spill Cause: caller reporting a spill of material from a leaky tank material is being stock piled and no callck is necessary

11

160 South 1/4-1/2 2613 ft.	ROADWAY 23 HUDSON STREET YONKERS, NY	NY LTANKS S106737777 N/A
Relative:	LTANKS:	
Higher	Site ID:	336056
•	Spill Date:	01/07/05
Actual:	Facility Addr2:	Not reported
37 ft.	Facility ID:	0410953
	Program Number:	0410953
	SWIS:	6018
	Region of Spill:	3
	Investigator:	WCHD
	Referred To:	Not reported
	Reported to Dept:	01/07/05
	CID:	17
	Spill Cause:	Tank Overfill
	Water Affected:	Not reported
	Spill Source:	Commercial Vehicle
	Spill Notifier:	Responsible Party
	Cleanup Ceased:	
	Cleanup Meets Standard:	True
	Last Inspection:	
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
	Spill Closed Dt:	01/22/05

TC1784877.2s Page 337

EDR ID Number

EPA ID Number

S104782528

Database(s)

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

ROADWAY (Continued)

Date Entered In Computer	
Spill Record Last Update: Spille Namer:	DEBBIE BAKER
Spiller Company:	ROADWAY
Spiller Phone:	(914) 476-8840
Spiller Extention:	Not reported
Spiller Address:	29 HUDSON STREET
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	001
Spiller Contact:	DEBBIE BAKER
Spiller Phone:	
•	(914) 476-8840 Not reported
Spiller Extention:	Not reported 3
DEC Region:	
Program Number:	0410953
DER Facility ID:	271394
Site ID:	336056
Operable Unit ID:	1098104
Operable Unit:	01
Material ID:	578275
Material Code:	0008
Material Name:	Diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	Gallons
Recovered:	20.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0410953 SPEEDY DRY WAS PUT ON IT AND CREWS ARE IN ROUTE FOR CLEAN UP END CallerRemark - 0410953
Remark:	Start DECRemark - 0410953 01/22/05 NORTHEAST ENVIRONMENTAL COMPLETED CLEAN jbo END DECRemark - 0410953

AB161 CRYSTAL TRANSPORTATION East 127 ASHBURTON AVE 1/2-1 YONKERS, NY 2668 ft. Site 3 of 3 in cluster AB

LTANKS:	
Site ID:	110322
Spill Date:	12/11/03
Facility Addr2:	Not reported
Facility ID:	0310495
Program Number:	0310495
SWIS:	6018
Region of Spill:	3
Investigator:	WCHD
	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill:

NY LTANKS S106124510 N/A

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S106124510

CRYSTAL TRANSPORTATION (Continued)

Referred To: Westchester Cnty Health Dept 12/11/03 Reported to Dept: CID: 17 Spill Cause: Tank Overfill Water Affected: SAWMILL RIVER Spill Source: Unknown Spill Notifier: **Responsible Party** Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 12/11/03 Remediation Phase: 0 Date Entered In Computer: 12/11/03 Spill Record Last Update: 12/26/03 Spille Namer: FRANK RIZZA Spiller Company: CRYSTAL TRANSPORTATION Spiller Phone: (718) 828-3100 Spiller Extention: Not reported Spiller Address: 127 ASHBURTON AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 FRANK RIZZA Spiller Contact: Spiller Phone: (718) 828-3100 Spiller Extention: Not reported DEC Region: 3 Program Number: 0310495 DER Facility ID: 96709 Site ID: 110322 **Operable Unit ID:** 875593 **Operable Unit:** 01 Material ID: 499349 Material Code: 0002 #4 Fuel Oil Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 15.00 Units: Gallons 0.00 Recovered: **Resource Affected:** Surface Water Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported **DEC Remarks:** Start CallerRemark - 0310495 spill recovery going to scene. Co. name ALEastman 718-378-3000, customer over ordered more then can handle. END CallerRemark -0310495

EDR ID Number Database(s) **EPA ID Number**

S106124510

CRYSTAL TRANSPORTATION (Continued)

Remark:

Start DECRemark - 0310495 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD - JACKSON" 12/11/03: Daniell Jackson, WCDOH, on site. Oil did reach Sawmill, unrecoverable. Spill on land & in storm drains has been cleaned up. NFA at this time. END DECRemark - 0310495

AD162 SE 1/2-1 2696 ft.	FAMILY MULTI USE BUILDING 45 PALISADE AVE YONKERS, NY		NY LTANKS	S107523242 N/A
	Site 1 of 4 in cluster AD			
Relative: Higher	LTANKS:	077000		
Relative: Higher Actual: 72 ft.		357303 12/26/05 Not reported 0511200 0511200 6018 3 WCHD WCDOH 12/26/05 17 Tank Failure Not reported Private Dwelling Health Department / / False 12/26/05 Penalty Not Recommended False Known release that creates potential for fire or hazard. DEC I Responsible Party. Corrective action taken.	Response. Willir	ığ
	Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company:			
	Spiller Phone: Spiller Extention: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: Program Number: DER Facility ID:	Not reported Not reported UNKNOWN UNKNOWN, NY 999 DANIELLE JACKSON (914) 224-7648 Not reported 3 0511200 307330		
	Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.:	357303 1114580 01 2104647 0001 #2 Fuel Oil Not reported		

Database(s)

EDR ID Number EPA ID Number

S107523242

FAMILY MULTI USE BUILDING (Continued)

Material FA:	Petroleum
Quantity:	30.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 0511200 CLEAN UP IN PROCESS. THE FUEL OIL COMPANY AND
Devee	OWNER ARE WORKING TO CLEAN IT UP. END CallerRemark - 0511200
Remark:	Not reported

AE163 SSE 1/2-1 2729 ft.	APT BUILDING 20 SOUTH BROADWAY YONKERS, NY	NY LTANKS	S107523550 N/A
	Site 1 of 3 in cluster AE		
Relative: Higher	LTANKS: Site ID:	359121	
Actual:	Spill Date:	02/01/06	
46 ft.	Facility Addr2:	Not reported	
	Facility ID:	0512725	
	Program Number:	0512725	
	SWIS:	6018	
	Region of Spill:	3	
	Investigator:	WCHD	
	Referred To:	WCDOH	
	Reported to Dept:	02/02/06	
	CID:	17	
	Spill Cause:	Tank Overfill	
	Water Affected:	Not reported	
	Spill Source:	Non Major Facility > 1,100 gal	
	Spill Notifier:	Responsible Party	
	Cleanup Ceased:		
	Cleanup Meets Standard:	False	
	Last Inspection:	02/02/06	
	Recommended Penalty:	Penalty Not Recommended	
	UST Involvement:	False	
	Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willir Responsible Party. Corrective action taken.	g
	Spill Closed Dt:		
	Remediation Phase:	1	
	Date Entered In Computer	·	
	Spill Record Last Update:		
	Spille Namer:	PASCAL, NICK	
	Spiller Company:	HESS	
	Spiller Phone:	(201) 489-5100	
	Spiller Extention:	Not reported	
	Spiller Address:	238 W. FORT LEE RD	
	opilier Address.		

Map ID Direction Distance Distance (ft.) Elevation Site

APT BUILDING (Continued)

Database(s)

	Spiller City, St, Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: Program Number: DER Facility ID: Site ID: Operable Unit ID: Operable Unit ID: Operable Unit: Material Code: Material Code: Material RA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Nize: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks:	BOGOTA, NJ 07603 001 BILL (914) 490-4075 Not reported 3 0512725 263726 359121 1116345 01 2106491 0002 #4 Fuel Oil Not reported Petroleum 40.00 Gallons 40.00 Soil False 359121 1103321 Not reported 5500 00 0.00 0 Watchdog 02/03/06 Unknown Start CallerRemark - 0512725 Hess overfilled the tank releasing the into a containment area in the basement. No impact to the environ tank cleaners will be doing the clean up. END CallerRemark - 0512 Not reported	ment. East	man
AE164 SSE 1/2-1 2729 ft.	NATIONAL WEST MINISTER 20 S. BROADWAY YONKERS, NY	BK NY NY HIST	LTANKS LTANKS	S104276097 N/A
Relative:	Site 2 of 3 in cluster AE			
Higher	LTANKS: Site ID:	228397		
Actual:	Spill Date:	06/23/88		
46 ft.	Facility Addr2: Facility ID:	Not reported 8802655		
	Program Number:	8802655		
	SWIS: Region of Spill:	6018 3		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept: CID:	06/23/88 17		
	Spill Cause:	Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Commercial/Industrial Tank Tester		
		runk rootor		

Database(s)

EDR ID Number EPA ID Number

S104276097

NATIONAL WEST MINISTER BK (Continued)

	Cleanup Ceased:	//
	Cleanup Meets Standard:	False
	Last Inspection:	11
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Possible release with minimal potential for fire or hazard or Known release with
		no damage. DEC Response. Willing Responsible Party. Corrective action taken.
	Spill Closed Dt:	04/17/05
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spille Namer:	Not reported
	Spiller Company:	SAME
	Spiller Phone:	() 963-6400
	Spiller Extention:	Not reported
	Spiller Address:	Not reported
	Spiller City,St,Zip:	ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number: DER Facility ID:	8802655 263726
	Site ID:	228397
	Operable Unit ID:	919859
	Operable Unit:	01
	Material ID:	458224
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Gallons
	Recovered:	0.00
	Resource Affected:	Groundwater
	Oxygenate:	False
	Site ID:	228397
	Spill Tank Test:	8749
	Tank Number:	Not reported
	Tank Size:	0
	Test Method:	00
	Leak Rate:	0.00
	Gross Fail:	Not reported
	Modified By:	Spills
	Last Modified:	10/01/04
	Test Method: DEC Remarks:	
	DEC Remarks.	Start CallerRemark - 8802655 LEAK RATE UNDETERMINABLE VISIBLE LEAK AT TOP BY MANHOLE END CallerRemark - 8802655
	Remark:	Start DECRemark - 8802655 Prior to Sept, 2004 data translation this spill Lead
	Remain.	DEC Field was "GHIOSAY" See Spill 93-12820 END DECRemark - 8802655
н	ST LTANKS:	
	Region of Spill:	3
	Spill Number:	8802655
	Investigator:	GHIOSAY
	Caller Name:	Not reported

Database(s)

EDR ID Number EPA ID Number

S104276097

NATIONAL WEST MINISTER BK (Continued)

Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 06/23/1988 12:00 Spill Time: Reported to Department Date: 06/23/88 Reported to Department Time: 14:33 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported SAME Spiller Name: Spiller Address: Not reported Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: () 963-6400 Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** Groundwater Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: Tank Tester PBS Number: Not reported **Cleanup Ceased:** 11 Cleanup Meets Standard: False Last Inspection: 11 Penalty Not Recommended **Recommended Penalty:** Spiller Cleanup Date: 11 Enforcement Date: 11 11 Investigation Complete: False UST Involvement: Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 06/29/88 Time Spill Entered In Computer Data File: Not reported 05/18/93 Spill Record Last Update: Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL

Map ID		MAP FINDINGS		
Direction Distance Distance (fl			-	EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	NATIONAL WEST MINISTER B	K (Continued)		S104276097
	Class Type:	#2 FUEL OIL		
	Times Material Entry In File CAS Number:	e: 24464 Not reported		
	Last Date:	19941207		
	DEC Remarks: Not repo Spill Cause: LEAK R	nea ATE UNDETERMINABLE VISIBLE LEAK AT TOP BY MAN⊦	IOLE	
	·			
165 NE	APT. BUILDING 324 NORTH BROADWAY		NY LTANKS NY Spills	S100782000 N/A
1/2-1	YONKERS, NY		NY Hist Spills	
2742 ft.		NY	HIST LTANKS	
Relative:	LTANKS:			
Higher	Site ID: Spill Date:	141081 12/31/03		
Actual:	Facility Addr2:	Not reported		
236 ft.	Facility ID:	0311160		
	Program Number: SWIS:	0311160 6018		
	Region of Spill:	3		
	Investigator:	WCHD		
	Referred To: Reported to Dept:	Westchester Cnty Health Dept 12/31/03		
	CID:	17		
	Spill Cause:	Tank Test Failure		
	Water Affected: Spill Source:	Not reported Commercial/Industrial		
	Spill Notifier:	Tank Tester		
	Cleanup Ceased:			
	Cleanup Meets Standard: Last Inspection:	True / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement: Spill Class:	False Known release with minimal potential for fire or hazard. DEC	Response Willi	na
		Responsible Party. Corrective action taken.		
	Spill Closed Dt:	02/05/04		
	Remediation Phase: Date Entered In Computer:	0 12/31/03		
	Spill Record Last Update:	02/05/04		
	Spille Namer:	SAM NEMEH APARTMENT BUILDING		
	Spiller Company: Spiller Phone:	(914) 968-7828		
	Spiller Extention:	Not reported		
	Spiller Address: Spiller City,St,Zip:	324 NORTH BROADWAY YONKERS, NY		
	Spiller County:	001		
	Spiller Contact:	SAM NEMEH		
	Spiller Phone: Spiller Extention:	(914) 968-7828 Not reported		
	DEC Region:	3		
	Program Number:	0311160		
	DER Facility ID: Site ID:	120490 141081		
	Operable Unit ID:	878902		
	Operable Unit: Material ID:	01 499986		
	Material Code:	499986 0001		
	Material Name:	#2 Fuel Oil		

Database(s)

Case No.:Not reportedMaterial FA:PetroleumQuantity:0.00Units:GallonsRecovered:0.00Recovered:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillSpill Tank Test:3458Tank Mumber:1Tank Namber:1Tank Namber:1Tank Kate:0.00Gross Fail:Not reportedModified By:SpillsLast Method:Honre F2 Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility JD:9309120SWIS:6018Region of Spill:3Investigator:10/27/93ClD:17Spill Cause:Tank FailureWater Affected:Not reportedReported to Dept:10/27/93ClD:17Spill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Source:Commercial/Industrial)
Material FA:PetroleumQuantity:0.00Quantity:0.00Recovered:0.00Recovered:0.00Resouree Affected:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:0.3Leak Rate:0.00Gross Fail:Not reportedModified By:Spill TantDEC Remarks:Stat CallerRemark - 0311160 TEST FAILED: UNCOVER.REPAIR.RETEST ENDCallerRemark - 0311160 Test TAILED: UNCOVER.REPAIR.RETEST AFTER PIPING WASREPARED END DECRemark - 0311160Ster ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility Addr2:909120SW156018Region of Spill:3Investigator:10/27/93CiD:17Spill Cause:Tark Failure <trr>Water Affected:Not reported<!--</th--><th></th></trr>	
Quantity:0.00Units:GallonsRecovered:0.00Resource Affected:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified:10/01/04Test Method:0.00Gross Fail:Not reportedModified:10/01/04Test Method:Homer EZ Check I or IIDEC Remarks:Stat DeCRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WOHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility ID:9309120Program Number:9309120Program Number:9309120Program Number:9309120Program Number:9309120Region of Spill:3Investigator:tdghiosaRefered To:Not reportedReported to Dept:10/27/93ClD:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:Failee	
Units:GallonsRecovered:0.00Resource Affected:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Statt CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedProgram Number:9309120SWIS:6018Region of Spill:3Investigator:tidphiosaReferred To:Not reportedReported to Dept:10/27/93ClD:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Recovered:0.00Resource Affected:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillDEC Remarks:Start CallerRemark - 0311160DEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tudphiosaRefered To:Not reportedRefered To:Not reportedRefered To:Not reportedRefered To:Not reportedSpill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Resource Affected:GroundwaterOxygenate:FalseSite ID:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/1/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160Remark:Start DECRemark - 0311160Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility Addr2:Not reportedFacility Addr2:Not reportedRegion of Spill:3Investigator:tdghiosaRefered To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Meets Standard:False	
Oxygenate:FalseSite ID:141081Spill Tark Test:3458Tark Number:1Tark Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/08/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120SWIS:6018Regorn of Spill:3Investigator:tdghiosaRefered To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWatter Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifien:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Site D:141081Spill Tank Test:3458Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085 Spill Date:Spill Date:10/23/93Facility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Cause:Tank FailureWater Affected:Not reportedSpill Cause:Tank FailureWater Affected:Not reportedSpill Cause:Commercial/IndustrialSpill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:Faise	
Spill Tank Test:3458Tank Number:1Tank Number:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horne FZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill LeadDEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:Commercial/IndustrialSpill Notifier:Commercial/IndustrialSpill Notifier:Commercial/IndustrialSpill Notifier:CotherCleanup Ceased:01/20/95Cleanup Ceased:01/20/95Cleanup Meets Standard:Faise	
Tank Number:1Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:Ot reportedSpill Notifier:OtherClaup Ceased:Ot1/20/95Cleanup Meets Standard:False	
Tank Size:2000Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility JD:9309120SWIS:6018Referred To:Not reportedReformed To:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:01/20/95CID:17Spill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:Failse	
Test Method:03Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Homer EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Notifier:OtreCleanup Meets Standard:False	
Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Meets Standard:False	
Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Stie ID:141085Spill Date:10/23/93Facility Addr2:Not reportedProgram Number:9309120SWIS:6018Referred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCID:17Spill Source:Commercial/IndustrialSpill Notifier:OtherCID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Meets Standard:False	
Modified By:SpillsLast Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085 Spill Date:Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility JD:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReferred To:Not reportedReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standari:False	
Last Modified:10/01/04Test Method:Horner EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085 Spill Date:Spill Date:10/23/93Facility Addr2:Not reported Facility ID:9309120SWIS:SWIS:6018Region of Spill:3 Investigator:Investigator:tdghiosa Referred To:Referred To:Not reported Ta Spill Cause:Reforted To:Tank Failure Water Affected:Water Affected:Not reported Ta Spill Notifier:Spill Notifier:Commercial/Industrial Spill Notifier:Spill Notifier:Commercial/Industrial Spill Notifier:Spill Notifier:Other Cleanup Meets Standari:False11/20/95	
Test Method:Homer EZ Check I or IIDEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER, REPAIR, RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:Faise	
DEC Remarks:Start CallerRemark - 0311160 TEST FAILED: UNCOVER,REPAIR,RETEST END CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085 Spill Date:Spill Date:10/23/93Facility Addr2:Not reported 9309120Program Number:9309120SWIS:6018Region of Spill:3 Investigator:Investigator:tdghiosa Referred To:Reported to Dept:10/27/93 CID:DEC:17Spill Cause:Tank Failure Vater Affected:Water Affected:Not reported Spill Notifier:OtherCleanup Ceased:Cileanup Meets Standard:False	
CallerRemark - 0311160Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Remark:Start DECRemark - 0311160 Prior to Sept, 2004 data translation this spill Lead DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160Site ID:141085 Spill Date:Spill Date:10/23/93Facility Addr2:Not reportedFacility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
DEC Field was "WCHD-JACKSON" 02/05/04 TANK PASSED RETEST AFTER PIPING WAS REPAIRED. END DECRemark - 0311160 Site ID: 141085 Spill Date: 10/23/93 Facility Addr2: Not reported Facility ID: 9309120 Program Number: 9309120 SWIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 10/27/93 CID: 17 Spill Cause: Tank Failure Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Ceased: 01/20/95 Cleanup Meets Standard: False	
REPAIRED. END DECRemark - 0311160Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Site ID:141085Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	AS
Spill Date:10/23/93Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Facility Addr2:Not reportedFacility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Facility ID:9309120Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Program Number:9309120SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Investigator:tdghiosaReferred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Referred To:Not reportedReported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Reported to Dept:10/27/93CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
CID:17Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Spill Cause:Tank FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Water Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Spill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Spill Notifier:OtherCleanup Ceased:01/20/95Cleanup Meets Standard:False	
Cleanup Ceased: 01/20/95 Cleanup Meets Standard: False	
Cleanup Meets Standard: False	
Last Inspection: / /	
Recommended Penalty: Penalty Not Recommended	
UST Involvement: False	
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing	
Responsible Party. Corrective action taken.	
Spill Closed Dt: 01/20/95	
Remediation Phase: 0	
Date Entered In Computer: 11/08/93	
Spill Record Last Update: 12/16/03	
Spille Namer: Not reported	
Spiller Company: SAM NEMETT	
Spiller Phone: (914) 968-7828	
Spiller Extention: Not reported	
Spiller Address: Not reported	
Spiller City, St, Zip: ZZ	
Spiller County: 001	
Spiller Contact: Not reported	

Database(s)

APT. BUILDING (Continued)	S100782000
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9309120
DER Facility ID:	120490
Site ID:	141085
Operable Unit ID:	988200
Operable Unit:	01
Material ID:	556921
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
	•
Material FA:	Petroleum
Quantity:	900.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9309120 SUSPECT TANK LEAK DELIVERY SHOULD HAVE BEEN MAD
	10/23/93 DRIVER UNABLE TO CONFIRM DELIVERY TEMP. TANK TO BE SET UP HIGH USA
Remark:	AT LOCATION BUT NOT SURE IF DELIVERY WAS MADE END CallerRemark - 9309120 Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120
	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead
NY Spills:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120
NY Spills: Site ID:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083
NY Spills: Site ID: Facility Addr2:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported
NY Spills: Site ID: Facility Addr2: Facility ID:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other / /
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other / / True
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other / / True / /
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other // True // Penalty Not Recommended
NY Spills: Site ID: Facility Addr2: Facility ID: Spill Number: Facility Type: SWIS: Region of Spill: Investigator: Referred To: Spill Date: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	Start DECRemark - 9309120 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" 01/20/95: TANK TEST FAILURE. END DECRemark - 9309120 141083 Not reported 0400214 ER 6018 3 WCHD Westchester Cnty Health Dept 04/07/04 04/07/04 04/07/04 17 Unknown Not reported Institutional, Educational, Gov., Other Other / / True / /

Database(s)

EDR ID Number EPA ID Number

S100782000

APT. BUILDING (Continued)

BUILDING (Continued)		51007820
	Responsible Party. Corrective action taken.	
Spill Closed Dt:	04/19/04	
Remediation Phase:	0	
Date Entered In Computer:	: 04/07/04	
Spill Record Last Update:	04/19/04	
Spiller Name:	ANTONY MACI	
Spiller Company:	APARTMENT BUILDING	
Spiller Address:	324 NORTH BROADWAY	
Spiller City,St,Zip:	YONKERS, NY	
Spiller Company:	001	
Spiller Phone:	(914) 847-0201	
Contact Name:	ANTONY MACI	
Contact Phone:	(914) 847-0201	
DEC Region:	3	
Program Number:	0400214	
DER Facility ID:	120490	
Site ID:	141083	
Operable Unit ID:	884616	
Operable Unit:	01	
Material ID:	495001	
Material Code:	0066A	
Material Name:	UNKNOWN PETROLEUM	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	0.00	
Units:	Gallons	
Recovered:	0.00	
Resource Affected:	Sewer	
Oxygenate:		
	IlerRemark - 0400214 unknown oil found in sump pump, attempted cleanup,	
	peared after cleanup. not a significant ammount, there does not appear y oil lines near location. owner is sam nemeh, his phone is	
	-7828 END CallerRemark - 0400214	
	CRemark - 0400214 Prior to Sept, 2004 data translation this spill Lead	
	eld was "WCHD-SILVA" 04/19/04 DUPLICATE REPORT. SEE SPILL 03-1402	3 NEA
	PILL NUMBER. jbo END DECRemark - 0400214	5. NI A
	The Nombert, job and Deortemark - 0400214	
Site ID:	141084	
Facility Addr2:	Not reported	
Facility ID:	9004259	
Spill Number:	9004259	
Facility Type:	ER	
SWIS:	6018	
Region of Spill:	3	
Investigator:	tdghiosa	
Referred To:	Not reported	
Spill Date:	04/01/90	
Reported to Dept:	07/17/90	
CID:	17	
Spill Cause:	Equipment Failure	
Water Affected:	Not reported	
Spill Source:	Private Dwelling	
Spill Notifier:	Affected Persons	
Cleanup Ceased:	08/02/90	
Cleanup Meets Std:	True	
Last Inspection:	08/02/90	
Recommended Penalty:	Penalty Not Recommended	

Database(s)

UST Trust:	F	alse
Spill Class:		lot reported
Spill Closed Dt:		1/21/90
Remediation Phase		
Date Entered In Co		
Spill Record Last U	•	1/21/90
Spiller Name:		lot reported
Spiller Company:		SAME
Spiller Address:		lot reported
Spiller City,St,Zip:		IY
Spiller Company:		01
Spiller Phone:		lot reported
Contact Name:		lot reported
Contact Phone:		lot reported
DEC Region:	3	
Program Number:		004259
DER Facility ID:		20490
Site ID:		41084
Operable Unit ID:		4004
Operable Unit:	0 [.]	
Material ID:	-	35360
Material Code:		001
Material Name:		2 Fuel Oil
Case No.:		
Material FA:		lot reported Petroleum
		.00
Quantity:	-	
Units: Recovered:		lot reported .00
		soil
Resource Affected:	-	
Oxygenate: DEC Remarks: S		alse rRemark - 9004259 LARGE FUEL OIL TANK AT APT. BUILDING HAS BEEN
		FOR THE LAST FOUR MONTHS END CallerRemark - 9004259
		Remark - 9004259 Prior to Sept, 2004 data translation this spill Lead
		was "GHIOSAY" END DECRemark - 9004259
L		Was OHIOSAT LIND DECKEMAR 9004239
C	lick this h	yperlink while viewing on your computer to access
а	dditional N	NY_SPILL: detail in the EDR Site Report.
NY Hist Spills:		
Region of Spill:		3
Spill Number:		9004259
Investigator:		GHIOSAY
Caller Name:		Not reported
Caller Agency:		Not reported
		Not reported
Caller Phone:		Not reported
Caller Phone: Notifier Name:		Not reported
Caller Phone: Notifier Name: Notifier Agency:		•
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone:		Not reported
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time:		Not reported 04/01/1990 12:00
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS: Spiller Name:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55 SAME
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS: Spiller Name: Spiller Contact:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55 SAME Not reported
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS: Spiller Name: Spiller Contact: Spiller Phone:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55 SAME
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS: Spiller Name: Spiller Contact: Spiller Phone: Spiller Address:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55 SAME Not reported Not reported Not reported
Caller Phone: Notifier Name: Notifier Agency: Notifier Phone: Spill Date/Time: Reported to Dept D SWIS: Spiller Name: Spiller Contact: Spiller Phone:	ate/Time:	Not reported 04/01/1990 12:00 07/17/90 16:35 55 SAME Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

AP

PT. BUILDING (Continued)			S100782000
Reported to Dept:	On Land		
Water Affected:	Not reported		
Spill Source:	09		
Spill Notifier:	Affected Perso	ns	
PBS Number:	Not reported		
Cleanup Ceased:	08/02/90		
Cleanup Meets Std:	True		
Last Inspection:	08/02/90		
Recommended Penalty:	Penalty Not Re	ecommended	
Spiller Cleanup Dt:	//		
Enforcement Date:	//		
Invstgn Complete:	//		
UST Involvement:	False		
Spill Class:	Not reported		
Spill Closed Dt:	11/21/90		
Corrective Action Plan Submit	ted:	//	
Date Region Sent Summary to	o Central Office:		
Date Spill Entered In Compute		07/31/90	
Date Spill Entered In Compute		Not reported	
Update Date:	11/21/90		
Is Updated:	False		
PBS Number:	Not reported		
Tank Number:	Not reported		
Tank Size:	Not reported		
Test Method:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material Class Type:	Petroleum		
Quantity Spilled:	0		
Unkonwn Quantity Spilled:	False		
Units:	Not reported		
Quantity Recovered:	0		
Unkonwn Quantity Recovered			
Material:	#2 FUEL OIL		
Class Type:	#2 FUEL OIL		
Times Material Entry In File:	24464		
CAS Number:	Not reported		
Last Date:	19941207		
DEC Remarks: Not reported			
Remark: LARGE FU		T APT. BUILDING HAS BEEN LEAKING FOR THE LAST F	OUR MONTHS
HIST LTANKS:			
Region of Spill:	3		
Spill Number:	9309120		
Investigator:	GHIOSAY		
Caller Name:	Not reported		
Caller Agency:	Not reported		
Caller Phone:	Not reported		
Caller Extension:	Not reported		
Notifier Name:	Not reported		
Notifier Agency:	Not reported		
Notifier Phone:	Not reported		
Notifier Extension:	Not reported		
Spill Date:	10/23/1993		
Spill Time:	12:00		
Reported to Department Date:			
Reported to Department Time	: 14:34		

Database(s)

APT. BUILDING (Continued)	S100782000
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	SAM NEMETT
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	(914) 968-7828
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other
PBS Number:	Not reported
Cleanup Ceased:	01/20/95
Cleanup Meets Standard:	False
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	//
Enforcement Date:	/ /
Investigation Complete:	/ /
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	01/20/95
Date Region Sent Summary	to Central Office: / /
Corrective Action Plan Subm	
Date Spill Entered In Comput	
Time Spill Entered In Compu	
Spill Record Last Update:	01/20/95
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	900
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	
Unkonwn Quantity Recovered	
Material:	#2 FUEL OIL #2 FUEL OIL
Class Type: Times Material Entry In File:	
CAS Number:	24464 Not reported
Last Date:	19941207
	TANK TEST FAILURE.
	TANK LEAK DELIVERY SHOULD HAVE BEEN MADE 10/23/93 DRIVER UNABLE TO
•	DELIVERY TEMP. TANK TO BE SET UP HIGH USAGE AT LOCATION BUT NOT SURE IF
	WAS MADE
DELIVEI	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

AD166 SSE 1/2-1 2752 ft.	MOBIL 60 ELIRA / SCHOOL ST YONKERS, NY		NY LTANKS ST LTANKS	S105054442 N/A
2752 11.	Site 2 of 4 in cluster AD			
Relative:				
Higher	LTANKS:	004005		
Actual:	Site ID:	231995		
61 ft.	Spill Date: Facility Addr2:	12/02/87 Not reported		
0110	Facility ID:	8707562		
	Program Number:	8707562		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	UNASSIGNED		
	Referred To:	Not reported		
	Reported to Dept:	12/03/87		
	CID:	Not reported		
	Spill Cause:	Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Gasoline Station Tank Tester		
	Cleanup Ceased:	02/18/88		
	•	True		
	Last Inspection:	02/18/88		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	True		
	Spill Class:	Possible release with minimal potential for fire or hazard or Kno	wn release wit	h
		no damage. DEC Response. Willing Responsible Party. Correct	tive action take	en.
	Spill Closed Dt:	02/18/88		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spille Namer:	07/26/90 Not reported		
	Spiller Company:	Not reported SAME		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	NY		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	Program Number: DER Facility ID:	8707562 191185		
	Site ID:	231995		
	Operable Unit ID:	911883		
	Operable Unit:	01		
	Material ID:	466504		
	Material Code:	0009		
	Material Name:	Gasoline		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	0.00		
	Units: Receivered:	Gallons 0.00		
	Recovered: Resource Affected:	Groundwater		
	Oxygenate:	False		
	engenate.			

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

MOBIL (Continued) S105054442 Site ID: 231995 Spill Tank Test: 7083 Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: 0.00 Not reported Gross Fail: Modified By: Spills Last Modified: 10/01/04 Test Method: Unknown Start CallerRemark - 8707562 2X3K & 1X2K 1.09GPH SUPER UNL END CallerRemark -**DEC Remarks:** 8707562 Start DECRemark - 8707562 Prior to Sept, 2004 data translation this spill Lead Remark: DEC Field was " " / / : RETESTED & PASSED. LR 2-18-88 N.F.A. 11/29/95: This is additional information about material spilled from the translation of the old spillfile: SUPER UNL. END DECRemark - 8707562 HIST LTANKS: Region of Spill: 3 Spill Number: 8707562 Not reported Investigator: Not reported Caller Name: Caller Agency: Not reported Not reported Caller Phone: Caller Extension: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 12/02/1987 Spill Time: 17:00 Reported to Department Date: 12/03/87 Reported to Department Time: 16:15 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: SAME Spiller Address: Not reported Spiller City, St, Zip: Not reported Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** Groundwater Water Affected: Not reported Spill Source: Gas Station Spill Notifier: Tank Tester PBS Number: Not reported 02/18/88 **Cleanup Ceased:** Cleanup Meets Standard: True Last Inspection: 02/18/88 Recommended Penalty: Penalty Not Recommended

11

Spiller Cleanup Date:

Investigation Complete:

Enforcement Date:

UST Involvement:

Map ID Direction	MAP FINDINGS				
Distance Distance (ft. Elevation) Site		Database(s)	EDR ID Number EPA ID Number	
	MOBIL (Continued)			S105054442	
	Spill Class:	Possible release with minimal potential for fire or hazard on o damage. DEC Response. Willing Responsible Party. (
	Spill Closed Dt:	02/18/88			
	Date Region Sent Summary	o Central Office: / /			
	Corrective Action Plan Subm				
	Date Spill Entered In Comput	er Data File: 01/04/88			
	Time Spill Entered In Compu				
	Spill Record Last Update:	07/26/90			
	Is Updated:	False			
	PBS Number:	Not reported			
	Tank Number:	Not reported			
	Tank Size:	0			
	Test Method:	Not reported			
	Leak Rate Failed Tank:	0.00			
	Gross Leak Rate:	Not reported			
	Material Class Type:	Petroleum			
	Quantity Spilled:	0			
	Unkonwn Quantity Spilled:	False			
	Units:	Gallons			
	Quantity Recovered:	0			
	2	Unkonwn Quantity Recovered: False			
	Material:	GASOLINE			
	Class Type:	GASOLINE			
	Times Material Entry In File:	21329			
	CAS Number:	Not reported			
	Last Date:	19940929			

DEC Remarks:	/ / : RETESTED PASSED. LR 2-18-88 N.F.A. 11/29/95: This is additional	
	information about material spilled from the translation of the old spill file:	
	SUPER UNL.	

2X3K 1X2K 1.09GPH SUPER UNL

AD167	ENGINE #1 YONKERS FD	

Spill Notifier:

Cleanup Ceased:

Last Inspection:

UST Involvement:

Recommended Penalty:

Cleanup Meets Standard: True

Spill Cause:

ABIO				
SE	5-7 NEW SCHOOL STREET			
1/2-1	YONKERS, NY			
2766 ft.				
	Site 3 of 4 in cluster AD			
Relative:				
Higher	LTANKS:			
	Site ID:	206332		
Actual:	Spill Date:	07/25/90		
72 ft.	Facility Addr2:	Not reported		
	Facility ID:	9004600		
	Program Number:	9004600		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	WXWADSWO		
	Referred To:	Not reported		
	Reported to Dept:	07/25/90		
	CID:	Not reported		
	Spill Cause:	Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Institutional, Educational, Gov., Other		

Tank Tester

Penalty Not Recommended

06/18/53

11

True

NY LTANKS S102618904 NY HIST LTANKS N/A

EDR ID Number Database(s) EPA ID Number

ENGINE #1 YONKERS FD (Continued)

	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
		Responsible Party. Corrective action taken.
	Spill Closed Dt:	07/25/90
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spille Namer:	Not reported
	Spiller Company:	CITY OF YONKERS
	Spiller Phone:	Not reported
	Spiller Extention: Spiller Address:	Not reported Not reported
	Spiller City,St,Zip:	ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	9004600
	DER Facility ID:	171320
	Site ID:	206332
	Operable Unit ID:	944967
	Operable Unit:	01
	Material ID:	435686
	Material Code:	0008
	Material Name:	Diesel
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00
	Units:	Pounds
	Recovered:	0.00
	Resource Affected:	Soil
	Oxygenate:	False
	Site ID: Spill Tank Test:	206332 11919
	Tank Number:	Not reported
	Tank Size:	0
	Test Method:	00
	Leak Rate:	0.00
	Gross Fail:	Not reported
	Modified By:	Spills
	Last Modified:	10/01/04
	Test Method:	Unknown
	DEC Remarks:	Start CallerRemark - 9004600 TANK IS EMPTY CITY OF YONKERS IS TAKING BIDS FOR
		TANK REMOVAL HORNER E-Z CHECK GROSS LEAK END CallerRemark - 9004600
	Remark:	Start DECRemark - 9004600 Administratively closed due to file review and/or
		information received. If new information arises to contradict this
		determination DEC reserves the right to reopen this spill without prejudice.
		Prior to Sept, 2004 data translation this spill Lead DEC Field was "WADSWORTH"
		09/27/95: This is additional information about material spilled from
		the translation of the old spill file: TANK TEST. END DECRemark - 9004600
HI	ST LTANKS:	
	Region of Spill:	3
	Spill Number:	9004600
	Investigator:	WADSWORTH
	Caller Name:	Not reported
	Caller Agency:	Not reported

Database(s)

EDR ID Number EPA ID Number

ENGINE #1 YONKERS FD (Continued)

Caller Phone: Not reported Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported 07/25/1990 Spill Date: Spill Time: 13:00 Reported to Department Date: 07/25/90 Reported to Department Time: 15:29 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported CITY OF YONKERS Spiller Name: Spiller Address: Not reported Spiller City,St,Zip: Not reported Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Test Failure Resource Affectd: On Land Water Affected: Not reported Spill Source: Other Non Commercial/Industrial Spill Notifier: Tank Tester PBS Number: Not reported 06/18/53 **Cleanup Ceased:** Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** True Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 06/18/53 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 07/31/90 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 06/06/97 Is Updated: False PBS Number: Not reported Not reported Tank Number: Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate: Petroleum Material Class Type: Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Pounds Quantity Recovered: 0 Unkonwn Quantity Recovered: False DIESEL Material: Class Type: DIESEL

Map ID Direction		MAP FINDINGS		
Distance Distance (ft Elevation	t.) Site		Database(s)	EDR ID Number EPA ID Number
	ENGINE #1 YONKERS FD (Co	ntinued)		S102618904
	translatio	Not reported 19940728 5: This is additional information about material spilled from the on of the old spill file: TANK TEST. 5: EMPTY CITY OF YONKERS IS TAKING BIDS FOR TANK F		NER E-Z CHECK
AD168 SE 1/2-1 2766 ft.	YONKERS FIRE ENGINE CO.# 5-7 NEW SCHOOL STREET YONKERS, NY		NY LTANKS HIST LTANKS	S100140793 N/A
Relative: Higher	Site 4 of 4 in cluster AD LTANKS:			
Actual: 72 ft.	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company: Spiller Phone: Spiller City,St,Zip: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Contact: Spiller Phone: Spiller Contact: Spiller Phone: Spiller Contact: Spiller Contact: Spiller Extention: DEC Region: Program Number: DER Facility ID:	206331 03/08/90 Not reported 8911558 8911558 6018 3 WXWADSWO Not reported 03/08/90 Not reported Tank Test Failure Not reported Institutional, Educational, Gov., Other Tank Tester 06/18/53 True / / Penalty Not Recommended False Not reported 03/08/90 0 0 03/08/90 0 0 03/09/90 09/02/93 Not reported SAME Not reported Not r		

206331

937241 01

441071

0001

Site ID:

. Material ID:

Material Code:

Operable Unit ID: Operable Unit:

Database(s)

EDR ID Number EPA ID Number

Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	206331
Spill Tank Test:	11404
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	
DEC Remarks: Remark:	 Start CallerRemark - 8911558 NO ACTION YET DETERMINED END CallerRemark - 89 Start DECRemark - 8911558 Administratively closed due to file review and/or information received. If new information arises to contradict this determination DEC reserves the right to reopen this spill without prejudice. Prior to Sept, 2004 data translation this spill Lead DEC Field was "WADSWORTH" 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST. END DECRemark - 8911558
HIST LTANKS:	2
Region of Spill: Spill Number:	3 8911558
Investigator:	WADSWORTH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	03/08/1990
Spill Time:	10:45
Reported to Departmer	nt Date: 03/08/90
Reported to Departmer	nt Time: 11:15
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	On Land
	Not reported
Water Affected: Spill Source:	Not reported Other Non Commercial/Industrial

Database(s)

EDR ID Number **EPA ID Number**

YONKERS FIRE ENGINE CO.#1 (Continued)

PBS Number: Not reported 06/18/53 Cleanup Ceased: Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 06/18/53 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 03/09/90 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 09/02/93 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL #2 FUEL OIL Class Type: Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207 DEC Remarks: 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST. NO ACTION YET DETERMINED Spill Cause:

S100140793

NY LTANKS S101509084 NY HIST LTANKS N/A

AF169 NNE 1/2-1 2838 ft.	APARTMENT BLDG. 292 WOODWORTH AVE. YONKERS, NY	
	Site 1 of 3 in cluster AF	
Relative: Higher	LTANKS:	
Inglief	Site ID:	140314
Actual:	Spill Date:	01/17/95
61 ft.	Facility Addr2:	Not reported
	Facility ID:	9413826
	Program Number:	9413826
	SWIS:	6018
	Region of Spill:	3
	Investigator:	tdghiosa

Referred To:

Spill Cause:

Water Affected:

CID:

Reported to Dept:

Not reported

Not reported

Tank Test Failure

01/17/95

17

Database(s)

EDR ID Number EPA ID Number

Spill Source:	Commercial/Industrial
Spill Notifier:	Tank Tester
Cleanup Ceased:	
Cleanup Meets Standard:	False
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
opin oldoo.	Responsible Party. Corrective action taken.
Spill Closed Dt:	05/16/05
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	05/16/05
Spille Namer:	Not reported
Spiller Company:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	
•	Not reported
Spiller Address: Spiller City,St,Zip:	Not reported ***Update***, ZZ
	001
Spiller County:	
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9413826
DER Facility ID:	119829
Site ID:	140314
Operable Unit ID:	1007400
Operable Unit:	01
Material ID:	372573
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	140314
Spill Tank Test:	18112
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 9413826 BELIEVED TO BE A PIPING PROBLEM NOT A TANK PROBLEM
	WILL RETEST VACU-TEST END CallerRemark - 9413826
Remark:	Start DECRemark - 9413826 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" May 2005 The reason for the initiation of this spill
	report is unknown since the owner has no knowledge of any u/g tanks at the
	site. Presentowner, John Prenty had US Tank Tech check the A/G storage system
	currently in use and no problems were noted. NFA TG END DECRemark - 9413826

Database(s)

EDR ID Number EPA ID Number

S101509084

HIST LTANKS: Region of Spill: 3 Spill Number: 9413826 Investigator: GHIOSAY Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Spill Date: 01/17/1995 Spill Time: 16:00 Reported to Department Date: 01/17/95 Reported to Department Time: 16:10 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Not reported Spiller Name: Spiller Address: Not reported Spiller City, St, Zip: Not reported Not reported Facility Contact: Facility Phone: Not reported Facility Extention: Not reported Tank Test Failure Spill Cause: Resource Affectd: On Land Water Affected: Not reported Other Commercial/Industrial Spill Source: Spill Notifier: Tank Tester PBS Number: Not reported **Cleanup Ceased:** 11 Cleanup Meets Standard: False Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Known release with minimal potential for fire or hazard. DEC Response. Willing Spill Class: Responsible Party. Corrective action taken. Spill Closed Dt: 11 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 01/30/95 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 02/08/95 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported 0.00 Leak Rate Failed Tank: Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0

Map ID Direction		MAP FINDINGS		
Distance Distance (f Elevation	t.) Site		Database(s)	EDR ID Number EPA ID Number
	APARTMENT BLDG. (Continue	ed)		S101509084
	Unkonwn Quantity Spilled: Units: Quantity Recovered: Unkonwn Quantity Recover Material: Class Type: Times Material Entry In File CAS Number: Last Date: DEC Remarks: Not repo Spill Cause: BELIEVE	#2 FUEL OIL #2 FUEL OIL :: 24464 Not reported 19941207	EM WILL RETEST VAC	CU-TEST
AE170 SSE 1/2-1 2848 ft.	OFFICE BUILDING 30 SOUTH BROADWAY YONKERS, NY		NY LTANKS NY Spills NY HIST LTANKS	S100165993 N/A
	Site 3 of 3 in cluster AE			
Relative: Higher	LTANKS:			
-	Site ID:	164744		
Actual: 49 ft.	Spill Date:	10/13/89 Not reported		
49 11.	Facility Addr2: Facility ID:	Not reported 8906911		
	Program Number:	8906911		
	SWIS:	6018		
	Region of Spill: Investigator:	3 wxwadswo		
	Referred To:	Not reported		
	Reported to Dept:	10/13/89		
	CID: Spill Cause:	17 Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Tank Tester		
	Cleanup Ceased: Cleanup Meets Standard:	06/18/53 True		
	Last Inspection:			
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		-
	Spill Class:	Known release that creates potential for fire or hazard. Responsible Party. Corrective action taken.	DEC Response. Willing	ig
	Spill Closed Dt:	08/17/92		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spille Namer:	08/24/92 Not reported		
	Spiller Company:	SOUTH ASSOC.		
	Spiller Phone:	(516) 347-3336		
	Spiller Extention:	Not reported		
	Spiller Address: Spiller City,St,Zip:	1015 CEADER LANE WOODMERE, NY 11598		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention: DEC Region:	Not reported 3		
	Program Number:	8906911		
	DER Facility ID:	138889		

Database(s)

EDR ID Number EPA ID Number

Site ID:194744Operable Unit ID:931833Operable Unit ID:931833Material ID:443719Material ID:443719Material ID:443719Material ID:445719Material ID:445719Material ID:445719Material ID:445719Material ID:445719Material ID:445719Material ID:94500Material ID:94500Material ID:94500Material ID:94500Material ID:94000Units:GalorsResource Affected:1000Constraint:90000Stat ID:184744Spill Tark Test:17078Tark Number:Not reportedTark Number:00Leak Rate:00Leak Rate:00Leak Rate:000Leak Rate:000 <t< th=""><th>OFF</th><th>ICE BUILDING (Continued</th><th>) S100165993</th></t<>	OFF	ICE BUILDING (Continued) S100165993
Operable Unit ID:931833 Operable Unit:01Material ID:443719Material ID:443719Material Obc:0002Material Name:#4 Fuel OICase No.:Not reportedCase No.:Not reportedOurnity:0.00Units:GallonsRescovered:0.00Rescovered:0.00Rescovered:0.00Corgenate:FalseOxygenate:FalseOxygenate:164744Spill Tank Test:10798Tank Number:Not reportedModified By:SpillsOdified By:SpillsModified By:SpillsModified By:SpillsDEC Remarks:Statt Corgenate:DEC Remarks:Statt Corgenate:Statt Dict14745Spill Date:11/1596Facility Addd2:Not reportedModified Tio:1061708Dict:11/596Facility Addd2:Not reportedModified Dy:Spill Corgenate:Spill Date:11/1596Facility Addd2:Not reportedModified:105233Program Number:9610233Program Number:9610233Program Number:9610233Program Number:961023Sylil Notifier:OtherOhrer76Oil Not reportedReported To portedNot reportedReported To DepretedNot reportedReported To Spill Corgenate:Not report		Site ID [.]	164744
Operable Unit:01Material ID:443719Material ID:443719Material ID:445719Material Code:0002Material Name:44 Fuel OliCase No :No reportedMaterial FA:PetroleumOuanity:0.00Units:GallonsRecourse Affected:GroundwaterOxygenate:FalseShil ID:164744Spil Tank Test:10798Tank Store:0Cross Falt:Not reportedMotified By:Spill Store:Outdite:1001/04Test Method:1001/04Test Method:1001/04Test Method:1001/04Test Method:1001/04Test Method:1001/04Test Method:1002/04DEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remark:Start DECRemark - 8906911Remark:Start CallerRemark - 8906911Remark:Start CallerRemark - 8906911Remark:Start CallerRemark - 8906911Remark:St			
Material ID:443719Material Name:#4 Fuel OilCase No::Not reportedMaterial Name:#4 Fuel OilCase No::Not reportedMaterial FA:PerfolumQuantity:0.00Uhits:GalonsRecovered:0.00Resource AffectedGroundwaterOxygenate:FalseShe ID:164744Spill Tank Test:10798Tank Number:Not reportedTank Number:Not reportedTank Size:0Leak Rate:0.00Leak Rate:1001/04Test Method:Uh/o4Test Method:Uh/o4Test Method:Uh/o4Remark:Start DE/Remark - 8006911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8006911 Fi/or to Sept. 2004 data translation this spill Lead DEC Remarks:Start DE/Remark - 8006911Start DE/Remark - 8006911 Fi/or to Sept. 2004 data translation this spill Lead DEC Field was 'W.WADSWORTH' 08/17/92: TANK PASSED RETEST. END DECRemark - 8006911Stie ID:164745Spill Date:11/15/96Facility Add/2:Not reportedProgram Number:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigato:tdg/isosaReferred To:Not reportedReported to Depr:11/15/96CiD:17Spill Cause:Tank Test FailureWater Affected:Not reportedReported to Depre:11/15/96 <td></td> <td>•</td> <td></td>		•	
Material Code: 002 Material Name: #4 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantly: 0.00 Units: Galons Recovered: 0.00 Recovered: 0.00 Recovered: 0.00 Shill Tank Test: 10738 Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: 0.00 Gords Fail: Not reported Modified By: Spill Tank DEC Remarks: Start CallerRemark - 8006911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8006911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8006911 Fir to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Start DECRemark - 8006911 Fior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Stile ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility Addr2: Not reported		•	
Material Name: # Fuel Oil Gase No.: Not reported Material FA: Petroleum Quantity: 0.0 Units: Gallons Recovered: 0.00 Resource Alfected: Groundwater Oxygenate: False She ID: 164744 Spill Tank Test: 10798 Tank Number: Not reported Tank Size: 0 Occess Fail: Not reported Tank Size: 0.00 Gross Fail: Not reported Modified: 10/01/04 Tast Method: 0/01/04 Last Modified: 10/01/04 Test Method: Unknown DEC Remarks: Stat DECRemark - 8906911 CallerRemark - 8906911 Sept 2004 data translation this spill Lead DEC Remarks: Stat DECRemark - 8906911 She ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility Addr2: Not reported Facility Addr2: Not reported Region of Spill: 3 Investigator: 11/15/96 CiD: 17 Spill Cause: Tank Test Failure Water Affected: <td></td> <td></td> <td></td>			
Case No.: Not reported Material FA:: Petroleum Quantity: 0.0 Quantity: Gallons Recovered: 0.00 Resource Alfected: Goundwater Oxygenate: False Sile ID: 164744 Spill Tank Number: Not reported Tank Number: Not reported Tank Number: 0 Leak Rate: 0.0 Leak Rate: 0.00 Gross Fail: Not reported Modified: 100104 Test Method: 0 Least Modified: 100104 Test Method: 00104 CalerRemark: Sup09115K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CalerRemark: Sup09115K DEC Remarks: Start CalerRemark - 8906911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CalerRemark: Sup0911 Sylid Date: 11/15/96 Sylid Date: 11/15/96 Sylid Cale: Not reported Facility Add/2: Not reported Region of Spill: 3 Investigator: tdfyliosa Referred To: Not reported Reported To Dept: True Cleanup Mumber: Solid			
Material FA: Petrojeum Quantify: 0.00 Units: Galons Recovered: 0.00 Resource Affected: Groundwater Oxygenate: False Shel D: 164744 Spill Tank Test: 10798 Tank Number: Not reported Tank Number: 0 Leak Rate: 0 Gross Fal: Not reported Modified By: Spills Last Modified: 1001/04 Test Method: Unknown DEC Remarks: Start CallerRemark - 8006911 SK, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8006911 Remark: Spill Date: 11/15/96 Facility Addr2: Not reported Spill Date: 11/15/96 Facility Addr2: Not reported Program Number: 9610233 SWIS: 6018 Reported to Dept: 11/15/96 Facility Addr2: Not reported Not reported Reported To Not reported Spill Cause: Spill Cause: Tark Test Failure Water Affected: Not reported Spill Cause: Tark Test Failure Water Affected: Not reported			
Quantity: 0.0 Units: Gallons Recovered: 0.00 Resource Affected: Groundwater Oxygenate: False She ID: 164744 Spill Tank Test: 10798 Tank Number: Not reported Tark Size: 0 Leak Rate: 0.00 Gords: GallerKemark DeC Remarks: Start CallerKemark - 8906911 Start CallerKemark - 8906911 FK, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerKemark - 8906911 CallerKemark - 8906911 Files to the fold t			
Units:GalonsRecource Affected:GroundwaterOxygenate:FalseSile ID:164744Spill Tank Test:10798Tank Number:Not reportedTank Size:00Cross Fall:Not reportedNot reportedTask Mumber:000Gross Fall:Not reportedModified By:SpillsLast Modified:100/104Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911DEC Remarks:Start CallerRemark - 8906911Remark:Start CallerRemark - 8906911Remark:Start CallerRemark - 8906911Spill Date:11/15/96Spill Date:11/15/96Facility Addr2:Not reportedProgram Number:9610233Program Number:9610233Program Number:961023SyllS:6018Referred To:Not reportedReferred To:Not reportedReferred To:Not reportedSpill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Cause:Theal Not RecommendedUST Involvement:FailureWater Affected:Not RecommendedUST Involvement:FailureWater Affected:Not RecommendedUST Involvement:FailureMarkettered In Compute:FailureSpill Class:Known			
Recovered: 0.00 Resource Affected: Groundwater Oxygenate: False Site ID: 164744 Spill Tank Test: 10798 Tank Number: Not reported Tank Size: 0 Leak Rate: 0.00 Gross Fall: Not reported Modified By: Spills Last Modified: 100/1/04 Test Method: Unknown DEC Remarks: Start CallerRemark - 8906911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 DEC Remarks: Start CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Site ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility Addr2: Not reported Facility Addr2: Not reported Facility Addr2: Not reported Program Number: 9610233 SWS 6018 Refered To: Not reported Refered To: Not reported Spill Cause: Tank Test Failure Water Affected: Not reported Spill Noutfier: Other Cleanup Dests 1/15/96 Sp		-	
Resource Affected:GroundwaterDyogenate:FalseSite ID:164744Spill Tank Test:10798Tank Number:Not reportedTank Number:0Leak Rate:0.0Leak Rate:0.0Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start Caller/Remark - 8906911 5K, AES SYSTEM IL - 21279 GPH, PBS TO FOLLOW END Caller/Remark - 8906911DEC Remarks:Start Caller/Remark - 8906911Spill Date:11/15/96Spill Date:11/15/96Spill Addr2:Not reportedFacility ID:9610233Program Number:9610233SWS:6018Referred To:Not reportedReferred To:Not reportedReferred To:Not reportedReferred To:Not reportedReferred To:Not reportedReferred To:Not reportedSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Cause:TrueLast Inspection:1/1Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:0ORemerciation Phase:ODate Entered In: Comput:Spill Roads900403Spill Roads900403Spill Roads900403Spill Roads900403 <td></td> <td></td> <td></td>			
Oxygenate:FalseSite ID:164744Spill Tank Test:10798Tank Number:Not reportedTank Size:0Leak Rate:0.00Gross Fall:Not reportedModified By:SpillsLast Method:10/01/04Test Method:UnknownDEC Remarks:Start DECRemark - 8906911 5K, AES SYSTEM II, - 21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remarks:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W-WADSWORTH" 08/17/92: TANK PASSED RETEST.Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedProgram Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReferred To:Not reportedReferred To:Not reportedReported to Dept:117/5/96CiD:17Spill Cause:Canmercial/IndustrialSpill Surce:Commercial/IndustrialSpill Surce:Commercial/IndustrialSpill Cause:/ /Cleanup Meets Standard:FrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:PiaseSpill Class:Fnow release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Class Diase:0Deate Entered In: Computer:11/15/96<			
Site ID:164744Spill Tank Test:10798Tank Number:Not reportedTank Number:0Ceak Rate:0.00Gross Falt:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remark:Start CallerRemark - 8906911Remark:Start CallerRemark - 8906911Remark:Start DECRemark - 8906911DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911Site ID:164745Spill Date:11/15/96Facility ID:9610233Program Number:9610233Program Number:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdphiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Ceased:/ /VIRecommended Penalty:Parity Not RecommendedResponse. Willing Responselbe Parity. Corrective action taken.Spill Class:Robit Pits/15/96Spill Class:0ODate Entered In Computer:Spill Robation Phase: <td></td> <td></td> <td></td>			
Spill Tank Test:10798Tank Number:Not reportedTank Size:0Test Method:00Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remarks:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility Addr2:Not reportedFacility ID:9610233Program Number:961023SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReportedDEC:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Cause:TrueLast Inspection:/Cleanup Ceased:/Cleanup Meets Standard:FalseSpill Closed Dt:08/07/97Remendiation Phase:0Obt Entered In Compute:11/15/96Spill Closed Dt:08/07/97Remediation Phase:0Obt Entered In Compute:11/15/96Spill Closed Dt:09/04/03Spill Robard Dt:09/04/03Spill			
Tank Number:Not reportedTank Size:0Test Method:00Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911DEC Remarks:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was 'W.WADSWORTH' 08/17/92: TANK PASSED RETEST.Ste ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233Program Number:9610233SWIS:6018Referred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Ceased:/ /Cleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Cleanup Meets Standard:ResortedSpill Clase:FalseSpill Closed Dt:9807/97Remended Dt:9807/97Remeridino Phase:0Date Entered In Compute:11/15/96Spill Clase:0Date Entered In Compute:11/15/96Spill Clase:0Date Entered In Compute:11/15/96Spill Clase Dt:090/797 <t< td=""><td></td><td></td><td></td></t<>			
Tank Size:0Test Method:00Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:100/104Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Remark:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Spill Date:11/15/96Facility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:11/15/96Referred To:Not reportedReported to Dept:11/15/96ClD:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Caased:/Cleanup Caased:/Cleanup Caased:/Spill Class:FalseSpill Class:FalseSpill Class:Not reportedSpill Class:80/07/97Remorediation Phase:00Dete Entered In Compute:11/15/96Classe:0Date Entered In Compute:11/15/96Spill Class:6018Responsible Party. Corrective action taken.Spill Classe:0Date Entered In Compute:11/15/96Spill		•	
Test Mathod:00Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:1001/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II, -21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remark:Start CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Meets Standard:TrueLast Inspection:/ /Cleanup Meets Standard:FrueVater Affected:Not reportedSpill Close Dt:FailseSpill Close Dt:Panalty Not RecommendedUST Involvement:FailseSpill Close Dt:08/07/97Remercial/IndustrialSpill Close Dt:Spill Close Dt:08/07/97Remercial/IndustrialSpill Close Dt:Spill Close Dt:08/07/97Remercial PAIN Not RecommendedUST Involvement:FalseSpill Close Dt:08/07/97			
Leak Rate:0.00Gross Fail:Not reportedModified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911Stei ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility Addr2:Not reportedFacility JD:9610233SWIS:6018Region of Spill:3Investigator:tdyfiosaReferred To:Not reportedReported to Dept:11/15/96CID:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Source:Commercial/IndustrialSpill Class:FalseSpill Class:FalseSpill Class:FalseSpill Class:FalseSpill Class:FalseSpill Class:00Det Entered In Compute:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record11/15/96Spill Reamer:Last UPDAteSpill Reamer:11/15/96 </td <td></td> <td></td> <td></td>			
Gross Fail: Not reported Modified By: Spills Last Modified: 1001/04 Test Method: Unknown DEC Remarks: Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Remark: Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Site ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility ID: 9610233 Program Number: 9610233 SWIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Commercial/Industrial Spill Source: Commercial/Industrial Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Class:			
Modified By:SpillsLast Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Remark:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWatter Affected:Not reportedSpill Notifier:OtherCleanup Meets Standard:TrueLast Affected:Not RecommendedSpill Class:Kown release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:0/07/97Remeridation Phase:0Date Entered In Compute:11/15/96Spill Record Last Update:09/04/03Spill Reamer:LYNN BRIEN			
Last Modified:10/01/04Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Remark:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST.Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Geased:/ /Cleanup Geased:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Closed Dt:0/07/97Remark Class:Known release with minimal potential for fire or hazard. DEC Response. Willing 			
Test Method:UnknownDEC Remarks:Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911Remark:Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911Site ID:164745Spill Date:11/15/96Facility Addr2:Not reportedFacility Addr2:Not reportedFacility JD:9610233SWIS:6018Region of Spill:3Investigator:tighiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Notifier:OtherCleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Closed DT:007/97Remediation Phase:0Date Entered In Compute:11/15/96Spill Closed DT:007/97Remediation Phase:0Date Entered In Compute:11/15/96Spill Class0Date Entered In Compute:11/15/96Spill Roard:11/15/96Spill Roard:0Date Entered In Compute:11/15/96Spill Roard:11/15/96Spill Roard:11/15/96Spill Roard:11/15/96Spill Roard:11/15/96Spill Roard:<		2	
DEC Remarks: Start CallerRemark - 8906911 5K, AES SYSTEM II,21279 GPH, PBS TO FOLLOW END CallerRemark - 8906911 Remark: Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Site ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility ID: 9610233 Program Number: 9610233 SWIS: 6018 Region of Spill: 3 Investigator: tdphiosa Referred To: Not reported Reported to Dept: 11/15/96 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Commendal/Industrial Spill Notifier: Other Cleanup Ceased: / Recommended Penalty: Penalty Not Recommended Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Classed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96			
CallerRemark - 8906911 Remark: Start DECRemark - 8906911 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8906911 Site ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility 1D: 9610233 Program Number: 9610233 SVIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 11/15/96 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Meets Standard: True Last Inspection: / Responsible Party: Penalty Not Recommended Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Compute: 11/15/96 Spill Namer: LYNN BRIEN			
DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark - 8006911 Site ID: 164745 Spill Date: 11/15/96 Facility Addr2: Not reported Facility ID: 9610233 Program Number: 9610233 SWIS: 6018 Region of Spill: 3 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 11/15/96 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Meets Standard: True Last Inspection: / / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Closed DI: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spill Namer: LYNN BRIEN		DEC Remarks:	
Spill Date:11/15/96Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Clases:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		Remark:	DEC Field was "W.WADSWORTH" 08/17/92: TANK PASSED RETEST. END DECRemark -
Facility Addr2:Not reportedFacility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Compute:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		Site ID:	164745
Facility ID:9610233Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Compute:1115/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		Spill Date:	11/15/96
Program Number:9610233SWIS:6018Region of Spill:3Investigator:tdphosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Resonmended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:11/15/96Spill Record Last Update:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:0Spill Record Last Update:11/15/96Spill Record Last Update:05/04/03Spill Record L		Facility Addr2:	Not reported
SWIS:6018Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:0Date Entered In Compute:11/15/96Spill Record Last Update:0/04/03Spill Record Last Update:0/04/03Spill Record Last Update:11/15/96		Facility ID:	9610233
Region of Spill:3Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/Cleanup Meets Standard:TrueLast Inspection:/Recommended Penalty:Penalty Not RecommendedSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:01/24/03Spill Record Last Update:<		Program Number:	9610233
Investigator:tdghiosaReferred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/Cleanup Meets Standard:TrueLast Inspection:/Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:0Date Entered In Compute:11/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:01/15/96Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:09/04/03Spill Record Last Update:01/03Spill Record Last Update:00/04/03Spill Record Last Update:01/03Spill Record Last Update:00/04/03Spill Record Last Update:00/04/03Spill Roade:00/04/03Spill Record Last Update:00/04/03Spill Record Last Update:00/04/03Spill Record Last Update:00/04/03Spill Record Last Update:00/04/		SWIS:	6018
Referred To:Not reportedReported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/Cleanup Meets Standard:TrueLast Inspection:/Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Namer:LYNN BRIEN		Region of Spill:	3
Reported to Dept:11/15/96CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Namer:LYNN BRIEN		Investigator:	tdghiosa
CID:17Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/Cleanup Meets Standard:TrueLast Inspection:/Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Closed Dt:0Spill Closed Dt:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spill Namer:LYNN BRIEN		Referred To:	Not reported
Spill Cause:Tank Test FailureWater Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Compute:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		Reported to Dept:	11/15/96
Water Affected:Not reportedSpill Source:Commercial/IndustrialSpill Notifier:OtherCleanup Ceased:/Cleanup Meets Standard:TrueLast Inspection:/Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		CID:	17
Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Ceased: / Cleanup Meets Standard: True Last Inspection: / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: OB/07/97 Remediation Phase: O Date Entered In Computer: Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Spill Cause:	Tank Test Failure
Spill Notifier:OtherCleanup Ceased:/ /Cleanup Meets Standard:TrueLast Inspection:/ /Recommended Penalty:Penalty Not RecommendedUST Involvement:FalseSpill Class:Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.Spill Closed Dt:08/07/97Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN			Not reported
Cleanup Ceased: / / Cleanup Meets Standard: True Last Inspection: / / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Spill Source:	Commercial/Industrial
Cleanup Meets Standard: True Last Inspection: / / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Spill Notifier:	Other
Last Inspection: / / Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Cleanup Ceased:	11
Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Cleanup Meets Standard:	True
UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Last Inspection:	11
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Recommended Penalty:	Penalty Not Recommended
Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN			False
Spill Closed Dt: 08/07/97 Remediation Phase: 0 Date Entered In Computer: 11/15/96 Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN			
Remediation Phase:0Date Entered In Computer:11/15/96Spill Record Last Update:09/04/03Spille Namer:LYNN BRIEN		Spill Closed Dt:	08/07/97
Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN			0
Spill Record Last Update: 09/04/03 Spille Namer: LYNN BRIEN		Date Entered In Computer:	11/15/96
Spille Namer: LYNN BRIEN			
		•	

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

OFFICE BUILDING (Contin	ued) \$100165993
Spiller Phone:	(914) 592-3500
Spiller Extention:	Not reported
Spiller Address:	30 SOUTH BROADWAY
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	001
Spiller Contact:	LYNN BRIEN
Spiller Phone:	(914) 592-3500
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9610233
DER Facility ID:	138889
Site ID:	164745
Operable Unit ID:	1038159
Operable Unit:	01
Material ID:	342447
Material Code:	0002
Material Name:	#4 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9610233 caller had no other info at this time END
	CallerRemark - 9610233
Remark:	Start DECRemark - 9610233 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" 11/15/96 WILL RETEST 08/07/97 PROBLEM IN PIPING;
	PREP. FOR TANK ABANDONEMENT; TANK INSPECTION REVEALED SOME TYPE OF
	INTERNAL LINING; BORINGS WERE ATTEMPTED AROUND THE TANK; THEY HIT
	SHALLOW BEDROCK; GEOLOGICAL RECORD SEARCH REVEALLED VERY
	TIGHT/CONFINING ROCK; NO SIGNS OF CONTAMINATION; END DECRemark - 9610233
NY Spills:	
Site ID:	164743
Facility Addr2:	Not reported
Facility ID:	0211687
Spill Number:	0211687
Facility Type:	ER
SWIS:	6018
Region of Spill:	3
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Spill Date:	02/25/03
Reported to Dept:	02/25/03
CID:	17
Spill Cause:	Other

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

OFFICE BUILDING (Continue	d) \$100165993
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Responsible Party
Cleanup Ceased:	
Cleanup Meets Std:	True
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
UST Trust:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	05/06/04
Remediation Phase:	0
Date Entered In Computer	
Spill Record Last Update:	05/06/04
Spiller Name:	LYNN PERSICO
Spiller Company:	Not reported
Spiller Address:	30 SOUTH BROADWAY CONDOS
Spiller City,St,Zip:	YONKERS, NY
Spiller Company:	001
Spiller Phone:	(914) 592-3500
Contact Name:	
Contact Phone:	(914) 592-3500
DEC Region:	3
Program Number:	0211687
DER Facility ID: Site ID:	138889
	164743 865011
Operable Unit ID: Operable Unit:	01
Material ID:	511475
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
DEC Remarks: Start Ca	IllerRemark - 0211687 EASTMEN TANK IS ENROUTE to pump/vac out water
w/oil sh	een from basement. Water line broke w/water going to basement &
furnace	. Oil from burners put sheen onto water. END CallerRemark - 0211687
	ECRemark - 0211687 Prior to Sept, 2004 data translation this spill Lead
	eld was "WCHD - MANCINI" RECOMMENDED FOR CLOSURE BY WCHD-MANCINI. END
DECRe	mark - 0211687
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8906911
Investigator:	W.WADSWORTH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone: Notifier Extension:	Not reported Not reported
	Νοιτεροπού

Database(s)

EDR ID Number EPA ID Number

S100165993

OFFICE BUILDING (Continued)

Spill Date: 10/13/1989 Spill Time: 12:00 Reported to Department Date: 10/13/89 Reported to Department Time: 15:47 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: SOUTH ASSOC. Spiller Address: 1015 CEADER LANE WOODMERE, NY 11598 Spiller City, St, Zip: Facility Contact: Not reported (516) 347-3336 Facility Phone: Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** Groundwater Water Affected: Not reported Other Commercial/Industrial Spill Source: Spill Notifier: Tank Tester PBS Number: 3-502618 Cleanup Ceased: 06/18/53 Cleanup Meets Standard: True Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/17/92 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 11/01/89 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 08/24/92 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #4 FUEL OIL #4 FUEL OIL Class Type: Times Material Entry In File: 1751 CAS Number: Not reported Last Date: 19941205 DEC Remarks: 08/17/92: TANK PASSED RETEST. 5K, AES SYSTEM II, -.21279 GPH, PBS TO FOLLOW Spill Cause:

Database(s)

EDR ID Number EPA ID Number

S100165993

OFFICE BUILDING (Continued)

Region of Spill: 3 9610233 Spill Number: Investigator: GHIOSAY Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported 11/15/1996 Spill Date: Spill Time: 13:15 Reported to Department Date: 11/15/96 Reported to Department Time: 13:59 SWIS 55 Spiller Contact: LYNN BRIEN Spiller Phone: (914) 592-3500 Spiller Extention: Not reported OFFICE BUILDING Spiller Name: Spiller Address: 30 S. BROADWAY Spiller City, St, Zip: YONKERS, NY Facility Contact: LYNN BRIEN Facility Phone: (914) 592-3500 Facility Extention: Not reported Spill Cause: Tank Test Failure **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Other Commercial/Industrial Spill Notifier: Other PBS Number: Not reported Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 08/07/97 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 11/15/96 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 10/14/97 Is Updated: False PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True

Map ID Direction		MAP FINDINGS		
Distance Distance (ft. Elevation) Site		Database(s)	EDR ID Number EPA ID Number
	OFFICE BUILDING (Continued) Gallons		S100165993
	Quantity Recovered: Unkonwn Quantity Recover	0		
	Material: Class Type:	#4 FUEL OIL #4 FUEL OIL		
	Times Material Entry In File CAS Number:			
	Last Date:	19941205		
	TANK IN AROUNI	WILL RETEST 08/07/97 PROBLEM IN PIPING; PRE SPECTION REVEALED SOME TYPE OF INTERNAL THE TANK; THEY HIT SHALLOW BEDROCK; GEO GHT/CONFINING ROCK: NO SIGNS OF CONTAMIN	LINING; BORINGS WE LOGICAL RECORD SE	RE ATTEMPTED
		d no other info at this time	Anon,	
171 NE 1/2-1	CO-OP BLDG 332 PALISADES AVE. YONKERS, NY		NY LTANKS NY HIST LTANKS	S100140680 N/A
2927 ft.	LTANKS:			
Relative: Higher	Site ID:	115918		
Actual:	Spill Date: Facility Addr2:	11/08/89 Not reported		
291 ft.	Facility ID: Program Number:	8907858 8907858		
	SWIS:	6018		
	Region of Spill: Investigator:	3 wxwadswo		
	Referred To:	Not reported		
	Reported to Dept:	11/08/89		
	CID: Spill Cause:	17 Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source:	Commercial/Industrial		
	Spill Notifier:	Tank Tester		
	Cleanup Ceased: Cleanup Meets Standard:	04/21/93 False		
	Last Inspection:	/ /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement: Spill Class:	False Known release that creates potential for fire or hazard Responsible Party. Corrective action taken.	I. DEC Response. Willin	ng
	Spill Closed Dt:	04/21/93		
	Remediation Phase:	0		
	Date Entered In Computer: Spill Record Last Update:			
	Spille Namer:	Not reported		
	Spiller Company:	FLOVAS MGT.		
	Spiller Phone: Spiller Extention:	(212) 355-1500 Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	ZZ		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported		
	DEC Region:	Not reported 3		
	Program Number:	8907858		

Resource Affectd:

Groundwater

Database(s)

EDR ID Number EPA ID Number

CO-OP BLDG (Continued)	S100140680
DER Facility ID:	100909
Site ID:	115918
Operable Unit ID:	935456
Operable Unit:	01
Material ID:	444635
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	115918
Spill Tank Test:	10940 Not see a stad
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown Stort ColleyDemorie 2007058 5 K TANK CROSS I FAK LIORNER F7 WILL EMPTY TANK
DEC Remarks:	Start CallerRemark - 8907858 5 K TANK GROSS LEAK, HORNER EZ, WILL EMPTY TANK,
Dementer	EIR. SHIRLEY WILL CALL BACK. END CallerRemark - 8907858
Remark:	Start DECRemark - 8907858 Prior to Sept, 2004 data translation this spill Lead DEC Field was "W. WADSWORTH" END DECRemark - 8907858
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8907858
Investigator:	W. WADSWORTH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	11/08/1989
Spill Time:	11:00
Reported to Department I	
Reported to Department	
SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	FLOVAS MGT.
Spiller Address:	Not reported
	•
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	(212) 355-1500 Not reported
Facility Extention:	Not reported Tank Test Failure
Spill Cause: Resource Affectd:	Tank Test Fallure Groundwater

CO-OP BLDG (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Water Affected:	Not reported
Spill Source:	Other Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	3-504955
Cleanup Ceased:	04/21/93
Cleanup Meets Standard:	False
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	False
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	04/21/93
Date Region Sent Summary t	o Central Office: / /
Corrective Action Plan Submi	tted: / /
Date Spill Entered In Comput	er Data File: 11/10/89
Time Spill Entered In Comput	er Data File: Not reported
Spill Record Last Update:	08/31/95
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	0
Test Method:	Not reported
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Not reported
Quantity Recovered:	0
Unkonwn Quantity Recovered	
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In File:	24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: Not reporte	
Spill Cause: 5 K TANK	GROSS LEAK, HORNER EZ, WILL EMPTY TANK, EIR. SHIRLEY WILL CALL BACK.

172 NNE 1/2-1 2961 ft.	140 RAVENA AV YONKERS, NY		NY LTANKS NY HIST LTANKS	S104620934 N/A
Relative: Higher Actual: 46 ft.	LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number:	128846 03/22/00 Not reported 9914447 9914447		
	SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID:	6018 3 WCHD WESTCHESTER CNTY HEALTH D 03/22/00 17		

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number EPA ID Number

S104620934

(Continued)	S104620934
Spill Cause:	Tank Failure
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	//
Cleanup Meets Standard:	False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	//
Remediation Phase:	1
Date Entered In Computer:	: 03/22/00
Spill Record Last Update:	
Spille Namer:	VICTOR/JOE MIGOO
Spiller Company:	Not reported
Spiller Phone:	(212) 837-3603
Spiller Extention:	Not reported
Spiller Address:	140 RAVENA AV
Spiller City,St,Zip:	YONKERS, NY
Spiller County:	001
Spiller Contact:	VICTOR/JOE MIGOO
Spiller Phone:	(212) 837-3603
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9914447
DER Facility ID:	111107
Site ID:	128846
Operable Unit ID:	1092526
Operable Unit: Material ID:	01 292734
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9914447 WHILE CLEANING TANK, HOLES WERE DISCOVERED END
	CallerRemark - 9914447
Remark:	Not reported
HIST LTANKS:	
Region of Spill:	3

Region of Spill:

3

Database(s)

EDR ID Number EPA ID Number

(Continued)

Spill Number:	9914447
Investigator:	WCHD
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	03/22/2000
Spill Time:	10:00
Reported to Department Date	
Reported to Department Time	
swis:	55
Spiller Contact:	VICTOR/JOE MIGOO
Spiller Phone:	(212) 837-3603
Spiller Extention:	Not reported
Spiller Name:	Not reported
Spiller Address:	140 RÁVENA AV
Spiller City,St,Zip:	YONKERS, NY
Facility Contact:	VICTOR/JOE MIGOO
Facility Phone:	(212) 837-3603
Facility Extention:	Not reported
Spill Cause:	Tank Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Affected Persons
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard:	False
Last Inspection:	
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	
Investigation Complete:	//
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	
Date Region Sent Summary	
Corrective Action Plan Subm	
Date Spill Entered In Comput	
Time Spill Entered In Compu	
Spill Record Last Update:	03/24/00
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method: Leak Rate Failed Tank:	Not reported Not reported
	•
Gross Leak Rate: Material Class Type:	Not reported
Quantity Spilled:	Petroleum 0
Unkonwn Quantity Spilled:	o False
Units:	Gallons
Ginto.	Gunorio

/lap ID		MAP FINDINGS		
Direction Distance	ч			
Distance (ft Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	(Continued)			S104620934
	WCHD T	#2 FUEL OIL #2 FUEL OIL	ACTION. TANK IS 50	000 GALLONS.
73 SE /2-1 022 ft.	APARTMENT BUILDING 127-129 NEW MAIN STREET YONKERS, NY		NY LTANKS	S105997142 N/A
Relative: ligher	LTANKS: Site ID: Spill Date:	256002 10/29/02		
Actual: 8 ft.	Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company: Spiller Phone: Spiller Cotty, St, Zip: Spiller Cotty, St, Zip: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: Program Number: DER Facility ID:		1. DEC Response. Willi	ng

Database(s)

EDR ID Number EPA ID Number

	APARTMENT BUILDING (Cont	inued)	S105997142
	Operable Unit:	01	
	Material ID:	514875	
	Material Code:	0001	
	Material Name:	#2 Fuel Oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	0.00	
	Units:	Gallons	
	Recovered:	0.00	
	Resource Affected:	Soil	
	Oxygenate:	False	
	Site ID:	256002	
	Spill Tank Test:	2197	
	Tank Number:	1	
	Tank Size:	2000	
	Test Method:	03	
	Leak Rate:	0.00	
	Gross Fail:	Not reported	
	Modified By:	Spills	
	Last Modified:	10/01/04	
	Test Method:	Horner EZ Check I or II	
	DEC Remarks:	Start CallerRemark - 0207870 TANK FAILED THE TEST. END CallerRem	ark - 0207870
	Remark:	Not reported	
AG174 South 1/2-1 3047 ft. Relative: Higher Actual: 64 ft.	YONKERS CITY HALL 40 SOUTH BROADWAY YONKERS, NY Site 1 of 2 in cluster AG LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Pacily Net States	278870 03/08/90 Not reported 8911572 8911572 6018 3 WXWADSWO Not reported 03/08/90 17 Tank Test Failure Not reported Institutional, Educational, Gov., Other	
	Spill Notifier: Cleanup Ceased:	Tank Tester 06/18/53	
	Cleanup Meets Standard:	True	
	Last Inspection:		
	Recommended Penalty:	Penalty Not Recommended	
	UST Involvement:	False	
	Spill Class:	Not reported	
	Spill Closed Dt:	02/07/91	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:	03/19/91 Not reported	

APARTMENT BUILDING (Continued)

Spille Namer:

Spiller Company:

Not reported

SAME

TC1784877.2s Page 374

Database(s)

EDR ID Number EPA ID Number

S102619105

TORALING CITT TIALE (CO	5102019105
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	8911572
DER Facility ID:	226429
Site ID:	278870
Operable Unit ID:	937255
Operable Unit:	01
Material ID:	441084
Material Code:	0001 #2 Fuel Oil
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	278870
Spill Tank Test:	11406
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 8911572 TANK INSIDE TANK ROOM ON CONCRETE NOTICED VISIBLE LEAK IN PIPING AND MANHOLE COVER TO REPAIR AND RETEST HORNER EZYCHECK END CallerRemark - 8911572
Remark:	Start DECRemark - 8911572 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WADSWORTH" 03/19/91: TANK PASSED RETEST. 09/27/95: This is
	additional information about material spilled from the translation
	of the old spill file: TANK TEST. END DECRemark - 8911572
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8911572
Investigator:	WADSWORTH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	03/08/1990
Spill Time:	12:00
Reported to Departmer	nt Date: 03/08/90

YONKERS CITY HALL (Continued)

Database(s)

EDR ID Number EPA ID Number

YONKERS CITY HALL (Continued)

Reported to Department Time: 14:21 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: SAME Spiller Address: Not reported Spiller City,St,Zip: Not reported Facility Contact: Not reported Facility Phone: Not reported Not reported Facility Extention: Tank Test Failure Spill Cause: **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Other Non Commercial/Industrial Spill Notifier: Tank Tester PBS Number: 3-493988 06/18/53 **Cleanup Ceased:** Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 UST Involvement: False Spill Class: Not reported Spill Closed Dt: 02/07/91 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 03/09/90 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 03/19/91 Is Updated: False PBS Number: Not reported Not reported Tank Number: Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate: Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported 19941207 Last Date: 03/19/91: TANK PASSED RETEST. 09/27/95: This is additional information about DEC Remarks: material spilled from the translation of the old spill file: TANK TEST. TANK INSIDE TANK ROOM ON CONCRETE NOTICED VISIBLE LEAK IN PIPING AND MANHOLE Spill Cause: COVER TO REPAIR AND RETEST HORNER EZYCHECK

Database(s)

EDR ID Number EPA ID Number

AG175 South	YONKERS CITY HALL BLDG 40 SOUTH BROADWAY		NY LTANKS NY HIST LTANKS	S102674855 N/A
1/2-1	YONKERS, NY		NT HIST LTANKS	N/A
3047 ft.	Site 2 of 2 in cluster AG			
Relative: Higher	LTANKS:			
nighei	Site ID:	278869		
Actual:	Spill Date:	10/12/88		
64 ft.	Facility Addr2:	Not reported		
	Facility ID: Program Number:	8805915 8805915		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	jkomara		
	Referred To:	Not reported		
	Reported to Dept: CID:	10/12/88		
	Spill Cause:	17 Tank Overfill		
	Water Affected:	Not reported		
	Spill Source:	Tank Truck		
	Spill Notifier:	Responsible Party		
	Cleanup Ceased:	10/12/88		
	Cleanup Meets Standard:			
	Last Inspection: Recommended Penalty:	10/12/88 Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Not reported		
	Spill Closed Dt:	10/12/88		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spille Namer:	12/02/03 Not reported		
	Spiller Company:	ROBISON OIL CORP.		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip: Spiller County:	ZZ 001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	Program Number: DER Facility ID:	8805915 226429		
	Site ID:	278869		
	Operable Unit ID:	921082		
	Operable Unit:	01		
	Material ID:	457826		
	Material Code:	0001 #2 Fuel Oil		
	Material Name: Case No.:	#2 Fuel Oil Not reported		
	Material FA:	Petroleum		
	Quantity:	10.00		
	Units:	Gallons		
	Recovered:	0.00		
	Resource Affected:	Soil		
	Oxygenate: Site ID:	False Not reported		
		Not reported		

Map ID Direction		MAP FINDINGS		
Distance Distance (ft.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	YONKERS CITY HALL BLD	G (Continued)		S102674855
	Spill Tank Test:	Not reported		
	Tank Number:	Not reported		
	Tank Size:	Not reported		
	Test Method:	Not reported		
	Leak Rate:	Not reported		
	Gross Fail:	Not reported		
	Modified By:	Not reported		
	Last Modified:	Not reported		
	Test Method:	Not reported		
	DEC Remarks:	Start CallerRemark - 8805915 DRIVER CONTAINED W		
		FINISH CLEAN UP 10/12/88 PM. ALL ON SIDEWALK.		
	Remark:	Start DECRemark - 8805915 Prior to Sept, 2004 data tr DEC Field was "J. O'MARA" END DECRemark - 88059		ad
	HIST LTANKS:			
	Region of Spill:	3		
	Spill Number:	8805915		
	Investigator:	J. O'MARA		
	Caller Name:	Not reported		
	Caller Agency:	Not reported		
	Caller Phone:	Not reported		
	Caller Extension:	Not reported		
	Notifier Name:	Not reported		
	Notifier Agency: Notifier Phone:	Not reported		
	Notifier Extension:	Not reported Not reported		
	Spill Date:	10/12/1988		
	Spill Time:	16:00		
	Reported to Departmen			
	Reported to Departmen			
	SWIS:	55		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	Spiller Name:	ROBISON OIL CORP.		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	Not reported Not reported		
	Facility Contact: Facility Phone:	Not reported		
	Facility Extention:	Not reported		
	Spill Cause:	Tank Overfill		
	Resource Affectd:	On Land		
	Water Affected:	Not reported		
	Spill Source:	Tank Truck		
	Spill Notifier:	Responsible Party		
	PBS Number:	Not reported		
	Cleanup Ceased:	10/12/88		
	Cleanup Meets Standar			
	Last Inspection:	10/12/88 Benetiv Not Recommended		
	Recommended Penalty			
	Spiller Cleanup Date: Enforcement Date:	/ / / / / / / / / / / / / / / / / / / /		
	Investigation Complete:			
	UST Involvement:	False		
	Spill Class:	Not reported		
	Spill Closed Dt:	10/12/88		
		mary to Central Office: / /		
	-			

Map ID		1	MAP FINDINGS		
Direction Distance Distance (f Elevation	t.) Site			Database(s)	EDR ID Number EPA ID Number
	YONKERS CITY HALL BLDG	(Continued)			S102674855
	Corrective Action Plan Sub Date Spill Entered In Comp Time Spill Entered In Comp Spill Record Last Update: Is Updated: PBS Number: Tank Number: Tank Size: Test Method: Leak Rate Failed Tank: Gross Leak Rate: Material Class Type: Quantity Spilled:	puter Data File:	/ / 10/17/88 Not reported		
	Unkonwn Quantity Spilled: Units: Quantity Recovered: Unkonwn Quantity Recove Material:	False Gallons 0 ered:False			
	Materia: Class Type: Times Material Entry In File CAS Number: Last Date:	#2 FUEL OIL #2 FUEL OIL e: 24464 Not reported 19941207			
			ABSORBENT MATERIAL. ROBISON	N TO FINISH CLEAN U	P 10/12/88 PM.
AH176 East 1/2-1 3065 ft.	YONKERS COMMUNITY CENT 164 ASHBURTON AVE YONKERS, NY	ſER		NY LTANKS	S107410587 N/A
	Site 1 of 3 in cluster AH				
Relative: Higher	LTANKS:				
Actual: 182 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	Tank Tester / / True / / Penalty Not Reco False Known release w	cational, Gov., Other ommended vith minimal potential for fire or hazar	d. DEC Response. Willi	ng
	Spill Closed Dt: Remediation Phase:	Responsible Par 05/10/06 0	ty. Corrective action taken.	- ·· p -····	5
	Date Entered In Computer:	. U9/21/05			

Map ID Direction Distance Distance (ft.) Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S107410587

YONKERS COMMUNITY CENTER (Continued)

Spill Record Last Update: 05/10/06 UNKNOWN NAME Spille Namer: Spiller Company: YONKERS COMMUNITY CENTER Spiller Phone: (914) 423-5905 Spiller Extention: Not reported Spiller Address: 164 ASHBOURTON AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: UNKNOWN NAME Spiller Phone: (914) 423-5905 Spiller Extention: Not reported DEC Region: 3 Program Number: 0507474 **DER Facility ID:** 300196 Site ID: 352898 Operable Unit ID: 1110371 Operable Unit: 01 Material ID: 2100383 Material Code: 0001 #2 Fuel Oil Material Name: Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Units: Gallons Recovered: 0.00 **Resource Affected:** Groundwater Oxygenate: False Site ID: 352898 Spill Tank Test: 1102955 Tank Number: 1 10000 Tank Size: Test Method: 03 Leak Rate: 0.00 Gross Fail: 0 Watchdog Modified By: Last Modified: 09/21/05 Test Method: Horner EZ Check I or II **DEC Remarks:** Start CallerRemark - 0507474 PBS No: 3-800417 END CallerRemark - 0507474 Start DECRemark - 0507474 May 10, 2006: TANK PASSED A RETEST AFTER PIPING WAS Remark: REPAIRED. BASED UPON INFORMATION PROVIDED TO DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod END DECRemark - 0507474

177LENDEGGERNNE28 GROVE ST1/2-1BRONXVILLE, NY

3073 ft.	
Relative: Higher	HIST LTANKS: Region of Spill: Spill Number:
Actual: 153 ft.	Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency:

Notifier Phone:

3 8606914 TRAVER WC Not reported Not reported Not reported Not reported Not reported Not reported Not reported

NY HIST LTANKS S100139021 N/A

Database(s)

EDR ID Number EPA ID Number

S100139021

Notifier Extension: Not reported 02/06/1987 Spill Date: Spill Time: 14:00 Reported to Department Date: 02/10/87 Reported to Department Time: 16:30 SWIS: 55 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: UNKNOWN Spiller Address: Not reported Not reported Spiller City, St, Zip: Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Cause: Tank Failure **Resource Affectd:** On Land Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Health Department PBS Number: Not reported Cleanup Ceased: 04/06/88 Cleanup Meets Standard: True Last Inspection: 02/10/87 Recommended Penalty: Penalty Not Recommended Spiller Cleanup Date: 11 Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False Spill Class: Not reported Spill Closed Dt: 04/06/88 Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 02/13/87 Time Spill Entered In Computer Data File: Not reported Spill Record Last Update: 04/06/88 Is Updated: False PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported Material Class Type: Petroleum Quantity Spilled: 500 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: #2 FUEL OIL Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207 **DEC Remarks:** / / : 2/10/87-WCHD RESPONDED-WILL INFORM DEC. / / : 2/11/87-WCHD MAINTAINING BOOM-SPILLER IS TO HIRE A CLEAN UP CONTRACTOR-WCHD TO KEEP DEC INFORMED.

Map ID Direction			MAP FINDINGS		
Distance Distance (ft Elevation	:.) Site			Database(s)	EDR ID Numbe EPA ID Numbe
	LENDEGGER (Continue	d)			S100139021
	Spill Cause: No	ot reported			
AH178	APT HOUSE			NY LTANKS	S105995990
East 1/2-1 3077 ft.	7 JONES PL YONKERS, NY				N/A
	Site 2 of 3 in cluster AH				
Relative: Higher	LTANKS: Site ID:	325963			
Actual: 186 ft.	Spill Date: Facility Addr2: Facility ID:	06/03/02 Not reported 0202308			

tive:	Sile 2 OF 5 III cluster AIT	
ner	LTANKS:	
	Site ID:	325963
ual:	Spill Date:	06/03/02
ft.	Facility Addr2:	Not reported
	Facility ID:	0202308
	Program Number:	0202308
	SWIS:	6018
	Region of Spill:	3
	Investigator:	jbodee
	Referred To:	Not reported
	Reported to Dept:	06/03/02
	CID:	17
	Spill Cause:	Tank Test Failure
	Water Affected:	Not reported
	Spill Source:	Commercial/Industrial
	Spill Notifier:	Tank Tester
	Cleanup Ceased:	//
	Cleanup Meets Standard:	True
	Last Inspection:	//
	Recommended Penalty:	Penalty Not Recommended
	UST Involvement:	False
	Spill Class:	Possible release with minimal potential for fire or hazard or Known release with
		no damage. DEC Response. Willing Responsible Party. Corrective action taken.
	Spill Closed Dt:	10/07/02
	Remediation Phase:	0
	Date Entered In Computer:	06/03/02
	Spill Record Last Update:	10/07/02
	Spille Namer:	LORIL MANNING
	Spiller Company:	Not reported
	Spiller Phone:	(914) 699-4871
	Spiller Extention:	Not reported
	Spiller Address:	7 JONES PL
	Spiller City,St,Zip:	YONKERS, ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	Program Number:	0202308
	DER Facility ID:	262583
	Site ID:	325963
	Operable Unit ID:	853149
	Operable Unit:	01
	Material ID:	520167
	Material Code:	0001
	Material Name:	#2 Fuel Oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	0.00

Material FA: Quantity:

Units:

0.00

Gallons

EDR ID Number EPA ID Number

Map ID Direction		MAP FINDINGS		
Distance				
Distance (ft	,			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
				6405005000
	APT HOUSE (Continued)			S105995990
	Recovered: Resource Affected:	0.00 Soil		
	Oxygenate:	False		
	Site ID:	325963		
	Spill Tank Test: Tank Number:	1736 1		
	Tank Size:	1000		
	Test Method:	03		
	Leak Rate: Gross Fail:	0.00 F		
	Modified By:	Spills		
	Last Modified:	10/01/04		
	Test Method: DEC Remarks:	Horner EZ Check I or II Start CallerRemark - 0202308 U/G FAILED TEST M	IESSAGE LEFT FOR P	ROPERTY OWNER
		NEXT STEP NOT YET DETERMINED END CallerRe	emark - 0202308	
	Remark:	Start DECRemark - 0202308 Prior to Sept, 2004 data DEC Field was "O'DEE" 10/07/02 TANK PASSED RE		
		DEC FIELD WAS O'DEE TO/07/02 TAINK FASSED RE	TEST. NFA END DECI	Cernark - 0202300
AH179	RESIDENTS		NY LTANKS	S105997935
East	3 JONES PLACE			N/A
1/2-1 3084 ft.	YONKERS, NY			
	Site 3 of 3 in cluster AH			
Relative: Higher	LTANKS:			
•	Site ID:	215896		
Actual: 182 ft.	Spill Date: Facility Addr2:	01/15/03 Not reported		
102 10	Facility ID:	0210461		
	Program Number:	0210461		
	SWIS: Region of Spill:	6018 3		
	Investigator:	jbodee		
	Referred To:	Westchester Cnty Health Dept		
	Reported to Dept: CID:	01/16/03 17		
	Spill Cause:	Tank Overfill		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Private Dwelling Health Department		
	Cleanup Ceased:	/ /		
	Cleanup Meets Standard:			
	Last Inspection: Recommended Penalty:	04/28/04 Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard	d. No DEC Response.	No
	Spill Closed Dt:	corrective action required. 04/28/04		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spille Namer:	05/14/04 Not reported		
	Spiller Company:	SCHILDWATCHER OIL		
	Spiller Phone:	Not reported		
	Spiller Extention: Spiller Address:	Not reported Not reported		
	Spiller City,St,Zip:	ZZ		
	Spiller County:	001		

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

DANIELLE JACKSON (917) 337-2655 Not reported 3 0210461 178754 215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False Not reported
Not reported 3 0210461 178754 215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
3 0210461 178754 215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
0210461 178754 215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
178754 215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
215896 863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
863900 01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
01 513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
513844 0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
0001 #2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
#2 Fuel Oil Not reported Petroleum 15.00 Gallons 0.00 Soil False
Not reported Petroleum 15.00 Gallons 0.00 Soil False
Not reported Petroleum 15.00 Gallons 0.00 Soil False
Petroleum 15.00 Gallons 0.00 Soil False
Gallons 0.00 Soil False
0.00 Soil False
Soil False
False
Not reported
Not reported
Start CallerRemark - 0210461 TANK WAS OVERFILLED POSSIBLY BY OIL COMPANY
HEALTH DEPT IS ON THE SCENE END CallerRemark - 0210461
Start DECRemark - 0210461 Prior to Sept, 2004 data translation this spill Lead
DEC Field was "O'DEE/WCHD-JACKSON" 01/16/03: SPEEDI DRI APPLIED BUT LEFT, NEEDS
TO BE CLEANED UP. OIL ON LAWN AND SIDEWALK, APPEARS TO HAVE SPRAYED OUT OF
VENT. 03/25/03 DANIELLE JACKSON, WCHD INSPECTED. NO CLEANUP WAS EVER
PREFORMED. TENANTS BELIEVE OIL COMPANY IS "SCHILDWACHTER". UNABLE TO CONTACT
LANDLORD. 04/28/04 NO CLEAN UP EVER PERFORMED. OIL DISPERSED. jbo END
DECRemark - 0210461

AF180 NNE 1/2-1 3088 ft.	RESIDENCE 312 WOODWORTH AVE YONKERS, NY			NY LTANKS NY HIST LTANKS	S102232758 N/A
	Site 2 of 3 in cluster AF				
Relative: Higher	LTANKS: Site ID:	257396			
Actual: 66 ft.	Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To:	02/12/96 Not reported 9514471 9514471 6018 3 tdghiosa Not reported			
	Reported to Dept: CID: Spill Cause:	02/12/96 17 Tank Test Failure			

Map ID Direction Distance Distance (ft.) Elevation Site

RESIDENCE (Continued)

Database(s)

EDR ID Number EPA ID Number

LO	IDENCE (Continued)		310
	Water Affected:	Not reported	
	Spill Source:	Private Dwelling	
	Spill Notifier:	Tank Tester	
	Cleanup Ceased:		
	Cleanup Meets Standard:	True	
	Last Inspection:		
	Recommended Penalty:	Penalty Not Recommended	
	UST Involvement:	False	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willi	na
	Spill Class.	Responsible Party. Corrective action taken.	ng
	Spill Closed Dt:	11/07/96	
	Spill Closed Dt: Remediation Phase:	0	
	Date Entered In Computer:	-	
	Spill Record Last Update:	12/16/96	
	Spille Namer:	Not reported	
	Spiller Company:	Not reported	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	Spiller Address:	Not reported	
	Spiller City,St,Zip:	***Update***, ZZ	
	Spiller County:	001	
	Spiller Contact:	CAROL GARCIA	
	Spiller Phone:	(914) 968-7686	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	Program Number:	9514471	
	DER Facility ID:	210755	
	Site ID:	Not reported	
	Operable Unit ID:	Not reported	
	Operable Unit:	Not reported	
	Material ID:	Not reported	
	Material Code:	Not reported	
	Material Name:	Not reported	
	Case No.:	Not reported	
	Material FA:	Not reported	
	Quantity:	Not reported	
	Units:	Not reported	
	Recovered:	Not reported	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
	Site ID:	257396	
	Spill Tank Test:	18975	
	Tank Number:	1	
	Tank Size:	2000	
	Test Method:	14	
	Leak Rate:	0.00	
	Gross Fail:	F	
	Modified By:	Spills	
	Last Modified:	10/01/04	
	Test Method:	VacuTest	
	DEC Remarks:	Not reported	
	Remark:	Start DECRemark - 9514471 Prior to Sept, 2004 data translation this spill Lea	ad
		DEC Field was "GHIOSAY" END DECRemark - 9514471	
н	IST LTANKS:		
	Region of Spill:	3	
	Spill Number:	9514471	

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S102232758

RESIDENCE (Continued)

	0102202100
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	02/12/1996
Spill Time:	15:00
Reported to Department Date:	
Reported to Department Time:	16:08
SWIS:	55
Spiller Contact:	CAROL GARCIA
Spiller Phone:	(914) 968-7686
Spiller Extention:	Not reported
Spiller Name:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling Tank Tester
Spill Notifier:	
PBS Number: Cleanup Ceased:	Not reported
Cleanup Meets Standard:	/ / True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	
Investigation Complete:	
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	11/07/96
Date Region Sent Summary to	Central Office: / /
Corrective Action Plan Submit	ted: / /
Date Spill Entered In Compute	r Data File: 02/12/96
Time Spill Entered In Compute	er Data File: Not reported
Spill Record Last Update:	12/16/96
Is Updated:	False
PBS Number:	Not reported
Tank Number:	1
Tank Size:	2000
Test Method:	Tankology [Vacutect]
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Talk Test Failures only pass or fail
Material Class Type:	Not reported
Quantity Spilled:	Not reported
Unkonwn Quantity Spilled:	Not reported
Units:	Not reported
Quantity Recovered:	Not reported

Map ID		MAP FINDINGS		
Direction	ų_			
Distance Distance (ft	•)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	RESIDENCE (Continued)			S102232758
	Unkonwn Quantity Recove			
	Material: Class Type:	Not reported Not reported		
	Times Material Entry In File			
	CAS Number: Last Date:	Not reported Not reported		
	DEC Remarks: Not repo			
	Spill Cause: Not repo	rted		
AF181			NY LTANKS	S104619297
NNE	312 WOODWORTH AVE		NY HIST LTANKS	N/A
1/2-1	YONKERS, NY			
3088 ft.	Site 3 of 3 in cluster AF			
Relative: Higher	LTANKS:			
Ingrier	Site ID:	257397		
Actual: 66 ft.	Spill Date:	04/05/96		
00 11.	Facility Addr2: Facility ID:	Not reported 9600254		
	Program Number:	9600254		
	SWIS:	6018		
	Region of Spill: Investigator:	3 tdghiosa		
	Referred To:	Not reported		
	Reported to Dept: CID:	04/05/96 17		
	Spill Cause:	Tank Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Institutional, Educational, Gov., Other Other		
	Cleanup Ceased:			
	Cleanup Meets Standard:			
	Last Inspection: Recommended Penalty:	/ / Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazard. I Responsible Party. Corrective action taken.	DEC Response. Willi	ng
	Spill Closed Dt:	11/07/96		
	Remediation Phase:	0		
	Date Entered In Computer: Spill Record Last Update:	04/05/96 12/16/96		
	Spille Namer:	CAROL GARCIA		
	Spiller Company:	GARCIA		
	Spiller Phone: Spiller Extention:	(914) 968-7686 Not reported		
	Spiller Address:	312 WOODWORTH AVE		
	Spiller City,St,Zip: Spiller County:	YONKERS, ZZ 001		
	Spiller Contact:	CAROL GARCIA		
	Spiller Phone:	(914) 968-7686		
	Spiller Extention: DEC Region:	Not reported 3		
	Program Number:	9600254		
	DER Facility ID:	210755		
	Site ID: Operable Unit ID:	257397 1031697		
	Operable Unit:	01		

Database(s)

EDR ID Number EPA ID Number

ontinued)	S104619297
Material ID:	353653
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9600254 2000 gal tank - tank is vaulted - but there is oil
	coming out from under the vault - oil is going across st and into a storm
Devent	sewer END CallerRemark - 9600254
Remark:	Start DECRemark - 9600254 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "GHIOSAY" 04/05/96 LUZON HIRED TO PUMP OUT TANK AND VAULT AND CLEANUP END DECRemark - 9600254
IST LTANKS:	
Region of Spill:	3
Spill Number:	9600254
Spill Number: Investigator:	9600254 GHIOSAY
Investigator:	GHIOSAY
Investigator: Caller Name:	GHIOSAY Not reported
Investigator: Caller Name: Caller Agency:	GHIOSAY Not reported Not reported
Investigator: Caller Name: Caller Agency: Caller Phone:	GHIOSAY Not reported Not reported Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension:	GHIOSAY Not reported Not reported Not reported Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name:	GHIOSAY Not reported Not reported Not reported Not reported Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Time: Reported to Department	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 13:15 tt Date: 04/05/96
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Department	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Department SWIS:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 13:15 tt Date: 04/05/96 tt Time: 13:51 55
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Extention: Spiller Name:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Od/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 At Date: 04/05/96 At Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported Tank Failure
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause: Resource Affectd:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 04/05/1996 13:15 tt Date: 04/05/96 tt Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported Tank Failure On Land
Investigator: Caller Name: Caller Agency: Caller Phone: Caller Extension: Notifier Name: Notifier Agency: Notifier Phone: Notifier Extension: Spill Date: Spill Date: Spill Time: Reported to Departmen SWIS: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Name: Spiller Name: Spiller Address: Spiller City,St,Zip: Facility Contact: Facility Phone: Facility Extention: Spill Cause:	GHIOSAY Not reported Not reported Not reported Not reported Not reported Not reported Not reported O4/05/1996 13:15 At Date: 04/05/96 At Time: 13:51 55 CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported GARCIA 312 WOODWORTH AVE YONKERS CAROL GARCIA (914) 968-7686 Not reported Tank Failure

Map ID Direction Distance Distance (ft.) Elevation Site

(Continued)

Database(s)

EDR ID Number EPA ID Number

· · · · · · · · · · · · · · · · · · ·		
Spill Notifier:	Other	
PBS Number:	Not reported	
Cleanup Ceased:	11	
Cleanup Meets Standard:	True	
Last Inspection:	11	
Recommended Penalty:	Penalty Not Re	commended
Spiller Cleanup Date:	11	
Enforcement Date:	11	
Investigation Complete:	//	
UST Involvement:	False	
Spill Class:	Known release	with minimal potential for fire or hazard. DEC Response. Willing
		arty. Corrective action taken.
Spill Closed Dt:	11/07/96	•
Date Region Sent Summary to	Central Office:	//
Corrective Action Plan Submit	ted:	//
Date Spill Entered In Compute	er Data File:	04/05/96
Time Spill Entered In Compute	er Data File:	Not reported
Spill Record Last Update:	12/16/96	
Is Updated:	False	
PBS Number:	Not reported	
Tank Number:	Not reported	
Tank Size:	Not reported	
Test Method:	Not reported	
Leak Rate Failed Tank:	Not reported	
Gross Leak Rate:	Not reported	
Material Class Type:	Petroleum	
Quantity Spilled:	0	
Unkonwn Quantity Spilled:	True	
Units:	Gallons	
Quantity Recovered:	0	
Unkonwn Quantity Recovered	:False	
Material:	#2 FUEL OIL	
Class Type:	#2 FUEL OIL	
Times Material Entry In File:	24464	
CAS Number:	Not reported	
Last Date:	19941207	
DEC Remarks: 04/05/96 L	UZON HIRED TO	O PUMP OUT TANK AND VAULT AND DO CLEANUP
Spill Cause: 2000 gal ta	nk - tank is vault	ed - but there is oil coming out from under the
vault - oil is	going across st	and into a storm sewer

Al182 SE 1/2-1 3167 ft.	POLICE DEPT. HDQTR.GAF 10 ST.CASAMIT AVE. YONKERS, NY	RAGE	NY LTANKS NY HIST LTANKS	S100140795 N/A
Relative:	Site 1 of 2 in cluster Al			
Higher	LTANKS:			
	Site ID:	157808		
Actual:	Spill Date:	03/08/90		
95 ft.	Facility Addr2:	Not reported		
	Facility ID:	8911573		
	Program Number:	8911573		
	SWIS:	6018		
	Region of Spill:	3		
	Investigator:	WXWADSWO		
	Referred To:	Not reported		
	Reported to Dept:	03/08/90		
	CID:	Not reported		

Database(s)

EDR ID Number EPA ID Number

POLICE DEPT. HDQTR.GARAGE (Continued)

o	
Spill Cause:	Tank Test Failure
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Tank Tester
Cleanup Ceased:	06/18/53
Cleanup Meets Standard:	True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
UST Involvement:	True
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
•	Responsible Party. Corrective action taken.
Spill Closed Dt:	12/16/91
Remediation Phase:	0
Date Entered In Computer:	
Spille Namer:	Not reported
Spiller Company:	SAME
Spiller Phone:	Not reported
Spiller Extention:	Not reported
	Not reported
Spiller Address:	
Spiller City,St,Zip:	NY
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	8911573
DER Facility ID:	133405
Site ID:	157808
Operable Unit ID:	938444
Operable Unit:	01
Material ID:	554602
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	157808
Spill Tank Test:	11407
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 8911573 WILL UNCOVER AND RETEST HORNER EZYCHECK GROSS LEAK END CallerRemark - 8911573
Remark:	Start DECRemark - 8911573 Prior to Sept, 2004 data translation this spill Lead
	DEC Field was "WADSWORTH" 09/27/95: This is additional information about
	material spilled from the translation of the old spill file: TANK
	TEST. END DECRemark - 8911573

Database(s)

EDR ID Number EPA ID Number

S100140795

HIST LTANKS:	
Region of Spill:	3
Spill Number:	8911573
Investigator:	WADSWORTH
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	03/08/1990
Spill Time:	12:45
Reported to Department Date:	03/08/90
Reported to Department Time	
ŚWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
Spiller Name:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	Not reported
Facility Contact:	Not reported
Facility Phone:	Not reported
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Other Non Commercial/Industrial
Spill Notifier:	Tank Tester
PBS Number:	3-493805
Cleanup Ceased:	06/18/53
Cleanup Meets Standard:	True
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	True
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
	Responsible Party. Corrective action taken.
Spill Closed Dt:	12/16/91
Date Region Sent Summary to	Central Office: / /
Corrective Action Plan Submit	ted: / /
Date Spill Entered In Compute	er Data File: 03/09/90
Time Spill Entered In Compute	er Data File: Not reported
Spill Record Last Update:	01/08/92
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	0
Test Method:	Not reported
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0

POLICE DEPT. HDQTR.GARAGE (Continued)

Map ID		MAP FINDINGS		
Direction Distance	۲			
Distance (ft Elevation	i.) Site		Database(s)	EDR ID Number EPA ID Number
	POLICE DEPT. HDQTR.GARAG	GE (Continued)		S100140795
	Unkonwn Quantity Spilled: Units:	False Not reported		
	Quantity Recovered:	0		
	Unkonwn Quantity Recover Material:	red: False GASOLINE		
	Class Type:	GASOLINE		
	Times Material Entry In File CAS Number:	e: 21329 Not reported		
	Last Date:	19940929		
		This is additional information about material spilled from the on of the old spill file: TANK TEST.	;	
	Spill Cause: WILL UN	ICOVER AND RETEST HORNER EZYCHECK GROSS LEAF	<	
AJ183			NY LTANKS	S105999780
NE 1/2-1	149 GLENWOOD AVE YONKERS, NY			N/A
3181 ft.				
Relative:	Site 1 of 2 in cluster AJ			
Higher	LTANKS: Site ID:	177758		
Actual: 289 ft.	Spill Date:	09/03/03		
200 11.	Facility Addr2: Facility ID:	Not reported 0305877		
	Program Number: SWIS:	0305877 6018		
	Region of Spill:	3		
	Investigator: Referred To:	jbodee Not reported		
	Reported to Dept:	09/03/03		
	CID: Spill Cause:	17 Tank Test Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Private Dwelling Tank Tester		
	Cleanup Ceased:	/ /		
	Cleanup Meets Standard: Last Inspection:	False / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement: Spill Class:	False Possible release with minimal potential for fire or hazard or K	(nown release w	ith
	Spill Closed Dt:	no damage. DEC Response. Willing Responsible Party. Com	ective action tak	en.
	Remediation Phase:	1		
	Date Entered In Computer: Spill Record Last Update:	09/03/03 10/17/03		
	Spille Namer:	Not reported		
	Spiller Company: Spiller Phone:	Not reported Not reported		
	Spiller Extention:	Not reported		
	Spiller Address: Spiller City,St,Zip:	Not reported ***Update***, ZZ		
	Spiller County:	001		
	Spiller Contact: Spiller Phone:	MARIE PULEO (914) 837-0739		
	Spiller Extention:	Not reported		
	DEC Region: Program Number:	3 0305877		

Database(s)

EDR ID Number EPA ID Number

	(Continued)		S105999780
		4 40204	
	DER Facility ID: Site ID:	149361 Not reported	
	Operable Unit ID:	Not reported	
	Operable Unit:	Not reported	
	Material ID:	Not reported	
	Material Code:	Not reported	
	Material Name:	Not reported	
	Case No.:	Not reported	
	Material FA:	Not reported	
	Quantity:	Not reported	
	Units:	Not reported	
	Recovered:	Not reported	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
	Site ID:	177758	
	Spill Tank Test:	3203	
	Tank Number:	1	
	Tank Size:	550	
	Test Method:	03	
	Leak Rate:	0.00	
	Gross Fail:	F	
	Modified By:	Spills	
	Last Modified:	10/01/04	
	Test Method:	Horner EZ Check I or II	
	DEC Remarks:	Not reported	
	Remark:	Start DECRemark - 0305877 Prior to Sept, 2004 data translation this spill Lead	
		DEC Field was "O'DEE" END DECRemark - 0305877	
184 NE 1/2-1	COSTA HOME 15 HUDSONVIEW TERRACE YONKERS, NY	NY LTANKS	S106972249 N/A
NE	15 HUDSONVIEW TERRACE YONKERS, NY	NY LTANKS	
NE 1/2-1	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS:		
NE 1/2-1 3193 ft.	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID:	349595	
NE 1/2-1 3193 ft. Relative: Higher	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date:	349595 07/19/05	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2:	349595 07/19/05 Not reported	
NE 1/2-1 3193 ft. Relative: Higher	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID:	349595 07/19/05 Not reported 0504661	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number:	349595 07/19/05 Not reported 0504661 0504661	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS:	349595 07/19/05 Not reported 0504661 0504661 6018	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill:	349595 07/19/05 Not reported 0504661 0504661 6018 3	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill:	349595 07/19/05 Not reported 0504661 0504661 6018 3	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause:	349595 07/19/05 Not reported 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier:	349595 07/19/05 Not reported 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other / /	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other / / True	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other / / True / /	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other / / True / / Penalty Not Recommended	
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other / / True / / Penalty Not Recommended False	N/A
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other // True // Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing	N/A
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other // True // Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	N/A
NE 1/2-1 3193 ft. Relative: Higher Actual:	15 HUDSONVIEW TERRACE YONKERS, NY LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement:	349595 07/19/05 Not reported 0504661 0504661 6018 3 JBODee WCDOH 07/19/05 17 Tank Failure Not reported Private Dwelling Other // True // Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing	N/A

Map ID Direction Distance Distance (ft.) Elevation Site

Database(s)

EDR ID Number **EPA ID Number**

S106972249

COSTA HOME (Continued)

Date Entered In Computer: 07/20/05

Spill Record Last Update: 09/13/05 Spille Namer: COSTA HOME Spiller Company: COSTA HOME Spiller Phone: (914) 968-5422 Spiller Extention: Not reported Spiller Address: 15 HUDSONVIEW TERRACE Spiller City,St,Zip: YONKERS, NY Spiller County: 001 Spiller Contact: COSTA HOME Spiller Phone: (914) 968-5422 Spiller Extention: Not reported DEC Region: 3 Program Number: 0504661 DER Facility ID: 296030 Site ID: 349595 **Operable Unit ID:** 1107184 **Operable Unit:** 01 Material ID: 2097079 Material Code: 0001 Material Name: #2 Fuel Oil Case No .: Not reported Material FA: Petroleum Quantity: 0.00 Gallons Recovered: 0.00 Groundwater **Resource Affected:** Oxygenate: False Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported Start CallerRemark - 0504661 HOLES IN TANK AND SMALL CONTAMINATION END **DEC Remarks:** CallerRemark - 0504661 Remark: Start DECRemark - 0504661 9/13/05: Letter to Steven Costa from S. Goreau, Office of Environ. Health Risk Control. Site closure report reviewed. Results satisfactory. No Further Action required. END DECRemark - 0504661

Units:

AK185 **REAL ESATE TRANSACTION** NNE **59 GLENWOOD AVE** 1/2-1 YONKERS, NY 3235 ft. Site 1 of 3 in cluster AK **Relative:** LTANKS: Higher 362460 Site ID: Actual: Spill Date: 04/12/06 113 ft. Facility Addr2: Not reported Facility ID: 0600466 0600466 Program Number: SWIS: 6018

Region of Spill:

3

NY LTANKS S107789155 N/A

Database(s)

EDR ID Number EPA ID Number

REAL ESATE TRANSACTION (Continued)

Investigator: JBODee Not reported Referred To: Reported to Dept: 04/12/06 CID: 17 Spill Cause: Tank Test Failure Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Tank Tester Cleanup Ceased: 11 Cleanup Meets Standard: False Last Inspection: 11 **Recommended Penalty:** Penalty Not Recommended UST Involvement: False Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 11 Remediation Phase: 1 Date Entered In Computer: 04/12/06 Spill Record Last Update: 04/13/06 Spille Namer: **BROKER-PAUL TARROATS** Spiller Company: REAL ESATE TRANSACTION Spiller Phone: (914) 882-1503 Spiller Extention: Not reported Spiller Address: 59 GLENWOOD AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: **BROKER-PAUL TARROATS** Spiller Phone: (914) 882-1503 Spiller Extention: Not reported DEC Region: 3 Program Number: 0600466 DER Facility ID: 312722 Site ID: 362460 Operable Unit ID: 1120570 Operable Unit: 01 Material ID: 2110057 Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0.00 Gallons Units: Recovered: 0.00 **Resource Affected:** Soil Oxygenate: False Site ID: 362460 Spill Tank Test: 1488955 Tank Number: 1 550 Tank Size: Test Method: 03 Leak Rate: 0.00 Gross Fail: 0 Modified By: Watchdog Last Modified: 04/12/06 Test Method: Horner EZ Check I or II DEC Remarks: Start CallerRemark - 0600466 repair and retest or remove END CallerRemark -0600466

Material FA:

Quantity: Units: Petroleum 40.00

Gallons

MAP FINDINGS

EDR ID Number Database(s) **EPA ID Number REAL ESATE TRANSACTION (Continued)** S107789155 Remark: Not reported NY LTANKS S107789199 AK186 **RASO HOME** NNE **379 WARBURTON AVE** N/A 1/2-1 YONKERS, NY 3269 ft. Site 2 of 3 in cluster AK Relative: LTANKS: Higher Site ID: 362796 Spill Date: Actual: 04/19/06 102 ft. Facility Addr2: Not reported Facility ID: 0600724 Program Number: 0600724 SWIS: 6018 Region of Spill: 3 Investigator: JBODee Referred To: WCDOH Reported to Dept: 04/19/06 CID: 17 Spill Cause: Tank Overfill Water Affected: Not reported Spill Source: Non Major Facility > 1,100 gal Spill Notifier: Other Cleanup Ceased: 11 Cleanup Meets Standard: True Last Inspection: 11 Recommended Penalty: Penalty Not Recommended UST Involvement: False Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Spill Closed Dt: 06/16/06 Remediation Phase: 0 Date Entered In Computer: 04/19/06 Spill Record Last Update: 06/16/06 Spille Namer: NAT RASO Spiller Company: RASO HOME Spiller Phone: (914) 993-0001 Spiller Extention: Not reported Spiller Address: 379 WARBURTON AVE Spiller City, St, Zip: YONKERS, NY Spiller County: 001 Spiller Contact: NAT RASO Spiller Phone: (914) 993-0001 Spiller Extention: Not reported DEC Region: 3 0600724 Program Number: DER Facility ID: 313023 Site ID: 362796 **Operable Unit ID:** 1120874 Operable Unit: 01 Material ID: 2110356 Material Code: 0001 Material Name: #2 Fuel Oil Case No .: Not reported

Database(s)

EDR ID Number EPA ID Number

	RASO HOME (Continued)	S107789199
	RASO HOME (Continued) Recovered: Resource Affected: Oxygenate: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method: DEC Remarks:	0.00 Soil False Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Start CallerRemark - 0600724 CUSTOMER ORDER 1000 GALLON OF OIL AND AFTER PUMPING 800 GALLONS LEAKED OUT: SPILL CREW ON SCENE AND CLEANI9NG UP END CallerRemark - 0600724 04/25/06: 3500 gal UST - driver pumped 840 when fuel
		came out vent pipe onto sidewalk. Robinson doing clean up. 04/26/06 PBS facility. Westchester County Health Dept responded. jod END DECRemark - 0600724
Al187 SE 1/2-1 3290 ft.	MOBIL 60 ELM ST. YONKERS, NY	NY LTANKS S100964699 NY HIST LTANKS N/A
	Site 2 of 2 in cluster Al	
Relative: Higher	LTANKS:	93072
Actual: 108 ft.	Site ID: Spill Date: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Class: Spill Class: Spill Class: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company: Spiller Phone: Spiller Phone:	12/02/87 Not reported 8707521 6018 3 jeokesso Not reported 12/02/87 17 Tank Test Failure Not reported Gasoline Station Tank Tester 02/11/88 Penalty Not Recommended True Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. 02/11/88 0

Not reported Not reported

Spiller Extention: Spiller Address:

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

MOBIL (Continued)	S100964699
Coillor City Ct Zio	
Spiller City,St,Zip:	RICHARD CHICOTELLI, ZZ 001
Spiller County:	
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
Program Number: DER Facility ID:	8707521
Site ID:	83463 93072
Operable Unit ID:	93072 911839
	01
Operable Unit: Material ID:	466465
Material Code:	0009
Material Name:	Gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	0.00
Units:	Not reported
Recovered:	0.00
Resource Affected:	Groundwater
Oxygenate:	False
Site ID:	93072
Spill Tank Test:	7066
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	0.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	10/01/04
Test Method:	Unknown
DEC Remarks:	Start CallerRemark - 8707521 2-3K'S & 2K SYSTEM1.09 GPH . TO POSSIBLY REMOVE PRODUCT & INVESTYIGATE. END CallerRemark - 8707521
Remark:	Start DECRemark - 8707521 Prior to Sept, 2004 data translation this spill Lead DEC Field was "OKESSON" // : 2-11-88 NOT IN SERVICE, BUT REPAIRED & PASSED RET. TITE. L.R. // : 2-11-88 NOT IN SERVICE, BUT REPAIRED & PASSED RET. TITE. N.F.A. L.R. END DECRemark - 8707521
HIST LTANKS:	
Region of Spill:	3
Spill Number:	8707521
Investigator:	OKESSON
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	12/02/1987
Spill Time:	14:45
Reported to Department Da	
Reported to Department Tir SWIS:	55
Spiller Contact:	Not reported
Spiller Phone:	Not reported

MOBIL (Continued)

Database(s)

EDR ID Number EPA ID Number

S100964699

	01000
Spiller Extention:	Not reported
Spiller Name:	SAME
Spiller Address:	Not reported
Spiller City, St, Zip:	RICHARD CHICOTELLI
Facility Contact:	Not reported
Facility Phone:	(914) 668-3793
Facility Extention:	Not reported
Spill Cause:	Tank Test Failure
Resource Affectd:	Groundwater
Water Affected:	Not reported
Spill Source:	Gas Station
Spill Notifier:	Tank Tester
PBS Number:	Not reported
Cleanup Ceased:	02/11/88
Cleanup Meets Standard:	True
Last Inspection:	02/11/88
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	11
Enforcement Date:	//
Investigation Complete:	//
UST Involvement:	True
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with
	no damage. DEC Response. Willing Responsible Party. Corrective action taken.
Spill Closed Dt:	02/11/88
Date Region Sent Summary t	o Central Office: / /
Corrective Action Plan Submi	tted: / /
Date Spill Entered In Compute	er Data File: 12/03/87
Time Spill Entered In Comput	er Data File: Not reported
Spill Record Last Update:	07/26/90
Is Updated:	False
PBS Number:	Not reported
Tank Number:	Not reported
Tank Size:	0
Test Method:	Not reported
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	0
Unkonwn Quantity Spilled:	False
Units:	Not reported
Quantity Recovered:	0
Unkonwn Quantity Recovered	
Material:	GASOLINE
Class Type:	GASOLINE
Times Material Entry In File:	21329
CAS Number:	Not reported
Last Date:	19940929
	8 NOT IN SERVICE, BUT REPAIRED PASSED RET. TITE. L.R. / / :
	T IN SERVICE, BUT REPAIRED PASSED RET. TITE. N.F.A. L.R.
Spill Cause: 2-3K S 2K	SYSTEM1.09 GPH . TO POSSIBLY REMOVE PRODUCT INVESTYIGATE.

Database(s)

EDR ID Number EPA ID Number

AJ188 NE 1/2-1	168 GLENWOOD AVE YONKERS, NY	NY LTANKS S105999018 N/A	
3291 ft.	Site 2 of 2 in cluster A I		
Relative:			
NE 1/2-1 3291 ft.	168 GLENWOOD AVE YONKERS, NY Site 2 of 2 in cluster AJ LTANKS: Site ID: Spill Date: Facility Addr2: Facility Addr2: Facility ID: Program Number: SWIS: Region of Spill: Investigator: Referred To: Reported to Dept: CID: Spill Cause: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Standard: Last Inspection: Recommended Penalty: UST Involvement: Spill Closed Dt: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spille Namer: Spiller Company: Spiller Company: Spiller Phone: Spiller County: Spiller Extention: </th <th>N/A 220547 05/21/03 Not reported 0301861 0301861 0301861 6018 3 jbodee Not reported 05/21/03 17 Tank Failure Not reported Private Dwelling Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 05/14/04 0 05/21/03</th> <th></th>	N/A 220547 05/21/03 Not reported 0301861 0301861 0301861 6018 3 jbodee Not reported 05/21/03 17 Tank Failure Not reported Private Dwelling Tank Tester / / False / / Penalty Not Recommended False Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 05/14/04 0 05/21/03	
	Material ID:	506346 0001	
	Material Code: Material Name:	#2 Fuel Oil	
	Case No.: Material FA: Quantity:	Not reported Petroleum 0.00	
	Units: Recovered: Resource Affected: Oxygenate:	Gallons 0.00 Soil False	

Map ID		MAP FINDINGS		
Direction	L			
Distance Distance (ft.	.)			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	(Continued)			S105999018
	Site ID:	Not reported		3103999018
	Spill Tank Test:	Not reported		
	Tank Number:	Not reported		
	Tank Size: Test Method:	Not reported Not reported		
	Leak Rate:	Not reported		
	Gross Fail: Modified By:	Not reported Not reported		
	Last Modified:	Not reported		
	Test Method:	Not reported		
	DEC Remarks:	Start CallerRemark - 0301861 several chemicals over CallerRemark - 0301861	nys guidelines END	
	Remark:	Start DECRemark - 0301861 Prior to Sept, 2004 data		
		DEC Field was "O'DEE" Tank removed by Northeast E DECRemark - 0301861	Environmental. TG EN	1D
AK189	383 WARBURTON AV			U003648451
NNE 1/2-1	383 WARBURTON AVE YONKERS, NY		NY HIST LTANKS	N/A
3298 ft.				
Relative:	Site 3 of 3 in cluster AK			
Higher	LTANKS: Site ID:	171716		
Actual:	Spill Date:	10/06/98		
102 ft.	Facility Addr2: Facility ID:	Not reported		
	Program Number:	9808442 9808442		
	SWIS:	6018		
	Region of Spill: Investigator:	3 tdghiosa		
	Referred To:	Not reported		
	Reported to Dept:	10/08/98 17		
	CID: Spill Cause:	Tank Failure		
	Water Affected:	Not reported		
	Spill Source: Spill Notifier:	Private Dwelling Responsible Party		
	Cleanup Ceased:	11		
	Cleanup Meets Standard: Last Inspection:	False / /		
	Recommended Penalty:	Penalty Not Recommended		
	UST Involvement:	False		
	Spill Class:	Known release with minimal potential for fire or hazarc Responsible Party. Corrective action taken.	a. DEC Response. Willi	ng
	Spill Closed Dt:	//		
	Remediation Phase: Date Entered In Computer:	1		
	Spill Record Last Update:			
	Spille Namer:	KENNETH NILSEN		
	Spiller Company: Spiller Phone:	383 WARBURTON AV (914) 738-4331		
	Spiller Extention:	Not reported		
	Spiller Address:	383 WARBURTON AVE		
	Spiller City,St,Zip: Spiller County:	YONKERS, NY 001		
	Spiller Contact:	KENNETH NILSEN		
	Spiller Phone:	(914) 738-4331		

Database(s)

EDR ID Number EPA ID Number

83 WARBURTON AV (Cont	tinued) U003648451
Spiller Extention:	Not reported
DEC Region:	3
Program Number:	9808442
DER Facility ID:	144517
Site ID:	171716
Operable Unit ID:	1065847
Operable Unit:	01
Material ID:	315952
Material Code:	0001
Material Name:	#2 Fuel Oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	Gallons
Recovered:	0.00
Resource Affected:	Soil
Oxygenate:	False
Site ID:	Not reported
Spill Tank Test:	Not reported
Tank Number:	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate:	Not reported
Gross Fail:	Not reported
Modified By:	Not reported
Last Modified:	Not reported
Test Method:	Not reported
DEC Remarks:	Start CallerRemark - 9808442 CALLER PULLED OLD 550 GAL U/G TANK AND FOUND
-	CONTAMINATION. END CallerRemark - 9808442
Remark:	Start DECRemark - 9808442 Prior to Sept, 2004 data translation this spill Lead DEC Field was "GHIOSAY" END DECRemark - 9808442
HIST LTANKS:	
Region of Spill:	3
Spill Number:	9808442
Investigator:	GHIOSAY
Caller Name:	Not reported
Caller Agency:	Not reported
Caller Phone:	Not reported
Caller Extension:	Not reported
Notifier Name:	Not reported
Notifier Agency:	Not reported
Notifier Phone:	Not reported
Notifier Extension:	Not reported
Spill Date:	10/06/1998
Spill Time:	12:00
Reported to Department	
Reported to Department	
SWIS:	55
Spiller Contact:	KENNETH NILSEN
Spiller Phone:	(914) 738-4331
Spiller Extention:	Not reported
Spiller Name:	383 WARBURTON AV
Spiller Address:	383 WARBURTON AVE
Spiller City,St,Zip:	YONKERS, NY KENNETH NILSEN
Facility Contact: Facility Phone:	(914) 738-4331
Facility FIIOHE.	(314) / 30-4331

383

383 WARBURTON AV (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U003648451

Facility Extention:	Not reported
,	Tank Failure
Spill Cause:	
Resource Affectd:	On Land
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Responsible Party
PBS Number:	Not reported
Cleanup Ceased:	
Cleanup Meets Standard:	False
Last Inspection:	//
Recommended Penalty:	Penalty Not Recommended
Spiller Cleanup Date:	//
Enforcement Date:	11
Investigation Complete:	11
UST Involvement:	False
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing
•	Responsible Party. Corrective action taken.
Spill Closed Dt:	//
Date Region Sent Summary to	
Corrective Action Plan Submit	
Date Spill Entered In Compute	
Time Spill Entered In Compute	
Spill Record Last Update:	10/21/98
Is Updated:	False
PBS Number:	Not reported
Tank Number:	•
	Not reported
Tank Size:	Not reported
Test Method:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported
Material Class Type:	Petroleum
Quantity Spilled:	50
Unkonwn Quantity Spilled:	False
Units:	Gallons
Quantity Recovered:	0
Unkonwn Quantity Recovered	l: False
Material:	#2 FUEL OIL
Class Type:	#2 FUEL OIL
Times Material Entry In File:	24464
CAS Number:	Not reported
Last Date:	19941207
DEC Remarks: Not reporte	
	ULLED OLD 550 GAL U/G TANK AND FOUND CONTAMINATION.
•	

190CON EDISON - NEPPERHAN AVE WORKS-YORK MGPENE7-11 MOQUETTE ROW NORTH1/2-1YONKERS, NY 10701

Manufactured Gas Plants 1008408074 N/A

4597 ft. Relative: Higher

Higher

Actual: 153 ft.

Database(s)

EDR ID Number EPA ID Number

191 WNW 1/2-1 5176 ft.	ALPINE BOAT BASIN & MAINT.YAR PALISADE INTERSTATE PARK ALPINE BORO, NJ 07620	D	NJ SHWS NJ UST	U000371101 N/A
517611.				
Relative: Lower	SHWS: Case Status:	Active		
201101	Status Date:	1994-08-16 00:00:00		
Actual:	Case ID:	020117		
0 ft.	Contact:	BSCM		
	Sub Section Label:	A: Sites with On-Site Sources of Contamination		
	Site Municipality:	0202		
	Remedial Level Code:	C2		
	Classification exception area dt:	Ongoing		
	Classification exception area dt:	9/30/2002		
	Deed Notice Status:	None		
	Deed Notice Date:	Not reported		
	Engineering Control Status:	None		
	Engineering Control Date:	Not reported		
	National Priorities List Status:	Not reported		
	National Priorities List Date:	Not reported		
	X Coordinate:	652656		
	Y Coordinate:	770055		
	Coordinate System:	NJ State Plane (NAD83) - USFEET		
	UST:			
	Facility ID:	020117		
	Tank Id:	TANK-1		
	Tank Number:	E1		
	Tank Contents:	Leaded Gasoline		
	Install Date:	1/1/1944		
	Tank Compliance:	No		
	Tank Status:	Abandoned in Place		
	Overfill:	No		
	Tank Status Date:	3/1/1994		
	Compliance Monitoring?:	No		
	Overfill Protection:	No		
	Spill Containment:	No		
	Tank Wellhead Protection:	Not reported		
	Owner Name:	Not Identified Not Identified		
	Organization:	Not Identified		
	Contact Type(UST Reg):	Facility Operator		
	Contact Address (UST Reg):	Not reported		
	Contact Address 2 (UST Reg):	Not reported		
	Conact City,St,Zip (UST Reg): Owner Name:	Not reported RICHARD OLSEN		
	Organization:	PALISADES INTERSTATE PARK COMMISSION		
	Contact Type(UST Reg):	Tank Owner		
	Contact Address (UST Reg):	PO BOX 155		
	Contact Address 2 (UST Reg):	Not reported		
	Conact City,St,Zip (UST Reg):	Alpine, NJ 07620		
	Monitor Tank ID:	TANK-1		
	Monitor Tank Number:	E1		
	Monitor Tank / Pipe:	Pipe		
	Monitor Type:	None		
	Monitor Tank ID:	TANK-1		
	Monitor Tank Number:	E1		
	Monitor Tank / Pipe:	Tank		
	Monitor Type:	None		

Map ID Direction Distance Distance (ft.) Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Tankpipe Tank ID: TANK-1 Tankpipe Tank Number: E1 Tankpipe Tank / Pipe: Pipe Tankpipe Construction Type: Bare steel Tankpipe Tank ID: TANK-1 Tankpipe Tank Number: E1 Tankpipe Tank / Pipe: Tank Tankpipe Construction Type: Bare steel Facility ID: 020117 Tank Id: TANK-2 Tank Number: E2 Leaded Gasoline Tank Contents: Install Date: 1/1/1944 Tank Compliance: No Tank Status: Abandoned in Place Overfill: No 3/1/1994 Tank Status Date: Compliance Monitoring?: No **Overfill Protection:** No Spill Containment: No Tank Wellhead Protection: Not reported Owner Name: Not Identified Not Identified Organization: Not Identified Contact Type(UST Reg): **Facility Operator** Contact Address (UST Reg): Not reported Contact Address 2 (UST Reg): Not reported Conact City, St, Zip (UST Reg): Not reported **Owner Name:** RICHARD OLSEN Organization: PALISADES INTERSTATE PARK COMMISSION Contact Type(UST Reg): Tank Owner Contact Address (UST Reg): **PO BOX 155** Contact Address 2 (UST Reg): Not reported Conact City, St, Zip (UST Reg): Alpine, NJ 07620 Monitor Tank ID: TANK-2 Monitor Tank Number: E2 Monitor Tank / Pipe: Pipe Monitor Type: None Monitor Tank ID: TANK-2 Monitor Tank Number: E2 Monitor Tank / Pipe: Tank Monitor Type: None TANK-2 Tankpipe Tank ID: Tankpipe Tank Number: E2 Tankpipe Tank / Pipe: Pipe Tankpipe Construction Type: Bare steel Tankpipe Tank ID: TANK-2 Tankpipe Tank Number: E2 Tankpipe Tank / Pipe: Tank Tankpipe Construction Type: Bare steel Facility ID: 020117 TANK-3 Tank Id: Tank Number: E3 Tank Contents: Medium Diesel Fuel (No. 2-D) Install Date: 1/1/1966 Tank Compliance: No

ALPINE BOAT BASIN & MAINT.YARD (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

U000371101

Tank Status: Abandoned in Place Overfill: No 2/1/1993 Tank Status Date: Compliance Monitoring?: No **Overfill Protection:** No Spill Containment: No Tank Wellhead Protection: Not reported Not Identified Not Identified Owner Name: Not Identified Organization: Contact Type(UST Reg): **Facility Operator** Contact Address (UST Reg): Not reported Contact Address 2 (UST Reg): Not reported Conact City, St, Zip (UST Reg): Not reported Owner Name: RICHARD OLSEN Organization: PALISADES INTERSTATE PARK COMMISSION Contact Type(UST Reg): Tank Owner Contact Address (UST Reg): **PO BOX 155** Contact Address 2 (UST Reg): Not reported Conact City, St, Zip (UST Reg): Alpine, NJ 07620 Monitor Tank ID: TANK-3 Monitor Tank Number: E3 Monitor Tank / Pipe: Pipe Monitor Type: None Monitor Tank ID: TANK-3 Monitor Tank Number: E3 Monitor Tank / Pipe: Tank Monitor Type: None Tankpipe Tank ID: TANK-3 Tankpipe Tank Number: E3 Tankpipe Tank / Pipe: Pipe Tankpipe Construction Type: Bare steel Tankpipe Tank ID: TANK-3 Tankpipe Tank Number: E3 Tankpipe Tank / Pipe: Tank Tankpipe Construction Type: Bare steel Facility ID: 020117 Tank Id: TANK-4 Tank Number: P1 Leaded Gasoline Tank Contents: Install Date: 1/1/1966 Tank Compliance: No Tank Status: Abandoned in Place Overfill: No 2/1/1993 Tank Status Date: Compliance Monitoring?: No **Overfill Protection:** No Spill Containment: No Tank Wellhead Protection: Not reported Owner Name: Not Identified Not Identified Organization: Not Identified Contact Type(UST Reg): Facility Operator Contact Address (UST Reg): Not reported Contact Address 2 (UST Reg): Not reported Conact City, St, Zip (UST Reg): Not reported Owner Name: RICHARD OLSEN Organization: PALISADES INTERSTATE PARK COMMISSION

Map ID Direction	MAP FINDINGS	
Distance		
Distance (ft.)		
Elevation Site		Database(s)
ALPINE BOAT BASIN & MAIN	NT.YARD (Continued)	
Contact Type(UST Reg):	Tank Owner	
Contact Address (UST Re	eg): PO BOX 155	
Contact Address 2 (UST	Reg): Not reported	
Conact City,St,Zip (UST F	Reg): Alpine, NJ 07620	

TANK-4

P1

P1

P1

P1

Tank

Pipe

Tank

None

TANK-4

Bare steel TANK-4

Bare steel

Pipe

None

TANK-4

192 CON EDISON - LUDLOW ST WORKS-YONKERS MGP **KNOWLES STREET** South YONKERS, NY 10705 > 1 5728 ft.

Monitor Tank ID: Monitor Tank Number:

Monitor Type:

Monitor Type:

Monitor Tank ID:

Monitor Tank / Pipe:

Monitor Tank Number:

Tankpipe Tank Number:

Tankpipe Construction Type:

Tankpipe Construction Type:

Tankpipe Tank / Pipe:

Tankpipe Tank / Pipe:

Monitor Tank / Pipe:

Tankpipe Tank ID:

Tankpipe Tank ID: Tankpipe Tank Number:

Relative: Higher

Actual: 13 ft.

TC1784877.2s Page 407

Manufactured Gas Plants 1008408073 N/A

EDR ID Number

EPA ID Number

MAP FINDINGS

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
ALPINE BORO	S107495227	ALPINE TEXACO SERVICE STATION INC	962 CLOSTER DOCK RD / CHURCH ST	07620	NJ SHWS
PLEASANTVILLE	1007371379	NYCDEP PLEASANTVILLE ALUM PLANT	RTE 141 & CHURCH RD SEC 553401	10701	RCRA-SQG, NY MANIFEST
YONKERS	1007944256	MYSTIC TRANSPORT	RTE 100 / 87		CT MANIFEST
YONKERS	S104647933		13 TO 15 MULBERRY SR		NY Spills, NY Hist Spills
YONKERS	S106719435	YONKERS TRANSFER STATION	RT 187 N, EXIT 6A		NY Spills
YONKERS	S106008898	STEW LEONARD DR	RT 87 EXIT 6A		NY Spills
YONKERS	1009284958	PATCLIN CHEMICAL COMPANY INCORPORATED	66 ALEXANDER ST.	10701	ICIS
YONKERS	1007207183	MH7755	ALEXANDER AVENUE AND ASHBURTON	10701	RCRA-SQG, NY MANIFEST
YONKERS	1008892081	YONKERS ALEXANDER ST REDEV INC	79-91 ALEXANDER ST	10701	RCRA-SQG, NY MANIFEST
YONKERS	1009249862	ALTMAN STAGE LIGHTING CO	57 ALEXANDER ST	10701	ICIS
YONKERS	1009264374	EXCELSIOR TRANSPARENT BAG MFG	159 ALEXANDER ST	10701	ICIS
YONKERS	A100276885	SUPERTRANS NY, INC.	60 ALEXANDER STREET	10701	NY AST
YONKERS	U003884956	POLYCHROME	ALEXANDER STREET	10701	NY UST
YONKERS	U003994968	SUPERTRANS NY, INC.	60 ALEXANDER STREET	10701	NY UST
YONKERS	S103573454	VAULT 9915	ALEXANDER ST/ASH BURTON		NY Spills, NY Hist Spills
YONKERS	S107407145	ATI TERMINAL	ALEXANDER STREET		NY Spills
YONKERS	1009240739	CONSOLIDATED EDISON	15 ALEXANDER PL		NY MANIFEST
YONKERS	S106719423	MANHOLE #1024	ALEXANDER AVE/WELLS AVE		NY Spills
YONKERS	S102155077	NEXT TO ATI TERMINAL	ALEXANDER STREET		NY Spills, NY Hist Spills
YONKERS	1007442627	110 ALEXANDER STREET, BLOCK/LOTS: 2618/2	110 ALEXANDER STREET		US BROWNFIELDS
YONKERS	1007442632	ATI	79,85,91,97 ALEXANDER STREET		US BROWNFIELDS
YONKERS	1007442638	EXCELSIOR BAG CORP.	159, 161 ALEXANDER STREET, BLOCK/LOTS:2615/18		US BROWNFIELDS
YONKERS	S106004015	VAULT 9915	ALEXANDER ST/ASHBURTON AVE		NY Spills
YONKERS	S106383897	CON ED MANHOLE#1023	ALEXANDER/WELL AVE		NY Spills
YONKERS	1009242962	CONSOLIDATED EDISON	ASHBURTON / WARBURTON MH567	10701	NY MANIFEST
YONKERS	S107610161	CONSOLIDATED EDISON CO OF NY	ASHBURTON / WARBURTON	10701	NJ MANIFEST
YONKERS	S104790093		ASHBURTON AVE/PALISADES A		NY Spills, NY Hist Spills
YONKERS	S107408053	NEPERHAN AT	ASHBURTON		NY Spills
YONKERS	S106007463		ASHBURTON AV / SAW MILL R		NY Spills
YONKERS	S106008220	SAWMILL RIVER ROAD AT	ASHBURTON AVENUE		NY Spills
YONKERS	S108057314	POLE # W1	ASHBURTON ST / ALEXANDE		NY Spills
YONKERS	S104879866	SAW MILL RIVER RD AND	ASHBURTON AVE		NY Spills, NY Hist Spills
YONKERS	1007882384	LIBERTY LINES	17 BABCOCK PLACE, BLOCK/LOTS: 2620/50		US BROWNFIELDS
YONKERS	S104881112	WOOD WORTH AVE AND	BABCOCK		NY Spills, NY Hist Spills
YONKERS	S105265341	A.R.J.R. TRUCKING	PO BOX 1076		NY SWF/LF
YONKERS	S103573754	MANHOLE 367- NW CORNER	OF DOCK ST / WOODWORTH AV		NY Spills, NY Hist Spills
YONKERS	1009243491	CONSOLIDATED EDISON	MH7755-ALEXANDER / ASHBURTON		NY MANIFEST
YONKERS	S106017659		PALISADES AV/ASHBURTON AV		NY Spills
YONKERS	S104541620	BICC CABLES	1 POINT STREET	10701	NY SHWS, NY VCP, NY Spills
YONKERS	S106697931	CON ED VEHICLE # 901803	WASHINGTON/RT 9 A		NY Spills

EPA Waste Codes Addendum

Code Description

D001 IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

EPA Region 6

EPA Region 7

EPA Region 8

EPA Region 9

Telephone: 214-655-6659

Telephone: 913-551-7247

Telephone: 303-312-6774

Telephone: 415-947-4246

FEDERAL RECORDS

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 07/05/2006 Date Data Arrived at EDR: 08/02/2006 Date Made Active in Reports: 09/12/2006 Number of Days to Update: 41 Source: EPA Telephone: N/A Last EDR Contact: 11/01/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC) Telephone: 202-564-7333

EPA Region 1 Telephone 617-918-1143

EPA Region 3 Telephone 215-814-5418

EPA Region 4 Telephone 404-562-8033

EPA Region 5 Telephone 312-886-6686

EPA Region 10 Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

Date of Government Version: 07/05/2006 Date Data Arrived at EDR: 08/02/2006 Date Made Active in Reports: 09/12/2006 Number of Days to Update: 41 Source: EPA Telephone: N/A Last EDR Contact: 11/01/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: Quarterly

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 07/05/2006 Date Data Arrived at EDR: 08/02/2006 Date Made Active in Reports: 09/12/2006 Number of Days to Update: 41 Source: EPA Telephone: N/A Last EDR Contact: 11/01/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: Quarterly

NPL RECOVERY: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 08/21/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: No Update Planned

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 06/19/2006 Date Data Arrived at EDR: 06/22/2006 Date Made Active in Reports: 08/23/2006 Number of Days to Update: 62 Source: EPA Telephone: 703-603-8960 Last EDR Contact: 09/21/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Quarterly

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 07/17/2006 Date Data Arrived at EDR: 08/02/2006 Date Made Active in Reports: 09/12/2006 Number of Days to Update: 41 Source: EPA Telephone: 703-603-8960 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Quarterly

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/15/2006 Date Data Arrived at EDR: 03/17/2006 Date Made Active in Reports: 04/13/2006 Number of Days to Update: 27 Source: EPA Telephone: 800-424-9346 Last EDR Contact: 09/05/2006 Next Scheduled EDR Contact: 12/04/2006 Data Release Frequency: Quarterly

RCRA: Resource Conservation and Recovery Act Information

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator off-site to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/13/2006 Date Data Arrived at EDR: 06/28/2006 Date Made Active in Reports: 08/23/2006 Number of Days to Update: 56 Source: EPA Telephone: 800-424-9346 Last EDR Contact: 09/28/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Quarterly

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Source: National Response Center, United States Coast Guard
Telephone: 202-260-2342
Last EDR Contact: 10/24/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Annually

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 07/03/2006 Date Data Arrived at EDR: 07/19/2006 Date Made Active in Reports: 08/23/2006 Number of Days to Update: 35 Source: U.S. Department of Transportation Telephone: 202-366-4555 Last EDR Contact: 10/18/2006 Next Scheduled EDR Contact: 01/15/2007 Data Release Frequency: Annually

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 03/21/2006 Date Data Arrived at EDR: 03/27/2006 Date Made Active in Reports: 05/22/2006 Number of Days to Update: 56

Source: Environmental Protection Agency Telephone: 703-603-8905 Last EDR Contact: 09/07/2006 Next Scheduled EDR Contact: 10/02/2006 Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 03/21/2006 Date Data Arrived at EDR: 03/27/2006 Date Made Active in Reports: 05/22/2006 Number of Days to Update: 56 Source: Environmental Protection Agency Telephone: 703-603-8905 Last EDR Contact: 09/07/2006 Next Scheduled EDR Contact: 10/02/2006 Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2004 Date Data Arrived at EDR: 02/08/2005 Date Made Active in Reports: 08/04/2005 Number of Days to Update: 177	Source: USGS Telephone: 703-692-8801 Last EDR Contact: 08/11/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: Semi-Annually
FUDS: Formerly Used Defense Sites	

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/05/2005	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 01/19/2006	Telephone: 202-528-4285
Date Made Active in Reports: 02/21/2006	Last EDR Contact: 09/18/2006
Number of Days to Update: 33	Next Scheduled EDR Contact: 01/01/2007
	Data Release Frequency: Varies

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 07/10/2006 Date Data Arrived at EDR: 07/13/2006 Date Made Active in Reports: 09/06/2006 Number of Days to Update: 55 Source: Environmental Protection Agency Telephone: 202-566-2777 Last EDR Contact: 09/11/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Semi-Annually

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/14/2004 Date Data Arrived at EDR: 02/15/2005 Date Made Active in Reports: 04/25/2005 Number of Days to Update: 69 Source: Department of Justice, Consent Decree Library Telephone: Varies Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 07/10/2006	Sourc
Date Data Arrived at EDR: 07/21/2006	Telep
Date Made Active in Reports: 09/06/2006	Last E
Number of Days to Update: 47	Next S

Source: EPA Telephone: 703-416-0223 Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Number of Days to Update: 50

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 11/04/2005 Date Data Arrived at EDR: 11/28/2005 Date Made Active in Reports: 01/30/2006 Number of Days to Update: 63	Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 09/05/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Varies		
ODI: Open Dump Inventory An open dump is defined as a disposal facilit Subtitle D Criteria.	y that does not comply with one or more of the Part 257 or Part 258		
Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004 Number of Days to Update: 39	Source: Environmental Protection Agency Telephone: 800-424-9346 Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned		
PRP: Potentially Responsible Parties A listing of verified Potentially Responsible P	arties		
Date of Government Version: 07/20/2006 Date Data Arrived at EDR: 07/21/2006 Date Made Active in Reports: 08/22/2006 Number of Days to Update: 32	Source: EPA Telephone: 202-564-6064 Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Quarterly		
TRIS: Toxic Chemical Release Inventory System Toxic Release Inventory System. TRIS ident land in reportable quantities under SARA Titl	ifies facilities which release toxic chemicals to the air, water and le III Section 313.		
Date of Government Version: 12/31/2004 Date Data Arrived at EDR: 06/22/2006 Date Made Active in Reports: 08/23/2006 Number of Days to Update: 62	Source: EPA Telephone: 202-566-0250 Last EDR Contact: 09/22/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Annually		
TSCA: Toxic Substances Control Act Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.			
Date of Government Version: 12/31/2002 Date Data Arrived at EDR: 04/14/2006 Date Made Active in Reports: 05/30/2006 Number of Days to Update: 46	Source: EPA Telephone: 202-260-5521 Last EDR Contact: 10/18/2006 Next Scheduled EDR Contact: 01/15/2007 Data Release Frequency: Every 4 Years		
FTTS tracks administrative cases and pestic	ederal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) ide enforcement actions and compliance activities related to FIFRA, d Community Right-to-Know Act). To maintain currency, EDR contacts the		
Date of Government Version: 07/14/2006 Date Data Arrived at EDR: 07/18/2006 Date Made Active in Reports: 09/06/2006	Source: EPA/Office of Prevention, Pesticides and Toxic Substances Telephone: 202-566-1667 Last EDR Contact: 09/18/2006		

Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

Date of Government Version: 07/14/2006 Date Data Arrived at EDR: 07/18/2006 Date Made Active in Reports: 09/06/2006 Number of Days to Update: 50 Source: EPA Telephone: 202-566-1667 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Quarterly

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2004 Date Data Arrived at EDR: 05/11/2006 Date Made Active in Reports: 05/22/2006 Number of Days to Update: 11 Source: EPA Telephone: 202-564-4203 Last EDR Contact: 10/30/2006 Next Scheduled EDR Contact: 01/15/2007 Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 02/13/2006 Date Data Arrived at EDR: 04/21/2006 Date Made Active in Reports: 05/11/2006 Number of Days to Update: 20 Source: Environmental Protection Agency Telephone: 202-564-5088 Last EDR Contact: 07/17/2006 Next Scheduled EDR Contact: 10/16/2006 Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 07/07/2006 Date Data Arrived at EDR: 08/09/2006 Date Made Active in Reports: 09/06/2006 Number of Days to Update: 28 Source: EPA Telephone: 202-566-0500 Last EDR Contact: 08/09/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/10/2006	S
Date Data Arrived at EDR: 07/20/2006	Т
Date Made Active in Reports: 09/06/2006	La
Number of Days to Update: 48	N

Source: Nuclear Regulatory Commission Telephone: 301-415-7169 Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Quarterly

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 05/16/2006	Source: Department of Labor, Mine Safety and Health Administration
Date Data Arrived at EDR: 06/28/2006	Telephone: 303-231-5959
Date Made Active in Reports: 08/23/2006	Last EDR Contact: 09/27/2006
Number of Days to Update: 56	Next Scheduled EDR Contact: 12/25/2006
	Data Release Frequency: Semi-Annually

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/21/2006 Date Data Arrived at EDR: 07/25/2006 Date Made Active in Reports: 09/06/2006 Number of Days to Update: 43 Source: EPA Telephone: N/A Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995 Number of Days to Update: 35 Source: EPA Telephone: 202-564-4104 Last EDR Contact: 09/05/2006 Next Scheduled EDR Contact: 12/04/2006 Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2003 Date Data Arrived at EDR: 06/17/2005 Date Made Active in Reports: 08/04/2005 Number of Days to Update: 48 Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 10/20/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Biennially

STATE AND LOCAL RECORDS

NY HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 09/01/2002 Date Data Arrived at EDR: 10/15/2002 Date Made Active in Reports: 10/30/2002 Number of Days to Update: 15 Source: Department of Environmental Conservation Telephone: 518-402-9564 Last EDR Contact: 10/20/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: No Update Planned

NY SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 08/04/2006 Date Data Arrived at EDR: 09/14/2006 Date Made Active in Reports: 10/16/2006 Number of Days to Update: 32 Source: Department of Environmental Conservation Telephone: 518-402-9622 Last EDR Contact: 09/14/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Annually

NJ SHWS: Known Contaminated Sites in New Jersey

The Known Contaminated Sites in New Jersey includes sites under the purview of the Site Remediation Program which have contamination present at levels greater than the applicable cleanup criteria for soil and/or groundwater standards. The sites appearing in Known Contaminated Sites in New Jersey are classified as either active, where the site is assigned to a specific remedial program area, or pending, where the site is awaiting assignment to a specific remedial program area. Sites where no further action (NFA) designation has been given are not included in this report unless there are other areas of identified contamination which have not been remediated. This report includes sites being remediated under all of the various regulatory programs administered by the Site Remediation Program such as: Federal Superfund Program, Federal Resource Conservation and Recovery Act (RCRA), New Jersey's Industrial Site Recovery Act (ISRA), New Jersey's Solid Waste Management Act, New Jersey's Water Pollution Control Act.

Date of Government Version: 05/31/2006 Date Data Arrived at EDR: 06/22/2006 Date Made Active in Reports: 08/01/2006 Number of Days to Update: 40 Source: New Jersey Department of Environmental Protection Telephone: 609-292-8761 Last EDR Contact: 10/20/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Varies

NY DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 08/04/2006 Date Data Arrived at EDR: 09/14/2006 Date Made Active in Reports: 10/16/2006 Number of Days to Update: 32 Source: Department of Environmental Conservation Telephone: 518-402-9622 Last EDR Contact: 09/14/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Annually

NY SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 07/31/2006 Date Data Arrived at EDR: 08/01/2006 Date Made Active in Reports: 09/01/2006 Number of Days to Update: 31 Source: Department of Environmental Conservation Telephone: 518-457-2051 Last EDR Contact: 10/30/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: Semi-Annually

NJ SWF/LF: Solid Waste Facility Directory

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 09/01/2006 Date Data Arrived at EDR: 09/20/2006 Date Made Active in Reports: 10/25/2006 Number of Days to Update: 35 Source: Department of Environmental Protection Telephone: 609-984-6741 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Quarterly

NY SWRCY: Registered Recycling Facility List A listing of recycling facilities. Date of Government Version: 07/31/2006 Source: Department of Environmental Conservation Date Data Arrived at EDR: 08/01/2006 Telephone: 518-402-8705 Date Made Active in Reports: 09/01/2006 Last EDR Contact: 10/30/2006 Next Scheduled EDR Contact: 01/29/2007 Number of Days to Update: 31 Data Release Frequency: Semi-Annually NY SWTIRE: Registered Waste Tire Storage & Facility List Date of Government Version: 04/01/2004 Source: Department of Environmental Conservation Date Data Arrived at EDR: 05/19/2004 Telephone: 518-402-8694 Date Made Active in Reports: 06/25/2004 Last EDR Contact: 08/18/2006 Number of Days to Update: 37 Next Scheduled EDR Contact: 11/13/2006 Data Release Frequency: Annually NJ SWRCY: Approved Class B Recycling Facilities "Class B recyclable material" means a source separated recyclable material which is subject to Department approval prior to receipt, storage, processing or transfer at a recycling center in accordance with N.J.S.A. 13:1E-99.34b. Date of Government Version: 08/29/2006 Source: Department of Environmental Protection Date Data Arrived at EDR: 08/30/2006 Telephone: 609-984-6650 Date Made Active in Reports: 10/09/2006 Last EDR Contact: 08/30/2006 Number of Days to Update: 40 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Varies NY LTANKS: Spills Information Database Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. Date of Government Version: 07/26/2006 Source: Department of Environmental Conservation Date Data Arrived at EDR: 08/23/2006 Telephone: 518-402-9549 Date Made Active in Reports: 10/16/2006 Last EDR Contact: 10/25/2006 Number of Days to Update: 54 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies NY HIST LTANKS: Listing of Leaking Storage Tanks A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation. Date of Government Version: 01/01/2002 Source: Department of Environmental Conservation Date Data Arrived at EDR: 07/08/2005 Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Date Made Active in Reports: 07/14/2005 Number of Days to Update: 6 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

NY UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 06/14/2006	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/26/2006	Telephone: 518-402-9549
Date Made Active in Reports: 08/21/2006	Last EDR Contact: 10/25/2006
Number of Days to Update: 26	Next Scheduled EDR Contact: 01/22/2007
	Data Release Frequency: No Update Planned

NJ UST: Underground Storage Tank Data

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 06/20/2006	Source: Department of Environmental Protection
Date Data Arrived at EDR: 07/27/2006	Telephone: 609-341-3121
Date Made Active in Reports: 08/18/2006	Last EDR Contact: 09/05/2006
Number of Days to Update: 22	Next Scheduled EDR Contact: 12/04/2006
	Data Release Frequency: Varies

NY CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002	Source: NYSDEC
Date Data Arrived at EDR: 02/20/2002	Telephone: 518-402-9549
Date Made Active in Reports: 03/22/2002	Last EDR Contact: 10/24/2005
Number of Days to Update: 30	Next Scheduled EDR Contact: 01/23/2006
	Data Release Frequency: No Update Planned

NY MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002 Number of Days to Update: 30 Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005 Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: Varies

NY HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006 Number of Days to Update: 48 Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies

NY AST: Petroleum Bulk Storage Registered Aboveground Storage Tanks.

Number of Days to Update: 26

Date of Government Version: 06/14/2006 Date Data Arrived at EDR: 07/26/2006 Date Made Active in Reports: 08/21/2006

Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/25/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: No Update Planned

NY CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002	Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005
Number of Days to Update: 30	Next Scheduled EDR Contact: 10/24/2005
	Data Release Frequency: No Update Planned

NY HIST AST: Historical Petroleum Bulk Storage Database These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information	
involved. See AST for more current data. Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006 Number of Days to Update: 48	Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: No Update Planned
NY MOSF AST: Major Oil Storage Facilities Datab Facilities that may be onshore facilities or ves greater.	base ssels, with petroleum storage capacities of 400,000 gallons or
Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002 Number of Days to Update: 30	Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005 Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned
NY MANIFEST: Facility and Manifest Data Manifest is a document that lists and tracks h facility.	azardous waste from the generator through transporters to a TSD
Date of Government Version: 08/01/2006 Date Data Arrived at EDR: 08/30/2006 Date Made Active in Reports: 10/16/2006 Number of Days to Update: 47	Source: Department of Environmental Conservation Telephone: 518-402-8651 Last EDR Contact: 08/30/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Annually
NJ MANIFEST: Manifest Information Hazardous waste manifest information.	
Date of Government Version: 06/01/2006 Date Data Arrived at EDR: 07/06/2006 Date Made Active in Reports: 08/01/2006 Number of Days to Update: 26	Source: Department of Environmental Protection Telephone: N/A Last EDR Contact: 10/05/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Annually
NY SPILLS: Spills Information Database Data collected on spills reported to NYSDEC	as required by one or more of the following: Article 12 of the Navigation

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 07/26/2006 Date Data Arrived at EDR: 08/23/2006 Date Made Active in Reports: 10/16/2006 Number of Days to Update: 54 Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/25/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies

NY HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002	
Date Data Arrived at EDR: 07/08/2005	
Date Made Active in Reports: 07/14/2005	
Number of Days to Update: 6	

Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

NY ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 08/04/2006	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 09/14/2006	Telephone: 518-402-9553
Date Made Active in Reports: 10/16/2006	Last EDR Contact: 09/14/2006
Number of Days to Update: 32	Next Scheduled EDR Contact: 12/11/2006
	Data Release Frequency: Quarterly

NJ ENG CONTROLS: Declaration Environmental Restriction/Deed Notice Sites Legal Document that restricts the use of contaminated property; holds owner(s) to the regulatory/statutory requirements for cleanup.

Date of Government Version: 07/13/2006 Date Data Arrived at EDR: 08/15/2006 Date Made Active in Reports: 08/30/2006 Number of Days to Update: 15 Source: Department of Environmental Protection Telephone: 609-341-3121 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Varies

NY INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 08/04/2006	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 09/14/2006	Telephone: 518-402-9553
Date Made Active in Reports: 10/16/2006	Last EDR Contact: 09/14/2006
Number of Days to Update: 32	Next Scheduled EDR Contact: 12/11/2006
	Data Release Frequency: Quarterly

NJ INST CONTROL: Classification Exception Area Sites

A Classification Exception Area is an institutional control providing notice that ground water contamination exists in a particular location above State standards.

Date of Government Version: 07/13/2006 Date Data Arrived at EDR: 08/15/2006 Date Made Active in Reports: 08/30/2006 Number of Days to Update: 15 Source: Department of Environmental Protection Telephone: 609-341-3121 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Varies

NY VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 08/04/2006	
Date Data Arrived at EDR: 09/14/2006	
Date Made Active in Reports: 10/16/2006	
Number of Days to Update: 32	

Source: Department of Environmental Conservation Telephone: 518-402-9711 Last EDR Contact: 09/14/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Semi-Annually

NJ VCP: Voluntary Cleanup Program Sites

Through the VCP, responsible parties, developers, local officials, or individuals may work with the department to remediate non-priority contaminated sites that pose no immediate threat to human health or the environment.

Date of Government Version: 08/14/2006 Date Data Arrived at EDR: 09/06/2006 Date Made Active in Reports: 10/09/2006 Number of Days to Update: 33	Source: Department of Environmental Protection Telephone: 609-341-3121 Last EDR Contact: 10/30/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: Varies	
NY DRYCLEANERS: Registered Drycleaners A listing of all registered drycleaning facilities.		
Date of Government Version: 06/15/2004 Date Data Arrived at EDR: 06/15/2004 Date Made Active in Reports: 07/29/2004 Number of Days to Update: 44	Source: Department of Environmental Conservation Telephone: 518-402-8403 Last EDR Contact: 05/21/2004 Next Scheduled EDR Contact: N/A Data Release Frequency: Varies	
NJ DRYCLEANERS: Drycleaner List A listing of registered drycleaners.		
Date of Government Version: 09/18/2006 Date Data Arrived at EDR: 09/18/2006 Date Made Active in Reports: 10/25/2006 Number of Days to Update: 37	Source: Department of Environmental Protection Telephone: 609-292-2795 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/04/2006 Data Release Frequency: Varies	
NY BROWNFIELDS: Brownfields Site List A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.		
Date of Government Version: 08/04/2006 Date Data Arrived at EDR: 09/14/2006 Date Made Active in Reports: 10/16/2006	Source: Department of Environmental Conservation Telephone: 518-402-9764 Last EDR Contact: 09/14/2006	

NJ BROWNFIELDS: Brownfields Database

Number of Days to Update: 32

Brownfields are identified as former or current commercial or industrial use sites that are presently vacant or underutilized, on which there is suspected to have been a discharge of a contamination to the soil or groundwater at concentrations greater than applicable cleanup criteria.

Date of Government Version: 07/11/2006 Date Data Arrived at EDR: 07/11/2006 Date Made Active in Reports: 08/01/2006 Number of Days to Update: 21 Source: Department of Environmental Protection Telephone: 609-292-1251 Last EDR Contact: 10/11/2006 Next Scheduled EDR Contact: 01/08/2007 Data Release Frequency: Annually

Next Scheduled EDR Contact: 12/11/2006

Data Release Frequency: Semi-Annually

NY SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 08/16/2006 Date Data Arrived at EDR: 08/17/2006 Date Made Active in Reports: 09/01/2006 Number of Days to Update: 15 Source: Department of Environmental Conservation Telephone: 518-402-8233 Last EDR Contact: 08/08/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: No Update Planned

NJPDES: New Jersey Pollutant Discharge Elimination System Dischargers

The NJPDES contains the names, addresses and other information of all permitted New Jersey Pollutant Discharge Elimination Sytem dischargers.

Date of Government Version: 02/24/2006 Date Data Arrived at EDR: 03/15/2006 Date Made Active in Reports: 04/11/2006 Number of Days to Update: 27

Source: Department of Environmental Protection Telephone: 609-242-4543 Last EDR Contact: 09/15/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Varies

NY AIRS: Air Emissions Data

Date of Government Version: 12/31/2002 Source: Department of Environmental Conservation Date Data Arrived at EDR: 09/13/2004 Telephone: 518-402-8452 Date Made Active in Reports: 10/18/2004 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Annually

TRIBAL RECORDS

INDIAN RESERV: Indian Reservations

Number of Days to Update: 35

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2004 Date Data Arrived at EDR: 02/08/2005 Date Made Active in Reports: 08/04/2005 Number of Days to Update: 177

Source: USGS Telephone: 202-208-3710 Last EDR Contact: 08/11/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: Semi-Annually

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 06/08/2006	Sour
Date Data Arrived at EDR: 06/09/2006	Tele
Date Made Active in Reports: 06/28/2006	Last
Number of Days to Update: 19	Next
• •	_

rce: EPA Region 1 ephone: 617-918-1313 EDR Contact: 08/21/2006 t Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 06/01/2006 Date Data Arrived at EDR: 07/10/2006 Date Made Active in Reports: 09/12/2006 Number of Days to Update: 64

Number of Days to Update: 40

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 06/08/2006	Source: EPA Region 10
Date Data Arrived at EDR: 06/09/2006	Telephone: 206-553-2857
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 06/01/2006 Date Data Arrived at EDR: 06/23/2006 Date Made Active in Reports: 08/02/2006

Source: Environmental Protection Agency Telephone: 415-972-3372 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Quarterly

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.		
Date of Government Version: 06/06/2006 Date Data Arrived at EDR: 06/09/2006 Date Made Active in Reports: 07/28/2006 Number of Days to Update: 49	Source: EPA Region 8 Telephone: 303-312-6271 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Quarterly	
INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in New Mexico and Oklahoma.		
Date of Government Version: 01/04/2005 Date Data Arrived at EDR: 01/21/2005 Date Made Active in Reports: 02/28/2005 Number of Days to Update: 38	Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Varies	
INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Florida, Minnesota, Mississippi and North Carolina.		
Date of Government Version: 01/01/2006 Date Data Arrived at EDR: 02/27/2006 Date Made Active in Reports: 03/28/2006 Number of Days to Update: 29	Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Semi-Annually	
INDIAN UST R4: Underground Storage Tanks on Ir	ndian Land	
Date of Government Version: 01/01/2006 Date Data Arrived at EDR: 02/27/2006 Date Made Active in Reports: 03/28/2006 Number of Days to Update: 29	Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Semi-Annually	
INDIAN UST R6: Underground Storage Tanks on Indian Land		
Date of Government Version: 06/30/2006 Date Data Arrived at EDR: 07/03/2006 Date Made Active in Reports: 09/06/2006 Number of Days to Update: 65	Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Semi-Annually	

INDIAN UST R5: Underground Storage Tanks on Indian Land

Date of Government Version: 12/02/2004 Date Data Arrived at EDR: 12/29/2004	Source: EPA Region 5 Telephone: 312-886-6136
Date Made Active in Reports: 02/04/2005	Last EDR Contact: 08/21/2006
Number of Days to Update: 37	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

Date of Government Version: 06/06/2006	Source: EPA Region 8
Date Data Arrived at EDR: 06/09/2006	Telephone: 303-312-6137
Date Made Active in Reports: 07/28/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

INDIAN UST R10: Underground Storage Tanks on Indian Land

Date of Government Version: 06/08/2006 Date Data Arrived at EDR: 06/09/2006 Date Made Active in Reports: 07/28/2006 Number of Days to Update: 49 Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 08/21/2006 Next Scheduled EDR Contact: 11/20/2006 Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land A listing of underground storage tank locations on Indian Land.

Date of Government Version: 06/08/2006	Source: EPA, Region 1
Date Data Arrived at EDR: 06/09/2006	Telephone: 617-918-1313
Date Made Active in Reports: 06/30/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 21	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

Date of Government Version: 06/01/2006	Source: EPA Region 7
Date Data Arrived at EDR: 07/10/2006	Telephone: 913-551-7003
Date Made Active in Reports: 09/12/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 64	Next Scheduled EDR Contact: 11/20/2006
- •	Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

Date of Government Version: 06/01/2006	Source: EPA Region 9
Date Data Arrived at EDR: 06/23/2006	Telephone: 415-972-3368
Date Made Active in Reports: 08/02/2006	Last EDR Contact: 08/21/2006
Number of Days to Update: 40	Next Scheduled EDR Contact: 11/20/2006
	Data Release Frequency: Quarterly

EDR PROPRIETARY RECORDS

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Source: EDR, Inc.

Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A

Telephone: N/A

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A Number of Days to Update: N/A

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

Date of Government Version: 06/23/2006 Date Data Arrived at EDR: 07/05/2006 Date Made Active in Reports: 08/07/2006 Number of Days to Update: 33 Source: Cortland County Health Department Telephone: 607-753-5035 Last EDR Contact: 05/30/2006 Next Scheduled EDR Contact: 08/28/2006 Data Release Frequency: Quarterly

Data Release Frequency: No Update Planned

Cortland County Storage Tank Listing

Date of Government Version: 06/23/2006 Date Data Arrived at EDR: 07/05/2006 Date Made Active in Reports: 08/07/2006 Number of Days to Update: 33 Source: Cortland County Health Department Telephone: 607-753-5035 Last EDR Contact: 08/28/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003 Number of Days to Update: 13

Storage Tank Database

Date of Government Version: 06/28/2006 Date Data Arrived at EDR: 07/28/2006 Date Made Active in Reports: 08/21/2006 Number of Days to Update: 24

Storage Tank Database

Date of Government Version: 06/28/2006 Date Data Arrived at EDR: 07/28/2006 Date Made Active in Reports: 08/21/2006 Number of Days to Update: 24

Registered Tank Database

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003 Number of Days to Update: 13 Source: Nassau County Health Department Telephone: 516-571-3314 Last EDR Contact: 10/31/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: No Update Planned

Source: Nassau County Office of the Fire Marshal Telephone: 516-572-1000 Last EDR Contact: 07/07/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: Varies

Source: Nassau County Office of the Fire Marshal Telephone: 516-572-1000 Last EDR Contact: 07/07/2006 Next Scheduled EDR Contact: 11/06/2006 Data Release Frequency: Varies

Source: Nassau County Health Department Telephone: 516-571-3314 Last EDR Contact: 10/31/2006 Next Scheduled EDR Contact: 01/29/2007 Data Release Frequency: No Update Planned

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

Date of Government Version: 07/05/2006 Date Data Arrived at EDR: 07/18/2006 Date Made Active in Reports: 08/21/2006 Number of Days to Update: 34

Petroleum Bulk Storage Database

Date of Government Version: 07/05/2006 Date Data Arrived at EDR: 07/18/2006 Date Made Active in Reports: 08/21/2006 Number of Days to Update: 34 Source: Rockland County Health Department Telephone: 914-364-2605 Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Quarterly

Source: Rockland County Health Department Telephone: 914-364-2605 Last EDR Contact: 10/02/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Quarterly

SUFFOLK COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Storage Tank Database

Date of Government Version: 06/21/2005 Date Data Arrived at EDR: 09/19/2005 Date Made Active in Reports: 11/03/2005 Number of Days to Update: 45

Storage Tank Database

Date of Government Version: 06/21/2005 Date Data Arrived at EDR: 09/19/2005 Date Made Active in Reports: 11/03/2005 Number of Days to Update: 45 Source: Suffolk County Department of Health Services Telephone: 631-854-2521 Last EDR Contact: 06/02/2006 Next Scheduled EDR Contact: 08/28/2006 Data Release Frequency: Annually

Source: Suffolk County Department of Health Services Telephone: 631-854-2521 Last EDR Contact: 08/28/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Annually

WESTCHESTER COUNTY:

Listing of Storage Tanks

Listing of aboveground storage tanks in Westchester County.

Date of Government Version: 05/05/2005	Source: Westchester County Department of Health
Date Data Arrived at EDR: 05/31/2005	Telephone: 914-813-5161
Date Made Active in Reports: 06/30/2005	Last EDR Contact: 09/05/2006
Number of Days to Update: 30	Next Scheduled EDR Contact: 11/27/2006
	Data Release Frequency: Varies

Listing of Storage Tanks

Listing of underground storage tanks in Westchester County.

Date of Government Version: 05/05/2005 Date Data Arrived at EDR: 05/31/2005 Date Made Active in Reports: 06/30/2005 Number of Days to Update: 30 Source: Westchester County Department of Health Telephone: 914-813-5161 Last EDR Contact: 09/05/2006 Next Scheduled EDR Contact: 11/27/2006 Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2004 Date Data Arrived at EDR: 02/17/2006 Date Made Active in Reports: 04/07/2006 Number of Days to Update: 49	Source: Department of Environmental Protection Telephone: 860-424-3375 Last EDR Contact: 09/11/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Annually
NJ MANIFEST: Manifest Information Hazardous waste manifest information.	
Date of Government Version: 06/01/2006 Date Data Arrived at EDR: 07/06/2006 Date Made Active in Reports: 08/01/2006 Number of Days to Update: 26	Source: Department of Environmental Protection Telephone: N/A Last EDR Contact: 10/05/2006 Next Scheduled EDR Contact: 01/01/2007 Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PAN	IANIFEST: Manifest Information Hazardous waste manifest information.	
	Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 05/04/2006 Date Made Active in Reports: 06/06/2006 Number of Days to Update: 33	Source: Department of Environmental Protection Telephone: N/A Last EDR Contact: 09/11/2006 Next Scheduled EDR Contact: 12/11/2006 Data Release Frequency: Annually
RIM	ANIFEST: Manifest information Hazardous waste manifest information	
	Date of Government Version: 09/30/2005 Date Data Arrived at EDR: 05/09/2006 Date Made Active in Reports: 05/24/2006 Number of Days to Update: 15	Source: Department of Environmental Management Telephone: 401-222-2797 Last EDR Contact: 09/18/2006 Next Scheduled EDR Contact: 12/18/2006 Data Release Frequency: Annually
VT N	IANIFEST: Hazardous Waste Manifest Data Hazardous waste manifest information.	
	Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 06/29/2006 Date Made Active in Reports: 07/31/2006 Number of Days to Update: 32	Source: Department of Environmental Conservation Telephone: 802-241-3443 Last EDR Contact: 08/15/2006 Next Scheduled EDR Contact: 11/13/2006 Data Release Frequency: Annually
WI M	IANIFEST: Manifest Information Hazardous waste manifest information.	
	Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 03/17/2006 Date Made Active in Reports: 05/02/2006 Number of Days to Update: 46	Source: Department of Natural Resources Telephone: N/A Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/08/2007 Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: PennWell Corporation

Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its

fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Public Schools

Source: National Center for Education Statistics Telephone: 202-502-7300 The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states. Private Schools Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers Source: Department of Health

Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2006 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

SUN CHEMICAL CORPORATION ALEXANDER STREET/ASHBURTON AVENUE YONKERS, NY 10701

TARGET PROPERTY COORDINATES

Latitude (North):	40.94060 - 40° 56' 26.2"
Longitude (West):	73.901 - 73° 54' 3.6"
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	592513.8
UTM Y (Meters):	4532533.0
Elevation:	9 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	40073-H8 YONKERS, NJ
Most Recent Revision:	1998

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General West

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

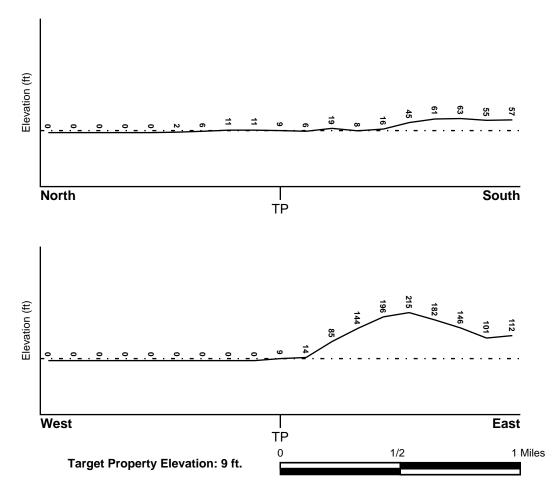

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Target Property County WESTCHESTER, NY	FEMA Flood <u>Electronic Data</u> YES - refer to the Overview Map and Detail Map
Flood Plain Panel at Target Property:	3609360010B
Additional Panels in search area:	34003C0210F 34003C0220F
NATIONAL WETLAND INVENTORY	NWI Electronic
NWI Quad at Target Property YONKERS	Data Coverage YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:		
Search Radius:	1.25 miles	
Status:	Not found	

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID Not Reported LOCATION FROM TP GENERAL DIRECTION GROUNDWATER FLOW

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION

Era: System:	Paleozoic Ordovicias	Category:	Stratified Sequence
Series: Code:	Lower Ordovician and Cambrian c OC (decoded above as Era, System		

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

a hydric soil.

Soil Component Name:	URBAN LAND
Soil Surface Texture:	variable
Hydrologic Group:	Not reported
Soil Drainage Class:	Not reported
Hydric Status: Soil does not meet the	requirements for
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 10 inches

Depth to Bedrock Max: > 10 inches

	Soil Layer Information						
	Bou	ndary		Classif	ication		
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures:	loamy sand silt loam sandy loam fine sandy loam
Surficial Soil Types:	loamy sand silt loam sandy loam fine sandy loam
Shallow Soil Types:	sandy loam
Deeper Soil Types:	very gravelly - loamy sand unweathered bedrock stratified sandy loam

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID

WELL ID

LOCATION FROM TP

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS2112722	1/8 - 1/4 Mile South
2	USGS2112709	1/2 - 1 Mile SE
3	USGS2112770	1/2 - 1 Mile North
5	USGS2112717	1/2 - 1 Mile ESE
6	USGS2112716	1/2 - 1 Mile ESE
A7	USGS2112734	1/2 - 1 Mile East
A8	USGS2112732	1/2 - 1 Mile East
A9	USGS2112733	1/2 - 1 Mile East
10	USGS2112755	1/2 - 1 Mile ENE
11	USGS2112911	1/2 - 1 Mile South

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
4	NY0006622	1/2 - 1 Mile South

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION


		LOCATION
MAP ID	WELL ID	FROM TP
No Wells Found		

OTHER STATE DATABASE INFORMATION

STATE OIL/GAS WELL INFORMATION

DISTANCE DISTANCE FROM TP (Miles) FROM TP (Mile	
1/4 - 1/2 Mile South	1/4 - 1/2 Mile South
1/4 - 1/2 Mile South	1/4 - 1/2 Mile South
1/4 - 1/2 Mile South	1/4 - 1/2 Mile South
1/4 - 1/2 Mile South	1/4 - 1/2 Mile South
1/4 - 1/2 Mile South	1/4 - 1/2 Mile South

PHYSICAL SETTING SOURCE MAP - 1784877.2s

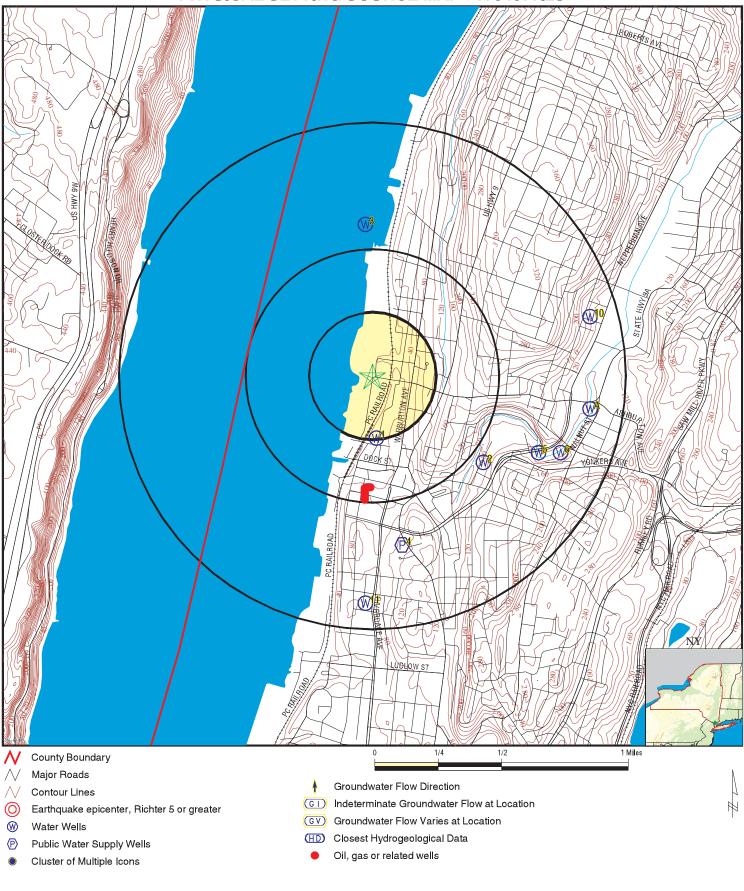

ADDRESS:	Alexander Street/Ashburton Avenue Yonkers NY 10701	CONTACT: INQUIRY #: DATE:	Paulus Sokolowski & Sartor Dyane Benardos 1784877.2s November 02, 2006 1:46 pm
		Copyrigh	t © 2006 EDR, Inc. © 2006 Tele Atlas Rel. 07/2005.

Map ID Direction I 1

State:

Country:

stance evation				Database	EDR ID Num
outh 3 - 1/4 Mile wer				FED USGS	USGS2112722
Agency cd:		USGS	Site no:	405613073540401	
Site name:		WE 16			
Latitude:		405613			
Longitude:		0735404	Dec lat:	40.93704313	
Dec lon:		-73.90069139	Coor meth:	Μ	
Coor accr:		F	Latlong datum:	NAD27	
Dec latlong	datum:	NAD83	District:	36	
State:		36	County:	119	
Country:		US	Land net:	Not Reported	
Location ma	ap:	BULL GW-35	Map scale:	Not Reported	
Altitude:		20.00	Altitude method:	M	
Altitude acc	curacy:	5	Altitude datum:	NGVD29	
Hydrologic:		Lower Hudson. Connecticut, Nev			
Topographi		Not Reported	•		
Site type:		Ground-water other than Spring	Date construction:	Not Reported	
Date invent	oried:	Not Reported	Mean greenwich time offset:	EST	
Local stand	lard time flag:	N	C		
Type of gro	und water site:	Single well, other than collector of	or Ranney type		
Aquifer Typ		Not Reported	, ,,,		
Aquifer:		BEDRÖCK			
Well depth:		305	Hole depth:	Not Reported	
Source of d		Not Reported	Project number:	BULLGW-35	
Real time d	•	0	Daily flow data begin date:	0000-00-00	
	lata end date:	0000-00-00	Daily flow data count:	0	
	lata begin date:	0000-00-00	Peak flow data end date:	0000-00-00	
Peak flow d	0	0	Water quality data begin date:	0000-00-00	
Water quali	ity data end date	e:0000-00-00	Water quality data count:	0	
		ate: 1942-00-00	Ground water data end date:	1942-00-00	
		1			
Ground-wat	ter levels. Num	per of Measurements: 1			
	Feet below	Feet to			
Date	Surface	Sealevel			
1942	8.00				
	8.00				
E 2 - 1 Mile igher				FED USGS	USGS2112709
Agency cd:		USGS	Site no:	405608073533501	
Site name:		WE 21			
Latitude:		405608			
Longitude:		0735335	Dec lat:	40.93565428	
Dec lon:		-73.89263561	Coor meth:	Μ	
Coor ocor		E	Lationa datum:		

-73. F Coor accr: NAD83 Dec latlong datum: 36 US Location map: BULL GW-35

89263561

Coor meth: Latlong datum: District: County: Land net: Map scale:

NAD27 36 119 Not Reported Not Reported

Altitude:	80.00	Altitude method:	Μ
Altitude accuracy:	5	Altitude datum:	NGVD29
Hydrologic:	Lower Hudson. Connecticut, Nev	v Jersey, New York. Area = 720	sq.mi.
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	Ν		
Type of ground water site:	Single well, other than collector of	or Ranney type	
Aquifer Type:	Not Reported		
Aquifer:	SAND AND GRAVEL		
Well depth:	38.0	Hole depth:	Not Reported
Source of depth data:	Not Reported	Project number:	BULLGW-35
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date	Not Reported	Water quality data count:	Not Reported
Ground water data begin da	ate: Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

3 North 1/2 - 1 Mile Lower			FED USGS	USGS2112770
Agency cd:	USGS	Site no:	405657073540701	
Site name:	WE 17			
Latitude:	405657			
Longitude:	0735407	Dec lat:	40.94926515	
Dec lon:	-73.9015247	Coor meth:	M	
Coor accr:	F	Latlong datum:	NAD27	
Dec latlong datum:	NAD83	District:	36	
State:	36	County:	119	
Country:	US	Land net:	Not Reported	
Location map:	BULL GW-35	Map scale:	Not Reported	
Altitude:	10.00	Altitude method:	M	
Altitude accuracy:	5	Altitude datum:	NGVD29	
Hydrologic:	Lower Hudson. Connecticut, Nev	v Jersey, New York. Area = 720	sq.mi.	
Topographic:	Not Reported			
Site type:	Ground-water other than Spring	Date construction:	Not Reported	
Date inventoried:	Not Reported	Mean greenwich time offset:	EST	
Local standard time flag:	N			
Type of ground water site:	Single well, other than collector of	or Ranney type		
Aquifer Type:	Not Reported			
Aquifer:	SAND AND GRAVEL			
Well depth:	55.0	Hole depth:	Not Reported	
Source of depth data:	Not Reported	Project number:	BULLGW-35	
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported	
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported	
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported	
Peak flow data count:	Not Reported	Water quality data begin date:	•	
Water quality data end date		Water quality data count:	Not Reported	
Ground water data begin da Ground water data count:	ate: Not Reported Not Reported	Ground water data end date:	Not Reported	

Ground-water levels, Number of Measurements: 0

Map ID Direction					
Distance Elevation				Database	EDR ID Number
4 South 1/2 - 1 Mile Higher				FRDS PWS	NY0006622
PWS ID: Date Initiated: PWS Name:			Active Not Reported		
Addressee / Facility:	System Owner/Responsible ABRAHAM SOL C/O SOL ABRAHAM 15 SATMAR DR. MONROE, NY 10950	Party			
Facility Latitude:	40 55 51		Facility Longitude: 0	73 53 57	
City Served: Treatment Class	THOMPSON (T) Not Reported		Population: N	ot Reported	
PWS currently has or had r	najor violation(s) or enforceme	ent:	No		
5 ESE 1/2 - 1 Mile Higher				FED USGS	USGS2112717
Agency cd:	USGS	Site no	:	405610073532001	
Site name:	WE 7 405610				
Latitude: Longitude:	405610 0735320	Dec lat		40.93620983	
Dec lon:	-73.88846883	Coor m		40.00020000 M	
Coor accr:	F		datum:	NAD27	
Dec latlong datum:	NAD83	District		36	
State:	36	County	:	119	
Country:	US	Land no	et:	Not Reported	
Location map:	BULL GW-35	Map sc	ale:	Not Reported	
Altitude:	100.00		e method:	M	
Altitude accuracy:	5		e datum:	NGVD29	
Hydrologic: Topographic:	Lower Hudson. Connecticut, Not Reported	New Jersey	, New York. Area = 720) sq.mi.	
Site type:	Ground-water other than Spr	ing Date co	onstruction:	Not Reported	
Date inventoried:	Not Reported	-	reenwich time offset:	EST	
Local standard time flag:	N			-	
Type of ground water site: Aquifer Type:	Single well, other than collec Not Reported	tor or Ranne	y type		
Aquifer:	BEDROCK				
Well depth:	401	Hole de	epth:	Not Reported	
Source of depth data:	Not Reported	Project	number:	BULLGW-35	
Real time data flag:	0		ow data begin date:	0000-00-00	
Daily flow data end date:	0000-00-00		ow data count:	0	
Peak flow data begin date:			ow data end date:	0000-00-00	
Peak flow data count:	0		quality data begin date:		
Water quality data end date			quality data count:	0	
Ground water data begin da Ground water data count:		Ground	I water data end date:	1947-00-00	

Date	Feet below Surface	Feet to Sealevel			
1947	13.00				
SE 2 - 1 Mile igher				FED USGS	USGS211271
Agency cd	:	USGS	Site no:	405610073531401	
Site name:		WE 5			
Latitude:		405610			
Longitude:		0735314	Dec lat:	40.93620983	
Dec lon:		-73.88680212	Coor meth:	M	
Coor accr:		F	Latlong datum:	NAD27	
Dec lationg	g datum:	NAD83	District:	36	
State:		36	County:	119	
Country:		US	Land net:	Not Reported	
Location m	iap:	BULL GW-35	Map scale:	Not Reported	
Altitude:		100.00	Altitude method:	M	
Altitude ac	curacy:	5	Altitude datum:	NGVD29	
Hydrologic		Lower Hudson. Connecticut, Nev	v Jersey, New York. Area = 720	sq.mi.	
Topograph	ic:	Not Reported			
Site type:		Ground-water other than Spring	Date construction:	Not Reported	
Date inven	toried:	Not Reported	Mean greenwich time offset:	EST	
	dard time flag:	N			
<i>.</i>	ound water site:	o	or Ranney type		
Aquifer Typ	be:	Not Reported			
Aquifer:		SAND AND GRAVEL			
Well depth		155	Hole depth:	Not Reported	
	depth data:	Not Reported	Project number:	BULLGW-35	
Real time of	0	Not Reported	Daily flow data begin date:	Not Reported	
	data end date:	Not Reported	Daily flow data count:	Not Reported	
	data begin date:	•	Peak flow data end date:	Not Reported	
	data count:	Not Reported	Water quality data begin date:		
	ity data end date		Water quality data count:	Not Reported	
		ate: Not Reported Not Reported	Ground water data end date:	Not Reported	

Ground-water levels, Number of Measurements: 0

A7 East 1/2 - 1 Mile Higher			FED USGS	USGS2112734
Agency cd:	USGS	Site no:	405619073530603	
Site name:	WE 11			
Latitude:	405619			
Longitude:	0735306	Dec lat:	40.93870979	
Dec lon:	-73.88457982	Coor meth:	Μ	
Coor accr:	F	Latlong datum:	NAD27	
Dec latlong datum:	NAD83	District:	36	
State:	36	County:	119	
Country:	US	Land net:	Not Reported	
Location map:	BULL GW-35	Map scale:	Not Reported	

Altitude:	100.00	Altitude method:	Μ
Altitude accuracy:	5	Altitude datum:	NGVD29
Hydrologic:	Lower Hudson. Connecticut, Nev	w Jersey, New York. Area = 720	sq.mi.
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	EST
Local standard time flag:	Ν		
Type of ground water site:	Single well, other than collector of	or Ranney type	
Aquifer Type:	Not Reported		
Aquifer:	SAND		
Well depth:	120	Hole depth:	Not Reported
Source of depth data:	Not Reported	Project number:	BULLGW-35
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported
Peak flow data count:	Not Reported	Water quality data begin date:	Not Reported
Water quality data end date	Not Reported	Water quality data count:	Not Reported
Ground water data begin da	ate: Not Reported	Ground water data end date:	Not Reported
Ground water data count:	Not Reported		

Ground-water levels, Number of Measurements: 0

A8 East 1/2 - 1 Mile Higher			FED USGS	USGS2112732
Agency cd:	USGS	Site no:	405619073530601	
Site name:	WE 9			
Latitude:	405619			
Longitude:	0735306	Dec lat:	40.93870979	
Dec lon:	-73.88457982	Coor meth:	M	
Coor accr:	F	Latlong datum:	NAD27	
Dec latlong datum:	NAD83	District:	36	
State:	36	County:	119	
Country:	US	Land net:	Not Reported	
Location map:	BULL GW-35	Map scale:	Not Reported	
Altitude:	100.00	Altitude method:	M	
Altitude accuracy:	5	Altitude datum:	NGVD29	
Hydrologic:	Lower Hudson. Connecticut, Nev	v Jersey, New York. Area = 720	sq.mi.	
Topographic:	Not Reported			
Site type:	Ground-water other than Spring	Date construction:	Not Reported	
Date inventoried:	Not Reported	Mean greenwich time offset:	EST	
Local standard time flag:	N			
Type of ground water site:	Single well, other than collector of	or Ranney type		
Aquifer Type:	Not Reported			
Aquifer:	SAND			
Well depth:	180	Hole depth:	Not Reported	
Source of depth data:	Not Reported	Project number:	BULLGW-35	
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported	
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported	
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported	
Peak flow data count:	Not Reported	Water quality data begin date:	•	
Water quality data end date		Water quality data count:	Not Reported	
Ground water data begin da	•	Ground water data end date:	Not Reported	
Ground water data count:	Not Reported			

Ground-water levels, Number of Measurements: 0

Map ID Direction Distance				
Elevation			Database	EDR ID Number
A9 East 1/2 - 1 Mile Higher			FED USGS	USGS2112733
Agency cd: Site name:	USGS WE 10	Site no:	405619073530602	
Latitude:	405619			
Longitude:	0735306	Dec lat:	40.93870979	
Dec lon:	-73.88457982	Coor meth:	M	
Coor accr:	F	Latlong datum:	NAD27	
Dec latlong datum:	NAD83	District:	36	
State:	36	County:	119	
Country:	US	Land net:	Not Reported	
Location map:	BULL GW-35	Map scale:	Not Reported	
Altitude:	100.00	Altitude method:	M	
Altitude accuracy:	5	Altitude datum:	NGVD29	
Hydrologic:	Lower Hudson. Connecticut, New	v Jersev. New York. Area = 720	sa.mi.	
Topographic:	Not Reported		- 1	
Site type:	Ground-water other than Spring	Date construction:	Not Reported	
Date inventoried:	Not Reported	Mean greenwich time offset:	EST	
Local standard time flag:	N	3		
Type of ground water site: Aquifer Type: Aquifer:	Single well, other than collector of Not Reported SAND	or Ranney type		
Well depth:	140	Hole depth:	Not Reported	
Source of depth data:	Not Reported	Project number:	BULLGW-35	
Real time data flag:	Not Reported	Daily flow data begin date:	Not Reported	
Daily flow data end date:	Not Reported	Daily flow data count:	Not Reported	
Peak flow data begin date:	Not Reported	Peak flow data end date:	Not Reported	
Peak flow data count:	Not Reported	Water quality data begin date:		
Water quality data end date	•	Water quality data count:	Not Reported	
Ground water data begin da		Ground water data end date:	Not Reported	
Ground water data count:	•		'	
Ground-water levels, Numb	er of Measurements: 0			

10 ENE 1/2 - 1 Mile Higher			FED USGS	USGS2112755
Agency cd:	USGS	Site no:	405638073530601	
Site name:	WE 285			
Latitude:	405638			
Longitude:	0735306	Dec lat:	40.94398748	
Dec lon:	-73.8845798	Coor meth:	Μ	
Coor accr:	F	Latlong datum:	NAD27	
Dec latlong datum:	NAD83	District:	36	
State:	36	County:	119	
Country:	US	Land net:	Not Reported	
Location map:	BULL GW-35	Map scale:	Not Reported	
Altitude:	140.00	Altitude method:	Μ	
Altitude accuracy:	5	Altitude datum:	NGVD29	
Hydrologic:	Lower Hudson. Connecticut, Nev	w Jersey, New York. Area = 72	0 sq.mi.	
Topographic:	Not Reported	•		
Site type:	Ground-water other than Spring	Date construction:	Not Reported	
Date inventoried:	Not Reported	Mean greenwich time offset:	EST	

	Local standard time flag: Type of ground water site Aquifer Type: Aquifer: Well depth: Source of depth data: Real time data flag: Daily flow data end date: Peak flow data begin date Peak flow data count: Water quality data end da Ground water data begin Ground water data count:	Not Reported BEDROCK 499 Not Reported 0 0000-00-00 0 0 0000-00-00 0 tte:0000-00-00 date: 1955-00-00	Hole depth: Project number: Daily flow data begin date: Daily flow data count: Peak flow data end date: Water quality data begin date: Water quality data count:	Not Reported BULLGW-35 0000-00-00 0 0000-00-00 0000-00-00 0 1955-00-00	
	Ground-water levels, Nun Feet below Date Surface				
	 1955 52.00				
1/:	outh 2 - 1 Mile igher			FED USGS	USGS2112911
	Agency cd: Site name: Latitude:	USGS WE 8 405539	Site no:	405539073540701	
	Longitude: Dec lon: Coor accr: Dec latlong datum:	0735407 -73.90152478 F NAD83	Dec lat: Coor meth: Latlong datum: District:	40.92759885 M NAD27 36	
	State: Country: Location map:	36 US BULL GW-35	County: Land net: Map scale:	119 Not Reported Not Reported	
	Altitude: Altitude accuracy: Hydrologic: Topographic:	50.00 5 Lower Hudson. Connecticut, Nev Not Reported	Altitude method: Altitude datum: v Jersey, New York. Area = 720	M NGVD29 sq.mi.	
	Site type: Date inventoried: Local standard time flag:	Ground-water other than Spring Not Reported N	Mean greenwich time offset:	Not Reported EST	
	Type of ground water site Aquifer Type: Aquifer:	Not Reported BEDROCK		Not Donoris d	
	Well depth: Source of depth data: Real time data flag: Daily flow data end date: Peak flow data begin date		Hole depth: Project number: Daily flow data begin date: Daily flow data count: Peak flow data end date: Woter guality data begin data:	Not Reported BULLGW-35 Not Reported Not Reported Not Reported	
	Peak flow data count: Water quality data end da Ground water data begin Ground water data count:	date: Not Reported	Water quality data begin date: Water quality data count: Ground water data end date:	Not Reported Not Reported Not Reported	

Ground-water levels, Number of Measurements: 0

Direction Distance

Direction Distance			Database	EDR ID Number
South 1/4 - 1/2 Mile			OIL_GAS	NYO1000112
Api wellno:	31119236720000			
Cnty:	Westchester			
Hole:	23672	Sidetrck:	0	
Completion:	0			
Well nm:	W-8			
Coname:	Main Street Lofts Yonke	ers, LLC		
Opno:	2272			
Dt approv:	Not Reported	Dt spud:	Not Reported	
Dt comp:	Not Reported			
Well typ:	Confidential			
Dtd:	1500			
WI status:	Confidential			
Town:	Yonkers	Field:	Confidential	
Prodform:	Confidential			
Xloc:	-73.90144			
Yloc:	40.93423			
Confid:	We have confidential inf	ormation for 6 months.		
Wellst:	CON			
Quad:	Yonkers	Quadsec:	Not Reported	
Deepestfor:	Confidential	Elevation:	100	
Dt mod:	Not Reported	Site id:	NYO1000112	

South 1/4 - 1/2 Mile

Api wellno:	31119236730000			
Cnty:	Westchester			
Hole:	23673	Sidetrck:	0	
Completion:	0			
Well nm:	W-9			
Coname:	Main Street Lofts Yonker	rs, LLC		
Opno:	2272			
Dt approv:	Not Reported	Dt spud:	Not Reported	
Dt comp:	Not Reported			
Well typ:	Confidential			
Dtd:	1500			
WI status:	Confidential			
Town:	Yonkers	Field:	Confidential	
Prodform:	Confidential			
Xloc:	-73.90129			
Yloc:	40.93423			
Confid:	We have confidential info	ormation for 6 months.		
Wellst:	CON			
Quad:	Yonkers	Quadsec:	Not Reported	
Deepestfor:	Confidential	Elevation:	100	
Dt mod:	Not Reported	Site id:	NYO1000113	

OIL_GAS

Direction

Distance Database EDR ID Number South 1/4 - 1/2 Mile OIL_GAS NYO1000114 Api wellno: 31119236740000 Cnty: Westchester 0 Hole: Sidetrck: 23674 Completion: 0 Well nm: W-10 Coname: Main Street Lofts Yonkers, LLC Opno: 2272 Not Reported Dt approv: Dt spud: Not Reported Not Reported Dt comp: Well typ: Confidential 1500 Dtd: WI status: Confidential Town: Yonkers Field: Confidential Prodform: Confidential Xloc: -73.90115 Yloc: 40.93423 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Not Reported Quad: Quadsec: Deepestfor: Confidential Elevation: 100 Not Reported NYO1000114 Dt mod: Site id:

South 1/4 - 1/2 Mile

Api wellno:	31119236650000		
Cnty:	Westchester		
Hole:	23665	Sidetrck:	0
Completion:	0		
Well nm:	W-1		
Coname:	Main Street Lofts Yonkers, LLC		
Opno:	2272		
Dt approv:	Not Reported	Dt spud:	Not Reported
Dt comp:	Not Reported		
Well typ:	Confidential		
Dtd:	1500		
WI status:	Confidential		
Town:	Yonkers	Field:	Confidential
Prodform:	Confidential		
Xloc:	-73.90158		
Yloc:	40.93418		
Confid:	We have confidential informatio	n for 6 months.	
Wellst:	CON		
Quad:	Yonkers	Quadsec:	Not Reported
Deepestfor:	Confidential	Elevation:	100
Dt mod:	Not Reported	Site id:	NYO1000111

TC1784877.2s Page A-16

OIL_GAS

Direction

Distance Database EDR ID Number South 1/4 - 1/2 Mile OIL_GAS NYO1000110 Api wellno: 31119236660000 Cnty: Westchester 0 Hole: 23666 Sidetrck: Completion: 0 Well nm: W-2 Coname: Main Street Lofts Yonkers, LLC Opno: 2272 Dt approv: Not Reported Dt spud: Not Reported Dt comp: Not Reported Confidential Well typ: Dtd: 1500 WI status: Confidential Yonkers Confidential Town: Field: Prodform: Confidential Xloc: -73.90158 Yloc: 40.93407 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Quad: Quadsec: Not Reported Deepestfor: Confidential Elevation: 103 NYO1000110 Dt mod: Not Reported Site id:

South 1/4 - 1/2 Mile

Api wellno: 31119236670000 Cnty: Westchester Hole: 23667 0 Sidetrck: Completion: 0 Well nm: W-3 Main Street Lofts Yonkers, LLC Coname: Opno: 2272 Not Reported Dt approv: Dt spud: Not Reported Not Reported Dt comp: Well typ: Confidential Dtd: 1500 WI status: Confidential Town: Yonkers Field: Confidential Prodform: Confidential -73.90158 Xloc: Yloc: 40.93396 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Quad: Quadsec: Not Reported Deepestfor: Confidential Elevation: 108 NYO1000109 Dt mod: Not Reported Site id:

OIL_GAS

Direction

Distance Database EDR ID Number South 1/4 - 1/2 Mile OIL_GAS NYO1000108 Api wellno: 31119236680000 Cnty: Westchester 0 Hole: 23668 Sidetrck: Completion: 0 Well nm: W-4 Coname: Main Street Lofts Yonkers, LLC Opno: 2272 Dt approv: Not Reported Dt spud: Not Reported Dt comp: Not Reported Confidential Well typ: Dtd: 1500 WI status: Confidential Yonkers Confidential Town: Field: Prodform: Confidential Xloc: -73.90158 Yloc: 40.93385 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Quad: Quadsec: Not Reported Deepestfor: Confidential Elevation: 114 NYO1000108 Dt mod: Not Reported Site id:

South 1/4 - 1/2 Mile

Api wellno: 31119236690000 Cnty: Westchester Hole: 23669 0 Sidetrck: Completion: 0 Well nm: W-5 Coname: Main Street Lofts Yonkers, LLC Opno: 2272 Not Reported Dt approv: Dt spud: Not Reported Not Reported Dt comp: Well typ: Confidential Dtd: 1500 WI status: Confidential Town: Yonkers Field: Confidential Prodform: Confidential -73.90158 Xloc: Yloc: 40.93374 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Quad: Quadsec: Not Reported Deepestfor: Confidential Elevation: 122 NYO1000107 Dt mod: Not Reported Site id:

OIL_GAS

Direction

Distance Database EDR ID Number South 1/4 - 1/2 Mile OIL_GAS NYO1000106 Api wellno: 31119236700000 Cnty: Westchester 0 Hole: 23670 Sidetrck: Completion: 0 Well nm: W-6 Coname: Main Street Lofts Yonkers, LLC Opno: 2272 Not Reported Dt approv: Dt spud: Not Reported Not Reported Dt comp: Well typ: Confidential 1500 Dtd: WI status: Confidential Town: Yonkers Field: Confidential Prodform: Confidential Xloc: -73.90158 Yloc: 40.93363 Confid: We have confidential information for 6 months. Wellst: CON Yonkers Not Reported Quad: Quadsec: Deepestfor: Confidential Elevation: 124 Not Reported NYO1000106 Dt mod: Site id:

South 1/4 - 1/2 Mile

Api wellno:	31119236710000			
Cnty:	Westchester			
Hole:	23671	Sidetrck:	0	
Completion:	0			
Well nm:	W-7			
Coname:	Main Street Lofts Yonke	ers, LLC		
Opno:	2272			
Dt approv:	Not Reported	Dt spud:	Not Reported	
Dt comp:	Not Reported	·		
Well typ:	Confidential			
Dtd:	1500			
WI status:	Confidential			
Town:	Yonkers	Field:	Confidential	
Prodform:	Confidential			
Xloc:	-73.90158			
Yloc:	40.93352			
Confid:	We have confidential int	formation for 6 months.		
Wellst:	CON			
Quad:	Yonkers	Quadsec:	Not Reported	
Deepestfor:	Confidential	Elevation:	130	
Dt mod:	Not Reported	Site id:	NYO1000105	

OIL_GAS

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

Zip	Num Sites	< 4 Pci/L	>= 4 Pci/L	>= 20 Pci/L	Avg > 4 Pci/L	Max Pci/L
10701	16	10 (62.5%)	6 (37.5%)	0 (0%)	3.22	15.2

Federal EPA Radon Zone for WESTCHESTER County: 3

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for WESTCHESTER COUNTY, NY

Number of sites tested: 650

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.930 pCi/L	97%	3%	0%
Basement	1.730 pCi/L	84%	13%	2%

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS) Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells Source: New York Department of Health Telephone: 518-458-6731

Oil and Gas Well Database

Department of Environmental Conservation Telephone: 518-402-8056 These files contain records, in the database, of wells that have been drilled.

OTHER STATE DATABASE INFORMATION

RADON

State Database: NY Radon

Source: Department of Health Telephone: 518-402-7556 Radon Test Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA Telephone: 703-356-4020 Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater Source: Department of Commerce, National Oceanic and Atmospheric Administration


PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2006 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX C

FOIA Requests and Responses

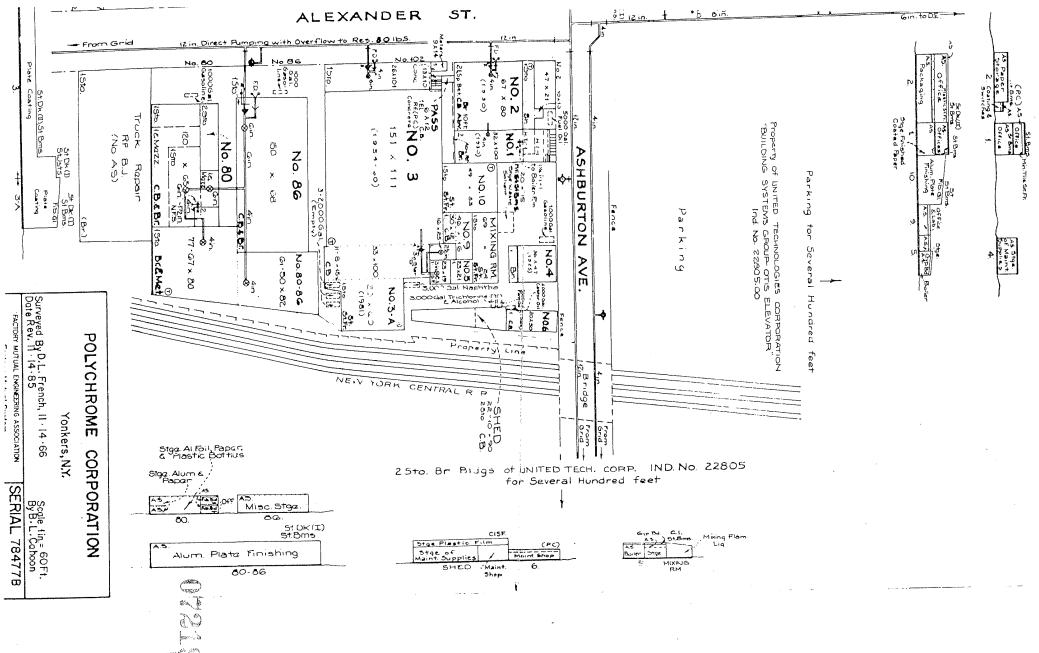

on ULED H BI MUC

1 ₹ 5+ DK (I) 5+. J 5+8. 5+. DK(I) 5+. J5+5. A5 AS OFFICES Fit BJ St Fr Asin Part Min Tile St Fr Offices CI 1AS Meral Cutting Stga Finished Costed Paper Stge Chemicals 1 Bo 45 45 -Aluminum i la est Offices, Dias Pallets Rolled (37) MLEP (SECOIS) St Bross State Pallets Pollets Aluminum 145 (54 cols.) 7 Boiler Rm Sffice Fance m Boiler) Stor Fence əbe. HUDSON RIVER Fence Equipment Several 100 ft. Wide (Sto (Tidal) 4 We Fence ence SHED CHAR π L SHED j t υ G l ٦ Ţ L Stge Maint. ٣ ļ Property of UNITED TECHNOLOGIES "BUILDING SYSTEMS GROUP-OTIS Index No. 22805.00 50 С 5 Ргоробей Мообен Деск ų, EXCELSIOR Ĩ J ELSIOR TRANSPARENT BAG MPG. CO. RF 510K(I) 91 Bms. (Spkir's) Index No.22776.03 20 国)^B 9 ۲Ľ 5-140,000 Gal N BIN ť٩ -(; r Drixing 6 Dixe jŪ, 5 ч **ХО** ч **О** св-2 х Ľ NÞ Sr.De.(L) Sr.Jets. Fis8d St.Fr. St.Come SHED ê Pallets á(r Δ (19 65) 137 (51. Cols) Property H Z_o. କ Property ĝ 1 Sto ŝ Rolled 10+0 È 0.0 5 CORPCRATION ELEVATOR" ATLANTIC DRILLING RF. BJ. (No AS.) (5 t) ω Θ -69) 55 1510 REST ø ÷, 5.5 CB. 14Ft. line Aluminum ţ)I. Print TARRICONE (CB 0 S 12510 RF. BJ SpKirid) (c. B.) 60 105×05 05×30 Shop 0 110 ちらい St Brito Ī э**Р** Truck Poading S X 30 15.15 24.22 × **₽**ĵ 6 ירה אררש 8 ð (CB).

2540 131

1510 -RF BU

ALL TO

<u>]</u>[

4

MORKS MORKS (No AS

ST Z TENO

ស្រ្ម័

844

NIE

515 24217 54

Ferseil

(CB

A5. Roof

4 E

FOIA Request No. 2RIN-00201-07.txt From: Abrines.David@epamail.epa.gov Sent: Monday, November 27, 2006 4:12 PM To: Benardos, Dyane Cc: Prieto.Quintin@epamail.epa.gov; McChesney.Dennis@epamail.epa.gov; Friend.Patricia@epamail.epa.gov; Jamison.Rebecca@epamail.epa.gov; Caldwell.Linda@epamail.epa.gov Subject: FOIA Request No. 2RIN-00201-07

Hi Mr. Benardos,

ŧ

Concerning your request for information for various addresses on Alexander Street in Yonkers, NY, we want to let you know that we have UIC information about an inspection that was done in 1999 at 91 Alexander Street, Yonkers, NY 10705, Alexander Street Terminal, and Rockland Fuel Terminal. There were no violations found during this inspection. The facility file is archived in our Kansas City, MO. Repository Center. We suggest that you contact Mr. Dennis McChesney of the Groundwater Compliance Section to discuss with him the information in this file. You can send an e-mail message to Mr. McChesney about your concerns.

×

EPA Region 2 Electronic FOIA Request Form

New Jersey, New York, Puerto Rico, U.S. Virgin Islands

Please complete the following form to submit your FOIA request electronically.

CAUTION: Any information you submit is not secure, and could be observed by a third party. Items in red must be completed for EPA to be able to process your request.

Dyane Benardos	Your Name
Paulus, Sokolowski and Sartor	Your Company Name
1025 Old Country Road, Suite 420	Your Mailing Address
Westbury, NY 11590	Your City, State, and ZIP Code
dbenardos@psands.com	Your E-Mail Address
516-512-7370	Your PhoneNumber

Please provide a specific statement regarding which documents you want to receive. If applicable, include the name(s) and addresses of the facility(ies) you are inquiring about. [Note: We do not maintain records for facilities by block and lot number; we need the facility name and address in order to search our records.]

Please provide all information in files regarding the _____ properties listed at: 137 Alexander Street, Yonkers, NY 145 Alexander Street, Yonkers, NY Section 2 Block 2615 Lots 1, 23 and 29

Since many facilities are regulated under more than one Federal environmental law, please indicate the program or programs from which you desire to request records.

```
USTS, LUSTS, Spills, ISRA, Site Remediation, permits, ____
etc.
```

If you need database lists for a ZIP code area, please include the State and the needed databases. Please also indicate whether you would like these lists as a printout or on a diskette.

1

· 1

.

If the information you request is for a commercial use, EPA charges either \$4 per half hour or \$10 per half hour, depending on the technical expertise used. We also charge fifteen cents per page copied. To expedite processing, please indicate your willingness to pay reasonable fees (you may set a ceiling if you wish).

If	copyi	ng o	f f.	iles	is	necessary,	please	advise	in	
adv	ance	the	cos	t. Th	an}	c you.				

If you do not wish to request a fee waiver, jump to the end to submit this form.

If you wish to request a fee waiver, you must complete the following sections.

1. A clear statement of your interest in the requested documents, the use proposed for the documents and whether you will derive income or other benefits from such use.

2. A statement of how the public will benefit from such use and from the release of the requested documents.

3. If specialized use of the documents or information is contemplated, a statement of your qualifications that are relevant to the specialized use.

4. A statement indicating how you plan to disseminate the documents or information to the public.

•

5. Any additional information you deem relevant to your request for a fee waiver (e.g., Technical

Assistance Grant from EPA).

Send FOIA Request Reset

Return to FOIA Table of Contents

	NEW YORK STATE DEPARTMENT OF ENVIRONM APPLICATION FOR ACCESS TO (See Instructions on Reverse Side) RECORDS	NUMBER	
A P P L I C A N T	TO THE DEPARTMENT OF ENVIRONMENTAL CONSERVATION: I hereby annly to inspect the following records under the provisions of the Freedom of Information Law: Divisions of Air, Regulatory Affairs, Water, PBS, Solid Waste, HWR and HSR for properties located at: 137 - 145 Alexander Street 80, 86A, 86, 94 Alexander Street and 2 Ashburton Ave Yonkers, New York 10701 Yonkers, New York 10701 Section 2 Block 2615 Lots 1, 23 and 29 Section 2 Block 2608 Lots 29, 35 and 37 After inspection, should I desire copies of all or part of the records inspected, I will identify the records to be copied and hereby offer to promptly pay the established fees. (Cost of reproduction or 25¢ per page as applicable). Contact me if cost will exceed \$			
R E C O R D S C U S T O D I A N	 Records have been (partially, fully) provided expected to be fully provided:	THE APPLICANT: cords Provided The reproduction costs for the records provided are \$		
	Records Custodian Signature	TitleDa	18e	

PAULUS, SOKOLOWSKI AND SARTOR

KEYSPAN Business Solutions

1025 Old Country Road, Suite 420 Westbury, NY 11590 Tel 516 512-7300 Fax 516 512-7320 www.psands.com

November 6, 2006 03113.007.014

Mr. Alex Russel, Fire fighter City of Yonkers Fire Department Fire Prevention Office 5-7 New School Street Yonkers, New York 10701

Re: Sun Chemical Corporation 137-145 Alexander Street Yonkers, New York 10701 Section 2, Block 2615, Lots: 1, 23 and 29

> 80, 86A, 86, 94 Alexander Street and 2 Ashburton Avenue Yonkers, New York 10701 Section 2, Block 2608, Lots: 29, 35 and 37

Dear Mr. Russel:

Paulus, Sokolowski and Sartor (PS&S) is currently conducting a Phase I Environmental Site Assessment at the properties referenced above. PS&S would like to review site information and records related to aboveground and underground fuel oil tanks and/or any violations at these properties recorded by the City of Yonkers Fire Department.

PS&S requests the opportunity to schedule an appointment to review and copy applicable files.

Please feel free to contact me via telephone at 516-512-7370 if there are any questions or additional information needed.

Thank you in advance for your cooperation.

Very truly yours,

PAULUS, SOKOLOWSKI AND SARTOR

Dyane Benardos Environmental Planner/Staff Scientist

PAULUS, SOKOLOWSKI AND SARTOR

1025 Old Country Road, Suite 420 Westbury, NY 11590 Tel 516 512-7300 Fax 516 512-7320 www.psands.com

KEYSPAN Business Solutions

November 6, 2006 03113.007.014

Westchester County Department of Health Freedom of Information Office 145 Huguenot Street, 8th Floor New Rochelle, NY 10801

Re: Sun Chemical Corporation 137-145 Alexander Street Yonkers, New York 10701 Section 2, Block 2615, Lots: 1, 23 and 29

> 80, 86A, 86, 94 Alexander Street and 2 Ashburton Avenue Yonkers, New York 10701 Section 2, Block 2608, Lots: 29, 35 and 37

Dear Sir or Madam:

Paulus, Sokolowski and Sartor (PS&S) is currently conducting a Phase I Environmental Site Assessment at the properties referenced above. PS&S would like to review site information and records related to aboveground and underground fuel oil tanks and/or any violations at these properties recorded by the Westchester County Department of Health.

PS&S requests the opportunity to schedule an appointment to review and copy applicable files.

Please feel free to contact me via telephone at 516-512-7370 if there are any questions or additional information needed.

Thank you in advance for your cooperation.

Very truly yours,

PAULUS, SOKOLOWSKI AND SARTOR

Dyane Benardos Environmental Planner/Staff Scientist

ACCESS TO RECORDS DEPARTMENT OF HOUSING & BUILDINGS

NAME (individual requesting file) <u>Greg</u> (PROVIDE DRIVERS LICENSE FOR 1D	19. Cle Ilan ENTIFICATION	V PURPOS	ES)
TELEPHONE # 509 8612 BUSH			
ADDRESS YOU Nepperhan Ave	Sulte 220		
DATE <u>10-11-6</u>		10:2	~~
LOCATION 80/94 Alexander	57 BLOCK 5	1608	LOT 2 9 (3) - 3

Under the provisions of the New York Freedom of Information Law, Article 6 of the Public Officers and Sections 84-89, certain information and records are available for review.

THE REQUEST TO EXAMINE THE FILE FOR:

CERTIFICATE OF OCCUPANCY	7
PERMITS ISSUED	
VIOLATION NOTICE(s)	

REVIEW OF PLANS TITLE SEARCH SURVEY 2

NOTE: All information contained in the file not covered by the above Public Officers Law including inter-agency, intra-agency communications, or as listed in the above Law is not available for copying or review.

FEES:	Certificate of Occupancy/Completion	\$5.00
C.C.C.C.	Correspondence Copy (per page)	.25

REPRODUCTION OF PLANS:

Unless the plans contain references to alarm or security systems or if the plans are Copyrighted, they will be available for copying. Department of Buildings will measure the plans to be reproduced and advise you of the copying charge. Payment must be made by check before the plans will be copied. You will be called when plans are ready for pick up. If you are not the property owner, and the plans contain any of the exempted items, a notarized letter of authorization giving permission for plan reproduction is required.

IT IS ILLEGAL TO REMOVE ANY DOCUMENT, PLAN, SURVEY, <u>CERTIFICATE OF OCCUPANCY, OR CORRESPONDENCE FROM</u> THE FILE. THIS ACT IS SUBJECT TO LEGAL ACTION.

ACCESS TO RECORDS DEPARTMENT OF HOUSING & BUILDINGS

NAME (individual requesting file) <u>Grey MClella</u> (PROVIDE DRIVERS LICENSE FOR IDENTIFICATI	···1
(PROVIDE DRIVERS LICENSE FOR IDENTIFICATI	(ON PURPOSES)
TELEPHONE # <u>509</u> 8612 BUSINESS NAME_	PS#S
ADDRESS 470 Nepperhan Ave Smite	220
DATE 10-11-6 TIME	<u>2:00</u>
LOCATION 137 Alexander 57 BLOCK	- 2615 LOT 23

Under the provisions of the New York Freedom of Information Law, Article 6 of the Public Officers and Sections 84-89, certain information and records are available for review.

THE REQUEST TO EXAMINE THE FILE FOR:

CERTIFICATE OF OCCUPANCY		REVIEW OF PLANS	()
PERMITS ISSUED	(\checkmark)	TITLE SEARCH	(),
VIOLATION NOTICE(s)	()	SURVEY	$\langle Z \rangle$

NOTE: All information contained in the file not covered by the above Public Officers Law including inter-agency, intra-agency communications, or as listed in the above Law is not available for copying or review.

FEES:	Certificate of Occupancy/Completion	\$5.00
	Correspondence Copy (per page)	.25

REPRODUCTION OF PLANS:

Unless the plans contain references to alarm or security systems or if the plans are Copyrighted, they will be available for copying. Department of Buildings will measure the plans to be reproduced and advise you of the copying charge. Payment must be made by check before the plans will be copied. You will be called when plans are ready for pick up. If you are not the property owner, and the plans contain any of the exempted items, a notarized letter of authorization giving permission for plan reproduction is required.

IT IS ILLEGAL TO REMOVE ANY DOCUMENT, PLAN, SURVEY, <u>CERTIFICATE OF OCCUPANCY, OR CORRESPONDENCE FROM</u> THE FILE. THIS ACT IS SUBJECT TO LEGAL ACTION.



Region 2 Freedom of Information Act

Serving New Jersey, New York, Puerto Rico, US Virgin Islands and 7 Tribal Nations

Recent Additions | Contact Us | Print Version Search:

GO

EPA Home > Region 2 > FOIA > FOIA Response

FOIA Response

Thank you for your Freedom of information Act (FOIA) request. You will receive a formal acknowledgement including a request Identification Number (RIN) by surface mail within the next several days. Please cite the RIN in any future correspondence pertaining to this request. EPA has twenty working days in which to respond to your request. If you do not get an acknowledgement and RIN within ten working days, please contact Wanda Calderon at 212-637-3668.

EPA Home | Privacy and Security Notice | Contact Us

Last updated on Monday, March 13th, 2006 URL: http://www.epa.gov/region02/foia/foia_response.htm

Region 2 Home A to Z Index Recursos en Español

Newsroom

FOIA Home

FOIA Contacts

Submit a FOIA Request

Reading Room

Reference Guide

Annual Reports

Reference Materials

Related Programs

EPA Resources

Related Links



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY Region 2, 290 Broadway, 26th Floor New York, NY 10007 212-637-3668 212-637-5046 (fax) Calderon.Wanda@epa.gov

November 07, 2006

Ms. Dyane Benardos Paulus, Sokolowski & Sartor 1025 Old Country Road Suite 420 Westbury, NY, 11590 United States

RE: Request No: 02-RIN-00201-07

Dear Ms. Benardos,

This is to acknowledge receipt of your Freedom of Information Act (FOIA), 5 U.S.C. 552, request dated November 02, 2006 and received in this office on November 02, 2006, for records related to:

Multiple sites along Alexander Street & Ashburton Street all in Yonkers, NY

The program(s) office(s) that have been assigned this request will be responding to you directly. The Agency has twenty (20) working days to respond to your request, except when you have agreed to an alternate due date or unusual circumstances exist that would require an extension of time under 5 U.S.C. 552 (a) (6) (B).

Include your FOIA request number in all subsequent communications with respect to this assignment. Additionally, for faster processing you may provide your email address.

Thank you.

Respectfully,

Wanda Calderon FOIA Specialist



November 14, 2006

Re: Freedom of Information Act Request No.(02)RIN-0201-07

Subject:137; 145; 80; 86; 94; Alexander Street and 2 Ashburton Street, Yonkers, NY 10701

Dear FOIA Requester:

The subject site is not listed on the CERCLIS or NFRAP lists at the present time.

As of February 15, 1995, CERCLIS no longer includes sites which EPA has assessed and designated "No Further Remedial Action Planned" (NFRAP). A NFRAP designation means, to the best of EPA's knowledge, Superfund has completed its assessment at a site and determined no further steps would be taken to list this site on the National Priorities List (NPL) unless information is received at a later time indicating this decision was not appropriate. A NFRAP decision does not necessarily mean that there is no hazard associated with a given site; it means only that based upon available information, the location is not judged to be a potential NPL site.

Also, the absence of a facility from the CERCLIS list should not be construed as a determination by the EPA that the facility has not been affected by the presence of any hazardous waste. The absence of a facility from this list means that EPA has not received information indicating that there has been a release or threat of hazardous substances at or from the facility. Therefore, EPA has not performed an assessment at this location to date. As with any parcel of real property, EPA may be called upon to assess the property for a release of hazardous substances should conditions warrant.

In the interest of saving time and paper, I suggest that in the future you identify the specific properties you have an interest in by accessing the following web sites. The information available through these web sites should address any future inquires you may have.

This is the address for the Superfund Information Systems homepage http://www.epa.gov/superfund/sites. From this site you may obtain a list of all sites which are currently on the CERCLIS database and sites archived from CERCLIS. Additionally you can access the RODS database from here as well as download reports or order a variety of site information products on line. This is the site for the National Response Center maintained by the U.S. Coast Guard -<u>http://www.nrc.uscg.mil</u>. From this site you can access information regarding spills which have occurred from 1990 to the present.

This is the site for the National Technical Information Service maintained by the U.S. Department of Commerce - http://ntis.gov. From this site you can order subscription datafiles on CD-ROMs and diskettes which allow you to run your own CERCLIS reports.

If your request includes non-Superfund inquiries, copies of your letter have been sent to other EPA Program Offices for separate response.

Sincerely,

Cione: H Pitemer

Leslie H. Peterson, Chief Resource Management/Cost Recovery Section Emergency and Remedial Response Division

New York State Department of Environmental Conservation

Records Access Office, Region 3 21 South Putt Corners Road, New Paltz, New York 12561-1620 Phone: (845) 256-3052• FAX: (845) 255-3414 Website: www.dec.state.ny.us



NOVEMBER 9, 2006

DYANE BENARDOS PAULUS, SOKOLOWSKI & SARTOR 1025 OLD COUNTRY ROAD, SUITE 420 WESTBURY, NY 11590

RE: FOIL #1018-3/06 137-145 ALEXANDER STREET YONKERS AND 80, 86A, 86, 94 ALEXANDER STREET AND 2 ASHBURTON AVENUE YONKERS 10701 **POLYCHROME** DATE RECEIVED: NOVEMBER 9, 2006

DEAR DYANE BENARDOS:

This letter acknowledges receipt of your request for access to records under New York State's Freedom of Information Law (FOIL). Your request has been forwarded to T. Ghiosay, B. More of the Spill Prevention & Response, Hazardous Materials Programs, respectively. Within twenty (20) business days, you can expect a response from the regional program as to whether such documents are in their custody.

If programs have records, you will have an opportunity to arrange to obtain access to the records. There is no charge to review records or for copies of seven or fewer pages. By law, copy charges will not exceed 25 cents per page or the actual cost of copying. Photographs, maps, oversized documents, videotapes or audio tapes generally cost more than 25 cents per page to copy. You may be required to pay a deposit prior to copies being made and/or to pay all copy charges prior to copies being sent.

If all records are not provided because the records are excepted from disclosure, you will be notified of the reasons and of your right to appeal the determination.

We have enclosed spill reports from our Spill Prevention & Response Program. Please submit a check in the amount of \$4.25 payable to NYS DEC for copying charges of 17 pages @ .25 cents per page. We have enclosed a self-addressed envelope for your convenience in mailing in your payment.

If you have questions about the status of your request, you may write to this office at the above address or call (845) 256-3000 and follow instructions to reach the program contact person(s) noted in the first paragraph.

Region 3 Records Access Office

cc: T. Ghiosay, B. More



			NYSDEC SPI	LL REPORT FC				
DEC REGION	: 3			SPILL NUMBER	:	000778	8	
SPILL NAME:	VAULT 9	915		DEC LEAD:		mbmas	tro	
CALLER NAM	E: STEVE	EROMERO		NOTIFIER'S NAM	ИE:	STEVE R	OMERO	
CLR'S AGENC		DISON		NOTIFIER'S AGE	ENCY:	CON ED		
CALLER'S PH				NOTIFIER'S PHO	ONE:	(212) 580	-6763	
SPILL DATE:		10/02/2	000	SPILL TIME:		5:00 p	m	
CALL RECEN	VED DATE:	10/02/2	000	RECEIVED TIN	ΛE:	6:32 p	m	
			SPILL L	OCATION				
PLACE:	VAULT 991	5		COUNTY:		Westche	ster	
STREET:	STREET: 86 ALEXANDER ST		TOWN/CITY:		Yonkers		wm	
				COMMUNITY		YONKEF		
CONTACT:	STEVE RO	DMERO			IONE:	(212) 58	30-6763	
SPILL CAUS	SE:	nknown		SPILL REPOR	RTED E	3Y: Affecte	d Person	S
SPILL SOUI	RCE: Ur	nknown		WATERBODY	':			
133732 MATERIAL UNKNOWN PE	TROLEUM		CLASS Petroleum	SPILLED 0 G	REC 0 G	OVERED	RESOU Soil,	IRCES AFFECTE
		. <u></u>	POTENT	AL SPILLERS				
COMPANY			DRESS '*Update*** ZZ	· .		COI	NTACT	
	Tank Nu	ımber	Tank Size	Test Method	•••	Leak F	Rate	Gross Failure
DEC REMA Prior to	RKS: Sept, 2004 d	ata translatio	n this spill Lead_DE	C Field was "MASTRO				
PIN		<u>T & A</u>	COS	T CENTER		<u></u>		
CLASS: C4	CLC	OSE DATE:	10/03/2000	MEETS STANDA	RDS:	True		

۰

		NYSDEC SPI		ORM			
DEC REGION:	3		SPILL NUMBE	र:	0007916		
SPILL NAME:	VS 6478		DEC LEAD:		DXWEITZ	7	······································
CALLER NAME	: ANTHONY NATALE		NOTIFIER'S NA	ME:	JIM TRAYN	OR	··· ··································
CLR'S AGENC	1:CON ED		NOTIFIER'S AG	SENCY:	CON EDISC	DN	
CALLER'S PHO	NE: (212) 580-6763		NOTIFIER'S PH	ONE:	<u></u>		······
SPILL DATE:	10/05/2	000	SPILL TIME:		9:50 am		
CALL RECEIVI	ED DATE: 10/05/2	000՝	RECEIVED TI	ME:	<u>10:54 am</u>		······
		SPILL L	OCATION				
PLACE:	VS 6478		COUNTY:		Westcheste	er	
STREET:	86 ALEXANDER ST	,,,,,,,,,			Yonkers (c) YONKERS		
CONTACT:	CALLER		CONTACT P				
SPILL CAUSE	E: Unknown		SPILL REPO		X • Affected F	Persons	
SPILL SOUR	·····		WATERBOD				
CALLER REM caller repor callback ne	ting a spill of unk materia	I its a sheen clean	up pending lab result			- 	water no
UNKNOWN PETI	ROLEUM	Petroleum	0 G	0 G		oil,	
		POTENTI	AL SPILLERS				
COMPANY UNK		RESS UNK ZZ			CONTA UNK	ACT	
					(000) 0	000-000	
	Tank Number	Tank Size	Test Method		Leak Rate	e Gro	ss Failure
DEC REMARI Prior to Se	<s:< b=""> ept, 2004 data translation</s:<>	this spill Lead_DEC	Field was "WEITZ"				
PIN	<u>T & A</u>	COST	CENTER				
CLASS: C4	CLOSE DATE:	10/05/2000	MEETS STANDA	RDS:	True		





DEC REGION: SPILL NAME:		LT 9915			SPILL NUME DEC LEAD:	BER:	020208 dxtrave		
CALLER NAME CLR'S AGENC CALLER'S PHO	Y: C	ICHARD ROAC ON EDISON 12) 580-6763	CH .		NOTIFIER'S NOTIFIER'S NOTIFIER'S	AGENCY:	WALTEF CON ED		RMANN
SPILL DATE: CALL RECEIV	ED DA		9/2002 9/2002		SPILL TIM		4:10 a 4:17 a		
PLACE: STREET: CONTACT:		NDER ST/ASH	SPIL		ATION COUNTY: TOWN/CIT COMMUN CONTACT	ITY:	Westche Yonkers YONKEF	(c)	
SPILL CAUS SPILL SOUR	-	Equipment F Commercial/			SPILL REI WATERBO	PORTED B	Y: Respor	nsible Pa	arty
	r leake		0 gal water contain CLASS	ed in vau	IIT. SPILLED	REC	OVERED	RESO	JRCES AFFECTED
TRANSFORME	ROIL		Petroleum		1 G	0 G		Soil,	
COMPANY CON EDISON			POTEI DDRESS IRVING PLACE		SPILLERS	3	CON	ТАСТ	
							(212	2) 580-6	763
	Tanl	< Number	Tank Size	Τe	est Method		Leak R	ate	Gross Failure
	ept, 200		ion this spill Lead_ IP. NFA AT THIS T		d was "TRAVI	ER"			
<u>PIN</u>		<u>T & A</u>	<u>C</u> (OST CEI	ITER				
CLASS: D4	(CLOSE DATE:	05/29/2002	n	IEETS STAN	DARDS:	True		

4

(

.



DEC REGION	: 3		SPILL NUMBER	:	870087	<u>′9</u>	
SPILL NAME:	POLY-CHROME		DEC LEAD:		WEED		
CALLER NAM CLR'S AGENC CALLER'S PH	CY:		~	NOTIFIER'S NAME: NOTIFIER'S AGENCY:			
SPILL DATE:		1987	SPILL TIME:		4:40 p	m	
CALL RECEI	······································		RECEIVED TIN	ΛE:	5:10 p		
		SPILL I					
PLACE:	POLY-CHROME		COUNTY:		Westche	ster	
STREET:	80 ALEXANDER ST		TOWN/CITY:	:	Yonkers		
CONTACT:			CONTACT PH				· · · · · · · · · · · · · · · · · · ·
SPILL CAU		······································	SPILL REPOR		3Y: Federa	Il Governr	nent
CALLER RE MATERIAL UNKNOWN PE		CLASS Petroleum	SPILLED 0	REC 0	OVERED	RESOU Sewer,	RCES AFFECTED
		POTENT	IAL SPILLERS				
COMPANY POLY-CHRON		DRESS ME ZZ			COI	NTACT	
	Tank Number	Tank Size	Test Method		Leak F	Rate	Gross Failure
DEC REMA	RKS:						
<u>PIN</u>	<u>T&A</u>	cos	T CENTER				
CLASS:	CLOSE DATE:	05/07/1987	MEETS STANDA	RDS:	True		





DEC REGION:	3		SPILL NUMBE	R:	890505	53	
SPILL NAME:	HUDSON RIVER ST	ORM DRAIN	DEC LEAD:		tdghios	a	
CALLER NAME		ORP.	NOTIFIER'S NA NOTIFIER'S AG NOTIFIER'S PH	SENCY:		·····	
SPILL DATE:	08/22/	1989	SPILL TIME:	•	9:45 a	 m	
CALL RECEIV	;		RECEIVED T	IME:	12:59 p	· · ·	· · · · · · · · · · · · · · · · · · ·
PLACE: STREET: CONTACT:	HUDSON RIVER STOP		LOCATION COUNTY: TOWN/CITY COMMUNITY CONTACT P	Y:	Westche Yonkers YONKEF	(C)	······································
SPILL CAUS SPILL SOUR			SPILL REPO		BY: Affecte	d Perso	ns
CALLER REI FAXED TO	WARKS:) TODD GHIOSAY, WIL	L HANDLE					
MATERIAL UNKNOWN PET	ROLEUM	CLASS Petroleum	SPILLED 0 G	REC 0 G	OVERED	RESO SW,	URCES AFFECTE
		POTENT	IAL SPILLERS				
COMPANY		DRESS **Update*** ZZ			CON	NTACT	
	Tank Number	Tank Size	Test Method		Leak R	late	Gross Failure
/ / : NC	ept, 2004 data translatic DISCHARGE WAS NC This is additional inforr	TICED AT TIME OF	INDPECTION N.F.A.			ill file: V	VHITE MILKY
<u>PIN</u>	<u>T & A</u>	cos	T CENTER	·			
CLASS:	CLOSE DATE:	08/23/1989	MEETS STAND	ARDS:	True		

NYSDEC SPILL	REPORT FO	DRM
--------------	-----------	-----



DEC REGION:	3		SPILL NUMBE	R:	8905788	8	
SPILL NAME:			DEC LEAD:		tdghiosa	3	
CALLER NAME:	NICK RELLA		NOTIFIER'S NA	AME:			
CLR'S AGENCY	POLYCHROME		NOTIFIER'S AG	SENCY:			
CALLER'S PHO	NE: (914) 378-4512		NOTIFIER'S PH	IONE:			
SPILL DATE:	09/12	/1989	SPILL TIME:		<u>11:00 a</u>	m	
CALL RECEIVE	D DATE: 09/12	/1989	RECEIVED T	IME:	<u>3:37 pn</u>	n	
		SPILL	LOCATION				
PLACE:			COUNTY:		Westches	ster	
STREET:	137 ALEXANDER ST				Yonkers (YONKER		
CONTACT:			CONTACT P	HONE:			
SPILL CAUSE	: Unknown		SPILL REPO	RTED E	Y: Affected	l Person	s
SPILL SOURC			WATERBOD	Y:	HUDSO	N RIVE	۲
DISCHARG	ING MATERIAL INTO		SCENE AND BELIEV	ING. W	CHD IS DIE	TESTIN	IG. WCHD ALSO
DISCHARG	BILL SCHNEIDER OF ING MATERIAL INTO CESARE MANFREDI.	SEWER LINE THE	SCENE AND BELIEV CORRODES THE PIP SPILLED 0 G	ing. Wo	OVERED	TESTIN	RCES AFFECTE
DISCHARG CONTACT	ING MATERIAL INTO	SEWER LINE THE CLASS Petroleum	CORRODES THE PIP	ING. WO	OVERED	RESOU	IG. WCHD ALSC
DISCHARG CONTACT	ING MATERIAL INTO CESARE MANFREDI.	SEWER LINE THE CLASS Petroleum	CORRODES THE PIP SPILLED 0 G	ING. WO	CHD IS DIE	RESOU	IG. WCHD ALSC
DISCHARG CONTACT MATERIAL Diesel	ING MATERIAL INTO CESARE MANFREDI.	CLASS Petroleum POTENT	CORRODES THE PIP SPILLED 0 G	ING. WO	CHD IS DIE	TESTIN RESOU SW, TACT	IG. WCHD ALSC
DISCHARG CONTACT MATERIAL Diesel COMPANY DEC REMARK Prior to Se 03/11/91: 1	ING MATERIAL INTO CESARE MANFREDI AI Tank Number (S: opt, 2004 data translati	CLASS Petroleum POTENT DRESS ***Update*** ZZ Tank Size on this spill Lead_DE EPLACED AND DEF	CORRODES THE PIP SPILLED 0 G	1NG. W(REC 0 G	OVERED	TESTIN RESOU SW, TACT	IG. WCHD ALSC

		NYSDE	C SPILL REPORT FORM	1	
DEC REGION: SPILL NAME:	3		SPILL NUMBER: DEC LEAD:	8905788 tdghiosa	
PIN	<u>T & A</u>		COST CENTER		
CLASS: D5	CLOSE DATE:	03/11/1991	MEETS STANDARDS:	True	
· .					
		1			



4



	Tank Number	Tank Size	Test Method	Leak	Rate	Gross Failure
COMPANY UNKNOWN	AD	DRESS NY		co	NTACT	
		POTENT	IAL SPILLERS			
MATERIAL UNKNOWN MAT	ſERIAL	CLASS Other	SPILLED 0 G	RECOVERED 0 G	RESOL SW,	JRCES AFFECTE
WHEN RE	PORT SEEN-MR BRAD)LEYS PAGER# (914				
YONKERS	JAIL. BEHIND SOCIAL	SERVICES BLDG-0	CALLER WAS 800 FT II	NAIR		
YARD SHE	EEN ON RIVER EMENA	TING IKN AREA-LA	NDMARKS-ACROSS S	T FROM		
CALLER REN CALLER W	MARKS: VAS FLYIONG OVERHI	EAD IN HELICOPOT	ER WHEN NOTICED A	60 x 40		
SPILL SOUR	CE: Unknown		WATERBODY	: HUDS	ON RIVE	R
SPILL CAUS	E: Unknown			TED BY: Local		
CONTACT:	FRANK BRADLEY		CONTACT PH	ONE: (914) 2	85-3364	
STREET:	137 ALEXANDER ST		COMMUNITY:			
PLACE:	SHEEN ON HUDSON I	RIVER	COUNTY: TOWN/CITY:	Westche Yonkers		
			OCATION			
CALL RECEIV	ED DATE:07/23/	1997	RECEIVED TIM	1 Ε: <u>7:33 β</u>	om	
SPILL DATE:	07/23/	1997	SPILL TIME:	7:33 p	om	
CALLER'S PHO	DNE: (914) 285-3364		NOTIFIER'S PHC	DNE:		
CLR'S AGENC				NCY:		
CALLER NAME	: FRANK BRADLEY	·	NOTIFIER'S NAM	NE:		
SPILL NAME:	SHEEN ON HUDSOI	N RIVER	DEC LEAD:	tdghio	sa	
DEC REGION:	3					

AREA LOCKED FENCING ALONG RIVERSIDE; ATI TERMINAL ON

ALEXANDER ST. WCHD WILL FOLLOW UP DURING DAYLIGHT HOURS

AND FORWARD REPORT TO DEC;



3

NYSDEC SPILL REPORT FORM



DEC REGION: SPILL NAME:

SHEEN ON HUDSON RIVER

SPILL NUMBER: DEC LEAD: 9704871 tdghiosa

07/24/97 FRANK BRADLEY INVESTIGATED FURTHER AND FOUND NOTHING;

MAY GO BACK AT LOW TIDE TO CHECK FOR SBMERGED PIPELINE;

<u>PIN</u>		<u>T & A</u>		COST CENTER	
· .					
CLASS:	B3	CLOSE DATE:	07/24/1997	MEETS STANDARDS:	True

- ·

Created On: 07/23/1997 Date Printed: 11/9/2006



DEC REGION:	3		SPILL NUMBER:	9809331	
SPILL NAME:	VAULT 9915		DEC LEAD:	tdghiosa	
CALLER NAME	E: ERNIE ROWLAND)	NOTIFIER'S NAME:	MR DIXON	
CLR'S AGENC	Y: CON EDISON		NOTIFIER'S AGENCY:	CON EDISON	
CALLER'S PHO	ONE: (212) 580-6763		NOTIFIER'S PHONE:	(914) 925-6205	
SPILL DATE:	10/26/	1998	SPILL TIME:	12:10 pm	
CALL RECEIV	ED DATE: 10/26/1	1998	RECEIVED TIME:	2:45 pm	
		SPILL L	OCATION		
PLACE:	VAULT 9915		COUNTY:	Westchester	
STREET:	ALEXANDER ST/ASH I	BURTON	TOWN/CITY: COMMUNITY:	Yonkers (c) YONKERS	
CONTACT:	ERNIE ROWLAND		CONTACT PHONE:	(212) 580-6763	
SPILL CAUS	E: Unknown		SPILL REPORTED E	SY • Other	
SPILL CAUS			WATERBODY:		
ED 120-82	F PETROLUEM BASED	CLASS		OVERED RESO	OF LABS. CON
UNKNOWN PET	FROLEUM	Petroleum	10 G 0 G	Soil,	
		POTENTI	<u>AL SPILLERS</u>		
COMPANY UNKNOWN	AD	DRESS NY		CONTACT	
	Tank Number	Tank Size	Test Method	Leak Rate	Gross Failure
DEC REMAR Prior to S	RKS: Sept, 2004 data translatic	n this spill Lead_DE	C Field was "GHIOSAY"		
<u>PIN</u>	<u>T & A</u>	<u>COS</u>	T CENTER		
CLASS: C4	CLOSE DATE:	10/22/2004	MEETS STANDARDS:	False	





	Tank Number	Tank Size					Ginee Failur
			e Test Method		(21: 	2) 580-67	763 Gross Failur
COMPANY CON EDISON		ADDRESS 4 IRVING PLACE	MANHATTAN NY		ERI	NTACT	
		POTE	NTIAL SPILLERS				
MATERIAL UNKNOWN MAT	ERIAL	CLASS Other	SPILLED 1 G	REC 0 G	OVERED	RESOL Soil,	JRCES AFFEC
REPORTE	D IN SPILL # 9809	331. NO CALL BACH	REQUESTED.				
CON EDISC	ON REFER # 1208	324. THIS VAULT IS	ADJACENT TO VAULT	·			
DISCOVER	Y OF RESULTS.	RESPONSABLE PAF	RTY IS UNKNOWN.				
			AT ABOVE LOCATION.				
CALLER REN	IARKS:				· ·		
SPILL SOUR	~	cial/Industrial	WATERBOD				<u> </u>
SPILL CAUSE			SPILL REPO	· · · · · · · · · · · · · · · · · · ·			artv
CONTACT:	ERNIE ROWLAN	D	COMMONT			30-6763	, , , , , , , , , , , , , , , , ,
STREET:	ALEXANDER ST//	ASHBURTON AV	TOWN/CITY		Yonkers		
PLACE:	JACOBELLIS	<u>SPI</u>	LL LOCATION COUNTY:		Westche	ster	
CALL RECEIVE	ED DATE:	0/26/1998	RECEIVED T	IME:	<u>3:17 p</u>	m	
SPILL DATE:	1	0/26/1998	SPILL TIME:		2:30 p	m	
CALLER'S PHO	NE: (212) 580-676	33	NOTIFIER'S PI	IONE:	(914) 928	5-6211	
CLR'S AGENCY	·		NOTIFIER'S A	GENCY:	CON ED	SON	
CALLER NAME	: ERNIE ROW	LAND	NOTIFIER'S N	AME:	MR DIXC)N	
SPILL NAME:	JACOBELLIS		DEC LEAD:		tdghios	a	· · · · · · · · · · · · · · · · · · ·

This spill was updated 08/11/2004 from info in V. McCabe's data files. 'Date:' = 10/26/98, 'Phone' = --, 'Site Insp' = 10-27;D.W..

		NYSDEC SPILL REPORT		
DEC REGION:	3	SPILL NUME	BER: 9809335	
SPILL NAME:	JACOBELLIS	DEC LEAD:	tdghiosa	
PIN	<u>T & A</u>	COST CENTER		
CLASS: C3	CLOSE DATE: 1	1/07/2002 MEETS STAN	DARDS: False	





DEC REGION:	3		SPILL NUMBER:	990985	7	
SPILL NAME:	VAULT #6478		DEC LEAD:	jbodee		
CALLER NAM	E: RICHARD ROACH	· · · · · · · · · · · · · · · · · · ·	NOTIFIER'S NAME:	NATE MC	ORE	
CLR'S AGENC			NOTIFIER'S AGENCY:	CON EDI	SON	
	ONE: (212) 580-6763		NOTIFIER'S PHONE:	(212) 580	-6763	
SPILL DATE:		1999	SPILL TIME:	10:25 a	m	
CALL RECEIV	/ED DATE: 11/14/	1999	RECEIVED TIME:	<u>12:03 p</u>	m	
		SPILL L	OCATION			
PLACE:	VAULT #6478		COUNTY:	Westche	ster	
STREET:	ALEXANDER ST/ASHE	BURTON AV		Yonkers		
CONTACT:	RICHARD ROACH		CONTACT PHONE:			
SPILL CAUS	E: Unknown		SPILL REPORTED	BY: Affected	d Person:	5
SPILL SOUR			WATERBODY:	- <u>, ; ; ;</u>		-
CON ED# MATERIAL UNKNOWN PE COMPANY UNKNOWN	TROLEUM	CLASS Petroleum POTENTI DRESS NY	SPILLED REC 1 G 0 G AL SPILLERS		RESOU Soil, ITACT	RCES AFFECTED
	Tank Number	Tank Size	Test Method	Leak R	ate	Gross Failure
DEC REMAI Prior to S	RKS: Sept, 2004 data translatio	on this spill Lead_DEC	Field was "O'DEE"			
PIN	<u>T & A</u>	COST	CENTER			
CLASS: C4	CLOSE DATE:	11/17/1999	MEETS STANDARDS:	True		

4





DEC REGION:	3		SPILL NUMBER:	9909858	
SPILL NAME:	POLY CHROME CC	RP	DEC LEAD:	jbodee	
CALLER NAM	E: STEVE ROMERC	}	NOTIFIER'S NAME:	MOORE	
CLR'S AGENC	Y: CON EDISON		NOTIFIER'S AGENCY:	CON ED	
CALLER'S PH	ONE: (212) 580-6763		NOTIFIER'S PHONE:		
SPILL DATE:	11/14	/1999	SPILL TIME:	10:25 am	
CALL RECEIV	/ED DATE:11/14	/1999	RECEIVED TIME:	<u>12:11 pm</u>	
<u></u>		SPILL	LOCATION		
PLACE:	POLY CHROME COR	P	COUNTY:	Westchester	
STREET:	ALEXANDER ST/ASH	BURTON AV	TOWN/CITY: COMMUNITY:	Yonkers (c) YONKERS	
CONTACT:	STEVE ROMERO		CONTACT PHONE:		763
SPILL CAUS	E: Unknown		SPILL REPORTED I	BY: Responsible	e Party
SPILL CAUG	······································	ndustrial	WATERBODY:		
MATERIAL UNKNOWN PET	FROLEUM	CLASS Petroleum	SPILLED REC 1 G 0 G		SOURCES AFFECTED
		POTENT	IAL SPILLERS		
COMPANY CON EDISON		DRESS	W YORK NY 10003	CONTAC	ст
<u></u>	Tank Number	Tank Size	Test Method	Leak Rate	Gross Failure
DEC REMAR Prior to S	RKS: Sept, 2004 data translati	on this spill Lead_DE	C Field was "O'DEE"		
PIN	<u>T & A</u>	<u>C08</u>	ST CENTER		
CLASS: C4					
	CLOSE DATE:	11/17/1999	MEETS STANDARDS:	True	

		NYSDEC SP	ILL REPORT FOR	M	
DEC REGION: 3			SPILL NUMBER:	8803623	
SPILL NAME: PC	EY CHROME PL	<u>NT</u>	DEC LEAD:	SLINGERLAN	ID
CALLER NAME:	NICK RELLA		NOTIFIER'S NAME:		
CLR'S AGENCY:	POLLY CHROME		NOTIFIER'S AGENC	Y:	
CALLER'S PHONE:	(914) 378-4512		NOTIFIER'S PHONE	E:	-
SPILL DATE:	07/26/	1988	SPILL TIME:	3:00 pm	
CALL RECEIVED D	ATE: 07/26/	1988	RECEIVED TIME:	5:31 pm	
		SPILL I	OCATION		
PLACE: POLY	CHROME PLAN		COUNTY:	Westchester	
STREET: 2 AS	HBURTON AVE		TOWN/CITY:	Yonkers (c)	
			COMMUNITY:	YONKERS	······
CONTACT:			CONTACT PHON	E:	
SPILL CAUSE:	Human Error		SPILL REPORTE	D BY: Responsible F	arty
SPILL SOURCE:	Commercial/Ir	Idustrial	WATERBODY:		-
CALLER REMARK NO ACTION -HA 9:05 AM 7/27. C/ SOME ON IT. NI MATERIAL	AD GONE INTO Y	ONKERS SEWER S SWERING MACHIN CLASS	YSTEM CALLED DOT ANS E AGAIN CALLED B. SCHI SPILLED RI	WERING MACHINE NEIDER OF WCHD. ECOVERED RESO	HE WILL SEND
		POTENT	AL SPILLERS		
COMPANY		DRESS **Update*** ZZ		CONTACT	
Tar	ak Number	Tank Size	Test Method	Leak Rate	Gross Failure
DEC REMARKS:					
PIN	<u>T & A</u>	<u>cos</u> -	<u>r center</u>		
CLASS: C3	CLOSE DATE:	08/03/1988	MEETS STANDARDS	: True	

1

		NYSDEC SP		ORM		
DEC REGION:	3		SPILL NUMBER	R: 8807	7603	•
SPILL NAME:	POLYCHROME COR	P	DEC LEAD:	tdgh	iosa	
CALLER NAME:	NICK RELLA		NOTIFIER'S NA	ME:		······································
CLR'S AGENCY	POLYCHROME		NOTIFIER'S AG	ENCY:		
CALLER'S PHO	NE <u>: (</u> 914) 378-4512		NOTIFIER'S PH	ONE:		
SPILL DATE:	12/15/1	988	SPILL TIME:	12:3	0 pm	
CALL RECEIVE	DATE: 12/16/1	988		ME: <u>9:25</u>	5 am	
		<u>SPILL L</u>	OCATION			
PLACE:	POLYCHROME CORP		COUNTY:	Westo	hester	
STREET:	2 ASHBURTON AVE		TOWN/CITY: COMMUNITY			
CONTACT:			CONTACT PI			
SPILL CAUSE	: Unknown		SPILL REPO	RTED BY: Res	onsible F	Partv
SPILL SOURC		dustrial	WATERBOD	·		
CALLER REM C&E ENVIR REMEDIAT	OMENTAL PULLING T	ANKS #2 FUEL SEE	EPING INTO HOLE TO	DDD GHIOSAY	WILL AD'	VISE ON
MATERIAL #2 Fuel Oil		CLASS Petroleum	SPILLED 0 G	RECOVERE 0 G	D RESC GW,	URCES AFFECTED
		POTENTI	AL SPILLERS			
COMPANY SAME		DRESS NY		C	ONTACT	
····	Tank Number	Tank Size	Test Method	Leat	Rate	Gross Failure
DEC REMARK Prior to Se	(S: pt, 2004 data translatior	n this spill Lead_DEC	C Field was "GHIOSA)	ZH.		
<u>PIN</u>	<u>T & A</u>	COST	CENTER			
CLASS:	CLOSE DATE:	11/28/1989	MEETS STANDA	RDS: True		

S. S



DEC REGION:	3		SPILL NUMBER:	90037	9003703		
SPILL NAME: POLYCHROME INC			DEC LEAD:	tdghio	tdghiosa		
CALLER NAMI CLR'S AGENC CALLER'S PHO			NOTIFIER'S AGE	NOTIFIER'S NAME: NOTIFIER'S AGENCY:			
SPILL DATE: CALL RECEIV	07/02/ ⁻ /ED DATE: 07/02/-		SPILL TIME: RECEIVED TIM	2:30 p E: 4:03 p			
PLACE:	POLYCHROME INC	SPILL	LOCATION COUNTY:	Westche	ester		
STREET: CONTACT:			TOWN/CITY: COMMUNITY: CONTACT PHO	YONKEI	Yonkers (c) YONKERS		
	SPILL CAUSE: Other SPILL SOURCE: Commercial/Industrial			SPILL REPORTED BY: Responsible Party WATERBODY:			
			AN ONTO CONCRETE I NATED MATERIAL	LOOR AND ST	REET EMPLOYEES		
MATERIAL UNKNOWN PET	ROLEUM	CLASS Petroleum	SPILLED 40 G	RECOVERED 0 G	RESOURCES AFFECTED Air,		
	ROLEUM	Petroleum					
	ADI	Petroleum	40 G	0 G			
UNKNOWN PET	ADI	Petroleum <u>POTENT</u> DRESS	40 G	0 G	Air, NTACT		
UNKNOWN PET COMPANY SAME DEC REMAR Prior to S	ADI Tank Number	Petroleum POTENT DRESS NY Tank Size n this spill Lead_DE	40 G TIAL SPILLERS Test Method	0 G COI	Air, NTACT		
UNKNOWN PET COMPANY SAME DEC REMAR Prior to S	ADI Tank Number KS: ept, 2004 data translation	Petroleum POTENT DRESS NY Tank Size n this spill Lead_DE BE CLEANED UP.	40 G TIAL SPILLERS Test Method	0 G COI	Air, NTACT		
UNKNOWN PET COMPANY SAME DEC REMAR Prior to S 07/25/90:	ADI Tank Number RKS: ept, 2004 data translation SPILL REPORTED TO <u>T & A</u>	Petroleum POTENT DRESS NY Tank Size n this spill Lead_DE BE CLEANED UP.	40 G TIAL SPILLERS Test Method C Field was "GHIOSAY" NO RESONSE BY DEC.	0 G COf	Air, NTACT		

.

New York State Department of Environmental Conservation SOLID & HAZARDOUS MATERIALS, Region 3

21 South Putt Corners Road, New Paltz, New York 12561-1620 Phone: (845) 256-3127 • FAX: (845) 255-3414 Website: www.dec.state.ny.us



November 13, 2006

DYANE BENARDOS PAULUS, SOKOLOWSKI & SARTOR 1025 OLD COUNTRY ROAD, SUITE 420 WESTBURY, NY 11590

RE: FOIL # 1018-3/06 137-145 ALEXANDER STREET YONKERS AND 80 80A, 86, 94 ALEXANDER STREET AND 2 ASHBURTON AVENUE YONKERS 10701 **POLYCHROME**

Dear Dyan Benardos:

The program noted below has reviewed your request for the above referenced records under New York State's Freedom of Information Law (FOIL). Please note that most of our records are filed by number under the names of individuals or corporations. We have no way of locating or retrieving records if they are filed under names or addresses other than those you have provided. If no records have been located, this does not necessarily mean, and should not be interpreted to mean that there have never been any violations, complaints, claims, investigations or inquiries involving those names or addresses. We cannot make any representations as to whether there are or have been any such violations, complaints, claims, investigations or inquiries.

Records are available for review and/or copying. Please contact the FOIL Secretary at (845) 256-3021 to schedule an appointment to review the records. There is no charge to review records or for copies of seven or fewer pages. By law, copy charges will not exceed 25 cents per page or the actual cost of copying. Photographs, maps, oversized documents, videotapes or audio tapes generally cost more than 25 cents per page to copy. You may be required to pay a deposit prior to copies being made and/or to pay all copy charges prior to copies being sent.

Please note there are approximately 1.5 inches of records responsive to this request. This may require a deposit of \$60 if you wish to have all of the records copied without first reviewing the records. Please inform us of how you wish to proceed.

Very truly yours, Maryanne O'Connor Solid & Hazardous Materials Region 3



Andrew J. Spano County Executive

1

Department of Health

Joshua Lipsman, M.D., J.D., M.P.H. Commissioner

November 13, 2006

Paulus, Sokolowski and Sartor 1025 Old Country Road Suite 420 Westbury, NY 11590 Att: Dyane Benardos

> Re: Freedom of Information Request No. 0472 Sun Chemical Corporation 137-145 Alexander Street

> > 80, 86A, 86, 94 Alexander Street 2 Ashburton Avenue Yonkers, New York 10701

Dear Ms. Benardos:

This is to acknowledge the receipt of your Freedom of Information request dated November 6, 2006 which was received in this office on November 13, 2006.

Your request has been forwarded to the appropriate staff for response; it is anticipated that you will have a response to your request by December 6, 2006.

If you need to communicate with us in the future, please use the "Request Number indicated above. The FOIL office number is: (914) 813-5004. Thank you.

Sincerely, Lach 14

Mary Landrigan Freedom of Information Officer

ML/ns

APPENDIX D

Sanborn Maps



"Linking Technology with Tradition"®

Sanborn® Map Report

Ship To:	Dyane Ben	ardos	Order Dat	te: 10/31/2	2006 Completion Date: 10/31/2006
	Paulus Sok	olowski &	Inquiry #:	: 178487	7.38
	67 Mountai	n Boulevard	P.O. #:	NA	
	Warren, NJ 07059		Site Name	e: Sun Ch	emical Corporation
			Ac	ddress:	Alexander Street/Ashburton Avenue
Custome	Project:	Sun Chemical Co	Ci	ty/State:	Yonkers, NY 10701
1019194TV	VC	732-560-9700	Cr	ross Stree	ets:

Based on client-supplied information, fire insurance maps for the following years were identified

1886 - 2 Maps	1978 - 2 Maps
1898 - 1 Map	1989 - 2 Maps
1917 - 1 Map	1990 - 1 Map
1942 - 2 Maps	1991 - 2 Maps
1951 - 1 Map	
1956 - 1 Map	
1957 - 2 Maps	
1973 - 1 Map	

Limited Permission to Photocopy

Total Maps: 18

Paulus Sokolowski & Sartor (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report AS 15. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission. EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

USER'S GUIDE

This User's Guide provides guidelines for accessing Sanborn Map® images and for transferring them to your Word Processor.

Reading Sanborn Maps

Sanborn Maps document historical property use by displaying property information through words, abbreviations, and map symbols. The Sanborn Map Key provides information to help interpret the symbols and abbreviations used on Sanborn Maps. The Key is available from EDR's Web Site at: http://www.edrnet.com/reports/samples/key.pdf

Organization of Electronic Sanborn Image File

- Sanborn Map Report, listing years of coverage
- User's Guide
- Oldest Sanborn Map Image
- Most recent Sanborn Map Image

Navigating the Electronic Sanborn Image File

- 1. Open file on screen.
- 2. Identify TP (Target Property) on the most recent map.
- Find TP on older printed images. 3.
- Using Acrobat® Reader®, zoom to 250% in order to view more 4 clearly. (200-250% is the approximate equivalent scale of hardcopy Sanborn Maps.)
 - A. On the menu bar, click "View" and then "Zoom to..."
 - B. Or, use the magnifying tool and drag a box around the TP

Printing a Sanborn Map From the Electonic File

- EDR recommends printing images at 300 dpi (300 dpi prints faster than 600 dpi)
- To print only the TP area, cut and paste from Acrobat to your word processor application.

Acrobat Versions 6 and 7

- 1. Go to the menu bar
- 2. Click the "Select Tool"
- 3. Draw a box around the area selected
- 4. "Right click" on your mouse
- 5. Select "Copy Image to Clipboard"
- 6. Go to Word Processor such as Microsoft Word, paste and print.

Acrobat Version 5

- 1. Go to the menu bar
- 2. Click the "Graphics Select Tool"
- 3. Draw a box around the area selected
- 4. Go to "Menu"
- 5. Highlight "Edit"
- 6. Highlight "Copy"
- 7. Go to Word Processor such as Microsoft Word, paste and print.


Important Information about Email Delivery of Electronic Sanborn Map Images


- Images are grouped intro one file, up to 2MB.
- In cases where in excess of 6-7 map years are available, the file size typically exceeds 2MB. In these cases,
- you will receive multiple files, labeled as "1 of 3", "2 of 3", etc. including all available map years. Due to file size limitations, certain ISPs, including AOL, may occasionally delay or decline to deliver files. Please contact your ISP to identify their specific file size limitations.










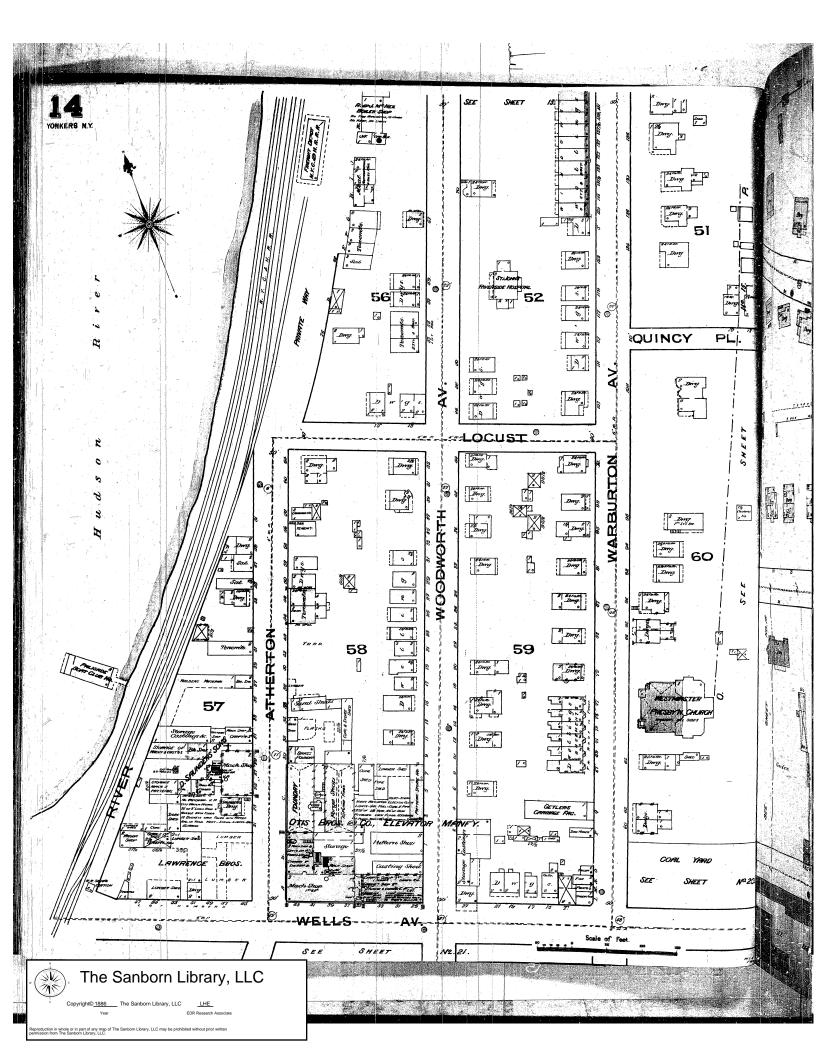

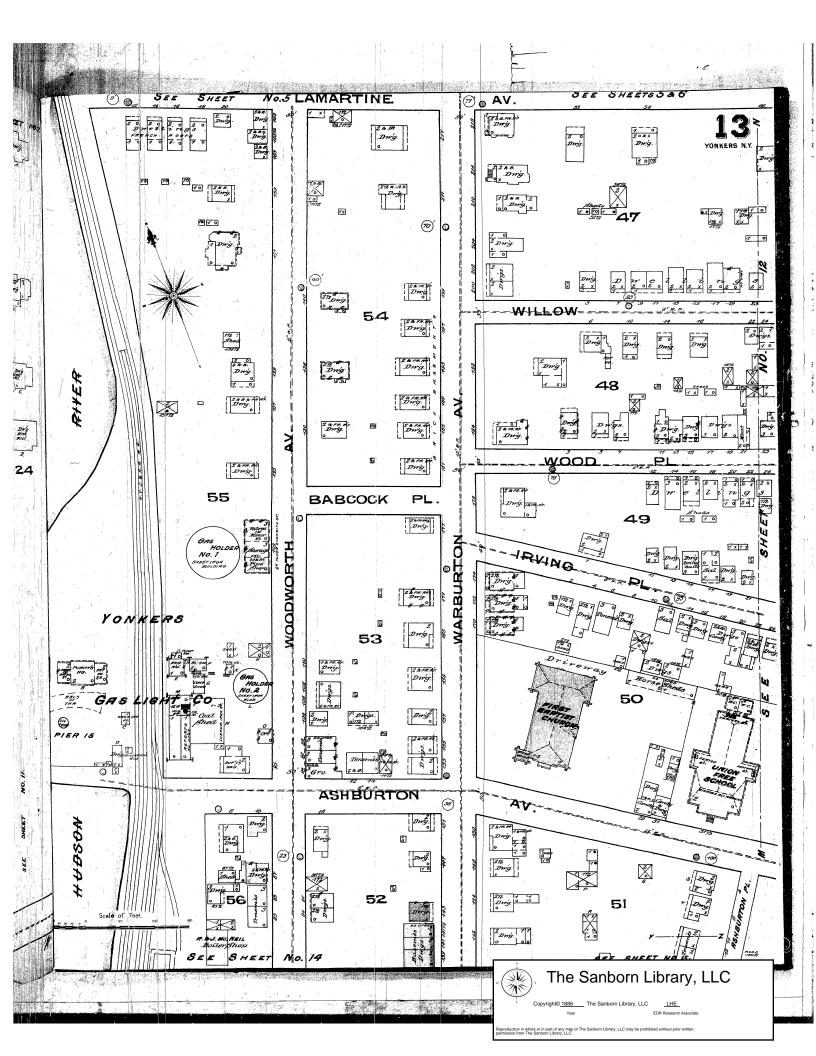

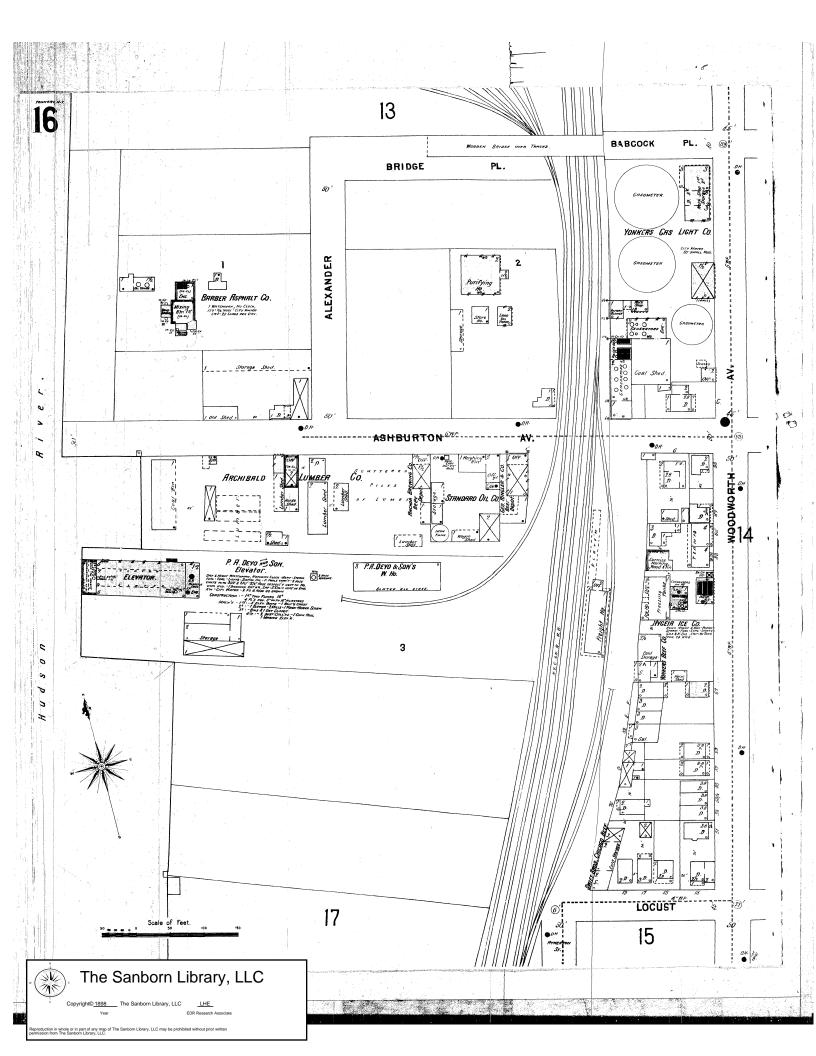

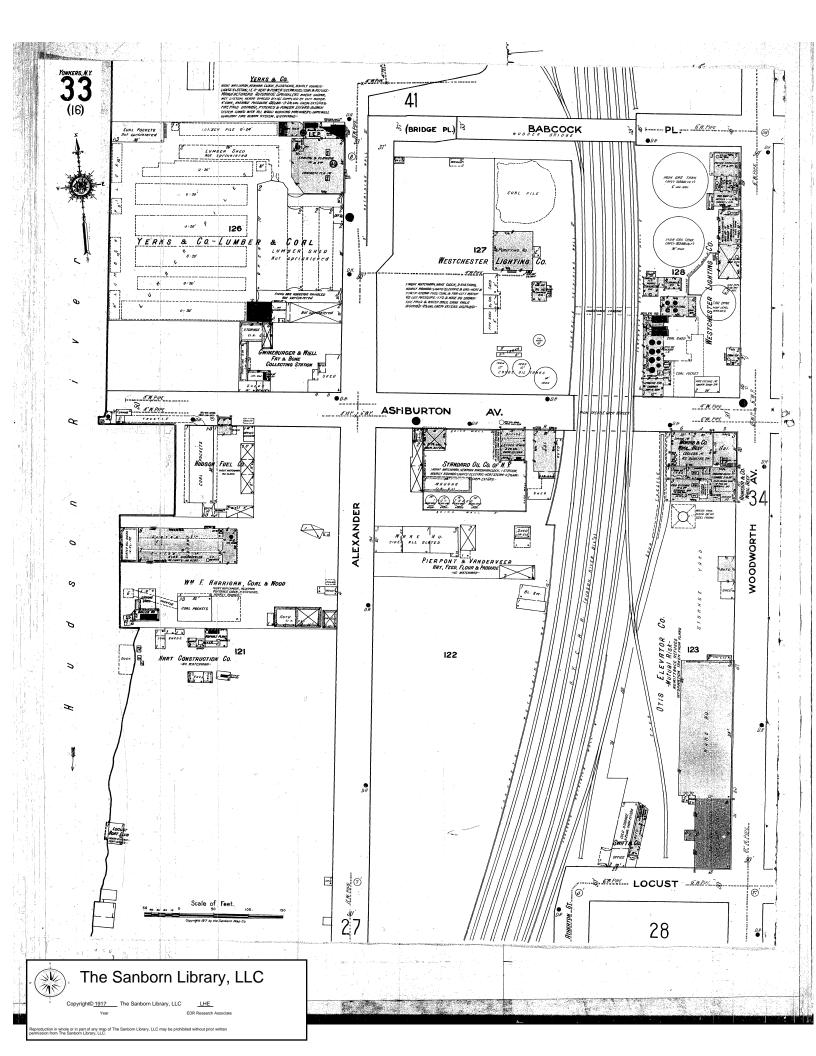


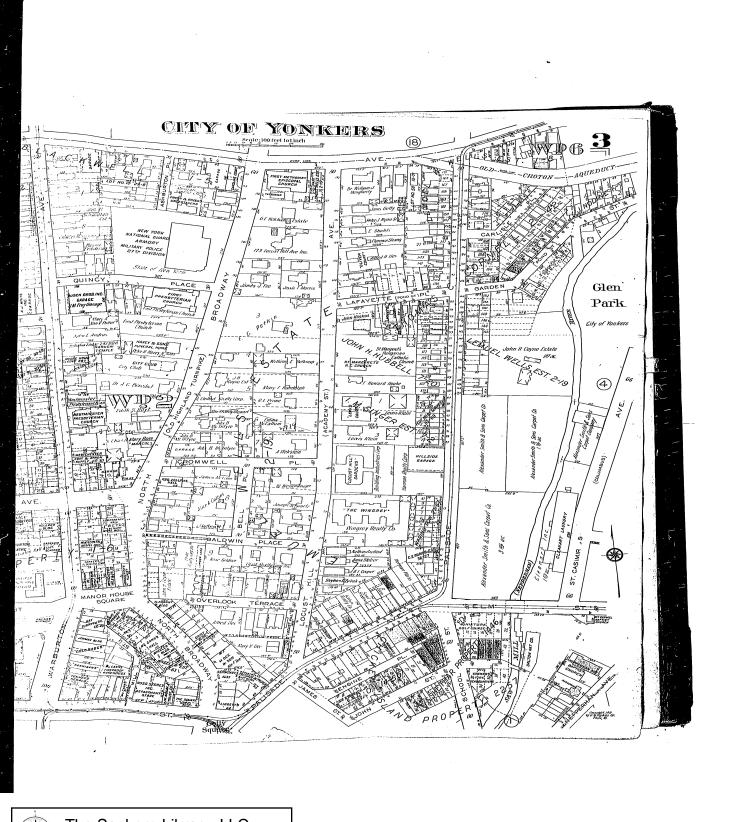

 Copyright@ 1942
 The Sanborn Library, LLC

 Year
 EDR Research Associate

 production in whole or in part of years of The Sanborn Library, LLC may be purchased webout prior written

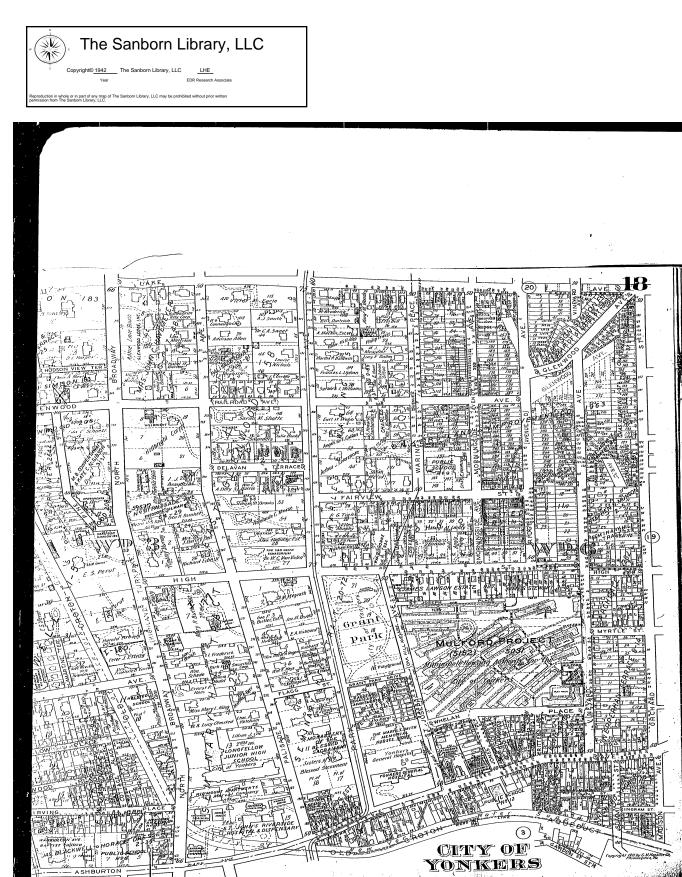


YONKERS


PUBLIC S

ASHBURTON


١ſ


7 Г

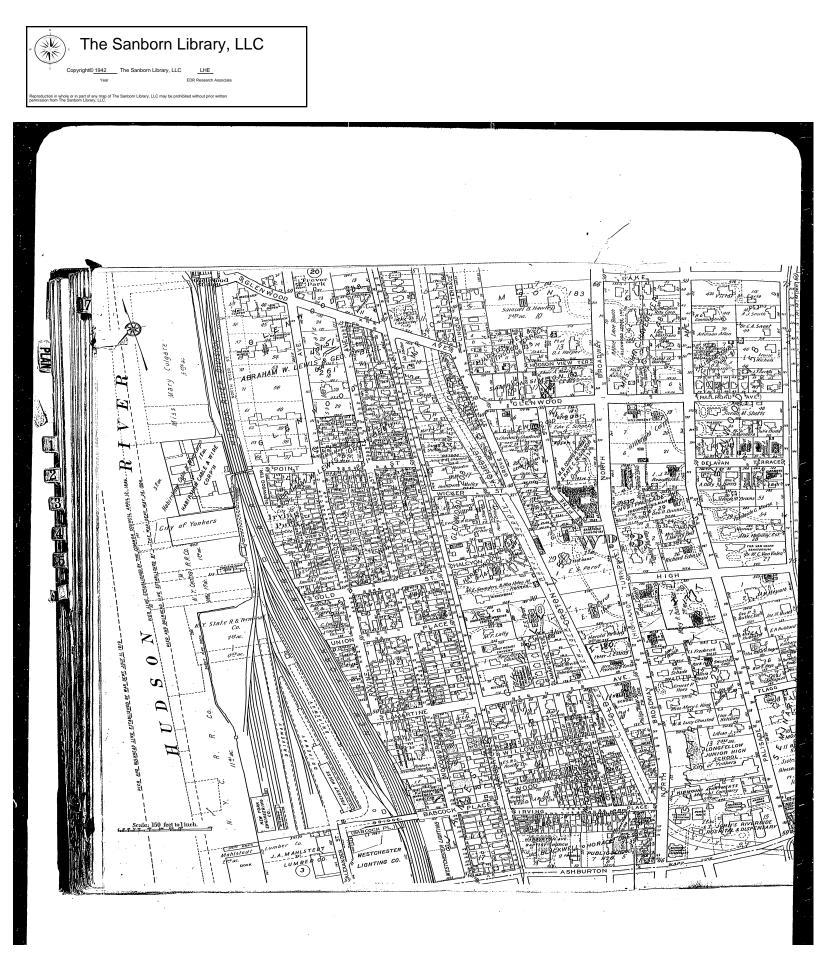

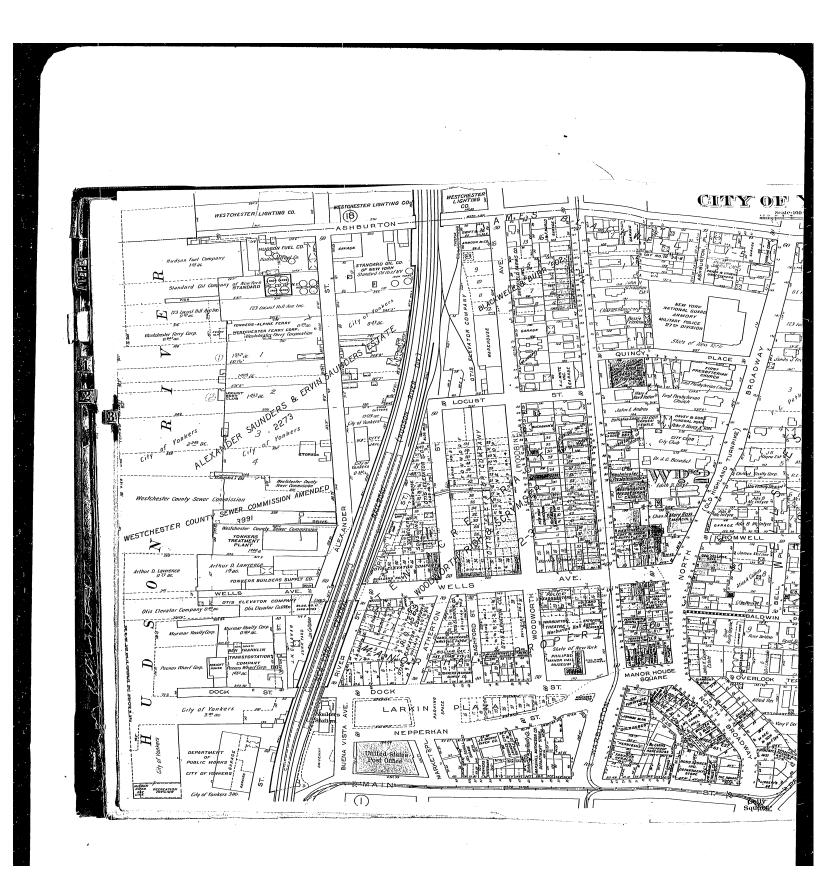

Copyright[6] 1942 Ver The Sanborn Library, LLC LHE ER Research Associate redistrin in whele are in part of any maps of the Sanborn Library, LLC may be prohibited without prior written

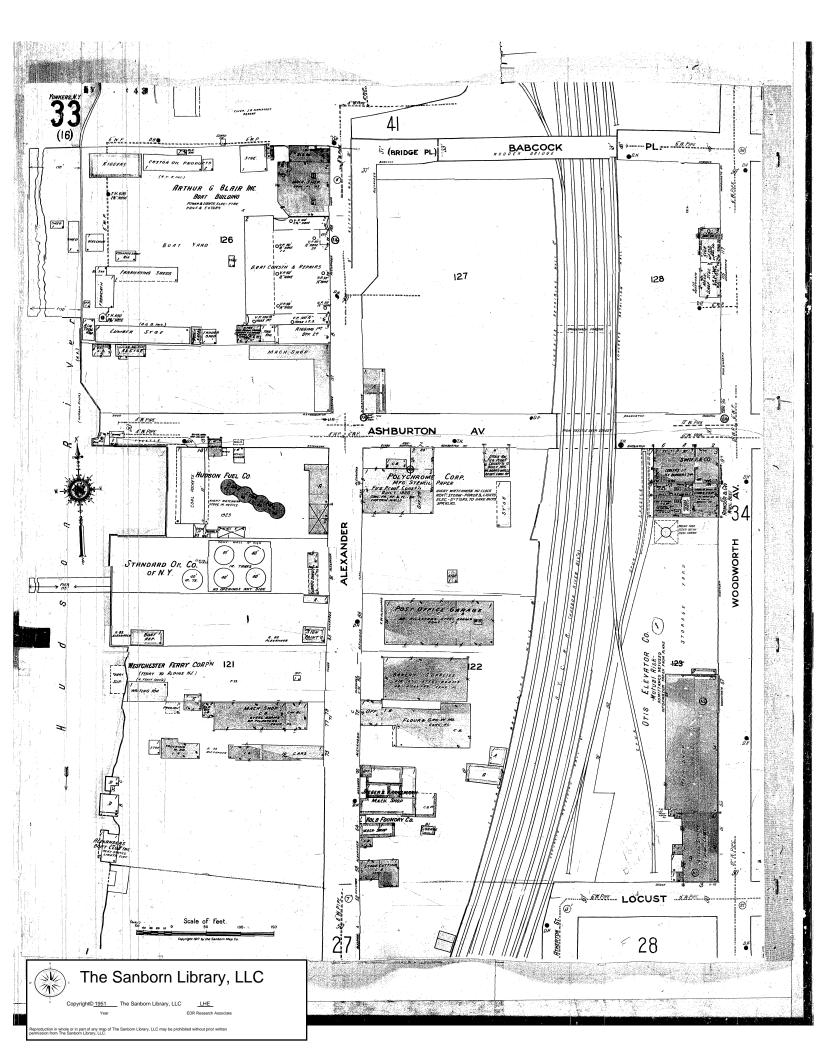

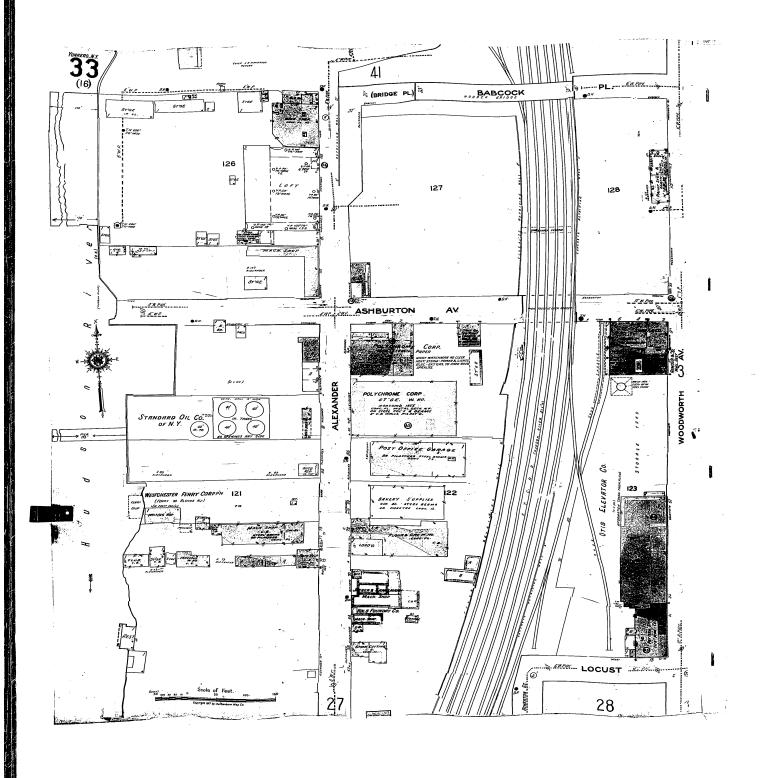



The Sanborn Library, LLC


____ The Sanborn Library, LLC _______ EDR Research As

reproduction in whole or in part of any map of The Sanborn Library, LLC may be prohibited without prior emission from The Sanborn Library, LLC.


Copyright©<u>1956</u>

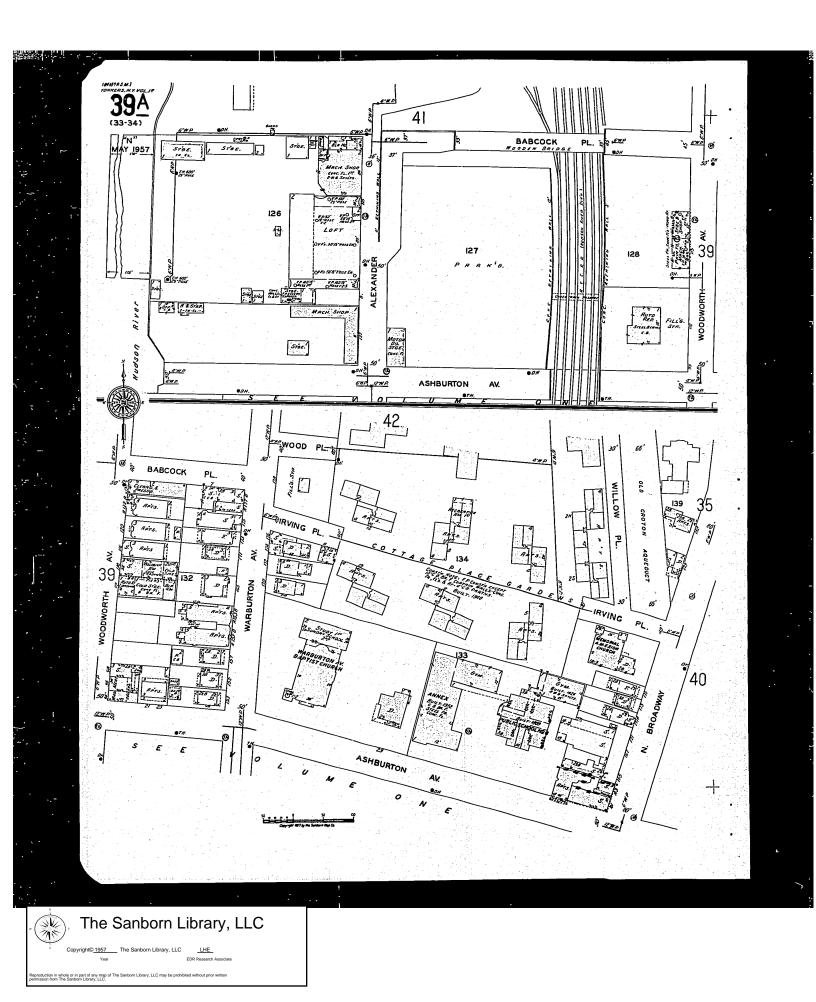


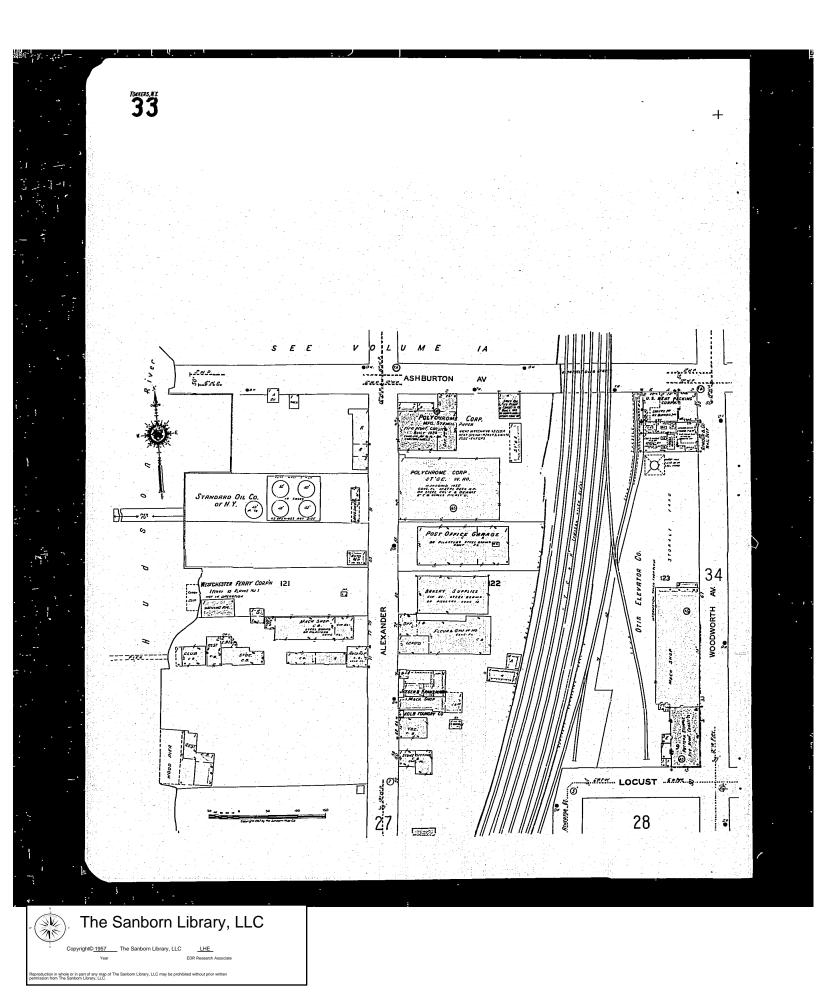


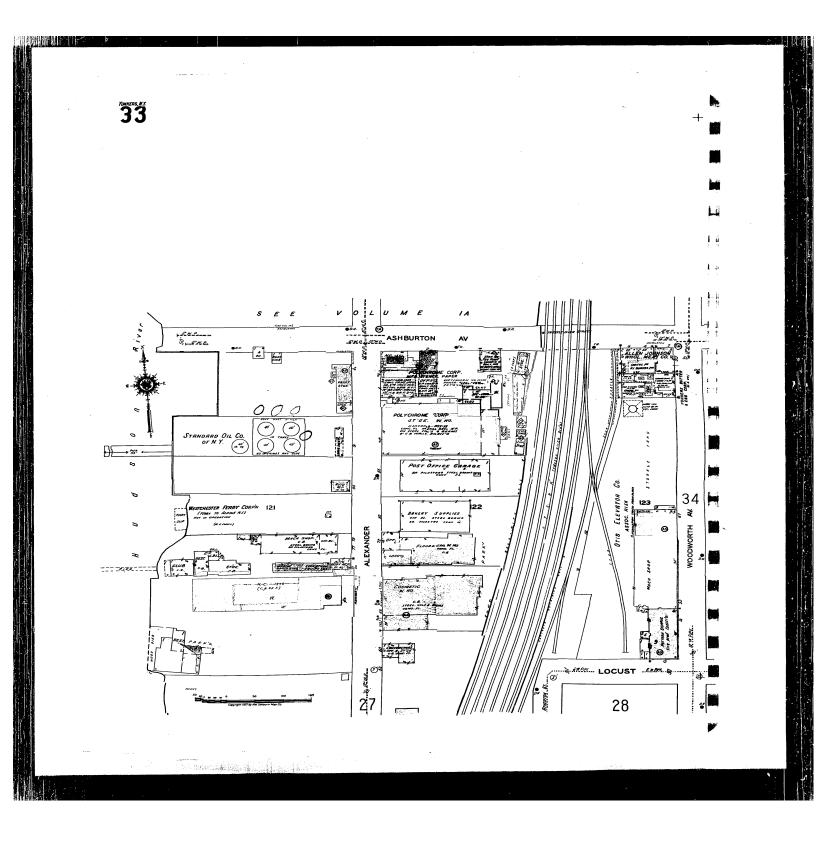


The Sanborn Library, LLC Copyright© 1973 The Sanborn Library, LLC Ver EDR Research Associate Reproduction in which or in and wr map of The Sanborn Library, LLC may be prohibited without prior written

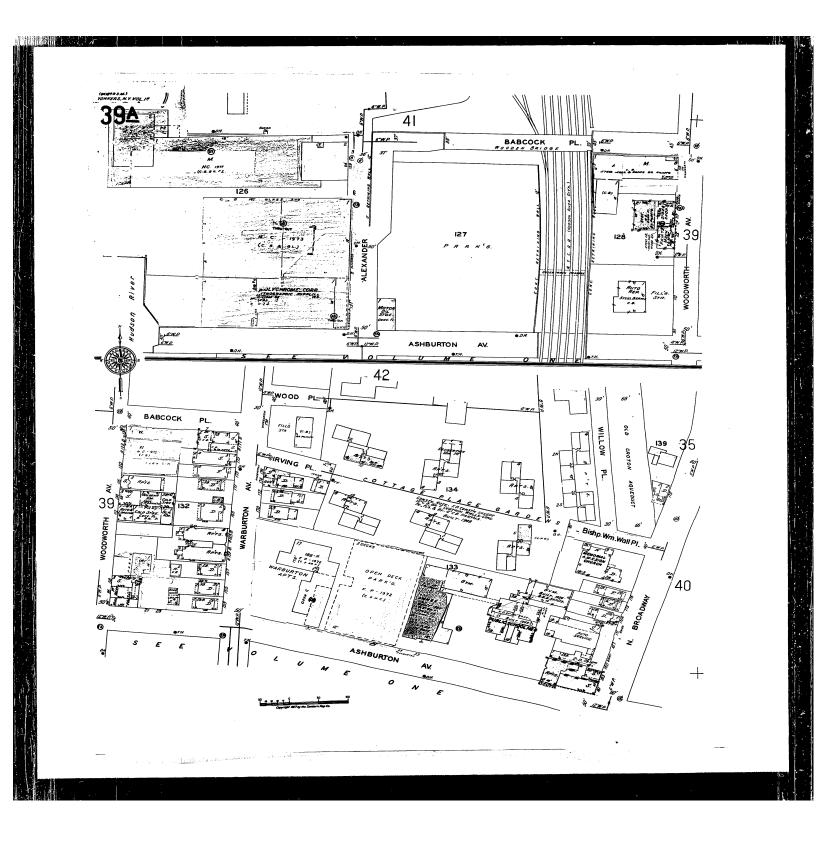


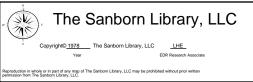


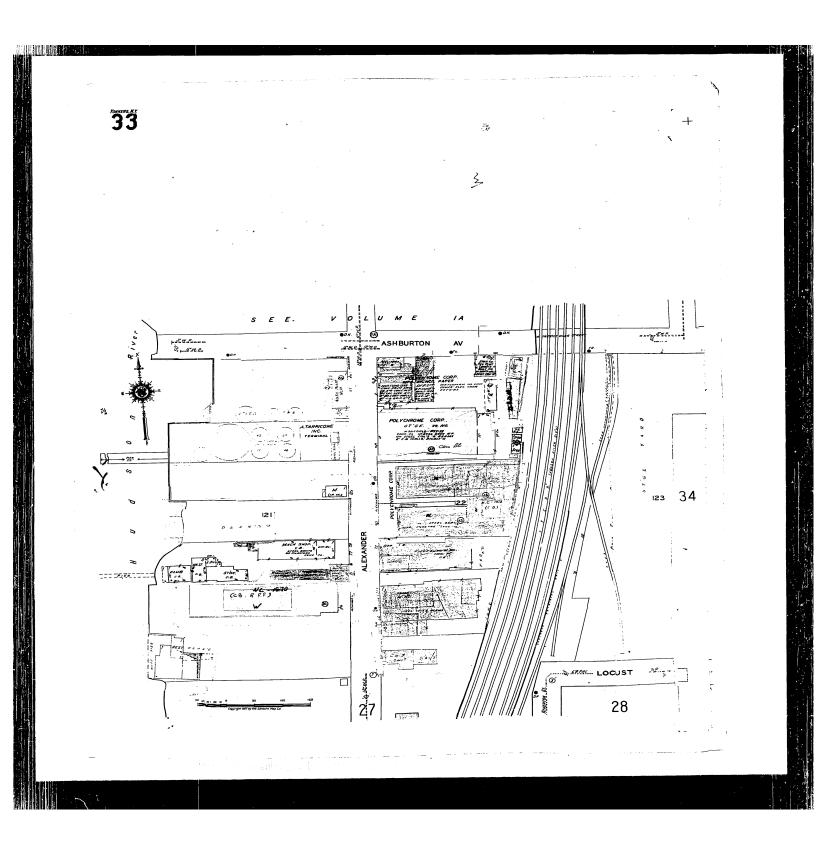




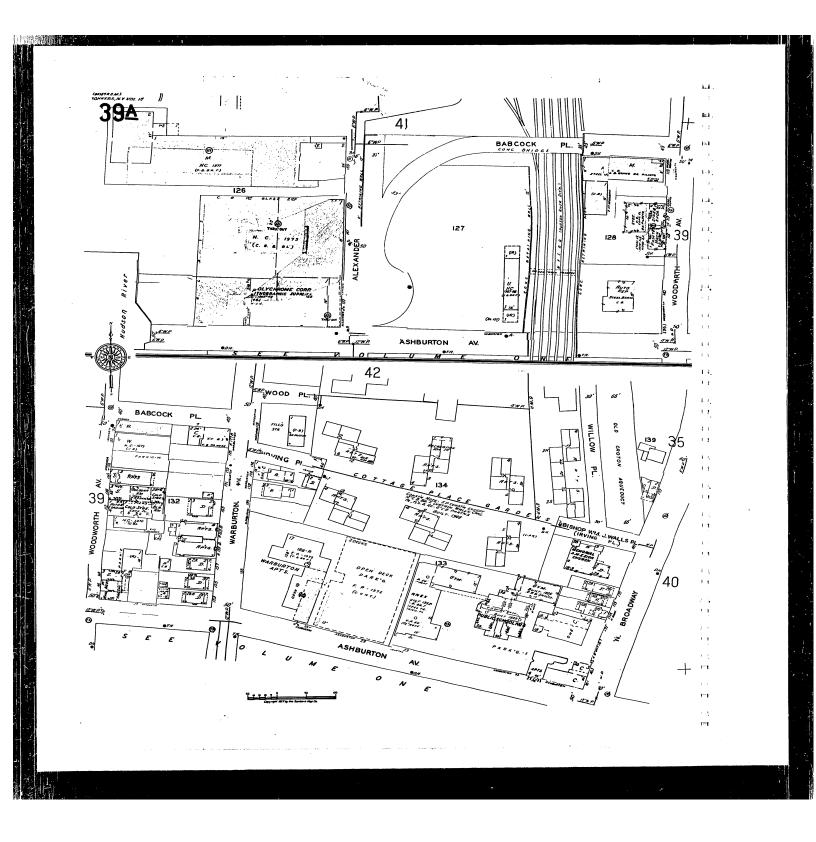

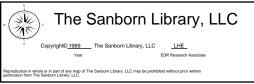


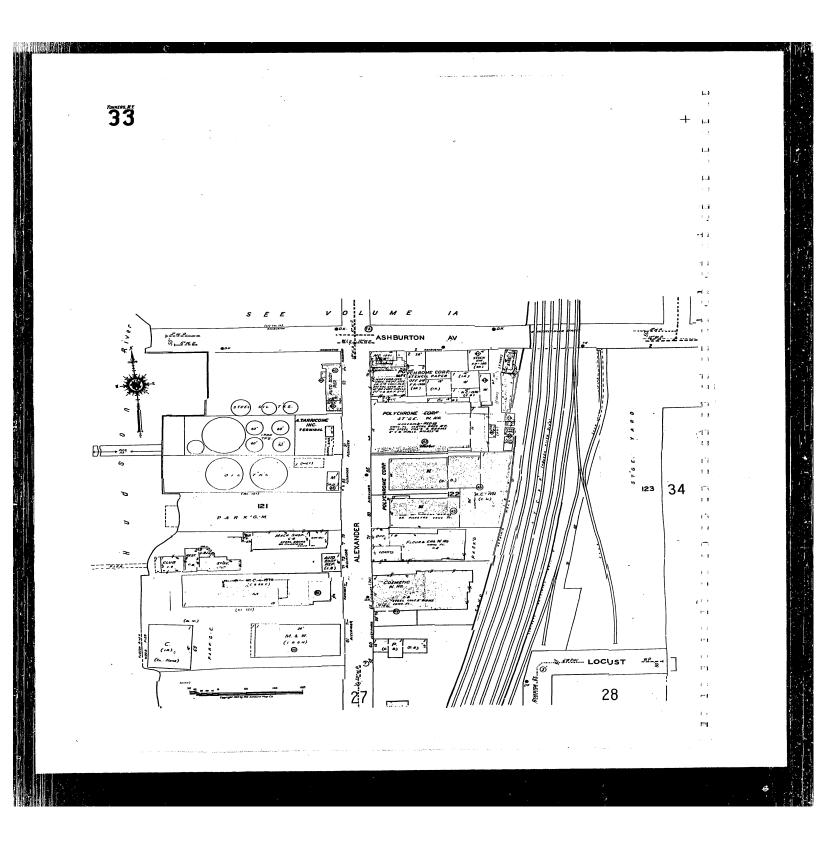




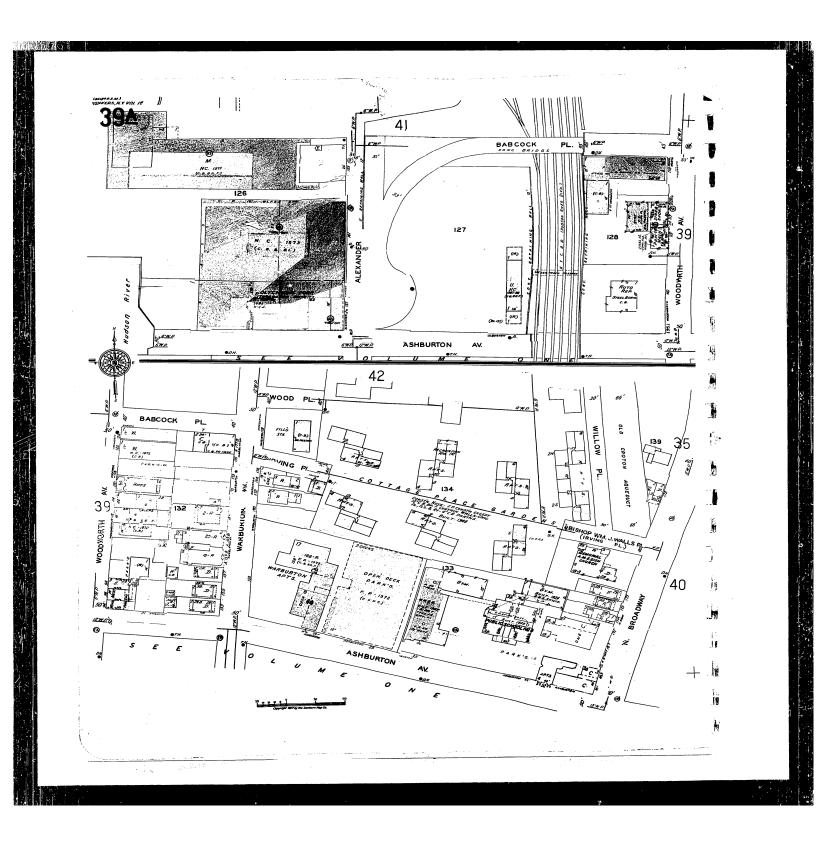



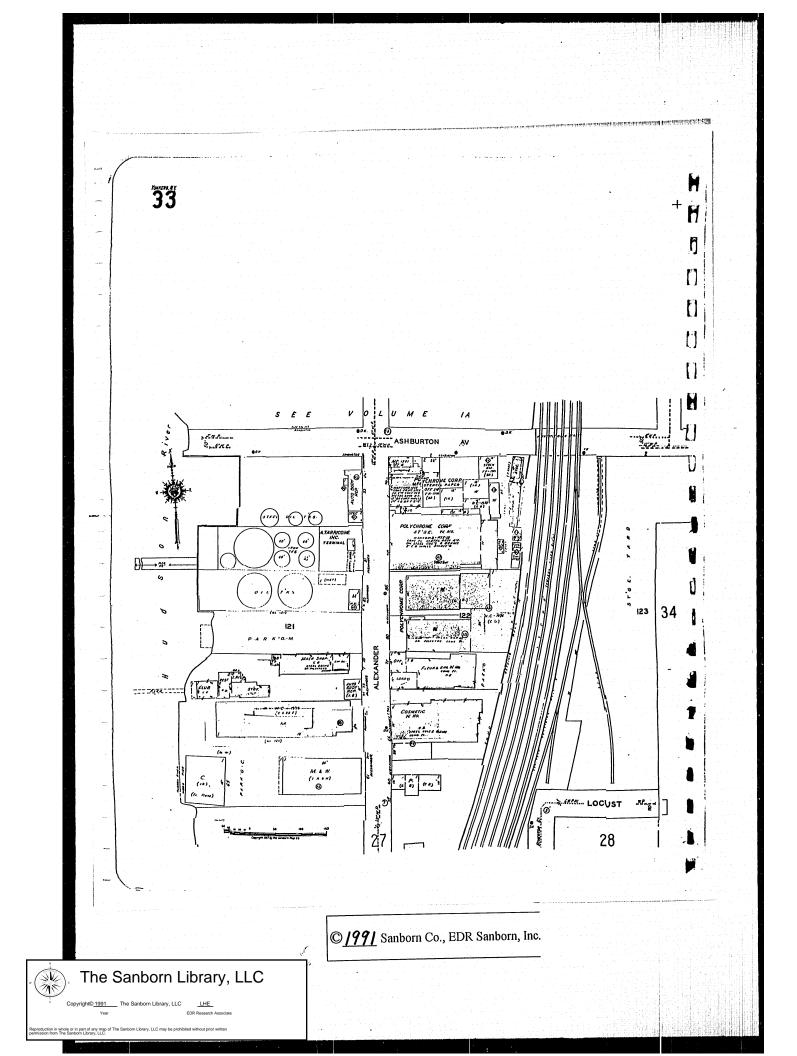

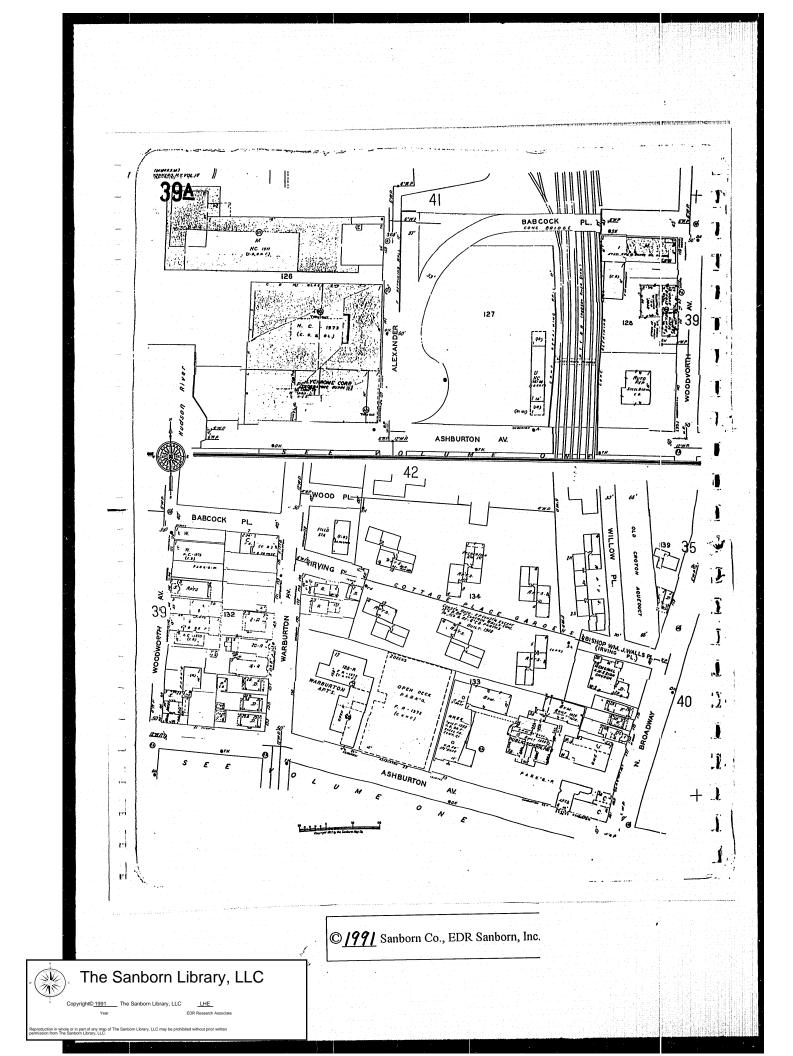

APPENDIX E

Aerial Photographs



The EDR Aerial Photo Decade Package

Sun Chemical Corporation Alexander Street/Ashburton Avenue Yonkers, NY 10701

Inquiry Number: 1784877.5

October 31, 2006

The Standard in Environmental Risk Management Information

440 Wheelers Farms Road Milford, Connecticut 06461

Nationwide Customer Service

Telephone:1-80Fax:1-80Internet:www

1-800-352-0050 1-800-231-6802 www.edrnet.com

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDRs professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business. Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:


Aerial Photography October 31, 2006

Target Property:

Alexander Street/Ashburton Avenue Yonkers, NY 10701


<u>Year</u>	Scale	<u>Details</u>	<u>Source</u>
1954	Aerial Photograph. Scale: 1"=750'	Panel #: 2440073-H8/Flight Date: March 22, 1954	EDR
1966	Aerial Photograph. Scale: 1"=750'	Panel #: 2440073-H8/Flight Date: January 12, 1966	EDR
1976	Aerial Photograph. Scale: 1"=1000'	Panel #: 2440073-H8/Flight Date: October 29, 1976	EDR
1984	Aerial Photograph. Scale: 1"=1000'	Panel #: 2440073-H8/Flight Date: March 26, 1984	EDR
1994	Aerial Photograph. Scale: 1"=833'	Panel #: 2440073-H8/Flight Date: April 04, 1994	EDR



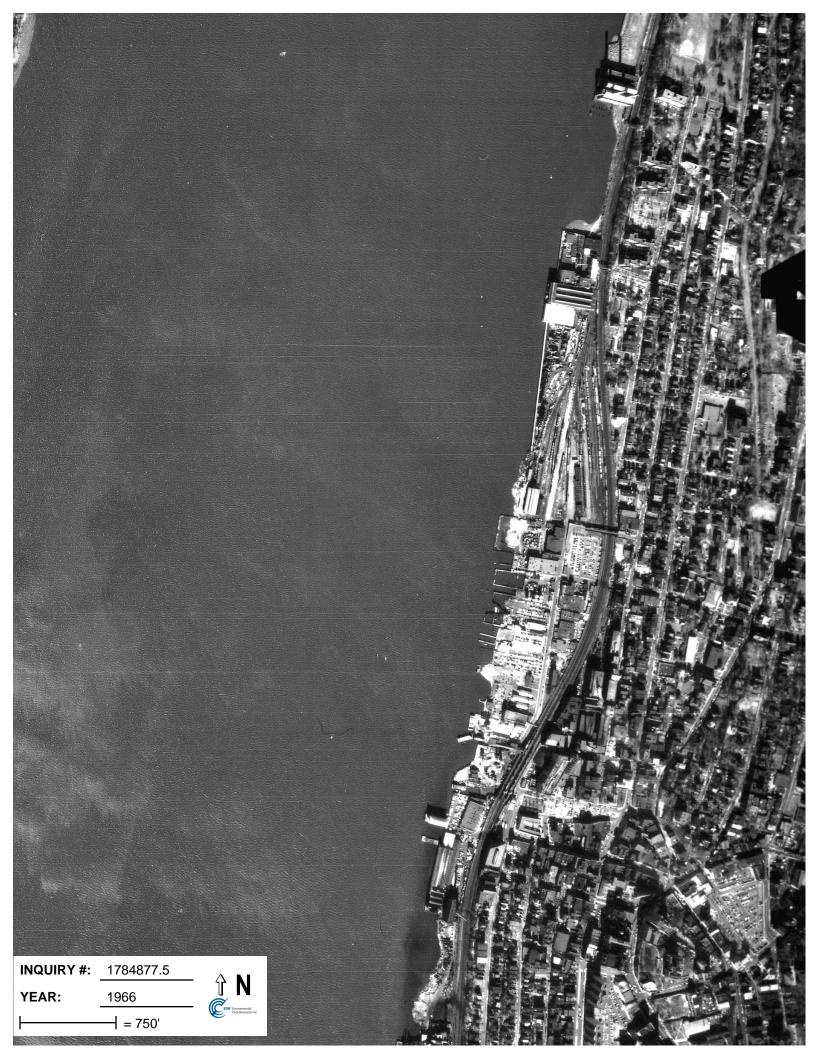





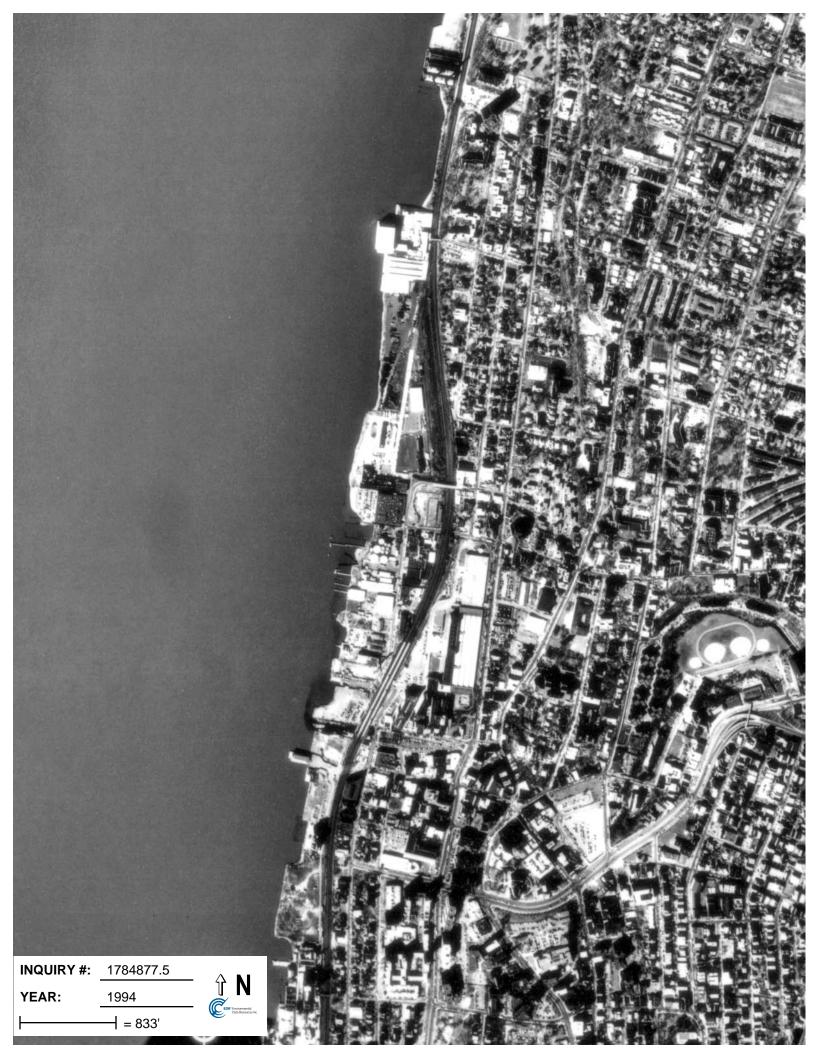

APPENDIX F

City Directory



The EDR-City Directory Abstract

Sun Chemical Corporation 137 Alexander Street Yonkers, NY 10701

Inquiry Number: 1784877.6

Wednesday, November 01, 2006

The Standard in Environmental Risk Management Information

440 Wheelers Farms Road Milford, Connecticut 06461

Nationwide Customer Service

 Telephone:
 1-800-352-0050

 Fax:
 1-800-231-6802

 Internet:
 www.edrnet.com

EDR City Directory Abstract

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening report designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

> *Thank you for your business.* Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provide in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as provided in this Report are provided for illustrative purposes only, and are environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

SUMMARY

City Directories:

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1991 through 2006. (These years are not necessarily inclusive.) A summary of the information obtained is provided in the text of this report.

Date EDR Searched Historical Sources: November 1, 2006

Target Property:

137 Alexander Street Yonkers, NY 10701

<u>Year</u> 1991	<u>Uses</u> Address Not Listed in Research Source	Source Cole Criss-Cross Directory
1996	No Return	Cole Criss-Cross Directory
2001	No Return	Cole Criss-Cross Directory
2006	County of Westchester	Cole Criss-Cross Directory

Adjoining Properties

SURROUNDING

Multiple Addresses Yonkers, NY 10701

<u>Year</u> 1991	<u>Uses</u> **Alexander Street**	Source Cole Criss-Cross Directory
	Address not listed in research source (80)	Cole Criss-Cross Directory
	Address not listed in research source (86)	Cole Criss-Cross Directory
	Address not listed in research source (94)	Cole Criss-Cross Directory
	Address not listed in research source (131)	Cole Criss-Cross Directory
	Address not listed in research source (145)	Cole Criss-Cross Directory
	Excelsior Packaging Group (159)	Cole Criss-Cross Directory
1996	**Alexander Street**	Cole Criss-Cross Directory
	Address not listed in research source (80)	Cole Criss-Cross Directory
	New York's Finest Chocolate Co (86)	Cole Criss-Cross Directory
	Address not listed in research source (94)	Cole Criss-Cross Directory
	Address not listed in research source (131)	Cole Criss-Cross Directory
	Address not listed in research source (145)	Cole Criss-Cross Directory
	Excelsior Packaging Group (159)	Cole Criss-Cross Directory

<u>Year</u> 2001	<u>Uses</u> **Alexander Street**	Source Cole Criss-Cross Directory
	Address not listed in research source (80)	Cole Criss-Cross Directory
	New York's Finest Chocolate Co (86)	Cole Criss-Cross Directory
	Address not listed in research source (94)	Cole Criss-Cross Directory
	No Return (131)	Cole Criss-Cross Directory
	Address not listed in research source (145)	Cole Criss-Cross Directory
	Excelsior Packaging Group (159)	Cole Criss-Cross Directory
2006	**Alexander Street**	Cole Criss-Cross Directory
	Address not listed in research source (80)	Cole Criss-Cross Directory
	Strip Mall (3 Occupants) (86)	Cole Criss-Cross Directory
	Address not listed in research source (94)	Cole Criss-Cross Directory
	Residence (131)	Cole Criss-Cross Directory
	Address not listed in research source (145)	Cole Criss-Cross Directory
	Excelsior Packaging Group (159)	Cole Criss-Cross Directory

APPENDIX G

USGS Topographic Maps



EDR Historical Topographic Map Report

Sun Chemical Corporation Alexander Street/Ashburton Avenue Yonkers, NY 10701

Inquiry Number: 1784877.4

October 31, 2006

The Standard in Environmental Risk Management Information

440 Wheelers Farms Rd Milford, Connecticut 06461

Nationwide Customer Service

Telephone:1-8Fax:1-8Internet:ww

1-800-352-0050 1-800-231-6802 www.edrnet.com

EDR Historical Topographic Map Report

Environmental Data Resources, Inc.s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.


Thank you for your business. Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice


This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

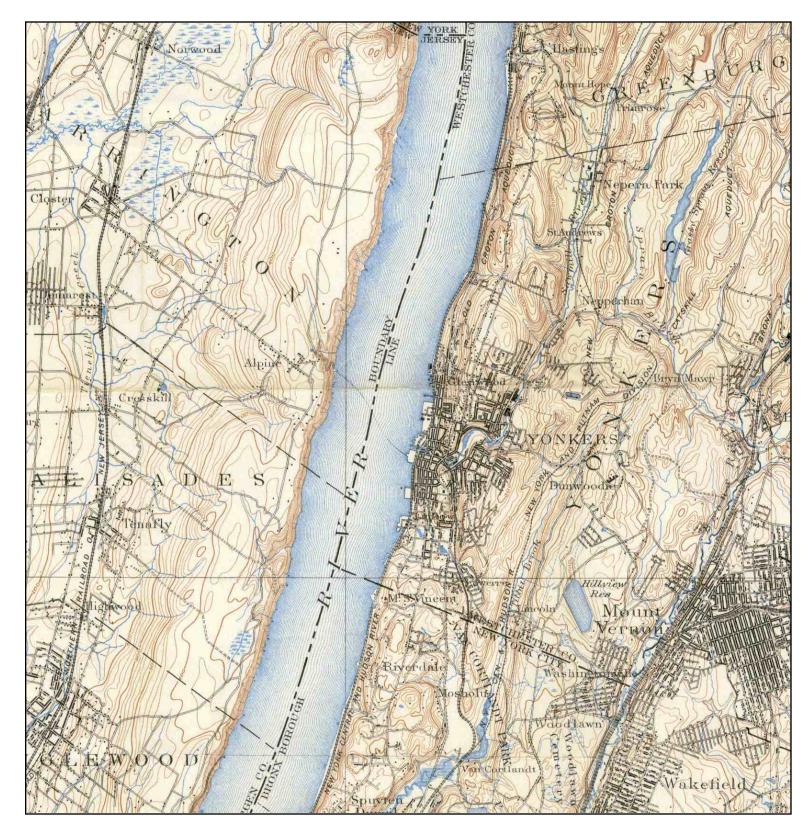


TARGET QUAD SITE NAME: Sun Chemical Corporation CLIENT: Paulus Sokolowski & Sartor Ν NAME: HARLEM ADDRESS: Alexander Street/Ashburton Avenue CONTACT: **Dyane Benardos** MAP YEAR: 1897 INQUIRY#: 1784877.4 Yonkers, NY 10701 **RESEARCH DATE: 10/31/2006** 40.9406 / 73.901 SERIES: LAT/LONG: 15 SCALE: 1:62500

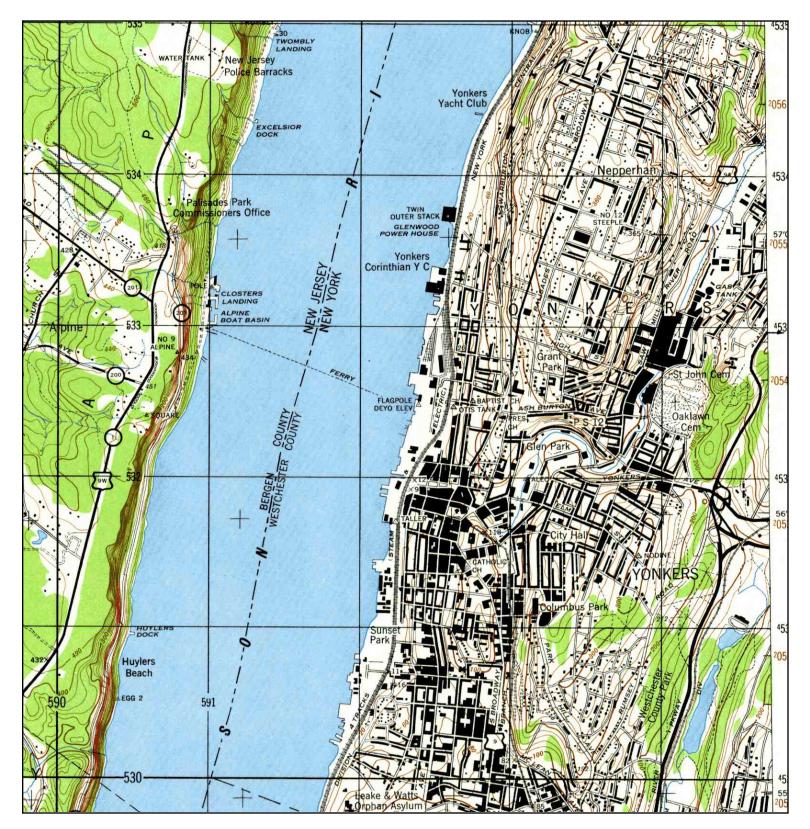

TARGET QUAD SITE NAME: Sun Chemical Corporation CLIENT: Paulus Sokolowski & Sartor Ν NAME: YONKERS ADDRESS: Alexander Street/Ashburton Avenue CONTACT: **Dyane Benardos** MAP YEAR: 1947 INQUIRY#: 1784877.4 Yonkers, NY 10701 RESEARCH DATE: 10/31/2006 SERIES: 7.5 LAT/LONG: 40.9406 / 73.901 SCALE: 1:25000

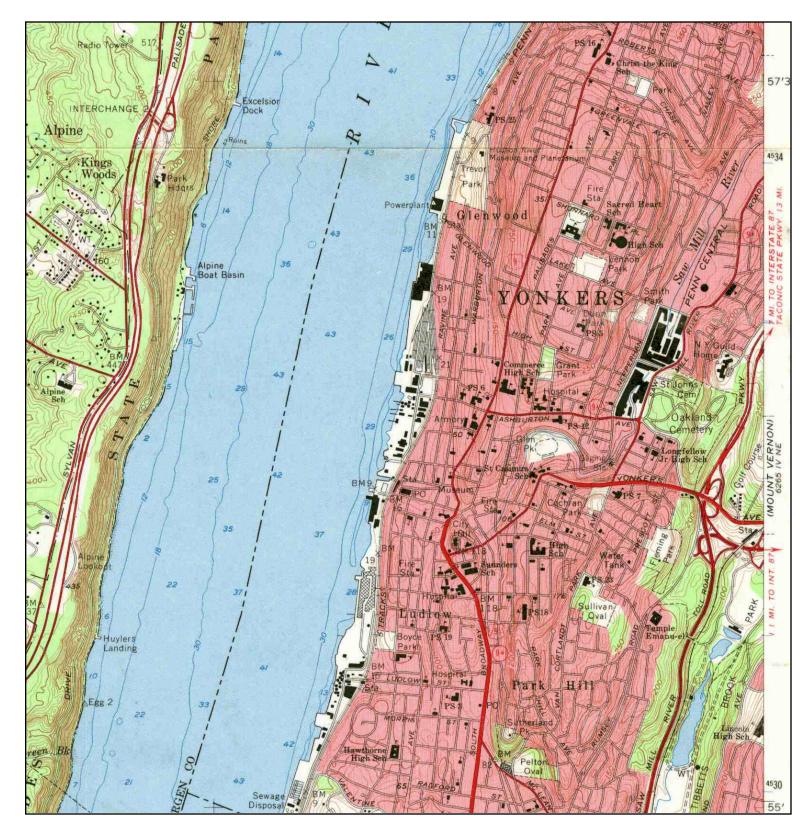

	TARGET QU NAME: MAP YEAR:	YONKERS	SITE NAME: ADDRESS:	Sun Chemical Corporation Alexander Street/Ashburton Avenue Yonkers, NY 10701	INQUIRY#:	Paulus Sokolowski & Sartor Dyane Benardos 1784877.4 DATE: 10/31/2006
	SERIES: SCALE:	7.5 1:24000	LAT/LONG:	40.9406 / 73.901	RESEARCH	DATE. 10/31/2000

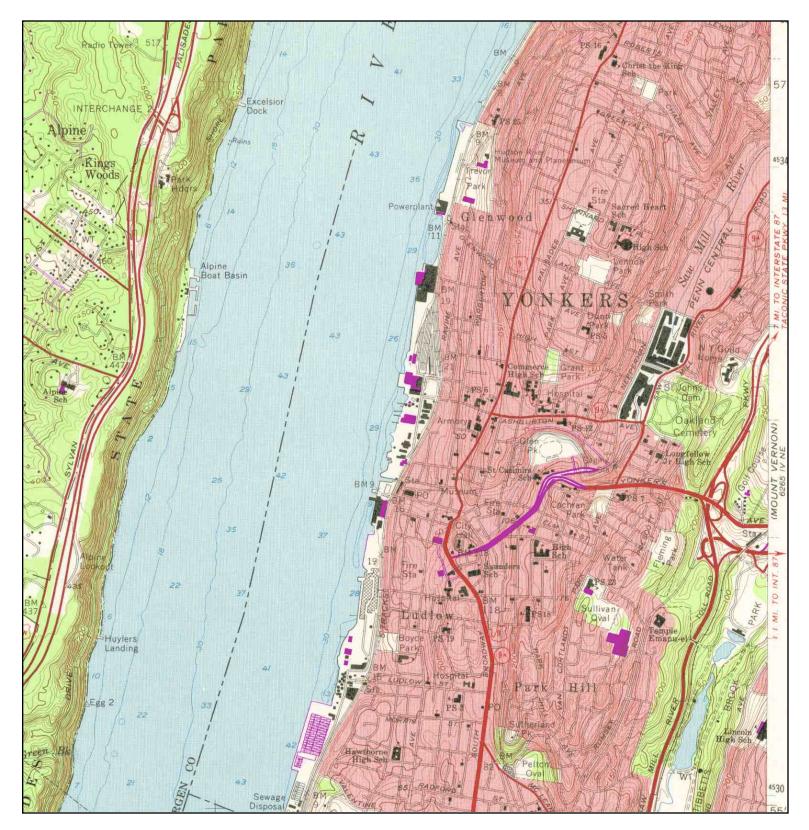

TARGET QUAD SITE NAME: Sun Chemical Corporation CLIENT: Paulus Sokolowski & Sartor Ν NAME: YONKERS ADDRESS: Alexander Street/Ashburton Avenue CONTACT: **Dyane Benardos** MAP YEAR: 1979 INQUIRY#: 1784877.4 PHOTOREVISED FROM:1966 Yonkers, NY 10701 RESEARCH DATE: 10/31/2006 SERIES: 7.5 LAT/LONG: 40.9406 / 73.901 SCALE: 1:24000



z 🔶	TARGET QU NAME: MAP YEAR:	YONKERS	SITE NAME: ADDRESS:	Sun Chemical Corporation Alexander Street/Ashburton Avenue	CLIENT: CONTACT: INQUIRY#:	Paulus Sokolowski & Sartor Dyane Benardos 1784877.4
	SERIES: SCALE:	7.5 1:24000	LAT/LONG:	Yonkers, NY 10701 40.9406 / 73.901	RESEARCH	DATE: 10/31/2006

APPENDIX H

Environmental Lien Search Report



The EDR Environmental Lien Search Report

SUN CHEMICAL CORPORATION ALEXANDER STREET / ASHBURTON AVENUE YONKERS, NEW YORK

Tuesday, November 28, 2006

Project Number: L06-7718

The Standard In Environmental Risk Management Information

440 Wheelers Farm Road Milford, Connecticut 06460

Nationwide Customer Service

Telephone: 1-800-352-0050 Fax: 1-800-231-6802

The EDR Environmental Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

TARGET PROPERTY INFORMATION

ADDRESS

SUN CHEMICAL CORPORATION 137 ALEXANDER STREET YONKERS, NEW YORK

DEED INFORMATION

Type of Deed: WD 🗌 QCD 🗌 Other 🛛 DEED

Title is vested in: Polychrome Corporation, a New York corporation

Title received from: Charles E. Pearsall & Son, Inc., a New York corporation

Deed Dated: 08-31-1964 Deed Recorded: 09-04-1964 Book: 6438 Page: 75

Type of Deed: WD 🗌 QCD 🗌 Other 🛛 DEED

Title is vested in: Resin Realty Corporation, a New York corporation

Title received from: Polychrome Corporation, a New York corporation

Deed Dated: 12-17-1969 Deed Recorded: 12-23-1969 Book: 6902 Page: 146 Comments: As to a portion of Lot 29 only. Taxes are paid by Sun Chemical Corporation. No deed was found conveying the subject property to Sun Chemical Corporation.

LEGAL DESCRIPTION

Description: All that certain piece or parcel of land being Section 2, Block 2615, Lots 1 & 29, lying and situate in the City of Yonkers, County of Westchester, and the State of New York.

ENVIRONMENTAL LIEN

Environmental Lien: Found 🗌 Not Found 🔀

1st Party:

2nd Party:

Recorded: Book: Page:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found 🗌 Not Found 🖂

The EDR Environmental Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

TARGET PROPERTY INFORMATION

ADDRESS

SUN CHEMICAL CORPORATION 145 ALEXANDER STREET YONKERS, NEW YORK

DEED INFORMATION

Type of Deed: WD 🗌 QCD 🗌 Other 🛛 BARGAIN AND SALE DEED

Title is vested in: Resin Realty Corporation, a New York corporation

Title received from: Polychrome Corporation, a New York corporation

Deed Dated: 05-22-1968 Deed Recorded: 06-12-1968 Book: 6785 Page: 137 Comments: Taxes are paid by Sun Chemical Corporation. No deed was found conveying the subject property to Sun Chemical Corporation.

LEGAL DESCRIPTION

Description: All that certain piece or parcel of land being Section 2, Block 2615, Lot 23, lying and situate in the City of Yonkers, County of Westchester, and the State of New York.

ENVIRONMENTAL LIEN

Environmental Lien: Found 🗌 Not Found 🔀

1st Party:

2nd Party:

Recorded: Book: Page:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found 🗌 Not Found 🖂

The EDR Environmental Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

TARGET PROPERTY INFORMATION

ADDRESS

SUN CHEMICAL CORPORATION 80 ALEXANDER STREET YONKERS, NEW YORK

DEED INFORMATION

Type of Deed: WD 🗌 QCD 🗌 Other 🛛 BARGAIN AND SALE DEED

Title is vested in: Polychrome Corporation, a New York corporation

Title received from: Brehn Realty Corporation, a New York corporation

Deed Dated: 11-15-1973 Deed Recorded: 11-21-1973 Book: 7167 Page: 105 Comments: Taxes are paid by Sun Chemical Corporation. No deed was found conveying the subject property to Sun Chemical Corporation.

LEGAL DESCRIPTION

Description: All that certain piece or parcel of land being Section 2, Block 2608, Lot 29, lying and situate in the City of Yonkers, County of Westchester, and the State of New York.

ENVIRONMENTAL LIEN

Environmental Lien:	Found	Not Foun	d 🖂
----------------------------	-------	----------	-----

1st Party:

2nd Party:

Recorded:
Book:
Page:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs:	Found		Not Found	\boxtimes
-------------	-------	--	-----------	-------------

The EDR Environmental Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

TARGET PROPERTY INFORMATION

ADDRESS

SUN CHEMICAL CORPORATION 90 ALEXANDER STREET YONKERS, NEW YORK

DEED INFORMATION

Type of Deed: WD 🗌 QCD 🗌 Other 🛛 BARGAIN AND SALE DEED

Title is vested in: Resin Realty Corporation, a New York corporation

Title received from: Socony Vacuum Oil Company, Inc., a New York corporation, formerly known as Socony-Vacuum Corporation, formerly known as Standard Oil Company of New York

Deed Dated: 12-19-1944 Deed Recorded: 12-29-1944 Book: 4219 Page: 88 Comments: Taxes are paid by Sun Chemical Corporation. No deed was found conveying the subject property to Sun Chemical Corporation.

LEGAL DESCRIPTION

Description: All that certain piece or parcel of land being Section 2, Block 2608, Lots 35 & 37, lying and situate in the City of Yonkers, County of Westchester, and the State of New York.

ENVIRONMENTAL LIEN

Environmental Lien: Found 🗌 Not Found 🔀

1st Party:

2nd Party:

Recorded:
Book:
Page:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found 🗌 Not Found 🖂

Thank you for your business. Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This report was prepared for the use of Environmental Data Resources, Inc., and Paulus Sokolowski & Sartor, exclusively. This report is neither a guarantee of title, a commitment to insure, nor a policy of title insurance. **NO WARRANTY, EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT**. Environmental Data Resources, Inc. (EDR) and Nationwide Environmental Title Research (NETR) specifically disclaim the making of any such warranties, including without limitation, merchantability or fitness for a particular use or purpose. The information contained in this report is retrieved as it is recorded from the various agencies that make it available. The total liability is limited to the fee paid for this report.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

APPENDIX I

Title Abstract Report



ORDER CONFIRMATION

TBD

Title Number: Date of Application: Sales Representative: 06-33086-W Tuesday, September 26, 2006 Assurance Title Services, LLC

Applicant 1 4 1

Lender/Bank Attorney

Al Donnellan, Esq. DelBello, Donnellan, Weingarten , Tartaglia, Wise & Wiederkehr, L.L.P. One North Lexington Avenue White Plains, NY 10601 Ph; (914) 681-0200 Fax: (914) 684-0288

Seller Attorney

Kevin P. Groarke, Esq. Sonnenschein, Nath & Rosenthal 1221 Avenue of Americas New York, NY 10020-1089 Ph: (212) 768-6700 Fax: (212) 398-5245

Copies To:

Alan S. Wellman Assurance Title Services, LLC One Washington Park, 15th Floor Newark, NJ 07102 Ph: (973) 643-7500 Fax: (973) 643-7576

\$12,900,000.00

Property Address:	137 Alexander Street Yonkers, NY 86 Alexander St., a/k/a 2 Yonkers, New York	Ashburton Avenue Street	
County:	Westchester	TRANSACTION:	Fee & Simul Mortgage

Town/Municipality:YonkersDistrict:Fee Liability:Section:2Block:2615, 2608Lot:1,23,29,35,37Mortgagee:TBD

Buyer/Borrower(s): SFC Sun, LLC, a New York Limited Liability Company

Seller(s): Sun Chemical Corp. - a Delaware Corporation

Survey Instruction: TBD

Departmental Searches Ordered:

Bank vs. Purchaser/Borrower	Fire	
Bank vs. Seller	Housing and Building	,
Certificate of Occupancy		
Street Report		

IF THIS IS A REFINANCE WITHIN TEN YEARS, YOU MAY BE ENTITLED TO A REDUCED PREMIUM. CONTACT THIS COMPANY IMMEDIATELY FOR DETAILS.

YOU HAVE REQUESTED SERVICES FROM STEWART TITLE. IN THE EVENT THAT THIS MATTER FAILS TO CLOSE OR YOU CANCEL FOR ANY REASON A SERVICE CHARGE WILL BE BILLED.

White Plains Office 707 Westchester Avenue, Suite 411 White Plains, NY 10604 914-993-9393 office 914-997-1698 fax 800-433-4698 toll free stewartwhiteplains.com NYSE: STC

-stewart	" Q N 1 '		707 Weste	698 fax 698 m
		WW0/07	NTSE: ST	C
		INVOICE		007
<u>TITLE NO</u> .: 06-33086-W			DATE October 12, 2	006
•			Closing Time	
<u>POLICY</u> M-8832-			TITLE CLOSER:	
<u>NUMBER</u>			CLOSING DATE:	~~×
			CLOSING LOCATI	UN:
	n, Weingarten , Tartaglis	a, Wise &		
Wiederkehr, L.L.P				
PREMISES: 137 Alexander Sti				
Yonkers,, New Yor		·	- (00	x
District: Sectio	n: 2, 2	Block: 2615	, 2608	Lot: 1,23,29 , 29,35,37, 1
PURCHASER/BORROWER:	SFC Sun, LLC, a New			
	Limited Liability Com	pany		
GHARGES	- Total	Buyer	- Seller III -	
Fee Insurance \$12,900,000.00				
Market Value Rider **				
Mortgage Insurance				
Mortgage Insurance				
Municipal Searches (Total)				
Bankruptcies	\$40.00			
3-Day Recission				ENDORSEMENTS
Other Searches				A) Envmt! (8.1) (429) - \$25.00
New Survey				B) Waiver (431) - \$25.00
Survey Locate				C) VRE (420) - \$25.00
Survey Inspection				D) Residential (436) - \$25.00
Endorsement Total:				E) Revolving Credit (406) - *
Survey Endorsement *				
Miscellaneous		~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~		F) Survey (402) - *
RECORDING FEE(s): Deed(s):				G) Alta 9 (401) - *
RP5217:				H) Market Value Rider (408) - **
NYS Transfer Tax (usually paid by				I)
seller):				
NYC Transfer Tax:				* 10% of Straight Mortgage Premium
Mortgage(s):				** 10% of Straight Owner's Premium
Mortgage Tax - (Mortgagor)				
Mortgage Tax -(Mortgagee)				
Satisfaction(s):				
Agreement(s):				
Other: Certificate of Occupancy				
Charge - TBD				
Other:				
Search Fee:				
Other Transfer Tax				
Other Mortgage Tax				
ESCROW - To Hold				
- To Pay	1	· · · · · · · · · · · · · · · · · · ·	n	
Tax Service Charge (\$75.00)	\$75.00			
Settlement Fee:				*****Closer MUST Verify Depts.
				******Closer MUST Verify Depts.
TOTAL:			NUMBERS: (MAND	<u> </u>
Subject to change/verification at closi	ing	POCIAL PECORT I	NUMBERS: (MAND	<u>mioni</u> .
		SELLERAN		
D D OD ID TO		SELLER(s):		
RECEIPTS	AMOUNT:	STIC CHEC	'K S·	AMOUNT:
DIRECT CHECKS:	AIMOUNT.	STIC CHIX		/ 1.10 01111
	·····			

The recording/filing fees referenced on this invoice include Stewart Titles fees for processing the subject recordings/filings



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 10604 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

MULTIPLE EXCEPTION AFFIDAVIT

State of New York		}	Stewart Title Insurance Company
County of Westchester		}	Title No.: 06-33086-W
	and _		· · ·
each being duly sworn, deposes and says:			

- 1) I (We) have not been known by any other name(s) for the past ten (10) years except
- 2) The judgments or liens, if any, returned in the above-captioned report of title are not against me (us), but against a person(s) of the same or similar name and that I/We have not filed bankruptcy under any other name or in any other state except as returned in the above-referenced title report, and that there are no judgments or Federal Tax Liens against me (us) in any jurisdiction.
- 3) I (We) am (are) the same person(s) names as the Grantee(s) in a Deed recorded in Liber/Reel _____ Pg
- am the same person entitled to the ______ exemption as stated in the above-captioned title report.
- 5) There are no leases conferring rights of possession to any tenant; there are no persons in possession and no one has the right of possession to the premises as tenant or for any other reason.
- 6) That We/I have owned the property described in the above-referenced title report since ______ and that our ownership has been peaceable and undisturbed and I /we have no knowledge of any other parties' claim to an interest in this property, except as set forth in the above referenced title report.
- 7) That I/we know of no other financing which will affect the property described in the above-referenced title report and I/We have not executed any instrument that is not disclosed by the above referenced title report.

8) (Initial to include) FOR CITY OF NY ONLY.

- A. That to the best of my (our) knowledge, there has been no work performed at the property by the City of New York, or any demand made by the City of New York for any such work that may result in charges by the New York City Department of Rent and Housing Maintenance Emergency Repair.
- B. To the best of my (our) knowledge, there are no street vaults, or if there are street vaults, any and all vault taxes have been paid to date.
- C. That to the best of my (our) knowledge, there have been no repairs performed by the Emergency Service Division of the Department of Rent and Housing Maintenance of the City of New York.

9) (Initial that which applies) TP584

- A. _____ (we) am (are) (a) resident(s) of the State of New York.
- B. _____ I (we) am (are) not (a) resident(s) of the State of New York but claim an exemption within Section 121 of the Internal Revenue Code.
- C. _____ I (we) am (are) required to file form IT2663 and pay an estimated tax prior to the transfer of the above indicated premises.

10) _____ (Initial to include) FOR CORPORATION/LLC

- A. That said resolutions/Operating agreements/certificates of incorporation attached hereto are valid and no changes to said instruments have been made.
- B. That the General Business tax to the City of New York/NYS Franchise Tax is paid to date/not due (Circle Applicable). Except as set forth in the attached Indemnity Agreement.
- 11) This affidavit has been executed and delivered in order to induce Stewart Title Insurance Company to remove certain possible exceptions to title set forth in the above captioned title report and to issues its policy of title insurance covering said property knowing that it will rely on the statements made herein.

12) OTHER:

Current/Forwarding Address

______SS#______

Sworn to before me this _____ day of _____, 200_____,

Another Quality Service Provided by: **Stewart Title Insurance Company** 707 Westchester Avenue, Suite 411 White Plains, NY 10604 (914) 993-9393

Multiple Exception Affidavit Page 2



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 10504 914-993-9393 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

EXHIBIT 1

PRIVACY POLICY NOTICE

PURPOSE OF THIS NOTICE

Title V of the Gramm-Leach Bailey Act (GLBA) generally prohibits any financial institution, directly or through its affiliates, from sharing nonpublic personal information about you with a nonaffiliated third party unless the institution provides you with notice of its privacy policies and practices, such as the type and information that it collects about you and the categories of persons or entities to whom it may be disclosed. In compliance with the GLBA, we are providing you with this document, which notifies you of the privacy practices of **Stewart Title Insurance Company, and/or its agents.**

We may collect nonpublic information about you from the following sources:

- Information we receive from you, such as on applications or other forms
- Information about your transactions we secure from our files, or from our affiliates or other.
- Information we receive from a consumer reporting agency
- Information that we receive from others involved in your transaction, such as the real estate agent or lender

Unless it is specifically stated otherwise in an amended Privacy Policy Notice, no additional nonpublic personal information will be collected about you.

We may disclose any of the above information that we collect from our customers or former customers to our affiliates or to nonaffiliated third parties as permitted by law.

We may also disclose this information about customers or former customers to the following types of nonaffiliated companies that perform marketing services on our behalf or with whom we have joint marketing agreements:

- Financial service providers such as companies engaged in banking, consumer finance, securities and insurance.
- Non-financial companies such as envelope stuffers and other fulfillment service providers.

WE DO NOT DISCLOSE ANY NONPUBLIC PERSONAL INFORMATION ABOUT YOU WITH ANYONE FOR ANY PURPOSE THAT IS NOT SPECIFICALLY PERMITTED BY LAW.

We restrict access to nonpublic personal information about you to those employees who need to know that information in order to provide products or services to you. We maintain physical, electronic, and procedural safeguards that comply with federal regulation to guard your nonpublic personal information.



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 10604 914-993-9393 914-997-1698 fax 800-433-0014 stewart.com NYSE: STC

TIRSA OWNER'S EXTENDED PROTECTION POLICY

You can request an Extended Protection Policy if the insured is a natural person and the property is a residential condominium unit or a one-to-four family residence. The Extended Protection Policy provides extensive, additional insurance for a premium of 120% of the regular Owner's policy rate.

Coverage against the inability of the insured to use the Land as a single family residence due to violation of zoning law regulation on the Policy Date.

Coverage against the force removal of a structure on the Land of the Policy Date (other than boundary walls and fences) if it was built without a proper building permit.

Coverage against the forced removal of a structure on the land (other than boundary walls and fences) for violating a zoning law or regulation on the Policy Date.

Coverage against the insured being forced to remove a structure which encroaches onto a neighbor's Land on the Policy Date.

Coverage if someone refuses to perform a contract to purchase or lease the Land, or make a mortgage loan on it because of the encroachment of a structure located on an adjoining property on the Policy Date.

Coverage against the insured not obtaining a building permit due to a violation of a subdivision law on the Policy Date.

Coverage against a neighbor building any structures after the Policy Date, other than boundary walls or fences, which encroach onto the insured Land.

Coverage against loss due to forgery or impersonation after the Policy Date.

Insurance automatically increases by 10% each year to 150% of the Policy amount without addition premium.

Certain covered risks are subject to a Deductible and a Maximum Amount of Liability.

PLEASE PROMPTLY CONTACT YOUR STEWART TITLE SALES REPRESENTATIVE TO REQUEST A EXTENDED PROTECTION POLICY.

CERTIFICATE OF TITLE ISSUED BY



STEWART TITLE® **INSURANCE COMPANY**

707 WESTCHESTER AVENUE WHITE PLAINS, NEW YORK 10604 914-993-9393 • FAX 914-997-1698

Certifies to the proposed insured named in Schedule A that an examination of title to the premises described in Schedule A has been made in accordance with its usual procedure and agrees to issue its standard form of title insurance policy in favor of the proposed insured, covering premises described in Schedule A, in the amounts hereinafter set forth, insuring the fee and/or mortgage and the marketability thereof, after the closing of the transaction in conformance with procedures approved by the Company excepting (a) all loss or damage by reason of the estates, interests, defects, objections, liens, encumbrances and other matter set forth herein that are not disposed of to the satisfaction of the Company prior to such closing or issuance of the policy (b) any question or objection coming to the attention of the Company before the date of closing, or if there be no closing, before the issuance of said policy.

This Certificate shall be null and void (1) if the fees therefor are not paid (2) if the prospective insured, his attorney or agent makes any untrue statement with respect to any material fact or suppresses or fails to disclose any material fact or if any untrue answers are given to material inquiries by or on behalf of the Company (3) upon delivery of the policy. Any claim arising by reason of the issuance hereof shall be restricted to the terms and conditions of the standard form of insurance policy. If title, interest or lien to be insured was acquired by the prospective insured prior to delivery hereof, the Company assumes no liability except under its policy when issued.



President



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 10604 914-993-9393 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

SCHEDULE A – CERTIFICATION

Title No: 06-33086-W Effective Date: 4/1/2006

Proposed Insured:

Purchaser/Borrower: SFC Sun, LLC, a New York Limited Liability Company

Mortgagee: TBD

Amount of Insurance:

Fee \$12,900,000.00

Mortgage

THIS COMPANY CERTIFIES that a good and marketable title to the premises described in Schedule A, subject to the liens, encumbrances and other matters, if any, set forth in this certificate may be conveyed and/or mortgaged by:

TITLE VESTED IN:

Block 2615, Lots 1, 29:

Polychrome Corporation who acquired title by deed from **Charles E**. **Pearsall & Sons, Inc.** dated 8/31/1964 and recorded 9/4/1964 in Liber 6438 Page 75.

And

Resin Realty Corporation who acquired title by deed from Polychrome Realty Corporation dated 12/17/1969 and recorded 12/23/1969 in Liber 6902 Page 146.

Block 2608, Lots 35, 37:

Resin Realty Corporation who acquired title by deed from Socony-Vacuum Oil Company, Incorporated dated 12/19/1944 and recorded 12/29/1944 in Liber 4219 Page 88.

Block 2608, Lot 29:

Polychrome Realty Corp. who acquired title by deed from **Harold T. Garrity** dated 1/4/1973 and recorded 1/5/1973 in Liber 7167 Page 105, and by deed from **Brehm Realty Corp.** dated 11/15/1973 and recorded 11/21/1973 in Liber 7167 Page 105.

Block 2615, Lot 23:

Resin Realty Corporation who acquired title by deed from Polychrome Realty Corp. dated 5/22/1968 and recorded 6/12/1968 in Liber 6785 Page 137.

Premises described herein are known as: 137 Alexander Street

County:	Westchester
Municipality:	Yonkers
Section:	2
Block:	2615, 2608
Lot:	1,23,29,35,37



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 914-993-9393 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

SCHEDULE A – DESCRIPTION

Title No: 06-33086-W

PARCEL A (BLOCK 2615, LOTS 1, 29)

Parcel I

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, and more particularly bounded and described as follows:

BEGINNING at the corner formed by the intersection of the center line of Ashburton Avenue, if extended, with the westerly line of Alexander Street;

THENCE northerly along the westerly side of Alexander Street, 125.00 feet, more or less to lands now or formerly of George J. Roberts;

THENCE westerly parallel with the said center line of Ashburton Avenue, if extended, extended 660.00 feet 2 inches, more or less, to the Exterior Pier Line, as fixed by the Municipal Authorities of the City of Yonkers under the Charter of said City;

THENCE southerly along said Exterior Pier Line, 125.00 feet, more or less, to the said center line of Ashburton Avenue extended;

THENCE easterly along said center line of Ashburton Avenue, if extended, extended 659.00 feet 8 inches, more or less, to the corner formed by the intersection of the center line of Ashburton Avenue extended with the westerly line of Alexander Street, the point or place of BEGINNING.

Excepting therefrom so much of the premises that was conveyed by Polychrome Corporation to Resin Realty Corporation by deed dated 12/17/1969 and recorded 12/23/1969 in Liber 6902 Page 146.

FOR CONVEYANCING ONLY: TOGETHER with all the rights, title and interest of the party of the first part, if any,

of, in and to the land lying in the street in front of and adjoining said premises.

Parcel II

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, bounded and described as follows:

BEGINNING at a point on the westerly side of Alexander Street where the same is intersected by the southerly boundary line of land conveyed by Polychrome Realty Corporation to Resin Realty Corporation by deed dated 5/22/1968 and recorded in the Westchester County Clerk's Office, Division of Land Records, on 6/12/1968in Liber 6785 of conveyances at Page 137;

RUNNING THENCE along the last mentioned boundary line North 81 degrees 27 minutes 00 seconds West 255.00 feet to an angle point;

RUNNING THENCE through land conveyed by Charles E. Pearsall & Son, Inc., to Polychrome Corporation by deed dated 8/3/1964 and recorded in said County Clerk's Office on 9/4/1964 in Liber 6438 of conveyances at Page 75, the following two (2) courses and distances:

South 8 degrees 32 minutes 40 seconds West 2.54 feet to an angle point; and

South 81 degrees 27 minutes 20 seconds East 255.00 feet to a point on the westerly side of Alexander Street which point is distant northerly as measured along the same 122.46 feet from a point where said westerly side of Alexander Street would be intersected by the prolongation westerly of the center line of Ashburton Avenue;

RUNNING THENCE along the westerly side of Alexander Street North 8 degrees 32 minutes 40 seconds East 2.54 feet to the point or place of BEGINNING.

PARCEL B (BLOCK 2608, LOTS 35 AND 37)

ALL those certain seven (7) pieces or parcels of land, together with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, more particularly bounded and described as follows:

Parcel I

BEGINNING at the corner formed by the intersection of the southerly side of Ashburton Avenue with the prolongation southerly of the easterly side of Alexander Street; and

RUNNING THENCE easterly along the said southerly side of Ashburton Avenue 66.00 feet more or less to land formerly owned by Mary F. Devitt;

THENCE southerly at right angles to Ashburton Avenue and along said land formerly owned by Mary F. Devitt, 125.00 feet more or less;

THENCE westerly and parallel with Ashburton Avenue 66.00 feet more or less to the said easterly side of Alexander Street; and

THENCE northerly and along said easterly side of Alexander Street 125.00 feet more or less to the point or place of BEGINNING.

Parcel II

BEGINNING at a point on the southerly side of Ashburton Avenue distant 115.00 feet and 10 ¾ inches, more or less, easterly from the point formed by the intersection of the prolongation southerly of the easterly side of Alexander Street with the southerly side of Ashburton Avenue;

RUNNING THENCE southerly at right angles to Ashburton Avenue 125.00 feet, more or less;

THENCE westerly and parallel with Ashburton Avenue 50.00 feet more or less;

THENCE northerly and parallel with the first described boundary line 125.00 feet, more or less, to the southerly side of Ashburton Avenue; and

THENCE easterly along the said southerly side of Ashburton Avenue 50.00 feet more or less to the point or place of BEGINNING.

Parcel III

BEGINNING at a point on the southerly side of Ashburton Avenue distant 215.00 feet and 10 % inches, more or less, easterly from the point formed by the intersection of the prolongation southerly of the easterly side of Alexander Street with the southerly side of Ashburton Avenue;

RUNNING THENCE southerly at right angles to Ashburton Avenue 125.00 feet, more or less;

THENCE westerly and parallel with Ashburton Avenue 100.00 feet, more or less;

THENCE northerly and parallel with the first described boundary line 125.00 feet, more or less, to Ashburton Avenue;

THENCE easterly along the said southerly line of Ashburton Avenue 100.00 feet, more or less, to the point or place of BEGINNING.

Parcel IV

BEGINNING at a point on the southerly side of Ashburton Avenue at the northeasterly corner of Parcel III hereinabove described; and

RUNNING THENCE southerly along said Parcel III 100.00 feet, more or less;

THENCE easterly parallel with Ashburton Avenue, or nearly so, 36.00 feet and 9 inches, more or less, to the westerly line of land formerly owned by Mary H. Archibald;

THENCE northerly and parallel or nearly so to the westerly boundary line of land now or formerly owned by New York Central & Hudson River Railroad Company, and along said other land of Mary H. Archibald, 100.00 feet, more or less, to the southerly side of Ashburton Avenue; and

THENCE westerly along the southerly side of Ashburton Avenue 47.00 feet, more or less, to the point or place of BEGINNING.

Parcel V

BEGINNING at a point on the prolongation southerly of the easterly side of Alexander Street distant 125.00 feet, more or less, southerly, measuring along said easterly side of Alexander Street from the southerly side of Ashburton Avenue; and

RUNNING THENCE easterly parallel, or nearly so, with Ashburton Avenue 215.00 feet and 10 % inches, more or less, to the Southeast corner of Parcel III hereinabove described;

THENCE northerly along said Parcel III 25.00, more or less, to the southwest corner of Parcel IV hereinabove described;

THENCE easterly along said Parcel IV 36.00 feet and 9 inches, more or less, to land now or formerly of the New York Central & Hudson River Railroad Company;

THENCE southerly along said land now or formerly of the New York Central & Hudson River Railroad Company 45.00 feet and 6 inches, more or less, to land formerly owned by Westchester Trust Company;

THENCE westerly along said land formerly owned by Westchester Trust Company 259.00 feet, more or less, to the said easterly side of Alexander Street;

THENCE northerly along the said easterly side of Alexander Street, 15.00 feet 6 inches, more or less, to the point or place of BEGINNING.

Parcel VI

BEGINNING at a point on the northerly line of property formerly owned by Westchester Trust Company where the same is intersected by the prolongation southerly of the easterly line of Alexander Street;

THENCE southerly along said easterly line of Alexander Street 63.00 feet, more or less;

THENCE easterly and parallel with the northerly line of said property formerly owned by Westchester Trust Company 126.00 feet and 6 inches, more or less;

THENCE northerly and parallel with the said easterly line of Alexander Street 63.00 feet, more or less, to the northerly line of land formerly owned by Westchester Trust Company;

THENCE westerly along said northerly line of land formerly owned by Westchester Trust Company 126.00 feet, 6 inches, more or less, to the point or place of BEGINNING.

Parcel VII

BEGINNING at a point on the prolongation southerly of the easterly side of Alexander Street distant 203.00 feet and 6 inches, more or less, southerly from the point formed by the intersection of the southerly side of Alexander Street, and which point of beginning is also at the intersection of the said easterly side of Alexander Street with the southerly boundary line of land formerly owned by Westchester Trust Company; and

RUNNING THENCE easterly along the land formerly owned by Westchester Trust Company 126.00 feet and 6 inches, more or less;

THENCE northerly parallel with Alexander Street and along the easterly boundary line of land formerly owned by Westchester Trust Company 63.00 feet, more or less, to the southerly line of land formerly owned by First National Bank of Yonkers;

THENCE easterly along the southerly line of said land formerly owned by First National Bank of Yonkers 139.00 feet and 9 inches, more or less, to the westerly line of land now or formerly of New York Central & Hudson River Railroad Company;

THENCE southerly along the westerly line of said land now or formerly of New York Central & Hudson River Railroad Company, 85.00 feet and 9 inches, more or less, to land now or formerly owned by William F. Harrigan;

THENCE westerly along said land now or formerly of William F. Harrigan, 255.00 feet, more or less, to the easterly side of Alexander Street;

THENCE northerly along the said easterly side of Alexander Street 19.00 feet and 9 inches, more or less, to the point or place of BEGINNING.

<u>Parcel II</u>

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, and more particularly bounded and described as follows:

BEGINNING at a point on the easterly side of Alexander Street, a public street 50.00 feet wide, distant 305.00 feet 7 inches southerly from the corner formed by the intersection of the southerly side of Ashburton Avenue, a public street 50.00 feet wide, and the said easterly side of Alexander Street;

RUNNING THENCE in an easterly direction on a line having an interior angle of 87 degrees 22 minutes a distance of 242.00 feet 3 inches to the westerly line of land of the New York Central Railroad Company;

RUNNING THENCE in a southerly direction and along the westerly line of land of the New York Central Railroad Company, a distance of 80.00 feet 9 inches;

RUNNING THENCE in a westerly direction on a line parallel to the first mentioned course, a distance of 227.00 feet, to the easterly side of Alexander Street;

RUNNING THENCE in a northerly direction and along the easterly line of Alexander Street, a distance of 80.00 feet 1 inch to the point or place of BEGINNING.

PARCEL C (BLOCK 2608, LOT 29)

Parcel I

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, bounded and described as follows:

BEGINNING at a point on the southeasterly side of Alexander Street distant southerly 223.25 feet measured along the southeasterly side of Alexander Street from the corner formed by the intersections of the southerly side of Alexander Street with the southwesterly side of Ashburton Avenue;

RUNNING THENCE, in an easterly direction on a line with an interior angle of 88 degrees 09 minutes 00 seconds with the southeasterly side of Alexander Street, a distance of 254.82 feet to lands now or formerly of the New York Central Railroad-Hudson division;

THENCE, along said lands now or formerly of the New York Central Railroad-Hudson Division in a southerly direction and on a curve to the right with a radius of 2707.48 feet a distance of 86.18 feet to the northerly line of lands conveyed by Edna Schwarzstein to Otto Brehm, Inc. by deed dated 9/1/1949 recorded 9/2/1949 in Liber 4776 Cp. 194;

THENCE along said northerly line of lands of Otto Brehm, Inc. in a westerly direction a distance of 242.25 feet to the southeasterly side of Alexander Street;

THENCE in a northerly direction along the southeasterly side of Alexander Street on a line forming an interior angle of 92 degrees 38 minutes 00 seconds with the last mentioned course, a distance of 82.33 feet to the point and place of BEGINNING.

Parcel II

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, and more particularly bounded and described as follows:

BEGINNING at a point on the easterly side of Alexander Street, a public street 50.00 feet wide, distant 305.00 feet 7 inches southerly from the corner formed by the intersection of the southerly side of Ashburton Avenue, a public street 50.00 feet wide, and the said easterly side of Alexander Street;

RUNNING THENCE in an easterly direction on a line having an interior angle of 87 degrees 22 minutes a distance of 242.00 feet 3 inches to the westerly line of land of the New York Central Railroad Company;

RUNNING THENCE in a southerly direction and along the westerly line of land of the New York Central Railroad Company, a distance of 80.00 feet 9 inches;

RUNNING THENCE in a westerly direction on a line parallel to the first mentioned course, a distance of 227.00 feet, to the easterly side of Alexander Street;

RUNNING THENCE in a northerly direction and along the easterly line of Alexander Street, a distance of 80.00 feet 1 inch to the point or place of BEGINNING.

PARCEL D (BLOCK 2615, LOT 23)

ALL that certain plot, piece or parcel of land, with the buildings and improvements thereon erected, situate, lying and being in the City of Yonkers, County of Westchester and State of New York, bounded and described as follows:

BEGINNING at a point on the westerly side of Alexander Street distant as measured along said westerly line of Alexander Street, 125.00 feet northerly from a point where the said westerly side of Alexander Street would be intersected by the prolongation westerly of the center line of Ashburton Avenue;

THENCE running along said westerly side of Alexander Street, North 8 degrees 32 minutes 40 seconds East 176.98 feet to the Northeast corner of premises hereby described;

THENCE running North 81 degrees 27 minutes 20 seconds West 660.00 feet more or less to the approximate location of pier line fixed by City of Yonkers in 1886;

THENCE along same a distance of 176.98 feet more or less to the Southwest corner of premises hereby described and the northerly line of lands now or formerly of Polychrome Corporation;

THENCE running along said northerly line South 81 degrees 27 minutes 20 seconds East 660.00 feet more or less to the point of BEGINNING.



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

SCHEDULE B

Title No: 06-33086-W

Hereinafter set forth are additional matters which will appear in the policy as exceptions from coverage, unless disposed of to our satisfaction prior to the closing or delivery of the policy.

DISPOSITION

- 1. Rights of tenants or parties in possession, if any.
- 2. Taxes, tax liens, tax sales, water rates, sewer rents and assessments set forth in schedule herein.
- 3. Covenants, conditions, easements, leases, agreements of record as follows:
 - a) Terms and Conditions in Letters Patent recorded in Liber 465 Page 350, Liber 482 Page 61, and Liber 1196 Page 184 (affects Block 2615, Lots 1, 23, 29) (see within).
 - b) Subject to unrecorded written agreements with Hudson Fuel Company and Habershaw Athletic Association recited in Liber 4372 Page 482 (affects Block 2615, Lots 1, 29) (see within).
 - c) Agreement between Polychrome Corporation and City of Yonkers recorded in Liber 6463 Page 89 (affects Block 2615, Lots 1, 29) (see within).
 - d) Terms and Conditions in Letters Patent recorded in Liber 742 Page 47, and Liber 1120 Page 221 (affects Block 2608, Lots 29, 35, 37) (see within).
 - e) Right of Ways recorded in Liber 2559 Page 88, Liber 1916 Page 149, Liber 2494 Page 51, Liber 1751 Page 104, Liber 1736 Page 197, and Liber 1734 Page 327 (affects Block 2608, Lots 35 and 37) (see within).
 - f) Lease between Vangar Realty Corp. and The United States of America recorded 4/15/1957 in Liber 5690 Page 139 (affects Block 2608, Lot 29) (see within).
 - g) Covenant and Restriction in Liber 4776 Page 194 (affects Block 26087, Lot 29) (see within).
- 4. Mortgage(s): Four (4) as consolidated and held by Seamen's Bank for Savings in the City of New York (see schedule).
- 5. No title is insured to so much of the premises that lies in the bed of Ashburton Avenue, Alexander Street, or Polychrome Place.
- 6. Proof is required that record owner(s)/purchaser(s) have been known by no other names for the past ten years. If they have been known by any other names then proof is required that there are no Judgments or Federal Tax Liens against them under those names.

SCHEDULE B CONTINUED

- 7. Title is certified as above. Application shows **Sun Chemical Corp.** as record owner(s). This must be explained prior to closing. Additional exceptions may be raised.
- 8. Proposed Purchaser(s): SFC Sun, LLC has been run for Judgments and Liens with the following results: NONE FOUND OF RECORD.
- 9. Record Owner(s): Polychrome Corporation, Resin Realty Corporation, Polychrome Realty Corp., and Sun Chemical Corp. have been run for Judgments and Liens with the following results: NONE FOUND OF RECORD.
- 10. Polychrome Corporation has been run for Bankruptcy Searches with the following results: NONE FOUND.
- 11. Sun Chemical Corp. has been run for Bankruptcy Searches with the following results: NONE FOUND.
- 12. Resin Realty Corporation has been run for Bankruptcy Searches with the following results: NONE FOUND.
- 13. Polychrome Realty Corp. has been run for Bankruptcy Searches with the following results: NONE FOUND.
- 14. Subject to any state of facts an accurate survey would show.
- 15. Proof is required that New York State franchise taxes have been paid for Sun Chemical Corp., Polychrome Corporation, Resin Realty Corporation, and Polychrome Realty Corporation. (Note: Please advise company if a franchise tax report is required).
- Proof is required to show that Sun Chemical Corp., a Delaware Corporation, is in good standing in the State of Delaware and is authorized to do business in the State of New York and its license fees have been paid.
- 17. Deed by grantor must recite that it is made with the unanimous consent of its stockholders or that it was made in the usual course of its business or said corporation must submit a corporate resolution so stating.
- 18. Proof is required as to the following with regard to SFC Sun, LLC, a limited liability company:

a) Proof of due formation: Proof of filing of the Articles of Organization with the Secretary of State; and proof of publication of the Articles of Organization (or a notice containing the substance of the articles);

b) Articles of Organization and Operating Agreement must be produced and reviewed; additional exceptions may be raised upon review of same;

c) Proof is required that there has been no change in the makeup or composition of the organization, and that there have been no amendments made to the Articles of Organization or Operating Agreement;

d) Proof is required that the party or parties executing instruments on behalf of the organization have authority to act.

e) b. For a LLC filed after June 1, 2006, proof will be required to show filing of a certificate of

SCHEDULE B CONTINUED

publication and affidavits of publication must be filed with the Department of State within the 120 day period.

- 19. Riparian rights and easements of others to and over Hudson River, but policy does not insure any riparian rights or easements in favor of the owner of the premises herein.
- 20. No title is insured to any land lying below the present or any formerly high water line of Hudson River.
- 21. No title is insured to any portion or part of the premises herein within the lines of Hudson River which is not under solid fill.
- 22. Except the right of the United States Government to establish harbor, bulkhead or pierhead lines or to change or alter any such existing lines and to remove or compel the removal of fill and improvements thereon (including buildings or other structures) from land now or formerly lying below the high water mark of Hudson River without compensation to the insured.
- 23. Except the right of the United States Government, the State of New York and the City of Yonkers or any of their departments or agencies to regulate and control the use of the piers, bulkheads, land under water and land adjacent thereto.

24. CITY OF YONKERS MORTGAGE TAX

Any mortgage recorded which covers property in the City of Yonkers is subject to an additional 1/2% tax, to be paid by the mortgagor.

- 25. City of Yonkers Transfer Tax is due upon transfer of the premises (1.5% payable by seller).
- 26. Policy will except water and sewer charges not entered and/or water and sewer charges entered subsequent to date of last actual reading.
- To facilitate recording in Westchester County, please make all checks for recording fees, transfer and mortgage tax payable to Stewart Title.
- 28. All parties attending the closing will be required to furnish a picture ID to be copied.
- 29. All personal checks over \$500.00 must be approved by the Company PRIOR TO CLOSING.
- 30. Please visit our web site for Company approved forms, affidavits, instruments, useful links and directions to our office at <u>www.stewartwhiteplains.com</u>
- 31. Pursuant to CPLR Section 8019(B), all instruments presented to the Company for recording must be in a legible format for microfilming or imaging by the County Clerk or City Register. Company reserves the right to charge additional recording fees in the event the Company deems an instrument illegible for recording purposes.
- 32. The TP-584 (11/04 version) is the only form that will be accepted.

The form requires a transferor (individual, estate or trust) to affirm they are a New York State resident. If they are not a New York State resident, and the property is not their principal residence, a form IT-2663(2004) must be filed, along with payment of the estimated NYS Income tax. The company can file same for a fee of \$150.00. Copies of these forms are available on request.

SCHEDULE B CONTINUED

33. <u>For Information Only:</u> -The mortgage tax in Westchester County has increased an additional ¼%, payable by the borrower, for any mortgage **recorded** after March 1, 2004.



White Plains Office 707 Westchester Ave., Suite 411 White Plains, NY 10604 914-997-1698 fax 800-433-4698 stewart.com NYSE: STC

MORTGAGES

Title No: 06-33086-W

MORTGAGE (A)

Mortgagor: Resin Realty Corporation

Mortgagee: Socony-Vacuum Oil Company, Incorporated

Amount: Dated: Recorded: Liber: Page:

\$40,000.00 12/27/1944 12/29/1944 4261 487

Tax Paid: \$200.00

Affects Block 2608, Lots 35 and 37.

ASSIGNMENT OF MORTGAGE

Assignor: Socony-Vacuum Oil Company, Incorporated

Assignee: Seamen's Bank for Savings in the City of New York

Dated:7/21/1954Recorded:8/2/1954Liber:5370Page:263

Assigns Mortgage A.

MORTGAGE (B)

Mortgagor: Resin Realty Corporation

Mortgagee: Seamen's Bank for Savings in the City of New York

Amount: Dated: Recorded: Liber: Page:

7/29/1954 8/2/1954 5370 259

\$59,500.00

Tax Paid: \$297.50

Affects Block 2608, Lots 35 and 37.

CONSOLIDATION AND EXTENSION AGREEMENT

Resin Realty Corporation

WITH

Seamen's Bank for Savings in the City of New York

Dated:7/29/1954Recorded:8/2/1954Liber:5370Page:245

Mortgages A and B are consolidated to form a single lien of \$90,000.00.

MORTGAGE (C)

Mortgagor: **Resin Realty Corporation**

Seamen's Bank for Savings in the City of New York Mortgagee:

Amount: \$75,000.00 Dated: 5/19/1955 Recorded: 5/26/1955 Liber: Page:

5492 350

\$375.00 Tax Paid:

Affects Block 2608, Lots 35 and 37.

CONSOLIDATION AND EXTENSION AGREEMENT

Resin Realty Corporation

WITH

Seamen's Bank for Savings in the City of New York

9/30/1955 Dated: 10/10/1955 Recorded: Liber: 5562 Page: 63

Mortgages A, B, and C are consolidated to form a single lien of \$161,000.00.

MORTGAGE (D)

Mortgagor: Resin Realty Corporation

Mortgagee: Seamen's Bank for Savings

Amount: Dated:	\$106,805.32 6/10/1959
Recorded:	6/12/1959
Liber:	6044
Page:	252

Tax Paid: \$534.00

Affects Block 2608, Lots 35 and 37.

CONSOLIDATION AND EXTENSION AGREEMENT

Resin Realty Corporation

WITH

Seamen's Bank for Savings in the City of New York

Dated:	6/10/1959
Recorded:	6/12/1959
Liber:	6044
Page:	256

Mortgages A, B, C, and D are consolidated to form a single lien of \$235,000.00.

TITLE NO. 0513-33086E TX

ABSTRACTERS' INFORMATION SERVICE, INC.

1111 MARCUS AVENUE – SUITE MZ214 LAKE SUCCESS, N.Y. 11042 PHONE (516) 918-4600 FAX (516) 918-4540

WESTCHESTER COUNTY TAX SEARCH

PREMISES: 137 ALEXANDER STREET, YONKERS

DATE: 9/28/2006

CITY OF YONKERS

ACREAGE: 1.02 LOT SIZE: N/A ASSESSED OWNER: SUN CHEMICAL CORP

ASSESSED VALUE: CITY

30000/226700

TAX CLASSIFICATION: 700

SD: YONKERS SECTION: 2 BLOCK: 2615 LOT: 29 RETURNS

KETUKNS

SEC: 2 BLOCK: 2615 LOT: 29

2006 COUNTY TAX PERIOD 1/1-12/31 FULL TAX \$27,715.02 PAID DUE BY 4/10

2006/2007 CITY TAX PERIOD 7/1-6/30 1 1/3 TAX \$38,269.43 PAID DUE BY 7/24 2 1/3 TAX \$38,269.41 PAID DUE BY 10/6 3 1/3 TAX \$38,269.41 OPEN DUE BY 1/8 NOTE: INCLUDES SUNDRY OF \$69.00

WATER DISTRICT - YONKERS ACCOUNT #204106144 PERIOD ENDING: 08/31/06 AMOUNT: \$2,813.82 OPEN

ACCOUNT #204106146 PERIOD ENDING: 08/31/06 AMOUNT: \$1,660.14 OPEN

ACCOUNT #999920740 PERIOD ENDING: 06/30/06 AMOUNT: \$60.00 PAID

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.


SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY on 9/28/2006. 05 I3-33086E Title Number: 0513-33086E

NOTE: UP-TO-DATE BILL OR RECEIPT MUST BE PRODUCED AT CLOSING. SUBJECT TO PRIOR WATER/SEWER CHARGES NOT ENTERED AND SUBSEQUENT WATER CHARGES SINCE DATE OF LAST READING.

SUBJECT TO CONTINUATION PRIOR TO CLOSING.

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY on 9/28/2006. 0513-33086E

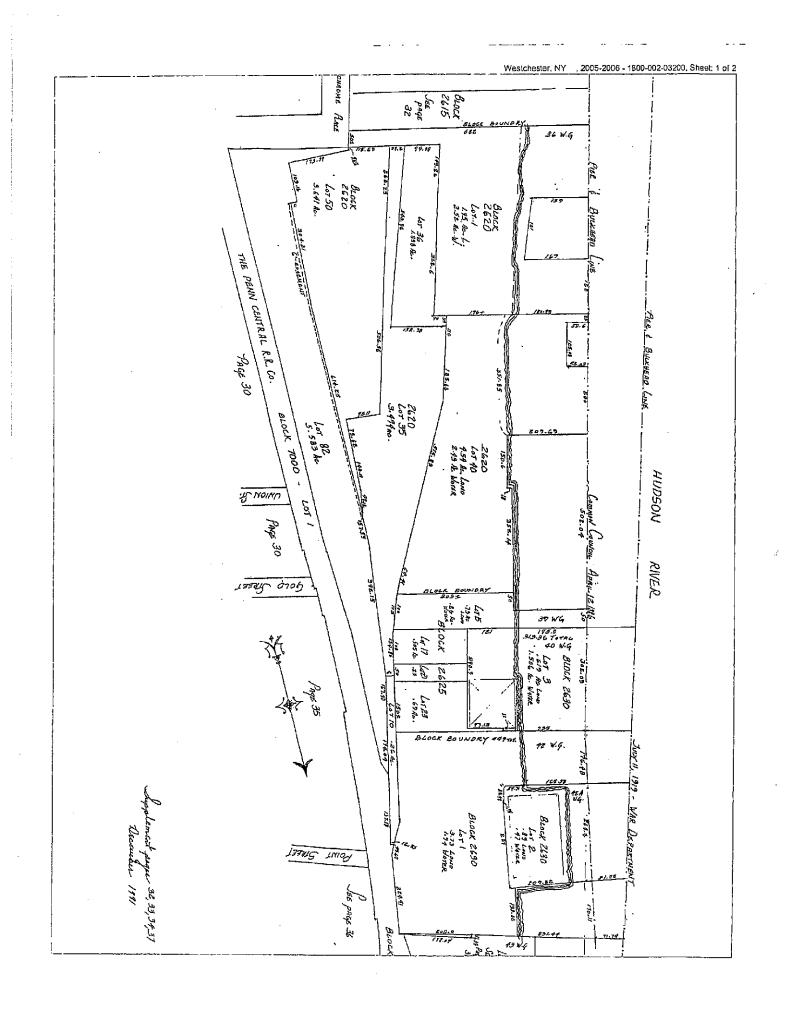

TITLE NO. 0513-33086D TX

ABSTRACTERS' INFORMATION SERVICE, INC.

1111 MARCUS AVENUE – SUITE MZ214 LAKE SUCCESS, N.Y. 11042 PHONE (516) 918-4600 FAX (516) 918-4540

WESTCHESTER COUNTY TAX SEARCH

DATE: 9/28/2006

PREMISES: 145 ALEXANDER STREET, YONKERS

CITY OF YONKERS

ACREAGE: 1.56 LOT SIZE: N/A ASSESSED OWNER: SUN CHEMICAL CORP

ASSESSED VALUE: CITY

50000/127300

TAX CLASSIFICATION: 700

SD: YONKERS SECTION: 2 BLOCK: 2615 LOT: 23

RETURNS

SEC: 2 BLOCK: 2615 LOT: 23

2006 COUNTY TAX PERIOD 1/1-12/31 FULL TAX \$15,727.38 PAID DUE BY 4/10

2006/2007 CITY TAX PERIOD 7/1-6/30 1 1/3 TAX \$21,709.97 PAID DUE BY 7/24 2 1/3 TAX \$21,709.95 PAID DUE BY 10/6 3 1/3 TAX \$21,709.95 OPEN DUE BY 1/8 NOTE: INCLUDES SUNDRY OF \$92.00

WATER DISTRICT - YONKERS ACCOUNT #204106152 PERIOD ENDING: 08/31/06 AMOUNT: \$34.50 OPEN

ACCOUNT #999920735 PERIOD ENDING: 06/30/06 AMOUNT: \$80.00 PAID


NOTE: UP-TO-DATE BILL OR RECEIPT MUST BE PRODUCED AT CLOSING. SUBJECT TO PRIOR WATER/SEWER CHARGES NOT ENTERED AND SUBSEQUENT WATER CHARGES SINCE DATE OF LAST READING.

SUBJECT TO CONTINUATION PRIOR TO CLOSING.

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY oN 9/28/2006. 0513-33086D

Page 1 of 1

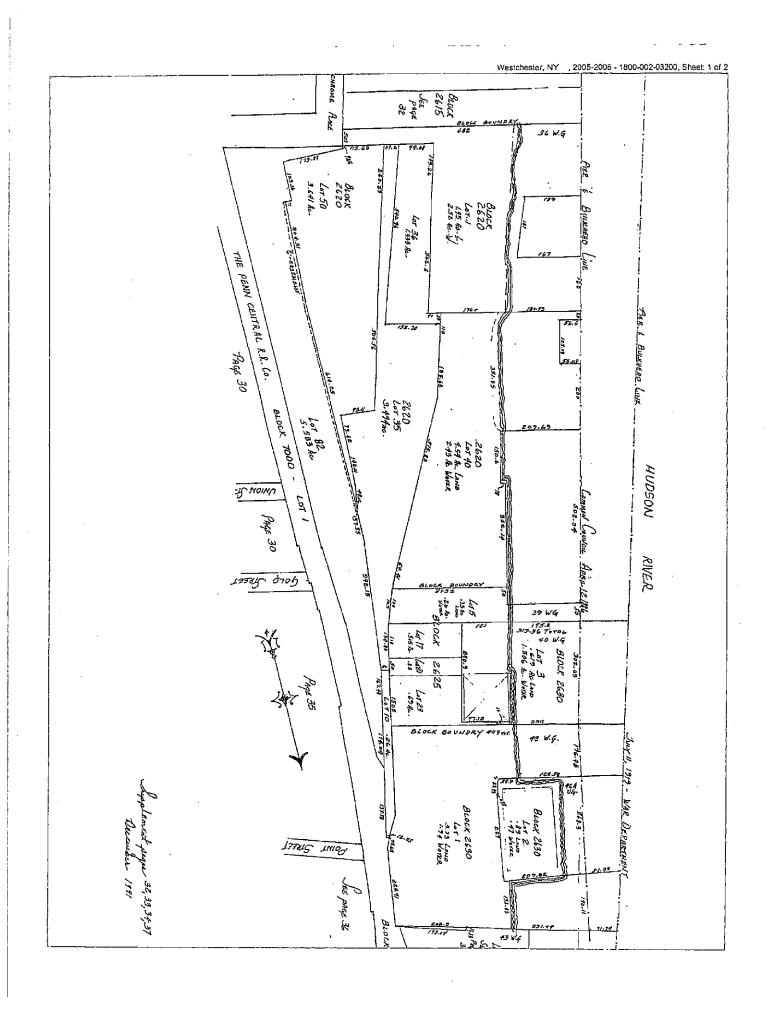

TITLE NO. 0513-33086B TX

ABSTRACTERS' INFORMATION SERVICE, INC.

1111 MARCUS AVENUE – SUITE M2214 LAKE SUCCESS, N.Y. 11042 PHONE (516) 918-4600 FAX (516) 918-4540

WESTCHESTER COUNTY TAX SEARCH

DATE: 9/28/2006

PREMISES: 94 ALEXANDER STREET, YONKERS

CITY OF YONKERS

ACREAGE: 1.32 LOT SIZE: N/A ASSESSED OWNER: SUN CHEMICAL CORP

ASSESSED VALUE: CITY

33400/97500

TAX CLASSIFICATION: 700

SD: YONKERS SECTION: 2 BLOCK: 2608 LOT: 35, 37

RETURNS

SEC: 2 BLOCK: 2608 LOT: 35, 37

2006 COUNTY TAX PERIOD 1/1-12/31 FULL TAX \$12,133.51 PAID DUE BY 4/10

2006/2007 CITY TAX PERIOD 7/1-6/30 1 1/3 TAX \$16,756.02 PAID DUE BY 7/24 2 1/3 TAX \$16,756.01 PAID DUE BY 10/6 3 1/3 TAX \$16,756.01 OPEN DUE BY 1/8 NOTE: INCLUDES SUNDRY OF \$379.29

WATER DISTRICT - YONKERS ACCOUNT #204106270 PERIOD ENDING: 08/31/06 AMOUNT: \$69.00 OPEN

ACCOUNT #204106273 PERIOD ENDING: 08/31/06 AMOUNT: \$34.50 OPEN

ACCOUNT #204106274 PERIOD ENDING: 08/31/06 AMOUNT: \$34.50 OPEN

SEE PAGE 2 FOR ADDIIONAL WATER INFORMATION

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY ON 9/28/2006. 0513-3308/6B

Page 1 of 2

Title Number : 0513-33086B ACCOUNT #204106278 PERIOD ENDING: 08/31/06 AMOUNT: \$34.50 OPEN

> ACCOUNT #204106280 PERIOD ENDING: 08/31/06 AMOUNT: \$295.32 OPEN


NOTE: UP-TO-DATE BILL OR RECEIPT MUST BE PRODUCED AT CLOSING. SUBJECT TO PRIOR WATER/SEWER CHARGES NOT ENTERED AND SUBSEQUENT WATER CHARGES SINCE DATE OF LAST READING.

SUBJECT TO CONTINUATION PRIOR TO CLOSING.

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY on 9/28/2006. 0513-33086B

Page 2 of 2

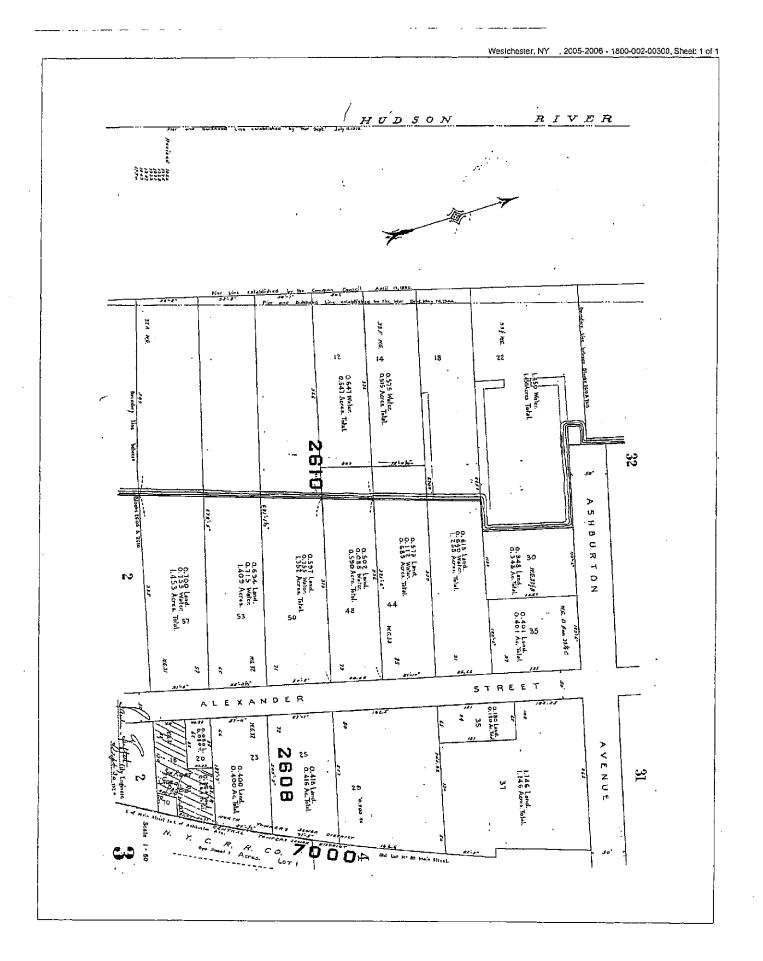

TITLE NO. 0513-33086A TX

ABSTRACTERS' INFORMATION SERVICE, INC.

1111 MARCUS AVENUE – SUITE MZ214 LAKE SUCCESS, N.Y. 11042 PHONE (516) 918-4600 FAX (516) 918-4540

WESTCHESTER COUNTY TAX SEARCH

DATE: 9/28/2006

PREMISES: 80 ALEXANDER STREET, YONKERS

CITY OF YONKERS

ACREAGE: 0.90 LOT SIZE: N/A ASSESSED OWNER: SUN CHEMICAL CORP

ASSESSED VALUE: CITY

39200/52000

TAX CLASSIFICATION: 700

SD: YONKERS SECTION: 2 BLOCK: 2608 LOT: 29

RETURNS

SEC: 2 BLOCK: 2608 LOT: 29

2006 COUNTY TAX PERIOD 1/1-12/31 FULL TAX \$6,646.20 PAID DUE BY 4/10

2006/2007 CITY TAX PERIOD 7/1-6/30 1 1/3 TAX \$8,908.20 PAID DUE BY 7/24 2 1/3 TAX \$8,908.18 PAID DUE BY 10/6 3 1/3 TAX \$8,908.18 OPEN DUE BY 1/8

WATER DISTRICT - YONKERS ACCOUNT #204106296 PERIOD ENDING: 08/31/06 AMOUNT: \$1,101.24 OPEN

ACCOUNT #204106288 PERIOD ENDING: 08/31/06 AMOUNT: \$5,072.88 OPEN

ACCOUNT #999920728 PERIOD ENDING: 06/30/06 AMOUNT: \$60.00 OPEN

NOTE: UP-TO-DATE BILL OR RECEIPT MUST BE PRODUCED AT CLOSING. SUBJECT TO PRIOR WATER/SEWER CHARGES NOT ENTERED AND SUBSEQUENT WATER CHARGES SINCE DATE OF LAST READING.


AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY on 9/28/2006. 0513-33086A Title Number: 0513-33086A

SUBJECT TO CONTINUATION PRIOR TO CLOSING.

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING. SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY ON 9/28/2006. 0513-33086A

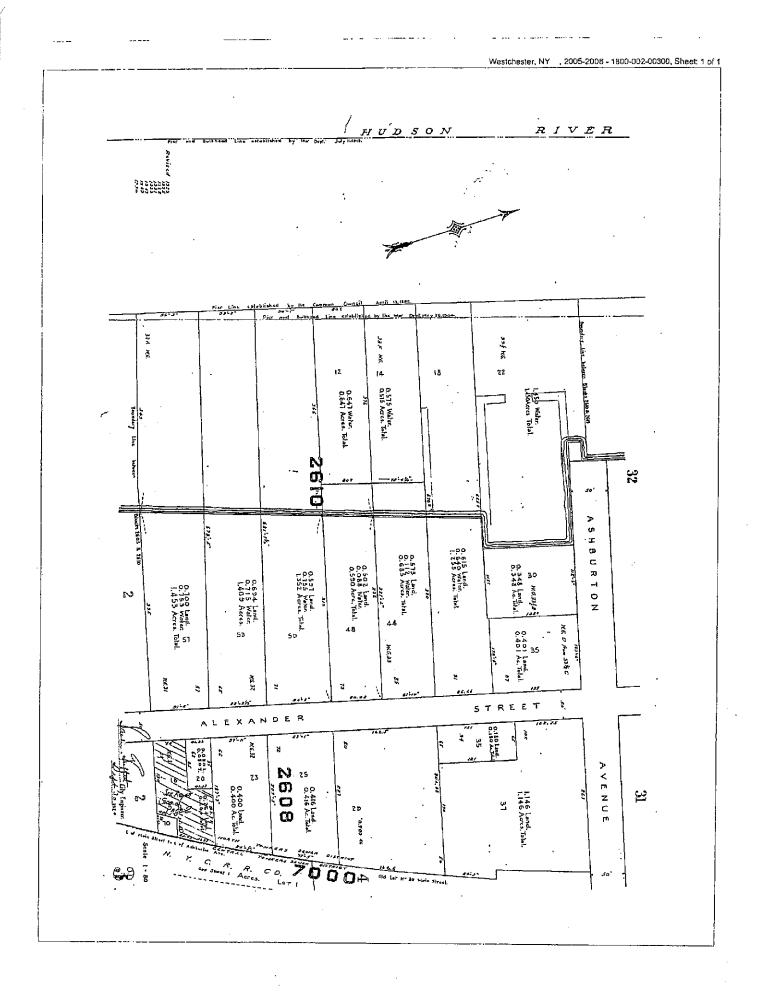

TITLE NO. 0513-33086C TX

ABSTRACTERS' INFORMATION SERVICE, INC.

1111 MARCUS AVENUE – SUITE MZ214 LAKE SUCCESS, N.Y. 11042 PHONE (516) 918-4600 FAX (516) 918-4540

WESTCHESTER COUNTY TAX SEARCH

DATE: 9/28/2006

PREMISES: 35 WATER GRANT, YONKERS

CITY OF YONKERS

ACREAGE: 0.87 LOT SIZE: N/A ASSESSED OWNER: SUN CHEMICAL CORP

ASSESSED VALUE: CITY

9500/9500

TAX CLASSIFICATION: 340

SD: YONKERS SECTION: 2 BLOCK: 2615 LOT: 1 RETURNS

SEC: 2 BLOCK: 2615 LOT: 1

2006 COUNTY TAX PERIOD 1/1-12/31 FULL TAX \$1,145.71 PAID DUE BY 4/10

2006/2007 CITY TAX PERIOD 7/1-6/30 1 1/3 TAX \$1,594.05 PAID DUE BY 7/24 2 1/3 TAX \$1,594.03 PAID DUE BY 10/6 3 1/3 TAX \$1,594.03 OPEN DUE BY 1/8


WATER - VACANT

SUBJECT TO CONTINUATION PRIOR TO CLOSING

AFFIDAVIT SHOULD BE TAKEN AT CLOSING THAT OWNER HAS NOT RECEIVED NOTICE OF SPECIAL ASSESSMENTS (I.E., SIDEWALK REPAIRS, LOT CLEARANCE, OR EMERGENCY REPAIRS). TAX SEARCH DOES NOT GUARANTEE AGAINST EXISTENCE OF SUCH NOTICES. TAX DUE DATES MAY VARY ANNUALLY. PLEASE CONFIRM DUE DATES WITH THE APPROPRIATE MUNICIPALITY.

SEARCH DOES NOT GUARANTEE AGAINST ITEMS NOT A LIEN UP TO THE DATE SHOWN. SOME OF THE ITEMS RETURNED MAY HAVE BEEN PAID BUT NOT OFFICIALLY POSTED. RECEIPTS FOR SUCH ITEMS SHOULD BE PRODUCED AT CLOSING, SEARCH DOES NOT GUARANTEE AGAINST CLAIMS RESULTING FROM LEVIES OF RESTORED TAXES. SEARCH DOES NOT GUARANTEE FOR ARREARS FILED AGAINST ANY NAME OTHER THAN THE ASSESSED OWNER AS SHOWN ABOVE. THIS SEARCH IS PREPARED EXCLUSIVELY FOR STEWART TITLE INSURANCE COMPANY on 9/28/2006. 0513-33086C

Page 1 of 1

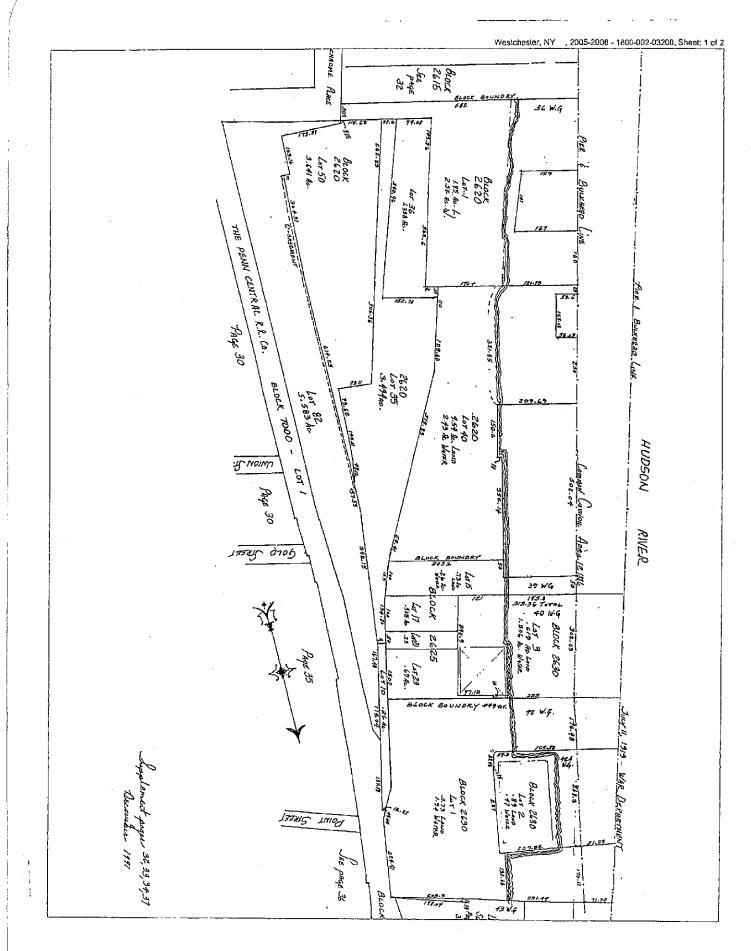

~.