

# PHASE I ENVIRONMENTAL SITE ASSESSMENT REPORT

JPMC Branch Portfolio - New Rochelle Main Street 491 Main Street New Rochelle, New York 10801

Date Issued: October 14, 2016 Partner Project No. 16-171696.29



**Prepared For** 

**Fortress Investment Group, LLC** 10250 Constellation Boulevard Los Angeles, California 90067



October 14, 2016

Mr. Joshua Pack Fortress Investment Group, LLC 10250 Constellation Boulevard Los Angeles, California 90067

Subject: Phase I Environmental Site Assessment JPMC Branch Portfolio 491 Main Street New Rochelle, New York 10801

Partner Project No. 16-171696.29

Dear Mr. Pack:

Partner Assessment Corporation (Partner) is pleased to provide the results of the *Phase I Environmental Site Assessment* (ESA) report of the above-mentioned address (the "subject property"). This assessment was performed in general conformance with the scope and limitations as detailed in the ASTM Practice E1527-13 Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process.

This assessment included a site reconnaissance, as well as research and interviews with representatives of the public, property ownership, site manager and regulatory agencies. An assessment was made, conclusions stated and recommendations outlined.

We appreciate the opportunity to provide environmental services to you. If you have any questions concerning this report, or if we can assist you in any other matter, please contact me at (310) 615-4500.

Sincerely,

#### PARTNER ASSESSMENT CORPORATION

Chris Gregor Relationship Manager

# **EXECUTIVE SUMMARY**

Partner Assessment Corporation (Partner) has performed a Phase I Environmental Site Assessment (ESA) in general accordance with the scope of work and limitations of ASTM Standard Practice E1527-13, the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) and set forth by Fortress Investment Group, LLC for the property located at 491 Main Street in the City of New Rochelle, Westchester County, New York (the "subject property"). This ESA is designed to provide Fortress Investment Group, LLC with an assessment concerning environmental conditions (limited to those issues identified in the report) as they exist at the subject property.

#### **Property Description**

The subject property is located on the northern corner of Main Street, and Lawton Street, within a mixed commercial area of Westchester County. Please refer to the table below for further description of the subject property:

Subject Property Data	
Address:	491 Main Street, New Rochelle, New York
Additional Address:	493 Main Street
Historical Addresses:	117, 118 Lawton Street / 613, 611 Main Street / 1, 5 A7B, A8B
	Lawton Street / 213, 215 Main Street
Property Use:	Commercial
Land Acreage (Ac):	0.43
Number of Buildings:	1
Number of Floors:	3
Gross Building Area (SF):	20,923
Net Rentable Area (SF):	18,320
Date of Construction:	circa 1918
Assessor's Parcel Number (APN):	1-229-0009
Type of Construction:	brick foundation, wood framing, brick masonry and stucco
Current Tenants:	Chase Bank
Site Assessment Performed By:	Candice Soder of Partner
Site Assessment Conducted On:	October 6, 2016

The subject property consists of a three-story structure with a basement. The subject property is currently occupied by Chase Bank for commercial use. On-site operations consist of banking services on the first floor, with unused office spaces on the second and third floors. In addition to the current structure, the subject property is improved with asphalt-paved parking and storm water drains.

According to available historical sources, The subject property was previous developed with commercial structures and out buildings (1887); developed with a commercial structures and out buildings, and a residential structure (1896); developed with two commercial structures and out buildings (1903); developed with a one story bank, and a commercial structure (1911); and developed with the current bank building *circa* 1918.



Tenants on the subject property have included a saloon, tailor, residential tenants, a grocery store, a hardware store, a stable and a hand laundry facility (1887-1903); the National City Bank of New Rochelle and four commercial store fronts (1911); and multiple bank tenants (1931-Present).

The immediately surrounding properties consist of a parking lot to the north, along Lawton Street; Alicia's Bakery, Korean BBQ Grill, Fancy Photo (494-498 Main Street), Nick's New Hair Design, Jay's Boutique, Natural Nails and Family & Cosmetic Dentistry (490A-D Main Street) to the south, across Main Street; Restaurant Pizza, Nail City, Midea Shoes, El Michoacano (487 Main street) and an indoor shopping center (481 Main Street) to the east, along Main Street; and The Mexican Corner Restaurant, Patrias Restaurant (497 Main Street) and Schweiger Dermatology-New Rochelle (14 Lawton Street) to the west, across Lawton Street.

According to on-line research, the depth of groundwater in the vicinity of the subject property is inferred to be approximately 10 to 15 feet below ground surface (bgs) and the direction of flow is toward the east.

#### Findings

A *recognized environmental condition (REC)* refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment. The following was identified during the course of this assessment:

 According to the regulatory database report and a Westchester County Health Department (WCHD) Petroleum Bulk Storage (PBS) Registration Certificate (PBS No. 3-164372), the subject property is identified as having operated a 2,000-gallon, steel underground storage tank (UST) that was closed-inplace as of April 5, 1990. The date of installation of the UST was not identified.

Partner's review of the regulatory database report also revealed that on August 23, 1989, a UST on the subject property failed a tank tightness test. A Leaking Tanks (LTANKS) listing for the subject property in the database report identified the tank as a 1,500-gallon, #2 fuel oil UST. No material was reported as released; however, limited information regarding the LTANKS case is available. Additionally, it was identified that the 1,500-gallon UST was removed in March 1991 and replaced (replacement information was not identified).

No other information regarding the 2,000-gallon or 1,500-gallon USTs was available. It is suspected that at least one of the USTs was installed along Main Street, as a fill pipe and two vent pipes were observed near the southeast corner of the subject property building. Partner presumes that the fill pipe and one of the vent pipes are associated with an active, 1,500-gallon aboveground storage tank (AST) observed during the site reconnaissance (further discussed below). The second observed vent pipe is presumed to have been associated with one of the former USTs.

Based on the information available to Partner, it appears that two USTs may have operated on the subject property. The lack of closure documentation for the USTs, along with the lack of information pertaining to the LTANKS case, is considered by Partner to represent a REC.



A *controlled recognized environmental condition (CREC)* refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls.

• Partner did not identify any CRECs during the course of this assessment.

A *historical recognized environmental condition (HREC)* refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls.

• Partner did not identify any HRECs during the course of this assessment.

An *environmental issue* refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion. The following was identified during the course of this assessment:

- Partner observed one, 1,500-gallon, #2 fuel oil AST located within an accessible vault in the basement of the subject building. The steel AST is located on the southeast portion of the subject property and a fill and vent pipe were observed adjacent to the AST's interior location, along Main Street. The AST is equipped with overfill protection in the form of a vent whistle. According to WCHD PBS records, the in-service AST was installed in 1997 and was last tested on March 1, 2011. The next test date is not listed. Based on the observed good condition of the AST, aboveground location, lack of staining and presence of overfill protection, this AST is not considered by Partner to represent an environmental concern at this time.
- Due to the age of the subject property building, the potential exists that asbestos-containing materials (ACMs) are present on-site. Overall, all suspect ACMs were observed in good condition and do not pose a health and safety concern to the occupants of the subject property.
- One area of mold growth was observed on the drywall within a basement closet. Based on the limited area of impact, approximately five square feet, the observed mold growth is not considered an environmental concern.

# Conclusions, Opinions and Recommendations

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of 491 Main Street in the City of New Rochelle, Westchester County, New York (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.

This assessment has revealed evidence of an REC and environmental issues in connection with the subject property. Based on the conclusions of this assessment, Partner recommends the following:



• The completion of a limited subsurface investigation appears warranted in order to determine the presence or absence of soil and/or groundwater contamination at the subject property in connection with the aforementioned USTs and associated LTANKS case.



# TABLE OF CONTENTS

1.0	INTRO	DDUCTION	1
1.1	Purp	)OSE	1
1.2	Scop	be of Work	1
1.3	Limi	tations	2
1.4	User	Reliance	3
1.5	Limi	ting Conditions	3
2.0	SITE D	DESCRIPTION	5
2.1	Site	Location and Legal Description	5
2.2		ent Property Use	
2.3	Curr	ent Use of Adjacent Properties	5
2.4	Phys	ical Setting Sources	6
2.4	4.1	Topography	6
2.4	4.2	Hydrology	6
2.4	4.3	Geology/Soils	
2.4	4.4	Flood Zone Information	7
3.0	HISTO	DRICAL INFORMATION	8
3.1	Aeri	al Photograph Review	8
3.2	Fire	Insurance Maps	9
3.3	City	Directories	11
3.4	Histo	orical Topographic Maps	13
4.0	REGU	LATORY RECORDS REVIEW	15
4.	1.1	State Department	15
4.	1.2	Health Department	15
4.	1.3	Assessor's Office	16
4.	1.4	Building Department	16
4.	1.5	Planning Department	16
4.	1.6	Fire Department	17
4.	1.10	Oil & Gas Exploration	17
4.2	Мар	ped Database Records Search	
4.	2.1	Regulatory Database Summary	
	2.2	Subject Property Listings	
	2.3	Adjacent Property Listings	
	2.4	Sites of Concern Listings	
4.	2.5	Orphan Listings	20
5.0	USER	PROVIDED INFORMATION AND INTERVIEWS	21
5.1	Inter	views	21
5.	1.1	Interview with Owner	
5.	1.2	Interview with Report User	
	1.3	Interview with Key Site Manager	
	1.4	Interviews with Past Owners, Operators and Occupants	
	1.5	Interview with Others	
5.2	User	Provided Information	22



5.2.1	L Title Records, Environmental Liens and AULs	
5.2.2		
5.2.3		
5.2.4	-	
5.2.	5 Commonly Known or Reasonably Ascertainable Information	
5.2.0	5 Previous Reports and Other Provided Documentation	
6.0 9	ITE RECONNAISSANCE	24
6.1	General Site Characteristics	
6.2	Potential Environmental Hazards	
6.3	Non-ASTM Services	
6.3.3		
6.3.2	2 Lead-Based Paint (LBP)	
6.3.3		
6.3.4	Lead in Drinking Water	
6.3.		
6.4	Adjacent Property Reconnaissance	
7.0 F	INDINGS AND CONCLUSIONS	
8.0 9	IGNATURES OF ENVIRONMENTAL PROFESSIONALS	32
9.0 F	REFERENCES	

# <u>Figures</u>

Figure 1	Site Location Map
Figure 2	Site Plan
Figure 3	Topographic Map

# **Appendices**

- Appendix A Site Photographs
- Appendix BHistorical/Regulatory/Supporting Documentation
- Appendix C Regulatory Database Report
- Appendix D Qualifications



# **1.0 INTRODUCTION**

Partner Assessment Corporation (Partner) has performed a Phase I Environmental Site Assessment (ESA) in general conformance with the scope and limitations of ASTM Standard Practice E1527-13 and the Environmental Protection Agency Standards and Practices for All Appropriate Inquiries (AAI) (40 CFR Part 312) for the property located at 491 Main Street in the City of New Rochelle, Westchester County, New York (the "subject property"). Any exceptions to, or deletions from, this scope of work are described in the report.

# 1.1 Purpose

The purpose of this ESA is to identify existing or potential Recognized Environmental Conditions (as defined by ASTM Standard E1527-13) affecting the subject property that: 1) constitute or result in a material violation or a potential material violation of any applicable environmental law; 2) impose any material constraints on the operation of the subject property or require a material change in the use thereof; 3) require clean-up, remedial action or other response with respect to Hazardous Substances or Petroleum Products on or affecting the subject property under any applicable environmental law; 4) may affect the value of the subject property; and 5) may require specific actions to be performed with regard to such conditions and circumstances.

The information contained in the ESA Report will be used by Client to: 1) evaluate its legal and financial liabilities for transactions related to foreclosure, purchase, sale, loan origination, loan workout or seller financing; 2) evaluate the subject property's overall development potential, the associated market value and the impact of applicable laws that restrict financial and other types of assistance for the future development of the subject property; and/or 3) determine whether specific actions are required to be performed prior to the foreclosure, purchase, sale, loan origination, loan workout or seller financing of the subject property.

This ESA was performed to permit the *User* to satisfy one of the requirements to qualify for the innocent landowner, contiguous property owner, or bona fide prospective purchaser limitations on scope of Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) (42 U.S.C. §9601) liability (hereinafter, the *"landowner liability protections,"* or *"LLPs"*). ASTM Standard E1527-13 constitutes *"all appropriate inquiry* into the previous ownership and uses of the *property* consistent with good commercial or customary practice" as defined at 42 U.S.C. §9601(35)(B).

# 1.2 Scope of Work

The scope of work for this ESA is in general accordance with the requirements of ASTM Standard E1527-13. This assessment included: 1) a property and adjacent site reconnaissance; 2) interviews with key personnel; 3) a review of historical sources; 4) a review of regulatory agency records; and 5) a review of a regulatory database report provided by a third-party vendor. Partner contacted local agencies, such as environmental health departments, fire departments and building departments in order to determine any current and/or former hazardous substances usage, storage and/or releases of hazardous substances on the subject property. Additionally, Partner researched information on the presence of activity and use limitations (AULs) at these agencies.



As defined by ASTM E1527-13, AULs are the legal or physical restrictions or limitations on the use of, or access to, a site or facility: 1) to reduce or eliminate potential exposure to hazardous substances or petroleum products in the soil or groundwater on the subject property; or 2) to prevent activities that could interfere with the effectiveness of a response action, in order to ensure maintenance of a condition of no significant risk to public health or the environment. These legal or physical restrictions, which may include institutional and/or engineering controls (IC/ECs), are intended to prevent adverse impacts to individuals or populations that may be exposed to hazardous substances and petroleum products in the soil or groundwater on the property.

If requested by Client, this report may also include the identification, discussion of, and/or limited sampling of asbestos-containing materials (ACMs), lead-based paint (LBP), mold and/or radon.

#### 1.3 Limitations

Partner warrants that the findings and conclusions contained herein were accomplished in accordance with the methodologies set forth in the Scope of Work. These methodologies are described as representing good commercial and customary practice for conducting an ESA of a property for the purpose of identifying recognized environmental conditions. There is a possibility that even with the proper application of these methodologies there may exist on the subject property conditions that could not be identified within the scope of the assessment or which were not reasonably identifiable from the available information. Partner believes that the information obtained from the record review and the interviews concerning the subject property is reliable. However, Partner cannot and does not warrant or guarantee that the information provided by these other sources is accurate or complete. The conclusions and findings set forth in this report are based solely on the services described therein, and not on scientific tasks or procedures beyond the scope of agreed-upon services or the time and budgeting restraints imposed by the Client. No other warranties are implied or expressed.

Some of the information provided in this report is based upon personal interviews, and research of available documents, records, and maps held by the appropriate government and private agencies. This report is subject to the limitations of historical documentation, availability, and accuracy of pertinent records, and the personal recollections of those persons contacted.

This practice does not address requirements of any state or local laws or of any federal laws other than the all appropriate inquiry provisions of the LLPs. Further, this report does not intend to address all of the safety concerns, if any, associated with the subject property.

Environmental concerns, which are beyond the scope of a Phase I ESA as defined by ASTM include the following: ACMs, LBP, radon and lead in drinking water. These issues may affect environmental risk at the subject property and may warrant discussion and/or assessment; however, are considered non-scope issues. If specifically requested by the Client, these non-scope issues are discussed in Section 6.3.



#### 1.4 User Reliance

This Report is for the use and benefit of, and may be relied upon by, Fortress Credit Co LLC, Fortress Credit Corp., Fortress Credit Advisors LLC, Fortress Real Estate Opportunities Advisors LLC, Drawbridge Special Opportunities Fund LP, any fund or account managed directly or indirectly by Fortress Investment Group LLC, and any of its and their respective assigns, affiliates, agents and advisors; any initial and subsequent holders from time to time of any debt and/or securities backed in whole or in part, directly or indirectly, by assets covered by this Report; any initial and subsequent holders of any participation or beneficial interest in any such debt and/or securities; any trustee, servicer or other agent acting on behalf of holders of such debt and/or securities; any rating agencies providing ratings to any such securities; and any institutional providers from time to time of any liquidity facility or credit support for the financing of any such debt and/or a reference to this Report may be included or quoted in any offering circular, registration statement, prospectus or sales brochure (in either electronic or hard copy format) in connection with a securitization, syndication or similar transaction involving such debt and/or such securities.

#### 1.5 Limiting Conditions

The findings and conclusions contain all of the limitations inherent in these methodologies that are referred to in ASTM E1527-13.

Specific limitations and exceptions to this ESA are more specifically set forth below:

- Interviews with past or current owners, operators and occupants were not reasonably-ascertainable and thus constitute a data gap. Based on information obtained from other historical sources (as discussed in Section 3.0), this data gap is not expected to alter the findings of this assessment.
- Partner requested information relative to deed restrictions and environmental liens, a title search and completion of a user questionnaire from the Client. This information was not provided at the time of the assessment.
- Partner was not able to document the historical use of the subject property prior to 1887. The following sources were reviewed during the course of this assessment and found to be limited: aerial photographs were not available prior to 1946; city directories were not available prior to 1972; topographic maps prior to 1898 were not reasonably ascertainable from local agencies; and fire insurance maps prior to 1887. This data failure is not considered critical and does not change the conclusions of this report, as the 1887 Sanborn map revealed the subject property to be developed with a two-story commercial structure, an additional one story-structure and two associated one-story structures, and a small portion of a two-story commercial structure. In addition, the adjacent and surrounding areas are also shown mostly as developed.



 Partner was unable to determine the property use at 5-year intervals, which constitutes a data gap. Information concerning historical use of the subject property was unavailable from 1887 to 1896, 1896 to 1903, 1903 to 1911 and 1911 to 1918. Except for property tax files and recorded land title records, which were not considered to be sufficiently useful, Partner reviewed all standard historical sources and conducted appropriate interviews.

Due to time constraints associated with this report, the Client has requested the report despite the abovelisted limitations.



# 2.0 SITE DESCRIPTION

# 2.1 Site Location and Legal Description

The subject property, addressed at 491 Main Street in New Rochelle, New York, is located on the northern corner of Main Street, and Lawton Street. According to the building records, the subject property is legally described as *1-229-0009*. Ownership is currently vested in JPMorgan Chase Bank (since 2007).

Please refer to Figure 1: Site Location Map, Figure 2: Site Plan, Figure 3: Topographic Map and Appendix A: Site Photographs for the location and site characteristics of the subject property.

# 2.2 Current Property Use

The subject property consists of a three-story structure with a basement. The subject property is currently occupied by Chase Bank for commercial use. Onsite operations consist of banking services on the first floor, and unused office spaces on the second and third floors. In addition to the current structure, the subject property is improved with asphalt-paved parking, and storm water drains.

The subject property is zoned "DB" for Downtown Business development by the City of New Rochelle.

The subject property is identified as a New York AST, a NY UST, and NY LTANKS site in the regulatory database report, as further discussed in Section 4.2.

#### 2.3 Current Use of Adjacent Properties

During the vicinity reconnaissance, Partner observed the following land use on properties in the immediate vicinity of the subject property:

Immedi	ately Surrounding Properties
North:	Parking lot
South:	Alicia's Bakery, Korean BBQ Grill, Fancy Photo (494-498 Main Street); Nick's New Hair Design,
	Jay's Boutique, Natural Nails, Family & Cosmetic Dentistry (490A-D Main Street)
East:	Restaurant Pizza, Nail City, Midea Shoes, El Michoacano (487 Main street); Indoor shopping
	center (481 Main Street)
West:	The Mexican Corner Restaurant, Patrias Restaurant (497 Main Street); Schweiger Dermatology-
	New Rochelle (14 Lawton Street)

The adjacent property to the east is identified as a NY UST, NY Spills, and an EDR Hist Cleaners site, as further discussed in the regulatory database report of Section 4.2.

The adjacent property to the south is identified as a NY Spills, Resource Conservation and Recovery Act Non Generator (RCRA Non Gen), Facility Index System (FINDS), New York Manifest (NY Manifest), and an Enforcement and Compliance History Information (ECHO) site, as further discussed in the regulatory database report of Section 4.2.



# 2.4 Physical Setting Sources

# 2.4.1 Topography

The United States Geological Survey (USGS) *Mount Vernon, New York* Quadrangle 7.5-minute series topographic map was reviewed for this ESA. According to the contour lines on the topographic map, the subject property is located at approximately 94 feet above mean sea level (MSL). The contour lines in the area of the subject property indicate the area is sloping moderately toward the east. The subject property is depicted on the 1995 map as shaded to indicate dense urban development.

A copy of the most recent topographic map is included as Figure 3 of this report.

# 2.4.2 Hydrology

According to topographic map interpretation, the direction of groundwater in the vicinity of the subject property is inferred to flow toward the east. The nearest surface water in the vicinity of the subject property is the Ferris Creek, which is located approximately 0.54 miles east of the subject property. No settling ponds, lagoons, surface impoundments, wetlands or natural catch basins were observed at the subject property during this assessment.

According to available information, a public water system operated by Suez serves the subject property vicinity. According to the 2016 Suez, Water Quality Report, shallow groundwater beneath the subject property is not utilized for domestic purposes. The sources of public water for the City of New Rochelle are surface water from the protected watershed areas 120 miles northwest of New Rochelle in the Catskill Mountains after which it travels through a New York City owned system.

Information specific to the subject property regarding the depth to groundwater and direction of groundwater flow was not available for the subject area. However, according to information obtained from on-line research, depth to the high water table is anticipated between 10 to 15 feet below ground surface (bgs).

# 2.4.3 Geology/Soils

The subject property is situated within the northeastern portion of the Hudson River Valley, on the eastern edge of the Atlantic Coastal Plain physiographic province of the State of New York. The Adirondack Mountains, which extend through New York State, are located approximately 40 miles west of the subject property and run northeast to southwest along the eastern shelf of the United States. Geology in the vicinity of the Property is comprised of the Hartland Formation which is characterized by a heavily metamorphosed complex of Precambrian and Paleozoic sedimentary and igneous rock depth of approximately 100 feet below ground surface (bgs). These rocks are of continental and oceanic in origin and are igneous and metamorphic in composition.



Based on information obtained from the United States Department of Agriculture (USDA) - Soils in the vicinity of the subject property are classified as Urban Land. Urban Land complex are those soils in which the soil's original structure and content have been so altered by human activities it has lost its original characteristics and is thus unidentifiable. Urban soils consist of nearly level to moderately steep areas where the soils have been altered or obscured by urban works and structures. Buildings and pavement cover more than 85 percent of the surface. Included in this unit in mapping are many small areas where the original soil material has been disturbed by construction and areas where fill has been added. Also included are small areas of undisturbed soils. The soil properties and characteristics of this unit vary.

# 2.4.4 Flood Zone Information

Partner performed a review of the Flood Insurance Rate Map (FIRM), published by the Federal Emergency Management Agency (FEMA). According to Community Panel Number 36119C0341F, dated September 28, 2007, the subject property appears to be located in Zone X, an area located outside of the 100-year and 500-year flood plains.



# 3.0 HISTORICAL INFORMATION

Partner obtained historical use information about the subject property from a variety of sources. A chronological listing of the historical data found is summarized in the table below:

Historical Use	Information	
Period/Date	Source	Description/Use
1887	Sanborn Maps	Developed with commercial structures and out buildings
1896	Sanborn Maps, Topographic Maps	Developed with a commercial structures and out buildings, and a residential structure
1903	Sanborn Maps, Topographic Maps	Developed with two commercial structure and out buildings
1911	Sanborn Maps, Topographic Maps	Developed with a one story bank, and a commercial structure
1918-Present	Sanborn Maps, Topographic Maps, City Directories, Aerial Photographs, Pre-survey Questionnaire, On-site Observations	Developed with a one-three story bank

Tenants on the subject property have included a saloon, tailor, residential tenants, a grocery store, a hardware store, and a stable, and a hand laundry facility (1887-1903); the National City Bank of New Rochelle, and four commercial store fronts (1911); and multiple bank tenants (1931-Present). No potential environmental concerns were identified in association with the current or former use of the subject property.

# 3.1 Aerial Photograph Review

Partner obtained available aerial photographs of the subject property and surrounding area from Environmental Data Resources, Inc. (EDR) on October 3, 2016. The following observations were noted to be visible on the subject property and adjacent properties during the aerial photograph review:

Date:	1947, 1951, 1954	Scale:	1"=500'	
Subject I	Property:	Appears	Appears to be developed with structure that encompasses the entire parcel	
North:		Appears to be developed with multiple structures along Lawton Street		
South:		Appears to be developed with multiple structures across Main Street		
East:		Appears to be developed with two structures along Main Street		
West:		Appears to be developed with multiple structures across Lawton Street		



Date:	1961- 2011	Scale:	1 <i>"=</i> 500'
Subject	Property:	No sign	ficant changes visible
North:		Appears	to be developed with a parking lot
South:		No sign	ficant changes visible
East:	East: No significant changes visible		ficant changes visible
West:		No sign	ficant changes visible

Copies of select aerial photographs are included in Appendix B of this report.

#### 3.2 Fire Insurance Maps

Partner reviewed the collection of Sanborn Fire Insurance (Sanborn) Maps from EDR on September 27, 2016. The following observations were noted to be depicted on the subject property and adjacent properties during the Sanborn Map review:

Date: 1887	
Subject Property:	Depicted as developed with a two-story commercial structure on the southern portion identified as a saloon and a portion of a tailor; a shed or stable and two small outbuildings on the center portion; and a portion of a two-story store on the
	northern portion (addressed as 116 and 117 Lawton Street, and 610 Main Street)
North:	Depicted as developed with a two-story store
South:	Depicted as developed as multiple commercial structures and as the Prosper LeFevere Carriage Factory Across Main Street
East:	Depicted as developed with a two-story building containing a tailor and a Carriage factory that is not in operation and used for storage
West:	Depicted as developed as multiple commercial structures including a post office, grocery and drug store across Lawton Street

Date: 1892	
Subject Property:	Depicted as developed with a salon, and tailor in a two-story structure on the southern portion of the property; a shed or stable, two small outbuildings, and portion of a storage building on the center portion; and a portion of a two-story dwelling on the northern portion (addressed as 1, 3, 5, and 7 Lawton Street, and 213 and 215 Main Street)
North:	Depicted with a dwelling
South:	Depicted with storefronts occupied by medicine manufactures on the 3 <sup>rd</sup> and 4 <sup>th</sup> floors with a Casino at the rear of the building
East:	Depicted as developed with the remainder of a storage building and a one-story structure
West:	Depicted as developed as multiple structures including a store, a grocery, two buildings of unidentified use, and a dwelling across Lawton Street



Date: 1896	
Subject Property:	Depicted as developed with a two-story commercial structure occupied by a laundry facility and saloon on the southern portion of the property; a shed or stable and small out building near the center portion; and a dwelling on the northern portion (addressed as 1-9 (odds) Lawton Street, and 213 and 215 Main Street)
North:	Depicted with a dwelling
South:	No significant changes depicted, except a jeweler and grocery store are depicted as well
East:	Depicted as developed with a structure occupied by a restaurant, saloon, Chinese laundry, and tobacco store
West:	Depicted as developed with structures occupied by a boot and shoe store, a plumber, a fruit store

Date:	1903	
Subject	Property:	Depicted as developed with a two-story commercial structure occupied by a hand laundry and saloon on the southern portion of the property; a shed or stable and small out building near the center portion; and a mixed use apartment and commercial building occupied by a grocery, a vacant space, and a hardware store (addressed as 1-9 (odds) Lawton Street)
North:		No significant changes depicted
South:		No significant changes depicted, except a jeweler and grocery store are depicted
East:		No significant changes depicted
West:		Depicted with an electronic supply tenant, a plumber, a hall, offices with associated printing, and bottling works

Date:	1911	
Subject Property:		Depicted as developed with a two-story bank, National City Bank of New Rochelle
		and a four-story commercial structure to the north with four storefronts with a small
		five-story structure to the east
North:		Structure depicted as a plumber tenant with two small out buildings
South:		No significant changes depicted, except the structures are depicted as stores with
		offices above in the Crennan Building with a one-story harness shop beyond it; and
the YMCA, depicted with a gymnasium, a		the YMCA, depicted with a gymnasium, a bowling alley, and locker rooms
East:	<b>East:</b> Depicted as developed with multiple two-story storefronts and out buildings	
West: Depicted with stores, an electronic work shop, a democratic club, and		Depicted with stores, an electronic work shop, a democratic club, and the New
		Rochelle Pioneer Gas & Electric Power- the printing offices



Date: 1931, 19	Date: 1931, 1942	
Subject Property:	Depicted as developed as a bank with concrete floors, and tile walls and areas of one- two- and three stories. Partner notes that the building now present on the property occupies the entire parcel footprint and is different from the structures noted in prior years.	
North:	Structure depicted as a storefront	
<b>South:</b> No significant changes depicted; no tenants depicted only "S" for storefro		
East: Depicted with stores and an unlabeled building		
West:         No significant changes depicted; depicted mostly as storefronts, with depicted as printing		

Date: 1951	
Subject Property: No significant changes depicted	
North:	No significant changes depicted
South:	No significant changes depicted
East:         No significant changes depicted, except the unlabeled building appear           depicted as "offices"	
West:	No significant changes depicted; depicted mostly as storefronts, with an upholstery store, and a printing store

Date: 1990, 1991	
Subject Property: No significant changes depicted	
North:	Depicted as a parking lot
South: No significant changes depicted	
East: No significant changes depicted	
<b>West:</b> Depicted as developed with two commercial structures and associated parking.	

Copies of reviewed Sanborn Maps are included in Appendix B of this report.

#### 3.3 City Directories

Partner reviewed historical city directories obtained from EDR on September 29, 2016 for past names and businesses that were listed for the subject property and adjacent properties. The findings are presented in the following table:



City Directory Search for 491 Main Street (Subject Property)		
Year(s)	Occupant Listed	
1972	First Westch National (491, 493 Main Street)	
1977	Barclay's Bank of New York (491, 493 Main Street)	
1982	Barclay's Bank of New York (491, 493 Main Street)	
1987	Barclay's Bank of New York (491, 493 Main Street)	
1992	Barclay's Bank of New York (491, 493 Main Street)	
1995	The Bank of New York Inc., the Westchester/Putnam Division (491, 493 Main Street)	
1999	The Bank of New York Inc. (491, 493 Main Street)	
2003	Unknown Occupant (491, 493 Main Street)	
2008	The Bank of New York Inc. (491, 493 Main Street)	
2013	Chase (491, 493 Main Street)	

Based on the city directory review, no environmentally-sensitive listings were identified for the subject property addresses.

City Dire	City Directory Search for Adjacent Properties		
Year(s)	Occupant Listed		
1972	South: NJ Patterson Pharmacy, J & R Russo Bros, DR, Fainas Donut Shop, residential tenants (494-498 Main Street); The Pottery House, Retail Fabric, Salt of the Earth, Shelly Card and Gift (490 Main Street)		
	East: Rahmey Hosiery, Wigs & Hats Shop (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street) West: Ajax Cigar Store, Craft from Inc. (497 Main Street)		
1977	South: NJ Patterson Pharmacy, Shampoo Haircutter, DR, Fainas Donut Shop, residential tenants(494-498 Main Street); Frank Used Furniture, KNP Stores (490 Main Street) East: Rahmey Hosiery, Wigs & Hats Shop (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street) West: Alex Cigar Store (497 Main Street)		
1982	South: Han Chung Sungs, Siena Pizza Resatratn, DR, Fainas Donut Shop, residential tenant, Dental Lab, Premeir Care, Tanduc Inc. (494-498 Main Street); House of Music, New Rochelle Music, A. Laboratory, Fancy Fabrics, Party Hut (490 Main Street) East: Fordham's Disc Wig, Rahmey Hosiery (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street) West: E & W Gifts (497 Main Street)		
1987	South: Nicks Salon, Pedro & Eric's Lunch (494-498 Main Street); Adrith Major Appliances, House of Music, Lloyds Major Appliance, DR., Stuman Sales Co., Tatters, The Parrot Penn, Repxtics (490 Main Street) East: Fordham Disc Wig, The Hair Factory, Nail City, Wigs Hats and Accessories (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street) West: Fanatics Photo (497 Main Street)		
1992	South: Nicks Salon, Siena Pizza, DDS, Faina's Donut Shop, County Legislator, United Limousine Service (494-498 Main Street); L & L Floors, DDS (490 Main Street) East: Nail City, Not Just Comics (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street)		



City Dir	ectory Search for Adjacent Properties
	West: Fanatics Photo, American Mexican Luncheonette (497 Main Street)
1995	South: Siena Pizza Restaurant, New Rochelle Donut Café, Quality Domestic Agency, County
	Legislator, Westchester Community Service (494-498 Main Street); Adrean Printing Corp, DDS,
	Majestic Auto Interiors, Nicks Salon (490 Main Street)
	East: Discount Thrift & Grocery, Nail City (487 Main Street); multiple commercial tenants, no
	tenants of concern (481 Main Street)
	West: Fanatic Photos Inc., Ay Caramba (497 Main Street)
1999	South: Natural Nails Salon, Telex press International Service, Pizza Perfect, Rivera Pizza and
	Café, residential tenants, Catskills Jazz & Soul Festival, Dagus Marketing, Davidson Attorney,
	Legal Expertise, Lupitas Tattoos, New Rochelle Donut Café, Primo Limo, County Legislator,
	Westchester Community Service (494-498 Main Street); Adrean Printing Corp, DDS, Carina
	Furniture, residential tenants, Nicks Salon (490 Main Street)
	East: Bella Bakery, L & M Bakery, Nail City (487 Main Street); multiple commercial tenants, no
	tenants of concern (481 Main Street)
2002	West: Fanatic Photos Inc., Ay Caramba (497 Main Street)
2003	South: Natural Nails, Pizza Perfect, residential tenants, American Nurse Recruiters, Lupitas
	Tattoos, New Rochelle Donut Café, County Legislator (494-498 Main Street); Adrean Printing,
	Nick's New Hair Design, , DDS, VIC Gina Printing (490 Main Street)
	East: Nail City One, Café Kimi, Bella Bakery (487 Main Street); multiple commercial tenants, no tenants of concern (481 Main Street)
	West: Fanatic Photo Inc., K2 Associates, The Mexican Corner Restaurant (497 Main Street)
2008	South: Hong Dao, Natural Nails, Alicia's Bakery, Indigo Moon, Kuriakose Pannikodu, Lupitas
2008	Tattoos, residential tenant (494-498 Main Street); Adrean Printing, Nick's New Hair Design,
	Paul Roberts (490 Main Street)
	East: Nail City One (487 Main Street); multiple commercial tenants, no tenants of concern (481
	Main Street)
	West: Caramba Ay, Fanatics Photo Inc (497 Main Street)
2013	South: Fancy Photo, Hong Dao, Number 1 locksmith, Brothers on main, Mamma Alaras Pizza,
	Mattys Pizza, Siena Pizza, Taylormade Locksmith, Alicia's Bakery, Dagus Marking Research,
	Mayoor Transportation, Rosa Contracting (494-498 Main Street); DDS, Carina Furniture, JS
	Boutique, Natural Nails, Nicks New Hair Design, Paul Roberts, Suber locksmith (490 Main
	Street)
	East: Get you in Locksmith, Nail City, Piazza, The best of New Roc Locksmith (487 Main Street);
	multiple commercial tenants, no tenants of concern (481 Main Street)
	West: Fanatics Photo Inc., Mexican Corner Restaurant (497 Main Street)

Environmental tenants of concern are further discussed in Section 4.2.3.

Copies of reviewed city directories are included in Appendix B of this report.

# 3.4 Historical Topographic Maps

Partner reviewed historical topographic maps obtained from EDR on October 3, 2016. The following observations were noted to be depicted on the subject property and adjacent properties during the topographic map review:



Date: 1898, 19	05, 1913, 1925, 1944, 1956
Subject Property:	Depicted as developed as indicated by black shading
North:	Depicted as developed as indicated by black shading
South:	Depicted as developed as indicated by black shading
East: Depicted as developed as indicated by black shading	
West:	Depicted as developed as indicated by black shading

Date: 1965, 19	1965, 1977, 1999	
Subject Property:	Depicted as developed as indicated by pink shading, indicating dense urban	
	development	
North:	Depicted as developed as indicated by pink shading, indicating dense urban	
	development	
South:	Depicted as developed as indicated by pink shading, indicating dense urban	
	development	
East:	Depicted as developed as indicated by pink shading, indicating dense urban	
	development	
West:	Depicted as developed as indicated by pink shading, indicating dense urban	
	development	

Copies of reviewed topographic maps are not included in Appendix B of this report.



# 4.0 REGULATORY RECORDS REVIEW

#### 4.1 Regulatory Agencies

#### 4.1.1 State Department

Regulatory Agency Data	Regulatory Agency Data	
Name of Agency:	New York State Department of Environmental Conservation	
	(NYSDEC)	
Point of Contact:	FOIA Department	
Agency Address:	625 Broadway, Albany, New York	
Agency Phone Number:	(518) 402-8013	
Date of Contact:	September 26, 2016	
Method of Communication:	Online FOIA Submission	
Summary of Communication:	No records regarding hazardous substance use, storage or releases, or the presence of USTs and AULs on the subject property were on file with the NYSDEC. The NYDEC recommending contacting the Westchester County Health Department (WCHD) for records for the subject property.	

#### 4.1.2 Health Department

Regulatory Agency Data	
Name of Agency:	Westchester County Health Department
Point of Contact:	FOIA Department
Agency Address:	145 Huguenot Street, New Rochelle, New York
Agency Phone Number:	(914) 813-5000
Date of Contact:	September 29, 2016
Method of Communication:	Online
Summary of Communication:	A Petroleum Bulk Storage (PBS) Registration Certificate (PBS No. 3- 164372) was issued to the subject property on January 15, 2016 and expired on October 1, 2016. According to this document, one (1) 1,500-gallon aboveground storage tank containing No. 2 Fuel Oil was installed at the subject property in January 1997. This AST was last tested in March 2011. The tank owner is indicated to be J P Morgan Chase Bank N.A. Also documented on the Certificate is one (1) 2,000-gallon underground storage tank which was closed in place on April 5, 1990. Tank contents are not reported.



#### 4.1.3 Assessor's Office

Regulatory Agency Data	
Name of Agency:	New Rochelle Tax Assessor (NRTA)
Point of Contact:	Dan Whittemore
Agency Address:	515 North Avenue, New Rochelle, New York
Agency Phone Number:	(914) 654-2035
Date of Contact:	September 26, 2016
Method of Communication:	Faxed Request
Summary of Communication:	According to records reviewed, the subject property is identified by Assessor Parcel Number (APN) 1-229-0009 and is currently owned by JPMorgan Chase Bank since 2007. The current building was constructed <i>circa</i> 1918 and totals approximately 20,923 square feet on a 0.43 acre lot.

#### 4.1.4 Building Department

Regulatory Agency Data		
Name of Agency:	New Rochelle Bureau of Buildings (NRBB)	
Point of Contact:	Bennie Giles	
Agency Address:	515 North Avenue, New Rochelle, New York	
Agency Phone Number:	(914) 654-2035	
Date of Contact:	September 26, 2016	
Method of Communication:	Faxed Request	
Summary of Communication:	The following records were provided for review by the Town Clerk:	
	April 20, 1992 - Notice of Sub-sidewalk Annual License Fee, associated with the presence of a Fuel oil tank, five areaways and a coal hole within the public sidewalk or area.	
	May 19, 1992 - Letter to Mr. Louis Goodman, Building Official, stating that the oil tank under the sidewalk is no longer in service. The tank was closed off according to DEC specifications in 1990.	

# 4.1.5 Planning Department

Regulatory Agency Data			
Name of Agency:	New Rochelle Zoning Department (NRZD)		
Point of Contact:	Online		
Agency Address:	515 North Avenue, New Rochelle, New York		
Agency Phone Number:	(914) 654-2035		
Date of Contact:	September 26, 2016		
Method of Communication:	Online		
Summary of Communication:	According to records reviewed, the subject property is zoned DB for		
	Downtown Business development by the City of New Rochelle.		



#### 4.1.6 Fire Department

Regulatory Agency Data			
Name of Agency:	New Rochelle Fire Department (NRFD)		
Point of Contact:	N/A		
Agency Address:	90 Beaufort Place, New Rochelle, New York		
Agency Phone Number:	(914) 654-2212		
Date of Contact:	September 26, 2016		
Method of Communication:	Faxed Request		
Summary of Communication:	The following records were provided for review by the Town Clerk: May 8, 1991-Department of Fire: License to replace a 1,500-gallon tank.		
	A Tier 2 Online submission Report identified that a #2 fuel oil AST was located in the basement of the subject property building, the AST was identified as 10,650 (units not provided; however online research indicates that the Tier 2 form records quantities in pounds. The regulatory database report identified the volume of the AST as 1,500-gallons, which is approximately 10,650 pounds).		

# 4.1.10 Oil & Gas Exploration

Regulatory Agency Data			
Name of Agency:	NYSDEC Mineral Mapper		
Point of Contact:	Online Database		
Date of Contact:	October 3, 2016		
Method of Communication:	Online		
Summary of Communication:	According to NYSDEC Mineral Mapper, no oil or gas wells are located		
	on or adjacent to the subject property.		

#### 4.2 Mapped Database Records Search

Information from standard federal, state, county, and city environmental record sources was provided by Environmental Data Resources, Inc. (EDR). Data from governmental agency lists are updated and integrated into one database, which is updated as these data are released. The information contained in this report was compiled from publicly available sources and the locations of the sites are plotted utilizing a geographic information system, which geocodes the site addresses. The accuracy of the geocoded locations is approximately +/-300 feet.

Using the ASTM definition of migration, Partner considers the migration of hazardous substances or petroleum products in any form onto the subject property during the evaluation of each site listed on the radius report, which includes solid, liquid and vapor.



### 4.2.1 Regulatory Database Summary

Radius Report Data				
Database	Search	Subject	Adjacent	Sites of
	Radius (mile)	Property	Properties	Concern
Federal NPL or Delisted NPL Site	1.00	Ν	N	Ν
Federal CERCLIS Site	0.50	Ν	N	Ν
Federal CERCLIS-NFRAP Site	0.50	Ν	N	Ν
Federal RCRA CORRACTS Facility	1.00	Ν	N	Ν
Federal RCRA TSDF Facility	0.50	Ν	N	Ν
Federal RCRA Generators Site (LQG, SQG,	0.25	N	Y	Ν
CESQG, Non-Gen)				
Federal IC/EC Registries	0.50	Ν	N	Ν
Federal ERNS Site	Subject	N		
	Property			
State/Tribal Equivalent NPL	1.00	Ν	N	Ν
State/Tribal Equivalent CERCLIS	1.00	Ν	N	Ν
State/Tribal Landfill/Solid Waste Disposal Site	0.50	N	N	Ν
State/Tribal Leaking Storage Tank Site	0.50	Y	N	Ν
State/Tribal Registered Storage Tank Sites	0.25	Y	Y	Ν
(UST/AST)				
State/Tribal Voluntary Cleanup Sites (VCP)	0.50	N	N	Ν
State/Tribal Spills	0.50	Ν	Y	Ν
Federal Brownfield Sites	0.50	N	N	Ν
State Brownfield Sites	0.50	Ν	N	Ν
EDR MGP	Varies	N	N	Ν
EDR US Hist Auto Station	Varies	N	N	Ν
EDR US Hist Cleaners	Varies	N	Y	Ν
Manifest	Varies	N	Y	Ν

# 4.2.2 Subject Property Listings

The subject property is identified as a New York Underground Storage Tank (NY UST), New York Aboveground Storage Tank (NY AST) and a New York Leaking Tanks (NY LTANKS) site in the regulatory database report, as discussed below:

 <u>Barclays Bank of NY/NA as 491 Main Street</u> – The subject property is associated with a NY UST listing in the database (3-164372). According to the regulatory database report and regulatory records available, the subject property was identified as having operated an UST that was closed-in-place in 1990. The UST was identified as a 2,000-gallon steel construction tank with steel piping that appears to have been located under the sidewalk (location not identified). The date of installation was not identified.



On August 23, 1989, a UST on the subject property failed a tank tightness test; the Leaking Tanks (LTANKS) listing identified the tank as a 1,500-gallon #2 fuel oil UST. No material was reported as released, however limited information about the LTANKS case was available. Additionally, it was identified that the 1,500-gallon UST was removed or possibly closed in place in March 1991 and replaced (replacement not identified). No other information about the USTs was available. It is suspected that at least one of the USTs was installed along Main Street, as a fill pipe and two vent pipes were observed near the southeast corner of the subject property building. It is assumed that the fill pipe and one vent pipe are associated with an active 1,500-gallon AST observed during the site reconnaissance, and the second vent pipe was associated with one of the former USTs.

Based on the information available to Partner, it is uncertain if there had been one or two former heating oil USTs under perimeter sidewalks at the edge of the subject property. The lack of closure documentation for the USTs, along with the lack of information pertaining to the LTANKS case, is considered by Partner to represent a Recognized Environmental Condition.

The subject property is also identified in the NY AST database (3-164372). According to the regulatory database report, Tank No. 02 is a 1,500-gallon steel #2 fuel oil AST. The tank was listed as installed in 1997 and is currently in service. Partner observed one 1,500-gallon steel #2 fuel oil AST located within an accessible vault in the basement of the subject property building. The AST is located on the southeast portion of the subject property and a fill and vent pipe were observed adjacent to the AST along Main Street. The AST is equipped with overfill protection in the form of a vent whistle. Based on the observed good condition of the AST, the lack of staining, and aboveground location and presence of overfill protection, this AST is not considered an environmental concern.

# 4.2.3 Adjacent Property Listings

The adjacent property to the east is identified as a NY UST, New York Spills (NY Spills), and an EDR Hist Cleaners site in the regulatory database report, as discussed below:

 <u>Rettner Management Corp at 481 Main Street</u> - is located adjacent to the east of the subject property. This site is associated with a NY UST listing in the database (3-255033). Tank No. 1 is a 3,000-gallon steel gasoline UST that was installed in 1900 (per the regulatory database), and permanently closed in 2002. This UST is identified as "administratively closed." Tank No. 2 is a 2,500-gallon steel #2 fuel oil UST that was installed in 1970, and is currently in service.

This site reported a release of #2 fuel oil on December 14, 2005. The release occurred as a result of a tank overfill spilling fuel into the basement that occurred in October 2005 and was cleaned up but a complaint was made regarding odor. The County Health Department was on site and said the spill was clear. Regulatory closure was obtained on December 18, 2008. Based on the nature of the release, regulatory closure, and the inferred direction of groundwater flow, this listing is not considered to represent an environmental concern.



This address was also identified in the EDR Hist Cleaner database. Acquire Carpet Cleaning Service was listed at this address in 2001. Based on the name of the tenant, it is not expected that dry cleaning operations or other operations of environmental concern were conducted by this tenant on the adjacent property. Based on the presumed nature of operations, carpet cleaning which is typically conducted offsite, this listing is not considered an environmental concern.

The adjacent property to the south is identified as a New York Spills (NY Spills), Resource Conservation and Recovery Act Non Generator (RCRA Non Gen), Facility Index System (FINDS), New York Manifest (NY Manifest), and an Enforcement and Compliance History Information (ECHO) site in the regulatory database report, as discussed below:

- <u>Attack Pesticides at 498 Main Street is</u> located adjacent to the south of the subject property. The site
  is associated with a NY Spills listing in the database (0335020). The spill occurred on March 12, 2004
  when an unknown, and unregistered pesticide spilled and was left unattended by the owner. The DEC
  seized and removed the materials (four 55-gallon drums). The spill was received regulatory closure on
  February 27, 2005. Based on the regulatory closure and inferred direction of groundwater flow, this
  listing is not considered an environmental concern.
- <u>Adrean Printing Co. at 490 Main Street-</u> is located adjacent to the south of the subject property. The site was identified as a RCRA Non Gen (NY0000233981) in 2007. The site was historically a Conditionally Exempt Small Quantity Generator (CESQG) of silver in 1994, and was verified as a Non Generator in 2006. The site is associated with a NY Manifests for the removal of silver between 1995 and 1997. No violations were found. The site is associated with a FINDS and ECHO listing (110004314297). These listing are cross-referencing systems for the RCRA, and Manifest listings. Based on the lack of a reported release and inferred direction of groundwater flow, this listing is not considered an environmental concern.

Based on these findings, vapor migration is not expected to represent an environmental concern at this time.

# 4.2.4 Sites of Concern Listings

No sites of concern are identified in the regulatory database report.

# 4.2.5 Orphan Listings

No orphan listings of concern are identified in the regulatory database report.

A copy of the regulatory database report is included in Appendix C of this report.





# 5.0 USER PROVIDED INFORMATION AND INTERVIEWS

In order to qualify for one of the *Landowner Liability Protections (LLPs)* offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the *Brownfields Amendments*), the *User* must conduct the following inquiries required by 40 CFR 312.25, 312.28, 312.29, 312.30 and 312.31. The *User* should provide the following information to the *environmental professional*. Failure to provide this information could result in a determination that *all appropriate inquiries* is not complete. The *User* is asked to provide information or knowledge of the following:

- Review Title and Judicial Records for Environmental Liens and AULs;
- Specialized Knowledge or Experience of the User;
- Actual Knowledge of the User;
- Reason for Significantly Lower Purchase Price;
- Commonly Known or Reasonably Ascertainable information;
- Degree of Obviousness; and
- Reason for Preparation of this Phase I ESA.

Fulfillment of these user responsibilities is key to qualification for the identified defenses to CERCLA liability. Partner requested our Client to provide information to satisfy User Responsibilities as identified in Section 6 of the ASTM guidance.

Pursuant to ASTM E1527-13, Partner requested the following site information from Fortress Investment Group, LLC (User of this report).

User Responsibilities				
Item	Provided By User	Not Provided By User	Discussed Below	Does Not Apply
User Questionnaire		Х		
Title Records, Environmental Liens and AULs			Х	
Specialized Knowledge			Х	
Actual Knowledge			Х	
Valuation Reduction for Environmental Issues			Х	
Identification of Key Site Manager	Section 5.1.3			
Reason for Performing Phase I ESA	Section 1.1			
Prior Environmental Reports			X	
Other				X

#### 5.1 Interviews

#### 5.1.1 Interview with Owner

An owner representative of the subject property, identified as JPMorgan Chase since 2007, was not available to be interviewed at the time of the assessment.



#### 5.1.2 Interview with Report User

Please refer to Section 5.2 below for information requested from the Report User. The information requested was not received prior to the issuance of this report. Because the Report User (Client) is a purchaser, it is understood that the Report User would not have knowledge of the property that would significantly impact our ability to satisfy the objectives of this assessment. The lack of this information is not considered to represent a significant data gap.

## 5.1.3 Interview with Key Site Manager

Mr. Domenick Margotta, key site manager, indicated that he had no information pertaining to any pending, threatened or past litigation relevant to hazardous substances or petroleum products in, on or from the subject property; any pending, threatened or past administrative proceedings relevant to hazardous substances or petroleum products in, on or from the subject property; or any notices from a governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products.

According to Mr. Margotta, the subject property was developed around 1918 for commercial use as a bank. Mr. Margotta has been the subject property manager since it was purchased by JPMorgan Chase in 2007. Since Mr. Margotta has been the property manager a new roof, façade, and HVAC system has been installed.

#### 5.1.4 Interviews with Past Owners, Operators and Occupants

Interviews with past owners, operators and occupants were not conducted since information regarding the potential for contamination at the subject property was obtained from other sources.

#### 5.1.5 Interview with Others

As the subject property is not an abandoned property as defined in ASTM 1527-13, interview with others were not performed.

# 5.2 User Provided Information

# 5.2.1 Title Records, Environmental Liens and AULs

At the request of the User, Partner contracted AFX Research, LLC (AFX) to perform an environmental lien search for the subject property. No environmental liens or AULs were identified for the subject property.

# 5.2.2 Specialized Knowledge

No specialized knowledge of environmental conditions associated with the subject property was provided by the User at the time of the assessment.

# 5.2.3 Actual Knowledge of the User

No actual knowledge of any environmental lien or AULs encumbering the subject property or in connection with the subject property was provided by the User at the time of the assessment.



### 5.2.4 Valuation Reduction for Environmental Issues

No knowledge of valuation reductions associated with the subject property was provided by the User at the time of the assessment.

#### 5.2.5 Commonly Known or Reasonably Ascertainable Information

The User did not provide information that is commonly known or *reasonably ascertainable* within the local community about the subject property at the time of the assessment.

#### 5.2.6 Previous Reports and Other Provided Documentation

No previous reports or other pertinent documentation was provided to Partner for review during the course of this assessment.



# 6.0 SITE RECONNAISSANCE

The weather at the time of the site visit was sunny and clear, with a temperature of approximately 75° Fahrenheit. Refer to Section 1.5 for limitations encountered during the field reconnaissance and Sections 2.1 and 2.2 for subject property operations. The table below provides the site assessment details:

Site Assessment Data		
Site Assessment Performed By:	Candice Soder	
Site Assessment Conducted On:	October 6, 2016	

The table below provides the subject property personnel interviewed during the field reconnaissance:

Site Visit Personnel for 491 Main Street (Subject Property)				
Name	Title/Role         Contact Number         Site Walk*			
			Yes/No	
Domenick Margotta	Key Site Manager	(914) 774-3838	Yes	

\* Accompanied Partner during the field reconnaissance activities and provided information pertaining to the current operations and maintenance of the subject property.

Environmental concerns were identified during the on-site reconnaissance related to an observed vent pipe, as further discussed in Sections 6.1 and 6.2.

#### 6.1 General Site Characteristics

#### 6.1.1 Solid Waste Disposal

Solid waste generated at the subject property is disposed of in a commercial dumpster located in the northeast corner of the subject property boarder. An independent solid waste disposal contractor, Great Forest, removes solid waste from the subject property. According to property personnel, only typical office trash is collected in the on-site solid waste dumpsters. No evidence of illegal dumping of solid waste was observed during Partner's site reconnaissance.

# 6.1.2 Sewage Discharge and Disposal

Sanitary discharges on the subject property are directed into the municipal sanitary sewer system. The City of New Rochelle services the subject property vicinity. No wastewater treatment facilities or septic systems are observed or reported on the subject property.

#### 6.1.3 Surface Water Drainage

Site storm water from roofs, landscaped areas and paved areas is directed to the public right-of-way. The subject property is connected to a municipal-owned and -maintained sewer system.

Based on information obtained from the United States Department of Agriculture (USDA), the subject property does not appear to be a designated wetland area; however, a comprehensive wetlands survey would be required in order to formally determine actual wetlands on the subject property.



No surface impoundments, wetlands, natural catch basins, settling ponds or lagoons are located on the subject property. No drywells were identified on the subject property.

# 6.1.4 Source of Heating and Cooling

Heating and cooling systems, as well as domestic hot water equipment, are fueled by electricity, and fuel oil provided by Con Edison, and Petro Oil. The mechanical system is an oil-fired boiler, and four packaged electric cooling units, as well as additional cooling from wall units. Hot water is provided by an electric hot water heater.

# 6.1.5 Wells and Cisterns

No aboveground evidence of wells or cisterns was observed during Partner's site reconnaissance.

# 6.1.6 Wastewater

Domestic wastewater generated at the subject property is disposed by means of the sanitary sewer system. No industrial process is currently performed at the subject property.

# 6.1.7 Septic Systems

No septic systems were observed or reported on the subject property.

# 6.1.8 Additional Site Observations

No additional general site characteristics were observed during the site reconnaissance.

# 6.2 Potential Environmental Hazards

# 6.2.1 Hazardous Substances and Petroleum Products Used or Stored at the Site

No hazardous substances or petroleum products, other than the fuel oil AST discussed in Section 6.2.2 below, were observed on the subject property during Partner's site reconnaissance.

# 6.2.2 Aboveground & Underground Hazardous Substance or Petroleum Product Storage Tanks (ASTs/USTs)

Partner observed one 1,500-gallon steel #2 fuel oil AST located within an accessible vault in the basement of the subject property building. The AST is located on the southeast portion of the subject property and a fill and vent pipe were observed adjacent to the AST along Main Street. The AST registered with the WCHD and is equipped with overfill protection in the form of a vent whistle. Based on the observed good condition of the AST, the lack of staining, and aboveground location and presence of overfill protection, this AST is not considered an environmental concern.

Partner also observed a second vent pipe near the southeast corner of the subject property building along Main Street. According to regulatory records the subject property formerly operated a 2,000-gallon UST that was located within the sidewalk (exact location not identified) and possibly a 1,500-gallon UST. It is unclear if there might be data entry discrepancies over time regarding tank capacity, or if a replacement tank might have been a basement AST, not a second UST. The storage tanks are further discussed in Section 4.2.2.



### 6.2.3 Evidence of Releases

No spills, stains or other indications that a surficial release has occurred at the subject property were observed.

# 6.2.4 Polychlorinated Biphenyls (PCBs)

No potential PCB-containing equipment (transformers, oil-filled switches, hoists, lifts, dock levelers, hydraulic elevators, etc.) was observed during Partner's site reconnaissance.

### 6.2.5 Strong, Pungent or Noxious Odors

No strong, pungent or noxious odors were evident during Partner's site reconnaissance.

#### 6.2.6 Pools of Liquid

No pools of liquid were observed on the subject property during Partner's site reconnaissance.

#### 6.2.7 Drains, Sumps and Clarifiers

Partner observed the following drains, sumps, and/or clarifiers located on the subject property:

Drains, Sumps and Clarifiers Observed On-site				
	Floor Drain(s)	Sump(s)	Clarifier(s)	
Number Observed:	Three	Two	N/A	
Location:	Bathroom; basement	Basement	N/A	
Point of Discharge:	Municipal Sewer System	Municipal Sewer System	N/A	
Sealed/Bermed:	N/A	N/A	N/A	

#### 6.2.8 Pits, Ponds and Lagoons

No pits, ponds or lagoons were observed on the subject property.

# 6.2.9 Stressed Vegetation

No stressed vegetation was observed on the subject property.

# 6.2.10 Additional Potential Environmental Hazards

No additional environmental hazards, including landfill activities or radiological hazards, were observed.

#### 6.3 Non-ASTM Services

# 6.3.1 Asbestos-Containing Materials (ACMs)

Asbestos is the name given to a number of naturally occurring, fibrous silicate minerals mined for their useful properties such as thermal insulation, chemical and thermal stability and high tensile strength. The Occupational Safety and Health Administration (OSHA) regulation 29 CFR 1926.1101 requires certain construction materials to be *presumed* to contain asbestos, for purposes of this regulation. All thermal system insulation (TSI), surfacing material and asphalt/vinyl flooring that are present in a building constructed prior to 1981, and have not been appropriately tested, are "presumed asbestos-containing material" (PACM).



The subject property building was constructed in *circa* 1918. Partner has conducted a limited, visual evaluation of accessible areas for the presence of suspect ACMs at the subject property. The objective of this visual survey was to note the presence and condition of suspect ACM observed. Please refer to the table below for identified suspect ACMs:

Suspect ACMs				
Suspect ACM	Location	Friable Yes/No	Physical Condition	
Drywall Systems	Throughout Building Interior	No	Good	
Ceiling Tiles	2 <sup>nd</sup> and 3 <sup>rd</sup> floor	No	Good	
Ceiling Tile Adhesive	2 <sup>nd</sup> and 3 <sup>rd</sup> floor	No	Good; Poor	
Floor tiles and mastic	Basement and 3 <sup>rd</sup> floor	No	Good	

Property Manager Mr. Margotta stated that an asbestos survey and associated removal of identified materials had been conducted for portions of the property, however he was unsure of the areas assessed and a copy of the report was not available for review. Ceiling tiles were observed to be missing from the second and third floors.

The limited visual survey consisted of noting observable materials (materials which were readily-accessible and visible during the course of the site reconnaissance) that are commonly-known to potentially contain asbestos. This activity was not designed to discover all sources of suspect ACM, PACM or asbestos at the site; or to comply with any regulations and/or laws relative to planned disturbance of building materials such as renovation or demolition, or any other regulatory purpose. Rather, it is intended to give the User an indication if significant (significant due to quantity, accessibility or condition) potential sources of ACM or PACM are present at the subject property. Additional sampling, assessment, and evaluation will be warranted for any other use.

Partner was not provided building plans or specifications for review, which may have been useful in determining areas likely to have used ACM.

According to the USEPA, ACM and PACM that is intact and in good condition can, in general, be managed safely in-place under an Operations and Maintenance (O&M) Program until removal is dictated by renovation, demolition or deteriorating material condition. Prior to any disturbance of the construction materials within this facility, a comprehensive ACM survey is recommended.

# 6.3.2 Lead-Based Paint (LBP)

Lead is a highly toxic metal that affects virtually every system of the body. LBP is defined as any paint, varnish, stain or other applied coating that has 1 mg/cm<sup>2</sup> (or 5,000 ug/g or 0.5% by weight) or more of lead. Congress passed the Residential Lead-Based Paint Hazard Reduction Act of 1992, also known as "Title X," to protect families from exposure to lead from paint, dust and soil. Under Section 1017 of Title X, intact LBP on most walls and ceilings is not considered a "hazard," although the condition of the paint should be monitored and maintained to ensure that it does not become deteriorated.



Further, Section 1018 of this law directed the Housing and Urban Development (HUD) and the USEPA to require the disclosure of known information on LBP and LBP hazards before the sale or lease of most housing built before 1978.

Due to the commercial use of the subject property, LBP was not considered within the scope of this assessment.

# 6.3.3 Radon

Radon is a colorless, odorless, naturally-occurring, radioactive, inert and gaseous element formed by the radioactive decay of radium (Ra) atoms. The United Stated Environmental Protection Agency (USEPA) has prepared a Map of Radon Zones to assist National, State and local organizations to target their resources and to implement radon-resistant building codes. The map divides the country into three Radon Zones, according to the table below:

EPA Radon Zones			
EPA Zones	Average Predicted Radon Levels	Potential	
Zone 1	Exceeds 4.0 picoCuries per liter (pCi/L)	Highest	
Zone 2	Between 2.0 and 4.0 pCi/L	Moderate	
Zone 3	Less than 2.0 pCi/L	Low	

It is important to note that the USEPA has found homes with elevated levels of radon in all three zones, and the USEPA recommends site-specific testing in order to determine radon levels at a specific location. However, the map does give a valuable indication of the propensity of radon gas accumulation in structures.

Radon sampling was not conducted as part of this assessment. Review of the USEPA Map of Radon Zones places the subject property in Zone 1. However, based upon the commercial nature of the subject property, radon sampling was not a part of the scope of work for this assessment.

# 6.3.4 Lead in Drinking Water

According to available information, a public water system operated by the United Water serves the subject property vicinity. According to the 2014 Untied Water Quality Report, shallow groundwater beneath the subject property is not utilized for domestic purposes. The sources of public water for the City of New Rochelle are surface water from the protected watershed areas 120 miles northwest of New Rochelle in the Catskill Mountains after which it travels through a New York City owned system.

According to the City of New Rochelle and the 2014 Annual Water Quality Report, water supplied to the subject property is in compliance with all State and Federal regulations pertaining to drinking water standards, including lead and copper. Water sampling was not conducted to verify water quality.

# 6.3.5 Mold

Molds are microscopic organisms found virtually everywhere, indoors and outdoors. Mold will grow and multiply under the right conditions, needing only sufficient moisture (e.g. in the form of very high humidity, condensation, water from a leaking pipe, etc.) and organic material (e.g. ceiling tile, drywall, paper or natural fiber carpet padding).

Phase I Environmental Site Assessment Project No. 16-171696.29 October 14, 2016 Page 28



Partner observed accessible, interior areas for the subject property building for significant evidence of mold growth, with the exceptions detailed in Section 1.5 of this report. However, this ESA should not be used as a mold survey or inspection. Additionally, this limited assessment was not designed to assess all areas of potential mold growth that may be affected by mold growth on the subject property. Rather, it is intended to give the client an indication as to whether or not conspicuous (based on observed areas) mold growth is present at the subject property. This evaluation did not include a review of pipe chases, mechanical systems or areas behind enclosed walls and ceilings.

The following indications of water damage or mold growth were observed during Partner's visual assessment:

Observations	
Location of area affected	Condition
Closet in Basement	Mold Growth

Partner observed a small area, approximately 5 square feet, of mold growth in the subject property basement. Based on the small area basement location, the area of localized impact should be addressed by property management as part of routine maintenance.

### 6.4 Adjacent Property Reconnaissance

The adjacent property reconnaissance consisted of observing the adjacent properties from the subject property premises. No items of environmental concern were identified on the adjacent properties during the site assessment, including hazardous substances, petroleum products, ASTs, USTs, evidence of releases, PCBs, strong or noxious odors, pools of liquids, sumps or clarifiers, pits or lagoons, stressed vegetation, or any other potential environmental hazards.



# 7.0 FINDINGS AND CONCLUSIONS

#### Findings

A *recognized environmental condition (REC)* refers to the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: due to release to the environment; under conditions indicative of a release to the environment; or under conditions that pose a material threat of a future release to the environment. The following was identified during the course of this assessment:

 According to the regulatory database report and a Westchester County Health Department (WCHD) Petroleum Bulk Storage (PBS) Registration Certificate (PBS No. 3-164372), the subject property is identified as having operated a 2,000-gallon, steel underground storage tank (UST) that was closed-inplace as of April 5, 1990. The date of installation of the UST was not identified.

Partner's review of the regulatory database report also revealed that on August 23, 1989, a UST on the subject property failed a tank tightness test. A Leaking Tanks (LTANKS) listing for the subject property in the database report identified the tank as a 1,500-gallon, #2 fuel oil UST. No material was reported as released; however, limited information regarding the LTANKS case is available. Additionally, it was identified that the 1,500-gallon UST was removed in March 1991 and replaced (replacement information was not identified).

No other information regarding the 2,000-gallon or 1,500-gallon USTs was available. It is suspected that at least one of the USTs was installed along Main Street, as a fill pipe and two vent pipes were observed near the southeast corner of the subject property building. Partner presumes that the fill pipe and one of the vent pipes are associated with an active, 1,500-gallon aboveground storage tank (AST) observed during the site reconnaissance (further discussed below). The second observed vent pipe is presumed to have been associated with one of the former USTs.

Based on the information available to Partner, it appears that two USTs may have operated on the subject property. The lack of closure documentation for the USTs, along with the lack of information pertaining to the LTANKS case, is considered by Partner to represent a REC.

A *controlled recognized environmental condition (CREC)* refers to a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls.

• Partner did not identify any CRECs during the course of this assessment.

A *historical recognized environmental condition (HREC)* refers to a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls.

• Partner did not identify any HRECs during the course of this assessment.



An *environmental issue* refers to environmental concerns identified by Partner, which do not qualify as RECs; however, warrant further discussion. The following was identified during the course of this assessment:

- Partner observed one, 1,500-gallon, #2 fuel oil AST located within an accessible vault in the basement
  of the subject building. The steel AST is located on the southeast portion of the subject property and
  a fill and vent pipe were observed adjacent to the AST's interior location, along Main Street. The AST
  is equipped with overfill protection in the form of a vent whistle. According to WCHD PBS records, the
  in-service AST was installed in 1997 and was last tested on March 1, 2011. The next test date is not
  listed. Based on the observed good condition of the AST, aboveground location, lack of staining and
  presence of overfill protection, this AST is not considered by Partner to represent an environmental
  concern at this time.
- Due to the age of the subject property building, the potential exists that asbestos-containing materials (ACMs) are present on-site. Overall, all suspect ACMs were observed in good condition and do not pose a health and safety concern to the occupants of the subject property.
- One area of mold growth was observed on the drywall within a basement closet. Based on the limited area of impact, approximately five square feet, the observed mold growth is not considered an environmental concern.

#### **Conclusions, Opinions and Recommendations**

Partner has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E1527-13 of 491 Main Street in the City of New Rochelle, Westchester County, New York (the "subject property"). Any exceptions to, or deletions from, this practice are described in Section 1.5 of this report.

This assessment has revealed evidence of an REC and environmental issues in connection with the subject property. Based on the conclusions of this assessment, Partner recommends the following:

• The completion of a limited subsurface investigation appears warranted in order to determine the presence or absence of soil and/or groundwater contamination at the subject property in connection with the aforementioned USTs and associated LTANKS case.





# 8.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

Partner has performed a Phase I Environmental Site Assessment (ESA) of the property located at 491 Main Street in the City of New Rochelle, Westchester County, New York (the "subject property") in general conformance with the scope and limitations of the protocol and the limitations stated earlier in this report. Exceptions to or deletions from this protocol are discussed earlier in this report.

By signing below, Partner declares that, to the best of our professional knowledge and belief, we meet the definition of *Environmental Professional* as defined in §312.10 of 40 CFR §312. Partner has the specific qualifications based on education, training and experience to assess a *property* of the nature, history and setting of the subject *property*. Partner has developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

Prepared By:


Canelia Sock r

Candice Soder Environmental Professional

Reviewed By:

Darah M. Mouissey

Sarah Morrissey Project Manager





# 9.0 REFERENCES

#### **Reference Documents**

AFX Research, LLC, Environmental Lien Search, September 2016

American Society for Testing and Materials, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, ASTM Designation: E1527-13

Environmental Data Resources, Inc. (EDR), The EDR Radius Map™ Report

Federal Emergency Management Agency, Federal Insurance Administration, National Flood Insurance Program, Flood Insurance Map

United States Department of Agriculture, Natural Resources Conservation Service, Web Soil Survey

United States Environmental Protection Agency, EPA Map of Radon Zones (Document EPA-402-R-93-071)


United States Geological Survey, Topographic Map, 1995, 7.5 minute series



# **FIGURES**

- **1** SITE LOCATION MAP
- 2 SITE PLAN
- **3** TOPOGRAPHIC MAP



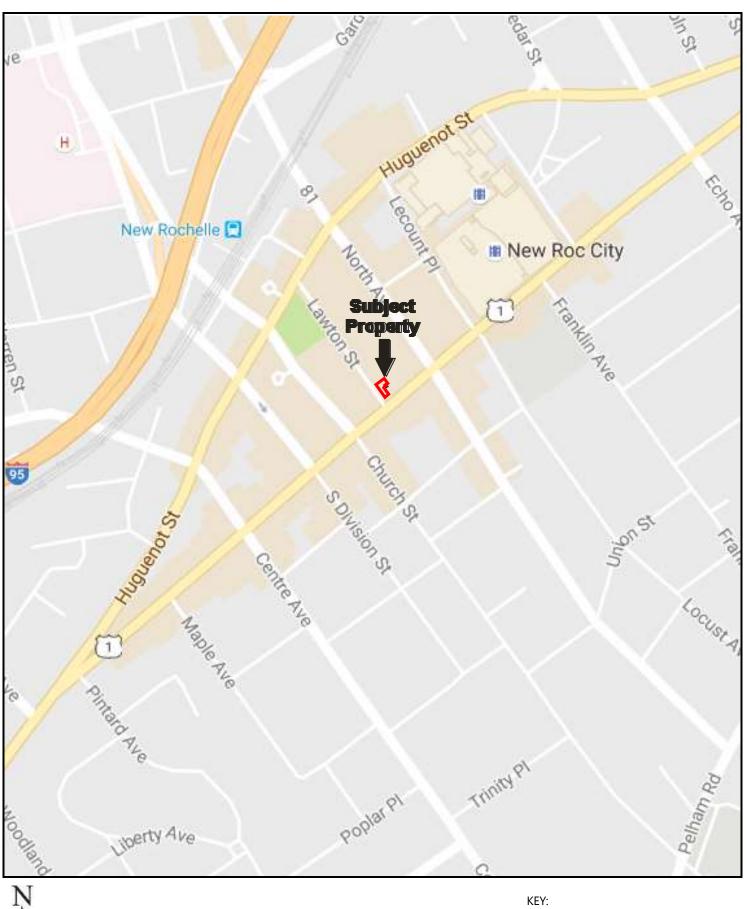



Subject Property



FIGURE 1: SITE LOCATION MAP Project No. 16-171696.29






KEY: Subject Property



FIGURE 2: SITE PLAN Project No. 17-161796.29

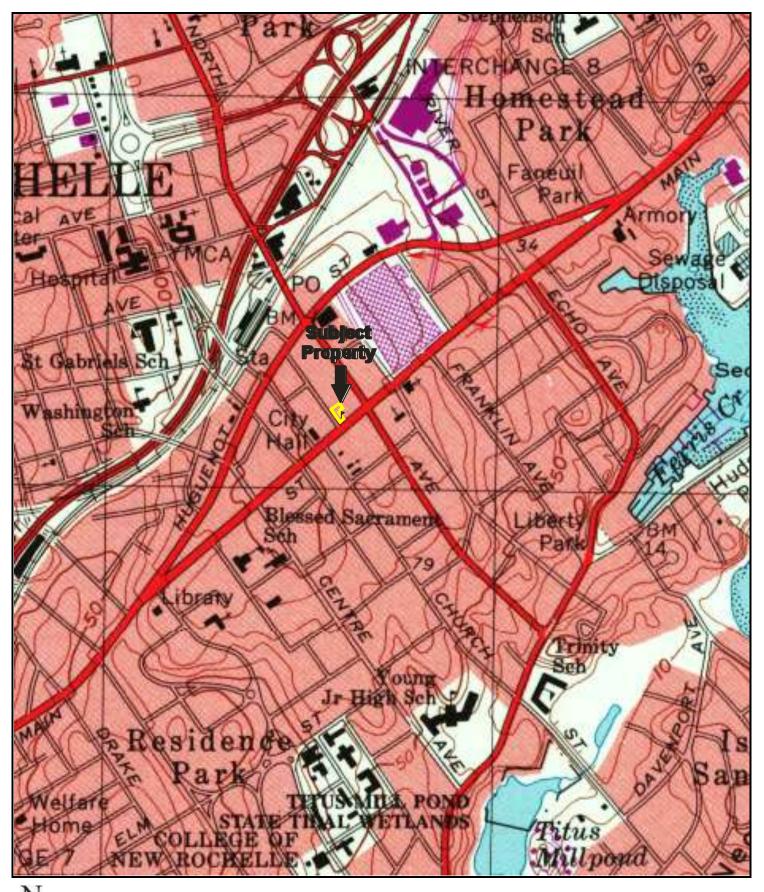

USGS 7.5 Minute *Mount Vernon, New York* Quadrangle Created: 1995 KEY: Subject Property

FIGURE 3: TOPOGRAPHIC MAP Project No. 16-171696.29







1. View of subject property.



2. View of northern adjacent parking lot.



3. View of southern adjacent property.



4. View of southern adjacent property.



5. View of eastern adjacent property.



6. View of western adjacent property.





7. View of western adjacent property.



8. View of entrance to subject property.



9. View of main lobby in subject property.



11. View of office space.



10. View of teller windows



12. View of office space.





13. View of vacant second floor.



15. View of missing ceiling tiles.



14. View of vacant second floor, former restroom.



16. View of vacant third floor.



17. View of roof top.



18. View of rooftop cooling unit.





19. View of basement.



20. View of basement.



21. View of sump pump in the basement.



22. View of sump pump.



23. View of fuel oil-fired boiler



24. View of electric water heater.





25. View of fuel oil AST located in basement.



26. View of pipe wrap, fiberglass visible.



27. View of pipe wrap, fiberglass visible.



28. View pipe wrap, fiberglass visible.



29. View of mold in basement.



30. View of employee breakroom in basement.





31. View of typical bathroom.




32. View of wall unit.



33. View of storm water drain.



34. View of typical trash.

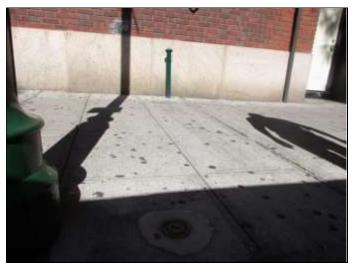

35. View of fill port and vent pipe.



36. View of in use vent pipe, and old vent pipe.



# APPENDIX B: HISTORICAL/REGULATORY/SUPPORTING DOCUMENTATION





Date of Photograph: 1947

N









KEY: Subject Property



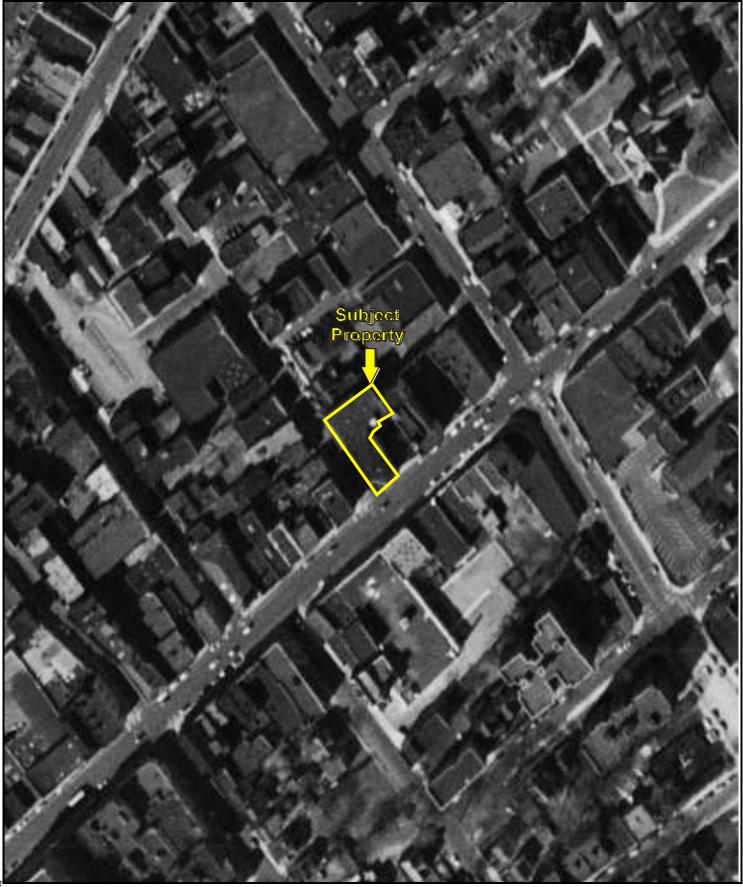





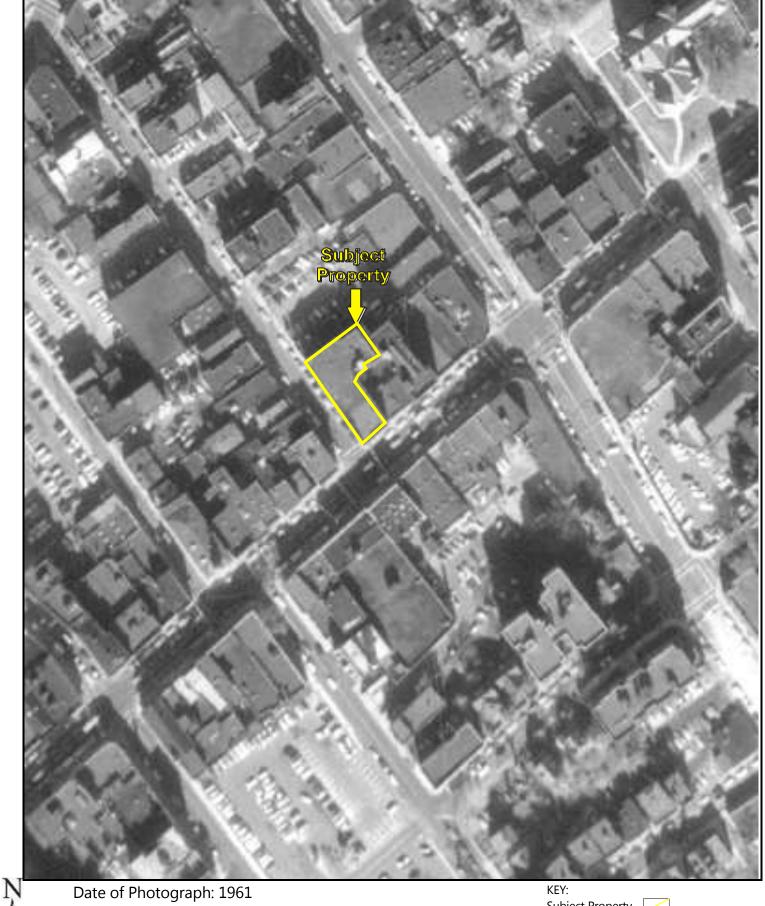












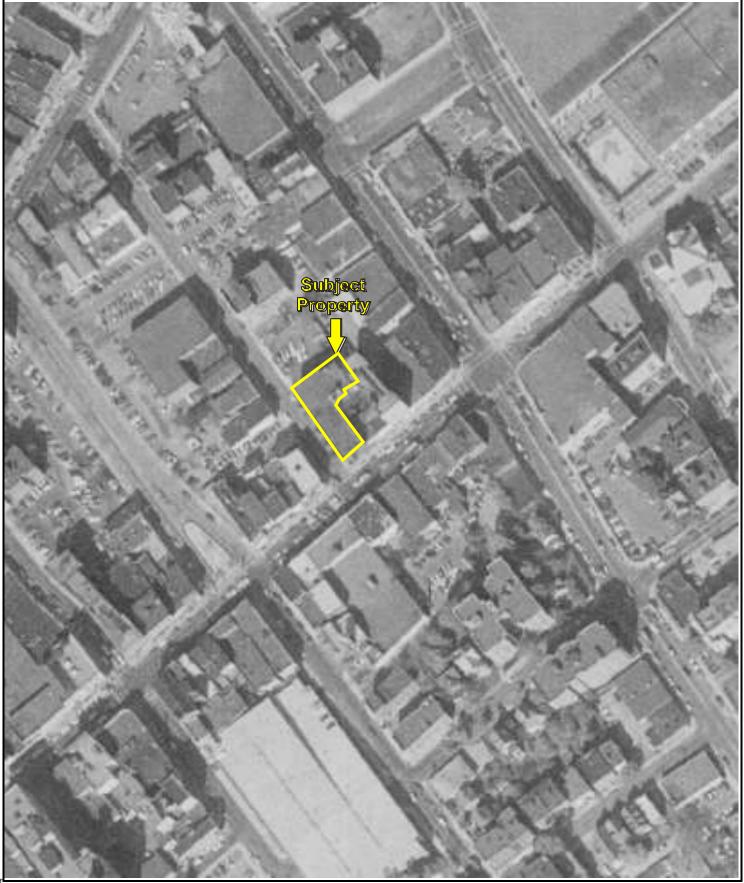

ſ












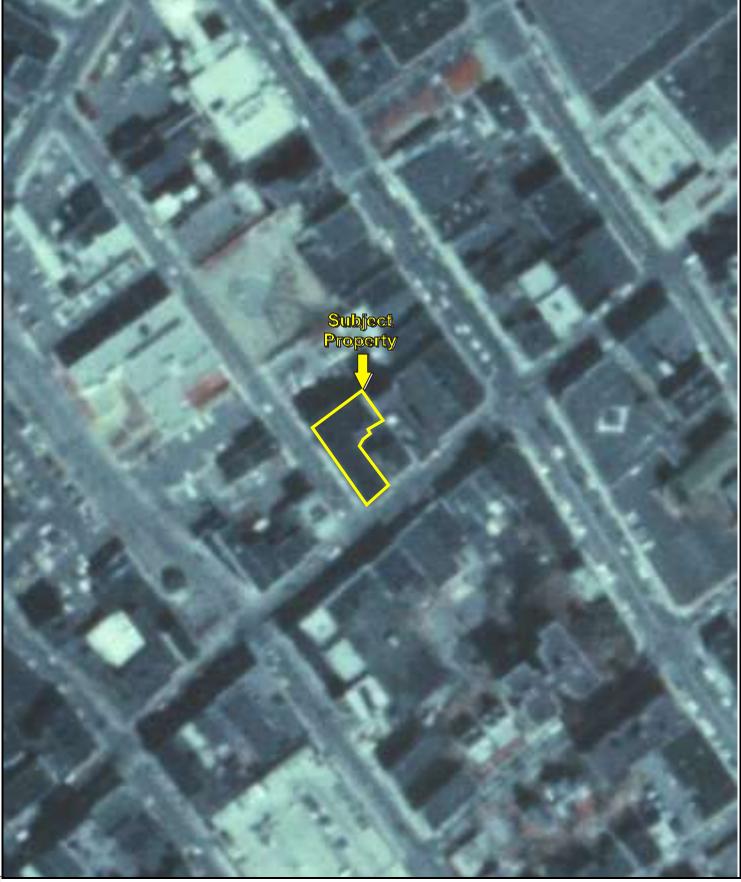

Ņ







Ņ








Date of Photograph: 2006


KEY: Subject Property



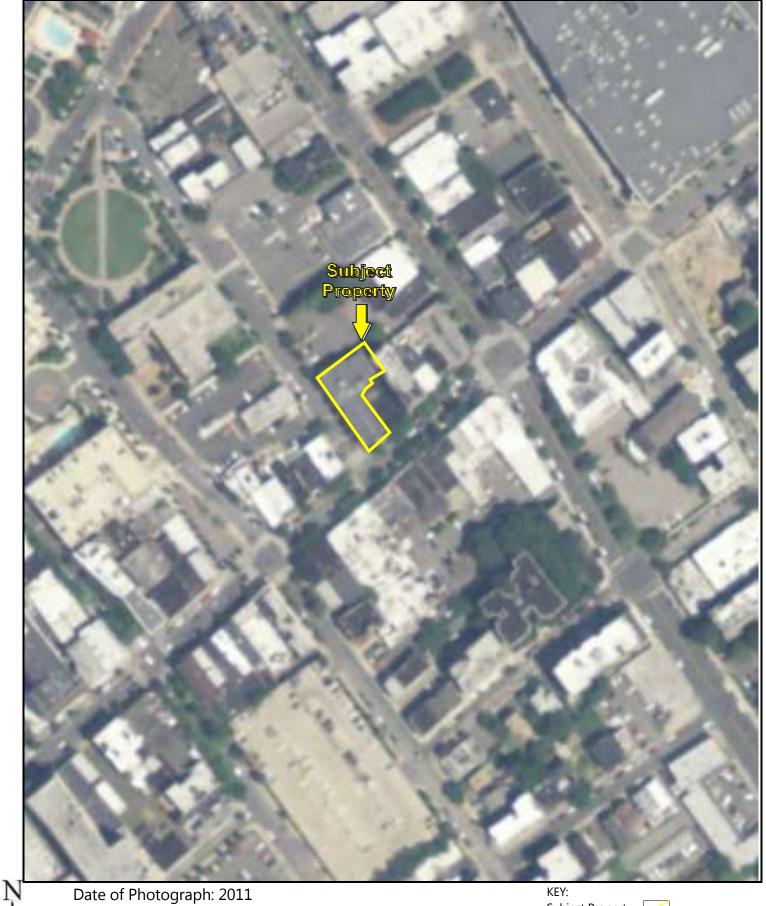








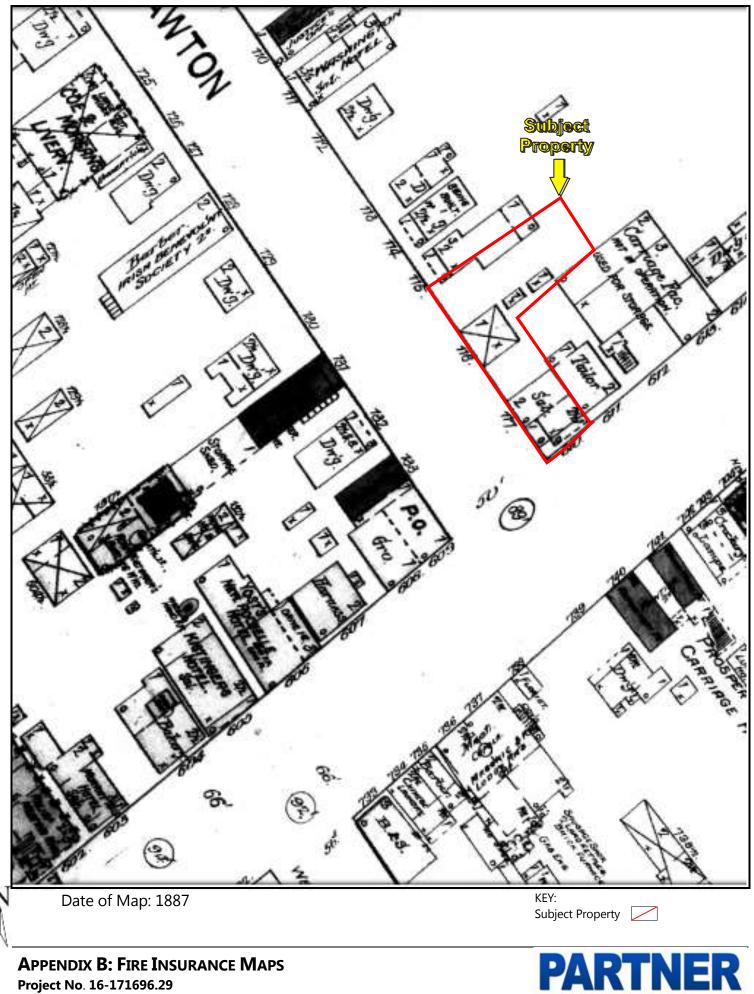


Project No. 16-171696.29

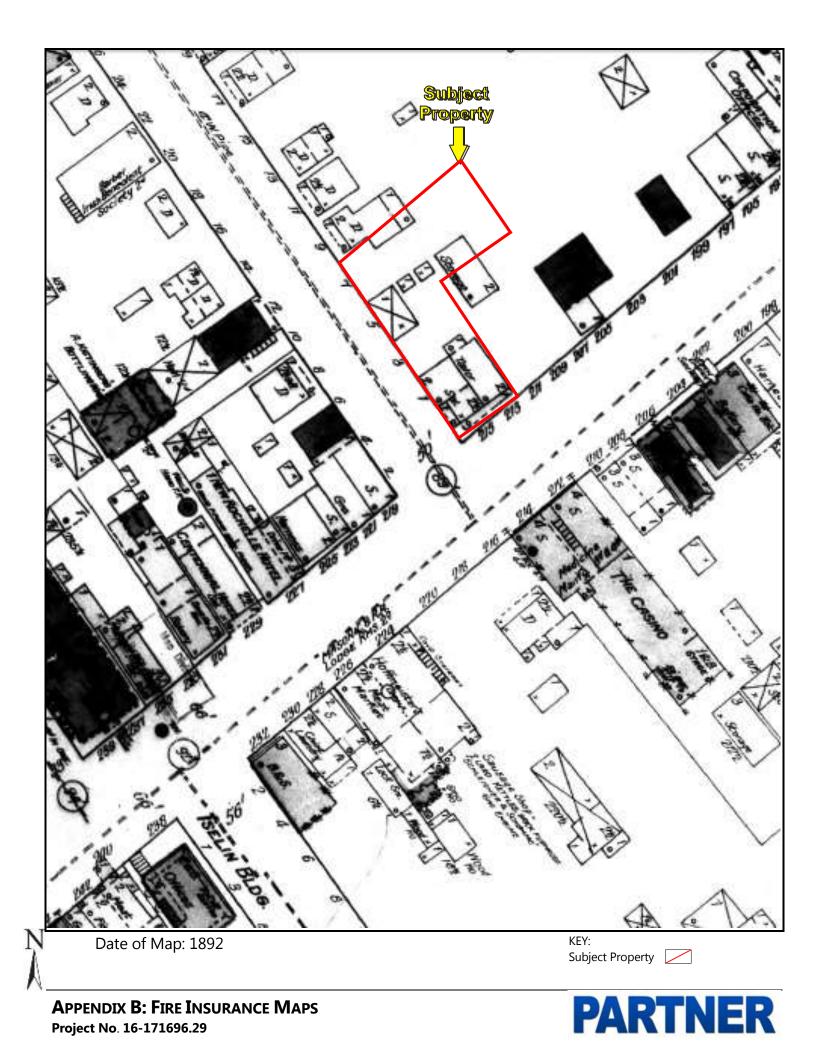


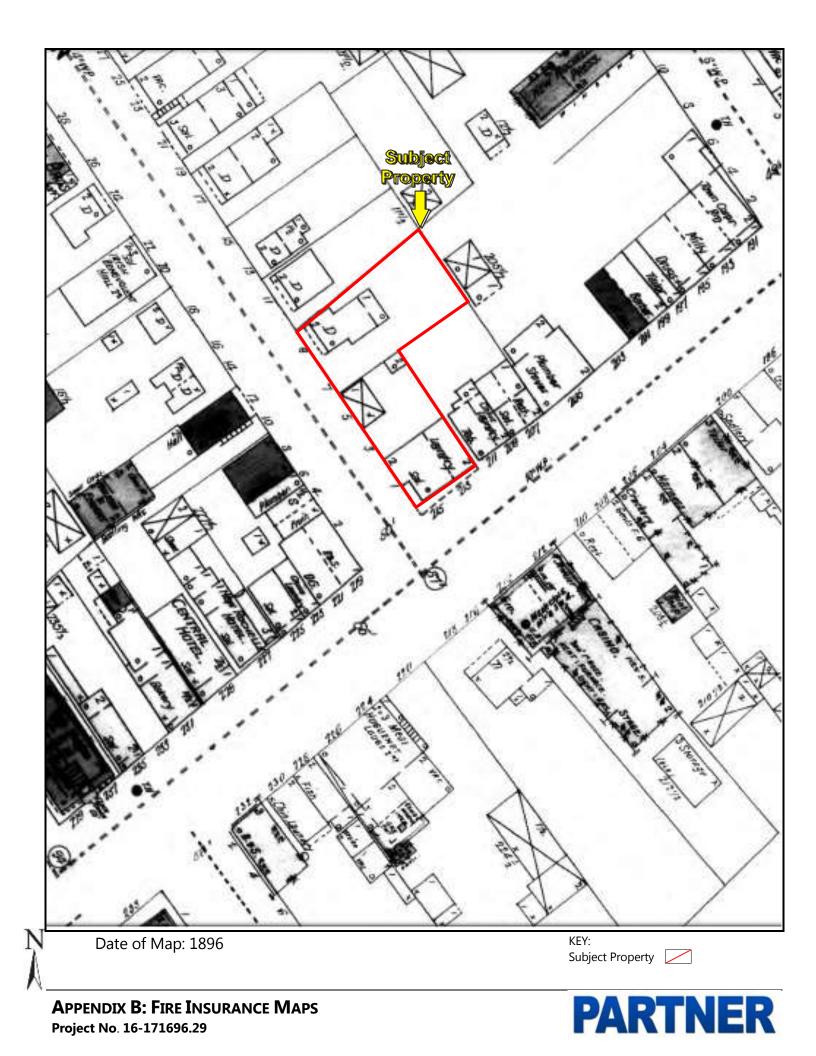

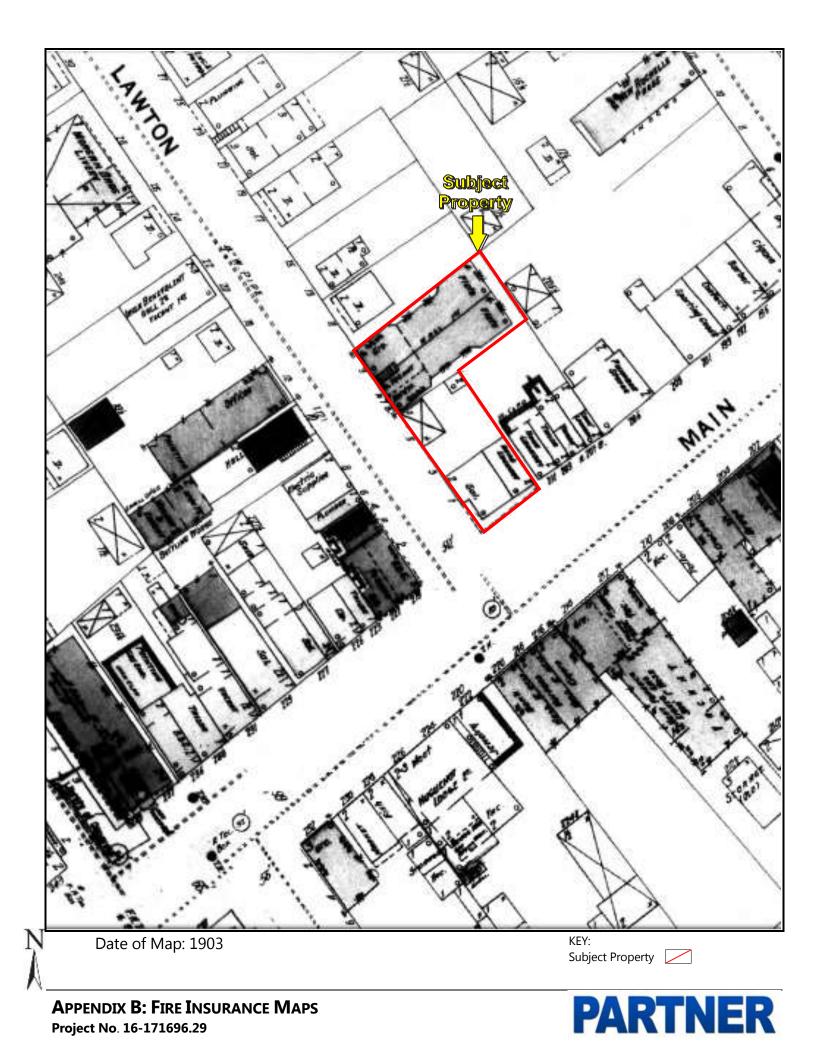

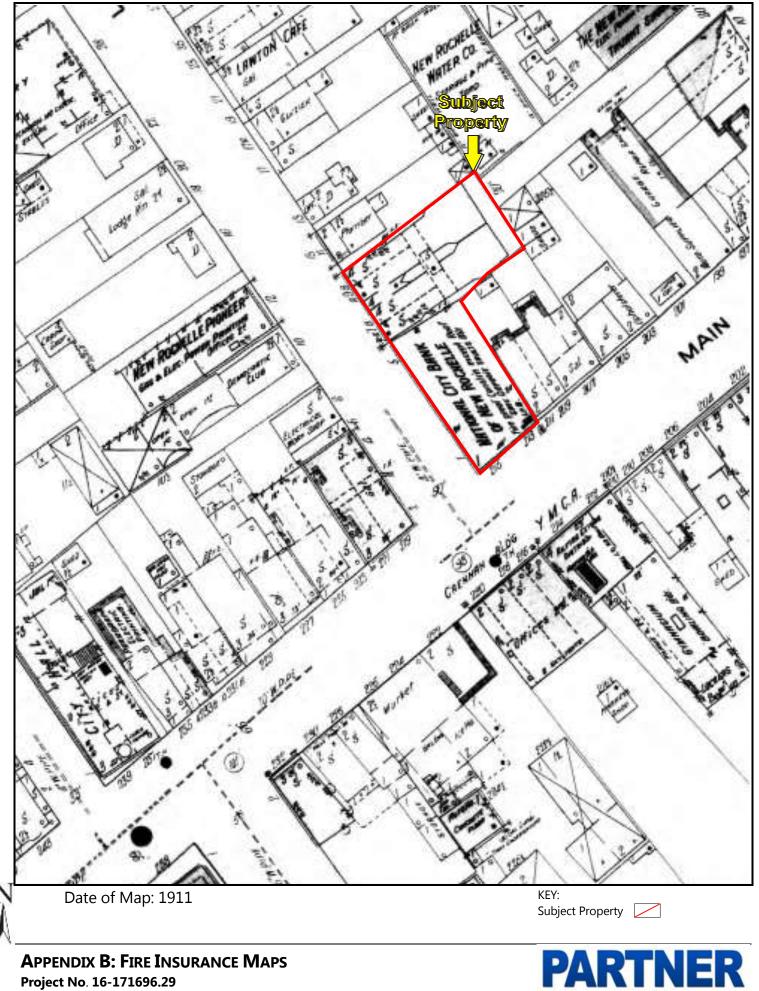


Project No. 16-171696.29

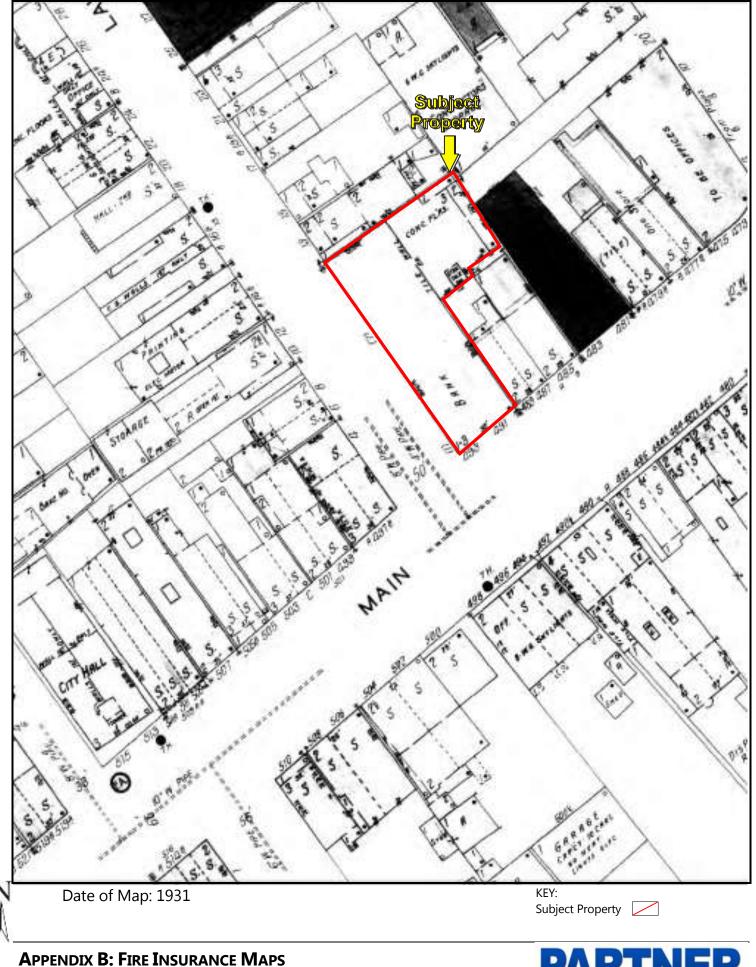


Project No. 16-171696.29




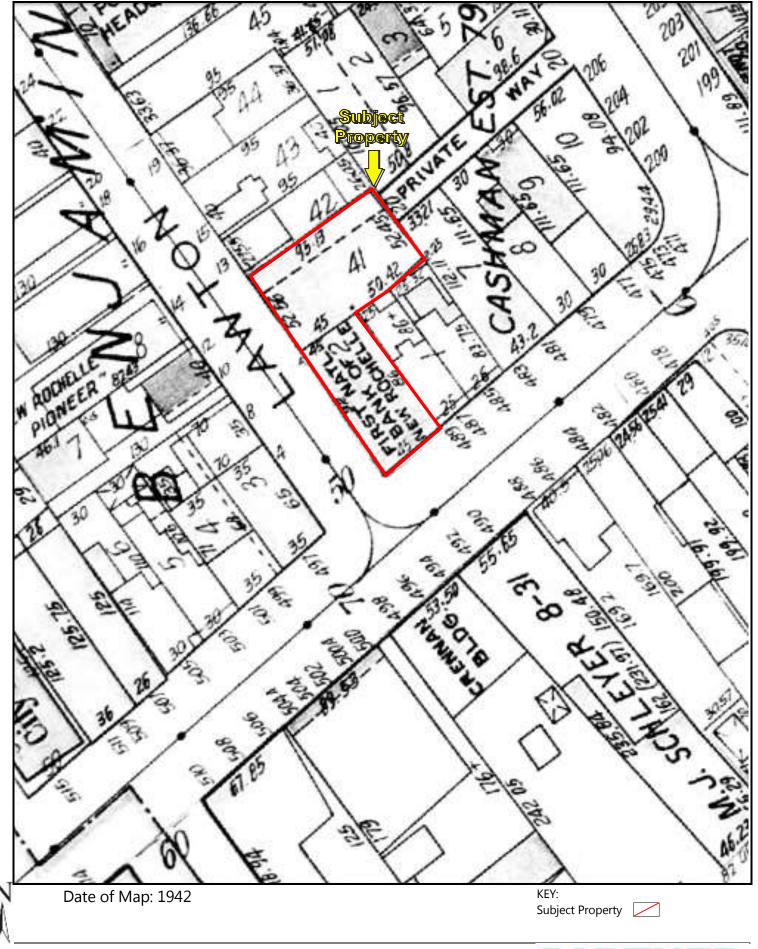


APPENDIX B: FIRE INSURANCE MAPS Project No. 16-171696.29



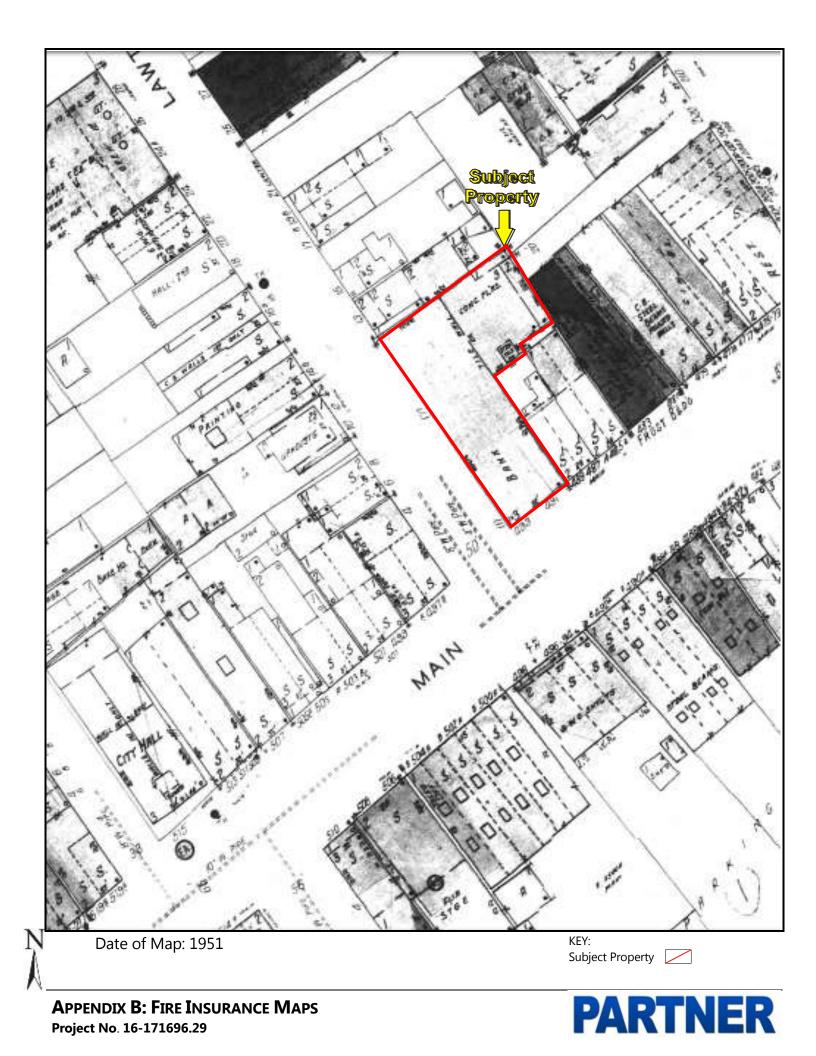


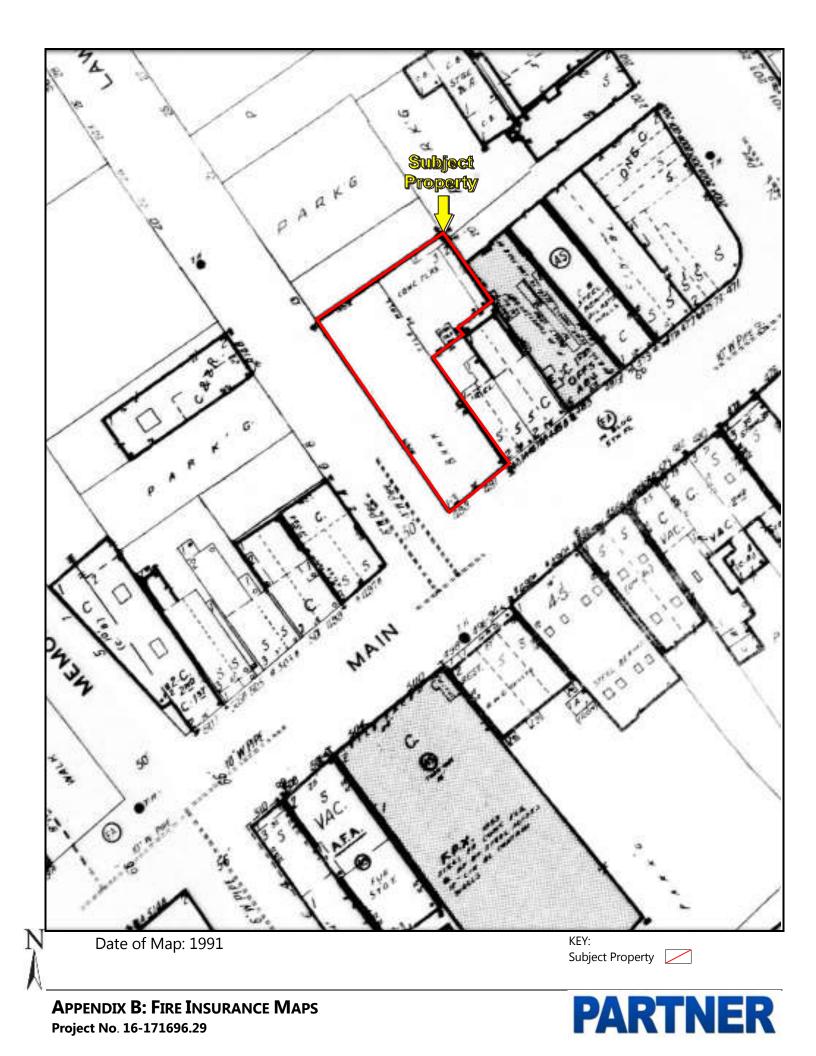



# Municipal Tax Parcel Viewer



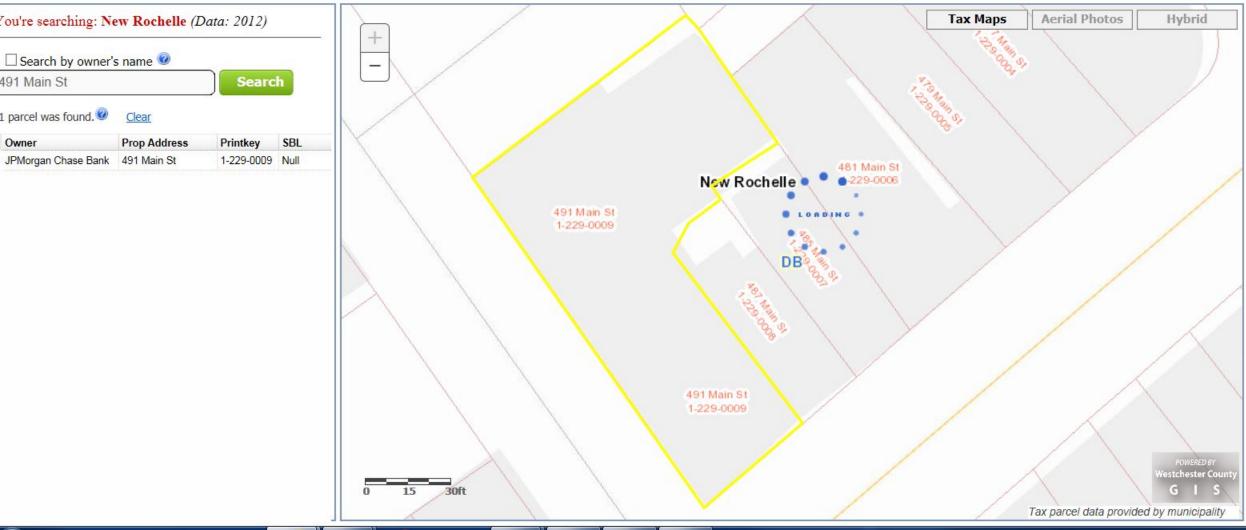



Date Printed: 10/3/2016

## NYSDEC SPILL REPORT FORM



1


DEC REGION:	3			BER: 8	905129	
SPILL NAME:	BARCLAYS BANK OF N	Y/NA	DEC LEAD:	<u> </u>	vxwadswo	
SPILL DATE:	08/23/198	39	SPILL TIM	E: _	1:00 pm	
CALL RECEIV	ED DATE: 08/23/198	39		) TIME:	3:35 pm	
		<u>SPILL LO</u>	CATION			
PLACE:	BARCLAYS BANK OF NY	/NA	COUNTY:	We	estchester	
STREET:	491 MAIN ST.		TOWN/CI <sup>-</sup> COMMUN		w Rochelle (c)	
CONTACT:						
CONT. FACTOR	: Tank Test Failure		SPILL REPOR	RTED BY: Tan	k Tester	
FACILITY TYPE	Commercial/Industri	al		/:		
	ETRO TITE 2K 4 GPH					
MATERIAL #2 fuel oil		CLASS Petroleum	<b>SPILLED</b> 0 G	RECOVE 0 G	RED RESOUR Soil,	CES AFFECTED
		POTENTIA	L SPILLERS			
<b>COMPANY</b> BARCLAYS BAI	ADDR NK OF NY/NA 604 BI	ESS ROAD HOLLOW RE	). MELVILLE M		CONTACT	
					(516) 420-0045	
Tank No. Tank		Cause S	ource	<b>Test Method</b> 00	<b>Leak Rate</b> 0.00	Gross Failure
DEC REMAR	KS:					
	04 data translation this spill NC. (516) 933-1085 NAT M			ORTH"		
RETEST -	132GPH. TANK TO BE RE	ELINED OR REPLAC	CED.			
03/25/91: TANK	REMOVED.					
<u>PIN</u>	<u>T &amp; A</u>	<u>COST C</u>	ENTER			
CLASS: C3	CLOSE DATE: 03	8/25/1991	MEETS STAN	DARDS: Tru	le	
Created On:	08/31/1989					

Last Updated: 02/12/1997

# DEC Environmental Navigator

### Mineral Resources

Navigator Home Feedback

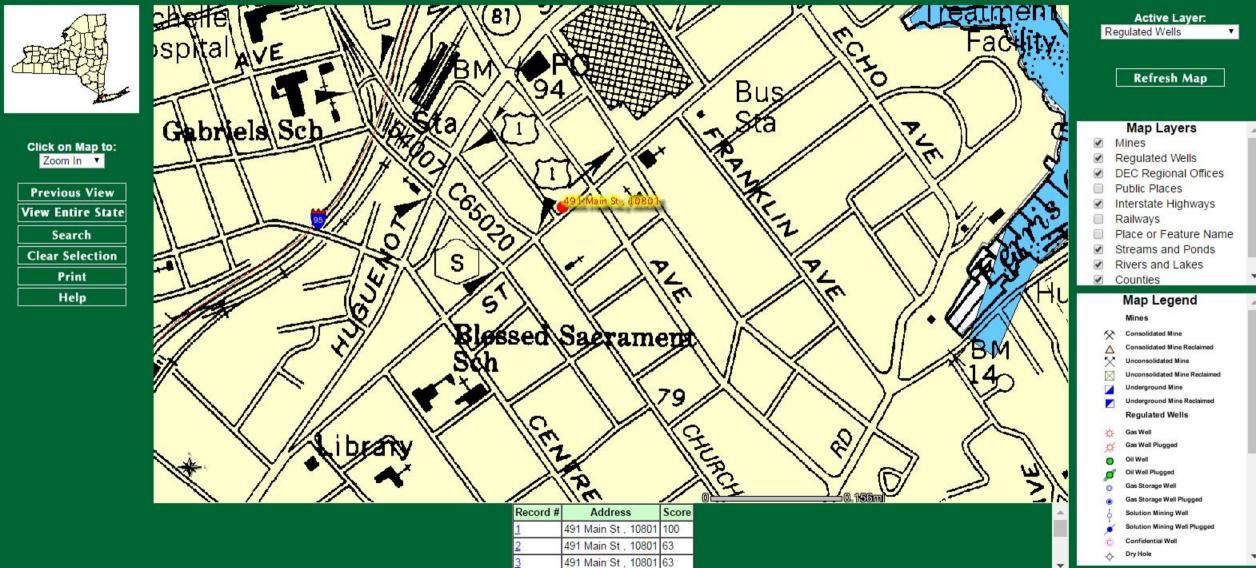

#### **Property Report For:**

# 491 Main St New Rochelle, NY, 10801

0.21 acres lot



Est. Value:

\$860,677

# Valuation & Financials Estimated Value: \$860,677 (0% Confidence\*)

Est. Low Value - | Est. High Value -

\* About Our Estimations: USRealtyRecords.com property valuations are calculated from a variety of sources. The confidence rating shown is based on how recent and reliable these sources are.

# **Property Details**

# Site Information

- Parcel Id: 1000-000-001-00229-000-0009
- Zoning Category: Commercial
- Description: Financial Institution
- Size: 9,148 sq ft.
- Acres: 0.2100
- Absentee Owner: Owner Occupied
- Municipality Name: NEW ROCHELLE
- Walk Score: 97
- Universal Property Id: 418022

# Structure Information

# Ownership Information

#### JPMORGAN CHASE BANK Corporate Owner

491 Main St New Rochelle, NY, 10801-6303

# Property History

## Sale History

Sale Date	Sale Amount	Sale Type	Sellers Name
December 11 1992	\$1,785,000	Grant Deed	Unable to locate
<ul> <li>Transaction ID: 1910010115159</li> <li>Multiple/Split Parcel Sale: Multiple Parcel Sale</li> </ul>			


### Tax History

Year:	Taxes:	Land:	Additions:	Total Assessment:
2015	\$56,657	\$29,400	\$19,600	\$49,000


### Mortgages

Our search did not find any current mortgages on this property.


# Location

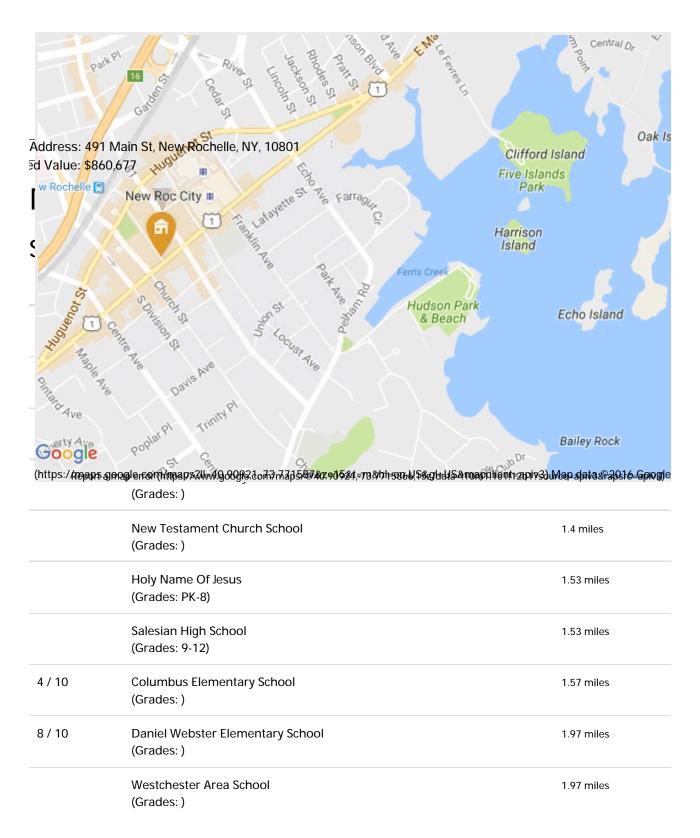


# Neighborhood Demographics

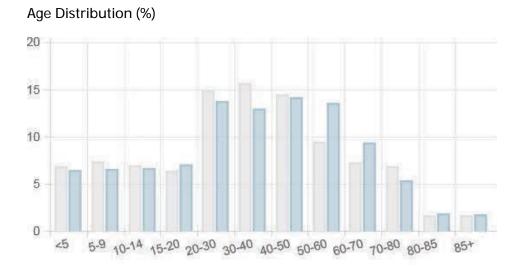


#### Comparison

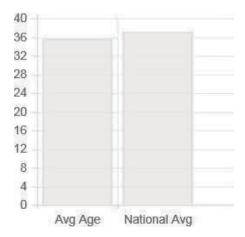


#### Education

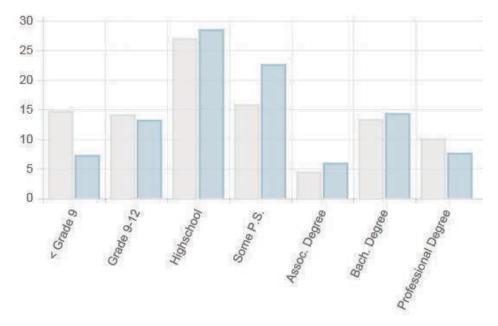

Comparison

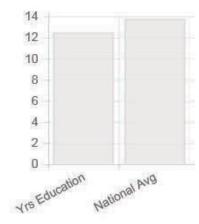

#### Ethnicity Breakdown

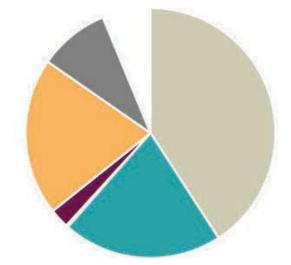

Legend

White Black Indian Asian Hawaiian Hispanic Other Race

**Economic Information** 

	Average in this ZIP	National Average
Household Income	\$42,290.00	\$51,939.00
Per Capita Income	\$21,838.00	\$24,062.00
House Value	\$260,500.00	\$188,900.00

## WalkScore Information



Restaurants: Mexican Corner Restaurant

Coffee: Twin Donut

Bars: The Clubhouse

Groceries: Viva Ranch Fruit Market

Parks: Liberty Park

More Places:


Where do you commute?

Score Your Home (Https://www.addredfin.com/how-walk-score-wc Go

# Market Conditions


## Price Trends

Median single family home price.

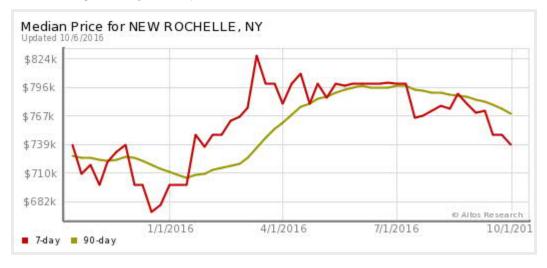


### Market Conditions

#### Market Action Index

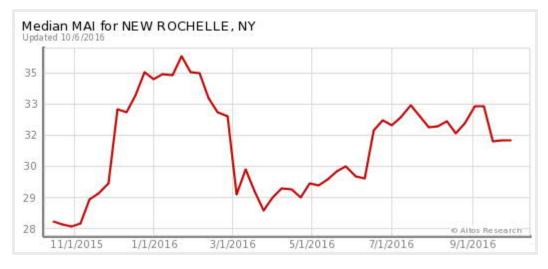


### Price per Square foot

Median price per square foot.

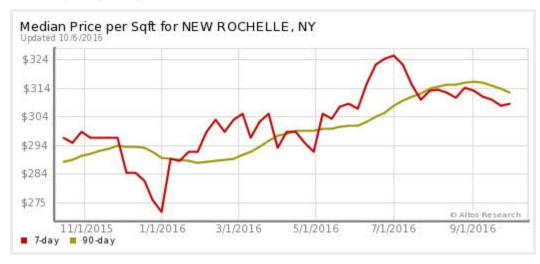


### Sales and Demand Trends

Average days on market.

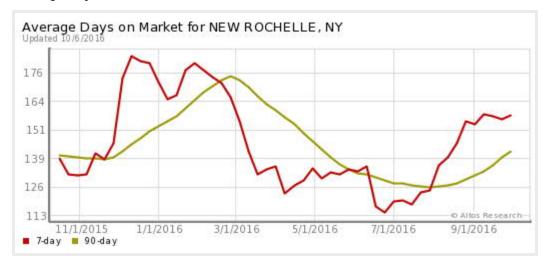

### Homes for Sale



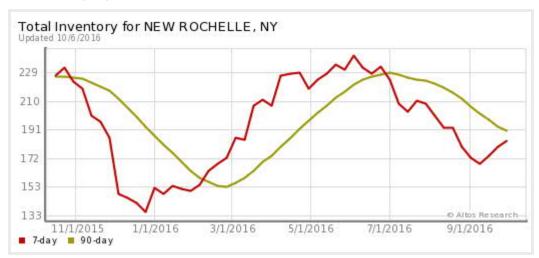

#### Soder, Candice

From: Sent: To: Subject: New York DEC Support <newyorkdec@mycusthelp.net> Tuesday, September 27, 2016 9:11 AM Soder, Candice Freedom of Information Law Request :: W012594-092616

--- Please respond above this line ---

×

Region 3 - New Paltz P: 845 256-3154 | F: www.dec.ny.gov

Good morning Candice

After searching our regional office records we were not able to locate any for the address you requested. You may want to contact the Westchester County Health Department for any records they may have. Thank you and have a nice day. - Region 3 FOIL Office

×



09/26/2016

PARTNER ENGINEERING AND SCIENCE, INC. Candice Soder 10 Mountainview Road, Suite 218 North, Upper Saddle River, NJ 07458

#### FREEDOM OF INFORMATION- ACKNOWLEDGEMENT LETTER UST/AST installation or removal, site remediation-#2016-09-0481

Dear Candice Soder:

Your FOIL request dated 09/26/2016 was received by the City of New Rochelle, New York on 09/26/2016. The request is being reviewed and I anticipate you will be contacted regarding your request on or before 10/24/2016.

Access to the records, in whole or part, will be determined in accordance with Article 89 section 5 of the Freedom of Information Law.

Once the research has been completed, I will notify you of the results of the records search and, if necessary, set a time and date for pick up of copies if available. Pursuant to FOIL, a fee of \$.25 per page for photocopies not exceeding 9"x14" will be charged. If you wish to have the copies mailed to you, please add \$5.00 for handling and shipping.

Oversized documents larger than 9"x14" will be sent out and will cost more. The vendor will notify you.

Thank you in advance for your cooperation. If you have any questions, or require further information, please do not hesitate to contact me.

Sincerely,

Bennie F. Giles, III Records Access Officer City of New Rochelle, New York

cc: Law Department

## FOIL Request Has Been Sent

Your request for information has been sent. Someone from the specified department will contact you soon. T FUIL Request Main Page

= I Want to ... \*

Reference No: W012594-092616 Contact E-Mail: csoder@partneresi.com

Dear Candice:

Thank you for your Freedom of Information Law (FOIL) request. Your request has been received and is being processed. Your request was received in this office on 9/26/2016 and given the reference number FOIL **#W012594-092616** for tracking purposes. You may expect the Department's response to your request no later than **10/25/2016**.

Record Requested: please send records of AST/UST installation or removal, and any records of site remediation for 491 Main street, New Rochelle, NY 10801 1-229-0009

You can monitor the progress of your request at the link below and you'll receive an email when your request has been completed. Again, thank you for using the FOIL Center.

https://mycusthelp.com/NEWYORKDEC/\_rs/RequestLogin.aspx

New York State Department of Environmental Conservation, Record Access Office

Powered by

# City of New Rochelle, New York Public Access to Records Application

For City Use

Received By City Clerk's Office

Sent To\_\_\_\_\_

Requested Date to Reply\_\_\_\_

Date Received

#### (PLEASE PRINT LEGIBLY)

Name Candice Soder

Address 10 mountain view road, suite 218 north City/State/Zip Upper Saddle River

Daytime Phone Number: <u>973-570-2630</u> email address <u>csoder@partneresi.com</u>

I (we) represent: X Myself

Name & Address of Third Party\_

# Records Request

□ A Third Party

Fully describe the records you are requesting. A complete and detailed description of the records you are requesting is necessary to accurately respond to your request. Your failure to describe the records that you are requesting in sufficient detail may result in a denial of your request. You must also include the dates of the documents.

The documents are in the Department(s) Building/Fire

I WOULD LIKE TO (CIRCLE ONE) INSPECT / HAVE COPIES OF THE DOCUMENT(S) LISTED.

**Documents**:

Please send any records of UST/AST installation or removal, and records of site remediation for 491 Main street, New Rochelle, NY 10801 1-229-0009

Date and/or Time Period of the Documents: Any

There is twenty-five cents  $(25\phi)$  per page charge per page for each regular size  $(8\frac{1}{2} \times 11)$  public document copied. There will be additional charges for larger size documents, maps, tapes, disks, etc. By signing this document, you agree to pay any reproduction costs that may apply.

Camilia Sollo

9/26/2016

Signature

Date

A response to your request will be within five days. Our departments will have up to twenty business days to research and provide the requested documents. If denied you have the right to appeal in writing to the City Manager within ten days of the denial. NR 2016 FOIL



**AFX Research, LLC** 211B Tank Farm Rd San Luis Obispo, CA 93402 (877) 848-5337 Fax: (800) 201-0620

# AFX Environmental Lien & AUL Search Report

16-171696.29

491 MAIN ST NEW ROCHELLE, NY 10801

AFX Order #79-28263-47

09/29/2016

# **ENVIRONMENTAL LIEN REPORT**

16-171696.29

The AFX Lien Search Report is intended to assist in the search for environmental liens filed in land title records.

#### TARGET PROPERTY INFORMATION

#### ADDRESS

491 MAIN ST NEW ROCHELLE, NY 10801-6303

#### RESEARCH SOURCE

UNITED STATES ENVIRONMENTAL PROTECTION AGENCY NEW YORK DEPARTMENT OF ENVIRONMENTAL CONSERVATION WESTCHESTER COUNTY OFFICIAL LAND RECORDS

#### **DEED INFORMATION**

Type of Instrument: BARGAIN AND SALE DEED WITHOUT COVENANT

Grantor: THE BANK OF NEW YORK

Grantee: JPMORGAN CHASE BANK

Deed Dated: 10/01/2006

Deed Recorded: 12/12/2006

Instrument: 46300/191

#### LEGAL DESCRIPTION

Legal Block: 229

Assessor's Parcel Number (s): 1000-000-001-00229-000-0009



# ENVIRONMENTAL LIEN REPORT 16-171696.29

#### ENVIRONMENTAL LIEN

Environmental Lien: Found Not Found X

If Found Describe:

#### OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AULs: Found Not Found X

If Found Describe:



# ENVIRONMENTAL LIEN REPORT

16-171696.29

# Thank you for your order! Please contact our office at (877) 848-5337 AFX Research, LLC

The **AFX Research**, **LLC** Environmental Lien & AUL Search Report, provides results from available current land title records for environmental cleanup liens and other activities and use limitations, such as engineering and institutional controls.

A network of trained, professional researchers, following established industry protocols, use client supplied property information to search for:

- Parcel information and / or legal description
- Ownership information
- Official land title documents recorded at jurisdictional agencies such as recorder's' office, registries of deeds, county clerks' offices, etc.
- Access a copy of the deed
- Environmental encumbrance(s) associate with the deed
- Provide a copy of any environmental encumbrance(s) based upon a review of keywords in the instrument(s) (title, parties involved and description)
- Provide a copy of the deed or cite documents reviewed

### -Disclaimer-

This report was prepared for the use of **AFX Research LLC** (AFX), exclusively. This report is neither a guarantee of title, a commitment to insure, nor a policy of title insurance. **NO WARRANTY, EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT.** AFX specifically disclaims the making of any such warranties, including without limitation, merchantability or fitness for a particular use or purpose. The information contained in this report is retrieved as it is recorded from the various agencies that make it available. The total liability is limited to the fee paid for this report.



#### **JPMC Branch Portfolio**

491 Main Street New Rochelle, NY 10801

Inquiry Number: 4738280.5 September 29, 2016

# The EDR-City Directory Image Report



6 Armstrong Road Shelton, CT 06484 800.352.0050 www.edrnet.com

#### **TABLE OF CONTENTS**

#### **SECTION**

**Executive Summary** 

Findings

**City Directory Images** 

*Thank you for your business.* Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING. WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

### **EXECUTIVE SUMMARY**

#### DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

#### **RESEARCH SUMMARY**

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Target Street</u>	<u>Cross Street</u>	<u>Source</u>
2013	$\checkmark$		Cole Information Services
2008	$\checkmark$		Cole Information Services
2003	$\checkmark$		Cole Information Services
1999	$\checkmark$		Cole Information Services
1995	$\checkmark$		Cole Information Services
1992	$\checkmark$		Cole Information Services
1987	$\checkmark$		Cole Criss-Cross Directory
1982	$\checkmark$		Cole Criss-Cross Directory
1977	$\checkmark$		Cole Criss-Cross Directory
1972	$\checkmark$		Cole Criss-Cross Directory

#### **RECORD SOURCES**

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

### FINDINGS

#### TARGET PROPERTY STREET

#### 491 Main Street New Rochelle, NY 10801


<u>Year</u>	<u>CD Image</u>	<u>Source</u>
<u>MAIN ST</u>		
2013	pg A2	Cole Information Services
2008	pg A6	Cole Information Services
2003	pg A10	Cole Information Services
1999	pg A15	Cole Information Services
1995	pg A20	Cole Information Services
1992	pg A24	Cole Information Services
1987	pg A28	Cole Criss-Cross Directory
1987	pg A29	Cole Criss-Cross Directory
1982	pg A30	Cole Criss-Cross Directory
1977	pg A31	Cole Criss-Cross Directory
1977	pg A32	Cole Criss-Cross Directory
1972	pg A33	Cole Criss-Cross Directory
1972	pg A34	Cole Criss-Cross Directory

### FINDINGS

#### **CROSS STREETS**


No Cross Streets Identified

**City Directory Images** 

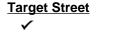

-


452	EMPORIO GELATO
. – .	
454	SILKIES SALOON
455	BEAST MUSIC INCORPORATED
	BRIM SNACK FOOD NE
	CLEGG DEBORAH D
	CROSSCULTURE SOLUTIONS
	DEBORAH CLEGG
	ECJ TAX & FINANCIAL SERVICES
	ELECTRONIC TECHNOLOGY
	INVESTMENT DESIGN PROPERTIES LTD
	JULIAN VARNER
	LOUIS ROME LAWRENCE GROUP INC
	NEW ROCHELLE SPORTS INC
	PHOTO VISIONS ROUNDHOUSE MULTIMEDIA
	WESTCHESTER INSTITUTE OF COMPUTER TE
457	
457	ARTISTIC HAIR DESIGNS
458	BARNES & NOBLE
459	AKITA STAFFING
100	AMCAFE INCORPORATED
	CHAMBER OF COMMERCE OF NEW ROCHELLE
	SAVINO JOHN A MD
	TRIAX COMPUTER SERVICES
	VIP HEALTH CARE SERVICES
	YACINES PLACE
463	BACKYARD PUB
	EMILIO FLORES
	MELCHOR COLORES
466	AEGIS RESOURCES
	ALDEN PERSONNEL OF NEW ROCHELLE
	ALL COMPUTER SVCES
	AMERICAN RECOVERY INC
	ANTON SATTLER MANAGEMENT CO INC
	B&H EMERGENCY LOCKSMITH
	BLUMBERG MARKETING
	BOBBY & FAMILY ROOFERS
	COMMUNITY HOUSING INNOVATION
	DE LELLO ROBERT
	DENNIS DOTHLYN
	EMPOWERED LEARNING INC
	FIRSTDIVISION SEC
	H&R BLOCK
	HAUSEN SCOTT DPM
	HOLLAR MILTON C DR

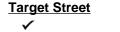

-

(Cont'd)


466	KATZ CLAIRE
	METROMED
	NESTLER WALTER
	NORTH & MAIN REALTY CO
	NUMBER 1 LOCKSMITH
	PREGNANCY CARE CENTER
	RECCO HOME CARE SERVICE INC
	RHEIN EIGHTY THREE USA INCORPORATED
	ROBSON FORENSIC
	SIEGEL FREDRICK
	STONE WATER ASSOCIATE
	TRI STATE OFFICE PRODS
	V & M SHERMAN DDS PC
	WJCS
	WATTSJONES D
	WOMEN MEDICAL WELLNESS
471	TWIN DONUTS
475	CELLULAR FACTORY INC
476	LOCKS & KEYS LOCKSMITH
	NEW ROCHELLE DELI
477	BSD LOCKSMITH
170	
478	ELEGANT HANDLERS FURS
479	PAYLESS SHOESOURCE
480	99 CENTS VALUE
404	
481	481 MAIN CLOTHING LLC ALSSARO CONSULTING SERVICES
	APPLIED TECHNOLOGY SERVICES INC
	ATOLL K ENTERPRISES INC
	BLANCA SALAZAR
	CHERYL FOSTER
	COMPUTER SOLUTIONS
	CON ZIGGY INC
	CONTINENTAL TAX SERVICE
	DEWEY DAVID W ATTORNEY
	ELLEN FRIED
	FRIED ELLEN ATTY
	FUN MILL
	GINGER CONNOLLY
	GROSS BENITA MD
	HASHIMI ENTERPRISES
	ILS IMMIGRATION LEGAL SERVICES
	JMS DIRECT
	KEL MULTI SERVICE
	MAIN STREET PEDIATRICS
	MALCOLM REAL ESTATE INC
	NATIONAL CAPITAL RECOVERY SVCE INC
	PETROV PRIMARY CARE MEDICINE OF NEW
	QUADREIGN MANAGEMENT CORP



-

(Cont'd)


101	
481	RETTNER MANAGMNT RETTNER REALTY
	SAMARITAN WORLDWIDE TRAVEL SVCES INC
	SAMUELS IMPORTS
	SAMUELS IMPORTS SCHROEDER MOLLY PHD
	SS SILBERBLATT INC
	SSTC TRANSPORTATION
	ST YVES MEDICAL & BEHAVIORAL HEALT
	WEISS RICHARD ESQ
	WHOLISTIC CLEANING SVCE
	WIDECSCOPE ENTERPRISES
482	RAINBOW FISH MARKET INC
484	FORMAL IMPRESSIONS
485	GUTIERREZ ALFONSO
	JUBILEE GIFT
	MIDEA SHOE
486	LUCKY TRADING 486
487	GET YOU IN LOCKSMITH
	NAIL CITY
	OCCUPANT UNKNOWN
	PIAZZA
	THE BEST OF NEW ROC LOCKSMITH
488	TIMING FASHION
489	GISELLE RAMOS
	JULIO CRUZ
490	BENNER THOMAS E DDS
	CARINA FURNITURE
	JS BOUTIQUE
	NATURAL NAILS BY EVIE
	NICKS NEW HAIR DESIGN
	PAUL ROBERTS
	PAUL S ROBERTS DDS PC
404	SUPERB LOCKSMITH
491	CHASE
494	FANCY PHOTO HONG DAO
	NUMBER 1 LOCKSMITH
496	BROTHERS ON MAIN
490	MAMMA ALARA PASTA PIZZA
	MATTYS PIZZA
	SIENA PIZZA RESTAURANT
	TAYLORMADE LOCKSMITH
497	FANTICS PHOTO INC
	MEXICAN CORNER RESTAURANT
	OCCUPANT UNKNOWN
498	ALICIAS BAKERY
	DAGUS MARKETING RESEARCH
	MAYOOR TRANSPORTATION
	ROSA CONTRACTING INC
499	ON MAIN OPTICAL



-


# MAIN ST 2013 (Cont'd)

500	NEW ROCHELLE EMERGENCY LOCKSMITH
500	NEW YORK COVENANT CHURCH
501	THE GNARLY VINE
503	EMBAJADA LATINA
	MARIA HERNANDEZ
	NEW ELEGANT BEAUTY SUPPLIES
	RAFAEL VALDOVINOS
	SECUNDINO GONZALES
505	EXOTIC NAILS
	JORGE REYES
	JOSE ZAPATA
	QUEENS WIG CORP
506	DOLLAR BEST
507	ALMARC DRUGS
	MAIN STREET APOTHECARY & SURGICAL SU
510	LIEBMANS CHILDRENS CLOTHING & SCHO
514	ABLE MORTGAGE GROUP
	ANDYS DELI
	CARE WELL AMBULETTE INC
	FLOOD CONTROL
	HANDYMAN SOLUTIONS INC
	MEACHEM TAX & FINANCE SERVICES
	NEW ROCK FOOTPRINT INC
518	TAX SERVICES BABYS OUTLET
516	EMMIS BROADCASTING
519	COOL CONNECTIONS INC
515	LUPITAS TATTOOS
	STARLITE II RESTAURANT
	THE MORNING STAR SOCIETY INC
521	RAYMOND OPTICIANS
523	HABIBS ATMOSPHERE IS HAIR
524	HABITAT FOR HUMANITY
	KENNY PUBLISHING
	NEW ROCHELLE VARIETY STORE
	RABEN CAPITAL GROWTH CORPORATION
525	CASINO STUDIOS
	COHEN I B
	CONSIGN IT ON MAIN
	FASTLINK WIRELESS
	QUEEN CITY STUDIOS
526	526 MAIN LAUNDORMAT
	CINDY CABRERA
527	BUZZ MAGAZINE INC
	UNLIMITED MEDIA SOLUTIONS

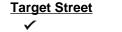

-


455	ALLIED ONE SECURITIES CORP
100	BROOKEITH CORP
	DEBORAH D MILLS PC
	DEBORAH MILLS
	ECJ TAX & FINANCIAL SERVICES
	INLAND SECURITY SOLUTIONS INC
	INVESTMENT DESIGN PROPERTIES LTD
	LATIN AMERICAN SERVICES
	LEE JOHN
	MISTER SPORTS
	PHOTO VISIONS
	R MANN CONSULTING
	RAWSOUL PRODUCTIONS
457	
457	
458	JOSE CUYA
459	AMCAFE INC
	CHAMBER OF COMMERCE OF NEW ROCHELLE
	HEIMER RICHARD L PE PC
	KENTEA LIMITED
	LEWIS STUDIO
	LINCOLN REFRIGERATION
	NANCY BARON
	NEWMAN LEONARD J
	NOTIFY MD
	PROFESSNAL OFFICE ANSWERING SERVICE
	VIP HEALTH CARE SERVICE
463	ALEJANDRO LOPEZ
405	BACKYARD PUB
	JENNIFER PAULINO
	MELCHOR COLORES
	NORTH & MAIN TAVERN INC
466	AEGIS RESOURCES INC
	ALDEN PERSONNEL OF NEW ROCHELLE
	ALL COMPUTER SERVICES
	ALLCOMSVC
	ANTON SATTLER INC
	ANTON SATTLER MANAGEMENT CO
	ASSOCIATES FIRST CAPITAL CORP
	BLUMBERG MARKETING
	CAREER PURSUIT SERVICES
	CHAMPAGNE ASSOCIATES PC
	CLAIRE KATZ
	DE LELLO ROBERT
	EMPOWERED LEARNING RESOURCES INC
	FAMILY CHRISTIAN CENTER
	FAMILY FOOT CARE
	FREDRIC S SIEGEL DDS
	HOLLAR MILTON C DR



-

(Cont'd)

466	JANICE E WILLIAMS
400	JOHN ERIC JACOBY MD PC
	JOSEPH TAMBASCO AMERICAN RECOVERY
	METRO MEDICAL
	MILTON HOLLAR
	PREGNANCY CARE CENTER
	RECCO HOME CARE SERVICE INC
	RHEIN 83
	SCOTT HAUSEN DPM
	TRI STATE OFFICE PRODUCTS INC
	V & M SHERMAN DDS PC
	WESTCHESTER INST OF COMPUTER
474	
471	TWIN DONUTS
475	
476	NEW ROCHELLE DELI
477	VIVA RANCH INC
478	ELEGANT FURS INC
479	PAYLESS SHOESOURCE
480	99 CENTER VALUE INC
	OCCUPANT UNKNOWN
481	151ST STREET REALTY CORP
	2 NV PRODUCTIONS
	BARRY LEVITEX
	BENITA GROSS
	BENITA L GROSS MD
	CONTINENTAL TAX SERVICE
	CORPORATE RESEARCH GROUP INC
	CRUISE HOLIDAYS INC
	DAVID DEWEY
	DEWEY ASSOCIATES INTERNATIONAL
	ELLEN FRIED
	EXCEPTIONAL FNDI WDDING PHOTOGRAPHY
	FOREMOST HOME CARE
	INTEGRITY SALES LLC
	MARGARITA SPINETTI
	MARIA KANTHA
	MOLLY SCHROEDER
	NATIONAL CAPITAL RECOVERY SERVICE
	NATIONAL PACKAGING & DISPLAY
	PERFORMANCE MARKETING ASSOCIATES NY
	QUADREIGN MANAGEMENT CORP
	RETTNER MANAGEMENT CORP
	SCRIPTMAIL PHARMACY
	U S INTERNATIONAL GROUP INC
482	RAINBOW FISH MARKET
484	NEW ROCHELLE FARM
485	ALFONSO GUTIERREZ
	JUBILEE GIFT

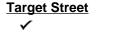


-

## MAIN ST 2008

(Cont'd)

485	TACO LOCO II	
486		
	LUCKY TRADING	
487		
	OCCUPANT UNKNOWN	
488		
489		
	JULIO CRUZ MARIA DETTLER	
	PEDRO PAZOS	
	RICHERD MORANTE	
490		
100	NICK JIMENEZ	
	NICK S NEW HAIR DESIGN	
	PAUL ROBERTS	
	PAUL ROBERTS	
491	THE BANK OF NEW YORK INC	
494	HONG DAO	
	NATURAL NAILS	
497		
400	FANTICS PHOTO INC	
498		
	INDIGO MOON KURIAKOSE PANNIKODU	
	LUPITAS TATTOOS	
	WAYNE HENRY	
499		
	PARK HILL OPTICAL INC	
500	NEW YORK COVENANT CHURCH	
503	ELEGANT BEAUTY SUPPLY INC	
	EMBAJADA LATINA	
	LATINA EMBAJADA	
	RAFAEL VALDOVINOS	
505		
	JOSE ZAPATA KIMS NAILS	
	YESENIA HERNANDEZ	
506		
507		
	ALMARC PHARMACY	
	MAIN ST APOTHECARY SURGCL SP	
510	LIEBMANS	
	STILLMAN INC	
514	AMERAPORT ASSET MANAGEMENT	
	CARE WELL AMBULETTE INC	
	CONNECTICUT VALLEY COURT	
	JM PROMOTIONS PHILIP ORNER	
	FHILIF UNIVER	



-

## MAIN ST 2008

(Cont'd)

RODWICK COMMUNICATIONS SERVICES
COOL CONNECTIONS
DIETZ FAMILY RESTAURANT CORP
DON KEENE STUDIO
THE VILLAGE OPTICIAN
AR KINGS INC
CLAUDIA BAQUERO
DIEGO ROJAS
LU MUNOZ
MIRIAM CALVO
HABIBS ATMOSPHERIC IS HAIR
HARRAZURA

RABEN CAPITAL GROWTH CORP

S HABIB

**TIEROS INC** 

COSIGN IT ON MAIN I B COHEN INC

UNIQUE CHOICE

NEW MEDICAL STUDIO LTD

MARCELINO CONTRACTING INC


UNLIMITED MEDICAL SOLUTIONS

COHEN I B

524


525

527

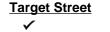

-

451	MOLLY SCHROEDER
452	OCCUPANT UNKNOWN
454	SPOTS PLACE CAFE
455	DEBORAH D MILLS
100	ELIZABETH MARSTON
	HOUSE OF INFORMATION
	INVESTMENT DESIGN PROPERTIES LTD
	JOHN BRYAN
	L & C PAINTING & CONTRACTING LTD
	LATIN AMERICAN SVCES
	MILLS DEBORAH D
	MISTER SPORTS
	NEAL BAKER
	NEW ROCHELLE DAY SPA & SALON INC
	NEW ROCK INTERNATIONAL
	ONE THOUSAND FRIENDS CORP
	SR CHECK IN SERVICES
	YOLANDA BERBICK
456	JOSE DIAZ
	WESTCHESTER JUJITSU LTD
457	DOUGLAS DEPIERRO
	DOUGLAS DEPIERRO
	HAIR CO
458	
459	ROSA ROLDAN AMCAFE INC
459	CALL SUPPORT SERVICES INC
	CHAMBER OF CMRC OF NEW ROCH INC
	DEWEY ASSOCS INTERNATIONAL INC
	DEWEY DAVID W ATTY
	FORE ASSOCS
	FRIED ELLEN ATTY
	HEIMER RICHARD L PE PC
	HOSPITALITYSTA
	KENTEA LIMITED
	LAWRENCE DAVID MD PC
	LEONARD J NEWMAN
	LEWIS STUDIO
	MARKETING TOMORROW INC
	NEW ROCHELLE CHAMBER OF CMRC
	SAVINO JOHN A MD
463	BACKYARD PUB
	MELCHOR COLORES
	NORTH & MAIN TAVERN INC
	TANISHA MILLER
466	ALL COMPUTER SVCES
	ALVIN B ZELLER MAILING LISTS
	ANTON SATTLER INC

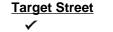

-

Source Cole Information Services

(Cont'd)

466	CHAMPAGNE ASSOCS PC
100	CHAMPAGNE SERVICES INC
	CLAIRE KATZ
	DENNIS DOTHLYN
	FAMILY FOOT CARE
	HAUSEN SCOTT L PODIATRIST
	HOLLAR MILTON C DR
	JACOBY JOHN E MD
	JANICE E WILLIAMS
	MANO & TAMBASCO LTD
	METRO MED
	MILTON C HOLLAR MD
	MW COMPUTER SERVICES INC
	NEARTEK INC
	POSMAN COLLEGIATE BOOKSTORE
	PREGNANCY CARE CTR INC
	ROBERT DE LELLO
	SCOTT L HAUSEN
	WESTCHESTER ACUPUNCTURE CTR
	WHITEHILL COUNSELING SRVC NEW
474	
471	OCCUPANT UNKNOWN
	TWIN DONUTS
475	CELLULAR FACTORY INC
	OCCUPANT UNKNOWN
477	OCCUPANT UNKNOWN
	VIVA RANCH INC
478	ELEGANT FURS INC
	HANDLER FURS INC
479	PAYLESS SHOESOURCE
480	99 CENTS VALUE INC
	KEITHS CATERING HALL
481	007 DISCOUNT VACATIONS INC
	2 NV PRODUCTIONS
	AMPAK CO
	APPLIED MERCHANDISING CONCEPTS
	BARRY LEVITEX
	BASE ONE TECHNOOLGY
	CGNTV THRPY CTR OF WSTCHSTR
	CONTINENTAL TAX SERVICE
	CRUISE HOLIDAYS OF NEW RCHL
	DR BENITA GROSS
	FIRST FINANCIAL EQUITIES INC
	GALLOWAY EMPLOYMENT AGENCY
	H FINKELSTEIN ATTY
	ICON SIGN & DISPLAY GROUP INC
	IMPOL ALUMINUM CORP
	J SILVER CLOTHING
	LIGHTSY CONSULTANTS
	MADISON HOME MORTGAGE CORP



-

(Cont'd)


2	481	
		NATIONAL CAPITAL RECOVERY SRVC INC
		NORFOLK SOUTHERN CORP PAMELA LIGHTSY
		QUADREIGN MANAGEMENT CORP RAYBURN ASSOCS
		RETTNER MANAGEMENT CORP
		SAMARITAN WORLWIDE TRVL SVCES INC
	482	OCCUPANT UNKNOWN
	102	RAINBOW FISH MARKET
4	484	NEW ROCHELLE FARM
_	10-1	YEONG PAK
2	485	ALFONSO GUTIERREZ
		DANCE CONNECTION
		DANNY LANDINO
		JUBILEE GIFT
		MIDEA SHOE
2	486	DOMENIC MENS SHOP
		OCCUPANT UNKNOWN
2	487	BELLA BAKERY
		CAFE KIMI
		NAIL CITY ONE
2	488	TIMING
2	489	JORGE HENAO
		PEDRO PAZOS
		RICHERD MORANTE
2	490	ADREAN PRINTING CORP
		FRANKEL STANLEY DDS PC
		NICK JIMENEZ NICKS NEW HAIR DESIGN
		OCCUPANT UNKNOWN
		VIC GINA PRINTING CO
	491	OCCUPANT UNKNOWN
	494	NATURAL NAILS
	496	PIZZA PERFECT
	497	FANTICS PHOTO INC
_	107	K2 ASSOCS INC
		THE MEXICAN CORNER RESTAURANT
2	498	ALBERTO MEJIA
		AMERICAN NURSE RECRUITERS INC
		JUAN VELAZQUEZ
		LUIS BARRENECHEA
		LUPITAS TATTOOS
		NEW ROCHELLE DONUT CAFE
		PAUL ROBERTS
		TENORE STEVE COUNTY LEGISLATOR
2	499	MANUEL DURAN
		OPTICAL ON MAIN INC



-

(Cont'd)

500	OCCUPANT UNKNOWN
500	RECREATIONAL EQUIPMENT INC
501	OCCUPANT UNKNOWN
503	CURTAIN SHOP
	ELEGANT BEAUTY SUPPLY
	EMBAJADA LATINA
505	ALEXANDRA ZAPIEN
	CRAFTFORM INC
	JORGE REYES
	JOSE SANCHEZ
	KIMS NAILS
	LORENZO IZAZAGA
506	DOLLAR LIMIT
	OCCUPANT UNKNOWN
507	ALMARC DRUGS
	OCCUPANT UNKNOWN
510	510 UNIFORMS INC
0.0	OCCUPANT UNKNOWN
	STILLMAN INC
514	BRAZILIAN AMERICAN RCRTN CLUB
••••	COMPUTER PERFECT DIRECT INC
	JOHN MULHERE
	KOCH EMPLOYMENT AGENCY
	PARK POONG RAN
	PHILIP ORNER
	RODWICK SECRETARIAL SERVICE
518	CLUB HOLLYWOOD
010	OCCUPANT UNKNOWN
519	ART HARBOUR INC
010	CINDY TOP NAIL CORP
	DON KEENE STUDIO
	HARRISON & MORGAN INC
	STARLITE II RESTAURANT
521	KEVIN ROHDEN
521	MILLENNIUM RLTY GROUP INTRNTNL
522	AR KINGS INC
522	MIRIAM CALVO
	STERN AGENCY
523	ANITA CRAWFORD
525	ANITA CRAWFORD
	GAIL SUTTLES
	HABIBS ATMOSPHERE IS HAIR
524	NEW ROCHELLE VARIETY STORE
524	RABEN CAPITAL GROWTH CORP
	ZELDA NET INC
525	I B COHEN
520	I COHEN
	JOFLO OF NORTH SALEM INC
	THE RUBY GROUP
526	406 MUSIC STORES
520	




-

Source Cole Information Services

(Cont'd)

- 526 HEE YANG
- 527 CLUB REVIVE
  - EXTERIOR APPLICATORS INC FRANCIS FORMISAN UNIQUE CHOICE

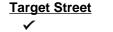

-

452	F M L MERCHANDISE BROKERS I
454	
455	BAKER NEAL W
400	BROWN & WILLIAMSON TOBACCO CORPORATION
	DAC ACCOUNTING & TAX SVCES
	GOSPEL TOWN MUSIC VIDEOS
	INVESTMENT DESIGN PROPERTIES LIMITED
	MCINTERNATIONAL
	MENTOR MAGAZINE
	MILLS DEBORAH D ATTORNEY
	MISTER SPORTS
	PRECISION PROJECTS
	PROSPEROUS ENTERPRISE
	SUPER STAR COMMUNICATIONS
456	EAST WEST KARATE JUJITSU STUDIO
	WESTCHESTER JUJITSU STUDIO
457	EXOTIC TAN THE
101	HAIR COMPANIES THE
	RAZZELS
458	AMELIA GOMEZ
400	ANN SCHAUER
	CELIA ECHEVARRIA
	GLORIA BARRERA
450	ROSA ROLDAN
459	
	BARON NANCY MD
	CALL SUPPORT SERVICES INCORPORATED
	DEWEY DAVID W ATTORNEY
	FORE ASSOCIATES
	FRIED ELLEN ATTORNEY
	HEIMER RICHARD L PE PC
	J R D MANAGMNT CORPORATION
	KENTEA LIMITED
	LEWIS STUDIO
	MARKETING TOMORROW INCORPORATED
	MEAD DATA CONTROL
	MEAD DATA CONTROL CENTER
	NEWMAN LEONARD J MD
	NORRIS ROBERT
	PROFESSIONAL ANSWERING SERVICE
	PROFESSIONAL CLEANING
	PROFESSIONAL OFFICE ANSWERING SVCE
	SAVINO JOHN A MD
	SEAJAY REALTY
463	BACKYARD PUB
403	
400	
466	ACCU STAFF INCORPORATED
	AMERICAN BUSINESS INFORMATION INCORPORATED
	ANTON SATTLER INCORPORATED
	ANTON SATTLER MANAGMENT COMPANY INCORPORATED




(Cont'd)

### MAIN ST 1999

AVCO FINANCIAL SERVICES OF NEW YORK INCORPORATED WESTCHESTER 466 BORY GEORGE F **BRODERICK JIM** CAREER PURSUIT SVCES CHAMPAGNE ASSOCIATES CHAMPAGNE ASSOCIATES PC CHAMPAGNE SERVICES INCORPORATED COMPILERS PLUS INCORPORATED **DEBBIE NIGRO** DELELLO ROBERT CSW DENNIS DOTHLYN PHD ELK MANAGEMENT CORPORATION **EVANS SEPTIC TANK** FAMILY FOOT CARE GENERAL MORTGAGE CORPORATION **GUREVICH NATALIA MD** HAUSEN SCOTT L PODIATRIST HOLLAR MILTON C DR **INTERCOUNTY BUSINESS & TECHNICAL INSTITUTE INCORPORATED** JACOBY JOHN E MD KATZ CLAIRE PHD METRO MED MONROE COLLEGE BOOKSTORE NEW ROCHELLE ECONOMIC DEVELOPMENT NEW ROCHELLE MEDICAL & HEALTH CLUB BUILDING INCORPORATED NEW ROCHELLE OVERALL ECONOMIC DEVELOPMENT CORPORATION PREGNANCY CARE CENTER **RESOURCE MANAGEMENT ALLIANCE** SATTLER ANTON INCORPORATED ESTABLISHED 1893 PERIOD RESTOR SCHWARTZ MICHAEL L DDS SIEGEL FREDRIC S DDS SLOAN BARRY MD SONG HUI JUN C MD STATE FARM INS COMPANY SWEET TALK PRODUCTIONS TCC **TELLER EDWARD MD** TEMP FORCE OF WESTCHESTER PREFERRED PERSONNEL SERVICES TREND CREDIT CONSULTANTS TRI STATE OFFICE PRODS **VIBERT EMILE** WATSON & COLLINS WEBER ROBERT L DDS WESTCHESTER CONSUMER WESTCHESTER JEWISH COMMUNITY SERVICES WHITEHILL COUNSELING SERVICE NEW ROCHELLE WILLIAMS JANICE E PHD WINCHESTER PENNY SHERMA MD WORKING MOM ON THE RUN XANADU

Target Street	Cross Street		<u>Source</u>
$\checkmark$	-		Cole Information Services
	MAIN ST	1999	(Cont'd)


466	ZELLER LIST CORP/DIVISION OF CONTACTS INFLUENTIAL
474	ZELLER LIST CORPORATION DIVISION OF CONTACTS INFLUENTIAL INC
471	
475	
476	WESTERN UNION NEW ROCHELLE
477	
478	ELEGANT FURS INCORPORATED
470	HANDLER FURS INCORPORATED
479	PAYLESS SHOESOURCE
480	BRUBAKERS
404	
481	
	ALEX CREAM SALES
	BERGMAN MELVYN H CPA BICOAST ENTERPRISES
	CHISHOLM AUTO LEASING
	CHOICES CENTER INCORPORATED
	CNIA SECURITY INCORPORATED
	COHEN JEROME CPA
	CONTINENTAL TAX SVCE
	DANIEL F REILLY & ASSOCIATES INCORPORATED
	DARAIO AGENCY CORPORATION
	DOMENICKS MEN SHOP
	FIELDS COMMUNICATION CORPORATION
	FINKELSTEIN HOWARD ATTORNEY
	FIRST FINANCIAL EQUITIES INCORPORATED
	G & J CONSUMER GROUP SVCES
	GOODFRIEND ISAAC ATTORNEY
	IMPOL ALUMINUM CORPORATION
	J V MEDICAL DISTRIBUTORS INCORPORATED
	LEVITEX BARRY
	NATIONAL CAPITAL RECOVERY SVCE INCORPORATED
	OOASIS SOFTWARE CONSULTING
	QUADREIGN MANAGEMENT CORPORATION
	RAYBURN RICHARD ASSOCIATES
	RETTNER MANAGMNT
	RETTNER REALTY
	TAX ASSESSMENT XPERTS INCORPORATED
482	RAINBOW FISH MARKET
484	EMPIRE FARM
485	MARIAS MEXICAN RESTAURANT
	RYTHM HOUSE
	TACO LOCO II
487	BELA BAKERY
	BELLA BAKERY
	L & M BAKERY
	NAIL CITY



-

(Cont'd)


488	MAN TO MAN
	NEUNG CHOI
489	EDDY MATTOS
	TERESO ALVAREZ
490	ADREAN PRINTING CORPORATION
	BENNER THOMAS E DDS
	CARINA FURNITURE
	FRANKEL STANLEY DDS PC OFFICE
	JIMENEZ NICK
	NICKS HAIR CUTTING SALON
	ROBERTS PAUL DDS
	ROBERTS PAUL DNTST
491	BANK OF NEW YORK THE
	BANK OF NEW YORK THE WESTCHESTER PUTNAM DIVISION
494	NATURAL NAILS NAILS
	TELEXPRESS INTERNATIONAL SVCE
496	PIZZA PERFECT
	RIVIERA PIZZA & CAFE
497	AY CARAMBA
	FANTICS PHOTO INCORPORATED
498	C SEALEY
	CATSKILLS JAZZ & SOUL FESTIVAL INCORPORATED
	DAGUS MARKETING RESEARCH
	DAVIDSON KATHIE E ATTORNEY
	FESTIVALS AND TRAVEL INCORPORATED
	JOHN MULHERE
	LEGAL EXPERTISE SERVICE
	LUPITAS TATTOOS
	NEW ROCHELLE DONUT CAFE
	PRIMO LIMO
	RAQUEL VINALAY
	TENORE STEVE COUNTY LEGISLATOR
	WESTCHESTER HAITIAN COMMUNITY SVCES
500	RECREATIONAL EQUIPMENT INCORPORATED
	REI RECREATIONAL EQUIPMENT INCORPORATED
501	DURAN TRAVEL
503	ELEGANT BEAUTY SUPPLY
	KIMS TAILOR
	SPEEDY TAILOR
505	A ZAPIEN
	ADAN SANCHEZ
	CRAFTFORM INCORPORATED
	IKA AIR MUSIC INCORPORATED
	JORGE REYES
	WADADA ROYALTIES
506	BENZA TRADING CORPORATION
	DOLLAR LIMIT THE
507	MAIN STREET APOTHECARY & SURGICAL SUPPLY
510	LIEBMANS BOYS & GIRLS SHOP
514	ALMARC DRUGS



-

(Cont'd)

514	BRAZILIAN AMERICAN RECREATION CLUB COMPUTER PERFECT EVANS SEYMOUR DDS PC FINE WINE IMPORT J SILVER CLOTHING KOCH EMPLOYMENT AGENCY MAIN STREET APOTHECARY & SURGICAL SUPPLY ORNER PHILIP ATTORNEY RODWICK SECRETARIAL SERVICE
518	CLUB HOLLYWOOD DIMENSION NIGHTCLUB
519	HARRISON & MORGAN INCORPORATED KEENE DON ARTIST NAILS CITY STARLITE II RESTAURANT
521	LISKINS COATS & DRESSES
522	A R KINGS INCORPORATED
524	KENNY PUBLISHING NEW ROCHELLE VARIETY STORE RABEN CAPITAL GROWTH CORPORATION V K V ASSOCIATES
525	A & M COHEN I B & SONS INCORPORATED COHEN I B CLTHG LUKASHOK ALVIN REAL ESTATE
526	JOHNS FISH MARKET TOP JEWELRY
527	CLUB REVIVE EXTERIOR APPLICATORS INCORPORATED FORMISAN FRANCES CPA HABITAT FOR HUMANITY OF WESTCHESTER HORNNEY A G COMPANY INSIDERS COMMUNICATIONS NETWORK UNIQUE CHOICE VIRGINIA WESTCHESTER CORPORATION ZEEARO COMPANY

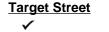

-

451	M G L SALES MANAGMNT CORP
452	F M L MERS BROKERS INC
454	
455	
400	
	ATLAS TECHNICAL SERVICES
	BAKER NEAL W
	BROWN & WILLIAMSON TOBACCO CORP
	INVESTMENT DESIGN PROPERTIES LTD
	KING JEWELRY
	LATIN AMERICAN IMMIGRATION SVCS
	MENTOR MAGAZINE
	MISTER SPORTS
	PREMIER AMBULETTE TRANSPORTATION
	PREMIER TRANSPORTATION
	ROWE, WILLIAM L, COUNSELOR
	SUPER STAR COMMUNICATIONS
	SUPERIOR PROTECTION
	TALISMAN COMPUTER SERVICES
456	WESTCHESTER JUJITSU STUDIO
457	HAIR COMPANIES THE
-	RAZZEL'S
	TANNING COMPANY THE
459	AMCAFE INC
	COMMUNITY SAFETY SYSTEMS INC
	CRANT, HENRY, ATTY
	CUSTOM SPECIALTY CO, ADVTG
	DEWEY ASOOCIATES INC
	DEWEY, DAVID W, ATTY
	FORE ASSOCS
	GATEWAY BUILDING SERVICES
	GLASS & GLASS
	GLASS, JOHN, III, CPA
	HEIMER RICHARD L PE PC
	J R D MANAGMNT CORP
	KENTEA LTD
	LINCOLN REFRIGERATION
	MARKETING TOMORROW INC
	MEAD DATA CONTROL
	MEAD DATA CONTROL CENTER
	NEWMAN, LEONARD J, MD
	NORRIS, ROBERT PROFESSIONAL OFC ANSWERING SVCE
	SAVINO, JOHN A, MD
400	WANDERMAN, PHILIP, ADVTG
463	BACKYARD PUB

Target Street	Cross Street
$\checkmark$	-

466	AMERICAN BUSINESS INFORMATION INC
	BRODERICK, JIM
	CHAMPAGNE ASSOC
	CHAMPAGNE ASSOC PC
	CHAMPAGNE ASSOCS PC
	CHAMPAGNE EBERLIN
	COMPILERS PLUS INC
	FRANCIOSA & MADONNA, CPA
	GRANT HUDSON MANAGMNT INC AGENT FOR CONN MUTUAL LIFE
	INTERCOUNTY BUSINESS & TECHNICAL INSTITUTE INC
	JACOBY, JOHN E, MD
	PEEK WALTER D INC, PAPER PREFERRED PERSONNEL SVCES TEMPFORCE OF WESTCHESTER
	RESOURCE MANAGEMENT ALLIANCE
	STATE FARM INS CO-AGTS
	TCC
	TELLER, EDWARD, MD
	TREND CREDIT CONSULTANTS DIVISION OF RMA
	WESTCHESTER ACUPUNCTURE CENTER
	WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-
	WHITEHILL COUNSELING SERVICE-NEW ROCHELLE
	WINCHESTER-PENNY, SHERMA, MD
471	MICHAEL'S RESTAURANT
475	ELIMU BOOK STORE
	NEW ROCHELLE BOOK STORE OF KNOWLEDGE
476	G & R CHECK CASHING INC
	WESTERN UNION-TO PICK-UP OR SEND MONEY OR TR-EASTCHESTER CK
477	HONG VEGETABLES & FRUIT MKT
478	HANDLER FURS INC
	NATIONAL FUR CORP
480	BRUBAKER'S
481	
	ARCHER MARKETING BERGMAN & BERGMAN, ATTYS
	BERGMAN, MELVYN H, CPA
	CENTRAL NATIONAL INVESTIGATION AGENCY
	CHOICES CENTER INC
	CNIA SECURITY INC
	COHEN CARL INSURANCE AGENCY
	COHEN, JEROME, CPA
	CONTINENTAL TAX SVCE
	DARAIO AGENCY CORP
	DI SERIO, JAMES
	DOMENICK'S MEN SHOP
	FIELDS COMMUNICATION CORP
	FIELDS, ARTHUR
	FINKELSTEIN, HOWARD, ATTY
	GOODFRIEND, ISAAC, ATTY

Target Street	Cross Street
$\checkmark$	-

481	IMPOL ALUMINUM CORP
101	NATIONAL CAPITAL RECOVERY SVCE INC
	QUADREIGN MANAGEMENT CORP
	RAYBURN RICHARD ASSOCIATES
	RETTNER MANAGMNT
	RETTNER REALTY
	SALES CAREERS
	SCEPTER PUBLISHERS
	SOUTHEAST PLANNING SVCES
484	NUMBER ONE FISH & FRUIT MARKET
485	MARIA'S MEXICAN RESTAURANT
	MARIA'S MEXICAN RSTRNT
	RYTHM HOUSE
486	BENEFICIAL CREDIT SERVICES-NEW ROCHELLE
	BENEFICIAL HOMEOWNER SERVICE CORPORATION-NEW ROCHELLE
	BENEFICIAL NEW YORK INC
487	DISCOUNT THRIFT & GROCERY
	NAIL CITY
490	ADREAN PRINTING CORP
400	BENNER, THOMAS E, DDS
	MAJESTIC AUTO INTERIORS
	NICK'S HAIR CUTTING SALON
	ROBERTS PAUL, DDS
	ROBERTS FAUL, DDS ROBERTS, PAUL, DNTST
404	
491	BANK OF NEW YORK THE-WESTCHESTER/PUTNAM DIVISION-BANKING OFFICES-
496	SIENA PIZZA RESTRNT
497	AY CARAMBA
	FANTICS PHOTO INC
498	NEW ROCHELLE DONUT CAFE
	QUALITY DOMESTIC AGENCY
	TENORE, STEVE, COUNTY LEGISLATOR
	WESTCHESTER HAITIAN COMMUNITY SVCES
500	RECREATIONAL EQUIPMENT INC
	REI-RECREATIONAL EQUIPMENT INC
501	DURAN TRAVEL
	WESTCHESTER HISPANIC CHAMBER OF COMMERCE
503	ELEGANT BEAUTY SUPPLY
	KIM'S TAILOR
505	CRAFTFORM INC
	PREGNANCY CARE CENTER
506	BENZA TRADING CORP
510	LIEBMAN'S BOY'S & GIRL'S SHOP
514	ALMARC DRUGS
	CHAMBER OF COMMERCE OF NEW ROCH INC
	COMPUTER PERFECT
	KOCH EMPLOYMENT AGENCY
	LIDO LIMOUSINE
	LIDO LIMOUSINE SERVICE
	MAIN STREET APOTHECARY & SURGICAL SUPL
	MAIN STREET APOTHECARY & SURGICAL SUPPLY

<b>Target</b>	Street
$\checkmark$	

-

# MAIN ST 1995 (Cont'd)

514	ORNER, PHILIP, ATTY
	RODWICK SECRETARIAL SERVICE
518	LEXUS CATERING & NIGHT CLUB
	PALACE DISCOTHEQUE
519	IGOR TROUT FINE ARTS
	MIELE INTERNATIONAL SCHOOLS OF LANGUAGES LTD
	MIELE, LOUIS, PHD
	NAILSCITY
	STARLITE II RESTAURANT
521	LISKIN'S, COATS & DRESSES
522	A R KINGS INC
523	ORGANIC CONNECTION THE
524	BENINATO, RAYMOND J, INS
	BENINATO, RAYMOND, CFP
	NEW ROCHELLE VARIETY STORE
	RABEN CAPITAL GROWTH CORP
525	A & M
	COHEN I B, CLTHG
	LUKASHOK, ALVIN, RL EST
526	LOPEZ & HERNANDEZ MEAT MKT
527	EXTERIOR APPLICATORS INC
	FORMISAN FRANCIS TAX PREPARATION
	HORNNEY A G CO, PKGNG MACH
	VIRGINIA WESTCHESTER CORP



-


451	M G L SALES MANAGMNT CORP
452	F M L MERS BROKERS INC
	MILES CHARMAINE, ATTYS
454	MAIN STREET CAFE
455	INVESTMENT DESIGN PROPERTIES LTD
	KAWANIS CLUB OF NEW ROCHELLE
	KING JEWELRY
	LAWRENCE ADVTNG & DESIGN STUDIO
	MORRISON, LEONARD M, ATTY
	ROWE, WILLIAM L, PUBLIC RELATIONS
	SPORTSTUFF
	THOM MC AN
	US GOVT MARINE CORP
456	
457	HAIR COMPANIES THE
	RAZZEL'S
458	DE CHIARA, C
	DE CHIARA, SERGIO & ELAINE
459	ARMS
	APPRAISAL CONSORTIUM INC
	CRANT, HENRY, ATTY
	CUSTOM SPECIALTY CO, ADVTG
	DUN & SONS LTD
	FERNANDEZ, PAUL GENERAL CONTRACTING CORP
	GLASS & CASSARA
	GLASS, JOHN, III, CPA
	KENTEA LTD
	MARKETING TOMORROW INC
	PRECISION ALARM CO
	PROFESSIONAL OFC ANSWERING SVCE
	RIEMER JOAN ASSOC INC
	RIEMER, H C, CPA
	SAFETY TRAINING INC
	SEAJAY REALTY
	SILVER LINING OF NY INC
	WANDERMAN, PHILIP, ADVTG
463	BENCHWARMER'S PUB
	SPENCER, C
466	AMERICAN BUSINESS INFORMATION INC
	AMERICAN CAREER SCHOOLS INC THE
	BELL FINANCIAL SVCE CO INC
	BRODERICK, JIM
	CHAMPAGNE ASSOC
	CHAMPAGNE ASSOC PC
	CHAMPAGNE ASSOCS PC
	CHAMPAGNE EBERLIN
	COMPILER'S PLUS INC
	FLEETWOOD FUNDING INC
	FRANCIOSA & MADONNA, CPA
	JACOBY, JOHN E, MD

Target Street	<u>C</u>
$\checkmark$	

-

992	(Cont'd)
JJZ	(Cont'd)

<ul> <li>466 METRO MED</li> <li>NAPPI, RALPH A, ATTY</li> <li>PEEK WALTER D INC, PAPER</li> <li>PERLMAN INDUSTRIES INC</li> <li>PREFERRED PERSONNEL SERVICES</li> <li>RESOURCE MANAGEMENT ALLIANCE</li> <li>RESSA &amp; NAPPI ESQS, ATTYS</li> <li>RESSA, AMES D, ATTY</li> <li>RESSA, AMES D, ATTY</li> <li>RESSA, STEPHEN A, ATTY</li> <li>RAM SEAFODD</li> <li>T I L MARKETING</li> <li>TCC</li> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-</li> <li>WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>471 MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>CARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; DERGMAN, ATTYS</li> <li>HOMELALIANZOCACE ADDITION AGENCY</li> <li>COHEN CARL I</li></ul>		
PEEK WALTER D INC, PAPER PERLMAN INDUSTRIES INC PREFERRED PERSONNEL SERVICES RESOURCE MANAGEMENT ALLIANCE RESSA & NAPPI ESOS, ATTYS RESSA, MAED, ATTY RESSA, STEPHEN A, ATTY RMA SEAFOOD T I L MARKETING TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLES & FOUT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, WINS S, PODITRIST B B MANAGMIT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AMPAK CO INC ARCHER MARKETING BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKLESTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOF, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	466	METRO MED
<ul> <li>PERLMAN INDUSTRIÉS INC</li> <li>PREFERRED PERSONNEL SERVICES</li> <li>RESOURCE MANAGEMENT ALLIANCE</li> <li>RESSA, AMES D, ATTYS</li> <li>RESSA, STEPHEN A, ATTY</li> <li>RMS SEAFOOD</li> <li>T11 MARKETING</li> <li>TCC</li> <li>TCC</li> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>471</li> <li>MICHAEL'S RESTAURANT</li> <li>476</li> <li>G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477</li> <li>A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; S FRUIT MKT</li> <li>478</li> <li>HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480</li> <li>ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481</li> <li>AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>COHTA SERVER TECHNOLOGY INC</li> <li>COHEN LINURAND, ATTYS</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>CONTRAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMAS BERGMAN, ATTYS</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>COHEN LARKETING</li> <li>DERGMAN, MELVYN H, CPA</li> <li>C C &amp; C ADVING INC</li> <li>COHEN CARE INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN, JEROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC&lt;</li></ul>		NAPPI, RALPH A, ATTY
<ul> <li>PERLMAN INDUSTRIÉS INC</li> <li>PREFERRED PERSONNEL SERVICES</li> <li>RESOURCE MANAGEMENT ALLIANCE</li> <li>RESSA, AMES D, ATTYS</li> <li>RESSA, STEPHEN A, ATTY</li> <li>RMS SEAFOOD</li> <li>T11 MARKETING</li> <li>TCC</li> <li>TCC</li> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>471</li> <li>MICHAEL'S RESTAURANT</li> <li>476</li> <li>G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477</li> <li>A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; S FRUIT MKT</li> <li>478</li> <li>HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480</li> <li>ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481</li> <li>AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>COHTA SERVER TECHNOLOGY INC</li> <li>COHEN LINURAND, ATTYS</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>CONTRAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMAS BERGMAN, ATTYS</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>COHEN LARKETING</li> <li>DERGMAN, MELVYN H, CPA</li> <li>C C &amp; C ADVING INC</li> <li>COHEN CARE INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN, JEROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC</li> <li>FROST HOME CARE INC&lt;</li></ul>		PEEK WALTER D INC, PAPER
<ul> <li>PREFERRED PERSONNEL SERVICES</li> <li>RESOLIRCE MANAGEMENT ALLIANCE</li> <li>RESSA &amp; AMES D, ATTY</li> <li>RESSA &amp; AMES D, ATTY</li> <li>RESSA, STEPHEN A, ATTY</li> <li>RESA &amp; ANES D, ATTY</li> <li>RESA &amp; ANES D, ATTY</li> <li>RESA &amp; RESOL</li> <li>RESA &amp; RESOL</li> <li>TI L MARKETING</li> <li>TCC</li> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER J, JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A K KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFREY L, PODITRIST</li> <li>B B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; BERGMAN, ATTY</li> <li>POREMAL MATIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>CONTINENTAL TAX SYCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		PERLMAN INDUSTRIES INC
RESOURCE MANAGEMENT ALLIANCE RESSA, & NAPPI ESOS, ATTYS RESSA, AMES D, ATTY RESSA, STEPHEN A, ATTY RMA SEAFOOD T IL MARKETING TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLES & FRUIT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMIT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & SERGMAN, ATTYS BERGMAN & SERGMAN, ATTYS BERGMAN & SERGMAN, ATTYS BERGMAN & SERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & DELSTANCE AGENCY COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
<ul> <li>RESSA &amp; NAPPI ESQS, ATTYS</li> <li>RESSA, AMES D, ATTY</li> <li>RESSA, ATS DHEN A, ATTY</li> <li>RESSA, STEPHEN A, ATTY</li> <li>RMA SEAFOOD</li> <li>T I L MARKETING</li> <li>TCC</li> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER J.EWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; FOOD TRIST</li> <li>ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMMT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN, MELYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>C COHEN CARL INSURANCE AGENCY</li> <li>C COHEN LARL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
RESSA, AMES D, ATTY RESSA, STEPHEN A, ATTY RESSA, STEPHEN A, ATTY RMA SEAFOOD T I L MARKETING TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET B HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMIT SYSTEMS INC GREENHOUSE THE 481 AMERCAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN, & BERGMAN, ATTYS BERGMAN, BERGMAN, ATTYS BERGMAN, BERGMAN, ATTYS BERGMAN, BERGMAN, ATTYS BERGMAN, BERGMAN, ATTY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS-ROWE ENTERPRISES, PUB RELTNS		
RESSA, STEPHEN A, ATTY RMA SEAFOOD T I L MARKETING TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET B HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING B ERGMAN, MELVYN H, CPA C & C ADVING INC COHEN CARL INSURANCE AGENCY CUIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST HOME CARE INC FROST HOME CARE INC FORST HOME CARE INC FORST HOME CARE INC FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELITNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
RMA SEAFOOD         T I L MARKETING         TCC         TREND CREDIT CONSULTANTS DIVISION OF RMA         WEINIG, HARVEY, ATTY         WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-         WHITEHILL COUNSELING SERVICE-NEW ROCHELLE         WIELAND         471         MICHAEL'S RESTAURANT         476       G & R CHECK CASHING INC         WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK         477       A R KINGS INC         HONG VEGETABLE & FOOD MARKET         HONG VEGETABLE S, PODITRIST         ADLER, JEFFREY L, PODITRIST         ADLER, MERVINS S, PODITRIST         B B MANAGMNT SYSTEMS INC         GREENHOUSE THE         481         AMERICAN WAYS         AMPAK CO INC         ARCHER MARKETING         BERGMAN, MELVYN H, CPA         C & C A DVTING INC         C & C ADVTING INC         C & C ADVTING INC         COHEN CARL INSURANCE AGENCY         CUIENT SERVER TECHNOLOGY INC         COHEN, JEROME, CPA         CONTINENTAL		
T I L MARKETING TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FRUIT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVITNG INC COHEN CARL INSURANCE AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS		
TCC TREND CREDIT CONSULTANTS DIVISION OF RMA WEINIG, HARVEY, ATTY WESTCHESTER JEVISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLES & FRUIT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN MELVYN H, CPA C & C ADVTNG INC COHEN, JERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN CARL INSURANCE AGENCY COHEN ACRL INSURANCE AGENCY COHEN, JEROME CARE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
<ul> <li>TREND CREDIT CONSULTANTS DIVISION OF RMA</li> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>471 MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINOS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST</li> <li>AD BER, MARWINS S, PODITRIST</li> <li>B B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN MELVYN H, CPA</li> <li>C &amp; C A DVTNG INC</li> <li>COHEN AL INIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN CARL INSURANCE AGENCY</li> <li>COHEN ALTIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN ARCH INSURANCE AGENCY</li> <li>COHEN, JEROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS JOUE, PUB RELTNS</li> </ul>		
<ul> <li>WEINIG, HARVEY, ATTY</li> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>MICHAEL'S RESTAURANT</li> <li>G &amp; CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN MELVYN H, CPA</li> <li>C &amp; C ADVING INC</li> <li>COHEN JEROME, CPA</li> <li>COHEN ALTIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN ARL INSURANCE AGENCY</li> <li>COHEN ARL INSURANCE AGENCY</li> <li>COHEN ARL INSURANCE AGENCY</li> <li>COHEN ARL INSURANCE AGENCY</li> <li>COHEN ARE LISTEN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
<ul> <li>WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS- WHITEHILL COUNSELING SERVICE-NEW ROCHELLE</li> <li>WIELAND</li> <li>471 MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC</li> <li>WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN, MELVYN H, CPA</li> <li>C &amp; C A DUTING INC</li> <li>CENTRAL NATIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN CARL INSURANCE AGENCY</li> <li>COHEN LEROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
<ul> <li>WHITEHILL COUNSELING SERVICE-NEW ROCHELLE WIELAND</li> <li>471 MICHAEL'S RESTAURANT</li> <li>475 G &amp; R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC HONG VEGETABLE &amp; FOOD MARKET HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN DALUMINUM CORP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
WIELAND 471 MICHAEL'S RESTAURANT 476 G & R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLE & FOOD MARKET HONG VEGETABLES & FRUIT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVING INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		WESTCHESTER JEWISH COMMUNITY SERVICES-FAMILY MENTAL HEALTH CLINICS-
<ul> <li>471 MICHAEL'S RESTAURANT</li> <li>476 G &amp; R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC HONG VEGETABLE &amp; FOOD MARKET HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC COHEN, JEROWE, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS</li> </ul>		WHITEHILL COUNSELING SERVICE-NEW ROCHELLE
<ul> <li>476 G &amp; R CHECK CASHING INC WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN &amp; NORTH CHECK</li> <li>477 A R KINGS INC HONG VEGETABLE &amp; FOOD MARKET HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS</li> </ul>		WIELAND
WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK 477 A R KINGS INC HONG VEGETABLE & FOOD MARKET HONG VEGETABLES & FRUIT MKT 478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN, MELYYN H, CPA C & C ADVTNG INC COHEN CARL INSURANCE AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	471	MICHAEL'S RESTAURANT
<ul> <li>477 A R KINGS INC HONG VEGETABLE &amp; FOOD MARKET HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENG SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS</li> <li>LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>	476	G & R CHECK CASHING INC
<ul> <li>HONG VEGETABLE &amp; FOOD MARKET</li> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN &amp; MELVYN H, CPA</li> <li>C &amp; C ADVTNG INC</li> <li>CENTRAL NATIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN CARL INSURANCE AGENCY</li> <li>COHEN CARL INSURANCE AGENCY</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS JOE, PUB RELTNS</li> </ul>		WESTERN UNION-TO PICK UP OR SEND MONEY TRANS-MAIN & NORTH CHECK
<ul> <li>HONG VEGETABLES &amp; FRUIT MKT</li> <li>478 HANDLER FURS INC</li> <li>LOPEZ, LUIS</li> <li>NATIONAL FUR CORP</li> <li>PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST</li> <li>ADLER, MERWINS S, PODITRIST</li> <li>B MANAGMNT SYSTEMS INC</li> <li>GREENHOUSE THE</li> <li>481 AMERICAN WAYS</li> <li>AMPAK CO INC</li> <li>ARCHER MARKETING</li> <li>BERGMAN &amp; BERGMAN, ATTYS</li> <li>BERGMAN MELVYN H, CPA</li> <li>C &amp; C ADVTNG INC</li> <li>CENTRAL NATIONAL INVESTIGATION AGENCY</li> <li>CLIENT SERVER TECHNOLOGY INC</li> <li>COHEN JEROME, CPA</li> <li>CONTINENTAL TAX SVCE</li> <li>FINKELSTEIN, HOWARD, ATTY</li> <li>FOREMOST HOME CARE INC</li> <li>FROST MENS SHOP</li> <li>GOODFRIEND, ISAAC, ATTY</li> <li>IMPOL ALUMINUM CORP</li> <li>LOUIS JOE, PUB RELTNS</li> </ul>	477	A R KINGS INC
<ul> <li>478 HANDLER FURS INC LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE</li> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		HONG VEGETABLE & FOOD MARKET
LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENE SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		HONG VEGETABLES & FRUIT MKT
LOPEZ, LUIS NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	478	HANDLER FURS INC
NATIONAL FUR CORP PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENE SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		LOPEZ, LUIS
PEREZ, GEORGE 480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
<ul> <li>480 ADLER, JEFFREY L, PODITRIST ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE</li> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC C &amp; C ADVTNG INC C CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
ADLER, MERWINS S, PODITRIST B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	480	
B B MANAGMNT SYSTEMS INC GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	400	
GREENHOUSE THE 481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
<ul> <li>481 AMERICAN WAYS AMPAK CO INC ARCHER MARKETING BERGMAN &amp; BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C &amp; C ADVTNG INC C &amp; C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS</li> </ul>		
AMPAK CO INC ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	101	
ARCHER MARKETING BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS	401	
BERGMAN & BERGMAN, ATTYS BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
BERGMAN, MELVYN H, CPA C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
C & C ADVTNG INC CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
CENTRAL NATIONAL INVESTIGATION AGENCY CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
CLIENT SERVER TECHNOLOGY INC COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
COHEN CARL INSURANCE AGENCY COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
COHEN, JEROME, CPA CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
CONTINENTAL TAX SVCE FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
FINKELSTEIN, HOWARD, ATTY FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		
FOREMOST HOME CARE INC FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		CONTINENTAL TAX SVCE
FROST MENS SHOP GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		FINKELSTEIN, HOWARD, ATTY
GOODFRIEND, ISAAC, ATTY IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		FOREMOST HOME CARE INC
IMPOL ALUMINUM CORP LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		FROST MENS SHOP
LOUIS JOE, PUB RELTNS LOUIS-ROWE ENTERPRISES, PUB RELTNS		GOODFRIEND, ISAAC, ATTY
LOUIS-ROWE ENTERPRISES, PUB RELTNS		IMPOL ALUMINUM CORP
LOUIS-ROWE ENTERPRISES, PUB RELTNS		LOUIS JOE, PUB RELTNS
		NATIONAL CAPITAL RECOVERY SVCE INC



-

(Cont'd)

481	QUADREIGN MANAGEMENT CORP
	RAYBURN RICHARD ASSOCIATES
	RETTNER MANAGMNT
	RETTNER REALTY
	SALES CAREERS
	SCEPTER PUBLISHERS
	SHERIDAN DESIGN
	SOUTHEAST PLANNING SVCES
101	NUMBER ONE FRUIT & FISH MARKET
484	
485	MASSO, RUBY, DDS
	WANG'S SZECHUAN RESTRNT
486	BENCHARGE CREDIT SERVICE OF NEW YORK-NEW ROCHELLE
	BENEFICIAL NEW YORK INC-NEW ROCHELLE
487	NAIL CITY
	NOT JUST COMICS
488	CENTURY 21-FOUR SEASONS REALTY CENTER
489	MEDINA, FRANCISCO
490	L & L FLOORS
	ROBERTS, PAUL, DNTST
491	BARCLAYS BANK OF NEW YORK-BANKING OFFICES-NEW ROCHELLE
	BARCLAYS BANK OF NEW YORK-DEPARTMENTS-CORPORATE/COMMERCIAL
494	NICK'S HAIR CUTTING SALON
496	SIENA PIZZA RESTRNT
497	FANTICS PHOTO INC
	PEDRO'S & ERIC'S AMERICAN MEXICAN LUNCHEONETTE
498	BELKIN, GEO H, DNTST
	FAINA'S DONUT SHOP
	SCHWARTZ, PERI
	TENORE, STEVE, COUNTY LEGISLATOR
	UNITED LIMOUSINE SVCE
500	RECREATIONAL EQUIPMENT INC
000	REI-RECREATIONAL EQUIPMENT INC
501	CURTAIN SHOP
505	CRAFTFORM INC
000	PREGNANCY CARE CENTER
507	A WORLD OF WINDOWS
307	GENERAL HOME IMPROVEMENTS
E10	LIEBMAN'S BOY'S & GIRL'S SHOP
510	CHAMBER OF COMMERCE OF NEW ROCH INC
514	
	JONELL-DEAN HAIR FASHIONS
	MAIN STREET APOTHECARY & SURGICAL SUPL
	OPTION CARE INC
	ORNER, PHILIP, ATTY
	PLAYGIRL HAIRSTYLISTS INC
518	PALACE DISCOTHEQUE
519	DELTA SECURITY SYSTEMS INC
	FOR YOU
	MIELE INTERNATIONAL SCHOOLS OF LANGUAGES LTD
	MIELE, LOUIS, PHD



## MAIN ST 1992 (Cont'd)

- 519 STARLITE II RESTRNT
- 521 LISKIN'S, COATS & DRESSES
- 522 ISLA, EULALIA MAGALE JAS, FLORIST WESTCHESTER FLORISTS YOUNG, D
- 523 NEW ROCHELLE BOOK SHOP
- 524 BENINATO, RAYMOND J, INS BENINATO, RAYMOND, CFP INTERNATIONAL DISCOUNT STORE MULTI N INTERNATIONAL RABEN CAPITAL GROWTH CORP UNITED STATES LIFE INSURANCE COMPANY THE-RABEN CAPITAL GROWTH CORP
- 525 ALMARC DRUGS COHEN I B, CLTHG LUKASHOK, ALVIN, RL EST
- 526 LOPEZ & HERNANDEZ MEAT MKT
- 527 AVON PRODUCTS FM PRODCTNS FORMISAN FRANCES TAX PRPRTN HORNNEY A G CO, PKGNG MACH POZZUOLI, JOSEPH, ATTY VIDEO PRODUCTIONS

Target Street Cross Street ✓

-

<u>Source</u> Cole Criss-Cross Directory

## **MAIN ST 1987**

	MAIN ST	
T	* Sol Sesses BLY SLN	
	<ul> <li>14 LE COUNT PL</li> <li>451 * MGL Sales Managmt</li> <li>452 * Wynclettes Boutiq</li> <li>454 * Main Street Cafe</li> <li>455 * A&amp;A Body Beautiful</li> <li>* Apple Windows Ltd</li> <li>* E L Cott Assocs</li> </ul>	
	451 * MGL Sales Managmt	A 576-7200
	452 × Wynciettes Boutig	83 235-9714
	455 ± A&A Rody Reautiful	# 636-3221
	* Apple Windows Ltd	85 633-0808
	* E L Cott Assocs	- 632-0707
	* Garafolo Holding .	84 636-7537
	* Invstmnt Desn Prps	85 633-3100
	* Micromatics Inc	85 636-7995
	* Lm Morrison Aty .	. д 636-7117
	* Prudent Loss Cntrl	A 633-0903
	* William L Howe	85 636 8808
	* Tiemmethe Institu	85 636-5939
	* Woodlawn Foundatin	# 632-3778
	455-7 * Richland Rity Inc	# 633-3337
	455-07 * Disposabel Phones	# 633-9400
	456 * Foam Rubber	72 632-4434
	* Foam Rubber Intrrs	83 632-4434
	* Apple Windows Ltd * E L Cott Assocs * Garafolo Holding * Invstmnt Desn Prps * Micromatics Inc * Lm Morrison Aty * Prudent Loss Cntrl * William L Rowe * Sun Data * Ticmmctns Institn * Woodlawn Foundatin 455–07 * Richland Rity Inc 455–07 * Disposabel Phones 456 * Foam Rubber * Kornsweet&Co	72 632-4434
	<ul> <li>Kornsweet&amp;Co</li> <li>457 * The Company</li> <li>Razzels</li> <li>458 Ana Ramos</li> <li>A M Schauer</li> <li>Marcelino Trinidad</li> <li>459 * Centrl Wy Auto Sch</li> <li>* Kentea Ltd</li> <li>* McCoy Group Inc</li> <li>* Prfssnl Ofc ANS Sv</li> <li>* Seaiay Bealty</li> </ul>	¤ 636-5834
	* Razzels	- 636-5834
	458 Ana Ramos	85 235-2039
	A M Schauer	// 032-/596
	Marcelino Trinidad .	04 235-5039
	459 Centri Wy Auto Sch	. 04 030-0037
	* Mentea Lto	- 633-7168
	+ Prfeshi Ofc ANS Sy	85 633-0036
	Sociar Realty	- 633-8212
	* Vista Secrty Costl	# 633-0199
	* Seajay Realty * Vista Secrty Cnstl 460	NP
	- 148 NORTH AV	
	463 Street MacDougal . S McQuire	- 235-1918
	S McQuire	83 235-0370
	T Montgomery	83 235-8712
	466 * Amer Career Schl .	632-5800
	* Eastchester Cardc .	85 633-3309
	* Electrovert Inc	85 633-0222
	S McQuire T Montgomery 466 * Amer Career Schl * Eastchester Cardc * Electrovert Inc * Dr John E Jacoby * Jacoby&Meyers Law * Metro Med * Walter D Peek Inc * Software Synergy 471 * Michael Rstrnt * Michaels Rest	85 633-1020
	* Jacoby&Meyers Law	. 84 033-1020
	* Metro Med	85 636-5055
	* Walter D Peek Inc	84 633-0400
5	A71 + Michael Betrnt	85 636-9688
;	* Michaels Rest	. 84 633-0119
	473★ Biltmore Wine&Ligr	636-1945
	475 * Fancy Fabrics	.81 632-7179
1	476 * Corner Shoe Outlt	633-7105
5	477★ Hong Veg&Fruit Mrk	¤ 632-6496
2	* Anthony M Polo .	632-6320
)	* Polomar Ceramics .	632-6320
2	* Polomar Gift Shop	632-6320
9	478 * Handler Furs Inc .	636-6065 636-6065
	* Nati Fur Corp	78 332-1700
,	479 ★ Citibank N A 480 ★ Dr J L Adler	79 576-0414
1	* Dr Merwin Adler	. 84 576-0414
200	* The Greenhouse Rst	# 576-6532
5	481 * Amer Micro Systems	. ¤ 633-3900
ĩ	* Amer Teleconnect .	- 636-0025
i	* Bergman&Bergman	235-0100
8	* M H Bergman Aty	235-0100
1	* M H Bergman CPA	
1	* A Bermini Aty	- 576-0220
25504781155	* A D Caratzas Pblsh	83 632-8487
5	* Citizen Actn of NY	¤ 576-0088
1	* Discnt Music Clb .	84 235-6844
VE	R EXCEPT AS AUTHORIZED BY TH	HE PUBLISHER.
tc	- Census Tract Wealth Rating CL1	U Map Location

4738280.5 Page: A28

Target Street Cross Street ✓

-

## <u>Source</u> Cole Criss-Cross Directory

WA	IN 51	1987
AIN		
481	S S Flaum Aty L H Fleischman CPA Foremost Home Care	10801
	k L H Fleischman CPA k Foremost Home Care	.72 576-0852
3	t D W Gallagher Aty	85 235-4500
	J Glass III CPA	- 235-5555
1	Hartford&Morgan	- 576-0220
	k Hill Spelts Adving k Intlight Mking	
	Bonald O Kluge	# 633-9546 # 633-1720
	L&K Exterminating	85 235-8590
	Joe Louis Pub Ritn	.80 636-1131
	NY Commity Action	1 576-0088
	Anthony Relia Aty	- 576-0220
	H Cap Riemer CPA	.77 632-1655
	Sales Careers	77 632-1655 78 632-8800
482 *	Franks Used Furn	80 636-3377
485 *	Stack Electronics	80 636-6644
	Dr Mark Nieder	80 235-3873
485 *	Dr S G Willinger	79 636-5506
400 4	Beneficial Hmwnrrs	636-1717
487 #	Fordham Disc Wig	.82 576-1636
÷	Nail City	85 576-1636
488 *	Wigs Hats&Accs	83 576-1636 81 632-2903
489 490 *	Luis Gonzalez Adrith Major Aninc	85 235-7680
*	House of Music	.73 632-4317 -
Â	* S S Haum Aty K L H Fleischman CPA Foremost Home Care D W Gallagher Aty Godfried Stass III CPA L Goodfried Aty Hartford&Morgan Hill Socits Adving Untilgan Mkrog J Glass J Glass H CPA Hartford&Morgan Hill Socits Adving Untilgan Mkrog Joanelli Ltd Donald D Kluge Lottigan Mkrog Robert Lindenteld Joe Louis Pub Rith Louis-Rowe Enterpr Joe Louis Pub Rith Louis-Rowe Enterpr NY Communy Action Read Agency Anthony Rella Aty Rettner Management Red Agency Sales Careers Scepter Publishers Franks Usde Furn Stack Electronics Lewtown Optical Dr Mark Nieder Wages Stechuan Dr S & Willinger Benchange Criff Svc Benchange Criff Svc Ben	80 632-8744
č	* Tatters	85 632-6792
G	* Repxotics Inc	= 632-7099
491*	Barclays Bank NY	.83 235-4434 = 636-3300
494 *	Barclays Bank NY	.77 636-3300 .84 636-8361
496 *	Siena Pizza Restrt .	.82 576-1663
497*	Fantics Photo Inc Pedros&Erics Lunch . Dr Geo H Belkin Pat Corvino Fainas Donut Shop	H 636-8598
498 *	Dr Geo H Belkin	632-8744
*	Fainas Donut Shop	235-4689
*	Lafay Cosmetics	15 235-5449
**	Premier Care	82 576-1844
*	Steve Tenore	.85 633-0707 # 633-8079
500 ×	The Market Place	11 633-3999 76 636-8794
503	Certiform Inc	IP 76 576-1232
*	Pregnancy Care Ctr .	.83 235-9535
300 ×	Leafs Inc	632-2355
507 ×	Projanskys Furs	77 636-0477
510×	Record Hut	.77 636-0477 632-2770
514*	Liebmans Polka Dot . American Red Cross	-70 632-2770 632-5250
:	Americas Future In Chambr Comrc NW Re	235-6000
1	Depilatron	.84 636-4944
	Main St Apthcr&Srg	84 235-3222
*	Playgirl Hairstyl	.84 636-4944
- 7 CH	Previouslinks Chelkin De Geo R Gelkin Parines Down Shop Farsheim Stratfiel Lafay Cosmetics Premier Care Tanduc Intil Ltd Steve Tenore Sen G J Velella The Market Place Curtain Shop The Market Place Curtain Shop Carliform Inc Pregnancy Care Ctr Leafs Inc Pregnancy Care Ctr Leafs for Shop Liebmans Polka Dot American Red Cross Americas Future In Deplatron Jonell-Dean Hair Main St. Apther&Sng Plate Incourter Place Incourter	04 033-8282
= 1 ME	Palace Discotheque	.74 235-7117
519 *	Miele Intel School	# 636-6679 80 636-6679
1	Dr Louis Miele	.83 636-6670 77 636-8685
*	Promadent Dati Std	80 235-4207
*	Hyman Shuiman CPA	78 636-4623
521 *	Hyman Shulman CPA Starlite II Restr	632-3543
522	Main Jewelers George Cekaj Eulalia Isla J Magale Florist	83 632-3543 83 632-0749 84 633-0809
*	Eulaita Isla	.76 535-5324 - 532-3510 -
	Wehstr Florists	632-3610 78 235-2908
523 ×	New Roch Book Shop	.75 636-4284 # 636-5379
	R J Beninato Ins	- 633-7244
	Raben Capital Grt	- 633-7244
525 1	I B Cohen Cithg	632-7100
122	* Almarc Drugs	.79 576-0100
527	Main Jewelers George Ceka Eulaia Isla J Magale Florist Wchstr Florists D Young New Roch Book Shop Raymond Beninato R J Beninato Imz Litt Diss Store Raben Capital Grt US Life Ins Co I B Cohen Citig A Lukashok RI Est & Alamarc Grogs Paul Donofmo Fa G Hornney Co A Mark Awarcis	.82 235-5329
;	A G Hornney Co	79 576-0506
528	t J J Monahan Inc . NW Roch Prescyte	
529	k Huguenot Windw Cling	632-5623 .73 632-8660
1	k Phil&Joes Heros	.85 632-7729 82 636-9851
530	Funtime A G Hornney Co A Mark Assocs J J Monahan Inc KW Roch Pressptm KHuguenot WndW Cling Koto Travel Svc Phil&Joes Heros t Richies Billards bonut Master Coffe Sues Place VISION	
- 2 01	VISION	91 536 3061
5357	t J Bs World Plants k Luggage Shop Inc . k Shirleys Jewelry	. п 633-9029
538± 539±	k F W Woolworth Michele Wallpaper	74 632-7999

## Source Cole Criss-Cross Directory

AIN ST	198
450★Soul Scissors ★Tko Studios Inc	235-6670
*Video Progms Intnl	576-3330
14 LE COUNT PL	010-0000
*Wstch Fedrl Savings	235-9000
451+St Unemploymnt Ins	632-4705
452 Residential Intrs	235-0967
455 Brentwood Furn	636-7537 532-4434
*Better Built Boding	949-6446
*Foam Rubber	632-4434
*Kornsweet&Co	632-4434
*J Kornsweet Matrs	632-4434
	5 636-6271
A M Schauer	7 632-7596 576-3440
160 NP	370-3440
148 NORTH AV	
	8 632-0590
173★Biltmore Wine&Ligr 175★Are The Best T Sht	636-1945
176±Corner Shoe Outit	235-6606 633-7105
77+Anthony M Polo	632-6320
*Polomar Ceramics	632-6320
*Polomar Gift Shop	632-6320
178★Handler Furs Inc	636-6065
rynan For Corp 179★Citibank N A	636-6065 332-1700
180 T F M Pollock	636-8044
+Zipperz	235-9805
181 gDr Jeffrey L Adler	576-0414
★Bergman&Bergman ★M H Bergman Atty ★M H Bergman CPA	235-0100
AM H Beroman CPA	235-0100 235-0100
*Morris Block Atty	636-2500
+Caratzas Bros Pbis	632-8487
*Emanuel Data Systm	235-6209
*Emanuel Law Outline	235-4545
★S L Emanuel Lwyr ★L H Fleischman CPA	235-6205 576-0852
*Foremost Home Care	632-3311
+I Goodfriend Atty	235-0100
*Goody Two Shoes	636-9208
*Hill Spolts Adving	632-3888
*Joe Louis Pub Ritn	636-1131
*Louis-Rowe Enterpr	636-1131 235-4545
★R H Lovell Atty ★Lovell&Asoc Attys	235-4545
*Robert C Parsons	576-1200
*Lovell&Asoc Attys	576-2525
+Rettner Management	636-7000
*H Cap Riemer CPA	632-1655

450★Soul Scissors ★Tko Studios Inc	235-6670
450 ± Soul Scissors ± Tko Studios Inc	636-2988 576-3330
14 LE COUNT PL +Watch Fedri Savnos	215-9000
* Facon redri Savriga 451 + 55 Unemployami ins 452 + Residential intrs 455 + Brentwood Furn 456 + Better Built Beddig + Foam Rubber * Foam Rubber	632-4705
455+Brentwood Furn	235-0967 636-7537
456 Better Built Beddg	532-4434
*Foam Rubber	632-4434
★Kornsweet&Co ★J Kornsweet Matrs	632-4434 632-4434
458 Walter Jansson	636-6271
*Foam Nudder *Konsweet Kats 458 Walter Jansson	632-7596 576-3440
460 148 NORTH AV	
	632-0590
475 Are The Best T Sht	235-6606
463 L Cottrell ine&Ligr . 78 473★Bitmore Wine&Ligr . 475 475★Are The Best T Sht . 475★Corner Shoe Dottit . 475★Corner Shoe Dottit . 476★Corner Gitt Shop 475★Handler Furs Inc . ★All Fur Corp . 475★Clibank N A. 480★Cr F M Policck	633-7105
*Polomar Ceramics	632-6320
477 ★ Anthony M Polo ★Polomar Ceramics ★Polomar Cill Shop 478 ★ Handler Furs Inc ★Nati Fur Corp 479 ★ Citibank N A	636-6065
★Nati Fur Corp	636-6065
479★Citibank N A 480★Dr F M Pollock ★Zipperz	636-8044 235-9805
	576-0414
★Bergman&Bergman ★M H Bergman Atty ★M H Bergman CPA	235-0100 235-0100
	235-0100
★Caratzas Bros Pbls	200 0 0 0 0 0 V
★Emanuel Data Systm	235-6209
★S L Emanuel Lwyr	235-6205
*Foremost Home Care	632-3311
★Carazza pros Pros ★Emanuel Data Systm ★Emanuel Law Outine ★S L Emanuel Law Outine ★L H Reischman CPA ★Foremost Home Care ★Goodfriend Atty ★Goodfriend Atty	235-0100
THII Sports Adving	632-3888
	636-1131 636-1131
AR H Lovell Atty	235-4545
*Robert C Parsons	235-4545 576-1200
Head Agency	576-2525 636-7000
+H Cap Riemer CPA	632-1655
★Joan Riemer Inc	632-1655 636-1131
Sales Careers	632-8800
*Scepter Publishers	636-3377
★Joan Hemmer Inc. ★William L Rowe ★Sales Careers ★Sales Machy Corp. ★Scepter Publishers ★Scorpio Data Systm ★Scorpio Data Systm ★Scorpio Data Systm ★Scorpio Data Systm ★Scorpio Data Systm ABSA Hemore Ontrial	576-1200
*Daniel D Tartaglia	235-4545
485±Lawtown Optical	
485*Lawtown Optical *Wans Restrnt *Dr S G Willinger 486*Beneficial Finance	235-3873 636-5506
486 Beneficial Finance	636-1717
★Benefcl Inc Tax Sv 487★Fordham Disc Wig	636-1717 576-1636
*Rahmey Hoslery Shp	636-7756 632-2903
*Rahmey Hoslery Shp 488*LAL Floors 489 Dennis Frederick 490*House of Music *New Rochi Ha Music	576-6750
490 House of Music	632-4317 632-4317
	632-1002
B Fancy Fabrics C Debros Party Hut 491 * Barclays Bank NY	632-9709
491 Barclays Bank NT	0.30-4201
494 Han Chung Sung	
497★E&W Gifts Inc. 498★Dr Geo H Belkin	632-6478
498 Dr Geo H Belkin	632-8744 235-4689
*Florsheim Stratfrd	235-5449 636-3418
Stava Lidenda Ad	632-9225
*Premier Care	576-1844 632-8744
★Inti Dental Lab     ★Premier Care     ★Dr Paul Roberts     ★Tanduc Inti Ltd     500★The Rink     Site Curtain Shop	632-7577
	636-3504 636-8794
503 J J Rall	632-2427 576-1232
SOCAL pate Fur Shon	632-2355
★Leafs Inc ★Projanskys Furs ★Projanskys Furs	632-2355 946-8400
	636-5680 636-0477
+Becord Hut	636-0477
510 Liebmans Shop Liebmans Polka Dot 514 American Red Cross Americas Future In	632-2770 632-2770
514 American Red Cross	632-5250 235-6000
Chambr Comrc NW Ho	632-5700
★Fashion Ranch	632-0910 235-2366
7 CHURCH	235-7117
518*Palace Discotheque	
519★Miele Intl Sh Lang ★Miele Intnl School ★Oriental Gift Shop	636-6670 635-6679
*Oriental Gift Shop	636-8685
*Promadent Dati Std	235-5272
Hyman Shulman CPA	636-4623 636-3450
	636-7020
521 ± Liskins	632-3543 8 632-5960
Eulalia (sia concentration	0 636-6324
+Wchstr Pionsts	632-3610 632-3610
D Young 523 New Roch Book Shop	8 235-2908 636-4284
524 K L Coleman	1 235-1780
±Inti Disc Store	633-8598 632-7100
A Almarc Drugs	
	235-5329
A G Hornney Co	632-4900 576-0506
*Master Messenger	
*J J Monanan mo	
Kenneth C Stern	in Location

Target	Street
$\checkmark$	

-

Source Cole Criss-Cross Directory

A	
14 LE COUNT PL	and an Edit
451 + Frank Packard Inc	NE6-7090
★Leatha-Glo Inc	NE6-7090
*Frank Packard Furn	NE6-7090
455 + Brentwood Furn	NE6-7537
456 + Better Built Beddg	632-4434
*Better Built Bddng	949-6446
*J Cornsweet Matrs	632-4434
*Foam Rubber	632-4434
★ Kornsweet&Co	632-5557
★Kornsweet&Co	949-6446
★J Kornsweet Matrs	632-4434
★J Kornsweet Beddng	632-4434
★J Kornsweet Beddng	632-5557
★J Kornsweet Beddng	949-6446
*Kornsweets Bedding	632-4434
*Kornsweets Bddng	949-6446
458 Walter Jansson 5	636-6271
B Williams -	633-7196
460 NP	and the second second
461★All Way Travel Bur	633-6900
★Country Wide Tx Sv	633-6900
★County Wide Brokrg	633-6900
NOT BE KEY PUNCHED, ENTERED INTO	A COMPUTER OR F
to that Street * - Business Listing T	z - mading zone

Cross Street

-

Source Cole Criss-Cross Directory

MAIN ST		1977
LE'S		PAC
148 NORTH AV 463 Mrs Violet Brown	0	235-7803
466 + Chilewich Sons&Co		632-3000
471★Pis Burger Palace 473★Biltmore Wine&Ligr		636-1846 NE6-1945
475 + Wig Country		576-0277
476 Corner Shoe Outit 477 Anthony M Polo		633-7105 632-6320
477 * Anthony M Polo * Polomar Ceramics * Polomar Gift Shop * Tru-Walk Shoes		632-6320 632-6320
★Tru-Walk Shoes 478★Handler Furs Inc		636-7701
	-	NE6-6065 576-1837
Joyce Manning H Mulings *National Fur Corp *Nati Fur Corp 479 * Citibank	5	576-2680 636-9239
*Nati Fur Corp		NE6-6065
480 + Caroan Corn	-11	235-9800 576-0764
#Dr   Pollock		NE6-8044 NE6-8044
★Second Floor ★Second Floor II		636-9883 636-9339
481★Bailer Computr Sys		633-7762
★Bergman&Bergman ★M H Bergman Atty ★M H Bergman CPA ★Biock&Greene Attys		235-0100 235-0100
*M H Bergman CPA *Block&Greene Attvs		235-0100
W Max blockason bid		030-5175
+ Blucher&Assos		636-2500 636-5454
★Fleischman&Hirsch		576-0851
#1 Goodfriend Atty		235-0100
* Hill Spots Adving		632-3888 576-0851
* Maypreno Inc		636-1477
★Maypreno Inc ★Robert C Parsons ★Chris Penn Acctnt	п	576-1200 235-9440
+ Pic-A-Shoe + Progrmd Pyrl Taxes		636-9245
*Regent Leasing		632-1230
★Regent Leasing ★Renaissance Proj ★Salles Machy Corp ★N R Shepis Acctnt ★Spencer Turbine	-	576-3320 636-0400
		235-9442 636-2109
+ Stressteel Corp		235-6205 632-1230
★Ultra Protctn Syst ★F I Zabriskie Atty		632-3800
		636-2384 NE2-9009
484 ★ Schulmans Cleanrs ★ Shulmans Cleaners 485 ★ Frances Pizza	42	NE2-9009 NE2-9009
485 ★ Frances Pizza ★ Necessities Discrit 486 ★ Beneficial Discrit ★ Beneficial Finance 487 ★ Rahmey Hosiery Shp		636-3098 235-0833
486 * Beneficial Discnt * Beneficial Finance		632-4040 636-1717
★Beneficial Finance 487 ★Rahmey Hosiery Shp ★WigsAkats Shop 488 ★David Breit Corp ★Davis Breit Corp 489 L Pennant	ŝ.	636-7756
488 + David Breit Corp		632-9169
★Davis Breit Corp 489 L Pennant		632-9169 576-3405
Patrick Teague 490 ★ Franks Used Furn	0	632-5935 235-1819
*KNP Stores		576-3926
491 + Barcleys Bank 494 + N J Patterson Phrm		636-3300 NE2-0597
496 * Shampoo Haircutter		633-8282
497 ★ Ajax Cigar Store ★ Ajax Cigar Store 498 ★ Dr Geo H Belkin ★ S M Cassara CPA ★ Fainas Donut Shop		235-2144 636-9505
498 t Dr Geo H Belkin		NE2-8744
★S M Cassara CPA ★Fainas Donut Shop	-	576-2323 BE5-4689
*Florsheim Stratfrd *Dr M W Solomon		235-5449 NE2-6542
503 + Curtain Shoppe		836-8794
505 + Crattform Inc	-	576-1232
A Demichelle 506 + Leafs Fur Shop		632-6576 NE2-2355
*Leafs Inc		NE2-2355
★ Projanskys Furs ★ Projanskys Furs		946-8400 636-5680
510 ± Liebmans Shop		NE2-2770 NE2-2770
514 + Jack Fishman		636-3879
Bernard L Gelbard # Journet Art Studio		NE6-2225 NE6-4261
★Personal Ctr Presc     ★Prescription Center		NE6-2225 636-1170
*Personal Ctr Presc *Prescrptn Center *Red Cross Shoe Sho *Gus Wartell Studio	2	NE2-5187
7 CHURCH		
518 * Palace Discotheque 1 MECHANIC		235-7117
519 * Mungs Inc.	-	633-6556 636-3450
		NE6-7020
521 ± Liskins Coats&Drss 522 Eulalia Isla		632-3543 636-6324
*J Magale Florist Rose Schaefer		NE2-3610 632-3614
D Skinner	5	235-2908
★Wchstr Florists 523★New Roch Book Sho		NE2-3610 636-4284
523 * New Roch Book Sho 524 Gary Garofolo * Natures Pet Land		235-5942 636-3260
525 ±1 B Cohen Cithg		632-7100
526 + Carson Beel Corp + Carson Beel Corp		636-9810 NE6-7100
527 * Amer Red Cross *Burt Mach Co		632-5250 632-4900
+A G Hornney Co		632-4900
*Gennaro Maddaloni *Panei Craft Inc		235-5492
+Anthony Pastore		576-0506 632-3847
+ Dr David Rudin + Schroeder Mach Cor		632-4900
*US Bottlers Mach 529 * Huguenot Wndw Cin * Noto Travel Svc	9	632-4900 NE2-5623
*Noto Travel Svc *Dr J Somerstein		632-8660 235-5444
+ Yellow Submarn Inc	-	235-5025
	=	235-4030 235-3644
2 DIVISION		636-7053
535★Illusns Silvr Btq ★Kadin Plant World		576-3082
★Nitty Gritty Jrs	12	636-8636

Cross Street

-

Source Cole Criss-Cross Directory

## MAIN ST 1972

MAIN SI	1972	
450*BUTLER LUMB	ER CO	63289
14 LE COUNT	PL	
451 *FRANK PACKA *LEATHA-GLO		NE670
*FRANK PACKA	RD FURN	
455*BRENTWOOD F 458 ROBERT YEAG	URN	NE675
458 RUBERT TEAG	NP	-23571
461 *MALLARY FUR	N	63285
463 MRS VIOLET	BROWN O	23578
*JOHNSON SAW	DUST	63695
466 CONSTABLE A 471*JIM ATKINS		63230 BE519
*ATKINS REST		NE697
#JIM ATKINS	INC	BE519
473*BILTMORE WI 475*NOTO TRAVEL	SVCE	NE285
476*CORNER SHOE	OUTLET	NEGRO
477 ANTHONY M P *POLOMAR CER	ANICS	03263
*POLOMAR GIF	T SHOP	63263
TRU-WALK SH		03675
478*HANDLER FUR *NATL FUR CO		THE DEC
479*BETTR BUILT	BEDDNG	NE660
*BETTER BEDD *J CORNSWEET	MTREES	- WHORK
*FOAM RUBBER	CITY	NE248
*KORNSWEET&C		NE255
*KORNSWEET&C *JACK KORNSW		-WH964 NE246
*J KORNSWEET	BEDDNG	NE244
*J KORNSWEET	and the second second second second	PY0927 NE255
# I KORNSWEET		-WH964
*KORNSWEET E	ETR BED	NE244
*KORNSWEETS 480*DOUGLAS REA	LTY CO	BEDUO
DR FREDK M	POLLOCK	NE680
SECOND FLOO		n63698
481 *BERGMANE BER		23501
*D R BERGMAN		2350+
*M H BERGMAN *M H BERGMAN		2350
*S BERGMANEC	O ACCTS	23501
*BLUCHER&ASS *CORONET FLC		0.365.
*EDSTRAND BR	IOS INC	63230 23598
*S M EISENMA *I GOODFRIEN	N CPA	20×32
*C E HEADHY	CO DADD	\$ 9001
TILL OF CLIP		163238
*DAVID KLEIN *MARKET SVCE	CPA	23598
*MAYPRENO IN	IC	63614
*LIONEL NALV *NALVENENALV		63.624
*CHRIS PENN		23594
*PIC-A-SHOE	OUNT	63692
*REGENT DISC *REGENT LEAS	ING COPI	163212
*M M ROSENTH	ALECO	63263
*SALLES MACH *A J SCHEFFL	ER ATY	463258
A	attent a tel but t	10 22 34
*M D SCHEFFL *SCHEFFLER&S *N R SHEPIS	CLEFFLR	163225
#SOLON DATA	SERVICE	20094
<b>*ULTRA PROTO</b>	TN SYST	403215
*ERNEST WINT *K J WINTER	ER	23598 23598
*F I ZABRISK	IE ATTY	0323A
482*GEM ELECTRN *GEM ELECTRO		63200
484*SCHULMANS C	LEANRS	636895 NE2900
*SHULMANS CL	EANERS	NE2900
485*BOBS CHILDR *QUEEN CTY K		636940 NE378
*QUEENS CTY	DELCTSN	636944
486*BENEFICIAL *BENEFICIAL		632404
COLINE ICIAL	- ALAMANE	

4738280.5 Page: A33

Cross Street

-

# Source

Cole Criss-Cross Directory

	WAIN			)/Z	
MAIN	ST		1	972	WESTCH
487	+CRANES	-COUSNS	S WIGS		0801
	*RAHMEY	HOSIEF	RY SHP	636	7756
489	PATRIC	K TEAG	JE 0		5935
490	THE PO	TTERY I	ISE AND	NE2	2040
180.	*RETAIL *SALT O	F THE	ARTH	576	0038
	*SHELLY	CRDEGE	T SHP	NEG	9763
491	FIRST	WESTCH	NATL	636	3300
492	*REGAL	MENS SH	HOP	235	1460
494	*N J PA	TTERSON	PHRM		0597
	*PATTER				9229
	2 LAWT	ON			3420
	*AJAX C	IGAR ST			9505
400	*CRAFTF *DR GED	ORM INC	1		1232
430	F S CL	APS LW	R		8744
1	*FAINAS	DONUT	SHOP		4689
	*G GALG	AND JR	ATTY		0906
499	PAULAS	CASUAL	S		6542
500	W T GR	ANT DEP	T STR		8300
1	W T GR	ANT DEP	T STR	BE5	1920
501	T MCAN	SHOF 5	TR		9509
503	RALPHS	ELEC A	PPLNC	NE2	1717
1.	RALPHS	ELEC A	PPLNC	NE2	6770
	#J TODA	RO ELEC	TRL	NE 2	6770
505	ARNOLD	CHELLE	S BK		8149
	MRS EL	IZ HANL	ON	BE5	2482
	JOAN F	RANCES	MLLNR	BE5	0922
506	*LEAFS	FUR SHO	16	NE2	2355
	LEAFS	INC FUR	s	WH8	2355
507	LIEBMA	LD BUS	MGMNT	1235	5025
510	LIEBMA	NS SHOP	A DOT	NE2	2770
5141	C A BU	SINESS	SVCESI		
	+COUNTY	PHOTO	SVCE	632	4994
-	BERNAR	D L GEL	BARD	NE6	2225
	MYDAS I	REALITY	SAL ON	NEO	4261 8876
	G J PO	SATERY	ACCT		8188
38	PRESCRI	PTN CEN	ITER	636	1170
0	PRESCR	IPTN CE	NTR	NE 0	2225
	DR A L				2915
	GUS WA	RTELL S	STUDIO	632	4994
695	WEBSTR		REE	NE3	7000
518	MRS M	KAHN	SHOES		
1000	PALACE	SHOF 9	TORE	632	0555
	1 MECH	ANIC	TURE	032	2386
5194	AVCO F	INANCL	SERVC	636	3880
	AVCO S	ECURITY	CORP	NE6	5254
	ZARO B	AKE SHE	P	NET	9839
	ZARO B	AKE SHO	P	NE6	9545
5201	HAAS L	INENS 1	NC	NE6	7020
	HUGH J				3543 6970
SEE		LE FLOR			3610
	H MEGA	LEMARTI	N	636	1266
Del -	ROSE S	FLORIS	TS	NE 2	3614 3610
623	ROOKMA	RK BKS			4284
524	BROMLY	OF NEW	ROCH	NE6	7510
525	I B CO	HEN CLI	HG		7100
1	*ITAPHE	MEDIA L	RNNG -		2334
526	*CARSON	BEEF C	ORP	NE6	7100
527	AMER R	ED CROS	S	632	5250 7847
	A J BEI	ACH CO	41.15		4900
	COLUMB	IA MACH	INC	632	4900
	A G HO	RNNEY C	ICNP.		4900
	NW ROC	H DWNT	N ASC		1177
1.011	PANEL	CRAFT 1	INC	235	5492
	DR DAV				3847
	SCHROE				4900
	US BOT		ACH		4900
528	<b>#EMPIRE</b>	BTY SU	PLS	BES	6850
	#J STEF	RWTIL	IL ADV		8628
	CITY D			633	8899
	HUGUEN	OT WNDY	CLNG	NE2	5623
	DR J S	OMERSTE			5444
1 1	THE SI	IPCOVED	SHOUT		
530	THE SL	S BY LI	LI		3314
530	THE SL	S BY LI	ILI	636 235	



## **JPMC Branch Portfolio**

491 Main Street New Rochelle, NY 10801

Inquiry Number: 4738280.2s September 27, 2016

# The EDR Radius Map<sup>™</sup> Report with GeoCheck®



6 Armstrong Road, 4th floor Shelton, CT 06484 Toll Free: 800.352.0050 www.edrnet.com

FORM-BPK-KTV

# TABLE OF CONTENTS

### SECTION

### PAGE

Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	702
Government Records Searched/Data Currency Tracking	GR-1

## **GEOCHECK ADDENDUM**

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-8
Physical Setting Source Map Findings	A-10
Physical Setting Source Records Searched	PSGR-1

*Thank you for your business.* Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental St Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

## **EXECUTIVE SUMMARY**

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

#### TARGET PROPERTY INFORMATION

#### ADDRESS

491 MAIN STREET NEW ROCHELLE, NY 10801

#### COORDINATES

Latitude (North):	40.9093880 - 40° 54' 33.79"
Longitude (West):	73.7814940 - 73° 46' 53.37"
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	602622.3
UTM Y (Meters):	4529201.5
Elevation:	94 ft. above sea level

#### USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	5940557 MOUNT VERNON, NY
Version Date:	2013

#### **AERIAL PHOTOGRAPHY IN THIS REPORT**

Portions of Photo from: Source: 20150522 USDA

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	J P MORGAN CHASE BAN	491 MAIN STREET	NY UST, NY AST		TP
A2	BARCLAYS BANK OF NY/	491 MAIN ST.	NY LTANKS		TP
A3	NEW ROCHELLE PUBLIC	ONE LIBRARY PLAZA	NY UST	Higher	81, 0.015, SE
A4	NEW ROCHELLE PUBLIC	1 LAWTON	NY LTANKS	Higher	118, 0.022, SSE
B5		481 MAIN ST	EDR Hist Cleaner	Lower	140, 0.027, ESE
C6	ADREAN PRINTING CO	490 MAIN ST	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Higher	154, 0.029, SSE
B7	LORDAE PROPERTIES -	484 MAIN ST	NY Spills	Lower	159, 0.030, ESE
B8	OFFICE BLDG	481 MAIN STREET	NY Spills	Lower	192, 0.036, East
B9	RETTNER MANAGEMENT C	481 MAIN ST	NY UST	Lower	192, 0.036, East
<b>C10</b>	ATTACK PESTICIDES	498 MAIN STREET	NY Spills	Higher	195, 0.037, South
D11	COMMERCIAL BUILDING	507 MAIN STREET	NY LTANKS	Higher	235, 0.045, SSW
E12	BARON MANAGEMENT	200 NORTH AVENUE	NY UST	Lower	247, 0.047, NE
13	NEW ROCHELLE PUBLIC	MEMORIAL HIGHWAY	NY LTANKS	Lower	253, 0.048, North
D14	DOLLAR BEST	506 MAIN ST	NY Spills	Higher	256, 0.048, SSW
E15	CATHOLIC NEWS PUBLIS	210 NORTH AVE	NY LTANKS	Lower	268, 0.051, NE
E16	CON EDISON	208 NORTH AVE	NY MANIFEST	Lower	269, 0.051, NNE
E17	NEW ROCHELLE MALL	MAIN & NORTH ST	NY Spills	Lower	285, 0.054, ENE
E18	MAIN ST. & NORTH AVE	MAIN ST. & NORTH AVE	NY Spills	Lower	285, 0.054, ENE
E19	ON ROAD	MAIN & NORTH AVE.	NY Spills	Lower	285, 0.054, ENE
D20	CON EDISON MANHOLE:	MAIN ST & CHURCH ST	RCRA NonGen / NLR, NY MANIFEST	Higher	293, 0.055, SSW
D21	CON EDISON TRANSFORM	CHURCH ST & MAIN ST	RCRA NonGen / NLR, NY MANIFEST	Higher	293, 0.055, SSW
D22	CON EDISON TRANSFORM	MAIN ST & CHRUCH ST	RCRA NonGen / NLR, NY MANIFEST	Higher	293, 0.055, SSW
D23	CON EDISON	MAIN ST & CHURCH ST	NY MANIFEST	Higher	293, 0.055, SSW
F24	SPEEDY CLEANERS	217 NORTH AVENUE	US AIRS, FINDS, NY DRYCLEANERS, ECHO	Lower	346, 0.066, NNE
F25	CVS PHARMACY #8447	222 NORTH AVE	RCRA-LQG, NY MANIFEST	Lower	356, 0.067, North
D26	COMMERCIAL PROPERTY	518,522&525 MAIN STR	NY Spills	Higher	364, 0.069, SSW
G27	LAWTON STREET REALTY	41-43 LAWTON STREET	NY UST	Higher	388, 0.073, NW
G28	PAVEMENT	41 LAWTON STREET	NY Spills	Higher	388, 0.073, NW
29	COMMERCIAL PROPERTY	522 MAIN STREET	NY LTANKS	Higher	413, 0.078, SSW
H30	CON ED	230 NORTH AVE	NY MANIFEST	Lower	422, 0.080, North
H31	CON EDISON	230 NORTH AVE	RCRA NonGen / NLR	Lower	422, 0.080, North
H32	CONCRETE FLOORING WI	230 NORTH AVENUE	NY Spills	Lower	422, 0.080, North
H33	MKM EQUITY, LLC	230 NORTH AVENUE	NY AST	Lower	422, 0.080, North
G34	ACCESSOCRAFT PRODUCT	48 LAWTON ST	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Higher	427, 0.081, NW
135	CON EDISON SERVICE B	174 NORTH AVE	RCRA NonGen / NLR, NY MANIFEST	Lower	442, 0.084, ESE
H36	CON EDISON TRANSFORM	NORTH AVE & ANDERSON	RCRA NonGen / NLR, NY MANIFEST	Lower	463, 0.088, North
H37	CON EDISON	ANDERSON ST & NORTH	NY MANIFEST	Lower	463, 0.088, North
H38	CON EDISON	NORTH AVE & ANDERSON	NY MANIFEST	Lower	463, 0.088, North
H39	CON EDISON	NORTH AVE & ANDERSON	RCRA NonGen / NLR	Lower	463, 0.088, North

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
H40	CON EDISON	NORTH AVE & ANDERSON	NY MANIFEST	Lower	463, 0.088, North
l41		170 NORTH AVE	EDR Hist Cleaner	Lower	488, 0.092, ESE
G42	MAIN LIBRARY	LAWTON ST	NY LTANKS	Lower	489, 0.093, NNW
43	MACYS NEW ROCHELLE	THE MALL	NY UST	Lower	499, 0.095, NNE
J44	COMMERCIAL - UST	455 MAIN ST	NY Spills	Lower	503, 0.095, ENE
K45	RPM REALTY INC	9-15 DIVISION STREET	NY UST	Higher	505, 0.096, SW
K46	RPM REALTY INC	9-15 DIVISION STREET	NY AST	Higher	505, 0.096, SW
K47	COMM/RESIDENT. PROPE	15 DIVISION STREET	NY LTANKS	Higher	511, 0.097, SW
<b>I</b> 48	DEVITO RESIDENCE	168 NORTH AVE	NY Spills	Lower	512, 0.097, ESE
K49	ARIEL CABLE	19 DIVISION STREET/W	NY Spills	Higher	518, 0.098, WSW
K50	SIDNEY FURNITURE	535 MAIN ST	NY Spills	Higher	534, 0.101, SW
K51	535 MAIN ST ASSOCIAT	535 MAIN STREET	NY Spills	Higher	534, 0.101, SW
K52	CON EDISON	DIVISION ST & MAIN S	NY MANIFEST	Higher	546, 0.103, SW
K53	CONSOLIDATED EDISON	DIVISION & MAIN	NY MANIFEST	Higher	546, 0.103, SW
L54	SINNOTT MANAGEMENT C	35 CLINTON PLACE	NY AST	Lower	546, 0.103, SE
L55	SPILL NUMBER 0001159	35 CLINTON PL	NY Spills	Lower	546, 0.103, SE
M56		47 CLINTON PL	EDR Hist Auto	Lower	548, 0.104, SSE
N57	CABLE	29 DIVISION STREET	NY Spills	Higher	550, 0.104, WSW
H58	ANDERSON DEVELOPMENT	5 ANDERSON STREET	NY AST	Lower	551, 0.104, North
H59	ANDERSON DEVELOPMENT	5 ANDERSON STREET	NY UST	Lower	551, 0.104, North
H60	NORTH AVE REALITY	5 ANDERSON ST	NY LTANKS	Lower	551, 0.104, North
J61	CON ED-V37	LECOUNT PL & MAIN ST	NY MANIFEST	Lower	556, 0.105, ENE
J62	CON ED-V14	LECOUNT PL & MAIN ST	NY MANIFEST	Lower	556, 0.105, ENE
O63	MEMORIAL HIGHWAY AND	HUGUNOT ST	NY Spills	Higher	557, 0.105, WNW
L64	CON EDISON	150 NORTH AV	NY MANIFEST	Lower	557, 0.105, ESE
L65	CO-OP	30 CLINTON PLACE	NY LTANKS	Lower	567, 0.107, SE
L66	30 CLINTON PLACE OWN	30 CLINTON PLACE	NY UST, NY AST	Lower	567, 0.107, SE
L67	CON EDISON MANHOLE:	NORTH AVE & CLINTON	RCRA NonGen / NLR, NY MANIFEST	Lower	570, 0.108, ESE
L68	CON EDISON SERVICE B	NORTH AVE & CLINTON	RCRA NonGen / NLR, NY MANIFEST	Lower	570, 0.108, ESE
M69	CON EDISON	46 CLINTON PL	RCRA-CESQG, NY MANIFEST	Lower	583, 0.110, SSE
<b>O7</b> 0	AVALON ON THE SOUND	HUGUENOT STREET AND	NY UST	Higher	587, 0.111, West
71	FEDERAL PROPERTY MAI	244 NORTH AVE SUITE	RCRA NonGen / NLR	Lower	590, 0.112, North
72	MH1204	HUGUENOT AVE/LAWTON	NY Spills	Lower	591, 0.112, NW
073	CONSOLIDATED EDISON	MEMORIAL HIGHWAY & H	NY MANIFEST	Higher	618, 0.117, WNW
74	SOIL	12 LOCUST AVE	NY Spills	Lower	620, 0.117, ENE
N75	NEW ROCHELLE IRISH B	38 DIVISION STREET	NY UST	Higher	627, 0.119, West
N76	LILLIAN VERNON CO.	WESTCHESTER PLACE	NY LTANKS	Higher	629, 0.119, West
P77	VACANT LOT	HUGUENOT ST/DIVISION	NY LTANKS	Higher	635, 0.120, West
P78	ROAD	HUGUENOT ST/DIVISION	NY Spills	Higher	635, 0.120, West

	MAP	
--	-----	--

MA ID	P SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
L79	REMEDIATION SITE #C3	149 NORTH AVE	NY Spills	Lower	645, 0.122, ESE
L80	OFF-SITE FLAMINGO CL	149 NORTH AVENUE	NY BROWNFIELDS	Lower	645, 0.122, ESE
L81	FLAMINGO CLEANERS	149 NORTH AVE	RCRA-LQG, NY BROWNFIELDS, NY MANIFEST	Lower	645, 0.122, ESE
L82	FLAMINGO/TYK CLEANER	149 NORTH AV.	NY DRYCLEANERS	Lower	645, 0.122, ESE
L83		149 NORTH AVE	EDR Hist Cleaner	Lower	645, 0.122, ESE
L84	COLONIAL CLEANERS CO	149 NORTH AVE	RCRA NonGen / NLR	Lower	645, 0.122, ESE
Q85	NEW ROCHELLE SUPERMA	538 MAIN STREET	NY AST	Higher	654, 0.124, SSW
R86	LILLIAN VERNON CORPO	543-549 MAIN STREET	NY UST	Higher	657, 0.124, SW
R87	543 MAIN STREET	543 MAIN STREET	NY UST	Higher	657, 0.124, SW
R88	BLUE GILL REALTY	543 MAIN ST	NY LTANKS, NY Spills	Higher	657, 0.124, SW
89	NYSDOT BIN 1049890	DIVISION ST OVER MET	RCRA NonGen / NLR	Higher	665, 0.126, West
90	MACYS	33 LE COUNT PLACE	NY MANIFEST	Lower	690, 0.131, NNE
Q91	542 MAIN STREET LLC	542 MAIN STREET	NY UST	Higher	697, 0.132, SW
Q92	OFFICE BLDG	542 MAIN STREET	NY LTANKS	Higher	697, 0.132, SW
S93	ROTH CLEANERS	1 LEROY PL	RCRA NonGen / NLR, FINDS, NY DRYCLEANERS, NY	Higher	700, 0.133, SSW
S94	CONSOLIDATED EDISON	<b>DIVISION ST &amp; LEROY</b>	NY MANIFEST	Higher	700, 0.133, South
P95	CON EDISON	HUGENOT ST & DIVISIO	NY MANIFEST	Higher	705, 0.134, West
P96	CON EDISON TRANSFORM	<b>DIVISION ST &amp; HUGUEN</b>	RCRA NonGen / NLR	Higher	705, 0.134, West
P97	CON EDISON - TRANSFO	DIVISION ST AND HUGE	RCRA-LQG	Higher	705, 0.134, West
P98	CON EDISON	HUGENOT & DIVISION S	NY MANIFEST	Higher	705, 0.134, West
P99	CON EDISON	<b>DIVISION &amp; HUGUENOT</b>	NY MANIFEST	Higher	705, 0.134, West
P10	0 CON ED	<b>DIVISION ST &amp; HUGENO</b>	NY MANIFEST	Higher	705, 0.134, West
P10	1 CON EDISON MANHOLE:	HUGENOT AVE & DIVISI	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Higher	705, 0.134, West
P10	2 SHORELINE OIL	296 HUGENOT ST,REAR	NY LTANKS	Higher	761, 0.144, West
T10	3 US POSTAL SERVICE	255 NORTH AVE	RCRA NonGen / NLR, NY MANIFEST	Lower	762, 0.144, NNW
T10	4 UNITED STATES POST O	255 NORTH AVENUE	NY UST	Lower	762, 0.144, NNW
U10	5 BLOOMINGDALE PARKING	554 MAIN ST	NY UST	Higher	807, 0.153, SW
V10	6 THE MALL	MAIN STREET	NY LTANKS	Lower	815, 0.154, NE
T10	7 CON EDISON	NORTH AVE & HUGENOT	NY MANIFEST	Lower	821, 0.155, NNW
T10	B CON EDISON TRANSFORM	NORTH AVE & HUGUENOT	RCRA NonGen / NLR, NY MANIFEST	Lower	821, 0.155, NNW
T10	9 CON EDISON MANHOLE:	HUGENUOT ST & NORTH	RCRA NonGen / NLR	Lower	821, 0.155, NNW
T11	CON EDISON MANHOLE:	HUGUENOT AVE & NORTH	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Lower	821, 0.155, NNW
W1 <sup>-</sup>	1 S.B.J. ASSOCIATES	38 LOCUST AVENUE	NY UST	Lower	823, 0.156, ESE
W1 <sup>-</sup>	2 COMMERCIAL PROPERTY	38 LOCUST AVE	NY LTANKS	Lower	823, 0.156, ESE
W1 <sup>-</sup>	3 SBJ ASSOCIATES	38 LOCUST AVE	NY LTANKS	Lower	823, 0.156, ESE
X11	4 CERUSSI AND VERE	306 HUGUENOT ST	NY UST	Higher	826, 0.156, WSW
X11	5 306 HUGUENOT STREET	306 HUGUENOT STREET	NY AST	Higher	826, 0.156, WSW
Y11	6 CON EDISON	NORTH AVE & BONNEFOY	NY MANIFEST	Lower	830, 0.157, SE
Y11	7 CON EDISON MANHOLE:	NORTH AVE & BONNEFOY	RCRA NonGen / NLR, NY MANIFEST	Lower	830, 0.157, SE

MAP ID SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
X118 JONES RESIDENCE	311 HUGUENOT STREET	NY LTANKS	Higher	839, 0.159, West
X119 TRINITY-ST. PAUL'S E	311 HUGUENOT STREET	NY UST	Higher	839, 0.159, West
V120 NEW ROCHELLE MALL	425 MAIN STREET	NY UST	Lower	844, 0.160, ENE
121 SOUND CLEANER	63 MEMORIAL HWY	NY DRYCLEANERS	Lower	851, 0.161, WNW
Z122 M.J. HACKER & SONS I	64 CENTRE AVE	NY UST	Higher	883, 0.167, WSW
V123 MONROE COLLEGE	420 MAIN STREET	NY AST	Lower	896, 0.170, ENE
U124 HANGERS CLEANERS	562-564 MAIN STREET	NY DRYCLEANERS	Higher	902, 0.171, SW
125 KAUFMAN HUGUENOT COM	271 NORTH AVENUE	NY UST, NY AST	Lower	915, 0.173, NNW
Z126 NYNEX LOCATION	342 HUEGNOT ST	NY LTANKS	Higher	937, 0.177, SW
AA127 CON EDISON	OPP. 134 NORTH AVENU	NY MANIFEST	Lower	939, 0.178, SE
AA128 CON EDISON - MANHOLE	OPP. 134 NORTH AVENU	RCRA-LQG	Lower	939, 0.178, SE
AB129APT. BUILDING	55-59 LOCUST AVE.	NY LTANKS	Lower	942, 0.178, ESE
AB130 TWIN PARK EQUITIES L	55/59 LOCUST AVENUE	NY AST	Lower	942, 0.178, ESE
AC131 PROSPECT ROCHELLE RE	1,3,5 PROSPECT STREE	NY AST	Lower	947, 0.179, SSE
AD132SEASONWEIN MANAGEMEN	54 CENTRE AVENUE	NY UST	Higher	951, 0.180, WSW
AD133APARTMENT BLDG	54 CENTRE AVE	NY LTANKS	Higher	951, 0.180, WSW
Z134 COMMERCIAL PROPERTY	64 CENTRE AVE	NY LTANKS	Higher	955, 0.181, WSW
Z135 GREEN HEAVEN/CENTRE	62 CENTRE AVE.	NY DRYCLEANERS	Higher	957, 0.181, WSW
Z136 GREEN HEAVEN CLEANER	62 CENTRE STREET	RCRA-CESQG, US AIRS, FINDS, NY MANIFEST, ECHO	Higher	957, 0.181, WSW
137 MONROE COLLEGE	5 FRANKLIN AVE	NY LTANKS	Lower	962, 0.182, ENE
AE138 COCO RESIDENCE	81 CENTRE AVE	NY LTANKS	Higher	968, 0.183, SW
Z139 75 CENTRE AVENUE LLC	75 CENTRE AVENUE	NY UST, NY AST	Higher	994, 0.188, SW
AC140RESIDENCE	64 CHURCH ST	NY LTANKS	Lower	1000, 0.189, SSE
AF141 CON ED	CENTRE AVE & MAIN ST	NY MANIFEST	Higher	1006, 0.191, SW
AF142 CON EDISON TRANSFORM	CENTRE AVE & MAIN ST	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Higher	1006, 0.191, SW
AF143 CON EDISON	MAIN ST & CENTRE ST	NY MANIFEST	Higher	1006, 0.191, SW
AD144CON EDISON	CENTER & HUGUENOT	NY MANIFEST	Higher	1013, 0.192, WSW
AD145CON EDISON	HUGENOT & CENTRE ST	NY MANIFEST	Higher	1013, 0.192, WSW
AD146CON EDISON	CENTRE AVE & HUGUENO	NY MANIFEST	Higher	1013, 0.192, WSW
AD147CON EDISON	HUGUENOT ST & CENTRE	RCRA NonGen / NLR	Higher	1013, 0.192, WSW
AE148 CENTRE-MAIN ASSOCIAT	75 - 77 CENTER AVE	NY LTANKS	Higher	1014, 0.192, SW
AG149CON EDISON MANHOLE 1	HUGUENOT ST & LECOUN	RCRA NonGen / NLR, NY MANIFEST, NJ MANIFEST	Lower	1034, 0.196, North
AG150CON EDISON MANHOLE 1	HUGUENOT ST & LECOUN	RCRA NonGen / NLR, NY MANIFEST, NJ MANIFEST	Lower	1034, 0.196, North
AG151CON EDISON	HUGENOT ST & LECOUNT	NY MANIFEST	Lower	1034, 0.196, North
AE152 CENTRE MAIN EQUITIES	573-579 MAIN STREET	NY UST, NY AST	Higher	1040, 0.197, SW
153 NYSDOT BIN 1091390	DIVISION ST OVER I 9	RCRA NonGen / NLR	Lower	1048, 0.198, WNW
154 TRIPLE A PROPERTIES,	25 PROSPECT STREET	NY AST	Lower	1054, 0.200, South
155 CON EDISON - GAS DRI	FRANKLIN AV & LAFAYE	RCRA-LQG, NY MANIFEST	Lower	1059, 0.201, ENE
AD156ERIC S TURNER & CO I	33-35 CENTRE AVE	RCRA-CESQG, NJ MANIFEST, NY MANIFEST	Higher	1074, 0.203, WSW

MAP ID SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
AH157NORTH BROOK REALTY A	270 NORTH AVENUE - U	NYUST	Lower	1088, 0.206, NNW
AI158 VERIZON NEW YORK INC	342 HUGUENOT STREET	NY UST, NY AST	Higher	1096, 0.208, WSW
AI159 NEW YORK TELEPHONE C	342 HUGUENOT ST	RCRA NonGen / NLR, NY MANIFEST	Higher	1096, 0.208, WSW
160 TRUMP PLAZA	175 HUGUENOT STREET	NY LTANKS, NY Spills	Lower	1109, 0.210, North
AJ161 CON EDISON SERVICE B	LEROY PL & CENTER AV	RCRA NonGen / NLR, NY MANIFEST	Higher	1110, 0.210, SSW
AJ162 CON EDISON SERVICE B	CENTRE AVE & LEROY	RCRA NonGen / NLR, FINDS	Higher	1110, 0.210, SSW
AJ163 CON EDISON	CENTRE AVE & LEROY	NY MANIFEST	Higher	1110, 0.210, SSW
AH164EAST RIVER SAVINGS B	277 NORTH AVE.	NY LTANKS	Lower	1128, 0.214, NNW
AH165277 NORTH LLC	277 NORTH AVENUE	NY UST	Lower	1128, 0.214, NNW
AH166BUSINESS	277 NORTH AVENUE	NY LTANKS	Lower	1128, 0.214, NNW
AH167277 NORTH LLC	277 NORTH AVENUE	NY LTANKS	Lower	1128, 0.214, NNW
AH168CON EDISON MANHOLE:	277 NORTH AVE	RCRA NonGen / NLR, NY MANIFEST	Lower	1128, 0.214, NNW
AI169 HUGUENOT HOLDINGS, L	347 HUGUENOT STREET	NY AST	Higher	1152, 0.218, WSW
170 CHURCH OF LATTER DAY	111 NORTH AVE	NY LTANKS	Lower	1171, 0.222, SE
AK17160-70 OWNERS CORP.	60-70 LOCUST AVENUE	NY UST	Lower	1171, 0.222, ESE
AK172 APARTMENT BUILDING	67-70 LOCUST AVE	NY LTANKS	Lower	1171, 0.222, ESE
173 MORAN PROPERTY	44 FRANKLIN AVENUE	NY UST	Lower	1192, 0.226, East
AL174 125	CENTRE AVE	NY LTANKS	Higher	1210, 0.229, SSW
AM175CON EDISON	HARRISON ST & MAIN S	NY MANIFEST	Lower	1211, 0.229, NE
AM176CON EDISON	HARRISON ST & MAIN S	RCRA NonGen / NLR	Lower	1211, 0.229, NE
AM177CON EDISON MANHOLE:	MAIN ST & HARRISON S	RCRA NonGen / NLR, NY MANIFEST	Lower	1211, 0.229, NE
AN178CON EDISON TRANSFORM	CENTRE AVE & RELYEA	RCRA NonGen / NLR, NY MANIFEST	Lower	1212, 0.230, WSW
AN179CON EDISON TRANSFORM	CENTRE AVE & RELYEA	RCRA NonGen / NLR, NY MANIFEST	Lower	1212, 0.230, WSW
AM1801 HARRISON REALTY, L	1 HARRISON STREET	NY AST	Lower	1230, 0.233, NE
AM181CITY OF NEW ROCHELLE	1 HARRISON STREET	NY LTANKS	Lower	1230, 0.233, NE
AL182 CENTRE AVENUE APARTM	130 CENTRE AVENUE	NY AST	Higher	1242, 0.235, SSW
AO183FIRST METRO SERVICES	357 HUGONOT ST	RCRA NonGen / NLR, FINDS, ECHO	Lower	1246, 0.236, WSW
AP184 CON EDISON	FOUNTAIN PL & HARRIS	NY MANIFEST	Lower	1257, 0.238, NE
AP185 CON ED	HARRISON ST & FOUNTA	NY MANIFEST	Lower	1257, 0.238, NE
AP186 CON EDISON	FOUNTAIN PL & HARRIS	NY MANIFEST	Lower	1257, 0.238, NE
AP187 CON EDISON	HARRISON ST & FOUNTA	NY MANIFEST	Lower	1257, 0.238, NE
AP188 CON EDISON	HARRISON ST & FOUNTA	RCRA NonGen / NLR	Lower	1257, 0.238, NE
AP189 CON EDISON	HARRISON ST & CEDER	RCRA NonGen / NLR	Lower	1266, 0.240, NE
AP190 CON ED	HARRISON ST & CEDER	NY MANIFEST	Lower	1266, 0.240, NE
AM191LUXOR VALET CLEANERS	389 MAIN ST.	NY Spills, NY DRYCLEANERS	Lower	1288, 0.244, NE
AM192LUTOR VALET	389 MAIN ST	RCRA-CESQG, FINDS, NY MANIFEST, ECHO	Lower	1288, 0.244, NE
AO193STORAGE USA	363 HUGUENOT STREET	NY UST	Lower	1300, 0.246, SW
194 CON EDISON TRANSFORM	592 MAIN ST	RCRA NonGen / NLR, NY MANIFEST	Higher	1300, 0.246, SW
AQ195MR CHIMNEY CLEAN	32 RELYEA PL	RCRA NonGen / NLR, FINDS, NY MANIFEST, ECHO	Lower	1318, 0.250, WSW

Click on Map ID to see full detail.

## ΜΔΡ

MAP ID SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
AR196CITY OF NEW ROCHELLE	45 HARRISON STREET	NY LTANKS	Lower	1342, 0.254, NNE
AQ197INDUSTRIAL OVERALL S	10 BARTELS PLACE	NY SHWS, NY CBS	Lower	1398, 0.265, WSW
AQ198INDUST OVERALL SERVI	10 BARTELS PLACE	NY LTANKS	Lower	1398, 0.265, WSW
AS199 BLESSED SACREMENT CH	15 SHEA PL	NY LTANKS	Higher	1405, 0.266, SSW
AR200FIREHOUSE	HARRISON ST	NY LTANKS	Lower	1460, 0.277, NNE
AT201 BLESSED SACRAMENT CH	SHEA PLACE	NY LTANKS	Lower	1474, 0.279, South
AT202 APARTMENT HOUSE	156-168 CENTRE AVE	NY LTANKS	Lower	1481, 0.280, South
AT203 FAILED TANK TEST	156 CENTRE AVE	NY LTANKS	Lower	1481, 0.280, South
204 SPILL NUMBER 0302495	85 NORTH AVE	NY LTANKS, NY Spills	Lower	1492, 0.283, SE
AS205 BLESSED SACRAMENT HI	24 SHEA PLACE	NY LTANKS	Higher	1493, 0.283, SSW
AS206 BLESSED SACRAMENT HS	24 SHEA PLACE	NY LTANKS	Higher	1493, 0.283, SSW
207 HEALTH DEPT OFFICE	145 HUGUENOT ST	NY LTANKS, NY Spills	Lower	1515, 0.287, NNE
208 BERGMAN REALTY SERVI	140 HUGUENOT STREET	NY LTANKS	Lower	1521, 0.288, NNE
209 SPILL 0106072 / PBS	370 MAIN ST	NY LTANKS	Lower	1527, 0.289, ENE
210 NICK MAZZA RESIDENCE	20 DAVIS AVE	NY LTANKS	Lower	1556, 0.295, SSE
211 BLESSED SACREMENT SC	24 MAPLE AVE.	NY LTANKS, NY Spills	Higher	1586, 0.300, SSW
212 DOMINIC PROCOPIO	618 MAIN ST	NY LTANKS, NY Spills	Lower	1599, 0.303, SW
AU213RESIDENCE	60 GRAND STREET	NY LTANKS, NY Spills	Lower	1657, 0.314, NW
AU214GUIDANCE CENTER INC	70 GRAND ST	NY LTANKS	Lower	1696, 0.321, NW
215 RITZCOVAN - TTF	22 BURLING LANE	NY LTANKS	Lower	1731, 0.328, NNW
AV216 CASARRA RESIDENCE	9 BADEAU PL	NY LTANKS	Higher	1754, 0.332, WNW
217 A D VANDROFF	47 MAPLE AVENUE	NY LTANKS, NY Spills	Lower	1765, 0.334, SSW
AW218NYNEX	40 WASHINGTON AVE	NY LTANKS	Higher	1776, 0.336, WNW
219 EXXON S/S	635 MAIN STREET	NY LTANKS, NY Spills	Lower	1778, 0.337, SW
AX220 GETTY S/S	ECHO & BOSTON POST R	NY LTANKS	Lower	1810, 0.343, NE
AW22150 WASHINTON AVE	50 WASHINTON AVE	NY LTANKS	Higher	1842, 0.349, WNW
AW222ST GABRIEL SCHOOL	50 WASHINGTON AVE	NY LTANKS	Higher	1842, 0.349, WNW
AV223 RESIDENCE	18 BADEAU PLACE	NY LTANKS	Higher	1849, 0.350, WNW
AY224 MICELI HOME	194 CENTRE AVE	NY LTANKS	Lower	1854, 0.351, South
225 CITIZEN	33 GROVE ST	NY LTANKS	Lower	1859, 0.352, West
AZ226 DIIORGI HOME	47 WARREN STREET	NY LTANKS	Higher	1866, 0.353, West
BA227 RESIDENCE	10 LAFAYETTE ST	NY LTANKS	Lower	1877, 0.355, ENE
AZ228 SPILL NUMBER 0109254	40 WARREN ST	NY LTANKS, NY Spills	Lower	1879, 0.356, West
AX229 GETTY 58114	340 MAIN STREET	NY LTANKS, NY Spills	Lower	1895, 0.359, NE
230 CIUSSETELLI RESIDENC	4 FAIRVIEW PLACE	NY LTANKS	Lower	1921, 0.364, SE
AY231200 CENTRA CORP	200 CENTER AVE	NY LTANKS	Lower	1921, 0.364, South
BB232 JEROME RESIDENCE	33 ECHO AVE	NY LTANKS	Lower	1945, 0.368, ENE
233 SCHMUCKLER'S DRY CLE	358-364 NORTH AVENUE	NY BROWNFIELDS	Lower	1962, 0.372, NNW
BA234 GONCALVES RESIDENCE	1 LAFFAYETTE STREET	NY LTANKS	Lower	1967, 0.373, ENE

# Target Property Address: 491 MAIN STREET NEW ROCHELLE, NY 10801

Click on Map ID to see full detail.

### ΜΔΡ

MAP ID SITE NAME	ADDRESS		RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
BA235 GONCALVES RESIDENCE	1 LAFAYETTE STREET	NY LTANKS	Lower	1967, 0.373, ENE
BC236NEW ROCHELLE HOSPITA	COVION PLACE	NY LTANKS	Higher	1979, 0.375, NW
BB237 POWERTEST, ECHO & MAI	36 ECHO AVE @ MAIN S	NY LTANKS	Lower	1982, 0.375, ENE
BB238 MARIO'S S/S	44 ECHO AVENUE	NY LTANKS, NY Spills	Lower	1988, 0.377, ENE
BB239 GAS STATION	44 ECHO AVE	NY LTANKS	Lower	1988, 0.377, ENE
240 FIUMFREDO RESIDENCE	12 BAYVIEW AVE	NY LTANKS	Lower	1988, 0.377, ENE
241 NORTH EVARTS	44 NORTH EVARTS AVE	NY LTANKS	Lower	2003, 0.379, SE
BD242APT. BUILDING	208 CENTER AVE.	NY LTANKS, NY Spills	Lower	2012, 0.381, South
BC243SOUTH SHORE MED CENT	16 GUION PLACE	NY LTANKS	Higher	2021, 0.383, NW
244 RESIDENCE	79 WARREN ST	NY LTANKS	Higher	2030, 0.384, WNW
245 66 MEMORIAL BLVD	66 MEMORIAL BLVD	NY LTANKS	Lower	2038, 0.386, NW
246 PROFESSIONAL OFFICE	421 HUGUENOT STREET	NY LTANKS, NY Spills	Lower	2042, 0.387, SW
BE247 RUSH MFG. CORP.	10-12 PINE CT	CORRACTS, RCRA-CESQG, NY Spills, FINDS, NY	Lower	2044, 0.387, WSW
BE248 GKIDS REALTY	10/12 PINE COURT	NY LTANKS	Lower	2044, 0.387, WSW
249 RESIDENCE	14 REVERE RD	NY LTANKS	Lower	2047, 0.388, NE
250 SUNOCO	71 HUGUENOT ST	NY LTANKS, NY Spills	Lower	2056, 0.389, NE
251 TRINITY ARMS APARTME	25 TRINITY PLACE	NY LTANKS	Lower	2070, 0.392, SSE
BD252RESIDENCE	6 POPLAR ROAD	NY LTANKS	Lower	2075, 0.393, South
253 CONSOLIDATED EDISON	ECHO AVENUE	NY SHWS	Lower	2085, 0.395, NE
BF254 100-102 UNION AVENUE	100-102 UNION AVENUE	NY LTANKS	Higher	2099, 0.398, West
BF255 KAGEL HOME	99 UNION AVE	NY LTANKS	Higher	2106, 0.399, West
256 TANK TEST FAILURE	50 WALNUT ST	NY LTANKS	Higher	2109, 0.399, West
BG257SPILL NUMBER 0009195	17 POPLAR PL	NY LTANKS	Lower	2116, 0.401, South
BD258LABELLA RESIDENCE	219 CENTRE AVE	NY LTANKS	Lower	2132, 0.404, South
BF259 ROBERTS HOME	58 WALNUT STREET	NY LTANKS	Higher	2141, 0.405, West
BF260 @	60 WALNUT STREET	NY LTANKS	Higher	2150, 0.407, West
261 CON EDISON-CEDAR ST	ONE RAMADA PLAZA	EDR MGP	Lower	2173, 0.412, NNE
BH262SHERIDEN PLAZA	1 SHERIDEN PLAZA	NY LTANKS	Lower	2179, 0.413, NNE
BG263FUNICELOLO HOME	24 POPLAR PLACE	NY LTANKS	Lower	2190, 0.415, South
BI264 INDUSTRIAL OVERALL S	30 PINE ST	RCRA-LQG, NY SHWS, NY Spills, FINDS, NY MANIFEST,	Lower	2202, 0.417, WSW
265 SPILL NUMBER 9908602	HUGUENOT ST & SOUTH	NY LTANKS	Lower	2213, 0.419, SW
BH266MUTUAL BISCUIT COMPA	65 RIVER ST.	NY LTANKS, NY Spills	Lower	2226, 0.422, NNE
BJ267 TELEDYNE HYDRA-POWER	310 MAIN ST	NY SWF/LF, NY Spills, RCRA NonGen / NLR, FINDS, NY	. Lower	2229, 0.422, NE
268 RESIDENCE	164 CHURCH STREET	NY LTANKS	Lower	2238, 0.424, SSE
269 CONSOLIDATED EDISON-	ECHO AVE	SEMS-ARCHIVE, RCRA-CESQG, NY Spills, NY MANIFES	T Lower	2241, 0.424, ENE
270 SPILL NUMBER 0011198	114 UNION AVE	NY LTANKS, NY Spills	Lower	2262, 0.428, West
BI271 BELIVE HOME	20 PINE STREET	NY LTANKS	Lower	2285, 0.433, WSW
BJ272 DEFENDER MARINE SUPP	309 MAIN ST	NY LTANKS	Lower	2292, 0.434, NE
273 DIMATTOE TTF	55 MAY STREET	NY LTANKS	Lower	2303, 0.436, NNW

# Target Property Address: 491 MAIN STREET NEW ROCHELLE, NY 10801

Click on Map ID to see full detail.

### MAP

MAP ID SITE NAME		ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
BK274 SPILL NUMBER	0208792	386 NORTH AV	NY LTANKS	Lower	2319, 0.439, NNW
BL275 DEMELIA - TTF		95 WASHINGTON AVE	NY LTANKS	Lower	2337, 0.443, WNW
BM276CANDREA/GALL	ETTA RES	35 CHARLES ST	NY LTANKS	Lower	2345, 0.444, West
BN277 JASON PARTNE	RS LTD	675 MAIN ST	NY LTANKS	Lower	2364, 0.448, SW
BM278MERLUCCI RES	DENCE	30 CHARLES STREET	NY LTANKS	Lower	2369, 0.449, West
BM279SPILL NUMBER	0007965	45 CHARLES ST	NY LTANKS	Lower	2378, 0.450, West
280 SPILL NUMBER	0104402	30 LINCOLN ST	NY LTANKS	Lower	2388, 0.452, NE
281 NELSTAD MATE	RIAL COR	40 HUNTINGTON PL	NY LTANKS, NY Spills, NY SPDES	Lower	2409, 0.456, ENE
BK282 KGM PROPERTY	ASSOC.	394 N. AVE.	NY LTANKS	Lower	2420, 0.458, NNW
BK283 KGM REALTY CO	Э.	396 NORTH AVE.	NY LTANKS	Lower	2428, 0.460, NNW
BO284GETTY# 677		381 NORTH AVE	NY LTANKS, NY Spills	Lower	2433, 0.461, NNW
BN2856 WEBSTER		6 WEBSTER AVE	NY LTANKS	Lower	2435, 0.461, SW
BL286 BRAM REALTY		105 WASHINGTON AVE	NY LTANKS	Lower	2438, 0.462, WNW
287 RESIDENCE		98 LIBERTY AVE	NY LTANKS	Lower	2440, 0.462, SSW
288 BUSINESS COM	PLEX	55 WEBSTER AVE	NY LTANKS	Lower	2457, 0.465, WSW
289 SPILL NUMBER	0012427	22 LAUREL PL	NY LTANKS	Lower	2458, 0.466, SW
290 LIPMAN RESIDE	NCE	54 LIBERTY AVE	NY LTANKS	Lower	2466, 0.467, SSW
291 SPILL NUMBER	0300463	52 LINCOLN ST	NY LTANKS, NY Spills	Lower	2470, 0.468, NNE
BP292 BUSINESS		88 GROVE AVE.	NY LTANKS	Lower	2485, 0.471, West
BP293 COMMERCIAL B	UILDING	88-90 GROVE AVE.	NY LTANKS	Lower	2485, 0.471, West
294 FRANKA INC.		132-143 UNION AVE.	NY LTANKS	Lower	2506, 0.475, West
295 AMOCO SERVIC	E STATIO	690 MAIN ST	NY LTANKS, NY Spills, RCRA NonGen / NLR, NY	Lower	2513, 0.476, SW
296 MUNCIPAL MAR	INA	22 PELHAM RD	NY LTANKS, NY Spills	Lower	2519, 0.477, East
297 OAKHURST GAF	RDENS OWN	100 PELHAM ROAD	NY LTANKS	Lower	2535, 0.480, ESE
BO298DIPASQUALE PF	ROPERTY	400 NORTH AVE	NY LTANKS	Lower	2537, 0.480, NNW
BQ299SPILL NUMBER	9803423	106 LIBERTY AV	NY LTANKS	Lower	2538, 0.481, SSW
BQ300COLLEGE OF NE	W ROCHE	103 LIBERTY AVE	NY LTANKS	Lower	2566, 0.486, SSW
301 RITACCO HOME		24 JACKSON STREET	NY LTANKS	Lower	2573, 0.487, NE
302 KLING		108 VAN GUILDER AVE	NY LTANKS, NY Spills	Lower	2637, 0.499, WNW
303 BLANCO RESIDE	ENCE	30 LINDEN PLACE	NY LTANKS	Lower	2639, 0.500, SSW

#### TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
J P MORGAN CHASE BAN 491 MAIN STREET NEW ROCHELLE, NY 10801	NY UST Database: WESTCHESTER CO. UST, Date of Government \ Status: 4. Closed - in place Id/Status:: 3-164372 Site Status: Active	N/A /ersion: 02/19/2016
	NY AST Database: WESTCHESTER CO. AST, Date of Government \ Status: 1. In-Service PBS Number: 3-164372	/ersion: 02/19/2016
BARCLAYS BANK OF NY/ 491 MAIN ST. NEW ROCHELLE, NY	NY LTANKS Spill Number/Closed Date: 8905129 / 1991-03-25 Site ID: 299548 Program Number: 8905129	N/A

#### DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

#### STANDARD ENVIRONMENTAL RECORDS

#### Federal NPL site list

NPL.....National Priority List Proposed NPL.....Proposed National Priority List Sites NPL LIENS.....Federal Superfund Liens

#### Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

#### Federal CERCLIS list

FEDERAL FACILITY	Federal Facility Site Information listing
	Superfund Enterprise Management System

#### Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

#### Federal RCRA generators list

RCRA-SQG..... RCRA - Small Quantity Generators

#### Federal institutional controls / engineering controls registries

LUCIS	Land Use Control Information System
	Engineering Controls Sites List
	Sites with Institutional Controls

#### Federal ERNS list

ERNS..... Emergency Response Notification System

#### State- and tribal - equivalent CERCLIS

NY VAPOR REOPENED...... Vapor Intrusion Legacy Site List

#### State and tribal leaking storage tank lists

INDIAN LUST	Leaking Underground Storage Tanks on Indian Land
	Listing of Leaking Storage Tanks

#### State and tribal registered storage tank lists

Underground Storage Tank Listing
Chemical Bulk Storage Database
Major Oil Storage Facilities Database
Major Oil Storage Facility Site Listing
Chemical Bulk Storage Database
Major Oil Storage Facilities Database
Underground Storage Tanks on Indian Land
Storage Tank Faciliy Listing

#### State and tribal institutional control / engineering control registries

NY RES DECL	Restrictive Declarations Listing
NY ENG CONTROLS	Registry of Engineering Controls
NY INST CONTROL	Registry of Institutional Controls

#### State and tribal voluntary cleanup sites

NY VCP	Voluntary Cleanup	Aareements
INDIAN VCP		

#### State and tribal Brownfields sites

NY ERP..... Environmental Restoration Program Listing

#### ADDITIONAL ENVIRONMENTAL RECORDS

#### Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

### Local Lists of Landfill / Solid Waste Disposal Sites

NY SWRCY	Registered Recycling Facility List
NY SWTIRE	Registered Waste Tire Storage & Facility List
INDIAN ODI	Report on the Status of Open Dumps on Indian Lands
ODI	Open Dump Inventory
DEBRIS REGION 9	Torres Martinez Reservation Illegal Dump Site Locations

#### Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL	Delisted National Clandestine Laboratory Register
NY DEL SHWS	Delisted Registry Sites
US CDL	National Clandestine Laboratory Register

### Local Lists of Registered Storage Tanks

NY HIST UST	Historical Petroleum Bulk Storage Database
NY HIST AST	Historical Petroleum Bulk Storage Database

#### Local Land Records

NY LIENS	Spill Liens Information
LIENS 2	CERCLA Lien Information

#### **Records of Emergency Release Reports**

HMIRS	Hazardous Materials Information Reporting System
NY Hist Spills	
	SPILLS 90 data from FirstSearch
NY SPILLS 80	SPILLS 80 data from FirstSearch

### Other Ascertainable Records

	Formerly Used Defense Sites
	Department of Defense Sites
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR	Financial Assurance Information
EPA WATCH LIST	EPA WATCH LIST
2020 COR ACTION	. 2020 Corrective Action Program List
TSCA	Toxic Substances Control Act
TRIS	_ Toxic Chemical Release Inventory System
SSTS	Section 7 Tracking Systems
ROD	Records Of Decision
RMP	Risk Management Plans
RAATS	RCRA Administrative Action Tracking System
PRP	Potentially Responsible Parties
PADS	PCB Activity Database System
ICIS	Integrated Compliance Information System
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide
	Act)/TSCA (Toxic Substances Control Act)
MLTS	Material Licensing Tracking System
COAL ASH DOE	. Steam-Electric Plant Operation Data
	Coal Combustion Residues Surface Impoundments List
	PCB Transformer Registration Database

DOT OPSInCONSENTSuINDIAN RESERVInFUSRAPFoUMTRAUnLEAD SMELTERSLeUS MINESMDOCKET HWCHaUXOUnNY AIRSAiNY COAL ASHCoNY Financial AssuranceFiNY HSWDSHa	TIFRA/TSCA Tracking System Administrative Case Listing incident and Accident Data Superfund (CERCLA) Consent Decrees indian Reservations Formerly Utilized Sites Remedial Action Program Jranium Mill Tailings Sites Lead Smelter Sites Aines Master Index File Hazardous Waste Compliance Docket Listing Jnexploded Ordnance Sites Air Emissions Data Coal Ash Disposal Site Listing E DESIGNATION SITE LISTING Financial Assurance Information Listing Hazardous Substance Waste Disposal Site Inventory
	Inderground Injection Control Wells PA Fuels Program Registered Listing

#### EDR RECOVERED GOVERNMENT ARCHIVES

#### **Exclusive Recovered Govt. Archives**

NY RGA HWS\_\_\_\_\_\_ Recovered Government Archive State Hazardous Waste Facilities List NY RGA LF\_\_\_\_\_\_ Recovered Government Archive Solid Waste Facilities List

#### SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

#### STANDARD ENVIRONMENTAL RECORDS

#### Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for

listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 03/07/2016 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CONSOLIDATED EDISON-	ECHO AVE	ENE 1/4 - 1/2 (0.424 mi.)	269	610

#### Federal RCRA CORRACTS facilities list

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 06/27/2016 has revealed that there is 1 CORRACTS site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
RUSH MFG. CORP.	10-12 PINE CT	WSW 1/4 - 1/2 (0.387 mi.)	BE247	501

#### Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/21/2016 has revealed that there are 5 RCRA-LQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON - TRANSFO	DIVISION ST AND HUGE	W 1/8 - 1/4 (0.134 mi.)	P97	200
Lower Elevation	Address	Direction / Distance	Map ID	Page
CVS PHARMACY #8447	222 NORTH AVE	N 0 - 1/8 (0.067 mi.)	F25	45
FLAMINGO CLEANERS	149 NORTH AVE	ESE 0 - 1/8 (0.122 mi.)	L81	146
CON EDISON - MANHOLE	OPP. 134 NORTH AVENU	SE 1/8 - 1/4 (0.178 mi.)	AA128	242
CON EDISON - GAS DRI	FRANKLIN AV & LAFAYE	ENE 1/8 - 1/4 (0.201 mi.)	155	300

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 06/21/2016 has revealed that there are 4 RCRA-CESQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GREEN HEAVEN CLEANER	62 CENTRE STREET	WSW 1/8 - 1/4 (0.181 mi.)	Z136	250
ERIC S TURNER & CO I	33-35 CENTRE AVE	WSW 1/8 - 1/4 (0.203 mi.)	AD156	302
Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON	46 CLINTON PL	SSE 0 - 1/8 (0.110 mi.)	M69	131
LUTOR VALET	389 MAIN ST	NE 1/8 - 1/4 (0.244 mi.)	AM192	380

#### State- and tribal - equivalent CERCLIS

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 05/17/2016 has revealed that there are 3 NY SHWS sites within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
INDUSTRIAL OVERALL S Site Code: 413917 Class Code: Significant threat to th	<b>10 BARTELS PLACE</b> ne public health or environment - acti	WSW 1/4 - 1/2 (0.265 mi.) on required.	AQ197	406
CONSOLIDATED EDISON Site Code: 56077	ECHO AVENUE	NE 1/4 - 1/2 (0.395 mi.)	253	542
INDUSTRIAL OVERALL S	30 PINE ST	WSW 1/4 - 1/2 (0.417 mi.)	BI264	555

#### State and tribal landfill and/or solid waste disposal site lists

NY SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the NY SWF/LF list, as provided by EDR, and dated 07/06/2016 has revealed that there is 1 NY SWF/LF site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
TELEDYNE HYDRA-POWER	310 MAIN ST	NE 1/4 - 1/2 (0.422 mi.)	BJ267	586

#### State and tribal leaking storage tank lists

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 08/16/2016 has revealed that there are 134 NY LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NEW ROCHELLE PUBLIC Spill Number/Closed Date: 0201697 / Spill Number/Closed Date: 1311408 / Site ID: 306611 Site ID: 492304 Program Number: 0201697 Program Number: 1311408		SSE 0 - 1/8 (0.022 mi.)	A4	11
COMMERCIAL BUILDING Spill Number/Closed Date: 9110835 / Site ID: 286303 Program Number: 9110835	507 MAIN STREET 1992-03-10	SSW 0 - 1/8 (0.045 mi.)	D11	25
COMMERCIAL PROPERTY Spill Number/Closed Date: 1100723 / Site ID: 448142 Program Number: 1100723	522 MAIN STREET 2011-06-06	SSW 0 - 1/8 (0.078 mi.)	29	69
COMM/RESIDENT. PROPE Spill Number/Closed Date: 9405558 / Site ID: 119901 Program Number: 9405558	15 DIVISION STREET 2005-02-10	SW 0 - 1/8 (0.097 mi.)	K47	99
LILLIAN VERNON CO. Spill Number/Closed Date: 9213055 / Site ID: 201286 Program Number: 9213055	WESTCHESTER PLACE 1995-03-16	W 0 - 1/8 (0.119 mi.)	N76	140
VACANT LOT Spill Number/Closed Date: 0510542 / Site ID: 356539 Program Number: 0510542	HUGUENOT ST/DIVISION 2006-03-15	W 0 - 1/8 (0.120 mi.)	P77	141
BLUE GILL REALTY Spill Number/Closed Date: 0308082 / Site ID: 94435 Program Number: 0308082	<b>543 MAIN ST</b> 2004-05-12	SW 0 - 1/8 (0.124 mi.)	R88	171
OFFICE BLDG Spill Number/Closed Date: 0509995 / Site ID: 355877 Program Number: 0509995	542 MAIN STREET 2006-03-22	SW 1/8 - 1/4 (0.132 mi.)	Q92	177
SHORELINE OIL Spill Number/Closed Date: 8709425 / Site ID: 83347 Program Number: 8709425	296 HUGENOT ST,REAR 1988-04-06	W 1/8 - 1/4 (0.144 mi.)	P102	208
JONES RESIDENCE	311 HUGUENOT STREET	W 1/8 - 1/4 (0.159 mi.)	X118	231

Spill Number/Closed Date: 0410335 / Site ID: 335236 Program Number: 0410335	2005-09-11			
NYNEX LOCATION Spill Number/Closed Date: 9708146 / Site ID: 270876 Program Number: 9708146	342 HUEGNOT ST 1997-10-10	SW 1/8 - 1/4 (0.177 mi.)	Z126	239
APARTMENT BLDG Spill Number/Closed Date: 0403405 / Spill Number/Closed Date: 0206558 / Site ID: 84302 Site ID: 254563 Program Number: 0403405 Program Number: 0206558		WSW 1/8 - 1/4 (0.180 mi.)	AD133	246
COMMERCIAL PROPERTY Spill Number/Closed Date: 1308480 / Site ID: 489220 Program Number: 1308480	64 CENTRE AVE 2015-04-28	WSW 1/8 - 1/4 (0.181 mi.)	Z134	249
COCO RESIDENCE Spill Number/Closed Date: 0311339 / Site ID: 313391 Program Number: 0311339	81 CENTRE AVE 2005-01-10	SW 1/8 - 1/4 (0.183 mi.)	AE138	270
CENTRE-MAIN ASSOCIAT Spill Number/Closed Date: 0311823 / Site ID: 149369 Program Number: 0311823	75 - 77 CENTER AVE 2004-12-30	SW 1/8 - 1/4 (0.192 mi.)	AE148	286
125 Spill Number/Closed Date: 0001835 / Site ID: 205498 Program Number: 0001835	CENTRE AVE 2000-05-15	SSW 1/8 - 1/4 (0.229 mi.)	AL174	346
BLESSED SACREMENT CH Spill Number/Closed Date: 0204856 / Site ID: 167332 Program Number: 0204856	15 SHEA PL 2003-10-03	SSW 1/4 - 1/2 (0.266 mi.)	AS199	411
BLESSED SACRAMENT HI Spill Number/Closed Date: 0400709 / Site ID: 249284 Program Number: 0400709	24 SHEA PLACE 2004-07-06	SSW 1/4 - 1/2 (0.283 mi.)	AS205	421
BLESSED SACRAMENT HS Spill Number/Closed Date: 1300960 / Site ID: 481320 Program Number: 1300960	24 SHEA PLACE Not Reported	SSW 1/4 - 1/2 (0.283 mi.)	AS206	422
BLESSED SACREMENT SC Spill Number/Closed Date: 0204857 / Site ID: 80066 Program Number: 0204857	<b>24 MAPLE AVE.</b> 2003-10-03	SSW 1/4 - 1/2 (0.300 mi.)	211	433
CASARRA RESIDENCE Spill Number/Closed Date: 0209171 / Site ID: 157707 Program Number: 0209171	9 BADEAU PL 2003-02-05	WNW 1/4 - 1/2 (0.332 mi.)	AV216	444
NYNEX	40 WASHINGTON AVE	WNW 1/4 - 1/2 (0.336 mi.)	AW218	447

NEW ROCHELLE PUBLIC	MEMORIAL HIGHWAY	N 0 - 1/8 (0.048 mi.)	13	26
Lower Elevation	Address	Direction / Distance	Map ID	Page
@ Spill Number/Closed Date: 0502010 Site ID: 346287 Program Number: 0502010	60 WALNUT STREET / 2005-07-17	W 1/4 - 1/2 (0.407 mi.)	BF260	551
ROBERTS HOME Spill Number/Closed Date: 0608623 Site ID: 372634 Program Number: 0608623		W 1/4 - 1/2 (0.405 mi.)	BF259	550
TANK TEST FAILURE Spill Number/Closed Date: 1107925 Site ID: 455637 Program Number: 1107925		W 1/4 - 1/2 (0.399 mi.)	256	546
KAGEL HOME Spill Number/Closed Date: 0513684 Site ID: 360201 Program Number: 0513684	99 UNION AVE / 2006-03-09	W 1/4 - 1/2 (0.399 mi.)	BF255	545
100-102 UNION AVENUE Spill Number/Closed Date: 9608199 Site ID: 166425 Program Number: 9608199	100-102 UNION AVENUE / 1996-11-08	W 1/4 - 1/2 (0.398 mi.)	BF254	544
RESIDENCE Spill Number/Closed Date: 0510555 Site ID: 356553 Program Number: 0510555	79 WARREN ST / 2006-03-28	WNW 1/4 - 1/2 (0.384 mi.)	244	496
SOUTH SHORE MED CENT Spill Number/Closed Date: 0512440 Site ID: 358758 Program Number: 0512440	16 GUION PLACE / 2006-12-19	NW 1/4 - 1/2 (0.383 mi.)	BC243	495
NEW ROCHELLE HOSPITA Spill Number/Closed Date: 9003911 Site ID: 136814 Program Number: 9003911	COVION PLACE / 1991-03-15	NW 1/4 - 1/2 (0.375 mi.)	BC236	479
DIIORGI HOME Spill Number/Closed Date: 0500295 Site ID: 343230 Program Number: 0500295	47 WARREN STREET / 2005-08-28	W 1/4 - 1/2 (0.353 mi.)	AZ226	458
RESIDENCE Spill Number/Closed Date: 9609269 Site ID: 177416 Program Number: 9609269	18 BADEAU PLACE / 1996-10-24	WNW 1/4 - 1/2 (0.350 mi.)	AV223	455
ST GABRIEL SCHOOL Spill Number/Closed Date: 0302359 Site ID: 314440 Program Number: 0302359	50 WASHINGTON AVE / 2003-12-12	WNW 1/4 - 1/2 (0.349 mi.)	AW222	454
50 WASHINTON AVE Spill Number/Closed Date: 0305820 Site ID: 280324 Program Number: 0305820	50 WASHINTON AVE / 2003-12-23	WNW 1/4 - 1/2 (0.349 mi.)	AW221	452
Spill Number/Closed Date: 8803234 Site ID: 60528 Program Number: 8803234	1 1300-01-22			

Spill Number/Closed Date: 9111450 / Site ID: 306853 Program Number: 9111450	1992-02-06			
CATHOLIC NEWS PUBLIS Spill Number/Closed Date: 0503023 / Site ID: 347516 Program Number: 0503023	210 NORTH AVE 2005-08-28	NE 0 - 1/8 (0.051 mi.)	E15	29
MAIN LIBRARY Spill Number/Closed Date: 9713843 / Site ID: 273025 Program Number: 9713843	LAWTON ST 1998-03-27	NNW 0 - 1/8 (0.093 mi.)	G42	95
NORTH AVE REALITY Spill Number/Closed Date: 8803214 / Spill Number/Closed Date: 9812584 / Spill Number/Closed Date: 9812585 / Site ID: 68769 Site ID: 68770 Site ID: 68771 Program Number: 8803214 Program Number: 9812584 Program Number: 9812585	1999-07-12	N 0 - 1/8 (0.104 mi.)	H60	117
CO-OP Spill Number/Closed Date: 9504589 / Site ID: 189169 Program Number: 9504589	30 CLINTON PLACE 1997-04-15	SE 0 - 1/8 (0.107 mi.)	L65	124
THE MALL Spill Number/Closed Date: 9010648 / Site ID: 326514 Program Number: 9010648	MAIN STREET 1991-01-04	NE 1/8 - 1/4 (0.154 mi.)	V106	214
COMMERCIAL PROPERTY Spill Number/Closed Date: 1213228 / Site ID: 476407 Program Number: 1213228	38 LOCUST AVE 2013-02-04	ESE 1/8 - 1/4 (0.156 mi.)	W112	223
SBJ ASSOCIATES Spill Number/Closed Date: 0206043 / Spill Number/Closed Date: 0408593 / Site ID: 239569 Site ID: 333366 Program Number: 0206043 Program Number: 0408593		ESE 1/8 - 1/4 (0.156 mi.)	W113	224
APT. BUILDING Spill Number/Closed Date: 9200639 / Site ID: 168647 Program Number: 9200639	55-59 LOCUST AVE. 1992-06-26	ESE 1/8 - 1/4 (0.178 mi.)	AB129	243
MONROE COLLEGE Spill Number/Closed Date: 0307536 / Site ID: 165556 Program Number: 0307536	5 FRANKLIN AVE 2005-03-27	ENE 1/8 - 1/4 (0.182 mi.)	137	269
RESIDENCE Spill Number/Closed Date: 0408510 / Site ID: 333255	64 CHURCH ST 2008-05-01	SSE 1/8 - 1/4 (0.189 mi.)	AC140	273

Program Number: 0408510

Program Number: 0408510				
TRUMP PLAZA Spill Number/Closed Date: 0512575 / Site ID: 358910 Program Number: 0512575	<b>175 HUGUENOT STREET</b> 2006-03-08	N 1/8 - 1/4 (0.210 mi.)	160	326
EAST RIVER SAVINGS B Spill Number/Closed Date: 8912285 / Site ID: 271129 Program Number: 8912285	277 NORTH AVE. 1991-01-16	NNW 1/8 - 1/4 (0.214 mi.)	AH164	333
BUSINESS Spill Number/Closed Date: 0611580 / Site ID: 376243 Program Number: 0611580	277 NORTH AVENUE 2008-12-04	NNW 1/8 - 1/4 (0.214 mi.)	AH166	336
277 NORTH LLC Spill Number/Closed Date: 0611648 / Site ID: 376329 Program Number: 0611648	277 NORTH AVENUE 2008-12-04	NNW 1/8 - 1/4 (0.214 mi.)	AH167	337
CHURCH OF LATTER DAY Spill Number/Closed Date: 0403126 / Site ID: 266466 Program Number: 0403126	111 NORTH AVE 2004-09-21	SE 1/8 - 1/4 (0.222 mi.)	170	341
APARTMENT BUILDING Spill Number/Closed Date: 1008207 / Site ID: 441682 Program Number: 1008207	67-70 LOCUST AVE 2011-03-10	ESE 1/8 - 1/4 (0.222 mi.)	AK172	343
CITY OF NEW ROCHELLE Spill Number/Closed Date: 0201696 / Site ID: 75380 Program Number: 0201696	1 HARRISON STREET 2002-09-18	NE 1/8 - 1/4 (0.233 mi.)	AM181	358
CITY OF NEW ROCHELLE Spill Number/Closed Date: 0513733 / Site ID: 360263 Program Number: 0513733	45 HARRISON STREET 2006-06-21	NNE 1/4 - 1/2 (0.254 mi.)	AR196	405
INDUST OVERALL SERVI Spill Number/Closed Date: 1400928 / Site ID: 494186 Program Number: 1400928	10 BARTELS PLACE Not Reported	WSW 1/4 - 1/2 (0.265 mi.)	AQ198	410
FIREHOUSE Spill Number/Closed Date: 9713840 / Site ID: 252028 Program Number: 9713840	HARRISON ST 1998-03-27	NNE 1/4 - 1/2 (0.277 mi.)	AR200	413
BLESSED SACRAMENT CH Spill Number/Closed Date: 8704259 / Site ID: 324974 Program Number: 8704259	SHEA PLACE 1987-11-20	S 1/4 - 1/2 (0.279 mi.)	AT201	414
APARTMENT HOUSE Spill Number/Closed Date: 0312650 / Site ID: 267104 Program Number: 0312650	156-168 CENTRE AVE 2004-04-22	S 1/4 - 1/2 (0.280 mi.)	AT202	415
FAILED TANK TEST	156 CENTRE AVE	S 1/4 - 1/2 (0.280 mi.)	AT203	416

Spill Number/Closed Date: 1308221 / Site ID: 488939 Program Number: 1308221	Not Reported			
SPILL NUMBER 0302495 Spill Number/Closed Date: 0507677 / Spill Number/Closed Date: 0302495 / Site ID: 353132 Site ID: 114935 Program Number: 0507677 Program Number: 0302495		SE 1/4 - 1/2 (0.283 mi.)	204	418
HEALTH DEPT OFFICE Spill Number/Closed Date: 8901038 / Site ID: 259815 Program Number: 8901038	<b>145 HUGUENOT ST</b> 1989-06-01	NNE 1/4 - 1/2 (0.287 mi.)	207	423
BERGMAN REALTY SERVI Spill Number/Closed Date: 0505137 / Site ID: 350100 Program Number: 0505137	140 HUGUENOT STREET 2007-11-07	NNE 1/4 - 1/2 (0.288 mi.)	208	429
SPILL 0106072 / PBS Spill Number/Closed Date: 0106072 / Site ID: 133647 Program Number: 0106072	370 MAIN ST 2001-11-13	ENE 1/4 - 1/2 (0.289 mi.)	209	430
NICK MAZZA RESIDENCE Spill Number/Closed Date: 0000532 / Site ID: 211468 Program Number: 0000532	20 DAVIS AVE 2000-04-20	SSE 1/4 - 1/2 (0.295 mi.)	210	431
DOMINIC PROCOPIO Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866	<b>618 MAIN ST</b> 2004-03-30	SW 1/4 - 1/2 (0.303 mi.)	212	436
Spill Number/Closed Date: 9809866 / Site ID: 278454	2004-03-30 60 GRAND STREET	SW 1/4 - 1/2 (0.303 mi.) NW 1/4 - 1/2 (0.314 mi.)	212 AU213	436 438
Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866 <b>RESIDENCE</b> Spill Number/Closed Date: 0407555 / Site ID: 332054	2004-03-30 <b>60 GRAND STREET</b> 2004-10-07 70 GRAND ST			
Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866 <b>RESIDENCE</b> Spill Number/Closed Date: 0407555 / Site ID: 332054 Program Number: 0407555 GUIDANCE CENTER INC Spill Number/Closed Date: 9613894 / Site ID: 77017	2004-03-30 <b>60 GRAND STREET</b> 2004-10-07 70 GRAND ST 1997-10-03 22 BURLING LANE	NW 1/4 - 1/2 (0.314 mi.)	AU213	438
Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866 <b>RESIDENCE</b> Spill Number/Closed Date: 0407555 / Site ID: 332054 Program Number: 0407555 GUIDANCE CENTER INC Spill Number/Closed Date: 9613894 / Site ID: 77017 Program Number: 9613894 RITZCOVAN - TTF Spill Number/Closed Date: 1506693 / Site ID: 514123	2004-03-30 <b>60 GRAND STREET</b> 2004-10-07 70 GRAND ST 1997-10-03 22 BURLING LANE 2016-03-22 <b>47 MAPLE AVENUE</b>	<b>NW 1/4 - 1/2 (0.314 mi.)</b> NW 1/4 - 1/2 (0.321 mi.)	<b>AU213</b> AU214 215	<b>438</b> 441
Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866 <b>RESIDENCE</b> Spill Number/Closed Date: 0407555 / Site ID: 332054 Program Number: 0407555 GUIDANCE CENTER INC Spill Number/Closed Date: 9613894 / Site ID: 77017 Program Number: 9613894 RITZCOVAN - TTF Spill Number/Closed Date: 1506693 / Site ID: 514123 Program Number: 1506693 <b>A D VANDROFF</b> Spill Number/Closed Date: 9603128 / Site ID: 178537	2004-03-30 <b>60 GRAND STREET</b> 2004-10-07 70 GRAND ST 1997-10-03 22 BURLING LANE 2016-03-22 <b>47 MAPLE AVENUE</b> 1996-06-14 <b>635 MAIN STREET</b>	<i>NW 1/4 - 1/2 (0.314 mi.)</i> NW 1/4 - 1/2 (0.321 mi.) NNW 1/4 - 1/2 (0.328 mi.)	<b>AU213</b> AU214 215	<b>438</b> 441 442
Spill Number/Closed Date: 9809866 / Site ID: 278454 Program Number: 9809866 <b>RESIDENCE</b> Spill Number/Closed Date: 0407555 / Site ID: 332054 Program Number: 0407555 GUIDANCE CENTER INC Spill Number/Closed Date: 9613894 / Site ID: 77017 Program Number: 9613894 RITZCOVAN - TTF Spill Number/Closed Date: 1506693 / Site ID: 514123 Program Number: 1506693 <i>A D VANDROFF</i> Spill Number/Closed Date: 9603128 / Site ID: 178537 Program Number: 9603128 <i>EXXON S/S</i> Spill Number/Closed Date: 9206930 / Site ID: 140421	2004-03-30 <b>60 GRAND STREET</b> 2004-10-07 70 GRAND ST 1997-10-03 22 BURLING LANE 2016-03-22 <b>47 MAPLE AVENUE</b> 1996-06-14 <b>635 MAIN STREET</b>	<i>NW 1/4 - 1/2 (0.314 mi.)</i> NW 1/4 - 1/2 (0.321 mi.) NNW 1/4 - 1/2 (0.328 mi.) <i>SSW 1/4 - 1/2 (0.334 mi.)</i>	<b>AU213</b> AU214 215 <b>217</b>	<ul> <li>438</li> <li>441</li> <li>442</li> <li>445</li> </ul>

MARIO'S S/S	44 ECHO AVENUE	ENE 1/4 - 1/2 (0.377 mi.)	BB238	482
POWERTEST,ECHO & MAI Spill Number/Closed Date: 8709260 Site ID: 283199 Program Number: 8709260	36 ECHO AVE @ MAIN S / 1988-02-11	ENE 1/4 - 1/2 (0.375 mi.)	BB237	481
GONCALVES RESIDENCE Spill Number/Closed Date: 0609401 Site ID: 373629 Program Number: 0609401	1 LAFAYETTE STREET / 2007-01-10	ENE 1/4 - 1/2 (0.373 mi.)	BA235	478
GONCALVES RESIDENCE Spill Number/Closed Date: 9410991 Site ID: 156301 Program Number: 9410991	1 LAFFAYETTE STREET / 1994-11-29	ENE 1/4 - 1/2 (0.373 mi.)	BA234	477
JEROME RESIDENCE Spill Number/Closed Date: 0405389 Site ID: 235222 Program Number: 0405389	33 ECHO AVE / 2005-02-13	ENE 1/4 - 1/2 (0.368 mi.)	BB232	473
200 CENTRA CORP Spill Number/Closed Date: 0604650 Site ID: 367663 Program Number: 0604650	200 CENTER AVE / 2007-12-12	S 1/4 - 1/2 (0.364 mi.)	AY231	472
CIUSSETELLI RESIDENC Spill Number/Closed Date: 0204230 Site ID: 161898 Program Number: 0204230	4 FAIRVIEW PLACE / 2010-07-13	SE 1/4 - 1/2 (0.364 mi.)	230	471
GETTY 58114 Spill Number/Closed Date: 0913713 Site ID: 426673 Program Number: 0913713	<b>340 MAIN STREET</b> / 2010-04-29	NE 1/4 - 1/2 (0.359 mi.)	AX229	464
SPILL NUMBER 0109254 Spill Number/Closed Date: 0109254 Spill Number/Closed Date: 0812107 Site ID: 150939 Site ID: 409713 Program Number: 0109254 Program Number: 0812107		W 1/4 - 1/2 (0.356 mi.)	AZ228	460
RESIDENCE Spill Number/Closed Date: 0512638 Site ID: 358990 Program Number: 0512638	10 LAFAYETTE ST / 2006-03-15	ENE 1/4 - 1/2 (0.355 mi.)	BA227	459
CITIZEN Spill Number/Closed Date: 8708588 Site ID: 135309 Program Number: 8708588	33 GROVE ST / 1989-11-28	W 1/4 - 1/2 (0.352 mi.)	225	457
MICELI HOME Spill Number/Closed Date: 0604103 Site ID: 366997 Program Number: 0604103	194 CENTRE AVE / 2006-10-22	S 1/4 - 1/2 (0.351 mi.)	AY224	456
Spill Number/Closed Date: 8602124 Site ID: 124816 Program Number: 8602124	/ 1989-11-28			

Spill Number/Closed Date: 9201557 / Spill Number/Closed Date: 9210810 / Spill Number/Closed Date: 1001469 / Site ID: 130487 Site ID: 130489 Site ID: 434525 Program Number: 9201557 Program Number: 9210810 Program Number: 1001469	1995-02-09			
GAS STATION Spill Number/Closed Date: 1309599 / Site ID: 490405 Program Number: 1309599	44 ECHO AVE 2014-02-13	ENE 1/4 - 1/2 (0.377 mi.)	BB239	488
FIUMFREDO RESIDENCE Spill Number/Closed Date: 1100096 / Site ID: 447470 Program Number: 1100096	12 BAYVIEW AVE 2011-09-22	ENE 1/4 - 1/2 (0.377 mi.)	240	489
NORTH EVARTS Spill Number/Closed Date: 9913333 / Site ID: 74554 Program Number: 9913333	44 NORTH EVARTS AVE 2005-02-26	SE 1/4 - 1/2 (0.379 mi.)	241	491
APT. BUILDING Spill Number/Closed Date: 9314003 / Spill Number/Closed Date: 9315255 / Site ID: 215702 Site ID: 215703 Program Number: 9314003 Program Number: 9315255		S 1/4 - 1/2 (0.381 mi.)	BD242	492
66 MEMORIAL BLVD Spill Number/Closed Date: 0002907 / Site ID: 59397 Program Number: 0002907	66 MEMORIAL BLVD 2000-10-24	NW 1/4 - 1/2 (0.386 mi.)	245	497
PROFESSIONAL OFFICE Spill Number/Closed Date: 0606014 / Site ID: 369299 Program Number: 0606014	<b>421 HUGUENOT STREET</b> 2007-01-29	SW 1/4 - 1/2 (0.387 mi.)	246	498
GKIDS REALTY Spill Number/Closed Date: 0200337 / Site ID: 235436 Program Number: 0200337	10/12 PINE COURT 2003-12-09	WSW 1/4 - 1/2 (0.387 mi.)	BE248	534
RESIDENCE Spill Number/Closed Date: 9611129 / Site ID: 69656 Program Number: 9611129	14 REVERE RD 1996-12-11	NE 1/4 - 1/2 (0.388 mi.)	249	535
SUNOCO Spill Number/Closed Date: 9514850 / Site ID: 255332 Program Number: 9514850	<b>71 HUGUENOT ST</b> 1996-07-26	NE 1/4 - 1/2 (0.389 mi.)	250	536
TRINITY ARMS APARTME Spill Number/Closed Date: 8905211 / Spill Number/Closed Date: 0811859 /		SSE 1/4 - 1/2 (0.392 mi.)	251	539

Site ID: 283512 Site ID: 409448 Program Number: 8905211 Program Number: 0811859				
RESIDENCE Spill Number/Closed Date: 0310014 / Site ID: 82997 Program Number: 0310014	6 POPLAR ROAD 2012-08-13	S 1/4 - 1/2 (0.393 mi.)	BD252	541
SPILL NUMBER 0009195 Spill Number/Closed Date: 0009195 / Site ID: 63217 Program Number: 0009195	17 POPLAR PL 2001-01-08	S 1/4 - 1/2 (0.401 mi.)	BG257	547
LABELLA RESIDENCE Spill Number/Closed Date: 0601959 / Site ID: 364328 Program Number: 0601959	219 CENTRE AVE 2009-09-01	S 1/4 - 1/2 (0.404 mi.)	BD258	549
SHERIDEN PLAZA Spill Number/Closed Date: 8909204 / Site ID: 80178 Program Number: 8909204	1 SHERIDEN PLAZA 1990-03-07	NNE 1/4 - 1/2 (0.413 mi.)	BH262	553
FUNICELOLO HOME Spill Number/Closed Date: 0509719 / Site ID: 355533 Program Number: 0509719	24 POPLAR PLACE 2006-11-19	S 1/4 - 1/2 (0.415 mi.)	BG263	554
SPILL NUMBER 9908602 Spill Number/Closed Date: 9908602 / Site ID: 283271 Program Number: 9908602	HUGUENOT ST & SOUTH 2000-09-14	SW 1/4 - 1/2 (0.419 mi.)	265	581
MUTUAL BISCUIT COMPA Spill Number/Closed Date: 8708530 / Spill Number/Closed Date: 8707334 / Site ID: 286037 Site ID: 286036 Program Number: 8708530 Program Number: 8707334		NNE 1/4 - 1/2 (0.422 mi.)	BH266	582
RESIDENCE Spill Number/Closed Date: 9506461 / Site ID: 197739 Program Number: 9506461	164 CHURCH STREET 1995-08-28	SSE 1/4 - 1/2 (0.424 mi.)	268	609
SPILL NUMBER 0011198 Spill Number/Closed Date: 0011198 / Spill Number/Closed Date: 9414493 / Site ID: 151446 Site ID: 238808 Program Number: 0011198 Program Number: 9414493		W 1/4 - 1/2 (0.428 mi.)	270	629
BELIVE HOME Spill Number/Closed Date: 0413182 / Spill Number/Closed Date: 0500819 / Site ID: 339043 Site ID: 343902		WSW 1/4 - 1/2 (0.433 mi.)	BI271	632

Program Number: 0413182 Program Number: 0500819				
DEFENDER MARINE SUPP Spill Number/Closed Date: 9806235 / Site ID: 93459 Program Number: 9806235	309 MAIN ST 2002-09-19	NE 1/4 - 1/2 (0.434 mi.)	BJ272	634
DIMATTOE TTF Spill Number/Closed Date: 1301890 / Site ID: 482303 Program Number: 1301890	55 MAY STREET 2013-08-08	NNW 1/4 - 1/2 (0.436 mi.)	273	635
SPILL NUMBER 0208792 Spill Number/Closed Date: 0208792 / Site ID: 71430 Program Number: 0208792	386 NORTH AV 2002-11-26	NNW 1/4 - 1/2 (0.439 mi.)	BK274	636
DEMELIA - TTF Spill Number/Closed Date: 1406916 / Site ID: 500408 Program Number: 1406916	95 WASHINGTON AVE 2015-04-14	WNW 1/4 - 1/2 (0.443 mi.)	BL275	638
CANDREA/GALLETTA RES Spill Number/Closed Date: 1202322 / Site ID: 465083 Program Number: 1202322	35 CHARLES ST 2012-09-13	W 1/4 - 1/2 (0.444 mi.)	BM276	639
JASON PARTNERS LTD Spill Number/Closed Date: 0211105 / Site ID: 86967 Program Number: 0211105	675 MAIN ST 2003-03-26	SW 1/4 - 1/2 (0.448 mi.)	BN277	640
MERLUCCI RESIDENCE Spill Number/Closed Date: 1103221 / Site ID: 450778 Program Number: 1103221	30 CHARLES STREET 2011-11-14	W 1/4 - 1/2 (0.449 mi.)	BM278	641
SPILL NUMBER 0007965 Spill Number/Closed Date: 0007965 / Site ID: 61314 Program Number: 0007965	45 CHARLES ST 2000-10-26	W 1/4 - 1/2 (0.450 mi.)	BM279	643
SPILL NUMBER 0104402 Spill Number/Closed Date: 0104402 / Site ID: 328750 Program Number: 0104402	30 LINCOLN ST 2001-11-14	NE 1/4 - 1/2 (0.452 mi.)	280	644
NELSTAD MATERIAL COR Spill Number/Closed Date: 0208898 / Site ID: 200280 Program Number: 0208898	<b>40 HUNTINGTON PL</b> 2004-05-03	ENE 1/4 - 1/2 (0.456 mi.)	281	645
KGM PROPERTY ASSOC. Spill Number/Closed Date: 9202033 / Site ID: 69270 Program Number: 9202033	394 N. AVE. 1993-01-27	NNW 1/4 - 1/2 (0.458 mi.)	BK282	648
KGM REALTY CO. Spill Number/Closed Date: 9201744 / Site ID: 89642 Program Number: 9201744	396 NORTH AVE. 1993-01-27	NNW 1/4 - 1/2 (0.460 mi.)	BK283	650
GETTY# 677	381 NORTH AVE	NNW 1/4 - 1/2 (0.461 mi.)	BO284	651

Spill Number/Closed Date: 0400912 / Site ID: 242546 Program Number: 0400912	2005-01-18			
6 WEBSTER Spill Number/Closed Date: 0403816 / Site ID: 81655 Program Number: 0403816	6 WEBSTER AVE 2004-10-08	SW 1/4 - 1/2 (0.461 mi.)	BN285	657
BRAM REALTY Spill Number/Closed Date: 0902464 / Site ID: 414506 Program Number: 0902464	105 WASHINGTON AVE 2010-02-01	WNW 1/4 - 1/2 (0.462 mi.)	BL286	658
RESIDENCE Spill Number/Closed Date: 0107187 / Site ID: 204562 Program Number: 0107187	98 LIBERTY AVE 2002-01-11	SSW 1/4 - 1/2 (0.462 mi.)	287	659
BUSINESS COMPLEX Spill Number/Closed Date: 9912136 / Site ID: 86196 Program Number: 9912136	55 WEBSTER AVE 2000-05-11	WSW 1/4 - 1/2 (0.465 mi.)	288	661
SPILL NUMBER 0012427 Spill Number/Closed Date: 0012427 / Site ID: 104510 Program Number: 0012427	22 LAUREL PL 2001-05-10	SW 1/4 - 1/2 (0.466 mi.)	289	662
LIPMAN RESIDENCE Spill Number/Closed Date: 0409061 / Site ID: 333699 Program Number: 0409061	54 LIBERTY AVE 2005-04-02	SSW 1/4 - 1/2 (0.467 mi.)	290	663
SPILL NUMBER 0300463 Spill Number/Closed Date: 0300463 / Site ID: 202585 Program Number: 0300463	<b>52 LINCOLN ST</b> 2003-04-14	NNE 1/4 - 1/2 (0.468 mi.)	291	664
BUSINESS Spill Number/Closed Date: 9411669 / Site ID: 172950 Program Number: 9411669	88 GROVE AVE. 2010-04-28	W 1/4 - 1/2 (0.471 mi.)	BP292	666
COMMERCIAL BUILDING Spill Number/Closed Date: 9411598 / Site ID: 113133 Program Number: 9411598	88-90 GROVE AVE. 2010-04-28	W 1/4 - 1/2 (0.471 mi.)	BP293	667
FRANKA INC. Spill Number/Closed Date: 9312205 / Site ID: 176106 Program Number: 9312205	132-143 UNION AVE. 1995-11-09	W 1/4 - 1/2 (0.475 mi.)	294	669
AMOCO SERVICE STATIO Spill Number/Closed Date: 0209490 / Spill Number/Closed Date: 0212950 / Spill Number/Closed Date: 8604411 / Site ID: 274754 Site ID: 274755 Site ID: 274757	2003-04-01	SW 1/4 - 1/2 (0.476 mi.)	295	670

Program Number: 0209490

Program Number: 0212950 Program Number: 8604411

Program Number: 8604411				
MUNCIPAL MARINA Spill Number/Closed Date: 9108518 / Spill Number/Closed Date: 0401082 / Spill Number/Closed Date: 0406232 / Site ID: 142427 Site ID: 303089 Site ID: 303090 Program Number: 9108518 Program Number: 0401082 Program Number: 0406232	2004-06-16	E 1/4 - 1/2 (0.477 mi.)	296	682
OAKHURST GARDENS OWN Spill Number/Closed Date: 8907948 / Site ID: 268980 Program Number: 8907948	100 PELHAM ROAD 1991-05-08	ESE 1/4 - 1/2 (0.480 mi.)	297	691
DIPASQUALE PROPERTY Spill Number/Closed Date: 1103122 / Site ID: 450672 Program Number: 1103122	400 NORTH AVE 2012-04-26	NNW 1/4 - 1/2 (0.480 mi.)	BO298	692
SPILL NUMBER 9803423 Spill Number/Closed Date: 9803423 / Site ID: 140786 Program Number: 9803423	106 LIBERTY AV 1998-08-18	SSW 1/4 - 1/2 (0.481 mi.)	BQ299	693
COLLEGE OF NEW ROCHE Spill Number/Closed Date: 9809357 / Site ID: 118985 Program Number: 9809357	103 LIBERTY AVE 2005-04-17	SSW 1/4 - 1/2 (0.486 mi.)	BQ300	694
RITACCO HOME Spill Number/Closed Date: 0600187 / Site ID: 362141 Program Number: 0600187	24 JACKSON STREET 2006-07-28	NE 1/4 - 1/2 (0.487 mi.)	301	696
KLING Spill Number/Closed Date: 0308565 / Site ID: 214235 Program Number: 0308565	<b>108 VAN GUILDER AVE</b> 2005-02-12	WNW 1/4 - 1/2 (0.499 mi.)	302	697
BLANCO RESIDENCE Spill Number/Closed Date: 9802704 / Site ID: 227988 Program Number: 9802704	30 LINDEN PLACE 1998-07-30	SSW 1/4 - 1/2 (0.500 mi.)	303	700

#### State and tribal registered storage tank lists

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, has revealed that there are 30 NY UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
NEW ROCHELLE PUBLIC Database: WESTCHESTER CO. US Status: 1. In-Service Id/Status:: 3-601216 Site Status: Active	ONE LIBRARY PLAZA ST, Date of Government Version: 02/	SE 0 - 1/8 (0.015 mi.) 19/2016	A3	10
LAWTON STREET REALTY Database: WESTCHESTER CO. US Status: 1. In-Service Id/Status:: 3-801435 Site Status: Active	41-43 LAWTON STREET ST, Date of Government Version: 02/7		G27	67
RPM REALTY INC Database: WESTCHESTER CO. US Status: 5. Closed - removed Id/Status:: 3-166189 Site Status: Active	9-15 DIVISION STREET ST, Date of Government Version: 02/ <sup>,</sup>	· · · · · · · · · · · · · · · · · · ·	K45	98
AVALON ON THE SOUND Database: WESTCHESTER CO. US Status: 5. Closed - removed Id/Status:: 3-800626 Site Status: Unregulated: <1101 gal	HUGUENOT STREET AND ST, Date of Government Version: 02/ . PBS	, , , , , , , , , , , , , , , , , , ,	O70	134
NEW ROCHELLE IRISH B Database: WESTCHESTER CO. US Status: 5. Closed - removed Id/Status:: 3-600097 Site Status: Unregulated	38 DIVISION STREET ST, Date of Government Version: 02/ <sup>,</sup>	W 0 - 1/8 (0.119 mi.) 19/2016	N75	139
LILLIAN VERNON CORPO Database: WESTCHESTER CO. US Status: 5. Closed - removed Id/Status:: 3-600279 Site Status: Unregulated: <1101 gal	543-549 MAIN STREET ST, Date of Government Version: 02/ . PBS	· · · · · · · · · · · · · · · · · · ·	R86	169
543 MAIN STREET Database: WESTCHESTER CO. US Status: 5. Closed - removed Id/Status:: 3-801106 Site Status: Unregulated: <1101 gal	543 MAIN STREET ST, Date of Government Version: 02/ . PBS	SW 0 - 1/8 (0.124 mi.) 19/2016	R87	170
542 MAIN STREET LLC Database: WESTCHESTER CO. US Status: 1. In-Service Id/Status:: 3-800617 Site Status: Active	542 MAIN STREET ST, Date of Government Version: 02/	SW 1/8 - 1/4 (0.132 mi.) 19/2016	Q91	176
BLOOMINGDALE PARKING Database: WESTCHESTER CO. US Status: 4. Closed - in place Id/Status:: 3-600330 Site Status: Unregulated: <1101 gal	554 MAIN ST ST, Date of Government Version: 02/ . PBS	SW 1/8 - 1/4 (0.153 mi.) 19/2016	U105	213
CERUSSI AND VERE Database: WESTCHESTER CO. US Status: 0. Administratively closed Id/Status:: 3-078360 Site Status: Administratively Closed	306 HUGUENOT ST ST, Date of Government Version: 02/	WSW 1/8 - 1/4 (0.156 mi.) 19/2016	X114	226
TRINITY-ST. PAUL'S E Database: WESTCHESTER CO. U	311 HUGUENOT STREET ST, Date of Government Version: 02/	W 1/8 - 1/4 (0.159 mi.) 19/2016	X119	232

	Status: 4. Closed - in place Id/Status:: 3-801006 Site Status: Unregulated: <1101 gal. PBS				
М	J. HACKER & SONS I Database: WESTCHESTER CO. UST, Da Status: 8. Unregistered Status: 5. Closed - removed Status: 3. Closed - Prior to 04/1991 Id/Status:: 3-137979 Site Status: Unregulated	64 CENTRE AVE te of Government Version: 02/19	WSW 1/8 - 1/4 (0.167 mi.) /2016	Z122	234
SI	EASONWEIN MANAGEMEN Database: WESTCHESTER CO. UST, Da Status: 1. In-Service Id/Status:: 3-169773 Site Status: Active		WSW 1/8 - 1/4 (0.180 mi.) /2016	AD132	246
7:	<b>CENTRE AVENUE LLC</b> Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Id/Status:: 3-800240 Site Status: Active	<b>75 CENTRE AVENUE</b> te of Government Version: 02/19	<b>SW 1/8 - 1/4 (0.188 mi.)</b> /2016	Z139	271
C	ENTRE MAIN EQUITIES Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Id/Status:: 3-800238 Site Status: Active	573-579 MAIN STREET te of Government Version: 02/19	· /	AE152	296
V	ERIZON NEW YORK INC Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Status: 1. In-Service Id/Status:: 3-184586 Site Status: Active	342 HUGUENOT STREET te of Government Version: 02/19	, , ,	AI158	319
	Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Status: 1. In-Service Id/Status:: 3-184586		, , ,	AI158 Map ID	319 Page
L	Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Status: 1. In-Service Id/Status:: 3-184586 Site Status: Active	te of Government Version: 02/19 Address 481 MAIN ST	/2016 Direction / Distance E 0 - 1/8 (0.036 mi.)		
L	Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Status: 1. In-Service Id/Status:: 3-184586 Site Status: Active <b>ower Elevation</b> ETTNER MANAGEMENT C Database: WESTCHESTER CO. UST, Da Status: 0. Administratively closed Status: 1. In-Service Id/Status:: 3-255033	te of Government Version: 02/19 Address 481 MAIN ST te of Government Version: 02/19 200 NORTH AVENUE	/2016 Direction / Distance E 0 - 1/8 (0.036 mi.) /2016 NE 0 - 1/8 (0.047 mi.)	<u>Map ID</u>	Page
L RI B/	Database: WESTCHESTER CO. UST, Da Status: 5. Closed - removed Status: 1. In-Service Id/Status:: 3-184586 Site Status: Active <b>ower Elevation</b> ETTNER MANAGEMENT C Database: WESTCHESTER CO. UST, Da Status: 0. Administratively closed Status: 1. In-Service Id/Status:: 3-255033 Site Status: Active ARON MANAGEMENT Database: WESTCHESTER CO. UST, Da Status: 0. Administratively closed Id/Status:: 3-167843	Address 481 MAIN ST te of Government Version: 02/19 200 NORTH AVENUE te of Government Version: 02/19 THE MALL	/2016 Direction / Distance E 0 - 1/8 (0.036 mi.) /2016 NE 0 - 1/8 (0.047 mi.) /2016	Map ID B9	Page 22

Status: 5. Closed - removed Id/Status:: 3-185515 Site Status: Unregulated				
30 CLINTON PLACE OWN Database: WESTCHESTER CO. UST, D Status: 5. Closed - removed Id/Status:: 3-078727 Site Status: Active	30 CLINTON PLACE ate of Government Version: 02/19	, ,	L66	125
UNITED STATES POST O Database: WESTCHESTER CO. UST, D Status: 0. Administratively closed Status: 1. In-Service Id/Status:: 3-448699 Site Status: Unregulated: <1101 gal. PBS			T104	212
S.B.J. ASSOCIATES Database: WESTCHESTER CO. UST, D Status: 1. In-Service Id/Status:: 3-800080 Site Status: Active	38 LOCUST AVENUE ate of Government Version: 02/19	ESE 1/8 - 1/4 (0.156 mi.) /2016	W111	222
NEW ROCHELLE MALL Database: WESTCHESTER CO. UST, D Status: 4. Closed - in place Id/Status:: 3-600042 Site Status: Unregulated: <1101 gal. PBS			V120	233
KAUFMAN HUGUENOT COM	271 NORTH AVENUE	NNW 1/8 - 1/4 (0.173 mi.)	125	238
Database: WESTCHESTER CO. UST, D Status: 4. Closed - in place Id/Status:: 3-183776 Site Status: Active	ate of Government Version: 02/19	/2016		
Status: 4. Closed - in place Id/Status:: 3-183776	270 NORTH AVENUE - U	NNW 1/8 - 1/4 (0.206 mi.)	AH157	318
Status: 4. Closed - in place Id/Status:: 3-183776 Site Status: Active NORTH BROOK REALTY A Database: WESTCHESTER CO. UST, D Status: 1. In-Service Id/Status:: 3-600117	270 NORTH AVENUE - U ate of Government Version: 02/19 277 NORTH AVENUE	NNW 1/8 - 1/4 (0.206 mi.) /2016 NNW 1/8 - 1/4 (0.214 mi.)		318 335
Status: 4. Closed - in place Id/Status:: 3-183776 Site Status: Active NORTH BROOK REALTY A Database: WESTCHESTER CO. UST, D Status: 1. In-Service Id/Status:: 3-600117 Site Status: Active 277 NORTH LLC Database: WESTCHESTER CO. UST, D Status: 1. In-Service Status: 5. Closed - removed Id/Status:: 3-502049	270 NORTH AVENUE - U ate of Government Version: 02/19 277 NORTH AVENUE ate of Government Version: 02/19 60-70 LOCUST AVENUE	NNW 1/8 - 1/4 (0.206 mi.) /2016 NNW 1/8 - 1/4 (0.214 mi.) /2016 ESE 1/8 - 1/4 (0.222 mi.)	AH165	
Status: 4. Closed - in place Id/Status:: 3-183776 Site Status: Active NORTH BROOK REALTY A Database: WESTCHESTER CO. UST, D Status: 1. In-Service Id/Status:: 3-600117 Site Status: Active 277 NORTH LLC Database: WESTCHESTER CO. UST, D Status: 1. In-Service Status: 5. Closed - removed Id/Status:: 3-502049 Site Status: Active 60-70 OWNERS CORP. Database: WESTCHESTER CO. UST, D Status: 1. In-Service Id/Status:: 3-413925	270 NORTH AVENUE - U ate of Government Version: 02/19 277 NORTH AVENUE ate of Government Version: 02/19 60-70 LOCUST AVENUE ate of Government Version: 02/19 44 FRANKLIN AVENUE	NNW 1/8 - 1/4 (0.206 mi.) /2016 NNW 1/8 - 1/4 (0.214 mi.) /2016 ESE 1/8 - 1/4 (0.222 mi.) /2016	AH165	335

Status: 5. Closed - removed Id/Status:: 3-801137 Site Status: Administratively Closed

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, has revealed that there are 18 NY AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
RPM REALTY INC Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-166189	9-15 DIVISION STREET AST, Date of Government Version: 02/19,	SW 0 - 1/8 (0.096 mi.) /2016	K46	99
NEW ROCHELLE SUPERMA Database: WESTCHESTER CO. Status: 5. Closed - removed PBS Number: 3-166995	538 MAIN STREET AST, Date of Government Version: 02/19,	SSW 0 - 1/8 (0.124 mi.) /2016	Q85	169
306 HUGUENOT STREET Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-800236	306 HUGUENOT STREET AST, Date of Government Version: 02/19,	· · · · · · · · · · · · · · · · · · ·	X115	226
75 CENTRE AVENUE LLC Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-800240	<b>75 CENTRE AVENUE</b> AST, Date of Government Version: 02/19,	<b>SW 1/8 - 1/4 (0.188 mi.)</b> /2016	Z139	271
CENTRE MAIN EQUITIES Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-800238	573-579 MAIN STREET AST, Date of Government Version: 02/19,	, ,	AE152	296
VERIZON NEW YORK INC Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-184586	342 HUGUENOT STREET AST, Date of Government Version: 02/19,		AI158	319
HOUDEHOI HOEDHOO, E	347 HUGUENOT STREET AST, Date of Government Version: 02/19,		AI169	340
CENTRE AVENUE APARTM Database: WESTCHESTER CO. Status: 1. In-Service PBS Number: 3-165735	130 CENTRE AVENUE AST, Date of Government Version: 02/19,		AL182	359
Lower Elevation	Address	Direction / Distance	Map ID	Page
MKM EQUITY, LLC Database: WESTCHESTER CO. Status: 5. Closed - removed PBS Number: 3-600105	230 NORTH AVENUE AST, Date of Government Version: 02/19,	N 0 - 1/8 (0.080 mi.) /2016	H33	75
SINNOTT MANAGEMENT C Database: WESTCHESTER CO.	35 CLINTON PLACE AST, Date of Government Version: 02/19,	SE 0 - 1/8 (0.103 mi.) /2016	L54	112

Status: 1. In-Service PBS Number: 3-078646				
ANDERSON DEVELOPMENT Database: WESTCHESTER CO. AST, Da Status: 6. Closed - Work Permit Open PBS Number: 3-185515			H58	115
30 CLINTON PLACE OWN Database: WESTCHESTER CO. AST, Da Status: 4. Closed - in place Status: 1. In-Service PBS Number: 3-078727	30 CLINTON PLACE ate of Government Version: 02/19	· · ·	L66	125
MONROE COLLEGE Database: WESTCHESTER CO. AST, Da Status: 0. Administratively closed Status: 5. Closed - removed Status: 1. In-Service PBS Number: 3-800251	420 MAIN STREET ate of Government Version: 02/19		V123	236
KAUFMAN HUGUENOT COM Database: WESTCHESTER CO. AST, Da Status: 1. In-Service PBS Number: 3-183776			125	238
TWIN PARK EQUITIES L Database: WESTCHESTER CO. AST, Da Status: 1. In-Service PBS Number: 3-800234	55/59 LOCUST AVENUE ate of Government Version: 02/19		AB130	244
PROSPECT ROCHELLE RE Database: WESTCHESTER CO. AST, Da Status: 1. In-Service PBS Number: 3-171158		, , ,	AC131	245
TRIPLE A PROPERTIES, Database: WESTCHESTER CO. AST, Da Status: 1. In-Service PBS Number: 3-165727			154	299
1 HARRISON REALTY, L Database: WESTCHESTER CO. AST, Da Status: 1. In-Service PBS Number: 3-191922			AM180	357

### State and tribal Brownfields sites

NY BROWNFIELDS: Brownfields Site List

A review of the NY BROWNFIELDS list, as provided by EDR, and dated 05/17/2016 has revealed that there are 3 NY BROWNFIELDS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
OFF-SITE FLAMINGO CL Site Code: 414661	149 NORTH AVENUE	ESE 0 - 1/8 (0.122 mi.)	L80	145
FLAMINGO CLEANERS	149 NORTH AVE	ESE 0 - 1/8 (0.122 mi.)	L81	146

Site Code: 335220 SCHMUCKLER'S DRY CLE Site Code: 357446

358-364 NORTH AVENUE

NNW 1/4 - 1/2 (0.372 mi.) 233

475

#### ADDITIONAL ENVIRONMENTAL RECORDS

#### **Records of Emergency Release Reports**

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 08/16/2016 has revealed that there are 23 NY Spills sites within approximately 0.125 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ATTACK PESTICIDES Spill Number/Closed Date: 0335020 / spillno: 0335020 Site ID: 274095	498 MAIN STREET 2005-02-27	S 0 - 1/8 (0.037 mi.)	C10	23
DOLLAR BEST Spill Number/Closed Date: 1304701 / spillno: 1304701 Site ID: 485236	506 MAIN ST 2013-10-10	SSW 0 - 1/8 (0.048 mi.)	D14	27
COMMERCIAL PROPERTY Spill Number/Closed Date: 0600054 / spillno: 0600054 Site ID: 361977	518,522&525 MAIN STR 2011-01-13	SSW 0 - 1/8 (0.069 mi.)	D26	66
PAVEMENT Spill Number/Closed Date: 1203965 / spillno: 1203965 Site ID: 466814	41 LAWTON STREET 2012-07-23	NW 0 - 1/8 (0.073 mi.)	G28	68
ARIEL CABLE Spill Number/Closed Date: 0804960 / spillno: 0804960 Site ID: 401964	19 DIVISION STREET/W 2008-08-16	WSW 0 - 1/8 (0.098 mi.)	K49	102
SIDNEY FURNITURE Spill Number/Closed Date: 1509029 / spillno: 1509029 Site ID: 517634	535 MAIN ST 2015-12-04	SW 0 - 1/8 (0.101 mi.)	K50	103
535 MAIN ST ASSOCIAT Spill Number/Closed Date: 9900400 / Spill Number/Closed Date: 9415294 / spillno: 9415294 spillno: 9900400 Site ID: 251083 Site ID: 81102		SW 0 - 1/8 (0.101 mi.)	K51	104
CABLE	29 DIVISION STREET	WSW 0 - 1/8 (0.104 mi.)	N57	114

Spill Number/Closed Date: 0804961 / spillno: 0804961 Site ID: 401965	2008-07-30			
MEMORIAL HIGHWAY AND Spill Number/Closed Date: 9912617 / spillno: 9912617 Site ID: 254637	HUGUNOT ST 2000-04-04	WNW 0 - 1/8 (0.105 mi.)	O63	122
ROAD Spill Number/Closed Date: 0606187 / spillno: 0606187 Site ID: 369495	HUGUENOT ST/DIVISION 2006-09-03	W 0 - 1/8 (0.120 mi.)	P78	142
BLUE GILL REALTY Spill Number/Closed Date: 9212475 / spillno: 9212475 Site ID: 125220	<b>543 MAIN ST</b> 2004-05-12	SW 0 - 1/8 (0.124 mi.)	R88	171
Lower Elevation	Address	Direction / Distance	Map ID	Page
LORDAE PROPERTIES - Spill Number/Closed Date: 1311131 / spillno: 1311131 Site ID: 492016	484 MAIN ST 2014-09-23	ESE 0 - 1/8 (0.030 mi.)	B7	20
OFFICE BLDG Spill Number/Closed Date: 0510734 / spillno: 0510734 Site ID: 356765	481 MAIN STREET 2008-12-18	E 0 - 1/8 (0.036 mi.)	B8	21
NEW ROCHELLE MALL Spill Number/Closed Date: 8900500 / spillno: 8900500 Site ID: 210797	MAIN & NORTH ST 1989-04-17	ENE 0 - 1/8 (0.054 mi.)	E17	33
MAIN ST. & NORTH AVE Spill Number/Closed Date: 9405214 / spillno: 9405214 Site ID: 308433	MAIN ST. & NORTH AVE 1994-07-19	ENE 0 - 1/8 (0.054 mi.)	E18	34
ON ROAD Spill Number/Closed Date: 9405242 / spillno: 9405242 Site ID: 171382	MAIN & NORTH AVE. 1994-07-19	ENE 0 - 1/8 (0.054 mi.)	E19	35
CONCRETE FLOORING WI Spill Number/Closed Date: 1400277 / spillno: 1400277 Site ID: 493512	230 NORTH AVENUE Not Reported	N 0 - 1/8 (0.080 mi.)	H32	74
COMMERCIAL - UST Spill Number/Closed Date: 1603310 / spillno: 1603310 Site ID: 529764	455 MAIN ST Not Reported	ENE 0 - 1/8 (0.095 mi.)	J44	97
DEVITO RESIDENCE Spill Number/Closed Date: 0805939 / spillno: 0805939 Site ID: 403155	168 NORTH AVE 2009-01-07	ESE 0 - 1/8 (0.097 mi.)	148	101
SPILL NUMBER 0001159	35 CLINTON PL	SE 0 - 1/8 (0.103 mi.)	L55	113

Spill Number/Closed Date: 0001159 / spillno: 0001159 Site ID: 230601	2000-05-01			
MH1204 Spill Number/Closed Date: 9912755 / spillno: 9912755 Site ID: 262084	HUGUENOT AVE/LAWTON 2000-02-14	NW 0 - 1/8 (0.112 mi.)	72	135
SOIL Spill Number/Closed Date: 1107221 / spillno: 1107221 Site ID: 454913	12 LOCUST AVE Not Reported	ENE 0 - 1/8 (0.117 mi.)	74	138
REMEDIATION SITE #C3 Spill Number/Closed Date: 1203976 / spillno: 1203976 Site ID: 466831	149 NORTH AVE 2013-12-09	ESE 0 - 1/8 (0.122 mi.)	L79	143

#### Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/21/2016 has revealed that there are 40 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ADREAN PRINTING CO	490 MAIN ST	SSE 0 - 1/8 (0.029 mi.)	C6	14
CON EDISON MANHOLE:	MAIN ST & CHURCH ST	SSW 0 - 1/8 (0.055 mi.)	D20	36
CON EDISON TRANSFORM	CHURCH ST & MAIN ST	SSW 0 - 1/8 (0.055 mi.)	D21	38
CON EDISON TRANSFORM	MAIN ST & CHRUCH ST	SSW 0 - 1/8 (0.055 mi.)	D22	40
ACCESSOCRAFT PRODUCT	48 LAWTON ST	NW 0 - 1/8 (0.081 mi.)	G34	76
NYSDOT BIN 1049890	DIVISION ST OVER MET	W 1/8 - 1/4 (0.126 mi.)	89	173
ROTH CLEANERS	1 LEROY PL	SSW 1/8 - 1/4 (0.133 mi.)	S93	178
CON EDISON TRANSFORM	<b>DIVISION ST &amp; HUGUEN</b>	W 1/8 - 1/4 (0.134 mi.)	P96	199
CON EDISON MANHOLE:	HUGENOT AVE & DIVISI	W 1/8 - 1/4 (0.134 mi.)	P101	205
CON EDISON TRANSFORM	CENTRE AVE & MAIN ST	SW 1/8 - 1/4 (0.191 mi.)	AF142	277
CON EDISON	HUGUENOT ST & CENTRE	WSW 1/8 - 1/4 (0.192 mi.)	AD147	285
NEW YORK TELEPHONE C	342 HUGUENOT ST	WSW 1/8 - 1/4 (0.208 mi.)	AI159	321
CON EDISON SERVICE B	LEROY PL & CENTER AV	SSW 1/8 - 1/4 (0.210 mi.)	AJ161	329
CON EDISON SERVICE B	CENTRE AVE & LEROY	SSW 1/8 - 1/4 (0.210 mi.)	AJ162	331
CON EDISON TRANSFORM	592 MAIN ST	SW 1/8 - 1/4 (0.246 mi.)	194	400
Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON	230 NORTH AVE	N 0 - 1/8 (0.080 mi.)	H31	73
CON EDISON SERVICE B	174 NORTH AVE	ESE 0 - 1/8 (0.084 mi.)	135	83
CON EDISON TRANSFORM	NORTH AVE & ANDERSON	N 0 - 1/8 (0.088 mi.)	H36	85
CON EDISON	NORTH AVE & ANDERSON	N 0 - 1/8 (0.088 mi.)	H39	92
CON EDISON MANHOLE:	NORTH AVE & CLINTON	ESE 0 - 1/8 (0.108 mi.)	L67	127
CON EDISON SERVICE B	NORTH AVE & CLINTON	ESE 0 - 1/8 (0.108 mi.)	L68	129
FEDERAL PROPERTY MAI	244 NORTH AVE SUITE	N 0 - 1/8 (0.112 mi.)	71	134

#### Lower Elevation

Lower Elevation	Address	Direction / Distance	Map ID	Page
COLONIAL CLEANERS CO	149 NORTH AVE	ESE 0 - 1/8 (0.122 mi.)	L84	167
US POSTAL SERVICE	255 NORTH AVE	NNW 1/8 - 1/4 (0.144 mi.)	T103	209
CON EDISON TRANSFORM	NORTH AVE & HUGUENOT	NNW 1/8 - 1/4 (0.155 mi.)	T108	216
CON EDISON MANHOLE:	HUGENUOT ST & NORTH	NNW 1/8 - 1/4 (0.155 mi.)	T109	219
CON EDISON MANHOLE:	HUGUENOT AVE & NORTH	NNW 1/8 - 1/4 (0.155 mi.)	T110	219
CON EDISON MANHOLE:	NORTH AVE & BONNEFOY	SE 1/8 - 1/4 (0.157 mi.)	Y117	229
CON EDISON MANHOLE 1	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG149	287
CON EDISON MANHOLE 1	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG150	291
NYSDOT BIN 1091390	<b>DIVISION ST OVER I 9</b>	WNW 1/8 - 1/4 (0.198 mi.)	153	298
CON EDISON MANHOLE:	277 NORTH AVE	NNW 1/8 - 1/4 (0.214 mi.)	AH168	338
CON EDISON	HARRISON ST & MAIN S	NE 1/8 - 1/4 (0.229 mi.)	AM176	350
CON EDISON MANHOLE:	MAIN ST & HARRISON S	NE 1/8 - 1/4 (0.229 mi.)	AM177	351
CON EDISON TRANSFORM	CENTRE AVE & RELYEA	WSW 1/8 - 1/4 (0.230 mi.)	AN178	353
CON EDISON TRANSFORM	CENTRE AVE & RELYEA	WSW 1/8 - 1/4 (0.230 mi.)	AN179	355
FIRST METRO SERVICES	357 HUGONOT ST	WSW 1/8 - 1/4 (0.236 mi.)	AO183	360
CON EDISON	HARRISON ST & FOUNTA	NE 1/8 - 1/4 (0.238 mi.)	AP188	374
CON EDISON	HARRISON ST & CEDER	NE 1/8 - 1/4 (0.240 mi.)	AP189	375
MR CHIMNEY CLEAN	32 RELYEA PL	WSW 1/8 - 1/4 (0.250 mi.)	AQ195	402

NY DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the NY DRYCLEANERS list, as provided by EDR, and dated 03/31/2016 has revealed that there are 7 NY DRYCLEANERS sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ROTH CLEANERS Facility Id: 3-5510-00292	1 LEROY PL	SSW 1/8 - 1/4 (0.133 mi.)	S93	178
HANGERS CLEANERS Facility Id: 3-5510-00358	562-564 MAIN STREET	SW 1/8 - 1/4 (0.171 mi.)	U124	238
GREEN HEAVEN/CENTRE Facility Id: 3-5510-00298	62 CENTRE AVE.	WSW 1/8 - 1/4 (0.181 mi.)	Z135	250
Lower Elevation	Address	Direction / Distance	Map ID	Page
Lower Elevation SPEEDY CLEANERS Facility Id: 3-5510-00344	Address 217 NORTH AVENUE	Direction / Distance NNE 0 - 1/8 (0.066 mi.)	Map ID F24	Page 44
SPEEDY CLEANERS			<b>·</b>	

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 08/01/2016 has revealed that there are 67 NY MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ADREAN PRINTING CO	490 MAIN ST	SSE 0 - 1/8 (0.029 mi.)	C6	14

EPA ID: NY0000233981				
CON EDISON MANHOLE: EPA ID: NYP004478624	MAIN ST & CHURCH ST	SSW 0 - 1/8 (0.055 mi.)	D20	36
CON EDISON TRANSFORM EPA ID: NYP004478517	CHURCH ST & MAIN ST	SSW 0 - 1/8 (0.055 mi.)	D21	38
CON EDISON TRANSFORM EPA ID: NYP004364576	MAIN ST & CHRUCH ST	SSW 0 - 1/8 (0.055 mi.)	D22	40
CON EDISON EPA ID: NYP004680070	MAIN ST & CHURCH ST	SSW 0 - 1/8 (0.055 mi.)	D23	43
ACCESSOCRAFT PRODUCT EPA ID: NYR000014753	48 LAWTON ST	NW 0 - 1/8 (0.081 mi.)	G34	76
CON EDISON EPA ID: NYP004872319	DIVISION ST & MAIN S	SW 0 - 1/8 (0.103 mi.)	K52	106
CONSOLIDATED EDISON EPA ID: NYP004123873	DIVISION & MAIN	SW 0 - 1/8 (0.103 mi.)	K53	108
CONSOLIDATED EDISON EPA ID: NYP004151221	MEMORIAL HIGHWAY & H	WNW 0 - 1/8 (0.117 mi.)	073	137
ROTH CLEANERS EPA ID: NYD078706686	1 LEROY PL	SSW 1/8 - 1/4 (0.133 mi.)	S93	178
CONSOLIDATED EDISON EPA ID: NYP004124210	DIVISION ST & LEROY	S 1/8 - 1/4 (0.133 mi.)	S94	196
CON EDISON EPA ID: NYP004677894	HUGENOT ST & DIVISIO	W 1/8 - 1/4 (0.134 mi.)	P95	197
CON EDISON EPA ID: NYP004677548	HUGENOT & DIVISION S	W 1/8 - 1/4 (0.134 mi.)	P98	201
CON EDISON EPA ID: NYP004676847	DIVISION & HUGUENOT	W 1/8 - 1/4 (0.134 mi.)	P99	203
CON ED EPA ID: NYP004353199	DIVISION ST & HUGENO	W 1/8 - 1/4 (0.134 mi.)	P100	204
CON EDISON MANHOLE: EPA ID: NYP004317285	HUGENOT AVE & DIVISI	W 1/8 - 1/4 (0.134 mi.)	P101	205
GREEN HEAVEN CLEANER EPA ID: NYD982531634	62 CENTRE STREET	WSW 1/8 - 1/4 (0.181 mi.)	Z136	250
CON ED EPA ID: NYP004760815	CENTRE AVE & MAIN ST	SW 1/8 - 1/4 (0.191 mi.)	AF141	274
CON EDISON TRANSFORM EPA ID: NYP004315198	CENTRE AVE & MAIN ST	SW 1/8 - 1/4 (0.191 mi.)	AF142	277
CON EDISON EPA ID: NYP004658019	MAIN ST & CENTRE ST	SW 1/8 - 1/4 (0.191 mi.)	AF143	280
CON EDISON EPA ID: NYP004676839	CENTER & HUGUENOT	WSW 1/8 - 1/4 (0.192 mi.)	AD144	281
CON EDISON EPA ID: NYP004677530	HUGENOT & CENTRE ST	WSW 1/8 - 1/4 (0.192 mi.)	AD145	282
CON EDISON EPA ID: NYP004332961	CENTRE AVE & HUGUENO	WSW 1/8 - 1/4 (0.192 mi.)	AD146	284
ERIC S TURNER & CO I	33-35 CENTRE AVE	WSW 1/8 - 1/4 (0.203 mi.)	AD156	302

EPA ID: NYD002015402				<b>a</b> a <i>i</i>
NEW YORK TELEPHONE C EPA ID: NYD986961605	342 HUGUENOT ST	WSW 1/8 - 1/4 (0.208 mi.)	AI159	321
CON EDISON SERVICE B EPA ID: NYP004475687	LEROY PL & CENTER AV	SSW 1/8 - 1/4 (0.210 mi.)	AJ161	329
CON EDISON EPA ID: NYP004517694	CENTRE AVE & LEROY	SSW 1/8 - 1/4 (0.210 mi.)	AJ163	332
CON EDISON TRANSFORM EPA ID: NYP004357059	592 MAIN ST	SW 1/8 - 1/4 (0.246 mi.)	194	400
Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON EPA ID: NYP004772265	208 NORTH AVE	NNE 0 - 1/8 (0.051 mi.)	E16	30
CVS PHARMACY #8447 EPA ID: NYR000194654	222 NORTH AVE	N 0 - 1/8 (0.067 mi.)	F25	45
CON ED EPA ID: NYP004760179	230 NORTH AVE	N 0 - 1/8 (0.080 mi.)	H30	70
CON EDISON SERVICE B EPA ID: NYP004442943	174 NORTH AVE	ESE 0 - 1/8 (0.084 mi.)	135	83
CON EDISON TRANSFORM EPA ID: NYP004367611	NORTH AVE & ANDERSON	N 0 - 1/8 (0.088 mi.)	H36	85
CON EDISON EPA ID: NYP004709622	ANDERSON ST & NORTH	N 0 - 1/8 (0.088 mi.)	H37	87
CON EDISON EPA ID: NYP004759452	NORTH AVE & ANDERSON	N 0 - 1/8 (0.088 mi.)	H38	89
CON EDISON EPA ID: NYP004683272	NORTH AVE & ANDERSON	N 0 - 1/8 (0.088 mi.)	H40	93
CON ED-V37 EPA ID: NYP004027967	LECOUNT PL & MAIN ST	ENE 0 - 1/8 (0.105 mi.)	J61	120
CON ED-V14 EPA ID: NYP004028122	LECOUNT PL & MAIN ST	ENE 0 - 1/8 (0.105 mi.)	J62	121
CON EDISON EPA ID: NYP004710497	150 NORTH AV	ESE 0 - 1/8 (0.105 mi.)	L64	123
CON EDISON MANHOLE: EPA ID: NYP004443198	NORTH AVE & CLINTON	ESE 0 - 1/8 (0.108 mi.)	L67	127
CON EDISON SERVICE B EPA ID: NYP004452439	NORTH AVE & CLINTON	ESE 0 - 1/8 (0.108 mi.)	L68	129
CON EDISON EPA ID: NYP004157665	46 CLINTON PL	SSE 0 - 1/8 (0.110 mi.)	M69	131
FLAMINGO CLEANERS EPA ID: NYD012946885	149 NORTH AVE	ESE 0 - 1/8 (0.122 mi.)	L81	146
MACYS EPA ID: NYP000890137	33 LE COUNT PLACE	NNE 1/8 - 1/4 (0.131 mi.)	90	175
US POSTAL SERVICE EPA ID: NYR000106369	255 NORTH AVE	NNW 1/8 - 1/4 (0.144 mi.)	T103	209
CON EDISON	NORTH AVE & HUGENOT	NNW 1/8 - 1/4 (0.155 mi.)	T107	215

EPA ID: NYP004343786				
CON EDISON TRANSFORM EPA ID: NYP004366100	NORTH AVE & HUGUENOT	NNW 1/8 - 1/4 (0.155 mi.)	T108	216
CON EDISON MANHOLE: EPA ID: NYP004312476	HUGUENOT AVE & NORTH	NNW 1/8 - 1/4 (0.155 mi.)	T110	219
CON EDISON EPA ID: NYP004339842	NORTH AVE & BONNEFOY	SE 1/8 - 1/4 (0.157 mi.)	Y116	227
CON EDISON MANHOLE: EPA ID: NYP004331732	NORTH AVE & BONNEFOY	SE 1/8 - 1/4 (0.157 mi.)	Y117	229
CON EDISON EPA ID: NYP004317624	OPP. 134 NORTH AVENU	SE 1/8 - 1/4 (0.178 mi.)	AA127	240
CON EDISON MANHOLE 1 EPA Id: NYP004219455	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG149	287
CON EDISON MANHOLE 1 EPA Id: NYP004219380	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG150	291
CON EDISON EPA ID: NYP004837407	HUGENOT ST & LECOUNT	N 1/8 - 1/4 (0.196 mi.)	AG151	294
CON EDISON - GAS DRI EPA ID: NYP004163416	FRANKLIN AV & LAFAYE	ENE 1/8 - 1/4 (0.201 mi.)	155	300
CON EDISON MANHOLE: EPA ID: NYP004323457	277 NORTH AVE	NNW 1/8 - 1/4 (0.214 mi.)	AH168	338
CON EDISON EPA ID: NYP004726550	HARRISON ST & MAIN S	NE 1/8 - 1/4 (0.229 mi.)	AM175	347
CON EDISON MANHOLE: EPA ID: NYP004326658	MAIN ST & HARRISON S	NE 1/8 - 1/4 (0.229 mi.)	AM177	351
CON EDISON TRANSFORM EPA ID: NYP004379020	CENTRE AVE & RELYEA	WSW 1/8 - 1/4 (0.230 mi.)	AN178	353
CON EDISON TRANSFORM EPA ID: NYP004365318	CENTRE AVE & RELYEA	WSW 1/8 - 1/4 (0.230 mi.)	AN179	355
CON EDISON EPA ID: NYP004769345	FOUNTAIN PL & HARRIS	NE 1/8 - 1/4 (0.238 mi.)	AP184	362
CON ED EPA ID: NYP004759510	HARRISON ST & FOUNTA	NE 1/8 - 1/4 (0.238 mi.)	AP185	365
CON EDISON EPA ID: NYP004769477	FOUNTAIN PL & HARRIS	NE 1/8 - 1/4 (0.238 mi.)	AP186	368
CON EDISON EPA ID: NYP004758272	HARRISON ST & FOUNTA	NE 1/8 - 1/4 (0.238 mi.)	AP187	371
CON ED EPA ID: NYP004759924	HARRISON ST & CEDER	NE 1/8 - 1/4 (0.240 mi.)	AP190	376
LUTOR VALET EPA ID: NYD072710296	389 MAIN ST	NE 1/8 - 1/4 (0.244 mi.)	AM192	380
<i>MR CHIMNEY CLEAN</i> EPA ID: NYD987011855	32 RELYEA PL	WSW 1/8 - 1/4 (0.250 mi.)	AQ195	402

#### NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 12/31/2013 has revealed that there are 3 NJ MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ERIC S TURNER & CO I EPA ID: NYD002015402	33-35 CENTRE AVE	WSW 1/8 - 1/4 (0.203 mi.)	AD156	302
Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON MANHOLE 1 EPA Id: NYP004219455	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG149	287
CON EDISON MANHOLE 1 EPA Id: NYP004219380	HUGUENOT ST & LECOUN	N 1/8 - 1/4 (0.196 mi.)	AG150	291

#### EDR HIGH RISK HISTORICAL RECORDS

#### EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CON EDISON-CEDAR ST	ONE RAMADA PLAZA	NNE 1/4 - 1/2 (0.412 mi.)	261	552

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there is 1 EDR Hist Auto site within approximately 0.125 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	47 CLINTON PL	SSE 0 - 1/8 (0.104 mi.)	M56	114

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.


A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 3 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
Not reported	481 MAIN ST	ESE 0 - 1/8 (0.027 mi.)	B5	13
Not reported	170 NORTH AVE	ESE 0 - 1/8 (0.092 mi.)	l41	94
Not reported	149 NORTH AVE	ESE 0 - 1/8 (0.122 mi.)	L83	167

Due to poor or inadequate address information, the following sites were not mapped. Count: 5 records.

Site Name	Database(s)
MEARL CORP.	NY SHWS
SIDEWALK / IN FRONT OF NE	NY LTANKS
APARTMENT BUILDING	NY LTANKS
MM 5.4 LEFT LANE	NY LTANKS
CE-CEDAR ST MGP NEW ROCHELLE	NY VCP

### **OVERVIEW MAP - 4738280.2S**

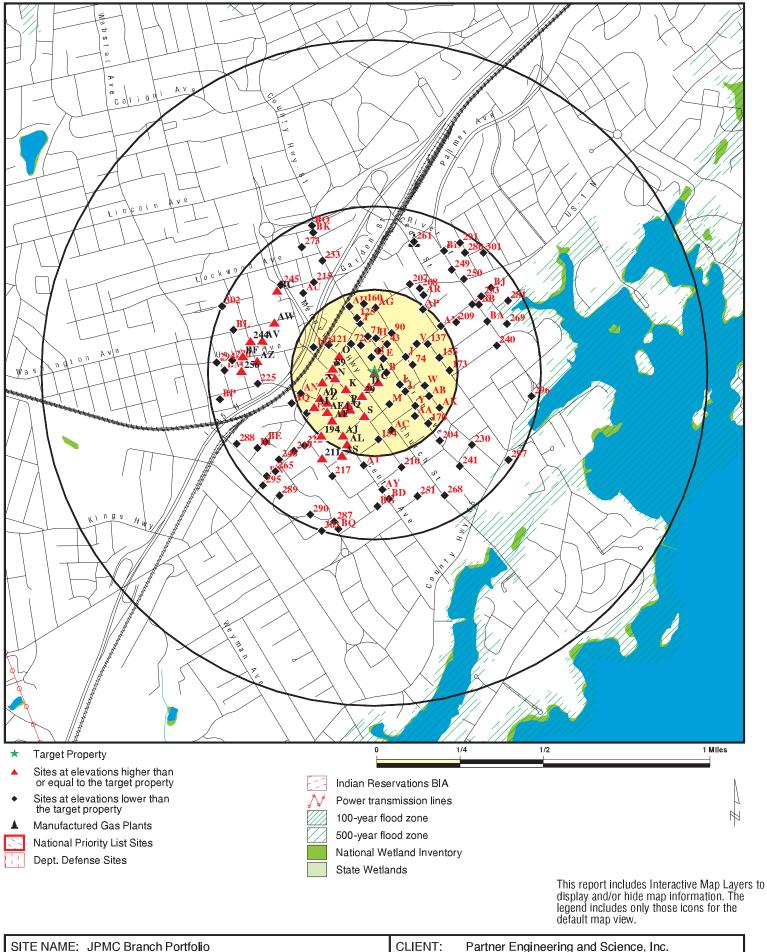


JPMC Branch PortfolioCLIENT:<br/>Partner Engineering and Science, Inc.<br/>CONTACT:<br/>Jenny Banh<br/>INQUIRY #:<br/>4738280.2s<br/>DATE:Partner Engineering and Science, Inc.<br/>CONTACT:<br/>Jenny Banh<br/>September 27, 2016<br/>4:17 pm

ADDRESS:

LAT/LONG:

Copyright © 2016 EDR, Inc. © 2015 TomTom Rel. 2015.

**DETAIL MAP - 4738280.2S** 

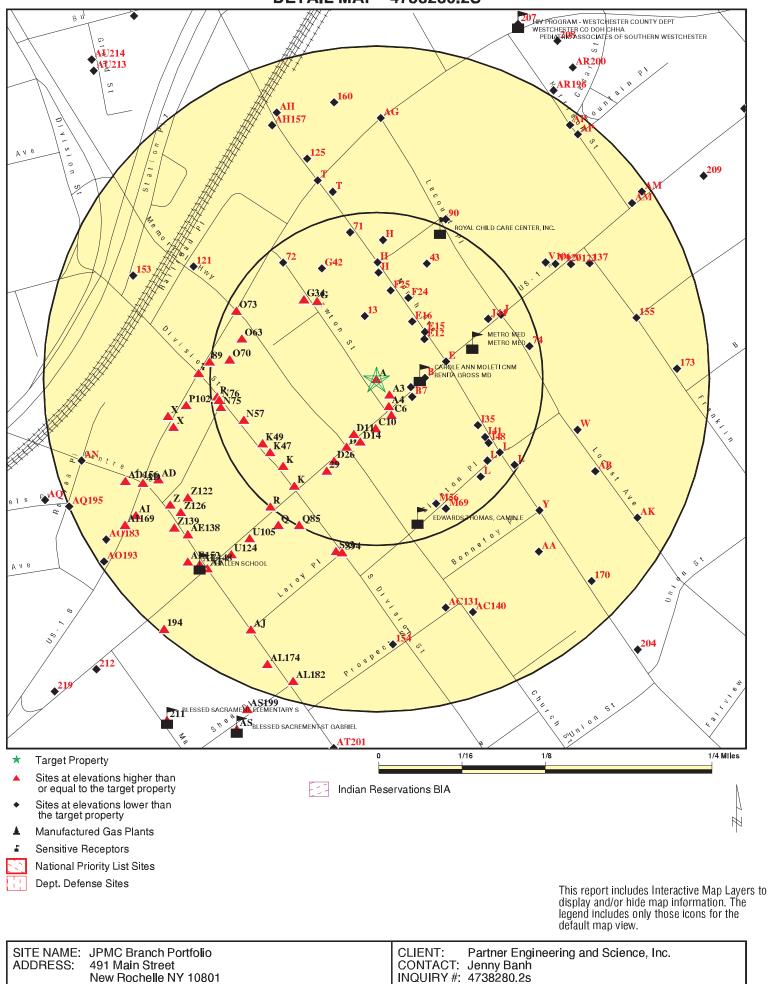

LAT/LONG:

40.909388 / 73.781494

September 27, 2016 4:18 pm Copyright © 2016 EDR, Inc. © 2015 TomTom Rel. 2015.

DATE:

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENT	AL RECORDS							
Federal NPL site list								
NPL Proposed NPL NPL LIENS	1.000 1.000 TP		0 0 NR	0 0 NR	0 0 NR	0 0 NR	NR NR NR	0 0 0
Federal Delisted NPL site	e list							
Delisted NPL	1.000		0	0	0	0	NR	0
Federal CERCLIS list								
FEDERAL FACILITY SEMS	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0
Federal CERCLIS NFRAF	P site list							
SEMS-ARCHIVE	0.500		0	0	1	NR	NR	1
Federal RCRA CORRACTS facilities list								
CORRACTS	1.000		0	0	1	0	NR	1
Federal RCRA non-COR	RACTS TSD f	acilities list						
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Federal RCRA generator	s list							
RCRA-LQG RCRA-SQG RCRA-CESQG	0.250 0.250 0.250		2 0 1	3 0 3	NR NR NR	NR NR NR	NR NR NR	5 0 4
Federal institutional com engineering controls reg								
LUCIS US ENG CONTROLS US INST CONTROL	0.500 0.500 0.500		0 0 0	0 0 0	0 0 0	NR NR NR	NR NR NR	0 0 0
Federal ERNS list								
ERNS	TP		NR	NR	NR	NR	NR	0
State- and tribal - equiva	lent CERCLIS	5						
NY SHWS NY VAPOR REOPENED	1.000 1.000		0 0	0 0	3 0	0 0	NR NR	3 0
State and tribal landfill a solid waste disposal site								
NY SWF/LF	0.500		0	0	1	NR	NR	1
State and tribal leaking s	torage tank l	ists						
INDIAN LUST NY LTANKS NY HIST LTANKS	0.500 0.500 0.500	1	0 12 0	0 22 0	0 100 0	NR NR NR	NR NR NR	0 135 0

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
State and tribal register	ed storage tai	nk lists						
FEMA UST NY UST NY CBS UST NY MOSF UST NY CBS NY MOSF NY AST NY CBS AST NY MOSF AST INDIAN UST NY TANKS	0.250 0.250 0.500 0.250 0.500 0.250 0.250 0.250 0.250 0.250	1	0 12 0 0 0 0 6 0 0 0 0 0 0	0 18 0 0 0 12 0 0 0 0	NR NR 0 NR 0 NR 0 NR NR	NR NR NR NR NR NR NR NR NR NR	NR NR NR NR NR NR NR NR NR NR	0 31 0 0 0 19 0 0 0 0
State and tribal instituti control / engineering co		s						
NY RES DECL NY ENG CONTROLS NY INST CONTROL	0.125 0.500 0.500		0 0 0	NR 0 0	NR 0 0	NR NR NR	NR NR NR	0 0 0
State and tribal volunta	ry cleanup site	es						
NY VCP INDIAN VCP	0.500 0.500		0 0	0 0	0 0	NR NR	NR NR	0 0
State and tribal Brownfi	ields sites							
NY BROWNFIELDS NY ERP	0.500 0.500		2 0	0 0	1 0	NR NR	NR NR	3 0
ADDITIONAL ENVIRONME	NTAL RECORD	s						
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Waste Disposal Sites	Solid							
NY SWRCY NY SWTIRE INDIAN ODI ODI DEBRIS REGION 9	0.500 0.500 0.500 0.500 0.500		0 0 0 0	0 0 0 0	0 0 0 0	NR NR NR NR NR	NR NR NR NR NR	0 0 0 0
Local Lists of Hazardou Contaminated Sites	is waste /							
US HIST CDL NY DEL SHWS US CDL	TP 1.000 TP		NR 0 NR	NR 0 NR	NR 0 NR	NR 0 NR	NR NR NR	0 0 0
Local Lists of Registere	ed Storage Tar	nks						
NY HIST UST NY HIST AST	0.250 TP		0 NR	0 NR	NR NR	NR NR	NR NR	0 0

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Land Records								
NY LIENS LIENS 2	TP TP		NR NR	NR NR	NR NR	NR NR	NR NR	0 0
Records of Emergency I	Release Repo	rts						
HMIRS NY Spills NY Hist Spills NY SPILLS 90 NY SPILLS 80	TP 0.125 0.125 0.125 0.125 0.125		NR 23 0 0 0	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	NR NR NR NR NR	0 23 0 0 0
Other Ascertainable Rec	ords							
RCRA NonGen / NLR FUDS DOD SCRD DRYCLEANERS US FIN ASSUR EPA WATCH LIST 2020 COR ACTION TSCA TRIS SSTS ROD RMP RAATS PRP PADS ICIS FTTS MLTS COAL ASH DOE COAL ASH DOE COAL ASH EPA PCB TRANSFORMER RADINFO HIST FTTS DOT OPS CONSENT INDIAN RESERV FUSRAP UMTRA LEAD SMELTERS	0.250 1.000 1.000 0.500 TP TP 0.250 TP TP TP 1.000 TP TP TP TP TP TP TP TP TP TP		13 0 0 0 NR 0 NR 0 NR 0 NR 0 NR 0 NR 0 NR	27 0 0 0 NR N N N N N N N N N N N N N N N	NR 0 0 0 RR RR NR 0 RR NR	NR 0 0 NR NR NR NR 0 NR NR 0 0 0 NR NR NR NR NR NR NR NR NR NR 0 0 0 NR NR	NR NR NR NR R R R R R R R R R R R R R R	40 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
US AIRS US MINES FINDS DOCKET HWC UXO NY AIRS NY COAL ASH NY DRYCLEANERS NY E DESIGNATION	TP 0.250 TP 1.000 TP 0.500 0.250 0.125		NR 0 NR 0 NR 0 2 0	NR 0 NR 0 NR 0 5 NR	NR NR NR 0 NR 0 NR NR	NR NR NR 0 NR NR NR NR	NR NR NR NR NR NR NR NR	0 0 0 0 0 0 7 0

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY Financial Assurance	TP		NR	NR	NR	NR	NR	0
NY HSWDS	0.500		0	0	0	NR	NR	0
NY MANIFEST	0.250		24	43	NR	NR	NR	67
RI MANIFEST	0.250		0	0	NR	NR	NR	0
NJ MANIFEST	0.250		0	3	NR	NR	NR	3
NY SPDES	TP		NR	NR	NR	NR	NR	0
NY UIC	TP		NR	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
ECHO	TP		NR	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	1	0	NR	1
EDR Hist Auto	0.125		1	NR	NR	NR	NR	1
EDR Hist Cleaner	0.125		3	NR	NR	NR	NR	3
EDR RECOVERED GOVERN	MENT ARCHI	/ES						
Exclusive Recovered Govt. Archives								
NY RGA HWS	TP		NR	NR	NR	NR	NR	0
NY RGA LF	TP		NR	NR	NR	NR	NR	0
- Totals		3	101	136	108	0	0	348

### NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Database(s)

EDR ID Number EPA ID Number

A1 Target Property	J P MORGAN CHASE BANK N.A. 491 MAIN STREET NEW ROCHELLE, NY 10801		NY UST NY AST	U003885235 N/A
	Site 1 of 4 in cluster A			
Actual: 94 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	3-164372 / Active Domenick Margotta J P Morgan Chase Bank N.A. 575 Washington Boulevard 14th Floor Jersey City NJ 07310 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	1 4. Closed - in place 2000 Not reported Not reported 0. None Not reported 04/05/1990 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. None 0. None 0. No Pipiing 1. Steel/Carbon/ steel/iron 0. None None None None 0. None 1. Steel/Carbon/ steel/iron 1. Steel/Carbon/ steel/iron 2. Suction		
	WESTCHESTER CO. AST: PBS Number: Site Status: GDS Number: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City/State/Zip: Tank Number: Status: Date Installation: Capacity: Product Stored: Product Stored: Product Stored Percent: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection:	3-164372 Active Not reported Domenick Margotta J P Morgan Chase Bank N.A. 575 Washington Boulevard 14th Floor Jersey City, NJ 07310 02 1. In-Service 01/01/1997 1500 1. No. 2 fuel oil Not reported 01/01/1900 3. Aboveground on saddles,legs,stilts,racks or cradle 1. Steel/Carbon steel/Iron 0. None Not reported		

	MAP FINDINGS		
Site		Database(s)	EDR ID Number EPA ID Number
J P MORGAN CHASE BANK N	A. (Continued)		U003885235
Piping Location: Piping Type: Piping External Protection: Piping Leak Detection:	ent: 10. Impervious Underlayment 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 0. None 0. None	d Only)	
BARCLAYS BANK OF NY/NA 491 MAIN ST. NEW ROCHELLE, NY		NY LTANKS	S100140601 N/A
Site 2 of 4 in cluster A			
Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County:	1989-08-23 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. I Willing Responsible Party. Corrective action taken. 1953-06-18 True 6010 wxwadswo Not reported 1989-08-23 Not reported Not reported Tank Tester Not reported False False 0 1989-08-31	DEC Response.	
	J P MORGAN CHASE BANK N. Tank Leak Detection: Tank Secondary Containme Piping Location: Piping Type: Piping External Protection: Piping Secondary Containm Overfill Prevention: Spill Prevention: Dispenser: BARCLAYS BANK OF NY/NA 491 MAIN ST. NEW ROCHELLE, NY Site 2 of 4 in cluster A LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Source: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Number/Closed Date: Spill Cause: Spill Number/Closed Date: Spill Number/Closed Date: Spill Cause: Spill Source: Spill Number/Closed Date: Spill Record: Spill Source: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip:	Site         J P MORGAN CHASE BANK N.A. (Continued)         Tank Leak Detection:       6. Impervious Barrier/Concrete Pad (Aboveground Tank Secondary Containment:         Tiping Location:       3. Aboveground/Underground Combination         Piping Location:       0. None         Piping External Protection:       0. None         Piping Secondary Containment:       0. None         Piping Secondary Containment:       0. None         Overfill Prevention:       5. Vent Whistle         Spill Prevention:       0. None         Dispenser:       2. Suction <b>BarCLAYS BANK OF NYNA 349 MAIN ST. BERCLAYS BANK OF NYNA 349 MAIN ST. BERCLUS SEANK OF NYNA 349 MAIN ST. BARCLAYS BANK OF NYNA 349 MAIN ST. BARCLAYS BANK OF NYNA 349 MAIN ST. BARCLAYS BANK OF NYNA 3911 Class: 299 548</b> Spill Number/Closed Date: 8905129 / 1991-03-25 Spill Cause: Tank Test Failure Spill Cause: Tank Roomercial/Industrial Spill Source: Commercial/Industrial Spill Cause: Tank Fest Failure Spill Cause: Solito Investigator: Not reported Reported to Dept: 1989-08-23 ClD: Not reported Reported to Dept: 1989-08-23 ClD: Not reported Reported To Computer: 1989-08-23 ClD: Not reported Reported To Computer: 1989-08-23 ClD: Not reported Reported To Computer: 1989-08-23 ClD: Not reported Reported To Dept: 1989-08-23	Site       Database(s)         Site       Database(s)         JP MORGAN CHASE BANK N.A. (Continued)       Tark Secondary Containment: 10. Impervious Barrier/Concrete Pad (Aboveground Only).         Tark Secondary Containment: 0. None       Piping Type:

"Prior to Sept, 2004 data translation this spill Lead\_DEC Field was

BARCLAYS AND REVIEWING OPTIONS. PETRO TITE 2K 4 GPH"

W. WADSWORTH 10/06/89: GND INC. (516) 933-1085 NAT MOSER: 1500 GAL #2 FAILED RETEST -.132GPH. TANK TO BE RELINED OR REPLACED. 03/25/91:

"NAT MOSER (TELECOM 8-23, 1615) WILL CALL BACK AFTER CONTACTING

Spiller Extention:

DER Facility ID:

DEC Region:

DEC Memo:

Remarks:

Not reported

TANK REMOVED. "

242324

3

Database(s)

EDR ID Number EPA ID Number

#### Material: Site ID: 299548 Operable Unit ID: 930451 Operable Unit: 01 Material ID: 445568 Material Code: 0001A

Matchar ID.	440000
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	299548
Spill Tank Test:	1535898
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Unknown

#### A3 NEW ROCHELLE PUBLIC LIBRARY SE ONE LIBRARY PLAZA < 1/8 NEW ROCHELLE, NY 10801

### 0.015 mi. 81 ft. Site 3 of 4 in cluster A

Relative: Higher	WESTCHESTER CO. UST: Id/Status: Operator Name:	3-601216 / Active Thomas Geoffino
Actual: 94 ft.	Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	New Rochelle Public Library One Library Plaza Not reported New Rochelle NY 10801 Not reported
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection:	LIB 1 1. In-Service 10000 1. No. 2 fuel oil Not reported 0. None 09/01/1979 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating

### BARCLAYS BANK OF NY/NA (Continued)

S100140601

### NY UST U004177022 N/A

TC4738280.2s Page 10

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	NEW ROCHELLE PUBLIC LIBR	RARY (Continued)		U004177022
	Tank Secondary Containm Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containr Spill Prevention: Dispenser:	3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 0. None 0. None		
A4 SSE < 1/8 0.022 mi.	NEW ROCHELLE PUBLIC LIBF 1 LAWTON NEW ROCHELLE, NY	RARY	NY LTANKS	S105995872 N/A
118 ft.	Site 4 of 4 in cluster A			
Relative:	LTANKS:			
Higher	Site ID:	306611		
Actual:	Spill Number/Closed Date: Spill Date:	0201697 / 2002-09-18 2002-05-15		
94 ft.	Spill Cause:	Tank Test Failure		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Class:	Known release with minimal potential for fire or hazard. D	EC Response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6000		
	Investigator:	WCHD		
	Referred To: Reported to Dept:	Westchester Cnty Health Dept 2002-05-15		
	CID:	282		
	Water Affected:	Not reported		
	Spill Notifier:	Tank Tester		
	Last Inspection: Recommended Penalty:	Not reported False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spiller Name:	2002-09-23 SAME		
	Spiller Company:	NEW ROCHELLE LIBRARY		
	Spiller Address:	1 LAWTON STREET		
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10801- 001		
	Spiller County: Spiller Contact:	FRANK GALLELO		
	Spiller Phone:	(914) 654-2316		
	Spiller Extention:	Not reported		
	DEC Region: DER Facility ID:	3 274126		
	DEC Memo:	11		
	Remarks:	"TANK FAILED THE TEST "		
	Material:			
	Site ID:	306611		
	Operable Unit ID:	852656		
	Operable Unit: Material ID:	01 523107		

Database(s)

EDR ID Number EPA ID Number

S105995872

NEW ROCHELLE PUBLIC LIB	RARY (Continued)
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
_	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	306611
Spill Tank Test:	1527134
Tank Number:	1
Tank Size:	10000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II
Site ID:	492304
Spill Number/Closed Date:	1311408 / Not Reported
Spill Date:	2014-03-06
Spill Cause:	Tank Test Failure
Spill Source:	Institutional, Educational, Gov., Other
Spill Class:	Possible release with minimal potential for fire or hazard or Known
	release with no damage. DEC Response. Willing Responsible Party.
	Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	6010
Investigator:	RDBENDEL
Referred To:	Not reported
Reported to Dept:	2014-03-06
CID: Water Affected:	Not reported
	Not reported
Spill Notifier:	Other Nationariad
Last Inspection: Recommended Penalty:	Not reported False
UST Involvement:	False
Remediation Phase:	4
Date Entered In Computer:	
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	NEW ROCHELLE PUBLIC LIBRARY
Spiller Address:	Not reported
Spiller City, St, Zip:	NY
Spiller County:	999
Spiller Contact:	ROB
Spiller Phone:	(914) 473-0784
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	447251
DEC Memo:	"Tank failed with a dry leak. Will most likely be uncovering,
	repairing and retesting. WCDOH has been notifiedmm 10-15-15 email

EDR ID Number Database(s) EPA ID Number

### NEW ROCHELLE PUBLIC LIBRARY (Continued)

Remarks:	forward an update"
aterial:	10000.1
Site ID:	492304
Operable Unit ID:	1241838
Operable Unit:	01
Material ID:	2242328
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Site ID:	492304
Operable Unit ID:	1241838
Operable Unit:	01
Material ID:	2242331
Material Code:	0001
Material Name:	#2 fuel oil (on-site consumption)
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
ank Test:	
Site ID:	492304
Spill Tank Test:	2495159
Tank Number:	1
Tank Size:	10000
Test Method:	21
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	MBMÁSTRO
Last Modified:	Not reported
Test Method:	Horner EZY3/EZY3 Locator Plus

B5	
ESI	

B5 ESE < 1/8 0.027 mi. 140 ft.	481 MAIN ST NEW ROCHELLE, NY 1080 Site 1 of 4 in cluster B	1
Relative: Lower Actual: 92 ft.	EDR Historical Cleaners: Name: Year: Address:	ACQUIRE CARPET CLEANING SRVC 2001 481 MAIN ST

EDR Hist Cleaner 1015066017 N/A

#### S105995872

Database(s)

EDR ID Number EPA ID Number

C6	ADREAN PRINTING CO	RCRA NonGen / NLR 1004755683	
SSE	490 MAIN ST	FINDS NY00002339	81
< 1/8 0.029 mi.	NEW ROCHELLE, NY 10801	NY MANIFEST ECHO	
0.029 mi. 154 ft.	Site 1 of 2 in cluster C	ECHO	
Relative:	RCRA NonGen / NLR:		
Higher	Date form received by agency	: 01/01/2007	
-	Facility name:	ADREAN PRINTING CO	
Actual:	Facility address:	490 MAIN ST	
94 ft.		NEW ROCHELLE, NY 10801	
	EPA ID:	NY0000233981	
	Mailing address:	MAIN ST NEW ROCHELLE, NY 10801	
	Contact:	MICHAEL GOLDBERGER	
	Contact address:	MAIN ST	
		NEW ROCHELLE, NY 10801	
	Contact country:	US	
	Contact telephone:	(914) 636-0200	
	Contact email:	Not reported	
	EPA Region:	02	
	Classification:	Non-Generator	
	Description:	Handler: Non-Generators do not presently generate hazardous waste	
	Owner/Operator Summary:		
	Owner/operator name:	MICHAEL GOLDBERGER	
	Owner/operator address:	490 MAIN ST NEW ROCHELLE, NY 10801	
	Owner/operator country:	US	
	Owner/operator telephone:	(914) 636-0200	
	Legal status:	Private	
	Owner/Operator Type:	Owner Net reported	
	Owner/Op start date: Owner/Op end date:	Not reported Not reported	
	owner/op end date.		
	Owner/operator name:	MICHAEL GOLDBERGER	
	Owner/operator address:	490 MAIN ST	
		NEW ROCHELLE, NY 10801	
	Owner/operator country:	US (014) 626 0200	
	Owner/operator telephone: Legal status:	(914) 636-0200 Private	
	Owner/Operator Type:	Operator	
	Owner/Op start date:	Not reported	
	Owner/Op end date:	Not reported	
	Handler Activities Summary:		
	U.S. importer of hazardous wa	aste: No	
	Mixed waste (haz. and radioa		
	Recycler of hazardous waste:	No	
	Transporter of hazardous was		
	Treater, storer or disposer of I		
	Underground injection activity		
	On-site burner exemption:	No	
	Furnace exemption: Used oil fuel burner:	No	
	Used oil processor:	No No	
	User oil refiner:	No	
	Used oil fuel marketer to burn		

Database(s)

EDR ID Number EPA ID Number

#### 1004755683

#### ADREAN PRINTING CO (Continued)

	Used oil Specification markete	er: No
	Used oil transfer facility:	No
	Used oil transporter:	No
Н	istorical Generators:	
	Date form received by agency	r: 01/01/2006
	Site name:	ADREAN PRINTING CO
	Classification:	Not a generator, verified
		0.4/04/4.0004
	Date form received by agency	
	Site name:	ADREAN PRINTING CO
	Classification:	Conditionally Exempt Small Quantity Generator
	. Waste code:	D000
	. Waste name:	Not Defined
	. Waste code:	D011
	. Waste name:	SILVER
	Violation Status:	No violations found
F	NDS:	
	Registry ID:	110004314297
	Environmental Interest/Inform	
	RCRAInfo i	s a national information system that supports the I

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

#### NY MANIFEST: Country: USA EPA ID: NY0000233981 Facility Status: Not reported 490 MAIN ST Location Address 1: Code: ΒP Location Address 2: Not reported Total Tanks: Not reported Location City: NEW ROCHELLE NY Location State: 10801 Location Zip: Location Zip 4: Not reported NY MANIFEST: EPAID: NY0000233981 Mailing Name: ADREAN PRINTING Mailing Contact: WILLIAM C WHITE Mailing Address 1: 490 MAIN ST Mailing Address 2: Not reported Mailing City: NEW ROCHELLE Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Not reported

Database(s)

EDR ID Number EPA ID Number

1004755683

### ADREAN PRINTING CO (Continued)

Mailing Country:	USA
Mailing Phone:	9146360200
NY MANIFEST: Document ID:	NYB8521299
Manifest Status:	C
seq:	Not reported
Year:	1997
Trans1 State ID:	PW2414
Trans2 State ID:	Not reported
Generator Ship Date:	01/16/1997
Trans1 Recy Date:	01/16/1997
Trans2 Recv Date:	
TSD Site Recv Date:	01/16/1997
Part A Recv Date:	/ /
Part B Recv Date:	01/31/1997
Generator EPA ID:	NY0000233981
Trans1 EPA ID:	NYR000025767
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD981182769
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator: Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D011 - SILVER 5.0 MG/L TCLP
Waste Code:	Not reported
Quantity:	
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001 DE Fiberheard ar plactic drume (alace)
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method: Specific Gravity:	R Material recovery of more than 75 percent of the total material. 100
opcomo Cravity.	
Document ID:	NYG0919566
Manifest Status:	C
seq:	Not reported
Year:	1997
Trans1 State ID:	PW2414
Trans2 State ID:	Not reported
Generator Ship Date:	08/28/1997
Trans1 Recv Date:	08/28/1997
Trans2 Recv Date:	
TSD Site Recv Date:	08/28/1997
Part A Recv Date:	//

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### ADREAN PRINTING CO (Continued)

Part B Recv Date: 09/19/1997 Generator EPA ID: NY0000233981 Trans1 EPA ID: NYR000025767 Trans2 EPA ID: Not reported TSDF ID 1: NYD981182769 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D011 - SILVER 5.0 MG/L TCLP Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 00030 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Document ID: NYB7750935 Manifest Status: С seq: Not reported 1996 Year: Trans1 State ID: XC2643 Trans2 State ID: Not reported Generator Ship Date: 04/16/1996 Trans1 Recv Date: 04/16/1996 Trans2 Recv Date: 11 TSD Site Recy Date: 04/16/1996 Part A Recv Date: 05/01/1996 Part B Recv Date: 05/03/1996 Generator EPA ID: NY0000233981 Trans1 EPA ID: NYD981182769 Trans2 EPA ID: Not reported TSDF ID 1: NYD981182769 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported

#### 1004755683

Database(s)

EDR ID Number EPA ID Number

### ADREAN PRINTING CO (Continued)

1004755683

CEAN FRINTING CO (Continued	J)
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D011 - SILVER 5.0 MG/L TCLP
Waste Code:	Not reported
Waste Code: Waste Code:	Not reported
	00030
Quantity: Units:	
Number of Containers:	G - Gallons (liquids only)* (8.3 pounds) 001
	DF - Fiberboard or plastic drums (glass)
Container Type:	
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Document ID:	NYB7902711
	C
Manifest Status:	-
seq:	Not reported
Year:	1995
Trans1 State ID:	GE9561
Trans2 State ID:	Not reported
Generator Ship Date:	05/25/1995
Trans1 Recv Date:	05/25/1995
Trans2 Recv Date:	
TSD Site Recv Date:	05/25/1995
Part A Recv Date:	06/16/1995
Part B Recv Date:	06/07/1995
Generator EPA ID:	NY0000233981
Trans1 EPA ID:	NYD981182769
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD981182769
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D011 - SILVER 5.0 MG/L TCLP
Waste Code:	Not reported
Quantity:	00030
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
ersono crany.	

Database(s)

EDR ID Number EPA ID Number

1004755683

#### ADREAN PRINTING CO (Continued)

Document ID: NYB6575904 Manifest Status: С Not reported seq: Year: 1994 Trans1 State ID: GE9561 Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: 11 TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: 00030 Units: Number of Containers: 001 Container Type: Handling Method: Specific Gravity: 100

Not reported 11/11/1994 11/11/1994 11/11/1994 11/21/1994 12/05/1994 NY0000233981 NYD981182769 Not reported NYD981182769 Not reported D011 - SILVER 5.0 MG/L TCLP Not reported Not reported Not reported Not reported Not reported G - Gallons (liquids only)\* (8.3 pounds) DF - Fiberboard or plastic drums (glass) R Material recovery of more than 75 percent of the total material.

## ECHO:

Envid: Registry ID: DFR URL: 1004755683 110004314297 http://echo.epa.gov/detailed\_facility\_report?fid=110004314297

Database(s)

EDR ID Number EPA ID Number

ESE         484 MAIN ST         N//           < 1/8         NEW ROCHELLE, NY         N//           0.030 mi.         1000 mi.         1000 mi.	553049 A
159 ft. Site 2 of 4 in cluster B	
159 ft.       Site 2 of 4 in cluster B         Relative:       SPILLS:         Lower       Facility 10:       1311131         Facility 10:       449073         92 ft.       Site 10:       492016         DEC Region:       3         Spill Number/Ocosed Date:       2014-02-26         Spill Cause:       Equipment Failure         Spill Cause:       Equipment Failure         Spill Cause:       Equipment Failure         Spill Cause:       Equipment Failure         Spill Cause:       G010         Investigator:       BDDEE Reportable Party. Corrective action taken.         SWIS:       G010         Investigator:       DDDEE Reported to Dept:         Vator Affected:       Not reported         Spill Number Other       Cother         Cleanup Detest Std:       True         Last Inspection:       Not reported         Spill Record Last Update:       2014-02-28         Spill Record Last Update:       2014-02-26         Cleanup Detest Std:       True         Last Inspection:       Not reported         Spill Record Last Update:       2014-02-28         Spill Record Last Update:       2014-02-23         Spill Record Last Upd	

EDR ID Number Database(s) **EPA ID Number** 

#### LORDAE PROPERTIES - UST (Continued)

there does appear to be ground water in the excavation. Message sent to Envirostar asking if a ground water sample was taken. jod 3/25/14: Envirostar is contacting Gallinger Environmental to do geo-probe work and ground water sampling. jod 5/28/14: Message from Tim Bishop at HES. He has been contacted by the property owner's attorney to move forward with a Ground water investigation. jod 7/09/14: Tim Bishop from HES reports arrangements are now being made to install a monitoring well on the neighboring property. jod 8/01/14: Ground water investigation report received from HES. All results on the neighboring property are below water standards and soil guidance. This spill number is ready to be closed out after final manifests from Envirostar have been reviewed. jod 9/23/14: Cleanup and investigation completed. Closure Report from Envirostar will be entered into D2/DecDocs system at a later date. Based upon the information provided, no further action is required at this time. jod" Not reported "Oil spilled to soil. Envirostar has been hired for clean up."

Remarks: Material:

Site ID:
Operable Unit ID:
Operable Unit:
Material ID:
Material Code:
Material Name:
Case No.:
Material FA:
Quantity:
Units:
Recovered:
Resource Affected:
Oxygenate:

492016

1241557

2242008

Petroleum

Not reported

Not reported

Not reported Not reported

Not reported

0001A #2 fuel oil Not reported

01

Tank Test:

B8 East < 1/8 0.036 mi. 192 ft.	OFFICE BLDG 481 MAIN STREET NEW ROCHELLE, NY Site 3 of 4 in cluster B	NY Spills	S107521186 N/A
Relative: Lower Actual: 92 ft.	SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	0510734 ER 306823 356765 3 2005-12-14 0510734 / 2008-12-18 Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jbodee WCDOH 2005-12-14 444	

#### S116553049

Database(s)

EDR ID Number **EPA ID Number** 

S107521186

#### **OFFICE BLDG (Continued)**

Water Affected: Not reported Commercial/Industrial Spill Source: Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2005-12-14 Spill Record Last Update: 2008-12-18 Spiller Name: BOBBY MINA Spiller Company: OFFICE BLDG Spiller Address: 481 MAIN STREET Spiller City, St, Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: BOBBY MINA Contact Phone: (718) 832-6057 12/14/2005/13:35 VMC UP TO BOBBY/ 4 TH AVE:INITIAL CALL:CONTACTED BY DEC Memo: CINDY/ WCHD REF: OLD SPILL AT LOC. OCT.2005 OVERFILLED: SOME INTO BASEMENT; CLEANED UP AT THE TIME; ODOR COMPLAINT. CALLED IN TO GEN. FILE FOR CLOSING." Remarks: "IS ALL CLEANED UP. UNSURE WHAT HAPPENED: BUT HEALTH DEPT. IS ON SCENE AND SAID IT WAS ALL SET:" Material: Site ID: 356765 **Operable Unit ID:** 1114061 **Operable Unit:** 01 2104139 Material ID: Material Code: 0001A Material Name: #2 fuel oil Case No .: Not reported Material FA: Petroleum Quantity: .00 Units: Gallons Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported

Tank Test:

B9 East < 1/8 0.036 mi. 192 ft.	RETTNER MANAGEMENT CORP 481 MAIN ST NEW ROCHELLE, NY 10801 Site 4 of 4 in cluster B		NY UST	0U 1
Relative: Lower Actual: 92 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner City: Owner State: Owner Zipcode:	3-255033 / Active Arnoldo Diaz Rettner Main Street, LLC 374 McLean Avenue Not reported Yonkers NY 10705		

004177201 N/A

Database(s)

EDR ID Number EPA ID Number

### **RETTNER MANAGEMENT CORP (Continued)**

GDS Number:	Not reported
Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	1 0. Administratively closed 3000 7. Gasoline Not reported 0. None 01/01/1900 09/01/2002 Not reported 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 1. Steel/Carbon/ steel/iron 1. Steel/Carbon/ steel/iron 0. None 4. Product Level Gauge (Aboveground Only) Not reported 1. Steother the steel/Iron 1. Steel/Carbon/ steel/Iron 1. Steel/Carbon/ steel/Iron 2. None 3. Product Level Gauge (Aboveground Only) Not reported 3. Suction
Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	2 1. In-Service 2500 1. No. 2 fuel oil Not reported 0. None 10/01/1970 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. No Piping 1. Steel/Carbon/ Steel/Iron 0. None 0. None

C10 South < 1/8 0.037 mi. 195 ft.	ATTACK PESTICIDES 498 MAIN STREET NEW ROCHELLE, NY Site 2 of 2 in cluster C	
Relative: Higher Actual: 94 ft.	SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date:	0335020 ER 222934 274095 3 2004-03-12

NY Spills S106383779 N/A

EDR ID Number Database(s) EPA ID Number

### ATTACK PESTICIDES (Continued)

### S106383779

	, u <i>j</i>
Spill Number/Closed Date:	0335020 / 2005-02-27
Spill Cause:	Unknown
Spill Class:	Known release that creates a file or hazard. DEC Response. Unknown
	Responsible Party. Corrective action taken. (ISR)
SWIS:	6010
Investigator:	jkomara
Referred To:	Not reported
Reported to Dept:	2004-03-15
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2004-03-16
Spill Record Last Update:	2005-02-27
Spiller Name:	SAME
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City, St, Zip:	ZZ -
Spiller Company:	001
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
DEO Memo.	O'MARA 2/27/05 not a petroleum spill (unknown wastes removed from a
	facility by DEC under supervision of j omaraclose "
Remarks:	"Unknown and Unregestered Pesticides of a Highky Toxic Nature spilled
Remarks.	
	and left unattended by owner. Dec under a seach warrent entered and
	removed the dangerous materials. They are stored in 4 55 gallon
	overpac drums at the RC Fire Training Center. Awaiting disposal. Upon
	DIsposal NFA JOM "
Material:	
Site ID:	274095
Operable Unit ID:	880664
Operable Unit:	01
Material ID:	496602
Material Code:	0063A
Material Name:	unknown hazardous material
Case No.:	Not reported
Material FA:	Hazardous Material
Quantity:	.00 Collans
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Database(s)

EDR ID Number EPA ID Number

D11 SSW < 1/8 0.045 mi. 235 ft.	COMMERCIAL BUILDING 507 MAIN STREET NEW ROCHELLE, NY Site 1 of 7 in cluster D		NY LTANKS	S100177795 N/A
Relative: Higher Actual: 96 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Cottact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	1992-01-17 Tank Failure Commercial/Industrial Not reported 1992-02-06 True 6010 TAYLOR Not reported 1992-01-17 Not reported Not reported Local Agency 1992-02-06 False False 0 1992-01-23	WITH ONE HO	LE IN
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	286303 960971 01 415913 0001A #2 fuel oil Not reported Petroleum .00 Not reported .00 Not reported Not reported Not reported		

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	COMMERCIAL BUILDING (Continu Tank Test:	ed)		S100177795
E12 NE < 1/8 0.047 mi. 247 ft.	BARON MANAGEMENT 200 NORTH AVENUE NEW ROCHELLE, NY 10801 Site 1 of 6 in cluster E		NY UST	U004187277 N/A
Relative:	WESTCHESTER CO. UST: Id/Status:	3-167843 / Administratively Closed		
Lower Actual: 92 ft.	Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	3-167843 / Administratively Closed Segundo Tirado Ronald Rettner 481 Main Street Not reported New Rochelle NY 10801 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection:	1 0. Administratively closed 3000 7. Gasoline Not reported 0. None 01/01/1900 03/05/2002 Not reported 1. Steel/Carbon steel/Iron 0. None 0. None 0. None Not reported 1. Steel/Carbon/ steel/iron 0. None Not reported 1. Steel/Carbon/ steel/iron 0. None		

Not reported

2. Suction

4. Product Level Gauge (Aboveground Only)

Relative: Lower	LTANKS: Site ID: Spill Number/Closed Date:	306853 9111450 / 1992-02-06
Actual: 93 ft.	Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard:	1992-02-06 Tank Failure Commercial Vehicle Not reported 1953-06-18 True

Overfill Prevention:

NEW ROCHELLE PUBLIC LIBR.

Spill Prevention:

. Dispenser:

**MEMORIAL HIGHWAY** 

NEW ROCHELLE, NY

13 North

< 1/8

0.048 mi. 253 ft.

Piping Secondary Containment: Not reported

NY LTANKS \$100177858 N/A

Database(s)

EDR ID Number **EPA ID Number** 

#### **NEW ROCHELLE PUBLIC LIBR. (Continued)**

S100177858 SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1992-02-06 CID: Not reported Water Affected: Not reported Spill Notifier: Fire Department Last Inspection: Not reported Recommended Penalty: False UST Involvement: False 0 Remediation Phase: Date Entered In Computer: 2003-12-02 Spill Record Last Update: 2003-12-02 Spiller Name: Not reported Spiller Company: CITY OF NEW ROCHELLE Spiller Address: Not reported Spiller City,St,Zip: NY Spiller County: 999 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 247822 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY Remarks: "SOME ON PAVEMENT, SOME IN STORM DRAIN F.D.HAZMAT USED SORBENT TO CONTAIN AND VENTED BUILING SPOKE WITH DEP. CHIEF STONE" Material: 306853 Site ID: Operable Unit ID: 965176 **Operable Unit:** 01 416486 Material ID: Material Code: 0009 Material Name: gasoline Not reported Case No.: Material FA: Petroleum Quantity: 30.00 Gallons Units: Recovered: .00 Not reported **Resource Affected:** Oxygenate: Not reported Tank Test: DOLLAR BEST NY Spills S113819683 **506 MAIN ST** N/A **NEW ROCHELLE, NY** 

0.048 mi. 256 ft.	Site 2 of 7 in cluster D	
Relative: Higher	SPILLS: Facility ID: Facility Type:	1304701 ER
Actual: 96 ft.	DER Facility ID: Site ID:	440386 485236

D14

SSW

< 1/8

Database(s)

EDR ID Number EPA ID Number

### DOLLAR BEST (Continued)

### S113819683

DEC Region: Spill Date:	3 2013-07-30
Spill Number/Closed Date:	1304701 / 2013-10-10
Spill Cause: Spill Class:	Equipment Failure Possible release with minimal potential for fire or hazard or Known
Spill Class.	release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	TDGHIOSA
Referred To:	Not reported
Reported to Dept:	2013-07-30
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust: Remediation Phase:	False
Date Entered In Computer:	0 2013-07-30
Spill Record Last Update:	2013-10-10
Spiller Name:	Not reported
Spiller Company:	BUSINESS
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	ROD LEARNER
Contact Phone:	(561) 900-6663
DEC Memo:	"7-30-13 Spoke with Rod. He is awaiting a proposal from Northeast. jc
	10/10/13 Northeast Environmental reported that they excavated and
	removed the tank along with 97.54 tons of contaminated soil. Post
	excavation soil sample results had a few compounds above DEC soil
	guidance values. NFA. TG"
Remarks:	"cleanup pending - tank in back alleyway"
Material:	
Site ID:	485236
Operable Unit ID:	1234904
Operable Unit:	01
Material ID:	2233997
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Database(s)

EDR ID Number EPA ID Number

E15 NE < 1/8	CATHOLIC NEWS PUBLISHING 210 NORTH AVE NEW ROCHELLE, NY		NY LTANKS	S106972587 N/A
0.051 mi. 268 ft.	Site 2 of 6 in cluster E			
Relative: Lower Actual: 92 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	2005-06-13 Tank Failure Institutional, Educational, Gov., Other Known release that creates potential for fire or hazard. (Highl Improbable) Not reported False 6010 JBODee Not reported 2005-06-13 44 Not reported Other Not reported False False 0 2005-06-13	8.90 TONS OF	C, NO FURTHER
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	347516 1105241 01 1502620 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported		

Database(s)

EDR ID Number EPA ID Number

S106972587

### CATHOLIC NEWS PUBLISHING (Continued)

Tank Test:

E16	CON EDISON		NY MANIFEST	S118089619
NNE	208 NORTH AVE			N/A
< 1/8	NEW ROCHELLE, NY 10801			
0.051 mi. 269 ft.	Site 3 of 6 in cluster E			
Relative:	NY MANIFEST:			
Lower	Country:	USA		
	EPA ID:	NYP004772265		
Actual:	Facility Status:	Not reported		
91 ft.	Location Address 1:	208 NORTH AVE		
	Code:	BP		
	Location Address 2:	SB 2029		
	Total Tanks:	Not reported		
	Location City:	NEW ROCHELLE		
	Location State: Location Zip:	NY 10801		
	Location Zip 4:	Not reported		
	Eocation Zip 4.	Not reported		
	NY MANIFEST:			
	EPAID:	NYP004772265		
	Mailing Name:	CON EDISON		
	Mailing Contact:			
	Mailing Address 1:	4 IRVING PL 15TH FL		
	Mailing Address 2: Mailing City:	Not reported NEW YORK		
	Mailing State:	NY		
	Mailing Zip:	10003		
	Mailing Zip 4:	Not reported		
	Mailing Country:	USA		
	Mailing Phone:	2124603770		
	NY MANIFEST:			
	Document ID:	Not reported		
	Manifest Status:	Not reported		
	seq:	Not reported		
	Year:	2015		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID:	Not reported		
	Generator Ship Date:	04/22/2015		
	Trans1 Recv Date: Trans2 Recv Date:	04/22/2015		
	TSD Site Recv Date:	Not reported 04/23/2015		
	Part A Recv Date:	Not reported		
	Part B Recv Date:	Not reported		
	Generator EPA ID:	NYP004772265		
	Trans1 EPA ID:	Not reported		
	Trans2 EPA ID:	Not reported		
	TSDF ID 1:	NJD002200046		
	TSDF ID 2:	Not reported		
	Manifest Tracking Number:	014454078JJK		
	Import Indicator:	Ν		
	Export Indicator:	N		
	Discr Quantity Indicator:	Ν		

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 30 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 04/22/2015 04/22/2015 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 04/23/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004772265 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014454078JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported

#### S118089619

Database(s)

EDR ID Number EPA ID Number

S118089619

#### **CON EDISON (Continued)**

Waste Code: Not reported Quantity: 30 P - Pounds Units: Number of Containers: 1 Container Type: TT - Cargo tank, tank truck Handling Method: T Chemical, physical, or bid Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 04/22/2015 Trans1 Recv Date: 04/22/2015 Trans2 Recy Date: Not reported TSD Site Recv Date: 04/23/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004772265 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014454078JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Not reported Waste Code: Quantity: 30 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks

ks iological treatme	ent.	

Map ID Direction		MAP FINDINGS		
Distance				EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	CON EDISON (Continued)			S118089619
		T Chamical physical or high right treatment		3110003013
	Handling Method: Specific Gravity:	T Chemical, physical, or biological treatment.		
	Waste Code:	D008		
	Waste Code 1_2: Waste Code 1_3:	Not reported Not reported		
	Waste Code 1_4:	Not reported		
	Waste Code 1_5:	Not reported		
	Waste Code 1_6:	Not reported		
E17	NEW ROCHELLE MALL		NY Spills	S102153404
ENE < 1/8	MAIN & NORTH ST NEW ROCHELLE, NY			N/A
< 1/8 0.054 mi.	NEW ROCHELLE, NI			
285 ft.	Site 4 of 6 in cluster E			
Relative:	SPILLS:			
Lower	Facility ID: Facility Type:	8900500 ER		
Actual:	DER Facility ID:	174766		
91 ft.	Site ID:	210797		
	DEC Region: Spill Date:	3 1989-04-17		
	Spill Number/Closed Date:	8900500 / 1989-04-17		
	Spill Cause: Spill Class:	Equipment Failure Known release with minimal potential for fire or hazard.	DEC Posponso	
	Opili Olass.	Willing Responsible Party. Corrective action taken.	DEC Response.	
	SWIS:	6010		
	Investigator: Referred To:	tdghiosa Not reported		
	Reported to Dept:	1989-04-17		
	CID: Water Affected:	Not reported		
	Spill Source:	Not reported Commercial/Industrial		
	Spill Notifier:	Responsible Party		
	Cleanup Ceased: Cleanup Meets Std:	1989-04-17 True		
	Last Inspection:	1989-04-17		
	Recommended Penalty: UST Trust:	False False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spiller Name:	2003-09-29 Not reported		
	Spiller Company:	AMERADA HESS		
	Spiller Address:	238 WEST FORT LEE ST		
	Spiller City,St,Zip: Spiller Company:	BOGOTA, NJ 07160 001		
	Contact Name:	Not reported		
	Contact Phone: DEC Memo:	Not reported "Prior to Sept, 2004 data translation this spill Lead_DE0	C Field was	
		GHIOSAY "		
	Remarks:	"BEING CLEANED UP WITH WPEEDI-DRY, SPILL FR	OM VENT ON PA	RKING LOT,
		SPOKE WITH TOM KRIVAS NFA"		
	Material: Site ID:	210797		
	Operable Unit ID:	926787		

**NEW ROCHELLE MALL (Continued)** 

01

Operable Unit:

#### MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

S102153404

#### 451837 Material ID: Material Code: 0002A Material Name: #4 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: 10.00 Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: E18 MAIN ST. & NORTH AVE. NY Spills S102155080 ENE MAIN ST. & NORTH AVE. N/A NEW ROCHELLE, NY < 1/8 0.054 mi. 285 ft. Site 5 of 6 in cluster E SPILLS: **Relative:** 9405214 Facility ID: Lower Facility Type: ER Actual: **DER Facility ID:** 249072 91 ft. Site ID: 308433 DEC Region: 3 Spill Date: 1994-07-16 Spill Number/Closed Date: 9405214 / 1994-07-19 Spill Cause: Equipment Failure Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 tdghiosa Investigator: Not reported Referred To: Reported to Dept: 1994-07-16 CID: Not reported Water Affected: Not reported Spill Source: **Commercial Vehicle** Spill Notifier: Fire Department Cleanup Ceased: 1994-07-19 Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False UST Trust: False **Remediation Phase:** 0 Date Entered In Computer: 1994-07-19 Spill Record Last Update: 1994-07-19 Spiller Name: Not reported Spiller Company: RYDER TRUCK Spiller Address: Not reported Spiller City, St, Zip: NY Spiller Company: 999 Contact Name: Not reported Contact Phone: Not reported DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY

EDR ID Number Database(s) **EPA ID Number** 

S102155080

### MAIN ST. & NORTH AVE. (Continued)

Remarks:

"LINE BROKE ON TRUCK SPILLED ON ROAD FOR THREE BLOCKS CAUSING ANOTHER ACCIDENT FD & PD ON SITE DPW ENROUTE TO SAND NO IMPACT TO STORM DRAIN SEE SPILL 9405242"

Material:	
Site ID:	308433
Operable Unit ID:	999439
Operable Unit:	01
Material ID:	381809
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	35.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

E19 ENE < 1/8 0.054 mi.	ON ROAD MAIN & NORTH AVE. NEW ROCHELLE, NY	NY Spills	S102155084 N/A
285 ft.	Site 6 of 6 in cluster E		
Relative: Lower Actual: 91 ft.	SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address:	9405242 ER 144226 171382 3 1994-07-16 9405242 / 1994-07-19 Traffic Accident Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 tdghiosa Not reported 1994-07-18 Not reported Not reported Commercial Vehicle Responsible Party 1994-07-19 False Not reported False 0 2003-12-02 2003-12-02 Not reported A & P 1400 EAST AVE	

84

Map ID Direction Distance Elevation Site

ON ROAD (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S102155084

	••••••••••••••••••••••••••••••••	
	Spiller City,St,Zip:	BRONX, ZZ
	Spiller Company:	001
	Contact Name:	Not reported
	Contact Phone:	Not reported
	DEC Memo:	•
	DEC Memo.	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY "
	Descela	
	Remarks:	"TRUCK HIT DEBRIS IN ROAD AND PUNCTURED FUEL TANK NEW ROCHELLE PD ON
		SCENE ENV. PRODUCTS & SVC. CLEANED SPILL SEE SPILL 9405214"
	Material:	
	Site ID:	171382
	Operable Unit ID:	999450
		01
	Operable Unit:	
	Material ID:	381836
	Material Code:	0008
	Material Name:	diesel
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	50.00
	Units:	Gallons
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	Tank Test:	
D20 SSW < 1/8 0.055 mi.	CON EDISON MANHOLE: 12758 MAIN ST & CHURCH ST NEW ROCHELLE, NY 10801	RCRA NonGen / NLR 1016974052 NY MANIFEST NYP004478624
293 ft.	Site 3 of 7 in cluster D	
Relative:	RCRA NonGen / NLR:	
Higher	Date form received by agency	04/25/2014
5	Facility name:	CON EDISON MANHOLE: 12758
Actual:	Facility address:	MAIN ST & CHURCH ST
97 ft.		NEW ROCHELLE, NY 10801
	EPA ID:	NYP004478624
	Mailing address:	IRVING PL, 15TH FL NE
	č	NEW YORK, NY 10003
	Contact:	THOMAS TEELING
	Contact address:	Not reported
		Not reported
	Contact country:	Not reported
	Contact telephone:	(212) 460-3770
	oontaot telephone.	(212) 400 0110
	Contact email:	Not reported
	Contact email:	Not reported
	EPA Region:	02
	EPA Region: Classification:	02 Non-Generator
	EPA Region:	02
	EPA Region: Classification: Description:	02 Non-Generator
	EPA Region: Classification: Description: Handler Activities Summary:	02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste
	EPA Region: Classification: Description:	02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste

No

No

No

Database(s)

EDR ID Number EPA ID Number

### CON EDISON MANHOLE: 12758 (Continued)

Underground injection activity:

On-site burner exemption:

Furnace exemption:

Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burne	er: No
Used oil Specification markete	er: No
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by agency	CON EDISON MANHOLE: 12758
Site name: Classification:	
Classification.	Conditionally Exempt Small Quantity Generator
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYP004478624
Facility Status:	Not reported
Location Address 1:	MAIN & CHURCH ST
Code:	BP
Location Address 2:	SB12758
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10801
Location Zip 4:	Not reported
Eccation Zip 4.	Not reported
NY MANIFEST:	
EPAID:	NYP004478624
Mailing Name:	CON EDISON
Mailing Contact:	CON EDISON
Mailing Address 1:	4 IRVING ST
Mailing Address 2:	15TH ST
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NYD006982359
Trans2 State ID: Generator Ship Date:	Not reported
Generator Ship Date:	03/25/2014
Trans1 Recv Date:	03/25/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/27/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported

Database(s)

EDR ID Number EPA ID Number

Generator EPA ID:	NYP004478624
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	012770524JJK
Import Indicator:	Ν
Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Quantity:	200
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

### 1016974052

D21 SSW < 1/8 0.055 mi.	CON EDISON TRANSFORMER CHURCH ST & MAIN ST NEW ROCHELLE, NY 10802	MANHOLE: 3586	RCRA NonGen / NLR NY MANIFEST	1016974043 NYP004478517
293 ft.	Site 4 of 7 in cluster D			
Relative:	RCRA NonGen / NLR:			
Higher	Date form received by agency: 04/25/2014			
-	Facility name:	CON EDISON TRANSFORMER MANHOLE: 3	586	
Actual: 97 ft.	Facility address:	CHURCH ST & MAIN ST NEW ROCHELLE, NY 10802		
	EPA ID:	NYP004478517		
	Mailing address:	IRVING PL, 15TH FL NE NEW YORK, NY 10003		
	Contact:	THOMAS TEELING		
	Contact address:	Not reported Not reported		
	Contact country:	Not reported		
	Contact telephone:	(212) 460-3770		
	Contact email:	Not reported		
	EPA Region:	02		

EDR ID Number Database(s) EPA ID Number

Classification: Description:	Non-Generator Handler: Non-Generators do not presently generate hazardous waste	
Handler Activities Summary:		
U.S. importer of hazardou	s waste: No	
Mixed waste (haz. and rac		
Recycler of hazardous wa		
Transporter of hazardous	waste: No	
Treater, storer or dispose	r of HW: No	
Underground injection act		
On-site burner exemption		
Furnace exemption:	No	
Used oil fuel burner:	No	
Used oil processor:	No	
User oil refiner:	No No	
Used oil fuel marketer to b		
Used oil Specification mai Used oil transfer facility:	No	
Used oil transporter:	No	
Historical Generators:		
Date form received by age	•	
Site name: Classification:	CON EDISON TRANSFORMER MANHOLE: 3586 Conditionally Exempt Small Quantity Generator	
Violation Status:	No violations found	
NY MANIFEST:		
Country:	USA	
EPA ID:	NYP004478517	
Facility Status:	Not reported	
Location Address 1:	CHURCH MAIN ST	
Code:	BP	
Location Address 2: Total Tanks:	SB3586	
Location City:	Not reported NEW ROCHELLE	
Location State:	NY	
Location Zip:	10801	
Location Zip 4:	Not reported	
NY MANIFEST:		
EPAID:	NYP004478517	
Mailing Name:	CON EDISON	
Mailing Contact:	CON EDISON	
Mailing Address 1:	4 IRVING ST	
Mailing Address 2:	15TH ST	
Mailing City:	NEW YORK	
Mailing State:	NY	
Mailing Zip:	10003 Not associated	
Mailing Zip 4:	Not reported	
Mailing Country: Mailing Phone:	USA Not reported	
NY MANIFEST:	Net concrete d	
Document ID:	Not reported	
Manifest Status:	Not reported	

Database(s)

EDR ID Number **EPA ID Number** 

Year: 2014 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/25/2014 Trans1 Recv Date: 03/25/2014 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/27/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004478517 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 012770521JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 200 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 D008 Waste Code: Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

D22 SSW < 1/8 0.055 mi. 293 ft.	CON EDISON TRANSFORMER MA MAIN ST & CHRUCH ST NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster D	ANHOLE: 5042	R
Relative: Higher Actual: 97 ft.	RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID:	: 10/23/2013 CON EDISON TRANSFORMER MANHOLE: 50 MAIN ST & CHRUCH ST NEW ROCHELLE, NY 10801 NYP004364576	42

#### 1016974043

NYP004364576

RCRA NonGen / NLR 1016963458 NY MANIFEST

Database(s)

EDR ID Number EPA ID Number

Mailing address:	IRVING PL, 15TH FL NE
maning address.	NEW YORK, NY 10003
Contact:	THOMAS TEELING
Contact address:	Not reported
	Not reported
Contact country:	Not reported
Contact telephone:	(212) 460-3770
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous w
Handler Activities Summary:	
U.S. importer of hazardou	
Mixed waste (haz. and rac	
Recycler of hazardous wa	,
Transporter of hazardous	waste: No
Treater, storer or disposer	
Underground injection act	iivity: No
On-site burner exemption:	: No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to b	
Used oil Specification mar	rketer: No
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by age	encv:09/23/2013
Site name:	CON EDISON TRANSFORMER MANHOLE: 5042
Classification:	Conditionally Exempt Small Quantity Generator
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYP004364576
Facility Status:	Not reported
Location Address 1:	MAINS T & CHURCH ST
Code:	BP
Location Address 2:	TM 5042
	Not reported
Total Tanks:	
Location City:	NEW ROCHELLE
Location City: Location State:	NY
Location City: Location State: Location Zip:	NY Not reported
Location City: Location State:	NY
Location City: Location State: Location Zip:	NY Not reported
Location City: Location State: Location Zip: Location Zip 4:	NY Not reported
Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST:	NY Not reported Not reported
Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID:	NY Not reported NYP004364576
Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name:	NY Not reported NYP004364576 CON EDISON
Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact:	NY Not reported NYP004364576 CON EDISON CON EDISON
Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1:	NY Not reported NYP004364576 CON EDISON CON EDISON 4 IRVING PL 15TH FL

Database(s)

EDR ID Number EPA ID Number

1016963458

Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770
3	
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2013
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	09/23/2013
Trans1 Recv Date:	09/23/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/26/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004364576
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	011694706JJK
Import Indicator:	Ν
Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code: Waste Code:	Not reported
Waste Code:	Not reported Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	120
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

# CON EDISON TRANSFORMER MANHOLE: 5042 (Continued)

Database(s)

EDR ID Number EPA ID Number

D23 SSW < 1/8 0.055 mi.	CON EDISON MAIN ST & CHURCH ST OSSINING, NY 10801		NY MANIFEST	S117535683 N/A
293 ft.	Site 6 of 7 in cluster D			
Relative: Higher Actual: 97 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location Address 2: Total Tanks: Location City: Location City: Location State: Location Zip Location Zip 4: NY MANIFEST: EPAID: Mailing Name:	USA NYP004680070 Not reported MAIN ST & CHURCH ST BP MH2419 Not reported OSSINING NY 10801 Not reported NYP004680070 CON EDISON CON EDISON		
	Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported		
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans1 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number:	Not reported Not reported 2014 NYD006982359 Not reported 10/19/2014 10/19/2014 Not reported 10/21/2014 Not reported Not reported Not reported NyP004680070 Not reported Not reported Not reported Not reported O12774891JJK N N N N N N N N N		

Map ID Direction Distance Elevation Site MAP FINDINGS

Not reported

Database(s)

EDR ID Number EPA ID Number

S117535683

#### CON EDISON (Continued)

Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1 3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported 25 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported

F24 NNE < 1/8 0.066 mi. 346 ft.	SPEEDY CLEANERS 217 NORTH AVENUE NEW ROCHELLE, NY 10801 Site 1 of 2 in cluster F	
Relative: Lower Actual: 91 ft.	US AIRS MINOR: Envid: Region Code: Programmatic ID: Facility Registry ID: D and B Number: Primary SIC Code: NAICS Code: Default Air Classification Code: Facility Type of Ownership Code: Air CMS Category Code: HPV Status:	1006295756 02 AIR NY0000NY3551000344 110012166921 Not reported 7212 812320 MIN POF Not reported Not reported

FINDS:

Registry ID:

#### 110012166921

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V

US AIRS 1006295756 FINDS N/A NY DRYCLEANERS ECHO

Database(s)

EDR ID Number EPA ID Number

# 1006295756

## SPEEDY CLEANERS (Continued)

of the Clean Air Act.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

DRYCLEANERS:	
Facility ID:	3-5510-00344
Phone Number:	914-654-9082
Region:	Not reported
Registration Effective Date:	9/24/2003 13:22:51:203
Inspection Date:	03DEC31
Install Date:	00/03
Drop Shop:	Not reported
Shutdown:	Y
Alternate Solvent:	Not reported
Current Business:	Not reported

#### ECHO:

Envid: Registry ID: DFR URL: 1006295756 110012166921 http://echo.epa.gov/detailed\_facility\_report?fid=110012166921

F25 North < 1/8 0.067 mi.	CVS PHARMACY #8447 222 NORTH AVE NEW ROCHELLE, NY 10801	RCRA-LQG 1014958220 NY MANIFEST NYR000194654
356 ft.	Site 2 of 2 in cluster F	
Relative: Lower Actual: 91 ft.	RCRA-LQG: Date form received by agend Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description:	y: 03/17/2014 CVS PHARMACY #8447 222 NORTH AVE NEW ROCHELLE, NY 10801 NYR000194654 CVS DR 23062A WOONSOCKET, RI 02895 WENDY BRANT CVS DR WOONSOCKET, RI 02895 US (401) 765-1500 WENDY.BRANT@CVSCAREMARK.COM 02 Large Quantity Generator Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting

EDR ID Number Database(s) EPA ID Number

## CVS PHARMACY #8447 (Continued)

## 1014958220

from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date: Owner/Op end date:	45 SOUTH MAIN STREET CORP GLEN OAKS DR RYE, NY 10580 US (917) 757-4922 Private Owner 01/20/2011 Not reported
Owner/operator name: Owner/operator address:	45 SOUTH MAIN STREET CORP GLEN OAKS DRIVE RYE, NY 10580
Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date: Owner/Op end date:	US (917) 757-4922 Private Owner 01/20/2011 Not reported
Owner/operator name: Owner/operator address:	CVS ALBANY, L.L.C. GLEN OAKS DRIVE
	RYE, NY 10580
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator 07/30/2011
Owner/Op start date: Owner/Op end date:	Not reported
Owner/Op end date.	Not reported
Owner/operator name:	CVS ALBANY LLC
Owner/operator address:	Not reported
	Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date: Owner/Op end date:	07/30/2011 Not reported
Owner/Op end date.	Not reported
Handler Activities Summary:	
U.S. importer of hazardous wa Mixed waste (haz. and radioa	
Recycler of hazardous waste:	
Transporter of hazardous waste	
Treater, storer or disposer of l	
Underground injection activity	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No

Database(s)

EDR ID Number EPA ID Number

CVS PHARMACY #8447 (Continued	) 1014958220
User oil refiner: Used oil fuel marketer to burner:	No No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code: D	001
	SNITABLE WASTE
	010
. Waste name: SI	ELENIUM
. Waste code: PO	001
	H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS,
	HEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & ALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
. Waste code: PO	075
	ICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, &
Si	ALTS
. Waste code: P	081
	2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
. Waste code: P <sup>-</sup>	188
	ENZOIC ACID, 2-HYDROXY-, COMPD. WITH
	AS-CIS)-1,2,3,3A,8,8A-HEXAHYDRO-1,3A,8-TRIMETHYLPYRROLO[2,3-B]INDOL- ′L METHYLCARBAMATE ESTER (1:1) (OR) PHYSOSTIGMINE SALICYLATE
Historical Generators:	
Date form received by agency: 07	7/01/2013
	VS PHARMACY #8447
Classification: La	arge Quantity Generator
. Waste code: D	001
	GNITABLE WASTE
. Waste Hame.	
. Waste code: De	002
. Waste name: Co	ORROSIVE WASTE
Wests adds:	009
	ERCURY
. Waste hame.	EKOKI
. Waste code: De	011
. Waste name: SI	ILVER
Wests and a	004
	001 H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS,
W	HEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & ALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
. Waste code: Po	042
	2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) PINEPHRINE
. Waste code: P	075
	ICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, &

EDR ID Number Database(s) EPA ID Number

	SALTS
. Waste code:	P081
. Waste name:	1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
Date form received by a	gency: 03/05/2012
Site name:	CVS PHARMACY #8447
Classification:	Conditionally Exempt Small Quantity Generator
. Waste code:	D001
. Waste name:	IGNITABLE WASTE
. Waste code:	D002
. Waste name:	CORROSIVE WASTE
. Waste code:	P001
. Waste name:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS
	WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARI SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
	GALLO, WILLIT REGENTAT GONGLITHATIONG GREATER THAN 0.5/1
. Waste code:	P042
. Waste name:	1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE
. Waste code:	P075
. Waste name:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, &
. Waste hame.	SALTS
. Waste code:	P081
. Waste name:	1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYR000194654
Facility Status:	Not reported
Location Address 1:	222 NORTH AVE.
Code:	BP
Location Address 2:	Not reported
Total Tanks:	
Location City: Location State:	NEW ROCHELLE NY
Location Zip:	10801
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYR000194654
Mailing Name:	CVS PHARMACY #8447
Mailing Contact:	CVS PHARMACY #8447
Mailing Address 1:	222 NORTH AVE
Mailing Address 2:	Not reported
Mailing City:	NEW ROCHELLE
Mailing State:	NY
Mailing Zip:	10801
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	9146377591

Database(s)

EDR ID Number EPA ID Number

## CVS PHARMACY #8447 (Continued)

NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 04/03/2013 Trans1 Recv Date: 04/03/2013 Trans2 Recv Date: 04/05/2013 TSD Site Recv Date: 04/12/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005199016FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 16 Units: P - Pounds Number of Containers: 1 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 04/03/2013 04/03/2013 Trans1 Recv Date:

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Trans2 Recv Date: 04/05/2013 04/12/2013 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005199016FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Not reported Waste Code: Waste Code: Not reported Quantity: 8 Units: P - Pounds Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 04/03/2013 Trans1 Recv Date: 04/03/2013 Trans2 Recv Date: 04/05/2013 TSD Site Recy Date: 04/12/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Manifest Tracking Number: 005199016FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν **Discr Type Indicator:** Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 20 P - Pounds Units: Number of Containers: 2 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 P188 Waste Code: Waste Code 1\_2: P001 Waste Code 1 3: P075 Waste Code 1 4: P081 Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 10/07/2013 Trans1 Recv Date: 10/07/2013 10/11/2013 Trans2 Recv Date: TSD Site Recv Date: 10/18/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005429484FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported

Database(s)

EDR ID Number EPA ID Number

Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 3 P - Pounds Units: Number of Containers: 1 Container Type: BA - Burlap, plastic, paper bags Handling Method: L Landfill. Specific Gravity: Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 10/07/2013 Trans1 Recv Date: 10/07/2013 Trans2 Recv Date: 10/11/2013 TSD Site Recy Date: 10/18/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported 005429484FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

Quantity: 0.04 P - Pounds Units: Number of Containers: 1 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: P001 Waste Code: Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 10/07/2013 Trans1 Recv Date: 10/07/2013 Trans2 Recv Date: 10/11/2013 TSD Site Recy Date: 10/18/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005429484FLE Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν **Discr Full Reject Indicator:** Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 15 P - Pounds Units: Number of Containers: 2 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: Waste Code: P188 Waste Code 1 2: P001 Waste Code 1\_3: P075

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Waste Code 1\_4: P081 Waste Code 1\_5: Not reported Not reported Waste Code 1\_6: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 01/08/2013 Trans1 Recv Date: 01/08/2013 Trans2 Recv Date: 01/16/2013 TSD Site Recv Date: 01/30/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005535371FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν **Discr Full Reject Indicator:** Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 13 Units: P - Pounds Number of Containers: 1 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1 6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Trans2 State ID: NJR000063677 Generator Ship Date: 01/08/2013 Trans1 Recv Date: 01/08/2013 Trans2 Recv Date: 01/16/2013 TSD Site Recv Date: 01/30/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported 005535371FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 2 P - Pounds Units: Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 01/08/2013 01/08/2013 Trans1 Recv Date: Trans2 Recv Date: 01/16/2013 01/30/2013 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005535371FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 6 Units: P - Pounds Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1 5: Not reported Waste Code 1 6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 01/08/2013 Trans1 Recv Date: 01/08/2013 Trans2 Recv Date: 01/16/2013 TSD Site Recv Date: 01/30/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005535371FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

**Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 1 Units: P - Pounds Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: P188 P001 Waste Code 1\_2: Waste Code 1\_3: P075 Waste Code 1\_4: P081 Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 NJR000063677 Trans2 State ID: Generator Ship Date: 07/24/2013 Trans1 Recv Date: 07/24/2013 Trans2 Recv Date: 07/30/2013 TSD Site Recv Date: 08/09/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 007144620JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 3 Units: P - Pounds Number of Containers: CF - Fiber or plastic boxes, cartons Container Type: Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 07/24/2013 Trans1 Recv Date: 07/24/2013 Trans2 Recv Date: 07/30/2013 TSD Site Recv Date: 08/09/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 007144620JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν **Discr Type Indicator:** Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 8 P - Pounds Units: Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 CTD983872698 Trans1 State ID: NJR000063677 Trans2 State ID: Generator Ship Date: 07/24/2013 Trans1 Recv Date: 07/24/2013 Trans2 Recv Date: 07/30/2013 TSD Site Recy Date: 08/09/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported 007144620JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν **Discr Type Indicator:** Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 7 Units: P - Pounds Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: D010 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

seq: Not reported Year: 2012 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 09/24/2012 Trans1 Recv Date: 09/24/2012 Trans2 Recv Date: 10/01/2012 TSD Site Recv Date: 10/09/2012 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005833472FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 2.0 P - Pounds Units: 1.0 Number of Containers: CF - Fiber or plastic boxes, cartons Container Type: Handling Method: L Landfill. Specific Gravity: 1.0 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2012 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 09/24/2012 Trans1 Recv Date: 09/24/2012 Trans2 Recy Date: 10/01/2012 TSD Site Recy Date: 10/09/2012 Part A Recv Date: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Part B Recv Date: Not reported NYR000194654 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported 005833472FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 18.0 Units: P - Pounds Number of Containers: 1.0 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1.0 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Not reported Waste Code 1\_6: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2012 Trans1 State ID: CTD983872698 Trans2 State ID: NJD054126164 Generator Ship Date: 09/24/2012 Trans1 Recv Date: 09/24/2012 Trans2 Recv Date: 10/01/2012 TSD Site Recv Date: 10/09/2012 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 005833472FLE Import Indicator: Ν Export Indicator: Ν

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

**Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν **Discr Full Reject Indicator:** Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 0.04 Units: P - Pounds Number of Containers: 1.0 Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1.0 Waste Code: P001 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2014 Trans1 State ID: MNS000110924 Trans2 State ID: NJD054126164 Generator Ship Date: 03/28/2014 Trans1 Recv Date: 03/28/2014 Trans2 Recv Date: 04/03/2014 TSD Site Recv Date: 04/07/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported 006441835FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: 0.04 Units: Number of Containers: Container Type: Handling Method: Specific Gravity: 1 P001 Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1 6: Document ID: Manifest Status: seq: Year: 2014 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν **Discr Full Reject Indicator:** Ν Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: H141 Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: 27 Units: P - Pounds Number of Containers: 1

Not reported Not reported Not reported Not reported Not reported Not reported P - Pounds CF - Fiber or plastic boxes, cartons L Landfill. Not reported MNS000110924 NJD054126164 03/28/2014 03/28/2014 04/03/2014 04/07/2014 Not reported Not reported NYR000194654 Not reported Not reported INR000110197 Not reported 006441835FLE Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Container Type: CF - Fiber or plastic boxes, cartons Handling Method: L Landfill. Specific Gravity: 1 Waste Code: P188 Waste Code 1\_2: P001 P075 Waste Code 1\_3: Waste Code 1\_4: P081 Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Not reported Manifest Status: seq: Not reported Year: 2014 Trans1 State ID: CTD983872698 Trans2 State ID: NJR000063677 Generator Ship Date: 06/16/2014 Trans1 Recv Date: 06/16/2014 Trans2 Recv Date: 06/19/2014 TSD Site Recv Date: 06/26/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: INR000110197 TSDF ID 2: Not reported Manifest Tracking Number: 007211387FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 0.01 Units: P - Pounds Number of Containers: Container Type: CF - Fiber or plastic boxes, cartons Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 1 Waste Code: P001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1 5: Not reported Waste Code 1\_6: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CVS PHARMACY #8447 (Continued)

Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2014 Trans1 State ID: MNS000110924 Trans2 State ID: NJD054126164 Generator Ship Date: 09/09/2014 Trans1 Recv Date: 09/09/2014 Trans2 Recv Date: 09/23/2014 TSD Site Recv Date: 10/09/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000194654 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported INR000110197 TSDF ID 1: TSDF ID 2: Not reported 007274056FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Not reported Waste Code: Quantity: 1 Units: P - Pounds Number of Containers: 1 CF - Fiber or plastic boxes, cartons Container Type: L Landfill. Handling Method: Specific Gravity: 1 Waste Code: D007 Waste Code 1\_2: D010 Waste Code 1\_3: Not reported Not reported Waste Code 1\_4: Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

<u>Click this hyperlink</u> while viewing on your computer to access 40 additional NY\_MANIFEST: record(s) in the EDR Site Report.

Database(s)

EDR ID Number EPA ID Number

D26 SSW < 1/8 0.069 mi.	COMMERCIAL PROPERTY 518,522&525 MAIN STREET NEW ROCHELLE, NY		NY Spills	S107658956 N/A
364 ft.	Site 7 of 7 in cluster D			
0.069 mi.		0600054 ER 312228 361977 3 2006-04-03 0600054 / 2011-01-13 Equipment Failure Known release that creates potential for fire or hazard. (High Improbable) 6010 TDGHIOSA Not reported 2006-04-03 444 Not reported Institutional, Educational, Gov., Other Other Not reported False Not reported False Sate 0 2006-04-03 2011-01-13 MR SAMUAL GACCIONE SIMONE CHURCH STREET LLC 518 MAIN STREET NEW ROCHELLE, NY 999 MR SAMUAL GACCIONE (914) 665-5511 "04/04/06: Borings around tank (probabaly 275-550) showed contamination; no known impacts at this time; will report to C and remove tank as part of property redevelopment. 04/10/0 red from JC Broderick & Associates, Inc. A Geo Probe sur- performed in the vicinty of 1 of 2 tanks on the parcel and ZPP conamination mas present in subsurface soils. Other tank v inaccessible location so conditions are unknown there. Repo stated that the property is going to be redeveloped. TG 05/06 Letter sent to Samuel Gaccione of the TNS Developement G that the pertoleum impacted soil surrounding the tank be exc and removed. TG 11/03/10 Bill Shlagetter from Preferred En called and report eceived from Preferred Environmental Edocs). 1,000 gallon UST removed along with 146.5 tons of soil. NFA. TG "CONTAMINATED SOIL AT THIS LOCATION:"	9'Dee 6 Report /ey was etroleum was in an rt author 8/06 Group requiring avated vironmental emoved be ind Spill (placed on	

Database(s)

EDR ID Number EPA ID Number

Material:	
Site ID:	361977
Operable Unit ID:	1120090
Operable Unit:	01
Material ID:	2109574
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

G27 NW < 1/8 0.073 mi. 388 ft.	LAWTON STREET REALTY CORP. 41-43 LAWTON STREET NEW ROCHELLE, NY 10801 Site 1 of 4 in cluster G		NY UST	U004176798 N/A
Relative: Higher Actual: 94 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Name: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Overfill Prevention: Dispenser:	3-801435 / Active Lawton Street Realty Corp. Lawton Street Realty Corp. 4391 Boston Post Road Not reported Pelham Manor NY 10803 Not reported 001 1. In-Service 3000 1. No. 2 fuel oil 0 0. None 06/01/1927 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating 0. None 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 1. Steel/Carbon/ Steel/Iron 1. Steel/Carbon/ Steel/Iron 1. Steel/Carbon/ Steel/Iron 2. Vent Whistle 0. None 3. None		

# S107658956

Database(s)

EDR ID Number EPA ID Number

G28 NW < 1/8	PAVEMENT 41 LAWTON STREET NEW ROCHELLE, NY	NY Spills	S112147960 N/A
0.073 mi. 388 ft.	Site 2 of 4 in cluster G		
NW < 1/8 0.073 mi.	41 LAWTON STREET NEW ROCHELLE, NY	1203965 ER 421153 466814 3 2012-07-23 1203965 / 2012-07-23 Equipment Failure Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JPCUMMIN Not reported 2012-07-23 Not reported Commercial Vehicle Other Not reported False False False False 0 2012-07-23 BADGE 620 UNKNOWN 41 LAWTON STREET NEW ROCHELLE, NY 999 BADGE 620	
	Contact Phone:	(914) 231-1905	
	DEC Memo: Remarks:	"7-23-12 FD cleaned up. jc" "Possibly from garbage truck. Fire Dept. Clean up."	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	466814 1216796 01 2215011 0010 hydraulic oil Not reported Petroleum 5.00 Gallons Not reported Not reported Not reported Not reported Not reported	

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	PAVEMENT (Continued) Tank Test:			S112147960
29 SSW < 1/8 0.078 mi. 413 ft.	COMMERCIAL PROPERTY 522 MAIN STREET NEW ROCHELLE, NY		NY LTANKS	S111012266 N/A
Relative: Higher Actual: 98 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Region: DEC Memo: Remarks: Material: Site ID: Operable Unit ID:	2011-04-20 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard release with no damage. DEC Response. Willing Respon Corrective action taken. Not reported True 6010 jbodee Not reported 2011-04-20 Not reported Tank Tester Not reported Tank Tester Not reported False False 0 2011-04-20 2011-06-06 PETER OH ADELPHI Not reported NY 999 JEFF (800) 440-8265 Not reported 3 402739 "Spoke to Georgia at Advanced. Soil boring had field evic petroleum impact. DT 4/20/11 6/6/11: Report from Prefer Environmental entered into eDocs. NFA jod" "1721 THE CALLER ADVISED DISPATCH THEY ARE A RESULTS."	dence of rred	ST
	Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.:	1198388 01 2194662 0001A #2 fuel oil Not reported		

Database(s)

EDR ID Number EPA ID Number

# COMMERCIAL PROPERTY (Continued)

Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

H30 North < 1/8 0.080 mi.	CON ED 230 NORTH AVE NEW ROCHELLE, NY 10801		NY MANIFEST	S118088454 N/A
422 ft.	Site 1 of 12 in cluster H			
Relative:	NY MANIFEST:			
Lower	Country:	USA		
A	EPA ID:	NYP004760179		
Actual: 90 ft.	Facility Status:	Not reported		
30 11.	Location Address 1:	OPP 230 NORTH AVE		
	Code: Location Address 2:	BP TM 3585		
	Total Tanks:			
	Location City:	Not reported NEW ROCHELLE		
	Location State:	NY		
	Location Zip:	10801		
	Location Zip 4:	Not reported		
	NY MANIFEST:			
	EPAID:	NYP004760179		
	Mailing Name: Mailing Contact:	CON ED TOM TEELING		
	Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR		
	Mailing Address 2:	Not reported		
	Mailing City:	NEW YORK		
	Mailing State:	NY		
	Mailing Zip:	10003		
	Mailing Zip 4:	Not reported		
	Mailing Country:	USA		
	Mailing Phone:	2124603770		
	NY MANIFEST:			
	Document ID:	Not reported		
	Manifest Status:	Not reported		
	seq:	Not reported		
	Year:	2015		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID:	Not reported		
	Generator Ship Date:	03/30/2015		
	Trans1 Recv Date:	03/30/2015		
	Trans2 Recv Date:	Not reported		
	TSD Site Recv Date:	04/01/2015		
	Part A Recv Date:	Not reported		
	Part B Recv Date:	Not reported		
	Generator EPA ID:	NYP004760179		
	Trans1 EPA ID:	Not reported		

Database(s)

EDR ID Number EPA ID Number

#### CON ED (Continued)

Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091109JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 600 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1 6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported 03/30/2015 Generator Ship Date: Trans1 Recv Date: 03/30/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004760179 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091109JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν

#### S118088454

Map ID Direction Distance Elevation Site

#### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### CON ED (Continued)

**Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 600 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 NYD006982359 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 03/30/2015 Trans1 Recv Date: 03/30/2015 Trans2 Recv Date: Not reported 04/01/2015 TSD Site Recv Date: Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYP004760179 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091109JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

S118088454

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

RCRA NonGen / NLR

EDR ID Number EPA ID Number

#### S118088454

1018281086 NYP004760179

#### CON ED (Continued)

Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6: Not reported Not reported 600 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported

#### H31 CON EDISON North 230 NORTH AVE

NEW ROCHELLE, NY 10801 < 1/8 0.080 mi. 422 ft. Site 2 of 12 in cluster H RCRA NonGen / NLR: **Relative:** Date form received by agency: 03/30/2015 Lower Facility name: CON EDISON Actual: Facility address: 230 NORTH AVE 90 ft. NEW ROCHELLE, NY 10801 EPA ID: NYP004760179 Mailing address: IRVING PL, 15TH FL NE NEW YORK, NY 10003 Contact: THOMAS TEELING Not reported Contact address: Not reported Contact country: Not reported Contact telephone: (212) 460-3770 Contact email: Not reported EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste Handler Activities Summary:

U.S. importer of hazardous waste: Mixed waste (haz. and radioactive): Recycler of hazardous waste: Transporter of hazardous waste: Treater, storer or disposer of HW: Underground injection activity:	No No No No No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Database(s)

EDR ID Number EPA ID Number

	CON EDISON (Continued)			1018281086
	Historical Generators:			
	Date form received by agend	xv: 03/30/2015		
	Site name:	CON EDISON		
	Classification:	Large Quantity Generator		
	Violation Status:	No violations found	_	
H32 North < 1/8 0.080 mi.	CONCRETE FLOORING WITH C 230 NORTH AVENUE NEW ROCHELLE, NY	RACKS	NY Spills	S116554293 N/A
422 ft.	Site 3 of 12 in cluster H			
Relative:	SPILLS:	4 400077		
Lower	Facility ID:	1400277		
Actual:	Facility Type: DER Facility ID:	ER 448207		
90 ft.	Site ID:	448397 493512		
	DEC Region:	3		
	Spill Date:	2014-04-08		
	Spill Number/Closed Date:	1400277 / Not Reported		
	Spill Cause:	Equipment Failure		
	Spill Class:	Known release that creates potential for fire or hazard. DEC Re	esponse.	
		Willing Responsible Party. Corrective action taken.		
	SWIS:	6010		
	Investigator:	RDBENDEL		
	Referred To:	WCDOH PBS		
	Reported to Dept:	2014-04-08		
	CID: Water Affected:	Not reported Not reported		
	Spill Source:	Private Dwelling		
	Spill Notifier:	Other		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Std:	False		
	Last Inspection:	2014-04-09		
	Recommended Penalty:	False		
	UST Trust:	False		
	Remediation Phase:	4		
	Date Entered In Computer:	2014-04-08		
	Spill Record Last Update:	2014-04-10		
	Spiller Name: Spiller Company:	Not reported STERLING SOLUTIONS		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	NY		
	Spiller Company:	999		
	Contact Name:	FRANK LANZELLI		
	Contact Phone:	(914) 666-4328		
	DEC Memo:	"4-9-14 Last night I traded voicemails with Jerry. He said that h		
		didn't know anymore than provided to the Hotline and I should		
		Frank in the morning. This morning I spoke to Frank. Location	nas a	
		1500 gallon vaulted tank with a remote fill at curb. There is	and it	
		currently some oil in the basement sump. Sump is unplugged a		
		doesn't appear any was pumped out. Frank doesn't know when from, but vault sounds inaccessible. Frank is trying to contact	ie on came	
		management company to let them know tank needs to be teste	he	
		Management Company: Sterling Solutions, 914/437-6245, Aur		
		Almeada contact Owner: Milka Iwanow, 914/409-6513 jc 4/09/		
		received this morning from Chris Lalak: Sebastian went to this		
		e e e e e e e e e e e e e e e e e e e		

EDR ID Number Database(s) EPA ID Number

### CONCRETE FLOORING WITH CRACKS (Continued)

and will follow up. It is a block away from my office. The tank in a vaulted AST (1500 gallon from 1931). There is a spill across the floor and in cracks in the floor getting to a sump pump. The sump goes to the sanitary. The spill may have been going on for so time, the super was very vague. The AST is visible except for a small area that sticks into the floor of the vault. The tank is not visibly leaking. Almeida replaced the underground lines with above ground lines recently. The between the tank, the former underground lines, and the sump is some distance and they will need to excavate the floor. The building has hired Dutchess. Pumping out the tank is not simple. The building has natural gas and oil. jod 04-09-14 followup email, After a second look at this one with a plumber, It looks like the old lines might be leaking. The plumber will uncover the old lines. The tank is not being pumped out at this time. The bottom of the tank is visible for the most part. (the plumber went in the vault, before we were there). Possibly, the remote fill is also an issue. They will replace the tank with an unregulated tank. Sebastian will continue to handle the spill. The floor will be opened up tomorrow to investigate. RDB " "Caller advised unknown amount of oil spilled onto concrete floor

Remarks:

### Material:

Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:

01 2243651 0001A #2 fuel oil Not reported Petroleum Not reported Not reported Not reported Not reported

493512

1243015

with cracks. Clean up is pending."

#### Tank Test:

H33 North < 1/8 0.080 mi. 422 ft.	MKM EQUITY, LLC 230 NORTH AVENUE NEW ROCHELLE, NY 10801 Site 4 of 12 in cluster H	
Relative: Lower Actual: 90 ft.	WESTCHESTER CO. AST: PBS Number: Site Status: GDS Number: Operator Name: Owner Name: Owner Name: Owner Street: Owner Address2: Owner City/State/Zip:	3-600105 Unregulated Not reported Pedro Benoit MKM Equity, LLC c/o Cornell Pace Inc. 542 Main Street, Ste. 2 Not reported New Rochelle, NY 10801
	Tank Number: Status:	1 5. Closed - removed

NY AST A100365275 N/A

Database(s)

EDR ID Number EPA ID Number

# MKM EQUITY, LLC (Continued)

A100365275

Date Installation: Capacity: Product Stored: Product Stored Percent: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Leak Detection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Piping Leak Detection: Piping Leak Detection: Piping Secondary Containment: Overfill Prevention: Spill Prevention:	08/01/1931 1500 1. No. 2 fuel oil Not reported 10/23/2014 6. Aboveground in subterranean vault with access for inspections 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. None 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 0. None 0. None 0. None 1. Float Vent Valve 0. None
Dispenser:	0. None

G34 NW < 1/8 0.081 mi.	ACCESSOCRAFT PRODUCTS IN 48 LAWTON ST NEW ROCHELLE, NY 10802	C R	CRA NonGen / NLR FINDS NY MANIFEST ECHO	1001079768 NYR000014753
427 ft.	Site 3 of 4 in cluster G			
Relative: Higher	RCRA NonGen / NLR: Date form received by agency Facility name:	: 01/01/2007 ACCESSOCRAFT PRODUCTS INC		
Actual: 94 ft.	Facility address:	48 LAWTON ST NEW ROCHELLE, NY 10802		
	EPA ID:	NYR000014753		
	Mailing address:	LAWTON ST NEW ROCHELLE, NY 10802		
	Contact:	Not reported		
	Contact address:	LAWTON ST NEW ROCHELLE, NY 10802		
	Contact country:	US		
	Contact telephone:	Not reported		
	Contact email:	Not reported		
	EPA Region:	02 Non Conceptor		
	Classification: Description:	Non-Generator Handler: Non-Generators do not presently generate	bazardouc wasta	
	Description.	Handler. Non-Generators do not presently generate	TIAZATUOUS WASIE	
	Owner/Operator Summary:			
	Owner/operator name: Owner/operator address:	CITY OF NEW ROCHELLE NORTH AVE - CITY HALL NEW ROCHELLE, NY 10802		
	Owner/operator country:	US		
	Owner/operator telephone:	(914) 654-2163		
	Legal status:	Municipal		
	Owner/Operator Type:	Operator Net apparted		
	Owner/Op start date:	Not reported		
	Owner/Op end date:	Not reported		
	Owner/operator name:	CITY OF NEW ROCHELLE		
	Owner/operator address:	NORTH AVE - CITY HALL		

Database(s)

EDR ID Number EPA ID Number

ACCESSOCRAFT PRODUCTS IN	C (Continued)	1001079768
	NEW ROCHELLE, NY 10802	
Owner/onerotor country		
Owner/operator country:	US (914) 654-2163	
Owner/operator telephone:		
Legal status:	Municipal Owner	
Owner/Operator Type: Owner/Op start date:	Not reported	
Owner/Op end date:	Not reported	
Owner/Op end date.	Notreponed	
Handler Activities Summary:		
U.S. importer of hazardous w	aste: No	
Mixed waste (haz. and radioa	active): No	
Recycler of hazardous waste	: No	
Transporter of hazardous wa	ste: No	
Treater, storer or disposer of	HW: No	
Underground injection activity	/: No	
On-site burner exemption:	No	
Furnace exemption:	No	
Used oil fuel burner:	No	
Used oil processor:	No	
User oil refiner:	No	
Used oil fuel marketer to burr		
Used oil Specification market	er: No	
Used oil transfer facility:	No	
Used oil transporter:	No	
Date form received by agenc Site name: Classification:	y:01/01/2006 ACCESSOCRAFT PRODUCTS INC Not a generator, verified	
Date form received by agenc	vr 05/10/1006	
Site name:	ACCESSOCRAFT PRODUCTS INC	
Classification:	Not a generator, verified	
Classification.	Not a generator, venned	
. Waste code:	NONE	
. Waste name:	None	
Date form received by agenc		
Site name:	ACCESSOCRAFT PRODUCTS INC	
Classification:	Large Quantity Generator	
Date form received by agenc		
Site name:	ACCESSOCRAFT PRODUCTS INC	
Classification:	Large Quantity Generator	
. Waste code:	D001	
. Waste name:	IGNITABLE WASTE	
. Waste code:	D002	
. Waste name:	CORROSIVE WASTE	
. Waste code:	D003	
. Waste name:	REACTIVE WASTE	
. Waste code:	F003	
. Waste code.	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE	ACETONE ETHVI
. waste name.		.,

Map ID	
Direction	
Distance	
Elevation	Site

EDR ID Number Database(s) EPA ID Number

ACCESSOCRAFT PRODUCTS	NC (Continued)	1001079768
	ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KI ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLV MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVI NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTL CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONH SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUM MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F00 BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS A MIXTURES.	ENT E SPENT JRES/BLENDS JALOGENATED ME) OF ONE OR J5; AND STILL
. Waste code: . Waste name:	F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUEN KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVEN CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OI LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE F THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.	E, T MIXTURES/BLENDS E (BY VOLUME) OF R THOSE SOLVENTS
. Waste code: . Waste name:	F006 WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING O FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZ (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGA ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AN PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND M ALUMINUM.	ING OF ALUMINUM; ITED BASIS) ON CARBON ND ALUMINUM
. Waste code: . Waste name:	P030 CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIF	IED
. Waste code: . Waste name:	P098 POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)	
. Waste code: . Waste name:	P106 SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)	
Violation Status:	No violations found	
FINDS:		
Registry ID:	110000849672	
Conserva events an and treat, program s	mation System o is a national information system that supports the Resource tion and Recovery Act (RCRA) program through the tracking of d activities related to facilities that generate, transport, store, or dispose of hazardous waste. RCRAInfo allows RCRA staff to track the notification, permit, compliance, and action activities required under RCRA.	
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1:	USA NYR000014753 Not reported 48 LAWTON STREET	

Database(s)

EDR ID Number EPA ID Number

1001079768

ACCESSOCRAFT PRODUCTS INC (	Continued)
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10802
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYR000014753
Mailing Name:	ACCESSOCRAFT INC
Mailing Contact:	PAUL STEINMAN
Mailing Address 1:	48 LAWTON STREET
Mailing Address 2:	Not reported
Mailing City:	NEW ROCHELLE
Mailing State:	NY
Mailing Zip:	10802
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	9146322411
NY MANIFEST:	
Document ID:	RIC0034295
Manifest Status:	С
seq:	Not reported
Year:	1996
Trans1 State ID:	RI49238
Trans2 State ID:	Not reported
Generator Ship Date:	01/22/1996
Trans1 Recv Date:	01/22/1996
Trans2 Recv Date:	/ /
TSD Site Recv Date:	01/23/1996
Part A Recv Date: Part B Recv Date:	02/01/1996 02/05/1996
Generator EPA ID:	NYR000014753
Trans1 EPA ID:	RID059735761
Trans2 EPA ID:	Not reported
TSDF ID 1:	RID059735761
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F009 - UNKNOWN
Waste Code:	Not reported

# Α

Database(s)

EDR ID Number EPA ID Number

#### ACCESSOCRAFT PRODUCTS INC (Continued)

Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date:

00148 G - Gallons (liquids only)\* (8.3 pounds) 003 DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. 100 D003 - NON-LISTED REACTIVE WASTES Not reported Not reported Not reported Not reported 00160 P - Pounds 002 DM - Metal drums, barrels B Incineration, heat recovery, burning. 100 F007 - PLATING BATH SOL FM ELECTROPLATING OPER Not reported Not reported Not reported Not reported 00152 G - Gallons (liquids only)\* (8.3 pounds) 003 DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. 100 NYB7484175 С Not reported 1995 Not reported LB49775QC 12/19/1995 12/19/1995 11 12/20/1995 01/04/1996 01/05/1996 NYR000014753 NYD986909752 Not reported CDD980756415 Not reported Not reported

Not reported

Database(s)

EDR ID Number EPA ID Number

### ACCESSOCRAFT PRODUCTS INC (Continued)

MGMT Method Type Code: Not reported D006 - CADMIUM 1.0 MG/L TCLP Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 07496 Units: P - Pounds Number of Containers: 001 Container Type: CF - Fiber or plastic boxes, cartons L Landfill. Handling Method: Specific Gravity: 100 Document ID: NYB6969807 Manifest Status: С seq: Not reported Year: 1995 Trans1 State ID: PD1011 Trans2 State ID: Not reported Generator Ship Date: 10/19/1995 Trans1 Recv Date: 10/19/1995 Trans2 Recv Date: 11 TSD Site Recv Date: 10/19/1995 Part A Recv Date: 02/22/1996 Part B Recv Date: 11/07/1995 Generator EPA ID: NYR000014753 Trans1 EPA ID: NYD077444263 Trans2 EPA ID: Not reported TSDF ID 1: NYD077444263 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F006 - WW TREAT SL FM ELECTROPLATING OPER Waste Code: Waste Code: Not reported Quantity: 00495 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 009 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Waste Code: F007 - PLATING BATH SOL FM ELECTROPLATING OPER Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

### ACCESSOCRAFT PRODUCTS INC (Continued)

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported 00110 Quantity: Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 002 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 NYB6969834 Document ID: Manifest Status: С seq: Not reported Year: 1995 Trans1 State ID: NYPP5193 Trans2 State ID: Not reported Generator Ship Date: 10/23/1995 Trans1 Recv Date: 10/23/1995 Trans2 Recv Date: 11 10/23/1995 TSD Site Recv Date: Part A Recv Date: 02/22/1996 Part B Recv Date: 11/07/1995 Generator EPA ID: NYR000014753 Trans1 EPA ID: NYD077444263 Trans2 EPA ID: Not reported TSDF ID 1: NYD077444263 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported P030 - CYANIDES N.O.S. Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: 00195 Quantity: Units: P - Pounds Number of Containers: 004 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 D002 - NON-LISTED CORROSIVE WASTES Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 00030

ACCESSOCRAFT PRODUCTS INC (Continued)

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1001079768

#### Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00010 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 ECHO: 1001079768 Envid: Registry ID: 110000849672 DFR URL: http://echo.epa.gov/detailed\_facility\_report?fid=110000849672 135 **CON EDISON SERVICE BOX: 2040** RCRA NonGen / NLR 1016970578 **174 NORTH AVE** NY MANIFEST NYP004442943 ESE < 1/8 NEW ROCHELLE, NY 10804 0.084 mi. Site 1 of 3 in cluster I 442 ft. RCRA NonGen / NLR: **Relative:** Date form received by agency: 03/16/2014 Lower Facility name: CON EDISON SERVICE BOX: 2040 Actual: Facility address: 174 NORTH AVE 91 ft. NEW ROCHELLE, NY 10804 NYP004442943 EPA ID: Mailing address: **IRVING PL, 15TH FL NE** NEW YORK, NY 10003 Contact: THOMAS TEELING Contact address: Not reported Not reported Contact country: Not reported Contact telephone: (212) 460-3770 Contact email: Not reported EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No

Database(s)

EDR ID Number EPA ID Number

# CON EDISON SERVICE BOX: 2040 (Continued)

ON EDISON SERVICE BOX: 2040	(Continued)
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner	
Used oil Specification marketer:	
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by agency:	02/16/2014
Site name: 0	CON EDISON SERVICE BOX: 2040
Classification: 0	Conditionally Exempt Small Quantity Generator
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYP004442943
Facility Status:	Not reported
Location Address 1:	FO 174 NORTH AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
	•
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10801
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYP004442943
Mailing Name:	CON EDISON
Mailing Contact:	CON EDISION
Mailing Address 1:	4 IRVING PL
Mailing Address 2:	15TH FL
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
	•
seq:	Not reported
Year:	2014
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	02/16/2014
Trans1 Recv Date:	02/16/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	02/20/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004442943
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046

Database(s)

EDR ID Number EPA ID Number

# CON EDISON SERVICE BOX: 2040 (Continued)

TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Partial Reject Indicator: Discr Partial Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code 1_2: Waste Code 1_4:	Not reported 011692698JJK N N N N N N N N N N N N N N N N N N
—	•
—	•
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

H36 North < 1/8 0.088 mi. 463 ft.	CON EDISON TRANSFORMER M NORTH AVE & ANDERSON ST NEW ROCHELLE, NY 10802 Site 5 of 12 in cluster H	IANHOLE: 3585	RCRA NonGen / NLR NY MANIFEST	1016963788 NYP004367611
Relative: Lower	RCRA NonGen / NLR: Date form received by agenc Facility name:	y: 10/29/2013 CON EDISON TRANSFORMER MANHOLE: 33	585	
Actual: 90 ft.	Facility address:	NORTH AVE & ANDERSON ST NEW ROCHELLE, NY 10802		
	EPA ID: Mailing address:	NYP004367611 IRVING PL, 15TH FL NE NEW YORK, NY 10003		
	Contact: Contact address:	THOMAS TEELING Not reported Not reported		
	Contact country: Contact telephone: Contact email: EPA Region: Classification:	Not reported (212) 460-3770 Not reported 02 Non-Generator		
	Description:	Handler: Non-Generators do not presently gene	erate hazardous waste	

# Map ID Direction Distance Elevation Site

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Handler Activities Summary:	
U.S. importer of hazardous wa	aste: No
Mixed waste (haz. and radioa	ctive): No
Recycler of hazardous waste:	No
Transporter of hazardous was	
Treater, storer or disposer of H	
Underground injection activity	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burn	
Used oil Specification markete	
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by agency	·· 09/29/2013
Site name:	CON EDISON TRANSFORMER MANHOLE: 3585
Classification:	Conditionally Exempt Small Quantity Generator
	contraction of the sound of the
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYP004367611
Facility Status:	Not reported
Location Address 1:	NORTH AVE & ANDERSON ST
Code:	BP
Location Address 2:	TM3585
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY 10001
Location Zip:	10801
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYP004367611
	CON EDISON
Mailing Name:	
Mailing Contact:	CON EDISON
Mailing Contact: Mailing Address 1:	4 IRVING PLACE
Mailing Contact: Mailing Address 1: Mailing Address 2:	4 IRVING PLACE Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City:	4 IRVING PLACE Not reported NEW YORK
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State:	4 IRVING PLACE Not reported NEW YORK NY
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip:	4 IRVING PLACE Not reported NEW YORK NY 10003
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA Not reported Not reported Not reported
Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq:	4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported USA Not reported Not reported Not reported Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

1016963788

Generator Ship Date: 09/29/2013 Trans1 Recv Date: 09/29/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/02/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004367611 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 011694650JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 400 P - Pounds Units: Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Not reported Waste Code 1\_6:

H37 North < 1/8 0.088 mi. 463 ft.	CON EDISON ANDERSON ST & NORTH AV NEW ROCHELLE, NY 10801 Site 6 of 12 in cluster H	
Relative: Lower	NY MANIFEST: Country: EPA ID:	USA NYP0047096
Actual: 90 ft.	Facility Status: Location Address 1: Code: Location Address 2: Total Tanks:	Not reported ANDERSON BP SB2063 Not reported

Location City:

NY MANIFEST S117538298 N/A

	Not reported
TH AV	
10801	
1	
	USA NYP004709622
1:	Not reported ANDERSON ST & NORTH AV

NEW ROCHELLE

Site

Database(s)

EDR ID Number **EPA ID Number** 

#### **CON EDISON (Continued)**

Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recy Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: **Discr Quantity Indicator:** Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code:

Quantity:

Number of Containers:

Container Type:

Units:

NY 10801 Not reported NYP004709622 CON EDISON CON EDISON 4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported Not reported Not reported Not reported 2014 NYD006982359 Not reported 12/23/2014 12/23/2014 Not reported 12/23/2014 Not reported Not reported NYP004709622 Not reported Not reported NJD002200046 Not reported 012773453JJK Ν Ν Ν Ν Ν Ν Ν Not reported Not reported Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported 25 P - Pounds 1 TT - Cargo tank, tank trucks

	Г			
Map ID		MAP FINDINGS		
Direction	L			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON (Continued)			6447520200
	CON EDISON (Continued)			S117538298
	Handling Method:	T Chemical, physical, or biological treatment.		
	Specific Gravity: Waste Code:	1 D008		
	Waste Code 1_2:	Not reported		
	Waste Code 1_3:	Not reported		
	Waste Code 1_4:	Not reported		
	Waste Code 1_5:	Not reported		
	Waste Code 1_6:	Not reported		
				044000004
H38 North	CON EDISON NORTH AVE & ANDERSON		NY MANIFEST	S118088384 N/A
< 1/8	NEW ROCHELLE, NY 10801			N/A
0.088 mi.				
463 ft.	Site 7 of 12 in cluster H			
Relative:	NY MANIFEST:			
Lower	Country:	USA		
Actual	EPA ID:	NYP004759452		
Actual: 90 ft.	Facility Status:			
50 11.	Location Address 1: Code:	NORTH AVE & ANDERSON ST BP		
	Location Address 2:	TM 3585		
	Total Tanks:	Not reported		
	Location City:	NEW ROCHELLE		
	Location State:	NY		
	Location Zip:	10802		
	Location Zip 4:	Not reported		
	NY MANIFEST:			
	EPAID:	NYP004759452		
	Mailing Name:			
	Mailing Contact: Mailing Address 1:	TOM TEELING 4 IRVING PLACE - 15TH FLOOR		
	Mailing Address 2:	Not reported		
	Mailing City:	NEW YORK		
	Mailing State:	NY		
	Mailing Zip:	10003		
	Mailing Zip 4:	Not reported		
	Mailing Country: Mailing Phone:	USA Not reported		
	Mailing Fhone.	Not reported		
	NY MANIFEST:			
	Document ID:	Not reported		
	Manifest Status:	Not reported		
	seq:	Not reported		
	Year:	2015		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID:	Not reported		
	Generator Ship Date: Trans1 Recv Date:	03/28/2015 03/28/2015		
	Trans2 Recv Date:	Not reported		
	TSD Site Recv Date:	03/31/2015		
	Part A Recv Date:	Not reported		
	Part B Recv Date:	Not reported		
	Generator EPA ID:	NYP004759452		
	Trans1 EPA ID:	Not reported		
	Trans2 EPA ID:	Not reported		

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014091137JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 200 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported 03/28/2015 Generator Ship Date: Trans1 Recv Date: 03/28/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/31/2015 Part A Recv Date: Not reported Not reported Part B Recv Date: NYP004759452 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091137JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν

### Map ID Direction Distance Elevation Site

### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### **CON EDISON (Continued)**

Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: 1 Container Type: Handling Method: Specific Gravity: 1 Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported 200 P - Pounds TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. D008 Not reported 2015 NYD006982359 Not reported 03/28/2015 03/28/2015 Not reported 03/31/2015 Not reported Not reported NYP004759452 Not reported Not reported NJD002200046 Not reported 014091137JJK Not reported Not reported Not reported H110

Map ID Direction Distance Elevation Site

H39

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

# **CON EDISON (Continued)**

Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Not reported Not reported 200 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported

# North **NORTH AVE & ANDERSON** < 1/8 NEW ROCHELLE, NY 10801 0.088 mi. 463 ft. Site 8 of 12 in cluster H Relativ Lower Actua 90 ft.

CON EDISON

RCRA	NonGen	/ NLR

1018281020 NYP004759452

ive:	RCRA NonGen / NLR:	
er	Date form received by agency: 03	/28/2015
	Facility name: CC	ON EDISON
al:	Facility address: NC	DRTH AVE & ANDERSON
	NE	EW ROCHELLE, NY 10801
	EPA ID: NY	/P004759452
	Mailing address: IR	VING PL, 15TH FL NE
	NE	EW YORK, NY 10003
	Contact: TH	IOMAS TEELING
	Contact address: No	ot reported
	Na	ot reported
	-	ot reported
	•	12) 460-3770
		ot reported
	EPA Region: 02	
		on-Generator
	Description: Ha	andler: Non-Generators do not presently generate hazardous waste
	Handler Activities Summary:	
	U.S. importer of hazardous waste	: No
	Mixed waste (haz. and radioactive	e): No
	Recycler of hazardous waste:	No
	Transporter of hazardous waste:	No
	Treater, storer or disposer of HW:	No
	Underground injection activity:	No
	On-site burner exemption:	No
	Furnace exemption:	No
	Used oil fuel burner:	No
	Used oil processor:	No
	User oil refiner:	No
	Used oil fuel marketer to burner:	No
	Used oil Specification marketer:	No
	Used oil transfer facility:	No
	Used oil transporter:	No

Database(s)

EDR ID Number EPA ID Number

	CON EDISON (Continued)			4040004000
	CON EDISON (Continued)			1018281020
	Historical Generators: Date form received by agenc	v: 03/28/2015		
	Site name:	CON EDISON		
	Classification:	Small Quantity Generator		
	Violation Status:	No violations found		
H40 North < 1/8 0.088 mi. 463 ft.	CON EDISON NORTH AVE & ANDERSON ST NEW ROCHELLE, NY 10801 Site 9 of 12 in cluster H		NY MANIFEST	S113920666 N/A
Relative: Lower	NY MANIFEST: Country:	USA		
Lower	EPA ID:	NYP004683272		
Actual:	Facility Status:	Not reported		
90 ft.	Location Address 1:	NORTH AVE & ANDERSON ST		
	Code:	BP		
	Location Address 2:	TM3585		
	Total Tanks:	Not reported		
	Location City: Location State:	NEW ROCHELLE NY		
	Location Zip:	10801		
	Location Zip 4:	Not reported		
	NY MANIFEST:			
	EPAID:	NYP004683272		
	Mailing Name:	CON EDISON		
	Mailing Contact:	CON EDISON		
	Mailing Address 1:	4 IRVING PL		
	Mailing Address 2:	15TH FLOOR		
	Mailing City:	NEW YORK		
	Mailing State:	NY 10000		
	Mailing Zip: Mailing Zip 4:	10003 Not reported		
	Mailing Country:	USA		
	Mailing Phone:	Not reported		
	NY MANIFEST: Document ID:	Not reported		
	Manifest Status:	Not reported		
	seq:	Not reported		
	Year:	2014		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID:	Not reported		
	Generator Ship Date:	10/23/2014		
	Trans1 Recv Date: Trans2 Recv Date:	10/23/2014 Not reported		
	TSD Site Recy Date:	Not reported 10/24/2014		
	Part A Recv Date:	Not reported		
	Part B Recv Date:	Not reported		
	Generator EPA ID:	NYP004683272		
	Trans1 EPA ID:	Not reported		
	Trans2 EPA ID:	Not reported		
	TSDF ID 1:	NJD002200046		
	TSDF ID 2: Manifest Tracking Number:	Not reported		
	Manifest Tracking Number:	012773173JJK		

Database(s)

EDR ID Number EPA ID Number

Ν
Ν
Ν
Ν
Ν
Ν
Ν
Not reported
Not reported
Not reported
H110
Not reported
500
P - Pounds
1
TT - Cargo tank, tank trucks
T Chemical, physical, or biological treatment.
1
D003
Not reported

H & K LAUNDROMAT

# S113920666

ESE < 1/8 0.092 mi.	170 NORTH AVE NEW ROCHELLE, NY 1080	)1
488 ft.	Site 2 of 3 in cluster I	
Relative: Lower	EDR Historical Cleaners: Name:	H
	Vear	-

**I**41

	Year:	2010
Actual: 90 ft.	Address:	170 NORTH AVE
	Name:	H&K LAUNDROMAT
	Year:	2011
	Address:	170 NORTH AVE
	Name:	H&K LAUNDROMAT
	Year:	2012
	Address:	170 NORTH AVE

EDR Hist Cleaner 1015003240 N/A

Database(s)

EDR ID Number EPA ID Number

G42 NNW < 1/8 0.093 mi. 489 ft.	MAIN LIBRARY LAWTON ST NEW ROCHELLE, NY Site 4 of 4 in cluster G	NY LTANKS S103037429 N/A	
Relative: Lower Actual: 91 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	1998-03-13 Tank Test Failure Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1998-03-13 199 Not reported Tank Tester Not reported False False 0 1998-03-13	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	273025 1056692 01 324833 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported Not reported	

Database(s)

EDR ID Number EPA ID Number

S103037429

Tank Test:	
Site ID:	273025
Spill Tank Test:	1545675
Tank Number:	1
Tank Size:	10000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

43 NNE < 1/8 0.095 mi. 499 ft.	MACYS NEW ROCHELLE THE MALL NEW ROCHELLE, NY 10801		NY UST	U003856957 N/A
Relative: Lower Actual: 90 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	3-167037 / Unregulated: <1101 gal. PBS Macys New York Macys New York The Mall Not reported New Rochelle NY 10801 Not reported 1 4. Closed - in place 10000 Not reported Not reported Not reported 0. None 12/01/1967 09/26/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. No Piping 1. Steel/Carbon/ steel/iron 0. None Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 2. Suction		

Tank Number: Status: Capacity: Product Stored: Product Stored Percent: 2

10000 Not reported

Not reported

4. Closed - in place

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	MACYS NEW ROCHELLE (Conti	nued)		U003856957
	Tank Leak Detection:	0. None		0000000000
	Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containmen Piping Location: Piping Type: Piping External Protection:	12/01/1967 09/26/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None t: 0. None 0. No Pipiing 1. Steel/Carbon/ steel/iron 0. None		
	Overfill Prevention: Piping Secondary Containme	Not reported nt: Not reported		
	Spill Prevention:	Not reported		
	Dispenser:	2. Suction		
J44 ENE < 1/8 0.095 mi. 503 ft.	COMMERCIAL - UST 455 MAIN ST NEW ROCHELLE, NY Site 1 of 3 in cluster J		NY Spills	S118706219 N/A
Relative:	SPILLS:			
Lower	Facility ID:	1603310 ER		
Actual: 88 ft.	Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Contact Name: Contact Phone: DEC Memo:	ER 483864 529764 3 2016-07-05 1603310 / Not Reported Equipment Failure Known release that creates potential for fire or hazs Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2016-07-06 Not reported Commercial/Industrial Other Not reported False Not reported False False 1 2016-07-06 2016-07-06 2016-07-25 Not reported Unknown owner Not reported Unknown owner Not reported NY 999 JOHN MANFREDI 9144475634 "7/6/16 - A 1K UST under the sidewall near a ConE UST was partially cut open and petroleum and wate	Ed power cable. The	

MAP FINDINGS

EDR ID Number Database(s)

EPA ID Number

	Remarks:	the UST. The UST is still in the ground and is difficult to remove this time. The Caller was hired by the bank to remove the UST, possible foreclosure and real estate transaction. KAB" "They were removing a 1000 gallon tank and they found oil on ti and ground water. The cleanup is pending. They don't know the of the spill."	he soil	
	Material:			
	Site ID:	529764		
	Operable Unit ID:	1278585		
	Operable Unit:	01		
	Material ID:	2283503		
	Material Code: Material Name:	0001A #2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	Not reported		
	Units:	Not reported		
	Recovered:	Not reported		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
K45 SW < 1/8	RPM REALTY INC 9-15 DIVISION STREET NEW ROCHELLE, NY 10801		NY UST	U004240676 N/A
0.096 mi. 505 ft.	Site 1 of 8 in cluster K			
Relative:	WESTCHESTER CO. UST:			
Higher	Id/Status:	3-166189 / Active		
	Operator Name:	Gary Garafolo		
Actual: 99 ft.	Owner Name:	RPM Realty Inc.		
55 m.	Owner Street:	PO Box 817		
	Owner Address2: Owner City:	Not reported Katonah		
	Owner State:	NY		
	Owner Zipcode:	10536		
	GDS Number:	Not reported		
	Tank Number:	1		
	Tank Number: Status:	1 5. Closed - removed		
	Status: Capacity: Product Stored:	5. Closed - removed 2000 7. Gasoline		
	Status: Capacity:	5. Closed - removed 2000		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground 1. Steel/Carbon steel/Iron		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection:	<ul> <li>5. Closed - removed</li> <li>2000</li> <li>7. Gasoline</li> <li>Not reported</li> <li>4. Groundwater Well</li> <li>Not reported</li> <li>06/17/1997</li> <li>5. Underground</li> <li>1. Steel/Carbon steel/Iron</li> <li>0. None</li> <li>0. None</li> <li>0. None</li> <li>2. Underground/on ground</li> </ul>		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location:	5. Closed - removed 2000 7. Gasoline Not reported 4. Groundwater Well Not reported 06/17/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None		

Database(s)

EDR ID Number EPA ID Number

	RPM REALTY INC (Continued)			U004240676
	Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	0. None Not reported 0. None 2. Suction		
K46 SW < 1/8 0.096 mi.	RPM REALTY INC 9-15 DIVISION STREET NEW ROCHELLE, NY 10801		NY AST	A100412045 N/A
505 ft.	Site 2 of 8 in cluster K			
Relative: Higher	WESTCHESTER CO. AST: PBS Number: Site Status:	3-166189 Active		
Actual: 99 ft.	GDS Number: Operator Name:	Not reported Gary Garafolo		
	Owner Name: Owner Street: Owner Address2:	RPM Realty Inc. PO Box 817 Not reported		
	Owner City/State/Zip:	Katonah, NY 10536		
	Tank Number: Status:	2 1. In-Service		
	Date Installation: Capacity: Product Stored:	06/01/1997 1500 1. No. 2 fuel oil		
	Product Stored Percent: Date Perm Closure: Tank Location:	Not reported 01/01/1900		
	Tank Location: Tank Type: Tank Internal Protection:	<ol> <li>Aboveground (contact w/ soil)</li> <li>Steel/Carbon steel/Iron</li> <li>None</li> </ol>		
	Tank External Protection: Tank Leak Detection:	0. None 0. None		
	Tank Secondary Containment:	2. Vault (w/ access)		
	Piping Location: Piping Type: Piping External Protection:	<ol> <li>Aboveground</li> <li>Steel/Carbon/ Steel/Iron</li> <li>Painted/Asphalt Coating</li> </ol>		
	Piping Leak Detection: Piping Secondary Containment:	0. None		
	Overfill Prevention: Spill Prevention:	5. Vent Whistle		
	Dispenser:	0. None 3. Gravity		
K47	COMM/RESIDENT. PROPERTY		NY LTANKS	S101341:

# 0.097 mi. 511 ft. Site 3 of 8 in cluster K

**NEW ROCHELLE, NY** 

< 1/8

Relative: Higher	LTANKS: Site ID:	119901
ingliei	Spill Number/Closed Date:	9405558 / 2005-02-10
Actual:	Spill Date:	1994-07-25
100 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.

TC4738280.2s Page 99

Database(s)

EDR ID Number EPA ID Number

#### COMM/RESIDENT. PROPERTY (Continued)

Modified By:

Spills

Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1994-07-25 CID: Not reported Water Affected: Not reported Spill Notifier: **Responsible Party** Last Inspection: Not reported **Recommended Penalty:** False UST Involvement: False **Remediation Phase:** 0 Date Entered In Computer: 2003-12-02 Spill Record Last Update: 2005-02-10 Spiller Name: Not reported Spiller Company: Not reported Spiller Address: Not reported Spiller City, St, Zip: \*\*\*Update\*\*\*, ZZ Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 104134 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST. Tank taken out of service by Royal Environmental. " "TANK TEST ON 7/21/94" Remarks: Material: 119901 Site ID: Operable Unit ID: 1002771 Operable Unit: 01 Material ID: 382138 Material Code: 0001A Material Name: #2 fuel oil Case No .: Not reported Material FA: Petroleum Quantity: .00 Units: Not reported Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: Site ID: 119901 1542973 Spill Tank Test: Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: .00 Gross Fail: Not reported

Mar 10				
Map ID Direction		MAP FINDINGS		
Distance	0.11			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	COMM/RESIDENT. PROPERTY	(Continued)		S101341321
		Not reported		
		Jnknown		
148	DEVITO RESIDENCE		NY Spills	S109207454
ESE < 1/8	168 NORTH AVE			N/A
< 1/8 0.097 mi.	NEW ROCHELLE, NY			
512 ft.	Site 3 of 3 in cluster I			
Relative:	SPILLS:	0005020		
Lower	Facility ID: Facility Type:	0805939 ER		
Actual:	DER Facility ID:	352353		
90 ft.	Site ID:	403155		
	DEC Region: Spill Date:	3 2008-08-25		
	Spill Number/Closed Date:	0805939 / 2009-01-07		
	Spill Cause:	Equipment Failure		
	Spill Class:	Known release with minimal potential for fire or hazard. Willing Responsible Party. Corrective action taken.	DEC Response.	
	SWIS:	6010		
	Investigator: Referred To:	jbodee Not reported		
	Reported to Dept:	2008-08-25		
	CID:	410 Not reported		
	Water Affected: Spill Source:	Not reported Private Dwelling		
	Spill Notifier:	Other		
	Cleanup Ceased: Cleanup Meets Std:	Not reported True		
	Last Inspection:	Not reported		
	Recommended Penalty: UST Trust:	False		
	Remediation Phase:	Not reported 0		
	Date Entered In Computer:	2008-08-25		
	Spill Record Last Update: Spiller Name:	2009-01-07 MIKE DEVITO		
	Spiller Company:	DEVITO RESIDENCE		
	Spiller Address: Spiller City,St,Zip:	168 NORTH AVE NEW ROCHELLE, NY		
	Spiller Company:	001		
	Contact Name:	NICKY RICKETTS		
	Contact Phone: DEC Memo:	(914) 777-1930 "Waiting on disposal sample to come back and will sche	edule removal of	
		soils. 10/16/08 Northeast Environmental reported that the	hey excavated	
		and removed the tank along with 19.63 tons of petroleur soil. Post excavation TAGM soil sample results were be		
		guidance values. NFA TG"		
	Remarks:	"DURING REMOVAL OF 550 GAL TANK, HOLES IN T.	ANK DISCOVERE	D ALONG WITH
	Matarial:	CONTAMINATED SOIL: CLEANUP TO FOLLOW:"		
	Material: Site ID:	403155		
	Operable Unit ID:	1159874		
	Operable Unit: Material ID:	01 2151004		
	Material Code:	0001A		

Petroleum

Not reported Not reported

Gallons

.00

.00

Database(s)

EDR ID Number EPA ID Number

Tank Test:

Material FA:

Recovered:

Oxygenate:

Resource Affected:

Quantity:

Units:

K49 WSW < 1/8 0.098 mi.	ARIEL CABLE 19 DIVISION STREET/WASHIN NEW ROCHELLE, NY	NY Spills	S109206705 N/A
518 ft.	Site 4 of 8 in cluster K		
	Site 4 of 8 in cluster K SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Contact Name: Contact Phone: DEC Memo:	0804960 ER 351169 401964 3 2008-07-30 0804960 / 2008-08-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jbodee Not reported 2008-07-30 444 Not reported Commercial/Industrial Responsible Party Not reported True Not reported False Not reported False Not reported 6 2008-07-30 2008-07-30 2008-07-30 2008-07-30 2008-07-30 2008-07-30 2008-07-30 2008-07-30 2008-08-16 ERTSDESK ARIEL CABLE 19 DIVISION STREET/WASHIN NEW ROCHELLE, NY 001 ERTSDESK (212) 580-8383	
	Remarks:	"6 OUNCES AND ONGOING AND CRW WILL BE ENROUTE"	
	Material: Site ID: Operable Unit ID:	401964 1158736	

# Map ID Direction Distance Elevation Site

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

# S109206705

# ARIEL CABLE (Continued)

Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:

01 2149826 0541A dielectric fluid Not reported Petroleum .00 Gallons .00 Not reported Not reported

Tank Test:

K50 SW < 1/8 0.101 mi.	SIDNEY FURNITURE 535 MAIN ST NEW ROCHELLE, NY	NY Spills	S118460140 N/A
534 ft.	Site 5 of 8 in cluster K		
534 ft. Relative: Higher Actual: 99 ft.	Site 5 of 8 in cluster K SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spille Record Last Update: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Contact Phone: DEC Memo:	1509029 ER 75076 517634 3 2015-12-03 1509029 / 2015-12-04 Unknown Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required. 6010 JBODEE Not reported 2015-12-04 Not reported Commercial/Industrial Affected Persons Not reported False Not reported False False 0 2015-12-04 2015-12-04 Not reported UNKNOWN Not reported UNKNOWN Not reported NY 999 MICHELLE GUERRERO (347) 982-5522	

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	SIDNEY FURNITURE (Continued	d)	S118460140
	Remarks:	states that they were working on the furnace and there was a small oil spill. She wanted to know if oil spills are hazardous. I was in the process of answering her questions and she hung up. Westchester County Dept of Health notified. No further DEC action. jod" "Caller advised aprx 1/2 gal of oil spilled onto carpet. Clean up is pending. Caller is requesting a call back"	
	Material: Site ID: Operable Unit ID: Operable Unit:	517634 1266703 01	
	Material ID: Material Code: Material Name: Case No.: Material FA:	2270652 0001A #2 fuel oil Not reported Petroleum	
	Quantity: Units: Recovered:	.50 Gallons Not reported	
	Resource Affected: Oxygenate:	Not reported Not reported	
K51 SW < 1/8 0.101 mi.	Tank Test: 535 MAIN ST ASSOCIATION 535 MAIN STREET NEW ROCHELLE, NY	NY Spills	S104648843 N/A
534 ft.	Site 6 of 8 in cluster K		
Relative: Higher	SPILLS: Facility ID: Facility Type:	9900400 ER	
Actual: 99 ft.	DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	75076 81102 3 1999-04-08 9900400 / 1999-07-09 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jbodee Not reported 1999-04-12 312 Not reported Private Dwelling Other Not reported True Not reported False False 0 1999-04-12 2004-02-24	

# 10

TC4738280.2s Page 104

Database(s)

EDR ID Number EPA ID Number

#### 535 MAIN ST ASSOCIATION (Continued) S104648843 MR GOLDBERG Spiller Name: MR GOLDBERG Spiller Company: Spiller Address: Not reported Spiller City, St, Zip: NY Spiller Company: 001 Contact Name: MR GOLDBERG Contact Phone: (212) 370-1333 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was O'DEE 7/9/99 SPILL CLEANED BY TOWN & COUNTRYF OIL. NFA" Remarks: "FAULTY VENT ALARM - SPILLED LESS THAN 1 GAL - CLEANED UP - TENANTS STILL COMPLAINING OF ODORS" Material: Site ID: 81102 Operable Unit ID: 1075164 Operable Unit: 01 Material ID: 307538 0001A Material Code: Material Name: #2 fuel oil Case No .: Not reported Material FA: Petroleum 1.00 Quantity: Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: Facility ID: 9415294 Facility Type: ER **DER Facility ID:** 205781 Site ID: 251083 DEC Region: 3 Spill Date: 1995-02-17 Spill Number/Closed Date: 9415294 / 1995-03-03 Spill Cause: Human Error Possible release with minimal potential for fire or hazard or Known Spill Class: release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1995-02-22 Not reported CID: Water Affected: Not reported Spill Source: Institutional, Educational, Gov., Other Spill Notifier: **Responsible Party** Cleanup Ceased: 1995-03-03 Cleanup Meets Std: False Last Inspection: Not reported **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2003-12-02 Spill Record Last Update: 2003-12-02

Database(s)

EDR ID Number EPA ID Number

	535 MAIN ST ASSOCIATION (C	ontinued) S104648843
	Spiller Name:	Not reported
	Spiller Company:	SAME
	Spiller Address:	Not reported
	Spiller City,St,Zip:	NY
	Spiller Company:	999
	Contact Name:	Not reported
	Contact Phone:	Not reported
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	DEC Memo.	GHIOSAY "
	Remarks:	"DRIVER DID NOT HEAR VENT ALARM AND OVERFILLED TANK REGENT OIL
	Remarks.	CLEANED UP"
	Material:	
	Site ID:	251083
	Operable Unit ID:	1012611
	Operable Unit:	01
	Material ID:	370473
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	2.00
	Units:	Gallons
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
K52 SW < 1/8 0.103 mi. 546 ft. Relative: Higher Actual: 99 ft.	CON EDISON DIVISION ST & MAIN ST NEW ROCHELLE, NY 10801 Site 7 of 8 in cluster K NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location City: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact:	USA NYP004872319 Not reported DIVISION ST & MAIN ST BP Not reported New ROCHELLE NY 10801 Not reported NYP004872319 CON EDISON DENNIS HUACON
	Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip:	4 IRVING PL 15TH FL Not reported NEW YORK NY 10003

Database(s)

EDR ID Number EPA ID Number

# CON EDISON (Continued)

ON EDISON (Continued)	
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770
Maining Phone.	2124000110
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	•
seq:	Not reported Not reported
Year:	2015
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	11/23/2015
Trans1 Recv Date:	11/23/2015
Trans2 Recv Date:	Not reported
TSD Site Recy Date:	11/23/2015
Part A Recy Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004872319
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	013245368JJK
Import Indicator:	N
Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Quantity:	9020
Units:	P - Pounds
Number of Containers:	1 TT Course teach teach truche
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2: Waste Code 1_3:	Not reported Not reported
Waste Code 1_3. Waste Code 1_4:	Not reported
Waste Code 1_4. Waste Code 1_5:	Not reported
Waste Code 1_5: Waste Code 1_6:	Not reported
Waste Code 1_0.	Not reported
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2015

Database(s)

EDR ID Number **EPA ID Number** 

#### **CON EDISON (Continued)**

Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 11/23/2015 Trans1 Recv Date: 11/23/2015 Trans2 Recv Date: Not reported 11/23/2015 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004872319 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 013245368JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 9020 P - Pounds Number of Containers: TT - Cargo tank, tank trucks Container Type: Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Not reported Waste Code 1 5: Waste Code 1\_6: Not reported

#### K53 CONSOLIDATED EDISON SW **DIVISION & MAIN** < 1/8 NEW ROCHELLE, NY 10802 0.103 mi. 546 ft. Site 8 of 8 in cluster K NY MANIFEST: **Relative:** Country: Higher EPA ID: Actual: Facility Status: 99 ft. Location Address 1: Code:

Location Address 2:

Units:

USA NYP004123873 Not reported **DIVISION & MAIN** BP Not reported

NY MANIFEST 1009243060 N/A

Database(s)

EDR ID Number EPA ID Number

Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10802
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	
Mailing Name: Mailing Contact:	CONSOLIDATED EDISON FRANKLIN MURRAY
Mailing Address 1:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124602808
NY MANIFEST:	
Document ID:	NYE1274139
Manifest Status:	Not reported
seq:	Not reported
Year:	2004
Trans1 State ID:	46207JMNY
Trans2 State ID: Generator Ship Date:	Not reported 08/22/2004
Trans1 Recv Date:	08/22/2004
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/23/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004123873
Trans1 EPA ID:	NYD006982359
Trans2 EPA ID: TSDF ID 1:	Not reported NYD077444
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator: Manifest Ref Number:	Not reported Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D018 - BENZENE 0.5 MG/L TCLP
Waste Code:	Not reported
Waste Code:	Not reported 01400
Quantity: Units:	G - Gallons (liquids only)* (8.3 pounds
Units.	G - Galions (liquids only) (6.5 pounds

# CON

Database(s)

EDR ID Number EPA ID Number

#### CONSOLIDATED EDISON (Continued)

Number of Containers: 013 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 D018 - BENZENE 0.5 MG/L TCLP Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00100 Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: L Landfill. Specific Gravity: 01.00 Document ID: NYE1308357 Manifest Status: Not reported seq: Not reported Year: 2004 Trans1 State ID: 47651JM Trans2 State ID: Not reported Generator Ship Date: 08/25/2004 Trans1 Recv Date: 08/25/2004 Trans2 Recv Date: Not reported TSD Site Recv Date: 08/25/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004123873 NYD006982359 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: NYD077444 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported **Discr Type Indicator:** Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D018 - BENZENE 0.5 MG/L TCLP Waste Code: Waste Code: Not reported Quantity: 00008 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00

Database(s)

EDR ID Number EPA ID Number

### **CONSOLIDATED EDISON (Continued)**

Document ID: NYE1308411 Manifest Status: Not reported seq: Not reported Year: 2004 Trans1 State ID: 47651JM Trans2 State ID: Not reported Generator Ship Date: 08/23/2004 08/23/2004 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 08/24/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004123873 Generator EPA ID: Trans1 EPA ID: NYD006982359 Trans2 EPA ID: Not reported NYD077444 TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D018 - BENZENE 0.5 MG/L TCLP Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 00005 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYE1309977 Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: 47651JM Trans2 State ID: Not reported Generator Ship Date: 08/28/2004 Trans1 Recv Date: 08/28/2004 Trans2 Recv Date: Not reported TSD Site Recv Date: 08/30/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004123873 NYD006982359 Trans1 EPA ID:

Not reported

Trans2 EPA ID:

### 1009243060

Database(s)

EDR ID Number **EPA ID Number** 

1009243060

### **CONSOLIDATED EDISON (Continued)**

TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Residue Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code:	NYD077444 Not reported Not reported
Waste Code:	Not reported
Waste Code: Waste Code: Quantity: Units:	Not reported Not reported 00001 G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: Container Type: Handling Method:	001 DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning.
Specific Gravity:	01.00

### L54 SINNOTT MANAGEMENT COMPANY LLC SE **35 CLINTON PLACE**

### < 1/8 NEW ROCHELLE, NY 10801 0.103 mi.

546 ft.

### Site 1 of 13 in cluster L

WESTCHESTER CO. AST: **Relative:** PBS Number: Lower Site Status: Actual: GDS Number: 90 ft. Operator Name: Owner Name: **Owner Street:** Owner Address2: Owner City/State/Zip: Tank Number: Status: Date Installation:

Capacity:

Piping Location:

New Rochelle, NY 10801 1 1. In-Service 12/01/1939 5000 Product Stored: 2. No. 4 fuel oil Product Stored Percent: Not reported Date Perm Closure: 01/01/1900 Tank Location: 2. Aboveground (contact w/ impervious barrier) Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 1. Epoxy liner Tank External Protection: 0. None 2. Manual Interstitial Monitoring Tank Leak Detection: Tank Secondary Containment: 2. Vault (w/ access)

3-078646

Not reported

Not reported

Norman Avelenda

35 Clinton Place LLC

35 Clinton Place, #1B

Active

1. Aboveground

NY AST A100359845 N/A

Map ID Direction		MAP FINDINGS
Distance Elevation	Site	
	SINNOTT MANAGEMENT COMP Piping Type: Piping External Protection: Piping Leak Detection: Piping Secondary Containme Overfill Prevention: Spill Prevention: Dispenser:	<ol> <li>Steel/Carbon/ Steel/Iron</li> <li>Fiberglass</li> <li>Groundwater Well</li> </ol>
L55 SE < 1/8 0.103 mi. 546 ft.	SPILL NUMBER 0001159 35 CLINTON PL NEW ROCHELLE, NY Site 2 of 13 in cluster L	
546 ft. Relative: Lower Actual: 90 ft.	Site 2 of 13 in cluster L SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	0001159 ER 190042 230601 3 2000-04-28 0001159 / 2000-05-01 Equipment Failure Known release with minimal potential for fire or Willing Responsible Party. Corrective action tal 6010 jbodee Not reported 2000-04-28 365 Not reported Unknown Other Not reported

Operable Unit:

01

EDR ID Number EPA ID Number

A100359845

Database(s)

Piping Type: Piping External Protection: Piping Leak Detection: Piping Secondary Containmen Overfill Prevention: Spill Prevention: Dispenser:	<ol> <li>Steel/Carbon/ Steel/Iron</li> <li>Fiberglass</li> <li>Groundwater Well</li> <li>None</li> <li>Product Level Gauge (Aboveground Only)</li> <li>None</li> <li>Gravity</li> </ol>
SPILL NUMBER 0001159 35 CLINTON PL	NY Spills S104650655 N/A
NEW ROCHELLE, NY	
Site 2 of 13 in cluster L	
SPILLS:	
Facility ID:	0001159
Facility Type:	ER
DER Facility ID:	190042
Site ID:	230601
DEC Region:	3
Spill Date:	2000-04-28
Spill Number/Closed Date:	0001159 / 2000-05-01
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	jbodee
Referred To:	Not reported
Reported to Dept:	2000-04-28
CID: Water Affected:	365 Not reported
Spill Source:	Not reported Unknown
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-04-28
Spill Record Last Update:	2000-05-09
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	PETER SINNOTT
Contact Phone:	(718) 542-5080
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'DEE 05/01/2000 JIM CAREY OF CASTLE REPORTS CLEANUP COMPLETED, SPIL OF 7 TO 8 GALLONS TO BASEMENT FLOOR. NFA"
Remarks:	"UNK SPILLER AT THIS TIME - POSSIBLY A DEFECTIVE GADGE - CASTLE OIL SENT A CREW UP TO HANDLE THE CLEAN UP"
Material:	
Site ID:	230601
Operable Unit ID:	822832
Operable Unit:	01

Direction			
Distance Elevation	Site	Database(s)	EDR ID Numb EPA ID Numb
	SPILL NUMBER 0001159 (C	ontinued)	S104650655
	Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	289385 0002A #4 fuel oil Not reported Petroleum 10.00 Gallons .00 Not reported Not reported	
	Tank Test:		
56 SE 1/8	47 CLINTON PL NEW ROCHELLE, NY 10801	EDR Hist Auto	1015509830 N/A
104 mi. 8 ft.	Site 1 of 2 in cluster M		
elative: ower	Year:	DAVENPORT TOWN CAR SERVICE 2011	
ctual: ft.	Address:	47 CLINTON PL	
	Year:	DAVENPORT TOWN CAR SERVICE 2012 47 CLINTON PL	
57 'SW 1/8	CABLE 29 DIVISION STREET NEW ROCHELLE, NY	NY Spills	S109206706 N/A
104 mi. 60 ft.	Site 1 of 3 in cluster N		
elative: igher	SPILLS: Facility ID:	0804961	
ctual: )1 ft.	Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Dat Spill Cause: Spill Class:	Equipment Failure Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party.	
	SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source:	Corrective action taken. 6010 jpcummin Not reported 2008-07-30 444 Not reported Commercial/Industrial	

Commercial/Industrial

Responsible Party Not reported

MAP FINDINGS

Map ID Direction

Spill Source:

Spill Notifier: Cleanup Ceased:

Database(s)

EDR ID Number EPA ID Number

S109206706

### CABLE (Continued)

Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: **Remediation Phase:** Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City, St, Zip: Spiller Company: Contact Name: Contact Phone: DEC Memo: Remarks: Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units:

True Not reported False Not reported 0 2008-07-30 2008-07-31 ERTSDESK CABLE 29 DIVISION STREET NEW ROCHELLE, NY 001 ERTSDESK (212) 580-8383 "SEE SP: 0804960. -- NFA" "8 OUNCES AND ON GOING AND WONT MAKE 2 HOUR CLEAN UP" 401965 1158737 01 2149827 0541A dielectric fluid Not reported Petroleum .00 Gallons .00 Not reported Not reported

Tank Test:

Recovered:

Oxygenate:

**Resource Affected:** 

H58 North < 1/8 0.104 mi. 551 ft.		
551 11.	Site 10 of 12 in cluster H	
Relative: Lower Actual: 90 ft.	WESTCHESTER CO. AST: PBS Number: Site Status: GDS Number: Operator Name: Owner Name: Owner Street:	3-185515 Unregulated Not reported Anderson Development Group Anderson Development Group 1955 Central Park Avenue
	Owner Address2:	Not reported
	Owner City/State/Zip:	Yonkers, NY 10701
	Tank Number: Status: Date Installation: Capacity: Product Stored: Product Stored Percent: Date Perm Closure:	01 6. Closed - Work Permit Open 04/01/1999 5000 1. No. 2 fuel oil Not reported 02/10/2015

### NY AST A100276594 N/A

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	ANDERSON DEVELOPMENT GROU	P (Continued) 3. Aboveground on saddles,legs,stilts,racks or cradle		A100276594
	Tank Type: Tank Internal Protection: Tank External Protection: Tank Leak Detection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Piping Leak Detection: Piping Secondary Containment: Overfill Prevention: Spill Prevention: Dispenser:	<ol> <li>Steel/Carbon steel/Iron</li> <li>None</li> <li>Painted/Asphalt Coating</li> <li>Impervious Barrier/Concrete Pad (Aboveground Only)</li> <li>Vault (w/ access),5. Synthetic Liner</li> <li>Aboveground</li> <li>Galvanized Steel</li> <li>Painted/Asphalt Coating</li> <li>Exempt suction piping</li> </ol>		
H59 North < 1/8 0.104 mi. 551 ft.	ANDERSON DEVELOPMENT GROU 5 ANDERSON STREET NEW ROCHELLE, NY 10801 Site 11 of 12 in cluster H	Ρ	NY UST	U003994331 N/A
Relative:	WESTCHESTER CO. UST: Id/Status:	2.195515 / Uprogulated		
Lower	Operator Name:	3-185515 / Unregulated Anderson Development Group		
Actual: 90 ft.	Owner Name: Owner Street:	Anderson Development Group 1955 Central Park Avenue		
	Owner Address2: Owner City:	Not reported Yonkers		
	Owner State:	NY		
	Owner Zipcode: GDS Number:	10701 Not reported		
	Tank Number: Status:	1 5. Closed - removed		
	Capacity:	1500		
	Product Stored: Product Stored Percent:	Not reported		
	Tank Leak Detection:	Not reported 0. None		
	Date Installation:	Not reported		
	Date Perm Closure: Tank Location:	04/01/1999 5. Underground		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection: Tank Secondary Containment:	0. None 7. Excavation/trench Liner system		
	Piping Location:	0. No Pipiing		
	Piping Type:	1. Steel/Carbon/ steel/iron		
	Piping External Protection: Overfill Prevention:	0. None 0. None		
	Piping Secondary Containment:	Not reported		
	Spill Prevention:	0. None		
	Dispenser:	2. Suction		

Tank Number:2Status:5. Closed - removedCapacity:550Product Stored:Not reported

Database(s)

EDR ID Number **EPA ID Number** 

### ANDERSON DEVELOPMENT GROUP (Continued)

Product Stored Percent: Not reported Tank Leak Detection: 0. None Date Installation: Not reported Date Perm Closure: 04/01/1999 Tank Location: 5. Underground 1. Steel/Carbon steel/Iron Tank Type: Tank Internal Protection: 0. None Tank External Protection: 0. None Tank Secondary Containment: 0. None Piping Location: 0. No Pipiing Piping Type: 1. Steel/Carbon/ steel/iron Piping External Protection: 0. None Overfill Prevention: 0. None Piping Secondary Containment: Not reported Spill Prevention: 0. None Dispenser: 2. Suction

### H60 NORTH AVE REALITY North **5 ANDERSON ST**

< 1/8 **NEW ROCHELLE, NY** 0.104 mi.

0.104 mi. 551 ft.	Site 12 of 12 in cluster H	
Deletion	LTANKS:	
Relative: Lower	Site ID:	68769
LOwei	Spill Number/Closed Date:	
Actual:	Spill Date:	1988-07-14
90 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Not reported
	Cleanup Ceased:	1989-11-30
	Cleanup Meets Standard:	True
	SWIS:	6000
	Investigator:	jeokesso
	Referred To:	Not reported
	Reported to Dept:	1988-07-14
	CID:	Not reported
	Water Affected:	Not reported
	Spill Notifier:	Tank Tester
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	1988-07-28
	Spill Record Last Update:	1989-11-30
	Spiller Name:	Not reported
	Spiller Company:	YOSHIAKI KOWANISHA
	Spiller Address:	Not reported
	Spiller City,St,Zip:	ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	281826
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was OKESSON "
	Remarks:	"2K FAILED 4-GAL. PER HOUR"

### U003994331

NY LTANKS \$103559119 N/A

Database(s)

EDR ID Number EPA ID Number

S103559119

### NORTH AVE REALITY (Continued)

Material: 68769 Site ID: Operable Unit ID: 918394 **Operable Unit:** 01 Material ID: 458777 Material Code: 0002A Material Name: #4 fuel oil Not reported Case No .: Material FA: Petroleum Quantity: .00 Units: Gallons .00 Recovered: Not reported **Resource Affected:** Oxygenate: Not reported Tank Test: 68769 Site ID: Spill Tank Test: 1534286 Not reported Tank Number: Tank Size: 0 Test Method: 00 Leak Rate: .00 Gross Fail: Not reported Spills Modified By: Last Modified: Not reported Test Method: Unknown Site ID: 68770 Spill Number/Closed Date: 9812584 / 1999-07-12 Spill Date: 1999-01-12 Spill Cause: Tank Test Failure Spill Source: Private Dwelling Possible release with minimal potential for fire or hazard or Known Spill Class: release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. **Cleanup Ceased:** Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: WCHD Referred To: Westchester Cnty Health Dept Reported to Dept: 1999-01-12 CID: 205 Water Affected: Not reported Spill Notifier: Responsible Party Last Inspection: Not reported **Recommended Penalty:** False False UST Involvement: Remediation Phase: 0 Date Entered In Computer: 1999-01-12 Spill Record Last Update: 2003-07-01 YOSHIAKI KAWANISHA Spiller Name: Spiller Company: **5 ANDERSON ST** Spiller Address: **5 ANDERSON ST** Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001

Database(s)

EDR ID Number EPA ID Number

Spiller Contact:	YOSHIAKI KAWANISHA	
Spiller Phone:	(914) 633-3708	
	Not reported	
DEC Region:	3	
DER Facility ID:	65455	
DEC Memo:	11	
Remarks:	"TESTED TANK, TANK FAILED."	
Material:		
Site ID:	68770	
Operable Unit ID:	1069836	
Operable Unit:	01	
Material ID:	557973	
Material Code:	0002A	
Material Name:	#4 fuel oil	
Case No.:	Not reported	
	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
	Not reported	
	Not reported	
Oxygenate.	Not reported	
Tank Test:	00770	
Site ID:	68770	
Spill Tank Test:	1546738	
Tank Number:	1	
	2000	
	03	
Leak Rate:	.00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Horner EZ Check I or II	
Site ID:	68771	
Spill Number/Closed Date:		
Spill Date:	1999-01-12	
•	Tank Test Failure	
•	Private Dwelling	
	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
•	Not reported	
•	True	
	6010	
	WCHD	
	Westchester Cnty Health Dept	
Reported to Dept:	1999-01-12	
	205	
Water Affected:	Not reported	
	Responsible Party	
Spill Notifier:		
	Not reported	
Last Inspection:	Not reported False	
Last Inspection: Recommended Penalty:	•	

# NORTH AVE REALITY (Continued)

NORTH AVE REALITY (Continued)

Date Entered In Computer: 1999-01-12

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S103559119

	: 1999-01-12
Spill Record Last Update:	1999-09-07
Spiller Name:	YOSHIAKI KAWANISHA
Spiller Company:	5 ANDERSON ST
Spiller Address:	5 ANDERSON ST
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	YOSHIAKI KAWANISHA
Spiller Phone:	(914) 633-3708
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	65455
DEC Memo:	""
Remarks:	"TESTED TANK, TANK FAILED."
Material:	
Site ID:	68771
Operable Unit ID:	1069838
Operable Unit:	01
Material ID:	312860
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
enjgenaler	
ank Test:	
Site ID:	68771
Spill Tank Test:	1546739
Tank Number:	2
Tank Size:	550
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
	Not reported
Last Modified:	

PL & MAIN ST

J61 ENE < 1/8 0.105 mi. 556 ft.	CON ED-V37 LECOUNT PL & MAIN ST NEW ROCHELLE, NY 10801 Site 2 of 3 in cluster J	
Relative: Lower Actual: 87 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks:	USA NYP004027967 Not reported LECOUNT PL & BP Not reported Not reported

NY MANIFEST S109064681 N/A

Database(s)

EDR ID Number **EPA ID Number** 

### NEW ROCHELLE Location City: Location State: NY Location Zip: 10801 Location Zip 4: 0000 NY MANIFEST: NYP004027967 EPAID: Mailing Name: CON ED-V37 Mailing Contact: Not reported Mailing Address 1: Not reported Mailing Address 2: Not reported Mailing City: Not reported Mailing State: Not reported Mailing Zip: Mailing Zip 4: Not reported Not reported Mailing Country: Not reported Mailing Phone: Not reported

### J62 CON ED-V14 ENE LECOUNT PL & MAIN ST <

< 1/8 0.105 mi.	NEW ROCHELLE, NY 10801		
556 ft.	Site 3 of 3 in cluster J		
Relative: Lower	NY MANIFEST: Country: EPA ID:	USA NYP004028122	
Actual: 87 ft.	Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	Not reported LECOUNT PL & MAIN ST BP Not reported Not reported NEW ROCHELLE NY 10801 0000	
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004028122 CON ED-V14 Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported	

# S109064681

NY MANIFEST N/A

S109064677

Database(s)

EDR ID Number EPA ID Number

O63 WNW < 1/8	MEMORIAL HIGHWAY AND HUGUNOT ST NEW ROCHELLE, NY	NY Spills S104509646 N/A
0.105 mi. 557 ft.	Site 1 of 3 in cluster O	
Relative: Higher Actual: 99 ft.	SPILLS: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Contact Name: Contact Phone: DEC Memo:	9912617 ER 208558 254637 3 2000-02-04 9912617 / 2000-04-04 Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 tdghiosa Not reported 2000-02-04 270 Not reported Commercial/Industrial Affected Persons Not reported True Not reported False
	Remarks:	CLEANUP SATISFACTORY - SPILL FILE CLOSED." "CONTAMINATED SOIL DISCOVERED FROM TANK REMOVAL"
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	254637 1091315 01 294499 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

S104509646

# MEMORIAL HIGHWAY AND (Continued)

Tank Test:

1.64				C447E20270
L64 ESE			NY MANIFEST	S117538379
ESE < 1/8	150 NORTH AV			N/A
< 1/6 0.105 mi.	NEW ROCHELLE, NY 10801			
557 ft.	Site 3 of 13 in cluster L			
007 11.				
Relative:	NY MANIFEST:			
Lower	Country:	USA		
Astual	EPA ID:	NYP004710497		
Actual: 89 ft.	Facility Status:	Not reported		
0311.	Location Address 1:	150 NORTH AV		
	Code:	BP SD2014		
	Location Address 2: Total Tanks:	SB2044		
		Not reported NEW ROCHELLE		
	Location City: Location State:	NY		
	Location Zip:	10801		
	Location Zip 4:	Not reported		
		Not reported		
	NY MANIFEST:			
	EPAID:	NYP004710497		
	Mailing Name:	CON EDISON		
	Mailing Contact:			
	Mailing Address 1:	4 IRVING PL		
	Mailing Address 2: Mailing City:	15TH FL NEW YORK		
	Mailing State:	NY		
	Mailing Zip:	10003		
	Mailing Zip 4:	Not reported		
	Mailing Country:	USA		
	Mailing Phone:	Not reported		
	-			
	NY MANIFEST:			
	Document ID:	Not reported		
	Manifest Status:	Not reported		
	seq:	Not reported		
	Year:	2014		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID:	Not reported		
	Generator Ship Date:	12/29/2014		
	Trans1 Recv Date:	12/29/2014		
	Trans2 Recv Date:	Not reported		
	TSD Site Recv Date:	01/06/2015		
	Part A Recv Date:	Not reported		
	Part B Recv Date:	Not reported		
	Generator EPA ID:	NYP004710497		
	Trans1 EPA ID:	Not reported		
	Trans2 EPA ID:	Not reported		
	TSDF ID 1:	NJD002200046		
	TSDF ID 2: Manifest Tracking Number:	Not reported 012774700JJK		
	Manifest Tracking Number: Import Indicator:	N		
	Export Indicator:	N		
	Discr Quantity Indicator:	N		
	21001 Quantity maloutor.			

Database(s)

EDR ID Number EPA ID Number

# S117538379

CON EDISON (Continued)

Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code 1_2: Waste Code 1_3:	N N N Not reported Not reported H110 Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported 25 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported
Waste Code 1_4: Waste Code 1_5: Waste Code 1_6:	Not reported Not reported Not reported
—	-

L65 SE < 1/8 0.107 mi 567 ft.	CO-OP 30 CLINTON PLACE NEW ROCHELLE, NY Site 4 of 13 in cluster L	NY LTANKS	S101658613 N/A
Relative: Lower Actual: 89 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Couse: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name:	1995-07-17 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 MONACO Not reported 1995-07-17 Not reported Not reported Responsible Party Not reported False False 0	

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	CO-OP (Continued)			S101658613
	Spiller Company:	MERILITH MNGT.		
	Spiller Address:	1101 MIDLAND AVE.		
	Spiller City,St,Zip:	BRONXVILLE, ZZ		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	157941		
	DEC Memo:	111		
	Remarks:	"OIL SEEPING INTO BASEMENT POSSIBLE TANK FAILURE SOME	OIL GO	DT INTO
		SUMP PIT AND DISCHARGED OUT SUMP PUMP TAKEN OFF LINE	="	
	Material:			
	Site ID:	189169		
	Operable Unit ID:	1019355		
	Operable Unit:	01		
	Material ID:	366101		
	Material Code:	0003A		
	Material Name:	#6 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	.00		
	Units:	Pounds		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
	Site ID:	189169		
	Spill Tank Test:	1544004		
	Tank Number:	Not reported		
	Tank Size:	0		
	Test Method:	00		
	Leak Rate:	.00		
	Gross Fail:	Not reported		
	Modified By:	Spills		
	Last Modified:	Not reported		
	Test Method:	Unknown		
L66	30 CLINTON PLACE OWNERS		UST	U003855209
SE < 1/8	30 CLINTON PLACE NEW ROCHELLE, NY 10801	NY	( AST	N/A
0.107 mi. 567 ft.	Site 5 of 13 in cluster L			
Relative:	WESTCHESTER CO. UST:			

Relative:	WESTCHESTER CO. UST:	
Lower	Id/Status:	3-078727 / Active
	Operator Name:	Dave Kuilan
Actual:	Owner Name:	30 Clinton Owners Inc.
89 ft.	Owner Street:	30 Clinton Place
	Owner Address2:	Not reported
	Owner City:	New Rochelle
	Owner State:	NY
	Owner Zipcode:	10801
	GDS Number:	Not reported

Database(s)

EDR ID Number EPA ID Number

### 30 CLINTON PLACE OWNERS INC. (Continued)

Tank Number: 1old 5. Closed - removed Status: 5000 Capacity: Product Stored: Not reported Product Stored Percent: Not reported Tank Leak Detection: 0. None Date Installation: 01/01/1900 Date Perm Closure: 07/01/1995 Tank Location: 5. Underground Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 0. None Tank Secondary Containment: 0. None Piping Location: 2. Underground/on Ground Piping Type: 1. Steel/Carbon/ Steel/Iron Piping External Protection: 0. None Overfill Prevention: Not reported Piping Secondary Containment: Not reported Spill Prevention: Not reported Dispenser: 3. Gravity WESTCHESTER CO. AST: PBS Number: 3-078727 Site Status: Active GDS Number: Not reported Operator Name: Dave Kuilan 30 Clinton Owners Inc. Owner Name: **Owner Street:** 30 Clinton Place Owner Address2: Not reported Owner City/State/Zip: New Rochelle, NY 10801 Tank Number: 001 Status: 1. In-Service Date Installation: 10/01/1996 Capacity: 3500 Product Stored: 1. No. 2 fuel oil Product Stored Percent: Not reported Date Perm Closure: 01/01/1900 Tank Location: 3. Aboveground on saddles, legs, stilts, racks or cradle Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating Tank Leak Detection: 6. Impervious Barrier/Concrete Pad (Aboveground Only) Tank Secondary Containment: 2. Vault (w/ access) Piping Location: 1. Aboveground Piping Type: 1. Steel/Carbon/ Steel/Iron Piping External Protection: 1. Painted/Asphalt Coating Piping Leak Detection: 0. None Piping Secondary Containment: 0. None Overfill Prevention: 4. Product Level Gauge (Aboveground Only), 5. Vent Whistle Spill Prevention: 0. None Dispenser: 2. Suction

Tank Number:	1
Status:	4. Closed - in place
Date Installation:	01/01/1996

### U003855209

Database(s)

EDR ID Number EPA ID Number

### 30 CLINTON PLACE OWNERS INC. (Continued)

Capacity: 4200 Product Stored: Not reported Product Stored Percent: Not reported Date Perm Closure: 07/01/1995 Tank Location: 3. Aboveground on saddles, legs, stilts, racks or cradle Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 0. None Tank Leak Detection: 0. None Tank Secondary Containment: 0. None Piping Location: 3. Aboveground/underground combination 1. Steel/Carbon/ steel/iron Piping Type: Piping External Protection: 1. Painted/Asphalt Coating Piping Leak Detection: Not reported Piping Secondary Containment: Not reported **Overfill Prevention:** 0. None Spill Prevention: 0. None Dispenser: 2. Suction

CON EDISON MANHOLE: 2042

### L67 CON EDISON MANHOLE: 2042

### ESE NORTH AVE & CLINTON PL < 1/8 NEW ROCHELLE, NY 10804

RCRA NonGen / NLR:

Facility name:

### 0.108 mi. 570 ft. Site 6 of 13 in cluster L

Relative: Lower

Actual: 89 ft.

Facility address: NORTH AVE & CLINTON PL NEW ROCHELLE, NY 10804 EPA ID: NYP004443198 Mailing address: **IRVING PL, 15TH FL NE** NEW YORK, NY 10003 THOMAS TEELING Contact: Contact address: Not reported Not reported Contact country: Not reported (212) 460-3770

Date form received by agency: 03/16/2014

Contact telephone:(212) 460-3770Contact email:Not reportedEPA Region:02Classification:Non-GeneratorDescription:Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste: Mixed waste (haz. and radioactive):	No No No
Recycler of hazardous waste: Transporter of hazardous waste:	No
•	No
Treater, storer or disposer of HW:	
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No

RCRA NonGen / NLR	1016970603
NY MANIFEST	NYP004443198

Database(s)

EDR ID Number EPA ID Number

1016970603

CON EDISON MANHOLE: 2042 (Continued)		
Used oil transfer facility: Used oil transporter:	No No	
Historical Generators: Date form received by agency Site name: Classification:	: 02/16/2014 CON EDISON MANHOLE: 2042 Conditionally Exempt Small Quantity Generator	
Violation Status:	No violations found	
NY MANIFEST:		
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004443198 Not reported NORTH AVE & CLINTON PL BP Not reported Not reported NEW ROCHELLE NY 10801 Not reported	
NY MANIFEST:		
EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004443198 CON EDISON CON EDISION 4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported	
NY MANIFEST:		
Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator:	Not reported Not reported Not reported 2014 NYD006982359 Not reported 02/16/2014 02/16/2014 Not reported 02/24/2014 Not reported Not reported Not reported NYP004443198 Not reported NYP004443198 Not reported NyP004443198 Not reported Not re	

Database(s)

EDR ID Number **EPA ID Number** 

1016970603

### CON EDISON MANHOLE: 2042 (Continued)

Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code 1_2: Waste Code 1_4:	N N N N N N Not reported Not reported Not reported Not reported H110 Not reported T O O P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not
_	•
—	•
_	•
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

### L68 **CON EDISON SERVICE BOX: 2040** ESE **NORTH AVE & CLINTON PL** < 1/8 NEW ROCHELLE, NY 10805

### 570 ft. Site 7 of 13 in cluster L

Relative:

0.108 mi.

RCRA NonGen / NLR: Lower Date form received by agency: 03/26/2014 CON EDISON SERVICE BOX: 2040 Facility name: Actual: Facility address: NORTH AVE & CLINTON PL 89 ft. NEW ROCHELLE, NY 10805 EPA ID: NYP004452439 Mailing address: **IRVING PL, 15TH FL NE** NEW YORK, NY 10003 Contact: THOMAS TEELING Contact address: Not reported Not reported Contact country: Not reported (212) 460-3770 Contact telephone: Contact email: Not reported EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No

RCRA NonGen / NLR 1016971500 NY MANIFEST NYP004452439

Database(s)

EDR ID Number EPA ID Number

CON EDISON SERVICE BOX: 2040	0 (Continued)
Transporter of hazardous wast Treater, storer or disposer of H Underground injection activity: On-site burner exemption: Furnace exemption: Used oil fuel burner: Used oil fuel burner: Used oil refiner: Used oil fuel marketer to burne Used oil fuel marketer to burne Used oil fuel marketer to burne Used oil fuensfer facility: Used oil transfer facility:	IW: No No No No No No er: No
Historical Generators: Date form received by agency: Site name: Classification:	02/26/2014 CON EDISON SERVICE BOX: 2040 Conditionally Exempt Small Quantity Generator
Violation Status:	No violations found
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	USA NYP004452439 Not reported NORTH AVE & CLINTON PLS BP SB2040 Not reported NEW ROCHELLE NY 10801 Not reported NYP004452439 CON EDISON CON EDISON CON EDISION 4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported
NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date:	Not reported Not reported 2014 NYD006982359 Not reported 02/26/2014 02/26/2014 Not reported 02/27/2014

### EDISON SERVICE BOX: 2040 (C **.**+i. 47

1016971500

Units:

Database(s)

EDR ID Number **EPA ID Number** 

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004452439 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 012772758JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 30 P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

101	697 <sup>·</sup>	1500
-----	------------------	------

M69 SSE < 1/8 0.110 mi. 583 ft.	CON EDISON 46 CLINTON PL NEW ROCHELLE, NY 10801 Site 2 of 2 in cluster M		RCRA-CESQG NY MANIFEST
Relative: Lower Actual: 91 ft.	RCRA-CESQG: Date form received by agend Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone:	cy: 04/01/2008 CON EDISON 46 CLINTON PL NEW ROCHELLE, NY 10801 NYP004157665 4 IRVING PL, RM 828 NEW YORK, NY 10003 DAVID DUKE Not reported Not reported Not reported (212) 580-8383	

### ANIFEST NYP004157665

1012184999

Database(s)

EDR ID Number EPA ID Number

### **CON EDISON (Continued)** 1012184999 Contact email: Not reported EPA Region: 02 Classification: Conditionally Exempt Small Quantity Generator Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less

of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any

time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No

No

No

Used oil Specification marketer:

Used oil transfer facility:

### Used oil transporter: No Violation Status: No violations found NY MANIFEST: USA Country: NYP004157665 EPA ID: Facility Status: Not reported Location Address 1: **46 CLINTON PLACE** Code: ΒP Location Address 2: Not reported Total Tanks: Not reported NEW ROCHELLE Location City: Location State: NY Location Zip: 10805 Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004157665 Mailing Name: CONSOLIDATED EDISON Mailing Contact: FRAMKLYN MURRAY Mailing Address 1: 4 IRVING PLACE RM 828 Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY

Database(s)

EDR ID Number EPA ID Number

1012184999

· · ·	
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124602808
5	
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2008
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	04/01/2008
Trans1 Recv Date:	04/01/2008
Trans2 Recy Date:	Not reported
TSD Site Recy Date:	04/01/2008
Part A Recv Date:	Not reported
Part B Recy Date:	Not reported
Generator EPA ID:	NYP004157665
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000705939
TSDF ID 2:	Not reported
Manifest Tracking Number:	002013408FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H135
Waste Code:	Not reported
Quantity:	180.0
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	6.0
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Waste Code:	D018
Waste Code 1_2:	Not reported
Wasta Codo 1 2:	Not reported

Not reported

Not reported Not reported Not reported

# CON EDISON (Continued)

Waste Code 1\_3:

Waste Code 1\_4: Waste Code 1\_5:

Waste Code 1\_6:

Database(s)

EDR ID Number EPA ID Number

O70 West < 1/8 0.111 mi.	AVALON ON THE SOUND HUGUENOT STREET AND MEMOR NEW ROCHELLE, NY 10801	RAL HWY	NY UST	U003994344 N/A
587 ft.	Site 2 of 3 in cluster O			
-	Site 2 of 3 in cluster O WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment	2. Underground/on ground 1. Steel/Carbon/ steel/iron 0. None 0. None		
	Spill Prevention:	0. None		
	Dispenser:	0. None		
71 North < 1/8 0.112 mi. 590 ft.	FEDERAL PROPERTY MAINTENA 244 NORTH AVE SUITE 153 NEW ROCHELLE, NY 10801	NCE CORP	RCRA NonGen / NLR	1012186472 NYR000163337
Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agency:	02/23/2009		
Actual: 89 ft.	Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone:	FEDERAL PROPERTY MAINTENANCE CORP 244 NORTH AVE SUITE 153 NEW ROCHELLE, NY 10801 NYR000163337 NORTH AVE SUITE 153 NEW ROCHELLE, NY 10801 KRISTIE EFFEREN NORTH AVE SUITE 153 NEW ROCHELLE, NY 10801 US (914) 355-2226 FEDERALPMC@AOL		
		02		
	Classification:	Non-Generator		

72

NW

< 1/8

0.112 mi. 591 ft.

### MAP FINDINGS

EDR ID Number **EPA ID Number** 

Database(s)

### FEDERAL PROPERTY MAINTENANCE CORP (Continued)

1012186472 Description: Handler: Non-Generators do not presently generate hazardous waste Owner/Operator Summary: Owner/operator name: **KRISTIE EFFEREN** Owner/operator address: Not reported Not reported Owner/operator country: Not reported Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: 06/24/2005 Owner/Op end date: Not reported Owner/operator name: ANTHONY VALENTINO Owner/operator address: GRANT AVE HARRISON, NY 10528 Owner/operator country: US Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 05/20/1978 Owner/Op end date: Not reported Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: Yes Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No Violation Status: No violations found NY Spills S104509750 MH1204 HUGUENOT AVE/LAWTON AV N/A **NEW ROCHELLE, NY** 

Relative: Lower	SPILLS: Facility ID: Facility Type:	9912755 ER
Actual: 91 ft.	DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	214030 262084 3 2000-02-09 9912755 / 2000-02-14 Unknown Known release with minimal potential for fire or hazard. DEC Response.

Database(s)

EDR ID Number EPA ID Number

# MH1204 (Continued)

S104509750

	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	ibodee
Referred To:	Not reported
Reported to Dept:	2000-02-09
CID:	270
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2000-02-09
Spill Record Last Update:	2000-02-17
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	O'DEE 02/09/2000 SOURCE UNKNOWN-NO OIL FILLED CONED EQUIPMENT NEARBY.
	VAC TRUCK BEING SENT TO SITE. WILL CALL WITH RESULTS OF PRODUCT I.D.
	SPILL VOLUME DOWNGRADED TO 3 GALLONS. 02/14/2000 CLEANUP REPORT SENT
	TO TARRYTOWN OFFICE. AMOUNT SPILLED WAS ACTUALLY 3 GALLONS. NFA"
Remarks:	"OIL STAGNANT SAMPLES WILL BE TAKEN CLEAN UP PENDING"
Material:	
Site ID:	262084
Operable Unit ID:	1091472
Operable Unit:	01
Material ID:	294626
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	3.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Database(s)

EDR ID Number EPA ID Number

O73 WNW < 1/8 0.117 mi. 618 ft.	CONSOLIDATED EDISON MEMORIAL HIGHWAY & HUGUENO NEW ROCHELLE, NY 10802 Site 3 of 3 in cluster O	T ST	NY MANIFEST	S108650791 N/A
WNW < 1/8 0.117 mi.	MEMORIAL HIGHWAY & HUGUENO NEW ROCHELLE, NY 10802 Site 3 of 3 in cluster O NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location State: Location Zip Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Part B Recv Date: Part B Recv Date: Canerator EPA ID: Trans2 EPA ID:	USA NYP004151221 Not reported MEMORIAL HIGHWAY & HUGUENOT ST BP Not reported NEW ROCHELLE NY 10802 Not reported NYP004151221 CONSOLIDATED EDISON FRANKLYN MURRAY 4 IRVING PLACE RM 828 Not reported NEW YORK NY 10003 Not reported USA 2124602808 Not reported Not reported NJD991291105 Not reported 000174983GBF		
	Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number:	N N Y N N Not reported		

Database(s)

EDR ID Number EPA ID Number

S108650791

Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H129 Waste Code: Not reported Quantity: 1820 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: D018 Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

74 ENE < 1/8 0.117 mi. 620 ft.	SOIL 12 LOCUST AVE NEW ROCHELLE, NY	NY Spills	S111238549 N/A
Relative:	SPILLS:		
Lower	Facility ID:	1107221	
Actual:	Facility Type:	ER 409508	
90 ft.	DER Facility ID: Site ID:	409508 454913	
	DEC Region:	3	
	Spill Date:	2011-09-08	
	Spill Number/Closed Date:	1107221 / Not Reported	
	Spill Cause:	Equipment Failure	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
	SWIS:	6010	
	Investigator:	JKOMARA	
	Referred To:	Not reported	
	Reported to Dept:	2011-09-08	
	CID:	Not reported	
	Water Affected:	Not reported	
	Spill Source:	Commercial/Industrial	
	Spill Notifier:	Other Net or particular	
	Cleanup Ceased: Cleanup Meets Std:	Not reported False	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Trust:	False	
	Remediation Phase:	4	
	Date Entered In Computer:	2011-09-08	
	Spill Record Last Update:	2013-04-18	
	Spiller Name:	Not reported	
	Spiller Company:	UNION BAPTIST CHURCH	

Database(s)

EDR ID Number EPA ID Number

### 238549

	SOIL (Continued)			S111238549
	Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name: Contact Phone: DEC Memo:	Not reported NY 999 JOE MANCINI Not reported "9/8/11- Spoke to Joe at WCHD. he reports that church burnt of site awhile ago but small house on property has suspect u/g ta may have filled with stormwater causing leak of oil. Soil around	ank that	
	Remarks:	pipe is impacted and sheen with stormwater ran out to sidewa to followup. DT 4-1-13 request update from WCHD RDB 4-12- update request to WCHD sent RDB 4-18-13 response from Mi he has nothing to update the spill with RDB." "Caller advised oil spilled onto soil. Clean up is pending."	-13 another	łD
	Matarial			
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	454913 1205063 01 2201890 0001A #2 fuel oil Not reported Petroleum Not reported Not reported Not reported Not reported Not reported Not reported		
N75 West < 1/8 0.119 mi. 627 ft.	NEW ROCHELLE IRISH BENEV 38 DIVISION STREET NEW ROCHELLE, NY 10801 Site 2 of 3 in cluster N	OLENT SOCIETY	NY UST	U003884840 N/A
Relative: Higher	WESTCHESTER CO. UST: Id/Status:	3-600097 / Unregulated		
riighei	Operator Name:	New Rochelle Irish Benevolent Society		
Actual: 101 ft.	Owner Name:	New Rochelle Irish Benevolent Society		
101 11.	Owner Street: Owner Address2:	38 Division Street Not reported		
	Owner City:	New Rochelle		
	Owner State: Owner Zipcode:	NY 10801		
	GDS Number:	Not reported		
	Tank Number:	26051652		
	Status:	5. Closed - removed		
	Capacity: Product Stored:	2000 1. No. 2 fuel oil		
	Product Stored: Product Stored Percent:	Not reported		
	Tank Leak Detection:	0. None		
	Date Installation:	01/01/1940		
	Date Perm Closure: Tank Location:	01/09/2015 5. Underground		
		5. Onderground		

Map ID		MAP FINDINGS		
Direction	Ц			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	NEW ROCHELLE IRISH BENEV	OLENT SOCIETY (Continued)		U003884840
				0003004040
	Tank Type: Tank Internal Protection:	1. Steel/Carbon steel/Iron 0. None		
	Tank External Protection:	8. Wrapped (Piping)		
	Tank Secondary Containme			
	Piping Location:	2. Underground/on Ground		
	Piping Type:	9. Copper		
	Piping External Protection: Overfill Prevention:	8. Wrapped (Piping)		
	Piping Secondary Containm	5. Vent Whistle		
	Spill Prevention:	1. Catch Basin		
	Dispenser:	3. Gravity		
N76 West	LILLIAN VERNON CO. WESTCHESTER PLACE		NY LTANKS	S100494788 N/A
< 1/8	NEW ROCHELLE, NY			N/A
0.119 mi.				
629 ft.	Site 3 of 3 in cluster N			
Relative:	LTANKS:			
Higher		201286		
Actual:	Spill Number/Closed Date:			
101 ft.		1993-02-22 Tank Test Failure		
	•	Commercial/Industrial		
	•	Known release with minimal potential for fire or hazard. DEC	Response.	
		Willing Responsible Party. Corrective action taken.		
		1995-03-16		
		False 6010		
		WXWADSWO		
		Not reported		
	Reported to Dept:	1993-02-22		
		Not reported		
		Not reported		
	•	Tank Tester Not reported		
	•	False		
	UST Involvement:	False		
		0		
	Date Entered In Computer: Spill Record Last Update:			
		1995-08-07 Not reported		
	•	Not reported		
	•	Not reported		
	1 22 2 1	***Update***, ZZ		
	, ,	001		
		Not reported Not reported		
	•	Not reported		
		3		
	DER Facility ID:	167465		
		"Prior to Sept, 2004 data translation this spill Lead_DEC Fie		
		WADSWORTH 09/27/95: This is additional information about	it material	
		spilled from the translation of the old spill file: TANK TEST." "TO HAVE MEETING TO DISCUSS FURTHER ACTION TA		
		TEMP TANK BEING SET UP AES SYSTEM II"		

Database(s)

EDR ID Number EPA ID Number

	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	201286 977443 01 570289 0001A #2 fuel oil Not reported Petroleum .00 Not reported .00 Not reported Not reported Not reported	
	Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	201286 1541204 Not reported 0 00 .00 Not reported Spills Not reported Unknown	
P77 West < 1/8 0.120 mi. 635 ft.	VACANT LOT HUGUENOT ST/DIVISION ST NEW ROCHELLE, NY Site 1 of 10 in cluster P	NY LTANKS	S107489335 N/A
Relative: Higher	LTANKS: Site ID:	356539	
Actual: 101 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer:	2005-12-08 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2005-12-08 407 Not reported Other Not reported False False 0	

# LILLIAN VERNON CO. (Continued)

Material:

S100494788

Map ID Direction Distance Elevation Site

P78

West

< 1/8

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

### VACANT LOT (Continued) S107489335 Spiller Name: STEVE GRENS Spiller Company: VACANT LOT Spiller Address: HUGUENOT ST/DIVISION ST Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: STEVE GRENS Spiller Phone: (914) 806-5650 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 306600 "March 15, 2006: BROOKSIDE ENVIRONMENTAL DISPOSED OF LUST AND 5.62 DEC Memo: TONS OF CONTAMINATED SOIL. CLOSURE REPORT RECEIVED FROM AKRF. BASED UPON INFORMATION PROVIDED TO DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod" Remarks: "Tank removal, tank size 1000 gallons." Material: Site ID: 356539 Operable Unit ID: 1113840 Operable Unit: 01 Material ID: 2103900 Material Code: 0001A Material Name: #2 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: Not reported Gallons Units: Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: ROAD NY Spills S108130430 **HUGUENOT ST/DIVISION ST** N/A **NEW ROCHELLE, NY** 0.120 mi. 635 ft. Site 2 of 10 in cluster P SPILLS: **Relative:** Facility ID: 0606187 Higher Facility Type: ER Actual: DER Facility ID: 306600 101 ft. Site ID: 369495 DEC Region: 3 2006-08-29 Spill Date: Spill Number/Closed Date: 0606187 / 2006-09-03 Spill Cause: Equipment Failure Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 JBODee Investigator: Referred To: Not reported Reported to Dept: 2006-08-29 CID: 410 Water Affected: Not reported

Database(s)

EDR ID Number EPA ID Number

### 30

ROAD (Continued)			S108130430
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Company: Contact Name: Contact Phone: DEC Memo: Remarks:	Commercial Vehicle Fire Department Not reported True Not reported False False 0 2006-08-29 2006-09-03 JEFF CULLEN GC RELIABLE SERVICE COMPA 80 GROVE ST NEW ROCHELLE, NY 001 WESTCHESTER FIRE CONTROL (914) 231-1905 "DPW sanded road. No product to recover. jod" "SPILL SPANS FOR FIVE BLOCKS BETWEEN THE TWO S LOCATION: CLEANUP IN PROGRESS: DPW ON SCENE:"	TREETS GI	VEN IN
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	369495 1127329 01 2116923 0001A #2 fuel oil Not reported Petroleum 60.00 Gallons .00 Not reported Not reported		
REMEDIATION SITE #C360078 149 NORTH AVE NEW ROCHELLE, NY Site 8 of 13 in cluster L SPILLS: Facility ID: Facility Type: DER Facility ID:	1203976 ER 421175	— NY Spills	S112147967 N/A
Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	466831 3 2012-07-23 1203976 / 2013-12-09 Other Possible release with minimal potential for fire or hazard or K release with no damage DEC Response Willing Responsible		

release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.

SWIS:

6010

L79

ESE

< 1/8 0.122 mi. 645 ft.

**Relative:** Lower Actual: 89 ft.

Database(s)

EDR ID Number EPA ID Number

### S112147967

### REMEDIATION SITE #C360078 (Continued)

Investigator: **ELMOORE** Referred To: Not reported Reported to Dept: 2012-07-23 CID: Not reported Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2012-07-23 Spill Record Last Update: 2013-12-09 **KIERRA THOMPSON** Spiller Name: Spiller Company: UNK Spiller Address: Not reported Spiller City, St, Zip: NY Spiller Company: 999 Contact Name: ALLISON PHEALAN Contact Phone: 914-592-3117 DEC Memo: "7-23-12 Kiera is the PM for the BCP site. She asked that spill be called in. jc 7/23/2012 -- BCP Volunteer will attempt to delineate and point in the direction of the source. At his point, source appears to be from off site. Spill follow up will wait for BCP delineation. ELM 12/9/2013 -- BCP will take care of this. nfa for spills ELM" "PRODUCT IN GW" Remarks: Material: Site ID: 466831 **Operable Unit ID:** 1216810 Operable Unit: 01 Material ID: 2215023 Material Code: 0066A Material Name: unknown petroleum Case No .: Not reported Material FA: Petroleum Not reported Quantity: Not reported Units: Not reported Recovered: **Resource Affected:** Not reported Oxygenate: Not reported

Tank Test:

Database(s)

EDR ID Number EPA ID Number

L80 ESE < 1/8 0 122 mi	OFF-SITE FLAMINGO CLEANERS 149 NORTH AVENUE NEW ROCHELLE, NY 10801	NY BROWNFIELDS S110043637 N/A
645 ft.	Site 9 of 13 in cluster L	
ESE < 1/8 0.122 mi.	Site 9 of 13 in cluster L Program: Site Code: Acres: HW Code: SWIS: Town: Record Added Date: Record Updated Date: Update By: Site Description: Site Description:	BCP 414661 Not reported C360078A 6010 New Rochelle (c) 06/03/2009 02/29/2016 DACROSBY Location: This site is the off-site component of the former Flamingo Dry Cleaners site (C360078). The site is located in an urban area of New Rochelle, Westchester County, at the southeastern corner of the intersection of Clinton Place and North Avenue. Site Features: The site itself is a one-story commercial building which includes four stores including the vacant dry cleaners. This off-site component is comprised of immediately-surrounding areas. Current Zoning/Uses: Surrounding land uses include parking lots, commercial establishments, a residential apartment complex, a college, a medical facility, and a church. Historical Uses: The on-site building was constructed in 1941 and used for retail. Flamingo Cleaners began operations in 1958 and ran until 2005 when all dry-cleaning equipment was removed. On-site contamination is a result of the former dry cleaner operations from improper management, disposal, and leaks of tetrachloroethylene (PCE). A referral for off-site work was completed in December 2007 and a SSF RI/FS Work assignment was approved in March 2009. The RI field work was conducted in the summer of 2009 and fall of 2009. Additional round of gw analyses occurred in spring 2010. The on-going off-site investigation thus far indicates that PCE is not present in environmental media above standards in the area surrounding the site. Site Geology/Hydrogeology: The area surrounding the site is underlain by glacial till which sit atop highly weathered bedrock. Area bedrock ranges from 5-25 feet below ground surface. The water table ranges from 5-11 feet below ground surface. Groundwater flow direction is dominantly to the south-southwest toward Long Island Sound, but site specific groundwater flow direction is radial and seasonally affected.(1/13) Nature and Extent of Contamination: Based on investigations to date, the primary contaminant of concern at the site is
	Hoolth Droblom:	the primary contaminant of concern at the site is tetracholoroethylene (PCE), a dry cleaning solvent. On-site, PCE has been detected in soils, soil vapor, indoor air, and groundwater. The off-site investigation to date indicates that there are no off-site impacts. Special Resources Impacted/Threatened: The site is located in an urban area of the City of New Rochelle. There are no special resources identified near the site.
	Health Problem:	Not reported

Database(s)

EDR ID Number EPA ID Number

FLAMINGO CLEANERS 149 NORTH AVE NEW ROCHELLE, NY 10801	RCRA-LQG 1000299848 NY BROWNFIELDS NYD012946885 NY MANIFEST
Site 10 of 13 in cluster L	
Site 10 of 13 in cluster L RCRA-LQG: Date form received by agence Facility name: Facility address: EPA ID: Mailing address: Contact: Contact country: Contact country: Contact telephone: Contact telephone: Contact email: EPA Region: Land type: Classification: Description:	y: 07/10/2012 FLAMINGO CLEANERS 149 NORTH AVE NEW ROCHELLE, NY 10801 NYD012946885 NORTH AVE NEW ROCHELLE, NY 10801 RICHARD H DORAN DORSON ENVIRONMENTAL MGMT INC 45 KNOLLWOOD RD SUITE 300 ELMSFORD, NY 10523 US (914) 592-3117 RDORAN@DORSON.COM 02 Private Large Quantity Generator Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely
	hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time
Owner/Operator Summary: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date: Owner/Op end date: Owner/operator name: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Operator Type: Owner/Op start date: Owner/Op end date: Owner/Op end date:	TAEYOON KIM 149 NORTH AVE NEW ROCHELLE, NY 10801 US (914) 235-1591 Private Operator Not reported Not reported V & V CAPITAL LLC PHILLIPS HILL RD NEW CITY, NY 10956 US Not reported Private Owner 07/14/2011 Not reported LUIGI LLESHAJ Not reported
	149 NORTH AVE         NEW ROCHELLE, NY 10801         Site 10 of 13 in cluster L         RCRA-LQG:         Date form received by agend         Facility name:         Facility address:         EPA ID:         Mailing address:         Contact:         Contact country:         Contact telephone:         Contact email:         EPA Region:         Land type:         Classification:         Description:         Owner/Operator Summary:         Owner/Operator rame:         Owner/operator rame:         Owner/operator rame:         Owner/operator rame:         Owner/operator rame:         Owner/Operator Type:         Owner/Op start date:         Owner/operator raddress:         Owner/operator rame:         Owner/operator rame:         Owner/Op end date:         Owner/operator raddress:         Owner/operator ruppe:         Owner/Operator Type:     <

Database(s)

EDR ID Number **EPA ID Number** 

## FLAMINGO CLEANERS (Continued)

EAMINGO DEEANENO (OOMING	
	Not reported
Owner/energian	US
Owner/operator country:	
Owner/operator telephone:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	07/14/2011
Owner/Op end date:	Not reported
Owner/operator name:	ΤΑΕΥΟΟΝ ΚΙΜ
Owner/operator address:	149 NORTH AVE
	NEW ROCHELLE, NY 10801
Owner/operator country:	US
Owner/operator telephone:	(914) 235-1591
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported
Handler Activities Summary:	
U.S. importer of hazardous wa	aste: No
Mixed waste (haz. and radioa	
Recycler of hazardous waste:	
Transporter of hazardous waste	
Treater, storer or disposer of	
Underground injection activity	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burn	er: No
Used oil Specification markete	er: No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	D039
. Waste name:	TETRACHLOROETHYLENE
. Waste code:	D040
. Waste name:	TRICHLORETHYLENE
. Waste code:	F001
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:
. Waste name.	TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE,
	1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED
	FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING
	CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF
	ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED
	IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE
	SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	F002
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE,
	METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,
	CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE,
	ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,
	TRICH ODOETHANE, ALL ODENT COLVENT MIXTURES (DI ENDS CONTAINING DECODE

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	FLAMINGO CLEANERS (Continu	ed)		1000299848
		USE, A TOTAL OF TEN PERCENT OR MORE (B ABOVE HALOGENATED SOLVENTS OR THOSE F005; AND STILL BOTTOMS FROM THE RECOV SPENT SOLVENT MIXTURES.	SOLVENTS LISTED I	N F001, F004, AND
	. Waste code: . Waste name:	F003 THE FOLLOWING SPENT NONHALOGENATED ACETATE, ETHYL BENZENE, ETHYL ETHER, M ALCOHOL, CYCLOHEXANONE, AND METHANO MIXTURES/BLENDS CONTAINING, BEFORE US NONHALOGENATED SOLVENTS; AND ALL SPE CONTAINING, BEFORE USE, ONE OR MORE O SOLVENTS, AND A TOTAL OF TEN PERCENT O MORE OF THOSE SOLVENTS LISTED IN F001, BOTTOMS FROM THE RECOVERY OF THESE S MIXTURES.	ETHYL ISOBUTYL KET DL; ALL SPENT SOLVEI E, ONLY THE ABOVE INT SOLVENT MIXTUR F THE ABOVE NONHA DR MORE (BY VOLUME F002, F004, AND F005	TONE, N-BÜTYL NT SPENT RES/BLENDS LOGENATED E) OF ONE OR ; AND STILL
<ul> <li>Waste code:</li> <li>Waste name:</li> <li>Waste name:</li> <li>THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRE AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY ( SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFO TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOL SPENT SOLVENT MIXTURES.</li> </ul>				
	. Waste code: . Waste name:	F005 THE FOLLOWING SPENT NONHALOGENATED KETONE, CARBON DISULFIDE, ISOBUTANOL, I 2-ETHOXYETHANOL, AND 2-NITROPROPANE; J CONTAINING, BEFORE USE, A TOTAL OF TEN ONE OR MORE OF THE ABOVE NONHALOGEN LISTED IN F001, F002, OR F004; AND STILL BO THESE SPENT SOLVENTS AND SPENT SOLVE	PYRIDINE, BENZENE, ALL SPENT SOLVENT PERCENT OR MORE ( ATED SOLVENTS OR TTOMS FROM THE RE	MIXTURES/BLENDS (BY VOLUME) OF THOSE SOLVENTS
	Historical Generators:			
	Date form received by agency Site name: Classification:	:01/01/2007 FLAMINGO CLEANERS Conditionally Exempt Small Quantity Generator		
	Date form received by agency Site name: Classification:	:01/01/2006 FLAMINGO CLEANERS Conditionally Exempt Small Quantity Generator		
	Date form received by agency Site name: Classification:	:11/21/1991 FLAMINGO CLEANERS Small Quantity Generator		
	. Waste code: . Waste name:	F002 THE FOLLOWING SPENT HALOGENATED SOLV METHYLENE CHLORIDE, TRICHLOROETHYLEN CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TR ORTHO-DICHLOROBENZENE, TRICHLOROFLU TRICHLOROETHANE; ALL SPENT SOLVENT MI USE, A TOTAL OF TEN PERCENT OR MORE (B' ABOVE HALOGENATED SOLVENTS OR THOSE F005; AND STILL BOTTOMS FROM THE RECOV	NE, 1,1,1-TRICHLOROE IFLUOROETHANE, OROMETHANE, AND XTURES/BLENDS COI Y VOLUME) OF ONE C SOLVENTS LISTED II	ETHANE, 1,1,2, NTAINING, BEFORE DR MORE OF THE N F001, F004, AND

Database(s)

EDR ID Number EPA ID Number

1000299848

# FLAMINGO CLEANERS (Continued)

SPENT SOLVENT MIXTURES.

<ul> <li>Facility Has Received Notices of Regulation violated: Area of violation:</li> <li>Date violation determined:</li> <li>Date achieved compliance:</li> <li>Violation lead agency:</li> <li>Enforcement action:</li> <li>Enforcement action date:</li> <li>Enf. disposition status:</li> <li>Enf. disp. status date:</li> <li>Enforcement lead agency:</li> <li>Proposed penalty amount:</li> <li>Final penalty amount:</li> <li>Paid penalty amount:</li> </ul>	Violations: Not reported Listing - General 07/10/2006 08/18/2006 State WRITTEN INFORMAL 08/03/2006 Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Evaluation Action Summary: Evaluation date: Evaluation: Area of violation: Date achieved compliance: Evaluation lead agency:	07/10/2006 COMPLIANCE EVALUATION INSPECTION ON-SITE Listing - General 08/18/2006 State
BROWNFIELDS: Program: Site Code: Acres: HW Code: SWIS: Town: Record Added Date: Record Updated Date: Update By: Site Description:	BCP 335220 0.12 C360078 6010 New Rochelle (c) 12/16/2004 05/28/2015 DACROSBY Location: The Flamingo Cleaners site is located in an urban area of New Rochelle, Westchester County, at the southeastern corner of the intersection of Clinton Place and North Avenue. Site Features: The site is a one-story commercial building with a full basement. The building is divided into four tenant spaces which include a bar/lounge, beauty salon, and two vacant spaces that previously housed a travel agency and a dry-cleaner.Current Zoning/use(s): The site consists of four retail spaces, two of which are currently occupied. The site is zoned for commercial use. The surrounding land uses include parking lots, commercial establishments, a residential apartment complex, a medical center, and a church. The dry cleaning operation is no longer active and the space is currently vacant.Historical Uses: The existing building was constructed in 1941 and used for retail. Flamingo Cleaners began dry cleaning operations in 1958, and ran until 2005 when all dry-cleaning equipment was removed. Site contamination is a result of the former dry cleaner operations from improper management, disposal, and leaks of tetrachloroethylene (PCE).Prior completed investigations include a Phase I Investigation in October of 2003 and a Phase II Investigation completed in March of 2004. The Volunteer entered into a Brownfield Cleanup Agreement in April 2005. A Decision Document was issued in March 2012 for a remedy involving source soil removal and in situ chemical oxidation treatment of groundwater. Based on the extent of

EDR ID Number Database(s) EPA ID Number

FLAMINGO CLEANERS (Continued)	10002998
	the site contamination, a referral to State Superfund for an off-site investigation was completed in December 2007. The groundwater plume was found to be isolated to immediately behind the building and little to no off-site impacts were noted in groundwater, soils, nor in soil vapor.Site Geology/hydrogeology: The site is underlain by glacial till which sits atop highly weathered bedrock. Bedrock ranges from 5 - 22 feet below ground surface. The water table is between 5 - 11 feet below ground surface. Groundwater flow direction dominantly to the south-southeast toward Long Island Sound, however, site specific groundwater flow direction is radial, and seasonally affected.
Env Problem:	<ul> <li>Nature and Extent of Contamination: Based on the investigations conducted to date, the primary contaminant of concern at the site is tetrachloroethylene (PCE or perc), a dry cleaning solvent. PCE has been detected in exceedance of SCGs in on-site soils, soil vapor, on-site indoor air, and on-site groundwater. The off-site investigation to date indicates that there are no off-site impacts. Source area soils contained as much as 1,300 parts per million (ppm) of PCE, which exceeds the 1.3 ppm protection of groundwater soil cleanup objective. Immediately outside of the source area, soil concentrations of PCE ranged from 0.06 ppm - 0.91 ppm and did not exceed the soil cleanup objective for commercial use. PCE in groundwater was found at concentrations ranging from 1,000 parts per billion (ppb) - 19,000 ppb, which greatly exceeds the 5 ppb groundwater standard. PCE concentrations in sub-slab soil gas ranged from 15,700 ug/m3 - 570,000 ug/m3, and PCE in indoor air ranged from 115 ug/m3 - 1,040 ug/m3, exceeding NYDOH ambient air guidance valu of 100 ug/m3 PCE. Concentrations of other volatile organic compounds (VOCs) including trichloroethene (TCE), 1,2-dichloroethene (1,2-DCE) and 1,1,1 trichloroethane (1,1,1 TCA) also exceeded groundwater standards but to a lesser extent. A state-funded RI/FS of the off-site extent of soil vapor and groundwater contamination was conducted from 2009-2011. The results indicate that the groundwater and soil vapor plumes appear to be limited to immediately below the site. Special Resources Impacted/Threatened: The site is located in an</li> </ul>
Health Problem:	site. Special Resources Impacted/Threatened: The site is located in an urban area of the City of New Rochelle. There are no special resources identified near the site. Direct contact with contaminants in the soil is unlikely because the majority of the site is covered with buildings and pavement. Contaminated groundwater at the site is not used for drinking or other purposes and the site is served by a public water supply that obtains water from a different source not affected by this contamination. Volatile organic compounds in groundwater and/or soil may move into the soil vapor (air space within the soil), which in turn may move into overlying building and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion. A sub-slab depressurization system (system that ventilate/remove the air beneath the building) has been installed in the on-site building to prevent the indoor air quality from being affected by the contamination in the soil vapor beneath the building. Sampling indicates soil vapor intrusion is not a concern for off-site buildings.

# NY MANIFEST: Country: EPA ID:

USA NYD012946885

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

EAMINGO CELANEING (Continued)	
Facility Status:	Not reported
Location Address 1:	149 NORTH AVE
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10801
Location Zip 4:	Not reported
	Norreported
NY MANIFEST:	
EPAID:	NYD012946885
Mailing Name:	V & V CAPITAL LLC
Mailing Contact:	V&V CAPITAL LLC - FORMER FLAMINGO CLEANERS
Mailing Address 1:	149 NORTH AVENUE
Mailing Address 2:	Not reported
Mailing City:	NEW ROCHELLE
Mailing State:	NY
Mailing Zip:	10801
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	3615865900
5	
NY MANIFEST: Document ID:	Not reported
	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2013 NUD054426464
Trans1 State ID:	NJD054126164
Trans2 State ID:	Not reported
Generator Ship Date:	01/29/2013
Trans1 Recv Date:	01/29/2013
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	01/31/2013
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD012946885
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	CDX168000000
TSDF ID 2:	Not reported
Manifest Tracking Number:	008835158JJK
Import Indicator:	N
Export Indicator:	Y
Discr Quantity Indicator:	Y
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported H141
MGMT Method Type Code:	
Waste Code:	Not reported
Waste Code: Waste Code:	Not reported
	Not reported
Waste Code:	Not reported

Database(s)

EDR ID Number EPA ID Number

## FLAMINGO CLEANERS (Continued)

Waste Code: Not reported Waste Code: Not reported 12000 Quantity: Units: K - Kilograms (2.2 pounds) Number of Containers: Container Type: CM - Metal boxes, cases, roll-offs Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: Not reported Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: F002 Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 Trans1 State ID: NJD054126164 Trans2 State ID: NJD054126164 Generator Ship Date: 01/30/2013 Trans1 Recv Date: 01/30/2013 Trans2 Recv Date: 01/30/2013 TSD Site Recv Date: 02/15/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: CDX168000000 TSDF ID 2: Not reported Manifest Tracking Number: 008835159JJK Import Indicator: Ν Export Indicator: Υ Discr Quantity Indicator: Υ Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 12080 Units: K - Kilograms (2.2 pounds) Number of Containers: Container Type: CM - Metal boxes, cases, roll-offs Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

### FLAMINGO CLEANERS (Continued)

Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: F002 Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 NJD054126164 Trans1 State ID: Not reported Trans2 State ID: 01/31/2013 Generator Ship Date: Trans1 Recv Date: 01/31/2013 Trans2 Recv Date: Not reported 02/15/2013 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: CDX168000000 TSDF ID 2: Not reported Manifest Tracking Number: 008835161JJK Import Indicator: Ν Export Indicator: Υ Discr Quantity Indicator: Υ Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported H141 MGMT Method Type Code: Waste Code: Not reported Quantity: 6160 Units: K - Kilograms (2.2 pounds) Number of Containers: Container Type: CM - Metal boxes, cases, roll-offs Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: Not reported Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: F002 Waste Code 1\_5: Not reported Not reported Waste Code 1\_6: Document ID: NYC7152142 Manifest Status: Not reported Not reported seq:

Database(s)

EDR ID Number EPA ID Number

## FLAMINGO CLEANERS (Continued)

Year: 2005 TXR000050930 Trans1 State ID: Trans2 State ID: NJD071629976 Generator Ship Date: 01/17/2005 Trans1 Recv Date: 01/17/2005 Trans2 Recv Date: 01/19/2005 TSD Site Recv Date: 01/20/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: NYDW9495 NJ712TVL Trans2 EPA ID: TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 00150 Units: P - Pounds 001 Number of Containers: Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC7146663 Document ID: Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: NYCF7875 Trans2 State ID: NJ044T468 Generator Ship Date: 05/18/2004 Trans1 Recv Date: 05/18/2004 Trans2 Recv Date: 05/26/2004 TSD Site Recv Date: 05/27/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 TXR000050930 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: OHD980587 TSDF ID 2: Not reported Manifest Tracking Number: Not reported

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

MINGO CLEANEING (COMMINED	)
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00150
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC7252402
Manifest Status:	Not reported
seq:	01
Year:	2003
Trans1 State ID:	NYCF7875
Trans2 State ID:	NJ044
Generator Ship Date:	12/29/2003
Trans1 Recv Date:	12/29/2003
Trans2 Recv Date:	12/30/2003
TSD Site Recv Date:	01/05/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD012946885
Trans1 EPA ID:	TXR000050930
Trans2 EPA ID:	NJD071629976
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator: Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
	,

Database(s)

EDR ID Number EPA ID Number

#### FLAMINGO CLEANERS (Continued)

Waste Code: Not reported Waste Code: Not reported 00156 Quantity: Units: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7019403 Manifest Status: Not reported 01 seq: Year: 2003 Trans1 State ID: NYCR3164 Trans2 State ID: 619TVANJ Generator Ship Date: 01/17/2003 Trans1 Recv Date: 01/17/2003 Trans2 Recv Date: 01/23/2003 TSD Site Recv Date: 01/23/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Not reported Manifest Ref Number: Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Quantity: 00150 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7072514 Manifest Status: Not reported seq: 01 Year: 2003 Trans1 State ID: NYCR3164 Trans2 State ID: NJ044

Database(s)

EDR ID Number EPA ID Number

## FLAMINGO CLEANERS (Continued)

Generator Ship Date: 07/29/2003 Trans1 Recv Date: 07/29/2003 Trans2 Recv Date: 08/06/2003 TSD Site Recv Date: 08/07/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00150 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5692331 Manifest Status: Not reported seq: 01 Year: 2002 NY43803AV Trans1 State ID: Trans2 State ID: NJ044 Generator Ship Date: 06/11/2002 Trans1 Recv Date: 06/11/2002 Trans2 Recv Date: 06/12/2002 TSD Site Recv Date: 06/13/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Uaste Code: Uaste Code: Uaste Code: Uaste Code: Uaste Code: Discrete	Not reported Not reported Not reported Not reported Not reported Not reported Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Not reported Not reported Not reported Not reported Not reported Not reported Not reported D1 DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans1 Recv Date: Trans2 Recv Date: Part A Recv Date: Part A Recv Date: Part B Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Discr Quantity Indicator: Discr Spe Indicator: Discr Full Reject Indicator: Discr Full Reject Indicator: Discr Full Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code:	NYC6809681 Not reported 01 2002 NY49455JE T474GL 08/06/2002 08/06/2002 08/06/2002 08/07/2002 08/08/2002 Not reported Not reported Not reported NyD012946885 SCR000075150 NJD071629976 OHD980587364 Not reported Not r
Waste Code: Waste Code: Waste Code: Waste Code: Quantity:	Not reported Not reported Not reported Not reported 00195

Database(s)

EDR ID Number EPA ID Number

#### FLAMINGO CLEANERS (Continued)

Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6422760 Document ID: Manifest Status: Not reported seq: 01 Year: 2001 NYC2456 Trans1 State ID: Trans2 State ID: Not reported 04/23/2001 Generator Ship Date: Trans1 Recv Date: 04/23/2001 Trans2 Recv Date: 04/27/2001 TSD Site Recv Date: 04/28/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: MOD095038998 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported Not reported MGMT Method Type Code: Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00195 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC6508574 Not reported Manifest Status: 01 seq: Year: 2001 NYCR2436 Trans1 State ID: Trans2 State ID: NJ044 Generator Ship Date: 09/26/2001 Trans1 Recv Date: 09/26/2001 Trans2 Recv Date: 10/01/2001

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000299848

## FLAMINGO CLEANERS (Continued)

TSD Site Recv Date: 10/02/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: B Incineration, heat recovery, burning. Handling Method: Specific Gravity: 01.00 Document ID: NYC5724303 Manifest Status: Not reported 01 seq: Year: 2000 Trans1 State ID: NYDW9495 Trans2 State ID: T422NYNJ Generator Ship Date: 01/19/2000 Trans1 Recv Date: 01/19/2000 01/24/2000 Trans2 Recv Date: TSD Site Recv Date: 01/27/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD012946885 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported

Database(s)

EDR ID Number EPA ID Number

## FLAMINGO CLEANERS (Continued)

#### 1000299848

Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC6305040 Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYCR2436 Trans2 State ID: T748NYNJ Generator Ship Date: 12/06/2000 Trans1 Recv Date: 12/06/2000 Trans2 Recy Date: 12/11/2000 TSD Site Recv Date: 12/13/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD012946885 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass)

Database(s)

EDR ID Number EPA ID Number

1000299848

# FLAMINGO CLEANERS (Continued)

Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC6133296
Manifest Status:	Not reported
seq:	01
Year:	2000
Trans1 State ID:	NYRCR2436
Trans2 State ID:	NJT162VW
Generator Ship Date: Trans1 Recv Date:	05/02/2000 05/02/2000
Trans2 Recv Date:	05/04/2000
TSD Site Recv Date:	05/11/2000
Part A Recy Date:	Not reported
Part B Recy Date:	Not reported
Generator EPA ID:	NYD012946885
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator: Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001 DE Eiharbaard er slastie drume (slaas)
Container Type: Handling Method:	DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Specific Oravity.	01.00
Document ID:	NYC6240633
Manifest Status:	Not reported
seq:	01
Year:	2000
Trans1 State ID:	NYCR2436
Trans2 State ID:	TNT218034
Generator Ship Date:	08/15/2000
Trans1 Recv Date:	08/15/2000
Trans2 Recv Date:	08/16/2000
TSD Site Recv Date: Part A Recv Date:	08/18/2000 Not reported
Part A Recv Date: Part B Recv Date:	Not reported Not reported
ו מון ם הפטי שמופ.	

Database(s)

EDR ID Number EPA ID Number

## FLAMINGO CLEANERS (Continued)

Generator EPA ID: NYD012946885 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported **Discr Residue Indicator:** Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC5644653 Document ID: Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR2436 T422NXNJ Trans2 State ID: Generator Ship Date: 05/20/1999 Trans1 Recv Date: 05/20/1999 Trans2 Recv Date: 05/24/1999 TSD Site Recv Date: 05/26/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity:	Not reported Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Not reported Not reported Not reported Not reported Not reported 00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC5193562
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	NYRC2745
Trans2 State ID:	FY22NXNJ
Generator Ship Date:	10/13/1999
Trans1 Recv Date:	10/13/1999
Trans2 Recv Date:	10/18/1999
TSD Site Recv Date:	10/21/1999
Part A Recv Date:	Not reported
Part B Recv Date: Generator EPA ID:	Not reported
	NYD012946885
Trans1 EPA ID: Trans2 EPA ID:	ILD984908202
TSDF ID 1:	SCD987574647 OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code: Waste Code:	Not reported
	Not reported 00195
Quantity: Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
. ,	

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

Document ID: NYC5520745 Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR2436 Trans2 State ID: TY22NXNJ Generator Ship Date: 02/03/1999 Trans1 Recv Date: 02/03/1999 Trans2 Recv Date: 02/08/1999 TSD Site Recv Date: 02/10/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD012946885 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: 00390 Quantity: Units: P - Pounds Number of Containers: 002 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0671282 Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported 01/08/1998 Generator Ship Date: Trans1 Recv Date: 01/08/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/12/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD012946885 ILD984908202 Trans1 EPA ID: Trans2 EPA ID: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

# FLAMINGO CLEANERS (Continued)

1000299848

TSDF ID 1:	CTD001156009
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00

<u>Click this hyperlink</u> while viewing on your computer to access 43 additional NY\_MANIFEST: record(s) in the EDR Site Report.

L82 ESE < 1/8 0.122 mi. 645 ft.	FLAMINGO/TYK CLEANERS 149 NORTH AV. NEW ROCHELLE, NY 10801 Site 11 of 13 in cluster L	
Relative:	DRYCLEANERS:	
Lower	Facility ID:	3-5510-00335
	Phone Number:	914-235-1591
Actual:	Region:	Not reported
89 ft.	Registration Effective Date:	9/24/2003 13:22:51:203
	Inspection Date:	08SEP19
	Install Date:	94/08
	Drop Shop:	Not reported
	Shutdown:	Y
	Alternate Solvent:	Not reported
	Current Business:	Not reported

NY DRYCLEANERS S110246604 N/A

Database(s)

EDR ID Number EPA ID Number

L83 ESE < 1/8 0.122 mi.	149 NORTH AVE NEW ROCHELLE, NY 1080	11	EDR Hist Cleaner	1014995403 N/A
645 ft.	Site 12 of 13 in cluster L			
Relative:	EDR Historical Cleaners:			
Lower	Name:	FLAMINGO CLEANERS		
	Year:	2001		
Actual: 89 ft.	Address:	149 NORTH AVE		
	Name:	FLAMINGO CLEANERS		
	Year:	2002		
	Address:	149 NORTH AVE		
	Name:	FLAMINGO CLEANERS		
	Year:	2003		
	Address:	149 NORTH AVE		
	Name:	FLAMINGO CLEANERS		
	Year:	2004		
	Address:	149 NORTH AVE		
	Name:	FLAMINGO CLEANERS		
	Year:	2005		
	Address:	149 NORTH AVE		
	Name:	FLAMINGO CLEANERS		
	Year:	2006		
	Address:	149 NORTH AVE		
L84 ESE < 1/8 0.122 mi.	COLONIAL CLEANERS CO 149 NORTH AVE NEW ROCHELLE, NY 1080		RCRA NonGen / NLR	1000338874 NYD982718058

645 ft. Site 13 of 13 in cluster L

Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agency:01/01/2007			
	Facility name:	COLONIAL CLEANERS CORP		
Actual:	Facility address:	149 NORTH AVE		
89 ft.		NEW ROCHELLE, NY 108017405		
	EPA ID:	NYD982718058		
	Mailing address:	NORTH AVE		
		NEW ROCHELLE, NY 10801		
	Contact:	Not reported		
	Contact address:	NORTH AVE		
		NEW ROCHELLE, NY 10801		
	Contact country:	US		
	Contact telephone:	Not reported		
	Contact email:	Not reported		
	EPA Region:	02		
	Classification:	Non-Generator		
	Description:	Handler: Non-Generators do not presently generate hazardous waste		

# Owner/Operator Summary: Owner/operator name: Owner/operator address:

SE COLONIAL CLEANERS CORP SS: NOT REQUIRED NOT REQUIRED, WY 99999

Database(s)

EDR ID Number EPA ID Number

# COLONIAL CLEANERS CORP (Continued)

CECHIAE CELANEIRO CONT (C		100000014
Owner/operator country:	US	
Owner/operator telephone:	(212) 555-1212	
Legal status:	Private	
Owner/Operator Type:	Owner	
Owner/Op start date:	Not reported	
Owner/Op end date:	Not reported	
Owner/operator name:	COLONIAL CLEANERS CORP	
Owner/operator address:	NOT REQUIRED	
	NOT REQUIRED, WY 99999	
Owner/operator country:	US	
Owner/operator telephone:	(212) 555-1212	
Legal status:	Private	
Owner/Operator Type:	Operator	
Owner/Op start date:	Not reported	
Owner/Op end date:	Not reported	
Handler Activities Summary:		
U.S. importer of hazardous w		
Mixed waste (haz. and radioa		
Recycler of hazardous waste:	No	
Transporter of hazardous was	ste: No	
Treater, storer or disposer of	HW: No	
Underground injection activity	: No	
On-site burner exemption:	No	
Furnace exemption:	No	
Used oil fuel burner:	No	
Used oil processor:	No	
User oil refiner:	No	
Used oil fuel marketer to burn		
Used oil Specification market		
Used oil transfer facility:	No	
Used oil transporter:	No	
Used on transporter.	INO	
Historical Generators:		
Date form received by agency	<i>r</i> :01/01/2006	
Site name:	COLONIAL CLEANERS CORP	
Classification:	Not a generator, verified	
Date form received by agency	/: 07/08/1999	
Site name:	COLONIAL CLEANERS CORP	
Classification:	Not a generator, verified	
Date form received by agency	<i>r</i> : 11/30/1988	
Site name:	COLONIAL CLEANERS CORP	
Classification:	Small Quantity Generator	
. Waste code:	F002	
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR	OFTHYLENE.
	METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROE	
	CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE,	· · · · · · · · · · · · · · · · · · ·
	ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND	112
	TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CON	
		·
	USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE C	
	ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN	
	F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPEN	I SOLVENTS AND

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	COLONIAL CLEANERS CORP (Con	itinued)		1000338874
		PENT SOLVENT MIXTURES.		
	Violation Status: N	o violations found		
Q85 SSW < 1/8 0.124 mi.	NEW ROCHELLE SUPERMARKET C 538 MAIN STREET NEW ROCHELLE, NY 10801	ORP.	NY AST	A100204374 N/A
654 ft.	Site 1 of 3 in cluster Q			
Relative:	WESTCHESTER CO. AST:			
Higher	PBS Number: Site Status:	3-166995 Unregulated		
Actual:	GDS Number:	Not reported		
100 ft.	Operator Name:	Andrew Taveras		
	Owner Name:	New Rochelle Supermarket Corp.		
	Owner Street:	538 Main Street		
	Owner Address2:	Not reported		
	Owner City/State/Zip:	New Rochelle, NY 10801		
	Tank Number:	1		
	Status:	5. Closed - removed		
	Date Installation:	01/01/1900		
	Capacity:	2500		
	Product Stored: Product Stored Percent:	1. No. 2 fuel oil		
	Date Perm Closure:	Not reported 06/09/2010		
	Tank Location:	3. Aboveground on saddles, legs, stilts, racks or cradle		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection:	0. None		
	Tank Leak Detection:	0. None		
	Tank Secondary Containment:	0. None		
	Piping Location:	1. Aboveground		
	Piping Type:	1. Steel/Carbon/ steel/iron		
	Piping External Protection:	0. None		
	Piping Leak Detection:	0. None		
	Piping Secondary Containment:			
	Overfill Prevention:	4. Product Level Gauge (Aboveground Only)		
	Spill Prevention:	0. None 2. Suction		
	Dispenser:	2. Suction		
<b>P</b> 86	LILLIAN VERNON CORPORATION		NY UST	U003994695
R86	LILLIAN VERNON CORPORATION		NT USI	0003994695 N/A

SW	543-549 MAIN STREET
< 1/8	NEW ROCHELLE, NY 10801

0.124 mi. 657 ft.

ft. Site 1 of 3 in cluster R

WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State:	3-600279 / Unregulated: <1101 gal. PBS Joseph F. Dimicco Lillian Vernon Corp. 510 South Fulton Ave Not reported Mount Vernon NY
Owner Zipcode:	10550
	Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City:

TC4738280.2s Page 169

N/A

Database(s)

EDR ID Number EPA ID Number

# LILLIAN VERNON CORPORATION (Continued)

GDS Number:	Not reported
Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention:	1 5. Closed - removed 2000 Not reported Not reported 0. None Not reported 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating 0. None 2. Underground/on ground 9. Copper 0. None 5. Vent Whistle Not reported Not reported 3. Gravity
-1	

# U003994695

R87 SW < 1/8 0.124 mi.	543 MAIN STREET 543 MAIN STREET NEW ROCHELLE, NY 10801		NY UST	U003994286 N/A
657 ft.	Site 2 of 3 in cluster R			
	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment:	3-801106 / Unregulated: <1101 gal. PBS Paul Risse Bluegill Realty, LLC 250 West 30th Street Not reported NY NY 10001 Not reported 001 5. Closed - removed 2500 6. Diesel Not reported 0. None Not reported 10/07/2003 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None		
	Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment:	2. Underground/on ground 9. Copper 0. None 0. None Not reported		

Database(s)

EDR ID Number EPA ID Number

	543 MAIN STREET (Continued	))		U003994286
	Spill Prevention: Dispenser:	0. None 2. Suction		
R88 SW < 1/8 0.124 mi. 657 ft.	BLUE GILL REALTY 543 MAIN ST NEW ROCHELLE, NY Site 3 of 3 in cluster R		NY LTANKS NY Spills	S102152290 N/A
Relative:	LTANKS:			
Higher	Site ID:	94435		
Actual: 100 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spiller Name: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo:	2003-07-14 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC I Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2003-10-30 252 Not reported Tank Tester Not reported False False 0 2003-10-30 2004-05-19 JEFF WEIR BLUE GILL REALTY 543 MAIN ST NEW ROCHELLE, ZZ 001 JEFF WEIR (646) 435-8110 Not reported 3 84546 "Prior to Sept, 2004 data translation this spill Lead_DEC Field WCHD - MAGNUSON 5/18/04: Letter to Geoffrey J. Weir, Blu LLC, 250 West 30th Street, NY,NY 10001 from Karen Magnus dated 12May2004. Closure report by Ambient Group has bee Results of soil and groundwater samples were satisfactory. W	l was legill Realty, son, WCDOH n reviewed. /CDOH	
	Remarks:	recommends NFA at this time. See also spill #9212475. Lette #3-801106." "TANK HAS BEEN REMOVED."	1 1103 F DO	
	Romano.			
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code:	94435 876585 01 501599 0001A		

Database(s)

EDR ID Number EPA ID Number

LUE GILL REALTY (Continue		S10215229
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	94435	
Spill Tank Test:	1528780	
Tank Number:	1	
Tank Size:	2500	
Test Method:	03	
	.00	
Leak Rate:		
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Horner EZ Check I or II	
SPILLS:		
Facility ID:	9212475	
Facility Type:	ER	
DER Facility ID:	108333	
Site ID:	125220	
DEC Region:	3	
Spill Date:	1993-02-03	
Spill Number/Closed Date:	9212475 / 2004-05-12	
Spill Cause:	Equipment Failure	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	tdghiosa	
Referred To:	Not reported	
Reported to Dept:	1993-02-03	
CID: Water Affected:	Not reported	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier:	Affected Persons	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	False	
Remediation Phase:	0	
Date Entered In Computer:	2003-12-02	
Spill Record Last Update:	2004-05-19	
Spiller Name:	Not reported	
Spiller Company:	Not reported	
Spiller Address:	Not reported	
Spiller City,St,Zip:	***Update***, ZZ	
	001	
Spiller Company:		
Contact Name:	Not reported	
Contact Phone:	Not reported	

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	BLUE GILL REALTY (Continu	led) \$10215229
	DEC Memo: Remarks:	<ul> <li>"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY 5/18/04: Letter to Geoffrey J. Weir, Bluegill Realty, LLC, 250 West 30th Street, NY,NY 10001 from Karen Magnuson, WCDOH dated 12May2004. Closure report by Ambient Group has been reviewed. Results of soil and groundwater samples were satisfactory. WCDOH recommends NFA at this time. See also spill #0308082."</li> <li>"FUEL OIL LINE HAS PIN HOLE LEAK DISCOVERED IN EXCAVATION BY EMER.ENVIRO. SERVICE TODAY REMOTE FILL LINE 2 VERY BADLY PITTED ANE CORRODED WILL DRILL WELL 2/4/93"</li> </ul>
	Material:	
	Site ID:	125220
	Operable Unit ID:	976940
	Operable Unit:	01
	Material ID:	402326
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.: Material FA:	Not reported Petroleum
	Quantity:	.00
	Units:	Pounds
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	Tank Test:	
Vest /8-1/4 .126 mi.		RCRA NonGen / NLR 1000789720 ORTH NYD987011
9 Vest /8-1/4 .126 mi. 65 ft. celative:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR:	ORTH NYD98701
Vest /8-1/4 .126 mi. 65 ft. elative:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age	ORTH NYD987011
/est /8-1/4 .126 mi. 65 ft. elative: igher	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890
Vest /8-1/4 .126 mi. 65 ft.	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NG NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NG NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NG NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NG NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact country:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address: Contact country: Contact telephone:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address: Contact country: Contact telephone: Contact email:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address: Contact country: Contact telephone:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743
/est /8-1/4 .126 mi. 65 ft. elative: igher ctual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact email: EPA Region:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported 02
/est /8-1/4 .126 mi. 65 ft. elative: igher ctual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact country: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported 02 Non-Generator
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description:	NYD987011 Ancy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste
/est /8-1/4 .126 mi. 65 ft. elative: igher ctual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description: Owner/Operator Summary: Owner/Operator name:	ORTH NYD987011 Procy: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported 02 Non-Generator
Vest /8-1/4 .126 mi. 65 ft. Relative: ligher actual:	DIVISION ST OVER METRO NO NEW ROCHELLE, NY 10803 RCRA NonGen / NLR: Date form received by age Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description:	ORTH NYD987011 ency: 01/01/2007 NYSDOT BIN 1049890 DIVISION ST OVER METRO NORTH NEW ROCHELLE, NY 10803 NYD987011897 BURNETT BLVD POUGHKEEPSIE, NY 12603 RICHARD MANNS BURNETT BLVD POUGHKEEPSIE, NY 12603 US (914) 431-5743 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste

Database(s)

EDR ID Number EPA ID Number

# NYSDOT BIN 1049890 (Continued)

	•		
	Owner/operator telephone: Legal status:	(212) State	555-1212
	Owner/Operator Type:	Owne	er
	Owner/Op start date:	Not re	eported
	Owner/Op end date:	Not re	eported
	Owner/operator name:	NYS	ТОТ
	•	-	REQUIRED
	Owner/operator address:	-	
	Owner/operator country:	US	REQUIRED, NY 99999
	Owner/operator country:		EEE 4040
	Owner/operator telephone:	` '	555-1212
	Legal status:	State	
	Owner/Operator Type:	Opera	
	Owner/Op start date:		eported
	Owner/Op end date:	NOT I	eported
Ŀ	andler Activities Summary:		
10	U.S. importer of hazardous wa	eto.	No
	Mixed waste (haz. and radioad		No
	Recycler of hazardous waste:	suve).	No
	Transporter of hazardous waste.	to:	No
	Treater, storer or disposer of H		No
	Underground injection activity:		No
	On-site burner exemption:	•	No
	Furnace exemption:		No
	Used oil fuel burner:		No
	Used oil processor:		No
	User oil refiner:		No
	Used oil fuel marketer to burn	or.	No

Ha

Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Historical Generators:

Date form received by agency	/:01/01/2006
Site name:	NYSDOT BIN 1049890
Classification:	Not a generator, verified
Date form received by agency	y: 08/12/1992
Site name:	NYSDOT BIN 1049890
Classification:	Not a generator, verified
. Waste code:	D000
. Waste name:	Not Defined
. Waste code:	D008
. Waste name:	LEAD
Violation Status:	No violations found

Database(s)

EDR ID Number EPA ID Number

90 NNE 1/8-1/4 0.131 mi. 690 ft.	MACYS 33 LE COUNT PLACE NEW ROCHELLE, NY		NY MANIFEST	1009232715 N/A
1/8-1/4 0.131 mi.		USA NYP000890137 Not reported 33 LE COUNT PLACE BP Not reported NEW ROCHELLE NY Not reported NYP000890137 MACYS MACYS 33 LE COUNT PLACE Not reported NEW ROCHELLE NY 10801 Not reported USA 9146337700 NYA7026894 K Not reported 1989 00000000 06/22/1989 06/22/1989 06/22/1989 06/22/1989 06/22/1989		Ν/Α
	Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number:	NYP000890137 NYD006801245 Not reported NYD082785429 Not reported Not reported		

Distance Elevation	Site		Database(s)	EDR ID Numbe
	MACYS (Continued)			1009232715
	Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity:	Not reported Not reported D001 - NON-LISTED IGNITABLE WASTES Not reported Not reported Not reported Not reported Not reported 00200 P - Pounds 002 DM - Metal drums, barrels L Landfill. 100		
Q91 SW 1/8-1/4 0.132 mi.	542 MAIN STREET LLC 542 MAIN STREET NEW ROCHELLE, NY 10801		NY UST	U003917838 N/A
697 ft.	Site 2 of 3 in cluster Q			
Relative: Higher	WESTCHESTER CO. UST: Id/Status: Operator Name:	3-800617 / Active Cornell Pace Inc.		
Actual: 101 ft.	Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	542 Main Street LLC 542 Main Street, 2nd Floor Not reported NY 10801 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention:	001 1. In-Service 3000 1. No. 2 fuel oil Not reported 0. None 01/01/1904 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 2. Rubber liner 0. None 1. Diking (aboveground only) 2. Underground/on Ground 1. Steel/Carbon/ Steel/Iron 0. None 5. Vent Whistle Not reported Not reported		

2. Suction

EDR ID Number EPA ID Number

# MAP FINDINGS

Map ID Direction

Distance

. Dispenser:

Database(s)

EDR ID Number EPA ID Number

Q92 SW 1/8-1/4 0.132 mi.	OFFICE BLDG 542 MAIN STREET NEW ROCHELLE, NY	NY LTANKS S107489194 N/A
697 ft.	Site 3 of 3 in cluster Q	
Relative: Higher Actual:	LTANKS: Site ID: Spill Number/Closed Date:	355877 0509995 / 2006-03-22 2005-11-21
101 ft.	Spill Date: Spill Cause: Spill Source: Spill Class:	Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response.
	Cleanup Ceased: Cleanup Meets Standard:	Willing Responsible Party. Corrective action taken. Not reported
	SWIS: Investigator: Referred To:	6010 WCHD WCDOH
	Reported to Dept: CID: Water Affected:	2005-11-21 407 Not reported
	Spill Notifier: Last Inspection: Recommended Penalty:	Tank Tester Not reported False
	UST Involvement: Remediation Phase: Date Entered In Computer	
	Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address:	UNKNOWN OFFICE BLDG 542 MAIN STREET
	Spiller City,St,Zip: Spiller County: Spiller Contact:	NEW ROCHELLE, NY 001 UNKNOWN
	Spiller Phone: Spiller Extention: DEC Region:	Not reported Not reported 3
	DER Facility ID: DEC Memo:	305921 "March 22, 2006 PBS SITE. TANK PASSED RETEST. SPILL FILE CLOSED BY DANIELLE JACKSON OF THE WESTCHESTER COUNTY HEALTH DEPT. NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod"
	Remarks:	nn
	Matarial	
	Material: Site ID:	355877
	Operable Unit ID:	1113209
	Operable Unit:	01
	Material ID:	2103275
	Material Code:	0001A
	Material Name: Case No.:	#2 fuel oil Not reported
	Material FA:	Petroleum
	Quantity:	.00
	Units:	Gallons
	Recovered: Resource Affected:	.00 Not reported
	Oxygenate:	Not reported

Database(s)

EDR ID Number EPA ID Number

# OFFICE BLDG (Continued)

Tank Test: Site ID: 355877 Spill Tank Test: 1549528 Tank Number: 1 Tank Size: 3000 Test Method: 03 Leak Rate: .00 Gross Fail: Not reported Modified By: Watchdog Last Modified: Not reported Test Method: Horner EZ Check I or II

S93 SSW 1/8-1/4 0.133 mi. 700 ft.	ROTH CLEANERS 1 LEROY PL NEW ROCHELLE, NY 10805 Site 1 of 2 in cluster S	NY DRYCLEANE NY MANIFI	IDS NYD078706686 RS
Relative: Higher Actual: 100 ft.	RCRA NonGen / NLR: Date form received by agenc Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact email: EPA Region:		
	Land type: Classification: Description: Owner/Operator Summary: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type:	Facility is not located on Indian land. Additional information is not kno Non-Generator Handler: Non-Generators do not presently generate hazardous wast BEN ROTH NOT REQUIRED NOT REQUIRED, WY 99999 US (212) 555-1212 Private Owner	
	Owner/Op start date: Owner/Op end date: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date:	Not reported Not reported BEN ROTH NOT REQUIRED NOT REQUIRED, WY 99999 US (212) 555-1212 Private Operator Not reported	

Database(s)

EDR ID Number EPA ID Number

ROTH CLEANERS (Continued)	1000237840
Owner/Op end date:	Not reported
Handler Activities Summary:	
U.S. importer of hazardous wa	aste: No
Mixed waste (haz. and radioad	ctive): No
Recycler of hazardous waste:	No
Transporter of hazardous was	ste: No
Treater, storer or disposer of H	HW: No
Underground injection activity:	: No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burne	er: No
Used oil Specification markete	er: No
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by agency	v: 01/01/2006
Site name:	ROTH CLEANERS
Classification:	Not a generator, verified
Date form received by agency	r: 08/27/1986
Site name:	ROTH CLEANERS
Classification:	Small Quantity Generator
. Waste code:	F002
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,
	TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFOUSE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF TH
	ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AN F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS A SPENT SOLVENT MIXTURES.
	SI ENT SOLVENT MIXTORES.
Facility Has Received Notices of	
Regulation violated:	Not reported
Area of violation:	Generators - Manifest
Date violation determined:	04/24/1987
Date achieved compliance:	04/26/1987
Violation lead agency:	State
Enforcement action:	
Enforcement action date:	04/24/1987
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
	State
Enforcement lead agency:	
Proposed penalty amount:	
	Not reported Not reported Not reported

Evaluation Action Summary:

Database(s)

EDR ID Number EPA ID Number

#### ROTH CLEANERS (Continued)

Evaluation date:	04/24/1987
Evaluation:	NON-FINANCIAL RECORD REVIEW
Area of violation:	Generators - Manifest
Date achieved compliance:	04/26/1987
Evaluation lead agency:	State

FINDS:

Registry ID:

110004370369

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

## DRYCLEANERS:

Facility ID: Facility ID: Phone Number: Region: Registration Effective Date: Inspection Date: Install Date: Drop Shop: Shutdown: Alternate Solvent: Current Business:	3-5510-00292 914-633-7114 Not reported N/A 09JUL16 98 Not reported Y Not reported Not reported
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYD078706686 Not reported 1 LEROY PLACE BP Not reported Not reported NEW ROCHELLE NY 10805 Not reported
NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip:	NYD078706686 ROTH CLEANERS ROTH CLEANERS 1 LEROY PLACE Not reported NEW ROCHELLE NY 10805

**ROTH CLEANERS (Continued)** 

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Mailing Zip 4:	Not reported USA
Mailing Country:	
Mailing Phone:	9146337114
NY MANIFEST:	
Document ID:	NYC6083291
Manifest Status:	Not reported
seq:	01
Year:	2000
Trans1 State ID:	NYRCR2436
Trans2 State ID:	NJT162VW
Generator Ship Date:	03/08/2000
Trans1 Recv Date:	03/08/2000
Trans2 Recv Date:	03/09/2000
TSD Site Recv Date:	03/13/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD078706686
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00060
Units:	P - Pounds
Number of Containers:	
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC6190896
Manifest Status:	Not reported
seq:	01
Year:	2000
Trans1 State ID:	NYCR2436
Trans2 State ID:	TNT218034
Generator Ship Date:	06/23/2000
Trans1 Recv Date:	06/23/2000
Trans2 Recv Date:	06/28/2000
TSD Site Recv Date:	06/30/2000

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000237840

#### **ROTH CLEANERS (Continued)**

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Quantity: 00300 Units: P - Pounds Number of Containers: 005 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Not reported Waste Code: 00195 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6133320 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYRCR2436 Trans2 State ID: NJT162VW Generator Ship Date: 05/03/2000 Trans1 Recv Date: 05/03/2000 Trans2 Recv Date: 05/04/2000 TSD Site Recv Date: 05/11/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD078706686 Generator EPA ID: Trans1 EPA ID: ILD984908202

Database(s)

EDR ID Number EPA ID Number

#### ROTH CLEANERS (Continued)

Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6038177 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYCR2346 Trans2 State ID: ILT104414 Generator Ship Date: 01/04/2000 Trans1 Recv Date: 01/04/2000 Trans2 Recv Date: 01/06/2000 TSD Site Recv Date: 01/11/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Not reported Discr Type Indicator: **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported

EDR ID Number EPA ID Number

Database(s)

#### **ROTH CLEANERS (Continued)**

TH CLEANERS (Continued)	
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
	· · ·
Waste Code:	Not reported
Quantity:	00060 D. Devrada
Units:	P - Pounds
Number of Containers:	
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
D I.D.	
Document ID:	NYC5558095
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	NYDW9495
Trans2 State ID:	NJT913LY
Generator Ship Date:	03/02/1999
Trans1 Recv Date:	03/02/1999
Trans2 Recv Date:	03/04/1999
TSD Site Recv Date:	03/07/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD078706686
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCD987574647
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	
	Not reported
Quantity:	00060 B. Bounda
Units: Number of Containers:	P - Pounds
Number of Containers:	001 DE Eiharbaard ar plaatia druma (class)
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC5658401
Manifest Status:	
พลาแยรเ อเลเนร.	Not reported

Database(s)

EDR ID Number EPA ID Number

#### **ROTH CLEANERS (Continued)**

seq: 01 Year: 1999 Trans1 State ID: CR2436 Trans2 State ID: T162VWNJ Generator Ship Date: 06/22/1999 Trans1 Recv Date: 06/22/1999 Trans2 Recv Date: 06/25/1999 TSD Site Recy Date: 07/07/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 SCD987574647 Trans2 EPA ID: TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 P - Pounds Units: Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5580404 Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR2436 Trans2 State ID: NJT913LY Generator Ship Date: 04/05/1999 Trans1 Recv Date: 04/05/1999 Trans2 Recv Date: 04/08/1999 TSD Site Recy Date: 04/14/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported

Database(s)

EDR ID Number EPA ID Number

### ROTH CLEANERS (Continued)

TH CLEANERS (Continued)	
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Specific Oravity.	01.00
Document ID:	NYC5849730
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	NYC2436
Trans2 State ID:	T604414IL
Generator Ship Date:	07/20/1999
Trans1 Recv Date:	07/20/1999
Trans2 Recv Date:	07/22/1999
TSD Site Recv Date:	07/26/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD078706686
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCD987574647
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Waste Code:	Not reported

Database(s)

EDR ID Number EPA ID Number

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported 00120 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC5520780 Document ID: Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR2436 Trans2 State ID: TY22NXNJ Generator Ship Date: 02/03/1999 Trans1 Recv Date: 02/03/1999 Trans2 Recv Date: 02/08/1999 TSD Site Recv Date: 02/10/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: 00060 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. Handling Method: Specific Gravity: 01.00 Document ID: CTF0671298 Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYCR2436

Database(s)

EDR ID Number EPA ID Number

1000237840

#### **ROTH CLEANERS (Continued)**

Trans2 State ID: Not reported 01/08/1998 Generator Ship Date: Trans1 Recv Date: 01/08/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/12/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported 00060 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0680858 Manifest Status: Not reported 01 seq: Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 02/09/1998 Trans1 Recv Date: 02/09/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/12/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

### ROTH CLEANERS (Continued)

Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00060
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	CTF0688530
Manifest Status:	Not reported
seq:	01
Year:	1998
Trans1 State ID:	NYDW9495
Trans2 State ID:	Not reported
Generator Ship Date:	03/06/1998
Trans1 Recv Date:	03/06/1998
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	03/12/1998
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD078706686
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	Not reported
TSDF ID 1:	CTD001156009
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code: Waste Code:	Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code: Waste Code:	
Waste Code:	Not reported Not reported
Waste Code: Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### **ROTH CLEANERS (Continued)**

seq:

seq:

Quantity: 00060 P - Pounds Units: Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 CTF0691573 Document ID: Manifest Status: Not reported 01 Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 03/30/1998 Trans1 Recv Date: 03/30/1998 Trans2 Recv Date: Not reported 04/02/1998 TSD Site Recy Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYD078706686 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported **Discr Type Indicator:** Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0712380 Manifest Status: Not reported 01 Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 05/27/1998 Trans1 Recv Date: 05/27/1998

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000237840

#### **ROTH CLEANERS (Continued)**

Trans2 Recv Date: Not reported 05/29/1998 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 ILD984908202 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Not reported **Discr Full Reject Indicator:** Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 CTF0722807 Document ID: Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYDW9495 Trans2 State ID: Not reported Generator Ship Date: 06/29/1998 Trans1 Recv Date: 06/29/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/01/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### ROTH CLEANERS (Continued)

#### 1000237840

**Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 01.00 CTF0723823 Document ID: Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYDW9495 Trans2 State ID: Not reported 08/19/1998 Generator Ship Date: Trans1 Recv Date: 08/19/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 08/31/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 P - Pounds Units: Number of Containers: 001

Database(s)

EDR ID Number EPA ID Number

#### **ROTH CLEANERS (Continued)**

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5443334 Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: T422NYNJ Generator Ship Date: 11/09/1998 11/09/1998 Trans1 Recv Date: Trans2 Recv Date: 11/12/1998 TSD Site Recv Date: 11/20/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD078706686 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Not reported Waste Code: Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 00060 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5478750 Manifest Status: Not reported seq: 01 1998 Year: Trans1 State ID: NYCR2436 Trans2 State ID: T422NXNJ Generator Ship Date: 12/10/1998 Trans1 Recv Date: 12/10/1998 Trans2 Recy Date: 12/14/1998 12/18/1998 TSD Site Recy Date: Part A Recv Date: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

EDR ID Number Database(s)

**EPA ID Number** 

1000237840

#### **ROTH CLEANERS (Continued)**

Part B Recv Date: Not reported NYD078706686 Generator EPA ID: ILD984908202 Trans1 EPA ID: Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00120 P - Pounds Units: Number of Containers: 002 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: 00195 Quantity: Units: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0622944 Manifest Status: С Not reported seq: Year: 1997 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 05/30/1997 05/30/1997 Trans1 Recv Date: Trans2 Recv Date: 11 TSD Site Recv Date: 06/05/1997 Part A Recv Date: 06/10/1997 Part B Recv Date: 06/19/1997 Generator EPA ID: NYD078706686 ILD984908202 Trans1 EPA ID: Trans2 EPA ID: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s) EPA ID N

EDR ID Number EPA ID Number

1000237840

#### ROTH CLEANERS (Continued)

TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00060 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: CTF0624862 Manifest Status: С seq: Not reported Year: 1997 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 04/29/1997 04/29/1997 Trans1 Recv Date: Trans2 Recv Date: 11 05/01/1997 TSD Site Recv Date: Part A Recv Date: 05/13/1997 Part B Recv Date: 05/14/1997 Generator EPA ID: NYD078706686 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Database(s)

EDR ID Number EPA ID Number

#### 1000237840

#### ROTH CLEANERS (Continued)

- Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity:
- Not reported Not reported Not reported Not reported 00060 P - Pounds 001 DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. 100

<u>Click this hyperlink</u> while viewing on your computer to access 121 additional NY\_MANIFEST: record(s) in the EDR Site Report.

## ECHO:

Envid: Registry ID: DFR URL: 1000237840 110004370369 http://echo.epa.gov/detailed\_facility\_report?fid=110004370369

S94 South 1/8-1/4 0.133 mi. 700 ft.	CONSOLIDATED EDISON DIVISION ST & LEROY PL NEW ROCHELLE, NY Site 2 of 2 in cluster S		NY MANIFEST	1009243086 N/A
Relative: Higher Actual: 100 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID:	USA NYP004124210 Not reported DIVISION ST & LEROY PL BP Not reported Not reported NEW ROCHELLE NY Not reported Not reported Not reported NYP004124210 CONSOLIDATED EDISON		
	Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq:	FRANKLIN MURRAY 4 IRVING PLACE RM 828 Not reported NEW YORK NY 10003 Not reported USA 2124602808 NYE1309986 Not reported Not reported Not reported		

Database(s)

EDR ID Number **EPA ID Number** 

Year:

2004 Trans1 State ID: 46614JM Trans2 State ID: Not reported Generator Ship Date: 08/30/2004 Trans1 Recv Date: 08/30/2004 Trans2 Recv Date: Not reported TSD Site Recv Date: 08/30/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004124210 NYD006982359 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: NYD077444 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D018 - BENZENE 0.5 MG/L TCLP Waste Code: Waste Code: Not reported Quantity: 00014 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00

1	00	92	43	086

P95 West 1/8-1/4 0.134 mi. 705 ft.	CON EDISON HUGENOT ST & DIVISION ST NEW ROCHELLE, NY 10802 Site 3 of 10 in cluster P		NY MANIFEST	S117535602 N/A
Relative: Higher	NY MANIFEST: Country: EPA ID:	USA NYP004677894		
Actual: 101 ft.	Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location State: Location Zip: Location Zip 4:	Not reported HUGENOT ST & DIVISION ST BP MH 1218 Not reported NEW ROCHELLE NY 10802 Not reported		

Database(s)

EDR ID Number EPA ID Number

## CON EDISON (Continued)

NY

NY

S117535602

NEDISON (Continued)	
IY MANIFEST:	
EPAID:	NYP004677894
Mailing Name:	CON EDISON
Mailing Contact:	TOM TEELING
Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY
Mailing Zip:	10003
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	Not reported
Ũ	
IY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	10/15/2014
Trans1 Recv Date:	10/15/2014
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	10/20/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004677894
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	012774861JJK
Import Indicator:	N
Export Indicator: Discr Quantity Indicator:	N N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Quantity:	100
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008

Map ID Direction		MAP FINDINGS	]	
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON (Continued)			S117535602
	Waste Code 1_2: Waste Code 1_3:	Not reported Not reported		
	Waste Code 1_4: Waste Code 1_5:	Not reported Not reported		
	Waste Code 1_6:	Not reported		
P96 West 1/8-1/4 0.134 mi.	CON EDISON TRANSFORMER MA DIVISION ST & HUGUENOT ST NEW ROCHELLE, NY 10801	NHOLE: 1154	RCRA NonGen / NLR	1016961985 NYP004349395
705 ft.	Site 4 of 10 in cluster P			
Relative: Higher	RCRA NonGen / NLR: Date form received by agency: Facility name:	09/21/2013 CON EDISON TRANSFORMER MANHOLE: 1154	4	
Actual: 101 ft.	Facility address:	DIVISION ST & HUGUENOT ST NEW ROCHELLE, NY 10801		
		NYP004349395 IRVING PL, RM 828		
		NEW YORK, NY 10003 DENNIS ROHRER		
	Contact address:	Not reported		
		Not reported Not reported		
	Contact telephone:	(914) 925-6219		
		Not reported 02		
	Classification:	Non-Generator		
	Description:	Handler: Non-Generators do not presently genera	te hazardous waste	
	Handler Activities Summary:			
	U.S. importer of hazardous was Mixed waste (haz. and radioact			
	Recycler of hazardous waste:	No		
	Transporter of hazardous wast			
	Treater, storer or disposer of H Underground injection activity:	W: No No		
	On-site burner exemption:	No		
	Furnace exemption:	No		
	Used oil fuel burner:	No		
	Used oil processor: User oil refiner:	No No		
	Used oil fuel marketer to burne			
	Used oil Specification marketer			
	Used oil transfer facility: Used oil transporter:	No No		
	Historical Generators:	09/21/2012		
	Date form received by agency: Site name:	CON EDISON TRANSFORMER MANHOLE: 1154	1	
		Conditionally Exempt Small Quantity Generator		
	Violation Status:	No violations found		

Database(s)

EDR ID Number EPA ID Number

P97 West 1/8-1/4 0.134 mi.	CON EDISON - TRANSFORMER I DIVISION ST AND HUGENOT ST NEW ROCHELLE, NY 10805	MANHOLE 1154	RCRA-LQG	1016962308 NYP004353199
705 ft.	Site 5 of 10 in cluster P			
Relative: Higher Actual: 101 ft.	RCRA-LQG: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address:	y:03/27/2014 CON EDISON - TRANSFORMER MANHOLE 1154 DIVISION ST AND HUGENOT ST NEW ROCHELLE, NY 10805 NYP004353199 IRVING PLACE, 15TH FL NE NEW YORK, NY 10003 DENNIS HUACON IRVING PLACE, 15TH FL NE		
	Contact country: Contact telephone: Contact email: EPA Region: Classification: Description:	NEW YORK, NY 10003 US (212) 460-2757 HUACOND@CONED.COM 02 Large Quantity Generator Handler: generates 1,000 kg or more of hazardous waste of calendar month; or generates more than 1 kg of acutely ha during any calendar month; or generates more than 100 kg residue or contaminated soil, waste or other debris resultin cleanup of a spill, into or on any land or water, of acutely ha waste during any calendar month; or generates 1 kg or less hazardous waste during any calendar month, and accumul kg of acutely hazardous waste at any time; or generates 10 of any residue or contaminated soil, waste or other debris for from the cleanup of a spill, into or on any land or water, of a hazardous waste during any calendar month, and accumul 100 kg of that material at any time	azardous waste o of any ig from the azardous s of acutely lates more than 00 kg or less resulting acutely	
	Owner/Operator Summary: Owner/operator name: Owner/operator address: Owner/operator country: Owner/Operator telephone: Legal status: Owner/Operator Type: Owner/Op start date: Owner/Op end date: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Operator Type: Owner/Op start date: Owner/Op end date:	CONSOLIDATED EDISON COMPANY OF NY, INC. IRVING PLACE NEW YORK, NY 10003 US Not reported Private Owner 08/29/2013 Not reported CONSOLIDATED EDISON COMPANY OF NY, INC. IRVING PLACE NEW YORK, NY 10003 US Not reported Private Operator 08/29/2013 Not reported		
	Handler Activities Summary: U.S. importer of hazardous w	aste: No		

U.S. importer of hazardous waste: No

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON - TRANSFORMER M Mixed waste (haz. and radioac	. ,		1016962308
	Recycler of hazardous waste: Transporter of hazardous wast Treater, storer or disposer of H Underground injection activity: On-site burner exemption: Furnace exemption: Used oil fuel burner: Used oil processor: User oil refiner: Used oil fuel marketer to burner Used oil fuel marketer to burner Used oil Specification marketer Used oil Specification marketer Used oil transfer facility: Used oil transporter: . Waste code: . Waste name: Historical Generators: Date form received by agency: Site name: Date form received by agency: Site name:	No e: No W: No No No No No No No r: No No No D008 LEAD		
P98 West 1/8-1/4 0.134 mi. 705 ft.	CON EDISON HUGENOT & DIVISION ST NEW ROCHELLE, NY 10801 Site 6 of 10 in cluster P		NY MANIFEST	S117535593 N/A
Relative:	NY MANIFEST: Country:	USA		
Higher Actual: 101 ft.	EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	NYP004677548 Not reported HUGENOT & DIVISION ST BP MH 1218 Not reported NEW ROCHELLE NY 10801 Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country:	NYP004677548 CON EDISON TOM TEELING 4 IRVING PLACE - 15TH FLOOR Not reported NEW YORK NY 10003 Not reported USA		

Database(s)

EDR ID Number EPA ID Number

### CON EDISON (Continued)

Mailing Phone:	Not reported
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2014
Trans1 State ID:	NYD006982359
Trans2 State ID:	Not reported
Generator Ship Date:	10/14/2014
Trans1 Recv Date:	10/14/2014
Trans2 Recy Date:	Not reported
TSD Site Recv Date:	10/20/2014
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004677548
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	012774875JJK
Import Indicator:	Ν
Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110
Waste Code:	Not reported
Quantity:	400
Units:	P - Pounds
Number of Containers:	1 TT Cargo took took trucko
Container Type:	TT - Cargo tank, tank trucks
Handling Method: Specific Gravity:	T Chemical, physical, or biological treatment.
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_2: Waste Code 1_3:	Not reported
Waste Code 1_3. Waste Code 1_4:	Not reported
Waste Code 1_4. Waste Code 1_5:	Not reported
Waste Code 1_3: Waste Code 1_6:	Not reported

## S117535593

Database(s)

EDR ID Number EPA ID Number

P99 West 1/8-1/4 0.134 mi.	CON EDISON DIVISION & HUGUENOT NEW ROCHELLE, NY		NY MANIFEST	S117319604 N/A
705 ft.	Site 7 of 10 in cluster P			
Relative: Higher Actual: 101 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004676847 Not reported DIVISION & HUGUENOT BP MH 1218 Not reported NEW ROCHELLE NY Not reported Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004676847 CON EDISON CON EDISON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770		
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans2 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Discr Quantity Indicator: Discr Quantity Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number:	Not reported Not reported 2014 NYD006982359 Not reported 10/13/2014 10/13/2014 Not reported 10/14/2014 Not reported Not reported NYP004676847 Not reported NJD002200046 Not reported 012770952JJK N N N N N N N N N		

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

S117319604

Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported
Not reported
500
P - Pounds
1
TT - Cargo tank, tank trucks
T Chemical, physical, or biological treatment.
1
D008
Not reported

P100 West 1/8-1/4 0.134 mi.	CON ED DIVISION ST & HUGENOT ST NEW ROCHELLE, NY 10805		NY MANIFEST	101 N
0.134 m. 705 ft.	Site 8 of 10 in cluster P			
Relative: Higher Actual: 101 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State:	USA NYP004353199 Not reported DIVISION ST AND HUGENOT ST BP Not reported Not reported NEW ROCHELLE NY		
	Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name:	10805 Not reported NYP004353199 CON ED		
	Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	TOM TEELING 4 IRVING PLACE - 15TH FLOOR Not reported NEW YORK NY 10003 Not reported USA 2124603770		
	NY MANIFEST: Document ID: Manifest Status:	Not reported Not reported		

1016962307 N/A

Database(s)

EDR ID Number **EPA ID Number** 

#### 1016962307

#### CON ED (Continued)

seq:

Not reported 2013 Year: Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 08/29/2013 Trans1 Recv Date: 08/29/2013 Trans2 Recv Date: Not reported TSD Site Recy Date: 09/03/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004353199 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 011694814JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 3000 P - Pounds Units: Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Not reported Waste Code 1\_6:

#### P101 **CON EDISON MANHOLE: 1215 HUGENOT AVE & DIVISION ST NE** West 1/8-1/4 NEW ROCHELLE, NY 10801 0.134 mi. 705 ft. Site 9 of 10 in cluster P RCRA NonGen / NLR: **Relative:** Date form received by agency: 06/30/2013 Higher CON EDISON MANHOLE: 1215 Facility name: Actual: HUGENOT AVE & DIVISION ST NE Facility address:

COR

101 ft.

RCRA NonGen / NLR 1016678044 NYP004317285 FINDS NY MANIFEST ECHO

TC4738280.2s Page 205

Database(s)

EDR ID Number **EPA ID Number** 

1016678044

#### CON EDISON MANHOLE: 1215 (Continued)

	NEW ROCHELLE, NY 10801
EPA ID:	NYP004317285
Mailing address:	VING PL, RM 828
-	NEW YORK, NY 10003
Contact:	GINO FRABASILE
Contact address:	Not reported
	Not reported
Contact country:	Not reported
Contact telephone:	(914) 925-6219
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

#### Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

#### Historical Generators:

Date form received by agency	:05/30/2013
Site name:	CON EDISON MANHOLE: 1215
Classification:	Conditionally Exempt Small Quantity Generator

Violation Status:

No violations found

#### FINDS:

Registry ID:

110058874865

#### Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

#### NY MANIFEST:

Country:	USA
EPA ID:	NYP004317285
Facility Status:	Not reported
Location Address 1:	<b>DIVISION ST &amp; HUGUENOT ST</b>

Database(s)

EDR ID Number EPA ID Number

CON EDISON MANHOLE: 1215 (Co	ntinued)
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10801
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYP004317285
Mailing Name:	CON EDISON
Mailing Contact:	CON EDISON
Mailing Address 1:	4 IRVING PLACE 15TH FLOOR
Mailing Address 2:	Not reported
Mailing City:	NEW YORK
Mailing State:	NY 10003
Mailing Zip: Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	2124603770
<b>3</b>	
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2013
Trans1 State ID:	NJ0000027193
Trans2 State ID:	Not reported
Generator Ship Date:	05/30/2013
Trans1 Recv Date: Trans2 Recv Date:	05/30/2013 Not reported
TSD Site Recy Date:	05/30/2013
Part A Recy Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP004317285
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number: Import Indicator:	010842831JJK N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H110 Not reported
Waste Code: Waste Code:	Not reported Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported

Database(s)

EDR ID Number EPA ID Number

Quantity:	200
Units:	P - Pounds
Number of Containers:	1
Container Type:	TT - Cargo tank, tank trucks
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

### ECHO:

Envid: Registry ID: DFR URL: 1016678044 110058874865 http://echo.epa.gov/detailed\_facility\_report?fid=110058874865

P102 West 1/8-1/4 0.144 mi. 761 ft.	SHORELINE OIL 296 HUGENOT ST,REAR OF NEW ROCHELLE, NY Site 10 of 10 in cluster P		NY LTANKS	S102674768 N/A
70111.				
Relative:	LTANKS:			
Higher	Site ID:	83347		
• • •	Spill Number/Closed Date:			
Actual: 101 ft.	Spill Date:	1988-02-03		
101 ft.	Spill Cause:	Tank Overfill		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Not reported		
	Cleanup Ceased:	1988-04-06		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator:	dxtraver		
	Referred To:	Not reported		
	Reported to Dept: CID:	1988-02-05		
	Water Affected:	Not reported		
		Not reported Citizen		
	Spill Notifier:	1988-05-02		
	Last Inspection: Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:	-		
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company:	SHORELINE OIL		
	Spiller Address:	34 EVANS ST		
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10805		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	76706		
	-			

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	SHORELINE OIL (Continued)	S102674768	
	DEC Memo: Remarks:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was TRAVER / / : SITE INSPECT:NO EVIDENCE OF CONTAMINATION FROM OUTSIDE LOCKED GATE. N.F.A. T.D. 05/03/88: NO EVIDENCE OF CONTAMINATION OBSERVED DURING INSPECTION. NFA. " "OIL INTO PRIVATE DRAIN, TO SUMP,TO SEWER,FROM CAPT.O'CONNOR NRFD(914-654-2215). COMPANY CLEANING UP. DEC TO INVESIGATE & VERIFY CLEAN UP. N.F.A. SEE UPDATE."	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	83347 914524 01 464747 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported	
T103 NNW 1/8-1/4	US POSTAL SERVICE 255 NORTH AVE	RCRA NonGen / NLR 1005444315 NY MANIFEST NYR00010636	9
0.144 mi. 762 ft.	NEW ROCHELLE, NY 10801 Site 1 of 6 in cluster T		
-	Site 1 of 6 in cluster T RCRA NonGen / NLR: Date form received by ager	ncy:01/01/2007	
762 ft. Relative:	Site 1 of 6 in cluster T RCRA NonGen / NLR:	Incy: 01/01/2007 US POSTAL SERVICE 255 NORTH AVE NEW ROCHELLE, NY 108019998 NYR000106369 WESTCHESTER AVE WHITE PLAINS, NY 106109111 JOANNE KUNNY WESTCHESTER AVE WHITE PLAINS, NY 106109111 US (914) 697-7074 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste US POSTAL SERVICE 255 NORTH AVE NEW ROCHELLE, NY 10801	

Database(s)

EDR ID Number EPA ID Number

#### US POSTAL SERVICE (Continued)

S POSTAL SERVICE (Continued	d)
Legal status: Owner/Operator Type: Owner/Op start date: Owner/Op end date:	Federal Operator 01/01/2001 Not reported
Owner/operator name: Owner/operator address:	US POSTAL SERVICE 255 NORTH AVE NEW ROCHELLE, NY 10801
Owner/operator country: Owner/operator telephone:	US (914) 632-5906
Legal status: Owner/Operator Type: Owner/Op start date:	Federal Owner 01/01/2001
Owner/Op end date:	Not reported
Handler Activities Summary: U.S. importer of hazardous wa Mixed waste (haz. and radioad Recycler of hazardous waste: Transporter of hazardous was Treater, storer or disposer of H Underground injection activity: On-site burner exemption: Furnace exemption: Used oil fuel burner: Used oil fuel burner: Used oil processor: User oil refiner: Used oil fuel marketer to burnet Used oil fuel marketer to burnet Used oil Specification marketet Used oil transfer facility: Used oil transporter:	ctive): No No te: No HW: No No No No No No No No No
Historical Generators: Date form received by agency Site name: Classification:	:01/01/2006 US POSTAL SERVICE Not a generator, verified
Date form received by agency Site name: Classification:	:05/17/2002 US POSTAL SERVICE Small Quantity Generator
. Waste code: . Waste name:	D002 CORROSIVE WASTE
Violation Status:	No violations found
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip:	USA NYR000106369 Not reported 255 NORTH AVENUE BP Not reported Not reported NEW ROCHELLE NY 10802

Database(s)

EDR ID Number EPA ID Number

### US POSTAL SERVICE (Continued)

US FUSTAL SERVICE (Continued)		10
Location Zip 4:	Not reported	
NY MANIFEST:		
EPAID:	NYR000106369	
Mailing Name:	US POSTAL SERVICE	
Mailing Contact:	RICHARD FERRARI	
Mailing Address 1:	255 NORTH AVENUE	
Mailing Address 2:	Not reported	
Mailing City:	NEW ROCHELLE	
Mailing State:	NY	
Mailing Zip:	10802	
Mailing Zip 4:	Not reported	
Mailing Country:	USA	
Mailing Phone:	9146977074	
NY MANIFEST:		
Document ID:	NYG2937357	
Manifest Status:	Not reported	
seq:	01	
Year:	2002	
Trans1 State ID:	27571PANY	
Trans2 State ID:	PW8913	
Generator Ship Date:	05/29/2002	
Trans1 Recv Date:	05/29/2002	
Trans2 Recv Date:	05/30/2002	
TSD Site Recv Date:	05/31/2002	
Part A Recv Date:	Not reported	
Part B Recv Date:	Not reported	
Generator EPA ID:	NYR000106369	
Trans1 EPA ID:	NYD986908085	
Trans2 EPA ID: TSDF ID 1:	NYD082785429 NYD082785429	
TSDF ID 2:	Not reported	
Manifest Tracking Number:	Not reported	
Import Indicator:	Not reported	
Export Indicator:	Not reported	
Discr Quantity Indicator:	Not reported	
Discr Type Indicator:	Not reported	
Discr Residue Indicator:	Not reported	
Discr Partial Reject Indicator:	Not reported	
Discr Full Reject Indicator:	Not reported	
Manifest Ref Number:	Not reported	
Alt Facility RCRA ID:	Not reported	
Alt Facility Sign Date:	Not reported	
MGMT Method Type Code:	Not reported	
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES	
Waste Code:	Not reported	
Waste Code: Waste Code:	Not reported Not reported	
Waste Code:	Not reported	
Waste Code:	Not reported	
Quantity:	00060	
Units:	G - Gallons (liquids only)* (8.3 pounds)	
Number of Containers:	002	
Container Type:	DM - Metal drums, barrels	
Handling Method:	T Chemical, physical, or biological treatment.	
Specific Gravity:	01.00	

Database(s)

EDR ID Number EPA ID Number

T104 NNW 1/8-1/4 0.144 mi.	UNITED STATES POST OFFICE 255 NORTH AVENUE NEW ROCHELLE, NY 10802		NY UST	U004177544 N/A
762 ft.	Site 2 of 6 in cluster T			
Relative: Lower Actual: 87 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status:	3-448699 / Unregulated: <1101 gal. PBS U.S. Postal Service U.s. Postal Service 255 North Ave. Not reported New Rochelle NY 10802 Not reported 1		
	Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	0. Administratively closed 10000 Not reported Not reported 0. None 01/01/1900 05/01/2003 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. None Not reported 2. Galvanized steel 0. None Not reported Not reported Not reported Not reported 2. Suction		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	2 1. In-Service 1000 Not reported Not reported 0. None Not reported 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None Not reported 0. No Pipiping 0. No Pipiping 0. None Not reported 0. None Not reported 0. None 0. None 0. None 0. None 0. None 0. None		

Database(s)

EDR ID Number EPA ID Number

U105 SW 1/8-1/4 0.153 mi.	BLOOMINGDALE PARKING LOT 554 MAIN ST NEW ROCHELLE, NY 10802		NY UST	U003884000 N/A
807 ft.	Site 1 of 2 in cluster U			
Relative:	WESTCHESTER CO. UST:			
Higher	Id/Status:	3-600330 / Unregulated: <1101 gal. PBS		
ingiloi	Operator Name:	Mel Watson		
Actual:	Owner Name:	Fraydun Enterprises		
102 ft.	Owner Street:	3 New York Plaza		
	Owner Address2:	Not reported		
	Owner City:	New York		
	Owner State:	NY		
	Owner Zipcode:	10004		
	GDS Number:	Not reported		
	CDC Humber.	Not reported		
	Tank Number:	1		
	Status:	4. Closed - in place		
	Capacity:	10000		
	Product Stored:	Not reported		
	Product Stored Percent:	Not reported		
	Tank Leak Detection:	0. None		
	Date Installation:	08/01/1992		
	Date Perm Closure:	Not reported		
	Tank Location:	5. Underground		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection:	0. None		
	Tank Secondary Containment:	0. None		
	Piping Location:	0. No Pipiing		
	Piping Type:	0. No Pippping		
	Piping External Protection:	0. None		
	Overfill Prevention:	0. None		
	Piping Secondary Containment:	Not reported		
	Spill Prevention:	0. None		
	Dispenser:	2. Suction		
	·			
	Tank Number:	2		
	Status:	4. Closed - in place		
	Capacity:	550		
	Product Stored:	Not reported		
	Product Stored Percent:	Not reported		
	Tank Leak Detection:	0. None		
	Date Installation:	08/01/1992		
	Date Perm Closure:	Not reported		
	Tank Location:	5. Underground		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection:	0. None		
	Tank Secondary Containment:	0. None		
	Piping Location:	0. No Pipiing		
	Piping Type:	0. No Pippping		
	Piping External Protection:	0. None		
	Overfill Prevention:	0. None		
	Piping Secondary Containment:	Not reported		
	Spill Prevention:	0. None		
	Dispenser:	2. Suction		

EDR ID Number Database(s) EPA ID Number

V106 NE 1/8-1/4	THE MALL MAIN STREET NEW ROCHELLE, NY	NY LTANKS	S100141913 N/A
0.154 mi. 815 ft.	Site 1 of 3 in cluster V		
Relative: Lower Actual: 80 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	326514 9010648 / 1991-01-04 1991-01-04 Tank Test Failure Commercial/Industrial	
	Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	6010 tdghiosa Not reported 1991-01-04 Not reported Not reported	
	Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Address: Spiller County: Spiller County: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	Tank Tester Not reported False False 0 1991-01-10 1992-07-31 Not reported SAME Not reported NY 999 Not reported Ny 999 Not reported Not reported Not reported Not reported Not reported Not reported Same Not reported Not reported Not reported Not reported Not reported Not reported Same Not reported Same Not reported Same Not reported Same Same Same Same Same Same Same Same	
	Remarks:	DEC reserves the right to reopen this spill without prejudice. Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST." "WATER FOUND IN TANK TO BE PUMPED OUT HONER EASY087"	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected:	326514 947782 01 430787 0002A #4 fuel oil Not reported Petroleum .00 Not reported .00 Not reported	

Database(s)

EDR ID Number **EPA ID Number** 

S100141913

## THE MALL (Continued) Oxygenate:

#### Tank Test: 326514 Site ID: Spill Tank Test: 1538129 Tank Number: Not reported Tank Size: 0 Test Method: 00 Leak Rate: .00 Gross Fail: Not reported Modified By: Spills Last Modified: Not reported Test Method: Unknown

Not reported

#### T107 CON EDISON

NNW 1/8-1/4 0.155 mi.	NORTH AVE & HUGENOT ST NEW ROCHELLE, NY 10801	
821 ft.	Site 3 of 6 in cluster T	
Relative: Lower	NY MANIFEST: Country: EPA ID:	USA NYP004343786
Actual: 85 ft.	Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	Not reported NORTH AVENUE & HUGENOT STR BP EET Not reported NEW ROCHELLE NY 10801 Not reported
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004343786 CON EDISON CON EDISON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date:	Not reported Not reported 2013 NJ0000027193 Not reported 08/08/2013 08/08/2013 Not reported

#### NY MANIFEST 1016961580 N/A

TC4738280.2s Page 215

Database(s)

EDR ID Number **EPA ID Number** 

#### **CON EDISON (Continued)**

TSDF ID 1:

TSDF ID 2:

Quantity:

Contact country:

Units:

TSD Site Recv Date: 08/09/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004343786 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002200046 Not reported Manifest Tracking Number: 011694746JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported 8000 P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1 5: Not reported Waste Code 1\_6: Not reported

101	6961	580
-----	------	-----

T108 NNW 1/8-1/4 0.155 mi.	CON EDISON TRANSFORMER N NORTH AVE & HUGUENOT ST NEW ROCHELLE, NY 10801	IANHOLE: 5042	RCRA NonGen / NLR NY MANIFEST	1016963620 NYP004366100
821 ft.	Site 4 of 6 in cluster T			
Relative: Lower	RCRA NonGen / NLR: Date form received by agence		40	
Actual: 85 ft.	Facility name: Facility address:	CON EDISON TRANSFORMER MANHOLE: 50- NORTH AVE & HUGUENOT ST NEW ROCHELLE, NY 10801	42	
	EPA ID:	NYP004366100		
	Mailing address:	IRVING PL, 15TH FL NE NEW YORK, NY 10003		
	Contact:	THOMAS TEELING		
	Contact address:	Not reported Not reported		

Not reported

Database(s)

EDR ID Number EPA ID Number

Contact telephone:	(212) 460-3770
Contact email:	Not reported
EPA Region: Classification:	02 Non Concreter
Description:	Non-Generator Handler: Non-Generators do not presently generate hazardous waste
Description.	Fianciel. Non-Generators do not presently generate nazardous waste
Handler Activities Summary:	
U.S. importer of hazardous w	
Mixed waste (haz. and radioa	
Recycler of hazardous waste	
Transporter of hazardous wa	
Treater, storer or disposer of	
Underground injection activity	
On-site burner exemption: Furnace exemption:	No No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burr	
Used oil Specification market	
Used oil transfer facility:	No
Used oil transporter:	No
Classification: Violation Status:	Conditionally Exempt Small Quantity Generator
NY MANIFEST	
NY MANIFEST: Country:	USA
NY MANIFEST: Country: EPA ID:	
Country:	USA
Country: EPA ID:	USA NYP004366100
Country: EPA ID: Facility Status: Location Address 1: Code:	USA NYP004366100 Not reported
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip: Location Zip 4: NY MANIFEST: EPAID:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip: Location Zip 4: NY MANIFEST: EPAID:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON 4 IRVING PLACE
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4: VY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing Address 2: Mailing City: Mailing State:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON 4 IRVING PLACE Not reported NEW YORK NY
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4: VY MANIFEST: EPAID: Mailing Name: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing State: Mailing Zip:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON 4 IRVING PLACE Not reported NEW YORK NY 10003
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON 4 IRVING PLACE Not reported NEW YORK NY 10003 Not reported
Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4: WMANIFEST: EPAID: Mailing Name: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing Address 2: Mailing State: Mailing State: Mailing Zip:	USA NYP004366100 Not reported NOAR/HUGUNOT ST BP MH5042 Not reported NEW ROCHELLE NY 10801 Not reported NYP004366100 CON EDISON CON EDISON 4 IRVING PLACE Not reported NEW YORK NY 10003

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON TRANSFORMER MANHOLE: 5042 (Continued)

NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 NYD006982359 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 09/25/2013 Trans1 Recv Date: 09/25/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/03/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004366100 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 011694648JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 150 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Not reported Waste Code 1\_6:

Database(s)

EDR ID Number EPA ID Number

T109 NNW 1/8-1/4	CON EDISON MANHOLE: 5071 HUGENUOT ST & NORTH AVE NEW ROCHELLE, NY 10805		RCRA NonGen / NLR	1016968295 NYP004419065
0.155 mi. 821 ft.	Site 5 of 6 in cluster T			
Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agency			
Actual:	Facility name: Facility address:	CON EDISON MANHOLE: 5071 HUGENUOT ST & NORTH AVE		
85 ft.		NEW ROCHELLE, NY 10805		
	EPA ID: Mailing address:	NYP004419065 IRVING PL, 15TH FL NE		
	Mailing address:	NEW YORK, NY 10003		
	Contact:	THOMAS TEELING		
	Contact address:	Not reported		
	Contact country:	Not reported		
	Contact country: Contact telephone:	Not reported (212) 460-3770		
	Contact email:	Not reported		
	EPA Region:	02		
	Classification:	Non-Generator		
	Description:	Handler: Non-Generators do not presently gener	ate hazardous waste	
	Handler Activities Summary:			
	U.S. importer of hazardous w	aste: No		
	Mixed waste (haz. and radioa	ctive): No		
	Recycler of hazardous waste:			
	Transporter of hazardous was Treater, storer or disposer of			
	Underground injection activity			
	On-site burner exemption:	No		
	Furnace exemption:	No		
	Used oil fuel burner:	No		
	Used oil processor:	No		
	User oil refiner: Used oil fuel marketer to burn	No er: No		
	Used oil Specification market			
	Used oil transfer facility:	No		
	Used oil transporter:	No		
	Historical Generators: Date form received by agency	1:01/15/2014		
	Site name:	CON EDISON MANHOLE: 5071		
	Classification:	Conditionally Exempt Small Quantity Generator		
	Violation Status:	No violations found		
T110	CON EDISON MANHOLE: 5071		RCRA NonGen / NLR	1016677599
NNW 1/8-1/4	HUGUENOT AVE & NORTH AVE NEW ROCHELLE, NY 10805		FINDS NY MANIFEST	NYP004312476
0.155 mi.	NEW ROCHELLE, NT 10005		ECHO	
821 ft.	Site 6 of 6 in cluster T			
Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agency	y:06/14/2013		
Actual	Facility name:	CON EDISON MANHOLE: 5071		
Actual: 85 ft.	Facility address:			
	EPA ID:	NEW ROCHELLE, NY 10805 NYP004312476		

Database(s)

EDR ID Number EPA ID Number

# CON EDISON MANHOLE: 5071 (Continued)

Mailing address:	VING PL, RM 828
	NEW YORK, NY 10003
Contact:	DOMINIC BIZZARO
Contact address:	Not reported
	Not reported
Contact country:	Not reported
Contact telephone:	(914) 925-6219
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste

# Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

# Historical Generators:

Date form received by agence	:y:05/14/2013
Site name:	CON EDISON MANHOLE: 5071
Classification:	Conditionally Exempt Small Quantity Generator

Violation Status:

No violations found

# FINDS:

Registry ID:

# 110058876550

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

# NY MANIFEST:

Country:
EPA ID:
Facility Status:
Location Address 1:
Code:
Location Address 2:

USA NYP004312476 Not reported HUGUENOT & NORTH AVE BP Not reported

# TC4738280.2s Page 220

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON MANHOLE: 5071 (Continued) Total Tanks: Not reported NEW ROCHELLE Location City: Location State: NY Location Zip: 10801 Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004312476 Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY 10003 Mailing Zip: Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 NYD006982359 Trans1 State ID: Trans2 State ID: Not reported 05/14/2013 Generator Ship Date: Trans1 Recv Date: 05/14/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 05/16/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004312476 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 007658348JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Not reported Waste Code: Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 100

P - Pounds

Units:

Map ID	
Direction	
Distance	
Elevation	Site

TT - Cargo tank, tank trucks

T Chemical, physical, or biological treatment.

Database(s)

EDR ID Number **EPA ID Number** 

### CON EDISON MANHOLE: 5071 (Continued)

1

1 D008

Not reported

Not reported

Not reported

Not reported

Not reported

3-800080 / Active

S.B.J. Associates

S.B.J. Associates

364 North Ave. Suite 107 New Rochelle

NY 10801 Not reported

Number of Containers:
Container Type:
Handling Method:
Specific Gravity:
Waste Code:
Waste Code 1_2:
Waste Code 1_3:
Waste Code 1_4:
Waste Code 1_5:
Waste Code 1_6:

# ECHO:

Envid: Registry ID: DFR URL:

1016677599 110058876550 http://echo.epa.gov/detailed\_facility\_report?fid=110058876550

#### W111 S.B.J. ASSOCIATES ESE **38 LOCUST AVENUE** 1/8-1/4 NEW ROCHELLE, NY 10801

0.156 mi. 823 ft.	Site 1 of 3 in cluster W
Relative: Lower	WESTCHESTER CO. UST: Id/Status:
	Operator Name:
Actual:	Owner Name:
89 ft.	Owner Street:
	Owner Address2:
	Owner City:
	Owner State:
	Owner Zipcode:
	GDS Number:
	Tank Number:
	Status:

1 1. In-Service Status: 3000 Capacity: Product Stored: 1. No. 2 fuel oil Product Stored Percent: Not reported Tank Leak Detection: 0. None Date Installation: 05/01/1984 Date Perm Closure: 01/01/1900 Tank Location: 5. Underground 2. Galvanized steel alloy Tank Type: Tank Internal Protection: 0. None Tank External Protection: 2. Original sacrificial anode Tank Secondary Containment: 0. None Piping Location: 1. Aboveground Piping Type: 2. Galvanized Steel Piping External Protection: 1. Painted/Asphalt Coating **Overfill Prevention:** 3. Automatic Shut-off Piping Secondary Containment: 0. None Spill Prevention: 0. None Dispenser: 2. Suction

# 1016677599

NY UST U003968120 N/A

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

W112 ESE 1/8-1/4 0.156 mi.	COMMERCIAL PROPERTY 38 LOCUST AVE NEW ROCHELLE, NY	NY LTANKS	S112810152 N/A
823 ft.	Site 2 of 3 in cluster W		
Relative: Lower Actual: 89 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Conty: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	2012-12-10 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 jbodee Not reported 2012-12-10 Not reported Tank Tester Not reported False False 0 2012-12-10 2013-02-04 Not reported SBJ ASSOCIATES Not reported SBJ ASSOCIATES Not reported 3 197040 "12-10-12 PBS site. Tank failed with popping. US Tank Tech has been testing since '98. Super was at site during test and Shapiro notified by phone. jc 12/19/12: Update from WCDoH PBS: >>> Lalak, Chris >>cjl1@westchestergov.com> 12/11/2012 4:23 PM >>> 1213228 38 Locust, new Rochelle PBS 3-800080 TTF 3K tank from 84 Tyra/Carlos Lead jod 2/4/2013: Tank passed a retest after piping was repaired. Report entered into eDocs. Based upon the information provided, no further action is required at this time. jod"	
	Remarks:	"1211 THE CALLER IS REPORTING A FAILED TANK TEST."	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	476407 1226235 01 2223616 0001A #2 fuel oil Not reported Petroleum Not reported	

Database(s)

EDR ID Number EPA ID Number

S112810152

# COMMERCIAL PROPERTY (Continued)

t reported
t reported
t reported
t reported

Tank Test:

W113 ESE 1/8-1/4 0.156 mi.	SBJ ASSOCIATES 38 LOCUST AVE NEW ROCHELLE, NY	NY LTANKS	U003857828 N/A
823 ft.	Site 3 of 3 in cluster W		
Relative: Lower Actual: 89 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	2002-09-11 Tank Test Failure Commercial/Industrial Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2002-09-11 252 Not reported Tank Tester Not reported False False 0 2002-09-11	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name:	239569 857630 01 571516 0001A #2 fuel oil	

Database(s)

EDR ID Number EPA ID Number

3J ASSOCIATES (Continued)	
	Not reported
	Petroleum
·····,	.00
	Gallons
	.00
	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	239569
Spill Tank Test:	1527440
Tank Number:	1
Tank Size:	3000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
	Spills
-	Not reported
	Horner EZ Check I or II
	333366
Spill Number/Closed Date:	0408593 / 2005-02-13
Spill Date:	2004-11-04
Spill Cause:	Tank Test Failure
	Institutional, Educational, Gov., Other
•	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
	Not reported
	True
	6010
5	JBODee
	WCHD
	2004-11-04
	444
	Not reported
•	Tank Tester
•	Not reported
	False
	False
	0
Date Entered In Computer:	
•	2005-02-13
•	BARRY SHAPIRO
	COMMERCIAL SITE
•	38 LOCUS AVE
	NEW ROCHELLE, NY
	001
	BARRY SHAPIRO
	(914) 393-2581
•	Not reported
5	3
,	197040
DEC Memo:	"02/13/05 TANK PASSED A RETEST AFTER PIPING WAS REPAIRED. BASED UPON
	INFORMATION PROVIDED TO DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod"

# SBJ ASSOCIATES (Continued)

Database(s)

EDR ID Number EPA ID Number

	SBJ ASSOCIATES (Continued) Material:			U003857828
	Tank Test:			
X114 WSW	CERUSSI AND VERE 306 HUGUENOT ST		NY UST	U004187246 N/A
1/8-1/4 0.156 mi. 826 ft.	NEW ROCHELLE, NY 10801 Site 1 of 4 in cluster X			
Relative: Higher	WESTCHESTER CO. UST: Id/Status:	3-078360 / Administratively Closed		
Actual: 101 ft.	Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	Not reported Michael A Cerussi & F G Vere 88 Woodlands Rd Not reported Harrison NY 10528 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	1 0. Administratively closed 1500 Not reported Not reported 0. None 12/01/1986 12/01/2001 Not reported 1. Steel/Carbon steel/Iron 0. None Not reported 1. Aboveground 1. Steel/Carbon/ steel/iron 0. None None None 0. None 0. None 3. Gravity	_	

X115 WSW 1/8-1/4 0.156 mi. 826 ft.	306 HUGUENOT STREET CORP. 306 HUGUENOT STREET NEW ROCHELLE, NY 10801 Site 2 of 4 in cluster X	
Relative: Higher Actual: 101 ft.	WESTCHESTER CO. AST: PBS Number: Site Status: GDS Number: Operator Name: Owner Name:	3-800236 Active Not reported Gary Garafolo 306 Huguenot Street Corp.

NY AST U004187406 N/A

Database(s)

EDR ID Number EPA ID Number

### 306 HUGUENOT STREET CORP. (Continued)

Mailing Phone:

**Owner Street:** P.O. Box 196 Owner Address2: Not reported Owner City/State/Zip: Katonah, NY 10536 Tank Number: 001 1. In-Service Status: Date Installation: 12/01/1986 Capacity: 1500 Product Stored: 1. No. 2 fuel oil Product Stored Percent: Not reported 01/01/1900 Date Perm Closure: Tank Location: 3. Aboveground on saddles, legs, stilts, racks or cradle 1. Steel/Carbon steel/Iron Tank Type: Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating Tank Leak Detection: 0. None Tank Secondary Containment: 2. Vault (w/ access) Piping Location: 1. Aboveground Piping Type: 1. Steel/Carbon/ Steel/Iron Piping External Protection: 1. Painted/Asphalt Coating Piping Leak Detection: Not reported Piping Secondary Containment: Not reported **Overfill Prevention:** 1. Float Vent Valve Spill Prevention: Not reported Dispenser: 3. Gravity

#### Y116 CON EDISON NY MANIFEST S113917978 NORTH AVE & BONNEFOY PL SE N/A 1/8-1/4 NEW ROCHELLE, NY 10801 0.157 mi. 830 ft. Site 1 of 2 in cluster Y NY MANIFEST: Relative: USA Country: Lower EPA ID: NYP004339842 Actual: Facility Status: Not reported 88 ft. Location Address 1: NORTH AVE & BONNEFOY PL Code: BP Location Address 2: MH #2047 Total Tanks: Not reported Location City: NEW ROCHELLE Location State: NY Location Zip: 10801 Location Zip 4: Not reported NY MANIFEST: NYP004339842 EPAID: Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA

Database(s)

EDR ID Number **EPA ID Number** 

S113917978

# **CON EDISON (Continued)**

NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: NYD006982359 Not reported Trans2 State ID: Generator Ship Date: 07/31/2013 Trans1 Recv Date: 07/31/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 08/01/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004339842 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 011695894JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 100 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. Handling Method: Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

EDR ID Number Database(s) EPA ID Number

Y117 SE 1/8-1/4 0.157 mi.	CON EDISON MANHOLE: 2047 NORTH AVE & BONNEFOY PL NEW ROCHELLE, NY 10804		RCRA NonGen / NLR NY MANIFEST	1016960898 NYP004331732
830 ft.	Site 2 of 2 in cluster Y			
Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agency			
Actual:	Facility name: Facility address:	CON EDISON MANHOLE: 2047 NORTH AVE & BONNEFOY PL		
88 ft.	-	NEW ROCHELLE, NY 10804		
	EPA ID: Mailing address:	NYP004331732 IRVING PL, RM 828		
	Maining address.	NEW YORK, NY 10003		
	Contact:	CHRISTOPHER BLAICH		
	Contact address:	Not reported		
	Contact country:	Not reported Not reported		
	Contact telephone:	(914) 925-6219		
	Contact email:	Not reported		
	EPA Region:	02		
	Classification: Description:	Non-Generator Handler: Non-Generators do not presently general	te bazardous waste	
	Description.	Handler. Non Ocherators do not presently general		
	Handler Activities Summary:			
	U.S. importer of hazardous wa	aste: No		
	Mixed waste (haz. and radioa			
	Recycler of hazardous waste:			
	Transporter of hazardous was Treater, storer or disposer of			
	Underground injection activity			
	On-site burner exemption:	No		
	Furnace exemption:	No		
	Used oil fuel burner: Used oil processor:	No No		
	User oil refiner:	No		
	Used oil fuel marketer to burn			
	Used oil Specification market	er: No		
	Used oil transfer facility:	No		
	Used oil transporter:	No		
	Historical Generators:			
	Date form received by agency	y:07/19/2013		
	Site name:	CON EDISON MANHOLE: 2047		
	Classification:	Conditionally Exempt Small Quantity Generator		
	Violation Status:	No violations found		
	NY MANIFEST:			
	Country:	USA		
	EPA ID:	NYP004331732		
	Facility Status: Location Address 1:	Not reported NORTH AVE & BONNEFOY PL		
	Code:	BP		
	Location Address 2:	MH #3047		
	Total Tanks:	Not reported		
	Location City:	NEW ROCHELLE		
	Location State: Location Zip:	NY 10805		
	Loodion Zip.			

Database(s) EPA ID N

EDR ID Number EPA ID Number

# CON EDISON MANHOLE: 2047 (Continued)

Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004331732 Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: MAD039322250 Trans2 State ID: MAD039322250 Generator Ship Date: 07/19/2013 Trans1 Recv Date: 07/19/2013 Trans2 Recv Date: 07/24/2013 TSD Site Recv Date: 07/24/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004331732 Generator EPA ID: Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID 1: NJD991291105 TSDF ID 2: Not reported Manifest Tracking Number: 004815809FLE Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν **Discr Type Indicator:** Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 300 P - Pounds Units: Number of Containers: Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1

Database(s)

EDR ID Number EPA ID Number

	CON EDISON MANHOLE: 2047	(Continued)	1016960898
	Waste Code: Waste Code 1_2: Waste Code 1_3: Waste Code 1_4: Waste Code 1_5: Waste Code 1_6:	D008 Not reported Not reported Not reported Not reported	
X118 West 1/8-1/4 0.159 mi. 839 ft.	JONES RESIDENCE 311 HUGUENOT STREET NEW ROCHELLE, NY Site 3 of 4 in cluster X	NY LTANKS	S106737602 N/A
Relative: Higher	LTANKS: Site ID: Seill Number/Cleased Date:	335236	
Actual: 101 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Cottact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	2004-12-17 Tank Test Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee WCHD 2004-12-17 444 Not reported Tank Tester Not reported False False 0 2004-12-17	
	Material:		
	Site ID: Operable Unit ID: Operable Unit:	335236 1097307 01	

Database(s)

EDR ID Number EPA ID Number

S106737602

#### Material ID: 577292 0001A Material Code: Material Name: #2 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: .00

Tank Test:	
Site ID:	335236
Spill Tank Test:	1548406
Tank Number:	1
Tank Size:	1500
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

Not reported

Not reported

JONES RESIDENCE (Continued)

Resource Affected:

Oxygenate:

X119 West 1/8-1/4 0.159 mi.	TRINITY-ST. PAUL'S EPISCOPAL CHURCH 311 HUGUENOT STREET NEW ROCHELLE, NY 10801		NY UST	U003995010 N/A
839 ft.	Site 4 of 4 in cluster X			
839 ft. Relative: Higher Actual: 101 ft.	Site 4 of 4 in cluster X WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment:	3-801006 / Unregulated: <1101 gal. PBS Not reported Trinity Episcopal Church 311 Huguenot Street Not reported New Rochelle NY 10801 Not reported 1 4. Closed - in place 1500 Not reported Not reported Not reported 0. None Not reported 03/23/2005 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating 0. None		
	Piping Location: Piping Type: Piping External Protection:	<ol> <li>Underground/on ground</li> <li>Copper</li> <li>None</li> </ol>		

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	TRINITY-ST. PAUL'S EPISCOPAL C	HURCH (Continued)		U003995010
	Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	0. None Not reported 0. None 2. Suction		
V120 ENE 1/8-1/4 0.160 mi. 844 ft.	NEW ROCHELLE MALL 425 MAIN STREET NEW ROCHELLE, NY 10801 Site 2 of 3 in cluster V		NY UST	U003857279 N/A
Relative:	WESTCHESTER CO. UST:			
Lower	Id/Status: Operator Name:	3-600042 / Unregulated: <1101 gal. PBS Unknown		
Actual:	Owner Name:	New Roc Associates		
79 ft.	Owner Street:	30 Glenn St.		
	Owner Address2:	Not reported		
	Owner City:	White Plains		
	Owner State:	NY		
	Owner Zipcode: GDS Number:	10603 Not reported		
	Tank Number:	1		
	Status:	4. Closed - in place		
	Capacity:	15000		
	Product Stored:	Not reported		
	Product Stored Percent: Tank Leak Detection:	Not reported 0. None		
	Date Installation:	Not reported		
	Date Perm Closure:	05/26/1998		
	Tank Location:	6. Underground, vaulted, with access		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	1. Epoxy liner		
	Tank External Protection:	0. None		
	Tank Secondary Containment:	0. None		
	Piping Location:	3. Aboveground/underground combination		
	Piping Type: Piping External Protection:	0. No Pippping 0. None		
	Overfill Prevention:	0. None		
	Piping Secondary Containment:	Not reported		
	Spill Prevention:	0. None		
	Dispenser:	2. Suction		

121 WNW 1/8-1/4 0.161 mi. 851 ft.	SOUND CLEANER 63 MEMORIAL HWY NEW ROCHELLE, NY 10801
Relative: Lower	DRYCLEANERS: Facility ID: Phone Number:

Lower	Facility ID:	Not reported
	Phone Number:	Not reported
Actual:	Region:	3
83 ft.	Registration Effective Date:	Not reported
	Inspection Date:	Not reported
	Install Date:	Not reported

NY DRYCLEANERS S110247943 N/A

Database(s)

EDR ID Number EPA ID Number

	SOUND CLEANER (Continued)			S110247943
	Shutdown: Alternate Solvent:	Not reported Not reported Not reported Not reported		
Z122 WSW 1/8-1/4 0.167 mi. 883 ft.	M.J. HACKER & SONS INC. 64 CENTRE AVE NEW ROCHELLE, NY 10801 Site 1 of 6 in cluster Z		NY UST	U004176847 N/A
Relative: Higher Actual: 100 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment Spill Prevention:	0. None		
	Dispenser: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location:	<ol> <li>Suction</li> <li>Suction</li> <li>Closed - Prior to 04/1991</li> <li>Colored - Prior to 04/1991</li> <li>Colored - Prior to 04/1991</li> <li>Gasoline</li> <li>Not reported</li> <li>None</li> <li>None</li> <li>Steel/Carbon steel/Iron</li> <li>None</li> <li>Not reported</li> </ol>		

Database(s)

EDR ID Number EPA ID Number

# M.J. HACKER & SONS INC. (Continued)

Piping Type:	2. Galvanized steel
Piping External Protection:	0. None
Overfill Prevention:	0. None
Piping Secondary Containment:	Not reported
Spill Prevention:	0. None
Dispenser:	2. Suction

Tank Number:	003
Status:	8. Unregistered
Capacity:	500
Product Stored:	13. Waste/Used Oil
Product Stored Percent:	Not reported
Tank Leak Detection:	Not reported
Date Installation:	01/01/1900
Date Perm Closure:	01/01/1900
Tank Location:	5. Underground
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	Not reported
Tank External Protection:	Not reported
Tank Secondary Containment:	Not reported
Piping Location:	Not reported
Piping Type:	Not reported
Piping External Protection:	Not reported
Overfill Prevention:	Not reported
Piping Secondary Containment:	Not reported
Spill Prevention:	Not reported
Dispenser:	Not reported

Tank Number:	004
Status:	<ol><li>Closed - removed</li></ol>
Capacity:	750
Product Stored:	13. Waste/Used Oil
Product Stored Percent:	Not reported
Tank Leak Detection:	Not reported
Date Installation:	01/01/1900
Date Perm Closure:	05/12/2014
Tank Location:	5. Underground
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	Not reported
Tank External Protection:	Not reported
Tank Secondary Containment:	Not reported
Piping Location:	Not reported
Piping Type:	Not reported
Piping External Protection:	Not reported
Overfill Prevention:	Not reported
Piping Secondary Containment:	Not reported
Spill Prevention:	Not reported
Dispenser:	Not reported

Tank Number:	005
Status:	5. Closed - removed
Capacity:	Not reported
Product Stored:	7. Gasoline
Product Stored Percent:	Not reported

# U004176847

Database(s)

EDR ID Number **EPA ID Number** 

Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention:	0. None 01/01/1900 05/14/2014 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 0. None 0. None 0. None 0. None 0. None 0. None 0. None 0. None
1 0 ,	
•	
Dispenser:	Not reported
Tank Number:	4
Status:	5. Closed - removed
Capacity:	550
Product Stored:	13. Waste/Used Oil

Tank Number:	4
Status:	5. Closed - removed
Capacity:	550
Product Stored:	13. Waste/Used Oil
Product Stored Percent:	Not reported
Tank Leak Detection:	0. None
Date Installation:	06/01/1979
Date Perm Closure:	03/06/2014
Tank Location:	5. Underground
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	0. None
Tank External Protection:	0. None
Tank Secondary Containment:	0. None
Piping Location:	2. Underground/on Ground
Piping Type:	1. Steel/Carbon/ Steel/Iron
Piping External Protection:	0. None
Overfill Prevention:	0. None
Piping Secondary Containment:	0. None
Spill Prevention:	0. None
Dispenser:	2. Suction

#### V123 MONROE COLLEGE ENE 420 MAIN STREET

1/8-1/4 0.170 mi.	NEW ROCHELLE, NY 10801	
896 ft.	Site 3 of 3 in cluster V	
Relative:	WESTCHESTER CO. AST:	
Lower	PBS Number:	3-800251
	Site Status:	Active
Actual:	GDS Number:	Not reported
77 ft.	Operator Name:	James Moore
	Owner Name:	Monroe College
	Owner Street:	434 Main Street
	Owner Address2:	Not reported
	Owner City/State/Zip:	New Rochelle, NY 10801
	Tank Number:	001
	Status:	1. In-Service
	Date Installation:	07/01/2004
	Capacity:	3000

U004176847

NY AST A100252339 N/A

TC4738280.2s Page 236

Database(s)

EDR ID Number **EPA ID Number** 

A100252339

### **MONROE COLLEGE (Continued)**

Product Stored: 1. No. 2 fuel oil Product Stored Percent: 0 Date Perm Closure: 04/13/2004 6. Aboveground in subterranean vault with access for inspections Tank Location: Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating 2. Manual Interstitial Monitoring Tank Leak Detection: 2. Vault (w/ access) Tank Secondary Containment: Piping Location: 1. Aboveground Piping Type: 1. Steel/Carbon/ Steel/Iron 0. None Piping External Protection: Piping Leak Detection: 2. Manual Interstitial Monitoring Piping Secondary Containment: 0. None **Overfill Prevention:** 3. Automatic Shut-off, 5. Vent Whistle 1. Catch Basin Spill Prevention: Dispenser: 3. Gravity Tank Number: 001old 5. Closed - removed Status: Date Installation: 01/01/1900 3000 Capacity: Product Stored: Not reported Product Stored Percent: Not reported Date Perm Closure: 04/13/2004 Tank Location: 3. Aboveground on saddles, legs, stilts, racks or cradle Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 99. Other Tank External Protection: 99. Other Tank Leak Detection: 0. None Tank Secondary Containment: Not reported Piping Location: 1. Aboveground Piping Type: 1. Steel/Carbon/ Steel/Iron Piping External Protection: 99. Other Piping Leak Detection: Not reported Piping Secondary Containment: Not reported **Overfill Prevention:** 99. Other Spill Prevention: Not reported Dispenser: 2. Suction Tank Number: 1 0. Administratively closed Status: 01/01/1900 Date Installation: Capacity: 275 Product Stored: Not reported Product Stored Percent: Not reported Date Perm Closure: 11/06/2003 3. Aboveground on saddles, legs, stilts, racks or cradle Tank Location: Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 0. None Tank Leak Detection: 0. None Tank Secondary Containment: 0. None Piping Location:

Piping Type:

<sup>1.</sup> Steel/Carbon/ steel/iron

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		 Database(s)	EDR ID Number EPA ID Number
	MONROE COLLEGE (Continued)			A100252339
	Piping External Protection: Piping Leak Detection: Piping Secondary Containmen Overfill Prevention: Spill Prevention: Dispenser:	0. None Not reported t: Not reported 0. None 0. None 2. Suction		
U124 SW 1/8-1/4 0.171 mi.	HANGERS CLEANERS 562-564 MAIN STREET NEW ROCHELLE, NY 10801		NY DRYCLEANERS	S110246761 N/A
902 ft.	Site 2 of 2 in cluster U			
Relative: Higher	DRYCLEANERS: Facility ID: Phone Number:	3-5510-00358 914-235-0300		
Actual: 102 ft.	Region: Registration Effective Date: Inspection Date: Install Date: Drop Shop: Shutdown: Alternate Solvent: Current Business:	Not reported 9/24/2003 13:22:51:203 04MAR23 02 Not reported Not reported CO2 Not reported		
125 NNW 1/8-1/4 0.173 mi. 915 ft.	KAUFMAN HUGUENOT COMPAN 271 NORTH AVENUE NEW ROCHELLE, NY 10801	(	NY UST NY AST	U003994672 N/A
Relative: Lower	WESTCHESTER CO. UST: Id/Status:	3-183776 / Active		
Actual: 84 ft.	Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	David Rabius Kaufman Huguenot Co. 450 Seventh Avenue Not reported New York NY 10123 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location:	1 4. Closed - in place 10000 Not reported 99. Other 01/01/1900 01/01/2011 5. Underground 1. Steel/Carbon steel/Iron 0. None 99. Other 1. Aboveground		

Database(s)

EDR ID Number EPA ID Number

Piping Type:	1. Steel/Carbon/ steel/iron
Piping External Protection:	0. None
Overfill Prevention:	Not reported
Piping Secondary Containment:	Not reported
Spill Prevention:	Not reported
Dispenser:	2. Suction
ESTCHESTER CO. AST:	
PBS Number:	3-183776
Site Status:	Active
GDS Number:	Not reported
Operator Name:	David Rabius
Owner Name:	Kaufman Huguenot Co.
Owner Street:	450 Seventh Avenue
Owner Address2:	Not reported
Owner City/State/Zip:	New York, NY 10123
Tank Number:	002
Status:	1. In-Service
Date Installation:	08/01/2007
Capacity:	5000
Product Stored:	4. No. 6 fuel oil
Product Stored Percent:	Not reported
Date Perm Closure:	01/01/1900
Tank Location:	2. Aboveground (contact w/ impervious barrier)
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	0. None
Tank External Protection:	1. Painted/Asphalt Coating
Tank Leak Detection:	4. Groundwater Well
Tank Secondary Containment:	1. Diking (aboveground only)
Piping Location:	1. Aboveground
Piping Type:	1. Steel/Carbon/ steel/iron
Piping External Protection:	1. Painted/Asphalt Coating
Piping Leak Detection:	4. Groundwater Well
Piping Secondary Containment:	1. Diking (aboveground only)
Overfill Prevention:	2. High Level Alarm,4. Product Level Gauge (Aboveground Only)
Spill Prevention: Dispenser:	2. Transfer Station Containment 2. Suction

Z126 SW 1/8-1/4 0.177 mi. 937 ft.	NYNEX LOCATION 342 HUEGNOT ST NEW ROCHELLE, NY Site 2 of 6 in cluster Z	NY LTANKS	S102660218 N/A
Relative: Higher Actual: 99 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator:	270876 9708146 / 1997-10-10 1997-10-10 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa	

# U003994672

NYNEX LOCATION (Continued)

Referred To:

MAP FINDINGS

Not reported

Database(s)

EDR ID Number EPA ID Number

#### 1997-10-10 Reported to Dept: CID: 365 Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported Recommended Penalty: False UST Involvement: False Remediation Phase: 0 Date Entered In Computer: 1997-10-10 Spill Record Last Update: 1997-11-12 Spiller Name: **RICH KALISTA** Spiller Company: **BELL ATLANTIC** Spiller Address: 2203 MCCONNELL ST Spiller City, St, Zip: BELLMORE, NY Spiller County: 001 Spiller Contact: TOM MUFF Spiller Phone: (914) 449-5321 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 220510 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY Remarks: "DOING AN UPGRADE FOR A NYNEX LOCATION AND REMOVING 2 UNDERGROUND TANKS FROM A BASEMENT - TANKS WERE ENCASED BY SAND & WHEN REMOVED THE SAND WAS CONTAMINATED - THEY HAVE REMOVED SAND." Material: Site ID: 270876 Operable Unit ID: 1051372 Operable Unit: 01 Material ID: 330133 Material Code: 0001A Material Name: #2 fuel oil Not reported Case No.: Petroleum Material FA: Quantity: .00 Units: Gallons .00 Recovered: Not reported **Resource Affected:** Not reported Oxygenate: Tank Test:

AA127 SE 1/8-1/4 0.178 mi.	CON EDISON OPP. 134 NORTH AVENUE NEW ROCHELLE, NY 10801	NY MANIFEST	1016959873 N/A
939 ft.	Site 1 of 2 in cluster AA		
Relative: Lower Actual: 86 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code:	USA NYP004317624 Not reported OPP. 134 NORTH AVENUE BP	

TC4738280.2s Page 240

#### Map ID Direction Distance Elevation Site

# MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

### **CON EDISON (Continued)**

Location Address 2: Not reported Not reported Total Tanks: Location City: NEW ROCHELLE Location State: NY Location Zip: 10801 Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004317624 Mailing Name: CON EDISON CON EDISON Mailing Contact: 4 IRVING PLACE 15TH FLOOR Mailing Address 1: Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2013 Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 05/31/2013 05/31/2013 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 05/31/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004317624 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 010456856JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 3000

# Map ID Direction Distance Elevation Site

CON EDISON (Continued)

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1016959873

	Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1_2: Waste Code 1_2: Waste Code 1_3: Waste Code 1_4: Waste Code 1_5: Waste Code 1_6:	P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported Not reported	
AA128 SE 1/8-1/4 0.178 mi. 939 ft.	CON EDISON - MANHOLE 2047 OPP. 134 NORTH AVENUE NEW ROCHELLE, NY 10801 Site 2 of 2 in cluster AA	RCRA-LQG	1016959874 NYP004317624
Relative:	RCRA-LQG:		
Lower	Date form received by agency Facility name:	CON EDISON - MANHOLE 2047	
Actual: 86 ft.	Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description:	OPP. 134 NORTH AVENUE NEW ROCHELLE, NY 10801 NYP004317624 IRVING PLACE, 15TH FL NE NEW YORK, NY 10003 DENNIS HUACON IRVING PLACE, 15TH FL NE NEW YORK, NY 10003 US (212) 460-2757 HUACOND@CONED.COM 02 Large Quantity Generator Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than kg of that material at any time	1
	Owner/Operator Summary: Owner/operator name: Owner/operator address: Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date:	CONSOLIDATED EDISON COMPANY OF NY, INC. IRVING PLACE NEW YORK, NY 10003 US Not reported Private Owner 05/31/2013	

Database(s)

EDR ID Number EPA ID Number

	CON EDISON - MANHOLE 2047	(Continued)		1016959874
	Owner/Op end date:	Not reported		1010333074
	Owner/operator name: Owner/operator address:	CONSOLIDATED EDISON COMPANY OF NY, INC. IRVING PLACE NEW YORK, NY 10003		
	Owner/operator country: Owner/operator telephone: Legal status: Owner/Operator Type: Owner/Op start date:	US Not reported Private Operator 05/31/2013		
	Owner/Op end date:	Not reported		
	<ul> <li>Handler Activities Summary:</li> <li>U.S. importer of hazardous of Mixed waste (haz. and radio Recycler of hazardous waste Transporter of hazardous waste Treater, storer or disposer of Underground injection activity On-site burner exemption:</li> <li>Furnace exemption:</li> <li>Used oil fuel burner:</li> <li>Used oil fuel burner:</li> <li>Used oil refiner:</li> <li>Used oil refiner:</li> <li>Used oil fuel marketer to but Used oil fuel marketer to but Used oil specification market Used oil transfer facility:</li> <li>Used oil transporter:</li> <li>Waste code:</li> <li>Waste name:</li> </ul>	ractive): No e: No aste: No f HW: No ty: No No No No No No No No		
	Historical Generators: Date form received by agen Site name: Classification:	cy:06/30/2013 CON EDISON MANHOLE: 2047 Not a generator, verified		
	Date form received by agend Site name: Classification:	cy:05/31/2013 CON EDISON MANHOLE: 2047 Conditionally Exempt Small Quantity Generator		
	Violation Status:	No violations found		
AB129 ESE 1/8-1/4 0.178 mi.	APT. BUILDING 55-59 LOCUST AVE. NEW ROCHELLE, NY		NY LTANKS	S102660713 N/A
942 ft.	Site 1 of 2 in cluster AB			
Relative: Lower	Site ID: Spill Number/Closed Date:			
Actual: 90 ft.	Spill Cause: Spill Source: Spill Class:	1992-04-01 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Willing Responsible Party. Corrective action taken.	C Response.	
	Cleanup Ceased:	1992-05-12		

Database(s)

EDR ID Number EPA ID Number

	APT. BUILDING (Continued)		S102660713
	Cleanup Meets Standard:	True	
	SWIS:	6010	
	Investigator:	TAYLOR	
	Referred To:	Not reported	
	Reported to Dept:	1992-04-16	
	CID:	Not reported	
	Water Affected:	Not reported	
	Spill Notifier:	Citizen	
	Last Inspection:	1992-05-12	
	Recommended Penalty:	False	
	UST Involvement:	False	
	Remediation Phase:	0	
	Date Entered In Computer: Spill Record Last Update:		
	Spiller Name:	Not reported	
	Spiller Company:	N.Y. PROPERTIES CO.	
	Spiller Address:	Not reported	
	Spiller City,St,Zip:	ZZ	
	Spiller County:	001	
	Spiller Contact:	Not reported	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	142042	
	DEC Memo: Remarks:	"TWO UC TANKS WERE BURIED RAIN FORCES OIL UP THRO	
	Remarks.	CO.APPLIES SPEEDI-DRY BUT DOES NOT REPORT OR REPA	
	Material:	4000.47	
	Site ID:	168647	
	Operable Unit ID: Operable Unit:	964508 01	
	Material ID:	415419	
	Material Code:	0002A	
	Material Name:	#4 fuel oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Pounds	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
	Tank Test:		
AB130	TWIN PARK EQUITIES LLC		NY AST A100379817
ESE 1/8-1/4	55/59 LOCUST AVENUE		N/A
1/8-1/4 0.178 mi.	NEW ROCHELLE, NY 10801		
0.178 ml. 942 ft.	Site 2 of 2 in cluster AB		
Relative:	WESTCHESTER CO. AST:		
Lower	PBS Number:	3-800234	
	Site Status:	Active	
Actual:	GDS Number:	Not reported	
90 ft.	Operator Name:	Ermin Radoncic	

Database(s)

EDR ID Number **EPA ID Number** 

### TWIN PARK EQUITIES LLC (Continued)

Status:

Capacity:

**Owner Name:** Twin Park Equities LLC 853-11 80th Avenue Owner Street: Owner Address2: Not reported Owner City/State/Zip: Glen Öaks, NY 11004 Tank Number: 001 1. In-Service Date Installation: 06/01/1997 4000 Product Stored: 1. No. 2 fuel oil Product Stored Percent: Not reported 01/01/1900 Date Perm Closure: 2. Aboveground (contact w/ impervious barrier) Tank Location: Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 1. Epoxy liner Tank External Protection: 1. Painted/Asphalt Coating Tank Leak Detection: 6. Impervious Barrier/Concrete Pad (Aboveground Only) Tank Secondary Containment: 0. None Piping Location: 3. Aboveground/Underground Combination Piping Type: 1. Steel/Carbon/ Steel/Iron Piping External Protection: 1. Painted/Asphalt Coating Piping Leak Detection: 0. None Piping Secondary Containment: 0. None **Overfill Prevention:** 5. Vent Whistle Spill Prevention: 0. None 3. Gravity

#### PROSPECT ROCHELLE REALTY LLC AC131

Dispenser:

SSE 1/8-1/4 0.179 mi.	1,3,5 PROSPECT STREET NEW ROCHELLE, NY 10805		N/A
947 ft.	Site 1 of 2 in cluster AC		
947 ft. Relative: Lower Actual: 86 ft.	Site 1 of 2 in cluster AC WESTCHESTER CO. AST: PBS Number: GDS Number: Operator Name: Owner Name: Owner Atdress2: Owner City/State/Zip: Tank Number: Status: Date Installation: Capacity: Product Stored:	3-171158 Active Not reported Artie Cepero Wagner 6001 MONTROSE ROAD #606 Not reported ROCKVILLE, MD 20852 1 1. In-Service 12/01/1969 5000 4. No. 6 fuel oil	
	Product Stored Percent: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Leak Detection: Tank Secondary Containment: Piping Location: Piping Type:	<ul> <li>100</li> <li>Not reported</li> <li>3. Aboveground on saddles,legs,stilts,racks or cradle</li> <li>1. Steel/Carbon steel/Iron</li> <li>0. None</li> <li>0. None</li> <li>6. Impervious Barrier/Concrete Pad (Aboveground Only)</li> <li>2. Vault (w/ access)</li> <li>1. Aboveground</li> <li>1. Steel/Carbon/ steel/iron</li> </ul>	

# A100379817

NY AST A100355603

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	PROSPECT ROCHELLE REALTY LL	C (Continued)		A100355603
	Piping External Protection:	0. None		
	Piping Leak Detection:	0. None		
	Piping Secondary Containment:	0. None	atla	
	Overfill Prevention: Spill Prevention:	<ol> <li>Product Level Gauge (Aboveground Only),5. Vent Whi</li> <li>None</li> </ol>	sue	
	Dispenser:	2. Suction		
		2. 0001011	_	
AD132 WSW 1/8-1/4	SEASONWEIN MANAGEMENT LLC 54 CENTRE AVENUE		NY UST	U003994353 N/A
0.180 mi. 951 ft.	NEW ROCHELLE, NY 10801 Site 1 of 7 in cluster AD			
Relative:	WESTCHESTER CO. UST:	3-169773 / Active		
Higher	Id/Status: Operator Name:	Matt Seasonwein		
Actual:	Owner Name:	Seasonwein Management LLC		
98 ft.	Owner Street:	300 Gramatan Avenue		
	Owner Address2:	Not reported		
	Owner City:	Mount Vernon		
	Owner State:	NY		
	Owner Zipcode:	10552		
	GDS Number:	Not reported		
	Tank Number:	1		
	Status:	1. In-Service		
	Capacity:	2000		
	Product Stored:	1. No. 2 fuel oil		
	Product Stored Percent: Tank Leak Detection:	Not reported 0. None		
	Date Installation:	01/01/1928		
	Date Perm Closure:	01/01/1900		
	Tank Location:	5. Underground		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection:	0. None		
	Tank Secondary Containment:	4. Double-Walled (underground only)		
	Piping Location:	1. Aboveground		
	Piping Type: Piping External Protection:	1. Steel/Carbon/ Steel/Iron 0. None		
	Overfill Prevention:	5. Vent Whistle		
	Piping Secondary Containment:			
	Spill Prevention:	0. None		
	Dispenser:	2. Suction		

# AD133 APARTMENT BLDG

WSW 1/8-1/4 0.180 mi. 951 ft.	54 CENTRE AVE NEW ROCHELLE, NY Site 2 of 7 in cluster AD	
Relative: Higher	LTANKS: Site ID: Spill Number/Closed Date:	84302
Actual: 98 ft.	Spill Number/Closed Date: Spill Date: Spill Cause:	2004-06-29 Tank Test Failure

NY LTANKS S105996855 N/A

EDR ID Number Database(s) EPA ID Number

# **APARTMENT BLDG (Continued)**

S105996855

	•	
	Spill Source:	Non Major Facility > 1,100 gal
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
		Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	WCHD
	Referred To:	WESTCHESTER CNTY HEALTH D
	Reported to Dept:	2004-06-29
	CID:	406
	Water Affected:	Not reported
	Spill Notifier:	Tank Tester
	Last Inspection:	Not reported
		•
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	2004-06-29
	Spill Record Last Update:	2004-12-10
	Spiller Name:	BASSAM MABER
	Spiller Company:	APARTMENT BLDG
	Spiller Address:	54 CENTRE AVE
	Spiller City, St, Zip:	NEW ROCHELLE, NY
	Spiller County:	
	, ,	001
	Spiller Contact:	BASSAM MABER
	Spiller Phone:	(914) 645-6420
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	77542
	DEC Memo:	"12/10/04 PBS facility. Tank passed a retest after piping was
		repaired. Spill file closed by Danielle Jackson of the Westchester
		County Health Dept. No further action is required at this time. jbo"
	Remarks:	"Tank Test Failure. Reccommend Retest."
	Remarks.	
Μ	laterial:	
	Site ID:	84302
	Operable Unit ID:	886824
	Operable Unit:	01
	Material ID:	490990
	Material Code:	0002A
	Material Name:	#4 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	.00
	Units:	Gallons
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	,,,	•
_		
T	ank Test:	
	Site ID:	84302
	Spill Tank Test:	1529391
	Tank Number:	1
	Tank Size:	2000
	Test Method:	03
	rest method.	03
	Leak Rate:	
	Leak Rate:	.00

Database(s)

EDR ID Number EPA ID Number

### **APARTMENT BLDG (Continued)**

Modified By: Spills Not reported Last Modified: Test Method: Horner EZ Check I or II Site ID: 254563 Spill Number/Closed Date: 0206558 / 2005-02-27 Spill Date: 2002-09-06 Spill Cause: Tank Overfill Spill Source: Private Dwelling Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 6010 Investigator: WCHD Referred To: WESTCHESTER CNTY HEALTH D Reported to Dept: 2002-09-24 CID: 390 Water Affected: Not reported Spill Notifier: Health Department Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False **Remediation Phase:** 0 Date Entered In Computer: 2002-09-24 Spill Record Last Update: 2005-02-27 Spiller Name: ENERITO GONZALEZ Spiller Company: APARTMENT BLDG Spiller Address: 54 CENTRE AV Spiller City,St,Zip: NEW ROCHELLE, ZZ Spiller County: 001 Spiller Contact: ENERITO GONZALEZ Spiller Phone: (914) 309-2775 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 208499 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was WCHD - SCHNEIDER 2/27/05 #4 overfill to surface -- close " Remarks: "spill was noticed on 9/6 - unk when it occurred" Material: Site ID: 254563 Operable Unit ID: 858169 Operable Unit: 01 Material ID: 517160 Material Code: 0002A Material Name: #4 fuel oil Not reported Case No .: Material FA: Petroleum Quantity: .00 Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate:

# S105996855

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	APARTMENT BLDG (Continue	ed)		S105996855
	Tank Test:			
	Tank Test.			
Z134 WSW 1/8-1/4 0.181 mi.	COMMERCIAL PROPERTY 64 CENTRE AVE NEW ROCHELLE, NY		NY LTANKS	S116156733 N/A
955 ft.	Site 3 of 6 in cluster Z			
Relative: Higher	LTANKS: Site ID:	489220		
Actual:	Spill Number/Closed Date: Spill Date:	1308480 / 2015-04-28 2013-11-20		
98 ft.	Spill Cause:	Tank Test Failure		
	Spill Source: Spill Class:	Commercial/Industrial Known release with minimal potential for fire or hazard. DE	C Response	
	Opin Olass.	Willing Responsible Party. Corrective action taken.	e Response.	
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard: SWIS:	False 6010		
	Investigator:	RDBENDEL		
	Referred To: Reported to Dept:	Not reported 2013-11-20		
	CID:	Not reported		
	Water Affected: Spill Notifier:	Not reported Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	False 0		
	Date Entered In Computer:	2013-11-20		
	Spill Record Last Update: Spiller Name:			
	Spiller Company:	Not reported UNKNOWN		
	Spiller Address:	64 CENTRE AVE		
	Spiller City,St,Zip: Spiller County:	NY 999		
	Spiller Contact:	STEVE MANGELS		
	Spiller Phone: Spiller Extention:	(914) 632-2610 Not reported		
	DEC Region:	3		
	DER Facility ID: DEC Memo:	444316 "11-20-13: Chris/WCHD call to V.Mc./Dispt.: Closed Unreg.	DDC	
	DEC Memo:	faciliy. Wayne/WCHD to handle. 11/20/2013 1:48:33 PM:: F		
		Lalak to Wayne Schneider via email:: Wayne, Former PBS		
		Expired in 1992 (removed gasoline tanks) TTF for Undergro oil tank estimated as a 550 (Ullage leak and they plan to re		
		tank.) The Facility is: M. Hacker and Sons. Please get them	n to	
		register and deal with the TTF jod 04/23/15 HydroEnvironm Solutions submitted a report documenting the installation of		
		temporary monitoring well in the location were the LUST wa		
		(See report in DecDocs) Trace levels of VOCs & SVOCs in	the sample.	
	Remarks:	TG 4-28-15 closed NFA -RDB" ""		
	Material:	100000		
	Site ID:	489220		

Database(s)

EDR ID Number EPA ID Number

S116156733

#### **COMMERCIAL PROPERTY (Continued)**

Operable Unit ID:	1238809
Operable Unit:	01
Material ID:	2238759
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

#### NY DRYCLEANERS Z135 **GREEN HEAVEN/CENTRE CLEANERS** S106437149 wsw 62 CENTRE AVE. N/A 1/8-1/4 NEW ROCHELLE, NY 10801 0.181 mi. 957 ft. Site 4 of 6 in cluster Z DRYCLEANERS: **Relative:** Facility ID: 3-5510-00298 Higher Phone Number: 914-636-5350 Actual: Region: Not reported 98 ft. **Registration Effective Date:** 9/24/2003 13:22:51:203 Inspection Date: 11SEP8 Install Date: 88/98 Drop Shop: Not reported Shutdown: Not reported Alternate Solvent: DF2000 Current Business: Not reported **GREEN HEAVEN CLEANERS** RCRA-CESQG 1000338662 Z136 wsw NYD982531634 **62 CENTRE STREET US AIRS** 1/8-1/4 NEW ROCHELLE, NY 10801 FINDS 0.181 mi. NY MANIFEST 957 ft. Site 5 of 6 in cluster Z **ECHO** RCRA-CESQG: **Relative:** Date form received by agency: 01/01/2007 Higher SIMONETTI CLEANERS Facility name: Actual: Facility address: 62 CENTRE ST 98 ft. NEW ROCHELLE, NY 10801 EPA ID: NYD982531634 Mailing address: CENTRE ST NEW ROCHELLE, NY 10801 Contact: KWANG YUN Contact address: CENTRE ST NEW ROCHELLE, NY 10801 Contact country: US Contact telephone: (914) 636-5350 Contact email: Not reported EPA Region: 02 Classification: Conditionally Exempt Small Quantity Generator

EDR ID Number Database(s) EPA ID Number

GREEN HEAVEN CLEANERS (Continued) 100				
Description:	Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste			
Owner/Operator Summary:				
Owner/operator name:	KWANG YUN			
Owner/operator address:	24 SUMMIT AVE MOUNT VERNON, NY 10550			
Owner/operator country:	US			
Owner/operator telephone:	(914) 665-0274			
Legal status:	Private			
Owner/Operator Type:	Owner			
Owner/Op start date:	Not reported			
Owner/Op end date:	Not reported			
Owner/operator name:	KWANG YUN			
Owner/operator address:	24 SUMMIT AVE MOUNT VERNON, NY 10550			
Owner/operator country:	US			
Owner/operator telephone:	(914) 665-0274			
Legal status:	Private			
Owner/Operator Type:	Operator			
Owner/Op start date:	Not reported			
Owner/Op end date:	Not reported			
Handler Activities Summary:				
U.S. importer of hazardous w	aste: No			
Mixed waste (haz. and radioa				
Recycler of hazardous waste:				
Transporter of hazardous was				
Treater, storer or disposer of				
Underground injection activity On-site burner exemption:	r: No No			
Furnace exemption:	No			
Used oil fuel burner:	No			
Used oil processor:	No			
User oil refiner:	No			
Used oil fuel marketer to burn				
Used oil Specification market	er: No			
Used oil transfer facility:	No			
Used oil transporter:	No			
Historical Generators:				

Historical Generators:

Date form received by agency: 01/01/2006

Site name: SIMONETTI CLEANERS

Database(s)

EDR ID Number EPA ID Number

GREEN HEAVEN CLEANERS (Continued) 1000338662				
Classification: 0	Conditionally Exempt Small Quantity Generator			
Date form received by agency:				
	SIMONETTI CLEANERS Small Quantity Generator			
Classification.				
. Waste code: [	D007			
. Waste name: 0	CHROMIUM			
. Waste code:	D008			
	EAD			
. Waste code:	0039			
	TETRACHLOROETHYLENE			
. Waste code:	D040			
. Waste name:	<b>FRICHLORETHYLENE</b>			
. Waste code:	-002			
	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLO	ROETHYLENE.		
	METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLORO	,		
	CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE,			
	ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND			
	RICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CO	-		
	JSE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE ( ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED			
	5005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPEI			
	SPENT SOLVENT MIXTURES.			
Violation Status:	No violations found			
US AIRS MINOR:				
Envid:	1000338662			
Region Code:	02			
Programmatic ID:	AIR 02000003606156000			
Facility Registry ID:	110012174805			
D and B Number: Primary SIC Code:	Not reported 7216			
NAICS Code:	812320			
Default Air Classification Code:	MIN			
Facility Type of Ownership Code	e: POF			
Air CMS Category Code:	Not reported			
HPV Status:	Not reported			
Envid:	1000338662			
Region Code:	02			
Programmatic ID:	AIR NY0000NY3551000298			
Facility Registry ID:	110012174805			
D and B Number: Primary SIC Code:	Not reported 7216			
NAICS Code:	812320			
Default Air Classification Code:	MIN			
Facility Type of Ownership Code				
Air CMS Category Code:	Not reported			
HPV Status:	Not reported			

FINDS:

Database(s)

EDR ID Number EPA ID Number

### **GREEN HEAVEN CLEANERS (Continued)**

Registry ID:

110012174805

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

NY MANIFEST: USA Country: EPA ID: NYD982531634 Facility Status: Not reported Location Address 1: **62 CENTRE AVENUE** Code: RΡ Location Address 2: Not reported Total Tanks: Not reported Location City: NEW ROCHELLE Location State: NY Location Zip: 10801 Location Zip 4: Not reported NY MANIFEST: EPAID: NYD982531634 Mailing Name: SIMONETTI CLEANERS Mailing Contact: SIMONETTI CLEANERS Mailing Address 1: **62 CENTRE AVENUE** Mailing Address 2: Not reported Mailing City: NEW ROCHELLE Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 9146365350 NY MANIFEST:

Document ID:

Not reported

# 1000338662

TC4738280.2s Page 253

Database(s)

EDR ID Number EPA ID Number

### **GREEN HEAVEN CLEANERS (Continued)**

Manifest Status: Not reported Not reported seq: 2009 Year: Trans1 State ID: NJD000664906 Trans2 State ID: CDX761010010 Generator Ship Date: 01/10/2009 Trans1 Recv Date: 01/10/2009 Trans2 Recv Date: 01/16/2009 TSD Site Recv Date: 01/17/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: CDX107000000 TSDF ID 2: Not reported 004562249JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Υ Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported 390.0 Quantity: P - Pounds Units: Number of Containers: 3.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 F002 Waste Code: Waste Code 1\_2: D039 Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2007 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629976 Generator Ship Date: 05/12/2007 Trans1 Recv Date: 05/12/2007 Trans2 Recv Date: 05/17/2007 TSD Site Recv Date: 05/24/2007

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD982531634 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported OHD980587364 TSDF ID 1: TSDF ID 2: Not reported 000497613SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported Quantity: 300 P - Pounds Units: Number of Containers: 2 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: Waste Code: F002 Waste Code 1 2: D007 Waste Code 1\_3: D039 D040 Waste Code 1\_4: Waste Code 1\_5: Not reported Not reported Waste Code 1 6: NYC7340343 Document ID: Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: NYCF7875 Trans2 State ID: T19L8DNJ Generator Ship Date: 05/03/2004 Trans1 Recv Date: 05/03/2004 Trans2 Recv Date: 05/05/2004 TSD Site Recv Date: 05/06/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: TXR000050930 Trans2 EPA ID: Not reported TSDF ID 1: OHD980587 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Not reported

Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### **GREEN HEAVEN CLEANERS (Continued)**

Export Indicator:

Units:

seq:

Year:

Waste Code: Waste Code:

Discr Quantity Indicator:

Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Not reported Manifest Ref Number: Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported 00150 Quantity: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7459705 Manifest Status: Not reported Not reported 2004 Trans1 State ID: NY49455JF Trans2 State ID: T470GL Generator Ship Date: 11/29/2004 Trans1 Recv Date: 11/29/2004 Trans2 Recv Date: 12/01/2004 TSD Site Recv Date: 12/03/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: TXR000050930 Trans1 EPA ID: Trans2 EPA ID: Not reported OHD980587 TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Waste Code: Not reported

Not reported

Not reported

Database(s)

EDR ID Number EPA ID Number

#### GREEN HEAVEN CLEANERS (Continued)

Waste Code: Not reported 00150 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7252356 Manifest Status: Not reported seq: 01 Year: 2003 Trans1 State ID: NYCF7875 Trans2 State ID: NJ044 Generator Ship Date: 12/29/2003 Trans1 Recv Date: 12/29/2003 Trans2 Recv Date: 12/30/2003 TSD Site Recv Date: 01/05/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Not reported Discr Type Indicator: Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00300 P - Pounds Units: Number of Containers: 002 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC7086767 Document ID: Manifest Status: Not reported seq: 01 Year: 2003 Trans1 State ID: NYCR3164 Trans2 State ID: AH0697 Generator Ship Date: 05/16/2003

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Trans1 Recv Date: 05/16/2003 05/21/2003 Trans2 Recv Date: TSD Site Recv Date: 05/22/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: TXR000050930 Trans2 EPA ID: MOR000505347 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00150 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7019346 Manifest Status: Not reported seq: 01 Year: 2003 Trans1 State ID: Not reported Trans2 State ID: T25L8DNJ Generator Ship Date: 01/24/2003 Trans1 Recv Date: 01/24/2003 Trans2 Recv Date: 01/29/2003 TSD Site Recv Date: 01/30/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

# **GREEN HEAVEN CLEANERS (Continued)**

	linaoa)
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00300
Units:	P - Pounds
Number of Containers:	002
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC6663240
Manifest Status:	Not reported
seq:	01
Year:	2002
Trans1 State ID:	DW9495
Trans2 State ID:	NJT51G9T
Generator Ship Date:	02/26/2002
Trans1 Recv Date:	02/26/2002
Trans2 Recv Date:	03/04/2002
TSD Site Recv Date:	03/05/2002
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID: Trans1 EPA ID:	NYD982531634 SCR000075150
Trans2 EPA ID:	NJD071629976
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6873568 Document ID: Manifest Status: Not reported seq: 01 Year: 2002 Trans1 State ID: NY49455JF Trans2 State ID: T53G9TNJ Generator Ship Date: 09/30/2002 Trans1 Recv Date: 09/30/2002 Trans2 Recv Date: 10/02/2002 TSD Site Recv Date: 10/03/2002 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD982531634 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00195 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6494207 Document ID: Manifest Status: Not reported 01 seq: Year: 2001 Trans1 State ID: 19952JF Trans2 State ID: NJ044 11/06/2001 Generator Ship Date: Trans1 Recy Date: 11/06/2001 Trans2 Recv Date: 11/12/2001 TSD Site Recv Date: 11/13/2001

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5750392 Manifest Status: Not reported 01 seq: Year: 2001 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 04/24/2001 Trans1 Recv Date: 04/24/2001 Trans2 Recv Date: 04/27/2001 TSD Site Recv Date: 04/28/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: MOD095038998 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

1000338662

Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC6083190 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYRCR2436 Trans2 State ID: NJT162VW Generator Ship Date: 03/08/2000 Trans1 Recv Date: 03/08/2000 Trans2 Recv Date: 03/09/2000 TSD Site Recy Date: 03/13/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 P - Pounds Units: Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning.

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Specific Gravity: 01.00 NYC6190817 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYCR2436 Trans2 State ID: TNT218034 Generator Ship Date: 06/28/2000 Trans1 Recv Date: 06/28/2000 Trans2 Recv Date: 06/28/2000 TSD Site Recv Date: 06/30/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: SCR000074591 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Not reported **Discr Quantity Indicator:** Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. Handling Method: Specific Gravity: 01.00 Document ID: NYC6304983 Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: NYCR2436 Trans2 State ID: TNT218034 Generator Ship Date: 12/06/2000 Trans1 Recv Date: 12/06/2000 Trans2 Recv Date: 12/06/2000 TSD Site Recv Date: 12/11/2000 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD982531634

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Trans1 EPA ID: SCR000075150 SCR000074591 Trans2 EPA ID: TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5974018 Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYR2436 Trans2 State ID: T422NXNJ Generator Ship Date: 11/10/1999 Trans1 Recv Date: 11/10/1999 Trans2 Recv Date: 11/15/1999 TSD Site Recv Date: 11/19/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported

Database(s) EPA ID N

EDR ID Number EPA ID Number

1000338662

#### **GREEN HEAVEN CLEANERS (Continued)**

Document ID:

MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Not reported Waste Code: 00195 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC5644552 Document ID: Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR243 Trans2 State ID: T422NXNY 05/28/1999 Generator Ship Date: Trans1 Recv Date: 05/28/1999 Trans2 Recv Date: 06/01/1999 TSD Site Recv Date: 06/03/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00

NYC5849605

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Manifest Status: Not reported 01 seq: Year: 1999 Trans1 State ID: NYCR2436 Trans2 State ID: T104414IL Generator Ship Date: 07/20/1999 Trans1 Recv Date: 07/20/1999 Trans2 Recv Date: 07/22/1999 TSD Site Recv Date: 07/26/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported 00195 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC5520666 Manifest Status: Not reported seq: 01 Year: 1999 Trans1 State ID: NYCR2436 Trans2 State ID: TY22NXNJ Generator Ship Date: 02/03/1999 Trans1 Recv Date: 02/03/1999 Trans2 Recv Date: 02/08/1999 02/10/1999 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: SCD987574647 TSDF ID 1: OHD980587364

Database(s)

EDR ID Number EPA ID Number

1000338662

#### **GREEN HEAVEN CLEANERS (Continued)**

TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Not reported Alt Facility RCRA ID: Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 00390 Units: P - Pounds Number of Containers: 002 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0671288 Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: NYCR2436 Trans2 State ID: Not reported Generator Ship Date: 01/08/1998 Trans1 Recv Date: 01/08/1998 Not reported Trans2 Recv Date: 01/12/1998 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982531634 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **GREEN HEAVEN CLEANERS (Continued)**

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00070 P - Pounds Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 CTF0688517 Document ID: Manifest Status: Not reported 01 seq: Year: 1998 Trans1 State ID: NYDW9495 Trans2 State ID: Not reported 03/06/1998 Generator Ship Date: Trans1 Recv Date: 03/06/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/12/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982531634 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID 1: CTD001156009 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported Not reported MGMT Method Type Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Quantity: 00140 Units: P - Pounds Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00

<u>Click this hyperlink</u> while viewing on your computer to access 66 additional NY\_MANIFEST: record(s) in the EDR Site Report.

Database(s)

	GREEN HEAVEN CLEANERS (Continued)		
	ECHO: Envid: Registry ID: DFR URL:	1000338662 110012174805 http://echo.epa.gov/detailed_facility_report?fid=110012174805	
137 ENE 1/8-1/4 0.182 mi. 962 ft.	MONROE COLLEGE 5 FRANKLIN AVE NEW ROCHELLE, NY	NY LTANKS	S106124169 N/A
Relative: Lower	LTANKS: Site ID:	165556	
Actual: 75 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Extention: DEC Region: DEC Region: DER Facility ID:	2003-10-16 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6000 WCHD WESTCHESTER CNTY HEALTH D 2003-10-16 270 Not reported Tank Tester Not reported False False 0 2003-10-16	
	DEC Memo: Remarks:	"03/27/05 CLEAN UP COMPLETED. SPILL FILE CLOSED BY OF THE WES COUNTY HEALTH DEPT. NO FURTHER ACTION IS REQUIRED AT THIS As per email from WCHD: 03-07536 5 Franklin Ave, NEw Rochelle, NY (also known as 420 Main St, New Rochelle) Tank removed from basement, soil disposed of. NFA" "recomend repair retest"	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code:	165556 873930 01 501063 0001A	

Database(s)

	MONROE COLLEGE (Continu Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	ed) #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported	S106124169
	Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	165556 1528740 1 3000 03 .00 Not reported Spills Not reported Horner EZ Check I or II	
AE138 SW 1/8-1/4 0.183 mi. 968 ft.	COCO RESIDENCE 81 CENTRE AVE NEW ROCHELLE, NY Site 1 of 3 in cluster AE	NY LTANKS	S106123934 N/A
Relative: Higher Actual: 101 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller County: Spiller County: Spiller County:	2004-01-07 Tank Test Failure Non Major Facility > 1,100 gal Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD WESTCHESTER CNTY HEALTH D 2004-01-07 403 Not reported Tank Tester Not reported False False 0 : 2004-01-07	

Z139 SW

1/8-1/4

MAP FINDINGS

Database(s)

COCO RESIDENCE (Continu	ed)		S106123934
Spiller Phone:	(914) 961-8200		
Spiller Extention:	Not reported		
DEC Region:	3		
DER Facility ID:	252696		
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD-JACKSON 01/10/05: Letter to Edward D. Coco, Centre-Main Associates from Danielle Jackson dated 9Feb2004(?). WCDOH requ NFA at this time."	ires	
Remarks:	"Failed test. Unknown if the tank is leaking"		
Material:			
Site ID:	313391		
Operable Unit ID:	878986		
Operable Unit:	01		
Material ID:	500153		
Material Code:	0001A		
Material Name:	#2 fuel oil		
Case No.:	Not reported		
Material FA:	Petroleum		
Quantity:	.00		
Units:	Gallons		
Recovered:	.00		
Resource Affected:	Not reported		
Oxygenate:	Not reported		
Tank Test:			
Site ID:	313391		
Spill Tank Test:	1528899		
Tank Number:	1		
Tank Size:	2000		
Test Method:	03		
Leak Rate:	.00		
Gross Fail:	Not reported		
Modified By:	Spills		
Last Modified:	Not reported		
Test Method:	Horner EZ Check I or II		
75 CENTRE AVENUE LLC 75 CENTRE AVENUE NEW ROCHELLE, NY 10801		Y UST Y AST	U004175967 N/A

Relative: HigherWESTCHESTER CO. UST: Id/Status:3-800240 / Active Operator Name:Actual: 99 ft.Owner Name: Owner Street:John & Dino Rentoulis S2 North Central Ave.Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:NY Not reportedTank Number: Status:1 S. Closed - removed	0.188 mi 994 ft.	i. Site 6 of 6 in cluster Z		
Actual:       Owner Name:       John & Dino Rentoulis         99 ft.       Owner Street:       52 North Central Ave.         Owner Address2:       Not reported         Owner City:       Elmsford         Owner State:       NY         Owner Zipcode:       10523         GDS Number:       Not reported		Id/Status:		
		Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode:	52 North Central Ave. Not reported Elmsford NY 10523	
			1 5. Closed - removed	

Database(s)

EDR ID Number **EPA ID Number** 

#### 75 CENTRE AVENUE LLC (Continued)

Status:

Dispenser:

Capacity: 2000 Product Stored: Not reported Product Stored Percent: Not reported Tank Leak Detection: Not reported Date Installation: Not reported 11/01/2004 Date Perm Closure: 6. Underground, vaulted, with access Tank Location: 1. Steel/Carbon steel/Iron Tank Type: Tank Internal Protection: 0. None Tank External Protection: 0. None Tank Secondary Containment: 0. None Piping Location: 0. No Pipiing Piping Type: 1. Steel/Carbon/ steel/iron Piping External Protection: 0. None **Overfill Prevention:** 0. None Piping Secondary Containment: Not reported Spill Prevention: 0. None Dispenser: 0. None WESTCHESTER CO. AST: 3-800240 PBS Number: Site Status: Active GDS Number: Not reported **Operator Name: Dino Rentoulis Owner Name:** John & Dino Rentoulis **Owner Street:** 52 North Central Ave. Owner Address2: Not reported Owner City/State/Zip: Elmsford, NY 10523 Tank Number: 002 1. In-Service Date Installation: 09/01/2004 Capacity: 1500 1. No. 2 fuel oil Product Stored: Product Stored Percent: Not reported Date Perm Closure: 01/01/1900 Tank Location: 1. Aboveground (contact w/ soil) Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating Tank Leak Detection: 6. Impervious Barrier/Concrete Pad (Aboveground Only) Tank Secondary Containment: 1. Diking (aboveground only) Piping Location: 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron Piping Type: Piping External Protection: 0. None Piping Leak Detection: Not reported Piping Secondary Containment: 0. None **Overfill Prevention:** 4. Product Level Gauge (Aboveground Only), 5. Vent Whistle Spill Prevention: 1. Catch Basin

2. Suction

#### U004175967

Database(s)

AC140 SSE 1/8-1/4 0.189 mi.	RESIDENCE 64 CHURCH ST NEW ROCHELLE, NY	NY LTANKS S1069714 N/A	497
1000 ft.	Site 2 of 2 in cluster AC		
	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller County:	2004-11-02 Tank Test Failure Private Dwelling Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2004-11-02 403 Not reported Other 2006-02-16 False False 0 : 2004-11-02	
	Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	RAMONE OCEGUERA (914) 396-7293 Not reported 3 268502 "11/22/04 AST ON GROUND UNDER DECK. TANK LOST APPROX 150 GALLONS AFTER TEST. FREE PRODUCT IN SUMP PIT IN BASEMENT. FURTHER INVESTIGATION TO BE DONE BY ADVANCED ENVIRONMENTAL. jod 5/1/2008: Advanced Environmental disposed of LUST and 26.15 tons of contaminated soil. Ground water was impacted and sampled. Spill closure report from ECC submitted to DEC. Based upon information provided, this Department requires No Further Action at this time. jod" "tank test failed."	
	Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	333255 1095424 01 575563 0001A #2 fuel oil Not reported Petroleum .00	

AF141

CON ED

Database(s)

EDR ID Number EPA ID Number

# **RESIDENCE** (Continued)

Units: Recovered: Resource Affected: Oxygenate:	Gallons .00 Not reported Not reported
Tank Test:	
Site ID:	333255
Spill Tank Test:	1548304
Tank Number:	1
Tank Size:	275
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

S106971497

NY MANIFEST S118088511 N/A

SW 1/8-1/4 0.191 mi. 1006 ft.	CENTRE AVE & MAIN ST NEW ROCHELLE, NY 10801 Site 1 of 3 in cluster AF	
Relative: Higher Actual: 100 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004760815 Not reported CENTRE AVE & MAIN ST BP TM 2750 Not reported NEW ROCHELLE NY 10801 Not reported
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004760815 CON ED TOM TEELING 4 IRVING PLACE - 15TH FLOOR Not reported NEW YORK NY 10003 Not reported USA 2124603770
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID:	Not reported Not reported Not reported 2015 NYD006982359 Not reported

Database(s)

EDR ID Number EPA ID Number

#### CON ED (Continued)

Generator Ship Date: 03/31/2015 Trans1 Recv Date: 03/31/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004760815 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091694JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 500 P - Pounds Units: Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/31/2015 Trans1 Recv Date: 03/31/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004760815 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### CON ED (Continued)

TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014091694JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 500 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/31/2015 Trans1 Recv Date: 03/31/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Not reported Part B Recv Date: NYP004760815 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014091694JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Specific Gravity: Waste Code 1_2: Waste Code 1_4:	N Not reported Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported Not reported S00 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported
—	•
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

AF142 SW 1/8-1/4 0.191 mi. 1006 ft.	CON EDISON TRANSFORMER MA CENTRE AVE & MAIN ST NEW ROCHELLE, NY 10801 Site 2 of 3 in cluster AF	ANHOLE: 2750	RCRA NonGen / NLR FINDS NY MANIFEST ECHO	1016677840 NYP004315198
1006 ft. Relative: Higher Actual: 100 ft.	Site 2 of 3 in cluster AF RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description:	:06/21/2013 CON EDISON TRANSFORMER MANHOLE: 2 CENTRE AVE & MAIN ST NEW ROCHELLE, NY 10801 NYP004315198 VING PL, RM 828 NEW YORK, NY 10003 DENNIS ROHRER Not reported Not reported Not reported (914) 925-6219 Not reported 02 Non-Generator Handler: Non-Generators do not presently gene		
	Handler Activities Summary: U.S. importer of hazardous wa Mixed waste (haz. and radioad Recycler of hazardous waste: Transporter of hazardous was Treater, storer or disposer of H Underground injection activity: On-site burner exemption:	aste: No ctive): No No te: No tW: No		

Database(s)

Fundace exemption:       No         Used oil fuel burner:       No         Used oil processor:       No         Used oil tuel marketer to burner:       No         Used oil tuel marketer to burner:       No         Used oil tuel marketer to burner:       No         Used oil transporter:       No         Used oil transporter:       No         Used oil transporter:       No         Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       CON EDISON TRANSFORMER         FNDS:       RCRAHOR is a national information system that supports the Resource         Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAHOR allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         Coation Address 1:       CENTE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location Ip 4:<	ON EDISON TRANSFORM	ER MANHOLE: 2750 (Continued)	1016677840
Used oil fuel burner: No Used oil processor: No Used oil Specification marketer in No Used oil Specification marketer: No Used oil transfer facility: No Used oil transfer facility: No Used oil transfer facility: No Historical Generators: Date form received by agency:05/21/2013 Site name: CON EDISON TRANSFORMER MANHOLE: 2750 Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found FINDS: Registry ID: 110058871369 Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo corrective action activities required under RCRA. NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: No treported Location Address 1: CENTRE ST & MAIN Code: BP Location Address 2: Not reported Location Address 2: Not reported Location Address 2: Not reported Location State: VY Mailing Address 1: CON EDISON Mailing Address 1: CON EDISON Mailing Address 1: A the roted EDISON Mailing Address 1: CON EDISON Mailing Address 1: A the roted Mailing Address 1: CON EDISON Mailing Address 1: A the VING PLACE 15TH FLOOR Mailing Address 1: Not reported Mailing Country: USA Mailing Di At: Not reported Mailing Country: USA Mailing Di At: Not reported Mailing Country: USA Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770	Furnace exemption:	No	
Used oil fueil marketer to turners:       No         Used oil Specification marketer:       No         Used oil transfer facility:       No         Used oil transfer facility:       No         Historical Generators:       Date form received by agency:05/21/2013         Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RCRAInto is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and tract, store, or dispose of hazardous waste. RCRAInto allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         EPA ID:       NY P004315198         Facility Status:       Not reported         Location Address 1:       CON EDISCN         Location Address 2:       Not reported         Location Address 2:       Not reported         Location Address 2:       Not reported         Numarity Name:       CON EDISCN         Mailing Name:       CON EDISCN         Mai		No	
Lised oil fuel marketer to burner:       No         Used oil transporter:       No         Used oil transporter:       No         Date form received by agency:05/21/2013         Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         Country:       USA         EPAID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location Zip :       10801         Location Zip :       10801         Location Zip :       10801         Location Address 2:       Not reported         Maling Address 1:       CON	Used oil processor:	No	
Used oil Specification marketer: No Used oil transporter: No Historical Generators: Date form received by agency: 05/21/2013 Site name: CON EDISON TRANSFORMER MANHOLE: 2750 Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found FINDS: Registry ID: 110058871369 Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: Not reported Location Address 12: Not reported Total Tanks: Not reported Total Tanks: Not reported Location State: Ny Location State: Ny Location State: CON EDISON Maling Contact: CON EDISON Maling Address 12: Not reported Maling Contact: CON EDISON Maling Contact: Not reported Maling Contact	•	No	
Used oil transfer facility: No Used oil transporter: No Historical Generators: Date form received by agency: 05/21/2013 Site name: CON EDISON TRANSFORMER MANHOLE: 2750 Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found FINDS: Registry ID: 110058871369 Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit. compliance, and corrective action activities required under RCRA. NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: Not reported Location Address 1: CENTRE ST & MAIN Code: BP Location Address 2: Not reported Total Tanks: Not reported Total Tanks: Not reported Location State: NY Mailing Address 1: CON EDISON Mailing Address 1: AVPN04315198 Mailing Name: CON EDISON Mailing Address 1: AVPN04315198 Mailing Contact: CON EDISON Mailing Address 1: AIRVINO PLACE 15TH FLOOR Mailing Address 1: Not reported Mailing Country: NEW YORK Mailing Zip 4: Not reported Mailing Country: NEW YORK Mailing Zip 4: Not reported Mailing Country: NEW YORK Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770	Used oil fuel marketer to	burner: No	
Used oil transporter:       No         Historical Generators:       Date form received by agency: 05/21/2013         Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waster. RCRAInfo liso score activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waster. RCRAInfo liso SCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       Country:         Country:       USA         EPA ID:       NY PPO04315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Location Address 2:       Not reported         Location State:       NY         EPA ID:       Not reported         Location Address 1:       CENTRE ST & MAIN         Location State:       NY         Location Address 2:       Not reported <t< th=""><th>Used oil Specification m</th><th>arketer: No</th><th></th></t<>	Used oil Specification m	arketer: No	
Historical Generators: Date form received by agency: 05/21/2013 Site name: CON EDISON TRANSFORMER MANHOLE: 2750 Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found FINDS: Registry ID: 110058871369 Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waster. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: Not reported Location Address 1: CENTRE ST & MAIN Code: BP Location Address 2: Not reported Total Tanks: Not reported Total Tanks: Not reported Total Tanks: Not reported Location Zip: 10801 Location Zip: 10801 Location Zip: Not reported Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 1: Not reported Mailing Zip: Not repo			
Date form received by agency: 05/21/2013         Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit. compliance, and corrective action activities required under RCRA.         NY MANIFEST:       Country:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 2:       Not reported         Location Address 2:       Not reported         Location Address 2:       Not reported         Location Zip 4:       Not reported         Location Zip 4:       Not reported         NY MANIFEST:       EPAID:         Multing Name:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Chry:       Nev YORK         Mailing Country: <th>Used oil transporter:</th> <th>No</th> <th></th>	Used oil transporter:	No	
Site name:       CON EDISON TRANSFORMER MANHOLE: 2750         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo is an activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       Country:         Country:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location City:       NEW ROCHELLE         Location State:       NY         Location State:       NY         NY MAINFEST:       EPAID:         EPAID:       NYP004315198         Mailing Name:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR </td <td>Historical Generators:</td> <td></td> <td></td>	Historical Generators:		
Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         FINDS:       Registry ID:       110058871369         Environmental Interest/Information System       RacRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       Country:       USA         Country:       USA       EPA ID:         Country:       USA         EPA ID:       NY PO04315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location Address 1:       Not reported         Location Zip:       10801         Location Zip 4:       NYP04315198         Maling Name:       CON EDISON         Maling Address 1:       CON EDISON         Maling Address 1:       4 IRVING PLACE 15TH FLOOR         Maling Address 1:       4 IRVING PLACE 15TH FLOOR         Maling Address 1:       A IRVING PLACE 15TH FLOO	Date form received by a	gency:05/21/2013	
Violation Status:       No violations found         FINDS:         Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location Address 2:       Not reported         Location State:       NY         NY MANIFEST:       EPA ID:         Violation State:       NY         Location Address 2:       Not reported         Location State:       NY         Multing Name:       CON EDISON         Mailing Name:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 1:       A IRVING PLACE 15TH FLOOR         Mailing Address 1:       Not reported         Mailing State:       N	Site name:	CON EDISON TRANSFORMER MANHOLE: 2750	
FINDS:         Registry ID:       110058871369         Environmental Interest/Information System finant supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code       B         Location Address 2:       Not reported         Location City:       NEW NOCHELLE         Location State:       NY         Location Zip A:       Not reported         Location Zip:       Not reported         Location Zip:       Not reported         Location Zip:       Not reported         Mailing Contact:       Not reported         Mailing Address 1:       A INC PLACE IST FIF LOCR         Mailing Address 1:       A INC PLACE IST FIF LOCR         Mailing Address 1:       A INC PLACE IST FIF LOCR         Mailing Address 1:       A INC PLACE IST FIF LOCR         Mailing Address 1:       A INC PLACE IST FIF LOCR         Mailing Address 1:       A	Classification:	Conditionally Exempt Small Quantity Generator	
Registry ID:       110058871369         Environmental Interest/Information System       RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         Country:       USA         EAPA ID:       NYP004315198         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 1:       CENTRE ST & MAIN         Location City:       Not reported         Location City:       Not reported         Location Zip 2:       Not reported         Location Zip 3:       Not reported         Location Zip 4:       Not reported         Maling Name:       CON EDISON         Maling Contact:       CON EDISON         Maling Address 1:       Altor PLOTED         Maling Address 2:       Not reported         Maling Address 2:       Not reported         Maling Address 1:       Not reported         Maling Address 1:	Violation Status:	No violations found	
Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: Not reported Location Address 1: CENTRE ST & MAIN Code: BP Location Address 2: Not reported Total Tanks: Not reported Location State: NY Location State: NY Location State: NY Location Zip: 10801 Location Zip 4: Not reported Mailing Name: CON EDISON Mailing Address 2: Not reported Mailing Address 2: Not reported Mailing Address 2: Not reported Mailing State: NY Mailing State: NY Mailing Zip 4: Net perfed Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770	FINDS:		
RCRAInfo is a national information system that supports the Resource         Conservation and Recovery Act (RCRA) program through the tracking of         events and activities related to facilities that generate, transport,         and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA         program staff to track the notification, permit, compliance, and         corrective action activities required under RCRA.         NY MANIFEST:         Country:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location Address 2:       Not reported         Location State:       NY         Location State:       NY         Location Zip 4:       Not reported         Location Zip 4:       Not reported         NY MANIFEST:       EPAID:         EPAID:       NYP004315198         Mailing Name:       CON EDISON         Mailing Address 2:       Not reported         Mailing Address 2:	Registry ID:	110058871369	
Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:		•	
events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Location State:       NY         Location State:       NY         Location Zip       10801         Location Zip 4:       Not reported         Notation Zip 4:       Not reported         Notation Zip 4:       Not reported         Nating Name:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing State:       NY         Mailing State:       NY         Mailing State:       NY         Mailing Zip 4:       Not reported         Mailing Zip 4:       Not reported         Mailing State:       NY         Mailing State:       NY         Mailing Phone:       2124603770			
and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.			of
program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.         NY MANIFEST:         Country:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Total Tanks:       Not reported         Location State:       NY         Location Zip:       10801         Location Zip:       10801         Location Zip:       Not reported         NY MANIFEST:       EPAID:         EPAID:       NYP004315198         Mailing Name:       CON EDISON         Mailing Contact:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 2:       Not reported         Mailing City:       NEW YORK         Mailing State:       NY         Mailing Zip 4:       Not reported         Mailing Zip 4:       Not rep			
NY MANIFEST:         Country:       USA         EPA ID:       NYP004315198         Facility Status:       Not reported         Location Address 1:       CENTRE ST & MAIN         Code:       BP         Location Address 2:       Not reported         Total Tanks:       Not reported         Location City:       NEW ROCHELLE         Location State:       NY         Location Zip:       10801         Location Zip:       Not reported         NY MANIFEST:       EPAID:         PAID:       NYP004315198         Mailing Name:       CON EDISON         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 2:       Not reported         Mailing Address 2:       Not reported         Mailing Address 1:       4 IRVING PLACE 15TH FLOOR         Mailing Address 2:       Not reported         Mailing Xip:       NO03         Mailing Zip 4:       Not reported         Mailing Contry:       USA         Mailing Zip 4:       Not reported         Mai			<a< td=""></a<>
NY MANIFEST: Country: USA EPA ID: NYP004315198 Facility Status: Not reported Location Address 1: CENTRE ST & MAIN Code: BP Location Address 2: Not reported Total Tanks: Not reported Location City: NEW ROCHELLE Location State: NY Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004315198 Mailing Name: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing Contact: NY Mailing State: NY Mailing State: NY Mailing County: USA Mailing County: USA Mailing County: USA Mailing Phone: 2124603770			
Country:USAEPA ID:NYP004315198Facility Status:Not reportedLocation Address 1:CENTRE ST & MAINCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing Zip:10003Mailing Zip 4:Not reported	001100		
Country:USAEPA ID:NYP004315198Facility Status:Not reportedLocation Address 1:CENTRE ST & MAINCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
EPA ID:NYP004315198Facility Status:Not reportedLocation Address 1:CENTRE ST & MAINCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Zip 4:Not reportedMailing Dip:10003Mailing Country:USAMailing Phone:2124603770	_		
Facility Status:Not reportedLocation Address 1:CENTRE ST & MAINCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Jip:10801Location Zip 4:Not reportedMailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Location Address 1:CENTRE ST & MAINCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Code:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770	•	•	
Location Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Total Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Zip:10003Mailing Country:USAMailing Phone:2124603770			
Location City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770		•	
Location State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770		•	
Location Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Dentry:USAMailing Phone:2124603770	•		
Location Zip 4:Not reportedNY MANIFEST:NYP004315198EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Phone:2124603770			
EPAID:NYP004315198Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Country:USAMailing Phone:2124603770	•		
Mailing Name:CON EDISONMailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Contact:CON EDISONMailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Address 1:4 IRVING PLACE 15TH FLOORMailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Zip:10003Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Zip 4:Not reportedMailing Country:USAMailing Phone:2124603770			
Mailing Country:USAMailing Phone:2124603770			
Mailing Phone: 2124603770		•	
NY MANIFEST:	Mailing Phone:	2124603770	
	NY MANIFEST:		
Document ID: Not reported	Document ID:	Not reported	

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON TRANSFORMER MANHOLE: 2750 (Continued)

Manifest Status: Not reported Not reported seq: Year: 2013 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 05/21/2013 Trans1 Recv Date: 05/21/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 05/28/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004315198 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002200046 TSDF ID 1: TSDF ID 2: Not reported 007019053JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 300 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

ECHO:

Envid: Registry ID: DFR URL: 1016677840 110058871369 http://echo.epa.gov/detailed\_facility\_report?fid=110058871369

Database(s)

AF143 SW 1/8-1/4 0.191 mi.	CON EDISON MAIN ST & CENTRE ST NEW ROCHELLE, NY 10801		NY MANIFEST	S117318285 N/A
1006 ft.	Site 3 of 3 in cluster AF			
Relative: Higher Actual: 100 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State:	USA NYP004658019 Not reported MAIN ST & CENTRE ST BP MH734 Not reported NEW ROCHELLE NY		
	Location Zip: Location Zip 4:	10801 Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004658019 CON EDISON CON EDISON 4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported		
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans1 Recv Date: Trans2 Recv Date: Part A Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator:	Not reported Not reported Not reported 2014 NYD006982359 Not reported 09/16/2014 09/16/2014 Not reported 09/19/2014 Not reported Not reported NYP004658019 Not reported NJD002200046 Not reported 012771786JJK N N N N N N N N N N N N		

Map ID Direction Distance Elevation Site MAP FINDINGS

Not reported

Database(s)

EDR ID Number **EPA ID Number** 

S117318285

Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Not reported
Not reported
H110
Not reported
50
P - Pounds
1
TT - Cargo tank, tank trucks
T Chemical, physical, or biological treatment.
1
D008
Not reported
•

AD144 WSW 1/8-1/4	CON EDISON CENTER & HUGUENOT NEW ROCHELLE, NY		NY MANIFEST	S117319603 N/A
0.192 mi. 1013 ft.	Site 3 of 7 in cluster AD			
Relative: Higher Actual: 96 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City:	USA NYP004676839 Not reported CENTER & HUGUENOT BP MH 1230 Not reported NEW ROCHELLE		
	Location State: Location Zip: Location Zip 4:	NY Not reported Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004676839 CON EDISON CON EDISON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770		
	NY MANIFEST: Document ID: Manifest Status:	Not reported Not reported		

Database(s)

EDR ID Number **EPA ID Number** 

S117319603

#### **CON EDISON (Continued)**

seq:

Year:

Units:

Not reported 2014 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 10/13/2014 Trans1 Recv Date: 10/13/2014 Trans2 Recv Date: Not reported TSD Site Recy Date: 10/14/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004676839 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 012770954JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 1000 P - Pounds Number of Containers: 1 TT - Cargo tank, tank trucks Container Type: Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Not reported Waste Code 1\_6:

#### AD145 CON EDISON wsw **HUGENOT & CENTRE ST** 1/8-1/4 NEW ROCHELLE, NY 10801 0.192 mi. 1013 ft. Site 4 of 7 in cluster AD NY MANIFEST: **Relative:** Country: USA Higher NYP004677530 EPA ID: Actual: Facility Status: Not reported 96 ft. Location Address 1: HUGENOT & CENTRE ST

NY MANIFEST S117535592 N/A

TC4738280.2s Page 282

#### Map ID Direction Distance Elevation

Site

#### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

ΒP Code: Location Address 2: Total Tanks: Location City: Location State: NY Location Zip: 10801 Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Mailing Country: USA Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: 2014 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recy Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: H110 Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Not reported Waste Code: Not reported

# MH 1230 Not reported NEW ROCHELLE Not reported NYP004677530 CON EDISON TOM TEELING 4 IRVING PLACE - 15TH FLOOR Not reported NEW YORK Not reported Not reported Not reported Not reported Not reported NYD006982359 Not reported 10/14/2014 10/14/2014 Not reported 10/20/2014 Not reported Not reported NYP004677530 Not reported Not reported NJD002200046 Not reported 012774876JJK Not reported Not reported Not reported Not reported Not reported Not reported Not reported

#### Map ID Direction Distance Elevation Site

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

### CON EDISON (Continued)

Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

#### 500 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported

#### AD146 CON EDISON

AD 146 WSW 1/8-1/4 0.192 mi. 1013 ft.	CENTRE AVE & HUGUENOT ST NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AD	
Relative: Higher	NY MANIFEST: Country: EPA ID:	USA NYP004332961
Actual: 96 ft.	Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	Not reported CENTRE AVE & HUGUENOT ST BP Not reported New ROCHELLE NY 10801 Not reported
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004332961 CON EDISON CON EDISON 4 IRVING PLACE 15TH FLOOR Not reported NEW YORK NY 10003 Not reported USA 2124603770
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date:	Not reported Not reported Not reported 2013 NYD006982359 Not reported 07/22/2013 07/22/2013 Not reported 07/26/2013 Not reported

#### NY MANIFEST S113917500 N/A

Database(s)

EDR ID Number **EPA ID Number** 

S113917500

#### **CON EDISON (Continued)**

TSDF ID 1:

TSDF ID 2:

Waste Code:

Quantity:

Units:

Part B Recv Date: Not reported NYP004332961 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002200046 Not reported 011695949JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Not reported Alt Facility RCRA ID: Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Not reported Not reported Not reported Not reported Not reported Not reported 100 P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Not reported Waste Code 1\_5: Not reported Waste Code 1\_6:

ST

#### A D1 47

AD147 WSW 1/8-1/4 0.192 mi. 1013 ft.	CON EDISON HUGUENOT ST & CENTRE S NEW ROCHELLE, NY 10801 Site 6 of 7 in cluster AD	т
Relative:	RCRA NonGen / NLR:	07/10/2010
Higher	Date form received by ag Facility name:	CON EDISON
Actual: 96 ft.	Facility address:	HUGUENOT ST & CENTRE S NEW ROCHELLE, NY 10801
	EPA ID:	NYP004211728
	Mailing address:	4 IRVING PL, RM 828 NEW YORK, NY 10003
	Contact:	DONALD SENNO
	Contact address:	Not reported Not reported
	Contact country: Contact telephone: Contact email:	Not reported (914) 925-6219 Not reported

1014398803 RCRA NonGen / NLR NYP004211728

Database(s)

	CON EDISON (Continued)				1014398803
	EPA Region:	02			
	Classification:	-	Generator		
	Description:		ler: Non-Generators do not presently generate hazard	ous wasta	
	Description.	Tianu	ier. Non-Generators do not presently generate nazard	ous waste	
	Handler Activities Summary:		NL		
	U.S. importer of hazardous		No		
	Mixed waste (haz. and radio	,			
	Recycler of hazardous was		No		
	Transporter of hazardous w		No No		
	Treater, storer or disposer of Underground injection activ		No		
	On-site burner exemption:	ity.	No		
	Furnace exemption:		No		
	Used oil fuel burner:		No		
	Used oil processor:		No		
	User oil refiner:		No		
	Used oil fuel marketer to bu	Irner:	No		
	Used oil Specification mark		No		
	Used oil transfer facility:		No		
	Used oil transporter:		No		
	Violation Status:	No vi	olations found		
AE148 SW 1/8-1/4 0.192 mi. 1014 ft.	CENTRE-MAIN ASSOCIATES 75 - 77 CENTER AVE NEW ROCHELLE, NY Site 2 of 3 in cluster AE			NY LTANKS	S106123770 N/A
1014 ft.	Site 2 of 3 in cluster AE				
Relative:	LTANKS:				
Higher		149369			
Actual:	Spill Number/Closed Date:				
100 ft.		2004-01	-21 st Failure		
	•	Private [			
			elease with minimal potential for fire or hazard. DEC R	esponse	
			Responsible Party. Corrective action taken.		
		Not repo			
		True			
	SWIS:	6010			
	5	WCHD			
	Referred To:		HESTER CNTY HEALTH D		
	Reported to Dept:	2004-01	-21		
	CID:	44	at a d		
		Not repo Tank Te			
		Not repo			
	•	False			
		False			
		0			
	Date Entered In Computer:		-21		
		2005-01			
		ED			
	Spiller Company:	Not repo	orted		
			CENTER AVE		
			DCHELLE, NY		
	1	001			
	Spiller Contact:	ED			

Map ID	
Direction	
Distance	
Elevation	Site

Contact country:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	CENTRE-MAIN ASSOCIATES	(Continued)	S106123770
	Spiller Phone:	(914) 961-8200	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	127066	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	DEO Memo.	WCHD-JACKSON 1/10/05: Letter to Edward D. Coco, Centre-Main	
		Associates from Danielle Jackson, WCDOH dated 30Dec2004. WCDOH	1
		requires NFA at this time."	I
	Remarks:	"recommend, uncover repair and retest. Tank is bolted in basement."	
	Remarks.		
	Material:		
	Site ID:	149369	
	Operable Unit ID:	877137	
	Operable Unit:	01	
	Material ID:	497066	
	Material Code:	0001A	
	Material Name:	#2 fuel oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Gallons	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
	Table Table		
	Tank Test:	4 400 00	
	Site ID:	149369	
	Spill Tank Test:	1528926	
	Tank Number:	1	
	Tank Size:	2000	
	Test Method:	03	
	Leak Rate:	.00	
	Gross Fail:	Not reported	
	Modified By:	Spills	
	Last Modified:	Not reported	
	Test Method:	Horner EZ Check I or II	
10110			U.D. 4044040004
AG149	CON EDISON MANHOLE 1178 HUGUENOT ST & LECOUNT F		
North			ST NYP004219455
1/8-1/4	NEW ROCHELLE, NY 10801	NJ MANIFE	:51
0.196 mi. 1034 ft.	Site 1 of 3 in cluster AG		
Delether	RCRA NonGen / NLR:		
Relative: Lower	Date form received by age	ancy: 12/03/2010	
Lower	Facility name:	CON EDISON MANHOLE 1178	
Actual:	Facility address:	HUGUENOT ST & LECOUNT PL	
88 ft.	r donity dedress.	MH 1178	
		NEW ROCHELLE, NY 10801	
	EPA ID:	NYP004219455	
	Mailing address:	IRVING PL RM 828	
	Manny address.	NEW YORK, NY 10003	
	Contact:	DOMINIC BIZZARO	
	Contact address:		
	Contact address.	Not reported	

Not reported

Not reported

Database(s)

Contact telephone:	(914) 925-6219
Contact email:	Not reported
EPA Region:	02
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous was
Handler Activities Summary:	
U.S. importer of hazardous	
Mixed waste (haz. and rad	
Recycler of hazardous was	
Transporter of hazardous v Treater, storer or disposer	
Underground injection activ	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to be	urner: No
Used oil Specification mark	
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by age	ncy:11/03/2010
Site name:	CON EDISON MANHOLE 1178
Classification:	Conditionally Exempt Small Quantity Generator
Violation Status:	No violations found
NY MANIFEST:	
Country:	USA
EPA ID:	NYP004219455
Facility Status: Location Address 1:	Not reported HUGUENOT ST & LE COURT
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	NEW ROCHELLE
Location State:	NY
Location Zip:	10802
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYP004219455
Mailing Name:	CONSOLIDATED EDISON - MH 1178
Mailing Contact:	
Mailing Address 1:	4 IRVING PLACE RM 828
Mailing Address 2:	Not reported
Mailing City:	NEW YORK NY
	NY 10003
Mailing State:	10003
Mailing Zip:	Not reported
	Not reported USA

Database(s)

EDR ID Number **EPA ID Number** 

NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2010 Trans1 State ID: NYD006982359 Not reported Trans2 State ID: Generator Ship Date: 11/03/2010 Trans1 Recv Date: 11/03/2010 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/05/2010 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004219455 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 006874912JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Υ Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H111 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Quantity: 100.0 Units: P - Pounds Number of Containers: 1.0 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1.0 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

#### NJ MANIFEST:

EPA Id: Mail Address: Mail City/State/Zip: Facility Phone: **Emergency Phone:** 

NYP004219455 **IRVING PL RM 828** NEW YORK, NY 10003 Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

#### **CON EDISON MANHOLE 1178 (Continued)**

Contact: DOMINIC BIZZARO Comments: Not reported SIC Code: Not reported NY119 County: Municipal: Not reported Previous EPA Id: Not reported Not reported Gen Flag: Not reported Trans Flag: TSDF Flag: Not reported Name Change: Not reported Date Change: Not reported Manifest: Manifest Number: 006874912JJK EPA ID: NYP004219455 Date Shipped: 11/03/2010 TSDF EPA ID: NJD002200046 Transporter EPA ID: NYD006982359 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 9 EPA ID: Not reported Transporter 10 EPA ID: Not reported 11/03/2010 Date Trans1 Transported Waste: Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 11/05/2010 TSDF EPA Facility Name: Not reported Not reported QTY Units: Transporter SEQ ID: Not reported Transporter-1 Date: Not reported Waste SEQ ID: Not reported Waste Type Code 2: Not reported Waste Type Code 3: Not reported Not reported Waste Type Code 4: Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: Not reported Was Load Rejected: NEW YORK, NY 10003 Reason Load Was Rejected: Not reported Waste: Manifest Year: Not reported Waste Code: D008 Hand Code: H111

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON MANHOLE 1178 (C	Continued)		1014918331
	Quantity:	100 P		
AG150 North 1/8-1/4 0.196 mi.	CON EDISON MANHOLE 1181 HUGUENOT ST & LECOUNT PL NEW ROCHELLE, NY 10801	RCRA	NonGen / NLR NY MANIFEST NJ MANIFEST	1014918324 NYP004219380
1034 ft.	Site 2 of 3 in cluster AG			
Relative:	RCRA NonGen / NLR:	: 12/02/2010		
Lower	Date form received by agency Facility name:	CON EDISON MANHOLE 1181		
Actual: 88 ft.	Facility address:	HUGUENOT ST & LECOUNT PL MH 1181		
	EPA ID:	NEW ROCHELLE, NY 10801 NYP004219380		
	Mailing address:	IRVING PL RM 828		
		NEW YORK, NY 10003		
	Contact: Contact address:	DONALD SENNO Not reported		
		Not reported		
	Contact country: Contact telephone:	Not reported (914) 925-6219		
	Contact email:	Not reported		
	EPA Region:	02		
	Classification: Description:	Non-Generator Handler: Non-Generators do not presently generate haz	ardous waste	
	Handler Activities Summary:			
	U.S. importer of hazardous w	aste: No		
	Mixed waste (haz. and radioa	,		
	Recycler of hazardous waste: Transporter of hazardous was			
	Treater, storer or disposer of	HW: No		
	Underground injection activity On-site burner exemption:	r: No No		
	Furnace exemption:	No		
	Used oil fuel burner:	No		
	Used oil processor: User oil refiner:	No No		
	Used oil fuel marketer to burn	er: No		
	Used oil Specification market Used oil transfer facility:	er: No No		
	Used oil transporter:	No		
	Historical Generators:			
	Date form received by agency			
	Site name: Classification:	CON EDISON MANHOLE 1181 Conditionally Exempt Small Quantity Generator		
	Violation Status:	No violations found		
	NY MANIFEST:			
	Country: EPA ID:	USA NYP004219380		

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON MANHOLE 1181 (Continued)

Facility Status: Not reported HUGENOT ST & LE COURT Location Address 1: Code: ΒP Location Address 2: Not reported Total Tanks: Not reported NEW ROCHELLE Location City: Location State: NY 10802 Location Zip: Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004219380 Mailing Name: **CONSOLIDATED EDISON - MH 1181** Mailing Contact: TOM TEELING 4 IRVING PLACE RM 828 Mailing Address 1: Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2010 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 11/02/2010 Trans1 Recv Date: 11/02/2010 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/05/2010 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004219380 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD002200046 TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: 006874911JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Υ Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H111 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Not reported

Not reported

P - Pounds

Not reported

Not reported

Not reported

Not reported

Not reported

NYP004219380

Not reported

Not reported

Not reported

Not reported NY119

Not reported

**IRVING PL RM 828** 

DONALD SENNO

NEW YORK, NY 10003

TT - Cargo tank, tank trucks

T Chemical, physical, or biological treatment.

100.0

1.0

1.0

D008

Database(s)

EDR ID Number **EPA ID Number** 

Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1 5: Waste Code 1\_6:

NJ MANIFEST:

EPA Id: Mail Address: Mail City/State/Zip: Facility Phone: **Emergency Phone:** Contact: Comments: SIC Code: County: Municipal: Previous EPA Id: Gen Flag: Trans Flag: TSDF Flag: Name Change: Date Change: Manifest:

Manifest Number: 006874911JJK EPA ID: NYP004219380 Date Shipped: 11/02/2010 TSDF EPA ID: NJD002200046 Transporter EPA ID: NYD006982359 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 9 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 11/02/2010 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Not reported Date Trans4 Transported Waste: Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### CON EDISON MANHOLE 1181 (Continued)

Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 11/05/2010 TSDF EPA Facility Name: Not reported QTY Units: Not reported Not reported Transporter SEQ ID: Not reported Transporter-1 Date: Waste SEQ ID: Not reported Waste Type Code 2: Not reported Waste Type Code 3: Not reported Waste Type Code 4: Not reported Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: Not reported Was Load Rejected: NEW YORK, NY 10003 Reason Load Was Rejected: Not reported Waste:

lot reported
8000
1111
00 P

AG151 North 1/8-1/4 0.196 mi. 1034 ft.	CON EDISON HUGENOT ST & LECOUNT PL NEW ROCHELLE, NY Site 3 of 3 in cluster AG		NY MANIFEST	S118259788 N/A
Relative: Lower Actual: 88 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004837407 Not reported HUGENOT ST & LECOUNT PL BP V 7723 Not reported NEW ROCHELLE NY Not reported Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004837407 CON EDISON DENNIS HUACON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770		

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 Trans1 State ID: NYD006982359 Not reported Trans2 State ID: Generator Ship Date: 09/11/2015 Trans1 Recv Date: 09/11/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 09/17/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004837407 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014472144JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 150 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 09/11/2015 Trans1 Recv Date: 09/11/2015

#### S118259788

Database(s)

EDR ID Number **EPA ID Number** 

#### **CON EDISON (Continued)**

Trans2 Recv Date: Not reported 09/17/2015 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004837407 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014472144JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 150 P - Pounds Units: Number of Containers: 1 TT - Cargo tank, tank trucks Container Type: Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

AE152 SW 1/8-1/4 0.197 mi. 1040 ft.	CENTRE MAIN EQUITIES LLC 573-579 MAIN STREET NEW ROCHELLE, NY 10801 Site 3 of 3 in cluster AE	
Relative: Higher Actual: 100 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street:	3-800238 / Active Pedro Benoit Centre Main Equities LLC 542 Main Street, 2nd Floor
	Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	Not reported New Rochelle NY 10801 Not reported

S118259788

NY UST U004176186 NY AST N/A

Database(s)

EDR ID Number EPA ID Number

## **CENTRE MAIN EQUITIES LLC (Continued)**

U004176186

		linuouj
	Tank Number:	1
	Status:	5. Closed - removed
	Capacity:	2000
	Product Stored:	Not reported
	Product Stored Percent:	Not reported
	Tank Leak Detection:	Not reported
	Date Installation:	Not reported
	Date Perm Closure:	11/01/2004
	Tank Location:	6. Underground, vaulted, with access
	Tank Type:	1. Steel/Carbon steel/Iron
	Tank Internal Protection:	0. None
	Tank External Protection:	0. None
	Tank Secondary Containment:	0. None
	Piping Location:	0. No Pipiing
	Piping Type:	1. Steel/Carbon/ steel/iron
	Piping External Protection:	0. None
	Overfill Prevention:	0. None
	Piping Secondary Containment:	
	Spill Prevention:	0. None
	Dispenser:	0. None
	2.000.0000	
W	ESTCHESTER CO. AST:	
	PBS Number:	3-800238
	Site Status:	Active
	GDS Number:	Not reported
	Operator Name:	Pedro Benoit
	Owner Name:	Centre Main Equities LLC
	Owner Street:	542 Main Street, 2nd Floor
	Owner Address2:	Not reported
	Owner City/State/Zip:	New Rochelle, NY 10801
	Tonk Number	001
	Tank Number:	
	Status:	1. In-Service
	Date Installation:	09/01/2004
	Capacity:	
	Product Stored:	1. No. 2 fuel oil
	Product Stored Percent:	Not reported
	Date Perm Closure:	01/01/1900
	Tank Location:	6. Aboveground in subterranean vault with access for inspections
	Tank Type:	1. Steel/Carbon steel/Iron
	Tank Internal Protection:	
	Tank External Protection:	1. Painted/Asphalt Coating,99. Other
	Tank Leak Detection:	0. None
	Tank Secondary Containment:	0. None
	Piping Location:	1. Aboveground
	Piping Type:	1. Steel/Carbon/ steel/iron
	Piping External Protection:	0. None
	Piping Leak Detection:	0. None
	Piping Secondary Containment:	
	Overfill Prevention:	4. Product Level Gauge (Aboveground Only),5. Vent Whistle
	Spill Prevention:	0. None
	Dispenser:	2. Suction

Database(s)

EDR ID Number EPA ID Number

153 WNW 1/8-1/4	NYSDOT BIN 1091390 DIVISION ST OVER I 95 NEW ROCHELLE, NY 10803	RCRA NonGen / NLR	1000790435 NYD987019197
0.198 mi.			
1048 ft.			
Relative:	RCRA NonGen / NLR: Date form received by agenc	N: 01/01/2007	
Lower	Facility name:	NYSDOT BIN 1091390	
Actual:	Facility address:	DIVISION ST OVER I 95	
79 ft.		NEW ROCHELLE, NY 10803	
	EPA ID:	NYD987019197	
	Mailing address:	BURNETT BLVD POUGHKEEPSIE, NY 12603	
	Contact:	RICHARD MANNS	
	Contact address:	BURNETT BLVD	
		POUGHKEEPSIE, NY 12603	
	Contact country:	US	
	Contact telephone: Contact email:	(914) 431-5743 Not reported	
	EPA Region:	02	
	Classification:	Non-Generator	
	Description:	Handler: Non-Generators do not presently generate hazardous waste	
	Owner/Operator Summary:	NV/0D07	
	Owner/operator name: Owner/operator address:	NYSDOT 4 BURNETT BLVD	
	Owner/operator address.	POUGHKEEPSIE, NY 12603	
	Owner/operator country:	US	
	Owner/operator telephone:	(914) 431-5743	
	Legal status:	State	
	Owner/Operator Type: Owner/Op start date:	Owner Not reported	
	Owner/Op end date:	Not reported	
	Owner/operator name:		
	Owner/operator address:	4 BURNETT BLVD POUGHKEEPSIE, NY 12603	
	Owner/operator country:	US	
	Owner/operator telephone:	(914) 431-5743	
	Legal status:	State	
	Owner/Operator Type: Owner/Op start date:	Operator Not reported	
	Owner/Op end date:	Not reported	
	·		
	Handler Activities Summary:		
	U.S. importer of hazardous w		
	Mixed waste (haz. and radioa		
	Recycler of hazardous waste Transporter of hazardous wa		
	Treater, storer or disposer of		
	Underground injection activity		
	On-site burner exemption:	No	
	Furnace exemption:	No	
	Used oil fuel burner: Used oil processor:	No No	
	User oil refiner:	No	
	Used oil fuel marketer to burr		

Database(s)

EDR ID Number EPA ID Number

	NYSDOT BIN 4001200 (Continued			4000700435
	NYSDOT BIN 1091390 (Continued		1000790435	
	Used oil Specification marketer			
	Used oil transfer facility: Used oil transporter:			
	Used on transporter.	No		
	Historical Generators:			
	Date form received by agency:	01/01/2006		
		NYSDOT BIN 1091390		
	Classification:	Not a generator, verified		
	Date form received by agency:	09/25/1992		
		NYSDOT BIN 1091390		
	Classification:	Not a generator, verified		
		<b>B</b> 444		
		D000 Not Defined		
	. waste hame.	Not Denned		
	. Waste code:	D008		
	. Waste name:	LEAD		
	Vieletien Cteture			
	Violation Status:	No violations found		
154	TRIPLE A PROPERTIES, INC.		NY AST	A100252348
South	25 PROSPECT STREET			N/A
1/8-1/4 0.200 mi.	NEW ROCHELLE, NY 10805			
1054 ft.				
Relative:	WESTCHESTER CO. AST:			
Lower	PBS Number:	3-165727		
	Site Status:	Active		
Actual: 89 ft.	GDS Number:	Not reported		
0311.	Operator Name: Owner Name:	Anna Marchetti		
	Owner Street:	Triple A Properties, Inc. P.O. Box 767		
	Owner Address2:	Not reported		
	Owner City/State/Zip:	Yonkers, NY 10703		
	Tank Number:	001 1 Ja Damian		
	Status: Date Installation:	1. In-Service 01/01/1995		
	Capacity:	4000		
	Product Stored:	2. No. 4 fuel oil		
	Product Stored Percent:	100		
	Date Perm Closure:	01/01/1900		
	Tank Location:	<ol><li>Aboveground on saddles, legs, stilts, racks or cradle</li></ol>		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection: Tank External Protection:	0. None other		
	Tank Leak Detection:	6. Impervious Barrier/Concrete Pad (Aboveground Only)		
	Tank Secondary Containment:	2. Vault (w/ access)		
	Piping Location:	1. Aboveground		
	Piping Type:	1. Steel/Carbon/ Steel/Iron		
	Piping External Protection:	1. Painted/Asphalt Coating,8. Wrapped (Piping)		
	Piping Leak Detection:	2. Manual Interstitial Monitoring		
	Piping Secondary Containment			
	Overfill Prevention: Spill Prevention:	<ol> <li>Product Level Gauge (Aboveground Only),5. Vent Whistle 0. None</li> </ol>	5	
	Disponsor:	2 Suction		

Dispenser:

Database(s)

EDR ID Number EPA ID Number

155 ENE 1/8-1/4 0.201 mi.	CON EDISON - GAS DRIP 407 FRANKLIN AV & LAFAYETTE ST NEW ROCHELLE, NY 10801		1012185533 NYP004163416
1059 ft.			
Relative:	RCRA-LQG:		
Lower	Date form received by agency Facility name:	: 03/23/2010 CON EDISON - GAS DRIP 407	
Actual: 68 ft.	Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact email: EPA Region:	FRANKLIN AV & LAFAYETTE ST NEW ROCHELLE, NY 10801 NYP004163416 4 IRVING PLACE NEW YORK, NY 10003 FRANKLYN MURRAY Not reported Not reported Not reported (212) 460-2808 MURRAYFR@CONED.COM 02	
	Classification: Description:	Large Quantity Generator Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time	1
	Owner/Operator Summary:		
	Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.	
	Owner/operator address:	4 IRVING PLACE	
	Owner/operator country:	NEW YORK, NY 10003 US	
	Owner/operator telephone:	Not reported	
	Legal status:	Private	
	Owner/Operator Type:	Owner	
	Owner/Op start date:	01/17/2009	
	Owner/Op end date:	Not reported	
	Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.	
	Owner/operator address:	4 IRVING PLACE	
	·	NEW YORK, NY 10003	
	Owner/operator country:	US	
	Owner/operator telephone:	Not reported	
	Legal status:	Private	
	Owner/Operator Type: Owner/Op start date:	Operator 01/17/2009	
	Owner/Op end date:	Not reported	
		·····	
	Handler Activities Summary: U.S. importer of hazardous wa	aste: No	

U.S. importer of hazardous waste: No

Database(s)

EDR ID Number EPA ID Number

1012185533

## CON EDISON - GAS DRIP 407 (Continued)

Mixed waste (haz. and radioactive): No         Recycler of hazardous waste:       No         Transporter of hazardous waste:       No         Transporter of hazardous waste:       No         Underground injection activity:       No         On-site burner exemption:       No         Used oil froetsor:       No         Used oil frole burner:       No         Used oil frole marketer to burner:       No         Used oil fransfer facility:       No         Used oil transfer facility:       No         Used oil transfer facility:       No         Used oil transporter:       No         Otarist name:       CON EDISON         Classification:       Conditionally Exempt Small Quantity Generator         Violation Status:       No violations found         NY MANIFEST:       Country:         Counting:       USA         EPA ID:       NY treported		onanueu)
. Waste name: BENZENE Historical Generators: Date form received by agency: 01/17/2009 Site name: CON EDISON Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found NY MANIFEST: Country: USA EPA ID: NYP004163416 Facility Status: Not reported Location Address 1: FRANKLIN AV & LAFAYETTE ST Code: BP Location Address 2: Not reported Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004163416 Mailing Name: CONSULDATED EDISON Mailing Contact: FRANKLYN MURRAY Mailing Address 1: 4 IRVING PL RM 828 Mailing Address 1: 4 IRVING PL RM 828 Mailing Address 1: 4 IRVING PL RM 828 Mailing State: NY Mailing Contact: FRANKLYN MURRAY Mailing Contact: NT Mailing State: NY Mailing S	Recycler of hazardous waste: Transporter of hazardous was Treater, storer or disposer of f Underground injection activity On-site burner exemption: Furnace exemption: Used oil fuel burner: Used oil fuel burner: Used oil processor: User oil refiner: Used oil fuel marketer to burn Used oil fuel marketer to burn Used oil Specification marketer Used oil transfer facility:	No ste: No HW: No : No No No No No No Pr: No No
Historical Generators: Date form received by agency: 01/17/2009 Site name: CON EDISON Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found NY MANIFEST: Country: USA EPA ID: NYP004163416 Facility Status: Not reported Location Address 1: FRANKLIN AV & LAFAYETTE ST Code: BP Location Address 2: Not reported Location City: NEW ROCHELLE Location City: NEW ROCHELLE Location State: NY Location Zip: 10801 Location Zip: 10801 Location Zip 4: Not reported Mailing Name: CONSOLIDATED EDISON Mailing Address 1: 4 IRVING PL RM 828 Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing State: NY Mailing Country: USA Mailing Country: USA Mailing Country: USA NY MANIFEST: Document ID: Not reported Mailing Phone: 2124602808 NY MANIFEST: Document ID: Not reported Mailing Fatus: Not reported Mailing Phone: 2009	. Waste code:	D018
Date form received by agency: 01/17/2009Site name:CON EDISONClassification:Conditionally Exempt Small Quantity GeneratorViolation Status:No violations foundNY MANIFEST:Country:Country:USAEPA ID:NYP004163416Facility Status:Not reportedLocation Address 1:FRANKLIN AV & LAFAYETTE STCode:BPLocation Address 2:Not reportedLocation Address 2:Not reportedLocation State:NYLocation State:NYLocation Zip:10801Location Zip:10801Location Zip:10801Location Zip:Not reportedNY MANIFEST:FRANKLYN MURRAYMailing Name:CONSOLIDATED EDISONMailing Address 1:4 IRVING PL RM 828Mailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Country:USAMailing Country:USAMailing Country:USAMailing Phone:2124602808NY MANIFEST:Document ID:Document ID:Not reportedMailing Phone:2124602808	. Waste name:	BENZENE
NY MANIFEST:USACountry:USAEPA ID:NYP004163416Facility Status:Not reportedLocation Address 1:FRANKLIN AV & LAFAYETTE STCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004163416Mailing Name:CONSOLIDATED EDISONMailing Address 1:4 IRVING PL RM 828Mailing Address 2:Not reportedMailing City:NEW YORKMailing Zip:10003Mailing Zip:10003Mailing Zip 4:Not reportedMailing Phone:2124602808NY MANIFEST:Document ID:Document ID:Not reportedMailing Status:Not reportedMailing Phone:2124602808	Date form received by agency Site name: Classification:	CON EDISON Conditionally Exempt Small Quantity Generator
Country:USAEPA ID:NYP004163416Facility Status:Not reportedLocation Address 1:FRANKLIN AV & LAFAYETTE STCode:BPLocation Address 2:Not reportedTotal Tanks:Not reportedLocation City:NEW ROCHELLELocation State:NYLocation Zip:10801Location Zip 4:Not reportedNY MANIFEST:EPAID:EPAID:NYP004163416Mailing Name:CONSOLIDATED EDISONMailing Address 1:4 IRVING PL RM 828Mailing Address 2:Not reportedMailing State:NYMailing State:NYMailing Zip:10003Mailing Zip 4:Not reportedMailing Phone:2124602808NY MANIFEST:EDocument ID:Not reportedMailing Phone:X124602808	Violation Status:	No violations found
EPAID:NYP004163416Mailing Name:CONSOLIDATED EDISONMailing Contact:FRANKLYN MURRAYMailing Address 1:4 IRVING PL RM 828Mailing Address 2:Not reportedMailing City:NEW YORKMailing State:NYMailing Zip:10003Mailing Country:USAMailing Phone:2124602808NY MANIFEST:Document ID:Not reportedNot reportedManifest Status:Not reportedseq:Not reportedYear:2009	Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip:	NYP004163416 Not reported FRANKLIN AV & LAFAYETTE ST BP Not reported Not reported NEW ROCHELLE NY 10801
Document ID:Not reportedManifest Status:Not reportedseq:Not reportedYear:2009	EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	CONSOLIDATED EDISON FRANKLYN MURRAY 4 IRVING PL RM 828 Not reported NEW YORK NY 10003 Not reported USA
	Document ID: Manifest Status: seq: Year:	Not reported Not reported 2009

Database(s)

EDR ID Number **EPA ID Number** 

Trans2 State ID: Not reported 01/17/2009 Generator Ship Date: Trans1 Recv Date: 01/17/2009 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/17/2009 Part A Recv Date: Not reported Not reported Part B Recv Date: NYP004163416 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NYD000705939 TSDF ID 1: TSDF ID 2: Not reported 002013040FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Ν Discr Type Indicator: **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H135 Waste Code: Not reported 270.0 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 5.0 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1.0 Waste Code: D018 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

#### AD156 ERIC S TURNER & CO INC. wsw 33-35 CENTRE AVE 1/8-1/4 NEW ROCHELLE, NY 10801

Quantity:

Units:

1074 ft.	Sito	7	of 7	in	cluster	۸D
10/4 π.	Site	1	017	m	cluster	AD

0.203 mi.

Relative:					
Higher	Date form received by agency: 01/01/2007				
-	Facility name:	ERIC S TURNER & CO INC.			
Actual:	Facility address:	33-35 CENTRE AVE			
94 ft.		NEW ROCHELLE, NY 108010000			
	EPA ID:	NYD002015402			
	Mailing address:	PO BOX #816			
		NEW ROCHELLE, NY 108010000			

RCRA-CESQG 1007204937 NJ MANIFEST NYD002015402 NY MANIFEST

#### 1012185533

TC4738280.2s Page 302

Database(s)

EDR ID Number EPA ID Number

ERIC S TURNER & CO INC. (Co	ntinuec	1)	
Contact:	\\//ILL	IAM TURNER	
Contact address:	PO BOX #816		
Contact address.	-	ROCHELLE, NY 108010000	
Contact country:		ROCHELLE, NT 100010000	
Contact country:	US	005 7444	
Contact telephone:	• •	235-7114	
Telephone ext.:	9999		
Contact email:		eported	
EPA Region:	02		
Classification: Description:	Hanc mont or ge	Conditionally Exempt Small Quantity Generator Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar	
		h, and accumulates at any time: 1 kg or less of acutely hazardous	
		e; or 100 kg or less of any residue or contaminated soil, waste or	
		debris resulting from the cleanup of a spill, into or on any	
		or water, of acutely hazardous waste; or generates 100 kg or less	
		y residue or contaminated soil, waste or other debris resulting	
		the cleanup of a spill, into or on any land or water, of acutely	
		rdous waste during any calendar month, and accumulates at any	
		1 kg or less of acutely hazardous waste; or 100 kg or less of	
		esidue or contaminated soil, waste or other debris resulting from	
		leanup of a spill, into or on any land or water, of acutely	
	haza	rdous waste	
Handler Activities Summary:			
U.S. importer of hazardous v	vacta.	No	
Mixed waste (haz. and radio			
Recycler of hazardous waste	,	No	
Transporter of hazardous waste		No	
Treater, storer or disposer of		No	
Underground injection activit	.y.	No No	
On-site burner exemption:		No	
Furnace exemption:			
Used oil fuel burner:		No	
Used oil processor: User oil refiner:		No No	
Used oil fuel marketer to bur			
		No No	
Used oil Specification marke	ler.		
Used oil transfer facility:		No	
Used oil transporter:		No	
Historical Generators:			
Date form received by agend	.v·01/01	1/2006	
Site name:		S TURNER & CO INC.	
Classification:		I Quantity Generator	
Classification.	Sinai		
Date form received by agend	N/ 02/19	2/2005	
Site name:		S TURNER & CO INC.	
Classification:			
Classification.	Large	e Quantity Generator	
Date form received by agend	•		
Site name:		S TURNER & CO INC.	
Classification:	Large	e Quantity Generator	
Violation Status:	No vi	olations found	

Database(s)

EDR ID Number **EPA ID Number** 

### ERIC S TURNER & CO INC. (Continued)

NJ MANIFEST: EPA Id: Mail Address: Mail City/State/Zip: Facility Phone: Emergency Phone: Contact: Comments: SIC Code: County: 00 Municipal: 00 Previous EPA Id: Gen Flag: Х Trans Flag: TSDF Flag: Name Change: Date Change: Manifest: Manifest Number: EPA ID: Date Shipped: TSDF EPA ID: Transporter EPA ID: Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Transporter 6 EPA ID: Transporter 7 EPA ID: Transporter 8 EPA ID: Transporter 9 EPA ID: Transporter 10 EPA ID: Date Trans1 Transported Waste: Date Trans2 Transported Waste: Date Trans3 Transported Waste: Date Trans4 Transported Waste: Date Trans5 Transported Waste: Date Trans6 Transported Waste: Date Trans7 Transported Waste: Date Trans8 Transported Waste: Date Trans9 Transported Waste: Date Trans10 Transported Waste: Date TSDF Received Waste: **TSDF EPA Facility Name:** QTY Units: Transporter SEQ ID: Transporter-1 Date: Waste SEQ ID: Waste Type Code 2: Waste Type Code 3: Waste Type Code 4: Waste Type Code 5: Waste Type Code 6: Date Accepted: Manifest Discrepancy Type: Data Entry Number:

NYD002015402 Not reported Not reported 9142357114 Not reported NJA5224399 NYD002015402 12/06/2004 NJR000022442 NJR000023325 OHD009865825 Not reported 12/06/2004 12/07/2004 Not reported 12/08/2004 Not reported 01250521

Database(s)

EDR ID Number **EPA ID Number** 

Was Load Rejected:	No
Reason Load Was Rejected:	Not reported

#### NY MANIFEST:

Country: EPA ID: Facility Status: Location Address 1: ΒP Code: Location Address 2: Total Tanks: Location City: Location State: NY Location Zip: 10801 Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Mailing Country: USA Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: 2004 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: **Discr Residue Indicator:** Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported

USA NYD002015402 Not reported 33-35 CENTRE AVE Not reported Not reported NEW ROCHELLE Not reported NYD002015402 ERIC S TURNER & CO INC. W V TURNER PRESIDENT P. O. BOX 816 Not reported NEW ROCHELLE Not reported 9142357114 MAQ0630594 Not reported Not reported NJAF906B Not reported 12/06/2004 12/06/2004 Not reported 12/06/2004 Not reported Not reported NYD002015402 NJR000023325 Not reported MAD047075 Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D007 - CHROMIUM 5.0 MG/L TCLP Waste Code: Not reported Quantity: 00300 P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: L Landfill. Specific Gravity: 01.00 Document ID: NJA5224399 Manifest Status: Not reported seq: Not reported Year: 2004 Trans1 State ID: NJAF906B Trans2 State ID: 58746 Generator Ship Date: 12/06/2004 Trans1 Recv Date: 12/06/2004 Trans2 Recv Date: 12/07/2004 TSD Site Recy Date: 12/08/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD002015402 Generator EPA ID: Trans1 EPA ID: NJR000023325 Trans2 EPA ID: Not reported TSDF ID 1: NJR000022 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: R Material recovery of more than 75 percent of the total material.

Database(s)

EDR ID Number EPA ID Number

## ERIC S TURNER & CO INC. (Continued)

C S TURNER & CO INC. (Contin	ueu)
Specific Gravity:	01.00
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Quantity:	00275
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	005
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	01.00
Document ID:	NYC5591092
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	ILP39038
Trans2 State ID:	564TUH
Generator Ship Date:	06/16/1999
Trans1 Recv Date:	06/16/1999
Trans2 Recv Date:	06/18/1999
TSD Site Recy Date:	06/21/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD002015402
Trans1 EPA ID:	ILD984908202
Trans2 EPA ID:	SCD987574647
TSDF ID 1:	NYD000708198
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP
Waste Code:	Not reported
Quantity:	00004
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
Document ID:	NJA2870118
Manifest Status:	Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### ERIC S TURNER & CO INC. (Continued)

seq:

Year:

Quantity:

Quantity:

Units:

seq: Year:

Units:

01 1998 Trans1 State ID: 50163 Trans2 State ID: Not reported 09/16/1998 Generator Ship Date: Trans1 Recv Date: 09/16/1998 Trans2 Recv Date: Not reported TSD Site Recy Date: 09/25/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD002015402 Trans1 EPA ID: NJR000023325 Trans2 EPA ID: Not reported TSDF ID 1: NJR000022442 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported 00055 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 01.00 D002 - NON-LISTED CORROSIVE WASTES Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported 00440 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 008 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 01.00 Document ID: NYB7375383 Manifest Status: Κ Not reported 1995 Trans1 State ID: GE9561 Trans2 State ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Generator Ship Date: 11/13/1995 Trans1 Recv Date: 11/13/1995 Trans2 Recv Date: 11 TSD Site Recv Date: 11/13/1995 Part A Recv Date: 11/27/1995 Part B Recv Date: 12/11/1995 Generator EPA ID: NYD002015402 Trans1 EPA ID: NYD981182769 Trans2 EPA ID: Not reported TSDF ID 1: NYD981182769 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Quantity: 00165 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 003 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Document ID: PAE1357226 Manifest Status: С seq: Not reported Year: 1994 Trans1 State ID: PAAH0317 Trans2 State ID: Not reported Generator Ship Date: 12/12/1994 Trans1 Recv Date: 12/12/1994 Trans2 Recv Date: 11 TSD Site Recv Date: 12/14/1994 Part A Recv Date: 11 Part B Recv Date: 01/03/1995 Generator EPA ID: NYD002015402 Trans1 EPA ID: PAD982661381 Trans2 EPA ID: Not reported TSDF ID 1: PAD085690592 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported

Database(s)

EDR ID Number EPA ID Number

## ERIC S TURNER & CO INC. (Continued)

	laca)
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code: Waste Code:	
Waste Code: Waste Code:	Not reported
	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Document ID:	DAE0192102
Manifest Status:	PAE0182103 K
seq:	Not reported
Year: Trans1 State ID:	1993 DAALI0247
Trans2 State ID:	PAAH0317
	Not reported
Generator Ship Date:	09/02/1993
Trans1 Recv Date:	09/02/1993
Trans2 Recv Date:	/ /
TSD Site Recv Date:	09/10/1993
Part A Recv Date:	10/15/1993
Part B Recv Date:	10/04/1993
Generator EPA ID:	NYD002015402
Trans1 EPA ID:	PAD982661381
Trans2 EPA ID:	Not reported
TSDF ID 1:	PAD085690592
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: **Discr Quantity Indicator:** Discr Type Indicator: **Discr Residue Indicator:** Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code:

Not reported Not reported Not reported Not reported D007 - CHROMIUM 5.0 MG/L TCLP Not reported Not reported Not reported Not reported Not reported 00225 G - Gallons (liquids only)\* (8.3 pounds) 004 DM - Metal drums, barrels T Chemical, physical, or biological treatment. 100 D007 - CHROMIUM 5.0 MG/L TCLP Not reported Not reported Not reported Not reported 00155 G - Gallons (liquids only)\* (8.3 pounds) 003 DM - Metal drums, barrels T Chemical, physical, or biological treatment. 100 PAC0336453 С Not reported 1992 PAAH0278 Not reported 07/22/1992 07/22/1992 11 07/23/1992 08/05/1992 07/30/1992 NYD002015402 NJD000813477 Not reported PAD087561015 Not reported Not reported

Not reported

Not reported

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Quantity: 00550 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 010 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 02900 Units: P - Pounds Number of Containers: 004 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 NYB2551311 Document ID: Manifest Status: Κ seq: Not reported Year: 1991 GX6293 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 10/10/1991 Trans1 Recv Date: 10/10/1991 Trans2 Recv Date: 11 TSD Site Recv Date: 10/11/1991 Part A Recv Date: 10/18/1991 Part B Recv Date: 11/06/1991 NYD002015402 Generator EPA ID: Trans1 EPA ID: NYD000691949 Trans2 EPA ID: Not reported TSDF ID 1: NYD000691949 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### ERIC S TURNER & CO INC. (Continued)

Units:

sea: Year:

Waste Code: Not reported Waste Code: Not reported 00800 Quantity: Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00165 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 003 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: NYB2109852 Manifest Status: Κ Not reported 1990 Trans1 State ID: GX6293 Trans2 State ID: Not reported Generator Ship Date: 04/30/1990 Trans1 Recv Date: 04/30/1990 Trans2 Recv Date: 11 TSD Site Recv Date: 05/07/1990 11/01/1990 Part A Recv Date: Part B Recv Date: 06/22/1990 Generator EPA ID: NYD002015402 Trans1 EPA ID: NYD000691949 Trans2 EPA ID: Not reported TSDF ID 1: NYD000691949 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D005 - BARIUM 100.0 MG/L TCLP Waste Code: Waste Code: Not reported 01500 Quantity: Units: P - Pounds

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code:

Waste Code:

002 DM - Metal drums, barrels L Landfill. 100 D002 - NON-LISTED CORROSIVE WASTES Not reported Not reported Not reported Not reported 00110 G - Gallons (liquids only)\* (8.3 pounds) 002 DM - Metal drums, barrels T Chemical, physical, or biological treatment. 100 D002 - NON-LISTED CORROSIVE WASTES Not reported Not reported Not reported Not reported 00055 G - Gallons (liquids only)\* (8.3 pounds) 001 DM - Metal drums, barrels T Chemical, physical, or biological treatment. 100 NYB2111013 Κ Not reported 1990 GX6293 Not reported 04/30/1990 04/30/1990 11 05/07/1990 11/01/1990 06/22/1990 NYD002015402 NYD000691949 Not reported NYD000691949 Not reported Not reported

#### D002 - NON-LISTED CORROSIVE WASTES

Database(s)

EDR ID Number EPA ID Number

## ERIC S TURNER & CO INC. (Continued)

Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00110
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	100
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	
Waste Code:	Not reported
	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	00600
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Document ID:	NYA7204554
Manifest Status:	C
seq:	Not reported
Year:	1989
Trans1 State ID:	00000000
Trans2 State ID:	00000000
Generator Ship Date:	03/29/1989
Trans1 Recv Date:	03/29/1989
Trans2 Recv Date:	/ /
TSD Site Recv Date:	03/29/1989
Part A Recv Date:	04/04/1989
Part B Recv Date:	04/12/1989
Generator EPA ID:	NYD002015402
Trans1 EPA ID:	NYD000691949
Trans2 EPA ID:	Not reported
TSDF ID 1:	NYD000691949
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Waste Code:	Not reported

Database(s)

EDR ID Number EPA ID Number

C S TURNER & CO INC. (Continued)				
Waste Code:	Not reported			
Quantity:	00110			
Units:	G - Gallons (liquids only)* (8.3 pounds)			
Number of Containers:	002			
Container Type:	DM - Metal drums, barrels			
Handling Method:	T Chemical, physical, or biological treatment.			
Specific Gravity:	100			
opecine Oravity.				
Document ID:	NJA0009467			
Manifest Status:	К			
seq:	Not reported			
Year:	1985			
Trans1 State ID:	NJSWAS632			
Trans2 State ID:	Not reported			
Generator Ship Date:	02/28/1985			
Trans1 Recv Date:	02/28/1985			
Trans2 Recv Date:	//			
TSD Site Recv Date:	02/28/1985			
Part A Recv Date:	06/03/1985			
Part B Recv Date:	03/07/1985			
Generator EPA ID:	NYD002015402			
Trans1 EPA ID:	NJD048810279			
Trans2 EPA ID:	Not reported			
TSDF ID 1:	NJD048810279			
TSDF ID 2:	Not reported			
Manifest Tracking Number:	Not reported			
Import Indicator:	Not reported			
Export Indicator:	Not reported			
Discr Quantity Indicator:	Not reported			
Discr Type Indicator:	Not reported			
Discr Residue Indicator:	Not reported			
Discr Partial Reject Indicator:	Not reported			
Discr Full Reject Indicator:	Not reported			
Manifest Ref Number:	Not reported			
Alt Facility RCRA ID:	Not reported			
Alt Facility Sign Date:	Not reported			
MGMT Method Type Code:	Not reported			
Waste Code:	U226 - 1,1,1-TRICHLOROETHANE			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Quantity:	00050			
Units:	G - Gallons (liquids only)* (8.3 pounds)			
Number of Containers:	001			
Container Type:	DM - Metal drums, barrels			
Handling Method:	R Material recovery of more than 75 percent of the total material.			
Specific Gravity:	100			
Document ID:	NYO1552698			
Manifest Status:	К			
seq:	Not reported			
Year:	1984			
Trans1 State ID:	Not reported			
Trans2 State ID:	Not reported			
Generator Ship Date:	08/09/1984			

### ERIC S

Database(s)

EDR ID Number EPA ID Number

#### ERIC S TURNER & CO INC. (Continued)

Trans1 Recv Date: 08/09/1984 Trans2 Recv Date: 11 TSD Site Recv Date: 08/09/1984 Part A Recv Date: 08/30/1984 Part B Recv Date: 09/05/1984 Generator EPA ID: NYD002015402 Trans1 EPA ID: NJD048810279 Trans2 EPA ID: Not reported TSDF ID 1: NJD048810279 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: U226 - 1,1,1-TRICHLOROETHANE Waste Code: Not reported 00050 Quantity: G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Document ID: NYA1234098 Manifest Status: С seq: Not reported Year: 1984 Trans1 State ID: NJSWAS632 Trans2 State ID: Not reported Generator Ship Date: 10/11/1984 Trans1 Recv Date: 10/11/1984 Trans2 Recv Date: 11 TSD Site Recv Date: 10/11/1984 Part A Recv Date: 10/16/1984 Part B Recv Date: 10/19/1984 Generator EPA ID: NYD002015402 Trans1 EPA ID: NJD048810279 Trans2 EPA ID: Not reported TSDF ID 1: NJD048810279 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported

AH157

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

#### ERIC S TURNER & CO INC. (Continued)

Waste Code:

Waste Code:

Waste Code:

Waste Code: Waste Code:

Waste Code:

Container Type:

Handling Method:

Specific Gravity:

Quantity:

Units:

Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported U226 - 1,1,1-TRICHLOROETHANE Not reported Not reported Not reported Not reported Not reported 00050 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 DM - Metal drums, barrels T Chemical, physical, or biological treatment. 100

#### NNW 270 NORTH AVENUE - UNDERGROUND 1/8-1/4 NEW ROCHELLE, NY 10801 0.206 mi. 1088 ft. Site 1 of 6 in cluster AH WESTCHESTER CO. UST: **Relative:** 3-600117 / Active Id/Status: Lower Operator Name: North Brook Realty Associates Actual: **Owner Name:** 270 North Avenue Realty Corp. 80 ft. **Owner Street:** 270 North Avenue, Suite 200 Owner Address2: Not reported New Rochelle Owner City: **Owner State:** NY Owner Zipcode: 10801 GDS Number: Not reported Tank Number: 1 Status: 1. In-Service Capacity: 15000 Product Stored: 1. No. 2 fuel oil Product Stored Percent: Tank Leak Detection: 0. None

NORTH BROOK REALTY ASSOCIATES

Not reported Date Installation: 01/01/1969 Date Perm Closure: 01/01/1900 Tank Location: 5. Underground 1. Steel/Carbon steel/Iron Tank Type: Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating Tank Secondary Containment: 0. None Piping Location: 2. Underground/on Ground 1. Steel/Carbon/ Steel/Iron Piping Type: Piping External Protection: 1. Painted/Asphalt Coating **Overfill Prevention:** 5. Vent Whistle Piping Secondary Containment: Not reported Spill Prevention: Not reported Dispenser: 2. Suction

NY UST U003994769 N/A

#### 1007204937

TC4738280.2s Page 318

Database(s)

EDR ID Number EPA ID Number

AI158 WSW 1/8-1/4 0.208 mi.	VERIZON NEW YORK INC. (NY96332 342 HUGUENOT STREET NEW ROCHELLE, NY 10801	2)	NY UST NY AST	U003949914 N/A
1096 ft.	Site 1 of 3 in cluster Al			
Relative: Higher Actual: 95 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner City: Owner State: Owner Zipcode: GDS Number:	3-184586 / Active Verizon New York Inc. Verizon New York Inc. 140 West Street Not reported New York NY 10007 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	1 5. Closed - removed 5000 Not reported 0. None 01/01/1949 01/01/1990 Not reported 1. Steel/Carbon steel/Iron 0. None 0. None Not reported 0. No Pipiing 1. Steel/Carbon/ steel/iron 0. None 0. None 0. None 0. None 2. Suction		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	2 5. Closed - removed 5000 Not reported Not reported 0. None 01/01/1949 11/01/1997 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None Not reported 1. Aboveground 1. Steel/Carbon/ steel/iron 0. None Not reported Not reported Not reported Not reported Not reported Not reported 2. Suction		

Database(s)

EDR ID Number EPA ID Number

#### VERIZON NEW YORK INC. (NY96332) (Continued)

Tank Number: 3 5. Closed - removed Status: 5000 Capacity: Product Stored: 6. Diesel Product Stored Percent: Not reported Tank Leak Detection: 0. None 01/01/1949 Date Installation: Date Perm Closure: 11/01/1997 Tank Location: 5. Underground Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None 0. None Tank External Protection: Tank Secondary Containment: Not reported Piping Location: 1. Aboveground Piping Type: 1. Steel/Carbon/ steel/iron Piping External Protection: 0. None Overfill Prevention: Not reported Piping Secondary Containment: Not reported Spill Prevention: Not reported Dispenser: 2. Suction

Tank Number: 4 Status: 5. Closed - removed Capacity: 550 Product Stored: 6. Diesel Product Stored Percent: Not reported Tank Leak Detection: 0. None Date Installation: 01/01/1949 Date Perm Closure: 09/01/1997 Tank Location: Not reported Tank Type: 1. Steel/Carbon steel/Iron Tank Internal Protection: 0. None Tank External Protection: 1. Painted/Asphalt Coating Tank Secondary Containment: 1. Diking (aboveground only) 1. Aboveground Piping Location: Piping Type: 1. Steel/Carbon/ steel/iron Piping External Protection: 0. None 4. Product Level Gauge (Aboveground Only) **Overfill Prevention:** Piping Secondary Containment: Not reported Spill Prevention: Not reported 2. Suction Dispenser:

Tank Number: 6 1. In-Service Status: Capacity: 6000 Product Stored: 6. Diesel Product Stored Percent: Not reported Tank Leak Detection: 1. Electronic Interstitial Monitoring 11/01/1997 Date Installation: Date Perm Closure: 01/01/1900 Tank Location: 5. Underground Tank Type: 6. Fiberglass reinforced plastic (FRP) Tank Internal Protection: 0. None Tank External Protection: 6. Fiberglass Tank Secondary Containment: 4. Double-Walled (underground only)

## U003949914

Database(s)

EDR ID Number EPA ID Number

U003949914

/ERIZON NEW YORK INC. (NY96332	2) (Continued)
Piping Location:	2. Underground/on Ground
Piping Type:	99. Other
Piping External Protection:	99. Other
Overfill Prevention:	2. High Level Alarm
Piping Secondary Containment:	4. Double-Walled (underground only)
Spill Prevention:	1. Catch Basin
Dispenser:	2. Suction
WESTCHESTER CO. AST:	
PBS Number:	3-184586
Site Status:	Active
GDS Number:	Not reported
Operator Name:	Verizon New York Inc.
Owner Name:	Verizon New York Inc.
Owner Street:	140 West Street
Owner Address2:	Not reported
Owner City/State/Zip:	New York, NY 10007
Tank Number:	5
Status:	1. In-Service
Date Installation:	09/01/1997
Capacity:	300
Product Stored:	6. Diesel
Product Stored Percent:	Not reported
Date Perm Closure:	01/01/1900
Tank Location:	<ol><li>Aboveground on saddles, legs, stilts, racks or cradle</li></ol>
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	0. None
Tank External Protection:	1. Painted/Asphalt Coating
Tank Leak Detection:	1. Electronic Interstitial Monitoring
Tank Secondary Containment:	1. Diking (aboveground only)
Piping Location:	1. Aboveground
Piping Type:	1. Steel/Carbon/ Steel/Iron
Piping External Protection:	0. None
Piping Leak Detection:	0. None
Piping Secondary Containment:	
Overfill Prevention:	3. Automatic Shut-off
Spill Prevention:	0. None
Dispenser:	2. Suction

NYD986961605

NEW YORK, NY 10001 CATHERINE ROM

NEW YORK, NY 10001

NINTH AVE

NINTH AVE

AI159 WSW 1/8-1/4 0.208 mi.	NEW YORK TELEPHONE CO 342 HUGUENOT ST NEW ROCHELLE, NY 10801	
1096 ft.	Site 2 of 3 in cluster Al	
Relative: Higher	RCRA NonGen / NLR: Date form received by agenc	y:01/01/2007
U	Facility name:	NEW YORK TELEPHONE CO
Actual: 95 ft.	Facility address:	342 HUGUENOT ST NEW ROCHELLE, NY 10801

EPA ID: Mailing address: Contact: Contact address:

#### RCRA NonGen / NLR 1000553730 NY MANIFEST NYD986961605

Database(s)

EDR ID Number **EPA ID Number** 

#### **NEW YORK TELEPHONE CO (Continued)** 1000553730 Contact country: US (212) 502-7694 Contact telephone: Not reported Contact email: EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste Owner/Operator Summary: Owner/operator name: NEW YORK TELEPHONE CO Owner/operator address: 342 HUGUENOT ST NEW ROCHELLE, NY 10801 Owner/operator country: US Owner/operator telephone: (914) 632-9964 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported NEW YORK TELEPHONE CO Owner/operator name: Owner/operator address: 342 HUGUENOT ST NEW ROCHELLE, NY 10801 Owner/operator country: US Owner/operator telephone: (914) 632-9964 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No Historical Generators: Date form received by agency: 01/01/2006 NEW YORK TELEPHONE CO Site name: Classification: Not a generator, verified Date form received by agency: 07/02/1991 NEW YORK TELEPHONE CO Site name: Classification: Small Quantity Generator Waste code: X003 OTHER STATE REGULATED WASTES [i.e., DIESEL FUEL, GASOLINE AND HOME Waste name:

EDR ID Number Database(s)

EW YORK TELEPHONE CO (Co	ntinued)
	HEATING OIL]
Violation Status:	No violations found
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location City: Location Zip: Location Zip:	USA NYD986961605 Not reported 342 HUGANAUGHT STREET BP Not reported Not reported WESTCHESTER NY Not reported
Location Zip 4:	Not reported
NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYD986961605 TELESECTOR RESOURCES GROUP WAYNE SEBRO 441 9TH AVENUE 5TH FLOOR Not reported NEW YORK NY 10001 Not reported USA 2125027694
NY MANIFEST:	
Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans1 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator:	ILA7651009 K Not reported 1997 1478 2075 10/23/1997 10/23/1997 10/23/1997 10/23/1997 10/29/1997 11/26/1997 11/26/1997 NYD986961605 MAD039322250 NJD00813477 ILD000608471 Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Discr Guanny Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID:	Not reported Not reported Not reported Not reported Not reported Not reported

EPA ID Number

Database(s)

EDR ID Number EPA ID Number

#### **NEW YORK TELEPHONE CO (Continued)**

Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00200 Units: P - Pounds Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 D001 - NON-LISTED IGNITABLE WASTES Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00030 Units: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: MAH2671330 Manifest Status: Κ seq: Not reported Year: 1993 Trans1 State ID: MA970642 Trans2 State ID: Not reported Generator Ship Date: 11/23/1993 Trans1 Recv Date: 11/23/1993 Trans2 Recv Date: 11 TSD Site Recv Date: 11/24/1993 Part A Recv Date: 11 Part B Recv Date: 12/20/1993 NYD986961605 Generator EPA ID: Trans1 EPA ID: MAD039322250 Not reported Trans2 EPA ID: TSDF ID 1: MAD980523203 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D009 - MERCURY 0.2 MG/L TCLP Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **NEW YORK TELEPHONE CO (Continued)**

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00004 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 MAF3478760 Document ID: Manifest Status: С Not reported seq: Year: 1991 Trans1 State ID: 50C143OH Trans2 State ID: 50C143OH Generator Ship Date: 07/11/1991 Trans1 Recv Date: 07/11/1991 Trans2 Recv Date: 07/12/1991 TSD Site Recv Date: 07/15/1991 Part A Recv Date: 07/26/1991 Part B Recv Date: 07/26/1991 Generator EPA ID: NYD986961605 Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MAD039322250 TSDF ID 1: MAD053452637 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported B005 - PCB ARTICLES WITH 500 PPM OR > PCB Waste Code: Waste Code: Not reported Quantity: 00364 Units: K - Kilograms (2.2 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100

Database(s)

EDR ID Number EPA ID Number

160 North 1/8-1/4 0.210 mi. 1109 ft.	TRUMP PLAZA 175 HUGUENOT STREET NEW ROCHELLE, NY		NY LTANKS NY Spills	S107522540 N/A
Relative: Lower Actual: 89 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Remo: Remarks:	2006-01-29 Tank Failure Unknown Known release that creates potential for fire or hazard. (High Improbable) Not reported False 6010 TDGHIOSA Not reported 2006-01-30 407 Not reported Other Not reported False False False 0 : 2006-01-30		
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	358910 1116137 01 2106280 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported		

Database(s)

EDR ID Number EPA ID Number

## TRUMP PLAZA (Continued)

S107522540

SPILLS:	0540000
Facility ID:	0510932
Facility Type:	ER
DER Facility ID:	307023
Site ID:	356986
DEC Region:	3
Spill Date:	2005-12-19
Spill Number/Closed Date:	0510932 / 2005-12-19
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	JBODee
Referred To:	WCDOH
Reported to Dept:	2005-12-19
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Health Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2005-12-19
Spill Record Last Update:	2006-03-08
Spiller Name:	SEAN MCKAY
Spiller Company:	TRUMP PLAZA
Spiller Address:	175 HUEGOTNOT STREET
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	SEAN MCKAY
Contact Phone:	(646) 772-6987
DEC Memo:	"CONFIRMED CLEANUP WITH WCDOH 3/8/06 See spill JM Associates closure
	report for 05-04821"
Remarks:	"SPILL AROUND GENERATOR AND IN PROCESS OF BEING CLEANED UP;"
Material:	
Site ID:	356986
Operable Unit ID:	1114275
Operable Unit:	01
Material ID:	2104355
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	2.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
raint root.	
Facility ID:	0504821

Database(s) EPA ID

EDR ID Number EPA ID Number

#### TRUMP PLAZA (Continued)

Facility Type: ER **DER Facility ID:** 307023 349739 Site ID: DEC Region: 3 Spill Date: 2005-07-20 Spill Number/Closed Date: 0504821 / 2006-03-08 Spill Cause: Other Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 JBODee Investigator: Referred To: WCDOH 2005-07-21 Reported to Dept: CID: 444 Water Affected: Not reported Spill Source: Institutional, Educational, Gov., Other Spill Notifier: Other **Cleanup Ceased:** Not reported Cleanup Meets Std: False Not reported Last Inspection: **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2005-07-21 Spill Record Last Update: 2006-03-08 Spiller Name: JOHN MANFREDIE Spiller Company: **NEW ROCHELLE #1A** Spiller Address: HUGIGNOT /LAACONTA Spiller City, St, Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: JOHN MANFREDIE Contact Phone: (914) 241-3795 DEC Memo: "3/02/06 UST removal report submitted by JM Associates including information about two other spill reports listed for the same parcel, 05-10932 and 05-12575. A total of 5 UST's were removed along with 3,351.05 tons of petroleum impacted soil. Based on the information contained in the report, no further action is required. TG" Remarks: "DURING EXCAVATION FOUND AN ABANDON TANK: AND FOUND CONTAMINATED SOIL" Not reported Material: 349739 Site ID: **Operable Unit ID:** 1107327 **Operable Unit:** 01 Material ID: 2097217 Material Code: 0001A #2 fuel oil Material Name: Case No .: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate:

Tank Test:

AJ161 SSW 1/8-1/4 0.210 mi.	CON EDISON SERVICE BOX: 331 LEROY PL & CENTER AVE NEW ROCHELLE, NY 10802	3 RCRA NonGen / NLR 1016973761 NY MANIFEST NYP004475687
1110 ft.	Site 1 of 3 in cluster AJ	
Relative: Higher	RCRA NonGen / NLR: Date form received by agency Facility name:	:04/22/2014 CON EDISON SERVICE BOX: 3313
Actual: 101 ft.	Facility address:	LEROY PL & CENTER AVE NEW ROCHELLE, NY 10802
	EPA ID: Mailing address:	NYP004475687 IRVING PL, 15TH FL NE
	Contact:	NEW YORK, NY 10003 THOMAS TEELING
	Contact address:	Not reported
	Contact country:	Not reported
	Contact country: Contact telephone:	Not reported (212) 460-3770
	Contact email:	Not reported
	EPA Region:	02
	Classification:	Non-Generator
	Description:	Handler: Non-Generators do not presently generate hazardous waste
	Handler Activities Summary:	
	U.S. importer of hazardous wa	
	Mixed waste (haz. and radioad	
	Recycler of hazardous waste:	No to: No
	Transporter of hazardous was Treater, storer or disposer of H	
	Underground injection activity:	
	On-site burner exemption:	No
	Furnace exemption:	No
	Used oil fuel burner:	No
	Used oil processor:	No
	User oil refiner:	No
	Used oil fuel marketer to burne	
	Used oil Specification markete	
	Used oil transfer facility:	No
	Used oil transporter:	No
	Historical Generators:	
	Date form received by agency	
	Site name:	CON EDISON SERVICE BOX: 3313
	Classification:	Conditionally Exempt Small Quantity Generator
	Violation Status:	No violations found
	NY MANIFEST:	
	Country:	USA
	EPA ID:	NYP004475687
	Facility Status:	
	Location Address 1: Code:	SEC LEROY & CENTRE AVE BP
	Location Address 2:	SB3313
	Total Tanks:	Not reported
	Location City:	NEW ROCHELLE
	Location State:	NY
	Location Zip:	10801

Database(s)

EDR ID Number EPA ID Number

#### Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004475687 Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING ST Mailing Address 2: 15TH ST Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: Not reported NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2014 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/22/2014 Trans1 Recv Date: 03/22/2014 Not reported Trans2 Recv Date: TSD Site Recv Date: 03/25/2014 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004475687 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 012772784JJK Import Indicator: Ν Export Indicator: Ν

Ν

Ν

Ν

Ν

Ν

H110

10 P - Pounds

1

Not reported

TT - Cargo tank, tank trucks

T Chemical, physical, or biological treatment.

Discr Quantity Indicator:

Discr Residue Indicator:

Manifest Ref Number:

Alt Facility RCRA ID:

Alt Facility Sign Date:

Number of Containers: Container Type:

Handling Method:

Specific Gravity:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Quantity:

Units:

**Discr Partial Reject Indicator:** 

Discr Full Reject Indicator:

MGMT Method Type Code:

**Discr Type Indicator:** 

#### CON EDISON SERVICE BOX: 3313 (Continued)

1016973761

Database(s)

	CON EDISON SERVICE BOX: 3313 (Continued)			1016973761
	Waste Code: Waste Code 1_2: Waste Code 1_3: Waste Code 1_4:	D008 Not reported Not reported Not reported		
	Waste Code 1_5: Waste Code 1_6:	Not reported Not reported		
AJ162 SSW 1/8-1/4 0.210 mi.	CON EDISON SERVICE BOX: 331 CENTRE AVE & LEROY NEW ROCHELLE, NY 10801	3	RCRA NonGen / NLR FINDS	1017773973 NYP004517694
1110 ft.	Site 2 of 3 in cluster AJ			
Relative: Higher	RCRA NonGen / NLR: Date form received by agency	r: 05/30/2014		
-	Facility name:	CON EDISON SERVICE BOX: 3313		
Actual: 101 ft.	Facility address:	CENTRE AVE & LEROY NEW ROCHELLE, NY 10801		
	EPA ID:	NYP004517694		
	Mailing address:	IRVING PL, 15TH FL NE		
	Contact:	NEW YORK, NY 10003 THOMAS TEELING		
	Contact address:	Not reported		
		Not reported		
	Contact country:	Not reported		
	Contact telephone: Contact email:	(212) 460-3770 Not reported		
	EPA Region:	02		
	Classification:	Non-Generator		
	Description:	Handler: Non-Generators do not presently	y generate hazardous waste	
	Handlor Activition Summary			
	Handler Activities Summary: U.S. importer of hazardous wa	aste: No		
	Mixed waste (haz. and radioa			
	Recycler of hazardous waste:			
	Transporter of hazardous was	te: No		
	Treater, storer or disposer of			
	Underground injection activity			
	On-site burner exemption: Furnace exemption:	No No		
	Used oil fuel burner:	No		
	Used oil processor:	No		
	User oil refiner:	No		
	Used oil fuel marketer to burn			
	Used oil Specification markete Used oil transfer facility:	er: No No		
	Used oil transporter:	No		
	Historical Generators:			
	Date form received by agency	:04/30/2014		
	Site name:	CON EDISON		
	Classification:	Large Quantity Generator		
	Date form received by agency	r:04/30/2014		
	Site name:	CON EDISON		
	Classification:	Not a generator, verified		

Trans2 Recv Date:

TSD Site Recv Date:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON SERVICE BOX: 3313 (Continued) 1017773973 Violation Status: No violations found FINDS: Registry ID: 110063800506 Environmental Interest/Information System RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. AJ163 **CON EDISON** NY MANIFEST S117059593 SSW **CENTRE AVE & LEROY** N/A 1/8-1/4 NEW ROCHELLE, NY 10801 0.210 mi. 1110 ft. Site 3 of 3 in cluster AJ NY MANIFEST: **Relative:** Country: USA Higher NYP004517694 EPA ID: Actual: Facility Status: Not reported 101 ft. Location Address 1: C/O CENTRE AVE & LEROY PL Code: BP Location Address 2: Not reported Total Tanks: Not reported Location City: NEW ROCHELLE Location State: NY Location Zip: 10802 Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004517694 Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PL Mailing Address 2: 15TH FL Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: Not reported NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2014 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 04/30/2014 Trans1 Recv Date: 04/30/2014

Not reported

05/01/2014

Database(s)

EDR ID Number **EPA ID Number** 

#### **CON EDISON (Continued)**

Trans1 EPA ID:

Trans2 EPA ID:

Import Indicator:

Export Indicator:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Waste Code:

Container Type:

Waste Code:

Quantity:

Units:

TSDF ID 1:

TSDF ID 2:

Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYP004517694 Not reported Not reported NJD002200046 Not reported Manifest Tracking Number: 012772797JJK Ν Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Not reported Not reported Not reported Not reported Not reported Not reported 100 P - Pounds Number of Containers: 1 TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Not reported Waste Code 1\_5: Waste Code 1\_6: Not reported

#### AH164 EAST RIVER SAVINGS BANK NNW 277 NORTH AVE. 1/8-1/4 **NEW ROCHELLE, NY** 0.214 mi. 1128 ft. Site 2 of 6 in cluster AH LTANKS: Relative: 271129 Site ID: Lower

	Spill Number/Closed Date:	8912285 / 1991-01-16
Actual:	Spill Date:	1990-03-26
81 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Not reported
	Cleanup Ceased:	1953-06-18
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	WXWADSWO
	Referred To:	Not reported
	Reported to Dept:	1990-03-27

NY LTANKS U003647446 N/A

Database(s)

AST RIVER SAVINGS BANK	(Continued) U003647446
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	: 1990-03-29
	1991-03-19
Spiller Name:	Not reported
, Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	220684
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	WADSWORTH 03/19/91: TANK WAS REKINED AND PASSED RETEST. 09/27/95:
	This is additional information about material spilled from the
	translation of the old spill file: TANK TEST."
Remarks:	"TANK WAS ISOLATED AND THEY WILL RETEST PETRO-TITE3385 GPH"
A - 1	
Material:	0744.00
Site ID:	271129
Operable Unit ID:	937979
Operable Unit:	01
Material ID:	441756
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	271129
Spill Tank Test:	1536885
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
mounicu Dy.	Opino
	Not reported
Last Modified: Test Method:	Not reported Unknown

Database(s)

AH165 NNW 1/8-1/4 0.214 mi.	277 NORTH LLC 277 NORTH AVENUE NEW ROCHELLE, NY 10801		NY UST	U003994270 N/A
1128 ft.	Site 3 of 6 in cluster AH			
1128 ft. Relative: Lower Actual: 81 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner Zipcode: GDS Number: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention:	3-502049 / Active Bruce J. Moses Robert J. Leaf 3720 South Ocean Blvd #1606 Highland Beach FL 33487 Not reported 1 5. Closed - removed 10000 Not reported Not reported 4. Groundwater Well 01/01/1900 10/10/2007 5. Underground 1. Steel/Carbon steel/Iron 0. None 0. None 2. Underground/on ground 1. Steel/Carbon/steel/iron 0. None 2. Underground/on ground 1. Steel/Carbon/steel/iron 0. None 5. Vent Whistle		
	Piping Secondary Containment: Spill Prevention: Dispenser: Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	Not reported Not reported 2. Suction 2 1. In-Service 5000 1. No. 2 fuel oil Not reported 2. Manual Interstitial Monitoring 10/01/2007 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 0. None 7. Jacketed (tank),9. Urethane 4. Double-Walled (underground only) 2. Underground/on Ground 10. Flexible Piping 8. Wrapped (Piping),9. Urethane 5. Vent Whistle 4. Double-Walled (underground only) 1. Catch Basin 2. Suction		

MAP FINDINGS

Database(s)

Database(s)

EDR ID Number EPA ID Number

S108467526

#### **BUSINESS** (Continued)

Oxygenate:	Not reported
Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified:	376243 1550567 1 10000 03 .00 Not reported Watchdog Not reported Horner EZ Check I or II
Test Method:	HOME LZ CHECKTOLI

#### AH167 277 NORTH LLC

NNW 1/8-1/4 0.214 mi. 1128 ft.	277 NORTH AVENUE NEW ROCHELLE, NY Site 5 of 6 in cluster AH		N
1120 11.	Sile 5 01 6 In cluster An		
Relative: Lower	LTANKS: Site ID:	376329	
Actual:	Spill Number/Closed Date:		
81 ft.	Spill Date: Spill Cause:	2007-01-19 Tank Test Failure	
0110	•	Commercial/Industrial	
	Spill Source: Spill Class:		
	Spill Class.	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
	•	True	
	SWIS:	6010	
	Investigator:	jbodee	
	Referred To:	WCDOH	
	Reported to Dept:	2007-01-19	
	CID:	410	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	False	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:		
	Spiller Name:	BRUCE MOSES	
	Spiller Company:	277 NORTH LLC	
	Spiller Address:	277 NORTH AVE	
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10801	
	Spiller County:	001 BRUCE MOSES	
	Spiller Contact:		
	Spiller Phone: Spiller Extention:	(914) 712-0600 Not reported	
	DEC Region:	Not reported 3	
	DER Facility ID:	327408	
	DEC Memo:	"Two LUSTs removed. Also see spill 06-11580 12/4/08: Northeast	
	DEC Mento.	Environmental disposed of LUST and 356.79 tons of petroleum	

contaminated soil. Exit sample results were near or below TAGM

# NY LTANKS S108467546

N/A

AH168

1/8-1/4

0.214 mi. 1128 ft.

Relative: Lower

Actual: 81 ft.

NNW

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

#### 277 NORTH LLC (Continued)

#### S108467546

	levels. Based upon the information provided, this Department requires
	No Further Action at this time. jod"
Remarks:	"EZ 3 LP WAS TEST USED: TANK IS BEING VACCED OUT AND TEMP TANK PUT IN
	PLACE: ARRANGEMENTS FOR FURTHER TESTING ARE BEING MADE:"
Material:	
Site ID:	376329
Operable Unit ID:	1133914
Operable Unit:	01
Material ID:	2123743
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Fank Test:	
Site ID:	376329
Spill Tank Test:	1550579
Tank Number:	1
Tank Size:	10000
Test Method:	99
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Modified By: Last Modified:	Watchdog Not reported
-	
Last Modified:	Not reported Alternate Test per 613.5a2v
Last Modified: Test Method: N EDISON MANHOLE: 112	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384
Last Modified: Test Method: N EDISON MANHOLE: 112 NORTH AVE	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384
Last Modified: Test Method: N EDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 Pency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE W ROCHELLE, NY 10802 6 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE WROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported Not reported
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE WROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported Not reported Not reported Not reported
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE WROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported Not reported Not reported Not reported (914) 925-6219
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE WROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact email:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported Not reported Not reported Not reported
Last Modified: Test Method: NEDISON MANHOLE: 112 NORTH AVE WROCHELLE, NY 10802 6 of 6 in cluster AH RCRA NonGen / NLR: Date form received by ag Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone:	Not reported Alternate Test per 613.5a2v 295 RCRA NonGen / NLR 1016960384 NY MANIFEST NYP0043234 ency: 07/28/2013 CON EDISON MANHOLE: 11295 277 NORTH AVE NEW ROCHELLE, NY 10802 NYP004323457 IRVING PL, RM 828 NEW YORK, NY 10003 GINO FRABASILE Not reported Not reported Not reported Not reported Not reported Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON MANHOLE: 11295 (Continued)

Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No Historical Generators: Date form received by agency: 06/28/2013 Site name: CON EDISON MANHOLE: 11295 Classification: Conditionally Exempt Small Quantity Generator Violation Status: No violations found NY MANIFEST: Country: USA EPA ID: NYP004323457 Facility Status: Not reported Location Address 1: FO 277 NORTH AVE ΒP Code: Location Address 2: MH #11295 Total Tanks: Not reported NEW ROCHELLE Location City: Location State: NY 10805 Location Zip: Location Zip 4: Not reported NY MANIFEST: NYP004323457 EPAID: Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2013 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported

#### 1016960384

Database(s)

EDR ID Number **EPA ID Number** 

Generator Ship Date: 06/28/2013 Trans1 Recv Date: 06/28/2013 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/03/2013 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004323457 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 011693229JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 200 P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported

AI169	HUGUENOT HOLDINGS, LLC
WSW	347 HUGUENOT STREET
1/8-1/4	NEW ROCHELLE, NY 10801
0.218 mi.	
1152 ft.	Site 3 of 3 in cluster Al
Relative:	WESTCHESTER CO. AST:

Units:

Higher	PBS Number:	3-502626
-	Site Status:	Active
Actual:	GDS Number:	Not reported
94 ft.	Operator Name:	Owen Henry (Super)
	Owner Name:	Huguenot Holdings, LLC
	Owner Street:	1333 A North Avenue
	Owner Address2:	#419
	Owner City/State/Zip:	New Rochelle, NY 10583

NY AST A100359858 N/A

Database(s)

EDR ID Number EPA ID Number

## HUGUENOT HOLDINGS, LLC (Continued)

A100359858

Tank Number:	1
Status:	1. In-Service
Date Installation:	06/01/1995
Capacity:	2500
Product Stored:	1. No. 2 fuel oil
Product Stored Percent:	Not reported
Date Perm Closure:	01/01/1900
Tank Location:	<ol><li>Aboveground (contact w/ impervious barrier)</li></ol>
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	0. None
Tank External Protection:	0. None
Tank Leak Detection:	0. None
Tank Secondary Containment:	3. Vault (w/ no access)
Piping Location:	1. Aboveground
Piping Type:	1. Steel/Carbon/ steel/iron
Piping External Protection:	0. None
Piping Leak Detection:	0. None
Piping Secondary Containment:	0. None
Overfill Prevention:	4. Product Level Gauge (Aboveground Only), 5. Vent Whistle
Spill Prevention:	0. None
Dispenser:	2. Suction

#### 170 CHURCH OF LATTER DAY SAIN 111 NORTH AVE SE 1/8-1/4 NEW ROCHELLE, NY

0.222 mi.

1171 ft.

#### **Relative:** Lo

NY LTANKS \$106471932 N/A

Relative:	LTANKS:	
Lower	Site ID:	266466
	Spill Number/Closed Date:	0403126 / 2004-09-21
Actual:	Spill Date:	2004-06-22
83 ft.	Spill Cause:	Tank Failure
	Spill Source:	Institutional, Educational, Gov., Other
	Spill Class:	Known release that creates a file or hazard. (Highly Improbable)
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	jbodee
	Referred To:	Not reported
	Reported to Dept:	2004-06-22
	CID:	444
	Water Affected:	Not reported
	Spill Notifier:	Other
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spiller Name:	MATT SCHIEFERSTEIN
	Spiller Company:	CHURCH OF LATTER DAY SAIN
	Spiller Address:	111 NORTH AVE
	Spiller City,St,Zip:	NEW ROCHELLE, NY
	Spiller County:	001
	Spiller Contact:	MATT SCHIEFERSTEIN
	Spiller Phone:	(631) 351-3555
	Spiller Extention:	Not reported

Map ID Direction Distance	ų_	MAP FINDINGS		EDR ID Numbe
levation	Site		Database(s)	EPA ID Numbe
	CHURCH OF LATTER DAY SA	NN (Continued)		S106471932
	DEC Region:	3		
	DER Facility ID: DEC Memo:	217081 "Prior to Sept, 2004 data translation this spill Lead_DEC Fiel	dwas	
	Remarks:	O'DEE 06/23/04 APPROXIMATELY 200 TONS OF CONTAI CLOSURE REPORT TO FOLLOW. jbo 09/21/04 ANSON EN OF LUST AND 168.02 TONS OF CONTAMINATED SOIL. B SUBMITTED TO DEC, NO FURTHER ACTION IS REQUIRE "WHILE DIGGING A FOUNDATION FOUND A TANK: CONT	MINATED SOIL IVIRONMENTA ASED UPON IN ED AT THIS TIM	L DISPOSED IFORMATION IE. jbo"
	Material:			
	Site ID:	266466		
	Operable Unit ID:	885085		
	Operable Unit: Material ID:	01 490726		
	Material Code:	0001A		
	Material Name:	#2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	.00		
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
AK171 ESE	60-70 OWNERS CORP. 60-70 LOCUST AVENUE		NY UST	U003949313 N/A
/8-1/4 ).222 mi.	NEW ROCHELLE, NY 10801			
171 ft.	Site 1 of 2 in cluster AK			
Relative: .ower	WESTCHESTER CO. UST: Id/Status:	3-413925 / Active		
	Operator Name:	Jim Williams		
Actual:	Owner Name:	60-70 Owners Corp.		
3 ft.	Owner Street:	60-70 Locust Avenue		
	Owner Address2:	Not reported		
	Owner City:	New Rochelle		
	Owner State:	NY		
	Owner Zipcode: GDS Number:	10801 Not reported		
	Tank Number: Status:	1 1. In-Service		
	Capacity:	8000		
	Product Stored:	4. No. 6 fuel oil		
	Product Stored Percent:	Not reported		
	Tank Leak Detection:	0. None		
	Date Installation:	01/01/1954		
	Date Perm Closure:	01/01/1900		
	Tank Location:	5. Underground		
	Tank Type:	1. Steel/Carbon steel/Iron		
	Tank Internal Protection:	0. None		
	Tank External Protection:	1. Painted/Asphalt Coating		

1. Painted/Asphalt Coating

Tank External Protection:1. PainteTank Secondary Containment:0. None

Database(s)

EDR ID Number EPA ID Number

U003949313

## 60-70 OWNERS CORP. (Continued)

#### AK172 **APARTMENT BUILDING**

ESE	67-70 LOCUST AVE
1/8-1/4	NEW ROCHELLE, NY
0.222 mi.	

#### Site 2 of 2 in cluster AK

Relative:	
Lower	

1171 ft.

NY LTANKS S110611357 N/A

LTANKS:	
Site ID:	441682
Spill Number/Closed Date:	1008207 / 2011-03-10
Spill Date:	2010-11-04
Spill Cause:	Tank Test Failure
Spill Source:	Private Dwelling
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	6010
Investigator:	JKOMARA
Referred To:	Not reported
Reported to Dept:	2010-11-04
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
,	False
	False
	0
Date Entered In Computer:	2010-11-04
	Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reforted to Dept: CID: Water Affected: Spill Notifier:

Database(s)

EDR ID Number EPA ID Number

#### S110611357

APARTMENT BUILDING (Continued)		
Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	2011-03-10 ABRAHAM WATHCELL UNKNOWN 67- 70 LOCUST AVE NEW ROCHELLE, NY 999 ABRAHAM WATHCELL (718) 731-7011 Not reported 3 396710 "Left message for callback. DT 11/4/10 11/5/10: Call back from Abraham Wathcell of NY Tank Testing to dispatch desk. This was a test failure of an 8K heating oil tank at a co-op. PBS #3-413925 will handled by WCDOH. Mr Wathcell stated he had discussed the results with the management compny and was recommending removal of the tank rather than retest. jod 3/10/11 As per WCDOH eplaced fill pipe, manway gasket and repaired gauge. Passed retest on 2/14/11. NFA JO'M " Not reported	
Remarks:	иот геропеа ""	
Material:		
Site ID:	441682	
Operable Unit ID:	1192229	
Operable Unit:	01	
Material ID:	2187465	
Material Code:	0003A	
Material Name:	#6 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	441682	
Spill Tank Test:	2489743	
Tank Number:	1	
Tank Size:	8000	
Test Method:	21	
Leak Rate:	Not reported	
Gross Fail:	Not reported	
Modified By:	jbodee	
Last Modified:	Not reported	
Test Method:	Horner EZY3/EZY3 Locator Plus	

Database(s)

173 East 1/8-1/4 0.226 mi. 1192 ft.	MORAN PROPERTY 44 FRANKLIN AVENUE NEW ROCHELLE, NY 10801		NY UST	U004225397 N/A
Relative: Lower Actual: 67 ft.	WESTCHESTER CO. UST: Id/Status: Operator Name: Owner Name: Owner Street: Owner Address2: Owner City: Owner State: Owner Zipcode: GDS Number:	3-801962 / Unregulated Michael Moran Moran Property 44 Franklin Avenue Not reported New Rochelle NY 10801 Not reported		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Secondary Containment: Piping Location: Piping Type: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	001 5. Closed - removed 3500 2. No. 4 fuel oil Not reported 0. None 01/01/1960 06/16/2014 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating 0. None 2. Underground/on Ground 1. Steel/Carbon/ Steel/Iron 0. None 0. None 0. None 0. None 2. Suction		
	Tank Number: Status: Capacity: Product Stored: Product Stored Percent: Tank Leak Detection: Date Installation: Date Perm Closure: Tank Location: Tank Location: Tank Type: Tank Internal Protection: Tank Secondary Containment: Piping Location: Piping External Protection: Overfill Prevention: Piping Secondary Containment: Spill Prevention: Dispenser:	002 5. Closed - removed 1000 1. No. 2 fuel oil Not reported 0. None 01/01/1960 01/01/1900 5. Underground 1. Steel/Carbon steel/Iron 0. None 1. Painted/Asphalt Coating 0. None 2. Underground/on Ground 9. Copper 0. None 0. None 0. None 0. None 2. Suction		

Database(s)

AL174 SSW 1/8-1/4 0.229 mi. 1210 ft.	125 CENTRE AVE NEW ROCHELLE, NY Site 1 of 2 in cluster AL	NY LTANKS S104621592 N/A
Relative: Higher Actual: 100 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Conty: Spiller Conty: Spiller Contox: Spiller Phone: Spiller Extention: DEC Region: DEC Memo: Remarks:	2000-05-12 Tank Overfill Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2000-05-12 196 Not reported Fire Department Not reported False False 0 : 2000-05-12
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	205498 823753 01 290047 0001A #2 fuel oil Not reported Petroleum 10.00 Gallons 10.00 Not reported Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

	125 (Continued)		S104621592
	Tank Test:		
AM175 NE 1/8-1/4 0.229 mi.	CON EDISON HARRISON ST & MAIN ST NEW ROCHELLE, NY 10801	NY MANIFEST	S117739533 N/A
1211 ft.	Site 1 of 7 in cluster AM		
Relative: Lower Actual:	NY MANIFEST: Country: EPA ID: Facility Status:	USA NYP004726550 Not reported	
73 ft.	Location Address 1: Code: Location Address 2: Total Tanks:	W/S HARRISON ST & MAIN ST BP VS155 Not reported	
	Location City: Location State: Location Zip: Location Zip 4:	NEW ROCHELLE NY 11801 Not reported	
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004726550 CON EDISON CON EDISON 4 IRVING PL 15TH FL NEW YORK NY 10003 Not reported USA Not reported	
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator:	Not reported Not reported 2015 NYD006982359 Not reported 02/05/2015 02/05/2015 Not reported 02/11/2015 Not reported Not reported Not reported NyP004726550 Not reported NyP004726550 Not reported NyD002200046 Not reported 012774734JJK N	

Discr Quantity Indicator:

Ν

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 300 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 02/05/2015 02/05/2015 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 02/11/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004726550 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 012774734JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported

#### S117739533

Database(s)

EDR ID Number **EPA ID Number** 

S117739533

#### **CON EDISON (Continued)**

Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: **Discr Full Reject Indicator:** Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: TT - Cargo tank, tank trucks

Not reported
Not reported
300
P - Pounds
TT - Cargo tank, tank trucks
T Chemical, physical, or biological treatment.
1
D008
Not reported
Not reported
Not reported
Not reported
Not reported
Not served a
Not reported
Not reported
Not reported
2015
NYD006982359
Not reported
02/05/2015
02/05/2015
Not reported
•
02/11/2015
Not reported
Not reported
NYP004726550
Not reported
Not reported
NJD002200046
Not reported
012774734JJK
N
N
N
N
N
N
N
Not reported
Not reported
Not reported
H110
Not reported
Not reported
Not reported
Not reported
Not reported
Not reported
300
P - Pounds
1
TT - Cargo tank tank trucks

TC4738280.2s Page 349

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON (Continued)			S117739533
	Handling Method: Specific Gravity: Waste Code: Waste Code 1_2: Waste Code 1_3: Waste Code 1_4:	T Chemical, physical, or biological treatmer 1 D008 Not reported Not reported Not reported	ıt.	
	Waste Code 1_5: Waste Code 1_6:	Not reported Not reported		
AM176 NE 1/8-1/4 0.229 mi.	CON EDISON HARRISON ST & MAIN ST NEW ROCHELLE, NY 10801		RCRA NonGen / NLR	1018277911 NYP004726550
1211 ft.	Site 2 of 7 in cluster AM RCRA NonGen / NLR:			
Relative: Lower	Date form received by agency: Facility name:	02/05/2015 CON EDISON		
Actual: 73 ft.		HARRISON ST & MAIN ST NEW ROCHELLE, NY 10801		
	EPA ID:	NYP004726550		
	Mailing address:	IRVING PL, 15TH FL NE NEW YORK, NY 10003		
	Contact:	THOMAS TEELING		
	Contact address:	Not reported Not reported		
	Contact country:	Not reported		
	Contact telephone:	(212) 460-3770		
	Contact email: EPA Region:	Not reported 02		
	Classification:	Non-Generator		
	Description:	Handler: Non-Generators do not presently gen	erate hazardous waste	
	Handler Activities Summary: U.S. importer of hazardous wa	ste: No		
	Mixed waste (haz. and radioac			
	Recycler of hazardous waste:	No e: No		
	Transporter of hazardous wast Treater, storer or disposer of H			
	Underground injection activity:	No		
	On-site burner exemption: Furnace exemption:	No No		
	Used oil fuel burner:	No		
	Used oil processor:	No		
	User oil refiner: Used oil fuel marketer to burne	No r: No		
	Used oil Specification markete			
	Used oil transfer facility: Used oil transporter:	No No		
	Historical Generators: Date form received by agency:	02/05/2015		
		CON EDISON		
	Classification:	Small Quantity Generator		
	Violation Status:	No violations found		

Database(s)

AM177 NE	CON EDISON MANHOLE: 8002 MAIN ST & HARRISON ST	RCRA NonGen / NLR 1016960612 NY MANIFEST NYP004326658
1/8-1/4	NEW ROCHELLE, NY 10801	
0.229 mi. 1211 ft.	Site 3 of 7 in cluster AM	
Relative:	RCRA NonGen / NLR:	
Lower	Date form received by agency	/:08/09/2013
A	Facility name:	CON EDISON MANHOLE: 8002
Actual: 73 ft.	Facility address:	MAIN ST & HARRISON ST
7010	EPA ID:	NEW ROCHELLE, NY 10801 NYP004326658
	Mailing address:	IRVING PL, RM 828
		NEW YORK, NY 10003
	Contact:	DOMINIC BIZZARO
	Contact address:	Not reported
		Not reported
	Contact country:	Not reported
	Contact telephone:	(914) 925-6219
	Contact email: EPA Region:	Not reported 02
	Classification:	Non-Generator
	Description:	Handler: Non-Generators do not presently generate hazardous waste
	·	
	Handler Activities Summary:	
	U.S. importer of hazardous w	
	Mixed waste (haz. and radioa	,
	Recycler of hazardous waste:	
	Transporter of hazardous was Treater, storer or disposer of	
	Underground injection activity	
	On-site burner exemption:	No
	Furnace exemption:	No
	Used oil fuel burner:	No
	Used oil processor:	No
	User oil refiner:	No
	Used oil fuel marketer to burn Used oil Specification market	
	Used oil transfer facility:	No
	Used oil transporter:	No
	Historical Generators:	
	Date form received by agency	
	Site name: Classification:	CON EDISON MANHOLE: 8002 Conditionally Exempt Small Quantity Generator
	Classification.	
	Violation Status:	No violations found
	NY MANIFEST:	
	Country:	USA
	EPA ID: Excility Status:	NYP004326658
	Facility Status: Location Address 1:	Not reported MAIN ST & HARRISON ST
	Code:	BP
	Location Address 2:	MH #8002
	Total Tanks:	Not reported
	Location City:	NEW ROCHELLE
	Location State:	NY
	Location Zip:	10801

EDR ID Number Database(s) EPA ID Number

#### CON EDISON MANHOLE: 8002 (Continued)

Location Zip 4: Not reported NY MANIFEST: EPAID: NYP004326658 Mailing Name: CON EDISON Mailing Contact: CON EDISON Mailing Address 1: 4 IRVING PLACE 15TH FLOOR Mailing Address 2: Not reported Mailing City: NEW YORK Mailing State: NY Mailing Zip: 10003 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 2124603770 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported 2013 Year: Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 07/09/2013 Trans1 Recv Date: 07/09/2013 Trans2 Recv Date: Not reported 07/10/2013 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004326658 Generator EPA ID: Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 011695971JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν **Discr Type Indicator:** Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 400 P - Pounds Units: Number of Containers: Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1

### 1016960612

Database(s)

	CON EDISON MANHOLE: 8002 (0	Continued)	1016960612
	Waste Code:	D008	
	Waste Code 1_2:	Not reported	
	Waste Code 1_2. Waste Code 1_3:	Not reported	
	Waste Code 1_3. Waste Code 1_4:	Not reported	
	Waste Code 1_4. Waste Code 1_5:	Not reported	
	Waste Code 1_5: Waste Code 1_6:	Not reported	
		Not reported	
AN178 WSW	CON EDISON TRANSFORMER M/ CENTRE AVE & RELYEA PL	ANHOLE: 4319 RCRA NonGen / NLR NY MANIFEST	1016965006 NYP004379020
1/8-1/4 0.230 mi.	NEW ROCHELLE, NY 10802		
1212 ft.	Site 1 of 2 in cluster AN		
Relative:	RCRA NonGen / NLR:		
Lower	Date form received by agency		
• • •	Facility name:	CON EDISON TRANSFORMER MANHOLE: 4319	
Actual: 88 ft.	Facility address:	CENTRE AVE & RELYEA PL NEW ROCHELLE, NY 10802	
	EPA ID:	NYP004379020	
	Mailing address:	IRVING PL, 15TH FL NE NEW YORK, NY 10003	
	Contact:	THOMAS TEELING	
	Contact address:	Not reported	
		Not reported	
	Contact country:	Not reported	
	Contact telephone:	(212) 460-3770	
	Contact email:	Not reported	
	EPA Region:	02	
	Classification:	Non-Generator	
	Description:	Handler: Non-Generators do not presently generate hazardous waste	
	Handler Activities Summary:		
	U.S. importer of hazardous wa	iste: No	
	Mixed waste (haz. and radioad	ctive): No	
	Recycler of hazardous waste:	No	
	Transporter of hazardous was		
	Treater, storer or disposer of H		
	Underground injection activity:		
	On-site burner exemption:	No	
	Furnace exemption:	No	
	Used oil fuel burner:	No	
	Used oil processor: User oil refiner:	No	
	User oil refiner: Used oil fuel marketer to burn	No er: No	
	Used oil Specification markete		
	Used oil transfer facility:	No	
	Used oil transporter:	No	
	Listorias Constant		
	Historical Generators: Date form received by agency	10/22/2012	
	Site name:	CON EDISON TRANSFORMER MANHOLE: 4319	
	Classification:	Conditionally Exempt Small Quantity Generator	
	Violation Status:	No violations found	
	NY MANIFEST:		

Database(s)

EDR ID Number EPA ID Number

## CON EDISON TRANSFORMER MANHOLE: 4319 (Continued)

Country: USA EPA ID: Facility Status: Location Address 1: Code: BΡ Location Address 2: Total Tanks: Location City: Location State: NY Location Zip: 10801 Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: NY Mailing Zip: Mailing Zip 4: Mailing Country: USA Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: 2013 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported

NYP004379020 Not reported CENTRE AVE & RELYEA PL SB4314 Not reported NEW ROCHELLE Not reported NYP004379020 CON EDISON CON EDISON **4 IRVING PLACE** 15TH FL NEW YORK 10003 Not reported Not reported Not reported Not reported Not reported NYD006982359 Not reported 10/23/2013 10/23/2013 Not reported 10/29/2013 Not reported Not reported NYP004379020 Not reported Not reported NJD002200046 Not reported 011693664JJK

#### 1016965006

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON TRANSFORMER	MANHOLE: 4319 (Continued)		1016965006
	Waste Code:	Not reported		
	Waste Code:	Not reported		
	Waste Code: Waste Code:	Not reported Not reported		
	Quantity:	300		
	Units:	P - Pounds		
	Number of Containers:	1		
	Container Type:	TT - Cargo tank, tank trucks		
	Handling Method:	T Chemical, physical, or biological treatment.		
	Specific Gravity: Waste Code:	1 D008		
	Waste Code 1 2:	Not reported		
	Waste Code 1_3:	Not reported		
	Waste Code 1_4:	Not reported		
	Waste Code 1_5:	Not reported		
	Waste Code 1_6:	Not reported		
AN179 WSW 1/8-1/4	CON EDISON TRANSFORMER CENTRE AVE & RELYEA PL NEW ROCHELLE, NY 10801		onGen / NLR Y MANIFEST	1016963532 NYP004365318
0.230 mi.				
1212 ft.	Site 2 of 2 in cluster AN			
Relative:	RCRA NonGen / NLR:			
Lower	Date form received by agen			
Actual:	Facility name:	CON EDISON TRANSFORMER MANHOLE: 4319		
88 ft.	Facility address:	CENTRE AVE & RELYEA PL NEW ROCHELLE, NY 10801		
	EPA ID:	NYP004365318		
	Mailing address:	IRVING PL, 15TH FL NE		
		NEW YORK, NY 10003		
	Contact:	THOMAS TEELING		
	Contact: Contact address:	THOMAS TEELING Not reported		
	Contact address:	THOMAS TEELING Not reported Not reported		
	Contact address: Contact country:	THOMAS TEELING Not reported Not reported Not reported		
	Contact address:	THOMAS TEELING Not reported Not reported		
	Contact address: Contact country: Contact telephone: Contact email: EPA Region:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02		
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator		
	Contact address: Contact country: Contact telephone: Contact email: EPA Region:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous w	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No of HW: No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast Transporter of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No of HW: No ity: No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast Transporter of hazardous wast Transporter of hazardous wast On-site burner exemption:	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No of HW: No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast Transporter of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No of HW: No ity: No No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No re: No aste: No of HW: No ity: No No No No No No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No pactive): No te: No aste: No of HW: No ity: No No No No No No No	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast Transporter of hazardous wast Treater, storer or disposer o Underground injection activi On-site burner exemption: Furnace exemption: Used oil fuel burner: Used oil processor: User oil refiner: Used oil fuel marketer to bu	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No bactive): No ite: No aste: No of HW: No ity: No No No No No No No No No No No No No N	lous waste	
	Contact address: Contact country: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary: U.S. importer of hazardous Mixed waste (haz. and radio Recycler of hazardous wast Transporter of hazardous wast	THOMAS TEELING Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazard waste: No bactive): No ite: No aste: No of HW: No ity: No No No No No No No No No No No No No N	lous waste	

EDR ID Number Database(s) EPA ID Number

Used oil transporter:	No	
Historical Generators:		
Date form received by agence	N: 00/2//2013	
Site name:	CON EDISON TRANSFORMER MANHOLE: 4319	
Classification:		
Classification.	Conditionally Exempt Small Quantity Generator	
Violation Status:	No violations found	
NY MANIFEST:		
Country:	USA	
EPA ID:	NYP004365318	
Facility Status:	Not reported	
Location Address 1:	CENTRE AVE & RELYEA PL	
Code:	BP	
Location Address 2:	TM 4319	
Total Tanks:	Not reported	
Location City:	NEW ROCHELLE	
Location State:	NY	
Location Zip:	Not reported	
Location Zip 4:	Not reported	
NY MANIFEST:		
EPAID:	NYP004365318	
Mailing Name:	CON EDISON	
Mailing Contact:	CON EDISON	
Mailing Address 1:	4 IRVING PL 15TH FL	
0		
Mailing Address 2:	Not reported	
Mailing City:	NEW YORK	
Mailing State:	NY	
Mailing Zip:	10003	
Mailing Zip 4:	Not reported	
Mailing Country:	USA	
Mailing Phone:	2124603770	
NY MANIFEST:		
Document ID:	Not reported	
Manifest Status:	Not reported	
seq:	Not reported	
Year:	2013	
Trans1 State ID:	NYD006982359	
Trans2 State ID:	Not reported	
Generator Ship Date:	09/24/2013	
Trans1 Recv Date:	09/24/2013	
Trans2 Recv Date:	Not reported	
TSD Site Recv Date:	09/26/2013	
Part A Recv Date:	Not reported	
Part B Recv Date:	Not reported	
Generator EPA ID:	NYP004365318	
Trans1 EPA ID:	Not reported	
Trans2 EPA ID:	Not reported	
TSDF ID 1:	NJD002200046	
TSDF ID 2:	Not reported	
Manifest Tracking Number:	011694707JJK	
Import Indicator:	N	
Export Indicator:	N	
Discr Quantity Indicator:	N	
DISCEQUARINY INDICATOR	IN	

Piping Location:

#### MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

1016963532

#### CON EDISON TRANSFORMER MANHOLE: 4319 (Continued)

#### AM180 **1 HARRISON REALTY, LLC** NE **1 HARRISON STREET** 1/8-1/4 NEW ROCHELLE, NY 10801 0.233 mi. 1230 ft. Site 4 of 7 in cluster AM WESTCHESTER CO. AST: **Relative:** 3-191922 PBS Number: Lower Site Status: Active Actual: GDS Number: Not reported 72 ft. Operator Name: Luis Hernandez Owner Name: 1 Harrison Realty, LLC **Owner Street:** 1919 Williamsbridge Road Owner Address2: Not reported Owner City/State/Zip: Bronx, NY 10461 Tank Number: 12 Status: 1. In-Service Date Installation: 05/01/1935 5000 Capacity: Product Stored: 1. No. 2 fuel oil Product Stored Percent: Not reported Date Perm Closure: 01/01/1900 3. Aboveground on saddles, legs, stilts, racks or cradle Tank Location: 1. Steel/Carbon steel/Iron Tank Type: Tank Internal Protection: 0. None Tank External Protection: 7. Jacketed (tank) Tank Leak Detection: other Tank Secondary Containment: 0. None

3. Aboveground/Underground Combination

#### NY AST U004187310 N/A

Database(s)

EDR ID Number EPA ID Number

1 HARRISON REALTY, LLC (Contin	ued)	U004187310
Piping Type: Piping External Protection: Piping Leak Detection: Piping Secondary Containment: Overfill Prevention: Spill Prevention: Dispenser:	<ol> <li>Steel/Carbon/ Steel/Iron</li> <li>None</li> <li>None</li> <li>None</li> <li>Product Level Gauge (Aboveground Only)</li> <li>None</li> <li>Suction</li> </ol>	
Tank Number: Status: Date Installation: Capacity: Product Stored: Product Stored Percent: Date Perm Closure: Tank Location: Tank Type: Tank Internal Protection: Tank External Protection: Tank Leak Detection: Tank Secondary Containment: Piping Type: Piping External Protection: Piping Leak Detection: Piping Leak Detection: Piping Secondary Containment: Overfill Prevention: Spill Prevention:	cleaners 1. In-Service 01/01/1936 275 1. No. 2 fuel oil 0 01/01/1900 3. Aboveground on saddles,legs,stilts,racks or cradle 1. Steel/Carbon steel/Iron 0. None 7. Jacketed (tank) other 0. None 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 0. None 3. Aboveground/Underground Combination 1. Steel/Carbon/ Steel/Iron 0. None 0. None 0. None 4. Product Level Gauge (Aboveground Only),5. Vent Whistle 0. None 2. Suction	

## AM181 CITY OF NEW ROCHELLE FIRE

NE	1 HARRISON STREET
1/8-1/4	NEW ROCHELLE, NY
0.233 mi.	

#### 1230 ft. Site 5 of 7 in cluster AM

Spill Number/Closed Date: 0201696 / 2002-09-18	
Actual: Spill Date: 2002-05-15	
72 ft. Spill Cause: Tank Test Failure	
Spill Source: Institutional, Educational, Gov., Other	
Spill Class: Known release with minimal potential for fire or hazard. DEC Response	se.
Willing Responsible Party. Corrective action taken.	
Cleanup Ceased: Not reported	
Cleanup Meets Standard: True	
SWIS: 6010	
Investigator: WCHD	
Referred To: Westchester Cnty Health Dept	
Reported to Dept: 2002-05-15	
CID: 282	
Water Affected: Not reported	
Spill Notifier: Tank Tester	
Last Inspection: Not reported	
Recommended Penalty: False	
UST Involvement: False	
Remediation Phase: 0	

NY LTANKS S105995871

N/A

Database(s)

EDR ID Number EPA ID Number

# S105995871

CITY OF NEW ROCHELLE FIRE (Continued)		
Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:		
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	75380 854864 01 523106 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported	
Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	75380 1527133 1 5000 03 .00 Not reported Spills Not reported Horner EZ Check I or II	

# AL182CENTRE AVENUE APARTMENTSSSW130 CENTRE AVENUE1/8-1/4NEW ROCHELLE, NY 108050.235 mi.

#### 1242 ft. Site 2 of 2 in cluster AL

Relative:	WESTCHESTER CO. AST:	
Higher	PBS Number:	3-165735
•	Site Status:	Active
Actual:	GDS Number:	Not reported
101 ft.	Operator Name:	Lorraine Quezada
	Owner Name:	130 Centre Avenue Co-op Corp.
	Owner Street:	1601 Bronxdale Avenue
	Owner Address2:	Suite 201

NY AST A100204222 N/A

Database(s)

EDR ID Number EPA ID Number

A100204222

#### **CENTRE AVENUE APARTMENTS (Continued)**

Owner City/State/Zip:	Bronx, NY 10462
Tank Number:	1
Status:	1. In-Service
Date Installation:	11/11/1959
Capacity:	4000
Product Stored:	2. No. 4 fuel oil
Product Stored Percent:	0
Date Perm Closure:	01/01/1900
Tank Location:	<ol><li>Aboveground (contact w/ impervious barrier)</li></ol>
Tank Type:	1. Steel/Carbon steel/Iron
Tank Internal Protection:	0. None
Tank External Protection:	0. None
Tank Leak Detection:	0. None
Tank Secondary Containment:	2. Vault (w/ access)
Piping Location:	1. Aboveground
Piping Type:	1. Steel/Carbon/ steel/iron
Piping External Protection:	8. Wrapped (Piping)
Piping Leak Detection:	0. None
Piping Secondary Containment:	2. Vault (w/ access)
Overfill Prevention:	5. Vent Whistle
Spill Prevention:	0. None
Dispenser:	0. None

#### AO183 **FIRST METRO SERVICES** RCRA NonGen / NLR 1004759815 WSW 357 HUGONOT ST FINDS NYR000022053 1/8-1/4 NEW ROCHELLE, NY 10805 ECHO 0.236 mi. 1246 ft. Site 1 of 2 in cluster AO RCRA NonGen / NLR: **Relative:** Date form received by agency: 01/01/2007 Lower Facility name: FIRST METRO SERVICES Actual: Facility address: 357 HUGONOT ST 92 ft. NEW ROCHELLE, NY 10805 EPA ID: NYR000022053 Mailing address: S DIVISION ST NEW ROCHELLE, NY 10805 BILL LIVANOS Contact: Contact address: S DIVISION ST NEW ROCHELLE, NY 10805 Contact country: US (914) 576-7210 Contact telephone: Contact email: Not reported EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste Owner/Operator Summary: Owner/operator name: LEO SATALICH Owner/operator address: 19 LYON PL NEW ROCHELLE, NY 10805 Owner/operator country: US Owner/operator telephone: (914) 632-9692 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported

Database(s)

EDR ID Number EPA ID Number

#### FIRST METRO SERVICES (Continued)

Owner/Op end date:	Not reported
Owner/operator name:	LEO SATALICH
Owner/operator address:	19 LYON PL
	NEW ROCHELLE, NY 10805
Owner/operator country:	US
Owner/operator telephone:	(914) 632-9692
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported
Handler Activities Summary:	

#### U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

#### Historical Generators:

Date form received by agency: 01/01/2006				
Site name:	FIRST METRO SERVICES			
Classification:	Not a generator, verified			

Date form received by agend	,
Site name:	FIRST METRO SERVICES
Classification:	Conditionally Exempt Small Quantity Generator
. Waste code:	D000
. Waste name:	Not Defined
. Waste name.	Not Denned

#### . Waste code: D006 . Waste name: CADMIUM

Violation Status:

#### FINDS:

#### Registry ID:

### 110004523882

No violations found

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

#### 1004759815

FIRST METRO SERVICES (Continued)

ECHO: Envid: MAP FINDINGS

1004759815

Database(s)

	Registry ID:	1004759815			
	DFR URL:	http://echo.epa.gov/detailed_facility_report?fid=110004523882			
	BIR ORE.		-110004323002		
AP184	CON EDISON		NY MANIFEST	S118089335	
NE	FOUNTAIN PL & HARRISON ST			N/A	
1/8-1/4	NEW ROCHELLE, NY				
0.238 mi.					
1257 ft.	Site 1 of 7 in cluster AP				
Relative:	NY MANIFEST:				
Lower	Country:	USA			
• • •	EPA ID:	NYP004769345			
Actual:	Facility Status:	Not reported			
75 ft.	Location Address 1:	FOUNTAIN PL & HARRISON ST			
	Code:	BP			
	Location Address 2:	MH 8008			
	Total Tanks:	Not reported			
	Location City:	NEW ROCHELLE			
	Location State:	NY			
	Location Zip:	Not reported			
	Location Zip 4:	Not reported			
	NY MANIFEST:				
	EPAID:	NYP004769345			
	Mailing Name:	CON EDISON			
	Mailing Contact:	DENNIS HUACON			
	Mailing Address 1:	4 IRVING PL 15TH FL			
	Mailing Address 2:	Not reported			
	Mailing City:	NEW YORK			
	Mailing State:	NY			
	Mailing Zip:	10003			
	Mailing Zip 4:	Not reported			
	Mailing Country:	USA			
	Mailing Phone:	2124603770			
	NY MANIFEST:				
	Document ID:	Not reported			
	Manifest Status:	Not reported			
	seq:	Not reported			
	Year:	2015			
	Trans1 State ID:	NJD003812047			
	Trans2 State ID:	NJD003812047			
	Generator Ship Date:	04/16/2015			
	Trans1 Recv Date:	04/16/2015			
	Trans2 Recv Date:	04/20/2015			
	TSD Site Recv Date:	04/20/2015			
	Part A Recv Date:	Not reported			
	Part B Recv Date:	Not reported			
	Generator EPA ID:	NYP004769345			
	Trans1 EPA ID:	Not reported			
	Trans2 EPA ID:	Not reported			
	TSDF ID 1:	NJD991291105			
	TSDF ID 2:	Not reported			
	Manifest Tracking Number:	002660843GBF			
	Import Indicator:	Ν			

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 500 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NJD003812047 Trans2 State ID: NJD003812047 Generator Ship Date: 04/16/2015 Trans1 Recv Date: 04/16/2015 Trans2 Recv Date: 04/20/2015 TSD Site Recv Date: 04/20/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004769345 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD991291105 TSDF ID 2: Not reported Manifest Tracking Number: 002660843GBF Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported

## Map ID Direction Distance Elevation Site

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### CON EDISON (Continued)

MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: 1 Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1 5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: P - Pounds

H110 Not reported Not reported Not reported Not reported Not reported Not reported 500 P - Pounds TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported 2015 NJD003812047 NJD003812047 04/16/2015 04/16/2015 04/20/2015 04/20/2015 Not reported Not reported NYP004769345 Not reported Not reported NJD991291105 Not reported 002660843GBF Ν Ν Ν Ν Ν Ν Ν Not reported Not reported Not reported H110 Not reported Not reported Not reported Not reported Not reported Not reported 500

#### Map ID Direction Distance Elevation Site

MAP FINDINGS

1

Database(s)

EDR ID Number **EPA ID Number** 

## CON EDISON (Continued)

Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

## TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported

AP185 NE 1/8-1/4 0.238 mi.	CON ED HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801		NY MANIFEST	S118088390 N/A
0.238 m. 1257 ft.	Site 2 of 7 in cluster AP			
Relative: Lower Actual: 75 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip:	USA NYP004759510 Not reported HARRISON ST & FOUNTAIN PL BP MH 8003 Not reported NEW ROCHELLE NY 10801		
	Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	Not reported NYP004759510 CON ED TOM TEELING 4 IRVING PLACE - 15TH FLOOR Not reported NEW YORK NY 10003 Not reported USA 2124603770		
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID:	Not reported Not reported 2015 NYD006982359 Not reported 03/28/2015 03/28/2015 Not reported 04/01/2015 Not reported Not reported Not reported Not reported Not reported NYP004759510		

## S118089335

TC4738280.2s Page 365

EDR ID Number Database(s) EPA ID Number

#### CON ED (Continued)

Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091122JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 200 Units: P - Pounds Number of Containers: Container Type: TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. Handling Method: Specific Gravity: 1 D008 Waste Code: Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/28/2015 Trans1 Recv Date: 03/28/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004759510 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 014091122JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν

Map ID Direction Distance Elevation Site

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Not reported Waste Code: Waste Code: Not reported Quantity: 200 Units: P - Pounds Number of Containers: Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 D008 Waste Code: Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Not reported Waste Code 1 4: Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/28/2015 Trans1 Recv Date: 03/28/2015 Trans2 Recv Date: Not reported 04/01/2015 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004759510 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091122JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported

Map ID Direction Distance Elevation Site

Database(s)

EDR ID Number EPA ID Number

## S118088390

## CON ED (Continued)

Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Not reported Not reported Not reported Not reported 200 P - Pounds 1 TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. 1 D008 Not reported Not reported Not reported Not reported Not reported

AP186 NE 1/8-1/4 0.238 mi.	CON EDISON FOUNTAIN PL & HARRISON ST NEW ROCHELLE, NY	
0.238 mi. 1257 ft.	Site 3 of 7 in cluster AP	
Relative: Lower Actual: 75 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004769477 Not reported FOUNTAIN PL & HARRISON ST BP SB 8007 Not reported NEW ROCHELLE NY Not reported Not reported
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004769477 CON EDISON DENNIS HUACON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770
	NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID:	Not reported Not reported 2015 NJD003812047 NJD003812047

Generator Ship Date:

04/16/2015

NY MANIFEST S118089345 N/A

Database(s)

EDR ID Number EPA ID Number

#### **CON EDISON (Continued)**

Trans1 Recv Date: 04/16/2015 Trans2 Recv Date: 04/20/2015 TSD Site Recv Date: 04/20/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004769477 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD991291105 TSDF ID 2: Not reported 002660844GBF Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 500 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NJD003812047 Trans2 State ID: NJD003812047 Generator Ship Date: 04/16/2015 Trans1 Recv Date: 04/16/2015 Trans2 Recv Date: 04/20/2015 TSD Site Recv Date: 04/20/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004769477 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD991291105

Database(s)

EDR ID Number EPA ID Number

## CON EDISON (Continued)

TSDF ID 2: Not reported 002660844GBF Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Not reported Alt Facility RCRA ID: Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 500 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1 3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NJD003812047 Trans2 State ID: NJD003812047 Generator Ship Date: 04/16/2015 Trans1 Recv Date: 04/16/2015 Trans2 Recv Date: 04/20/2015 TSD Site Recv Date: 04/20/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004769477 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD991291105 TSDF ID 2: Not reported Manifest Tracking Number: 002660844GBF Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν

Not reported

Database(s)

EDR ID Number

## CON EDISON (Continued)

Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6:

Document ID:

Not reported
Not reported
H110
Not reported
500
P - Pounds
1
TT - Cargo tank, tank trucks
T Chemical, physical, or biological treatment.
1
D008
Not reported

AP187 NE 1/8-1/4 0.238 mi. 1257 ft.	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 Site 4 of 7 in cluster AP		NY MANIFEST	S118088276 N/A
Relative: Lower Actual: 75 ft.	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYP004758272 Not reported HARRISON ST & FOUNTAIN PL BP SB 8044 Not reported NEW ROCHELLE NY 10802 Not reported		
	NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYP004758272 CON EDISON DENNIS HUACON 4 IRVING PL 15TH FL Not reported NEW YORK NY 10003 Not reported USA 2124603770		
	NY MANIFEST:	N		

Not reported

TC4738280.2s Page 371

EPA ID Number

Site

Database(s)

EDR ID Number EPA ID Number

S118088276

#### **CON EDISON (Continued)**

Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 03/26/2015 Trans1 Recv Date: 03/26/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/31/2015 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 50 Units: P - Pounds Number of Containers: 1 Container Type: Handling Method: Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 03/26/2015 Trans1 Recv Date: 03/26/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/31/2015

NYD006982359 NYP004758272 NJD002200046 014091128JJK TT - Cargo tank, tank trucks T Chemical, physical, or biological treatment. NYD006982359

# TC4738280.2s Page 372

Database(s)

EDR ID Number EPA ID Number

#### **CON EDISON (Continued)**

Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYP004758272 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091128JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 50 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Not reported Waste Code 1\_5: Not reported Waste Code 1 6: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported Generator Ship Date: 03/26/2015 Trans1 Recv Date: 03/26/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/31/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported NYP004758272 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091128JJK Import Indicator: Ν

CON EDISON (Continued)

Export Indicator:

Discr Quantity Indicator:

Ν

Ν

Database(s)

EDR ID Number EPA ID Number

	Discr Quantity Indicator:	Ν	
	Discr Type Indicator:	Ν	
	Discr Residue Indicator:	Ν	
	Discr Partial Reject Indicator:	Ν	
	Discr Full Reject Indicator:	Ν	
	Manifest Ref Number:	Not reported	
	Alt Facility RCRA ID:	Not reported	
	Alt Facility Sign Date:	Not reported	
	MGMT Method Type Code:	H110	
	Waste Code:		
		Not reported	
	Waste Code:	Not reported	
	Waste Code:	Not reported	
	Waste Code:	Not reported	
	Waste Code:	Not reported	
	Waste Code:	Not reported	
	Quantity:	50	
	Units:	P - Pounds	
	Number of Containers:	1	
	Container Type:	TT - Cargo tank, tank trucks	
	Handling Method:	T Chemical, physical, or biological treatment.	
	Specific Gravity:	1	
	Waste Code:	D008	
	Waste Code 1_2:	Not reported	
	Waste Code 1_2: Waste Code 1_3:		
	_	Not reported	
	Waste Code 1_4:	Not reported	
	Waste Code 1_5:	Not reported	
	Waste Code 1_6:	Not reported	
AP188 NE	CON EDISON	RCRA NonGen / NL	
1/8-1/4	HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801		NYP004758272
1/8-1/4 0.238 mi. 1257 ft.			NYP004758272
0.238 mi. 1257 ft.	NEW ROCHELLE, NY 10801		NYP004758272
0.238 mi. 1257 ft. Relative:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR:	:03/26/2015	NYP004758272
0.238 mi. 1257 ft.	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency		NYP004758272
0.238 mi. 1257 ft. Relative:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name:	CON EDISON	NYP004758272
0.238 mi. 1257 ft. Relative: Lower	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency	CON EDISON HARRISON ST & FOUNTAIN PL	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact: Contact address:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact country: Contact country: Contact telephone:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact clephone: Contact email:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact country: Contact telephone: Contact email: EPA Region:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact email: EPA Region: Classification:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact clephone: Contact email:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact telephone: Contact telephone: Contact email: EPA Region: Classification:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact address: Contact country: Contact country: Contact telephone: Contact email: EPA Region:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact country: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description: Handler Activities Summary:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste	NYP004758272
0.238 mi. 1257 ft. Relative: Lower Actual:	NEW ROCHELLE, NY 10801 Site 5 of 7 in cluster AP RCRA NonGen / NLR: Date form received by agency Facility name: Facility address: EPA ID: Mailing address: Contact: Contact country: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact telephone: Contact email: EPA Region: Classification: Description:	CON EDISON HARRISON ST & FOUNTAIN PL NEW ROCHELLE, NY 10801 NYP004758272 IRVING PL, 15TH FL NE NEW YORK, NY 10003 THOMAS TEELING Not reported Not reported Not reported (212) 460-3770 Not reported 02 Non-Generator Handler: Non-Generators do not presently generate hazardous waste	NYP004758272

Mixed waste (haz. and radioactive): No

S118088276

TC4738280.2s Page 374

Database(s)

EDR ID Number EPA ID Number

	CON EDISON (Continued)		1018280916
	Recycler of hazardous waste: Transporter of hazardous waste Treater, storer or disposer of H <sup>V</sup> Underground injection activity: On-site burner exemption:		
	Furnace exemption:	No	
	Used oil fuel burner:	No	
	Used oil processor: User oil refiner:	No	
	Used oil fuel marketer to burner	No r: No	
	Used oil Specification marketer		
	Used oil transfer facility:	No	
	Used oil transporter:	No	
	Historical Generators: Date form received by agency: Site name:	03/26/2015 CON EDISON	
		Small Quantity Generator	
	Violation Status:	No violations found	
AP189 NE 1/8-1/4 0.240 mi.	CON EDISON HARRISON ST & CEDER ST NEW ROCHELLE, NY 10801	RCRA NonGen / NLR	1018281062 NYP004759924
1266 ft.	Site 6 of 7 in cluster AP		
Relative:	RCRA NonGen / NLR:		
Lower	Date form received by agency:		
Actual:	5	CON EDISON HARRISON ST & CEDER ST	
75 ft.		NEW ROCHELLE, NY 10801	
		NYP004759924	
	0	RVING PL, 15TH FL NE	
		NEW YORK, NY 10003	
		THOMAS TEELING Not reported	
		Not reported	
		Not reported	
		(212) 460-3770	
		Not reported	
	0	02 Non-Generator	
		Handler: Non-Generators do not presently generate hazardous waste	
	Handler Activities Summary:	to. No	
	U.S. importer of hazardous was Mixed waste (haz. and radioact		
	Recycler of hazardous waste:	No	
	Transporter of hazardous waste	e: No	
	Treater, storer or disposer of H		
	Underground injection activity:	No	
	On-site burner exemption: Furnace exemption:	No No	
	Used oil fuel burner:	No	
	Used oil processor:	No	
	User oil refiner:	No	
	Used oil fuel marketer to burner	r: No	

Map ID		MAP FINDINGS		
Direction Distance Elevation	۲ Site		Database(s)	EDR ID Number EPA ID Number
	CON EDISON (Continued)			1018281062
	Used oil Specification mark Used oil transfer facility:	eter: No No		
	Used oil transporter:	No		
	Historical Generators:			
	Date form received by ager			
	Site name: Classification:	CON EDISON Small Quantity Generator		
	Violation Status:	No violations found		
AP190	CON ED		NY MANIFEST	S118088428
NE 1/8-1/4 0.240 mi.	HARRISON ST & CEDER ST NEW ROCHELLE, NY 10801		-	N/A
1266 ft.	Site 7 of 7 in cluster AP			
Relative:	NY MANIFEST:			
Lower	Country:	USA		
Actual:	EPA ID: Facility Status:	NYP004759924 Not reported		
75 ft.	Location Address 1:	HARRISON ST & CEDAR ST		
	Code:	BP		
	Location Address 2: Total Tanks:	MH 8003 Not reported		
	Location City:	NEW ROCHELLE		
	Location State:	NY		
	Location Zip:	10801 Not reported		
	Location Zip 4:	Not reported		
	NY MANIFEST: EPAID:	NYP004759924		
	Mailing Name:	CON ED		
	Mailing Contact:	TOM TEELING		
	Mailing Address 1:	4 IRVING PLACE - 15TH FLOOR		
	Mailing Address 2: Mailing City:	Not reported NEW YORK		
	Mailing State:	NY		
	Mailing Zip:	10003		
	Mailing Zip 4:	Not reported		
	Mailing Country: Mailing Phone:	USA 2124603770		
	NY MANIFEST:	Metazarata		
	Document ID: Manifest Status:	Not reported Not reported		
	seq:	Not reported		
	Year:	2015		
	Trans1 State ID:	NYD006982359		
	Trans2 State ID: Generator Ship Date:	Not reported 03/29/2015		
	Trans1 Recv Date:	03/29/2015		
	Trans2 Recv Date:	Not reported		
	TSD Site Recv Date:	04/01/2015 Not reported		
	Part A Recv Date: Part B Recv Date:	Not reported Not reported		
	Generator EPA ID:	NYP004759924		
	Trans1 EPA ID:	Not reported		

Database(s)

EDR ID Number EPA ID Number

#### CON ED (Continued)

Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091107JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 75 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1 6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2015 Trans1 State ID: NYD006982359 Trans2 State ID: Not reported 03/29/2015 Generator Ship Date: Trans1 Recv Date: 03/29/2015 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/01/2015 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYP004759924 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091107JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν

Database(s)

EDR ID Number EPA ID Number

### CON ED (Continued)

**Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Quantity: 75 Units: P - Pounds Number of Containers: 1 Container Type: TT - Cargo tank, tank trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1 Waste Code: D008 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2015 Trans1 State ID: NYD006982359 Not reported Trans2 State ID: Generator Ship Date: 03/29/2015 Trans1 Recv Date: 03/29/2015 Trans2 Recv Date: Not reported 04/01/2015 TSD Site Recv Date: Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYP004759924 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 014091107JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H110 Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
			()	
	CON ED (Continued)			S118088428
	Waste Code:	Not reported		5110000420
	Waste Code:	Not reported		
	Waste Code: Quantity:	Not reported 75		
	Units:	P - Pounds		
	Number of Containers: Container Type:	1 TT - Cargo tank, tank trucks		
	Handling Method:	T Chemical, physical, or biological treatment.		
	Specific Gravity: Waste Code:	1 D008		
	Waste Code 1_2:	Not reported		
	Waste Code 1_3: Waste Code 1 4:	Not reported Not reported		
	Waste Code 1_5:	Not reported		
	Waste Code 1_6:	Not reported		
				0400407450
AM191 NE	LUXOR VALET CLEANERS 389 MAIN ST.		NY Spills NY DRYCLEANERS	S106437153 N/A
1/8-1/4	NEW ROCHELLE, NY 10801			
0.244 mi. 1288 ft.	Site 6 of 7 in cluster AM			
Relative:	SPILLS:			
Lower	Facility ID: Facility Type:	9301198 ER		
Actual:	DER Facility ID:	166367		
71 ft.	Site ID: DEC Region:	199918 3		
	Spill Date:	1993-04-26		
	Spill Number/Closed Date:	9301198 / 1993-05-13		
	Spill Cause: Spill Class:	Unknown No spill occured. No DEC Response. No corrective	e action required.	
	SWIS:	6010	, action required.	
	Investigator: Referred To:	tdghiosa Not reported		
	Reported to Dept:	1993-04-26		
	CID:	Not reported		
	Water Affected: Spill Source:	Not reported Commercial/Industrial		
	Spill Notifier:	Affected Persons		
	Cleanup Ceased: Cleanup Meets Std:	1993-05-13 False		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Trust: Remediation Phase:	False 0		
	Date Entered In Computer:	1993-04-26		
	Spill Record Last Update: Spiller Name:	1993-05-13 Not reported		
	Spiller Company:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip: Spiller Company:	***Update***, ZZ 001		
	Contact Name:	Not reported		
	Contact Phone: DEC Memo:	Not reported "Prior to Sept, 2004 data translation this spill Lead	DEC Field was	
		GHIOSAY 05/03/93: INSPECTION- SMOKE FILLE		/INGROOM.

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	LUXOR VALET CLEANERS (Cor	ntinued)	S106437153
	Remarks:	RESTAURANT BENEATH BEDROOM HAD SIMILAR SMOKE AND ODD VENTILATION BY THE RESTAURANT. BILL SCHNEIDER OF WCHD N 09/27/95: This is additional information about material spilled from the translation of the old spill file: STRONG FUMES." "ONGOING ONE YEAR INTERMITTENT WOULD LIKE CALL BACK NO	IOTIFIED. NFA.
	Material:		
	Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	199918 979789 01 401921 0066A unknown petroleum Not reported Petroleum .00 Not reported .00 Not reported Not reported	
	Tank Test:		
	DRYCLEANERS: Facility ID: Phone Number: Region: Registration Effective Date: Inspection Date: Install Date: Drop Shop: Shutdown: Alternate Solvent: Current Business:	3-5510-00325 914-632-2479 Not reported 9/24/2003 13:22:51:203 07MAY23 86/99 Not reported Not reported Not reported Not reported Not reported	
AM192 NE 1/8-1/4 0.244 mi.	LUTOR VALET 389 MAIN ST NEW ROCHELLE, NY 10801	RCRA-CESQG FINDS NY MANIFEST ECHO	
1288 ft.	Site 7 of 7 in cluster AM		
Relative: Lower	RCRA-CESQG: Date form received by agenc Facility name:	y:01/01/2007 LUTOR VALET	
Actual: 71 ft.	Facility address: EPA ID: Mailing address:	389 MAIN ST NEW ROCHELLE, NY 10801 NYD072710296 MAIN ST	
	Contact: Contact address: Contact country:	NEW ROCHELLE, NY 10880 Not reported MAIN ST NEW ROCHELLE, NY 10880 US	
	Contact country: Contact telephone: Contact email: EPA Region:	Not reported Not reported 02	

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

LUTOR VALET (Continued)	
Land type: Classification: Description:	Facility is not located on Indian land. Additional information is not known. Conditionally Exempt Small Quantity Generator Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste
Owner/Operator Summary:	
Owner/operator name: Owner/operator address:	Not reported NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported
Owner/operator name:	Not reported
Owner/operator address:	NOT REQUIRED NOT REQUIRED, WY 99999
Owner/operator country:	US
Owner/operator telephone:	(212) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not reported
Owner/Op end date:	Not reported
Handler Activities Summary:	
U.S. importer of hazardous w	aste: No
Mixed waste (haz. and radioa	
Recycler of hazardous waste:	, No
Transporter of hazardous was	
Treater, storer or disposer of	HW: No
Underground injection activity	/: No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner: Used oil fuel marketer to burn	No No
Used oil Specification market Used oil transfer facility:	No
Used oil transporter:	No

Database(s)

EDR ID Number EPA ID Number

LUTOR VALET (Continued)		1000340703
Historical Generators: Date form received by agenc		
Site name: Classification:	LUTOR VALET Conditionally Exempt Small Quantity Generator	
Date form received by agenc	y:07/14/1999	
Site name:	LUTOR VALET	
Classification:	Small Quantity Generator	
Date form received by agenc		
Site name:	LUTOR VALET	
Classification:	Large Quantity Generator	
. Waste code:	F002	
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRA METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICH CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHA ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLEN USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LI F005; AND STILL BOTTOMS FROM THE RECOVERY OF THES SPENT SOLVENT MIXTURES.	HLOROETHANE, ANE, E, AND 1,1,2, IDS CONTAINING, BEFORE F ONE OR MORE OF THE ISTED IN F001, F004, AND
Violation Status:	No violations found	
Evaluation Action Summary: Evaluation date: Evaluation: Area of violation: Date achieved compliance:	02/27/2013 COMPLIANCE EVALUATION INSPECTION ON-SITE Not reported Not reported	
Evaluation lead agency:	State	
FINDS:		
Registry ID:	110004367453	
Conservati events and and treat, s program st	nation System is a national information system that supports the Resource on and Recovery Act (RCRA) program through the tracking of activities related to facilities that generate, transport, store, or dispose of hazardous waste. RCRAInfo allows RCRA aff to track the notification, permit, compliance, and action activities required under RCRA.	
NY MANIFEST:		
Country:	USA	
EPA ID:	NYD072710296	
Facility Status:	Not reported	
Location Address 1:	389 MAIN STREET	
Code:	BP	
Location Address 2: Total Tanks:	Not reported Not reported	
Location City:	NEW ROCHELLE	
Location State:	NY	

Database(s)

EDR ID Number **EPA ID Number** 

#### LUTOR VALET (Continued)

Location Zip: Location Zip 4: NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone: NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recy Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: 1 Container Type: Handling Method:

10801 Not reported NYD072710296 LUXOR VALET LUXOR VALET 389 MAIN STREET Not reported NEW ROCHELLE NY 10801 Not reported USA 9146322479 Not reported Not reported Not reported 2013 TXR000081205 Not reported 02/21/2013 02/21/2013 Not reported 03/01/2013 Not reported Not reported NYD072710296 Not reported Not reported RID084802842 Not reported 003766504SKS Not reported Not reported Not reported H020 Not reported Not reported Not reported Not reported Not reported Not reported 100 P - Pounds

DF - Fiberboard or plastic drums (glass)

R Material recovery of more than 75 percent of the total material.

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

Specific Gravity: 1 F002 Waste Code: Waste Code 1\_2: D007 Waste Code 1\_3: D039 Waste Code 1\_4: D040 Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2011 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 12/21/2011 Trans1 Recv Date: 12/21/2011 Trans2 Recv Date: Not reported TSD Site Recv Date: 12/30/2011 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: RID084802842 TSDF ID 2: Not reported Manifest Tracking Number: 003006479SKS Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported Quantity: 100.0 P - Pounds Units: Number of Containers: 1.0 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: F002 Waste Code 1 2: D007 Waste Code 1\_3: D029 Waste Code 1\_4: D039 Waste Code 1\_5: D040 Waste Code 1\_6: Not reported Document ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### LUTOR VALET (Continued)

Manifest Status: Not reported Not reported seq: Year: 2010 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 10/18/2010 Trans1 Recv Date: 10/18/2010 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/27/2010 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: RID084802842 TSDF ID 2: Not reported 004334861FLE Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported 120.0 Quantity: P - Pounds Units: Number of Containers: 1.0 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 D007 Waste Code: Waste Code 1\_2: D029 Waste Code 1\_3: D039 Waste Code 1\_4: D040 Waste Code 1\_5: F002 Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: OHR000110858 Generator Ship Date: 11/20/2009 Trans1 Recv Date: 11/20/2009 Trans2 Recv Date: 12/03/2009 TSD Site Recv Date: 12/04/2009

Database(s)

EDR ID Number EPA ID Number

#### LUTOR VALET (Continued)

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported OHD980587364 TSDF ID 1: TSDF ID 2: Not reported 002049656SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported Quantity: 150.0 P - Pounds Units: Number of Containers: 1.0 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: F002 Waste Code 1 2: D007 Waste Code 1\_3: D029 Waste Code 1\_4: D039 D040 Waste Code 1\_5: Waste Code 1 6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629976 Generator Ship Date: 02/26/2009 Trans1 Recv Date: 02/26/2009 Trans2 Recv Date: 03/06/2009 TSD Site Recv Date: 03/09/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD072710296 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: 001781619SKS Import Indicator: Ν

LUTOR VALET (Continued)

TSD Site Recv Date:

Part A Recv Date:

Part B Recv Date:

Generator EPA ID:

Manifest Tracking Number:

Discr Quantity Indicator:

Discr Residue Indicator:

Manifest Ref Number:

Alt Facility RCRA ID:

Alt Facility Sign Date:

Discr Partial Reject Indicator:

Discr Full Reject Indicator:

Discr Type Indicator:

Trans1 EPA ID:

Trans2 EPA ID:

Import Indicator:

Export Indicator:

TSDF ID 1:

TSDF ID 2:

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

1000340703

Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H020
Waste Code:	Not reported
Quantity:	150.0
Units:	P - Pounds
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Waste Code:	F002
Waste Code 1_2:	D007
Waste Code 1_3:	D029
Waste Code 1_4:	D039
Waste Code 1_5:	D040
Waste Code 1_6:	Not reported
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2008
Trans1 State ID:	TXR000050930
Trans2 State ID:	MOD095038998
Generator Ship Date:	07/25/2008
Trans1 Recv Date:	07/25/2008
Trans2 Recv Date:	08/15/2008

08/18/2008

Not reported

Ν

Ν

Ν

Ν

Ν

Ν

Ν

NYD072710296

OHD980587364

001310527SKS

TC4738280.2s Page 387

Database(s)

EDR ID Number EPA ID Number

1000340703

## LUTOR VALET (Continued)

MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1 5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity:

Units:

P - Pounds

H020 Not reported Not reported Not reported Not reported Not reported Not reported 150.0 P - Pounds 1.0 DF - Fiberboard or plastic drums (glass) R Material recovery of more than 75 percent of the total material. 1.0 F002 D007 D039 D040 Not reported Not reported Not reported Not reported Not reported 2008 TXR000050930 NJD071629976 01/25/2008 01/25/2008 01/29/2008 01/31/2008 Not reported Not reported NYD072710296 Not reported Not reported OHD980587364 Not reported 000109240SKS Ν N Ν Ν Ν Ν Ν Not reported Not reported Not reported H020 Not reported Not reported Not reported Not reported Not reported Not reported 150.0

Database(s)

EDR ID Number EPA ID Number

# LUTOR VALET (Continued)

(	
Number of Containers:	1.0
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1.0
Waste Code:	F002
Waste Code 1 2:	D007
Waste Code 1_3:	D039
Waste Code 1_4:	D040
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2007
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	03/07/2007
Trans1 Recv Date:	03/07/2007
Trans2 Recv Date:	03/15/2007
TSD Site Recv Date:	03/16/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD072710296
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	000017580SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H020
Waste Code:	Not reported
Quantity:	150
Units:	P - Pounds
Number of Containers:	1
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1
Waste Code:	F002
Waste Code 1_2:	
Waste Code 1_2: Waste Code 1_3:	D007 D039
Waste Code 1_3. Waste Code 1_4:	
_	D040 Not reported
Waste Code 1_5:	Not reported

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

OR VALET (Continued)	
Waste Code 1_6:	Not reported
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2007
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD071629976
Generator Ship Date:	08/22/2007
Trans1 Recv Date:	08/22/2007
Trans2 Recv Date:	08/30/2007
TSD Site Recv Date:	09/04/2007
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD072710296
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	000285579SKS
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator: Discr Type Indicator:	N N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H020
Waste Code:	Not reported
Quantity:	150
Units:	P - Pounds
Number of Containers:	
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	1 F002
Waste Code: Waste Code 1_2:	
Waste Code 1_2. Waste Code 1_3:	D007 D039
Waste Code 1_4:	D040
Waste Code 1 5:	Not reported
Waste Code 1_6:	Not reported
Document ID:	NYC7751092
Manifest Status:	Not reported
seq:	01
Year:	2006
Trans1 State ID:	TXR000050930
Trans2 State ID:	NJD986607380
Generator Ship Date:	02/09/2006

Database(s)

EDR ID Number EPA ID Number

1000340703

#### LUTOR VALET (Continued)

Trans1 Recv Date: 02/09/2006 Trans2 Recv Date: 02/16/2006 TSD Site Recv Date: 02/17/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD072710296 Generator EPA ID: Trans1 EPA ID: NYDW9495 Trans2 EPA ID: 50059 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00150 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7849203 Manifest Status: Not reported seq: 01 Year: 2006 TXR000050930 Trans1 State ID: Trans2 State ID: NJD071629976 Generator Ship Date: 08/11/2006 Trans1 Recv Date: 08/11/2006 Trans2 Recv Date: 08/21/2006 TSD Site Recv Date: 08/23/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: NY47344JE Trans2 EPA ID: T19L8D TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

1000340703

Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00150 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC7678271 Manifest Status: Not reported Not reported sea: Year: 2005 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629976 Generator Ship Date: 07/05/2005 Trans1 Recv Date: 07/05/2005 Trans2 Recv Date: 07/06/2005 TSD Site Recv Date: 07/07/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: NY1061454 Trans2 EPA ID: TAP35PNJ TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00150 Quantity: Units: P - Pounds

Database(s)

EDR ID Number EPA ID Number

#### LUTOR VALET (Continued)

Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC7146595 Document ID: Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: NYC87875 Trans2 State ID: T44V4WNJ Generator Ship Date: 05/12/2004 Trans1 Recv Date: 05/12/2004 Trans2 Recv Date: 05/19/2004 TSD Site Recv Date: 05/20/2004 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD072710296 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: Not reported TSDF ID 1: OHD980587 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00150 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC7153380 Document ID: Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: NY49455JF Trans2 State ID: T470GL Generator Ship Date: 11/29/2004 Trans1 Recv Date: 11/29/2004 Trans2 Recv Date: 12/01/2004 TSD Site Recv Date: 12/03/2004

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: TXR000050930 Trans2 EPA ID: Not reported TSDF ID 1: OHD980587 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Waste Code: Not reported Quantity: 00150 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC6976833 Manifest Status: Not reported 01 seq: Year: 2003 Trans1 State ID: NYCR3164 Trans2 State ID: FT97358CA Generator Ship Date: 04/17/2003 Trans1 Recv Date: 04/17/2003 Trans2 Recv Date: 04/23/2003 TSD Site Recv Date: 04/24/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 TXR000050930 Trans1 EPA ID: Trans2 EPA ID: MOR000505347 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported

Database(s)

EDR ID Number **EPA ID Number** 

## LUTOR VALET (Continued)

Units:

seq:

Year:

Units:

Handling Method:

Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00150 P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NYC7150410 Document ID: Manifest Status: Not reported 01 2003 Trans1 State ID: NYDW9495 Trans2 State ID: T83G9TNJ Generator Ship Date: 11/06/2003 Trans1 Recv Date: 11/06/2003 Trans2 Recv Date: 11/12/2003 TSD Site Recy Date: 11/13/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD072710296 Generator EPA ID: Trans1 EPA ID: TXR000050930 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported 00150 Quantity: P - Pounds Number of Containers: 001 DF - Fiberboard or plastic drums (glass) Container Type:

B Incineration, heat recovery, burning.

Database(s)

EDR ID Number EPA ID Number

#### LUTOR VALET (Continued)

Specific Gravity: 01.00 NYC6723123 Document ID: Manifest Status: Not reported seq: 01 Year: 2002 Trans1 State ID: NY4945559 Trans2 State ID: T53G9TNJ Generator Ship Date: 10/01/2002 Trans1 Recv Date: 10/01/2002 Trans2 Recv Date: 10/02/2002 TSD Site Recv Date: 10/03/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 SCR000075150 Trans1 EPA ID: Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. Handling Method: Specific Gravity: 01.00 Document ID: NYC6781803 Manifest Status: Not reported seq: 01 Year: 2002 NYDW9495 Trans1 State ID: Trans2 State ID: NJ862T2L Generator Ship Date: 05/11/2002 Trans1 Recv Date: 05/11/2002 Trans2 Recv Date: 05/15/2002 TSD Site Recv Date: 05/16/2002 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD072710296

Database(s)

EDR ID Number EPA ID Number

## LUTOR VALET (Continued)

Trans1 EPA ID: SCR000075150 Trans2 EPA ID: NJD071629976 TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00195 Units: P - Pounds Number of Containers: 001 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NYC6639772 Manifest Status: Not reported seq: 01 Year: 2002 Trans1 State ID: 5NYCR2436 Not reported Trans2 State ID: Generator Ship Date: 01/25/2002 Trans1 Recv Date: 01/25/2002 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/31/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD072710296 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: Not reported TSDF ID 1: OHD980587364 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported

EDR ID Number Database(s) EPA ID Number

# LUTOR VALET (Continued)

MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	
	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
Document ID:	NYC5797596
Manifest Status:	
	Not reported
seq:	01
Year:	2001
Trans1 State ID:	NYCR2436
Trans2 State ID:	TNT218034
Generator Ship Date:	01/08/2001
Trans1 Recv Date:	01/08/2001
Trans2 Recv Date:	01/10/2001
TSD Site Recv Date:	01/16/2001
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD072710296
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	OHD980587364
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	
Discr Residue Indicator:	Not reported
	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV
Waste Code:	Not reported
Quantity:	00195
Units:	P - Pounds
Number of Containers:	001
Container Type:	DF - Fiberboard or plastic drums (glass)
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
. ,	

Database(s)

	LUTOR VALET (Continued)		1000340703
		<u>rlink</u> while viewing on your computer to access NY_MANIFEST: record(s) in the EDR Site Report.	
	ECHO: Envid: Registry ID: DFR URL:	1000340703 110004367453 http://echo.epa.gov/detailed_facility_report?fid=110004367453	
AO193 SW 1/8-1/4 0.246 mi. 1300 ft.	STORAGE USA 363 HUGUENOT STREET NEW ROCHELLE, NY 10801 Site 2 of 2 in cluster AO	NY UST	U003949850 N/A
Relative:	WESTCHESTER CO. UST:	2.001107 / Administratively Olacad	
Lower	Id/Status:	3-801137 / Administratively Closed	
Actual:	Operator Name: Owner Name:	Narine Nathu SUSA Partnership, L.P.	
92 ft.	Owner Street:	175 Toyota Plaza	
	Owner Address2:	Not reported	
	Owner City:	Memphis	
	Owner State:	TN	
	Owner Zipcode:	38103	
	GDS Number:	Not reported	
	Tank Number:	1	
	Status:	5. Closed - removed	
	Capacity:	1500	
	Product Stored:	Not reported	
	Product Stored Percent:	Not reported	
	Tank Leak Detection:	0. None	
	Date Installation: Date Perm Closure:	01/01/1934 03/15/2004	
	Tank Location:	5. Underground	
	Tank Type:	1. Steel/Carbon steel/Iron	
	Tank Internal Protection:	0. None	
	Tank External Protection:	0. None	
	Tank Secondary Containment:	0. None	
	Piping Location:	2. Underground/on ground	
	Piping Type:	1. Steel/Carbon/ steel/iron	
	Piping External Protection:	0. None	
	Overfill Prevention:	0. None	
	Piping Secondary Containment:		
	Spill Prevention:	0. None	
	Dispenser:	0. None	

Database(s) EPA ID

194 SW 1/8-1/4	CON EDISON TRANSFORMER M 592 MAIN ST NEW ROCHELLE, NY 10804		6962648 2004357059
0.246 mi. 1300 ft.			
Relative:	RCRA NonGen / NLR:		
Higher	Date form received by agency Facility name:	r: 10/09/2013 CON EDISON TRANSFORMER MANHOLE: 2806	
Actual:	Facility address:	592 MAIN ST	
96 ft.	EPA ID:	NEW ROCHELLE, NY 10804	
	Mailing address:	NYP004357059 IRVING PL, RM 828	
	Maning address.	NEW YORK, NY 10003	
	Contact:	CHRISTOPHER BLAICH	
	Contact address:	Not reported	
		Not reported	
	Contact country:	Not reported	
	Contact telephone:	(914) 925-6219	
	Contact email:	Not reported 02	
	EPA Region: Classification:	02 Non-Generator	
	Description:	Handler: Non-Generators do not presently generate hazardous waste	
		Tanaion ten constatore de net procentily generate nazaracite videte	
	Handler Activities Summary:		
	U.S. importer of hazardous w	aste: No	
	Mixed waste (haz. and radioa	ctive): No	
	Recycler of hazardous waste:		
	Transporter of hazardous was		
	Treater, storer or disposer of		
	Underground injection activity		
	On-site burner exemption: Furnace exemption:	No	
	Used oil fuel burner:	No No	
	Used oil processor:	No	
	User oil refiner:	No	
	Used oil fuel marketer to burn		
	Used oil Specification market		
	Used oil transfer facility:	No	
	Used oil transporter:	No	
	Historical Generators:		
	Date form received by agency Site name:	CON EDISON TRANSFORMER MANHOLE: 2806	
	Classification:	Conditionally Exempt Small Quantity Generator	
	Violation Status:	No violations found	
	NY MANIFEST:		
	Country:	USA	
	EPA ID:	NYP004357059	
	Facility Status:	Not reported	
	Location Address 1:	592 MAIN ST.	
	Code:	BP	
	Location Address 2:	MH # 2806	
	Total Tanks:		
	Location City: Location State:	NEW ROCHELLE NY	
	Location Zip:	10802	
	Loouton Lip.		

Database(s)

EDR ID Number EPA ID Number

CON EDISON TRANSFORMER MANHOLE: 2806 (Continued)		
Location Zip 4:	Not reported	
NY MANIFEST:		
EPAID:	NYP004357059	
Mailing Name:	CON EDISON	
Mailing Contact:	TOM TEELING	
Mailing Address 1:	4 IRVING PLACE 15TH FLOOR	
Mailing Address 2:	Not reported	
Mailing City:	NEW YORK	
Mailing State:	NY	
Mailing Zip:	10003	
Mailing Zip 4:	Not reported	
Mailing Country: Mailing Phone:	USA	
Maning Fridne.	2124603770	
NY MANIFEST:		
Document ID:	Not reported	
Manifest Status:	Not reported	
seq:	Not reported	
Year:	2013	
Trans1 State ID:	NJ0000027193	
Trans2 State ID:	Not reported	
Generator Ship Date:	09/09/2013	
Trans1 Recv Date:	09/09/2013	
Trans2 Recv Date:	Not reported	
TSD Site Recv Date: Part A Recv Date:	09/09/2013 Not reported	
Part B Recv Date:	Not reported	
Generator EPA ID:	NYP004357059	
Trans1 EPA ID:	Not reported	
Trans2 EPA ID:	Not reported	
TSDF ID 1:	NJD002200046	
TSDF ID 2:	Not reported	
Manifest Tracking Number:	010707806JJK	
Import Indicator:	Ν	
Export Indicator:	Ν	
Discr Quantity Indicator:	Ν	
Discr Type Indicator:	Ν	
Discr Residue Indicator:	N	
Discr Partial Reject Indicator:	N	
Discr Full Reject Indicator:	N	
Manifest Ref Number:	Not reported	
Alt Facility RCRA ID:	Not reported	
Alt Facility Sign Date: MGMT Method Type Code:	Not reported H110	
Waste Code:	Not reported	
Quantity:	2000	
Units:	P - Pounds	
Number of Containers:	1	
Container Type:	TT - Cargo tank, tank trucks	
Handling Method:	T Chemical, physical, or biological treatment.	
Specific Gravity:	1	

## CON EDISON TRANSFORMER MANHOLE: 2806 (Continued)

Map ID	
Direction	
Distance	
Elevation	Site

Database(s)

	CON EDISON TRANSFORMER M	ANHOLE: 2806 (Continued)	1016962648
	Waste Code: Waste Code 1_2:	D008 Not reported	
		Not reported	
	Waste Code 1_3:	Not reported Not reported	
	Waste Code 1_4: Waste Code 1 5:	•	
	Waste Code 1_5. Waste Code 1_6:	Not reported	
	Wasie Code 1_0.	Not reported	
AQ195	MR CHIMNEY CLEAN	RCRA NonGen / NLI	R 1004758604
WSW	32 RELYEA PL	FIND	
1/8-1/4	NEW ROCHELLE, NY 10801	NY MANIFES	
0.250 mi.		ECHO	C
1318 ft.	Site 1 of 3 in cluster AQ		
Relative:	RCRA NonGen / NLR:		
Lower	Date form received by agend	cv:01/01/2007	
20110.	Facility name:	MR CHIMNEY CLEAN	
Actual:	Facility address:	32 RELYEA PL	
88 ft.		NEW ROCHELLE, NY 10801	
	EPA ID:	NYD987011855	
	Mailing address:	RELYEA PL	
		NEW ROCHELLE, NY 10801	
	Contact:	MAURICE MCKENNA	
	Contact address:	RELYEA PL	
		NEW ROCHELLE, NY 10801	
	Contact country:	US	
	Contact telephone:	(914) 632-6660	
	Contact email:	Not reported	
	EPA Region:	02	
	Classification:	Non-Generator	
	Description:	Handler: Non-Generators do not presently generate hazardous waste	
	Owner/Operator Summary:		
	Owner/operator name:	NAUAL MOTION PICTURES	
	Owner/operator address:	270 MAIN ST	
		NEW ROCHELLE, NY 10801	
	Owner/operator country:	US	
	Owner/operator telephone:	(914) 632-2406	
	Legal status:	Private	
	Owner/Operator Type:	Owner Not reported	
	Owner/Op start date:	Not reported	
	Owner/Op end date:	Not reported	
	Owner/operator name:	NAUAL MOTION PICTURES	
	Owner/operator address:	270 MAIN ST	
		NEW ROCHELLE, NY 10801	
	Owner/operator country:	US	
	Owner/operator telephone:	(914) 632-2406	
	Legal status:	Private	
	Owner/Operator Type:	Operator	
	Owner/Op start date:	Not reported	
	Owner/Op end date:	Not reported	
	Handler Activities Summary:		
	U.S. importer of hazardous v		
	Mixed waste (haz. and radio		

MR CHIMNEY CLEAN (Continued)

MAP FINDINGS

Database(s)

•••••••••••••••••••••••••••••••••••••••	(••••••••)		1
Transporter of ha	zardous waste:	No	
Treater, storer or	disposer of HW:	No	
Underground inje		No	
On-site burner ex		No	
Furnace exemptic	on:	No	
Used oil fuel burn	er:	No	
Used oil processo	or:	No	
User oil refiner:		No	
Used oil fuel mark	keter to burner:	No	
Used oil Specifica	ation marketer:	No	
Used oil transfer f	acility:	No	
Used oil transport	er:	No	
Historical Generators	s.		
	ed by agency:01/0	1/2006	
Site name:		CHIMNEY CLEAN	
Classification:		a generator, verified	
Date form receive	ed by agency: 06/0	1/1994	
Site name:		CHIMNEY CLEAN	
Classification:		ditionally Exempt Small Quantity Generator	
	Cont	anonary Exemptionian educity concrator	
. Waste code:	D003	3	
. Waste name:	REA	CTIVE WASTE	
. Waste code:	X002	2	
. Waste name:		YCHLORINATED BIPHENOLS (PCBs)	
Violation Status:	No v	iolations found	
FINDS:			
Registry ID:	1100	04493922	
Environmental Int	erest/Information	System	
	RCRAInfo is a na	tional information system that supports the Resource	
		Recovery Act (RCRA) program through the tracking of	
		ies related to facilities that generate, transport,	
		or dispose of hazardous waste. RCRAInfo allows RCRA	
		rack the notification, permit, compliance, and	
	corrective action	activities required under RCRA.	
NY MANIFEST:			
Country:	U	SA	
EPA ID:	N	YD987011855	
Facility Status:	N	ot reported	
Location Address	1: 2	70 MAIN ST	
Code:	В	Р	
Location Address	2: N	ot reported	
Total Tanks:		ot reported	
Location City:		EW ROCHELLE	
Location State:		Y	
Location Zip:	1	0801	
Location Zip 4:	N	ot reported	
NY MANIFEST:			

Database(s)

EDR ID Number EPA ID Number

#### MR CHIMNEY CLEAN (Continued)

EPAID: NYD987011855 Mailing Name: NAVAL MOTION PICTURE SERVICE Mailing Contact: PAUL RAMOS Mailing Address 1: 270 MAIN ST Mailing Address 2: Not reported Mailing City: NEW ROCHELLE Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 000000000 NY MANIFEST: CTF0276746 Document ID: Manifest Status: С seq: Not reported Year: 1994 Trans1 State ID: Not reported Trans2 State ID: Not reported 06/23/1994 Generator Ship Date: Trans1 Recv Date: 06/23/1994 Trans2 Recy Date: 11 TSD Site Recv Date: 06/27/1994 Part A Recv Date: 11 Part B Recv Date: 07/11/1994 Generator EPA ID: NYD987011855 NYD173735192 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: CTD000604488 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: L Landfill. Specific Gravity: 100

#### 1004758604

Database(s)

EDR ID Number EPA ID Number

1004758604

## MR CHIMNEY CLEAN (Continued)

ECHO: Envid: Registry ID: DFR URL:

1004758604 110004493922 http://echo.epa.gov/detailed\_facility\_report?fid=110004493922

AR196 NNE 1/4-1/2 0.254 mi.	CITY OF NEW ROCHELLE 45 HARRISON STREET NEW ROCHELLE, NY	NY LTANKS	S107658678 N/A
1342 ft.	Site 1 of 2 in cluster AR		
Relative: Lower Actual: 74 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Company: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Extention: DEC Region: DEC Region: DER Facility ID: DEC Memo: Remarks: Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	2006-02-28 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee WCDOH 2006-02-28 408 Not reported Tank Tester Not reported False True 0 : 2006-02-28	S,"

Database(s)

EDR ID Number **EPA ID Number** 

	. ,
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Site ID:	360263
Operable Unit ID:	1117439
Operable Unit:	01
Material ID:	2107948
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

AQ197 INDUSTRIAL OVERALL SERVICE CORP. NY SHWS S110043643 wsw **10 BARTELS PLACE** NY CBS N/A 1/4-1/2 NEW ROCHELLE, NY 10801 0.265 mi. 1398 ft. Site 2 of 3 in cluster AQ SHWS: Relative: HW Program: Lower Site Code: 413917 Actual: Classification: Significant threat to the public health or environment - action 84 ft. required. Region: 3 0.42 Acres: HW Code: 360109 Record Add: 05/15/2009 Record Upd: 09/18/2015 Updated By: DACROSBY Site Description: Location: The Industrial Overall Service Corporation site is located at 10 Bartels Place in the City of New Rochelle, Westchester County, NY. The site is located east of I-95 and west of US-1 (Huguenot Street) and it is bounded by Reylea Place, Bartels Place, Centre Avenue and the Metro North railroad property and tracks. Site Features: The site is 0.42 acres in size and resides on a slightly sloping irregularly shaped parcel. The main site feature includes a six-sided building which occupies the majority of the property and a small parking area located to the south and southwest of the building. The surrounding area is urban with a mix of commercial and residential establishments mixed in between the commercial businesses. Current Zoning/ Uses: This property is zoned for commercial use. The building is the location of two active businesses, Workingmans Closet and Apparel +Plus. The Workingmans Closet business uses the business address of 27 Centre Street. Historic Uses: Industrial Overall Services has been operating at the current location as a uniform and industrial clothing laundering facility, historically cleaning heavily soiled clothing from auto body and gasoline dispensing businesses since 1939. Based on a

EDR ID Number Database(s) EPA ID Number

#### INDUSTRIAL OVERALL SERVICE CORP. (Continued)

Sanborn Fire Insurance Map form 1931, the site previously operated as an automobile garage. In 1980, Workingmans Closet which sells new and reclaimed work clothes, was opened, and a dry cleaning facility operated there for a short time in the same decade. Today, Workingmans Closet launders linens and uniforms for restaurants and other businesses, and Apparel +Plus is a retail uniform business. Laundry operations on the site have used various cleaning products in the past. A remedial investigation conducted at the site has measured high concentrations of the dry cleaning chemical tetrachloroethylene (PCE) and its degradation products which is migrating from two sources: the subsurface lint trap located within the site building, and a debris and waste disposal area on the ground surface on site and on the adjacent Metro North Railroad property. Contamination migrating from these sources has impacted groundwater in the bedrock and overburden aquifers and has developed a plume extending downgradient (southwest) from the site over 1900 feet, as well as the bedrock itself.Site Geology and Hydrology: Groundwater is found in the overburden and in the bedrock. Groundwater is generally found 10 to 15 feet below ground surface and flows in a southwesterly direction. Overburden in the vicinity ranges in thickness from 2.2 feet to 32 feet, and consists of fill material (1-5 feet in thickness) and varied amounts of fine to coarse sand with varying amounts of silt. Deeper overburden is described as having till-like characteristics (higher density, well consolidated, and lower moisture content). Bedrock in the vicinity is a highly weathered gneissic/schistosic rock which is undulating in nature and is generally more transmissive than the till-like overburden material directly above. Env Problem: Nature and Extent of Contamination: The primary contaminants of concern at the site include tetrachloroethylene (PCE) and its associated breakdown products. PCE was detected in groundwater at the site and downgradient off-site. On-site PCE in groundwater was noted at greater than 5,300 parts per billion (ppb) in site. The levels of PCE appear to diminish from the 1,000's of ppb of PCE to non detectable approximately 1000 feet to the southwest of the site. However, a high (PCE) concentration of 200 ppm was documented by within the adjoining Metro North railway property. Trichloroethylene (TCE) and TCA, were also detected in the groundwater both downgradient and on the site. Special Resources Impacted/Threatened: The site is located in an urban area of the City of New Rochelle. No significant environmental resources have been identified near the site. Significant Threat: The site presents a significant threat to the environment and a potential threat to human health due to the ongoing release of contamination from the site and from adjoining Metro North property into groundwater and soil vapor. Health Problem: Direct contact with contaminants in groundwater is unlikely because the area is served by an uncontaminated public water supply. While the majority of the site is covered with buildings and pavement, trespassers or employees may come in direct contact with some contaminated surficial soils on site and on the adjacent Metro North Railroad property. Volatile organic compounds in the groundwater or soil may move into the soil vapor (air spaces within the soil), which in turn may move into overlying buildings and affect the indoor air quality. This process, which is similar to the movement of radon gas from the subsurface into the indoor air of buildings, is referred to as soil vapor intrusion (SVI). Inhalation of site contaminants in indoor air due to soil vapor intrusion is unknown because the on-site

Dump:

Structure:

Disp Start: Disp Term:

Lat/Long: Dell:

Record Add:

Record Upd:

Updated By:

**Owner Name:** 

Owner Addr2:

Own Op:

Sub Type:

**Owner Name:** 

Own Op:

Sub Type:

Lagoon: Landfill:

Pond:

MAP FINDINGS

EDR ID Number Database(s) **EPA ID Number** 

#### INDUSTRIAL OVERALL SERVICE CORP. (Continued)

building is an active laundry facility. However, an evaluation to determine the potential for soil vapor intrusion to occur, will be needed should the current site use of the building or chemical use change in the future. Sub-slab depressurization systems have been installed in two off-site buildings to prevent the inhalation of site-related contamination. In addition, air monitoring is on-going at four additional off-site buildings to verify further actions are not needed. Sampling indicates soil vapor intrusion may be a concern for additional off-site buildings. False False False False False UNKNOWN Not reported Not reported Not reported 6/11/2009 3:11:00 PM 8/10/2015 11:09:00 AM **KATHOMPS** Owner NNN ROBERT O'BRIEN WORKING MAN'S CLOSET, INC Owner Company: Owner Address: **3 KOLBERT DRIVE** Not reported Owner City, St, Zip: SCARSDALE, NY 10583 **Owner Country:** United States of America **Document Repository** NNN Not reported **Owner Company:** New Rochelle Public Library **Owner Address:** 1 Library Plaza Not reported Owner City,St,Zip: New Rochelle, NY 10801 Owner Country: United States of America **On-Site Operator** 08 Robert R. O'Brien Apparel + Plus Textile Rental, LLC Owner Company: 27 Centre Avenue/10 Bartells Place **Owner Address:** Not reported Owner City, St, Zip: New Rochelle, NY 10801 **Owner Country:** United States of America **Document Repository** NNN **Region 3 Headquarters Owner Company:** New York State Department of Environmental Conservation Owner Address: 21 South Putt Corners Rd Not reported Owner City, St, Zip: New Paltz, NY 12561 Owner Country: United States of America Owner 01 Mr Burton Dorfman, Esg. Owner Company: Industrial Overall Services, Inc.(IOS)

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICE CORP. (Continued)

Owner Address: 10 Bartells Place Owner Addr2: Not reported Owner City, St, Zip: New Rochelle, NY 10801 Owner Country: United States of America HW Code: 360109 TETRACHLOROETHYLENE (PCE) Waste Type: Waste Quantity: UNKNOWN Waste Code: Not reported HW Code: 360109 Waste Type: trichloroethene (TCE) Waste Quantity: UNKNOWN Not reported Waste Code: 360109 HW Code: Waste Type: 1,1,1-TCA Waste Quantity: UNKNOWN Waste Code: Not reported HW Code: 360109 Waste Type: tetrachloroethene (PCE) Waste Quantity: UNKNOWN Waste Code: Not reported HW Code: 360109 Waste Type: 1,1-dichloroethane UNKNOWN Waste Quantity: Waste Code: Not reported HW Code: 360109 vinyl chloride Waste Type: Waste Quantity: UNKNOWN Waste Code: Not reported 360109 HW Code: Waste Type: methylene chloride UNKNOWN Waste Quantity: Waste Code: Not reported HW Code: 360109 Waste Type: cis-1,2-dichloroethene UNKNOWN Waste Quantity: Not reported Waste Code: Crossref ID: 1309988 Cross Ref Type Code: 01 Cross Ref Type: Spill No. 4/14/2014 11:03:00 AM Record Added Date: **Record Updated:** 4/14/2014 11:03:00 AM Updated By: RDBENDEL Crossref ID: 1310684 Cross Ref Type Code: 01 Cross Ref Type: Spill No. Record Added Date: 2/14/2014 8:19:00 AM **Record Updated:** 2/14/2014 8:19:00 AM Updated By: **ELMOORE** 360087 Crossref ID: Cross Ref Type Code: 02 Cross Ref Type: HW Site ID Record Added Date: 5/21/2009 3:07:00 PM 5/21/2009 3:07:00 PM **Record Updated:** Updated By: RXKEATIN

#### CBS:

CBS Number:

3-000235

Map ID Direction		MAP FINDINGS		
Distance	Site		Database(s)	EDR ID Number EPA ID Number
	INDUSTRIAL OVERALL SERV	ICE CORP. (Continued)		S110043643
	Program Type:	CBS		
	Facility Status: Expiration Date:	Unregulated/Closed Not reported		
	Dec Region:	3		
	UTMX: UTMY:	602235.14737 4529262.58924		
	UTMT.	4029202.00924		
AQ198 WSW 1/4-1/2 0.265 mi.	INDUST OVERALL SERVICE C 10 BARTELS PLACE NEW ROCHELLE, NY	CORP	NY LTANKS	S116555778 N/A
1398 ft.	Site 3 of 3 in cluster AQ			
Relative: Lower	LTANKS: Site ID:	494186		
Lower	••	1400928 / Not Reported		
Actual: 84 ft.	Spill Date:	2014-04-28		
04 11.	Spill Cause: Spill Source:	Tank Test Failure Commercial/Industrial		
	Spill Class:	Known release that creates potential for fire or hazard	. DEC Response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported		
	Cleanup Meets Standard:	False		
	SWIS:	6010		
	Investigator: Referred To:	ELMOORE Not reported		
	Reported to Dept:	2014-04-28		
	CID:	Not reported		
	Water Affected: Spill Notifier:	Not reported Tank Tester		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase: Date Entered In Computer	4 · 2014-04-28		
	Spill Record Last Update:			
	Spiller Name:	BOB OBRIEN		
	Spiller Company: Spiller Address:	INDUSTRIAL OVERALL SERV CORP 10 BARTELL PL		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller County: Spiller Contact:	999 POR ORDIEN		
	Spiller Phone:	BOB OBRIEN (914) 235-1220		
	Spiller Extention:	Not reported		
	DEC Region: DER Facility ID:	3 449117		
	DEC Memo:	"4-28-14: Chris/WCHD call to Dispt./V.Mc.: Heating oil	I tank, out of	
	Remarks:	service, failed test." "tank 2 5000 gallon"		
	Material:			
	Site ID:	494186		
	Operable Unit ID:	1243715		
	Operable Unit: Material ID:	01 2244419		
	Material Code:	0001A		
	Material Name:	#2 fuel oil		

Database(s)

EDR ID Number EPA ID Number

#### INDUST OVERALL SERVICE CORP (Continued)

DUST OVERALL SERVICE	IDUST OVERALL SERVICE CORP (Continued)		
Case No.:	Not reported		
Material FA:	Petroleum		
Quantity:	Not reported		
Units:	Not reported		
Recovered:	Not reported		
Resource Affected:	Not reported		
Oxygenate:	Not reported		
Tank Test:			
Site ID:	494186		
Spill Tank Test:	2495577		
Tank Number:	1		
Tank Size:	4000		
Test Method:	99		
Leak Rate:	Not reported		
Gross Fail:	Not reported		
Modified By:	JBODEE		
Last Modified:	Not reported		
Test Method:	Alternate Test per 613.5a2v		
Site ID:	494186		
Spill Tank Test:	2495578		
Tank Number:	2		
Tank Size:	5000		
Test Method:	21		
Leak Rate:	Not reported		
Gross Fail:	Not reported		
Modified By:	JBODEE		
Last Modified:	Not reported		
Test Method:	Horner EZY3/EZY3 Locator Plus		

AS199 SSW 1/4-1/2 0.266 mi.	BLESSED SACREMENT CHUR 15 SHEA PL NEW ROCHELLE, NY	СН	NY LTANI
0.266 m. 1405 ft.	Site 1 of 3 in cluster AS		
Relative: Higher	LTANKS: Site ID: Spill Number/Closed Date:	167332 0204856 / 2003-10-03	
Actual: 97 ft.	Spill Date: Spill Cause:	2002-08-07 Tank Test Failure	
	Spill Source: Spill Class:	Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Willing Responsible Party. Corrective action taken.	Response.
	Cleanup Ceased: Cleanup Meets Standard: SWIS:	Not reported True 6010	
	Investigator: Referred To: Reported to Dept:	WCHD Westchester Cnty Health Dept 2002-08-07	
	CID: Water Affected:	211 Not reported	
	Spill Notifier: Last Inspection: Recommended Penalty:	Tank Tester Not reported False	

False

UST Involvement:

S116555778

NY LTANKS S105996474 N/A

Database(s)

EDR ID Number EPA ID Number

## BLESSED SACREMENT CHURCH (Continued)

Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update: Spiller Name:	
•	
Spiller Company:	BLESSED SACREMENT CHURCH
Spiller Address:	15 SHEA PL
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001 Not expected
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	WCHD-MAGNUSON 10/17/03: Letter to Blessed Sacrament Church from Karen
	Magnuson, WCDOH dated 10/3/2003. Closure report by RND Services has
	been reviewed. WCDOH recommends NFA at this time."
Remarks:	"DRY LEAK"
Material:	
Site ID:	167000
	167332
Operable Unit ID:	856138 01
Operable Unit: Material ID:	-
Material Code:	519078
Material Code: Material Name:	0001A
	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tonk Toot	
Tank Test: Site ID:	167332
	1527358
Spill Tank Test: Tank Number:	1
Tank Size:	2000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II
rest methou.	

Database(s)

AR200 NNE 1/4-1/2 0.277 mi.	FIREHOUSE HARRISON ST NEW ROCHELLE, NY	NY LTANKS S103 N/A	037428 \
1460 ft.	Site 2 of 2 in cluster AR		
Relative: Lower Actual: 71 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	1998-03-13 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1998-03-13 199 Not reported Tank Tester Not reported False True 0 : 1998-03-13	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	252028 1059801 01 324831 0008 diesel Not reported Petroleum .00 Gallons .00 Not reported Not reported Not reported	

AT201

Database(s)

EDR ID Number EPA ID Number

## FIREHOUSE (Continued)

**BLESSED SACRAMENT CHURCH** 

Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified:	252028 1545673 2 5000 03 .00 Not reported Spills Not reported
•	Not reported Horner EZ Check I or II

NY LTANKS	S100165619
	N/A

A I 201 South 1/4-1/2 0.279 mi.	BLESSED SACRAMENT CHUR SHEA PLACE NEW ROCHELLE, NY	CH	NY LIANKS	S10016 N/A
1474 ft.	Site 1 of 3 in cluster AT			
Relative:	LTANKS:	00/07/		
Lower	Site ID:	324974		
Actual:	Spill Number/Closed Date:			
91 ft.	Spill Date:	1987-08-02		
5110.	Spill Cause:	Tank Test Failure		
	Spill Source: Spill Class:	Institutional, Educational, Gov., Other		
	Cleanup Ceased:	Not reported 1987-11-20		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator:	UNASSIGNED		
	Referred To:	Not reported		
	Reported to Dept:	1987-08-02		
	CID:	Not reported		
	Water Affected:	NONE		
	Spill Notifier:	Tank Tester		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:	: 1987-09-30		
	Spill Record Last Update:	1987-11-20		
	Spiller Name:	Not reported		
	Spiller Company:	SAME		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	ZZ		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported		
		Not reported 3		
	DEC Region: DER Facility ID:	3 261780		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field	was /	
		/: 8/2/87-CHURCH TO EXCAVATE, ISOLATE AND RETEST.	//:8/2/87-CHU	JRCH
	Remarks:	TO EXCAVATE, ISOLATE AND RETEST RETEST PASSED. "TTTF-TWO TANKS FAILED"	NFA. "	

Database(s)

EDR ID Number EPA ID Number

S100165619

	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	324974 908133 01 466902 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported	
	Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	324974 1531452 Not reported 0 00 .00 Not reported Spills Not reported Unknown	
AT202 South 1/4-1/2 0.280 mi. 1481 ft.	APARTMENT HOUSE 156-168 CENTRE AVE NEW ROCHELLE, NY Site 2 of 3 in cluster AT	NY LTANKS	S106385339 N/A
Relative: Lower Actual: 89 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	2004-02-13 Tank Test Failure Non Major Facility > 1,100 gal Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2004-02-13 406 Not reported Tank Tester Not reported False False 0 2004-02-13	

## **BLESSED SACRAMENT CHURCH (Continued)**

TC4738280.2s Page 415

Remediation Phase:

4

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	APARTMENT HOUSE (Continu	ued) \$106385339
	Spiller Name:	JIM DONELAN
	Spiller Company:	PROTEST
	Spiller Address:	PO BOX 1937
	Spiller City,St,Zip:	WEST BABYLON, NY 11704
	Spiller County:	001
		PAUL
	Spiller Contact:	
	Spiller Phone:	(914) 698-4100
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	217585
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
		WCHD-JACKSON 04/22/04 TANK PASSED A RETEST ON 3-22-04. NFA jbo"
	Remarks:	"Failed tank test"
	Material:	
	Tank Test:	
	Site ID:	267104
	Spill Tank Test:	1528979
	Tank Number:	1
	Tank Size:	10000
	Test Method:	03
	Leak Rate:	.00
	Gross Fail:	Not reported
	Modified By:	Spills
	Last Modified:	Not reported
	Test Method:	Horner EZ Check I or II
AT203 South 1/4-1/2 0.280 mi. 1481 ft.	FAILED TANK TEST 156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT	NY LTANKS S114561821 N/A
South 1/4-1/2 0.280 mi. 1481 ft.	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT	
South 1/4-1/2 0.280 mi. 1481 ft. Relative:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS:	N/A
South 1/4-1/2 0.280 mi. 1481 ft.	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID:	N/A 488939
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date:	488939 1308221 / Not Reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date:	488939 1308221 / Not Reported 2013-11-12
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party.
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2013-11-12
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2013-11-12 Not reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2013-11-12 Not reported 2013-11-12 Not reported Not reported
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier:	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2013-11-12 Not reported 2013-11-12 Not reported Not reported Not reported Tank Tester
South 1/4-1/2 0.280 mi. 1481 ft. Relative: Lower Actual:	156 CENTRE AVE NEW ROCHELLE, NY Site 3 of 3 in cluster AT LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cau	488939 1308221 / Not Reported 2013-11-12 Tank Test Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2013-11-12 Not reported 2013-11-12 Not reported Not reported Tank Tester Not reported

## TC4738280.2s Page 416

Database(s)

EDR ID Number EPA ID Number

FAILED TANK TEST (Continued)			
Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:			
Remarks:	"Tank test failure"		
Material:			
Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	488939 1238546 01 2238468 9999 other - failed tank test Not reported Other Not reported Not reported Not reported Not reported Not reported Not reported Not reported		
Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	488939 2494704 1 10000 21 Not reported Not reported JBODEE Not reported Horner EZY3/EZY3 Locator Plus		

Database(s)

204	SPILL NUMBER 0302495	NY LTANKS	S105999167
SE 1/4-1/2 0.283 mi.	85 NORTH AVE NEW ROCHELLE, NY	NY Spills	N/A
1492 ft.			
Relative:	LTANKS:		
Lower	Site ID:	353132	
	Spill Number/Closed Date:	0507677 / 2009-10-09	
Actual:	Spill Date:	2005-09-26	
69 ft.	Spill Cause:	Tank Test Failure	
	Spill Source: Spill Class:	Gasoline Station or other PBS Facility Known release that creates potential for fire or hazard. DEC Response.	
	opiii Class.	Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
		False	
	SWIS:	6010	
	Investigator:	jkomara	
	Referred To:	WCDOH	
	Reported to Dept: CID:	2005-09-26 408	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	True	
	Remediation Phase: Date Entered In Computer:	0	
	Spill Record Last Update:		
	Spiller Name:	FRANK	
	Spiller Company:	GAS STATION	
	Spiller Address:	85 NORTH AVE.	
	Spiller City,St,Zip:	NEW ROCHELLE, NY	
	Spiller County: Spiller Contact:	001 FRANK	
	Spiller Phone:	(914) 632-2109	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	100200	
	DEC Memo:	"9/28/05 Also see spills 03-04446, 05-11827 and 05-07653. jod Closure	
		report received and site visit with WCHD performed. NFA if no money State money spent on Spill # 0304446 pin # 03236. 4/5/07 JO'M 10/9/09	
		Closed this spill refer to 0304446 JO'M"	
	Remarks:	"LINE FAILURE."	
	Material:		
	Site ID:	353132	
	Operable Unit ID:	1110599	
	Operable Unit:	01	
	Material ID:	2100636	
	Material Code: Material Name:	0009 gasoline	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Gallons	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	

Database(s)

EDR ID Number EPA ID Number

## SPILL NUMBER 0302495 (Continued)

Tank Test:

Site ID:	114935
Spill Number/Closed Date:	
Spill Date:	2003-06-09
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2003-06-09
CID:	405
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	-
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	85 NORTH AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	DISPATCHER 629
Spiller Phone:	(914) 231-1905
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	100200
DEC Memo:	11
Remarks:	"caller states that there is an overspill at the above address - some
	has gone into the sewer - cell # 914-760-1305 is for the fire chief
	on scene - unknown if the spill is stopped or not"
Material:	
Site ID:	114935
Operable Unit ID:	869316
Operable Unit:	01
Material ID:	506969
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
2.1, 90	·····

Database(s)

EDR ID Number EPA ID Number

S105999167

#### SPILL NUMBER 0302495 (Continued)

Tank Test:

SPILLS: 0507653 Facility ID: Facility Type: ER DER Facility ID: 100200 Site ID: 353098 DEC Region: 3 Spill Date: 2005-09-26 Spill Number/Closed Date: 0507653 / 2005-10-07 Spill Cause: Unknown Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 Investigator: **JKOMARA** WCDOH Referred To: Reported to Dept: 2005-09-26 CID: 444 Water Affected: Not reported Spill Source: Gasoline Station or other PBS Facility Spill Notifier: Health Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2005-09-26 Spill Record Last Update: 2005-10-07 Spiller Name: FRANK Spiller Company: FRANKIES AUTO Spiller Address: 85 NORTH AVE. Spiller City,St,Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: FRANK Contact Phone: (914) 632-2109 "9/28/05 Also see spills 03-04446, 03-11827 and 05-07677. jod DEC Memo: 10/07/05 Refer to spill 05-07677 for all updates. This spill number closed. jod" "GASOLINE IN SANITARY SEWER NEXT TO STATION AND ODORS: PLEASE CALL Remarks: DOH ON THIS ISSUE" Material: Site ID: 353098 Operable Unit ID: 1110568 **Operable Unit:** 01 Material ID: 2100602 Material Code: 0009 gasoline Material Name: Case No.: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported

Map ID		MAP FINDINGS		
Direction	ų_			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	SPILL NUMBER 0302495 (Con	ntinued)		S105999167
	Tank Test:			
AS205 SSW 1/4-1/2 0.283 mi.	BLESSED SACRAMENT HIGH 24 SHEA PLACE NEW ROCHELLE, NY	SC	NY LTANKS	S106385926 N/A
1493 ft.	Site 2 of 3 in cluster AS			
Relative: Higher Actual: 95 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo:	2004-04-21 Tank Test Failure Non Major Facility > 1,100 gal Known release with minimal potential for fire or hazard. D Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2004-04-21 444 Not reported Tank Tester Not reported False False 0 2004-04-21 2004-04-21 2004-04-21 2004-04-21 2004-04-21 2004-07-06 LARRY HANSEN BLESSED SACRAMENT HIGH SC 24 SHEA PLACE NEW ROCHELLE, NY 001 LARRY HANSEN (914) 632-2595 Not reported 3 204413 "Prior to Sept, 2004 data translation this spill Lead_DEC F		
	Remarks:	WCHD-JACKSON 07/06/04 TANK PASSED RETEST." "FAILED SUBLINGS RECOMMEND UNCOVER REPAIR	& RETEST OR RE	MOVE: "
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units:	249284 884909 01 491955 0001A #2 fuel oil Not reported Petroleum .00 Gallons		

Database(s)

EDR ID Number EPA ID Number

## BLESSED SACRAMENT HIGH SC (Continued)

Recovered: Resource Affected: Oxygenate:	.00 Not reported Not reported
Tank Test:	
Site ID:	249284
Spill Tank Test:	1529181
Tank Number:	1
Tank Size:	5000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

#### AS206 **BLESSED SACRAMENT HS** SSW 24 SHEA PLACE

1/4-1/2 NEW ROCHELLE, NY 0.283 mi. 1493 ft. Site 3 of 3 in cluster AS

Relative:	LTANKS:	
Higher	Site ID:	481320
	•	1300960 / Not Reported
Actual:	Spill Date:	2013-04-29
95 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Institutional, Educational, Gov., Other
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
		Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	
	SWIS:	6010
	Investigator:	RDBENDEL
	Referred To:	Not reported
	Reported to Dept:	2013-04-29
	CID:	Not reported
	Water Affected:	Not reported
	Spill Notifier:	Tank Tester
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	4
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spiller Name:	ED SULLIVAN
	Spiller Company:	HIGH SCHOOL
	Spiller Address:	24 SHEA PLACE
	Spiller City,St,Zip:	NEW ROCHELLE, NY
	Spiller County:	999 50 OLIVANI
	Spiller Contact:	ED SULLIVAN
	Spiller Phone:	(914) 632-2595
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	
	DEC Memo:	"This is a 1K ust. Testing done every year. Appears to be a piping

NY LTANKS S113494296

N/A

EDR ID Number Database(s) EPA ID Number

#### **BLESSED SACRAMENT HS (Continued)**

Remarks:

Operable Unit ID:

Operable Unit:

Material: Site ID: problem, will uncover, repair and retest. WCDOH has been notified....mm 8/5/13 Failed retest. Spoke to Kathy Morgan at US Tank Test. dw " "tank test failure" 481320 1231094 01 2230143 0001

	Operable Offic.	01
	Material ID:	2230143
	Material Code:	0001
	Material Name:	#2 fuel oil (on-site consumption)
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	Not reported
	Units:	Not reported
	Recovered:	Not reported
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	Site ID:	481320
	Operable Unit ID:	1231094
	Operable Unit:	01
	Material ID:	2229789
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	Not reported
	Units:	Not reported
	Recovered:	Not reported
	Resource Affected:	Not reported
	Oxygenate:	Not reported
т	ank Test:	
Ιċ	Site ID:	484320
		481320 2493383
	Spill Tank Test: Tank Number:	
	Tank Number: Tank Size:	0
	Test Method:	1000 21
	Leak Rate:	1.00
	Gross Fail:	
		Not reported
	Modified By: Last Modified:	jbodee
		Not reported
	Test Method:	Horner EZY3/EZY3 Locator Plus

#### S113494296

207	HEALTH DEPT OFFICE
NNE	145 HUGUENOT ST
1/4-1/2	NEW ROCHELLE, NY
0.287 mi.	

1515 ft.

Relative: Lower	LTANKS: Site ID:	259815
Actual: 70 ft.	Spill Number/Closed Date: Spill Date: Spill Cause:	1989-05-02 Tank Test Failure

NY LTANKS S105236833 NY Spills N/A

EDR ID Number Database(s) EPA ID Number

HEALTH DEPT OFFICE (Continued)

	Spill Source:	Commercial/Industrial	
	Spill Class:	Possible release with minimal potential for fire or hazard or Known	
		release with no damage. DEC Response. Willing Responsible Party.	
		Corrective action taken.	
	Cleanup Ceased:	1989-06-01	
	Cleanup Meets Standard:	True	
	SWIS:	6010	
	Investigator:	tdghiosa	
	Referred To:	Not reported	
	Reported to Dept:	1989-05-02	
	CID:	Not reported	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	True	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:		
	Spiller Name:	Not reported	
	Spiller Company:	SAME	
	Spiller Address:	Not reported	
	Spiller City,St,Zip:	NY	
	Spiller County:	999 National tenanted	
	Spiller Contact: Spiller Phone:	Not reported	
	Spiller Extention:	Not reported Not reported	
	DEC Region:	3	
	DER Facility ID:	212473	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
		GHIOSAY // : TANK & CONTAMINATED SOIL HAS BEEN REMOVED N.F.A. // :	
		TANK & CONTAMINATED SOIL HAS BEEN REMOVED N.F.A. "	
	Remarks:	"8K,116"	
N	laterial:		
	Site ID:	259815	
	Operable Unit ID:	927170	
	Operable Unit:	01	
	Material ID: Material Code:	452349	
	Material Name:	0001A #2 fuel oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Pounds	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
Т	ank Test:		
	Site ID:	259815	
	Spill Tank Test:	1535410	
	Tank Number:	Not reported	
	Tank Size:	0	
	Test Method:	00	
	Leak Rate:	.00	

Database(s)

EDR ID Number EPA ID Number

Not reported
Spills
Not reported
Unknown

# SP

SPILLS:	
Facility ID:	0909155
Facility Type:	ER
DER Facility ID:	212473
Site ID:	421828
DEC Region:	3
Spill Date:	2009-11-16
Spill Number/Closed Date:	0909155 / 2009-11-16
Spill Cause:	Human Error
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
Spill Class.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	MBMASTRO
Referred To:	Not reported
	2009-11-16
Reported to Dept: CID:	
Water Affected:	Not reported Not reported
	Commercial/Industrial
Spill Source:	
Spill Notifier:	Other Not reported
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False 2009-11-16
Last Inspection:	
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-11-16
Spill Record Last Update:	2009-11-16
Spiller Name:	
Spiller Company:	CASTLE OIL
Spiller Address:	290 LOCUST AVE
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	999
Contact Name:	
Contact Phone:	(718) 579-3414
DEC Memo:	"11/16/09 This spill was at the WCDOH bldg, C Lalak confirmed clean
5	up is done, nfamm"
Remarks:	"DUE TO AN OVERFILL ABOUT 10 GALLON SPILLED TO CONCRETE AND SOIL.
	CLEAN UP PENDING."
Material:	
Site ID:	421828
Operable Unit ID:	1177706
Operable Unit:	01
Material ID:	2170525
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	Gallons
Recovered:	10.00

Not reported Not reported Database(s)

EDR ID Number EPA ID Number

S105236833

Resource Affected:	
Oxygenate:	

Tank Test:

Facility ID:	0909156
Facility Type:	ER
DER Facility ID:	212473
Site ID:	421829
DEC Region:	3
Spill Date:	2009-11-16
Spill Number/Closed Date:	0909156 / 2009-11-16
Spill Cause:	Human Error
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	MBMASTRO
Referred To:	Not reported
Reported to Dept:	2009-11-16
CID:	
Water Affected:	Not reported
	Not reported Commercial/Industrial
Spill Source:	
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2009-11-16
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-11-16
Spill Record Last Update:	2009-11-16
Spiller Name:	MILLIE LOPEZ
Spiller Company:	CASTLE OIL
Spiller Address:	290 LOCUST AVE
Spiller City,St,Zip:	BRONX, NY
Spiller Company:	999
Contact Name:	MILLIE LOPEZ
Contact Phone:	(718) 579-3414
DEC Memo:	"11/16/09 This spill was at the WCDOH bldg, C Lalak confirmed clean
	up is done, nfamm"
Remarks:	"DUE TO AN OVERFILL ABOUT 10 GALLON SPILLED TO CONCRETE AND SOIL.
	CLEAN UP PENDING."
<b>NA</b> ( ) ( )	
Material:	104.000
Site ID:	421829
Operable Unit ID:	1177707
Operable Unit:	01
Material ID:	2170526
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	Gallons
Recovered:	10.00
Resource Affected:	Not reported

Not reported

Database(s)

EDR ID Number EPA ID Number

Tank Test:

Facility ID:	0308837
Facility Type:	ER
DER Facility ID:	212473
Site ID:	259814
DEC Region:	3
Spill Date:	2003-11-19
Spill Number/Closed Date:	0308837 / 2003-11-19
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
opin olass.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2003-11-19
CID:	322
Water Affected:	Not reported
Spill Source:	Unknown
Spill Notifier:	Health Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-11-19
Spill Record Last Update:	2003-12-02
Spiller Name:	UNKNOWN
Spiller Company:	Unknown
Spiller Address:	UNKNOWN
Spiller City,St,Zip:	UNKNOWN, NY
Spiller Company:	999
Contact Name:	CHRIS LALAK
Contact Phone:	(914) 424-4679
DEC Memo:	Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	WCHD-LALAK 11/19/03: Spill is unrecoverable per C. Lalak, WCDOH.
	Recommends NFA at this time."
Remarks:	"approx 10 gal unk oil on roadway - highway dept placing sand "
Motorial	
Material:	250014
Site ID: Operable Unit ID:	259814 875003
•	
Operable Unit: Material ID:	01
Material Code:	571327 0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
exygenate.	

Database(s)

EDR ID Number EPA ID Number

S105236833

## HEALTH DEPT OFFICE (Continued)

Tank Test:

Facility ID:	0109500
Facility Type:	ER
DER Facility ID:	212473
Site ID:	259813
DEC Region:	3
Spill Date:	2001-12-28
Spill Number/Closed Date:	0109500 / 2001-12-28
Spill Cause:	Equipment Failure
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2001-12-28
CID:	257
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Responsible Party
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
•	
Last Inspection:	Not reported
Recommended Penalty: UST Trust:	False
	False
Remediation Phase:	0
Date Entered In Computer:	2001-12-28
Spill Record Last Update:	2002-01-03
Spiller Name:	
Spiller Company:	HEALTH DEPT OFFICE
Spiller Address:	145 HUGUENOT ST
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	
Contact Name:	CHRIS LALAK
Contact Phone:	(917) 578-9269
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	WCDOH 12/28/2001 C. LALAK @ WCDOH HANDLED. SPILL CLEANED UP. NO
<b>-</b> .	FURTHER ACTION."
Remarks:	"all cleaned up less than 1 oz"
Material:	
Site ID:	259813
Operable Unit ID:	846776
Operable Unit:	01
Material ID:	527159
Material Code:	0031A
Material Name:	mercury
Case No.:	07439976
Material FA:	Hazardous Material
Quantity:	1.00
Units:	Gallons
Recovered:	1.00
Resource Affected:	Not reported
Oxygenate:	Not reported
	'

Map ID Direction		MAP FINDINGS		
Distance				EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	HEALTH DEPT OFFICE (Conti	inued)		S105236833
	Tank Test:			
				0400070504
208 NNE	BERGMAN REALTY SERVICES 140 HUGUENOT STREET	5	NY LTANKS	S106972591 N/A
1/4-1/2 0.288 mi.	NEW ROCHELLE, NY			
0.200 mi. 1521 ft.				
Relative:	LTANKS:			
Lower	Site ID:	350100		
	Spill Number/Closed Date:			
Actual: 67 ft.	Spill Date:	2005-07-28		
07 11.	Spill Cause: Spill Source:	Tank Test Failure Non Major Facility > 1,100 gal		
	Spill Class:	Known release with minimal potential for fire or hazard	L DEC Response.	
		Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	False		
	SWIS: Investigator:	6010 TDGHIOSA		
	Referred To:	WCDOH		
	Reported to Dept:	2005-07-28		
	CID:	444		
	Water Affected:	Not reported		
	Spill Notifier:	Tank Tester		
	Last Inspection: Recommended Penalty:	Not reported False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spiller Name:	2007-11-07 STEVE RING		
	Spiller Company:	RING HOME		
	Spiller Address:	140 HUGINOT STREET		
	Spiller City, St, Zip:	NEW ROCHELLE, NY		
	Spiller County:	001		
	Spiller Contact: Spiller Phone:	STEVE RING (732) 855-8600		
	Spiller Extention:	109		
	DEC Region:	3		
	DER Facility ID:	296544		
	DEC Memo:	"10/13/05 Closure letter sent to the RP from Danielle J		
	Remarks:	WCHD based on information submitted in a tank closu	ire report. NFA IG"	
	Remarks.			
	Material:			
	Site ID:	350100		
	Operable Unit ID:	1107682		
	Operable Unit:	01		
	Material ID: Material Code:	2097572 0001A		
	Material Code. Material Name:	#2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	Not reported		
	Units:	Gallons		

Database(s)

EDR ID Number EPA ID Number

S106972591

#### **BERGMAN REALTY SERVICES (Continued)**

Resource Affected: N	00 Not reported Not reported
Tank Test:	
Site ID: 3	350100
Spill Tank Test: 1	1549133
Tank Number: 1	l
Tank Size: 1	10000
Test Method: 0	)3
Leak Rate: .(	00
Gross Fail: N	Not reported
Modified By: V	Natchdog
Last Modified: N	Not reported
Test Method:	Horner EZ Check I or II

SPILL 0106072 / PBS 3-800919

**370 MAIN ST** 

**NEW ROCHELLE, NY** 

Spiller Contact:

Spiller Phone:

DEC Region:

Spiller Extention:

**DER Facility ID:** 

NY LTANKS S105135128 N/A

209 ENE 1/4-1/2 0.289 mi. 1527 ft.

#### LTANKS: Relative: Site ID: 133647 Lower Spill Number/Closed Date: 0106072 / 2001-11-13 Actual: Spill Date: 2001-09-07 60 ft. Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 6010 Investigator: jbodee Not reported Referred To: Reported to Dept: 2001-09-07 CID: 257 Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False False UST Involvement: Remediation Phase: 0 Date Entered In Computer: 2001-09-07 Spill Record Last Update: 2014-08-15 Spiller Name: STEVEN WOODS Spiller Company: Monroe College Spiller Address: 370 MAIN ST Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001

Not reported

Not reported

Not reported

3

114844

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	SPILL 0106072 / PBS 3-800919 DEC Memo:	"09/07/2001 PROPERTY FOR SALE. TANK TESTED BY POTENTIAL BUY TO REMOVE OR RETEST. 11/13/2001 TANK PASSED A RETEST AFTER FURTHER ACTION. 8/15/14: Hard copy file pulled for FOIL. File scanned	
		to PDF, will will entered into DecDocs. Paper file discarded. NOTE: WCDoH PBS records indicate this UST was Closed - in place and the site listed as Unregulated 7/30/2002. jod"	
	Remarks:	"will fill tank with sand and abandoned it"	
	Material:		
	Site ID:	133647	
	Operable Unit ID:	844476	
	Operable Unit:	01	
	Material ID:	530955	
	Material Code:	0001A	
	Material Name:	#2 fuel oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	Not reported	
	Units:	Gallons	
	Recovered:	Not reported	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
	Tank Test:		
	Site ID:	133647	
	Spill Tank Test:	2495803	
	Tank Number:	1	
	Tank Size:	2000	
	Test Method:	21	
	Leak Rate:	Not reported	
	Gross Fail:	Not reported	
	Modified By:	JBODEE	
	Last Modified:	Not reported	
	Test Method:	Horner EZY3/EZY3 Locator Plus	
210 SSE 1/4-1/2 0.295 mi.	NICK MAZZA RESIDENCE 20 DAVIS AVE NEW ROCHELLE, NY	NY LTANKS	S104621408 N/A
1556 ft.			
Deletive	LTANKS:		
Relative: Lower	Site ID: Spill Number/Closed Date:	211468	
Actual:	Spill Date:	2000-04-13	
77 ft.	Spill Cause:	Tank Test Failure	
	Spill Source:	Private Dwelling	
	Spill Class:	Possible release with minimal potential for fire or hazard or Known	
	opin oldob.	release with no damage. DEC Response. Willing Responsible Party.	
		Corrective action taken.	
	Cleanup Coased		
	Cleanup Ceased:	Not reported	
	Cleanup Meets Standard:	True	
	SWIS:	6010 ibadaa	
	Investigator:	jbodee Net reported	
	Referred To: Reported to Dept:	Not reported	
	Reported to Dept:	2000-04-13	

Database(s)

CK MAZZA RESIDENCE (Co	
CID:	282
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2000-04-13
Spill Record Last Update:	2000-05-03
Spiller Name:	N/A
Spiller Company:	NICK MAZZA
Spiller Address:	20 DAVIS AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	N/A
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	175240
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	O'DEE 04/14/2000 ENVIROSTAR REPAIRED; U.S. TANK TO RETEST ON
	4/17/2000. 04/20/2000 U.S. TANK TECH RETESTED TANK AFTER ENVIROSTA
	REPLACED PIPING. TANK PASSED RETEST. NFA"
Remarks:	"tank failed the test. he did not have the homeowners name or phone
	number "
Material: Site ID:	211468
Operable Unit ID:	822249
Operable Unit:	01
Material ID:	288777
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Chygonato.	
Tank Test:	
Site ID:	211468
Spill Tank Test:	1525485
Tank Number:	1
Tank Size:	1000
Test Method:	18
	.00
Leak Rate	
Leak Rate: Gross Fail:	Not reported
Gross Fail:	Not reported
	Not reported Spills Not reported

Database(s)

211 SSW	BLESSED SACREMENT SCHO 24 MAPLE AVE.	OL NY LTANKS S10215 NY Spills N/A	54123
33VV 1/4-1/2	NEW ROCHELLE, NY	NY Spills N/A	
0.300 mi.			
1586 ft.			
Relative:	LTANKS:		
Higher	Site ID:	80066	
-	Spill Number/Closed Date:	0204857 / 2003-10-03	
Actual:	Spill Date:	2002-08-07	
94 ft.	Spill Cause:	Tank Test Failure	
	Spill Source: Spill Class:	Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Response.	
	opiii olass.	Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
	•	True	
	SWIS:	6010	
	Investigator:	WCHD	
	Referred To: Reported to Dept:	Westchester Cnty Health Dept 2002-08-07	
	CID:	211	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	False	
	Remediation Phase: Date Entered In Computer:	0 2002-08-07	
	Spill Record Last Update:		
	Spiller Name:	Not reported	
	Spiller Company:	NEW ROCHELLE CATH MIDDLE	
	Spiller Address:	24 MAPLE AV	
	Spiller City,St,Zip:	NEW ROCHELLE, NY	
	Spiller County: Spiller Contact:	001 MARV	
	Spiller Phone:	(914) 637-7505	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	74246	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
		WCHD-MAGNUSON 10/17/03: Letter to Blessed Sacrament Church from Karen Magnuson, WCDOH dated 10/3/2003. Closure report by RND Services has	
		been reviewed. WCDOH recommends NFA at this time."	
	Remarks:		
	Material:		
	Site ID:	80066	
	Operable Unit ID:	856140	
	Operable Unit:	01	
	Material ID:	519079	
	Material Code:	0001A	
	Material Name: Case No.:	#2 fuel oil Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Gallons	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	

Database(s)

EDR ID Number EPA ID Number

## BLESSED SACREMENT SCHOOL (Continued)

Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By:	80066 1527359 1 2000 03 .00 Not reported Spills
Modified By: Last Modified: Test Method:	Spills Not reported Horner EZ Check I or II

## SPILLS:

SPILLS:	
Facility ID:	9111148
Facility Type:	ER
DER Facility ID:	107755
Site ID:	124421
DEC Region:	3
Spill Date:	1992-01-29
Spill Number/Closed Date:	9111148 / 1992-03-17
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	1992-01-29
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Other
Cleanup Ceased:	1992-02-05
Cleanup Meets Std:	True
Last Inspection:	1992-02-05
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1992-01-30
Spill Record Last Update:	1992-03-17
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	111
Remarks:	"OIL DISCOVERED SEEPING OUT OF GROUND/BLACKTOP WALKWAY (BETWEEN
	SCHOOL AND BEAUTY SALON) SUSPECT BROKEN RETURN LINE APPROX 30' FROM
	TANK TO BURNER - 2K TANK AL EASTMAN TO EIR CASTLE OIL CREW ENROUTE"
Material:	
Site ID:	124421
Operable Unit ID:	964875
Operable Unit:	01
Material ID:	416206
Material Code:	0001A

Database(s)

EDR ID Number EPA ID Number

Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	9008354
Facility Type:	ER
DER Facility ID:	107755
Site ID:	124420
DEC Region:	3
Spill Date:	1990-10-30
Spill Number/Closed Date:	9008354 / 1990-11-26
Spill Cause:	Equipment Failure
Spill Class:	Not reported
SWIS:	6010 totaliana
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept: CID:	1990-10-31 Not reported
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Fire Department
Cleanup Ceased:	1990-10-31
Cleanup Meets Std:	True
Last Inspection:	1990-10-31
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1990-11-06
Spill Record Last Update:	1990-11-26
Spiller Name:	Not reported
Spiller Company:	CASTLE FUEL
Spiller Address:	290 LOCUST AVE
Spiller City, St, Zip:	BRONX, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY "
Remarks:	"PIPE BURST DURING DELIVERY WC FIRE CONTROL ON SCENE ABSORBANT F
	HAVE BEEN PUT DOWN CHIEF MCCAFFREY CONTACTED BUT HE WASN'T ON S HAS NO INFO."
Material:	
Site ID:	124420
Operable Unit ID:	945552
Operable Unit:	01
Material ID:	432188
Material Code: Material Name:	0001A #2 fuel oil

### SACREMENT SCHOOL íc ... ....

Database(s)

EDR ID Number EPA ID Number

S102154123

### **BLESSED SACREMENT SCHOOL (Continued)**

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	50.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

212 SW 1/4-1/2 0.303 mi. 1599 ft.	DOMINIC PROCOPIO 618 MAIN ST NEW ROCHELLE, NY		NY LTANKS NY Spills	S103558292 N/A
Relative: Lower	LTANKS: Site ID: Spill Number/Closed Date:	278454 9809866 / 2004-03-30		
Actual: 87 ft.	Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	6010 WCHD Westchester Cnty Health Dept 1998-11-05 270 Not reported Tank Tester Not reported False False 0 : 1998-11-05	Response.	
	Material: Site ID: Operable Unit ID: Operable Unit:	278454 1067125 01		

Database(s)

DOMINIC PROCOPIO (Continu	ied)	S103558292
Material ID:	313759	
Material Code:	0001A	
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	278454	
Spill Tank Test:	1546499	
Tank Number:	1	
Tank Size:	1500	
Test Method:	03	
Leak Rate:	.00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Horner EZ Check I or II	
SPILLS: Facility ID: Facility Type:	0408557 ER	
Facility Type:		
DER Facility ID: Site ID:	226099	
DEC Region:	333327 3	
Spill Date:	2004-11-03	
Spill Number/Closed Date:	0408557 / 2005-03-17	
Spill Cause:	Other	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
014/00	Willing Responsible Party. Corrective action taken.	
SWIS:	6010 MOUD	
Investigator:	WCHD	
Referred To:	WCDOH	
Reported to Dept:	2004-11-03	
CID:	407 Not concreted	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier:	Health Department	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust: Remediation Phase:	False	
	0 2004-11-03	
Date Entered In Computer:	2004-11-03 2005-04-05	
Spill Record Last Update:		
Spiller Name:	DOMINICKO PROCOPIO	
Spiller Company:	Not reported 618 MAIN ST	
Spiller Address: Spiller City,St,Zip:	NEW ROCHELLE, NY	
	001	
Spiller Company:		

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	DOMINIC PROCOPIO (Continu	Jed)	S103558292
	Contact Name: Contact Phone: DEC Memo:	DOMINICKO PROCOPIO (914) 636-9570 "PBS #3-800233 11/16/2004 Stephan Goreau of WCDOH spill update several inches in basement of sewer/oil mixBHY 4/4/05: Letter to Vincent Rippa, Domenico Procopio Property from Stefan Goreau, WCDOI deted 17Mr2005. WCDOH requires NEA at this time."	ч
	Remarks:	dated 17Mar2005. WCDOH requires NFA at this time." "Imporperly Abondoned tank."	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	333327 1095482 01 575615 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported	
AU213 NW 1/4-1/2 0.314 mi. 1657 ft.	RESIDENCE 60 GRAND STREET NEW ROCHELLE, NY Site 1 of 2 in cluster AU	NY LTANKS NY Spills	S107788125 N/A
Relative: Lower Actual: 80 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address:	2004-10-07 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 TDGHIOSA Not reported 2004-10-07 408 Not reported Responsible Party Not reported False False 0 2004-10-07	

### Map ID Direction Distance Elevation Site

MAP FINDINGS

Database(s) EPA ID

ESIDENCE (Continued)	S1077
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	ROB HILL
Spiller Phone:	(718) 579-3414
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	267201
DEC Memo:	HH
Remarks:	"TRUCK DIRVER OVERFILLED AND BLEW A LINE. CREWS ARE IN ROUTE."
Material:	
Site ID:	332054
Operable Unit ID:	1094311
Operable Unit:	01
Material ID:	574419
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
SPILLS:	
Facility ID:	0602271
Facility ID: Facility Type:	ER
Facility ID:	ER 267201
Facility ID: Facility Type: DER Facility ID: Site ID:	ER 267201 364705
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region:	ER 267201 364705 3
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date:	ER 267201 364705 3 2006-05-31
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response.
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported False
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported False Not reported
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported False Not reported False
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported False Not reported False Not reported False False False False False O
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase:	ER 267201 364705 3 2006-05-31 0602271 / 2007-02-16 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2006-05-31 444 Not reported Private Dwelling Other Not reported False Not reported False Not reported False False False False False O

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

<b>RESIDENCE</b> (Continued)	S107788
Spiller Company:	CIOTTI RESIDENCE
Spiller Address:	60 GRAND STREET
Spiller City, St, Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	ROBERT CIOTTI
Contact Phone:	(914) 479-8680
DEC Memo:	ин ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) ( ) (
Remarks:	"TESTED THE REMOTE FILL PIPE AND FOUND IT NOT WORKING: 02/15/07
	Northeast Envoronmental reported that they excavated 12.31 tons of
	petroleum impacted soil. NFA TG"
Material:	
Site ID:	364705
Operable Unit ID:	1122726
Operable Unit:	01
Material ID:	2112202
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	0601618
Facility Type:	ER
DER Facility ID:	267201
Site ID:	363896
DEC Region:	3
Spill Date:	2006-05-12
Spill Number/Closed Date:	0601618 / 2006-11-07
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
0)4/10	Unknown Responsible Party. Corrective action taken. (ISR)
SWIS:	
Investigator:	TDGHIOSA Not reported
Referred To: Reported to Dept:	Not reported 2006-05-12
CID:	408
Water Affected:	STORM DRAINS ON GRAN
Spill Source:	Private Dwelling
Spill Notifier:	Health Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-05-12
Spill Record Last Update:	2006-11-07
Spiller Name:	Not reported
Spiller Company:	UNKNOWN

AU214 NW

1/4-1/2 0.321 mi. 1696 ft. **Relative:** Lower

Actual: 80 ft.

Database(s)

EDR ID Number EPA ID Number

RESIDENCE (Continued)		S107788125
Spiller Address:	Not reported	
•	Not reported NY	
Spiller City,St,Zip: Spiller Company:	999	
Contact Name:	WAYNE SCHNEIDER	
Contact Name:	(914) 813-5972	
DEC Memo:	"05/12/06 Friday Stefan Goreau reported from the field that the	
DEC Mento.	spilled oil resembled motor oil rather than fuel oil, so he doesn't	
	believe that the spill came from the residence. Northeast	
	Environmental was called by the homeowner to do the cleanup but now	
	the homeowner is not considered the RP. Since rain is imminent and	
	Northeast has a vac truck on site, NE was advised to pump the oil out	
	of the drains. DEC to pick up the expense. TG 11/07/06 IRS completed.	
	TG"	
Remarks:	"CAUSE IS EITHER TANK OVERFILL OR CHECK VALVE FAILURE."	
Material:		
Site ID:	363896	
Operable Unit ID:	1121950	
Operable Unit:	01	
Material ID:	2111430	
Material Code:	0015	
Material Name:	motor oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
		0400550000
GUIDANCE CENTER INC	NY LTANKS	S102556009
70 GRAND ST	NY LTANKS	S102556009 N/A
0 GRAND ST	NY LTANKS	
70 GRAND ST NEW ROCHELLE, NY	NY LTANKS	
70 GRAND ST NEW ROCHELLE, NY	NY LTANKS	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID:	77017	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date:	77017	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date:	77017 9613894 / 1997-10-03 1997-02-26	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response.	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True	
O GRAND ST IEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010	
TO GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1997-02-26	
O GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1997-02-26 365	
A Constant of the second stress of the second stres	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1997-02-26 365 Not reported	
70 GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1997-02-26 365 Not reported Other	
70 GRAND ST NEW ROCHELLE, NY Site 2 of 2 in cluster AU LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected:	77017 9613894 / 1997-10-03 1997-02-26 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 tdghiosa Not reported 1997-02-26 365 Not reported	

Database(s)

EDR ID Number **EPA ID Number** 

S102556009

Material:

Units:

LTANKS:

Spill Source:

Cleanup Meets Standard:

True

6010 JBODEE

Not reported

Spill Class:

Investigator: Referred To:

SWIS:

215

NNW

1/4-1/2

0.328 mi. 1731 ft.

Relative:

Lower

Actual:

73 ft.

UST Involvement: True **Remediation Phase:** Λ Date Entered In Computer: 1997-02-26 Spill Record Last Update: 1997-10-22 Spiller Name: STEVEN SMITH Spiller Company: **GUIDANCE CENTER INC** Spiller Address: 70 GRAND ST Spiller City,St,Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: STEVEN SMITH Spiller Phone: (914) 636-4440 Spiller Extention: 250 DEC Region: 3 **DER Facility ID:** 71920 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY 10/03/97 LETTER SENT; BASED ON TANK REMOVAL REPORT, NFA; " "OLD GASOLINE TANK FOUND UNDER THE GROUND - FOUND CONTAMINATED SOIL Remarks: PHASE 2 COMPLETED - NO REMEDATION STARTED OWNER OF PROPERTY WILL AWAIT DIRECTION FROM DEC ABOUT TANK REMOVAL" Site ID: 77017 Operable Unit ID: 1041477 Operable Unit: 01 Material ID: 339001 Material Code: 0009 Material Name: aasoline Case No .: Not reported Material FA: Petroleum .00 Quantity: Gallons Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: **RITZCOVAN - TTF** NY LTANKS S118263505 22 BURLING LANE N/A **NEW ROCHELLE, NY** 514123 Site ID: Spill Number/Closed Date: 1506693 / 2016-03-22 Spill Date: 2015-09-22 Spill Cause: Tank Test Failure

Database(s)

EDR ID Number EPA ID Number

### **RITZCOVAN - TTF (Continued)**

RITZCOVAN - TTF (Continued	)
Reported to Dept:	2015-09-24
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	
	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	
Spiller Name:	Not given
Spiller Company:	Ritzcovan (Owner)
Spiller Address:	22 BURLING LANE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	999
Spiller Contact:	BRUCE
Spiller Phone:	9147120600
Spiller Extention:	1
DEC Region:	3
DER Facility ID:	468599
DEC Memo:	"9/24/15 Spoke to Bruce, the contact, who is trying to arrange tank
	removal, as he is tentatively purchasing the property from Ritzcovan.
	I gave him a list of contractors in Westchester. dw 3/22/16: Grazi-1
	Environmental disposed of the leaking UST and approximately 10.15
	tons of petroleum contaminated soil. Soil sample results submitted
	for review. Tank Closure Report entered into DecDocs system. Based
	upon the information provided, no further action is required at this
	time. jod"
Remarks:	"unknown whether contaminated. option recover & repair, or remove;
	unknown at this time"
Matarial	
Material:	F4 44 00
Site ID:	514123
Operable Unit ID:	1263331
Operable Unit:	01
Material ID:	2267021
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Units:	Not reported
Units: Recovered:	Not reported Not reported
Units: Recovered: Resource Affected:	Not reported Not reported Not reported
Units: Recovered: Resource Affected:	Not reported Not reported Not reported
Units: Recovered: Resource Affected: Oxygenate:	Not reported Not reported Not reported
Units: Recovered: Resource Affected: Oxygenate: Tank Test:	Not reported Not reported Not reported
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID:	Not reported Not reported Not reported 514123 2498471
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test:	Not reported Not reported Not reported 514123
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size:	Not reported Not reported Not reported 514123 2498471 Not reported
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method:	Not reported Not reported Not reported 514123 2498471 Not reported 275 NN
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate:	Not reported Not reported Not reported 514123 2498471 Not reported 275 NN Not reported
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail:	Not reported Not reported Not reported 514123 2498471 Not reported 275 NN Not reported Not reported Not reported Not reported
Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate:	Not reported Not reported Not reported 514123 2498471 Not reported 275 NN Not reported

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	RITZCOVAN - TTF (Continued			S118263505
	Test Method:	Testing Not Required		
AV216 WNW 1/4-1/2 0.332 mi.	CASARRA RESIDENCE 9 BADEAU PL NEW ROCHELLE, NY		NY LTANKS	S105997517 N/A
1754 ft.	Site 1 of 2 in cluster AV			
Relative: Higher Actual: 104 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class:	2002-12-06 Tank Test Failure Private Dwelling		
	Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Company: Spiller Company: Spiller Company: Spiller Cottact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:		Field was	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	157707 860605 01 516149 0001A #2 fuel oil Not reported Petroleum .00		

Database(s)

EDR ID Number EPA ID Number

### **CASARRA RESIDENCE (Continued)** S105997517 Units: Gallons .00 Recovered: Not reported **Resource Affected:** Not reported Oxygenate: Tank Test: A D VANDROFF NY LTANKS S102241692 217 **47 MAPLE AVENUE** SSW NY Spills N/A 1/4-1/2 **NEW ROCHELLE, NY** 0.334 mi. 1765 ft. LTANKS: **Relative:** Site ID: 178537 Lower Spill Number/Closed Date: 9603128 / 1996-06-14 Actual: Spill Date: 1996-06-05 87 ft. Spill Cause: Tank Test Failure Spill Source: Private Dwelling Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: tdghiosa Referred To: Not reported 1996-06-05 Reported to Dept: 205 CID: Not reported Water Affected: Spill Notifier: **Responsible Party** Last Inspection: Not reported Recommended Penalty: False UST Involvement: False Remediation Phase: 0 Date Entered In Computer: 1996-06-05 Spill Record Last Update: 1996-09-04 A D VANDROFF Spiller Name: Spiller Company: A D VANDROFF Spiller Address: **47 MAPLE AVENUE** Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: A D VANDROFF Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 149935 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY 06/14/96 SEE SPILL # 9603064" Remarks: "gross failure of tank."

Material:

Tank Test:

Database(s)

EDR ID Number EPA ID Number

# A D VANDROFF (Continued)

SPILLS: Facility ID:	9603064
	9003004 ER
Facility Type: DER Facility ID:	
Site ID:	248269
	307417
DEC Region:	3
Spill Date:	1996-06-04
Spill Number/Closed Date:	9603064 / 1996-08-12
Spill Cause:	Unknown
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept:	1996-06-04
CID:	349
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	1996-06-04
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-06-04
Spill Record Last Update:	1996-10-21
Spiller Name:	OWNER - ARTHUR DANDROFF
Spiller Company:	Not reported
Spiller Address:	47 MAPLE AV
Spiller City, St, Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	OWNER - ARTHUR DANDROFF
Contact Phone:	(941) 954-4445
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY 06/04/96 WCHD TO INSPECT 06/14/96 SEE SPILL # 9603128
	08/12/96 CONTENTS GONE IN FOUR DAYS AFTER FILL UP TANK REMOVED LINES
	TESTED NO LEAKS FOUND FROM TESTS SMALL HOLES FOUND IN TANKS VERY
	MINIMAL CONTAMINATION "
Remarks:	"APARTMENT BLDG - SUPERINTENDENT MRS CHURCHILL 914-636-4142 -
	RECIEVED 900 GALLONS ON THURSDAY - NOW ITS IS EMPTY - CHECK OF AREA
	INCLUDING SEWERS NO ODOR - FD ON SCENE - WILL BE TESTING W/WATER -
	TEMP. TANK TO BE PUT IN"
N de la stel	
Material:	007447
Site ID:	307417
Operable Unit ID:	1030609
Operable Unit:	01
Material ID:	349302
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported

Database(s)

	A D VANDROFF (Continued)			S102241692
	Oxygenate:	Not reported		
	Tank Test:			
AW218 WNW 1/4-1/2 0.336 mi. 1776 ft.	NYNEX 40 WASHINGTON AVE GREENBUSH, NY Site 1 of 3 in cluster AW	N	- Y LTANKS	S100164268 N/A
	LTANKS:			
Relative: Higher	Site ID:	60528		
Actual: 112 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	1988-07-14 Tank Test Failure Commercial/Industrial Not reported 1988-07-22 True 6000 jeokesso Not reported 1988-07-14 Not reported Not reported Not reported Tank Tester 1988-07-22 False False 0	25	
	Material:			
	Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	60528 918404 01 458797 0001A #2 fuel oil Not reported Petroleum .00		

Database(s)

	NYNEX (Continued)			S100164268
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
	Site ID:	60528		
	Spill Tank Test:	1534290		
	Tank Number:	Not reported		
	Tank Size:	0		
	Test Method: Leak Rate:	00 .00		
	Gross Fail:	Not reported		
	Modified By:	Spills		
	Last Modified:	Not reported		
	Test Method:	Unknown		
219	EXXON S/S		NY LTANKS	1000553075
SW 1/4-1/2	635 MAIN STREET NEW ROCHELLE, NY		NY Spills	N/A
0.337 mi.	NEW ROCHELLE, NY			
0.337 mi. 1778 ft.				
Relative:	LTANKS:			
Lower	Site ID:	140421		
Actual:	Spill Number/Closed Date:			
85 ft.	Spill Date:	1992-09-16 Tank Follura		
0011.	Spill Cause: Spill Source:	Tank Failure Gasoline Station or other PBS Facility		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	Response	
	Opin Oldss.	Willing Responsible Party. Corrective action taken.	response.	
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	False		
	SWIS:	6010		
	Investigator:	WXWADSWO		
	Referred To:	Not reported		
	Reported to Dept:	1992-09-16		
	CID: Water Affected:	Not reported		
	Spill Notifier:	Not reported Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	True		
	Remediation Phase:	0		
	Date Entered In Computer			
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company:	EXXON		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	WESTBURG, ZZ		
	Spiller County: Spiller Contact:	001 Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	119925		

EDR ID Number Database(s) EPA ID Number

EXXON S/S (Continued)	1000553075
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WADSWORTH 3/11/05 per contractors report 7 tanks removes all in good condition (no evidence of holes or cracks; no detect in post
	excavation samplesclose "
Remarks:	"DURING TANK REMOVAL CONTAMINATED SOIL DISCOVERED WILL TEST"
Material:	
Site ID:	140421
Operable Unit ID:	970699
Operable Unit:	01
Material ID:	407611
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity: Units:	.00 Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
SPILLS:	
Facility ID:	1405322
Facility Type:	ER
DER Facility ID: Site ID:	119925
	498745 3
DEC Region: Spill Date:	5 2014-08-15
Spill Number/Closed Date:	
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
·	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	RDBENDEL
Referred To:	Not reported
Reported to Dept:	2014-08-15
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility Other
Spill Notifier: Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	4
Date Entered In Computer	2014-08-15
Spill Record Last Update:	2016-03-09
Spiller Name:	Not reported
Spiller Company:	CUMBERLAND FARMS 70288
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999

Database(s)

EDR ID Number EPA ID Number

### 1000553075

EXXON S/S (Continued)	1000553075
Contact Name: Contact Phone: DEC Memo:	JOHN Not reported "8-15-14 Spoke with Angela Pimento at CF. She will have John return call to dispatch desk. jm Recv'd callback from Chris Lalak - WCDOH. He has spoken with John. Double wall fiberglass piping from dispensers to tanks. Leak is contained in tanktop sump. System has has been shut down at this time until they figure out what they are going to do. They believe they will probably replace lines. Chris says no leak to environment and he will be taking lead. jm 5-15 new spill 15-01325; Phase 2report 10-15-15 email status request sent to WCHD & Cumby RDB 10-22-15, from Cumby In response to the line failure, CFI engaged Island Pump & Tank (IPT) to perform the repairs. In lieu of replacing the product piping, IPT installed a siphon bar on the regular tanks and removed the submersible pump from the regular tank that had the failed product piping. IPT then removed and capped the regular product piping that had failed. The secondary line was tested and the dispenser pans and STP sumps were hydrostatically tested and passed. RDB 2-16 new SPills 15-10746 3-8-16 during meeting with WCHD, Singh, his att, his consultant, Cumby, their consultant and att, taking place in New Rochelle. Closure was denied on spills 14-05322 & 15-01325and RPs agreed to a scope of work by March 16. RDB"
Remarks:	Not reported "spill to containment/clean up complete"
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	498745 1248186 01 2249583 0009 gasoline Not reported Petroleum 20.00 Gallons Not reported Not reported Not reported
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	0514511 ER 119925 361248 3 2006-03-20 0514511 / 2006-03-20 Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 RXAMATO WCDOH 2006-03-20 444

Database(s)

EDR ID Number EPA ID Number

### 1000553075

EXXON S/S (Continued)

ON S/S (Continued)	
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-03-20
Spill Record Last Update:	2006-03-31
Spiller Name:	MELISSA GLIDEN
Spiller Company:	CUMBERLAND FARM
Spiller Address:	635 MAIN STREET
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	MELISSA GLIDEN
Contact Phone:	(800) 225-9702 3412
DEC Memo:	"03/21/06: Closed - NFA R. Amato"
Remarks:	"water in the dispenser pan and tyree enroute to clean up"
latarial	

Material:

Tank Test:

AX220 NE 1/4-1/2 0.343 mi. 1810 ft.	GETTY S/S ECHO & BOSTON POST RD NEW ROCHELLE, NY Site 1 of 2 in cluster AX	NY LTANKS	S105054437 N/A
Relative: Lower Actual: 42 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase:	124816 8602124 / 1989-11-28 1986-06-28 Tank Failure Commercial/Industrial Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. 1989-11-28 True 6010 tdghiosa Not reported 1986-06-28 Not reported 1986-06-28 Not reported Not reported Fire Department 1988-08-19 False True 0	
	Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company:	1988-09-21	

AW221

WNW

1/4-1/2

0.349 mi. 1842 ft.

**Relative:** 

Higher

Actual:

110 ft.

Database(s)

EDR ID Number EPA ID Number

### **GETTY S/S** (Continued) S105054437 Spiller Address: Not reported Spiller City, St, Zip: NY Spiller County: 999 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 108052 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead DEC Field was GHIOSAY / / : 6/29-NEPCCO DRILLED RECOVERY WELLS. / / : 6/29-NEPCCO DRILLED RECOVERY WELLS 6/30-PRESSURE TESTS UNSUCCESSFUL. //: 6/29-NEPCCO DRILLED RECOVERY WELLS 6/30-PRESSURE TESTS UNSUCCESSFUL.7/1/86-TANKS MUST BE PETRO-TITE TESTED. //: 7/1/86-PROBLEM REPAIRED-NFAY WELLS 6/30-PRESSURE TESTS UNSUCCESSFUL.7/1/86-TANKS MUST BE PETRO-TITE TESTED. / / : 7/23/86-NO EXPLOSIVE READINGS IN SEWER.MONITORING WELLS ON SITE HAVE NO FREE PRODUCT. 08/18/88: BAILED ALL WELLS.NO FREE PRODUCT. " "FD FLUSHED SEWERS.NEPCO DRILLING RECOVERY WELLS. ALL WELLS CLEAN OF Remarks: FREE PRODUCT." Material: Site ID: 124816 **Operable Unit ID:** 898693 Operable Unit: 01 Material ID: 478579 Material Code: 0009 Material Name: aasoline Case No .: Not reported Material FA: Petroleum .00 Quantity: Units: Not reported Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: **50 WASHINTON AVE** NY LTANKS S105999773 **50 WASHINTON AVE** N/A **NEW ROCHELLE, NY** Site 2 of 3 in cluster AW LTANKS: 280324 Site ID: Spill Number/Closed Date: 0305820 / 2003-12-23 Spill Date: 2003-09-02 Spill Cause: Tank Failure Spill Source: Commercial/Industrial Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. **Cleanup Ceased:** Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: WCHD Referred To: Westchester Cnty Health Dept

Database(s)

EDR ID Number EPA ID Number

S105999773

### 50 WASHINTON AVE (Continued)

Por	ported to Dept:	2003-09-02
CID		2003-09-02
	ter Affected:	Not reported
	ll Notifier:	Responsible Party
	st Inspection:	Not reported
	commended Penalty:	False
	T Involvement:	False
	mediation Phase:	0
	e Entered In Computer:	
	Il Record Last Update:	
	ller Name:	UNKNOWN
	ller Company:	Unknown
	ller Address:	UNKNOWN
	ller City,St,Zip:	UNKNOWN, NY
Spil	ller County:	999
Spil	ller Contact:	MIGEL ROSARIO
Spil	ller Phone:	(914) 632-0211
Spil	ller Extention:	Not reported
DE	C Region:	3
DEI	R Facility ID:	227605
DE	C Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
		WCHD-SCHNEIDER 12/12/03 PREVIOUSLY REPORTED AS SPILL 03-02359.
		12/26/03: Letter sent to Fr. Patrick V. McNamara, St Gabriel
		Church-Archdiocese NY from Wayne Schneider, WCDOH dated 23Dec2003.
		Closure report has been reviewed. WCDOH recommends NFAA at this time."
		Not reported
Rer	marks:	"ST GABRIELS CHURCH - FR PATRICK MCNAMARA WOULD LIKE A CALL HE CAN BE
		REACHED AT 914-632-0211 THE CHURCH IS RESPONSIBLE FOR THE SPILL "
Materi		
	al. e ID:	000004
		280324
•	erable Unit ID:	874264
	erable Unit:	01
	terial ID:	503057
	terial Code:	0001A
	terial Name:	#2 fuel oil
	se No.:	Not reported
	terial FA:	Petroleum
	antity:	.00
Uni		Gallons
	covered:	.00
	source Affected:	Not reported
Оху	/genate:	Not reported

Tank Test:

Database(s)

AW222 WNW 1/4-1/2 0.349 mi.	ST GABRIEL SCHOOL 50 WASHINGTON AVE NEW ROCHELLE, NY	NY LTANKS S105999147 N/A
1842 ft.	Site 3 of 3 in cluster AW	
Relative: Higher Actual: 110 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo:	2003-06-05 Tank Test Failure Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD Westchester Cnty Health Dept 2003-06-05 205 Not reported Responsible Party Not reported False False 0 2003-06-05
	Remarks:	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	314440 869188 01 506840 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported Not reported

Database(s)

EDR ID Number EPA ID Number

S105999147

Tank Test:	
Site ID:	314440
Spill Tank Test:	1528429
Tank Number:	1
Tank Size:	3000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

### AV223 RESIDENCE

WNW **18 BADEAU PLACE** 1/4-1/2 **NEW ROCHELLE, NY** 0.350 mi. 1849 ft. Site 2 of 2 in cluster AV LTANKS: **Relative:** 177416 Site ID: Higher Spill Number/Closed Date: 9609269 / 1996-10-24 Actual: Spill Date: 1996-10-24 104 ft. Spill Cause: Tank Overfill Spill Source: Private Dwelling Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1996-10-24 CID: 266 Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported **Recommended Penalty:** False **UST Involvement:** False Remediation Phase: 0

> Date Entered In Computer: 1996-10-24 Spill Record Last Update: 1996-12-05

Not reported

001

3

JULIO VALER

JULIO VALER

(914) 636-8917

Not reported

149078

GHIOSAY "

CLEANED UP."

**18 BADEAU PLACE** 

NEW ROCHELLE, NY

"Prior to Sept, 2004 data translation this spill Lead\_DEC Field was

"CUSTOMER ORDERED TOO MUCH OIL. SPILLED ONTO BLACKTOP DRIVEWAY.

Spiller Name:

Spiller Company:

Spiller City, St, Zip:

Spiller Address:

Spiller County:

Spiller Contact:

Spiller Extention:

**DER Facility ID:** 

Spiller Phone:

DEC Region:

DEC Memo:

Remarks:

NY LTANKS S102663947 N/A

Database(s)

EDR ID Number EPA ID Number

### **RESIDENCE** (Continued)

Material:	
Site ID:	177416
Operable Unit ID:	1037374
Operable Unit:	01
Material ID:	345000
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	5.00
Units:	Gallons
Recovered:	5.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

AY224 South 1/4-1/2 0.351 mi. 1854 ft.	MICELI HOME 194 CENTRE AVE NEW ROCHELLE, NY Site 1 of 2 in cluster AY	NY LTANKS	S108059468 N/A
Relative: Lower Actual: 78 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Cottact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID:	2006-07-13 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-07-13 444 Not reported Other Not reported False False 0 2006-07-13	

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	MICELI HOME (Continued)		S108059468
	DEC Memo:	"CLOSING REPORT TO JOHN O'DEE. October 22, 2006: NORTHEAST ENVIRONMENTAL DISPOSED OF LUST AND 23.30 TONS OF CONTAMI BASED UPON INFORMATION PROVIDED TO DEC, NO FURTHER ACTIO AT THIS TIME. jod"	
	Remarks:	"1000 gallon tank had holes"	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	366997 1124924 01 2114431 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported	
225 West 1/4-1/2 0.352 mi. 1859 ft.	CITIZEN 33 GROVE ST NEW ROCHELLE, NY	NY LTANKS	S100165790 N/A
Relative: Lower	LTANKS: Site ID:	135309	
Actual: 89 ft.	Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller City,St,Zip: Spiller County:	1988-01-07 Tank Failure Private Dwelling Not reported 1989-11-28 True 6010 tdghiosa Not reported 1988-01-07 Not reported Not reported Fire Department Not reported Fire Department Not reported False False 0	

**CITIZEN (Continued)** 

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

### S100165790

S106869098

N/A

CHIZEN (Continued)	· · · · · · · · · · · · · · · · · · ·
Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	Not reported Not reported 3 116184 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY " "TANK RUPTURE IN CITIZEN'S BASEMENT. TANK TO BE EMPTIED."
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	135309 913258 01 463968 0001A #2 fuel oil Not reported Petroleum 550.00 Gallons .00 Not reported Not reported
Tank Test:	
DIIORGI HOME 47 WARREN STREET NEW ROCHELLE, NY Site 1 of 2 in cluster AZ LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill	2005-04-07 Tank Failure Private Dwelling Known release that creates potential for fire or hazard. (Highly Improbable) Not reported True 6010 JBODee Not reported 2005-04-07 444 Not reported Other Not reported False False 0 2005-04-07
	Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks: Material: Site ID: Operable Unit ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: DIIORGI HOME 47 WARREN STREET NEW ROCHELLE, NY Site 1 of 2 in cluster AZ LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Number/Closed Date: Spill Class: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer:

MAP FINDINGS

Database(s)

	DIIORGI HOME (Continued)	S106869098
	Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	DIIORGI HOME 47 WARREN STREET NEW ROCHELLE, NY 001 ANTHONY DIIORGI Not reported 3 289715 "August 28, 2005: GC RELIABLE REMOVED LUST AND CONTAMINATED SOIL. NORTHEST ENVIRONMENTAL DISPOSED OF 18 DRUMS OF SOIL. BASED UPON INFORMATION PROVIDED TO DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod" "SHE WILL CALLL BACK WITH MORE INFO:"
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	343230 1101915 01 582154 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported
BA227 ENE 1/4-1/2 0.355 mi. 1877 ft.	RESIDENCE 10 LAFAYETTE ST NEW ROCHELLE, NY Site 1 of 3 in cluster BA	NY LTANKS S107523528 N/A
Actual: 47 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection:	358990 0512638 / 2006-03-15 2006-02-01 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-02-01 407 Not reported Other Not reported

MAP FINDINGS

Database(s)

	RESIDENCE (Continued)			S107523528
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spiller Name:	MARIO KOTLAR		
	Spiller Company:	RESIDENCE		
	Spiller Address:	10 LAFFEYTE ST		
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10801		
	Spiller County:	001		
	Spiller Contact:	MARIO KOTLAR		
	Spiller Phone:	(914) 235-8882		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	308993		
	DEC Memo:	"Northeast to return 2/3/06 for soil excavation & sampling. Ma		
		2006: NORTHEAST ENVIRONMENTAL DISPOSED OF LUS	ST AND 42.57 T	ONS OF
		CONTAMINATED SOIL. BASED UPON INFORMATION PRO	OVIDED TO DE	C, NO FURTHER
		ACTION IS REQUIRED AT THIS TIME. jod"		
	Remarks:	"Tank removal, tank size 1000 gallon."		
	Material:			
	Site ID:	358990		
	Operable Unit ID:	1116216		
	Operable Unit:	01		
	Material ID:	2106363		
	Material Code:	0001A		
	Material Name:	#2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	Not reported		
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected: Oxygenate:	Not reported Not reported		
	Oxygenale.	Not reported		
	Tank Test:			
AZ228 West 1/4-1/2 0.356 mi.	SPILL NUMBER 0109254 40 WARREN ST NEW ROCHELLE, NY		NY LTANKS NY Spills	S105230135 N/A
1879 ft.	Site 2 of 2 in cluster AZ			
Relative:	LTANKS:			
Lower	Site ID:	150939		
Actual	Spill Number/Closed Date:			
Actual: 92 ft.	Spill Date:	2001-12-19		
32 IL.	Spill Cause:	Tank Overfill		
	Spill Source:	Private Dwelling	Booponaa	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator:	jghardy		

SPILL NUMBER 0109254 (Continued)

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

LL NUMBER 0109254 (CON	tinued) 51052301
Referred To:	Not reported
Reported to Dept:	2001-12-19
CID:	211
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2001-12-19
Spill Record Last Update:	2002-01-03
Spiller Name:	Not reported
Spiller Company:	ROBISON OIL
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ -
Spiller County:	001
Spiller Contact:	
•	MALLARDI RES
Spiller Phone:	(914) 636-7448
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	128278
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
Remarks:	HARDY " "DRIVER OVERFILLED TANK - SPILL CONTAINED WITH PADS - CLEAN UP CREW ENROUTE"
Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: ank Test:	846633 01 530463 0001A #2 fuel oil Not reported Petroleum 2.00 Gallons .00 Not reported Not reported
Site ID:	409713
Spill Number/Closed Date:	
•	
Spill Date:	2009-02-06 Tank Test Failure
Spill Cause:	Tank Test Failure
Spill Source:	Private Dwelling
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required.
	·
Cleanup Ceased	NOT REPORTED
Cleanup Ceased: Cleanup Meets Standard:	Not reported False
Cleanup Meets Standard:	False

Database(s)

EDR ID Number EPA ID Number

### SPILL NUMBER 0109254 (Continued)

FILL NUMBER 0109254 (COI	iunueu)
Referred To:	Not reported
Reported to Dept:	2009-02-06
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	
	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	UNKNOWN
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	359905
DEC Memo:	"Piping failure, need to repair and retest - mm 02/20/2009 Passed
	retest results that came into PBS to J. O'DeeBHY 3/3/09: Review of
	report submitted by WCC Tank Technology. Tank was tested by WCC on
	1-9-09 for the property owner. The tank passed the test and
	documentation was submitted to the owner and the New Rochelle FD.
	Elite Environmental tested the tank for a prospective buyer on 2-6-09
	and failed the tank, resulting in this spill report to the DEC. On
	2-12-09 WCC again tested the tank with reps from New Rochelle FD and
	Royal Environmental. The tank passed this test. All three tests were
	preformed with the Horner Locator Plus system. Based upon the
	information received as of this date, DEC is requiring No Further
<b>.</b>	Action at this time. jod"
Remarks:	"550 gal tank failed test/ failure due to bad fitting"
Material:	
Site ID:	409713
Operable Unit ID:	1166213
Operable Unit:	01
Material ID:	2157665
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	
Material FA:	Not reported
	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
SPILLS:	
Facility ID:	0908848
	000000
Facility Type:	ER

Database(s)

EDR ID Number EPA ID Number

### SPILL NUMBER 0109254 (Continued)

DER Facility ID:	128278
Site ID:	421508
DEC Region:	3
Spill Date:	2009-11-06
Spill Number/Closed Date:	0908848 / 2010-04-08
Spill Cause:	Other
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
opin oldso.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	TDGHIOSA
Referred To:	Not reported
Reported to Dept:	2009-11-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-11-06
Spill Record Last Update:	2010-04-08
Spiller Name:	GABREILLE BARRAGAN
Spiller Company:	GABREILLE BARRAGAN
Spiller Address:	40 WARREN ST
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	999
Contact Name:	NIKKI RICKETTS
Contact Phone:	(914) 777-1930
DEC Memo:	"11/06/09: Property was purchased by a new owner within the past
	year. New owner passed away, his wife was having the tank replaced
	for sale of the property. Northeast installed a new AST in the
	basement and pulled this 1K tank. Contamination evident. New Rochelle
	FD inspected. Northeast will be completing clean up. jod 02/09/10
	Northeast Environmental reported that they excavated and removed one
	tank along with 35.64 tons of petroleum contaminated soil. Post
	excavation TAGM soil sample results were below DEC guidance values.
	NFA TG"
Remarks:	"REMOVAL OF A 1000 GALLON UST SOIL CONTAMINATION FOUND CLEAN UP
romano.	PENDING."
Material:	
Site ID:	421508
Operable Unit ID:	1177396
Operable Unit:	01
Material ID:	2170184
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Map ID		MAP FINDINGS		
Direction Distance Elevation	۲ Site		Database(s)	EDR ID Number EPA ID Number
	SPILL NUMBER 0109254 (Con	tinued)		S105230135
	Tank Test:			
AX229 NE 1/4-1/2 0.359 mi. 1895 ft.	GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY Site 2 of 2 in cluster AX		NY LTANKS NY Spills	S107657288 N/A
Relative:	LTANKS:			
Lower	Site ID: Spill Number/Closed Date:	426673		
Actual:	Spill Date:	2010-03-26		
38 ft.	Spill Cause:	Tank Test Failure		
	Spill Source: Spill Class:	Gasoline Station or other PBS Facility Known release with minimal potential for fire or hazard. DE	C Response.	
		Willing Responsible Party. Corrective action taken.	e	
	Cleanup Ceased: Cleanup Meets Standard:	Not reported False		
	SWIS:	6010		
	Investigator:	JKOMARA		
	Referred To: Reported to Dept:	Not reported 2010-03-26		
	CID:	Not reported		
	Water Affected:	Not reported		
	Spill Notifier: Last Inspection:	Other Not reported		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	False 0		
	Date Entered In Computer:	-		
	Spill Record Last Update:	2010-04-29		
	Spiller Name: Spiller Company:	ROBERT O'KEEFE TANK TEST FAILURE		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	NY		
	Spiller County: Spiller Contact:	999 TOM ANDERSON		
	Spiller Phone:	(845) 216-8064		
	Spiller Extention: DEC Region:	Not reported 3		
	DER Facility ID:	310476		
	DEC Memo:	"3/26/10 Tyree to go there on Mon. 3/29 to do repairs. dw 4		
		Getty 340 Main St New Rochelle line test failed do to faulty valve. Tyree replaced check valve. Passed retest on 4/12/1		
		Not reported		
	Remarks:	"in line problem - Tyree notified - cleanup and repair pendin	g"	
	Material:			
	Site ID:	426673		
	Operable Unit ID: Operable Unit:	1182349 01		
	Material ID:	2176532		
	Material Code:	0009		
	Material Name: Case No.:	gasoline Not reported		
	Material FA:	Petroleum		

Database(s)

EDR ID Number EPA ID Number

### S107657288

GETTY 58114 (Continued)	
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

### SPI

SPILLS:	
Facility ID:	0606306
Facility Type:	ER
DER Facility ID:	310476
Site ID:	369636
DEC Region:	3
Spill Date:	2006-09-01
Spill Number/Closed Date:	0606306 / 2006-09-03
Spill Cause:	Housekeeping
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
Spill Class.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
	JBODee
Investigator:	
Referred To:	Not reported
Reported to Dept:	2006-09-01
CID:	409
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2006-09-01
Spill Record Last Update:	2006-09-03
Spiller Name:	MIKE CARR
Spiller Company:	GETTY 58114
Spiller Address:	340 MAIN STREET
Spiller City, St, Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	MIKE CARR
Contact Phone:	(518) 369-7822
DEC Memo:	() III
Remarks:	"LESS THAN A GAL OF BOTH ABND THEY HAVE BEEN CLEANED UP."
• • • •	
Material:	
Site ID:	369636
Operable Unit ID:	1127472
Operable Unit:	01
Material ID:	2117069
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons

Database(s)

EDR ID Number EPA ID Number

		S107657288
Recovered:	1.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Site ID:	369636	
Operable Unit ID:	1127472	
Operable Unit:	01	
Material ID:	2117068	
Material Code:	0043A	
Material Name:	antifreeze	
Case No.:	Not reported	
Material FA:	Other	
Quantity:	Not reported	
Units:	Gallons	
Recovered:	1.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Fank Test:		
Facility ID:	0606253	
Facility Type:	ER	
DER Facility ID:	310476	
Site ID:	369567	
DEC Region:	3	
Spill Date:	2006-08-30	
Spill Number/Closed Date:	0606253 / 2006-09-03	
Spill Cause:	Housekeeping	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
Spill Class.	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	JBODee	
Referred To:	Not reported	
Reported to Dept:	2006-08-30	
CID:	77	
Water Affected:	Not reported	
	•	
	Gasoline Station or other PBS Facility	
Spill Source:	Gasoline Station or other PBS Facility Other	
Spill Source: Spill Notifier:	Other	
Spill Source: Spill Notifier: Cleanup Ceased:	Other Not reported	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	Other Not reported True	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	Other Not reported True Not reported	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	Other Not reported True Not reported False	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	Other Not reported True Not reported False False	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase:	Other Not reported True Not reported False False 0	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer:	Other Not reported True Not reported False False 0 2006-08-31	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY 001	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY 001 MIKE CARR	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name: Contact Name:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY 001 MIKE CARR (518) 369-7822	
Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name:	Other Not reported True Not reported False False 0 2006-08-31 2006-09-03 MIKE CARR GETTY 58114 340 MAIN STREET NEW ROCHELLE, NY 001 MIKE CARR	

Material:

### Map ID Direction Distance Elevation Site

## MAP FINDINGS

Database(s)

	200507	7288
Site ID:	369567	
Operable Unit ID:	1127402	
Operable Unit:	01	
Material ID:	2117000	
Material Code:	0022	
Material Name:	waste oil/used oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
ank Test:		
Facility ID:	0603586	
Facility Type:	ER	
DER Facility ID:	ER 310476	
Site ID:	366335	
DEC Region:	3	
Spill Date:	2006-06-30	
Spill Number/Closed Date:	0603586 / 2006-07-03	
Spill Cause:	Housekeeping	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	JPCUMMIN	
Referred To:	Not reported	
Reported to Dept:	2006-06-30	
CID:	409	
Water Affected:	Not reported	
Spill Source:	Gasoline Station or other PBS Facility	
Spill Notifier:	Local Agency	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	False	
Remediation Phase:	0	
Date Entered In Computer:	2006-06-30	
Spill Record Last Update:	2006-07-11	
Spiller Name:	MIKE CARR	
Spiller Company:	GETTY 58114	
Spiller Address:	340 MAIN STREET	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	001	
Contact Name:	MIKE CARR	
Contact Phone:	(518) 369-7822	
DEC Memo:	"	
Remarks:	"COMBINED TOTAL OF LESS THAN A GAL. HAS BEEN CLEANED UP."	
aterial:		
	200020	
Site ID:	366335	
	366335 1124284 01	

Database(s)

Material ID:	2113775	
Material Code:	0043A	
Material Name:	antifreeze	
Case No.:	Not reported	
Material FA:	Other	
Quantity:	Not reported	
Units:	Gallons	
Recovered:	1.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Site ID:	366335	
Operable Unit ID:	1124284	
Operable Unit:	01	
Material ID:	2113776	
Material Code:	0022	
Material Name:	waste oil/used oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Gallons	
Recovered:	1.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Facility ID: Facility Type:	0602340 FR	
Facility ID: Facility Type: DER Facility ID:	0602340 ER 310476	
Facility Type:	ER	
Facility Type: DER Facility ID: Site ID:	ER 310476	
Facility Type: DER Facility ID:	ER 310476 364789	
Facility Type: DER Facility ID: Site ID: DEC Region:	ER 310476 364789 3	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response.	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False False 0	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False 0 2006-06-01	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False 0 2006-06-01 2006-06-01 2006-06-01	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False 0 2006-06-01 2006-06-01 2006-06-07 MIKE CARR	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported False False False 0 2006-06-01 2006-06-01 2006-06-01 2006-06-01 2006-06-07 MIKE CARR GETTY #58114	
Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name:	ER 310476 364789 3 2006-06-01 0602340 / 2006-06-07 Housekeeping Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 JBODee Not reported 2006-06-01 444 Not reported Gasoline Station or other PBS Facility Other Not reported True Not reported False False 0 2006-06-01 2006-06-01 2006-06-07 MIKE CARR	

Database(s)

EDR ID Number EPA ID Number

### GETT

GETTY 58114 (Continued)	
Spiller Company:	001
Contact Name:	MIKE CARR
Contact Phone:	(518) 369-7822
DEC Memo:	
Remarks:	"SPEEDI DRI DOWN STAINING ONLY"
Material:	
Site ID:	364789
Operable Unit ID:	1122807
Operable Unit:	01
Material ID:	2112285
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00 Cellere
Units: Recovered:	Gallons
Resource Affected:	.00 Not reported
Oxygenate:	Not reported Not reported
Site ID:	364789
Operable Unit ID:	1122807
Operable Unit:	01
Material ID:	2112286
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	0601041
Facility Type:	ER
DER Facility ID:	310476
Site ID:	363188
DEC Region:	3
Spill Date: Spill Number/Closed Date:	2006-04-27 0601041 / 2006-04-27
Spill Cause:	Housekeeping
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
opin oldos.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	MBMASTRO
Referred To:	Not reported
Reported to Dept:	2006-04-27
CID:	444
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True

Database(s)

EDR ID Number EPA ID Number

### GETTY 58114 (Continued)

Last Inspection: Not reported Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2006-04-27 Spill Record Last Update: 2006-05-02 Spiller Name: MIKE CARR Spiller Company: GETTY #58114 Spiller Address: 340 MAIN STREET Spiller City, St, Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: MIKE CARR Contact Phone: (518) 369-7822 DEC Memo: "5/2/06: Staining - cleaned up NFA" "speedi dri applied and cleaned up" Remarks: Material: 363188 Site ID: **Operable Unit ID:** 1121255 Operable Unit: 01 Material ID: 2110749 Material Code: 0022 Material Name: waste oil/used oil Case No .: Not reported Petroleum Material FA: .00 Quantity: Units: Gallons Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported Site ID: 363188 Operable Unit ID: 1121255 **Operable Unit:** 01 Material ID: 2110750 Material Code: 0043A Material Name: antifreeze Case No .: Not reported Material FA: Other Quantity: .00 Units: Gallons Recovered: .00 Not reported **Resource Affected:** Oxygenate: Not reported Site ID: 363188 Operable Unit ID: 1121255 Operable Unit: 01 Material ID: 2110748 Material Code: 0009 Material Name: gasoline Not reported Case No .: Material FA: Petroleum Quantity: .00 Units: Gallons Recovered: .00 Not reported **Resource Affected:** Oxygenate: Not reported

Database(s)

EDR ID Number EPA ID Number

S107657288

# GETTY 58114 (Continued)

Tank Test:

# <u>Click this hyperlink</u> while viewing on your computer to access additional NY\_SPILL: detail in the EDR Site Report.

230 SE 1/4-1/2 0.364 mi. 1921 ft.	CIUSSETELLI RESIDENCE 4 FAIRVIEW PLACE NEW ROCHELLE, NY	NY LT	TANKS	S105996325 N/A
1/4-1/2		2002-07-22 Tank Test Failure Private Dwelling Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required. Not reported False 6010 jbodee Not reported 2002-07-23 396 Not reported Tank Tester Not reported False False 0 2002-07-23 2010-07-13 Not reported SAME Not reported NY 999 RON CIUSSETELLI Not reported NY 999 RON CIUSSETELLI Not reported 3 136674 "7/13/10: Report of a residential tank test failure. No indication of contamination noted on initial report. Report indicates all exterior		
	Remarks:	piping loose, multiple vents and fills. Probable air leak. No further information received. jod" "all exterior piping loosemultiple vents and filleand questions contact caller."		
	Material: Site ID: Operable Unit ID: Operable Unit:	161898 857023 01		

Database(s)

EDR ID Number EPA ID Number

CIUSSETELLI RESIDENCE (	Continued)
-------------------------	------------

	. ,
Material ID:	518487
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	161898
Spill Tank Test:	1527307
Tank Number:	1
Tank Size:	550
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II

AY231 South 1/4-1/2 0.364 mi.	200 CENTRA CORP 200 CENTER AVE NEW ROCHELLE, NY	NY LTAN	KS S108059537 N/A
1921 ft.	Site 2 of 2 in cluster AY		
Relative: Lower Actual: 77 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip:	2006-07-25 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 WCHD WCDOH 2006-07-25 444 Not reported Tank Tester Not reported False False 0 2006-07-25	

Database(s)

EDR ID Number EPA ID Number

CENTRA CORP (Conti		S1080
Spiller County:	001	
Spiller Contact:	SHARON ROURKE	
Spiller Phone:	(203) 557-3600	
Spiller Extention:	Not reported	
DEC Region:	3	
DER Facility ID:	317637	
DEC Memo:	"12/04/06 Tank removed and samples ok according to D Jackson - WCHD. TG"	
Remarks:	"PBS No: 3-800237 -PBS No. not found in UIS, may be invalid. UNCOVER REPAIR AND TEST"	
Material:		
Site ID:	367663	
Operable Unit ID:	1125568	
Operable Unit:	01	
Material ID:	2115091	
Material Code:	0001A	
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	367663	
Spill Tank Test:	1550151	
Tank Number:	1	
Tank Size:	5000	
Test Method:	03	
Leak Rate:	.00	
Gross Fail:	Not reported	
Modified By:	Watchdog	
Last Modified:	Not reported	
Test Method:	Horner EZ Check I or II	

BB232 ENE 1/4-1/2 0.368 mi. 1945 ft.	JEROME RESIDENCE 33 ECHO AVE NEW ROCHELLE, NY Site 1 of 4 in cluster BB	NY LTANKS	S106702572 N/A
Relative: Lower Actual: 35 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator:	235222 0405389 / 2005-02-13 2004-08-17 Tank Test Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 jbodee	

Database(s)

EDR ID Number EPA ID Number

# JEROME RESIDENCE (Continued)

JEROME RESIDENCE (COntin	(led) 5106702572
Referred To:	Not reported
Reported to Dept:	2004-08-17
CID:	444
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	: 2004-08-17
Spill Record Last Update:	
Spiller Name:	MARK JEROME
Spiller Company:	JEROME RESIDENCE
Spiller Address:	33 ECHO AVE
	NEW ROCHELLE, NY
Spiller City,St,Zip:	
Spiller County:	
Spiller Contact:	MARK JEROME
Spiller Phone:	(914) 632-5400
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	193747
DEC Memo:	"02/13/05 MILLER ENVIRONMENTAL REMOVED AND DISPOSED OF TANK. NO
	EVIDENCE OF LEAK OR CONTAMINATION WAS FOUND. BASED UPON INFORMATION
	PROVIDED TO DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod"
Remarks:	"RECOMMEND- ISOLATION & RETEST"
Material:	
Site ID:	235222
Operable Unit ID:	888925
Operable Unit:	01
Material ID:	489551
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Site ID:	235222
Operable Unit ID:	888925
Operable Unit:	01
Material ID:	489552
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	235222

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### JEROME RESIDENCE (Continued)

Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:

#### 1529557 Not reported 1000 03 .00 Not reported Spills Not reported Horner EZ Check I or II

233 NNW 1/4-1/2 0.372 mi. 1962 ft.	SCHMUCKLER'S DRY CLEANERS 358-364 NORTH AVENUE NEW ROCHELLE, NY 10804	NY BROWNFIELDS S107787044 N/A
Relative: Lower Actual: 74 ft.	BROWNFIELDS: Program: Site Code: Acres: HW Code: SWIS: Town: Record Added Date: Record Updated Date: Update By: Site Description:	BCP 357446 0.21 C360088 6010 New Rochelle (c) 12/29/2005 12/31/2015 DACROSBY Location: The Schmucklers Dry Cleaners site is located in an urban area located at 258-364 North Avenue in New Rochelle, Westchester County. The site is 0.21 acres, most of which is covered by a two-story row building with a full basement. Site Features: In addition to the former dry cleaners, historically located on the first floor, the site also includes an enclosed backyard area to the immediate west of the building. The backyard is mostly covered by lawn, but also includes elevated vegetable beds, and a paved walkway. Current Zoning/Use(s): The site is commercially zoned, and currently has five commercial tenants occupying both the first and second floors. Properties along North Avenue are predominantly zoned for commercial or mixed use, some maintaining residential apartments above. Commercial uses dominate areas within one block east and west of North Avenue with the exception of a multi-unit residential building immediately to the west of the site. Drinking water on-site is provided from a municipal source. Past Uses of the Site: The building on-site was acquired by the Volunteer, HNJ Realty, LLC, in August 2005, and entered into a BCA in June 2006. An interim remedial measure (IRM) was conducted starting in late 2008 to install a combined soil vapor extraction system/sub-slab depressurization system (SVE/SSDS) in the former dry cleaner to mitigate PCE in indoor air. The IRM was deemed complete in December 2013, but the SVE/SSDS continues to operate. A second IRM work plan was approved in May 2015 to conduct a pilot study of an enhanced biological in situ treatment to remediate contaminants under the on-site building slab. Site Geology and Hydrogeology: The site is underlain by historic fill which is underlain by poorly sorted glacial material (silty-clay with sand and gravel). The highly weathered bedrock surface is between 9

EDR ID Number Database(s) EPA ID Number

#### SCHMUCKLER'S DRY CLEANERS (Continued)

#### S107787044

and 13 feet below ground surface at site. Groundwater was encountered between 9 to 12 feet below site. Bedrock groundwater at the site flows in a southeasterly direction. Only two overburden wells onsite have produced water, therefore a groundwater flow direction in overburden cannot be determined. It is assumed that it flows in the same basic southeast direction as the bedrock groundwater. Env Problem: Based on the investigations conducted to date, the primary contaminants of concern at the site are chlorinated volatile organic compounds (VOCs), primarily tetrachloroethylene (PCE) and its breakdown compounds, in soils, groundwater, sub-slab vapor, and soil gas; petroleum-related VOCs in soils, groundwater, sub-slab vapor, and soil gas; and semi-volatile organic compounds (SVOCs) in groundwater. Soils: Tetrachloroethylene (PCE), trichloroethene (TCE), and multiple petroleum related VOCs were detected in onsite soils underneath the building slab. The highest concentration of PCE at 210 parts per million (ppm), exceeding restricted commercial soil cleanup objectives (SCOs), was located underneath the former dry cleaning equipment room. Other contaminants detected in soils only exceeded the Protection of Groundwater SCOs. These exceedences were largely in soils located downgradient of the dry cleaning equipment room and consisted of: TCE at 1.3 ppm, cis-1,2 dichloroethene (cis-1,2-DCE) at 3 ppm, n-propylbenzene at 16 ppm, m+p xylenes at 15 ppm, ethylbenzene at 6.6 ppm, 1.3.5-trimethylbenzene at 63 ppm, and 1,2,4-trimethylbenzene at 99 ppm. Groundwater: Petroleum-based floating product (LNAPL, or light non-aqueous phase liquid) was observed in groundwater under much of the on-site building slab, a maximum of 6 inches thick under the former dry cleaning equipment room. Also observed were very high concentrations of select VOCs also under the former drycleaning equipment room. The maximum detected PCE was 830,000 parts per billion (ppb), and TCE at 58,000 ppb, indicating the presence of these compounds as free product DNAPLs (dense non-aqueous phase liquid) in groundwater. 25 individual VOCs were also detected in site groundwater samples exceeding NYS Class GA groundwater standards. These include the above-mentioned PCE, TCE, as well as other maximum detected concentrations of PCE breakdown products: cis-1,2-DCE at 8,700 ppb, and vinyl chloride at 28 ppb. BTEX was detected, with benzene at 62 ppb, toluene at 130 ppb, ethylbenzene at 150 ppb, m+p xylene at 520 ppb, and o-xylene at 290 ppb. Other significant concentrations of VOCs detected in groundwater include 1,3,5-trimethylbenzene at 890 ppb, and 1,2,4-trimethylbenzene at 840 ppb. Eight SVOCs were detected over groundwater standards in groundwater under the building slab, including napthalene at a concentration of 1300 ppb, phenanthrene at 2400 ppb, acenapthene at 710 ppb, and antracene at 280 ppb. Bedrock wells were installed off-site in the downgradient, sidegradient, and upgradient directions. Petroleum-based VOCs and SVOCs were detected in the bedrock aquifer at concentrations above groundwater standards. For VOCs, total maximum BTEX concentration of 722 ppb was detected in a downgradient bedrock well. 11 individual SVOC contaminants were detected over groundwater standards in the same downgradient off-site bedrock well, including naphthalene at 4100 ppb, phenanthrene at 2800 ppb, acenapthene at 710 ppb, and antracene at 300 ppb.The extent of groundwater contamination is concentrated underneath the on-site building slab, with petroleum-based VOC and SVOC contaminants and LNAPL extending off-site in the bedrock downgradient or southeast direction. Soil Gas/Soil Vapor: The high concentrations of PCE (787,000 ug/m3), TCE (15,200 ug/m3), cis-1,2-DCE (46,000 ug/m3), and

EDR ID Number Database(s) EPA ID Number

# SCHMUCKLER'S DRY CLEANERS (Continued)

#### S107787044

combined soil vapor exi a 2008-2013 Interim Re and TCE (13.4 ug/m3) y building near the location toluene (126 ug/m3), et 1,3,5-trimethylbenzene ug/m3) were also detect Resources Impacted/Th of the City of New Roch identified near the site. Health Problem: While direct contact with most contaminated soil persons who dig below come into contact with drinking the contaminate public water supply that sub-slab depressurizati to prevent vapors bene Sampling indicates soil adjacent off-site building	stallation and continuing operation of a traction and sub-slab mitigation system during emedial Measure (IRM) action. PCE (at 91 ug/m3) were also detected in soil gas outside of the on of a former drywell. Benzene (37 ug/m3), hylbenzene (85 ug/m3), xylene (555 ug/m3), (3 ug/m3), and 1,2,4-trimethylbenzene (14 the din subslab vapor and soil gas. Special meatened: The site is located in an urban area nelle. There are no special resources h contaminants in the soil is unlikely because s are found beneath the on-site building, the ground surface adjacent to the building may contaminants in subsurface soil. People are not ed groundwater because the area is served by a t is not affected by this contamination. A on system was installed in the on-site building ath the slab from entering the building. vapor intrusion is not a concern in one g. However, the potential exists for ninants due to soil vapor intrusion for other s.
---	--

NY LTANKS S102674341 N/A

BA234 ENE 1/4-1/2 0.373 mi.	GONCALVES RESIDENCE 1 LAFFAYETTE STREET NEW ROCHELLE, NY	NY LTANKS	S
1967 ft.	Site 2 of 3 in cluster BA		
Relative: Lower	LTANKS: Site ID: Spill Number/Closed Date:	156301 9410991 / 1994-11-29	
Actual: 35 ft.	Spill Date: Spill Date: Spill Cause: Spill Couse: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reforted to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer:	1994-11-17 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 1994-11-29 False 6010 tdghiosa Not reported 1994-11-17 Not reported Not reported Not reported Other Not reported False False False 0	
	Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip:	2003-12-02 Not reported Not reported ***Update***, ZZ	

Map ID	
Direction	
Distance	
Elevation	Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	GONCALVES RESIDENCE (Co	ontinued) S102674341	
	Spiller County:	001	
	Spiller Contact:	Not reported	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	132292	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	DEC Merrio.	GHIOSAY "	
	Remarks:	"CUSTOMER ORDERED 100 GAL. COULDN'T FIT BEING CLEANED NOW SPEEDI-DRI	
	Remarks.	AND PADS COMPLETED"	
	Material:		
	Site ID:	156301	
	Operable Unit ID:	1008868	
	Operable Unit:	01	
	Material ID:	376855	
	Material Code:	0001A	
	Material Name:	#2 fuel oil	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	40.00	
	Units:	Gallons	
	Recovered:	.00	
	Resource Affected:	Not reported	
	Oxygenate:	Not reported	
BA235 ENE 1/4-1/2 0.272 mi	GONCALVES RESIDENCE 1 LAFAYETTE STREET NEW ROCHELLE, NY	NY LTANKS S108298870 N/A	
ENE	1 LAFAYETTE STREET		
ENE 1/4-1/2 0.373 mi. 1967 ft.	1 LAFAYETTE STREET NEW ROCHELLE, NY		
ENE 1/4-1/2 0.373 mi.	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA		
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS:	N/A 373629	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date:	N/A 373629	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date:	N/A 373629 0609401 / 2007-01-10	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date:	N/A 373629 0609401 / 2007-01-10 2006-11-15	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response.	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Date: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept:	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Date: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410 Not reported	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410 Not reported Local Agency	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spil	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410 Not reported Local Agency Not reported	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spil	N/A 373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410 Not reported Local Agency Not reported False	
ENE 1/4-1/2 0.373 mi. 1967 ft. Relative: Lower Actual:	1 LAFAYETTE STREET NEW ROCHELLE, NY Site 3 of 3 in cluster BA LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: SwiS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement:	373629 0609401 / 2007-01-10 2006-11-15 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-11-15 410 Not reported Local Agency Not reported False False 0	

# 41

Database(s)

EDR ID Number EPA ID Number

Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	2007-01-10 ED ALLEN ROBINSON OIL 500 EXECUTIVE BLVD ELMSFORD, NY 001 ED ALLEN (914) 345-5700 Not reported 3 323367 ""
Material: Site ID: Operable Unit ID: Operable Unit ID: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Site ID: Operable Unit ID: Operable Unit ID: Operable Unit ID: Operable Unit ID: Material ID: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	373629 1131331 01 2121025 0001A #2 fuel oil Not reported Petroleum 2.00 Gallons .00 Not reported Not reported 373629 1131331 01 2121026 0001A #2 fuel oil Not reported Petroleum 2.00 Gallons .00 Not reported Not reported

Tank Test:

BC236 NW 1/4-1/2 0.375 mi. 1979 ft.	NEW ROCHELLE HOSPITAL COVION PLACE NEW ROCHELLE, NY Site 1 of 2 in cluster BC	
1979 11.	Site I of 2 in cluster DC	
Relative:	LTANKS:	
Higher	Site ID:	136814
•	Spill Number/Closed Date:	9003911 / 1991-03-15
Actual:	Spill Date:	1990-07-09
102 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Commercial/Industrial

#### S108298870

NY LTANKS S100141273 N/A

Database(s)

EDR ID Number EPA ID Number

# NEW ROCHELLE HOSPITAL (Continued)

NEW ROCHELLE HOSPITAL (	continued)
Spill Class:	Not reported
Cleanup Ceased:	1953-06-18
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	WXWADSWO
5	
Referred To:	Not reported
Reported to Dept:	1990-07-09
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	: 1990-07-11
Spill Record Last Update:	1991-04-05
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	117069
DEC Memo:	"Prior to Sept. 2004 data translation this spill Lead DEC Field was
BEO Memo.	WADSWORTH 03/15/91: PASSED RETEST. 09/27/95: This is additional
	information about material spilled from the translation of the old
	spill file: TANK TEST."
Remarks:	"WILL EIR PBS TO FOLLOW AINLEY +.094"
Remarks.	WILL EIR PBS TO FOLLOW AINLEY +.094
Material:	
Site ID:	136814
Operable Unit ID:	941734
Operable Unit:	01
Material ID:	435036
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Oxygenate.	Not reported
Tank Test:	
Site ID:	136814
Spill Tank Test:	1537277
Tank Number:	Not reported
Tank Size:	0
Test Method:	0
i oot motriou.	00
Leak Rate:	
	00 .00
Leak Rate:	00

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	NEW ROCHELLE HOSPITAL (	(Continued)		S100141273
	Last Modified: Test Method:	Not reported Unknown		
BB237 ENE 1/4-1/2 0.375 mi. 1982 ft.	POWERTEST,ECHO & MAIN 36 ECHO AVE @ MAIN ST. NEW ROCHELLE, NY Site 2 of 4 in cluster BB		NY LTANKS	S100139866 N/A
	LTANKS:			
Relative: Lower	Site ID:	283199		
Actual:	Spill Number/Closed Date:			
33 ft.	Spill Date: Spill Cause:	1988-01-30 Tank Failure		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Possible release with minimal potential for fire or hazard		
		release with no damage. DEC Response. Willing Respor Corrective action taken.	isible Party.	
	Cleanup Ceased:	1988-02-11		
	Cleanup Meets Standard: SWIS:	True 6010		
	Investigator:	jeokesso		
	Referred To:	Not reported		
	Reported to Dept:	1988-01-30		
	CID: Water Affected:	Not reported Not reported		
	Spill Notifier:	Citizen		
	Last Inspection:	Not reported		
	Recommended Penalty: UST Involvement:	False True		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update: Spiller Name:	1988-06-13 Not reported		
	Spiller Company:	HACKER, JOSHUA; POWERTEST		
	Spiller Address:	Not reported		
	Spiller City,St,Zip: Spiller County:	LISK, MA 001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention: DEC Region:	Not reported 3		
	DER Facility ID:	229700		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC OKESSON / / : 02-01-88 TANK REPLACED 5 YRS.AGO WILLIAM COMVERY,BASEMENT ODORS GREATLY D 02/11/88: CHECKED STATION; SEEMS TO BE ODOR F DELIVERIES. 11/29/95: This is additional information ab spilled from the translation of the old spill file: FUMES."	D. AS PER DEPUTY ISSAPATED, ONCE PROBLEM DURING out material	VENTED.
	Remarks:	"DELIVERY THIS MORNING, ONGOING PROBLEM, E> BASEMENT. NEW ROCHELLE F.D. HAS VENTED BAS		
	Material:			
	Site ID:	283199		
	Operable Unit ID: Operable Unit:	914517 01		

Database(s)

EDR ID Number EPA ID Number

# **POWERTEST, ECHO & MAIN (Continued)**

Material ID:	464589
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

BB238 ENE 1/4-1/2 0.377 mi.	MARIO'S S/S 44 ECHO AVENUE NEW ROCHELLE, NY	NY LTANKS S110309404 NY Spills N/A	
1988 ft.	Site 3 of 4 in cluster BB		
Relative:	LTANKS:		
Lower	Site ID:	130487	
	Spill Number/Closed Date:	9201557 / 2006-02-17	
Actual:	Spill Date:	1992-05-08	
32 ft.	Spill Cause:	Tank Test Failure	
	Spill Source:	Gasoline Station or other PBS Facility	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
		Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
	Cleanup Meets Standard:	True	
	SWIS:	6010	
	Investigator:	JBODee	
	Referred To:	Not reported	
	Reported to Dept:	1992-05-08	
	CID:	Not reported	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	True	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:		
	Spiller Name:	Not reported	
	Spiller Company:	Not reported	
	Spiller Address:	Not reported ****Update***, ZZ	
	Spiller City,St,Zip: Spiller County:	001	
	Spiller County.	Not reported	
	Spiller Phone:	Not reported	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DEC Region. DER Facility ID:	309856	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	DEC MONO.	GHIOSAY 2/17/06 SEE SPILLS 92-10118 AND 92-10810. jod"	
	Remarks:	"FOUND LINE LEAKING AT DISPENSER GASOLINE TANK IS OK MAIN & ELMSFORD TO POSS. REPAIR MONDAY WILLIAMS SUGGESTED TO MAIN & ELMSFORD CO. THA	Т

#### EDR ID Number Database(s) EPA ID Number

# MARIO'S S/S (Continued)

THEUY SHUT THIS PUMP DOWN UNTIL REPAIRS ARE MADE SPOKE W/ WILL"

Material:	
Site ID:	130487
Operable Unit ID:	968828
Operable Unit:	01
Material ID:	412859
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
,,,	•
Tank Test:	
Site ID:	130487
Spill Tank Test: Tank Number:	1539973 Not reported
Tank Number. Tank Size:	Not reported
	0
Test Method:	00
Leak Rate:	.00 Not reported
Gross Fail:	Not reported
Modified By: Last Modified:	Spills National stand
Test Method:	Not reported Unknown
Test Method.	UTIKHOWH
Site ID:	130489
Spill Number/Closed Date:	
Spill Date:	1992-12-17
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
Opin Olass.	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	1995-02-09
Cleanup Meets Standard:	
SWIS:	6010
Investigator:	WXWADSWO
Referred To:	Not reported
Reported to Dept:	1992-12-18
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer	
Spill Record Last Update:	2006-02-17
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
opinor ony,or,zip.	

MARIO'S S/S (Continued)

Database(s)

EDR ID Number EPA ID Number

( , , , , , , , , , , , , , , , , , , ,	
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
•	•
DEC Region:	3
DER Facility ID:	309856
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
DEC Mento.	
	WADSWORTH 09/27/95: This is additional information about material
	spilled from the translation of the old spill file: TANK TEST."
Remarks:	"E.I.R. PETRO-TITE"
Romanio.	
Material:	
Site ID:	130489
Operable Unit ID:	975022
Operable Unit:	01
•	
Material ID:	404252
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
	•
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	130489
Spill Tank Test:	1540972
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
	•
Test Method:	Unknown
Site ID:	434525
••	
Spill Number/Closed Date:	1001469 / 2010-11-01
Spill Date:	2010-05-07
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
	1
Cleanup Meets Standard:	False
SWIS:	6010
Investigator:	JKOMARA
Referred To:	Not reported
	•
Reported to Dept:	2010-05-07
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
•	
Last Inspection:	Not reported

MARIO'S S/S (Continued)

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

Recommended Penalty:	False	
UST Involvement:	False	
Remediation Phase:	0	
Date Entered In Computer:	2010-05-07	
Spill Record Last Update:		
Spiller Name:	Not reported	
Spiller Company:	OWNER	
Spiller Address:	Not reported	
•	NY	
Spiller City,St,Zip: Spiller County:	999	
Spiller Contact:		
Spiller Phone:	(914) 235-8073	
Spiller Extention:	Not reported	
DEC Region:	3	
DER Facility ID:	389397	
DEC Memo:	"5/7/10 Metro Env. tested UST, and it failed a TT. Davenport Auto	
	thinks it may be fuel lines, and got list of contractors to examine	
	problem more closely, and to determine remedial actions. Site is a	
	WCHD-PBS site# 3-137480 Tank was tank #6- 550 gal. dw 11/1/10 As per	
	WCDOH Two tanks pulled, reviewed TCR, recommend NFA. NFA JOM "	
Remarks:	"tank test - cleanup pending"	
-ti-l		
aterial:	121525	
Site ID:	434525	
Operable Unit ID:	1185347	
Operable Unit:	01	
Material ID:	2179667	
Material Code:	0001A	
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
ank Test:		
SPILLS:		
Facility ID:	1310365	
Facility Type:	ER	
DER Facility ID:	389397	
Site ID:	491212	
DEC Region:	3	
Spill Date:	2014-01-29	
Spill Number/Closed Date:	Equipment Failure	
Spill Cause:		
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
014/10	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	RDBENDEL	
Referred To:	Not reported	
Reported to Dept:	2014-01-29	
CID:	Not reported	
	·	

Database(s)

EDR ID Number EPA ID Number

MARIO'S S/S (Continued)		S
Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name: Contact Phone: DEC Memo:	Not reported Gasoline Station or other PBS Facility Other Not reported False Not reported False False O 2014-01-29 2016-07-26 Not reported WEST PLAINS SERVICE INC Not reported WEST PLAINS SERVICE INC Not reported NY 999 MICHAEL BURNSTEIN (914) 235-8073 "Chris Lalak called duty desk. American Petro is pulling tanks today. WCDOH is handling this and will do follow upmm 1/29/2014 Called Pat Dunn @ APECCO to get some details. Dispensers had no sumps; discovered soil contamination under a dispenser. Trench along side dispenser is clean to 2 1/2 feet below grade; they expect limited dig and haul. ELM 2-11-14 lyt was not a tank pull as originally noted by WCHD only line and dispenser replacement. RDB 2-13-14, spill #13-09599 was closed and referred to this one, the line test failure led to thic contamination RDB 03-14 contamination deep in excavation under former dispenser. crews worried about garage and building under neath, met on site with Gary and owner, advised them additional soil needed removal. 03-10-14 Using a Hydro Vac to get the remaining contaminated soils from excavation. 03-18-14 status report in edocs 05-13-14 email from Gary, Work done, report done, plan on forwarding report to you today once we get payment. RDB 07-22-14 gary looking for closure, I am looking for closure report.sent email requesting RDB 7-25-16 TCR submitted- Spill closed RDB"	
Remarks:	"cleanup in progress"	
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	491212 1240767 01 2240992 0009 gasoline Not reported Petroleum Not reported Not reported Not reported Not reported Not reported Not reported Not reported	
Facility ID: Facility Type:	9210118 ER	

Database(s)

EDR ID Number EPA ID Number

#### S110309404

MARIO'S S/S	(Continued)
-------------	-------------

	3110303404
DER Facility ID:	309856
Site ID:	130488
DEC Region:	3
Spill Date:	1992-12-01
Spill Number/Closed Date:	9210118 / 1997-11-07
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept:	1992-12-01
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1992-12-15
Spill Record Last Update:	2006-02-17
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY "
Remarks:	"GASOLINE ODOR IN BASEMENT OF APARTMENT BUILDING NEXT DOOR TO GAS
	STATION GAS STATION RECEIVED A DELIVERY AT 8:00 A.M. T. GHIOSAY
	RESPONDED"
Material:	400400
Site ID:	130488
Operable Unit ID:	976578
Operable Unit:	01
Material ID:	407123
Material Code:	0009
Material Name:	gasoline
	Not reported
Material FA:	Petroleum
Quantity:	.00 Deurada
Units:	Pounds
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Database(s) E

EDR ID Number EPA ID Number

BB239 ENE 1/4-1/2 0.377 mi	GAS STATION 44 ECHO AVE NEW ROCHELLE, NY	NY LTANKS	S116156793 N/A
1988 ft.	Site 4 of 4 in cluster BB		
0.377 mi. 1988 ft. Relative: Lower Actual: 32 ft.	Site 4 of 4 in cluster BB LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Memo:	2014-01-02 Tank Test Failure Gasoline Station or other PBS Facility Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 RDBENDEL Not reported 2014-01-02 Not reported Tank Tester Not reported False 0 2014-01-02 2014-01-02 2014-01-02 2014-01-02 2014-01-02 2014-02-13 Not reported TANK TEST FAILURE Not reported TANK TEST FAILURE Not reported TANK TEST FAILURE Not reported 3 389397 "1/2/14 - WCDOH is oversight the ongoing tank tests. KAB 1/2/2014 APECCO hired by new operator (lease signed within past 6 weeks). Piping and dispensers and electronic leak monitoring equipment to be replaced. Based on lack of leak detection records for past 10 to 12 years, DEC requested TT and IS tests and system check of electronics. Tanks are probably suitable for service, but testing required for confirmation. It appears to be loose fittings. Electronics recently rewired at the computer console within past couple of weeks, but wiring ended near the top of the tanks. No probes in the interstitial space, just loose wiring near top of tank. Owner's representative took electronic system wire ends from the site despite WCDOH's request to take custody. ELM 2-13-14 closed and referred to spill 13-10365 which revealed contaminated soils when the failed lines were	
	Remarks:	removed. RDB" "repair/retest pending - to Ed Moore (waiting for results)"	
	Material: Site ID: Operable Unit ID: Operable Unit:	490405 1239966 01	

Database(s)

EDR ID Number EPA ID Number

# GAS STATION (Continued)

Material ID:	2240056
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

240 ENE 1/4-1/2 0.377 mi. 1988 ft.	FIUMFREDO RESIDENCE 12 BAYVIEW AVE NEW ROCHELLE, NY		NY LTANKS	S111012239 N/A
	LTANKS:			
Relative:		447470		
Lower	Site ID:	447470		
A	Spill Number/Closed Date:			
Actual:	Spill Date:	2011-04-04		
47 ft.	Spill Cause:	Tank Test Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Possible release with minimal potential for fire or hazard or K	nown	
		release with no damage. (Highly Improbable)		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	False		
	SWIS:	6010		
	Investigator:	jbodee		
	Referred To:	Not reported		
	Reported to Dept:	2011-04-04		
	CID:	Not reported		
	Water Affected:	Not reported		
	Spill Notifier:	Tank Tester		
	Last Inspection:	2011-08-08		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer	: 2011-04-04		
	Spill Record Last Update:			
	Spiller Name:	ROSE FIUMFREDO		
	Spiller Company:	ROSE FIUMFREDO		
	Spiller Address:	12 DAYVIEW AVE		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller County:	999		
	Spiller Contact:	ROSE FIUMFREDO		
	Spiller Phone:	(914) 632-0496		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DEC Region. DER Facility ID:	3 402070		
	DEC Memo:	"4/4/11 - To retest tank. KAB 4/28/11 Morris called in for follo	W UD	
	DEC Mento.	Tank failed again. He said tank top was exposed for most of		
			0	
		and one side and some samples taken. Morris said whoever		
		sounds like they only put a new vent riser on. Did not check p	nping,	

EDR ID Number Database(s) EPA ID Number

#### FIUMFREDO RESIDENCE (Continued)

which is heavily crusted. jc 5-6-11 Failed 2nd retest today. Owner giving Kathy a hard time. Morris will retest again next week. Kathy said road name should be Bayview not Dayview, made change. jc 5/13/11 Tank failed for a 3rd time. Plan to pull, according to Tank Tech. dw 8-4-11 Homeowner called dispatch desk. He wants to remove the tank himself and do ALL of the work. He says he would cut open the tank and clean with speedi dri, dispose of tank at scrap yard, etc. I recommended that he hire an environmental consultant to AT LEAST oversee project because the DEC will need a TCR which would include soil samples, manifests, disposal receipts, etc. I told him that this spill will not be closed out until a proper and acceptable Tank Closure Report has been submitted to this office for review. I told him to contact J O'Dee in White Plains for further info. This guy seems bent on doing everything himself even though it was recommended that he hire a consultant to oversee the project. jm 8/4/11: Recieved call from Sandy Perratta 914-557-0142. He is the same individual who called the dispatch desk earlier today. He is not the property owner but a friend of the owner. States he is in the construction business and he can remove the tank himself. He states he has the OSHA 30-hour training and also states he knows that he doesn't need confined space entry training if the tank is less than 4 feet below ground . I again stated he should have a professional contractor do the work for safety reasons, iod 8/8/11: Received voice-mail message from Mr Perratta stating he had removed the tank and it was on the lawn awaiting a DEC drive-by inspection. I met New Rochelle Fire Captain Henry Senno on site. The tank was cut and cleaned and is on plastic. The excavation is open and is not fenced or secured. There is no evidence of any holes in the tank, and no evidence of any leak or contamination. Captain Senno states he will follow up with the owner, as no permits were filed for the removal as required in New Rochelle. DEC Spills requires no further action at this time. jod 9/8/11: I left this spill open after discussing the situation with Capt Senno on either August 9th or 10th. There was still a 55-gallon drum of heating oil and heating oil sludge that was removed from the tank remaining on the site. On either Aug 11th or 12th I spoke with Mr Perrotta and stated the spill would be left open until he submitted a disposal receipt to DEC for proper disposal of that waste drum. To date, Mr Perrotta has submitted a disposal recipt for the tank (entered in eDocs) but has not submitted a disposal receipt for the drum. jod 9/22/11: Letter from Linda Enes forwarded to DEC. She states she is in posesseion of the 55-gallon drum, and is using it to fuel a space heater. I called her this morning and she states her husband transported the drum in his pick-up truck from New Rochelle to their home in Dover Plains NY. Letter has been entered into eDocs. DEC requires no further action. jod" "repair/retest pending"

#### Remarks:

#### Material:

Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: 447470 1197626 01 2193927 0001A #2 fuel oil Not reported Petroleum Not reported

#### S111012239

TC4738280.2s Page 490

Database(s)

EDR ID Number EPA ID Number

S111012239

Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

241 SE 1/4-1/2 0.379 mi. 2003 ft.	NORTH EVARTS 44 NORTH EVARTS AVE ELSMFORD, NY	N	Y LTANKS	S104620864 N/A
2003 ft. Relative: Lower Actual: 40 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Cottact: Spiller Contact: Spiller Contact: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	2000-02-24 Tank Failure Vessel Not reported Not reported False 6000 jkomara Not reported 2000-02-24 322 Not reported Fire Department Not reported Fire Department Not reported True False 0 2000-02-24	а	
	Material: Site ID: Operable Unit ID: Operable Unit:	74554 1087874 01		

Database(s)

EDR ID Number EPA ID Number

# NORTH EVARTS (Continued)

Material ID:	295189
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	20.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

BD242 South 1/4-1/2	APT. BUILDING 208 CENTER AVE. NEW ROCHELLE, NY		NY LTANKS NY Spills	S102674170 N/A
0.381 mi.	Site 4 of 2 in eluctor PD			
2012 ft.	Site 1 of 3 in cluster BD			
Relative:	LTANKS:			
Lower	Site ID:	215702		
	Spill Number/Closed Date:	9314003 / 1994-03-11		
Actual:	Spill Date:	1994-02-28		
73 ft.	Spill Cause:	Tank Overfill		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	Response.	
		Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased:	1994-03-11		
	Cleanup Meets Standard:	False		
	SWIS:	6010		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept:	1994-02-28		
	CID:	Not reported		
	Water Affected:	Not reported		
	Spill Notifier:	Responsible Party		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:	1994-03-11		
	Spill Record Last Update:	1995-01-05		
	Spiller Name:	Not reported		
	Spiller Company:	CASTLE OIL		
	Spiller Address:	290 LOCUST AVE		
	Spiller City,St,Zip:	BRONX, ZZ		
	Spiller County:	001		
	Spiller Contact:	Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	178636		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field	was	
		GHIOSAY "		
	Remarks:	"TANK WAS OVERFILLED CASTLE CREW TO CLEAN UP"		

Database(s)

EDR ID Number EPA ID Number

#### APT. BUILDING (Continued)

Material: Site ID: 215702 Operable Unit ID: 996014 Operable Unit: 01 Material ID: 389350 Material Code: 0002A Material Name: #4 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: 20.00 Units: Gallons Recovered: .00 Not reported Not reported Resource Affected: Oxygenate:

Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Coty,St,Zip: Spiller Contact: Spiller Phone: Spiller Extention:	1994-03-26 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 1994-04-11 False 6010 tdghiosa Not reported 1994-03-26 Not reported Not reported Not reported Other Not reported False False 0
•	•
•	•
DEC Region:	3
DER Facility ID: DEC Memo:	178636 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY "
Remarks:	"FAULTY GUAGE RESULTED IN OVERFILL WCHD NOTIFIED CASTLE OIL WILL CLEAN UP"

Database(s)

EDR ID Number EPA ID Number

# APT. BUILDING (Continued)

Material: Site ID: 215703 Operable Unit ID: 997178 Operable Unit: 01 Material ID: 387016 Material Code: 0003A Material Name: #6 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: 10.00 Units: Gallons Recovered: .00 Resource Affected: Not reported Not reported Oxygenate:

# Tank Test:

#### SPILLS:

Facility ID:	0202241
Facility Type:	ER
DER Facility ID:	177797
Site ID:	214599
DEC Region:	3
Spill Date:	2002-06-01
Spill Number/Closed Date:	0202241 / 2002-08-12
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2002-06-01
CID:	257
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2002-06-01
Spill Record Last Update:	2002-09-26
Spiller Name:	Not reported
Spiller Company:	APT BUILDING
Spiller Address:	208 CENTER AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	nn
Remarks:	"bad gauge - contained - cleanup to be done by castleton enviromental"
	Not reported

Database(s)

EDR ID Number EPA ID Number

Material:	
Site ID:	214599
Operable Unit ID:	855230
Operable Unit:	01
Material ID:	520107
Material Code:	0002A
Material Name:	#4 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

BC243 NW 1/4-1/2 0.383 mi	SOUTH SHORE MED CENTER 16 GUION PLACE NEW ROCHELLE, NY		NY LTANKS	S10752350 N/A
2021 ft.	Site 2 of 2 in cluster BC			
0.383 mi. 2021 ft. Relative: Higher Actual: 100 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer:	2006-01-26 Tank Test Failure Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Rev Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee WCDOH 2006-01-26 406 Not reported Tank Tester Not reported False True 0 2006-01-26	esponse.	
	Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID:	NEW ROCHELLE, NY 001 VERONICA (201) 489-8700 Not reported 3 308757		

# 501

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	SOUTH SHORE MED CENTER	(Continued)	S107523501
	DEC Memo:	"Tank removed, no contamination found. NFA jod 12/22/06 - Letter from Wayne Schneider of WCDOD dated 8/29/06 addressed to Dir. of Engr., Sound Shore Medical Center, has requested NYSDEC to colose this spill #."	
	Remarks:	"Tank test failure. Ullage leak was detected."	
	Material: Site ID:	358758	
	Operable Unit ID:	1115985	
	Operable Unit:	01	
	Material ID:	2106096	
	Material Code:	0008	
	Material Name:	diesel	
	Case No.:	Not reported	
	Material FA:	Petroleum	
	Quantity:	.00	
	Units:	Gallons	
	Recovered: Resource Affected:	.00 Not reported	
	Oxygenate:	Not reported	
	Tank Test:		
	Site ID:	358758	
	Spill Tank Test:	1549678	
	Tank Number:	5	
	Tank Size:	2000	
	Test Method: Leak Rate:	03 .00	
	Gross Fail:	Not reported	
	Modified By:	Watchdog	
	Last Modified:	Not reported	
	Test Method:	Horner EZ Check I or II	
244	RESIDENCE	NY LTANKS	S107489339
WNW	79 WARREN ST		N/A
1/4-1/2	NEW ROCHELLE, NY		
0.384 mi. 2030 ft.	,,,		
Relative:	LTANKS:		
Higher	Site ID:	356553	
-	Spill Number/Closed Date:	0510555 / 2006-03-28	
Actual:	Spill Date:	2005-12-08	
98 ft.	Spill Cause:	Tank Failure	
	Spill Source:	Private Dwelling	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Cleanup Casaadi	Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased: Cleanup Meets Standard:	Not reported True	
	SWIS:	6010	
	Investigator:	JBODee	
	Referred To:	Not reported	
	Reported to Dept:	2005-12-08	
	CID:	407	
	Water Affected:	Not reported	
	Spill Notifier:	Other	

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	<b>RESIDENCE</b> (Continued)			S107489339
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spiller Name:	ISHMAL GALVIN		
	Spiller Company:	RESIDENCE		
	Spiller Address:	79 WARREN ST		
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10801		
	Spiller County:			
	Spiller Contact:	ISHMAL GALVIN		
	Spiller Phone:	(914) 224-3193 Not reported		
	Spiller Extention:	Not reported		
	DEC Region: DER Facility ID:	3 306611		
	DEC Memo:	"March 28, 2006: GRAZI-1 CORP DISPOSED OF LUST AND		E
	DEC Merrio.	CONTAMINATED SOIL. BASED UPON INFORMATION PRO		
		ACTION IS REQUIRED AT THIS TIME. jod"		, NO FURTHER
	Remarks:	"Tank removal, tank size 550 gallons"		
	itemarks.	Talik Terrioval, talik size 550 galoris		
	Material:			
	Site ID:	356553		
	Operable Unit ID:	1113853		
	Operable Unit: Material ID:	01		
	Material Code:	2103913 0001A		
	Material Name:	#2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	Not reported		
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
245 NW 1/4-1/2 0.386 mi.	66 MEMORIAL BLVD 66 MEMORIAL BLVD NEW ROCHELLE, NY		NY LTANKS	S104621761 N/A
2038 ft.				
Relative: Lower	LTANKS: Site ID:	59397		
	Spill Number/Closed Date:			
Actual:	Spill Date:	2000-06-08		
90 ft.	Spill Cause:	Tank Failure		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC F	Response.	
		Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6010 MCUD		
	Investigator:	WCHD		

246

SW

1/4-1/2

0.387 mi. 2042 ft.

Relative:

Lower

Actual:

77 ft.

LTANKS:

Site ID:

Spill Date:

Spill Cause:

Spill Source:

Spill Class:

369299

2006-08-23

Tank Test Failure

Commercial/Industrial

Known release with minimal potential for fire or hazard. DEC Response.

Spill Number/Closed Date: 0606014 / 2007-01-29

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### 66 MEMORIAL BLVD (Continued)

Westchester Cnty Health Dept 2000-06-08 389 Not reported Citizen Not reported False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported Not reported S8153 ""
389 Not reported Citizen Not reported False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
Not reported Citizen Not reported False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
Citizen Not reported False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
Not reported False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
False False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
False 0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
0 2000-06-08 2000-11-21 UNKNOWN UNKNOWN UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
2000-06-08 2000-11-21 UNKNOWN Unknown UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
2000-11-21 UNKNOWN Unknown UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
UNKNOWN Unknown UNKNOWN 999 CALLER Not reported Not reported 3 58153
Unknown UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
UNKNOWN UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
UNKNOWN, NY 999 CALLER Not reported Not reported 3 58153
999 CALLER Not reported 3 58153
CALLER Not reported Not reported 3 58153
Not reported Not reported 3 58153
Not reported 3 58153
3 58153 ""
58153
11
callor reporting a spill of material from a tank being hit while
escavating land for a basement. no callback is necessary caller is
anaymous. clena up is being done at this time."
59397 824416
01
551247
0001A
#2 fuel oil
Not reported
Petroleum
10.00
Gallons
10.00
Not reported
Not reported
NY LTAN NY Sp
58050#NF101NN

S104621761

S108982494

N/A

Database(s)

EDR ID Number EPA ID Number

# PROFESSIONAL OFFICE CORP (Continued)

	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	JBODee
Referred To:	WCDOH
Reported to Dept:	2006-08-24
CID:	444 National states
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	: 2006-08-24
Spill Record Last Update:	2007-01-29
Spiller Name:	GERRI SEENY
Spiller Company:	PROFESSIONAL OFFICE CORP
Spiller Address:	421 HUGUENOT STREET
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	GERRI SEENY
Spiller Phone:	(914) 632-3400
Spiller Extention:	Not reported
•	3
DEC Region:	
DER Facility ID:	319185
DEC Memo:	"RECOMMENDING ISOLATION. 0606014 - 421 Huguenot St, New Rochelle -
	removed petrometer and remote fill from system and retested, passed.
	NFA. 10/23/06 test date"
Remarks:	NFA. 10/23/06 test date"
Remarks:	
Remarks: Material:	
	n
Material: Site ID:	369299
Material: Site ID: Operable Unit ID:	"" 369299 1127138
Material: Site ID: Operable Unit ID: Operable Unit:	"" 369299 1127138 01
Material: Site ID: Operable Unit ID: Operable Unit: Material ID:	"" 369299 1127138 01 2116724
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code:	"" 369299 1127138 01 2116724 0001A
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name:	"" 369299 1127138 01 2116724 0001A #2 fuel oil
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	"" 369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported Sal9299
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported 1
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported 1 369299 1550220 1 3000
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported 1 369299 1550220 1 3000 03
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported Not reported 1 550220 1 369299 1550220 1 3000 03 .00
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail:	369299         1127138         01         2116724         0001A         #2 fuel oil         Not reported         Petroleum         Not reported         Gallons         .00         Not reported         S69299         1550220         1         3000         03         .00         Not reported
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate:	369299 1127138 01 2116724 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported Not reported 1 550220 1 369299 1550220 1 3000 03 .00

Database(s)

EDR ID Number **EPA ID Number** 

S108982494

Test Method:

Horner EZ Check I or II

SPILLS:	
OF ILLO.	

Remarks: Material: Site ID: Operable Operable

> Quantity: Units:

Recovered:

Oxygenate:

**Resource Affected:** 

Gallons

Not reported

Not reported

.00

PILLS:	
Facility ID:	0711337
Facility Type:	ER
DER Facility ID:	319185
Site ID:	392804
DEC Region:	3
Spill Date:	2008-01-28
Spill Number/Closed Date:	0711337 / 2008-06-24
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	WCHD
Referred To:	SCHNEIDER
Reported to Dept:	2008-01-28
CID:	444
Water Affected:	Not reported
Spill Source:	Commercial/Industrial
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2008-01-28
Spill Record Last Update:	2008-06-24
Spiller Name:	GERRY
Spiller Company:	PROFESSIONAL BUILDING COP
Spiller Address:	421 HUGUENOT STREET
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	GERRY
Contact Phone:	(914) 632-3400
DEC Memo:	"Spoke to Gerry. Danielle Jackson of WCHD may be handling. WCHD to
	inspect today. 06/24/08 Wayne Schneider WCHD reported 421 Huguenot
	St, New Rochelle - leaking tank. Contaminated soil remediated. See
<b>_</b>	attached NFA TG "
Remarks:	"HOLES AND CONTAMINATED SOIL"
laterial:	
Site ID:	392804
Operable Unit ID:	1149789
Operable Unit:	01
Material ID:	2140347
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
1.1	0 - 11

Database(s)

EDR ID Number EPA ID Number

Tank Test:	
Site ID:	392804
Spill Tank Test:	2384563
Tank Number:	Not reported
Tank Size:	3000
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified:	Not reported
Test Method:	Unknown

BE247 WSW 1/4-1/2 0.387 mi. 2044 ft. Relative:	RUSH MFG. CORP. 10-12 PINE CT NEW ROCHELLE, NY 1080 Site 1 of 2 in cluster BE	CORRACTS 1000201737 RCRA-CESQG NYD075436394 NY Spills FINDS NY MANIFEST NJ MANIFEST RI MANIFEST
Lower		ECHO
Actual: 56 ft.	CORRACTS:	
	EPA ID: EPA Region: Area Name: Actual Date: Action: NAICS Code(s):	NYD075436394 02 SITEWIDE 19940503 CA075LO - CA Prioritization, Facility or area was assigned a low corrective action priority 336413 332999 336413 Other Aircraft Parts and Auxiliary Equipment Manufacturing All Other Miscellaneous Fabricated Metal Product Manufacturing Other Aircraft Parts and Auxiliary Equipment Manufacturing
	Original schedule date: Schedule end date:	, , , , , , , , , , , , , , , , , , , ,
	EPA ID: EPA Region: Area Name: Actual Date: Action: NAICS Code(s):	NYD075436394 02 SITEWIDE 19920922 CA050 - RFA Completed 336413 332999 336413 Other Aircraft Parts and Auxiliary Equipment Manufacturing All Other Miscellaneous Fabricated Metal Product Manufacturing Other Aircraft Parts and Auxiliary Equipment Manufacturing
	Original schedule date: Schedule end date:	
	RCRA-CESQG: Date form received by a Facility name: Facility address: EPA ID: Mailing address:	gency: 01/01/2007 RUSH MANUFACTURING CORP 10-12 PINE CT NEW ROCHELLE, NY 10801 NYD075436394 PINE CT

Database(s)

EDR ID Number EPA ID Number

1000201737

RUSH MFG. CORP. (Continued)	
Contact: Contact address:	NEW ROCHELLE, NY 10801 DENNIS MCNAMARA PINE CT NEW ROCHELLE, NY 10801
Contact country: Contact telephone: Contact email:	US (914) 636-2700 Not reported
EPA Region: Land type: Classification: Description:	02 Facility is not located on Indian land. Additional information is not known. Conditionally Exempt Small Quantity Generator Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste
Owner/Operator Summary:	
Owner/operator name: Owner/operator address:	TELEDYNE HYDRA-POWER 10-12 PINE COURT OPERCITY, NY 99999
Owner/operator country:	US
Owner/operator telephone:	(914) 632-2200
Legal status: Owner/Operator Type:	Private
Owner/Op start date:	Operator Not reported
Owner/Op end date:	Not reported
Owner/operator name: Owner/operator address:	RUSH MANUFACTURING CORP 10-12 PINE CT
	NEW ROCHELLE, NY 10801
Owner/operator country:	US
Owner/operator telephone:	(914) 636-2700
Legal status:	Private
Owner/Operator Type: Owner/Op start date:	Owner Not reported
Owner/Op end date:	Not reported
Handler Activities Summary:	· •
U.S. importer of hazardous wa Mixed waste (haz. and radioad	
Recycler of hazardous waste:	No
Transporter of hazardous waste.	
Treater, storer or disposer of H	
Underground injection activity:	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No

Database(s)

EDR ID Number EPA ID Number

RUSH MFG. CORP. (Continued)		1000201737
Used oil processor:	No	
User oil refiner:	No	
Used oil fuel marketer to burn		
Used oil Specification markete		
Used oil transfer facility: Used oil transporter:	No No	
Used on transporter.	INO	
Historical Generators: Date form received by agency	:01/01/2006	
Site name:	RUSH MANUFACTURING CORP	
Classification:	Conditionally Exempt Small Quantity Generator	
Date form received by agency	: 06/09/1997	
Site name:	RUSH MANUFACTURING CORP	
Classification:	Conditionally Exempt Small Quantity Generator	
. Waste code:	D001	
. Waste name:	IGNITABLE WASTE	
. Waste code:	F001	
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLEN	
	1,1,1-TRICHLOROETHTLENE, TRICHLORETHTLENE, METHTLENE 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CH	
	FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS	
	CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR M	ORE (BY VOLUME) OF
	ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR	
	IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE REC	COVERY OF THESE
	SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.	
. Waste code:	F002	
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRAC	
	METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHL	
	CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHAN ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE,	-
	TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLEND	
	USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF O	-
	ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LIS	TED IN F001, F004, AND
	F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE	SPENT SOLVENTS AND
	SPENT SOLVENT MIXTURES.	
. Waste code:	F005	
. Waste name:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOL	
	KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZ	
	2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOL CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR M	
	ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENT	( )
	LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM TI	
	THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.	
. Waste code:	U002	
. Waste name:	2-PROPANONE (I) (OR) ACETONE (I)	
. Waste code:	U019	
. Waste name:	BENZENE (I,T)	
. Waste code:	U140	
. Waste code.	1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL ALCOHOL (I,T)	

Database(s) EPA

EDR ID Number EPA ID Number

RUSH MFG. CORP. (Continued)	1000201	737
. Waste code: . Waste name:	U154 METHANOL (I) (OR) METHYL ALCOHOL (I)	
. Waste code: . Waste name:	U238 CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)	
. Waste code: . Waste name:	U239 BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)	
Date form received by agency Site name: Classification:	y:02/25/1992 TELEDYNE HYDRA-POWER Large Quantity Generator	
Date form received by agency Site name: Classification:	y: 11/19/1980 RUSH MANUFACTURING CORP Not a generator, verified	
. Waste code: . Waste name:	F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLE METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F0 F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVE SPENT SOLVENT MIXTURES.	, BEFORE OF THE 004, AND
. Waste code: . Waste name:	F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURE CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLU ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE S LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.	S/BLENDS ME) OF OLVENTS
. Waste code: . Waste name:	U002 2-PROPANONE (I) (OR) ACETONE (I)	
. Waste code: . Waste name:	U019 BENZENE (I,T)	
. Waste code: . Waste name:	U140 1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL ALCOHOL (I,T)	
. Waste code: . Waste name:	U154 METHANOL (I) (OR) METHYL ALCOHOL (I)	
. Waste code: . Waste name:	U238 CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)	
. Waste code: . Waste name: Date form received by agency	U239 BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)	

Site name:	RUSH MANUFACTURING CORP

EDR ID Number Database(s) EPA ID Number

1000201737

RUSH MFG. CORP. (Continued)	
Classification:	Large Quantity Generator
Corrective Action Summary:	
Event date:	09/22/1992
Event:	RFA Completed
Event date:	05/03/1994
Event:	CA Prioritization, Facility or area was assigned a low corrective action priority.
Facility Has Received Notices of	f Violations:
Regulation violated:	Not reported
Area of violation:	Generators - General
Date violation determined:	01/26/1990
Date achieved compliance:	05/02/1990
Violation lead agency:	State
Enforcement action:	WRITTEN INFORMAL
Enforcement action date:	03/12/1990
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency: Proposed penalty amount:	
Final penalty amount:	Not reported
Paid penalty amount:	Not reported
Regulation violated:	Not reported
Area of violation:	Generators - General
Date violation determined:	02/23/1989
Date achieved compliance:	05/12/1989
Violation lead agency:	State
Enforcement action:	WRITTEN INFORMAL
Enforcement action date:	03/27/1989
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency:	State
Proposed penalty amount:	Not reported
Final penalty amount:	Not reported
Paid penalty amount:	Not reported
Regulation violated:	Not reported
Area of violation:	Generators - General
Date violation determined: Date achieved compliance:	03/16/1988 11/17/1988
Violation lead agency:	State
Enforcement action:	WRITTEN INFORMAL
Enforcement action date:	05/09/1988
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency:	
Proposed penalty amount:	
Final penalty amount:	Not reported
Paid penalty amount:	Not reported
Regulation violated:	Not reported
Area of violation:	Generators - General
Date violation determined:	08/27/1987

Database(s)

EDR ID Number EPA ID Number

Date achieved compliance: Violation lead agency: Enforcement action: Enforcement action date: Enf. disposition status: Enf. disp. status date: Enforcement lead agency: Proposed penalty amount: Final penalty amount: Paid penalty amount:	11/17/1988 EPA Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Regulation violated: Area of violation: Date violation determined: Date achieved compliance: Violation lead agency: Enforcement action: Enforcement action date: Enf. disposition status: Enf. disp. status date: Enforcement lead agency: Proposed penalty amount: Final penalty amount: Paid penalty amount:	Not reported Generators - General 03/19/1986 05/27/1986 State WRITTEN INFORMAL 04/15/1986 Not reported Not reported State Not reported Not reported Not reported Not reported Not reported Not reported
Regulation violated: Area of violation: Date violation determined: Date achieved compliance: Violation lead agency: Enforcement action: Enforcement action date: Enf. disposition status: Enf. disp. status date: Enforcement lead agency: Proposed penalty amount: Final penalty amount: Paid penalty amount:	Not reported Generators - General 02/23/1984 10/07/1985 State WRITTEN INFORMAL 03/27/1985 Not reported Not reported State Not reported Not reported Not reported Not reported Not reported Not reported
Evaluation Action Summary: Evaluation date: Evaluation: Area of violation: Date achieved compliance: Evaluation lead agency:	01/26/1990 COMPLIANCE EVALUATION INSPECTION ON-SITE Generators - General 05/02/1990 State
Evaluation date: Evaluation: Area of violation: Date achieved compliance: Evaluation lead agency:	02/23/1989 COMPLIANCE EVALUATION INSPECTION ON-SITE Generators - General 05/12/1989 State
Evaluation date: Evaluation: Area of violation: Date achieved compliance: Evaluation lead agency:	03/16/1988 COMPLIANCE EVALUATION INSPECTION ON-SITE Generators - General 11/17/1988 State

1000201737

Database(s)

EDR ID Number EPA ID Number

1000201737

#### RUSH MFG. CORP. (Continued)

Evaluation date: 03/11/1988 NON-FINANCIAL RECORD REVIEW Evaluation: Not reported Area of violation: Date achieved compliance: Not reported Evaluation lead agency: State Evaluation date: 08/27/1987 COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation: Area of violation: Generators - General Date achieved compliance: 11/17/1988 Evaluation lead agency: EPA Evaluation date: 03/19/1986 Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE Area of violation: Generators - General 05/27/1986 Date achieved compliance: Evaluation lead agency: State Evaluation date: 02/23/1984 COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation: Area of violation: Generators - General Date achieved compliance: 10/07/1985 Evaluation lead agency: State SPILLS: 0901536 Facility ID: Facility Type: ER **DER Facility ID:** 350696 Site ID: 413531 DEC Region: 3 2009-05-07 Spill Date: Spill Number/Closed Date: 0901536 / 2009-06-22 Spill Cause: Unknown Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 TDGHIOSA Investigator: Referred To: Not reported Reported to Dept: 2009-05-07 CID: Not reported Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Local Agency Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2009-05-07 Spill Record Last Update: 2009-06-22 Spiller Name: Not reported Spiller Company: ALPHA MEDICAL Spiller Address: Not reported Spiller City,St,Zip: NY Spiller Company: 999 Contact Name: NIKI (914) 777-1930 Contact Phone:

Site	Database(s)	EDR ID Numb
RUSH MFG. CORP. (Continued)		1000201737
DEC Memo:	"5/7/09 At a construction site, contaminated soils were encountered, which was confirmed by soil tests done by Northeast. They will be doing the site remediation and will submit a cleanup report. dw 06/12/09 Northeast Environmental provided oversight activity when petroleum impacted soil was discovered and need to be removed. Remediation consisted of the removal of 425.66 tons of petroleum	
Remarks:	contaminated soil. Post excavation TAGM soil sample results were all below DEC guidance values. NFA required. TG" "1231 The caller advised dispatch North East Environmental will conduct the clean up. The caller requested a call back. No water ways affected."	
Material:		
Site ID:	413531	
Operable Unit ID:	1169955	
Operable Unit:	01	
Material ID:	2161660	
Material Code:	0001A	
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
	0804532	
Facility ID:	0804532 ER	
Facility ID: Facility Type:	ER	
Facility ID: Facility Type: DER Facility ID:	ER 350696	
Facility ID: Facility Type: DER Facility ID: Site ID:	ER 350696 401456	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date:	ER 350696 401456 3	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response.	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False Not reported	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False Not reported False	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False Not reported False Not reported False Not reported	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False Not reported False Fals	
Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust:	ER 350696 401456 3 2008-07-21 0804532 / 2008-09-26 Equipment Failure Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 TDGHIOSA Not reported 2008-07-21 444 Not reported Commercial/Industrial Other Not reported False Not reported False Not reported False Not reported	

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

RUSH MFG. CORP. (Continued)		100
Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller Company: Contact Name: Contact Phone: DEC Memo:	COMMERCIAL MACHINE SHOP 10-12 PINE COURT NEW ROCHELLE, NY 001 MICHEAL (845) 561-1512 "08/01/08 Conklin Services & Construction submitted a Limited Subsurface Investigation Report. Four geoprobe borings were placed around an abandoned tank. Slight soil contamination exists in borings 1 and 2, however the levels are below DEC TAGM guidance values. NFA TG"	
Remarks:	"SOIL BORINGS SHOWED CONTAMINATED SHOP"	
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	401456 1158245 01 2149301 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported Not reported	
Tank Test:		
FINDS:		
Registry ID:	110009468343	
Federal Ins Toxic Subs regions and and settlem US EPA TF from facilitie these facilitie transported RCRAInfo i Conservatie events and and treat, s program sta	ional Compliance Data Base) supports implementation of the ecticide, Fungicide, and Rodenticide Act (FIFRA) and the tances Control Act (TSCA). The system tracks inspections in d states with cooperative agreements, enforcement actions, nents. RIS (Toxics Release Inventory System) contains information es on the amounts of over 300 listed toxic chemicals that ies release directly to air, water, land, or that are	
NY MANIFEST:		

Database(s)

EDR ID Number EPA ID Number

#### RUSH MFG. CORP. (Continued)

Country: USA EPA ID: NYD075436394 Facility Status: Not reported Location Address 1: 10-12 PINE COURT ΒP Code: Location Address 2: Not reported Not reported Total Tanks: NEW ROCHELLE Location City: Location State: NY Location Zip: 10801 Location Zip 4: 6908 NY MANIFEST: EPAID: NYD075436394 TELEDYNE HYDRA-POWER INC Mailing Name: Mailing Contact: MARCY LATELLA Mailing Address 1: 10-12 PINE COURT Mailing Address 2: Not reported Mailing City: NEW ROCHELLE Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: 6908 Mailing Country: USA Mailing Phone: 9146362700 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2010 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 01/29/2010 Trans1 Recv Date: 01/29/2010 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/01/2010 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported 002486638SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H020 Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

1000201737

Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 7.0 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 D039 Waste Code: Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 10/01/2009 Trans1 Recv Date: 10/01/2009 Trans2 Recv Date: Not reported TSD Site Recy Date: 10/08/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD982270506 TSDF ID 2: Not reported 002115978SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 5.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material.

Database(s)

EDR ID Number EPA ID Number

#### **RUSH MFG. CORP. (Continued)**

Specific Gravity: 1.0 D039 Waste Code: Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported 02/23/2009 Generator Ship Date: 02/23/2009 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 02/26/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD982270506 TSDF ID 2: Not reported Manifest Tracking Number: 001619722SKS Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 7.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D039 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### RUSH MFG. CORP. (Continued)

Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: Not reported Generator Ship Date: 07/16/2009 Trans1 Recv Date: 07/16/2009 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/21/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD982270506 TSDF ID 1: TSDF ID 2: Not reported 001819324SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 8.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 4.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D039 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Not reported Trans2 State ID: Generator Ship Date: 05/08/2009 Trans1 Recv Date: 05/08/2009 Trans2 Recv Date: Not reported TSD Site Recv Date: 05/14/2009

Database(s)

EDR ID Number **EPA ID Number** 

#### **RUSH MFG. CORP. (Continued)**

seq:

Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD982270506 TSDF ID 2: Not reported 001803673SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 7.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D039 Waste Code 1 2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Not reported Waste Code 1\_5: Not reported Waste Code 1 6: Document ID: Not reported Manifest Status: Not reported Not reported 2009 Year: TXR000050930 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 08/31/2009 08/31/2009 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 09/03/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID 1: NJD982270506 TSDF ID 2: Not reported Manifest Tracking Number: 001811141SKS Import Indicator: Ν

Database(s)

EDR ID Number EPA ID Number

1000201737

## RUSH MFG. CORP. (Continued)

Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 8.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D039 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Not reported Trans2 State ID: Generator Ship Date: 10/30/2009 Trans1 Recv Date: 10/30/2009 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/05/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD982270506 TSDF ID 2: Not reported Manifest Tracking Number: 000266181CEX Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported

Database(s)

EDR ID Number EPA ID Number

1000201737

## RUSH MFG. CORP. (Continued)

MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1 5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity:

Units:

H141 Not reported Not reported Not reported Not reported Not reported Not reported 9.0 G - Gallons (liquids only)\* (8.3 pounds) 1.0 DM - Metal drums, barrels R Material recovery of more than 75 percent of the total material. 1.0 D039 Not reported 2008 TXR000050930 Not reported 08/22/2008 08/22/2008 Not reported 08/22/2008 Not reported Not reported NYD075436394 Not reported Not reported RID084802842 Not reported 001491827SKS Ν N Ν Ν Ν Ν Ν Not reported Not reported Not reported H020 Not reported Not reported Not reported Not reported Not reported Not reported 77.0 G - Gallons (liquids only)\* (8.3 pounds)

EDR ID Number Database(s) **EPA ID Number** 

#### **RUSH MFG. CORP. (Continued)**

seq: Year:

Units:

sea: Year:

Number of Containers: 1.0 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D039 Waste Code 1\_2: Not reported Not reported Waste Code 1\_3: Waste Code 1\_4: Not reported Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: CTF1162731 Manifest Status: Not reported Not reported 2005 Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 07/12/2005 Trans1 Recv Date: 07/12/2005 Trans2 Recv Date: 07/19/2005 TSD Site Recv Date: 07/20/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: Not reported Trans2 EPA ID: V38815 TSDF ID 1: CTD002593887 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D002 - NON-LISTED CORROSIVE WASTES Waste Code: Waste Code: Not reported Quantity: 00110 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: CTF1236411 Manifest Status: Not reported Not reported 2005

Database(s)

EDR ID Number EPA ID Number

#### RUSH MFG. CORP. (Continued)

Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 01/18/2005 Trans1 Recv Date: 01/18/2005 Trans2 Recv Date: 01/24/2005 TSD Site Recv Date: 01/28/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: CTK15551 Trans2 EPA ID: V40374PA TSDF ID 1: CTD002593887 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: L Landfill. Specific Gravity: 01.00 CTD1170550 Document ID: Manifest Status: Not reported Not reported seq: Year: 2004 Trans1 State ID: CTJ71372 Trans2 State ID: Not reported Generator Ship Date: 09/14/2004 Trans1 Recv Date: 09/14/2004 Trans2 Recv Date: 09/16/2004 TSD Site Recv Date: 09/21/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: CTD021816889 Trans2 EPA ID: Not reported TSDF ID 1: CTD002593 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

(	
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Quantity:	00055
Units: Number of Containers:	G - Gallons (liquids only)* (8.3 pounds)
	001 DM Matal druma harrala
Container Type: Handling Method:	DM - Metal drums, barrels
Specific Gravity:	T Chemical, physical, or biological treatment. 01.00
Specific Gravity.	01.00
Document ID:	CTF1045117
Manifest Status:	Not reported
seq:	Not reported
Year:	2004
Trans1 State ID:	CTJ11372
Trans2 State ID:	V59864CT
Generator Ship Date:	05/25/2004
Trans1 Recy Date:	05/25/2004
Trans2 Recv Date:	05/26/2004
TSD Site Recv Date:	06/01/2004
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD075436394
Trans1 EPA ID:	CTD021816889
Trans2 EPA ID:	Not reported
TSDF ID 1:	CTD002593
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### **RUSH MFG. CORP. (Continued)**

seq:

seq:

Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: CTF1140188 Manifest Status: Not reported 01 Year: 2003 Trans1 State ID: CT30006A Trans2 State ID: VS9864 Generator Ship Date: 06/23/2003 Trans1 Recv Date: 06/23/2003 Trans2 Recv Date: 06/28/2003 TSD Site Recv Date: 07/07/2003 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: CTD021816889 Trans2 EPA ID: CTD021816889 TSDF ID 1: CTD002593887 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported 00220 Quantity: Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 004 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYC5692522 Manifest Status: Not reported 01 Year: 2002 Trans1 State ID: NYDW9495 Trans2 State ID: CAFT97593 Generator Ship Date: 05/21/2002

Map ID Direction Distance Elevation Site

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### **RUSH MFG. CORP. (Continued)**

Trans1 Recv Date: 05/21/2002 Trans2 Recv Date: 05/29/2002 TSD Site Recv Date: 06/01/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: MOD095038998 TSDF ID 1: KYD053348108 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported 00458 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NJA4016263 Manifest Status: Not reported seq: 01 Year: 2001 Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 12/05/2001 Trans1 Recv Date: 12/05/2001 Trans2 Recv Date: Not reported TSD Site Recv Date: 12/12/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s) EPA ID N

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

1000201737

Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported Quantity: 00458 Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NJA3218557 Manifest Status: Not reported sea: 01 Year: 2001 Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 07/26/2001 Trans1 Recv Date: 07/26/2001 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/31/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D002 - NON-LISTED CORROSIVE WASTES Waste Code: Not reported 00453 Quantity: Units: P - Pounds

Database(s)

EDR ID Number EPA ID Number

#### RUSH MFG. CORP. (Continued)

Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NJA3218563 Document ID: Manifest Status: Not reported seq: 01 Year: 2001 Trans1 State ID: 08690 Trans2 State ID: Not reported 10/10/2001 Generator Ship Date: 10/10/2001 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 10/16/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D002 - NON-LISTED CORROSIVE WASTES Waste Code: Waste Code: Not reported Quantity: 00458 P - Pounds Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NJA3163834 Manifest Status: Not reported 01 seq: Year: 2001 Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 06/14/2001 Trans1 Recv Date: 06/14/2001 Not reported Trans2 Recv Date: TSD Site Recv Date: 06/19/2001

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### RUSH MFG. CORP. (Continued)

Part A Recv Date: Not reported Part B Recv Date: Not reported NYD075436394 Generator EPA ID: Trans1 EPA ID: SCR000075150 Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D002 - NON-LISTED CORROSIVE WASTES Waste Code: Waste Code: Not reported Quantity: 00430 Units: P - Pounds Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NJA3051384 Manifest Status: Not reported 01 seq: Year: 2000 Trans1 State ID: 08690 Trans2 State ID: H10364 11/08/2000 Generator Ship Date: Trans1 Recv Date: 11/08/2000 Trans2 Recv Date: 11/09/2000 TSD Site Recv Date: 11/13/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD075436394 Trans1 EPA ID: SCR000075150 Trans2 EPA ID: SCR000074591 TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

H MFG. CORP. (Continued)	
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Quantity:	00127
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	01.00
1	
Document ID:	NJA3084154
Manifest Status:	Not reported
seq:	01
Year:	2000
Trans1 State ID:	08690
Trans2 State ID:	H10364
Generator Ship Date:	08/03/2000
Trans1 Recv Date:	08/03/2000
Trans2 Recv Date:	08/07/2000
TSD Site Recv Date:	08/09/2000
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD075436394
Trans1 EPA ID:	SCR000075150
Trans2 EPA ID:	SCR000074591
TSDF ID 1:	NJD002182897
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	
Waste Code:	D002 - NON-LISTED CORROSIVE WASTES
Waste Code:	Not reported
Waste Code:	Not reported 00435
Quantity: Units:	P - Pounds
Number of Containers:	P - Pounds 001
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
rianaling method.	

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

Specific Gravity:

01.00

# <u>Click this hyperlink</u> while viewing on your computer to access 84 additional NY\_MANIFEST: record(s) in the EDR Site Report.

NJ MANIFEST:	
EPA Id:	NYD075436394
Mail Address:	Not reported
Mail City/State/Zip:	Not reported
Facility Phone:	Not reported
Emergency Phone:	Not reported
Contact:	Not reported
Comments:	Not reported
SIC Code:	•
	Not reported
County:	00
Municipal:	
Previous EPA Id:	Not reported
Gen Flag:	X
Trans Flag:	Х
TSDF Flag:	X
Name Change:	Not reported
Date Change:	Not reported
Manifest:	
Manifest Number:	001619722SKS
EPA ID:	NYD075436394
Date Shipped:	02/23/2009
TSDF EPA ID:	NJD982270506
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/23/2009
Date Trans2 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Transa Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	
•	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/26/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

Waste Type Code 4: Waste Type Code 5: Waste Type Code 6: Date Accepted: Manifest Discrepancy Type: Data Entry Number: Was Load Rejected: Reason Load Was Rejected: Waste: Manifest Year: Waste Code: Hand Code: Quantity:	Not reported Not reported Not reported Not reported Not reported No Not reported D039 H141 7 G
Manifest Number: EPA ID: Date Shipped: TSDF EPA ID: Transporter EPA ID: Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Transporter 6 EPA ID: Transporter 7 EPA ID: Transporter 7 EPA ID: Transporter 9 EPA ID: Transporter 10 EPA ID: Date Trans1 Transported Waste: Date Trans2 Transported Waste: Date Trans5 Transported Waste: Date Trans6 Transported Waste: Date Trans7 Transported Waste: Date Trans8 Transported Waste: Date Trans9 Transported Waste: Date Trans9 Transported Waste: Date TSDF Received Waste: Date TSDF Received Waste: TSDF EPA Facility Name: QTY Units: Transporter SEQ ID: Transporter-1 Date: Waste SEQ ID: Waste Type Code 2: Waste Type Code 3: Waste Type Code 4: Waste Type Code 5: Waste Type Code 5: Waste Type Code 6: Date Accepted: Manifest Discrepancy Type: Data Entry Number: Was Load Rejected: Reason Load Was Rejected:	002115978SKS NYD075436394 10/01/2009 NJD982270506 TXR000050930 Not reported Not reported

Waste:

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

Manifest Year: Waste Code: Hand Code:	Not reported D039 H141
Quantity:	5 G
Manifest Number: EPA ID:	001803673SKS NYD075436394
Date Shipped:	05/08/2009
TSDF EPA ID:	NJD982270506
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID: Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported Not reported
•	Not reported
Transporter 7 EPA ID: Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	05/08/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	05/14/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID: Transporter-1 Date:	Not reported Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D039
Hand Code:	H141
Quantity:	7 G
Manifest Number:	001811141SKS
EPA ID:	NYD075436394
Date Shipped:	08/31/2009
TSDF EPA ID:	NJD982270506

Map ID Direction Distance Elevation Site

#### MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

#### **RUSH MFG. CORP. (Continued)**

Transporter EPA ID: TXR000050930 Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Transporter 6 EPA ID: Transporter 7 EPA ID: Transporter 8 EPA ID: Transporter 9 EPA ID: Transporter 10 EPA ID: Date Trans1 Transported Waste: Date Trans2 Transported Waste: Date Trans3 Transported Waste: Date Trans4 Transported Waste: Date Trans5 Transported Waste: Date Trans6 Transported Waste: Date Trans7 Transported Waste: Date Trans8 Transported Waste: Date Trans9 Transported Waste: Date Trans10 Transported Waste: Date TSDF Received Waste: **TSDF EPA Facility Name:** QTY Units: Transporter SEQ ID: Transporter-1 Date: Waste SEQ ID: Waste Type Code 2: Waste Type Code 3: Waste Type Code 4: Waste Type Code 5: Waste Type Code 6: Date Accepted: Manifest Discrepancy Type: Data Entry Number: Was Load Rejected: No Reason Load Was Rejected: Waste: Manifest Year: Waste Code: D039 Hand Code: H141 Quantity: 8 G Manifest Number: EPA ID: Date Shipped: TSDF EPA ID: Transporter EPA ID: Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Not reported Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Transporter 8 EPA ID: Not reported Transporter 9 EPA ID: Not reported Transporter 10 EPA ID: Not reported

Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 08/31/2009 Not reported 09/03/2009 Not reported 002486638SKS NYD075436394 01/29/2010 NJD002182897 TXR000050930 Not reported Not reported Not reported

Database(s)

EDR ID Number **EPA ID Number** 

1000201737

## **RUSH MFG. CORP. (Continued)**

Date Trans1 Transported Waste: 01/29/2010 Date Trans2 Transported Waste: Date Trans3 Transported Waste: Date Trans4 Transported Waste: Date Trans5 Transported Waste: Date Trans6 Transported Waste: Date Trans7 Transported Waste: Date Trans8 Transported Waste: Date Trans9 Transported Waste: Date Trans10 Transported Waste: Date TSDF Received Waste: **TSDF EPA Facility Name:** QTY Units: Transporter SEQ ID: Transporter-1 Date: Waste SEQ ID: Waste Type Code 2: Waste Type Code 3: Waste Type Code 4: Waste Type Code 5: Waste Type Code 6: Date Accepted: Manifest Discrepancy Type: Data Entry Number: Was Load Rejected: No Reason Load Was Rejected: Waste: Manifest Year: Waste Code: D039 H020 Hand Code: Quantity: 7 G Manifest Number: EPA ID: Date Shipped: TSDF EPA ID: Transporter EPA ID: Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Transporter 6 EPA ID: Transporter 7 EPA ID: Transporter 8 EPA ID: Transporter 9 EPA ID: Transporter 10 EPA ID: Date Trans1 Transported Waste: Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Not reported Date Trans6 Transported Waste: Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported

Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported 02/01/2010 Not reported 000266181CEX NYD075436394 10/30/2009 NJD982270506 TXR000050930 Not reported 10/30/2009 Not reported

## TC4738280.2s Page 530

Map ID Direction Distance Elevation Site

#### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### **RUSH MFG. CORP. (Continued)**

Date TSDF Received Waste: 11/05/2009 TSDF EPA Facility Name: Not reported Not reported QTY Units: Not reported Transporter SEQ ID: Transporter-1 Date: Not reported Waste SEQ ID: Not reported Not reported Waste Type Code 2: Not reported Waste Type Code 3: Waste Type Code 4: Not reported Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: Not reported Was Load Rejected: No Reason Load Was Rejected: Not reported Waste: Manifest Year: Not reported Waste Code: D039 Hand Code: H141 9 G Quantity: Manifest Number: 001632477SKS EPA ID: NYD075436394 Date Shipped: 01/30/2009 TSDF EPA ID: NJD982270506 Transporter EPA ID: TXR000050930 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Not reported Transporter 8 EPA ID: Transporter 9 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 01/30/2009 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported 02/05/2009 Date TSDF Received Waste: **TSDF EPA Facility Name:** Not reported QTY Units: Not reported Not reported Transporter SEQ ID: Transporter-1 Date: Not reported Not reported Waste SEQ ID: Not reported Waste Type Code 2: Waste Type Code 3: Not reported Waste Type Code 4: Not reported Waste Type Code 5: Not reported

Database(s)

EDR ID Number EPA ID Number

## RUSH MFG. CORP. (Continued)

Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
	•
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported
Waste:	
	Niet new enteral
Manifest Year:	Not reported
Waste Code:	D039
Hand Code:	H141
Quantity:	7 G
Manifest Number:	001819324SKS
EPA ID:	NYD075436394
Date Shipped:	07/16/2009
TSDF EPA ID:	NJD982270506
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	•
•	Not reported
Date Trans1 Transported Waste:	07/16/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/21/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
	•
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	No
Reason Load Was Rejected:	Not reported
Waste:	Not see to t
Manifest Year:	Not reported
Waste Code:	D039

Database(s)

EDR ID Number EPA ID Number

1000201737

## RUSH MFG. CORP. (Continued)

Hand Code:	H141
Quantity:	8 G

RI MANIFEST: EPA Id: Manifest Document Number: GEN Cert Date: TSDF Id: TSDF Name: TSDF Date: Transporter 2 Id: Transporter 2 Name: Transporter Receipt Date: Number Of Containers: Container Type: Waste Code1: Waste Code2: Waste Code3: Fee Exempt Code: Comment:	NYD075436394 CTC0168898 10/7/1991 CTD021816889 UNITED Not reported Not reported Not reported O Not reported F002 Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Details: EPA ID: Manifest Docket Number: Waste Description: Quantity: WT/Vol Units: Item Number: Transporter Name: Transporter Receipt Date: Transporter Receipt Date: Transporter 2 Receipt Date: TSDF Receipt Date: Transporter 2 ID:	NYD075436394 CTC0168898 OIL 575 G 1 SEALAND CTD983872748 10/7/1991 Not reported Not reported Not reported Not reported Not reported Not reported
EPA ID: Manifest Docket Number: Waste Description: Quantity: WT/Vol Units: Item Number: Transporter Name: Transporter Receipt Date: Transporter Receipt Date: Transporter 2 Receipt Date: TSDF Receipt Date: Transporter 2 ID:	NYD075436394 CTC0168898 OIL 575 G 1 SEALAND CTD983872748 10/7/1991 Not reported Not reported Not reported Not reported Not reported Not reported

## ECHO:

Envid: Registry ID: 1000201737 110009468343

TC4738280.2s Page 533

EDR ID Number EPA ID Number

Database(s)

	RUSH MFG. CORP. (Continue	d) 100020173
	DFR URL:	http://echo.epa.gov/detailed_facility_report?fid=110009468343
BE248 WSW 1/4-1/2 0.387 mi.	GKIDS REALTY 10/12 PINE COURT NEW ROCHELLE, NY	NY LTANKS S10599560 N/A
2044 ft.	Site 2 of 2 in cluster BE	
Relative: Lower	LTANKS: Site ID:	235436
Actual	Spill Number/Closed Date:	
Actual: 56 ft.	Spill Date: Spill Cause:	2002-04-10 Tank Test Failure
	Spill Source:	Private Dwelling
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	opin oldos.	Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	WCHD
	Referred To:	Westchester Cnty Health Dept
	Reported to Dept:	2002-04-10
	CID: Water Affected:	204 Not reported
	Spill Notifier:	Not reported Responsible Party
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spiller Name:	GKIDS REALTY
	Spiller Company:	GKIDS REALTY 10/12 PINE COURT
	Spiller Address: Spiller City,St,Zip:	NEW ROCHELLE, NY
	Spiller County:	001
	Spiller Contact:	MICHAEL GOLD
	Spiller Phone:	(800) 666-2605
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	193919
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD-SCHNEIDER #2 PBS 3-504998 handled by WCHD 12/09/03 TANK CLOSED IN PLACE, SAMPLE RESULTS BELOW TAGM. SPILL CLOSED BY WAYNE SCHNEIDE OF WCHD."
	Remarks:	"TANK TEST FAILURE - RECOMMEND TO ISOLATE PIPING AND RETEST "
	Material:	
	Site ID:	235436
	Operable Unit ID:	851333
	Operable Unit: Material ID:	01 525339
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	.00

Database(s)

EDR ID Number EPA ID Number

	GKIDS REALTY (Continued)			S10599560
	Units:	Gallons		
	Recovered: Resource Affected:	.00 Not reported		
	Oxygenate:	Not reported		
	Chygonato.			
	Tank Test:			
	Site ID:	235436		
	Spill Tank Test:	1527023		
	Tank Number:	1		
	Tank Size:	5000		
	Test Method: Leak Rate:	99		
	Gross Fail:	.00 Not reported		
	Modified By:	Spills		
	Last Modified:	Not reported		
	Test Method:	Alternate Test per 613.5a2v		
249	RESIDENCE	NV I	LTANKS	S10244812
NE	14 REVERE RD			N/A
1/4-1/2	NEW ROCHELLE, NY			
0.388 mi.				
2047 ft.				
Relative:	LTANKS:			
Lower	Site ID:	69656		
	Spill Number/Closed Date:	9611129 / 1996-12-11		
Actual:	Spill Date:	1996-12-09		
34 ft.	Spill Cause:	Tank Failure		
	Spill Source:	Tank Truck	~	
	Spill Class:	Known release that creates a file or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	y	
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6000		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept:	1996-12-09		
	CID:			
	Water Affected: Spill Notifier:	CARPENTERS POND Fire Department		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:	1996-12-09		
	Spill Record Last Update:	1997-01-02		
	Spiller Name:	Not reported		
	Spiller Company:	FRED M. SCHILDWACHLER &		
	Spiller Address:	SONS		
	Spiller City,St,Zip:	ZZ		
	Spiller County:	001 Not reported		
	Spiller Contact:	Not reported		
	Spiller Phone: Spiller Extention:	Not reported Not reported		
	DEC Region:	3		
	DER Facility ID:	66210		
	(D.			

MAP FINDINGS

	<b>RESIDENCE</b> (Continued)	S102448122
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY 12/10/96 WCHD AT SITE." Remarks: "DRIVER OVERFILLED TANK OIL INTO BROOK BROOK RUNS TO A		
	Remarks:	"DRIVER OVERFILLED TANK OIL INTO BROOK BROOK RUNS TO A POND (CARPENTERS POND) FD ON SCENE CELL # FOR CHIEF 914-263-2302 WESTCHESTER FIRE CONTROL 914-593-5905"
	Material:	
	Site ID:	69656
	Operable Unit ID:	1042681
	Operable Unit: Material ID:	01 343331
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	50.00
	Units: Recovered:	Gallons 50.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	Tank Test:	
250 NE 1/4-1/2 0.389 mi. 2056 ft.	SUNOCO 71 HUGUENOT ST NEW ROCHELLE, NY	NY LTANKS S102233475 NY Spills N/A
Relative:	LTANKS:	
Lower	Site ID: Spill Number/Closed Date:	255332
Actual:	Spill Date:	1996-02-20
32 ft.	Spill Cause:	Tank Failure
	Spill Source:	Gasoline Station or other PBS Facility
	Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept: CID:	1996-02-20 312
	Water Affected:	Not reported
	Spill Notifier:	Other
	Last Inspection:	Not reported
	Recommended Penalty: UST Involvement:	False True
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	1996-09-05
	Spiller Name:	RUSSELL HAMMOND
	Spiller Company: Spiller Address:	SUNOCO / A-PLUS 71 HUGUENOT
	Spiller City,St,Zip:	NEW ROCHELLE, NY

Database(s)

EDR ID Number EPA ID Number

## S102233475

SUNOCO (Continued)	S102233
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	209140
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
DEC Mento.	GHIOSAY 07/26/96 EPS SUBMITTED G.W. INVESTIAGATION WHICH INDICATES
	THAT SUNOCO IS THE SOURCE OF G.W. CONTAM. ON 15 RIVER ST. "
Remarks:	"soil boring for assessment for station upgrade - head space reading
Remarks.	indicates potential of petroleum release"
	indicates potential of petroleum release
Material:	
Site ID:	255332
Operable Unit ID:	1025945
Operable Unit:	01
Material ID:	354972
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
SPILLS:	0040004
Facility ID:	9610201
Facility Type:	ER
DER Facility ID:	201279
Site ID:	245037
DEC Region:	3 1996-02-28
Spill Date: Spill Number/Closed Date:	
Spill Cause:	Unknown
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	jghardy
Referred To:	Not reported
Reported to Dept:	1996-11-15
CID:	366
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Local Agency
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1996-11-15

Database(s)

EDR ID Number EPA ID Number

## S102233475

SUNOCO (Continued)	S102233475
Spill Record Last Update:	2005-01-21
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller Company:	001
Contact Name:	RUSSELL HAMMOND
Contact Phone:	(516) 239-2431
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	HARDY 11/15/96 PETROLEUM FOUND DURING WELL SAMPLING; 09/22/97 LETTER
	SENT; REMEDIATION IS REQUIRED AT THIS SITE; 01/02/98 LETTER SENT;
	REMEDIATION PROPOSAL IS APPROVED; WORK MUST START WITHIN THIRTY DAYS;
	12/30/99 LETTER SENT TO SUN COMPANY; PROPOSAL TO INSTALL HI-VAC
	SYSTEM AT THIS SITE IS APPROVED & REQUIRED 1/20/05 nfa letter has
	been sent do to low and declining groundwater contaminationclose
	05/18/00 LETTER SENT TO MATRIX ENV. BY J. HARDY; REMEDIAL ACTION PLAN
	OF 1/12/00 IS APPROVED AND REQUIRED 04/19/01 LETTER SENT TO MATRIX
	ENV. BY J. HARDY; YOU ARE AUTHOR IZED TO OPERATE REMEDIAL SYSTEMS FOR
	90 DAYS WHILE DISCHARGE PERMIT APPLICATIONS ARE BEING PROCESSED
	06/22/01 LETTER SENT TO MATRIX ENV. BY J. HARDY; AUTHORIZED BY WCDOH
	TO OPERATE SYSTEM FOR 90 DAYS WHILE PERMITTING IS IN PROGRESS
	05/09/03: Letter sent to Matrix Env. Tech. by J. Hardy; Report
	submitted dated March 20, 2003. Next report due after completion of one year monitoring period. 2/12/04: Letter sent to Matrix Env. Tech.
	by J. Hardy. No further action is required at this time. Spill cannot
	be closed due to BTEX levels in monitoring wells 2 & 4."
Remarks:	"while removing old tanks discovered contaminated soil. caller's
Komano.	company is cleaning. "
Material:	
Site ID:	245037
Operable Unit ID:	1038129
Operable Unit:	01
Material ID:	342418
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Site ID:	245037
Operable Unit ID:	1038129 01
Operable Unit: Material ID:	2096838
Material Code:	1213A
Material Name:	MTBE (methyl-tert-butyl ether)
Case No.:	01634044
Material FA:	Hazardous Material
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	SUNOCO (Continued)			S102233475
	Tank Test:			
251 SSE 1/4-1/2 0.392 mi. 2070 ft.	TRINITY ARMS APARTMENTS 25 TRINITY PLACE NEW ROCHELLE, NY		NY LTANKS	S109416298 N/A
Relative: Lower	LTANKS: Site ID:	283512		
	Spill Number/Closed Date:	8905211 / 1992-07-30		
Actual: 70 ft.	Spill Date: Spill Cause:	1989-08-12 Tank Test Failure		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Known release with minimal potential for fire or hazard. D Willing Responsible Party. Corrective action taken.	EC Response.	
	Cleanup Ceased:	1992-07-30		
	Cleanup Meets Standard: SWIS:	True 6010		
	Investigator:	tdghiosa		
	Referred To:	Not reported		
	Reported to Dept: CID:	1989-08-12 Not reported		
	Water Affected:	Not reported		
	Spill Notifier:	Tank Tester		
	Last Inspection: Recommended Penalty:	Not reported False		
	UST Involvement:	False		
	Remediation Phase: Date Entered In Computer:	0		
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company: Spiller Address:	ANN JASLOCKI REAL ESTATE		
	Spiller City,St,Zip:	ZZ		
	Spiller County:	001		
	Spiller Contact: Spiller Phone:	Not reported Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID: DEC Memo:	229952 "Prior to Sept, 2004 data translation this spill Lead_DEC I	Field was	
		GHIOSAY "		
	Remarks:	"4K PETRO TITE,234 GPH"		
	Material:			
	Site ID:	283512		
	Operable Unit ID: Operable Unit:	932936 01		
	Material ID:	445651		
	Material Code:	0001A #2 fuel oil		
	Material Name: Case No.:	#2 fuel oil Not reported		
	Material FA:	Petroleum		
	Quantity: Units:	.00 Gallons		
	Unito.	Gaioria		

Database(s)

EDR ID Number EPA ID Number

## TRINITY ARMS APARTMENTS (Continued)

	(continuou)
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	
Tank Test:	
Site ID:	283512
Spill Tank Test:	1535913
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Unknown
Site ID:	409448
Spill Number/Closed Date:	
Spill Date:	2009-01-30
Spill Cause:	Tank Test Failure
Spill Source:	Private Dwelling
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	TDGHIOSA
Referred To:	Not reported
Reported to Dept:	2009-01-30
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	2009-04-22
Spiller Name:	WILLY SILSDORF
Spiller Company:	TRINITY ARMS LTD
Spiller Address:	25 TRINITY PLACE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	
Spiller Contact: Spiller Phone:	LARRY BOYD
Spiller Extention:	(914) 682-5676 Not reported
DEC Region:	3
DER Facility ID:	229952
DEC Memo:	"Spoke to W. Silsdorf. Think it may be leak in piping or fitting.
DEO MONO.	Will probably Uncover, repair and retest. dvw 04/21/09 Wayne
	Schnieder reported ttf 1/3/09. passing retest after line replacement.
	No contamination. NFA TG "
Remarks:	"Caller states he performed a EZ-3 test and had a failure. Caller
	does not believe a spill or resources are affected."

Database(s)

EDR ID Number EPA ID Number

Material:	
Site ID:	409448
Operable Unit ID:	1165955
Operable Unit:	01
Material ID:	2157389
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

BD252 South 1/4-1/2 0.393 mi. 2075 ft.	RESIDENCE 6 POPLAR ROAD NEW ROCHELLE, NY Site 2 of 3 in cluster BD	NY LTANKS	S106124419 N/A
2075 ft. Relative: Lower Actual: 73 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller County: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region:	2003-11-25 Tank Test Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 UNASSIGNED Not reported 2003-11-25 444 Not reported Tank Tester Not reported False False 0 Not reported 2012-08-13 Not reported 2012-08-13 Not reported Not reported 3	
	DER Facility ID:	76439	

## S109416298

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	RESIDENCE (Continu	Jed)		S106124419
	DEC Memo:	"7/29/10 Homeowner TTF JO'M 7/25/12: There is no such add Poplar Road in New Rochelle. This should either be 6 Poplar R Larchmont, or 6 Poplar Place in New Rochelle. jod 8/13/12 Wit and regional approval all Homeowner Tank Test Failure with no older than 5 years will be closed. NFA JO M"	oad in h Albany	
	Remarks:	ии		
	Material:			
	Site ID:	82997		
	Operable Unit ID:	875149		
	Operable Unit:	01		
	Material ID:	498967		
	Material Code:	0001A		
	Material Name:	#2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	.00		
	Units:	Pounds		
	Recovered:	.00		
	Resource Affecte			
	Oxygenate:	Not reported		
	Tank Test:			
	Site ID:	82997		
	Spill Tank Test:	1528823		
	Tank Number:	1		
	Tank Size:	500		
	Test Method:	03		
	Leak Rate:	.00		
	Gross Fail:	Not reported		
	Modified By:	Spills		
	Last Modified:	Not reported		
	Test Method:	Horner EZ Check I or II		
253		SON - ECHO AVE. SITE	NY SHWS	S101008407
NE	ECHO AVENUE			N/A
1/4-1/2	NEW ROCHELLE, NY	10801		
0.395 mi.				
2085 ft.				
Relative:	SHWS:			
Lower	Program:	HW		
Actual:	Site Code: Classification:	56077 P		
30 ft.	Region:	3		
	Acres:	3		
	HW Code:	360016		
	Record Add:	11/18/1999		
	Record Upd:	04/26/2016		
	Updated By:	GWHEITZM		
	Site Description:	LocationThe Site is located at 78 Echo Avenue in New Rochelle,		
		Westchester County, New York. This 3 acre site is bordered to the		
		north by Echo Bay, an estuary of the Long Island Sound. It is		
		bordered to the east and south by residential properties, to the		
		southwest by Echo Bay Avenue, and to the west by a landscaping		
		company (formerly a fuel oil terminal).Site FeaturesAll the former		

EDR ID Number Database(s)

EPA ID Number

### CONSOLIDATED EDISON - ECHO AVE. SITE (Continued)

### S101008407

130LIDATED EDISON	- ECHO AVE. SITE (Conunded)
	structures and underground utility services have been removed, and the whole site has been levelled, top-soiled and grassed.Current UseThe site is currently vacantPast Use of the SiteCon Edison used the site as an electrical distribution substation until 1981. PCBs transformers were stored and used at the site. Leaks and spills of PCBs may have occurred in the handling or servicing of these transformers. The soil on site and the sediment in the Bay were contaminated with PCBs.
Env Problem:	Prior to remediation the contaminant of concern was PCBs.Remediation of the site is complete. The cleanup of PCBs and other incidentally detected contaminants has mitigated the threat to the environment, and in particular to the natural habitat in the bay.
Health Problem:	As information for this site becomes available, it will be reviewed by the NYSDOH to determine if site contamination presents public health exposure concerns.
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	Disp. Owner
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	CONSOLIDATED EDISON OF NEW YORK, INC
Owner Address:	Not reported
Owner Addr2:	Not reported
Owner City,St,Zip:	ZZ
Owner Country:	United States of America
Own Op:	On-Site Operator
Sub Type:	E
Owner Name:	Not reported
Owner Company:	Consolidated Edison of New York, Inc.
Owner Address:	4 IRVING PLACE
Owner Addr2:	Not reported
Owner City,St,Zip:	NEW YORK, NY 10003
Owner Country:	United States of America
Own Op:	Owner
Sub Type:	NNN
Owner Name:	Not reported
Owner Company:	Consolidated Edison of New York, Inc.
Owner Address:	4 IRVING PLACE
Owner Addr2:	Not reported
Owner City,St,Zip:	NEW YORK, NY 10003
Owner Country:	United States of America
Own Op: Sub Type:	Owner E
Sub Type:	
Owner Name: Owner Company:	Not reported
	Consolidated Edison of New York, Inc.
Owner Address: Owner Addr2:	4 IRVING PLACE
Owner Addrz:	Not reported

Map ID	
Direction	
Distance	
Elevation	Site

Database(s)

EDR ID Number **EPA ID Number** 

#### CONSOLIDATED EDISON - ECHO AVE. SITE (Continued)

Owner Address:4 IRVING PLACEOwner Addr2:Not reportedOwner City,St,Zip:NEW YORK, NY 10003Owner Country:United States of AmericaHW Code:Not reportedWaste Type:Not reportedWaste Quantity:Not reportedWaste Code:Not reportedCrossref ID:Not reportedCross Ref Type Code:Not reportedCross Ref Type:Not reportedRecord Added Date:Not reportedRecord Updated:Not reportedUpdated By:Not reported
--

#### NY LTANKS S104514442 N/A

BF254 **100-102 UNION AVENUE 100-102 UNION AVENUE** West NEW ROCHELLE, NY 1/4-1/2 0.398 mi. 2099 ft. Site 1 of 4 in cluster BF LTANKS: **Relative:** 166425 Site ID: Higher Spill Number/Closed Date: 9608199 / 1996-11-08 Actual: Spill Date: 1996-10-01 95 ft. Spill Cause: Tank Failure Spill Source: Institutional, Educational, Gov., Other Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1996-10-01 CID: 205 Water Affected: Not reported Spill Notifier: **Responsible Party** Last Inspection: Not reported **Recommended Penalty:** False UST Involvement: False Remediation Phase: 0 Date Entered In Computer: 1996-10-01 Spill Record Last Update: 1996-12-10 Spiller Name: LJ NJ ASSOC Spiller Company: 100-102 UNION AVENUE Spiller Address: 100-102 UNION AVENUE Spiller City,St,Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: LJ NJ ASSOC Spiller Phone: (914) 636-7297 Spiller Extention: Not reported

### S101008407

EDR ID Number Database(s)

# EPA ID Number

### 100-102 UNION AVENUE (Continued)

DEC Region: DER Facility ID: DEC Memo: Remarks:	3 140217 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY 11/08/96 LETTER SENT BASED ON CLOSURE REPORT NFA" "caller pulled tank and found contaminated soil."
Material:	
Site ID:	166425
Operable Unit ID:	1036474
Operable Unit:	01
Material ID:	343940
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

BF255	KAGEL HOME			S107658662
West	99 UNION AVE			N/A
1/4-1/2	NEW ROCHELLE, NY			
0.399 mi.				
2106 ft.	Site 2 of 4 in cluster BF			
Relative:	LTANKS:			
Higher	Site ID:	360201		
• • •	Spill Number/Closed Date:			
Actual: 95 ft.	Spill Date:	2006-02-27		
95 H.	Spill Cause:	Tank Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Re	esponse.	
	Cleanup Casadi	Willing Responsible Party. Corrective action taken. 2006-03-06		
	Cleanup Ceased:	False		
	Cleanup Meets Standard: SWIS:	6010		
	Investigator:	JBODee		
	Referred To:	Not reported		
	Reported to Dept:	2006-02-27		
	CID:	444		
	Water Affected:	Not reported		
	Spill Notifier:	Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:	2006-02-27		
	Spill Record Last Update:			
	Spiller Name:	ANDREW KAGEL		
	Spiller Company:	KAGEL HOME		
	Spiller Address:	99 UNION AVE		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		

**KAGEL HOME (Continued)** 

001

Spiller County:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### Spiller Contact: ANDREW KAGEL Spiller Phone: (914) 403-2881 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 310321 DEC Memo: "Homeowner waiting on proposal from N.E. to finish job. 3/6/06 Northeast Environmental reported that the tank was removed along with eight drums of petroleum impacted soil. NFA. TG" Remarks: "550 gallon tank had holes and found contaminated soil;" Material: Site ID: 360201 Operable Unit ID: 1117385 Operable Unit: 01 Material ID: 2107892 Material Code: 0001A Material Name: #2 fuel oil Case No.: Not reported Petroleum Material FA: Quantity: Not reported Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: TANK TEST FAILURE NY LTANKS S111239332 **50 WALNUT ST** N/A **NEW ROCHELLE, NY**

#### S107658662

256 West

#### 1/4-1/2 0.399 mi. 2109 ft.

Relative:	LTANKS:	
Higher	Site ID:	455637
U	Spill Number/Closed Date:	1107925 / 2013-02-05
Actual:	Spill Date:	2011-09-21
94 ft.	Spill Cause:	Tank Test Failure
	Spill Source:	Private Dwelling
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
		Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	False
	SWIS:	6010
	Investigator:	jbodee
	Referred To:	Not reported
	Reported to Dept:	2011-09-21
	CID:	Not reported
	Water Affected:	Not reported
	Spill Notifier:	Tank Tester
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	2011-09-21

BG257

South

1/4-1/2

0.401 mi.

17 POPLAR PL

NEW ROCHELLE, NY

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

### S111239332

TANK TEST FAILURE (C	Continued)
----------------------	------------

ILL NUMBER 0009195	NY LTA
Tank Test:	
Oxygenate:	Not reported
Resource Affected:	Not reported
Recovered:	Not reported
Units:	Not reported
Quantity:	Not reported
Material FA:	Petroleum
Case No.:	Not reported
Material Name:	#2 fuel oil
Material Code:	0001A
Material ID:	2202749
Operable Unit:	01
Operable Unit ID:	1205789
Material: Site ID:	455637
Remarks:	"tank test failure"
	Based upon the information provided, this Department requires no further action at this time. Closed - doesn not meet standarsds. jod"
	with causing possible structural damage to the building foundations.
	values. Additional excavation of contaminted soil is not possible
	sample results showed residual contamination over CP-51 Guidance
	LUST and a total of 21.05 tons of petroleum contaminated soil. Exit
	investigate further. jc 2/6/13: Northeast Environmental disposed of
	son. Sal cell: (914)424-2239. Sal has Eastern Env coming out Wed to
DEC Memo:	"9-21-11 Owner is Pietro Vigna and doesn't speak english. Sal is his
DER Facility ID:	410212
DEC Region:	3
Spiller Extention:	Not reported
Spiller Phone:	Not reported
Spiller Contact:	KEN RONK
Spiller County:	999
Spiller City,St,Zip:	NY
Spiller Address:	Not reported
Spiller Company:	SAL VIGNA
Spiller Name:	Not reported
Sniller Name	Not reported

NY LTANKS	S104877181
	N/A

2116 ft.	Site 1 of 2 in cluster BG	
Relative: Lower	LTANKS: Site ID: Spill Number/Closed Date:	63217 0009195 / 2001-01-08
Actual: 74 ft.	Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased:	2000-11-09 Tank Test Failure Private Dwelling Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported
	Cleanup Ceased: Cleanup Meets Standard:	Corrective action taken. Not reported

Database(s)

EDR ID Number EPA ID Number

77181

SPILL NUMBER 0009195 (Con	tinued)	S10487718
SWIS:	6010	
Investigator:	jbodee	
Referred To:	Not reported	
Reported to Dept:	2000-11-09	
CID:	257	
Water Affected:	Not reported	
Spill Notifier:	Tank Tester	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Involvement:	False	
Remediation Phase:	0	
Date Entered In Computer:	2000-11-09	
Spill Record Last Update:	2001-02-02	
Spiller Name:	DESIGN BUILDERS GROUP	
Spiller Company:	Not reported	
Spiller Address:	17 POPLAR PL	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller County:	001	
Spiller Contact:	DESIGN BUILDERS GROUP	
Spiller Phone:	(914) 948-9785	
Spiller Extention:	Not reported	
DEC Region:	3	
DER Facility ID:	61128	
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	O'DEE 11/17/2000 TANK TEST FAILURE LETTER SENT. TANK SCHEDULE	
	RETEST ON 11/20/00. 01/08/2001 ENVIROSTAR PULLED TANK. TANK WA	
	SOUND, NO RELEASE. EVIROSTAR REPORTS TANK FAILED DUE TO FA	
Domorkov	LINES. NO CONTAMINATION FOUND. NO FURTHER ACTION REQUIRED.	
Remarks:	"uncover repair retest"	
<b>••</b>		
Material: Site ID:	63217	
Operable Unit ID:		
Operable Unit:	831505 01	
Material ID:	543152	
Material Code:	0001A	
Material Name:	#2 fuel oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
,,,		

Tank Test:

Database(s)

EDR ID Number EPA ID Number

BD258 South 1/4-1/2 0.404 mi.	LABELLA RESIDENCE 219 CENTRE AVE NEW ROCHELLE, NY	NY LTANKS	S107789449 N/A
2132 ft.	Site 3 of 3 in cluster BD		
1/4-1/2 0.404 mi.	NEW ROCHELLE, NY Site 3 of 3 in cluster BD LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Company: Spiller Company: Spiller County: Spiller County: Spiller County: Spiller County: Spiller County: Spiller Extention: DEC Region: DEC Memo: Remarks:	2006-05-23 Tank Test Failure Private Dwelling Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2006-05-23 409 Not reported Tank Tester Not reported False False 0 : 2006-05-23	N/A
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity:	364328 1122357 01 2111830 0001A #2 fuel oil Not reported Petroleum .00	

BF259

West

**ROBERTS HOME** 

**58 WALNUT STREET** 

### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S107789449

### LABELLA RESIDENCE (Continued)

Gallons .00 Not reported Not reported
364328
1550008
1
1000
03
.00
Not reported
Watchdog
Not reported
Horner EZ Check I or II

NY LTANKS S108298719

N/A

1/4-1/2 0.405 mi.	NEW ROCHELLE, NY		IN/ <i>7</i> -
2141 ft.	Site 3 of 4 in cluster BF		
Relative:	LTANKS:		
Higher	Site ID:	372634	
-	Spill Number/Closed Date:	0608623 / 2012-08-17	
Actual:	Spill Date:	2006-10-23	
95 ft.	Spill Cause:	Tank Test Failure	
	Spill Source:	Private Dwelling	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
		Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
	Cleanup Meets Standard:	False	
	SWIS:	6010	
	Investigator:	UNASSIGNED	
	Referred To:	Not reported	
	Reported to Dept:	2006-10-27	
	CID:	444	
	Water Affected:	Not reported	
	Spill Notifier:	Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	False	
	Remediation Phase:	0	
	Date Entered In Computer:		
	Spill Record Last Update:		
	Spiller Name:	TOM ROBERTS	
	Spiller Company:	ROBERTS HOME	
	Spiller Address:	58 WALNUT STREET	
	Spiller City,St,Zip:	NEW ROCHELLE, NY	
	Spiller County:	001	
	Spiller Contact:	TOM ROBERTS	
	Spiller Phone:	(914) 755-9816	
	Spiller Extention:	Not reported	
	DEC Region:	3	
	DER Facility ID:	322369	

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	ROBERTS HOME (Continued)		S108298719
	DEC Memo:	"8/2/10 Homeowner TTF JO'M 8/17/12 Homeomer TTF greater then 5 years old and no indications of contamination will be closed. This was done with consultations between Albany and the Region. NFA JO'M"	
	Remarks:	""	
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	372634 1130371 01 2120048 0001A #2 fuel oil Not reported Petroleum Not reported Gallons .00 Not reported Not reported Not reported	
	Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	372634 1550391 1 550 03 .00 Not reported Watchdog Not reported Horner EZ Check I or II	
BF260 West 1/4-1/2 0.407 mi. 2150 ft.	@ 60 WALNUT STREET NEW ROCHELLE, NY Site 4 of 4 in cluster BF	NY LTANKS	S106971852 N/A
Relative: Higher Actual: 95 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection:	346287 0502010 / 2005-07-17 2005-05-19 Tank Failure Private Dwelling Known release that creates potential for fire or hazard. (Highly Improbable) Not reported True 6010 JBODee Not reported 2005-05-19 444 Not reported Other Not reported	

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	@ (Continued)	S106971852
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spiller Name:	MR. GALLERO
	Spiller Company:	Not reported
	Spiller Address:	60 WALNUT STREET
	Spiller City,St,Zip:	NEW ROCHELLE, NY
	Spiller County:	001
	Spiller Contact:	MR. GALLERO
	Spiller Phone:	(914) 469-7160
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	292543
	DEC Memo:	"July 17, 2005: NORTHEAST ENVIRONMENTAL DISPOSED OF LUST AND 33.65
	DEO Memo.	TONS OF CONTAMINATED SOIL. BASED UPON INFORMATION PROVIDED TO DEC, NO
		FURTHER ACTION IS REQUIRED AT THIS TIME, jod"
	Remarks:	"1000 GALLON TANK HAD HOLES IN IT:"
	•••	
	Material:	
Site ID:		346287
	Operable Unit ID:	1104017
	Operable Unit:	01
	Material ID:	584224
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	Not reported
	Units:	Gallons
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	Tank Test:	
261 NNE 1/4-1/2 0.412 mi. 2173 ft.	CON EDISON-CEDAR ST WOR ONE RAMADA PLAZA NEW ROCHELLE, NY 10801	KS-NEWROCH'LE MGP 1008407973 N/A N/A
Relative: Lower	Manufactured Gas Plants:	o additional information available
Actual: 50 ft.		

Database(s)

EDR ID Number EPA ID Number

BH262 NNE 1/4-1/2 0.413 mi. 2179 ft.	SHERIDEN PLAZA 1 SHERIDEN PLAZA NEW ROCHELLE, NY Site 1 of 2 in cluster BH	Ν	NY LTANKS	S100138278 N/A
217911.				
Relative: Lower Actual: 36 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	1989-12-19 Tank Failure Commercial/Industrial Not reported 1953-06-18 True 6000 tdghiosa Not reported 1989-12-19 Not reported Not reported Not reported Other Not reported False False 0 : 1989-12-21	TO BE STOCK	PILED ON
	Material:			
	Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered:	80178 934143 01 442378 0001A #2 fuel oil Not reported Petroleum .00 Not reported .00		
	Resource Affected: Oxygenate:	Not reported Not reported		

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	SHERIDEN PLAZA (Continued	3)		S100138278
	-			
	Tank Test:			
BG263 South 1/4-1/2 0.415 mi.	FUNICELOLO HOME 24 POPLAR PLACE NEW ROCHELLE, NY		NY LTANKS	S107489124 N/A
2190 ft.	Site 2 of 2 in cluster BG			
Relative: Lower	LTANKS: Site ID:	355533		
Actual	Spill Number/Closed Date:			
Actual: 73 ft.	Spill Date: Spill Cause:	2005-11-14 Tank Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC	Response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator: Referred To:	JBODee Not reported		
	Reported to Dept:	2005-11-14		
	CID:	444		
	Water Affected: Spill Notifier:	Not reported Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	False 0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spiller Name: Spiller Company:	FUNICEOLO HOME FUNICELOLO HOME		
	Spiller Address:	24 POPULAR PLACE		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller County: Spiller Contact:	001 FUNICEOLO HOME		
	Spiller Phone:	(914) 636-5043		
	Spiller Extention:	Not reported		
	DEC Region: DER Facility ID:	3 305561		
	DEC Memo:	"PLAN WAS TO ABANDON BUT FOUND HOLES SO NOW"	THEY WILL REM	MOVE NO KNOWN
		EXPERTS AT THIS TIME November 19, 2006: ONE HOLE F		
		TANK. TANK CANNOT BE REMOVED DUE TO SAFETY AN CONSIDERATIONS. MUNICIPAL WATER AND SEWER. RC		
		GROUND WATER SAMPLE BENATH TANK, ALL ANALYTE		
		ABANDONED IN PLACE WITH SLURRY. BASED UPON IN		ROVIDED TO
	Remarks:	DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME "HOLES FOUND IN A 1000 GALLON TANK;"	. joa	
		· · · · · · · · · · · · · · · · ·		
	Material: Site ID:	355533		
	Operable Unit ID:	1112888		
	Operable Unit:	01		
	Material ID: Material Code:	2102930 0001A		

Database(s)

EDR ID Number EPA ID Number

### FUNICELOLO HOME (Continued)

Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

BI264 WSW 1/4-1/2 0.417 mi.	INDUSTRIAL OVERALL SERVICE 30 PINE ST NEW ROCHELLE, NY 10805	NY S NY S		1004571492 NYD986925808
2202 ft.	Site 1 of 2 in cluster Bl	NY MANI NJ MANI	-	
Relative: Lower		E	СНО	
Actual	RCRA-LQG:			
Actual: 49 ft.	Date form received by agency			
4911.	Facility name:	INDUSTRIAL OVERALL SERVICES FORMER		
	Facility address:			
	EPA ID:	NEW ROCHELLE, NY 10805 NYD986925808		
	Mailing address:	PINE ST		
	Maning address.	NEW ROCHELLE, NY 10805		
	Contact:	BURT DORFMAN		
	Contact address:	BARTELS AVE		
		NEW ROCHELLE, NY 10801		
	Contact country:	US		
	Contact telephone:	(845) 353-3500		
	Contact email:	Not reported		
	EPA Region:	02		
	Land type:	Private		
	Classification:	Large Quantity Generator		
	Description:	Handler: generates 1,000 kg or more of hazardous waste during an		
		calendar month; or generates more than 1 kg of acutely hazardous	waste	
		during any calendar month; or generates more than 100 kg of any		
		residue or contaminated soil, waste or other debris resulting from the		
		cleanup of a spill, into or on any land or water, of acutely hazardous		
		waste during any calendar month; or generates 1 kg or less of acut		l .
		hazardous waste during any calendar month, and accumulates mol		
		kg of acutely hazardous waste at any time; or generates 100 kg or of any residue or contaminated soil, waste or other debris resulting	622	
		from the cleanup of a spill, into or on any land or water, of acutely		
		hazardous waste during any calendar month, and accumulates mo	re than	
		100 kg of that material at any time		
	Owner/Operator Summary:			
	Owner/operator name:	INDUSTRIAL OVERALL SERVICE CORP		
	Owner/operator address:	BARTELS AVE		
		NEW ROCHELLE, NY 10801		
	Owner/operator country:	US		
	Owner/operator telephone:	(845) 353-3500		
	Legal status:	Private		

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Owner/Operator Type: Owner/Op start date: Owner/Op end date:	Owner 08/01/2010 Not reported
Owner/operator name:	NYS DEPT ENVIRONMENTAL CONSERVATION
Owner/operator address:	Not reported
	Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Legal status:	State
Owner/Operator Type:	Operator
Owner/Op start date:	12/13/2011
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

. Waste code:

. Waste name:

F001

THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code:F002Waste name:THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE,<br/>METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,<br/>CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE,<br/>ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,<br/>TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE<br/>USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE<br/>ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND<br/>F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND<br/>SPENT SOLVENT MIXTURES.

Historical Generators:

Date form received by agency: 12/16/2008			
Site name:	BAKERS PRIDE OVEN		
Classification:	Small Quantity Generator		

Map ID		MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	INDUSTRIAL OVERALL SERVI	CES FORMER (Continued)		1004571492
. Waste code: . Waste name:		F001 THE FOLLOWING SPENT HALOGENATED SOLV TETRACHLOROETHYLENE, TRICHLORETHYLE 1,1,1-TRICHLOROETHANE, CARBON TETRACH FLUOROCARBONS; ALL SPENT SOLVENT MIXT CONTAINING, BEFORE USE, A TOTAL OF TEN I ONE OR MORE OF THE ABOVE HALOGENATED IN F002, F004, AND F005; AND STILL BOTTOMS SPENT SOLVENTS AND SPENT SOLVENT MIXT	NE, METHYLENE CHL LORIDE AND CHLORI I'URES/BLENDS USEE PERCENT OR MORE O SOLVENTS OR THO FROM THE RECOVE	LORIDE, INATED D IN DEGREASING (BY VOLUME) OF ISE SOLVENTS LISTED
	. Waste code: . Waste name:	F002 THE FOLLOWING SPENT HALOGENATED SOLV METHYLENE CHLORIDE, TRICHLOROETHYLEN CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRI ORTHO-DICHLOROBENZENE, TRICHLOROFLU TRICHLOROETHANE; ALL SPENT SOLVENT MIX USE, A TOTAL OF TEN PERCENT OR MORE (BY ABOVE HALOGENATED SOLVENTS OR THOSE F005; AND STILL BOTTOMS FROM THE RECOV SPENT SOLVENT MIXTURES.	IE, 1,1,1-TRICHLOROI IFLUOROETHANE, OROMETHANE, AND XTURES/BLENDS COI Y VOLUME) OF ONE C SOLVENTS LISTED II	ETHANE, 1,1,2, NTAINING, BEFORE DR MORE OF THE N F001, F004, AND
	Date form received by age Site name: Classification:	ncy: 01/01/2007 BAKERS PRIDE OVEN CO INC Small Quantity Generator		
Date form received by ag Site name: Classification:		ncy: 01/01/2006 BAKERS PRIDE OVEN CO INC Conditionally Exempt Small Quantity Generator ncy: 05/12/1994		
	Site name: Classification:	BAKERS PRIDE OVEN CO INC Conditionally Exempt Small Quantity Generator		
	. Waste code: . Waste name:	D001 IGNITABLE WASTE		
	Violation Status:	No violations found		
Evaluation: C Area of violation: N Date achieved compliance: N		06/14/2012 COMPLIANCE EVALUATION INSPECTION ON-S Not reported Not reported EPA	ITE	
		009		

EDR ID Number

INDUSTRIAL OVERALL SERVICES FORMER (Continued)

with commercial and residential establishments mixed in between the commercial businesses. The Baker?s Pride site is an approximately 3.75 acre flat to severely sloping irregularly shaped parcel. The Baker?s Pride building occupies approximately 111,450 sf of building space and occupies the majority of the property. Baker?s Pride owns the Bakers Pride Oven Company Inc and is engaged in the production of restaurant/commercial grade ovens and broilers. The site is bordered by Metro North railroad tracks to the west and northwest, a mix of commercial and residential properties to the northeast, east, and south. Interstate (I-95) is located to the west of the Metro North railroad tracks. In 2005, a Phase II Environmental Assessment report was completed by Enercon as part of closure proceedings for a 3,000 gallon fuel oil UST that was closed in place and a 10,000 gallon fuel oil UST that was removed. Monitoring wells installed as part of this assessment revealed the presence of PCE in groundwater at levels up to 1,430 ppb. (The State groundwater standard for PCE is 5 ppb.) Also, this report noted chemical storage for cutting oils, lubricants, solvents and paints. No products were indicated that contained PCE. In 2007 a follow up report was conducted which revealed PCE in groundwater at levels up to 1,700 ppb. The site was added as a potential inactive hazardous waste disposal site ("P site") in 2007. A State funded site characterization was initiated in 2008 to determine the source of the PCE groundwater plume. A total of 9 monitoring wells were installed in the fall of 2008. Groundwater contaminated with PCE showed higher levels of PCE in wells upgradient from the Baker?s Pride facility. The PCE concentrations were as high as 3,700 ppb in MW-13 which is located about 300 feet upgradient from the Baker?s Pride facility. This prompted the State to do a second round of groundwater sampling further upgradient of MW-13. Two additional wells (MW-24 and MW-25) were installed about 150 feet upgradient of MW-13 in the winter of 2009. MW-24 revealed PCE at 5,300 ppb. The second round of sampling further defined a groundwater plume with a source area upgradient from the Bakers Pride site. Since the site information for Baker?s Pride indicates that the plume of PCE is coming from an off-site source, the Baker?s Pride site (360087) will not be listed in the Registry of Inactive Hazardous Waste Disposal sites. A separate site was added to the Registry to address the source of the PCE plume (See site #360109.) Based upon investigations to date, the primary contaminants of concern at the site include tetrachloroetylene (PCE) and its associated breakdown products. PCE was detected in upgradient groundwater as well as on-site and also in indoor air in residences upgradient of the site. PCE was detected on-site in groundwater from non-detect up to 3,200 parts per billion (ppb) at MW-1) above the respective groundwater standard of 5 ppb. Upgradient off-site levels of PCE were as high as 5,300 ppb. Indoor air was impacted in two residences with the highest level being 530 micrograms per cubic meter (ug/m3) at a property on Bartels Place. Since the highest levels of PCE were identified in the groundwater upgradient of the site this suggests an off-site source that is impacting the Baker?s Pride site. The source of this contamination is the Industrial Overall Service Corp. Class 2 site (#360109) Not reported

Health Problem: Dump: Structure: Lagoon:

Not reported

Not reported Not reported

Env Problem:

Database(s)

EPA ID Number

#### 1004571492

TC4738280.2s Page 558

Database(s)

EDR ID Number EPA ID Number

1004571492

NDUSTRIAL OVERALL SE	ERVICE	S FORMER (Continued)
Landfill:	Not re	ported
Pond:	Not re	
Disp Start:	Not re	
Disp Term:	Not re	
Lat/Long:	Not re	
Dell:	Not re	
Record Add:	Not re	ported
Record Upd:	Not re	ported
Updated By:	Not re	ported
Own Op:	Not re	ported
Sub Type:	Not re	ported
Owner Name:	Not rep	ported
Owner Company:	Not rep	ported
Owner Address:	Not re	ported
Owner Addr2:	Not re	ported
Owner City,St,Zip:	Not re	ported
Owner Country:	Not rep	ported
HW Code:	Not rep	ported
Waste Type:	Not re	
Waste Quantity:	Not re	ported
Waste Code:	Not re	
Crossref ID:	Not re	
Cross Ref Type Code:		
Cross Ref Type:	Not rep	
Record Added Date:	Not rep	
Record Updated:	Not rep	
Updated By:	Not re	Dorted
SPILLS:		
Facility ID:		9404759
Facility Type:		ER
DER Facility ID:		122872
Site ID:		144128
DEC Region:		3
Spill Date:		1994-07-07
Spill Number/Closed D	Date:	9404759 / 2003-10-08
Spill Cause:		Other
Spill Class:		Known release with minimal potential for fire or hazard. DEC Response.
CM/IC.		Willing Responsible Party. Corrective action taken.
SWIS: Investigator:		6010 WCHD
Referred To:		Westchester Cnty Health Dept
Reported to Dept:		1994-07-07
CID:		Not reported
Water Affected:		Not reported
Spill Source:		Commercial/Industrial
Spill Notifier:		Other
Cleanup Ceased:		Not reported
Cleanup Meets Std:		False
Last Inspection:		Not reported
Recommended Penalt	v:	False
UST Trust:		False
Remediation Phase:		0
Date Entered In Computer:		1994-07-11
Spill Record Last Update:		2004-03-25
Spiller Name:		Not reported
Spiller Company:		Not reported

### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Database(s)

EDR ID Number EPA ID Number

Spiller Address:	Not reported		
Spiller City,St,Zip:	***Update***, ZZ		
Spiller Company:	001		
Contact Name:	Not reported		
Contact Phone:	Not reported		
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD-JACKSON 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK REMOVAL.		
	10/17/03: Letter to Mark Fogarty, Baker's Pride from Danielle		
	Jackson, dated 10/8/2003. Closure report by Env. Products & Services		
	and sample results have been reviewed. While there is some		
	contamination remaining, WCDOH does not see the contamination as a		
	risk to human health. WCDOH recommends NFA at this time."		
Remarks:	"SOIL STOCKPILED BOB SPERONI WAS ON SITE FAXED TO TARRYTOWN & W		
Material:			
Site ID:	144128		
Operable Unit ID:	1001834		
Operable Unit: Material ID:	01 381361		
Material Code:	0002A		
Material Name:	#4 fuel oil		
Case No.:	Not reported		
Material FA:	Petroleum		
Quantity:	.00		
Units:	Gallons		
Recovered:	.00		
Resource Affected:	Not reported		
Oxygenate:	Not reported		
Tank Test:			
FINDS:			
Registry ID:	110002092949		
	rest/Information System		
	JS EPA TRIS (Toxics Release Inventory System) contains information rom facilities on the amounts of over 300 listed toxic chemicals that		
	hese facilities release directly to air, water, land, or that are		
	ransported off-site.		
	JS National Pollutant Discharge Elimination System (NPDES) module of		
	he Compliance Information System (ICIS) tracks surface water permits		
	ssued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United		
	States are required to obtain a permit. The permit will likely contain		
	imits on what can be discharged, impose monitoring and reporting		
	equirements, and include other provisions to ensure that the		
	lischarge does not adversely affect water quality.		
r	FIS (New York - Facility Information System) is New York's Department		
	of Environmental Conservation (DEC) information system for tracking		
	environmental facility information found across the State.		
e	structure and the state of the		

TC4738280.2s Page 560

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

1004571492

NY MANIFEST: Country: USA EPA ID: NYD986925808 Facility Status: Not reported Location Address 1: 30 PINE ST ΒP Code: Location Address 2: Not reported Not reported Total Tanks: Location City: NEW ROCHELLE Location State: NY Location Zip: 10801 Location Zip 4: Not reported NY MANIFEST: NYD986925808 EPAID: Mailing Name: INDUSTIRAL OVERALL UNIFORM Mailing Contact: **IRA NEVIN** Mailing Address 1: 30 PINE ST Mailing Address 2: Not reported NEW ROCHELLE Mailing City: Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 5184029564 NY MANIFEST: Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2012 Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 07/02/2012 Trans1 Recv Date: 07/02/2012 Trans2 Recv Date: Not reported TSD Site Recv Date: 07/02/2012 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: 008921150JJK Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Waste Code: Not reported 1200.0 Quantity: P - Pounds Units: Number of Containers: 31.0 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 1.0 F001 Waste Code: Waste Code 1\_2: F002 Waste Code 1\_3: Not reported Waste Code 1\_4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2012 Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 07/02/2012 07/02/2012 Trans1 Recv Date: Trans2 Recy Date: Not reported TSD Site Recv Date: 07/02/2012 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD986925808 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported 008921150JJK Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 1815.0 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 33.0 Container Type: DM - Metal drums, barrels

Database(s) EPA ID

EDR ID Number EPA ID Number

1004571492

NDUSTRIAL OVERALL SERVICES	FORMER (Continued)
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Waste Code:	F001
Waste Code 1_2:	F002
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_1:	Not reported
Waste Code 1_6:	Not reported
	Not reported
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2012
Trans1 State ID:	NJ000027193
Trans2 State ID:	Not reported
Generator Ship Date:	07/31/2012
Trans1 Recv Date:	07/31/2012
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	07/31/2012
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986925808
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	008923039JJK
Import Indicator:	Ν
Export Indicator:	Ν
Discr Quantity Indicator:	Ν
Discr Type Indicator:	Ν
Discr Residue Indicator:	Ν
Discr Partial Reject Indicator:	Ν
Discr Full Reject Indicator:	Ν
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Quantity:	150.0
Units:	P - Pounds
Number of Containers:	2.0
Container Type:	DM - Metal drums, barrels
Handling Method:	T Chemical, physical, or biological treatment.
Specific Gravity:	1.0
Waste Code:	F001
Waste Code 1_2:	F002
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

## INDUSTRIAL OVERALL SERVICES FORMER (Continued)

TC4738280.2s Page 563

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: N Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Waste Code: Waste Code 1\_2: Waste Code 1\_3: Waste Code 1\_4: Waste Code 1\_5: Waste Code 1\_6: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date:

Not reported Not reported Not reported 2012 NJ0000027193 Not reported 12/28/2012 12/28/2012 Not reported 12/28/2012 Not reported Not reported NYD986925808 Not reported Not reported NJD002200046 Not reported 008923493JJK Not reported Not reported Not reported H141 Not reported Not reported Not reported Not reported Not reported Not reported 1800.0 P - Pounds 4.0 DM - Metal drums, barrels B Incineration, heat recovery, burning. 1.0 F001 F002 Not reported 2009 TXR000050930 NJD071629976 10/15/2009 10/15/2009 10/19/2009

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

TSD Site Recv Date: 10/25/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: ILD980613913 TSDF ID 2: Not reported 002049551SKS Manifest Tracking Number: Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 10.0 Units: P - Pounds Number of Containers: 1.0 DF - Fiberboard or plastic drums (glass) Container Type: Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 1.0 Waste Code: D009 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Not reported Waste Code 1\_4: Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629926 Generator Ship Date: 10/15/2009 Trans1 Recv Date: 10/15/2009 Trans2 Recv Date: 10/19/2009 TSD Site Recv Date: 10/21/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: KYD053348108 TSDF ID 2: Not reported Manifest Tracking Number: 002049550SKS

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν **Discr Residue Indicator:** Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 200.0 Units: P - Pounds Number of Containers: 5.0 Container Type: DF - Fiberboard or plastic drums (glass) L Landfill. Handling Method: Specific Gravity: 1.0 Waste Code: D001 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1 5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported Not reported seq: Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629926 Generator Ship Date: 10/15/2009 Trans1 Recv Date: 10/15/2009 Trans2 Recv Date: 10/19/2009 TSD Site Recv Date: 10/21/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: KYD053348108 TSDF ID 2: Not reported Manifest Tracking Number: 002049550SKS Import Indicator: Ν Export Indicator: Ν **Discr Quantity Indicator:** Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν Discr Partial Reject Indicator: Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Alt Facility Sign Date: Not reported MGMT Method Type Code: H141 Waste Code: Not reported Quantity: 20.0 Units: P - Pounds Number of Containers: 1.0 Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 1.0 Waste Code: D002 Waste Code 1\_2: Not reported Waste Code 1\_3: Not reported Waste Code 1 4: Not reported Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: Not reported Manifest Status: Not reported seq: Not reported Year: 2009 Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629976 Generator Ship Date: 10/15/2009 Trans1 Recv Date: 10/15/2009 Trans2 Recv Date: 10/19/2009 TSD Site Recv Date: 10/21/2009 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID 1: NJD002182897 TSDF ID 2: Not reported Manifest Tracking Number: 002049543SKS Import Indicator: Ν Export Indicator: Ν Discr Quantity Indicator: Ν Discr Type Indicator: Ν Discr Residue Indicator: Ν **Discr Partial Reject Indicator:** Ν Discr Full Reject Indicator: Ν Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: H061 Waste Code: Not reported Not reported Waste Code: Quantity: 600.0

Database(s)

EDR ID Number EPA ID Number

JSTRIAL OVERALL SERVICES FORMER (Continued)			
Units:	P - Pounds		
Number of Containers:	3.0		
	DM - Metal drums, barrels		
Container Type:	B Incineration, heat recovery, burning.		
Handling Method:			
Specific Gravity:	1.0		
Waste Code:	F003		
Waste Code 1_2:	F005		
Waste Code 1_3:	D001		
Waste Code 1_4:	D035		
Waste Code 1_5:	D005		
Waste Code 1_6:	Not reported		
Document ID:	Not reported		
Manifest Status:	Not reported		
seq:	Not reported		
Year:	2009		
Trans1 State ID:	TXR000050930		
Trans2 State ID:	NJD071629976		
Generator Ship Date:	10/15/2009		
Trans1 Recy Date:	10/15/2009		
Trans2 Recy Date:	10/19/2009		
TSD Site Recy Date:	10/21/2009		
Part A Recy Date:	Not reported		
Part B Recy Date:	Not reported		
Generator EPA ID:	NYD986925808		
Trans1 EPA ID:	Not reported		
Trans2 EPA ID:	Not reported		
TSDF ID 1:	NJD002182897		
TSDF ID 2:	Not reported		
	002049543SKS		
Manifest Tracking Number:	N		
Import Indicator:	N		
Export Indicator:			
Discr Quantity Indicator:	N N		
Discr Type Indicator:			
Discr Residue Indicator:	N		
Discr Partial Reject Indicator:	N		
Discr Full Reject Indicator:	N		
Manifest Ref Number:	Not reported		
Alt Facility RCRA ID:	Not reported		
Alt Facility Sign Date:	Not reported		
MGMT Method Type Code:	H061		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Quantity:	50.0		
Units:	P - Pounds		
Number of Containers:	1.0		
Container Type:	DM - Metal drums, barrels		
Handling Method:	B Incineration, heat recovery, burning.		
Specific Gravity:	1.0		
Waste Code:	D001		
Waste Code 1_2:	Not reported		
Waste Code 1_3:	Not reported		
Waste Code 1_4:	Not reported		

### INDU

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Waste Code 1\_5: Not reported Waste Code 1\_6: Not reported Document ID: NJA4033255 Manifest Status: Not reported seq: Not reported Year: 2004 Trans1 State ID: 50060 Trans2 State ID: Not reported Generator Ship Date: 04/02/2004 04/02/2004 Trans1 Recv Date: Trans2 Recv Date: Not reported 04/05/2004 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYD986925808 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 00242 Units: P - Pounds Number of Containers: 004 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 NJA2889530 Document ID: Manifest Status: Not reported seq: 01 Year: 2001 Trans1 State ID: 50060 Trans2 State ID: Not reported Generator Ship Date: 02/09/2001 02/09/2001 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 02/13/2001 Not reported Part A Recv Date: Part B Recv Date: Not reported

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D001 - NON-LISTED IGNITABLE WASTES Waste Code: Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NJA2889566 Manifest Status: Not reported seq: 01 Year: 2001 Trans1 State ID: 50060 50060 Trans2 State ID: Generator Ship Date: 03/30/2001 Trans1 Recv Date: 03/30/2001 Trans2 Recv Date: 04/04/2001 TSD Site Recv Date: 04/05/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: NYD980761191 TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

USTRIAL OVERALL SERVICES	FORMER (Continued)
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Quantity:	00250
Units:	P - Pounds
Number of Containers:	002
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	01.00
opositio oravity.	
Document ID:	NJA2889390
Manifest Status:	Not reported
seq:	01
Year:	1999
Trans1 State ID:	S50060
Trans2 State ID:	Not reported
Generator Ship Date:	08/24/1999
Trans1 Recv Date:	08/24/1999
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	09/10/1999
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD986925808
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	Not reported
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Quantity:	00150
Units:	P - Pounds
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	01.00
-	

Database(s)

EDR ID Number EPA ID Number

### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Document ID: NJA2968556 Manifest Status: Not reported 01 seq: Year: 1999 Trans1 State ID: 50060 Trans2 State ID: S50060 Generator Ship Date: 08/23/1999 Trans1 Recv Date: 08/23/1999 Trans2 Recv Date: 08/24/1999 TSD Site Recv Date: 08/27/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD986925808 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: NYD980761191 TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NJA2295827 Manifest Status: Not reported seq: 01 Year: 1998 Trans1 State ID: S50060 Trans2 State ID: 88672 08/14/1998 Generator Ship Date: Trans1 Recv Date: 08/14/1998 08/26/1998 Trans2 Recv Date: TSD Site Recv Date: 08/27/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986925808 NYD980761191 Trans1 EPA ID:

NYD980761191

Trans2 EPA ID:

Database(s)

EDR ID Number EPA ID Number

### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Not reported Import Indicator: Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D001 - NON-LISTED IGNITABLE WASTES Waste Code: Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: NJA2729357 Manifest Status: Κ seq: Not reported Year: 1997 Trans1 State ID: 50060 Trans2 State ID: Not reported Generator Ship Date: 05/20/1997 Trans1 Recv Date: 05/20/1997 Trans2 Recv Date: 05/23/1997 TSD Site Recv Date: 05/29/1997 Part A Recv Date: 06/10/1997 Part B Recv Date: 07/15/1997 Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES

seq:

#### MAP FINDINGS

INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Database(s)

EDR ID Number **EPA ID Number** 

#### Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: NJA2590786 Manifest Status: Κ seq: Not reported Year: 1997 Trans1 State ID: S50060 Trans2 State ID: Not reported Generator Ship Date: 12/17/1997 Trans1 Recv Date: 12/17/1997 Trans2 Recv Date: 11 TSD Site Recv Date: 12/18/1997 Part A Recv Date: 01/07/1998 Part B Recv Date: 01/20/1998 Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: Discr Partial Reject Indicator: Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Document ID: NJA2630871 Manifest Status: Κ Not reported

Database(s)

EDR ID Number EPA ID Number

INDUSTRIAL OVERALL SERVICES FORMER	(Continued)
------------------------------------	-------------

Year: 1996 S50060 Trans1 State ID: Trans2 State ID: S50060 Generator Ship Date: 11/08/1996 Trans1 Recv Date: 11/08/1996 Trans2 Recv Date: 11/17/1996 TSD Site Recv Date: 11/20/1996 Part A Recv Date: 12/02/1996 Part B Recv Date: 01/31/1997 Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: NYD980761191 TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D001 - NON-LISTED IGNITABLE WASTES Waste Code: Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) 001 Number of Containers: Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: NJA2133346 Manifest Status: κ seq: Not reported Year: 1996 Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 06/27/1996 Trans1 Recv Date: 06/27/1996 Trans2 Recv Date: 07/05/1996 TSD Site Recv Date: 07/15/1996 Part A Recv Date: 07/16/1996 Part B Recv Date: 08/02/1996 Generator EPA ID: NYD986925808 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported

Database(s)

EDR ID Number EPA ID Number

### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

USTRIAL OVERALL SERVICES	ONMEN (Continued)
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Quantity:	00055
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	001
Container Type:	DM - Metal drums, barrels
Handling Method:	R Material recovery of more than 75 percent of the total material.
Specific Gravity:	100
Document ID:	NJA2630864
Manifest Status:	К
seq:	Not reported
Year:	1996
Trans1 State ID:	75818
Trans2 State ID:	S50060
Generator Ship Date:	10/25/1996
Trans1 Recv Date:	10/25/1996
Trans2 Recv Date:	11/05/1996
TSD Site Recv Date:	11/06/1996
Part A Recv Date:	11/12/1996
Part B Recv Date:	12/16/1996
Generator EPA ID:	NYD986925808
Trans1 EPA ID:	NYD980761191
Trans2 EPA ID:	NYD980761191
TSDF ID 1:	NJD002200046
TSDF ID 2:	Not reported
Manifest Tracking Number:	Not reported
Import Indicator:	Not reported
Export Indicator:	Not reported
Discr Quantity Indicator:	Not reported
Discr Type Indicator:	Not reported
Discr Residue Indicator:	Not reported
Discr Partial Reject Indicator:	Not reported
Discr Full Reject Indicator:	Not reported
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Not reported Not reported 00055 G - Gallons (liquids only)\* (8.3 pounds) 001 DM - Metal drums, barrels B Incineration, heat recovery, burning. 100

<u>Click this hyperlink</u> while viewing on your computer to access 6 additional NY\_MANIFEST: record(s) in the EDR Site Report.

**NEW ROCHELLE 10801** 

NYD986925808

30 PINE ST

9145760200

Not reported

Not reported Not reported

008921150JJK

NYD986925808

NJD002200046

NJ0000027193

Not reported

Not reported

Not reported Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported Not reported

Not reported

Not reported

Not reported

Not reported

7/2/2012

00 00

х

NJ MANIFEST:

EPA Id: Mail Address: Mail City/State/Zip: Facility Phone: **Emergency Phone:** Contact: Comments: SIC Code: County: Municipal: Previous EPA Id: Gen Flag: Trans Flag: **TSDF** Flag: Name Change: Date Change: Manifest: Manifest Number: EPA ID: Date Shipped: TSDF EPA ID: Transporter EPA ID: Transporter 2 EPA ID: Transporter 3 EPA ID: Transporter 4 EPA ID: Transporter 5 EPA ID: Transporter 6 EPA ID: Transporter 7 EPA ID: Transporter 8 EPA ID: Transporter 9 EPA ID: Transporter 10 EPA ID: Date Trans1 Transported Waste: Date Trans2 Transported Waste: Date Trans3 Transported Waste: Date Trans4 Transported Waste: Date Trans5 Transported Waste: Date Trans6 Transported Waste: Date Trans7 Transported Waste: Date Trans8 Transported Waste: Date Trans9 Transported Waste: Date Trans10 Transported Waste: Date TSDF Received Waste:

Database(s)

EDR ID Number EPA ID Number

#### INDUSTRIAL OVERALL SERVICES FORMER (Continued)

**TSDF EPA Facility Name:** Not reported Not reported QTY Units: Transporter SEQ ID: Not reported Transporter-1 Date: Not reported Waste SEQ ID: Not reported Not reported Waste Type Code 2: Not reported Waste Type Code 3: Not reported Waste Type Code 4: Waste Type Code 5: Not reported Waste Type Code 6: Not reported Date Accepted: Not reported Manifest Discrepancy Type: Not reported Data Entry Number: Not reported Was Load Rejected: NEW ROCHELLE 10801 Reason Load Was Rejected: Not reported Waste: Manifest Year: Not reported Waste Code: F001 F002 Hand Code: Not reported 1,815.00 gallons Quantity: Manifest Year: Not reported Waste Code: F001 F002 Hand Code: Not reported 1,200.00 Pounds Quantity: Manifest Number: 008923493JJK EPA ID: NYD986925808 Date Shipped: 12/28/2012 TSDF EPA ID: NJD002200046 Transporter EPA ID: NJ0000027193 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Not reported Transporter 8 EPA ID: Transporter 9 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: Not reported Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Not reported Date Trans10 Transported Waste: Date TSDF Received Waste: Not reported TSDF EPA Facility Name: Not reported QTY Units: Not reported Transporter SEQ ID: Not reported Transporter-1 Date: Not reported Waste SEQ ID: Not reported

#### Map ID Direction Distance Elevation Site

#### MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

## INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Waste Type Code 2: Not reported Not reported Waste Type Code 3: Waste Type Code 4: Not reported Waste Type Code 5: Not reported Waste Type Code 6: Not reported Not reported Date Accepted: Not reported Manifest Discrepancy Type: Data Entry Number: Not reported Was Load Rejected: NEW ROCHELLE 10801 Reason Load Was Rejected: Not reported Waste: Manifest Year: Not reported F001 F002 Waste Code: Hand Code: Not reported 1,800.00 Pounds Quantity: Manifest Number: 008923039JJK EPA ID: NYD986925808 Date Shipped: 7/31/2012 TSDF EPA ID: NJD002200046 Transporter EPA ID: NJ0000027193 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 9 EPA ID: Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: Not reported Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Not reported Date Trans4 Transported Waste: Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Not reported Date Trans8 Transported Waste: Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: Not reported **TSDF EPA Facility Name:** Not reported QTY Units: Not reported Not reported Transporter SEQ ID: Transporter-1 Date: Not reported Waste SEQ ID: Not reported Waste Type Code 2: Not reported Waste Type Code 3: Not reported Waste Type Code 4: Not reported Not reported Waste Type Code 5: Waste Type Code 6: Not reported Not reported Date Accepted: Manifest Discrepancy Type: Not reported Data Entry Number: Not reported Was Load Rejected: NEW ROCHELLE 10801 Reason Load Was Rejected: Not reported

Database(s)

EDR ID Number EPA ID Number

## INDUSTRIAL OVERALL SERVICES FORMER (Continued)

Waste:

asie.	
Manifest Year:	Not reported
Waste Code:	F001 F002
Hand Code:	Not reported
Quantity:	150.00 Pounds

Manifest Number:	NJA4033255
FPA ID:	NYD986925808
Date Shipped:	04/02/2004
TSDF EPA ID:	NJD002200046
	NYD980761191
Transporter EPA ID:	
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/02/2004
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	04/05/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	05030425
Was Load Rejected:	NEW ROCHELLE 10801
Reason Load Was Rejected:	Not reported

ECHO:

Envid: Registry ID: DFR URL: 1004571492 110002092949 http://echo.epa.gov/detailed\_facility\_report?fid=110002092949

Database(s)

265 SW 1/4-1/2 0.419 mi. 2213 ft.	SPILL NUMBER 9908602 HUGUENOT ST & SOUTH PLA NEW ROCHELLE, NY	ZA	NY LTANKS	S104620556 N/A
2213 ft. Relative: Lower Actual: 77 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo:	1999-10-15 Tank Failure Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Willing Responsible Party. Corrective action taken. Not reported True 6010 jghardy Not reported 1999-10-15 322 Not reported Other Not reported False True 0 1999-10-15	Id was EEN REMOVED JBMIT REPORT. THE EXTENT OF JDWATER 05/18 TIONAL INVESTI TY OF NEW ROC JERGY & ENVIRG	12/09/99 = /00 LETTER IGATION IS CHELLE BY
	Remarks:	"VACANT LOT AND DURING EXCAVATION - CONTAMIN/		ND"
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA:	283271 1087287 01 297711 0009 gasoline Not reported Petroleum		

Database(s)

	SPILL NUMBER 9908602 (Cor	ntinued)		S104620556
	Quantity: Units: Recovered: Resource Affected: Oxygenate:	.00 Gallons .00 Not reported Not reported		
	Tank Test:			
BH266	MUTUAL BISCUIT COMPANY		NY LTANKS	S104193116
NNE 1/4-1/2	65 RIVER ST. NEW ROCHELLE, NY		NY Spills	N/A
0.422 mi.	·····,···			
2226 ft.	Site 2 of 2 in cluster BH			
Relative:	LTANKS:	206027		
Lower	Site ID: Spill Number/Closed Date:	286037		
Actual:	Spill Date:	1988-01-05		
35 ft.	Spill Cause:	Tank Test Failure		
	Spill Source:	Commercial/Industrial		
	Spill Class:	Possible release with minimal potential for fire or hazard or Kr	nown	
		release with no damage. DEC Response. Willing Responsible	Party.	
		Corrective action taken.		
	Cleanup Ceased:	1988-02-18		
	Cleanup Meets Standard: SWIS:	True 6010		
	Investigator:	jeokesso		
	Referred To:	Not reported		
	Reported to Dept:	1988-01-05		
	CID:	Not reported		
	Water Affected:	Not reported		
	Spill Notifier:	Tank Tester		
	Last Inspection:	1988-02-18		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	True 0		
	Date Entered In Computer	-		
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company:	HUGH GEORGE		
	Spiller Address:	Not reported		
	Spiller City,St,Zip:	ZZ		
	Spiller County: Spiller Contact:	001 Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	231833		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field	was	
	Dementer	OKESSON / / : TANKS REMOVED 02-18-88 LR N F A. "		
	Remarks:	"5K (RETEST) 1.34GPH TO PUMP & PULL TANK"		
	Matai			
	Material:	206027		

Database(s)

MUTUAL BISCUIT COMPANY	(Continued)	S1041931
Material ID:	570954	
Material Code:	0009	
Material Name:	gasoline	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	286037	
Spill Tank Test:	1532919	
Tank Number:	Not reported	
Tank Size:	•	
Test Method:	0 00	
Leak Rate:	.00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Unknown	
Site ID:	286036	
Spill Number/Closed Date:	8707334 / 1988-02-18	
Spill Date:	1987-11-25	
Spill Cause:	Tank Test Failure	
Spill Source:	Commercial/Industrial	
Spill Class:	Possible release with minimal potential for fire or hazard or Known	
	release with no damage. DEC Response. Willing Responsible Party.	
Cleanur Casaad	Corrective action taken.	
Cleanup Ceased:	1988-02-18 Tous	
	True	
SWIS:	6010	
Investigator:	UNASSIGNED	
Referred To:	Not reported	
Reported to Dept:	1987-11-25	
CID:	Not reported	
Water Affected:	NONE	
Spill Notifier:	Tank Tester	
Last Inspection:	1988-02-18	
Recommended Penalty:	False	
UST Involvement:	True	
Remediation Phase:	0	
Date Entered In Computer	: 1987-10-01	
Spill Record Last Update:	1988-03-11	
Spiller Name:	HUGH GEORGE	
Spiller Company:	SAME	
Spiller Address:	Not reported	
Spiller City,St,Zip:	ZZ	
Spiller County:	001	
Spiller Contact:	Not reported	
Spiller Phone:	Not reported	
Spiller Extention:	Not reported	
DEC Region	-2	
DEC Region: DER Facility ID:	3 231833	

EDR ID Number Database(s)

EPA ID Number

## **MUTUAL BISCUIT COMPANY (Continued)**

MUTUAL BISCUIT COMPANY	(Continued)
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was / / : WILL RETEST. / / : TANKS REMOVED. LR 02-18-88 N F A. "
Remarks:	"TTTF-4K TANK;-0.7584 GPH,4K TANK;-0.3312 GPH"
Material:	
Site ID:	286036
Operable Unit ID:	911503
Operable Unit:	01
Material ID:	466293
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	286036
Spill Tank Test:	1532438
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Unknown
SPILLS:	
Facility ID:	9908179
Facility Type:	ER
DER Facility ID:	118852
Site ID:	139057
DEC Region:	3
Spill Date:	1999-10-05
Spill Number/Closed Date:	
Spill Cause:	Other
Spill Class:	Possible release with minimal potential for fire or hazard or Known
	release with no damage. DEC Response. Willing Responsible Party.
0.1110	Corrective action taken.
SWIS:	6010 it a data
Investigator:	jbodee
Referred To:	Not reported
Reported to Dept:	1999-10-05
CID: Water Affected:	388 Not reported
Spill Source:	Not reported Commercial/Industrial
Spill Notifier:	Affected Persons
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
recommended i charty.	

Database(s)

EDR ID Number EPA ID Number

S104193116

•	,
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	-
•	1999-10-05
Spill Record Last Update:	1999-11-04
Spiller Name:	MICHAEL GRAVANESE
Spiller Company:	POST MARINE SUPLLY
Spiller Address:	65 RIVER SR
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	CALLER
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
DEC Mento.	O'DEE 10/18/99 DEC INSPECTED SITE. ONE LEAKY BATTERY FOUND NEXT TO
	DIESEL TANKS. BATTERIES TO BE REMOVED LATER TODAY. NFA"
Remarks:	"CALLER IS AN EX EMPLOYEE REPORTING BATTERIES BEING STORED NEXT TO
	GASOLINE TANKS AND BELIEVES THEY MIGHT BE LEAKING BATTERY ACID."
Material:	
	120057
Site ID:	139057
Operable Unit ID:	1082477
Operable Unit:	01
Material ID:	300856
Material Code:	0044A
Material Name:	battery acid
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
	•
Oxygenate:	Not reported
Tank Test:	
Facility ID:	9904805
Facility Type:	ER
DER Facility ID:	
	118852
Site ID:	118852 139056
Site ID: DEC Region:	
	139056
DEC Region: Spill Date:	139056 3 1999-07-22
DEC Region: Spill Date: Spill Number/Closed Date:	139056 3 1999-07-22 9904805 / 1999-07-22
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate
DEC Region: Spill Date: Spill Number/Closed Date:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response.
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270 Not reported
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270 Not reported Institutional, Educational, Gov., Other Health Department
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270 Not reported Institutional, Educational, Gov., Other Health Department Not reported
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270 Not reported Institutional, Educational, Gov., Other Health Department Not reported False
DEC Region: Spill Date: Spill Number/Closed Date: Spill Cause: Spill Class: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased:	139056 3 1999-07-22 9904805 / 1999-07-22 Deliberate Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. 6010 jkomara Not reported 1999-07-22 270 Not reported Institutional, Educational, Gov., Other Health Department Not reported

Owner Name: Owner Type:

Owner Address:

Owner City,St,Zip:

Owner Addr2:

Owner Email:

Owner Phone:

Contact Name: Contact Address:

Contact Addr2:

Contact Email:

Contact Phone:

Contact City,St,Zip:

BJ267

0.422 mi. 2229 ft.

**Relative:** Lower Actual: 21 ft.

NE 1/4-1/2 Database(s)

EDR ID Number **EPA ID Number** 

## **MUTUAL BISCUIT COMPANY (Continued)**

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported Not reported

Not reported

Not reported

Not reported

Not reported Not reported S104193116

	(••••••••		
UST Trust:	False		
Remediation Phase:	0		
Date Entered In Comp	uter: 1999-07-22		
Spill Record Last Upda	ate: 1999-09-10		
Spiller Name:	NASER JABER		
Spiller Company:	POST MARINE SUPPLY		
Spiller Address:	65 RIVER ST		
Spiller City,St,Zip:	NEW ROCHELLE, NY		
Spiller Company:	001		
Contact Name:	NASER JABER		
Contact Phone:	(914) 235-9800		
DEC Memo:	"Prior to Sept, 2004 data translat O'MARA "	ion this spill Lead_DEC Field was	
Remarks:	"CALLER STATES THAT HE WI	TTNESSED SUBJ DUMPING GAS INTO	) A STORM
	DRAIN. JOHN O'MARA (REGIO	N 3 SPILLS) NOTIFIED AND ALSO ENC	ON POLICE"
Material:			
Site ID:	139056		
Operable Unit ID:	1079250		
Operable Unit:	01		
Material ID:	301132		
Material Code:	0009		
Material Name:	gasoline		
Case No.:	Not reported		
Material FA:	Petroleum		
Quantity:	1.00		
Units:	Gallons		
Recovered:	.00		
Resource Affected:	Not reported		
Oxygenate:	Not reported		
Tank Test:			
ELEDYNE HYDRA-POWE	R	NY SWF/LF	1000201735
10 MAIN ST		NY Spills	NYD001650209
IEW ROCHELLE, NY 108	01	RCRA NonGen / NLR	
		FINDS	
Site 1 of 2 in cluster BJ		NY MANIFEST ECHO	
SWF/LF:			
	INACTIVE		
Ū	3		
•	Not reported		
Owner Neme	Not reported		

**TELEDYNE HYDRA-POWER (Continued)** 

Operable Unit:

Material ID:

01

2252898

## MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	-	• • •	
	Activity Desc: Activity Number: Active: East Coordinate: North Coordinate: Accuracy Code: Regulatory Status: Waste Type:	Vehicle [60J11] No 603184 452983 Not rep Not rep Not rep	orted orted
	Authorization #:	Not rep	
	Authorization Date:	Not rep	
	Expiration Date:	Not rep	
S	SPILLS:		
	Facility ID:		1408123
	Facility Type:		ER
	DER Facility ID:		456652
	Site ID:		501675
	DEC Region:		3
	Spill Date:	_	2014-11-06
	Spill Number/Closed	Date:	1408123 / 2014-11-06
	Spill Cause:		Equipment Failure
	Spill Class:		Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party.
			Corrective action taken.
	SWIS:		6010
	Investigator:		DXTRAVER
	Referred To:		Not reported
	Reported to Dept:		2014-11-06
	CID:		Not reported
	Water Affected:		Not reported
	Spill Source:		Commercial/Industrial
	Spill Notifier:		Other
	Cleanup Ceased:		Not reported
	Cleanup Meets Std:		False
	Last Inspection: Recommended Pena	1+	Not reported
	UST Trust:	iity.	Not reported False
	Remediation Phase:		0
	Date Entered In Com	puter:	2014-11-06
	Spill Record Last Up	•	2014-11-06
	Spiller Name:		MIKE TASHENT
	Spiller Company:		M TECH MOTORS
	Spiller Address:		310 MAIN ST REAR
	Spiller City,St,Zip:		NEW ROCHELLE, NY
	Spiller Company:		
	Contact Name: Contact Phone:		MIKE TASHENT (914) 355-2500
	DEC Memo:		"11/6/14- Spoke to caller. He was on site and noted where auto shop
	DEO Memo.		flushed some waste oil to roadside curb. Cleanup completed by spiller
			with speedidry. Caller states cleanup is complete. NFA DT"
	Remarks:		"loss to sewer and roadway. C/u in progress"
N	/aterial:		
IV	Site ID:		501675
	Operable Unit ID:		1251062
	Operable Unit:		01

Database(s)

ELEDYNE HYDRA-POWER (Co	ontinued)	10002017
Material Code:	0015	
Material Name:	motor oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	1.00	
Units:	Gallons	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Oxygenale.	Not reported	
Tank Test:		
Facility ID:	0713299	
Facility Type:	ER	
DER Facility ID:	344570	
Site ID:	395027	
DEC Region:	3	
0	-	
Spill Date:	2008-03-17	
Spill Number/Closed Date:	0713299 / 2010-11-30	
Spill Cause:	Other	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	jkomara	
Referred To:	WCDOH - PBS	
Reported to Dept:	2008-03-17	
CID:	444	
Water Affected:	Not reported	
Spill Source:	Commercial/Industrial	
Spill Notifier:	Responsible Party	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	False	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:		
	Not reported	
Remediation Phase:	0	
Date Entered In Computer:	2008-03-17	
Spill Record Last Update:	2010-11-30	
Spiller Name:		
Spiller Company:	CAR DEALER	
Spiller Address:	310 MAIN STREET	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	001	
Contact Name:	MIMI	
Contact Phone:	(212) 962-4301	
DEC Memo:	"11/30/10 No Info 3 years old spills will nbot be following up NFA	
Remarks:	JO'M " "DURING SOIL BORINGS FOUND CONTAMINTAED SOIL"	
Material:		
Site ID:	395027	
Operable Unit ID:	1151973	
Operable Unit:	01	
Material ID:	2142744	
Material Code:	0066A	
Material Name:	unknown petroleum	

Database(s)

EDR ID Number EPA ID Number

Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
RCRA NonGen / NLR:		
Date form received by agence	v:01/01/2007	
Facility name:	TELEDYNE HYDRA-POWER	
Facility address:	310 MAIN ST	
. admy addrood.	NEW ROCHELLE, NY 108015716	
EPA ID:	NYD001650209	
Mailing address:	MAIN ST	
manny auress.	NEW ROCHELLE, NY 10801	
Contact:	Not reported	
	•	
Contact address:	MAIN ST NEW ROCHELLE, NY 10801	
Contact country		
Contact country:	US Not reported	
Contact telephone:	Not reported	
Contact email:	Not reported	
EPA Region:	02	
Land type:	Facility is not located on Indian land. Additional information is not known.	
Classification:	Non-Generator	
Description:	Handler: Non-Generators do not presently generate hazardous waste	
Owner/Operator Summary:		
Owner/operator name:	TELEDYNE HYDRA-POWER	
Owner/operator address:	310 MAIN ST	
· · · · · · · · · · · · · · · · · · ·	NEW ROCHELLE, NY 10801	
Owner/operator country:	US	
Owner/operator telephone:	(914) 632-2200	
Legal status:	Private	
Owner/Operator Type:	Owner	
Owner/Op start date:	Not reported	
Owner/Op end date:	Not reported	
Owner/operator name:	TELEDYNE HYDRA-POWER	
Owner/operator address:	310 MAIN ST	
·	OPERCITY, NY 99999	
Owner/operator country:	US	
Owner/operator telephone:	(914) 632-2200	
Legal status:	Private	
Owner/Operator Type:	Operator	
Owner/Op start date:	Not reported	
Owner/Op end date:	Not reported	
Handler Activities Summary:		
U.S. importer of hazardous w	vaste: No	
Mixed waste (haz. and radioa		

TC4738280.2s Page 589

Database(s)

ELEDYNE HYDRA-POWER (Co	ntinued) 1000201735
Transporter of hazardous was	ste: No
Treater, storer or disposer of	
Underground injection activity	
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burn	
Used oil Specification market	
Used oil transfer facility:	No
Used oil transporter:	No
Historical Generators:	
Date form received by agency	v: 01/01/2006
Site name:	TELEDYNE HYDRA-POWER
Classification:	Not a generator, verified
Date form received by agency	
Site name:	TELEDYNE HYDRA-POWER
Classification:	Not a generator, verified
Date form received by agency	
Site name:	TELEDYNE HYDRA-POWER
Classification:	Not a generator, verified
. Waste code:	F005
. Waste name:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	U002
. Waste name:	2-PROPANONE (I) (OR) ACETONE (I)
. Waste code:	U140
. Waste name:	1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL ALCOHOL (I,T)
. Waste code:	U238
. Waste name:	CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)
. Waste code:	U239
. Waste name:	BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)
Date form received by agency	
Site name:	TELEDYNE HYDRA-POWER
Classification:	Large Quantity Generator
. Waste code:	D001
. Waste name:	IGNITABLE WASTE
. Waste code:	F005
. Waste name:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	TELEDYNE HYDRA-POWER	(Continued)		1000201735
		2-ETHOXYETHANOL, AND 2-NITROPROPANE; A CONTAINING, BEFORE USE, A TOTAL OF TEN F ONE OR MORE OF THE ABOVE NONHALOGEN/ LISTED IN F001, F002, OR F004; AND STILL BOT THESE SPENT SOLVENTS AND SPENT SOLVEN	PERCENT OR MORE ATED SOLVENTS OR ITOMS FROM THE RI	(BY VOLUME) OF THOSE SOLVENTS
	. Waste code: . Waste name:	U002 2-PROPANONE (I) (OR) ACETONE (I)		
	. Waste code: . Waste name:	U140 1-PROPANOL, 2-METHYL- (I,T) (OR) ISOBUTYL A	ALCOHOL (I,T)	
	. Waste code: . Waste name:	U238 CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CA	ARBAMATE (URETHA	NE)
	. Waste code: . Waste name:	U239 BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)		
	Violation Status:	No violations found		
	Evaluation Action Summary Evaluation date: Evaluation: Area of violation: Date achieved complian Evaluation lead agency:	08/27/1987 COMPLIANCE EVALUATION INSPECTION ON-SI Not reported		
	Evaluation date: Evaluation: Area of violation: Date achieved complian Evaluation lead agency:	03/19/1986 COMPLIANCE EVALUATION INSPECTION ON-SI Not reported e: Not reported State	ITE	
	FINDS:			
	Registry ID:	110004335808		
	Conse event: and tr progra correc FIS (N of Env	est/Information System CRAInfo is a national information system that supports the Resource onservation and Recovery Act (RCRA) program through the tracking of vents and activities related to facilities that generate, transport, nd treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA rogram staff to track the notification, permit, compliance, and prrective action activities required under RCRA. IS (New York - Facility Information System) is New York's Department <sup>c</sup> Environmental Conservation (DEC) information system for tracking nvironmental facility information found across the State.		
	NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2:	USA NYD001650209 Not reported 310 MAIN ST BP Not reported		

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)** Total Tanks: Not reported NEW ROCHELLE Location City: NY Location State: Location Zip: 10801 Location Zip 4: 5716 NY MANIFEST: EPAID: NYD001650209 Mailing Name: TELEDYNE HYDRA POWER INC Mailing Contact: **RICHARD C. SNYDER** Mailing Address 1: 10-12 PINE COURT Mailing Address 2: Not reported NEW ROCHELLE Mailing City: Mailing State: NY Mailing Zip: 10801 Mailing Zip 4: Not reported Mailing Country: USA Mailing Phone: 9146322200 NY MANIFEST: Document ID: PAC6193121 Manifest Status: С sea: Not reported Year: 1993 Trans1 State ID: PAAH0421 Trans2 State ID: Not reported Generator Ship Date: 01/21/1993 Trans1 Recv Date: 01/21/1993 Trans2 Recv Date: 01/22/1993 TSD Site Recv Date: 01/22/1993 Part A Recv Date: 02/02/1993 Part B Recv Date: 02/04/1993 Generator EPA ID: NYD001650209 Trans1 EPA ID: CTD983883745 Trans2 EPA ID: Not reported TSDF ID 1: PAD067098822 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F001 - UNKNOWN Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported 00300 Quantity:

G - Gallons (liquids only)\* (8.3 pounds)

Units:

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Number of Containers: 006 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 NJA1021398 Document ID: Manifest Status: С Not reported seq: Year: 1991 Trans1 State ID: NJDEPS581 Trans2 State ID: Not reported Generator Ship Date: 04/17/1991 Trans1 Recv Date: 04/17/1991 Trans2 Recv Date: 11 TSD Site Recv Date: 04/17/1991 Part A Recv Date: 04/25/1991 Part B Recv Date: 05/08/1991 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Waste Code: F001 - UNKNOWN Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Document ID: Manifest Status: С seq: Year: 1991 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: 11 TSD Site Recv Date: Part A Recv Date: 11 Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: 00055 Units: Number of Containers: 001 Container Type: Handling Method: Specific Gravity: 100 Document ID: Manifest Status: κ seq: Year: 1990 Trans1 State ID: S5811 Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: 11 TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID:

NJA1241335 Not reported NJDEPS581 Not reported 10/24/1991 10/24/1991 10/24/1991 11/08/1991 NYD001650209 NJD982281016 Not reported NJD002200046 Not reported F001 - UNKNOWN Not reported Not reported Not reported Not reported Not reported G - Gallons (liquids only)\* (8.3 pounds) DM - Metal drums, barrels R Material recovery of more than 75 percent of the total material. NJA1053512 Not reported Not reported 11/28/1990 11/28/1990 11/28/1990 12/28/1990 01/07/1991 NYD001650209 NJD982281016 Not reported

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D001 - NON-LISTED IGNITABLE WASTES Waste Code: Waste Code: Not reported Quantity: 00040 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Waste Code: D007 - CHROMIUM 5.0 MG/L TCLP Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 DM - Metal drums, barrels Container Type: Handling Method: L Landfill. Specific Gravity: 100 NJA0798146 Document ID: Manifest Status: Κ Not reported seq: Year: 1990 Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 05/01/1990 05/01/1990 Trans1 Recv Date: Trans2 Recv Date: 11 TSD Site Recv Date: 05/02/1990 Part A Recv Date: 06/14/1990 Part B Recv Date: 06/20/1990 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported

Database(s)

EDR ID Number **EPA ID Number** 

#### **TELEDYNE HYDRA-POWER (Continued)**

Units:

Units:

seq: Year:

Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F001 - UNKNOWN Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Document ID: NJA0846650 Manifest Status: Κ Not reported 1990 Trans1 State ID: NJDEPS581 Trans2 State ID: Not reported 01/25/1990 Generator Ship Date: Trans1 Recv Date: 01/25/1990 Trans2 Recv Date: 11 TSD Site Recv Date: 01/26/1990 03/28/1990 Part A Recv Date: Part B Recv Date: 03/30/1990 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

**Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00110 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: NJA0632991 Manifest Status: Κ seq: Not reported Year: 1989 Trans1 State ID: S58112066 Not reported Trans2 State ID: Generator Ship Date: 10/06/1989 Trans1 Recy Date: 10/06/1989 Trans2 Recv Date: 11 TSD Site Recv Date: 10/06/1989 10/12/1989 Part A Recv Date: Part B Recv Date: 11/14/1989 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001

EDR ID Number EPA ID Number

1000201735

Database(s)

#### **TELEDYNE HYDRA-POWER (Continued)**

Container Type: DM - Metal drums, barrels R Material recovery of more than 75 percent of the total material. Handling Method: Specific Gravity: 100 Document ID: NJA0632447 Manifest Status: С seq: Not reported Year: 1989 Trans1 State ID: S58112603 Trans2 State ID: Not reported Generator Ship Date: 06/26/1989 Trans1 Recv Date: 06/26/1989 Trans2 Recv Date: 11 TSD Site Recv Date: 06/27/1989 Part A Recv Date: 07/19/1989 Part B Recv Date: 07/07/1989 NYD001650209 Generator EPA ID: Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported NJD002200046 TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Not reported Discr Type Indicator: **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F001 - UNKNOWN Waste Code: Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: NJA0632704 Manifest Status: С seq: Not reported 1989 Year: Trans1 State ID: S58112066 Trans2 State ID: Not reported 08/22/1989 Generator Ship Date: Trans1 Recv Date: 08/22/1989 Trans2 Recy Date: 11 08/23/1989 TSD Site Recy Date: Part A Recv Date: 09/07/1989

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Part B Recv Date: 09/05/1989 NYD001650209 Generator EPA ID: Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: F001 - UNKNOWN Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: CTC0168881 Manifest Status: Κ seq: Not reported Year: 1990 Trans1 State ID: CTE43069 Trans2 State ID: Not reported Generator Ship Date: 12/26/1990 Trans1 Recv Date: 12/26/1990 Trans2 Recv Date: 11 TSD Site Recv Date: 12/26/1990 Part A Recv Date: 04/03/1991 Part B Recv Date: 01/23/1991 Generator EPA ID: NYD001650209 Trans1 EPA ID: CTD983872748 Trans2 EPA ID: Not reported TSDF ID 1: CTD021816889 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code: Not reported Quantity: 00500 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: TT - Cargo tank, tank trucks Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: NJA0560838 Manifest Status: Κ seq: Not reported Year: 1989 Trans1 State ID: S58112603 Trans2 State ID: Not reported Generator Ship Date: 02/01/1989 Trans1 Recv Date: 02/01/1989 Trans2 Recv Date: 11 TSD Site Recv Date: 02/06/1989 Part A Recv Date: 03/15/1989 Part B Recv Date: 02/13/1989 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported NJD002200046 TSDF ID 1: TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported **Discr Type Indicator:** Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F001 - UNKNOWN Waste Code: Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)** Waste Code: X726 - MISC OIL/GAS PRODUCTS (NJ ONLY) Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: NJA0798464 Manifest Status: κ Not reported seq: Year: 1990 Trans1 State ID: NJDEPS581 Trans2 State ID: Not reported Generator Ship Date: 06/22/1990 Trans1 Recv Date: 06/22/1990 Trans2 Recv Date: 11 TSD Site Recv Date: 06/25/1990 Part A Recv Date: 08/07/1990 Part B Recv Date: 08/06/1990 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Waste Code: F001 - UNKNOWN Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: NJA0632201 Manifest Status: С Not reported seq: Year: 1989 Trans1 State ID: S58112603 Trans2 State ID: Not reported 04/25/1989 Generator Ship Date: Trans1 Recv Date: 04/25/1989 Trans2 Recv Date: 11 TSD Site Recv Date: 05/01/1989 Part A Recv Date: 05/10/1989 Part B Recv Date: 05/09/1989 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F001 - UNKNOWN Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: R Material recovery of more than 75 percent of the total material. Specific Gravity: 100 Waste Code: X726 - MISC OIL/GAS PRODUCTS (NJ ONLY) Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001

EDR ID Number Database(s) EPA ID Number

1000201735

#### **TELEDYNE HYDRA-POWER (Continued)**

Container Type: DM - Metal drums, barrels R Material recovery of more than 75 percent of the total material. Handling Method: Specific Gravity: 100 Document ID: NYA6456618 Manifest Status: С seq: Not reported Year: 1988 Trans1 State ID: PLATE# Trans2 State ID: Not reported Generator Ship Date: 03/30/1988 Trans1 Recv Date: 03/30/1988 Trans2 Recv Date: 11 TSD Site Recv Date: 03/30/1988 Part A Recv Date: 04/05/1988 Part B Recv Date: 04/12/1988 NYD001650209 Generator EPA ID: Trans1 EPA ID: NYD000824334 Trans2 EPA ID: Not reported TSDF ID 1: NYD000824334 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F001 - UNKNOWN Waste Code: Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00030 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00030 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100

Database(s)

EDR ID Number EPA ID Number

1000201735

#### **TELEDYNE HYDRA-POWER (Continued)**

Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Quantity: Units: Number of Containers: Container Type: Handling Method: Specific Gravity: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID:

Trans2 EPA ID:

NYA5744286 С Not reported 1987 PLATE# 57745GB 04/14/1987 04/14/1987 11 04/14/1987 04/22/1987 05/05/1987 NYD001650209 NYD000824334 Not reported NYD000824334 Not reported F001 - UNKNOWN Not reported Not reported Not reported Not reported Not reported 00055 G - Gallons (liquids only)\* (8.3 pounds) 001 DM - Metal drums, barrels B Incineration, heat recovery, burning. 100 NYA6402132 С Not reported 1987 Not reported 57745GB 12/30/1987 12/30/1987 11 12/30/1987 01/15/1988 01/12/1988 NYD001650209 NYD000824334

Not reported

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

TSDF ID 1: NYD000824334 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Not reported Import Indicator: Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F001 - UNKNOWN Waste Code: Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: CTA0042088 Manifest Status: С seq: Not reported Year: 1987 Trans1 State ID: CT4163A Trans2 State ID: Not reported Generator Ship Date: 03/31/1987 03/31/1987 Trans1 Recv Date: Trans2 Recv Date: 11 03/31/1987 TSD Site Recv Date: Part A Recv Date: 04/07/1987 Part B Recv Date: 04/14/1987 Generator EPA ID: NYD001650209 Trans1 EPA ID: CTD980521280 Trans2 EPA ID: Not reported TSDF ID 1: CTD021816889 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: **CR02 - AUTHORIZED WASTE OIL** 

Database(s)

EDR ID Number EPA ID Number

## **TELEDYNE HYDRA-POWER (Continued)**

EDYNE HYDRA-POWER (Continued)				
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
	00500			
Quantity: Units:	G - Gallons (liquids only)* (8.3 pounds)			
Number of Containers:	001			
	TT - Cargo tank, tank trucks			
Container Type: Handling Method:				
Specific Gravity:	T Chemical, physical, or biological treatment.			
Specific Gravity.	100			
Document ID:	NYA6458922			
Manifest Status:	K			
seq:	Not reported			
Year:	1988			
Trans1 State ID:	PLATE#			
Trans2 State ID:	IC1244			
Generator Ship Date:	06/24/1988			
Trans1 Recv Date:	06/24/1988			
Trans2 Recv Date:	/ /			
TSD Site Recv Date:	06/24/1988			
Part A Recy Date:	07/01/1988			
Part B Recv Date:	07/19/1988			
Generator EPA ID:	NYD001650209			
Trans1 EPA ID:	NYD000824334			
Trans2 EPA ID:	Not reported			
TSDF ID 1:	NYD000824334			
TSDF ID 2:	Not reported			
Manifest Tracking Number:	Not reported			
Import Indicator:	Not reported			
Export Indicator:	Not reported			
Discr Quantity Indicator:	Not reported			
Discr Type Indicator:	Not reported			
Discr Residue Indicator:	Not reported			
Discr Partial Reject Indicator:	Not reported			
Discr Full Reject Indicator:	Not reported			
Manifest Ref Number:	Not reported			
Alt Facility RCRA ID:	Not reported			
Alt Facility Sign Date:	Not reported			
MGMT Method Type Code:	Not reported			
Waste Code:	D001 - NON-LISTED IGNITABLE WASTES			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
Quantity:	00055			
Units:	G - Gallons (liquids only)* (8.3 pounds)			
Number of Containers:	001			
Container Type:	DM - Metal drums, barrels			
Handling Method:	B Incineration, heat recovery, burning.			
Specific Gravity:	100			
Waste Code:	F001 - UNKNOWN			
Waste Code:	Not reported			
Waste Code:	Not reported			
Waste Code:	Not reported			
	•			

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100 Document ID: NJA0533423 Manifest Status: С Not reported seq: Year: 1988 Trans1 State ID: S58112603 Trans2 State ID: Not reported Generator Ship Date: 11/21/1988 Trans1 Recv Date: 11/21/1988 Trans2 Recv Date: 11 TSD Site Recv Date: 11/22/1988 Part A Recv Date: 11/25/1988 Part B Recv Date: 11/30/1988 Generator EPA ID: NYD001650209 Trans1 EPA ID: NJD982281016 Trans2 EPA ID: Not reported TSDF ID 1: NJD002200046 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: F001 - UNKNOWN Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Waste Code: X726 - MISC OIL/GAS PRODUCTS (NJ ONLY) Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00055 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 001

Database(s)

EDR ID Number EPA ID Number

#### **TELEDYNE HYDRA-POWER (Continued)**

Container Type: DM - Metal drums, barrels Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 100 Document ID: NYA3825472 Manifest Status: С seq: Not reported Year: 1986 Trans1 State ID: PLATE# Trans2 State ID: 577-45GB Generator Ship Date: 10/29/1986 Trans1 Recv Date: 10/29/1986 Trans2 Recv Date: 11 TSD Site Recv Date: 10/29/1986 Part A Recv Date: 11/07/1986 Part B Recv Date: 11/10/1986 NYD001650209 Generator EPA ID: Trans1 EPA ID: NYD000824334 Trans2 EPA ID: Not reported TSDF ID 1: NYD000824334 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Not reported Import Indicator: Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported F001 - UNKNOWN Waste Code: Waste Code: Not reported Quantity: 00055 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100

1000201735

<u>Click this hyperlink</u> while viewing on your computer to access 9 additional NY\_MANIFEST: record(s) in the EDR Site Report.

ECHO:

Envid: Registry ID: DFR URL: 1000201735 110004335808 http://echo.epa.gov/detailed\_facility\_report?fid=110004335808

Database(s)

268 SSE 1/4-1/2 0.424 mi. 2238 ft.	RESIDENCE 164 CHURCH STREET NEW ROCHELLE, NY	NY LTANKS S102674492 N/A
	LTANKS:	
Relative: Lower	Site ID:	197739
LOWEI	Spill Number/Closed Date:	
Actual:	Spill Date:	1995-08-25
44 ft.	Spill Cause:	Tank Overfill
	Spill Source:	Private Dwelling
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	1995-08-28
	Cleanup Meets Standard:	
	SWIS:	6010
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept: CID:	1995-08-25 Not reported
	Water Affected:	Not reported
	Spill Notifier:	Responsible Party
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	
	Spill Record Last Update:	
	Spiller Name:	Not reported
	Spiller Company: Spiller Address:	Not reported Not reported
	Spiller City,St,Zip:	***Update***, ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY "
	Remarks:	"OVERFILLED TANK FOR APT. BUILDING ONTO THE CEMENT BEING SHOVELED UP CLEANED UP"
	Material:	
	Site ID:	197739
	Operable Unit ID:	1021235
	Operable Unit:	01
	Material ID:	364425
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum 10.00
	Quantity: Units:	Gallons
	Recovered:	10.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported

Map ID		MAP FINDINGS		
Direction	Ч			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
				6400074400
	RESIDENCE (Continued)			S102674492
	Tank Test:			
200				4000444004
269 ENE	CONSOLIDATED EDISON-ECHO ECHO AVE	JAVE. SITE	SEMS-ARCHIVE RCRA-CESQG	1000111631 NYD981141252
1/4-1/2 0.424 mi.	NEW ROCHELLE, NY 10801		NY Spills NY MANIFEST	
2241 ft.				
Relative:	SEMS-ARCHIVE:			
Lower	Site ID: EPA ID:	202659 NYD981141252		
Actual:	Federal Facility:	N		
17 ft.	NPL:	Not on the NPL		
	Non NPL Status:	NFRAP-Site does not qualify for the NPL based on	existing information	
		s gathered from the prior CERCLIS update comple	ted in 10/2013:	
	Site ID:	0202659		
	Federal Facility: NPL Status:	Not a Federal Facility Not on the NPL		
	Non NPL Status:	NFRAP-Site does not qualify for the NPL based on	existing information	
	CERCLIS-NFRAP Site Alias Na Alias Name:			
	Alias Address:	CONSOLIDATED EDISON-ECHO AVE. SITE Not reported		
		WESTCHESTER, NY		
	CERCLIS-NFRAP Assessment	t History		
	Action:	DISCOVERY		
	Date Started:	/ /		
	Date Completed:	04/19/88		
	Priority Level:	Not reported		
	Action:	ARCHIVE SITE		
	Date Started:	/ /		
	Date Completed: Priority Level:	09/30/92 Not reported		
	Action:	PRELIMINARY ASSESSMENT		
	Date Started: Date Completed:	/ / 09/30/92		
	Priority Level:	NFRAP-Site does not qualify for the NPL based on	existing information	
	-		-	
	RCRA-CESQG:			
	Date form received by agen	-		
	Facility name: Facility address:	CON EDISON - ECHO AVENUE SUBSTATION ECHO AVENUE		
	r dointy doubood.	NEW ROCHELLE, NY 10801		
	EPA ID:	NYD981141252		
	Mailing address:	4 IRVING PLACE		
	Contect	NEW YORK, NY 10003		
	Contact: Contact address:	ANTHONY DRUMMINGS 4 IRVING PLACE		
		NEW YORK, NY 10003		
	Contact country:	US		
	Contact telephone:	(212) 460-3770		

Database(s)

CONSOLIDATED EDISON-ECHO AVE. SITE (Continued) 1000111631			
Contact email:	Not reported		
EPA Region:	02		
Classification:	Conditionally Exempt Small Quantity Generator		
Description:	Handler: generates 100 kg or less of hazardous waste per calendar		
Description.	month, and accumulates 1000 kg or less of hazardous waste per calendar time;		
	or generates 1 kg or less of acutely hazardous waste per calendar		
	month, and accumulates at any time: 1 kg or less of acutely hazardous		
	waste; or 100 kg or less of any residue or contaminated soil, waste or		
	other debris resulting from the cleanup of a spill, into or on any		
	land or water, of acutely hazardous waste; or generates 100 kg or less		
	of any residue or contaminated soil, waste or other debris resulting		
	from the cleanup of a spill, into or on any land or water, of acutely		
	hazardous waste during any calendar month, and accumulates at any		
	time: 1 kg or less of acutely hazardous waste; or 100 kg or less of		
	any residue or contaminated soil, waste or other debris resulting from		
	the cleanup of a spill, into or on any land or water, of acutely		
	hazardous waste		
Owner/Operator Summary:			
Owner/operator Summary.	CONSOLIDATED EDISON COMPANY OF NY, INC.		
Owner/operator address:	4 IRVING PLACE		
	NEW YORK, NY 10003		
Owner/operator country:	US		
Owner/operator telephone:	Not reported		
Legal status:	Private		
Owner/Operator Type:	Owner		
Owner/Op start date:	01/01/1951		
Owner/Op end date:	Not reported		
Owner/operator name:	CONSOLIDATED EDISON COMPANY OF NY, INC.		
Owner/operator address:	4 IRVING PLACE		
	NEW YORK, NY 10003		
Owner/operator country:	US		
Owner/operator telephone:	Not reported		
Legal status:	Private		
Owner/Operator Type:	Operator		
Owner/Op start date:	01/01/1951		
Owner/Op end date:	Not reported		
Handler Activities Summary:			
U.S. importer of hazardous wa	aste: No		
Mixed waste (haz. and radioa			
Recycler of hazardous waste:	,		
Transporter of hazardous was			
Treater, storer or disposer of			
Underground injection activity			
On-site burner exemption:	No		
Furnace exemption:	No		
Used oil fuel burner:	No		
Used oil processor:	No		
User oil refiner:	No		
Used oil fuel marketer to burn			
Used oil Specification markete			
Used oil transfer facility:	No		
Used oil transporter:	No		

Database(s)

EDR ID Number EPA ID Number

CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)		
Historical Generators:		
Date form received by agency		
Site name:	CON EDISON - ECHO AVENUE SUBSTATION	
Classification:	Conditionally Exempt Small Quantity Generator	
Date form received by agency		
Site name:	CON EDISON - ECHO AVENUE SUBSTATION	
Classification:	Large Quantity Generator	
. Waste code:	D008	
. Waste name:	LEAD	
Date form received by agency	:01/01/2001	
Site name:	ECHO AVENUE SUBSTATION	
Classification:	Large Quantity Generator	
Date form received by agency	:07/14/1999	
Site name:	CON EDISON - ECHO AVENUE SUB	
Classification:	Small Quantity Generator	
Date form received by agency	:03/29/1996	
Site name:	CON EDISON - ECHO AVENUE SUBSTATION	
Classification:	Large Quantity Generator	
Date form received by agency	:11/19/1985	
Site name:	CON EDISON - ECHO AVENUE SUB	
Classification:	Large Quantity Generator	
. Waste code:	X002	
. Waste name:	POLYCHLORINATED BIPHENOLS (PCBs)	
Violation Status:	No violations found	
SPILLS:		
Facility ID:	9711031	
Facility Type:	ER	
DER Facility ID:	101608	
Site ID:	116789	
DEC Region:	3	
Spill Date:	1998-01-01	
Spill Number/Closed Date:	9711031 / 1998-01-06	
Spill Cause:	Equipment Failure	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	tdghiosa	
Referred To:	Not reported	
Reported to Dept: CID:	1998-01-01 204	
Water Affected:	Not reported	
Spill Source:	Non Major Facility > 1,100 gal	
Spill Notifier:	Responsible Party	
Cleanup Ceased:	Not reported	
•	•	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	False	

Database(s)

ONSOLIDATED EDISON-ECHO		1000111631
Remediation Phase:	0	
Date Entered In Computer:	1998-01-01	
Spill Record Last Update:	1998-01-29	
Spiller Name:	STEVE ROMERO	
Spiller Company:	CON EDISON	
Spiller Address:	4 IRVING PLACE	
Spiller City,St,Zip:	MANHATTAN, NY	
Spiller Company:	001	
Contact Name:	STEVE ROMERO	
Contact Phone:	(212) 580-6763	
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Fie	eld was
	GHIOSAY 01/01/98 OIL/WATER SEPARATOR OVERFLO	
	BECAME CLOGGED OR FROZEN CAUSING OVERFLOW	
	CONTAINED IN DIKED AREA; 100 GAL OVERFLOWED D	
	DRAIN; 01/06/98 SPILL CLEANED UP BY CON ED; H20 F	
	PCB "	HAS LESS THAN I FFM
Remarks:	"OIL / WATER SEPARATOR MALFUNCTIONED 3300 IN (	CONTAINMENT AREA"
Material:		
Site ID:	116789	
Operable Unit ID:	1053908	
Operable Unit:	01	
Material ID:	329298	
Material Code:	9999	
Material Name:	other -	
Case No.:	Not reported	
Material FA:	Other	
Quantity:	3400.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
en genaler		
Tank Test:		
NY MANIFEST:		
Country:	USA	
EPA ID:	NYD981141252	
Facility Status:	Not reported	
Location Address 1:	ECHO AVE	
Code:	BP	
Location Address 2:	Not reported	
Total Tanks:	Not reported	
Location City:	NEW ROCHELLE	
Location State:	NY	
Location Zip:	10801	
Location Zip 4:	Not reported	
NY MANIFEST:		
EPAID:	NYD981141252	
Mailing Name:	CONSOLIDATED EDISON	
Mailing Contact:	FRANKLIN MURRAY	
Mailing Address 1:	4 IRVING PLACE RM 828	
Mailing Address 2:	Not reported	
Mailing City:	NEW YORK	
Mailing State:	NY	

Database(s)

EDR ID Number EPA ID Number

DNSOLIDATED EDISON-ECHO AVE. SITE (Continued)			
Mailing Zip:	10003		
Mailing Zip 4:	Not reported		
Mailing Country:	USA		
Mailing Phone:	2124602808		
<b>3 3 4 3</b>			
NY MANIFEST:			
Document ID:	NYB9791883		
Manifest Status:	Not reported		
seq: Year:	01 2003		
Trans1 State ID:	AE50394PA		
Trans2 State ID:	Not reported		
Generator Ship Date:	01/20/2003		
Trans1 Recv Date:	01/20/2003		
Trans2 Recy Date:	Not reported		
TSD Site Recv Date:	01/21/2003		
Part A Recv Date:	Not reported		
Part B Recv Date:	Not reported		
Generator EPA ID:	NYD981141252		
Trans1 EPA ID:	PAD146714878		
Trans2 EPA ID:	Not reported		
TSDF ID 1:	NYD049836679		
TSDF ID 2:	Not reported		
Manifest Tracking Number:	Not reported		
Import Indicator:	Not reported		
Export Indicator:	Not reported		
Discr Quantity Indicator: Discr Type Indicator:	Not reported		
Discr Residue Indicator:	Not reported Not reported		
Discr Partial Reject Indicator:	Not reported		
Discr Full Reject Indicator:	Not reported		
Manifest Ref Number:	Not reported		
Alt Facility RCRA ID:	Not reported		
Alt Facility Sign Date:	Not reported		
MGMT Method Type Code:	Not reported		
Waste Code:	B004 - PCB ARTICLES WITH 50 PPM BUT < 500 PPM		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported Not reported		
Waste Code: Quantity:	08210		
Units:	K - Kilograms (2.2 pounds)		
Number of Containers:	001		
Container Type:	CM - Metal boxes, cases, roll-offs		
Handling Method:	L Landfill.		
Specific Gravity:	01.00		
Document ID:	NYB9689319		
Manifest Status:	Not reported		
seq:	01		
Year:	2002		
Trans1 State ID:	XS83701PA		
Trans2 State ID: Generator Ship Date:	Not reported 10/22/2002		
Trans1 Recv Date:	10/22/2002		
Trans2 Recy Date:	Not reported		

Database(s)

EDR ID Number EPA ID Number

# CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

TSD Site Recv Date: 10/23/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: B004 - PCB ARTICLES WITH 50 PPM BUT < 500 PPM Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 02304 Units: K - Kilograms (2.2 pounds) Number of Containers: 001 CM - Metal boxes, cases, roll-offs Container Type: Handling Method: L Landfill. Specific Gravity: 01.00 Document ID: NYG1699497 Manifest Status: Not reported 01 seq: Year: 2000 Trans1 State ID: XF31635PA Trans2 State ID: Not reported 01/18/2000 Generator Ship Date: Trans1 Recv Date: 01/18/2000 Not reported Trans2 Recv Date: TSD Site Recv Date: 01/20/2000 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD981141252 Generator EPA ID: Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported

Database(s)

EDR ID Number EPA ID Number

# CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 10100 Units: P - Pounds Number of Containers: 001 Container Type: CM - Metal boxes, cases, roll-offs Handling Method: L Landfill. Specific Gravity: 01.00 Document ID: NYB9245052 Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: AD06661PA Trans2 State ID: Not reported Generator Ship Date: 01/27/2000 01/27/2000 Trans1 Recv Date: Trans2 Recy Date: Not reported TSD Site Recv Date: 01/28/2000 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD981141252 Generator EPA ID: Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported **B007 - OTHER MISCELLANEOUS PCB WASTES** Waste Code: Waste Code: Not reported Quantity: 00499 K - Kilograms (2.2 pounds) Units: Number of Containers: 001 Container Type: CM - Metal boxes, cases, roll-offs

Database(s)

EDR ID Number EPA ID Number

#### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Handling Method: L Landfill. 01.00 Specific Gravity: Document ID: NYB8851671 Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: XH47240PA Trans2 State ID: Not reported Generator Ship Date: 03/14/2000 03/14/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported 03/15/2000 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Waste Code: Not reported Waste Code: Not reported Quantity: 45320 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NYB8851689 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: TZ47345PA Trans2 State ID: Not reported Generator Ship Date: 03/14/2000 03/14/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 03/15/2000 Not reported Part A Recv Date: Part B Recv Date: Not reported

Database(s)

EDR ID Number EPA ID Number

### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D008 - LEAD 5.0 MG/L TCLP Waste Code: Waste Code: Not reported Quantity: 50440 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NYB8851698 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: XB51788PA Not reported Trans2 State ID: Generator Ship Date: 03/14/2000 Trans1 Recv Date: 03/14/2000 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/15/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported

Database(s)

EDR ID Number EPA ID Number

### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 44140 Units: P - Pounds Number of Containers: 001 DT - Dump trucks Container Type: Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYB8851707 Manifest Status: Not reported 01 seq: Year: 2000 Trans1 State ID: XG32072PA Trans2 State ID: Not reported 03/14/2000 Generator Ship Date: Trans1 Recv Date: 03/14/2000 Trans2 Recv Date: Not reported 03/15/2000 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 44160 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00

Database(s)

EDR ID Number EPA ID Number

### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Document ID: Manifest Status: seq: 01 Year: 2000 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator: Discr Quantity Indicator: Discr Type Indicator: Discr Residue Indicator: Discr Partial Reject Indicator: Discr Full Reject Indicator: Manifest Ref Number: Alt Facility RCRA ID: Alt Facility Sign Date: MGMT Method Type Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: Waste Code: 46640 Quantity: Units: Number of Containers: 001 Container Type: Handling Method: Specific Gravity: 01.00 Document ID: Manifest Status: seq: 01 Year: 2000 Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID:

Trans2 EPA ID:

NYB8851716 Not reported TV30802PA Not reported 03/10/2000 03/10/2000 Not reported 03/13/2000 Not reported Not reported NYD981141252 PAD146714878 Not reported NYD049836679 Not reported D008 - LEAD 5.0 MG/L TCLP Not reported Not reported Not reported Not reported Not reported P - Pounds DT - Dump trucks T Chemical, physical, or biological treatment. NYB8851725 Not reported TY15443PA Not reported 03/10/2000 03/10/2000 Not reported 03/13/2000 Not reported Not reported NYD981141252 PAD146714878

Not reported

Database(s)

EDR ID Number EPA ID Number

## CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Not reported Import Indicator: Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 57300 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYB8851734 Manifest Status: Not reported seq: 01 2000 Year: Trans1 State ID: XE53087PA Trans2 State ID: Not reported Generator Ship Date: 03/10/2000 03/10/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 03/13/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP

Database(s)

EDR ID Number EPA ID Number

#### Waste Code: Not reported 50640 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NYB8851752 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: XB51788PA Trans2 State ID: Not reported Generator Ship Date: 03/10/2000 03/10/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 03/13/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD981141252 Generator EPA ID: Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Not reported Discr Residue Indicator: Discr Partial Reject Indicator: Not reported Not reported Discr Full Reject Indicator: Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 49720 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYB8851761 Manifest Status: Not reported 01 seq:

#### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Database(s)

EDR ID Number EPA ID Number

#### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Year: 2000 Trans1 State ID: XH447244P Trans2 State ID: Not reported Generator Ship Date: 03/09/2000 Trans1 Recv Date: 03/09/2000 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/10/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: **Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 46700 Units: P - Pounds 001 Number of Containers: Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NYB8851779 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: XA49178PA Trans2 State ID: Not reported 03/09/2000 Generator Ship Date: Trans1 Recv Date: 03/09/2000 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/10/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 PAD146714878 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported

Database(s)

EDR ID Number EPA ID Number

## CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 47240 Units: P - Pounds Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 NYB8851788 Document ID: Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 03/09/2000 Trans1 Recv Date: 03/09/2000 Trans2 Recv Date: Not reported 03/10/2000 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYD981141252 Generator EPA ID: Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Not reported Manifest Tracking Number: Import Indicator: Not reported Not reported Export Indicator: Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Not reported Manifest Ref Number: Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported

Database(s)

EDR ID Number EPA ID Number

NSOLIDATED EDISON-ECHO AVE. SITE (Continued)			
Waste Code:	Not reported		
Waste Code:	Not reported		
Quantity:	48460		
Units:	P - Pounds		
Number of Containers:	001		
Container Type:	DT - Dump trucks		
Handling Method:	T Chemical, physical, or biological treatment.		
Specific Gravity:	01.00		
Document ID:	NYB8851797		
Manifest Status:	Not reported		
seq:	01		
Year:	2000		
Trans1 State ID:	XG70657PA		
Trans2 State ID:	Not reported		
Generator Ship Date: Trans1 Recv Date:	03/09/2000 03/09/2000		
Trans2 Recv Date:	Not reported		
TSD Site Recv Date:	03/10/2000		
Part A Recv Date:	Not reported		
Part B Recv Date:	Not reported		
Generator EPA ID:	NYD981141252		
Trans1 EPA ID:	PAD146714878		
Trans2 EPA ID:	Not reported		
TSDF ID 1:	NYD049836679		
TSDF ID 2:	Not reported		
Manifest Tracking Number:	Not reported		
Import Indicator:	Not reported		
Export Indicator:	Not reported		
Discr Quantity Indicator:	Not reported		
Discr Type Indicator: Discr Residue Indicator:	Not reported Not reported		
Discr Partial Reject Indicator:	Not reported		
Discr Full Reject Indicator:	Not reported		
Manifest Ref Number:	Not reported		
Alt Facility RCRA ID:	Not reported		
Alt Facility Sign Date:	Not reported		
MGMT Method Type Code:	Not reported		
Waste Code:	D008 - LEAD 5.0 MG/L TCLP		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code: Waste Code:	Not reported		
Quantity:	Not reported 59640		
Units:	P - Pounds		
Number of Containers:	001		
Container Type:	DT - Dump trucks		
Handling Method:	T Chemical, physical, or biological treatment.		
Specific Gravity:	01.00		
Document ID:	NYB8851806		
Manifest Status:	Not reported		
seq:	01		
Year:	2000		
Trans1 State ID:	TS31639PA		
Trans2 State ID:	Not reported		

# CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Database(s)

EDR ID Number EPA ID Number

# CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Generator Ship Date: 03/09/2000 Trans1 Recv Date: 03/09/2000 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/10/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported 52920 Quantity: P - Pounds Units: Number of Containers: 001 Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYB8851815 Manifest Status: Not reported seq: 01 Year: 2000 Trans1 State ID: XC58821PA Trans2 State ID: Not reported Generator Ship Date: 03/09/2000 03/09/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 03/10/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD196714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported

Database(s)

EDR ID Number EPA ID Number

### CONSOLIDATED EDISON-ECHO AVE. SITE (Continued)

Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Not reported Alt Facility Sign Date: MGMT Method Type Code: Not reported Waste Code: D008 - LEAD 5.0 MG/L TCLP Waste Code: Not reported Quantity: 51220 P - Pounds Units: 001 Number of Containers: Container Type: DT - Dump trucks Handling Method: T Chemical, physical, or biological treatment. Specific Gravity: 01.00 Document ID: NYB8851824 Manifest Status: Not reported seq: 01 Year: 2000 XD54730PA Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 03/09/2000 03/09/2000 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 03/10/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD981141252 Trans1 EPA ID: PAD146714878 Trans2 EPA ID: Not reported TSDF ID 1: NYD049836679 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Not reported Export Indicator: Not reported Discr Quantity Indicator: Discr Type Indicator: Not reported **Discr Residue Indicator:** Not reported Not reported **Discr Partial Reject Indicator:** Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported D008 - LEAD 5.0 MG/L TCLP Waste Code: Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Not reported Waste Code: Quantity: 62880

Database(s)

EDR ID Number EPA ID Number

ISOLIDATED EDISON-ECHO AVE. SITE (Continued)			
Units:	P - Pounds		
Number of Containers:	001		
Container Type:	DT - Dump trucks		
Handling Method:	T Chemical, physical, or biological treatment.		
Specific Gravity:	01.00		
Document ID:	NYB8851833		
Manifest Status:	Not reported		
seq:	01		
Year:	2000		
Trans1 State ID:	XG70656PA		
Trans2 State ID:	Not reported		
Generator Ship Date:	03/09/2000		
Trans1 Recv Date:	03/09/2000		
Trans2 Recv Date:	Not reported		
TSD Site Recv Date:	03/10/2000		
Part A Recv Date:	Not reported		
Part B Recv Date:	Not reported		
Generator EPA ID:	NYD981141252		
Trans1 EPA ID:	PAD146714878		
Trans2 EPA ID:	Not reported		
TSDF ID 1:	NYD049836679		
TSDF ID 2:	Not reported		
Manifest Tracking Number:	Not reported		
Import Indicator:	Not reported		
Export Indicator:	Not reported		
Discr Quantity Indicator:	Not reported		
Discr Type Indicator:	Not reported		
Discr Residue Indicator:	Not reported		
Discr Partial Reject Indicator:	Not reported		
Discr Full Reject Indicator:	Not reported		
Manifest Ref Number:	Not reported		
Alt Facility RCRA ID: Alt Facility Sign Date:	Not reported		
MGMT Method Type Code:	Not reported		
Waste Code:	Not reported D008 - LEAD 5.0 MG/L TCLP		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Waste Code:	Not reported		
Quantity:	49100		
Units:	P - Pounds		
Number of Containers:	001		
Container Type:	DT - Dump trucks		
Handling Method:	T Chemical, physical, or biological treatment.		
Specific Gravity:	01.00		
-, -, -, -, -, -, -, -, -, -, -, -, -, -			

# CON

<u>Click this hyperlink</u> while viewing on your computer to access 22 additional NY\_MANIFEST: record(s) in the EDR Site Report.

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

270 West 1/4-1/2 0.428 mi. 2262 ft.	SPILL NUMBER 0011198 114 UNION AVE NEW ROCHELLE, NY	NY LTANKS S104950549 NY Spills N/A
Relative: Lower Actual: 92 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spiller Name: Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo: Remarks:	2001-01-14 Tank Overfill Institutional, Educational, Gov., Other Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported 6010 jbodee Not reported 2001-01-14 322 Not reported Other Not reported False False False False 0 2001-01-14 2001-01-14 2001-04-24 Not reported ALBINO FUELS Not reported ZZ 001 Not reported 3 128711 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'DEE SEE ONE PAGE UDATE BY V. MCCABE 04/06/2001 NORTHEAST COMPLETED OLEANUP. DISPOSED OF 4 DRUMS OF CONTAMINATION. SPILL INFORMATION FORWARDED TO LAW ENFORCEMENT FOR FURTHER ACTION. SPILLS - NO FURTHER ACTION."
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units:	this time" 151446 832582 01 541520 0001A #2 fuel oil Not reported Petroleum 40.00 Gallons

Database(s)

EDR ID Number EPA ID Number

# S104950549

# SPILL NUMBER 0011198 (Continued)

Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

# Tank Test:

Site ID:	238808
Spill Number/Closed Date:	
Spill Date:	1995-02-02
Spill Cause:	Tank Overfill
Spill Source:	Private Dwelling
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
Spill Class.	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	1995-02-06
Cleanup Ceased. Cleanup Meets Standard:	True
SWIS:	6010
Investigator: Referred To:	tdghiosa
	Not reported
Reported to Dept:	1995-02-02
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	1995-03-31
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller City,St,Zip:	***Update***, ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	196552
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY "
Remarks:	"ESTIMATED WRONG TANK SIZE SPILL CONTAINED NATL.ENVIR.CO. SPILL CREW
	ON WAY ENV PROD. AND SERVICES HIRED TO CLEAN UP. WILL EXCAVATE
	DRYWELL."
Material:	
Site ID:	238808
Operable Unit ID:	1012066
Operable Unit:	01
Material ID:	373228
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	175.00
Units:	Gallons

Database(s)

EDR ID Number EPA ID Number

Recovered: Resource Affected: Oxygenate:	.00 Not reported Not reported
Tank Test:	
SPILLS: Facility ID:	9414511
,	
Facility Type: DER Facility ID:	ER 106552
Site ID:	196552 238809
DEC Region:	3
0	3 1995-02-02
Spill Date: Spill Number/Closed Date:	
Spill Cause:	Human Error
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
Opin Class.	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept:	1995-02-02
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Fire Department
Cleanup Ceased:	1995-02-13
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1995-02-07
Spill Record Last Update:	1995-02-13
Spiller Name:	Not reported
Spiller Company:	REGENT OIL
Spiller Address:	53 CHARLES STREET
Spiller City,St,Zip:	NEW ROCHELLE, ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY "
Remarks:	"SPILLER MAKING DELIVERY FILLED WRONG HOLE FD & CLEAN UP CREW ( SCENE TANK OVERFILL EP & S HIRED BY SPILLER AND ON SCENE CONTAC WCHD WILL RESPOND SEE SPILL #94-14493"
Material:	
Site ID:	238809
Operable Unit ID:	1008085
Operable Unit:	01
Material ID:	373246
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	200.00

Database(s)

EDR ID Number EPA ID Number

#### SPILL NUMBER 0011198 (Continued) S104950549 Units: Gallons .00 Recovered: **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: BI271 NY LTANKS S106869214 **BELIVE HOME 20 PINE STREET** wsw N/A 1/4-1/2 **NEW ROCHELLE, NY** 0.433 mi. 2285 ft. Site 2 of 2 in cluster BI LTANKS: Relative: 339043 Site ID: Lower Spill Number/Closed Date: 0413182 / 2005-05-22 Actual: Spill Date: 2005-03-18 47 ft. Spill Cause: Tank Test Failure Spill Source: Private Dwelling Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: True 6000 SWIS: Investigator: JBODee Referred To: Not reported Reported to Dept: 2005-03-18 CID: 444 Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False UST Involvement: False Remediation Phase: 0 Date Entered In Computer: 2005-03-18 2005-05-22 Spill Record Last Update: Spiller Name: JOE PONSERELLA Spiller Company: PONSERELLA HOME Spiller Address: 20 PINE STREET Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: JOE PONSERELLA Spiller Phone: (914) 760-6684 Spiller Extention: CELL DEC Region: 3 **DER Facility ID:** 285664 DEC Memo: "5/22/05 See spill 05-00819. NFA this number. jod"

#### Material:

Remarks:

Site ID:	339043
Operable Unit ID:	1100961
Operable Unit:	01
Material ID:	581111
Material Code:	0001A
Material Name:	#2 fuel oil

Database(s)

EDR ID Number EPA ID Number

Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	339043
Spill Tank Test:	1548700
Tank Number:	1
Tank Size:	550
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Watchdog
Last Modified: Test Method:	Not reported Horner EZ Check I or II
rest method.	
Site ID:	343902
Spill Number/Closed Date:	
Spill Date:	2005-04-20
Spill Cause:	Tank Failure
Spill Source:	Private Dwelling
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	True
SWIS:	6000
Investigator:	JBODee
Referred To:	Not reported
Reported to Dept: CID:	2005-04-20 444
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2005-04-20
Spill Record Last Update:	2005-05-22
Spiller Name:	JOHN BELIVE
Spiller Company:	BELIVE HOME
Spiller Address:	20 PINE STREET
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	
Spiller Contact:	JOHN BELIVE (914) 252 8440
Spiller Phone: Spiller Extention:	(914) 253-8449 Not reported
DEC Region:	3
DER Facility ID:	285664
DEC Memo:	"05/22/05 PREVIOUSLY REPORTED TTF IS 04-13182. NORTHEAST
	ENVIRONMENTAL DISPOSED OF LUST AND 34.56 TONS OF CONTAMINATED S
	BASED UPON THE CLOSURE INFORMATION SUBMITTED TO DEC, NO FURTHI

#### ntir **4**)

NE

**BELIVE HOME (Continued)** 

Remarks:

# MAP FINDINGS

"550 gallon , found holes and contaminated soil:"

Database(s)

EDR ID Number **EPA ID Number** 

#### Material: Site ID: 343902 Operable Unit ID: 1102568 Operable Unit: 01 Material ID: 582785 Material Code: 0001A Material Name: #2 fuel oil Case No.: Not reported Petroleum Material FA: Quantity: Not reported Units: Gallons .00 Recovered: **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: BJ272 **DEFENDER MARINE SUPPLY** 309 MAIN ST 1/4-1/2 NEW ROCHELLE, NY 0.434 mi. Site 2 of 2 in cluster B I

NY LTANKS S103479285 N/A

0.434 mi. 2292 ft.	Site 2 of 2 in cluster BJ	
Relative:	LTANKS:	
Lower	Site ID:	93459
	Spill Number/Closed Date:	
Actual:	Spill Date:	1998-08-19
25 ft.	Spill Cause:	Tank Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Cleanup Casada	Willing Responsible Party. Corrective action taken.
	Cleanup Ceased: Cleanup Meets Standard:	Not reported True
	SWIS:	6010
	Investigator:	ibodee
	Referred To:	Not reported
	Reported to Dept:	1998-08-19
	CID:	257
	Water Affected:	Not reported
	Spill Notifier:	Other
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	: 1998-08-19
	Spill Record Last Update:	
	Spiller Name:	WILLIAM GOING
	Spiller Company:	DEFENDER MARINE SUPPLY
	Spiller Address:	309 MAIN ST
	Spiller City,St,Zip:	NEW ROCHELLE, NY
	Spiller County:	001
	Spiller Contact:	WILLIAM GOING
	Spiller Phone:	(914) 744-3705 National second
	Spiller Extention:	Not reported

S106869214

	Γ			
Map ID Direction		MAP FINDINGS		
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	DEFENDER MARINE SUPPLY	(Continued)		S103479285
	DEC Region:	3		
	DER Facility ID: DEC Memo:	83786 "Prior to Sept, 2004 data translation this spill Lead_DEC F O'DEE 08/19/98 WCHD NOTIFIED. 09/14/02 - 8 TO 10 Y. STOCKPILED. CLOSURE REPORT TO FOLLOW ONCE 09/19/02 CLOSURE REPORT RECEIVED FROM WILLIA	ARDS OF SOIL SAMPLE RESUL	
	Remarks:	AND 10.45 TONS OF CONTAMINATED SOIL. NFA" "during a tank removal caller found contamined soil"		
	Material:			
	Site ID:	93459		
	Operable Unit ID:	1067422		
	Operable Unit:	01		
	Material ID: Material Code:	317407		
	Material Name:	0001A #2 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	.00		
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
273 NNW 1/4-1/2	DIMATTOE TTF 55 MAY STREET NEW ROCHELLE, NY		NY LTANKS	S113820294 N/A
0.436 mi. 2303 ft.				
Relative:	LTANKS:			
Lower	Site ID:	482303		
A	Spill Number/Closed Date:			
Actual: 79 ft.	Spill Date:	2013-05-23		
7911.	Spill Cause: Spill Source:	Tank Test Failure		
	Spill Class:	Private Dwelling Possible release with minimal potential for fire or hazard o	r Known	
	Opin Class.	release with no damage. DEC Response. Willing Response		
		Corrective action taken.	sibio r arty.	
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator:	TDGHIOSA		
	Referred To:	Not reported		
	Reported to Dept:	2013-05-23		
	CID:	Not reported		
	Water Affected: Spill Notifier:	Not reported Tank Tester		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Demediation Dheese	0		

Remediation Phase:

0

Date Entered In Computer: 2013-05-23 Spill Record Last Update: 2013-08-08

Database(s)

EDR ID Number EPA ID Number

## S113820294

DIMATTOE TTF (Continued)	
Spiller Name: Spiller Company: Spiller Address: Spiller City,St,Zip: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	Not reported DIMATTOE Not reported NY 999 AMELIO DIMATTOE (914) 403-1942 Not reported 3 437556 "5/23/13 left message on homeowner's phone. Spoke to Kathy, at US Tank Tech Tank is 1000 gal. Real estate transaction, and plans are to retest. dw 07/31/13 Northeast Environmental reported that they cut & cleaned the tank and obtained a soil sample from beneath the tank. The soil sample results were below DEC guidance values. NFA. TG "
Remarks:	"repair/retest pending"
Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate:	482303 1232041 01 2230831 0001A #2 fuel oil Not reported Petroleum Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported
Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	482303 2493480 1 1000 21 .70 Not reported jbodee Not reported Horner EZY3/EZY3 Locator Plus

BK274 NNW 1/4-1/2 0.439 mi. 2319 ft.	SPILL NUMBER 0208792 386 NORTH AV NEW ROCHELLE, NY Site 1 of 3 in cluster BK	
Relative: Lower Actual: 75 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause:	71430 0208792 / 2002-11-26 2002-11-25 Tank Overfill

Spill Source:

Tank Truck

NY LTANKS S105997404 N/A

EDR ID Number Database(s) EPA ID Number

SPILL NUMBER 0208792 (Continued)

#### S105997404

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 6010 Investigator: jbodee Referred To: Not reported Reported to Dept: 2002-11-25 CID: 365 Water Affected: Not reported Spill Notifier: **Responsible Party** Not reported Last Inspection: **Recommended Penalty:** False **UST Involvement:** False **Remediation Phase:** 0 Date Entered In Computer: 2002-11-25 Spill Record Last Update: 2002-11-26 ROBERT CRIILLO Spiller Name: Spiller Company: WILCO Spiller Address: 95 PLAIN AV NEWROCHELLE, NY 10801-Spiller City, St, Zip: Spiller County: 001 Spiller Contact: CARTER RESIDENCE Spiller Phone: (914) 632-6577 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 67588 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead DEC Field was O'DEE 11/25/02 SPILL CLEANUP TO BE COMPLETED TOMORROW." Remarks: "take pride environmental enroute to clean up the soil" Material: Site ID: 71430 Operable Unit ID: 861979 Operable Unit: 01 Material ID: 515786 Material Code: 0001A Material Name: #2 fuel oil Case No .: Not reported Material FA: Petroleum 10.00 Quantity: Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate:

Tank Test:

Database(s)

EDR ID Number EPA ID Number

BL275 WNW 1/4-1/2 0.443 mi. 2337 ft.	DEMELIA - TTF 95 WASHINGTON AVE NEW ROCHELLE, NY Site 1 of 2 in cluster BL	NY LTANKS	S117364514 N/A
Relative: Lower Actual: 90 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Cottact: Spiller County: Spiller County: Spiller County: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	2014-10-01 Tank Test Failure Private Dwelling Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 JBODEE Not reported 2014-10-01 Not reported Not reported Tank Tester Not reported False False 0 2014-10-01	

**DEMELIA - TTF (Continued)** 

Material:

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test:	500408 1249816 01 2251444 0001A #2 fuel oil Not reported Petroleum Not reported Not reported Not reported Not reported Not reported Not reported Not reported S00408 2496432		
	Tank Number: Tank Size:	1		
	Tank Size: Test Method:	550 21		
	Leak Rate:	Not reported		
	Gross Fail:	Not reported		
	Modified By:	JBODEE		
	Last Modified: Test Method:	Not reported Horner EZY3/EZY3 Locator Plus		
BM276 West 1/4-1/2 0.444 mi. 2345 ft. Relative:	CANDREA/GALLETTA RESIDE 35 CHARLES ST NEW ROCHELLE, NY Site 1 of 3 in cluster BM LTANKS:		NY LTANKS	S112148789 N/A
West 1/4-1/2 0.444 mi. 2345 ft.	35 CHARLES ST NEW ROCHELLE, NY Site 1 of 3 in cluster BM	465083	nown	

BN277

0.448 mi. 2364 ft.

SW 1/4-1/2 MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

# S112148789

Spill Record Last Update: Spiller Name: Spiller Company:	2012-09-13 Not reported GALETTA
Spiller Company: Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	GALETTA
Spiller Phone:	914-497-9141
Spiller Extention:	Not reported
DEC Region: DER Facility ID:	3 419452
DEC Memo:	"6-7-12 Kathy already notified owner. Spoke with Anthony, owners son-in-law. Told him to forward passing retest to office for spill to be closed. He asked for email to that affect. I sent. jc 6/18/12- US Tank reports that retest failed. Unknown further action. DT 09/13/12 Castlton Environmental reported that they excavated and removed the tank along with 21.04 tons of contaminated soil. Post excavation soil sample results were below DEC guidance values. NFA. TG "
Remarks:	"550 gal ust"
Material:	
Site ID:	465083
Operable Unit ID:	1215116
Operable Unit: Material ID:	01
Material Code:	2213205 0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected: Oxygenate:	Not reported Not reported
Tank Test:	
JASON PARTNERS LTD 675 MAIN ST	NY LTANKS
NEW ROCHELLE, NY	
Site 1 of 2 in cluster BN	

Relative: Lower	LTANKS: Site ID:	86967
	Spill Number/Closed Date:	0211105 / 2003-03-26
Actual:	Spill Date:	2003-02-05
65 ft.	Spill Cause:	Tank Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
		Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard:	True
	SWIS:	6010
	Investigator:	WCHD
	Referred To:	Westchester Cnty Health Dept

S105998096 N/A

BM278

1/4-1/2 0.449 mi. 2369 ft.

**Relative:** 

Lower

Actual:

92 ft.

Spill Date:

Spill Cause:

Spill Source:

Spill Class:

2011-06-22

Tank Test Failure

Private Dwelling

West

**JASON PARTNERS LTD (Continued)** 

2003-02-05

Reported to Dept:

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

S105998096

#### CID: 297 Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported **Recommended Penalty:** False False UST Involvement: **Remediation Phase:** 0 Date Entered In Computer: 2003-02-05 Spill Record Last Update: 2003-04-09 Spiller Name: JAMIE MIZRAHI Spiller Company: JASON PARTNERS LTD Spiller Address: 675 MAIN ST Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: JAMIE MIZRAHI Spiller Phone: (914) 682-6664 Spiller Extention: Not reported DEC Region: 3 **DER Facility ID:** 79721 DEC Memo: "CALLERS COMPANY HIRED TO REMOVE A 3000 GAL INGROUND TANK AT THE Remarks: ABOVE LOCATION, AFTER TANK WAS REMOVED. HOLE WERE FOUND IN TANK AND CONTAMINATED SOIL WAS DISCOVERED - DIRT IS BEING REMOVED AND STORED ON PLASTIC" Material: Site ID: 86967 Operable Unit ID: 862143 Operable Unit: 01 Material ID: 514466 Material Code: 0001A Material Name: #2 fuel oil Not reported Case No .: Petroleum Material FA: Quantity: .00 Units: Gallons Recovered: .00 **Resource Affected:** Not reported Not reported Oxygenate: Tank Test: MERLUCCI RESIDENCE NY LTANKS S111063886 **30 CHARLES STREET** N/A **NEW ROCHELLE, NY** Site 2 of 3 in cluster BM LTANKS: 450778 Site ID: Spill Number/Closed Date: 1103221 / 2011-11-14

Known release with minimal potential for fire or hazard. DEC Response.

Database(s)

EDR ID Number EPA ID Number

# MERLUCCI RESIDENCE (Continued)

S111063886

	Million Deers and the Deets Operative active takes
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	False
SWIS:	6010
Investigator:	jbodee
Referred To:	Not reported
Reported to Dept:	2011-06-22
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	2011-06-22
Spill Record Last Update:	2011-11-14
Spiller Name:	Not reported
Spiller Company:	TANK TEST FAILURE
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller County:	999
Spiller Contact:	MR MERLUCCI
Spiller Phone:	(914) 632-2099
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	405335
DEC Memo:	"6/22/11 UST is 62 years old, according to Ms. Merlucci. House is for
	sale. US Tank Tech has notified Town & Country Oil not evacuate tank
	prior to further action (repair, retest, tank pull) of owner. dw
	11/14/11: UST removed by JM Associates. Report states tank was
	inspected and no corrosion holes were found. Soil samples taken from
	tank grave showed minor amounts of contamination, most below CP-51
	with a few slight exceedences of SVOCs. Excavation was backfilled.
	Report will be entered into eDocs. jod"
Remarks:	"repair retest pending or removal"
•• • • •	
Material:	
Site ID:	450778
Operable Unit ID:	1200979
Operable Unit:	01
Material ID:	2197455
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

BM279 West 1/4-1/2 0.450 mi.	SPILL NUMBER 0007965 45 CHARLES ST NEW ROCHELLE, NY	NY LTANKS	S104782459 N/A
2378 ft.	Site 3 of 3 in cluster BM		
1/4-1/2 0.450 mi.	NEW ROCHELLE, NY Site 3 of 3 in cluster BM LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spiller Company: Spiller Company: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks: Material: Site ID: Operable Unit ID: Operable Unit ID: Operable Unit: Material ID:	2000-10-06 Tank Overfill Private Dwelling Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 jbodee Not reported 2000-10-06 382 Not reported Other Not reported False False False False 0 2000-10-06 2000-11-07 Not reported ALBANO FUEL Not reported ZZ 001 ALBANO FUEL (914) 667-0900 Not reported 3 59724 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'DEE 10/26/2000 TRI-STATE COMPLETED CLEANUP AFTER DEC INSFI INITIAL SPILL BY ALBANO FUEL WAS NEVER REPORTED. NFA" "SPILL OCCURRED DURING FILL. TRI STATE WAS CONTRACTED FOR 61314 830442 01 545482	PECTION.
	Material Code:	0001A	
	Material Name:	#2 fuel oil	
	Case No.: Material FA:	Not reported Petroleum	
	Quantity:	20.00	
	Units:	Gallons	
	Recovered: Resource Affected:	.00 Not reported	
	Oxygenate:	Not reported	

Map ID	ſ	MAP FINDINGS		
Direction Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	SPILL NUMBER 0007965 (Cor	ntinued)		S104782459
	Tank Test:			
280 NE 1/4-1/2 0.452 mi. 2388 ft.	SPILL NUMBER 0104402 30 LINCOLN ST NEW ROCHELLE, NY		NY LTANKS	S105135031 N/A
Relative:	LTANKS: Site ID:	328750		
Lower	Spill Number/Closed Date:			
Actual: 27 ft.	Spill Date: Spill Cause:	2001-07-24 Tank Test Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Possible release with minimal potential for fire or hazard or release with no damage. DEC Response. Willing Responsi		
		Corrective action taken.	Die Faity.	
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard: SWIS:	True 6010		
	Investigator:	jbodee		
	Referred To: Reported to Dept:	Not reported 2001-07-25		
	CID:	205		
	Water Affected:	Not reported		
	Spill Notifier: Last Inspection:	Responsible Party Not reported		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	False 0		
	Date Entered In Computer			
	Spill Record Last Update:			
	Spiller Name: Spiller Company:	OWNER AVALLONE		
	Spiller Address:	30 LINCOLN ST		
	Spiller City,St,Zip: Spiller County:	NEW ROCHELLE, NY 001		
	Spiller Contact:	CALLER		
	Spiller Phone:	Not reported		
	Spiller Extention: DEC Region:	Not reported 3		
	DER Facility ID:	264577		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Fi O'DEE 11/14/2001 G.C. RELIABLE PULLED TANK. NO LE		RGE
	Remarks:	EVIDENT. NO FURTHER ACTION." "failed test"		
	Material:			
	Site ID:	328750		
	Operable Unit ID: Operable Unit:	841036 01		
	Material ID:	532897		
	Material Code: Material Name:	0001A #2 fuel oil		
	Case No.:	#2 fuel oil Not reported		
	Material FA:	Petroleum		

SPILL NUMBER 0104402 (Continued)

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	Quantity: Units: Recovered: Resource Affected: Oxygenate:	.00 Gallons .00 Not reported Not reported		
	Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail: Modified By: Last Modified: Test Method:	328750 1526481 1 550 03 .00 Not reported Spills Not reported Horner EZ Check I or II		
281 ENE 1/4-1/2 0.456 mi. 2409 ft.	NELSTAD MATERIAL CORP 40 HUNTINGTON PL NEW ROCHELLE, NY 10801		NY LTANKS NY Spills NY SPDES	S1021549 N/A
Relative:	LTANKS: Site ID:	200280		
Lower	Spill Number/Closed Date:			
Actual: 13 ft.	Spill Date:	2002-11-27		
1011.	Spill Cause: Spill Source:	Tank Failure Commercial/Industrial		
	Spill Class:	Known release that creates potential for fire or hazard. DI	EC Response.	
	Cleanup Casada	Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased: Cleanup Meets Standard:	Not reported True		
	SWIS:	6010		
	Investigator:	WCHD		
	Referred To: Reported to Dept:	Westchester Cnty Health Dept 2002-11-27		
	CID:	211		
	Water Affected:	Not reported		
	Spill Notifier:	Other Net reported		
	Last Inspection: Recommended Penalty:	Not reported False		
	UST Involvement:	True		
	Remediation Phase:	0		
	Date Entered In Computer: Spill Record Last Update:			
	Spiller Name:	JOHN CAPOSELLA		
	Spiller Company:	NELSTAD CONCRETE		
	Spiller Address: Spiller City,St,Zip:	40 HUNTINGTON PL NEW ROCHELLE, ZZ		
	Spiller County:	001		
	Spiller Contact:	JOHN CAPOSELLA		
	Spiller Phone:	(914) 636-8090		
	Spiller Extention:	Not reported 3		
	DEC Region:	5		

EDR ID Number Database(s) EPA ID Number

NELSTAD MATERIAL CORP (	Continued) S102154943	3
DER Facility ID: DEC Memo:	166657 "Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD - MANCINI 5/11/04: Letter to Nelstadt Materials Corp from Joe Mancini, WCDOH dated 3May2004. Closure report by Ira D Conklin has	
Remarks:	been reviewed. WCDOH recommends NFA at this time." "1000 UST LEAKING - CALLER DOING ABANDONMENT ON TANK AND DISCOVERED WATER IN IT"	I
Material:		
Site ID:	200280	
Operable Unit ID:	862078	
Operable Unit:	01	
Material ID:	515890	
Material Code:	0008	
Material Name:	diesel	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected: Oxygenate:	Not reported Not reported	
Tank Test:		
SPILLS:		
Facility ID:	9400648	
Facility Type:	ER	
DER Facility ID:	126495	
Site ID:	148664	
DEC Region:	3	
Spill Date:	1994-04-14 9400648 / 1994-04-20	
Spill Number/Closed Date: Spill Cause:	9400648 / 1994-04-20 Unknown	
Spill Class:	Possible release with minimal potential for fire or hazard or Known	
	release with no damage. No DEC Response. No corrective action required.	
SWIS:	6010	
Investigator:	tdghiosa	
Referred To:	Not reported	
Reported to Dept:	1994-04-14	
CID:	Not reported	
Water Affected:	L.I. SOUND	
Spill Source:	Unknown	
Spill Notifier:	Federal Government	
Cleanup Ceased:	1994-04-20	
Cleanup Meets Std:	False	
Last Inspection:	Not reported	
Recommended Penalty: UST Trust:	False	
Remediation Phase:	False 0	
Date Entered In Computer:	-	
Spill Record Last Update:	2003-12-02	
Spiller Name:	Not reported	
Spiller Company:	Not reported	
opilier company.		

Database(s)

EDR ID Number EPA ID Number

# NELSTAD MATERIAL CORP (Continued)

NELSTAD MATERIAL CORP (Co	ontinued)		S102154943
Spiller Address:	Not report		
Spiller City,St,Zip:	***Update	***, ZZ	
Spiller Company:	001		
Contact Name:	Not report	ed	
Contact Phone:	Not report	ed	
DEC Memo:	"Prior to S	ept, 2004 data translation this spill Lead_DEC Field was	
	GHIOSAY	и 1	
Remarks:		AKING OIL INTO SOUND COAST GUARD WILL RESPOND PO JTFALL SHEEN PRESENTED BUT NOT RECOVERABLE REC	
Material:			
Site ID:	148664		
Operable Unit ID:	994366		
Operable Unit:	01		
Material ID:	558757		
Material Code:	0066A		
Material Name:	unknown	petroleum	
Case No.:	Not report	ed	
Material FA:	Petroleum		
Quantity:	.00		
Units:	Not report	ed	
Recovered:	.00		
Resource Affected:	Not report	ed	
Oxygenate:	Not report		
SPDES:			
Permit Number:		NYR00D345	
State-Region:		03	
Expiration Date:		03/31/2012	
Current Major Minor Status:		Minor	
Primary Facility SIC Code:		3273	
State Water Body Name:		ECHO BAY	
Limit Set Status Flag:		Active	
Total Actual Average Flow(M	GD):	Not reported	
Total App Design Flow(MGD	):	Not reported	
UDF1:		Not reported	
Lat/Long:		+40.912861 / -73.772611	
DMR Cognizant Official:		Not reported	
UDF2:		Not reported	
UDF3:		Not reported	
FIPS County Code:		NY119	
Non-Gov Permit Affiliation Ty Non-Gov Permit Org Formal		DMR Mailing Address NELSTAD MATERIAL CORP	
Non-Gov Permit Street Addre	ess:	NELSTAD MATERIAL CORP	
Non-Gov Permit Supplement	al Location:	40 HUNTINGTON PL	
Non-Gov Permit City:		NEW ROCHELLE	
Non-Gov Permit State Code:		NY	
Non-Gov Permit Zip Code:		10801	
Non-Gov Facility Affiliation Ty		Owner	
Non-Gov Facility Org Formal		NELSTAD MATERIAL CORP.	
Non-Gov Facility Street Addr		NELSTAD MATERIAL CORP.	
Non-Gov Facility Supplemen	tal Location:	40 HUNTINGTON PL	

Database(s)

EDR ID Number EPA ID Number

GM PROPERTY ASSOC.		NY LTANKS	U003647638 N/A
			11000047000
State Water Body:	Not reported		
Non-Gov Facility Zip Code:	10801		
Non-Gov Facility State Code:	NY		
Non-Gov Facility City:	NEW ROCHELLE		
Non-Gov Facility Supplemental Loca	ation: 40 HUNTINGTON PL		
Non-Gov Facility Street Address:	NELSTAD MATERIAL CORP.		
Non-Gov Facility Org Formal Name:			
Non-Gov Facility Affiliation Type Des	sc. Owner		
Non-Gov Permit Zip Code:	Not reported		
Non-Gov Permit State Code:	Not reported		
Non-Gov Permit City:	Not reported		
Non-Gov Permit Supplemental Loca	•		
Non-Gov Permit Street Address:	Not reported		
Non-Gov Permit Org Formal Name:	Not reported		
Non-Gov Permit Affiliation Type Des	c: Not reported		
FIPS County Code:	NY119		
UDF3:	Not reported		
UDF2:	Not reported		
State Water Body:	Not reported		
Non-Gov Facility Zip Code:	10801		
Non-Gov Facility City: Non-Gov Facility State Code:	NEW ROCHELLE NY		
Non-Gov Facility Supplemental Loca Non-Gov Facility City:	NEW ROCHELLE		
Non-Gov Facility Street Address:	NELSTAD MATERIAL CORP.		
Non-Gov Facility Affiliation Type Des Non-Gov Facility Org Formal Name:			
•			
Non-Gov Permit State Code: Non-Gov Permit Zip Code:	N Y 10801		
Non-Gov Permit City: Non-Gov Permit State Code:	NEW ROCHELLE NY		
Non-Gov Permit Supplemental Loca	•		
Non-Gov Permit Street Address:	40 HUNTINGTON PL		
Non-Gov Permit Org Formal Name:	NELSTAD MATERIAL CORP.		
Non-Gov Permit Affiliation Type Des			
FIPS County Code:	NY119		
UDF3:	Not reported		
UDF2:	Not reported		
State Water Body:	Not reported		
Non-Gov Facility Zip Code:			
Non-Gov Facility State Code:	NY 10801		
Non Cov Facility State Codes			
Non-Gov Facility City:			

#### **NELSTAD MATERIAL CORP (Continued)**

BK282 NNW 1/4-1/2 0.458 mi. 2420 ft.	KGM PROPERTY ASSOC. 394 N. AVE. NEW ROCHELLE, NY Site 2 of 3 in cluster BK	NY LTANKS			
Relative:	LTANKS:				
Lower	Site ID:	69270			
	Spill Number/Closed Date: 9202033 / 1993-01-27				
Actual:	Spill Date:	1992-05-12			
73 ft.	Spill Cause:	Tank Test Failure			
	Spill Source:	Commercial/Industrial			
	Spill Class:	Known release that creates potential for fire or hazard. DEC Response.			

Willing Responsible Party. Corrective action taken.

# S102154943

Database(s)

EDR ID Number EPA ID Number

U003647638

# KGM PROPERTY ASSOC. (Continued) Cleanup Ceased: 1993-01-27

Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name:	6010 WXWADSWO Not reported 1992-05-19 Not reported Not reported Tank Tester Not reported False False 0 1992-05-20 1993-02-09 Not reported
Spiller Company: Spiller Address:	SAME National states and state
Spiller City,St,Zip:	Not reported ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region: DER Facility ID:	3 65872
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
Remarks:	WADSWORTH 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST." "TANK IS 38 YEARS OLD THIS TANK WAS ORIGINAL REPORTED UNDER #9201744 BUT IS LOCATED AT DIFFERENT ADDRESS PETRO-TITE422 GPH"
Material:	
Site ID:	69270
Operable Unit ID:	966124
Operable Unit:	01
Material ID:	557154
Material Code: Material Name:	0001A #2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Not reported
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Table Table	
Tank Test: Site ID:	69270
Spill Tank Test:	1540014
Tank Number:	Not reported
Tank Size:	0
Test Method:	00
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported

Map ID Direction		MAP FINDINGS				
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number		
	KGM PROPERTY ASSOC. (Continued) U003647638					
	Test Method:	Unknown				
BK283 NNW 1/4-1/2 0.460 mi.	KGM REALTY CO. 396 NORTH AVE. NEW ROCHELLE, NY		NY LTANKS	S100493525 N/A		
2428 ft.	Site 3 of 3 in cluster BK					
Relative: Lower Actual: 73 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller City,St,Zip: Spiller Cottact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DEC Region: DEC Memo:	1992-05-12 Tank Test Failure Commercial/Industrial Known release that creates potential for fire or hazard. DEC Willing Responsible Party. Corrective action taken. 1993-01-27 False 6010 WXWADSWO Not reported 1992-05-12 Not reported Not reported Tank Tester Not reported False False 0	eld was ut material			
	Remarks:	"TANK #1 IS 64 YEARS OLD AND TANK #2 IS 38 YEARS NEXT WEEK"		ANK #2		
Material:						
	Site ID:	89642				
	Operable Unit ID:	969160				
	Operable Unit:	01				
	Material ID:	413039				
	Material Code:	0001A				
	Material Name:	#2 fuel oil				
	Case No.	Not reported				
	Material FA:	Petroleum				

Database(s)

EDR ID Number EPA ID Number

KGM REALTY CO. (Continued)		()		S100493525
	Quantity:	.00		
	Units:	Not reported		
	Recovered:	.00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
	Site ID:	89642		
	Spill Tank Test:	1539987		
	Tank Number:	Not reported		
	Tank Size:	0		
	Test Method:	00		
	Leak Rate:	.00		
	Gross Fail:	Not reported		
	Modified By:	Spills		
	Last Modified:	Not reported		
	Test Method:	Unknown		
BO284			NY LTANKS	S103482965
NNW 1/4-1/2 0.461 mi.	381 NORTH AVE NEW ROCHELLE, NY		NY Spills	N/A
2433 ft.	Site 1 of 2 in cluster BO			
Relative:	LTANKS:			
Lower	Site ID:	242546		
	Spill Number/Closed Date:			
Actual: 73 ft.	Spill Date:	2004-04-27		
73 11.	Spill Cause:	Tank Failure		
	Spill Source:	Gasoline Station or other PBS Facility		
	Spill Class:	Known release that creates potential for fire or hazard.	DEC Response.	
	Cleanup Casaadi	Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased: Cleanup Meets Standard:	Not reported False		
	SWIS:	6010		
	Investigator:	WCHD		
	Referred To:	WESTCHESTER CNTY HEALTH D		
	Reported to Dept:	2004-04-27		
	CID:	444		
	Water Affected:	Not reported		
	Spill Notifier:	Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer			
	Spill Record Last Update:			
	Spiller Name:	STEVEN PHELTS		
	Spiller Company:			
	Spiller Address:			
	Spiller City,St,Zip:	NEW ROCHELLE, NY 001		
	Spiller County:	STEVEN PHELTS		
	Spiller Contact: Spiller Phone:	(518) 786-3200		
	Spiller Extention:	Not reported		
	DEC Region:	3		
		-		

EDR ID Number EPA ID Number

# Database(s)

GETTY# 677 (Continued)		S1034
DER Facility ID:	199318	
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD-SCHNEIDER 1/18/2005 close and handle under existing spill	
Remarks:	9003146 " "FOUND CONTAMINATED SOIL WHILE REMOVING TANK: "	
Material:		
Site ID:	242546	
Operable Unit ID:	882894	
Operable Unit:	01	
Material ID:	555170	
Material Code:	0066A	
Material Name:	unknown petroleum	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units: Recovered:	Gallons .00	
Recovered. Resource Affected:	Not reported	
Oxygenate:	Not reported	
exygenate.		
Tank Test:		
SPILLS:		
Facility ID:	1012947	
Facility Type:	ER	
DER Facility ID:	401849	
Site ID:	447247	
DEC Region:	3	
Spill Date:	2011-03-29	
Spill Number/Closed Date:		
Spill Cause:	Housekeeping	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
SWIS:	6038	
Investigator:	JYMCCART	
Referred To:	Not reported	
Reported to Dept:	2011-03-29	
CID: Water Affected:	Not reported	
Spill Source:	Not reported Gasoline Station or other PBS Facility	
Spill Notifier:	Responsible Party	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	False	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	False	
Remediation Phase:	0	
Date Entered In Computer		
Spill Record Last Update: Spiller Name:	2011-03-31 MIKE CARR	
Spiller Company:	GETTY 677	
Spiller Address:	381 NORTH AVE	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	999	

EDR ID Number Database(s) EPA ID Number

# S103482965

GETTY# 677 (Continued) S				
	Contact Name:	MIKE CARR		
	Contact Phone:	(518) 786-4945		
	DEC Memo:	"3-29-11 Called and left message for Mike to return call to dispatch		
		desk. jm 3-31-11 Spoke with Mike. Spill was as stated and cleanup		
	Remarks:	completed. jm" "contained to bay floor, clean up"		
		contained to bay hoor, clean up		
Ν	laterial:			
	Site ID:	447247		
	Operable Unit ID:	1197384		
	Operable Unit: Material ID:	01 2193703		
	Material Code:	0022		
	Material Name:	waste oil/used oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	.50		
	Units:	Not reported		
	Recovered:	Not reported		
	Resource Affected:	Not reported Not reported		
	Oxygenate:	not reported		
Т	ank Test:			
	Facility ID:	1005811		
	Facility Type:	ER		
	DER Facility ID:	199318		
	Site ID:	439142		
	DEC Region:	3		
	Spill Date: Spill Number/Closed Date:	2010-08-25 1005811 / 2010-08-25		
	Spill Cause:	Housekeeping		
	Spill Class:	Possible release with minimal potential for fire or hazard or Known		
		release with no damage. DEC Response. Willing Responsible Party.		
		Corrective action taken.		
	SWIS:	6010		
	Investigator:	MBMASTRO		
	Referred To:	Not reported		
	Reported to Dept: CID:	2010-08-25 Not reported		
	Water Affected:	Not reported Not reported		
	Spill Source:	Gasoline Station or other PBS Facility		
	Spill Notifier:	Other		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Std:	False		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Trust: Remediation Phase:	False 0		
	Date Entered In Computer:	0 2010-08-25		
	Spill Record Last Update:	2010-08-25		
	Spiller Name:	MIKE CARR		
	Spiller Company:	GETTY		
	Spiller Address:	381 NORTH AVE		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller Company:	999		

EDR ID Number Database(s) EPA ID Number

<b>GETTY# 677</b>	(Continued)

S103482965

GETTY# 677 (Continued)	
Contact Name: Contact Phone: DEC Memo: Remarks:	MIKE CARR (518) 369-7822 "8/25/10 Confirmed clean up with caller, nfamm" "Caller stated they had spilt waste oil on concrete, Are has been
	cleaned up."
Material:	
Site ID:	439142
Operable Unit ID:	1189791
Operable Unit:	01
Material ID:	2184749
Material Code:	0022
Material Name:	waste oil/used oil
Case No.: Material FA:	Not reported Petroleum
Quantity:	.50
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	1001015
Facility Type: DER Facility ID:	ER 199318
Site ID:	433723
DEC Region:	3
Spill Date:	2010-04-27
Spill Number/Closed Date:	1001015 / 2010-04-27
Spill Cause:	Housekeeping
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.
SWIS:	6010 Laborare
Investigator: Referred To:	kabrowne Not roported
Reported to Dept:	Not reported 2010-04-27
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	
Last Inspection: Recommended Penalty:	2010-04-27 False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2010-04-27
Spill Record Last Update:	2010-05-10
Spiller Name:	CARRIE WILSEY
Spiller Company:	GETTY 677
Spiller Address:	
Spiller City,St,Zip: Spiller Company:	NEW ROCHELLE, NY 999
Contact Name:	CARRIE WILSEY
Contact Phone:	(518) 786-3200

EDR ID Number Database(s) EPA ID Number

GETTY# 677 (Continued)		S103482965
DEC Memo:	"4/27/10 - Spill cleaned up. NFA. KAB 5/10/10: Update from Denise	
	Heinzinger of WCDOH who inspected: #1001015 small spill onto concrete at 381 North Ave, New Rochelle, clean up performed jod"	
Remarks:	"1 pint onto concrete. Clean up complete"	
Material:		
Site ID:	433723	
Operable Unit ID:	1184583	
Operable Unit:	01	
Material ID:	2178854	
Material Code:	0022	
Material Name:	waste oil/used oil	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Facility ID:	0912229	
Facility Type:	ER	
DER Facility ID:	199318	
Site ID: DEC Region:	425106 3	
Spill Date:	2010-02-23	
Spill Number/Closed Date:	0912229 / 2010-02-23	
Spill Cause:	Housekeeping	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	MBMASTRO	
Referred To:	Not reported	
Reported to Dept: CID:	2010-02-23 Not reported	
Water Affected:	Not reported	
Spill Source:	Gasoline Station or other PBS Facility	
Spill Notifier:	Other	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	2010-02-23	
Recommended Penalty:	False	
UST Trust:	False	
Remediation Phase:	0	
Date Entered In Computer:	2010-02-23	
Spill Record Last Update:	2010-03-30	
Spiller Name:	MIKE CARR	
Spiller Company:	GETTY # 677	
Spiller Address:	381 NORTH AVE	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	999 MIKE CARR	
Contact Name:	MIKE CARR	
Contact Phone:	(518) 369-7822 "2/22/10 confirmed clean up, nfa, mm"	
DEC Memo:	"2/23/10 confirmed clean up, nfamm"	

EDR ID Number Database(s) EPA ID Number

Remarks:	"HALF GALLON OF WASTE OIL TO CONCRETE CLEAN UP WAS DONE."
Material:	
Site ID:	425106
Operable Unit ID:	1180837
Operable Unit:	01
Material ID:	2174836
Material Code:	0022
Material Name:	waste oil/used oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Gallons
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	0900607
Facility Type:	ER
DER Facility ID:	199318
Site ID:	412555
DEC Region:	3
Spill Date:	2009-04-16
Spill Number/Closed Date:	0900607 / 2009-04-16
Spill Cause:	Housekeeping
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
014/10	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	RXAMATO
Referred To:	Not reported
Reported to Dept:	2009-04-16
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2009-04-16
Spill Record Last Update:	2009-04-16
Spiller Name:	CARRIE WILSEY
Spiller Company:	GETTY # 677
Spiller Address:	381 NORTH AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	999
Contact Name:	CARRIE WILSEY
Contact Name:	
DEC Memo:	(518) 369-7822
	"4/17/09: Vac truck pumped out dispenser sumpclose/nfara"
Remarks:	"DUE TO POOR HOUSEKEEPING A HALF GALLON OF PRODUCT WAS SPILLE

Database(s)

EDR ID Number **EPA ID Number** 

S103482965

#### GETTY# 677 (Continued)

Material: Site ID: 412555 Operable Unit ID: 1169019 Operable Unit: 01 Material ID: 2160665 Material Code: 0022 Material Name: waste oil/used oil Case No.: Not reported Material FA: Petroleum Quantity: .50 Units: Gallons Recovered: .50 Resource Affected: Not reported Not reported Oxygenate:

#### Tank Test:

Click this hyperlink while viewing on your computer to access additional NY\_SPILL: detail in the EDR Site Report.

BN285 SW 1/4-1/2 0.461 mi.	6 WEBSTER 6 WEBSTER AVE NEW ROCHELLE, NY	NY LTANKS	S1064720 N/A
2435 ft.	Site 2 of 2 in cluster BN		
Relative: Lower Actual: 60 ft.	LTANKS: Site ID: Spill Number/Closed Date: Spill Date: Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Reforted to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer:	2004-07-09 Tank Test Failure Non Major Facility > 1,100 gal Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 WCHD WESTCHESTER CNTY HEALTH D 2004-07-09 403 Not reported Tank Tester Not reported False False 0 2004-07-09	
		· ·	

2061

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

	6 WEBSTER (Continued)	S106472061
	Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	Not reported 3 75517 "10/08/04 TANK PASSED A RETEST AFTER PIPING WAS REPAIRED. SPILL CLOSED BY DANIELLE JACKSON OF THE WESTCHESTER COUNTY HEALTH DEPT. NFA
	Remarks:	REQUIRED AT THIS TIME. jbo " "tank test failed.uncover the tank isolate,and retest"
	Material: Site ID: Operable Unit ID: Operable Unit ID: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test: Site ID: Spill Tank Test: Tank Number: Tank Size: Test Method: Leak Rate: Gross Fail:	81655 886220 01 491374 0001A #2 fuel oil Not reported Petroleum .00 Not reported .00 Not reported Not reported Not reported Not reported Not reported S1655 1529427 1 3000 03 .00
	Modified By: Last Modified: Test Method:	Spills Not reported Horner EZ Check I or II
BL286 WNW 1/4-1/2 0.462 mi. 2438 ft.	BRAM REALTY 105 WASHINGTON AVE NEW ROCHELLE, NY Site 2 of 2 in cluster BL	NY LTANKS S109583709 N/A
2438 π. Relative: Lower Actual: 85 ft.	Site 2 of 2 in cluster BL LTANKS: Site ID: Spill Number/Closed Date: Spill Cause: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	414506 0902464 / 2010-02-01 2009-06-01 Tank Test Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported True 6010 TDGHIOSA Not reported 2009-06-01 Not reported

287

SSW

1/4-1/2

0.462 mi. 2440 ft.

**Relative:** 

Lower

Actual:

46 ft.

Spill Date:

Spill Cause:

Spill Source:

2001-10-11

Tank Test Failure

Private Dwelling

MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

#### **BRAM REALTY (Continued)**

S109583709 Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False **UST Involvement:** False **Remediation Phase:** 0 Date Entered In Computer: 2009-06-01 Spill Record Last Update: 2010-02-01 Spiller Name: HAL SHAPIRO Spiller Company: **BRAM REALTY** Spiller Address: 105 WASHINGTON AVE Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 999 Spiller Contact: KATHY MORGAN (845) 225-5240 Spiller Phone: Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 363644 DEC Memo: "6-1-09: V.Mc.^ Hal/BRAM REALTY: Left Mess: Req.Callbk. to dispt &/or J.O'Dee. 6-3-09: HAL SHAPIRO CALLED AND STATED IS WAS AWARE OF PROPER PROCEDURES TO FOLLOW. HE WILL CONTACT HIS OIL CO. FOR DIRECTION AND NOTIFY DEC OF OUTCOME. 01/25/10 Enviroshield reported that they excavated and removed one 550 gallon tank. No petroleum contaminated soil was obseved in the tank excavation. NFA TG " "TANK TEST FAILURE ON A 550 GALLON UST UNK IF ANY PRODUCT WAS Remarks: SPILLED." Material: Site ID: 414506 Operable Unit ID: 1170891 Operable Unit: 01 Material ID: 2162674 Material Code: 0001A #2 fuel oil Material Name: Case No .: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: Not reported Not reported **Resource Affected:** Oxygenate: Not reported Tank Test: S105230245 RESIDENCE NY LTANKS **98 LIBERTY AVE** N/A **NEW ROCHELLE, NY** LTANKS: Site ID: 204562 Spill Number/Closed Date: 0107187 / 2002-01-11

Database(s)

EDR ID Number EPA ID Number

#### **RESIDENCE** (Contin ч)

RESIDENCE (Continued)	S105230245
Spill Class:	Known release that creates potential for fire or hazard. (Highly Improbable)
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	
SWIS:	6010
Investigator:	jbodee
Referred To:	Not reported
Reported to Dept:	2001-10-11
CID:	252
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	2002-03-22
Spiller Name:	REALTOR
Spiller Company:	MR GAMIANO
Spiller Address:	98 LIBERTY AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
Spiller Contact:	CAROL MASCOLINO-REALTOR
Spiller Phone:	(914) 576-1112
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID: DEC Memo:	170048 "Driar to Sont, 2004 data translation this shill Load, DEC Field was
DEC Memo.	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was O'DEE 01/11/2002 ADVANCED PULLED TANK AND 99.6 TONS OF CONTAMINATED
Remarks:	SOIL. NO FURTHER ACTION." "PETROLEUM ODOR AND STAINING IN THE SOIL-RECOMMEND TANK REMOVAL"
Remains.	
Material:	
Site ID:	204562
Operable Unit ID:	844253
Operable Unit:	01
Material ID:	532018
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	204562
Spill Tank Test:	1526660
Tank Number:	Not reported
Tank Size:	1000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
2	

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

	<b>RESIDENCE</b> (Continued)		S105230245
	Last Modified: Test Method:	Not reported Horner EZ Check I or II	
288 WSW 1/4-1/2 0.465 mi. 2457 ft.	BUSINESS COMPLEX 55 WEBSTER AVE NEW ROCHELLE, NY	NY LTANKS	S104516367 N/A
Relative:	LTANKS:		
Lower	Site ID: Spill Number/Closed Date:	86196 9912136 / 2000-05-11	
Actual: 54 ft.	Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID:	2000-01-19 Tank Failure Commercial/Industrial Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Not reported False 6010 JKOMARA Not reported 2000-01-20 282	
	Water Affected: Spill Notifier:	Not reported Other	
	Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Company: Spiller Address: Spiller Cottact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	Not reported False False 0 2000-01-20	e _ON TANK L INTO THE
	Site ID:	86196	
	Operable Unit ID: Operable Unit:	1086666 01	

Database(s)

EDR ID Number EPA ID Number

### **BUSINESS COMPLEX (Continued)**

Material ID:	294030
Material Code:	0064A
Material Name:	unknown material
Case No.:	Not reported
Material FA:	Other
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Oxygenate:	Not reported

Tank Test:

289 SW 1/4-1/2 0.466 mi. 2458 ft.	SPILL NUMBER 0012427 22 LAUREL PL NEW ROCHELLE, NY		NY LTANKS	S104950616 N/A
Relative:	LTANKS:			
Lower	Site ID:	104510		
Lower	Spill Number/Closed Date:			
Actual:	Spill Date:	2001-02-20		
75 ft.	Spill Cause:	Tank Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Known release with minimal potential for fire or hazard. DEC I	20000000	
	Spill Class.	•	Response.	
	Cleanup Casada	Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased: Cleanup Meets Standard:	Not reported True		
	SWIS:	6010		
	Investigator:	jbodee Not reported		
	Referred To:	Not reported		
	Reported to Dept:	2001-02-20		
	CID:	382		
	Water Affected:	Not reported		
	Spill Notifier:	Other		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement:	False		
	Remediation Phase:	0		
	Date Entered In Computer:			
	Spill Record Last Update:			
	Spiller Name:	LOUIS MEAD		
	Spiller Company:	Not reported		
	Spiller Address:	22 LAUREL PL		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller County:	001		
	Spiller Contact:	LOUIS MEAD		
	Spiller Phone:	(914) 662-3557		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	92327		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field		
		O'DEE 02/20/2001 TANK OUT OF USE FOR 20 YEARS. PIN CONTAMINATION FOUND. 05/10/2001 ELITE ENVIRONME TANK AND COMPLETED CLEANUP; NO FURTHER ACTION	NTAL AND NES	
		HARAME COM LETED CLEANOL, NOT ONTHER ACTION	۰.	

EDR ID Number EPA ID Number

	SPILL NUMBER 0012427 (Continued)		S104950616	
	Remarks:	"small amount of contamination found while pulling a 1000 gal	tank. "	
	Material:			
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered:	104510 833963 01 542696 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00		
	Resource Affected:	Not reported		
	Oxygenate:	Not reported		
	Tank Test:			
290 SSW 1/4-1/2 0.467 mi. 2466 ft.	LIPMAN RESIDENCE 54 LIBERTY AVE NEW ROCHELLE, NY		— NY LTANKS	S106971579 N/A
Relative:	LTANKS:			
Lower	Site ID: Spill Number/Closed Date:	333699 0409061 / 2005-04-02		
Actual:	Spill Date:	2004-11-16		
48 ft.	Spill Cause: Spill Cause: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Cotact: Spiller Contact: Spiller Contact: Spiller Phone: Spiller Extention:	Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. DEC R Willing Responsible Party. Corrective action taken. Not reported True 6010 JBODee Not reported 2004-11-16 444 Not reported Tank Tester Not reported False False 0 : 2004-11-16	esponse.	

#### 16

Database(s)

Map ID		MAP FINDINGS		
Direction	ų_			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	LIPMAN RESIDENCE (Continu	ied)		S106971579
	DEC Region: DER Facility ID: DEC Memo:	3 268950 "02/18/04 ZURICH CLAIM BEING HANDLED BY LEW AMOUNT OF CONTAMINATION UNDER PUBLIC SID REMOVED SAFELY. DEC SPOKE WITH LEWIS (BO REQUIREMENTS. REPORT TO FOLLOW. jod 04/02/ DISPOSED OF LUST AND 82.08 TONS OF CONTAM CLOSURE INFORMATION SUBMITTED TO DEC, NO	DEWALK/ROADWAY C B KRAUSE) ABOUT S 05 LEWIS ENVIRONM /INATED SOIL. BASEE	CANNOT BE AMPLING ENTAL D UPON THE
	Remarks:	AT THIS TIME. jod" "SOILTEST CAME BACK OVER THE LIMIT:"		
	Material:			
	Tank Test:			
291 NNE 1/4-1/2 0.468 mi. 2470 ft.	SPILL NUMBER 0300463 52 LINCOLN ST NEW ROCHELLE, NY		NY LTANKS NY Spills	S105998684 N/A
Relative:	LTANKS:	000505		
Lower	Site ID: Spill Number/Closed Date:			
Actual: 27 ft.	Spill Date: Spill Cause:	2003-04-14 Tank Overfill		
	Spill Source: Spill Class:	Commercial/Industrial Known release with minimal potential for fire or hazard	J. DEC Response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported	•	
	Cleanup Meets Standard:	True		
	SWIS: Investigator:	6010 jghardy		
	Referred To:	Not reported		
	Reported to Dept: CID:	2003-04-14 281		
	Water Affected:	Not reported		
	Spill Notifier:	Responsible Party		
	Last Inspection: Recommended Penalty:	Not reported False		
	UST Involvement:	False		
	Remediation Phase: Date Entered In Computer:	0 2003-04-14		
	Spill Record Last Update:	2003-04-22		
	Spiller Name: Spiller Company:	CALLER ROBISON OIL		
	Spiller Address:	500 EXECUTIVE BLVD		
	Spiller City,St,Zip:	ELMSFORD, NY 10523-		
	Spiller County: Spiller Contact:	001 ED ALLAN		
	Spiller Phone:	(914) 345-5700		
	Spiller Extention: DEC Region:	Not reported 3		
	DER Facility ID:	168519		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DE HARDY "	C Field was	

EDR ID Number Database(s) EPA ID Number

#### SPILL NUMBER 0300463 (Continued)

"Above material reported spilled at above location due to tank overfill. Crew is on site and cleanup is in progress at time of call. All material is expected to be recovered."

#### Material:

Remarks:

Material:	
Site ID:	202585
Operable Unit ID:	868761
Operable Unit:	01
Material ID:	508540
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	10.00
Units:	
	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Talik Test.	
SPILLS:	
Facility ID:	0806544
Facility Type:	ER
DER Facility ID:	168519
Site ID:	403827
DEC Region:	3
Spill Date:	2008-09-10
Spill Number/Closed Date:	0806544 / 2008-12-26
Spill Cause:	Equipment Failure
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	TDGHIOSA
Referred To:	Not reported
Reported to Dept:	2008-09-11
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	
	0
Date Entered In Computer	
Spill Record Last Update:	2008-12-26
Spiller Name:	LOUIS VACCARO
Spiller Company:	
Spiller Address:	52 LINCOLN ST
Spiller City, St, Zip:	NEW ROCHELLE, NY
Spiller Company:	999
Contact Name:	LOUIS VACCARO
Contact Phone:	(914) 235-8284

BP292

1/4-1/2

2485 ft.

West

MAP FINDINGS

EDR ID Number Database(s) **EPA ID Number** 

#### SPILL NUMBER 0300463 (Continued) DEC Memo: "11/16/08 New England Tank Services reported that they removed one 550 gallon tank along with 7.09 tons of petroleum contaminated soil. NFA TG' "Callers company was removing a 550 gallon tank and found it had Remarks: holes in it. Unknown how much fuel had been leaking or for how long. Clean up will start within the next few days." Material: 403827 Site ID: **Operable Unit ID:** 1160514 Operable Unit: 01 Material ID: 2151689 Material Code: 0001A Material Name: #2 fuel oil Case No .: Not reported Material FA: Petroleum Quantity: Not reported Units: Not reported Recovered: Not reported **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: BUSINESS NY LTANKS S101341432 88 GROVE AVE. N/A **NEW ROCHELLE, NY** 0.471 mi. Site 1 of 2 in cluster BP LTANKS:

**Relative:** 172950 Lower Site ID: Spill Number/Closed Date: 9411669 / 2010-04-28 Actual: Spill Date: 1994-12-01 91 ft. Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1994-12-01 CID: Not reported Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported **Recommended Penalty:** False UST Involvement: False **Remediation Phase:** 0 Date Entered In Computer: 2003-12-02 Spill Record Last Update: 2010-04-28 Spiller Name: Not reported Spiller Company: MR. OGMAN Spiller Address: 88 GROVE AVE. Spiller City, St, Zip: NEW ROCHELLE, ZZ

#### S105998684

#### Map ID Direction Distance Elevation Site

#### MAP FINDINGS

Database(s)

EDR ID Number **EPA ID Number** 

BUSINESS (Continued)			S101341432
Spiller County:	001		
Spiller Contact:	Not reported		
Spiller Phone:	Not reported		
Spiller Extention:	Not reported		
DEC Region:	3		
DER Facility ID:	145542		
DEC Memo:	"4/28/10 16 year old TTF No further info NFA JO'M "		
Remarks:	"WILL EXPLORE IT NEXT"		
Material:			
Site ID:	172950		
Operable Unit ID:	1005375		
Operable Unit:	01		
Material ID:	374006		
Material Code:	0066A		
Material Name:	unknown petroleum		
Case No.:	Not reported		
Material FA:	Petroleum		
Quantity:	.00		
Units:	Not reported		
Recovered:	.00		
Resource Affected:	Not reported		
Oxygenate:	Not reported		
Tank Test:			
Site ID:	172950		
Spill Tank Test:	1543408		
Tank Number:	Not reported		
Tank Size:	0		
Test Method:	00		
Leak Rate:	.00		
Gross Fail:	Not reported		
Modified By:	Spills		
Last Modified:	Not reported		
Test Method:	Unknown		
		NY LTANKS	S104276178
8-90 GROVE AVE.			N/A
NEW ROCHELLE, NY			
Site 2 of 2 in cluster BP			

#### 432

Lower Actual:

91 ft.

Relative:

BP293

West 1/4-1/2 0.471 mi. 2485 ft.

> LTANKS: Site ID: 113133 Spill Number/Closed Date: 9411598 / 2010-04-28 Spill Date: 1994-11-29 Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 6010 Investigator: tdghiosa Referred To: Not reported Reported to Dept: 1994-11-30

Database(s)

EDR ID Number EPA ID Number

#### COMMERCIAL BUILDING (Continued)

	· ·	,
	CID:	Not reported
	Water Affected:	Not reported
	Spill Notifier:	Tank Tester
	Last Inspection:	Not reported
	•	•
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer:	2003-12-02
	Spill Record Last Update:	2010-04-28
	Spiller Name:	Not reported
		•
	Spiller Company:	Not reported
	Spiller Address:	Not reported
	Spiller City,St,Zip:	***Update***, ZZ
	Spiller County:	001
	Spiller Contact:	Not reported
	Spiller Phone:	Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	98741
	DEC Memo:	"4/28/10 16 year old TTF NFA JO'M"
	Remarks:	"TANK TEST FAILURE PETRO-TITE II VISUAL"
Ν.	aterial:	
IVI		110100
	Site ID:	113133
	Operable Unit ID:	1005335
	Operable Unit:	01
	Material ID:	373942
	Material Code:	0001A
	Material Name:	#2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	.00
	Units:	Not reported
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported
	20	
Τa	ank Test:	
	Site ID:	113133
	Spill Tank Test:	1543402
	Tank Number:	Not reported
	Tank Size:	0
	Test Method:	00
	Leak Rate:	.00
	Gross Fail:	Not reported
	Modified By:	Spills
	Last Modified:	Not reported
	Test Method:	Unknown

MAP FINDINGS

EDR ID Number Database(s) EPA ID Number

294 West 1/4-1/2 0.475 mi. 2506 ft.	FRANKA INC. 132-143 UNION AVE. NEW ROCHELLE, NY	NY LTANKS S104276153 N/A
Relative: Lower	LTANKS: Site ID:	176106
LOWEI	Spill Number/Closed Date	
Actual: 90 ft.	Spill Date: Spill Cause:	1994-01-17 Tank Failure
	Spill Source:	Commercial/Industrial
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
		Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	1995-11-09 Tous
	Cleanup Meets Standard: SWIS:	True 6010
	Investigator:	tdghiosa
	Referred To:	Not reported
	Reported to Dept:	1994-01-17
	CID:	Not reported
	Water Affected: Spill Notifier:	Not reported Other
	Last Inspection:	1995-11-08
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer	
	Spill Record Last Update: Spiller Name:	1995-11-27 Not reported
	Spiller Company:	REGENT OIL CO.
	Spiller Address:	53 CHARLES STREET
	Spiller City,St,Zip:	NEW ROCHELLE, NY 10801-
	Spiller County:	001
	Spiller Contact: Spiller Phone:	Not reported Not reported
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID:	148008
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was GHIOSAY 11/08/95 FINAL INSPECTION PERFORMED TRENCH IS OIL FREE SUMP PIT IS OIL FREE BASEMENT IS FREE OF PETROLEUM NO OIL STAIN ON
	Demerker	
	Remarks:	"1K TANK UNDERGROUND POSSIBLE LEAK CLEAN UP CREW ENROUTE"
	Material:	
	Site ID:	176106
	Operable Unit ID:	994225
	Operable Unit:	01
	Material ID:	391197
	Material Code:	0001A
	Material Name: Case No.:	#2 fuel oil Not reported
	Material FA:	Not reported Petroleum
	Quantity:	50.00
	Units:	Gallons
	Recovered:	.00
	Resource Affected:	Not reported
	Oxygenate:	Not reported

Map ID		MAP FINDINGS	1	
Direction	L_			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
				0404070450
	FRANKA INC. (Continued)			S104276153
	Tank Test:			
295 SW	AMOCO SERVICE STATION #7 690 MAIN ST	736	NY LTANKS NY Spills	1001128018 NYR000036855
1/4-1/2	NEW ROCHELLE, NY 10801		RCRA NonGen / NLR NY MANIFEST	
0.476 mi. 2513 ft.			NY MANIFEST	
Relative:	LTANKS:			
Lower	Site ID: Spill Number/Closed Date:	274754 0209490 / 2002-12-16		
Actual:	Spill Date:	2002-12-16		
64 ft.	Spill Cause:	Tank Overfill		
	Spill Source:	Gasoline Station or other PBS Facility	rd DEC Baapanaa	
	Spill Class:	Known release with minimal potential for fire or haza Willing Responsible Party. Corrective action taken.	Id. DEC Response.	
	Cleanup Ceased:	Not reported		
	•	False		
	SWIS: Investigator:	6010 WCHD		
	Referred To:	Westchester Cnty Health Dept		
	Reported to Dept:	2002-12-16		
	CID: Water Affected:	246 Not reported		
	Spill Notifier:	Not reported Fire Department		
	Last Inspection:	Not reported		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	True 0		
	Date Entered In Computer:	2002-12-16		
	Spill Record Last Update:	2002-12-19		
	Spiller Name: Spiller Company:	UNKNOWN Unknown		
	Spiller Address:	UNKNOWN		
	Spiller City,St,Zip:	UNKNOWN, NY		
	Spiller County: Spiller Contact:	999 DAVE BERRY		
	Spiller Phone:	(914) 231-1905		
	Spiller Extention:	Not reported		
	DEC Region: DER Facility ID:	3 223479		
	DEC Memo:	""		
	Remarks:	"Tanker overfilled tank and material spilled at location		
		gal went into storm drain and sewer. Fire dept on sce dry applied"	ene now speedy	
	Material:	074754		
	Site ID: Operable Unit ID:	274754 862563		
	Operable Unit:	01		
	Material ID:	512914		
	Material Code: Material Name:	0009 gasoline		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	25.00		

Database(s)

EDR ID Number EPA ID Number

1001128018

### AMOCO SERVICE STATION #736 (Continued)

Units:	Gallons
Recovered:	15.00
Resource Affected:	Not reported
Oxygenate:	Not reported

#### Tank Test:

Site ID:	274755
Spill Number/Closed Date:	0212950 / 2003-04-01
Spill Date:	2003-03-31
Spill Cause:	Tank Overfill
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2003-03-31
CID:	211
Water Affected:	Not reported
Spill Notifier:	Fire Department
Last Inspection:	Not reported
Recommended Penalty:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	-
Spill Record Last Update:	
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	
Spiller City,St,Zip:	Not reported ZZ -
Spiller County:	001
Spiller Contact:	WESTCHESTER CO 911
Spiller Phone:	(914) 231-1904
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	223479
DEC Memo:	
Remarks:	"PRODUCT DID ENTER CONTAINMENT AREA - NO CLEAN UP"
Material:	
Site ID:	274755
Operable Unit ID:	863771
Operable Unit:	01
Material ID:	512669
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	30.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
	·····

EDR ID Number Database(s) EPA ID Number

#### AMOCO SERVICE STATION #736 (Continued)

Oxygenate:

Not reported

Tank Test:

Site ID:	074767
Site ID:	274757
Spill Number/Closed Date:	
Spill Date:	1986-10-08
Spill Cause:	Tank Test Failure
Spill Source:	Gasoline Station or other PBS Facility
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	1987-01-14
Cleanup Meets Standard:	True
SWIS:	6010
Investigator:	PATEL
Referred To:	Not reported
Reported to Dept:	1986-10-09
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Tank Tester
Last Inspection:	1987-01-14
Recommended Penalty:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	1998-03-20
Spiller Name:	
•	Not reported AMOCO
Spiller Company:	SAME
Spiller Address:	
Spiller City,St,Zip:	ZZ
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	223479
DEC Memo:	11
Remarks:	"TTTF"
Material:	
Site ID:	274757
Operable Unit ID:	901332
Operable Unit:	01
Material ID:	477220
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Pounds
Recovered:	.00
Resource Affected:	
	Not reported Not reported
Oxygenate:	not reported

Database(s)

EDR ID Number EPA ID Number

1001128018

~			1001120010
	Tank Test:		
	Site ID:	274757	
	Spill Tank Test:	1530280	
	Tank Number:		
	Tank Number. Tank Size:	Not reported	
		0	
	Test Method:	00	
	Leak Rate:	.00	
	Gross Fail:	Not reported	
	Modified By:	Spills	
	Last Modified:	Not reported	
	Test Method:	Unknown	
	SPILLS:		
	Facility ID:	0305414	
	Facility Type:	ER	
	DER Facility ID:	223479	
	Site ID:	274756	
	DEC Region:	3	
	Spill Date:	2003-08-21	
	Spill Number/Closed Date:	0305414 / 2003-10-29	
	Spill Cause:	Equipment Failure	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
		Willing Responsible Party. Corrective action taken.	
	SWIS:	6010	
	Investigator:	WCHD	
	Referred To:	Westchester Cnty Health Dept	
	Reported to Dept:	2003-08-21	
	CID:	257	
	Water Affected:	Not reported	
	Spill Source:	Gasoline Station or other PBS Facility	
	Spill Notifier:	Local Agency	
	Cleanup Ceased:	Not reported	
	Cleanup Meets Std:	True	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Trust:	True	
	Remediation Phase:	0	
	Date Entered In Computer		
	Spill Record Last Update:	2003-10-29	
	Spiller Name:	Not reported	
	Spiller Company:	USA PETRO	
	Spiller Address:	690 MAIN ST	
	Spiller City, St, Zip:	NEW ROCHELLE, NY	
	Spiller Company:	001	
	Contact Name:		
	Contact Phone:	(914) 813-5165	
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	DEC Mento.	WCHD - BADOLATO 10/29/03 CLOSED BY WCHD - CLEAN UP COMPL	
		9/12/03"	
	Remarks:	"leaking valve on a pump - pbs #3-183660 - pump taken out of service"	
	Material:	074750	
	Site ID:	274756	
	Operable Unit ID:	873709	
	Operable Unit:	01	
	Material ID:	502669	

### AMOCO SERVICE STATION #736 (Continued)

TC4738280.2s Page 673

Database(s)

EDR ID Number EPA ID Number

Motorial Code:	0000	
Material Code:	0009	
Material Name:	gasoline	
Case No.:	Not reported	
Material FA:	Petroleum 2.00	
Quantity: Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
exygenate:		
Tank Test:		
Facility ID:	0002007	
Facility Type:	ER	
DER Facility ID:	223479	
Site ID:	274753	
DEC Region:	3	
Spill Date:	2000-05-17	
Spill Number/Closed Date:	0002007 / 2000-05-17	
Spill Cause:	Equipment Failure	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	WCHD	
Referred To:	Westchester Cnty Health Dept	
Reported to Dept:	2000-05-17	
CID:	257	
Water Affected:	Not reported	
Spill Source:	Gasoline Station or other PBS Facility	
Spill Notifier:	Other	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	True	
Remediation Phase:	0	
Date Entered In Computer:	2000-05-17	
Spill Record Last Update:	2000-07-17	
Spiller Name:	ALFRED	
Spiller Company:	AM0CO STATION 736	
Spiller Address:	690 MAIN ST	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	001	
Contact Name:	ALFRED	
Contact Phone:	(914) 632-8617	
DEC Memo:	"" "	
Remarks:	"maintance crew on the way for cleanup and repairs"	
Material:		
Site ID:	274753	
Operable Unit ID:	823636	
Operable Unit:	01	
Material ID:	550387	
Material Code:	0009	
Material Name:	gasoline	

Database(s)

EDR ID Number EPA ID Number

MOCO SERVICE STATION #736	(Continued) 1001128	8018
Material FA:	Petroleum	
Quantity:	1.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Facility ID:	9806161	
Facility Type:	ER	
DER Facility ID:	223479	
Site ID:	274759	
DEC Region:	3	
Spill Date:	1998-08-18	
Spill Number/Closed Date:	9806161 / 2005-02-14	
Spill Cause:	Equipment Failure	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	WCHD	
Referred To:	WESTCHESTER CNTY HEALTH D	
Reported to Dept:	1998-08-18	
CID:	211	
Water Affected:	Not reported	
Spill Source:	Gasoline Station or other PBS Facility	
Spill Notifier:	Other	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	False	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	True	
Remediation Phase:	0	
Date Entered In Computer:	1998-08-18	
Spill Record Last Update:	2005-02-14	
Spiller Name:	ERIC LISMANIS	
Spiller Company:		
Spiller Address:	690 MAIN ST	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	001 ERIC LISMANIS	
Contact Name:	ERIC LISMANIS	
Contact Phone: DEC Memo:	(914) 273-2626 "2/14/05 HANDLE AS PART OF 9613029CLSOE"	
Remarks:	"PUMP MALFUNCTION FOR UNDERGROUND STORAGE TANK / NO CLEAN UF	<b>)</b> "
Material: Site ID:	27/750	
Site ID: Operable Unit ID:	274759 1067358	
Operable Unit:	01	
Material ID:	317336	
Material Code:	0009	
Material Name:	gasoline	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
ormo.	Guilono	

#### AMOCO SERVICE STATION #736 (Continued)

TC4738280.2s Page 675

Database(s)

EDR ID Number EPA ID Number

1001128018

Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

Facility ID:	9613029
Facility Type:	ER
DER Facility ID:	223479
Site ID:	274758
DEC Region:	3
Spill Date:	1997-01-29
Spill Number/Closed Date:	9613029 / 2013-04-26
Spill Cause:	Unknown
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
	Willing Responsible Party. Corrective action taken.
SWIS:	6010
Investigator:	mxtipple
Referred To:	Not reported
Reported to Dept:	1997-02-04
CID:	312
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Other
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1997-02-04
Spill Record Last Update:	2013-04-26
Spiller Name:	Not reported
Spiller Company:	AMOCO
Spiller Address:	690 MAIN ST
Spiller City, St.Zip:	NEW ROCHELLE, NY
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
220	HARDY ALSO SEE SPILL 91-11342. 02/07/97 AS PART OF AN ONGOING
	REMEDIATION THEY FOUND NEWER PRODUCT INFLUENCING THEIR CLEAN UP.
	04/24/97 LETTER & STIPULATION AGREEMENT SENT TO BE SIGNED. 12/10/97
	COPY OF SIGNED STIPULATION SENT BACK 08/11/98 LETTER SENT; IMMEDIATE
	ACTION TOWARD AUTOMATED PRODUCT REMOVAL AND GROUNDWATER CONTROL AT
	SITE IS REQUIRED. 12/07/00 LETTER SENT TO DELTA ENVIRONMENTAL BY J.
	HARDY; PROPOSE A REMEDIAL ACTION PLAN WHICH IS SUBSTANTIALLY MORE
	AGRESSIVE THAN THE ONE EXISTING AT THIS TIME. 01/11/01 LETTER SENT TO
	DELTA ENV. BY J. HARDY; CONCEPTUAL REMEDIAL ACTION PLAN OF 12/13/00
	IS APPROVED & REQUIRED. 4/23/04: Letter to Aaron Lapine, Delta Env.
	Consultants by J. Hardy. Submit one report per year. Include
	operating data and GW monitoring data in same report. 8/9/04: Letter
	to A. Lapine, Delta Env. from J Hardy. Reduce monitor well sampling
	to semi-annual. Report annually. 6/15/09 annual submitted 6/9/09
	shows relatively stable groundwater levels but no info as to system
	operationsent email to envirotrac to submit operation info jh

EDR ID Number Database(s) EPA ID Number

AMOCO SERVICE STATION #736	(Continued)	1001128018
	4/20/10 site in remediation as system has been operating for many years. Original impacts to adjoining restaurant have also been resolved for years so it seems spill is contained; spill cannot be closed however as there is still significant contamination jh 07/02/12 Contaminated soils on the station have been excavated down to bedrock. 4 gw wells remain, 1 on-site upgradient, 2 off-site downgradient , 1 in the tank field. After review of the documentation and a phone conversation, consultant will submit a quarterly groundwater monitoring plan for the next year, after which time the monitoring frequency may be adjusted based on results. It appears the source has been removed. mt 4/26/13 Spill Closed, asymptptic conditions approaching gw standards in final well. no further action required. mt "	
Remarks:	"THEY HAVE A 1991 SPILL NUMBER, BUT THIS APPEARS TO BE A FF UNK IF SAME"	CON SPILL
Material:		
Site ID:	274758	
Operable Unit ID:	1040708	
Operable Unit:	01	
Material ID: Material Code:	2096843 1213A	
Material Name:	MTBE (methyl-tert-butyl ether)	
Case No.:	01634044	
Material FA:	Hazardous Material	
Quantity:	Not reported	
Units:	Not reported	
Recovered:	Not reported	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Site ID:	274758	
Operable Unit ID:	1040708	
Operable Unit:	01	
Material ID: Material Code:	341679 0009	
Material Name:	gasoline	
Case No.:	Not reported	
Material FA:	Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
	0040000	
Facility ID: Facility Type:	9313209 ER	
DER Facility ID:	101511	
Site ID:	116685	
DEC Region:	3	
Spill Date:	1994-02-07	
Spill Number/Closed Date:	9313209 / 1994-02-28	
Spill Cause:	Equipment Failure	
Spill Class:	Possible release with minimal potential for fire or hazard or Known	
	release with no damage. DEC Response. Willing Responsible Party.	

Database(s)

EDR ID Number EPA ID Number

#### ... AMO

1001128018

MOCO SERVICE STATION #736	(Continued)
	Corrective action taken.
SWIS:	6010
Investigator:	tdghiosa
Referred To:	Not reported
Reported to Dept:	1994-02-07
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	Responsible Party
Cleanup Ceased:	1994-02-28
Cleanup Meets Std:	False
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	True
Remediation Phase:	0
Date Entered In Computer:	1994-02-28
Spill Record Last Update:	1994-06-03
Spiller Name:	Not reported
Spiller Company:	SAME
Spiller Address:	Not reported
Spiller City,St,Zip:	ZZ
Spiller Company:	001
Contact Name:	Not reported
Contact Phone:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
	GHIOSAY 06/03/94: NO DEC RESPONSE. "
Remarks:	"ICE IN FILL BOX SORBENTS USED TO CLEAN UP"
Material:	
Site ID:	116685
Operable Unit ID:	995095
Operable Unit:	01
Material ID:	388600
Material Code:	0009
Material Name:	
Case No.:	gasoline Not reported
Material FA:	Petroleum
Quantity:	15.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Oxygenate.	Not reported
Tank Test:	
Click this hy	perlink while viewing on your computer to access
	Y_SPILL: detail in the EDR Site Report.
RCRA NonGen / NLR:	04/04/0007
Date form received by agency:	
Facility name:	AMOCO SERVICE STATION #736
Facility address:	690 MAIN ST
	NEW ROCHELLE, NY 10801

EPA ID: Mailing address: NYR000036855 OLD POST RD BALTEZ ASSOCIATES INC

Database(s)

EDR ID Number EPA ID Number

#### AMOCO SERVICE STATION #736 (Continued) 1001128018 BEDFORD, NY 10506 Contact: Not reported OLD POST RD Contact address: BEDFORD, NY 10506 Contact country: US Contact telephone: Not reported Not reported Contact email: EPA Region: 02 Classification: Non-Generator Description: Handler: Non-Generators do not presently generate hazardous waste Owner/Operator Summary: AMOCO CORP Owner/operator name: 300 INTERPACE PKWY MORRIS CORP Owner/operator address: PARSIPPANY, NJ 07054 Owner/operator country: US Owner/operator telephone: (201) 331-7000 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported Owner/operator name: AMOCO CORP 300 INTERPACE PKWY MORRIS CORP Owner/operator address: PARSIPPANY, NJ 07054 Owner/operator country: US Owner/operator telephone: (201) 331-7000 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported Handler Activities Summary: U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No Historical Generators: Date form received by agency: 01/01/2006 AMOCO SERVICE STATION #736 Site name: Classification: Not a generator, verified Date form received by agency: 07/14/1999 AMOCO SERVICE STATION #736 Site name:

Database(s)

EDR ID Number EPA ID Number

#### AMOCO SERVICE STATION #736 (Continued)

WOCO SERVICE STATION #750	(continueu)
Classification:	Small Quantity Generator
Date form received by agency Site name: Classification:	:03/21/1997 AMOCO SERVICE STATION #736 Large Quantity Generator
. Waste code: . Waste name:	D001 IGNITABLE WASTE
Violation Status:	No violations found
NY MANIFEST: Country: EPA ID: Facility Status: Location Address 1: Code: Location Address 2: Total Tanks: Location City: Location State: Location Zip: Location Zip 4:	USA NYR000036855 Not reported 690 MAIN ST BP Not reported Not reported NEW ROCHELLE NY 10801 Not reported
NY MANIFEST: EPAID: Mailing Name: Mailing Contact: Mailing Address 1: Mailing Address 2: Mailing City: Mailing City: Mailing State: Mailing Zip: Mailing Zip 4: Mailing Country: Mailing Phone:	NYR000036855 AMOCO SERVICE STATION #736 JONATHAN LANDAU 130 BUSINESS PARK DR Not reported ARMONK NY 10504 Not reported USA 9142349580
NY MANIFEST: Document ID: Manifest Status: seq: Year: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID 1: TSDF ID 1: TSDF ID 2: Manifest Tracking Number: Import Indicator: Export Indicator:	NYG0063774 Not reported 01 1998 Not reported 04/27/1998 04/27/1998 Not reported 05/07/1998 Not reported 05/07/1998 Not reported Not reported NYR000036855 NJD986607380 Not reported GAD093380814 Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported Not reported

#### 1001128018

Map ID Direction Distance Elevation Site MAP FINDINGS

Database(s) E

EDR ID Number EPA ID Number

**Discr Quantity Indicator:** Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported Discr Partial Reject Indicator: Not reported **Discr Full Reject Indicator:** Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00110 G - Gallons (liquids only)\* (8.3 pounds) Units: Number of Containers: 002 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Waste Code: Not reported Quantity: 00150 Units: G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 003 Container Type: DM - Metal drums, barrels Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 01.00 Document ID: CTF0396117 Manifest Status: С Not reported seq: Year: 1997 Trans1 State ID: 7069A Trans2 State ID: Not reported 04/24/1997 Generator Ship Date: Trans1 Recv Date: 04/24/1997 Trans2 Recv Date: 11 TSD Site Recv Date: 04/25/1997 Part A Recv Date: 05/21/1997 Part B Recv Date: 05/15/1997 Generator EPA ID: NYR000036855 Trans1 EPA ID: CTD983883745 Trans2 EPA ID: Not reported TSDF ID 1: CTD021816889 TSDF ID 2: Not reported Manifest Tracking Number: Not reported Import Indicator: Not reported Export Indicator: Not reported Discr Quantity Indicator: Not reported Discr Type Indicator: Not reported Discr Residue Indicator: Not reported **Discr Partial Reject Indicator:** Not reported

#### 1001128018

Map ID	
Direction	
Distance	
Elevation	Site

Database(s)

EDR ID Number **EPA ID Number** 

#### AMOCO SERVICE STATION #736 (Continued)

Discr Full Reject Indicator: Not reported Manifest Ref Number: Not reported Alt Facility RCRA ID: Not reported Alt Facility Sign Date: Not reported MGMT Method Type Code: Not reported Waste Code: D001 - NON-LISTED IGNITABLE WASTES Waste Code: Not reported Quantity: 00619 G - Gallons (liquids only)\* (8.3 pounds) Number of Containers: 001 Container Type: TT - Cargo tank, tank trucks Handling Method: B Incineration, heat recovery, burning. Specific Gravity: 100

#### 296 **MUNCIPAL MARINA** 22 PELHAM RD East 1/4-1/2 **NEW ROCHELLE, NY** 0.477 mi.

Units:

# 2519 ft. **Relative:**

Lower Actual: 14 ft.

LTANKS: Site ID: 142427 Spill Number/Closed Date: 9108518 / 1993-02-23 Spill Date: 1991-11-08 Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. Cleanup Ceased: 1993-02-23 Cleanup Meets Standard: False SWIS: 6010 Investigator: WXWADSWO Referred To: Not reported Reported to Dept: 1991-11-08 CID: Not reported Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported Recommended Penalty: False UST Involvement: False **Remediation Phase:** 0 Date Entered In Computer: 1991-11-12 Spill Record Last Update: 1993-04-02 Spiller Name: Not reported Spiller Company: SAME Spiller Address: Not reported Spiller City, St, Zip: ΖZ Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 **DER Facility ID:** 121561

1001128018

S100346597 NY LTANKS NY Spills N/A

EDR ID Number Database(s) EPA ID Number

#### MUN

IUNCIPAL MARINA (Continued) S		
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WADSWORTH 09/27/95: This is additional information about material spilled from the translation of the old spill file: TANK TEST."	
Remarks:	"EXCAVATE AND INVESTIGATE"	
Material:		
Site ID:	142427	
Operable Unit ID:	962556	
Operable Unit:	01	
Material ID:	420665	
Material Code:	0066A	
Material Name:	unknown petroleum	
Case No.: Material FA:	Not reported Petroleum	
Quantity:	.00	
Units:	Not reported	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Site ID:	142427	
Spill Tank Test:	1539285	
Tank Number:	Not reported	
Tank Size:	0	
Test Method: Leak Rate:	00 .00	
Gross Fail:	Not reported	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Unknown	
Site ID:	303089	
Spill Number/Closed Date:	0401082 / 2004-06-16	
Spill Date:	2004-04-29	
Spill Cause:	Tank Failure	
Spill Source:	Non Major Facility > 1,100 gal	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
Cleanup Ceased:	Not reported	
Cleanup Meets Standard:	True	
SWIS:	6010	
Investigator:	WCHD	
Referred To:	Westchester Cnty Health Dept	
Reported to Dept: CID:	2004-04-30	
Water Affected:	403 Not reported	
Spill Notifier:	Tank Tester	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Involvement:	True	
Remediation Phase:	0	
Date Entered In Computer:	2004-04-30	
Spill Record Last Update:	2004-06-16	
Spiller Name:	SAL	

Database(s)

EDR ID Number EPA ID Number

MUNCIPAL MARINA (Continue	ed) \$100346597
Spiller Company:	MUNCIPAL MARINA
Spiller Address:	22 PELHAM RD
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller County:	001
	SAL
Spiller Contact:	
Spiller Phone:	(914) 235-6930
Spiller Extention:	Not reported
DEC Region:	3
DER Facility ID:	244879
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was WCHD-JACKSON 06/16/04 TANK PASSED A RETEST ON 5-25-04. FILE CLOSED BY
Remarks:	CINDY BADOLATO OF THE WESTCHESTER COUNTY HEALTH DEPT. jbo" "failed vaccumm test. thinks that water is getting into the tank through a bad line."
Material:	
Site ID:	303089
Operable Unit ID:	882977
Operable Unit:	01
Material ID:	492310
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Site ID:	303089
Spill Tank Test:	1529230
Tank Number:	4
Tank Size:	2000
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II
Site ID:	303090
Spill Number/Closed Date:	0406232 / 2006-12-19
Spill Date:	2004-09-07
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Known release that creates potential for fire or hazard. DEC Response.
·	Willing Responsible Party. Corrective action taken.
Cleanup Ceased:	Not reported
Cleanup Meets Standard:	•
SWIS:	6010
Investigator:	JBODee
Referred To:	WCDOH
Reported to Dept:	2004-09-07
	2004-03-07

Database(s)

EDR ID Number EPA ID Number

	CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller Company: Spiller Cotact: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo: Remarks:	
м	aterial:	
	Site ID:	303090
	Operable Unit ID:	888853
	Operable Unit:	01
	Material ID:	487246
	Material Code:	0009
	Material Name:	gasoline
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	.00
	Units:	Not reported
	Recovered:	.00

#### **MUNCIPAL MARINA (Continued)**

S100346597

Tank Test:

Resource Affected:

Oxygenate: Site ID: Operable Unit ID:

Material ID:

Case No.: Material FA:

Quantity:

Recovered:

Oxygenate:

Resource Affected:

Units:

. Operable Unit:

Material Code:

Material Name:

SPILLS: Facility ID:

1206713

Not reported Not reported 303090

888853

487247

gasoline Not reported

Petroleum

Not reported

Not reported

Gallons

0009

.00

.00

01

Database(s)

EDR ID Number EPA ID Number

#### **MUNCIPAL MARINA (Continued)**

S100346597

UNCIPAL MARINA (Continued	)
Facility Type:	ER
DER Facility ID:	121561
Site ID:	469721
DEC Region:	3
Spill Date:	2012-10-07
Spill Number/Closed Date:	1206713 / 2012-10-09
Spill Cause:	Unknown
Spill Class:	Known release with minimal potential for fire or hazard. No DEC
	Response. No corrective action required.
SWIS:	6010
Investigator:	MBMASTRO
Referred To:	Not reported
Reported to Dept:	2012-10-07
CID:	Not reported
Water Affected:	LONG ISLAND SOUND
Spill Source:	Unknown
Spill Notifier:	Police Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	Not reported False
Recommended Penalty: UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2012-10-07
Spill Record Last Update:	2012-10-07
Spiller Name:	ROBERT BENZD
Spiller Company:	UNKOWN
Spiller Address:	22 PLEM RD
Spiller City,St,Zip:	NEW ROSHELL, NY
Spiller Company:	999
Contact Name:	ROBERT BENZD
Contact Phone:	(914) 654-2392
DEC Memo:	"10/9/12 The harbor police responded along with the FD. Could not
	locate a source. The sheen is too light for the boom to be effective,
	not continuous and is in and out of the docks. WCDOH did a site
	inspection and sheen is gone. NFAmm"
Remarks:	"oil sheen on 1/4 mile area in the sound - clean up pending"
Material:	
Site ID:	469721
Operable Unit ID:	1219615
Operable Unit:	01
Material ID:	2218144
Material Code:	0008
Material Name:	diesel
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	0401610

Database(s)

EDR ID Number EPA ID Number

# \$10034650

MUNCIPAL MARINA (Continued)
-----------------------------

MUNCIPAL MARINA (Continued)		S100346597
Facility Type:	ER	
DER Facility ID:	121561	
Site ID:	142424	
DEC Region:	3	
Spill Date:	2004-05-14	
Spill Number/Closed Date:	0401610 / 2004-05-17	
Spill Cause:	Equipment Failure	
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.	
	Willing Responsible Party. Corrective action taken.	
SWIS:	6010	
Investigator:	WCHD	
Referred To:	Westchester Cnty Health Dept	
Reported to Dept:	2004-05-14	
CID:	444	
Water Affected:	Not reported	
Spill Source:	Institutional, Educational, Gov., Other	
Spill Notifier:	Other	
Cleanup Ceased:	Not reported	
Cleanup Meets Std:	True	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Trust:	False	
Remediation Phase:	0	
Date Entered In Computer:	2004-05-14	
Spill Record Last Update:	2004-05-18	
Spiller Name:	PETER DEGRASIO	
Spiller Company:	NEW ROCHELLE MARINA	
Spiller Address:	22 PELHAM ROAD	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller Company:	001	
Contact Name:	PETER DEGRASIO	
Contact Phone:	(516) 369-2888	
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was	
	WCHD-BADOLATO ALSO SEE SPILL 04-01618. CLOSED BY WESTCH	ESTER COUNTY
	HEALTH DEPARTMENT. jbo"	
Remarks:	"DEPT. OF HEALTH WAS ON SCENE: LITTLE GAS GAS ON TOP OF TA	ANK, ALL
	CLEANED UP: "	
Material:		
	140404	
Site ID:	142424	
Operable Unit ID:	883460	
Operable Unit:	01 492808	
Material ID:		
Material Code:	0009	
Material Name: Case No.:	gasoline Not reported	
Material FA:	Not reported	
	Petroleum	
Quantity: Units:	.00 Gallons	
	.00	
Recovered: Resource Affected:	Not reported	
Oxygenate:	Not reported	
Tank Test:		
Facility ID:	0401618	

Database(s)

EDR ID Number **EPA ID Number** 

### S100346597

**MUNCIPAL MARINA (Continued)** Facility Type: ER **DER Facility ID:** 121561 142425 Site ID: DEC Region: 3 Spill Date: 2004-05-14 Spill Number/Closed Date: 0401618 / 2004-05-17 Spill Cause: Unknown Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken. SWIS: 6010 WCHD Investigator: Referred To: Westchester Cnty Health Dept Reported to Dept: 2004-05-14 CID: 403 Water Affected: Not reported Spill Source: Unknown Spill Notifier: Other **Cleanup Ceased:** Not reported Cleanup Meets Std: True Not reported Last Inspection: **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2004-05-14 Spill Record Last Update: 2004-05-18 CINDY Spiller Name: Spiller Company: NEW ROCHELLE MARINA Spiller Address: 22 PELHAM ROAD Spiller City, St, Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: CINDY Contact Phone: (914) 813-5165 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead DEC Field was WCHD-BADOLATO ALSO REPORTED AS SPILL 04-01610. CLOSED BY WESTCHESTER COUNTY HEALTH DEPARTMENT. jbo" "no further action required" Remarks: Material: Site ID: 142425 **Operable Unit ID:** 883469 Operable Unit: 01 Material ID: 492814 Material Code: 0001A Material Name: #2 fuel oil Not reported Case No .: Material FA: Petroleum 15.00 Quantity: Units: Gallons .00 Recovered: **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: Facility ID: 0304781 Facility Type: ER

Database(s)

EDR ID Number EPA ID Number

# **MUNCIPAL MARINA (Continued)**

S100346597

	)
DER Facility ID:	244879
Site ID:	303087
DEC Region:	3
Spill Date:	2003-08-05
Spill Number/Closed Date:	0304781 / 2003-08-05
Spill Cause:	Other
Spill Class:	Known release with minimal potential for fire or hazard. No DEC
Spill Class.	•
014/10	Response. No corrective action required.
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2003-08-05
CID:	205
Water Affected:	LONG ISLAND SOUND
Spill Source:	Vessel
Spill Notifier:	Police Department
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-08-05
Spill Record Last Update:	2003-08-07
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City,St,Zip:	NY
Spiller Company:	999
Contact Name:	
	CALLER
Contact Phone:	Not reported
DEC Memo:	
Remarks:	"vessell sank from heavy rain. boomb in place. fire dept on scene."
Material:	
Site ID:	303087
Operable Unit ID:	871599
Operable Unit:	01
Material ID:	505633
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Tank Test:	
Facility ID:	0304788
Facility ID:	0304788 ER
Facility Type:	
DER Facility ID:	244879
Site ID:	303088
DEC Region:	3

Database(s)

EDR ID Number EPA ID Number

# MUNCIPAL MARINA (Continued)

S100346597

Spill Date: Spill Number/Closed Date: Spill Cause:	2003-08-02 0304788 / 2003-08-06 Unknown
Spill Class:	Known release with minimal potential for fire or hazard. No DEC Response. No corrective action required.
SWIS:	6010
Investigator:	WCHD
Referred To:	Westchester Cnty Health Dept
Reported to Dept:	2003-08-06
CID:	
Water Affected:	LONG ISLAND SOUND
Spill Source: Spill Notifier:	Unknown
Cleanup Ceased:	Local Agency Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2003-08-06
Spill Record Last Update:	2003-08-07
Spiller Name:	Not reported
Spiller Company:	UNKNOWN
Spiller Address:	Not reported
Spiller City, St, Zip:	NY
Spiller Company:	999
Contact Name:	CINDY BADOLATO
Contact Phone:	(914) 813-5165
DEC Memo:	
Remarks:	"sheen was found in marina"
Material:	
Site ID:	303088
Operable Unit ID:	873184
Operable Unit:	01
Material ID:	505641
Material Code:	0009
Material Name:	gasoline
Case No.:	Not reported
Material FA:	Petroleum
Quantity: Units:	15.00 Gallons
Recovered:	15.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Chygonato.	

Tank Test:

<u>Click this hyperlink</u> while viewing on your computer to access additional NY\_SPILL: detail in the EDR Site Report.

Database(s)

EDR ID Number EPA ID Number

297	OAKHURST GARDENS OWNE	De	NY LTANKS	S100964766
ESE	100 PELHAM ROAD	r3	NT LIANKS	N/A
1/4-1/2	NEW ROCHELLE, NY			-
0.480 mi.				
2535 ft.				
Relative:	LTANKS:			
Lower	Site ID:	268980		
Actual:	Spill Number/Closed Date: Spill Date:	1989-11-10		
16 ft.	Spill Cause:	Tank Failure		
	Spill Source:	Institutional, Educational, Gov., Other		
	Spill Class:	Known release that creates potential for fire or hazard. DEC F	Response.	
		Willing Responsible Party. Corrective action taken.		
	Cleanup Ceased:	Not reported		
	Cleanup Meets Standard:	True		
	SWIS: Investigator:	6010 tdebioso		
	Referred To:	tdghiosa Not reported		
	Reported to Dept:	1989-11-10		
	CID:	Not reported		
	Water Affected:	Not reported		
	Spill Notifier:	Other		
	Last Inspection:	1990-03-07		
	Recommended Penalty:	False		
	UST Involvement: Remediation Phase:	False 0		
	Date Entered In Computer:	-		
	Spill Record Last Update:			
	Spiller Name:	Not reported		
	Spiller Company:	OAKHUSRT GARDENS OWNERS		
	Spiller Address:	100 PELHAM ROAD		
	Spiller City,St,Zip:	NEW ROCHELLE, NY		
	Spiller County: Spiller Contact:	001 Not reported		
	Spiller Phone:	Not reported		
	Spiller Extention:	Not reported		
	DEC Region:	3		
	DER Facility ID:	219083		
	DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field		
		GHIOSAY 05/08/91: CLEANUP COMPLETED BUT SOIL REI COOP HAS NO MONEY TO DISPOSE OF SOIL PROPERLY		BECAUSE
	Remarks:	"JOE MACELLARO (EES) ON SCENE. #6 FO IS BUBBLING		
	Remarks.	TANK. JOE RESPONDED TO THIS CALL AT 1100 PM. THE		
		BUT FUEL IS STILL BUBBLING OUT. WCHD IS RESPONDI		
	Material:			
	Site ID:	268980		
	Operable Unit ID:	932878		
	Operable Unit:	01		
	Material ID: Material Code:	444717 0003A		
	Material Name:	#6 fuel oil		
	Case No.:	Not reported		
	Material FA:	Petroleum		
	Quantity:	7000.00		
	Units:	Gallons		
	Recovered:	.00		
	Resource Affected:	Not reported		

Database(s)

EDR ID Number EPA ID Number

	OAKHURST GARDENS OWNE	RS (Continued)	S100964766
	Oxygenate:	Not reported	
	Tank Test:		
BO298 NNW 1/4-1/2 0.480 mi. 2537 ft.	DIPASQUALE PROPERTY 400 NORTH AVE NEW ROCHELLE, NY Site 2 of 2 in cluster BO	NY LTANKS	S111063882 N/A
Relative:	LTANKS:		
Lower	Site ID:	450672	
Actual:	Spill Number/Closed Date: Spill Date:	2011-06-20	
70 ft.	Spill Cause:	Tank Test Failure	
	Spill Source: Spill Class:	Commercial/Industrial Known release that creates potential for fire or hazard. DEC Response.	
		Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased: Cleanup Meets Standard:	Not reported True	
	SWIS:	6010	
	Investigator: Referred To:	jbodee Net reported	
	Reported to Dept:	Not reported 2011-06-20	
	CID:	Not reported	
	Water Affected: Spill Notifier:	Not reported Tank Tester	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement: Remediation Phase:	False 0	
	Date Entered In Computer:		
	Spill Record Last Update:		
	Spiller Name: Spiller Company:	MR CHARLIE DIPASQUALE NDR GROUP	
	Spiller Address:	400 NORTH AVE	
	Spiller City,St,Zip: Spiller County:	NEW ROCHELLE, NY 999	
	Spiller Contact:	MR DIPASQUALE	
	Spiller Phone:	(914) 633-7092	
	Spiller Extention: DEC Region:	Not reported 3	
	DER Facility ID:	404310	
	DEC Memo:	"6/20/11: This spill initially reported as a residential TTF. Property is actually a commercial office building with apartments on	
		the second floor. Previous Spill number for this site is 1102214	
		which was reported on May 27th. Owner informed US Tank Tech of the	
		prior Phase I site investigation, but apparently did not inform them of the Phase II which found high levels of contamination. US Tank	
		Tech reports they were hired to test the in-service 550 gallon	
		heating oil tank, and perform a site investigation to locate a	
		second, out-of-service tank. The 550 failed the vaccuum test, petroleum odors evident in the well point. US Tank Tech also reports	
		they believe the second out-of-service tank may be located under the	
		office building. Owner states the second tank is a 275 gallon heating	
		oil, but that can not be confirmed at this time. US Tank Tech also	

Database(s)

EDR ID Number **EPA ID Number** 

# **DIPASQUALE PROPERTY (Continued)**

reports there are at least two additional sets of fill and vent pipes, for other out-of-service or abandoned USTs. Tester also noted petroleum odors from the basement sump pit. jod 6/21/11: US Tank Tech reported that the owner says he hired Northeast Environmental to address these two spills issues. Message sent to Northeast asking for confirmation. jod 9/29/11: Northeast reports the owner has hired them to begin investigation and remediation. jod 10/21/11: The UST has been removed by Northeast and contaminated soil is evident. Remediation work is being scheduled. jod 4/26/2012: Closure report from Northeast Environmental entered into eDocs. Based upon information provided, no further action required at this time. jod" "repair/retest pending"

Remarks:

#### Material:

Site ID: Operable Unit ID: Operable Unit:	450672 1200876 01
Material ID:	2197327
Material Code:	0001A
Material Name:	#2 fuel oil
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	Not reported
Units:	Not reported
Recovered:	Not reported
Resource Affected:	Not reported
Oxygenate:	Not reported

Tank Test:

BQ299 SSW 1/4-1/2 0.481 mi. 2538 ft.	SPILL NUMBER 9803423 106 LIBERTY AV NEW ROCHELLE, NY Site 1 of 2 in cluster BQ	NY LTANKS	S104619561 N/A
2550 n.			
Relative: Lower	LTANKS: Site ID: Spill Number/Closed Date:	140786 9803423 / 1998-08-18	
Actual:	Spill Date:	1998-06-17	
45 ft.	Spill Cause:	Tank Failure	
	Spill Source:	Private Dwelling	
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.	
	Cleanup Ceased:	Not reported	
	Cleanup Meets Standard:	True	
	SWIS:	6010	
	Investigator:	tdghiosa	
	Referred To:	Not reported	
	Reported to Dept:	1998-06-17	
	CID:	365	
	Water Affected:	Not reported	
	Spill Notifier:	Other	
	Last Inspection:	Not reported	
	Recommended Penalty:	False	
	UST Involvement:	False	

# S111063882

BQ300

1/4-1/2

0.486 mi. 2566 ft.

**Relative:** 

Lower

Actual:

Reported to Dept:

1998-10-26

44 ft.

SSW

SPILL NUMBER 9803423 (Continued)

Date Entered In Computer: 1998-06-17 Spill Record Last Update: 1998-10-02

0

Remediation Phase:

# MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

#### Spiller Name: MARGURITE FINCH Spiller Company: Not reported Spiller Address: 106 LIBERTY AV Spiller City, St, Zip: NEW ROCHELLE, NY Spiller County: 001 Spiller Contact: MARGURITE FINCH Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 120231 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY "PULLED THE TANK TODAY & FOUND IT TO BE LEAKING - CONTAMINATED SOIL Remarks: IS BEING DUG UP & STOCK PILED" Material: 140786 Site ID: **Operable Unit ID:** 1064251 **Operable Unit:** 01 Material ID: 566529 Material Code: 0001A Material Name: #2 fuel oil Case No .: Not reported Petroleum Material FA: Quantity: .00 Units: Gallons .00 Recovered: Not reported **Resource Affected:** Oxygenate: Not reported Tank Test: **COLLEGE OF NEW ROCHELLE** NY LTANKS S104619776 **103 LIBERTY AVE** N/A **NEW ROCHELLE, NY** Site 2 of 2 in cluster BQ LTANKS: Site ID: 118985 Spill Number/Closed Date: 9809357 / 2005-04-17 Spill Date: 1998-10-26 Tank Test Failure Spill Cause: Spill Source: Institutional, Educational, Gov., Other Spill Class: Possible release with minimal potential for fire or hazard or Known release with no damage. No DEC Response. No corrective action required. Not reported Cleanup Ceased: Cleanup Meets Standard: False SWIS: 6010 Investigator: JBODee WESTCHESTER CNTY HEALTH D Referred To:

## S104619561

TC4738280.2s Page 694

Database(s)

EDR ID Number EPA ID Number

	E (Continued) S104619	776
CID:	281	
Water Affected:	Not reported	
Spill Notifier:	Tank Tester	
Last Inspection:	Not reported	
Recommended Penalty:	False	
UST Involvement:	False	
Remediation Phase:	0	
Date Entered In Computer:	1998-10-26	
Spill Record Last Update:	2005-04-17	
Spiller Name:	UNKNOWN	
Spiller Company:	COLLEGE OF NEW ROCHELLE	
Spiller Address:	103 LIBERTY AVE	
Spiller City,St,Zip:	NEW ROCHELLE, NY	
Spiller County:	001	
Spiller Contact:	COLLEGE OF NEW ROCHELLE	
Spiller Phone:	Not reported	
Spiller Extention:	Not reported	
DEC Region:	3	
DER Facility ID:	103367	
DEC Memo:	"02/23/99 Letter sent to tank owner requesting information 04/17/05	
	NON-REGULATED TTF. NO RETEST OR CLOSURE INFORMATION SUBMITTED TO	
	SPILL ADMINISTRATIVELY CLOSED AS PER DIRECTIVE FROM CENTRAL OFFICE	•
	jod"	
Remarks:	"TANK TEST FAILURE AT ABOVE LOCATION. PROPERTY OWNER ADVISED OF	
	RESULTS. NO CALL BACK REQUESTED AT TIME OF CALL."	
Material:	440005	
Site ID:	118985	
Operable Unit ID:	1066630	
Operable Unit:	01	
Material ID:	316813	
Material Code:	0001A	
Material Name: Case No.:	#2 fuel oil	
Material FA:	Not reported Petroleum	
Quantity:	.00	
Units:	Gallons	
Recovered:	.00	
Resource Affected:	Not reported	
Oxygenate:	Not reported	
Chygenate.		
Tank Test:		
Site ID:	118985	
Spill Tank Test:	1546454	
Tank Number:	1	
Tank Size:	1080	
Test Method:	03	
Leak Rate:	.00	
Gross Fail:	F	
Modified By:	Spills	
Last Modified:	Not reported	
Test Method:	Horner EZ Check I or II	

# С

Database(s)

EDR ID Number EPA ID Number

201	RITACCO HOME	
301 NE	24 JACKSON STREET	NY LTANKS S107789088 N/A
1/4-1/2	NEW ROCHELLE, NY	
0.487 mi. 2573 ft.		
	LTANKS:	
Relative: Lower	Site ID:	362141
A	Spill Number/Closed Date:	
Actual: 24 ft.	Spill Date: Spill Cause:	2006-04-06 Tank Failure
	Spill Source:	Private Dwelling
	Spill Class:	Known release with minimal potential for fire or hazard. DEC Response.
	-	Willing Responsible Party. Corrective action taken.
	Cleanup Ceased:	Not reported
	Cleanup Meets Standard: SWIS:	True 6010
	Investigator:	JBODee
	Referred To:	Not reported
	Reported to Dept:	2006-04-06
	CID:	444
	Water Affected: Spill Notifier:	Not reported Other
	Last Inspection:	Not reported
	Recommended Penalty:	False
	UST Involvement:	False
	Remediation Phase:	0
	Date Entered In Computer: Spill Record Last Update:	
	Spiller Name:	RITACCO HOME
	Spiller Company:	RITACCO HOME
	Spiller Address:	24 JACKSON STREET
	Spiller City,St,Zip: Spiller County:	NEW ROCHELLE, NY 001
	Spiller Contact:	RITACCO HOME
	Spiller Phone:	(914) 576-1430
	Spiller Extention:	Not reported
	DEC Region:	3
	DER Facility ID: DEC Memo:	312378 "04/10/06: Northeast to continue remediation. No GW involved as of
	DEC Mento.	now. July 28, 2006: NORTHEAST ENVIRONMENTAL DISPOSED OF LUST AND
		20.00 TONS OF CONTAMINATED SOIL. BASED UPON INFORMATION PROVIDED TO
		DEC, NO FURTHER ACTION IS REQUIRED AT THIS TIME. jod"
	Remarks:	"HOLES IN A 550 GALLON AND CONTAMINATED SOIL;"
	Material:	
	Site ID:	362141
	Operable Unit ID:	1120244
	Operable Unit:	01
	Material ID:	2109739
	Material Code: Material Name:	0001A #2 fuel oil
	Case No.:	Not reported
	Material FA:	Petroleum
	Quantity:	Not reported
	Units:	Gallons
	Recovered: Resource Affected:	.00 Not reported
	Oxygenate:	Not reported
	- , ;	

Map ID		MAP FINDINGS		
Direction	4			
Distance Elevation	Site		Database(s)	EDR ID Number EPA ID Number
	RITACCO HOME (Continued)			S107789088
	Tank Test:			
302	KLING		NY LTANKS	S106124350
WNW	108 VAN GUILDER AVE		NY Spills	N/A
1/4-1/2	NEW ROCHELLE, NY			
0.499 mi. 2637 ft.				
	LTANKS:			
Relative: Lower	Site ID:	214235		
A	Spill Number/Closed Date:			
Actual: 77 ft.	Spill Date: Spill Cause:	2003-11-13 Tank Test Failure		
	Spill Source:	Private Dwelling		
	Spill Class:	Known release with minimal potential for fire or hazard.	DEC Response.	
	Cleanup Ceased:	Willing Responsible Party. Corrective action taken. Not reported		
	Cleanup Meets Standard:	True		
	SWIS:	6010		
	Investigator: Referred To:	jbodee Not reported		
	Reported to Dept:	2003-11-13		
	CID:	199 Not reported		
	Water Affected: Spill Notifier:	Not reported Tank Tester		
	Last Inspection:	Not reported		
	Recommended Penalty: UST Involvement:	False False		
	Remediation Phase:	0		
	Date Entered In Computer			
	Spill Record Last Update: Spiller Name:	2005-02-12 Not reported		
	Spiller Company:	Not reported		
	Spiller Address:	Not reported		
	Spiller City,St,Zip: Spiller County:	***Update***, ZZ 001		
	Spiller Contact:	RICHARD KLING		
	Spiller Phone: Spiller Extention:	(914) 636-0076 Not reported		
	DEC Region:	3		
	DER Facility ID:			
	DEC Memo:	"03/24/04 TANK IS IN A CRAWL SPACE UNDER THE REMOVED. ROYAL ENVIRONMENTAL INSPECTED		
		CONTAMINATION. ROYAL INSTALLED A NEW 275 A		
		TANK IN SERVICE, AWAITING INSPECTION FROM N		
		ONCE AST IS IN SERVICE, ROYAL IS TO CUT AND ( A SOIL SAMPLE FROM BENEATH TANK. SAMPLE R		
		DEC. ADDITIONAL SPILL NUMBERS CALLED IN: 03-		
	Remarks:	"uncover / repair / retest"		
	Material:			
	Site ID:	214235		
	Operable Unit ID:	874811		
	Operable Unit: Material ID:	01 502049		
	Material Code:	0001A		

Database(s)

EDR ID Number EPA ID Number

ING (Continued)	#2 fuel oil
Material Name: Case No.:	#2 fuel oil Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	Gallons
Recovered:	.00
Resource Affected:	Not reported
Oxygenate:	Not reported
Oxygenale.	Not reported
Tank Test:	
Site ID:	214235
Spill Tank Test:	1528806
Tank Number:	1
Tank Size:	550
Test Method:	03
Leak Rate:	.00
Gross Fail:	Not reported
Modified By:	Spills
Last Modified:	Not reported
Test Method:	Horner EZ Check I or II
SPILLS:	
Facility ID:	0314031
Facility Type:	ER
DER Facility ID:	177496
Site ID:	214237
DEC Region:	3
Spill Date:	2004-03-24
Spill Number/Closed Date:	0314031 / 2004-03-24
Spill Cause:	Unknown
Spill Class:	No spill occured. No DEC Response. No corrective action required.
SWIS:	6010
Investigator:	jbodee
Referred To:	Not reported
Reported to Dept:	2004-03-24
CID:	407
Water Affected:	Not reported
Spill Source:	Institutional, Educational, Gov., Other
Spill Notifier:	Citizen
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	Not reported
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	
Spill Record Last Update:	2005-02-12
Spiller Name:	RICHARD KLING MD
Spiller Company:	Not reported
Spiller Address:	108 VAN GUILDER AVE
Spiller City,St,Zip:	NEW ROCHELLE, NY
Spiller Company:	
Contact Name:	RICHARD KLING MD
Contact Phone:	Not reported
DEC Memo:	"03/24/04 SEE SPILL 03-08565. jbo 03/30/04 SITE INSPECTED BY STEFAN

Remarks:

# MAP FINDINGS

EDR ID Number Database(s) **EPA ID Number** 

#### **KLING** (Continued) GOREAU OF WCHD. jbo" "unknown if spill, caller refused to give name, detected odor of Remarks: gas/oil from neighbors building, renovation ongoing at building, caller believed odor was related to work.' Material: Site ID: 214237 Operable Unit ID: 880985 Operable Unit: 01 Material ID: 495617 Material Code: 0064A Material Name: unknown material Not reported Case No .: Material FA: Other Quantity: .00 Units: Gallons Recovered: .00 **Resource Affected:** Not reported Oxygenate: Not reported Tank Test: Facility ID: 0313745 Facility Type: ER **DER Facility ID:** 177496 Site ID: 214236 **DEC Region:** 3 Spill Date: 2004-03-16 Spill Number/Closed Date: 0313745 / 2004-03-24 Spill Cause: Unknown Spill Class: No spill occured. No DEC Response. No corrective action required. SWIS: 6010 Investigator: jbodee Not reported Referred To: Reported to Dept: 2004-03-16 CID: 444 Water Affected: Not reported Commercial/Industrial Spill Source: Spill Notifier: Citizen Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported **Recommended Penalty:** False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 2004-03-16 Spill Record Last Update: 2005-02-12 DR RICHARD KLEIN Spiller Name: Spiller Company: Not reported Spiller Address: **108 VAN GUILDER AVE** Spiller City, St, Zip: NEW ROCHELLE, NY Spiller Company: 001 Contact Name: DR RICHARD KLEIN Contact Phone: Not reported DEC Memo: "03/24/04 SEE SPILL 03-08565. ibo"

# S106124350

Map ID		MAP FINDINGS		
Direction Distance	ų_			EDR ID Number
Elevation	Site		Database(s)	EPA ID Number
	KLING (Continued)			S106124350
		OFFICE AND SHE CAN SMELL IT AT HER HOME. OVERWELMING: A LARGE CONTAINER IS IN THE OFFICE: SHE JUST WANTED SOMEONE TO CHEC CALLED BACK AND SAID THAT SOMEONE TOLD CHECKED IT OUT- ROYAL IN PELHAM NY*"	BACK YARD OF DO CK OUT: *****UPDA	OCTOR'S TE***** SHE
	Material: Site ID: Operable Unit ID: Operable Unit: Material ID: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Resource Affected: Oxygenate: Tank Test:	214236 879034 01 495337 0001A #2 fuel oil Not reported Petroleum .00 Gallons .00 Not reported Not reported		
303 SSW 1/4-1/2 0.500 mi. 2639 ft.	BLANCO RESIDENCE 30 LINDEN PLACE NEW ROCHELLE, NY		NY LTANKS	S103238839 N/A
Relative:	LTANKS:	007000		
Lower	Site ID: Spill Number/Closed Date:			
Actual: 50 ft.	Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: Cleanup Meets Standard: SWIS: Investigator: Referred To: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Company: Spiller City,St,Zip: Spiller County:	1998-06-01 Tank Failure Private Dwelling Known release with minimal potential for fire or hazard. I Willing Responsible Party. Corrective action taken. Not reported False 6010 tdghiosa Not reported 1998-06-01 351 Not reported Other Not reported False False 0 1998-06-01 1998-08-04 FRANK BLANCO BLANCO RESIDENCE 30 LINDEN PLACE NEW ROCHELLE, NY 001	DEC Response.	

Database(s)

EDR ID Number EPA ID Number

#### **BLANCO RESIDENCE (Continued)** S103238839 FRANK BLANCO Spiller Contact: Spiller Phone: (914) 633-7605 Spiller Extention: Not reported DEC Region: 3 DER Facility ID: 188052 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead\_DEC Field was GHIOSAY 07/27/98 LETTER REC'D FROM NES, INC. INDICATING TANK AND APPROX. 21.86 TONS CONTAMINATED SOIL WAS REMOVED. NFA." Remarks: "CALLERS AGENCY CALLED FOR NO HOT WATER - SERVICE MAN FOUND TANK EMPTY - POSSIBLY A TANK LEAK OR LINE FAILURE" Material: Site ID: 227988 Operable Unit ID: 1063369 Operable Unit: 01 Material ID: 321024 Material Code: 0001A Material Name: #2 fuel oil Case No.: Not reported Material FA: Petroleum Quantity: .00 Units: Gallons Recovered: .00

Not reported

Not reported

Tank Test:

**Resource Affected:** 

Oxygenate:

Count: 5 records.

#### ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
NEW ROCHELLE NEW ROCHELLE NEW ROCHELLE NEW ROCHELLE NEW ROCHELLE	S118707739 S105684699 S113916612	SIDEWALK / IN FRONT OF NE APARTMENT BUILDING CE-CEDAR ST MGP NEW ROCHELLE MEARL CORP. MM 5.4 LEFT LANE	HARRISON STREET 60-70 LOCUST AVE ONE RAMADA PLAZA PALMER AVE I-95 SOUTHBOUND	10801 10801	NY LTANKS NY LTANKS NY VCP NY SHWS NY LTANKS

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

**Number of Days to Update:** Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

# STANDARD ENVIRONMENTAL RECORDS

# Federal NPL site list

#### NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/05/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 10 Source: EPA Telephone: N/A Last EDR Contact: 07/07/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC) Telephone: 202-564-7333

EPA Region 1 Telephone 617-918-1143

EPA Region 3 Telephone 215-814-5418

EPA Region 4 Telephone 404-562-8033

EPA Region 5 Telephone 312-886-6686

EPA Region 10 Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

EPA Region 6

EPA Region 7

EPA Region 8

**EPA Region 9** 

Telephone: 214-655-6659

Telephone: 913-551-7247

Telephone: 303-312-6774

Telephone: 415-947-4246

Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/05/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 10

Source: EPA Telephone: N/A Last EDR Contact: 07/07/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

# NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991 Date Data Arrived at EDR: 02/02/1994 Date Made Active in Reports: 03/30/1994 Number of Days to Update: 56 Source: EPA Telephone: 202-564-4267 Last EDR Contact: 08/15/2011 Next Scheduled EDR Contact: 11/28/2011 Data Release Frequency: No Update Planned

## Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/05/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 10 Source: EPA Telephone: N/A Last EDR Contact: 07/07/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

# Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/13/2015	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/06/2016	Telephone: 703-603-8704
Date Made Active in Reports: 05/20/2016	Last EDR Contact: 07/06/2016
Number of Days to Update: 135	Next Scheduled EDR Contact: 10/17/2016
	Data Release Frequency: Varies

# SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/05/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 10 Source: EPA Telephone: 800-424-9346 Last EDR Contact: 07/22/2016 Next Scheduled EDR Contact: 10/31/2016 Data Release Frequency: Quarterly

#### Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/05/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 10 Source: EPA Telephone: 800-424-9346 Last EDR Contact: 07/22/2016 Next Scheduled EDR Contact: 10/31/2016 Data Release Frequency: Quarterly

# Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/27/2016	Source: EPA
Date Data Arrived at EDR: 06/30/2016	Telephone: 800-424-9346
Date Made Active in Reports: 09/02/2016	Last EDR Contact: 06/30/2016
Number of Days to Update: 64	Next Scheduled EDR Contact: 10/10/2016
	Data Release Frequency: Quarterly

# Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/21/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 64 Source: Environmental Protection Agency Telephone: (212) 637-3660 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

### Federal RCRA generators list

# RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/21/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 64 Source: Environmental Protection Agency Telephone: (212) 637-3660 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

#### RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/21/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 64 Source: Environmental Protection Agency Telephone: (212) 637-3660 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly

# RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/21/2016Source: Environmental Protection AgencyDate Data Arrived at EDR: 06/30/2016Telephone: (212) 637-3660Date Made Active in Reports: 09/02/2016Last EDR Contact: 06/30/2016Number of Days to Update: 64Next Scheduled EDR Contact: 10/17/2016Data Release Frequency: Varies

## Federal institutional controls / engineering controls registries

#### LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 05/28/2015	Source: Department of the Navy
Date Data Arrived at EDR: 05/29/2015	Telephone: 843-820-7326
Date Made Active in Reports: 06/11/2015	Last EDR Contact: 08/12/2016
Number of Days to Update: 13	Next Scheduled EDR Contact: 11/28/2016
	Data Release Frequency: Varies

# US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 05/09/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/01/2016	Telephone: 703-603-0695
Date Made Active in Reports: 09/02/2016	Last EDR Contact: 08/31/2016
Number of Days to Update: 93	Next Scheduled EDR Contact: 12/12/2016
	Data Release Frequency: Varies

# US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 05/09/2016	Sour
Date Data Arrived at EDR: 06/01/2016	Tele
Date Made Active in Reports: 09/02/2016	Last
Number of Days to Update: 93	Next

Source: Environmental Protection Agency Telephone: 703-603-0695 Last EDR Contact: 08/31/2016 Next Scheduled EDR Contact: 12/12/2016 Data Release Frequency: Varies

# Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 03/28/2016 Date Data Arrived at EDR: 03/30/2016 Date Made Active in Reports: 05/20/2016 Number of Days to Update: 51 Source: National Response Center, United States Coast Guard Telephone: 202-267-2180 Last EDR Contact: 09/26/2016 Next Scheduled EDR Contact: 01/09/2017 Data Release Frequency: Annually

# State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 05/17/2016	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 05/19/2016	Telephone: 518-402-9622
Date Made Active in Reports: 07/07/2016	Last EDR Contact: 08/17/2016
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/28/2016
	Data Release Frequency: Annually

## VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 08/01/2015 Date Data Arrived at EDR: 11/19/2015 Date Made Active in Reports: 12/10/2015 Number of Days to Update: 21 Source: Department of Environmenal Conservation Telephone: 518-402-9814 Last EDR Contact: 08/19/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Varies

# State and tribal landfill and/or solid waste disposal site lists

#### SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 07/06/2016	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/08/2016	Telephone: 518-457-2051
Date Made Active in Reports: 09/09/2016	Last EDR Contact: 07/01/2016
Number of Days to Update: 63	Next Scheduled EDR Contact: 10/17/2016
	Data Release Frequency: Semi-Annually

# State and tribal leaking storage tank lists

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/13/2015	Source: EPA Region 8
Date Data Arrived at EDR: 10/23/2015	Telephone: 303-312-6271
Date Made Active in Reports: 02/18/2016	Last EDR Contact: 07/27/2016
Number of Days to Update: 118	Next Scheduled EDR Contact: 11/07/2016
	Data Release Frequency: Quarterly

INDIAN LUST R5: Leaking Underground Storage T Leaking underground storage tanks located on	anks on Indian Land I Indian Land in Michigan, Minnesota and Wisconsin.
Date of Government Version: 02/17/2016 Date Data Arrived at EDR: 04/27/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 37	Source: EPA, Region 5 Telephone: 312-886-7439 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies
INDIAN LUST R7: Leaking Underground Storage T LUSTs on Indian land in Iowa, Kansas, and Ne	
Date of Government Version: 10/09/2015 Date Data Arrived at EDR: 02/12/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 112	Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies
INDIAN LUST R6: Leaking Underground Storage T LUSTs on Indian land in New Mexico and Okla	
Date of Government Version: 12/11/2015 Date Data Arrived at EDR: 02/19/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 105	Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies
INDIAN LUST R4: Leaking Underground Storage Table LUSTs on Indian land in Florida, Mississippi ar	
Date of Government Version: 02/05/2016 Date Data Arrived at EDR: 04/29/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 35	Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 07/26/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Semi-Annually
INDIAN LUST R1: Leaking Underground Storage T A listing of leaking underground storage tank lo	
Date of Government Version: 10/27/2015 Date Data Arrived at EDR: 10/29/2015 Date Made Active in Reports: 01/04/2016 Number of Days to Update: 67	Source: EPA Region 1 Telephone: 617-918-1313 Last EDR Contact: 07/29/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies
INDIAN LUST R10: Leaking Underground Storage LUSTs on Indian land in Alaska, Idaho, Oregor	
Date of Government Version: 01/07/2016 Date Data Arrived at EDR: 01/08/2016 Date Made Active in Reports: 02/18/2016 Number of Days to Update: 41	Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Quarterly
INDIAN LUST R9: Leaking Underground Storage T LUSTs on Indian land in Arizona, California, N	
Date of Government Version: 02/25/2016 Date Data Arrived at EDR: 04/27/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 37	Source: Environmental Protection Agency Telephone: 415-972-3372 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Quarterly

# LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 08/16/2016 Date Data Arrived at EDR: 08/19/2016 Date Made Active in Reports: 09/09/2016 Number of Days to Update: 21 Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 08/19/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Varies

# HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/08/2005	Telephone: 518-402-9549
Date Made Active in Reports: 07/14/2005	Last EDR Contact: 07/07/2005
Number of Days to Update: 6	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

## State and tribal registered storage tank lists

# FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010	Source: FEMA
Date Data Arrived at EDR: 02/16/2010	Telephone: 202-646-5797
Date Made Active in Reports: 04/12/2010	Last EDR Contact: 07/07/2016
Number of Days to Update: 55	Next Scheduled EDR Contact: 10/24/2016
	Data Release Frequency: Varies

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 06/28/2016	5
Date Data Arrived at EDR: 06/30/2016	٦
Date Made Active in Reports: 09/08/2016	L
Number of Days to Update: 70	١

Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/10/2016 Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002	
Date Made Active in Reports: 03/22/2002 Number of Days to Update: 30	
Number of Days to Opuate. 50	

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 10/24/2005 Next Scheduled EDR Contact: 01/23/2006 Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002	Source: NYSDEC
Date Data Arrived at EDR: 02/20/2002	Telephone: 518-402-9549
Date Made Active in Reports: 03/22/2002	Last EDR Contact: 07/25/2005
Number of Days to Update: 30	Next Scheduled EDR Contact: 10/24/2005
	Data Release Frequency: No Update Planned

CBS: Chemical Bulk Storage Site Listing These facilities store regulated hazardous sub and/or in underground tanks of any size	bstances in aboveground tanks with capacities of 185 gallons or greater,
Date of Government Version: 06/28/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 70	Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/10/2016 Data Release Frequency: Quarterly
MOSF: Major Oil Storage Facility Site Listing These facilities may be onshore facilities or ve greater.	essels, with petroleum storage capacities of 400,000 gallons or
Date of Government Version: 06/28/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 70	Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/10/2016 Data Release Frequency: Quarterly
AST: Petroleum Bulk Storage Registered Aboveground Storage Tanks.	
Date of Government Version: 06/28/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 70	Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/10/2016 Data Release Frequency: No Update Planned
CBS AST: Chemical Bulk Storage Database Facilities that store regulated hazardous subs and/or in underground tanks of any size.	stances in aboveground tanks with capacities of 185 gallons or greater,
Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002 Number of Days to Update: 30	Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005 Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned
MOSF AST: Major Oil Storage Facilities Database Facilities that may be onshore facilities or ves greater.	sels, with petroleum storage capacities of 400,000 gallons or
Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002 Number of Days to Update: 30	Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005 Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned
INDIAN UST R6: Underground Storage Tanks on Indian Land The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).	
Date of Government Version: 12/03/2015 Date Data Arrived at EDR: 02/04/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 120	Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Semi-Appually

Data Release Frequency: Semi-Annually

# INDIAN UST R9: Underground Storage Tanks on Indian Land The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 02/25/2016
Date Data Arrived at EDR: 04/27/2016
Date Made Active in Reports: 06/03/2016
Number of Days to Update: 37

Source: EPA Region 9 Telephone: 415-972-3368 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Quarterly

## INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 01/26/2016	Source: EPA Region 8
Date Data Arrived at EDR: 02/05/2016	Telephone: 303-312-6137
Date Made Active in Reports: 06/03/2016	Last EDR Contact: 07/27/2016
Number of Days to Update: 119	Next Scheduled EDR Contact: 11/07/2016
	Data Release Frequency: Quarterly

# INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/20/2015 Date Data Arrived at EDR: 10/29/2015 Date Made Active in Reports: 01/04/2016 Number of Days to Update: 67 Source: EPA, Region 1 Telephone: 617-918-1313 Last EDR Contact: 07/29/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies

# INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 02/05/2016 Date Data Arrived at EDR: 04/29/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 35 Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 07/26/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Semi-Annually

# INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 11/05/2015	Source: EPA Region 5
Date Data Arrived at EDR: 11/13/2015	Telephone: 312-886-6136
Date Made Active in Reports: 01/04/2016	Last EDR Contact: 07/27/2016
Number of Days to Update: 52	Next Scheduled EDR Contact: 11/07/2016
	Data Release Frequency: Varies

# INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 09/23/2014	Source: EPA Region 7
Date Data Arrived at EDR: 11/25/2014	Telephone: 913-551-7003
Date Made Active in Reports: 01/29/2015	Last EDR Contact: 07/27/2016
Number of Days to Update: 65	Next Scheduled EDR Contact: 11/07/2016
	Data Release Frequency: Varies

# INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 01/07/2016 Date Data Arrived at EDR: 01/08/2016 Date Made Active in Reports: 02/18/2016 Number of Days to Update: 41 Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 07/27/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Quarterly

TANKS: Storage Tank Faciliy Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 06/28/2016	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 06/30/2016	Telephone: 518-402-9543
Date Made Active in Reports: 09/09/2016	Last EDR Contact: 06/30/2016
Number of Days to Update: 71	Next Scheduled EDR Contact: 10/10/2016
	Data Release Frequency: Quarterly

# State and tribal institutional control / engineering control registries

#### ENV RES DECL: Environmental Restrictive Declarations

The Environmental Restrictive Declarations (ERD) listed were recorded in connection with a zoning action against the noted Tax Blocks and Tax Lots, or portion thereof, and are available in the property records on file at the Office of the City Register for Bronx, Kings, New York and Queens counties or at the Richmond County Clerk's office. They contain environmental requirements with respect to hazardous materials, air quality and/or noise in accordance with Section 11-15 of this Resolution.

Date of Government Version: 06/16/2016 Date Data Arrived at EDR: 06/24/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 76 Source: New York City Department of City Planning Telephone: 212-720-3300 Last EDR Contact: 09/20/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Varies

### **RES DECL:** Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 11/18/2010 Date Data Arrived at EDR: 06/30/2014 Date Made Active in Reports: 07/21/2014 Number of Days to Update: 21 Source: NYC Department of City Planning Telephone: 212-720-3401 Last EDR Contact: 09/23/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Varies

# ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 05/17/2016	
Date Data Arrived at EDR: 05/19/2016	
Date Made Active in Reports: 07/07/2016	
Number of Days to Update: 49	

Source: Department of Environmental Conservation Telephone: 518-402-9553 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 05/17/2016 Date Data Arrived at EDR: 05/19/2016 Date Made Active in Reports: 07/07/2016 Number of Days to Update: 49

Source: Department of Environmental Conservation Telephone: 518-402-9553 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Quarterly

# State and tribal voluntary cleanup sites

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008	Source: EPA, Region 7
Date of Government version. 03/20/2006	Source. EFA, Region /
Date Data Arrived at EDR: 04/22/2008	Telephone: 913-551-7365
Date Made Active in Reports: 05/19/2008	Last EDR Contact: 04/20/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 05/17/2016 Date Data Arrived at EDR: 05/19/2016 Date Made Active in Reports: 07/07/2016 Number of Days to Update: 49

Source: Department of Environmental Conservation Telephone: 518-402-9711 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015	Source: EPA, Region 1
Date Data Arrived at EDR: 09/29/2015	Telephone: 617-918-1102
Date Made Active in Reports: 02/18/2016	Last EDR Contact: 09/26/2016
Number of Days to Update: 142	Next Scheduled EDR Contact: 01/09/2017
	Data Release Frequency: Varies

### State and tribal Brownfields sites

#### **BROWNFIELDS:** Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 05/17/2016 Date Data Arrived at EDR: 05/19/2016 Date Made Active in Reports: 07/07/2016 Number of Days to Update: 49

Source: Department of Environmental Conservation Telephone: 518-402-9764 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Semi-Annually

### ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 05/17/2016 Date Data Arrived at EDR: 05/19/2016 Date Made Active in Reports: 07/07/2016 Number of Days to Update: 49

Source: Department of Environmental Conservation Telephone: 518-402-9622 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Quarterly

# ADDITIONAL ENVIRONMENTAL RECORDS

# Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 06/21/2016 Date Data Arrived at EDR: 06/22/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 72 Source: Environmental Protection Agency Telephone: 202-566-2777 Last EDR Contact: 09/21/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Semi-Annually

# Local Lists of Landfill / Solid Waste Disposal Sites

SWTIRE: Registered Waste Tire Storage & Facility List A listing of facilities registered to accept waste tires.

	Date of Government Version: 08/01/2006 Date Data Arrived at EDR: 11/15/2006 Date Made Active in Reports: 11/30/2006 Number of Days to Update: 15	Source: Department of Environmental Conservation Telephone: 518-402-8694 Last EDR Contact: 09/16/2016 Next Scheduled EDR Contact: 12/26/2016 Data Release Frequency: Annually
SWR	CY: Registered Recycling Facility List A listing of recycling facilities.	
	Date of Government Version: 07/06/2016 Date Data Arrived at EDR: 07/08/2016 Date Made Active in Reports: 09/09/2016 Number of Days to Update: 63	Source: Department of Environmental Conservation Telephone: 518-402-8705 Last EDR Contact: 07/01/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Semi-Annually
INDIAN ODI: Report on the Status of Open Dumps on Indian Lands Location of open dumps on Indian land.		
	Date of Government Version: 12/31/1998 Date Data Arrived at EDR: 12/03/2007 Date Made Active in Reports: 01/24/2008 Number of Days to Update: 52	Source: Environmental Protection Agency Telephone: 703-308-8245 Last EDR Contact: 08/05/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Varies
ODI:	ODI: Open Dump Inventory An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.	
	Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004 Number of Days to Update: 39	Source: Environmental Protection Agency Telephone: 800-424-9346 Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009 Date Data Arrived at EDR: 05/07/2009 Date Made Active in Reports: 09/21/2009 Number of Days to Update: 137 Source: EPA, Region 9 Telephone: 415-947-4219 Last EDR Contact: 07/20/2016 Next Scheduled EDR Contact: 10/07/2016 Data Release Frequency: No Update Planned

# Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 08/31/2016	Source: Drug Enforcement Administration
Date Data Arrived at EDR: 09/06/2016	Telephone: 202-307-1000
Date Made Active in Reports: 09/23/2016	Last EDR Contact: 08/31/2016
Number of Days to Update: 17	Next Scheduled EDR Contact: 10/10/2016
	Data Release Frequency: No Update Planned

## DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 05/17/2016	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 05/19/2016	Telephone: 518-402-9622
Date Made Active in Reports: 07/07/2016	Last EDR Contact: 08/17/2016
Number of Days to Update: 49	Next Scheduled EDR Contact: 11/28/2016
	Data Release Frequency: Annually

### US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 08/30/2016 Date Data Arrived at EDR: 09/06/2016 Date Made Active in Reports: 09/23/2016 Number of Days to Update: 17 Source: Drug Enforcement Administration Telephone: 202-307-1000 Last EDR Contact: 08/31/2016 Next Scheduled EDR Contact: 12/12/2016 Data Release Frequency: Quarterly

# Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006 Number of Days to Update: 48 Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: Varies

### HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006 Number of Days to Update: 48

Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 10/23/2006 Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: No Update Planned

# Local Land Records

LIENS: Spill Liens Information Lien information from the Oil Spill Fund.

> Date of Government Version: 06/30/2016 Date Data Arrived at EDR: 07/05/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 65

Source: Office of the State Comptroller Telephone: 518-474-9034 Last EDR Contact: 08/08/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/18/2014 Date Data Arrived at EDR: 03/18/2014 Date Made Active in Reports: 04/24/2014 Number of Days to Update: 37

Source: Environmental Protection Agency Telephone: 202-564-6023 Last EDR Contact: 07/29/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies

# **Records of Emergency Release Reports**

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 06/27/2016	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 06/28/2016	Telephone: 202-366-4555
Date Made Active in Reports: 09/23/2016	Last EDR Contact: 06/28/2016
Number of Days to Update: 87	Next Scheduled EDR Contact: 10/10/2016
	Data Release Frequency: Annually

#### SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 08/16/2016	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 08/19/2016	Telephone: 518-402-9549
Date Made Active in Reports: 09/09/2016	Last EDR Contact: 08/19/2016
Number of Days to Update: 21	Next Scheduled EDR Contact: 11/28/2016
	Data Release Frequency: Varies

### HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 07/08/2005 Date Made Active in Reports: 07/14/2005 Number of Days to Update: 6

Source: Department of Environmental Conservation Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

#### SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012SourceDate Data Arrived at EDR: 01/03/2013TelepiDate Made Active in Reports: 02/12/2013Last ENumber of Days to Update: 40Next S

Source: FirstSearch Telephone: N/A Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

## SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010 Date Data Arrived at EDR: 01/03/2013 Date Made Active in Reports: 03/07/2013 Number of Days to Update: 63 Source: FirstSearch Telephone: N/A Last EDR Contact: 01/03/2013 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

### Other Ascertainable Records

# RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 06/21/2016 Date Data Arrived at EDR: 06/30/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 64 Source: Environmental Protection Agency Telephone: (212) 637-3660 Last EDR Contact: 06/30/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Varies

### FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/31/2015	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 07/08/2015	Telephone: 202-528-4285
Date Made Active in Reports: 10/13/2015	Last EDR Contact: 09/09/2016
Number of Days to Update: 97	Next Scheduled EDR Contact: 12/19/2016
	Data Release Frequency: Varies

# DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 11/10/2006 Date Made Active in Reports: 01/11/2007 Number of Days to Update: 62 Source: USGS Telephone: 888-275-8747 Last EDR Contact: 07/15/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: Semi-Annually

# FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 02/06/2006 Date Made Active in Reports: 01/11/2007 Number of Days to Update: 339

Source: U.S. Geological Survey Telephone: 888-275-8747 Last EDR Contact: 07/15/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: N/A

# SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 03/07/2011 Date Data Arrived at EDR: 03/09/2011 Date Made Active in Reports: 05/02/2011 Number of Days to Update: 54

Source: Environmental Protection Agency Telephone: 615-532-8599 Last EDR Contact: 08/15/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Varies

# US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 05/08/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 05/18/2016	Telephone: 202-566-1917
Date Made Active in Reports: 09/02/2016	Last EDR Contact: 08/17/2016
Number of Days to Update: 107	Next Scheduled EDR Contact: 11/28/2016
	Data Release Frequency: Quarterly

# EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013 Date Data Arrived at EDR: 03/21/2014 Date Made Active in Reports: 06/17/2014 Number of Days to Update: 88

Source: Environmental Protection Agency Telephone: 617-520-3000 Last EDR Contact: 08/08/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Quarterly

# 2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 04/22/2013 Date Data Arrived at EDR: 03/03/2015 Date Made Active in Reports: 03/09/2015 Number of Days to Update: 6

Source: Environmental Protection Agency Telephone: 703-308-4044 Last EDR Contact: 09/06/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Varies

### TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2012	S
Date Data Arrived at EDR: 01/15/2015	Т
Date Made Active in Reports: 01/29/2015	L
Number of Days to Update: 14	N

Source: EPA Telephone: 202-260-5521 Last EDR Contact: 09/23/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2014 Date Data Arrived at EDR: 11/24/2015 Date Made Active in Reports: 04/05/2016 Number of Days to Update: 133 Source: EPA Telephone: 202-566-0250 Last EDR Contact: 08/26/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Annually

# SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009	Source: EPA
Date Data Arrived at EDR: 12/10/2010	Telephone: 202-564-4203
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 07/25/2016
Number of Days to Update: 77	Next Scheduled EDR Contact: 11/07/2016
	Data Release Frequency: Annually

### ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 11/25/2013	Source: EPA
Date Data Arrived at EDR: 12/12/2013	Telephone: 703-416-0223
Date Made Active in Reports: 02/24/2014	Last EDR Contact: 09/09/2016
Number of Days to Update: 74	Next Scheduled EDR Contact: 12/19/2016
	Data Release Frequency: Annually

### RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 05/01/2016 Date Data Arrived at EDR: 05/26/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 99 Source: Environmental Protection Agency Telephone: 202-564-8600 Last EDR Contact: 07/25/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies

# RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

	Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995 Number of Days to Update: 35	Source: EPA Telephone: 202-564-4104 Last EDR Contact: 06/02/2008 Next Scheduled EDR Contact: 09/01/2008 Data Release Frequency: No Update Planned
PRF	P: Potentially Responsible Parties A listing of verified Potentially Responsible Pa	rties
	Date of Government Version: 10/25/2013 Date Data Arrived at EDR: 10/17/2014 Date Made Active in Reports: 10/20/2014 Number of Days to Update: 3	Source: EPA Telephone: 202-564-6023 Last EDR Contact: 08/12/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Quarterly
PAE	DS: PCB Activity Database System PCB Activity Database. PADS Identifies gener of PCB's who are required to notify the EPA of	rators, transporters, commercial storers and/or brokers and disposers f such activities.
	Date of Government Version: 01/20/2016 Date Data Arrived at EDR: 04/28/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 127	Source: EPA Telephone: 202-566-0500 Last EDR Contact: 07/15/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: Annually
ICIS: Integrated Compliance Information System The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.		
	Date of Government Version: 01/23/2015 Date Data Arrived at EDR: 02/06/2015 Date Made Active in Reports: 03/09/2015 Number of Days to Update: 31	Source: Environmental Protection Agency Telephone: 202-564-5088 Last EDR Contact: 07/07/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: Quarterly
FTT	FTTS tracks administrative cases and pesticid	deral Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) le enforcement actions and compliance activities related to FIFRA, Community Right-to-Know Act). To maintain currency, EDR contacts the
	Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009 Number of Days to Update: 25	Source: EPA/Office of Prevention, Pesticides and Toxic Substances Telephone: 202-566-1667 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Quarterly
FTT	S INSP: FIFRA/ TSCA Tracking System - FIFR A listing of FIFRA/TSCA Tracking System (FT	A (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) TS) inspections and enforcements.
	Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009 Number of Days to Update: 25	Source: EPA Telephone: 202-566-1667 Last EDR Contact: 08/17/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Quarterly
MLT	S: Material Licensing Tracking System	

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

	Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 03/18/2016 Date Made Active in Reports: 04/15/2016 Number of Days to Update: 28	Source: Nuclear Regulatory Commission Telephone: 301-415-7169 Last EDR Contact: 09/05/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Quarterly	
COAL ASH DOE: Steam-Electric Plant Operation Data A listing of power plants that store ash in surface ponds.			
	Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 08/07/2009 Date Made Active in Reports: 10/22/2009 Number of Days to Update: 76	Source: Department of Energy Telephone: 202-586-8719 Last EDR Contact: 09/09/2016 Next Scheduled EDR Contact: 12/19/2016 Data Release Frequency: Varies	
COA	COAL ASH EPA: Coal Combustion Residues Surface Impoundments List A listing of coal combustion residues surface impoundments with high hazard potential ratings.		
	Date of Government Version: 07/01/2014 Date Data Arrived at EDR: 09/10/2014 Date Made Active in Reports: 10/20/2014 Number of Days to Update: 40	Source: Environmental Protection Agency Telephone: N/A Last EDR Contact: 09/06/2016 Next Scheduled EDR Contact: 12/19/2016 Data Release Frequency: Varies	
PCB TRANSFORMER: PCB Transformer Registration Database The database of PCB transformer registrations that includes all PCB registration submittals.			
	Date of Government Version: 02/01/2011 Date Data Arrived at EDR: 10/19/2011 Date Made Active in Reports: 01/10/2012 Number of Days to Update: 83	Source: Environmental Protection Agency Telephone: 202-566-0517 Last EDR Contact: 07/29/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Varies	
RADINFO: Radiation Information Database The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.			
	Date of Government Version: 07/07/2015 Date Data Arrived at EDR: 07/09/2015 Date Made Active in Reports: 09/16/2015 Number of Days to Update: 69	Source: Environmental Protection Agency Telephone: 202-343-9775 Last EDR Contact: 07/07/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly	
HIS	ST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.		
	Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007 Number of Days to Update: 40	Source: Environmental Protection Agency Telephone: 202-564-2501 Last EDR Contact: 12/17/2007 Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned	
HIS	FTTS INSP: FIFRA/TSCA Tracking System Ir	nspection & Enforcement Case Listing	

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date Data Arrived a	nt Version: 10/19/2006 at EDR: 03/01/2007 n Reports: 04/10/2007 Update: 40	Source: Environmental Protection Agency Telephone: 202-564-2501 Last EDR Contact: 12/17/2008 Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned	
		Data Nelease Frequency. No optice France	
DOT OPS: Incident and Accident Data Department of Transporation, Office of Pipeline Safety Incident and Accident data.			
Date Data Arrived a	nt Version: 07/31/2012 at EDR: 08/07/2012 n Reports: 09/18/2012 Update: 42	Source: Department of Transporation, Office of Pipeline Safety Telephone: 202-366-4595 Last EDR Contact: 08/02/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Varies	
CONSENT: Superfund (CERCLA) Consent Decrees Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.			
Date Data Arrived a	nt Version: 03/31/2016 at EDR: 08/01/2016 n Reports: 09/23/2016 Update: 53	Source: Department of Justice, Consent Decree Library Telephone: Varies Last EDR Contact: 09/26/2016 Next Scheduled EDR Contact: 01/09/2017 Data Release Frequency: Varies	
The Biennial Repor	RS: Biennial Reporting System The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.		
Date Data Arrived a	nt Version: 12/31/2013 at EDR: 02/24/2015 n Reports: 09/30/2015 Update: 218	Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 08/26/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Biennially	
INDIAN RESERV: Indian Reservations This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.			
Date Data Arrived a	nt Version: 12/31/2005 at EDR: 12/08/2006 n Reports: 01/11/2007 Update: 34	Source: USGS Telephone: 202-208-3710 Last EDR Contact: 07/15/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: Semi-Annually	
FUSRAP: Formerly Utilized Sites Remedial Action Program DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.			
Date Data Arrived a	nt Version: 07/21/2016 at EDR: 07/26/2016 n Reports: 09/23/2016 Update: 59	Source: Department of Energy Telephone: 202-586-3559 Last EDR Contact: 07/26/2016 Next Scheduled EDR Contact: 11/21/2016 Data Release Frequency: Varies	
UMTRA: Uranium Mill Ta Uranium ore was m	-	for federal government use in national defense programs. When the mills	

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010 Date Data Arrived at EDR: 10/07/2011 Date Made Active in Reports: 03/01/2012 Number of Days to Update: 146	Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 09/09/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Varies
LEAD SMELTER 1: Lead Smelter Sites A listing of former lead smelter site locations.	
Date of Government Version: 03/07/2016 Date Data Arrived at EDR: 04/07/2016 Date Made Active in Reports: 09/02/2016 Number of Days to Update: 148	Source: Environmental Protection Agency Telephone: 703-603-8787 Last EDR Contact: 07/08/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Varies
	re secondary lead smelting was done from 1931and 1964. These sites gestion or inhalation of contaminated soil or dust
Date of Government Version: 04/05/2001 Date Data Arrived at EDR: 10/27/2010 Date Made Active in Reports: 12/02/2010 Number of Days to Update: 36	Source: American Journal of Public Health Telephone: 703-305-6451 Last EDR Contact: 12/02/2009 Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned
on air pollution point sources regulated by the information comes from source reports by var steel mills, factories, and universities, and pro	System Facility Subsystem (AFS) nformation Retrieval System (AIRS). AFS contains compliance data U.S. EPA and/or state and local air regulatory agencies. This ious stationary sources of air pollution, such as electric power plants, vides information about the air pollutants they produce. Action, al level plant data. It is used to track emissions and compliance
Date of Government Version: 10/20/2015 Date Data Arrived at EDR: 10/27/2015 Date Made Active in Reports: 01/04/2016 Number of Days to Update: 69	Source: EPA Telephone: 202-564-2496 Last EDR Contact: 09/26/2016 Next Scheduled EDR Contact: 01/09/2017 Data Release Frequency: Annually
US AIRS MINOR: Air Facility System Data A listing of minor source facilities.	
Date of Government Version: 10/20/2015 Date Data Arrived at EDR: 10/27/2015 Date Made Active in Reports: 01/04/2016 Number of Days to Update: 69	Source: EPA Telephone: 202-564-2496 Last EDR Contact: 09/26/2016 Next Scheduled EDR Contact: 01/09/2017 Data Release Frequency: Annually
US MINES: Mines Master Index File Contains all mine identification numbers issue violation information.	ed for mines active or opened since 1971. The data also includes
Date of Government Version: 08/05/2016 Date Data Arrived at EDR: 09/01/2016 Date Made Active in Reports: 09/23/2016 Number of Days to Update: 22	Source: Department of Labor, Mine Safety and Health Administration Telephone: 303-231-5959 Last EDR Contact: 09/01/2016 Next Scheduled EDR Contact: 12/12/2016 Data Release Frequency: Semi-Annually
	s Database Listing I mines are facilities that extract ferrous metals, such as iron

ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 12/05/2005 Date Data Arrived at EDR: 02/29/2008 Date Made Active in Reports: 04/18/2008 Number of Days to Update: 49 Source: USGS Telephone: 703-648-7709 Last EDR Contact: 09/02/2016 Next Scheduled EDR Contact: 12/12/2016 Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011 Date Data Arrived at EDR: 06/08/2011 Date Made Active in Reports: 09/13/2011 Number of Days to Update: 97 Source: USGS Telephone: 703-648-7709 Last EDR Contact: 09/02/2016 Next Scheduled EDR Contact: 12/12/2016 Data Release Frequency: Varies

#### FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 07/20/2015 Date Data Arrived at EDR: 09/09/2015 Date Made Active in Reports: 11/03/2015 Number of Days to Update: 55 Source: EPA Telephone: (212) 637-3000 Last EDR Contact: 09/07/2016 Next Scheduled EDR Contact: 12/19/2016 Data Release Frequency: Quarterly

#### DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 06/02/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/03/2016	Telephone: 202-564-0527
Date Made Active in Reports: 09/02/2016	Last EDR Contact: 08/24/2016
Number of Days to Update: 91	Next Scheduled EDR Contact: 12/12/2016
	Data Release Frequency: Varies
UXO: Unexploded Ordnance Sites A listing of unexploded ordnance site locations	

Date of Government Version: 10/25/2015Source: Department of DefenseDate Data Arrived at EDR: 01/29/2016Telephone: 571-373-0407Date Made Active in Reports: 04/05/2016Last EDR Contact: 09/19/2016Number of Days to Update: 67Next Scheduled EDR Contact: 01/02/2017Data Release Frequency: Varies

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 01/25/2016 Date Data Arrived at EDR: 02/16/2016 Date Made Active in Reports: 03/22/2016 Number of Days to Update: 35 Source: Department of Environmental Conservation Telephone: 518-402-8452 Last EDR Contact: 07/25/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: Annually

COAL ASH: Coal Ash Disposal Site Listing A listing of coal ash disposal site locations.

Date of Government Version: 07/06/2016 Date Data Arrived at EDR: 07/11/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 59	Source: Department of Environmental Conservation Telephone: 518-402-8660 Last EDR Contact: 07/01/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Varies	
DRYCLEANERS: Registered Drycleaners A listing of all registered drycleaning facilities.		
Date of Government Version: 03/31/2016 Date Data Arrived at EDR: 07/13/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 57	Source: Department of Environmental Conservation Telephone: 518-402-8403 Last EDR Contact: 09/12/2016 Next Scheduled EDR Contact: 12/26/2016 Data Release Frequency: Varies	
E DESIGNATION: E DESIGNATION SITE LISTING The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.		
Date of Government Version: 06/16/2016 Date Data Arrived at EDR: 06/24/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 76	Source: New York City Department of City Planning Telephone: 718-595-6658 Last EDR Contact: 09/20/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Varies	
Financial Assurance 1: Financial Assurance Information Listing Financial assurance information.		
Date of Government Version: 07/05/2016 Date Data Arrived at EDR: 07/05/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 65	Source: Department of Environmental Conservation Telephone: 518-402-8660 Last EDR Contact: 07/01/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: Quarterly	
Financial Assurance 2: Financial Assurance Informa A listing of financial assurance information for	ation Listing hazardous waste facilities. Financial assurance is intended to	

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 12/01/2015 Date Data Arrived at EDR: 12/29/2015	Source: Department of Environmental Conservation Telephone: 518-402-8712
Date Made Active in Reports: 02/11/2016	Last EDR Contact: 08/15/2016
Number of Days to Update: 44	Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: Varies

#### HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003 Date Data Arrived at EDR: 10/20/2006 Date Made Active in Reports: 11/30/2006 Number of Days to Update: 41	Source: Department of Environmental Conservation Telephone: 518-402-9564 Last EDR Contact: 05/26/2009 Next Scheduled EDR Contact: 08/24/2009 Data Release Frequency: No Update Planned	
NY MANIFEST: Facility and Manifest Data Manifest is a document that lists and tracks h facility.	nazardous waste from the generator through transporters to a TSD	
Date of Government Version: 08/01/2016 Date Data Arrived at EDR: 08/03/2016 Date Made Active in Reports: 09/09/2016 Number of Days to Update: 37	Source: Department of Environmental Conservation Telephone: 518-402-8651 Last EDR Contact: 08/03/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Annually	
for the control of wastewater and stormwater State law the program is known as the State	stem as been approved by the United States Environmental Protection Agency discharges in accordance with the Clean Water Act. Under New York Pollutant Discharge Elimination System (SPDES) and is broader in Act in that it controls point source discharges to groundwaters as	
Date of Government Version: 05/03/2016 Date Data Arrived at EDR: 05/10/2016 Date Made Active in Reports: 06/17/2016 Number of Days to Update: 38	Source: Department of Environmental Conservation Telephone: 518-402-8233 Last EDR Contact: 08/08/2016 Next Scheduled EDR Contact: 11/07/2016 Data Release Frequency: No Update Planned	
UIC: Underground Injection Control Wells A listing of enhanced oil recovery undergrour	nd injection wells.	
Date of Government Version: 06/06/2016 Date Data Arrived at EDR: 06/08/2016 Date Made Active in Reports: 07/01/2016 Number of Days to Update: 23	Source: Department of Environmental Conservation Telephone: 518-402-8056 Last EDR Contact: 09/08/2016 Next Scheduled EDR Contact: 12/19/2016 Data Release Frequency: Quarterly	
ECHO: Enforcement & Compliance History Information ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.		
Date of Government Version: 09/20/2015 Date Data Arrived at EDR: 09/23/2015 Date Made Active in Reports: 01/04/2016 Number of Days to Update: 103	Source: Environmental Protection Agency Telephone: 202-564-2280 Last EDR Contact: 09/20/2016 Next Scheduled EDR Contact: 01/02/2017 Data Release Frequency: Quarterly	
FUELS PROGRAM: EPA Fuels Program Register This listing includes facilities that are register Programs. All companies now are required to	ed under the Part 80 (Code of Federal Regulations) EPA Fuels	
Date of Government Version: 05/24/2016 Date Data Arrived at EDR: 05/25/2016 Date Made Active in Reports: 07/13/2016 Number of Days to Update: 49	Source: EPA Telephone: 800-385-6164 Last EDR Contact: 08/23/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Quarterly	

#### EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

#### EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A Number of Days to Update: N/A Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A Next Scheduled EDR Contact: N/A Data Release Frequency: No Update Planned

#### EDR Hist Auto: EDR Exclusive Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A Number of Days to Update: N/A Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

#### EDR Hist Cleaner: EDR Exclusive Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A Number of Days to Update: N/A Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

#### EDR RECOVERED GOVERNMENT ARCHIVES

#### Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A Date Data Arrived at EDR: 07/01/2013 Date Made Active in Reports: 12/30/2013 Number of Days to Update: 182 Source: Department of Environmental Conservation Telephone: N/A Last EDR Contact: 06/01/2012 Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

#### RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A Date Data Arrived at EDR: 07/01/2013 Date Made Active in Reports: 01/10/2014 Number of Days to Update: 193 Source: Department of Environmental Conservation Telephone: N/A Last EDR Contact: 06/01/2012 Next Scheduled EDR Contact: N/A Data Release Frequency: Varies

#### COUNTY RECORDS

#### CORTLAND COUNTY:

#### Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 05/18/2016 Date Data Arrived at EDR: 05/24/2016 Date Made Active in Reports: 07/01/2016 Number of Days to Update: 38 Source: Cortland County Health Department Telephone: 607-753-5035 Last EDR Contact: 08/01/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 05/18/2016 Date Data Arrived at EDR: 05/24/2016 Date Made Active in Reports: 07/01/2016 Number of Days to Update: 38 Source: Cortland County Health Department Telephone: 607-753-5035 Last EDR Contact: 08/01/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Quarterly

#### NASSAU COUNTY:

#### Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 04/22/2016	Source: Nassau County Health Department
Date Data Arrived at EDR: 04/26/2016	Telephone: 516-571-3314
Date Made Active in Reports: 06/17/2016	Last EDR Contact: 07/05/2016
Number of Days to Update: 52	Next Scheduled EDR Contact: 10/17/2016
	Data Release Frequency: No Update Planned

#### Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011	Source: Nassau County Office of the Fire Marshal
Date Data Arrived at EDR: 02/23/2011	Telephone: 516-572-1000
Date Made Active in Reports: 03/29/2011	Last EDR Contact: 09/06/2016
Number of Days to Update: 34	Next Scheduled EDR Contact: 11/14/2016
	Data Release Frequency: Varies

#### Registered Tank Database in Nassau County

A listing of facilities in Nassau County with storage tanks.

Date of Government Version: 04/22/2016	Source: Nassau County Department of Health
Date Data Arrived at EDR: 04/26/2016	Telephone: 516-227-9691
Date Made Active in Reports: 06/17/2016	Last EDR Contact: 07/05/2016
Number of Days to Update: 52	Next Scheduled EDR Contact: 10/17/2016
	Data Release Frequency: Varies

#### Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 04/22/2016 Date Data Arrived at EDR: 04/26/2016 Date Made Active in Reports: 06/17/2016 Number of Days to Update: 52 Source: Nassau County Health Department Telephone: 516-571-3314 Last EDR Contact: 07/05/2016 Next Scheduled EDR Contact: 10/17/2016 Data Release Frequency: No Update Planned

Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011	Source: Nassau County Office of the Fire Marshal
Date Data Arrived at EDR: 02/23/2011	Telephone: 516-572-1000
Date Made Active in Reports: 03/29/2011	Last EDR Contact: 09/06/2016
Number of Days to Update: 34	Next Scheduled EDR Contact: 11/14/2016
	Data Release Frequency: Varies

#### ROCKLAND COUNTY:

Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 06/08/2016	Source: Rockland County Health Department
Date Data Arrived at EDR: 06/14/2016	Telephone: 914-364-2605
Date Made Active in Reports: 09/08/2016	Last EDR Contact: 09/06/2016
Number of Days to Update: 86	Next Scheduled EDR Contact: 12/19/2016
	Data Release Frequency: Quarterly

#### Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 06/08/2016 Date Data Arrived at EDR: 06/14/2016 Date Made Active in Reports: 09/08/2016 Number of Days to Update: 86 Source: Rockland County Health Department Telephone: 914-364-2605 Last EDR Contact: 09/06/2016 Next Scheduled EDR Contact: 12/19/2016 Data Release Frequency: Quarterly

#### SUFFOLK COUNTY:

Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 03/03/2015	Source: Suffolk County Department of Health Services
Date Data Arrived at EDR: 03/10/2015	Telephone: 631-854-2521
Date Made Active in Reports: 03/23/2015	Last EDR Contact: 08/01/2016
Number of Days to Update: 13	Next Scheduled EDR Contact: 11/14/2016
	Data Release Frequency: No Update Planned

#### Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 03/03/2015	Source: Suffolk County Department of Health Services
Date Data Arrived at EDR: 03/10/2015	Telephone: 631-854-2521
Date Made Active in Reports: 03/23/2015	Last EDR Contact: 08/01/2016
Number of Days to Update: 13	Next Scheduled EDR Contact: 11/14/2016
	Data Release Frequency: No Update Planned

#### WESTCHESTER COUNTY:

#### Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 02/19/2016 Date Data Arrived at EDR: 02/24/2016 Date Made Active in Reports: 03/22/2016 Number of Days to Update: 27 Source: Westchester County Department of Health Telephone: 914-813-5161 Last EDR Contact: 08/01/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Varies

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 02/19/2016 Date Data Arrived at EDR: 02/24/2016 Date Made Active in Reports: 03/22/2016 Number of Days to Update: 27 Source: Westchester County Department of Health Telephone: 914-813-5161 Last EDR Contact: 08/01/2016 Next Scheduled EDR Contact: 11/14/2016 Data Release Frequency: Varies

#### OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

#### CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 07/30/2013 Date Data Arrived at EDR: 08/19/2013 Date Made Active in Reports: 10/03/2013 Number of Days to Update: 45 NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2013 Date Data Arrived at EDR: 07/17/2015 Date Made Active in Reports: 08/12/2015 Number of Days to Update: 26

PA MANIFEST: Manifest Information Hazardous waste manifest information.

> Date of Government Version: 12/31/2014 Date Data Arrived at EDR: 07/24/2015 Date Made Active in Reports: 08/18/2015 Number of Days to Update: 25

RI MANIFEST: Manifest information Hazardous waste manifest information

> Date of Government Version: 12/31/2013 Date Data Arrived at EDR: 06/19/2015 Date Made Active in Reports: 07/15/2015 Number of Days to Update: 26

Source: Department of Energy & Environmental Protection Telephone: 860-424-3375 Last EDR Contact: 08/10/2016 Next Scheduled EDR Contact: 11/28/2016 Data Release Frequency: No Update Planned

Source: Department of Environmental Protection Telephone: N/A Last EDR Contact: 07/11/2016 Next Scheduled EDR Contact: 10/24/2016 Data Release Frequency: Annually

Source: Department of Environmental Protection Telephone: 717-783-8990 Last EDR Contact: 07/18/2016 Next Scheduled EDR Contact: 10/31/2016 Data Release Frequency: Annually

Source: Department of Environmental Management Telephone: 401-222-2797 Last EDR Contact: 09/20/2016 Next Scheduled EDR Contact: 12/05/2016 Data Release Frequency: Annually

#### VT MANIFEST: Hazardous Waste Manifest Data Hazardous waste manifest information.

Date of Government Version: 05/02/2016 Date Data Arrived at EDR: 05/24/2016 Date Made Active in Reports: 07/13/2016 Number of Days to Update: 50 Source: Department of Environmental Conservation Telephone: 802-241-3443 Last EDR Contact: 07/18/2016 Next Scheduled EDR Contact: 10/31/2016 Data Release Frequency: Annually

#### WI MANIFEST: Manifest Information Hazardous waste manifest information.

Date of Government Version: 12/31/2015 Date Data Arrived at EDR: 04/14/2016 Date Made Active in Reports: 06/03/2016 Number of Days to Update: 50

Source: Department of Natural Resources Telephone: N/A Last EDR Contact: 09/12/2016 Next Scheduled EDR Contact: 12/26/2016 Data Release Frequency: Annually

#### **Oil/Gas Pipelines**

Source: PennWell Corporation

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

#### Electric Power Transmission Line Data

Source: PennWell Corporation

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

#### AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

**Public Schools** 

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary

and secondary public education in the United States. It is a comprehensive, annual, national statistical

database of all public elementary and secondary schools and school districts, which contains data that are

comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers Source: Department of Health Telephone: 212-676-2444

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA Telephone: 877-336-2627 Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands Source: Department of Environmental Conservation Telephone: 518-402-8961

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

#### STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

# **GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM**

#### TARGET PROPERTY ADDRESS

JPMC BRANCH PORTFOLIO 491 MAIN STREET NEW ROCHELLE, NY 10801

#### TARGET PROPERTY COORDINATES

Latitude (North):	40.909388 - 40° 54' 33.80''
Longitude (West):	73.781494 - 73° 46' 53.38''
Universal Tranverse Mercator:	Zone 18
UTM X (Meters):	602622.3
UTM Y (Meters):	4529201.5
Elevation:	94 ft. above sea level

#### USGS TOPOGRAPHIC MAP

Target Property Map:	5940557 MOUNT VERNON, NY
Version Date:	2013

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principal investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

#### **GROUNDWATER FLOW DIRECTION INFORMATION**

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


#### **TOPOGRAPHIC INFORMATION**

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

#### TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General East

#### SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

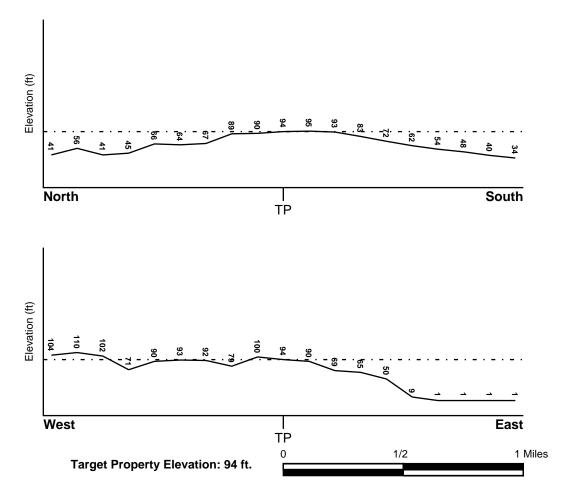

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

#### HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

#### FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
36119C0341F	FEMA FIRM Flood data
Additional Panels in search area:	FEMA Source Type
36119C0342F 36119C0343F 36119C0344F	FEMA FIRM Flood data FEMA FIRM Flood data FEMA FIRM Flood data
NATIONAL WETLAND INVENTORY	
NWI Quad at Target Property	NWI Electronic Data Coverage
MOUNT VERNON	YES - refer to the Overview Map and Detail Map

#### HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:			
Search Radius:	1.25 miles		
Status:	Not found		

#### **AQUIFLOW®**

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID Not Reported LOCATION FROM TP GENERAL DIRECTION GROUNDWATER FLOW

#### **GROUNDWATER FLOW VELOCITY INFORMATION**

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

#### **GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY**

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.


#### **ROCK STRATIGRAPHIC UNIT**

## GEOLOGIC AGE IDENTIFICATION

Era:	Paleozoic	Category:	Stratified Sequence
System:	Ordovician		
Series:	Middle Ordovician (Mohawkian)		
Code:	O2 (decoded above as Era, System & S	Series)	

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).



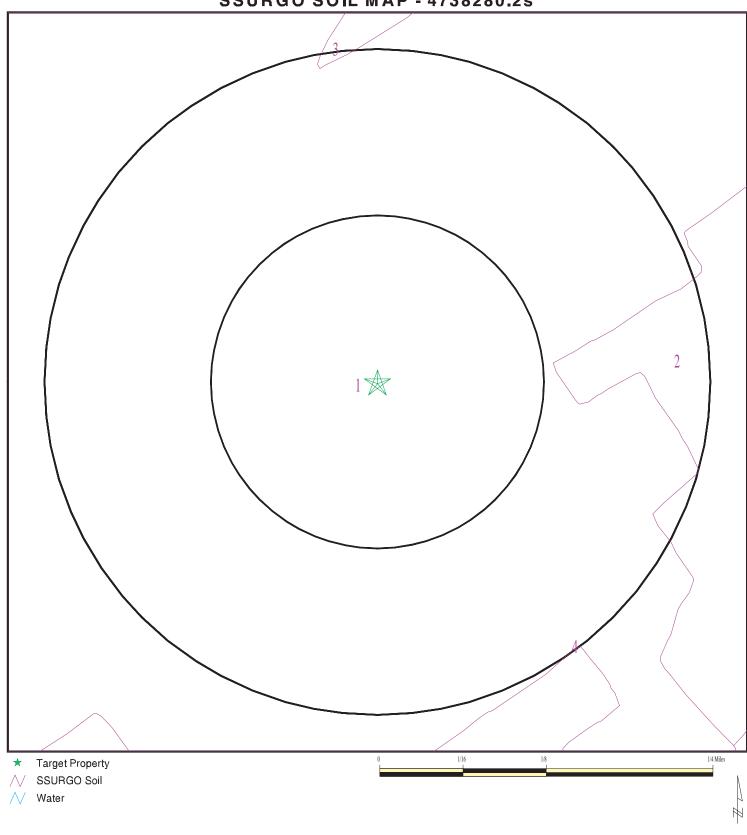

SITE NAME: ADDRESS:	JPMC Branch Portfolio 491 Main Street
LAT/LONG:	New Rochelle NY 10801 40.909388 / 73.781494

	CLIENT: CONTACT: INQUIRY #: DATE:	Partner Engineering and Science, Inc. Jenny Banh 4738280.2s September 27, 2016 4:18 pm		
	DAIL.	September 27, 2010 4.16 pm		
Copyright © 2016 EDR, Inc. © 2015 TomTom Rel. 2015.				

#### DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1	
Soil Component Name:	Urban land
Soil Surface Texture: Hydrologic Group:	Not reported
Soil Drainage Class: Hydric Status: Unknown	
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 0 inches
Depth to Watertable Min:	> 0 inches
No Layer Information available.	

Soil Map ID: 2	
Soil Component Name:	Urban land
Soil Surface Texture: Hydrologic Group:	Not reported
Soil Drainage Class: Hydric Status: Unknown	
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 77 inches
Depth to Watertable Min:	> 0 inches
No Layer Information available.	

Soil Map ID: 3	
Soil Component Name:	Udorthents
Soil Surface Texture:	gravelly loam
Hydrologic Group:	Not reported
Soil Drainage Class:	Somewhat poorly drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 127 inches

Depth to Watertable Min: > 38 inches

	Soil Layer Information						
	Βοι	undary		Classification		Saturated hydraulic	
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec	Soil Reaction (pH)
1	0 inches	3 inches	gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand.	Max: 141 Min: 4	Max: 7.3 Min: 4.5
2	3 inches	72 inches	very gravelly loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Gravels, Gravels with fines, Clayey Gravel	Max: 42 Min: 0.42	Max: 8.4 Min: 4.5

Soil Map ID: 4	
Soil Component Name:	Urban land
Soil Surface Texture:	gravelly loam
Hydrologic Group:	Not reported
Soil Drainage Class: Hydric Status: Unknown	
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 0 inches
Depth to Watertable Min:	> 61 inches
No Layer Information available.	

#### LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

#### WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 0.001 miles
State Database	1.000

#### FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS40000835790	0 - 1/8 Mile North
2	USGS40000835842	1/8 - 1/4 Mile NNW
3	USGS40000835896	1/2 - 1 Mile NNE
4	USGS40000835908	1/2 - 1 Mile NNE
5	USGS40000835943	1/2 - 1 Mile NNW
6	USGS40000835557	1/2 - 1 Mile SSW
7	USGS40000835919	1/2 - 1 Mile NE

#### FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

		LOCATION
MAP ID	WELL ID	FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

#### STATE DATABASE WELL INFORMATION

		LOCATION
MAP ID	WELL ID	FROM TP


No Wells Found

#### **OTHER STATE DATABASE INFORMATION**

#### STATE OIL/GAS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	NYOG80000040052	1/2 - 1 Mile West
A2	NYOG8000040051	1/2 - 1 Mile West
A3	NYOG8000040050	1/2 - 1 Mile West
A4	NYOG8000040053	1/2 - 1 Mile West
A5	NYOG8000040049	1/2 - 1 Mile West

# **PHYSICAL SETTING SOURCE MAP - 4738280.2s**

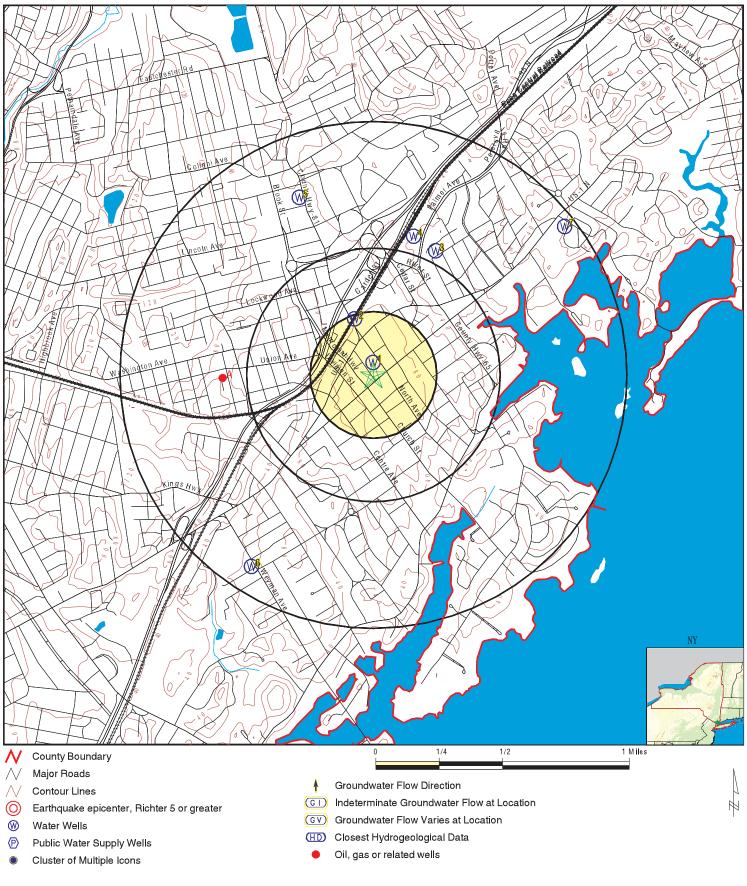

|--|

Map ID Direction					
Distance Elevation				Database	EDR ID Number
1 North 0 - 1/8 Mile Lower				FED USGS	USGS40000835790
Org. Identi	ifier:	USGS-NY			
Formal na	ime:	USGS New York Water S	cience Center		
Monloc Ide	entifier:	USGS-405436073465501			
Monloc na		WE 105			
Monloc typ		Well			
Monloc de		Not Reported		Not Demonte d	
Huc code:		02030102	Drainagearea value:	Not Reported	
Drainagea		Not Reported	Contrib drainagearea:	Not Reported	
	ainagearea units:	-73.7815215	Latitude:	40.9100993 Not Reported	
Longitude: Horiz Acc		5	Sourcemap scale: Horiz Acc measure units:	seconds	
	ection method:	Interpolated from map	Honz Acc measure units.	Seconds	
Horiz coor		NAD83	Vert measure val:	98.00	
Vert meas	•	feet	Vertacc measure val:	5	
	easure units:	feet	vonaco mododro val	0	
	tion method:	Interpolated from topogra	ohic map		
Vert coord		NGVD29	Countrycode:	US	
Aquifernar	•	Not Reported			
Formation	type:	Bedrock			
Aquifer typ	be:	Not Reported			
Constructi	on date:	Not Reported	Welldepth:	268	
Welldepth		ft	Wellholedepth:	Not Reported	
Wellholede	epth units:	Not Reported			
		· · ·			
Ground-wa		er of Measurements: 1			
Date	Feet below Surface	Feet to Sealevel			
 1955	8.00				
	8.00				
2 NNW				FED USGS	USGS40000835842
1/8 - 1/4 Mile Lower	9				
Org. Identi	ifier.	USGS-NY			
Formal na		USGS New York Water S	cience Center		
Monloc Ide		USGS-405445073470001			
Monloc na		WE 100			
Monloc typ	pe:	Well			
Monloc de	esc:	Not Reported			
Huc code:		02030102	Drainagearea value:	Not Reported	
Drainagea	area Units:	Not Reported	Contrib drainagearea:	Not Reported	
Contrib dra	ainagearea units:	Not Reported	Latitude:	40.9125993	
Longitude:		-73.7829104	Sourcemap scale:	Not Reported	
Horiz Acc		5	Horiz Acc measure units:	seconds	
	ection method:	Interpolated from map		05.00	
Horiz coor	•	NAD83	Vert measure val:	85.00	
Vert meas		feet	Vertacc measure val:	5	
	easure units:	feet	abia man		
Vertcollect Vert coord	tion method:	Interpolated from topogra NGVD29	pnic map Countrycode:	US	
Aquifernar	•	Not Reported	CountryCoue.	00	
Formation		Bedrock			
	.,,				

Aquifer ty		Not Reported		000	
Construct		Not Reported	Welldepth:	300	
Welldepth		ft	Wellholedepth:	Not Reported	
Wellholed	epth units:	Not Reported			
Ground-w	ater levels, Numb Feet below	er of Measurements: 1 Feet to			
Date	Surface	Sealevel			
1955	8.00				
NE 2 - 1 Mile ower				FED USGS	USGS40000835890
Org. Ident	ifier:	USGS-NY			
Formal na	ime:	USGS New York Water So	cience Center		
Monloc Id	entifier:	USGS-405459073463801			
Monloc na	ame:	WE 104			
Monloc ty	pe:	Well			
Monloc de		Not Reported			
Huc code	:	02030102	Drainagearea value:	Not Reported	
Drainagea	area Units:	Not Reported	Contrib drainagearea:	Not Reported	
	ainagearea units:	Not Reported	Latitude:	40.9164881	
Longitude		-73.7767991	Sourcemap scale:	Not Reported	
Horiz Acc	measure:	5	Horiz Acc measure units:	seconds	
Horiz Coll	ection method:	Interpolated from map			
Horiz coo		NAD83	Vert measure val:	35.00	
Vert meas	sure units:	feet	Vertacc measure val:	5	
Vert accm	easure units:	feet			
Vertcollec	tion method:	Interpolated from topograp	ohic map		
Vert coord	d refsys:	NGVD29	Countrycode:	US	
Aquiferna	•	Not Reported			
Formation	type:	Bedrock			
Aquifer ty		Not Reported			
Construct		Not Reported	Welldepth:	750	
Welldepth		ft	Wellholedepth:	Not Reported	
•	epth units:	Not Reported	·	•	
Ground-w		er of Measurements: 1			
Data	Feet below	Feet to			
Date	Surface	Sealevel			
1955	15.00				
NE 2 - 1 Mile ower				FED USGS	USGS4000083590
Org. Ident	ifier:	USGS-NY			
Formal na		USGS New York Water So	cience Center		
Monloc Id		USGS-405502073464401			
Monloc na		WE 283			
Monloc ty		Well			
Monloc de		Not Reported			
Huc code		02030102	Drainagearea value:	Not Reported	
	area Units:	Not Reported	Contrib drainagearea:	Not Reported	
-	ainagearea units:		Latitude:	40.9173214	
		-73 7784658	Sourceman scale	Not Reported	

Sourcemap scale:

Longitude:

-73.7784658

Not Reported

Horiz Acc measure:	5	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	50.00
Vert measure units:	feet	Vertacc measure val:	5
Vert accmeasure units:	feet		
Vertcollection method:	Interpolated from topographic m	ар	
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Bedrock		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	Not Reported
Welldepth units:	Not Reported	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 0

# 5 NNW 1/2 - 1 Mile Lower

FED USGS USGS40000835943

Org. Identifier:	USGS-NY			
Formal name:	USGS New York Water Science Center			
Monloc Identifier:	USGS-405510073471501			
Monloc name:	WE 98			
Monloc type:	Well			
Monloc desc:	Not Reported			
Huc code:	02030102	Drainagearea value:	Not Reported	
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported	
Contrib drainagearea units:	Not Reported	Latitude:	40.9195436	
Longitude:	-73.7870772	Sourcemap scale:	Not Reported	
Horiz Acc measure:	5	Horiz Acc measure units:	seconds	
Horiz Collection method:	Interpolated from map			
Horiz coord refsys:	NAD83	Vert measure val:	55.00	
Vert measure units:	feet	Vertacc measure val:	5	
Vert accmeasure units:	feet			
Vertcollection method:	Interpolated from topographic ma	ιp		
Vert coord refsys:	NGVD29	Countrycode:	US	
Aquifername:	Not Reported			
Formation type:	Bedrock			
Aquifer type:	Not Reported			
Construction date:	Not Reported	Welldepth:	401	
Welldepth units:	ft	Wellholedepth:	Not Reported	
Wellholedepth units:	Not Reported			
Ground-water levels, Numb	er of Measurements: 1			
Feet below	Feet to			

Feet below Feet to Date Sealevel Surface 4.00

1955

6 SSW 1/2 - 1 Mile Lower

FED USGS USGS40000835557

Org. Identifier: Formal name: Monloc Identifier: Monloc name:	USGS-NY USGS New York Water Science USGS-405354073472801 WE 103	Center	
Monloc type:	Well		
Monloc desc:	Not Reported		
Huc code:	02030101	Drainagearea value:	Not Reported
Drainagearea Units:	Not Reported	Contrib drainagearea:	Not Reported
Contrib drainagearea units:	Not Reported	Latitude:	40.8984329
Longitude:	-73.7906885	Sourcemap scale:	Not Reported
Horiz Acc measure:	5	Horiz Acc measure units:	seconds
Horiz Collection method:	Interpolated from map		
Horiz coord refsys:	NAD83	Vert measure val:	50.00
Vert measure units:	feet	Vertacc measure val:	5
Vert accmeasure units:	feet		
Vertcollection method:	Interpolated from topographic ma	ар	
Vert coord refsys:	NGVD29	Countrycode:	US
Aquifername:	Not Reported		
Formation type:	Bedrock		
Aquifer type:	Not Reported		
Construction date:	Not Reported	Welldepth:	220
Welldepth units:	ft	Wellholedepth:	Not Reported
Wellholedepth units:	Not Reported		

Ground-water levels, Number of Measurements: 1 Feet below Feet to Date Surface Sealevel

1955 12.00

#### 7 NE 1/2 - 1 Mile Lower

USGS-NY Org. Identifier: Formal name: USGS New York Water Science Center USGS-405504073460301 Monloc Identifier: WE1055 Monloc name: Monloc type: Well Monloc desc: Not Reported Not Reported Huc code: 02030102 Drainagearea value: Not Reported Not Reported Drainagearea Units: Contrib drainagearea: Contrib drainagearea units: Not Reported 40.917877 Latitude: Longitude: -73.7670766 Sourcemap scale: Not Reported Horiz Acc measure: 5 Horiz Acc measure units: seconds Horiz Collection method: Interpolated from map NAD83 Vert measure val: 40 Horiz coord refsys: Vert measure units: feet Vertacc measure val: 1 Vert accmeasure units: feet Interpolated from topographic map Vertcollection method: US Vert coord refsys: NGVD29 Countrycode: Aquifername: Not Reported Formation type: Till

FED USGS USGS40000835919

Aquifer type: Not Reported Construction date: Not Reported Welldepth units: ft Wellholedepth units: Not Reported

Welldepth: Wellholedepth: 17 Not Reported

Ground-water levels, Number of Measurements: 1 Feet below Feet to Date Surface Sealevel ---------------

1955 3.00

Map ID
Direction
Distance

. .

Database

EDR ID Number

A1 West 1/2 - 1 Mile			OIL_GAS NYOG80000040052
Api wellno:	31119237750000	Cnty:	0
Hole:	23775	Sidetrck:	0
Completion:	0	Well name:	SCW 4
Company na:	180 Union Avenue Owner LP	Operator n:	2438
Well type:	TH	Map symbol:	0
Well statu:	AC	Date statu:	2008-11-13 00:00:00
Date permi:	2008-04-04 00:00:00	Permit iss:	2008-05-13 00:00:00
Date spudd:	2008-09-02 00:00:00	Date total:	2008-09-19 00:00:00
Date well :	2008-10-09 00:00:00	Date wel00:	Not Reported
Date wel01:	2	Confid:	Released
Town:	New Rochelle	Quad:	Mount Vernon
Quadsec:	Н	Producing :	Not Applicable
Producin00:	Not Applicable	Financial :	True
Slant:	Vertical	County:	Westcheste
Region:	3	State leas:	NA
Proposed d:	1500	Surface lo:	SURF
Surface 00:	-73.792499		
Surface la:	40.909323		
Bottom hol:	BH		
Bottom h00:	-73.792499		
Bottom h01:	40.909323		
True verti:	500	Measured d:	500
Kickoff:	0	Drilleddep:	500
Elevation:	75	Original w:	TH
Permit fee:	670	Objective :	NA - Geoexchange
Depth fee:	570	Spacing:	Exempt - not an oil or gas well
Spacing ac:	Not Reported	Integratio:	Ν
Dt hearing:	Not Reported	Dt mod:	2009-03-02 08:26:15.897000000
Link:	http://www.dec.ny.gov/cfmx/ext	apps/GasOil/search/well	s/index.cfm?api=31119237750000
Site id:	NYOG8000040052		

## A2 West 1/2 - 1 Mile

Api wellno: Hole: Completion: Company na: Well type: Well statu: Date permi: Date spudd: Date well : Date wel01: Town: Quadsec: Producin00: Slant: Region: Proposed d: Surface 00: Surface la: Bottom hol: Bottom h00:

#### 31119237740000 23774 0 180 Union Avenue Owner LP ΤН AC 2008-04-04 00:00:00 2008-08-21 00:00:00 2008-10-09 00:00:00 2 New Rochelle Н Not Applicable Vertical 3 1500 -73.792772 40.909283 BΗ -73.792772

#### Cnty: Sidetrck: Well name: Operator n: Map symbol: Date statu: Permit iss: Date total: Date wel00: Confid: Quad: Producing : Financial : County: State leas: Surface lo:

#### OIL\_GAS

NYOG80000040051

0 0 SCW 3 2438 0 2008-11-13 00:00:00 2008-05-13 00:00:00 2008-09-16 00:00:00 Not Reported Released Mount Vernon Not Applicable True Westcheste NA SURF

Bottom h01:	40.909283			
True verti:	500	Measured d:	500	
Kickoff:	0	Drilleddep:	500	
Elevation:	73	Original w:	ТН	
Permit fee:	670	Objective :	NA - Geoexchange	
Depth fee:	570	Spacing:	Exempt - not an oil or gas well	
Spacing ac:	Not Reported	Integratio:	Ν	
Dt hearing:	Not Reported	Dt mod:	2009-03-02 08:26:30.367000000	
Link:	http://www.dec.ny.gov/cfmx/extapps/GasOil/search/wells/index.cfm?api=31119237740000			
Site id:	NYOG8000040051			

#### A3 West 1/2 - 1 Mile

### OIL\_GAS

NYOG80000040050

Api wellno:	31119237730000	Cnty:	0
Hole:	23773	Sidetrck:	0
Completion:	0	Well name:	SCW 2
Company na:	180 Union Avenue Owner LP	Operator n:	2438
Well type:	NL	Map symbol:	OP
Well statu:	PA	Date statu:	2008-11-06 00:00:00
Date permi:	2008-04-04 00:00:00	Permit iss:	2008-05-13 00:00:00
Date spudd:	2008-07-10 00:00:00	Date total:	2008-07-19 00:00:00
Date well :	Not Reported	Date wel00:	2008-10-10 00:00:00
Date wel01:	2	Confid:	Released
Town:	New Rochelle	Quad:	Mount Vernon
Quadsec:	Н	Producing :	Not Applicable
Producin00:	Not Applicable	Financial :	True
Slant:	Vertical	County:	Westcheste
Region:	3	State leas:	NA
Proposed d:	1500	Surface lo:	SURF
Surface 00:	-73.792953		
Surface la:	40.909185		
Bottom hol:	BH		
Bottom h00:	-73.792953		
Bottom h01:	40.909185		
True verti:	1500	Measured d:	1500
Kickoff:	0	Drilleddep:	1500
Elevation:	71	Original w:	TH
Permit fee:	670	Objective :	NA - Geoexchange
Depth fee:	570	Spacing:	Exempt - not an oil or gas well
Spacing ac:	Not Reported	Integratio:	Ν
Dt hearing:	Not Reported	Dt mod:	2009-03-02 08:26:56.020000000
Link:	http://www.dec.ny.gov/cfmx/ext	apps/GasOil/search/wells/index	x.cfm?api=31119237730000
Site id:	NYOG8000040050		

A4 West 1/2 - 1 Mile

OIL\_GAS NYOG8000040053

Api wellno:	31119237760000	Cnty:	0
Hole:	23776	Sidetrck:	0
Completion:	0	Well name:	SCW 5
Company na:	180 Union Avenue Owner LP	Operator n:	2438
Well type:	TH	Map symbol:	0
Well statu:	AC	Date statu:	2008-11-13 00:00:00
Date permi:	2008-04-04 00:00:00	Permit iss:	2008-05-13 00:00:00
Date spudd:	2008-09-08 00:00:00	Date total:	2008-09-23 00:00:00
Date well :	2008-10-09 00:00:00	Date wel00:	Not Reported
Date wel01:	2	Confid:	Released
Town:	New Rochelle	Quad:	Mount Vernon
Quadsec:	Н	Producing :	Not Applicable
Producin00:	Not Applicable	Financial :	True
Slant:	Vertical	County:	Westcheste
Region:	3	State leas:	NA
Proposed d:	1500	Surface lo:	SURF
Surface 00:	-73.793036		
Surface la:	40.909069		
Bottom hol:	ВН		
Bottom h00:	-73.793036		
Bottom h01:	40.909069		
True verti:	500	Measured d:	500
Kickoff:	0	Drilleddep:	500
Elevation:	69	Original w:	ТН
Permit fee:	670	Objective :	NA - Geoexchange
Depth fee:	570	Spacing:	Exempt - not an oil or gas well
Spacing ac:	Not Reported	Integratio:	Ν
Dt hearing:	Not Reported	Dt mod:	2009-03-10 07:50:13.420000000
Link:	http://www.dec.ny.gov/cfmx/exta	pps/GasOil/search/wells/index.	.cfm?api=31119237760000
Site id:	NYOG8000040053		

#### Α5 West 1/2 - 1 Mile

Surface 00:

Surface la:

Bottom hol:

Bottom h00:

#### Api wellno: 31119237720000 23772 Hole: Completion: 0 Company na: Well type: TΗ Well statu: AC Date permi: Date spudd: Date well : Date wel01: 2 Town: New Rochelle Quadsec: н Not Applicable Producin00: Slant: Vertical Region: 3 Proposed d: 1500

ΒH

-73.793051

180 Union Avenue Owner LP 2008-04-04 00:00:00 2008-09-08 00:00:00 2008-10-09 00:00:00 -73.793051 40.909223

#### Well name: Operator n: Map symbol: Date statu: Permit iss: Date total: Date wel00: Confid: Quad: Producing : Financial : County: State leas: Surface lo:

Cnty:

Sidetrck:

0 0 SCW 1 2438 0 2008-11-13 00:00:00 2008-05-13 00:00:00 2008-09-23 00:00:00 Not Reported Released Mount Vernon Not Applicable True Westcheste NA SURF

OIL\_GAS

NYOG8000040049

Bottom h01:	40.909223		
True verti:	500	Measured d:	500
Kickoff:	0	Drilleddep:	500
Elevation:	72	Original w:	TH
Permit fee:	670	Objective :	NA - Geoexchange
Depth fee:	570	Spacing:	Exempt - not an oil or gas well
Spacing ac:	Not Reported	Integratio:	Ν
Dt hearing:	Not Reported	Dt mod:	2009-03-10 07:49:59.300000000
Link:	http://www.dec.ny.gov/c	fmx/extapps/GasOil/search/well	s/index.cfm?api=31119237720000
Site id:	NYOG8000040049		

## AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
WESTCHESTER	BEDFORD	108	2.44	1.65	21.7
WESTCHESTER	CORTLANDT	169	5.15	2.22	95.4
WESTCHESTER	EASTCHESTER	76	2.89	1.75	41.9
WESTCHESTER	GREENBURGH	222	2.26	1.46	21.8
WESTCHESTER	HARRISON	69	3.3	2.07	42.3
WESTCHESTER	LEWISBORO	72	3.91	2.61	19.2
WESTCHESTER	MAMARONECK	123	4	2.42	35.9
WESTCHESTER	MT. KISCO	38	2.33	1.72	9.3
WESTCHESTER	MT. PLEASANT	172	2.13	1.43	17.1
WESTCHESTER	MT. VERNON	53	2.82	1.65	32
WESTCHESTER	NEW CASTLE	134	2.2	1.46	31.7
WESTCHESTER	NEW ROCHELLE	127	1.92	1.31	13.8
WESTCHESTER	NO. CASTLE	64	3.49	2.25	16.5
WESTCHESTER	NO. SALEM	56	3.78	2.56	25.7
WESTCHESTER	OSSINING	65	2.08	1.39	10.9
WESTCHESTER	PEEKSKILL	47	3.66	2.34	19.9
WESTCHESTER	PELHAM	26	2.5	1.91	9.1
WESTCHESTER	POUND RIDGE	34	3.37	2.22	18.5
WESTCHESTER	RYE	98	2.24	1.63	9.5
WESTCHESTER	SCARSDALE	138	2.35	1.63	22.4
WESTCHESTER	SOMERS	72	3.89	2.82	21.3
WESTCHESTER	WHITE PLAINS	132	2.76	1.48	65.2
WESTCHESTER	YONKERS	153	2.23	1.37	16
WESTCHESTER	YORKTOWN	181	2.7	1.72	27.2

#### Federal EPA Radon Zone for WESTCHESTER County: 3

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Number of sites tested: 650					
Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L	
Living Area Basement	0.930 pCi/L 1.730 pCi/L	97% 84%	3% 13%	0% 2%	

#### Federal Area Radon Information for WESTCHESTER COUNTY, NY

#### **TOPOGRAPHIC INFORMATION**

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map Source: U.S. Geological Survey

#### HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA Telephone: 877-336-2627 Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation Telephone: 518-402-8961

#### HYDROGEOLOGIC INFORMATION

AQUIFLOW<sup>R</sup> Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

#### **GEOLOGIC INFORMATION**

#### Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

#### STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS) The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS) Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

# PHYSICAL SETTING SOURCE RECORDS SEARCHED

#### LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS) This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells Source: New York Department of Health Telephone: 518-458-6731

#### **OTHER STATE DATABASE INFORMATION**

Oil and Gas Well Database Department of Environmental Conservation Telephone: 518-402-8072 These files contain records, in the database, of wells that have been drilled.

#### RADON

State Database: NY Radon Source: Department of Health Telephone: 518-402-7556 Radon Test Results

Area Radon Information

Source: USGS Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

**EPA Radon Zones** 

Source: EPA Telephone: 703-356-4020 Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

#### OTHER

Airport Landing Facilities: Private and public use landing facilities Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

# PHYSICAL SETTING SOURCE RECORDS SEARCHED

#### STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

# APPENDIX D: QUALIFICATIONS





## **Education**

Bachelors of Art, Environmental Studies, Ramapo College-2015 Masters of Art, Sustainability Studies, Ramapo College expected graduation 5/2017

## **Highlights**

1 year of experience in the environmental education field working at the meadowland environment center as an ecology teacher for grades K-12

5 years of experience in customer service, dealing with clients with the utmost level of professionalism.

## **Experience Summary**

Ms. Soder performs due diligence assessments for a variety of property types and the needs and requirements of varied number of reporting standards, including ASTM standards, EPA's All Appropriate Inquiry (AAI), and customized client formats. Ms. Fort will be performing Phase I Environmental Site Assessments and other related environmental assessments for multi-family residential, commercial office buildings, shopping centers, and multi-tenant commercial complexes.

## **Project Experience**

## **Phase I Environmental Site Assessment**

*300 South Technology Drive, Central Islip, NY.* Participated in an assessment of a 4.5 ac vacant lot for development of an addition of a pharmaceutical company.

*89-15 138<sup>th</sup> Street, Queens, New York.* Participated in an assessment of a construction zone to be developed as a multi-family elevator building.

*2195 US Route 1 & Elizabeth Street, North Brunswick, New Jersey.* Participated in an assessment of a 2.5 ac lot of wooded land to be develop for the future use of a Holiday Inn.

73 South Broadway, Nyack, New York. Participated in a ghost write for a current mixed commercial residential structure with two residential units and a dance studio tenant. Facility was previously a drycleaner for ten years.

## Affiliations

Hawthorne Environmental Commission, Hawthorne Green Team.

## Contact

csoder@partneresi.com

www.PARTNEResi.com



## **Education**

BS, Environmental Geoscience, Boston College Economics & GIS coursework, University of Maine

## Training

40-Hour OSHA HAZWOPER

## **Highlights**

15 years in the environmental service industry12 years of experience in Phase I Environmental Site Assessments3 years of experience with NEPA documentation2 years of experience with land management for the United States Army

## **Experience Summary**

Ms. Morrissey serves as a Project Manager and technical reviewer for Partner Engineering and Science, Inc. (Partner) a variety of Clients with specific attention to financial scopes of work including SBA, Foreclosures, and others. Ms. Morrissey is currently involved in the daily Quality Assurance/Quality Control (QA/QC) and technical reviews of Phase I Environmental Site Assessment reports that have been performed throughout the United States.

Ms. Morrissey has significant experience in due diligence assessments for a variety of property types and the needs and requirements of varied number of reporting standards, including ASTM standards, EPA's All Appropriate Inquiry (AAI), and customized client formats. Specifically, Ms. Morrissey has performed Phase I Environmental Site Assessments, Environmental Transaction Screens, Phase II Subsurface Investigations and has reviewed Phase I Environmental Site Assessments, Environmental Site Assessments, Environmental Site Assessments, Environmental Transaction Screens, Phase II Subsurface Investigations, Remediation Design projects, Asbestos Surveys and Operation and Maintenance Plans, Lead-based Paint Surveys and Operation and Maintenance Plans, Radon Studies, Mold Assessments, Lead-in-water sampling and analysis, and NEPA reports.

## **Project Experience**

Ms. Morrissey has served as Project Manager for 1,200+ projects during her time with Partner, including Phase I Environmental Site Assessments, Property Condition Assessments, Zoning Reports, Seismic Reports, Environmental Transaction Screens, Desktop Reviews, Peer Reviews, Asbestos Surveys and Operation and Maintenance Plans, Lead-based Paint Surveys and Operation and Maintenance Plans, and Radon Studies.

Ms. Morrissey has served as Technical Reviewer for 1,700+ projects during her time with Partner, including Phase I Environmental Site Assessments, Environmental Transaction Screens, Desktop Reviews, Peer Reviews, Asbestos Operation and Maintenance Plans, Lead-based Paint Operation and Maintenance Plans, and Radon Studies.

Ms. Morrissey was responsible for overseeing environmental compliance nationwide for a telecommunications company. She was responsible for reviewing all Phase I Site Assessments and NEPA documentation for industry compliance and accuracy. She created a national database of parties with potential interest in the impacts of telecommunication tower development to ensure that the highest level

of due diligence was achieved. Ms. Morrissey delivered educational programs on environmental compliance to internal and external audiences.

Ms. Morrissey served as the Environmental Compliance Manager for MMA Financial's DUS and Tax Credit groups. During her five years at MMA, she was involved in over 400 projects worth over 2 billion dollars in revenue, half of which was for Fannie Mae or Freddie Mac projects. She served as a technical resource for originators and administration and ensured that all projects met the ASTM E1527-05 standard, EPA's All Appropriate Inquiry (AAI), Fannie Mae DUS, and Freddie Mac standards as appropriate. Ms. Morrissey's technical contributions aided in ensuring that the investors' standard of care had been achieved. During her tenure at MMA Financial, Fannie Mae waved the requirement for their checklist to be completed for MMA Financial projects as the internal environmental standards in place were found to be sufficient. Additionally, she standardized MMA Financial's environmental compliance standards and timelines for all projects.

Ms. Morrissey planned, managed, and executed road and land improvement projects with the assistance of Military Manpower (the National Guard Reserve Engineers, Marine Reserve Engineers, and Naval Reserve Seabees) on US Army Base Fort Devens, in Devens, Massachusetts. These projects additionally served as a training opportunity for the involved units. These projects were completed to assist in maintaining the 4,800 acres of United States Army training land that comprise Fort Devens. Ms. Morrissey received recognition from the Fort Devens' Base Commander for the completion of projects with the National Guard Reserve Engineers.

Ms. Morrissey served as the only GIS professional at Fort Devens, providing maintenance of data, as well as mapping projects for project planning and completion documentation.

## **Publications**

Fort Devens Integrated Training Area Management (ITAM) 5 Year Plan, 2012

## Contact

smorrissey@partneresi.com





## **Education**

Bachelors of Science, Natural Resources, The Ohio State University Masters of Environmental Studies, University of Pennsylvania

## Training

OSHA, Hazardous Waste Operator (HAZWOPER) 40 hour Certification U.S. Environmental Protection Agency, Accredited Asbestos Building Inspector

## **Highlights**

11 years in the environmental due diligence industry Manages due diligence team across a broad spectrum of clientele, services and requirements Served as Technical Director for U.S. SBA guaranteed lending prior to moving to the United Kingdom Expert opinion in support of ASTM E1527 tort cases in U.S. Establishment and operation of Partner's European consultancy from London UK

## **Experience Summary**

Mr. Gregor currently serves as the Managing Director of Partner Engineering and Science Ltd., based in London, United Kingdom. Mr. Gregor is responsible for the development of European technical services and client relationships as well as the operational management of the London office. Mr. Gregor develops and implements short, medium, and long term growth plans incorporating Partner's Mission Statement and Core Values. Mr. Gregor has technical knowledge across several sectors and significant experience in developing technical product and expanding client relationships in the lending, development, and private equity sectors, as well as in team and project management.

Mr. Gregor, prior to heading the European consultancy, managed an internal team of Relationship Managers, Project Managers, and associated staff in the performance of physical, technical due diligence assessments across the USA. These assessments consisted of Phase I ESAs, Phase II Investigations, Property Condition Reports, land surveys, zoning reports, and radon, lead, asbestos, mold, and other potential business and health risk surveys. Additionally, Mr. Gregor provided technical support throughout the company for assessments performed in accordance with U.S. Small Business Administration SOP requirements, and managed his own portfolio of Private Equity clientele. Mr. Gregor has managed numerous large portfolio acquisitions and divestments for PE clientele and has directly managed thousands of environmental due diligence assessments.

In addition, Mr. Gregor has provided expert opinion on ASTM tort cases as they relate to the US SBA SOP, and, at a previous firm, was director of all environmental due diligence services including: project management and oversight; staff supervision; employee training; report review; and client management. Mr. Gregor has also directly performed hundreds of Phase I ESAs, Phase II Limited Subsurface Investigations, and various industrial hygiene (radon, mold, asbestos, LBP) surveys both in the USA and internationally.

## **Project Experience**

*Heavy Industrial Facilities, Netherlands & Northern Ireland.* Large bank client and a manufacturing corporation with international footprint conducting debt restructuring with multiple heavy manufacturing facilities in Europe and the USA as collateral. Partner Engineering and Science Ltd. conducted Phase I Environmental Site Assessments at manufacturing facilities in Gelderland and outside Belfast. The facilities

had large footprints and long term historical industrial use. Mr. Gregor provided technical expertise to the bank and was present during the on-site inspection due to the scale and complexity of the property use.

*Petrol Station Portfolio, Multiple Locations, California USA.* Private equity client was the potential purchaser of over 200 retail gas station sites. Partner conducted multiple scopes of work at each site, including Phase I ESAs, Property Condition Reports, Seismic Loss Evaluations, and/or Phase II Limited Subsurface Investigations. Mr. Gregor managed the overall project and ensured a satisfactory delivery to all stakeholders, including joint venture partners and lenders, involved. This portfolio transaction also involved a sophisticated insurance component due to the sensitive nature of property use.

*Low-rise Office Building Portfolios, Multiple Locations, Netherlands.* Mr. Gregor managed building surveys and environmental assessments for the purchase of several groups of low-rise (one – five story) office buildings across the major cities of the Netherlands. The properties were well maintained but aged and utilizing older systems, particularly in regard to refrigeration and vertical conveyance. Additionally, very shallow, often below sea level, groundwater conditions complicated potential environmental impacts.

*HMS Queen Mary, Long Beach, California USA.* This assessment was performed for a potential purchasing group of the HMS Queen Mary and surrounding port and surface water area in the Port of Long Beach. Mr. Gregor personally conducted the Phase I ESA and review of asbestos abatement for the former luxury passenger ship and adjacent Russian World War II submarine. Also included in the transaction were nearly twenty (20) acres of imported fill which made up the land for the parking lot and retail shops and approximately thirty-five (35) acres of surface water.

*Transatlantic Telecommunications Centres, Multiple Locations, England & Ireland.* Mr. Gregor managed Phase I ESAs for multiple locations of an international telecommunications company. The facilities contained significant amounts of sensitive transatlantic cabling and associated power, backup, and data handling equipment, with highly sensitive end-user clients. Due to the physical nature of the data transfer, Partner evaluated multiple centres in remote locations along the coasts of England and Ireland, as well as the USA and Canada.

*Buckhead Office Complex, Atlanta, Georgia USA*. Mr. Gregor managed multiple scopes of work involved in the acquisition of a large Class A office complex outside Atlanta, Georgia USA. This complex was occupied by a single tenant, a multi-national corporation using the site as their international corporate headquarters. In addition to the large scale of the facilities, Partner guided the private equity client and their JV partner and lender through a complex root intrusion problem plaguing a portion of the site.

*Fixed-Based Operation (FBO) Terminals, Multiple Locations, United Kingdom & France.* Mr. Gregor managed building surveys and environmental assessments for the acquisition of a group of FBO terminals at airports across the United Kingdom and France. The properties were had long aviation histories including aircraft fueling and heavy maintenance operations, and complex lease agreements.

*Expert Opinion, Tort Case, Los Angeles, California USA.* Mr. Gregor provided expert opinion to the legal counsel for a party in a case involving both the ASTM E1527 and U.S. SBA SOP 5010 standards. The case revolved around a dry cleaner release site and the question of adequate performance of the Phase I ESA.

## Contact

cgregor@partneresi.com

