



DRAFT

REMEDIAL INVESTIGATION

WORK PLAN

Parcel B of the

ALCO-Maxon Site

(Formerly a.k.a. Nott Street Industrial Park)

Prepared on behalf of: BCP Applicant:
Maxon-Alco Holdings, LLC
301 Nott Street
Schenectady, New York

Prepared By:
Kleinfelder, Inc.
99 Lamberton Road, Suite 201
Windsor, Connecticut 06095

May 24, 2010

Copyright 2010 Kleinfelder
All Rights Reserved

UNAUTHORIZED USE OF THIS DOCUMENT IS STRICTLY PROHIBITED BY
ANYONE OTHER THAN THE CLIENT FOR THE SPECIFIC BCP PROJECT



This bound report:

**REMEDIAL INVESTIGATION WORK PLAN
for Parcel B of the
ALCO-Maxon Site (a.k.a. Nott Street Industrial Park)**

was prepared, reviewed, and approved by:

Technical Author

Anna M. Smith
Senior Project Geologist

Technical Reviewer

Kurt A. Frantzen, PhD, CHMM
Senior Principal Scientist

Principal-in-Charge

David C. Raymes
Vice President

Table of Contents

Cover Page	
Signature Page	i
Table of Contents	ii

TABLE OF CONTENTS

1.0 INTRODUCTION AND PURPOSE	1
2.0 SITE HISTORY AND DESCRIPTION	3
2.1 DESCRIPTION.....	3
2.2 HISTORIC USE OF THE SITE AND ADJOINING PROPERTIES.....	4
2.2.1 <i>Historic Use</i>	4
2.2.2 <i>Abutters</i>	5
2.3 PREVIOUS INVESTIGATIONS.....	5
2.4 REVIEW AND INTERPRETATION OF PERTINENT ENVIRONMENTAL DATA.....	5
3.0 OBJECTIVES OF CURRENT INVESTIGATION.....	7
3.1 QUALITATIVE EXPOSURE ASSESSMENT	7
3.1.1 <i>Area of Concern</i>	8
3.1.2 <i>Exposure Assessment</i>	9
3.1.3 <i>Contaminant Source</i>	10
3.1.4 <i>Sensitive Receptor Survey</i>	10
3.1.5 <i>Release/Transport Mechanisms</i>	11
3.1.6 <i>Points of Exposure</i>	11
3.1.7 <i>Routes of Exposure</i>	12
3.1.8 <i>Receptor Population</i>	13
3.1.9 <i>Conclusion</i>	13
3.2 FISH AND WILDLIFE RESOURCE IMPACT ANALYSIS	13
3.3 OBJECTIVES	ERROR! BOOKMARK NOT DEFINED.
3.4 GOALS	17
4.0 PROPOSED SCOPE OF WORK	18
4.1 BUILDINGS.....	18
4.2 SOIL AND GROUNDWATER ASSESSMENT	18
4.2.1 <i>Surface Soil Assessment</i>	18
4.2.2 <i>Subsurface Soil Assessment</i>	19
4.2.3 <i>Groundwater Monitoring</i>	20
4.3 QUALITY ASSURANCE PLAN FOR SOIL AND GROUNDWATER ASSESSMENT	22
4.3.1 <i>Field Screening</i>	22
4.3.1.1 Summary	22
4.3.1.2 Calibration	23

4.3.1.3 Field Screening Methods	23
4.3.2 Laboratories	24
4.3.3 Analytical Methods	25
4.3.4 Environmental Media Sampling.....	25
4.3.5 Data Usability Summary Report	27
4.4 SOIL VAPOR ASSESSMENT	27
4.4.1 Sampling Procedures	27
4.4.1.1 Subsurface Samples.....	27
4.5 QUALITY ASSURANCE OF SOIL VAPOR ASSESSMENT.....	30
4.5.1 Quality Assurance for Air Sampling.....	30
4.5.1.1 Sampling Instruments / Equipment Calibration and Frequency	30
4.5.1.2 Analytical Methods	31
4.5.1.3 Quality Assurance / Quality Control Samples	31
4.6 TANKS, STORAGE FACILITIES, AND DRAINAGE STRUCTURES.....	31
4.7 HISTORIC FILL ASSESSMENT	32
5.0 SCHEDULE AND REPORTING.....	33
5.1 SCHEDULE	33
5.2 REPORTING	33
5.3 ALTERNATIVES ANALYSIS.....	34
6.0 REFERENCES	35

Tables

Table 1 – Existing and Proposed Monitoring Well Construction

Table 2 – Proposed Soil Sampling Locations and Analytical Methods

Table 3 – Proposed Groundwater Sampling Locations and Analytical Methods

Table 4 – Proposed Soil Vapor Sampling Locations and Analytical Methods

Table 5 – Proposed Schedule for Site Investigation

Figures

Figure 1 - Site Locus

Plates

Plate 1 – Tax Parcels

Plate 2 – Site Layout

Plate 3 – Conceptual Site Model (CSM)

Plate 4 – Investigation Sample Locations

Appendices

Appendix A Historic Environmental Data and Recognized Environmental Conditions Summary

Appendix B Waste Management Plan

Appendix C Health and Safety Plan

Appendix D NYSDOH Indoor Air Quality Questionnaire and Building Inventory Center for Environmental Health

Appendix E Investigation Team Qualifications

Acronym List

ALCO: American Locomotive Company
AOC: Area of Concern
AST: Aboveground Storage Tank
BBL: Blasland, Bouck & Lee, Inc.
BCP: Brownfield Cleanup Program
COPCs: Constituents of Potential Concern
CSM: Conceptual Site Model
DUSR: Data Usability Summary Report
FWRIA: Fish and Wildlife Resource Impact Analysis
GE: The General Electric Company
GSC: Geologic Services Corporation
HASP: Health and Safety Plan
RIWP: Remedial Investigation Work Plan
KLF: Kleinfelder, Inc.
LNAPL: Light Non-Aqueous Phase Liquid
NYSDEC: New York State Department of Environmental Conservation
NYSDOH: New York State Department of Health
PAHs: polycyclic aromatic hydrocarbons
PCBs: polychlorinated biphenyls
REC: Recognized Environmental Condition
SIC: Schenectady Industrial Corporation
SRS: Sensitive Receptor Survey
SVOC: Semi-Volatile Organic Compound
TCL/TAL: total contaminant list and total analyte list
USEPA: United States Environmental Protection Agency
UST: Underground Storage Tank
VOC: Volatile Organic Compound
Works: Schenectady Locomotive Works
Y-S: Young/Sommer, LLC

1.0 Introduction and Purpose

Kleinfelder, Inc. (KLF) prepared this Site Investigation and Phase II Work Plan (or remedial investigation work plan [RIWP]) to accompany the BCP Application of Maxon ALCO Holdings, LLC (MAH, or the Client). MAH plans to implement a remedial action program and then to redevelop the property referred to as ALCO-Maxon Parcel B (or Parcel B), which is located on the central portion of the ALCO-Maxon Site (which will be referred to herein as the Site). The entire Site (which includes three large parcels: A, B, and C), and is also known as the Nott Street Industrial Park, is located at Nott Street and Erie Boulevard in the City of Schenectady, New York (as shown on Figure 1).

KLF, on behalf of the Applicant, has evaluated the existing contaminant data with regard to Parcel B. KLF respectfully suggests that Parcel B is fully eligible for investigation and remediation under the New York State Brownfield Cleanup Program ("BCP"). This RIWP is submitted together with a BCP Application by MAH as a "Volunteer" to the New York State Department of Environmental Conservation ("NYSDEC") BCP.

Parcel B includes a portion of a tax lot of land with City and County of Schenectady Real Property tax lot number summarized below and shown on Plate 1:

- A majority portion of Lot 39.49-2-1.311.

The general purposes of this proposed RIWP are to:

- Supplement the historic investigations that have been conducted on the Site,
- Further identify source(s) of contamination,
- Define the nature and extent of that contamination,
- Assess the impact of contamination on public health or the environment, and

-
- Provide information for the development and selection of a remedial work plan across all parcels (A, B, and C) that make up the Alco property.

Upon completion of the RIWP, KLF will be in a position to submit a Final Site Investigation Report for Parcel B, along with an Alternatives Analysis for Parcel B.

As described elsewhere (see §2.3), the entire Site, including Parcel B, has been the subject of considerable investigation and environmental remedial activity over the last two decades. This RIWP presents the proposed additional investigative steps required to identify and evaluate existing data gaps in the environmental knowledge base for Parcel B of the Site, to delineate the nature and extent of contamination and assess the potential impact to public health and environment. Additionally, the proposed investigation will provide data required for the evaluation of remedial options and the selection of remedial action programs for consideration by the NYSDEC.

The identification and assessment of current data gaps includes further delineation of surface soil, subsurface soil, groundwater, and characterization of soil vapor quality. The proposed plan includes the installation of additional on-site test pits and soil borings with soil sampling for appropriate constituents, additional on-site groundwater monitoring well installation/sampling for appropriate constituents, and on-site soil vapor characterization.

This RIWP includes a description of Parcel B (§2), presents the objectives of the remedial investigation (§3), summarizes the proposed scope of work (§4), and proposes a schedule and reporting framework (§5), consistent with the requirements under the BCP.

2.0 Site History and Description

2.1 Description

Parcel B may be described as follows:

Parameter	Information/Comments
ADDRESS	301 Nott Street, Schenectady, New York
LOCATION	42°49'29.25" North, 73°56'2.28" West
COUNTY	Schenectady County
ASSESSOR'S PARCEL NOS.	39.49-2-1.311 See Plate 1
LEGAL DESCRIPTION	See Plates 1 and 2
ACREAGE	Approximately 17.3 acres
ZONING	C-3, Waterfront Development District

Figure 1 is site locus map based upon the applicable USGS 7.5 minute topographic quadrangle map. Plate 2 presents a detailed layout, including buildings and infrastructure of the Site, including Parcel B and its relationship to Parcels A and C.

Parcel B has various structures and/or improvements observed (See Plate 2):

Parameter	General Observations
STRUCTURES	Four large and mid-sized buildings
IMPROVEMENTS	Asphalt parking areas Public Water Electrical Service Sewerage

2.2 Historic Use of the Site and Adjoining Properties

2.2.1 Historic Use

The Schenectady Locomotive Engine Manufactory initially developed a portion of the existing Park in 1849. In 1851, the company changed its name to Schenectady Locomotive Works (Works) and continued to develop the Site. Although an 1866 fire destroyed most of the main buildings, the Works continued to rebuild and develop the land. In 1901, the Works merged with several other companies to form the American Locomotive Company (ALCO). ALCO manufactured steam locomotives until 1946, when manufacturing of diesel-electric locomotives began. During World War II, ALCO also produced battlefield tanks, marine boilers, and other war-related equipment. By 1948, ALCO was manufacturing only diesel-electric locomotives. A new multi-million dollar centralized diesel locomotive construction facility was built in 1958. The production of diesel locomotives continued until 1969, when ALCO closed, terminating 121 years of locomotive manufacturing in Schenectady. Schenectady Industrial Corporation (SIC) purchased the Park in 1971.

The General Electric Company (GE) occupied the Park from 1971 to 1985. Small industrial, manufacturing and fabrication companies have occupied various buildings within the Park since 1985, when GE began to release buildings back to SIC.

In 2010, after purchasing the property, the Volunteer (MAH) divided the Property into three parcels: Parcel A, Parcel B and Parcel C (see Plate 2). Again, this Work Plan is focused on Parcel B. Parcels A and C are addressed as separate BCP sites.

2.2.2 Abutters

The current abutting properties include the following:

Direction	Land Use Description
NORTH	Parcel A, beyond which is the Mohawk River
SOUTH	Parcel C, beyond which is Industrial/commercial
EAST	Industrial/commercial
WEST	Industrial/commercial, residential within 0.25 miles down Front Street.

2.3 Previous Investigations

The attached exhibits summarize previous investigations, underground storage tank (UST) removal assessments, and remedial activities at the site. The Final Investigation Report (“FIR”) will incorporate these previously performed activities and their findings and results. These prior site investigation and remediation activities provide a firm foundation for the development of this final Investigation Work Plan to be implemented across Parcel B. See Appendix A for details.

2.4 Review and Interpretation of Pertinent Environmental Data

A review of the pertinent environmental data pertaining to this site led to the development of a Conceptual Site Model (CSM, Plate 3, described in the next section) which addresses known source areas and current data gaps. The CSM also includes a tabulation of Recognized Environmental Conditions at the Site. The REC table identifies a variety of data gaps, which are to be filled through the completion of the investigation proposed herein. The AOCs and RECs pertaining to Parcel B are listed below. For details of AOCs and RECs, which were identified in reports for the entire former ALCO site, see Appendix A.

Parcel	REC #	REC Description
A	1	Parcel 324 & A43/College Creek Outfalls
A	10	River - Bank / Sediment
A	20A	Building 320 UST
A	20B	Building 320 AST
A	21	Building 322
A	22	Building 324
A	23	Buildings 326/328
A	33	Building 344
A	34	Building 346
A & B	2	Parcel 322 & Building 320 Waste Tank
A & B	9A	PCB Removal
A & B	19	Building 320
A, B & C	6	Chlorinated Solvent Plume
A, B & C	8	EVI Parcel
B	9B	Mercury Removal
B	15	Building 308
B	16	Building 308 UST
B	18	Building 318
B	30	Building 340
B	31	Building 342
B	32	Building 342 AST
C	3	Building 332 Former Fuel Oil UST
C	4	Building 332 Former Fuel Oil USTs
C	5	Site Entry Area, Parcel 304 & Parcel 306
C	7	Erie Blvd. Substation Area
C	11	Building 300
C	12	Building 304
C	13	Building 304 UST
C	14	Building 306
C	17	Building 316
C	24	Buildings 330/Addition
C	25	Building 332
C	26	Building 334
C	27	Building 336
C	28	Building 336 UST
C	29	Building 338

3.0 Objectives of Current Investigation

3.1 Qualitative Exposure Assessment

A preliminary qualitative exposure assessment for the site was prepared, resulting in a CSM (Plate 3) and REC Table (Appendix A). This assessment included identifying former, existing and potential contaminant sources, potential points and routes of exposure, completing a sensitive receptor survey (SRS) and demonstrating the release fate and transport mechanisms. The investigation work plan will incorporate the previously compiled discussion of the qualitative exposure assessment.

Using the available data and information, KLF has prepared a CSM. The purpose of conceptual models is to provide a clear spatial understanding of the Site and immediate area to aid the identification of actual or potential contaminant sources, to present the current understanding of potential environmental transport pathways, to help in the identification of possible human and ecological receptors of hazardous substances, and insight into possible complete routes of exposure. Plate 3 presents the CSM for the Site and shows:

- The Site, which due to its general historical land use is considered potentially impacted by the former release of petroleum or other chemical constituents in soil, soil gas, and groundwater, as well as certain building components.
- Environmental Transport Pathways for possible Constituents of Potential Concern (COPCs).
- Possible (human) Receptors and the potential Exposure Routes.

The long history of industrial activity at the Site resulted in generalized soil impacts, and certain former aboveground storage tanks (ASTs) and USTs, among other on-site and off-site activities, resulted in the contamination of both soils and groundwater at the site.

Possible human receptors of site-related contamination include:

- On-Site Workers and/or Visitors/Trespassers—may potentially be exposed to potentially contaminated surface soils, soil vapor, groundwater seeps, and hazardous building materials.
- On-Site Workers (construction and/or utility)—due to the general subsurface soil contamination, as well as possible contamination associated with buried infrastructure (such as power lines, pipes, and sewers).

3.1.1 Area of Concern

The New York State Department of Environmental Conservation (NYSDEC) defines areas of concern (AOCs) as:

[A]ny existing or former location(s) where hazardous substances, hazardous wastes, or petroleum are or were known or suspected to have been discharged, generated, manufactured, refined, transported, stored, handled, treated, released, disposed, or where hazardous substances, hazardous wastes, or petroleum have or may have migrated.

As many as six AOCs have been defined previously for the Site consisting of Parcels A, B and C; however, based upon the available data, soils and groundwater across the entire Site could be considered of concern. The previously identified AOCs included possible soil, groundwater, and/or soil vapor contamination.

The AOCs which specifically pertain to Parcel B include AOC-3, which is an area suspected of fuel oil impact, AOC-4, which is an area suspected of petroleum impact and AOC-6, which is an area suspected of chlorinated solvent impact. See Plate 3 for location details regarding these AOCs. The RECs which specifically pertain to Parcel B include RECs 3, 4, 6, 8, 9A, 9B, 15, 16, 18, 19,

20A, 30, 31 and 32. A detailed description of these RECs is included in Appendix A.

3.1.2 Exposure Assessment

A public health exposure assessment qualitatively considers the potential for people to be exposed to contaminants originating from the Site. According to the New York State Department of Health (NYSDOH), as cited in Appendix 3B of NYSDEC's DER-10 Guidance, 2002, there are five elements necessary to have a complete Exposure Pathway:

- A contaminant source, such as waste disposal areas;
- A contaminant release and transport mechanism, which might carry contaminants from the source to points where exposure may occur;
- A point of exposure, where actual or potential human contact with contaminated media may occur;
- A route of exposure (inhalation, ingestion, absorption); and
- A receptor population, such as people who could be exposed to the contaminants at the point of exposure.

Decisions regarding the existence of exposure pathways are based upon the following:

- An exposure pathway, as defined, exists when each element exists.
- A potential exposure pathway exists when one or more of the elements are not fully known, but the others are present and identifiable.
- An exposure pathway does not exist when one of the five elements does not exist, has not existed in the past, and will not exist in the future.

The following discussion analyzes the potential for exposure pathways to exist at this site.

3.1.3 Contaminant Source

Chemical constituents within soils and groundwater at the Site are the result of long-term industrial and urban activity at and around the site. The majority of the constituents are derived from petroleum products, oils, and lubricants, various heavy metals used in industrial process, and, in a limited area, chlorinated solvents. These constituents were released to the environment either during normal operations leaks and spills, leaking tanks (above ground or underground), or from large spills or tank releases from off-site that entered the Site via buried municipal infrastructure such as sewers or its bedding.

3.1.4 Sensitive Receptor Survey

Sensitive receptor information was collected in late 2009 by KLF for the Site. Within 1 mile of the Site, the estimated population is 13,489 persons; additionally, there are:

Type	Within 1 Mile Radius
Day Care Centers	Yes
Medical Centers	No
Nursing Homes	Yes
Schools	Yes
Hospitals	Yes
Colleges	Yes
Arena	No
Prison	No

On-site receptors are typically workers, visitors, or trespassers. There are no data establishing an off-site exposure threat associated with contaminants on the site.

3.1.5 Release/Transport Mechanisms

The following release/transport mechanisms have been identified for the Site that are relevant to Parcel B:

- Former tank/piping release—there is sufficient data to suggest that both off-site and on-site former tanks leaked resulting in petroleum fuel releases into the subsurface on the site.
- Migration from Soil into Groundwater—the available data indicate that soils near these tanks became saturated allowing product to flow through the soil to groundwater under the site.
- Migration along buried infrastructure—the available data support the conclusion that leaked fuels flowed within sewers or their bedding from off-site as well as on-site through the site traveling east to west.
- Migration of Contaminated Groundwater—data indicate migration of contaminated groundwater has occurred on the Site, consistent with groundwater flow towards the Mohawk River.
- Volatilization into Air—the potential for volatile organic compounds (VOCs), such as the chemicals observed in soil or groundwater, to volatilize into soil gas and then into either ambient air or intrude into indoor air at buildings on-site.

Based on a review of the release/transport mechanisms, the potential exists for groundwater migration and volatilization of chlorinated solvents into air, as well as impacts along various types of buried infrastructure (sewers and piping) on Parcel B.

3.1.6 Points of Exposure

The following have been identified as the potential points of exposure on the site:

- Use of Potable Water—the site and surrounding areas are served by public water. It does not now appear that drinking water is a point of exposure. The primary down-gradient issue is the river but there is no data reflecting an adverse impact associated with the site on surface water quality.
- Construction—disturbance of subsurface soils will likely be performed in the upper 7-feet of surface soils. The concentrations detected in soils vary across the site and at depths varying from near surface down to 20 feet bgs. There is potential for exposure to workers generally at the site, and potential when working on or about former ASTs and USTs, as well as buried infrastructure such as piping and sewers.
- Volatilization of Groundwater Contamination—groundwater measurements made during prior investigations indicate a water table 10 feet bgs or less. The potential for volatilization exists, although it remains unmeasured.

In summary, there appears to be complete exposure pathways present within Parcel B in various locations, as well as potential exposure pathways.

3.1.7 Routes of Exposure

The following have been identified as the potential routes of exposure:

- Ingestion of Contaminated Groundwater—is unlikely because no down-gradient receptors are identifiable and the site is serviced by municipal water and sewer.
- Inhalation of VOCs from Soil Vapor—is possible in and around those areas with known subsurface areas with subsurface contamination.
- Incidental Ingestion and Absorption through Dermal Contact of on-site Contaminated Soils and Groundwater—contact with soil is not a route of exposure for routine commercial workers because shallow soils are generally not contaminated. Dermal contact during construction is

probable. Dermal contact with groundwater (about 7-12-feet bgs on Site, as shallow as approximately 15-feet bgs off site) is possible during normal construction related activities.

In summary, there appears to be several routes of potential exposure in Parcel B via incidental ingestion and dermal contact to subsurface soil or groundwater and/or inhalation of fuel-related VOCs and in certain areas because of migration from Parcel C of the site of chlorinated solvent VOCs from soil vapor from within Parcel B.

3.1.8 Receptor Population

The receptor population consists of commercial personnel and construction (utility, etc.) personnel conducting intrusive activities on Parcel B.

3.1.9 Conclusion

Based on a review of the above elements, a complete exposure pathway exists for direct soil exposure and soil vapor while on Parcel B. Potentially complete exposure pathways exist for groundwater and soils across Parcel B where intrusive investigation or construction activities will be conducted.

Asbestos, lead based paint and other hazardous materials associated with the buildings on the Site are of a concern and known to exist. These materials are to be abated in concert with the demolition of the buildings and therefore are not be addressed within this RIWP. A demolition work plan will be submitted to the NYSDEC, if such work is conducted after Parcel B is accepted into the BCP.

3.2 Fish and Wildlife Resource Impact Analysis

The NYSDEC normally requires the completion of the first component (i.e., Resource Characterization) of a Fish and Wildlife Resources Impact Analysis (FWRIA, see

§3.10.1 of NYSDEC 2002). The purpose of the analysis is to identify actual or potential impacts to fish and wildlife resources from Site contaminants of ecological concern. The first step of the Resource Characterization is completion of the Agency's FWRIA Decision Key (see Appendix 3C of NYSDEC's DER-10 Guidance, 2002). KLF completed the Decision Key below (see the next page; decision key answers are in **BOLD**). Based on the available data and land use, especially the lack of off-site impacts, as determined from prior investigation, KLF concludes that a FWRIA need not be undertaken.

3.3 Objectives

KLF understands that MAH anticipates entering into three BCP Agreements with NYSDEC in 2010, one for each development parcel (A, B, and C). Under the BCP, Parcel B (as well as the other development parcels) will go through several stages, coordinated with the overall development of the Site, and these stages include the following:

- *Application*—Prepare necessary documentation required under the BCP
- *IWP*—Submit to NYSDEC for approval an Investigation Work Plan to fill in remaining data gaps. [See Section 4 below]
- *Investigation*
 - o Complete investigation activities and submit report[s] to NYSDEC for approval
 - o Identify, plan, and perform Interim Remedial Measures (IRM) if necessary, applicable, and approved by the NYSDEC

*§3.3 continues on the page following the
Fish and Wildlife Resources Impact Analysis Decision Key*

Fish and Wildlife Resources Impact Analysis Decision Key

1. Is the site or area of concern a discharge or spill event? If "YES" go to: 13 If "**NO**" go to: **2**
2. Is the site or area of concern a point source of contamination to groundwater that will be prevented from discharging to surface water? Soil contamination is not widespread, or if widespread, is confined under buildings and paved areas. If "YES," go to 13; If "**NO**," go to **3**
3. Is the site, and all adjacent property, a developed area with buildings, paved surfaces and little or no vegetation? If "**YES**," go to **4**, If "NO" go to 9
4. Does the site contain habitat of an endangered, threatened, or special concern species? If "YES," go to PRC, If "**NO**," go to 5
5. Has the contamination gone off site? If "YES," go to 6, if "**NO, there are no data that reflect off-site impact associated with site contaminants**" go to 14
6. Is there any discharge or erosion of contamination to surface water or the potential for discharge or erosion of contamination? If "**YES**," go to **7**, if "NO," go to 14
7. Are the site contaminants polychlorinated biphenyls (PCBs), pesticides or other persistent, bioaccumulable substances? If "YES" go to: PRC If "**NO**" go to: **8**
8. Does contamination exist at concentrations that could exceed SCGs or be toxic to aquatic life if discharged to surface water? If "YES, for some on-site detections" go to: PRC If "**NO, there are no data that reflect off-site impact associated with site contaminants**" go to: **14**
9. Does the site or any adjacent or downgradient property contain any of the following resources?

a) Any endangered, threatened, or special concern species or rare plants or their habitat	f) Drainage ditch or channel
b) Any State designated significant habitats or rare State Ecological Communities	g) Other surface water feature
c) Tidal or freshwater wetlands	h) Other marine or freshwater habitat
d) Stream, creek or river	i) Forest
e) Pond, lake, lagoon	j) Grassland or grassy field
	k) Parkland or woodland
	l) Shrubby area
	m) Urban wildlife habitat
	n) Other terrestrial habitat

If "YES" go to: 11 If "NO" go to: 10
10. Is the lack of resources due to the contamination? If "YES" go to: PRC If "NO" go to: 14
11. Is the contamination a localized source which has not migrated and will not migrate from the source to impact any on-site or off-site resources? If "YES" go to: 14 If "NO" go to: 12
12. Does the site have widespread soil contamination that is not confined under and around buildings or paved areas? If "YES" go to: PRC If "**NO**" go to: 13
13. Does the contamination at the site or area of concern have the potential to migrate to, erode into or otherwise impact any on-site or off-site habitat of endangered, threatened or special concern species or other fish and wildlife resource? (See #9 for list of potential resources. Contact appropriate agency for information regarding endangered species.) If "YES" go to: PRC If "**NO**" go to: 14
14. **No Fish and Wildlife Resources Impact Analysis needed.**

-
- *Remedy Selection*
 - o Based upon investigation results, an approach to remedying the contamination will be developed in consultation with NYSDEC. An Alternatives Analysis will be prepared and the Volunteer will recommend for DEC consideration remedial programs for each parcel/BCP site.
 - o Submit Final Remediation Work Plans for NYSDEC approval
 - *Construction*
 - o Implement active remediation measures, which may include:
 - Remove and remedy remaining USTs and ASTs and surrounding, impacted soils
 - Remediate other source soils, to the extent necessary
 - Treat areas with light non-aqueous phase liquid (LNAPL)
 - Treat the chlorinated solvent plume
 - Integrated geotechnical cap and foundation system(s)
 - o Submit appropriate Site Management Plan(s) [SMP] and Final Engineering Report(s) [FER] for NYSDEC approval
 - o Complete construction and create/record institutional controls/engineering controls (IC/EC) programs and Environmental Easement[s]
 - *Liability Releases and Operation, Monitoring, and Maintenance (OM&M)*
 - o NYSDEC issues Certificates of Completion
 - o Perform supplemental monitoring as needed

3.4 Goals

The goals of the Final RIWP proposed herein include:

1. Filling of remaining data gaps with respect to contamination of soil, soil gas, and groundwater media within Parcel B.
2. Delineation of impacts to the underground infrastructure within Parcel B.

4.0 Proposed Scope of Work

The scope of work focuses on environmental contaminant conditions within Parcel B. Note: KLF is not recommending further investigation of background soil or off-site surface water or sediments as part of this assessment.

4.1 Buildings

As part of the redevelopment of the Site, the Volunteer intends to perform an ACM / hazardous materials survey that will include ACM, LBP, HBM, and liquids/solids sampling (within buildings). Further, KLF understands that abatement will occur should, as anticipated, ACM, LBP, or HBM be discovered. Such a course of action is necessary to advance the re-development of the Site. In the event that this building related work is performed after the submission of the BCP Application, the Volunteer expects to submit a building demolition work plan to the NYSDEC for review and approval, most likely as an Interim Remedial Measure ("IRM").

4.2 Soil and Groundwater Assessment

Despite almost 18 years of assessment, remediation, and monitoring and the large amount of available data, KLF recommends additional assessment of surface and subsurface soils, as well as groundwater, to fill-in data gaps and clarify current groundwater quality conditions.

4.2.1 Surface Soil Assessment

The Parcel B RI will include an updated survey of surface soil conditions across the Parcel. This survey will include collection of approximately eight soil samples analyzed for: aromatic volatile organic compounds (AVOCs), a select set of semi-volatile organic hydrocarbons (polycyclic aromatic hydrocarbons [PAHs]), PCBs,

total analyte list (TAL) metals and chlorinated solvents. A map (Plate 4) showing the anticipated locations of these soil samples is attached hereto.

4.2.2 Subsurface Soil Assessment

Because of known historic conditions, three areas on the Site, and the main portion of the Site, have known data gaps concerning subsurface conditions and associated sewer lines that transect Parcel B, namely:

- **Area 3**—A 2,700-gallon UST, suspected to have been used for the storage of fuel oil, was removed from Area 3 in November 1992. The UST was located adjacent to the north side of Building 332. UST closure samples contained concentrations of VOCs which exceeded regulatory criteria. KLF recommends advancing a soil test pit and installing a soil vapor point within this area to determine current impact levels.
- **Northern Edge of Area 4**—Area 4 has an active remedial system present. The system is used to address what is thought to be a fuel oil release from certain former tanks on the southwest side of Building 332. There also is a stormwater conduit running through this area. KLF recommends visual inspection of this sewer line from catch basins D29, -33, and -40 and from D-7 to their convergence, which then leads off to the outfall D42 at the Mohawk River. This investigation would clarify if the sewer lines (and possibly associated annulus) act as a storage area or a conveyance system for possible petroleum materials. This data, together with the previously developed Area 3 and 4 data are expected to be sufficient to recommend an overall remedial approach to resolving the petroleum hydrocarbon contamination in this area of the site.
- **Mid-section of Area 6**—Area 6 is a chlorinated solvent plume running from Erie Boulevard (MW-19) beneath Building 332, towards the Mohawk River (MW-51), the mid-section of the plume is within the boundary of Parcel B. KLF recommends investigation downgradient of this Area in Parcel A, rather than from within Parcel B.

-
- **Other Portions of the Parcel**—in addition to the Areas mentioned above, KLF recommends further evaluating the nature of possible impacts within the Parcel B by installing a test pit and several soil borings/surface soil samples and collecting soil samples.
 - This set of soil test pits and borings will be coordinated with the anticipated geotechnical evaluation of the property. As such, this investigation component will include approximately 5 borings advanced within Parcel B, generally advanced to 20 feet bgs, unless deeper extents are essential as part of the geotechnical investigation.

Much of this work would involve the use of a backhoe to place test pits and visual inspection of the soils, groundwater (if present) and structures (if present), along with limited sampling of subsurface soils. Of course, prior to subsurface exploration private Site utility clearance protocol would be implemented as well as initial clearing using air-knifing techniques to avoid shallow unmarked utilities or other subsurface hazards and obstructions. The environmental samples would require laboratory analysis for the general suite of volatile/semi-volatile organic hydrocarbons, heavy metals, and PCBs. If hydrocarbon product is observed, then KLF will sample it for hydrocarbon fingerprint analysis by a laboratory.

4.2.3 Groundwater Monitoring

The last full round of groundwater sampling occurred in 2001. Although additional sampling has occurred since then, it has been limited to select areas. Therefore, the completion of another round of sampling in Parcel B as detailed below will be undertaken.

- **Area 3**—MW-12 was installed in March 1994 at the request of NYSDEC to monitor groundwater in the location of a former UST. Subsequent data suggested the presence of VOCs and SVOCs in groundwater at this location. Because of this data, monitoring well MW-12D was installed in December 1998. Initial sampling detected free-phase petroleum product in MW-12D. Neither subsequent groundwater data collected in December

1999 nor regularly scheduled monitoring of MW-12 and MW-12D indicate that a free-phase petroleum plume exists around these monitoring wells. Attribution of the lone detection of petroleum-related hydrocarbons in MW-12D was to the disturbance of stained subsurface soils rather than the presence of free product. However, groundwater collected from MW-12 during the last sampling event in December 1999 continued to indicate the presence of VOCs and SVOCs in Area 3. In December 2007, KLF recommended continuing scheduled monitoring of MW-12 and MW-12D for the presence of free-phase petroleum product. KLF proposes re-sampling MW-12 and MW-12D for VOCs and SVOCs to clarify the conditions in this area.

- **Area 4**—in 1986, GE reportedly closed four diesel fuel or motor oil USTs located adjacent to the northeast corner of Building 332 by filling them with sand/concrete. Several groundwater investigations conducted in this area subsequent to the UST closure identified the presence of free-phase petroleum products. In January 2006, KLF installed an active LNAPL recovery system in MW-36, MW-36B, and MW-36C, which removes floating LNAPL in these wells. Semi-monthly (1-2 times each month) system checks are used to improve operational efficiency, as well as to gauge wells and evaluate pump placement within the wells. Additionally, absorbent bailers have been installed in MW-35, MW-36A, -36D, -36E, and -36F, which are regularly inspected for staining and LNAPL. Although the LNAPL impacts are understood and proposed sewer line investigation in Area 4 (see above), KLF believes additional groundwater sampling of this series of wells is warranted.
- **Area 6**—In September 2007, KLF submitted a sampling plan for Area 6, which recommended an additional investigation to clarify the nature and extent of the chlorinated solvent plume that originates in Parcel C. Based upon previous data, the plume extends a minimum of 900 feet from MW-19 to at least MW-51. The extent of the plume beyond MW-51 is unknown. To delineate the groundwater plume and progress of natural attenuation via dechlorination, KLF proposes re-sampling monitoring wells MW-16, -19, -46, -47, -48, -49, -50, and -51 for VOCs and SVOCs, together with the new well to be placed further to the west near the river and located on the known centerline of the plume (this well will be placed within Parcel A).

- **EVI Parcel**—A draft Site Characterization Report Summary prepared by Blasland, Bouck & Lee, Inc. (BBL) for SIC in February 2002 contained additional site investigation groundwater analytical data specific to the EVI Parcel, namely groundwater samples from EVIMW-1, -2, -6, and -8. These data indicated the presence of SVOCs and several inorganic constituents in groundwater above Class GA groundwater quality criteria. In 2005, Geologic Services Corp. (GSC) submitted a Site Characterization Report. In this report, GSC concluded that a deed restriction limiting subsurface soil excavation would reduce the potential for groundwater contact during Parcel redevelopment work. Additionally, GSC noted low concentrations of chemical constituents in monitoring wells EVIMW-2, EVIMW-3, MW-24 and MW-25 (which are downgradient of the EVI Parcel) concluding that SVOCs in the EVI Parcel did not pose a significant threat to the environment or potential for significant exposure to humans. Based upon these findings, KLF proposes re-sampling monitoring well EVIMW-1 to document changes in groundwater conditions.
- **Other Areas in Parcel B**—In addition to the Areas mentioned above, KLF proposes re-sampling a number of monitoring wells located on in Parcel B but not associated with a particular area. These include additional wells located in three transects running north and south across the site. Those applicable that fall within Parcel B include the mid-line transect of wells running through the middle of the property approximately parallel to the river (see Plate 4). Sampling these wells will help clarify potential offsite sources contributing to groundwater contamination on site and the potential migration of contaminated groundwater towards the river across the site and establish a comprehensive baseline of the Site and Parcel B overall.

4.3 Quality Assurance Plan for Soil and Groundwater Assessment

4.3.1 Field Screening

4.3.1.1 Summary

Field screening of soil samples for volatile organic compounds will be conducted using photo ionization detectors. Field measurements of water samples for

dissolved oxygen, pH, conductivity, salinity, specific conductance, ORP, and turbidity will be collected using portable water quality instrumentation.

The field staff operating the analytical equipment are experienced in its operation and will perform proper calibrations and measurements.

4.3.1.2 Calibration

Photo ionization detectors will be calibrated to ambient outdoor air for zero and a 100 ppm isobutylene standard for the span calibration at 100 ppm. Photo ionization detectors will be checked against the 100 ppm isobutylene standard at mid day. If the calibration is off by 5% or greater the instrument will be recalibrated. Water trap and particulate filters will be used on the photo ionization detectors and will be in place during calibration. The photo ionization detectors will be recalibrated if the filters are changed during the course of the work day.

Water quality parameter instrumentation will be calibrated according to the manufactures specification. Commercially available calibration solution appropriate for the instrument selected will be used to conduct this calibration. The calibration will be done daily at a minimum and more frequently if warranted based on the manufactures specifications or failure of the mid day calibration check. At mid day the water quality meters will be checked against the standard calibration solutions. If any of the parameters are out of calibration by more than 5%, the instrument will be recalibrated.

4.3.1.3 Field Screening Methods

For soil screening using photo ionization detectors the soil will be placed in a Ziploc (or similar) plastic bag with air space above the soil sample. The soil will be allowed to sit in the bag for one minute or longer to allow diffusion of any volatile organics from the soil matrix to the air within the bag. The probe tip of the photo ionization detector will be inserted through the side of the bag to create

a small hole with little or no dilution of the air inside the bag. The maximum reading within the bag over a 15 second observation period will be recorded.

For water quality parameter collection a flow through cell will be used. The well pump will be connected to the inlet side of the flow through cell and the water quality instrument will be connected to the cell through a sealed port. Water quality parameters will be recorded at set time intervals and the final readings will be noted only after stabilization of parameters based on the EPA guidance on low stress aquifer sampling. If stabilization does not occur within 45 minutes the lack of stabilization will be noted and the monitoring suspended. Water samples for laboratory analysis will not be collected from the flow through cell. The flow through cell and water quality instrument probe head will be rinsed with de-ionized water between sampling locations.

4.3.2 Laboratories

The laboratory selected for soil and water quality analysis will be certified pursuant to NYSDOH ELAP Certification for all constituents or constituent categories for which it analyzes in aqueous samples. The polymerase chain reaction analysis will be conducted by a laboratory qualified to conduct that analysis.

Non-aqueous samples will be analyzed according to methods included in the latest version of the NYSDEC Analytical Services Protocol (ASP) or USEPA Publication SW-846, *Test Methods for Evaluating Solid Waste*, third edition, update IIF, January 1995 as amended and supplemented, for a constituent or constituent category. For parameters for which certification exists pursuant to NYSDOH ELAP Certification, the laboratory will be certified for that parameter or parameter category.

4.3.3 Analytical Methods

The analytical methods utilized in the laboratory analyses will be those published by the United States Environmental Protection Agency (USEPA) and in the most recent NYSDEC Analytical Services Protocol where applicable. The laboratories will perform the prescribed quality assurance for each analytical method that is used. To the extent that the methods accommodate, detection limits will be below the lowest standard guidance value in Part 375-6 Brownfield Soil Cleanup Objectives or applicable groundwater criteria of the NYSDEC Technical and Operational Guidance Series (TOGS) 1.1.1 Ambient Water Quality Standards and Guidance Values and Groundwater Effluent Limitations. Laboratory data reports will meet ASP Category B.

4.3.4 Environmental Media Sampling

Sample collection methods, sample preservation, sample holding times, and the number of field blank, field duplicate, and trip blank samples will conform to the NYSDEC Analytical Services Protocol (ASP). Details of the collection and comments concerning the samples will be included on chains of custody that will accompany the samples from the collector to the receiving laboratory. Tables 4 and 5 included in this report, provide a summary of the proposed sampling program, including the required QA/QC samples.

Soil samples will be collected in 2-5 foot split spoon samplers or disposable sleeves using both direct push and hollow-stem auguring techniques. Segments of the samples will be transferred to laboratory provided, clean, sample containers using aluminum or stainless steel disposable scoops, disposal plastic soil syringes, and hands gloved with new nitrile disposal gloves. Following the use of any of the disposal soil sample handling tools the tool will be isolated and disposed of with other wastes from the site.

Groundwater sampling conducted by purge and sample methods will be conducted with disposable polyethylene bailers which are prepackaged and will be opened on site. The bailers will be attached to nylon string or rope to allow recovery from the monitoring wells. During the purging of the well the field personnel will wear nitrile gloves. These gloves will be changed to a fresh set of glove prior to sample collection.

Groundwater sampling conducted by low flow sampling techniques will follow the EPA guidance no low stress aquifer sampling. The sampling will be conducted using a bladder pump or a geopump. At each well location a new bladder will and new sample tubing will be used. The sample tubing will be laboratory grade polyethylene tubing. Compressed air or nitrogen will be used to power the sampling pump. The pump body will be of stainless steel construction. Decontamination will be conducted by washing the pump in laboratory grade detergent and triple rinsing the pump with de-ionized. One pump blank will be collected by immersing the pump in de-ionized water and pumping a sample through the pump and a short length of sample tubing.

Field blanks will be collected by transferring de-ionized water to a sample container at the location of groundwater sample collection. This sample will be analyzed for the same parameters as the water groundwater samples less the polymerase chain reaction analysis (if found necessary).

Soil and groundwater samples will be stored on-site in a cooler with temperature maintained at 4 degrees Celsius or cooler using ice. The sample bottles will be placed into zip lock or similar plastic bags prior to placement in the cooler. Samples will be maintained under chain of custody and in the immediate control of the field personnel. Samples will either be shipped directly to the laboratory from the site or will be transported to a Kleinfelder office location for pick up by a lab courier. Samples stored at Kleinfelder offices will be maintained within a refrigerator at 4 degrees Celsius or cooler until pick up by the laboratory.

The number of soil and groundwater samples to be collected is presented on Tables 2 and 3, respectively.

4.3.5 Data Usability Summary Report

The project manager will prepare a Data Usability Summary Report (DUSR) documenting the sampling and analytical procedures and results. This will certify that the data are valid and usable.

4.4 Soil Vapor Assessment

Soil vapor surveys are typically required under brownfield redevelopment scenarios. For this reason, KLF proposes collection of 12 soil vapor samples in Parcel B using hand set shallow soil vapor probes and simultaneous ambient air samples for comparative purposes. This would allow the collection of sufficient data to evaluate the potential for significant indoor vapor intrusion across Parcel B. A map (Plate 4) showing the anticipated locations of these soil vapor samples is attached hereto. This soil vapor survey consists of subsurface soil vapor sampling.

4.4.1 Sampling Procedures

4.4.1.1 Subsurface Samples

The purpose of the subsurface sampling is to evaluate the potential for human exposure within a nearby building. The sampling locations are positioned such that the areas surrounding buildings will be evaluated.

The locations of these structures and sample locations are shown on Plate 4.

Preparation for Subsurface Sampling

At each sampling location, a hole appropriate for the diameter of the sampling tube will be advanced using an air lance. The flexible tubing will be inserted ensuring that the distal end of the tubing extends between two and three feet

below grade. The tubing will be sealed into the hole using hydrated bentonite and a watertight, bolt-down road box will be used to secure the sampling port.

Purging and Pre-Sample Testing of Subsurface Sample Points

To ensure that representative samples are being collected ambient air will be purged from the sample tubing and the bentonite seal will be tested. Three tube volumes will be purged from the tubing by attaching a syringe to the sample tubing to assure that the purge air flow rates do not exceed 0.2 liters per minute. A five-gallon pail will be temporarily installed over the sampling location to create a confined atmosphere above the sample point. Helium gas will be applied to the inside of the five-gallon pail and the atmosphere concentrations will be determined with direct reading instrument. The helium concentration within the bucket will be between 50 and 100%. This will be confirmed using a direct reading instrument. Once the high percentage helium atmosphere is established over the sample point the direct read instrument will be secured to sample tubing to determine if helium is passing through the bentonite seal or tubing. If the concentration within the sampling tubing is greater than 10% then the seal will be reconstructed and tested again. Once a good seal is confirmed sample collection will begin.

Sample Collection of Subsurface Soil Vapor

Each soil vapor sample will be collected using a certified clean, six liter, Summa[®] canisters with pre-set flow controller. Sampling times for sub-slab soil vapor samples will be 8 hours within the commercial tenant spaces and 24 hours within the residences. The pre-set flow controllers will be calibrated such that the flow rates do not exceed 0.2 liters per minute.

For preparation of the canister and collection of the sample the following procedure will be implemented. The canister will be placed on a stable surface adjacent to the sample tube. The canister's serial number will be recorded on the chain of custody (COC) and field notebook/ sample form. A sample identification name will be recorded on the canister ID tag and recorded on the COC and field notebook or sample form.

Once the canister is in place and the information about the canister identification and location has been recorded the plug from the canister fitting will be removed and the sample tubing will be connected to the flow controller. If applicable, the canister valve will be opened and closed. The pressure gauge will then be read and recorded. The pre-sampling pressure gauge reading should be -25 in Hg or less or else. If the pressure in the canister is greater than -25 in Hg, then verification from the laboratory of the initial pressure will be required to assure that the canister did not leak during transport.

Following confirmation that the canister has the appropriate internal pressure the valve to initiate sampling will be opened. The pressure gauge will be observed for the first two minutes. If the pressure increases at a rate greater than $\frac{1}{2}$ inch of Hg per minute it will be assumed that there is a leak in the sampling system and sample collection will be terminated. The leak will be identified and the sample will be recollected using a new Summa[®] canister and flow controller.

A digital photograph will be taken of the system set up and surrounding area for each sampling location. The sampling start time will be recorded on the COC and field notebook/ sample form. At the end of the one hour sampling period the canister valve will be closed and the stop time recorded on the COC and field notebook/ sample form. The final gauge pressure will be read and recorded to ensure that it falls between -5 and 0 in Hg. The sampling tubing and flow controller will be disconnected from the canister and the plug will be installed on the canister. The sample container will be placed in its original box for transport to the laboratory. The sample collection log will be completed at this time. The information included on this will be; sample identification, date and time of sample collection, identity of samplers, sampling methods and devices, purge volumes, volume of soil vapor extracted, vacuum pressure before and after, apparent moisture content (dry, moist, saturated, etc.) of the sampling zone, and log each sample on the COC.

4.5 Quality Assurance of Soil Vapor Assessment

4.5.1 Quality Assurance for Air Sampling

The quality of data collected in an environmental study depends on the quality and thoroughness of field sampling activities. Due to the sensitivity of analytical methods and the extremely low levels of detection specified for sample analysis, the sampling process becomes integral to the integrity of the data generated. As a result, general field operations and practices, and specific sample collection and inventory must be well planned and carefully implemented.

The sampling methods and appropriate quality control measures for sample collection are included in the sampling procedures in sections 4.4.1.1 of this report.

Sample volumes, container types, and preservation methods are included in the air and soil vapor sampling summary included as Table 6.

4.5.1.1 Sampling Instruments / Equipment Calibration and Frequency

Field screening of ambient air for volatile organic compounds will be conducted using photo ionization detectors during the building survey operations as sampling protocol.

The field staff operating the analytical equipment are experienced in its operation and will perform proper calibrations and measurements.

Photo ionization detectors will be calibrated to ambient outdoor air for zero and a 100 ppm isobutylene standard for the span calibration at 100 ppm. Photo ionization detectors will be checked against the 100 ppm isobutylene standard at mid day. If the calibration is off by 5% or greater the instrument will be recalibrated. Water trap and particulate filters will be used on the photo

ionization detectors and will be in place during calibration. The photo ionization detectors will be recalibrated if the filters are changed during the course of the workday.

4.5.1.2 Analytical Methods

All soil vapor samples collected at the site will be analyzed using USEPA Method TO-15 for volatile organic compounds. All subsurface and outdoor air samples collected will be analyzed using USEPA Method TO-15 for volatile organic compounds and selective ion monitoring (SIM) for trichloroethene. Reporting limits for this method are below 1 microgram per cubic meter. For the initial round of sampling the target analytes will be the EPA TO-15 full compendium list.

A NYSDOH ELAP certified laboratory, will perform the analysis of all soil vapor samples.

4.5.1.3 Quality Assurance / Quality Control Samples

The Quality Assurance / Quality Control Samples for the subsurface and ambient air quality sampling will include co-located duplicates at a rate of one per twenty samples, equipment blank at a rate of one per twenty samples (conducted at the analytical laboratory), and trip blank samples at a rate of one trip blank sample per batch of sample containers shipped. The total number of these quality control samples is detailed in Table 4.

4.6 Tanks, Storage Facilities, and Drainage Structures

Locations of former USTs will be re-identified (if practicable) using geophysical techniques, such as ground penetrating radar (GPR), and test pits and/or soil borings will be placed in the area of on-site former storage tank features as necessary to complete the profile of each location. Soil samples will be collected only if suspected contamination is encountered.

4.7 Historic Fill Assessment

Historic fill is known to be present across the Site (BBL 2002). During this investigation historic fill will be characterized if encountered as part of the various activities described above, and the findings correlated with currently available data, and thus aid in the description of the nature and extent of the fill across Parcel B.

5.0 Schedule and Reporting

5.1 Schedule

The investigation measures to be implemented are planned to be coordinated with field investigation work at all three distinct parcels on the Maxon-Alco Site. Some of the above sampling assumes that elements of the investigation will occur across separate BCP parcels; for example, the chlorinated VOC plume that originates in the Parcel C area and migrates under both Parcel B and Parcel A.

It is anticipated that work can begin within one month of approval of this plan, depending upon the coordination of the sequence of the other development-Parcels (Parcels A and C) and their particular schedule. Once the investigation begins, KLF anticipates that completion approximately six months after initiation. Of course, this schedule does not take into account unexpected weather events, or various development activities which may delay work or other events out of the control of KLF. A proposed schedule in tabular format is presented as Table 5, which does not take into consideration sequencing with the development process.

5.2 Reporting

A Final Investigation Report[s] will be developed following the completion of the above field activities. This report[s] will include the data collected from the above described investigation, along with interpretation of this data within the context of former investigations and remedial actions. The report[s] will be issued 90 days following the completion of the field activities. This report[s] will follow the format and include the content specified for remedial investigation reports as outlined in the Draft DER-10 Technical Guidance for Site Investigation and Remediation.

5.3 Alternatives Analysis

The Final Investigation Report[s] also will briefly discuss remedial alternatives that can be implemented within Parcel B and that will be fully assessed in the Alternatives Analysis submission to the NYSDEC.

6.0 References

File Reviews

Schenectady Tax Assessor's Office, December 18, 2009
(<http://64.132.212.43/imate/search.aspx>)

City of Schenectady Official Zoning Map, August 11, 2008

References

General Electric, December 1992, Closure of a 2,700-gallon Concrete Underground Storage Tank (UST) Located at GE's Nott Street Facility (Letter Report).

Dames & Moore, May 1993, Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent File No. R4-1338-92-05, Job #24707-001-017.

Dames & Moore, June 1993, Interim Report, Tasks 1 through 4 Drainage System Assessment, Job #24707-001-017.

Dames & Moore, July 1993, Surface, Subsurface and Ground Water Investigation Work Plan, Job #24707-002-5450.

Dames & Moore, July 1994, Summary of Investigations.

Dames & Moore, March 1995, Fourth Quarter Report, 1994 Free Product Recovery & Site Inspection Summary, Job #24707-004-L566.

ABB Engineers & Surveyors, April 1996, Map Showing Well Locations, Schenectady Industrial Corporation.

ABB Environmental Services, Inc., April 1996, UST Removal, Building 320, November 1995.

ABB Environmental Services, Inc., September 1997, Investigation Program Report Subsurface Investigation Proposed EVI Facility.

Harding Lawson Associates, Inc., July 1998, MW-01 PCB Remediation Program Report, DEC Order on Consent R4-1338-92-05, Project #2349.00.

Harding Lawson Associates, Inc., July 1998, Remedial Alternative Evaluation Report, Nott Street Industrial Park, Remedial Alternative Evaluation-Proposed EVI Facility.

Harding Lawson Associates, Inc., April 1999, Subsurface Investigation Report, Building 306.

Harding Lawson Associates, Inc., April 1999, Subsurface Investigation Report, Former Tank Farm, Building 332.

Harding Lawson Associates, Inc., April 1999, Subsurface Investigation Report, Building 306.

Harding Lawson Associates, Inc., June 14, 1999, Building 308, Environmental Assessment Report (Letter Report).

Roy F. Weston, Inc., May 10, 2000, Historic Release from Building 342 Aboveground Storage Tank.

Blasland, Bouck & Lee, Inc., July 2000, Perimeter Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York.

Whiteman Osterman & Hanna, November 21, 2000, Fax Cover Sheet regarding November 20, 2000, STS Steel Corporation, Proposed Addition to Building 330, Nott Street Industrial Park, Environmental Concerns.

Vanasse Hangen Brustlin, Inc, September 2001, Schenectady Industrial Corp., Nott Street Industrial Park, Draft Follow-up Subsurface Investigation Report, Bioventing System Subsurface Soil Assessment (Letter Report).

Vanasse Hangen Brustlin, Inc., January 11, 2002, EVI Parcel, Memorandum.

Blasland, Bouck & Lee, Inc., February 2002, Draft Site Investigation Summary Report, Nott Street Industrial Park, Schenectady, New York.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., June 25, 2002, Nott Street Industrial Park EVI Parcel Report, Schenectady, NY, NYSDEC VCA #R4-VA-02-96-09.

NYSDEC, October 8, 2002, Nott Street Industrial Park, EVI Parcel Report, Schenectady (C), Schenectady County, VA #R4-VA-02-96-09.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., December 30, 2002, Nott Street Industrial Park, VA No. R4-VA-02-96-09, EVI Parcel Impact Analysis & Closure Petition Report, Response to Comments.

NYSDEC, January 29, 2003, Closure of GE Nott Street Building 332 Less Than 90 Day Storage Area, EPA Identification Number: NYD002084135.

Nott St. Industrial Park February 14, 2003 Vac Event Email, March 7, 2003, Summary of LNAPL Recovery Test Data.

Waste Management, April 2, 2003, Asbestos Disposal & Documentation Form.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., May 19, 2003, Nott Street Park, Closing of Bioventing System Operation.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., June 9, 2003, Schenectady Industrial Corporation, Nott Street Industrial Park, Order on Consent R4-1338-92-05, Additional Groundwater Data.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., June 13, 2003, Building 306, Nott Street Industrial Park, Environmental Data.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., June 20, 2003, Nott Street Industrial Park, Monthly Monitoring Findings.

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., October 30, 2003, Building 308, Nott Street Industrial Park, Environmental Data

Vanasse Hangen Brustlin, Inc. Engineering & Surveying, P.C., December 17, 2003, Nott Street Industrial Park, Schenectady, NY, Soil Excavation and Monitoring Well Installation Activities Report.

Vanasse Hangen Brustlin, Inc., February 2004, Nott Street Industrial Park, Remaining Environmental Issues – Definition & Prioritization, DRAFT.

Geologic Services Corporation, January 2005, Site Characterization, EVI Parcel, Nott Street Industrial Park, 301 Nott Street, Schenectady, New York.

NYSDEC, May 20, 2005, Nott Street Industrial Park, Schenectady (C), Schenectady County, R4-1338-92-05, letter requesting submittal of free product recovery system in area of MW-36.

Geologic Services Corporation, June 3, 2005, Memorandum, Nott Street Industrial Park, Current Issues.

Schenectady Fire Department, June 3, 2005, Incident Report.

Geologic Services Corporation, June 13, 2005, Nott Street Industrial Park, Upstate Textile Inspection.

GSC/KLF, August 2, 2005, Vacuum Extraction Feasibility Test Results – MW-26 Area Product Recovery, Nott Street Industrial Park, Schenectady, New York.

NYSDEC, August 22, 2005, Nott Street Industrial Park, Nott Street Industrial Park, Schenectady (C), Schenectady County, letter of approval of Ferret System.

US EPA Facility Registry System, September 9, 2005, Facility Detail Report.

GSC/KLF, September 12, 2005, Nott Street Industrial Park, Sewer & College Creek Outfall Issue, (NYSDEC Letter of 8/22/05).

Environmental Risk Group, September 12, 2005, Nott Street Industrial Park, STS Field Storage Area Inspection (9/7/05), Memo.

Environmental Risk Group, September 12, 2005, Nott Street Industrial Park, Upstate Textile Post-Departure Inspection (9/7/05), Memo.

Environmental Risk Group, October 17, 2005, Memo, Nott Street Industrial Park, Best Management Practice for Diesel AST's.

Environmental Risk Group, October 17, 2005, Nott Street Industrial Park, College Creek Outfall Releases of October 13 and 14.

GSC/KLF, November 10, 2005, Schenectady Industrial Corporation – Nott Street Industrial Park, Order on Consent R4-1338-92-05, Sewer & Outlet Report.

GSC/KLF, January 27, 2006, Nott Street Industrial Park, MW-35, MW-36 and Building 332 Area, LNAPL Delineation Investigation Trip Report.

Accutest New England, March 7, 2006, Geologic Services Corporation, NSIP/Schenectady 301 Nott St., Schenectady NY, Accutest Job Number: M54074.

GSC/KLF, March 10, 2006, Nott Street Industrial Park, Building 332/MW-36 Product Recovery System Power Alternatives.

GSC/KLF, March 17, 2006, Nott Street Industrial Park, MW-35, MW-36 and Building 332 Area, LNAPL Delineation Investigation Data Analysis.

GSC/KLF, May 5, 2006, Building 304 & Building 330, Nott Street Industrial Park, Environmental Data.

NYSDEC, June 6, 2006, Notice of Violation, Schenectady Industrial Corporation, Schenectady (C), Schenectady County, R4-1338-92-05.

NYSDEC, January 3, 2007, STIP #R4-391, Spill #900219, Nott St. Industrial Park, Schenectady (C), Schenectady County.

Arcadis BBL, Inc., February 2007, Groundwater Sampling and Analysis, Nott Street Industrial Park, Schenectady, New York

Arcadis BBL, Inc., February 2007, MW 19/MW 46 Additional Investigation, Nott Street Industrial Park, Schenectady, New York

KLF, February 5, 2007, Schenectady Industrial Corporation – Nott Street Industrial Park, Order on Consent R4-1338-92-05, Annual Report, 2006.

KLF, April 9, 2007, Corrective Action Plan Schedule of Events for 2007, Nott Street Industrial Park, Schenectady, NY.

KLF, June – September 2007, Monthly Park-Wide Observational Summaries, SIC Nott Street Industrial Park, 301 Nott Street, Schenectady, NY.

KLF, September 5, 2007, Nott Street Industrial Park, Schenectady Industrial Corp., Chlorinated Solvent Plume Update.

KLF, December 13, 2007, Schenectady Industrial Corporation – Nott Street Industrial Park, Stipulation #R4-391, Corrective Action Items, Area 3 & Area 4 Report.



KLF, February 14, 2008, Schenectady Industrial Corporation – Nott Street Industrial Park, Order on Consent R4-1338-92-05, Annual Report, 2007.

KLF, September 3, 2008, Waste Manifests for Building 320 RCRA Storage and MW-36 Combustible Liquids, Schenectady Industrial Corporation – Nott Street Industrial Park.

KLF, 2009, Compilation of Well Construction Logs for Former Alco-NSIP Site

KLF, January 30, 2009, Schenectady Industrial Corporation – Nott Street Industrial Park, Order on Consent R4-1338-92-05, Annual Report, 2008.

Data Sources

Environmental Data Resources, August 21, 2009, EDR Aerial Photo Decade Package – ALCO-Maxon, 301 Nott Street, Schenectady, New York 12308

Environmental Data Resources, August 21, 2009, Certified Sanborn Map Report – ALCO-Maxon, 301 Nott Street, Schenectady, New York 12308

Environmental Data Resources, November 19, 2009, EDR NEPACheck – ALCO-Maxon, 301 Nott Street, Schenectady, New York 12308

Environmental Data Resources, November 19, 2009, EDR Offsite Receptor Report – ALCO-Maxon, 301 Nott Street, Schenectady, New York 12308

Environmental Data Resources, November 20, 2009, EDR Radius Map Report with Geotrack – ALCO-Maxon, 301 Nott Street, Schenectady, New York 12308



LIMITATION TO CLIENT

This work was performed in a manner consistent with that level of care and skill ordinarily exercised by other members of KLF's profession practicing in the same locality, under similar conditions and at the date the services are provided. Our conclusions, opinions and recommendations are based on a limited number of observations and data. It is possible that conditions vary between or beyond the data evaluated. KLF makes no other representation, guarantee or warranty, express or implied, regarding the services, communication (oral or written), report, opinion, or instrument of service provided.

This report may be used only by the Client and the registered design professional in responsible charge and only for the purposes stated for this specific engagement within a reasonable time from its issuance, but in no event later than two (2) years from the date of the report.

The work performed was based on project information provided by Client. If Client does not retain KLF to review any plans and specifications, including any revisions or modifications to the plans and specifications, KLF assumes no responsibility for the suitability of our recommendations. In addition, if there are any changes in the field to the plans and specifications, Client must obtain written approval from KLF's engineer that such changes do not affect our recommendations. Failure to do so will vitiate KLF's recommendations.

The information included on graphic representations in this report has been compiled from a variety of sources and is subject to change without notice. KLF makes no representations or warranties, express or implied, as to accuracy, completeness, timeliness, or rights to the use of such information. These documents are not intended for use as a land survey product nor are they designed or intended as a construction design document. The use or misuse of the information contained on these graphic representations is at the sole risk of the party using or misusing the information.

Table 1
Existing and Proposed
Monitoring Well Construction
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenectady, New York

DRAFT



Location	Install date	Total Depth	Screen Interval	Comments
Existing Monitoring Wells				
MW-01	08/12/92	22.00	12-22	Also named RW-1 and OW-01
MW-02	08/12/92	21.00	11-21	Area 1
MW-03	08/13/92	23.00	13-23	Area 1
MW-04	08/13/92	24.00	14-24	Area 2
MW-05	08/13/92	25.00	15-25	Area 1
MW-06	04/01/94	34.50	29.5-34.5	Area 1
MW-07	03/31/94	18.50	8.5-18.5	Area 1
MW-08	03/31/94	12.50	5.5-12.5	Area 1, Bldg. 324
MW-09	03/28/94	16.00	6-16	Area 1, Bldg. 324
MW-10	03/29/94	34.00	31-34	Area 2
MW-11	03/29/94	17.00	7-17	Area 2
MW-12	03/31/94	15.50	5.5-15.5	Area 3
MW-12D	12/09/98	NA	NA	Area 3
MW-13	08/16/95	17.00	7-17	Area 4
MW-14	08/15/95	16.00	6-16	Area 4
MW-15	08/15/95	15.00	5-15	Area 4
MW-16	08/15/95	16.00	6-16	Site
MW-17	11/23/99	19.54	9.54-19.54	Site
MW-18	11/15/99	19.93	9.93-19.93	Site
MW-19	11/29/99	20.03	10.03-20.03	Area 6
MW-20	11/22/99	19.93	9.93-19.93	Site
MW-21	11/23/99	20.10	10.10-20.10	Area 4
MW-22	11/29/99	17.75	7.75-17.75	EVI Parcel
MW-23	11/24/99	19.90	9.9-19.9	RPI Parcel
MW-24	11/19/99	19.33	9.33-19.33	RPI Parcel
MW-25	11/17/99	19.58	9.58-19.58	Site
MW-26	11/17/99	20.03	10.03-20.03	Site
MW-27	11/18/99	20.00	10-20	Site
MW-28	11/18/99	20.00	10-20	Site
MW-29	11/22/99	18.02	8.02-18.02	Site
MW-30	11/19/99	20.00	10-20	Site
MW-31	11/30/99	19.01	9.01-19.01	Site
MW-32	11/08/00	17.00	7-17	Site
MW-33	11/13/00	18.00	8-18	Site
MW-34	11/09/00	16.00	6-16	Site
MW-35	11/13/00	16.00	6-16	Area 4
MW-36	11/10/00	16.00	6-16	Area 4
MW-36A	11/10/00	17.00	7-17	Area 4
MW-36B	09/03/03	20.00	10-20	Area 4
MW-36C	09/02/03	20.00	10-20	Area 4
MW-36D	09/02/03	20.00	10-20	Area 4
MW-36E	09/03/03	20.00	10-20	Area 4
MW-36F	09/03/03	20.00	10-20	Area 4
MW-37	11/10/00	17.00	7-17	Site
MW-38	11/09/00	14.00	4-14	Site
MW-39	11/09/00	14.00	4-14	Site

Table 1
Existing and Proposed
Monitoring Well Construction
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenectady, New York

DRAFT



Location	Install date	Total Depth	Screen Interval	Comments
Existing Monitoring Wells				
MW-40	11/08/00	20.00	10-20	Site
MW-41	11/10/00	16.00	6-16	Site
MW-42	11/09/00	16.00	6-16	Site
MW-43	11/14/00	21.00	11-21	Site
MW-44	11/15/00	17.00	7-17	Site
MW-45	01/18/01	19.68	9.98-19.68	Site
MW-46	05/23/01	43.00	33-43	Area 6
MW-47	05/21/01	55.20	45.2-55.2	Site
MW-48	05/22/01	65.00	55-65	Area 3
MW-49	10/05/05	67.00	57-67	Site
MW-50	10/06/05	57.00	47-57	Site
MW-51	10/05/05	67.00	55-67	Area 6
EVI MW-1	07/08/96	20.00	10.10-19.90	EVI Parcel
EVI MW-2	07/08/96	19.00	9.10-18.80	EVI Parcel
EVI MW-3	07/08/96	20.00	10-20	EVI Parcel
EVI MW-4	05/12/97	19.73	9.73-19.73	EVI Parcel
EVI MW-5	05/12/97	17.75	7.75-17.75	EVI Parcel
EVI MW-6	05/12/97	18.65	8.65-18.65	EVI Parcel
EVI MW-7	05/13/97	19.58	9.58-19.58	EVI Parcel
EVI MW-8	05/12/97	19.61	9.61-19.61	EVI Parcel
RW-1	11/12/92	24.00	9-24	
RW-2	11/05/92	24.00	9-24	
RW-3	11/05/92	25.00	10-25	
RW-4	11/12/92	20.00	10-20	
OSMW-1	08/06/09	12.00	2-12	
OSMW-2	08/05/09	20.00	5-20	
OSMW-3	08/05/09	17.00	2-17	
Proposed Monitoring Wells				
MW-25D		65.00	55-65	
MW-52		67.00	57-67	

Notes:

All permanent wells are constructed with polyvinyl chloride (PVC) risers
All permanent wells are constructed with PVC well screens with 0.010 slot size

Table 2
Proposed Soil Sampling
Locations & Analytical Methods
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenectady, New York

DRAFT



Location	Depths	Methods	Comments
Soil Boring/Monitoring Well Locations			
SB-B1	Approx. 20 feet bgs	EPA 8260, EPA 8270	Continuous soil screening will be conducted using a PID.
SB-B2	Approx. 20 feet bgs		Continuous soil screening will be conducted using a PID.
SB-B3	Approx. 20 feet bgs		Continuous soil screening will be conducted using a PID.
SB-B4	Approx. 20 feet bgs		Continuous soil screening will be conducted using a PID.
SB-B5	Approx. 20 feet bgs		Continuous soil screening will be conducted using a PID.
Sample duplicate			
Trip Blank			
Surface Soil Locations			
SS-B1	0-2 feet bgs	EPA 6010, EPA 7470, EPA 8082, EPA 8260, EPA 8270, TAL Metals	Soil will be screened with a PID.
SS-B2	0-2 feet bgs		Soil will be screened with a PID.
SS-B3	0-2 feet bgs		Soil will be screened with a PID.
SS-B4	0-2 feet bgs		Soil will be screened with a PID.
SS-B5	0-2 feet bgs		Soil will be screened with a PID.
SS-B6	0-2 feet bgs		Soil will be screened with a PID.
SS-B7	0-2 feet bgs		Soil will be screened with a PID.
SS-B8	0-2 feet bgs		Soil will be screened with a PID.
Sample duplicate			
Trip Blank			
Test Pit Locations			
TP-B1	Approx. 6-8 feet bgs	EPA 6010, EPA 7470, EPA 8082, EPA 8260, EPA 8270, TAL Metals	Continuous soil screening will be conducted using a PID.
Sample duplicate			
Trip Blank			

EPA 8260 samples will be collected in VOA vials and preserved with either methanol or sodium bi-sulfate, the will be extracted and analyzed by the lab within 14 days.

EPA 6010, EPA 7470, EPA 8082, EPA 8270 and TAL Metals samples will be collected in unpreserved 1 liter amber glass bottles, the will be extracted by the lab within 7 days and analyzed within 40 days.

Notes:

bgs - below ground surface
EPA - Environmental Protection Agency
PID - photoionization detector
TAL - total analyte list

Table 3
Proposed Groundwater Sampling
Locations & Analytical Methods
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenctady, New York

DRAFT



Analytical Methods	VOC 8260B	SVOC 8270	Comments
Sample container and preservation method	(3) 40 ml VOA vials, HCL, 14 day hold time	1 Liter amber, 4 degrees C.	
MW-12	X	X	
MW-12D	X	X	
MW-16	X	X	
MW-32	X	X	
MW-34	X	X	
MW-35	X	X	
MW-37	X	X	
MW-38	X	X	
MW-39	X	X	
MW-40	X	X	
MW-42	X	X	
MW-48	X	X	
MW-49	X	X	
MW-50	X	X	
EVI MW-1		X	
Field Blank 1			
Equipment Blank 1			
Sample Duplicate			
Trip Blank 1			

Yellow = Monitoring wells to be installed as part of this investigation

Green = Pre-existing Monitoring wells

Table 4
Proposed Soil Vapor Sampling
Locations & Analytical Methods
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenectady, New York

DRAFT



Locations	# of Samples	Method	Sample Container
Soil vapor points SV-B1 through SV-B12	17	EPA Method TO-15	1 Liter SUMA analysis within 28 days
Co-located Duplicates	2		1 Liter SUMA for sub slab colocated sample, 6 Liter SUMA for Indoor air colocated sample, both with analysis within 28 days
Equipment Blank	2		conducted at the laboratory, SUMA size at the discretion of the laboratory
Trip Blanks	2		1 or 6 Liter SUMA analysis within 28 days
Totals	23		


Table 5
Proposed Site Investigation Schedule
Young-Sommer/Maxon
Parcel B - ALCO-Maxon Site
Schenectady, New York

DRAFT




Task	Months past approval of Investigation Work Plan					
	Month 1	Month 2	Month 3	Month 4	Month 5	Month 6
Pre monitoring well installation groundwater sampling						
New monitoring well installation						
Groundwater sampling						
Vapor sampling point installation						
Vapor sampling						
Data review and report preparation						

* - if required the schedule for heating season sampling will be established in consultation with NY DEC and DOH

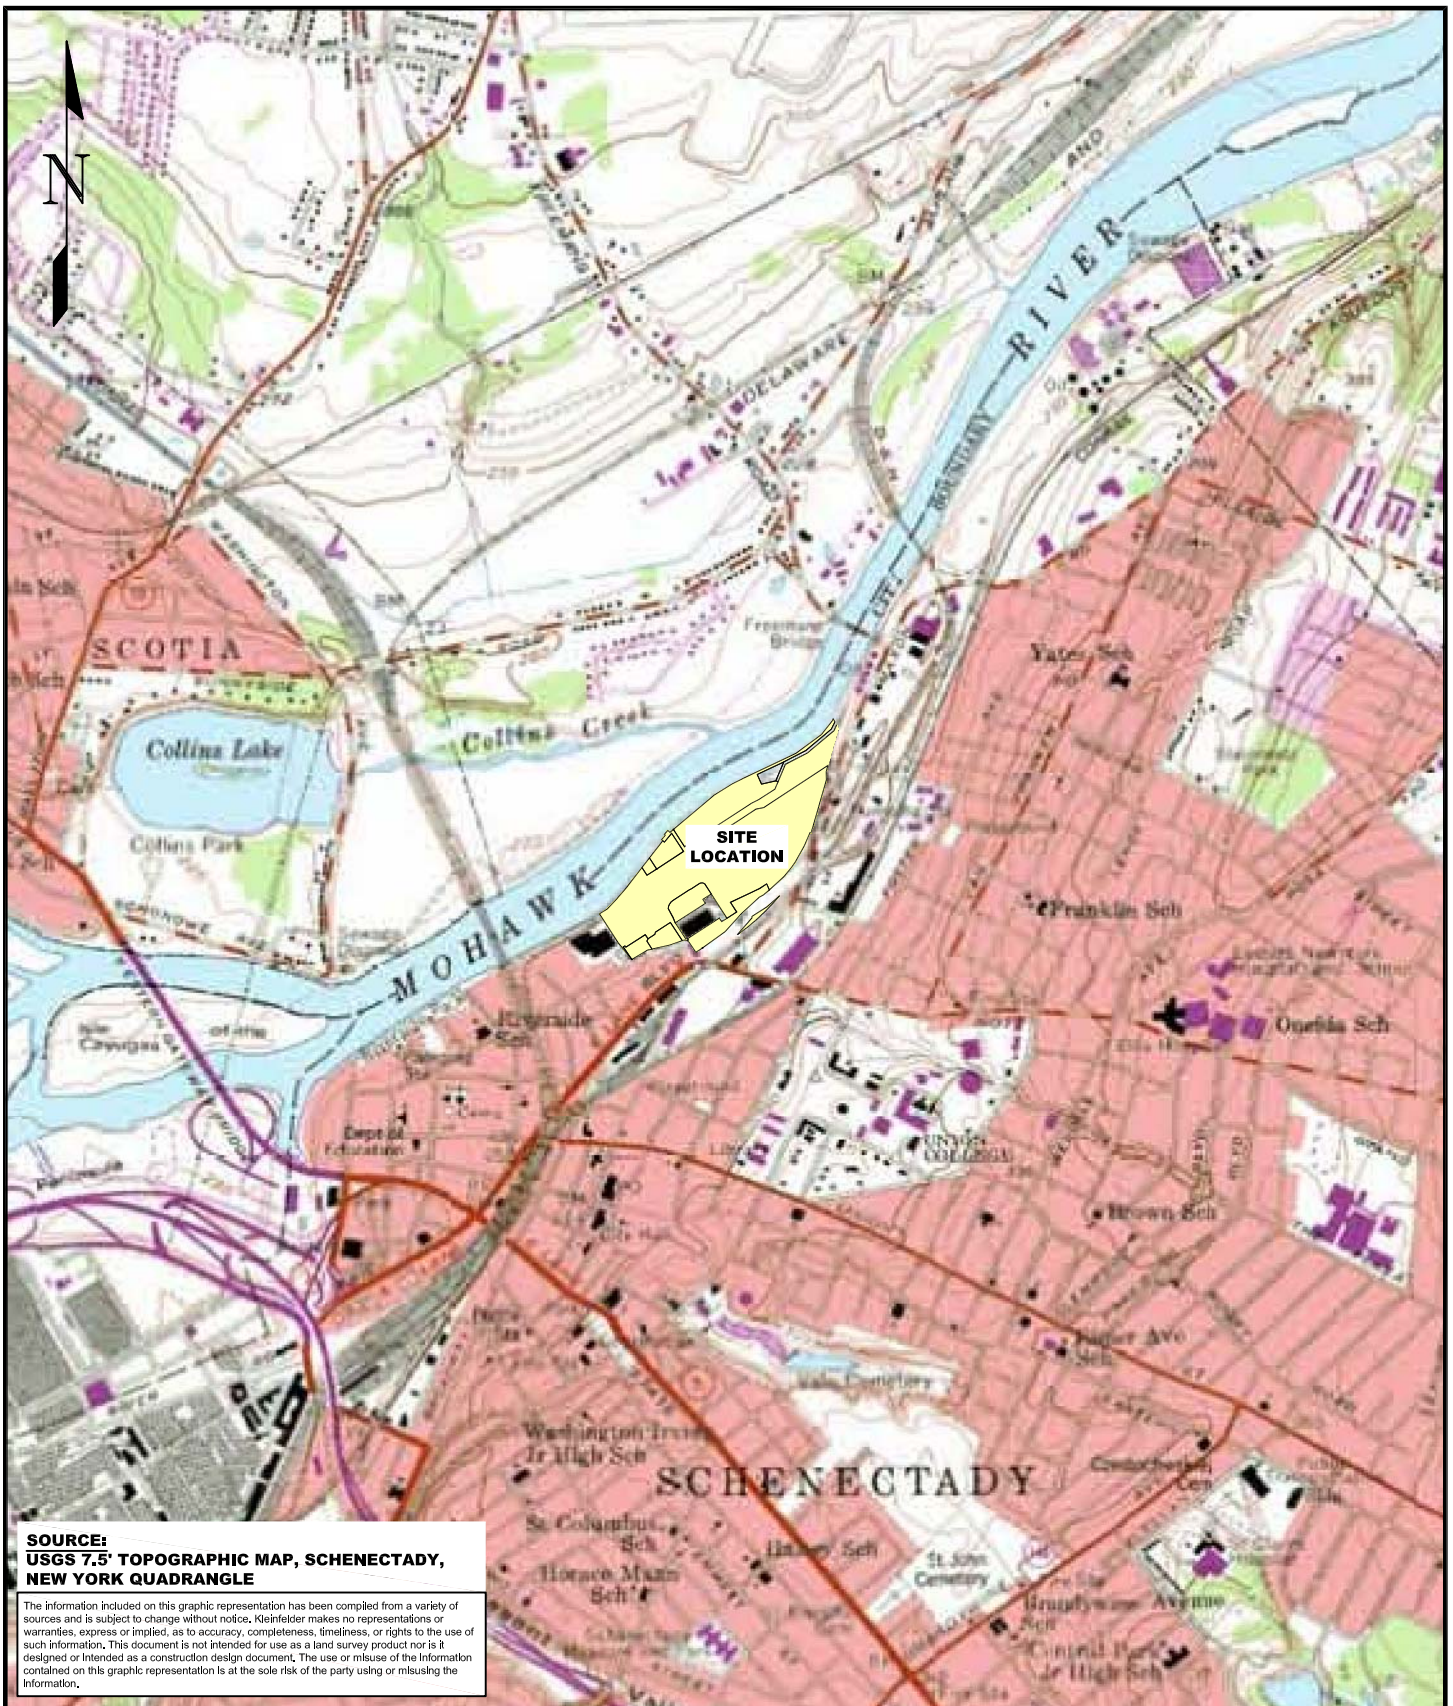

 KLEINFELDER <i>Bright People. Right Solutions.</i> www.kleinfelder.com	PROJECT NO. 107121	SITE LOCUS	FIGURE 1
	DRAWN: 05/01/10		
	DRAWN BY: CTH	YOUNG-SUMMER-MAXON ALCO-MAXON SITE DEVELOPMENT SCEHENCTADY, NEW YORK	
	SCALE: 1" = 2,000'		
	FILE NAME: 107121BCPMAY10.dwg		

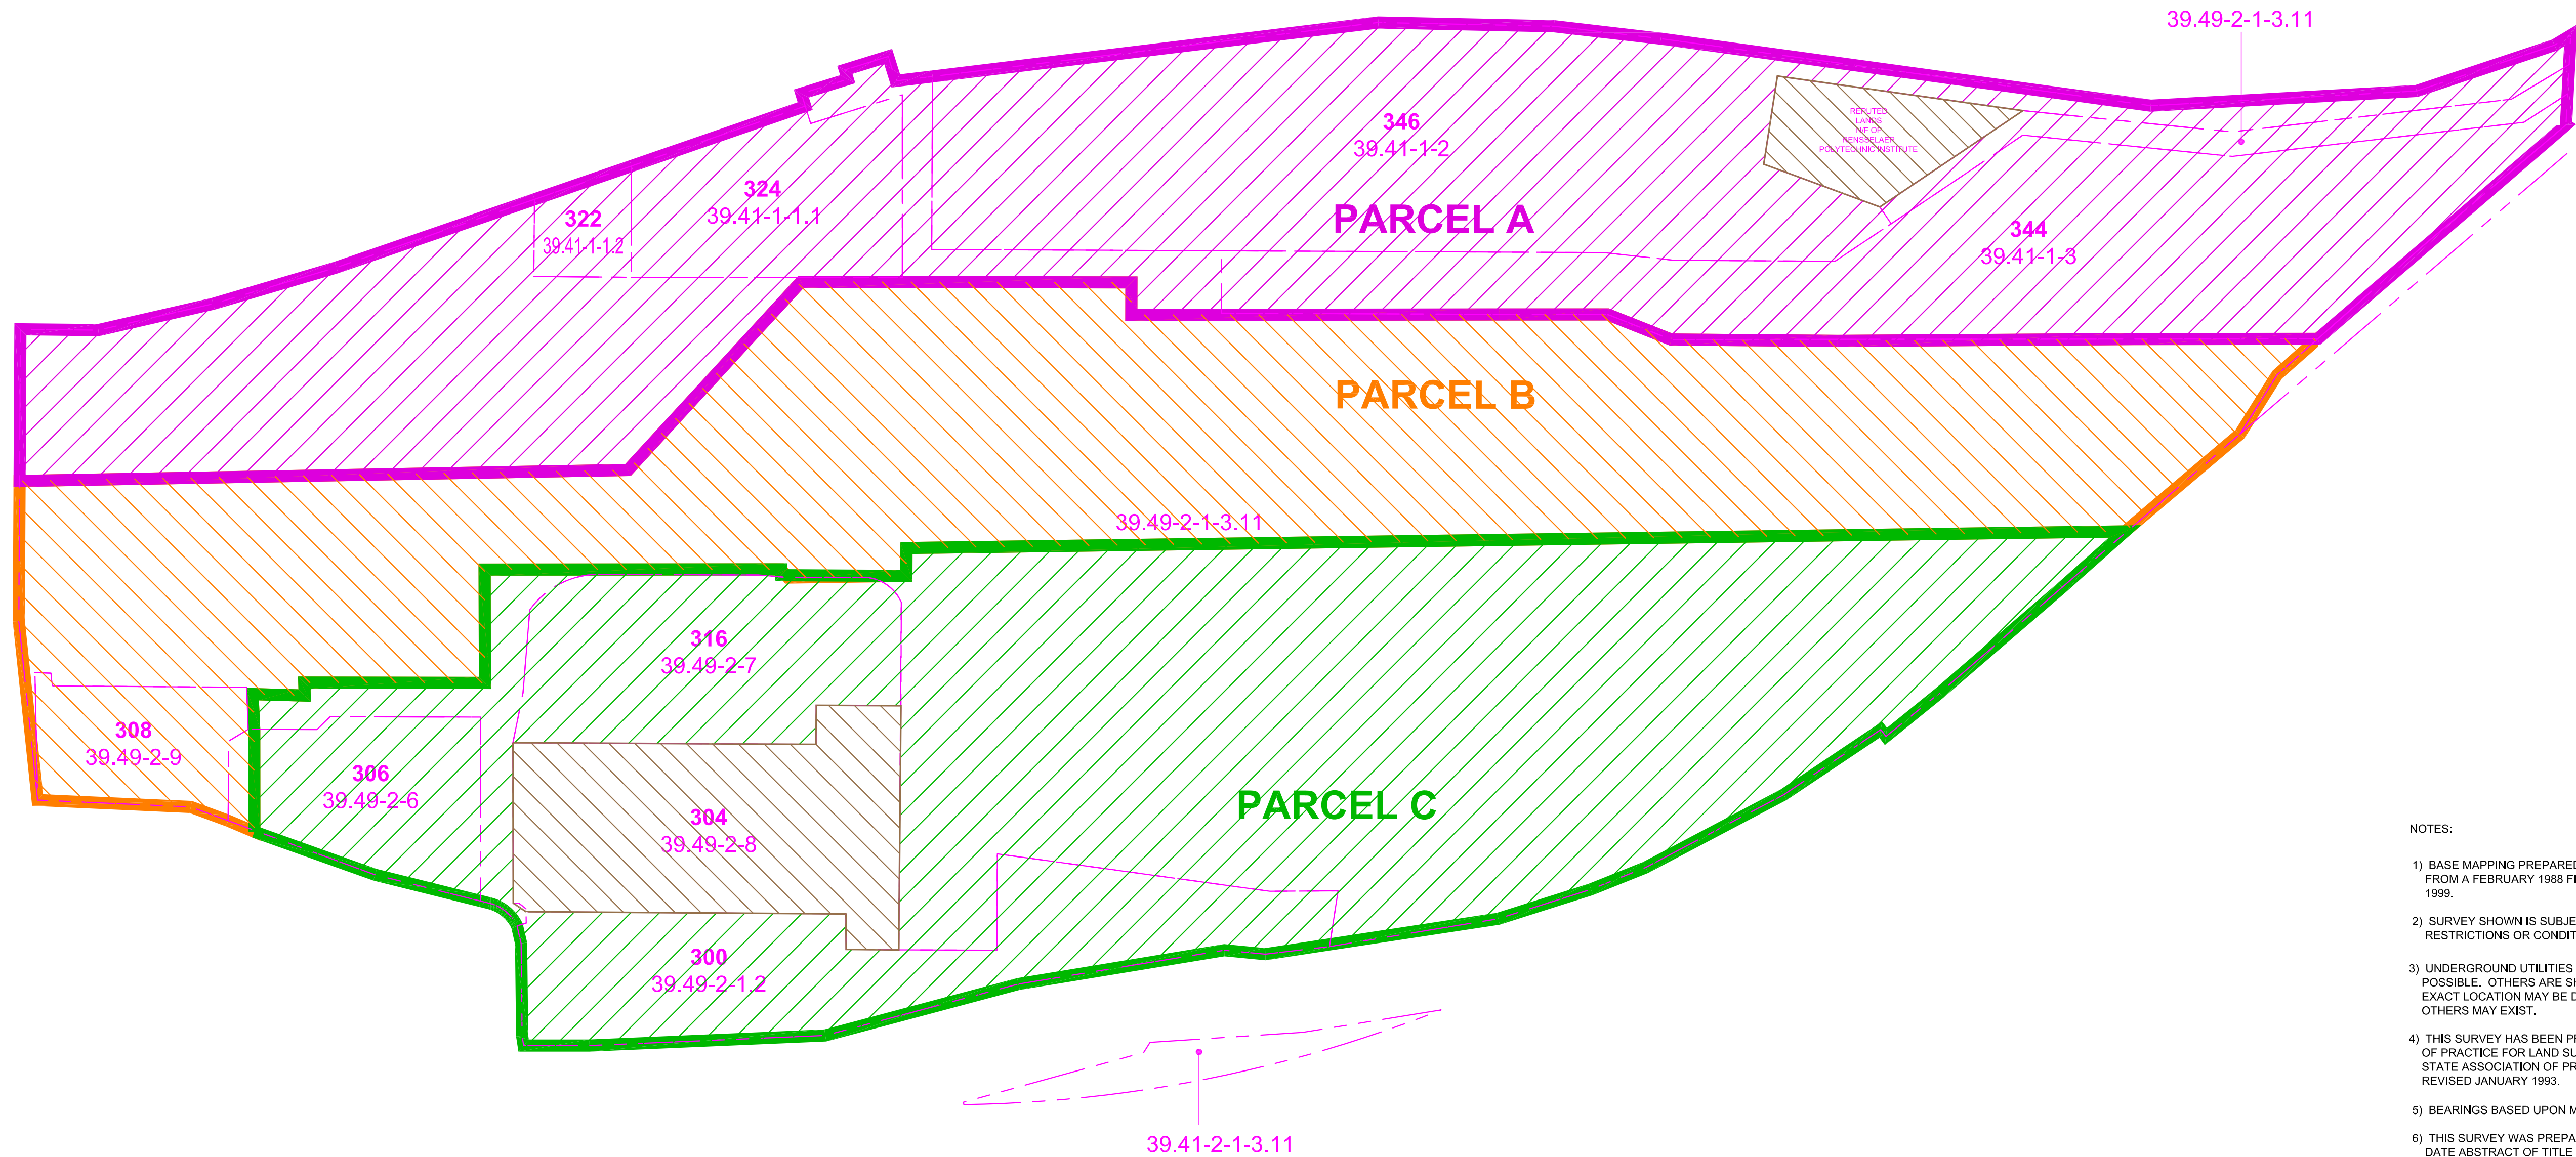

MAP REFERENCE:

- 1) "SURVEY OF LANDS, ALCO LOCOMOTIVE, INC., CITY OF SCHENECTADY, COUNTY OF SCHENECTADY", DATED MARCH 1970, AS PREPARED BY C.T. MALE ASSOCIATES.
- 2) "A SUBDIVISION OF A PORTION OF LANDS OF SCHENECTADY INDUSTRIAL CORPORATION", DATED JUNE 30, 1988, AS PREPARED BY THE ENVIRONMENTAL DESIGN PARTNERSHIP.
- 3) "SITE PLAN, PROPOSED C & D RECYCLING FACILITY, NOTT STREET INDUSTRIAL PARK", DATED FEBRUARY 1995, AS PREPARED BY INGALLS SMART ASSOCIATES.



A horizontal scale bar labeled "SCALE (feet)". The bar has markings at 120, 60, 0, and 120. The segments between 120 and 60, and between 60 and 0, are white. The segments between 0 and 120, and between 120 and 60, are black.

	Address	Lat.	Long.	Parcel	Section #	Block #	Lot #	Acresage
1	____ Nott Street (internal parcel, river front)	42°49'28.37"N	73°50'12.25"W	324	39.41	1	1.1	1.39
2	____ Nott Street (internal parcel, river front)	42°49'26.62"N	73°50'14.64"W	322	39.41	1	1.2	0
3	____ Nott Street (internal parcel, river front)	42°49'33.40"N	73°56'14"W	346	39.41	1	2	6.39
4	____ Nott Street (internal parcel, river front)	42°49'34.49"N	73°55'57.14"W	344	39.41	1	3	5.3
5	____ Nott Street (internal parcel, river front)	42°49'28.37"N	73°56'12.25"W		39.41	1	3.1	5.3
6	301 Nott Street (fronts on Nott and Erie Blvd)	42°49'20.29"N	73°56'5.75"W	300	39.49	2	1.2	2.7
7	____ Nott Street	42°49'28.37"N	73°50'12.25"W		39.49	2	1.4	2.6
8	____ Erie Street	42°49'28.37"N	73°56'11.30"W	308	39.49	2	5	0.86
9	405 Front St	42°49'19.59"N	73°56'13.13"W	306	39.49	2	6	1.26
10	____ Front Street (internal parcel, river front)	42°49'23.51"N	73°56'9.24"W	316	39.49	2	7	2.21
11	____ Nott Street (internal parcel, river front)	42°49'21.20"N	73°56'8.26"W	304	39.49	2	8	2.48
12	____ Nott Street	42°49'29.25"N	73°56'2.28"W	Large Main NW'd Erie Blvd	39.49	2	1.311	37.42
		42°49'28.96"N	73°55'52.49"W					
		42°49'22.16"N	73°55'59.38"W					
	229 Front Street				39.48	1	16	0.88

PARCEL A - 21.00 ACRES
PARCEL B - 17.22 ACRES
PARCEL C - 19.30 ACRES

The information included on this graphic representation has been compiled from a variety of sources and is subject to change without notice. Kiefhaber makes no representations or warranties, express or implied, as to accuracy, completeness, timeliness, or rights to the use of such information. This document is not intended for use as a land survey product nor is it designed or intended as a construction design document. The use or misuse of the information contained on this graphic representation is at the sole risk of the party using or misusing the information.



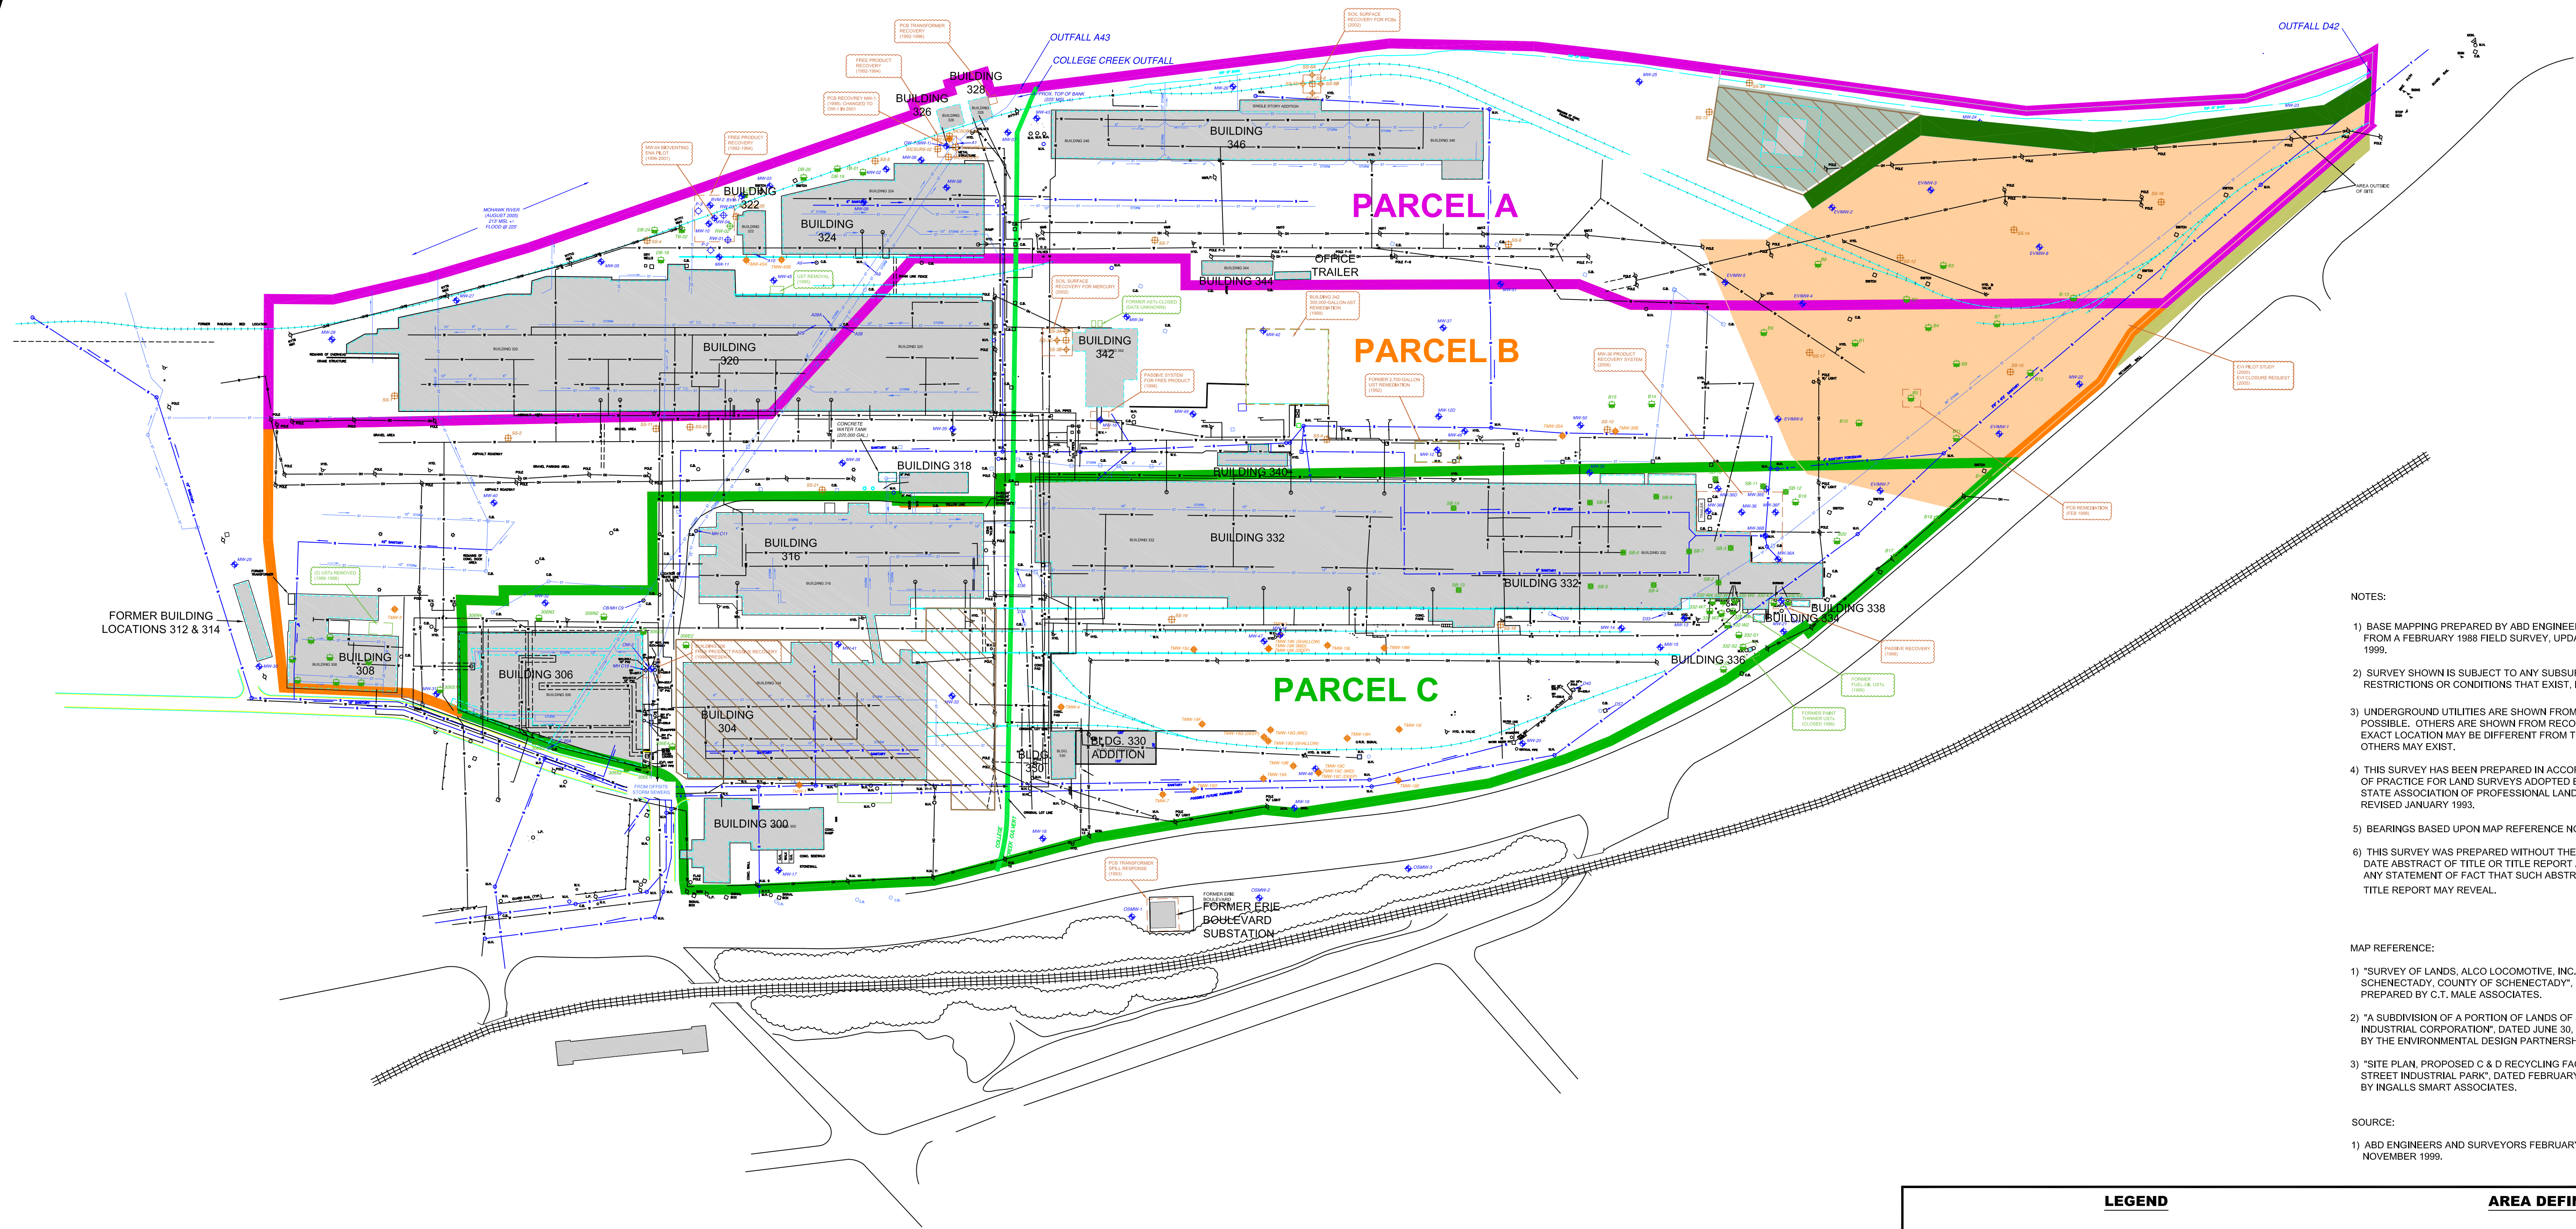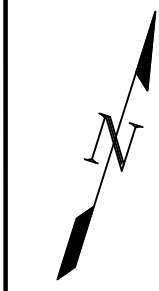

NOTES:

- 1) BASE MAPPING PREPARED BY ABD ENGINEERS & SURVEYORS FROM A FEBRUARY 1988 FIELD SURVEY, UPDATED TO NOVEMBER 1999.
- 2) SURVEY SHOWN IS SUBJECT TO ANY SUBSURFACE EASEMENTS, RESTRICTIONS OR CONDITIONS THAT EXIST, IF ANY.
- 3) UNDERGROUND UTILITIES ARE SHOWN FROM FIELD LOCATION IF POSSIBLE. OTHERS ARE SHOWN FROM RECORD DATA. THEIR EXACT LOCATION MAY BE DIFFERENT FROM THAT AS SHOWN AND OTHERS MAY EXIST.
- 4) THIS SURVEY HAS BEEN PREPARED IN ACCORDANCE WITH THE CODE OF PRACTICE FOR LAND SURVEYS ADOPTED BY THE NEW YORK STATE ASSOCIATION OF PROFESSIONAL LAND SURVEYORS AS LAST REVISED JANUARY 1993.
- 5) BEARINGS BASED UPON MAP REFERENCE NO. 1.
- 6) THIS SURVEY WAS PREPARED WITHOUT THE BENEFIT OF AN UP TO DATE ABSTRACT OF TITLE OR TITLE REPORT AND IS SUBJECT TO ANY STATEMENT OF FACT THAT SUCH ABSTRACT OF TITLE OR TITLE REPORT MAY REVEAL.

MAP REFERENCE:

- 1) "SURVEY OF LANDS, ALCO LOCOMOTIVE, INC., CITY OF SCHENECTADY, COUNTY OF SCHENECTADY", DATED MARCH 1970, AS PREPARED BY C.T. MALE ASSOCIATES.
- 2) "A SUBDIVISION OF A PORTION OF LANDS OF SCHENECTADY INDUSTRIAL CORPORATION", DATED JUNE 30, 1988, AS PREPARED BY THE ENVIRONMENTAL DESIGN PARTNERSHIP.
- 3) "SITE PLAN, PROPOSED C & D RECYCLING FACILITY, NOTT STREET INDUSTRIAL PARK", DATED FEBRUARY 1995, AS PREPARED BY INGALLS SMART ASSOCIATES.

SOURCE:

- 1) ABD ENGINEERS AND SURVEYORS FEBRUARY 1988, REVISED NOVEMBER 1999.

LEGEND

PROPERTY BOUNDARY

MANHOLE WITH DRAINAGE STRUCTURE NUMBER

CATCH BASIN WITH DRAINAGE STRUCTURE NUMBER

LIFT STATION WITH DRAINAGE STRUCTURE NUMBER

MANHOLE (M.H.)

CATCH BASIN (C.B.)

MONITORING WELL (MW)

TEMPORARY MONITORING WELL (TMW)

RECOVERY WELL

PIEZOMETER

GEOPROBE BORING

SURFACE SOIL SAMPLE LOCATION (SS)

SOIL BORING LOCATION

AREA DEFINITIONS

BUILDINGS/STRUCTURES

"EVI" PARCEL

"RPI" PARCEL

OTHER PROPERTIES NO PART OF SITE

REMEDIATION AREA

FORMER UST/AST LOCATIONS

120 60 0 120
SCALE (feet)



PROJECT NO. 107121
DRAWN: 05/01/10
DRAWN BY: CTH
CHECKED BY:
FILE NAME:
107121BCPMAY10.dwg




SITE LAYOUT

YOUNG-SUMMER-MAXON
ALCO-MAXON SITE DEVELOPMENT
SCHENECTADY, NEW YORK

PLATE

2

The information included on this graphic representation has been verified from a variety of sources and is subject to change without notice. The user of this graphic representation is responsible for its use and for its accuracy. The user of this graphic representation is responsible for its use and for its accuracy. The user of this graphic representation is responsible for its use and for its accuracy.

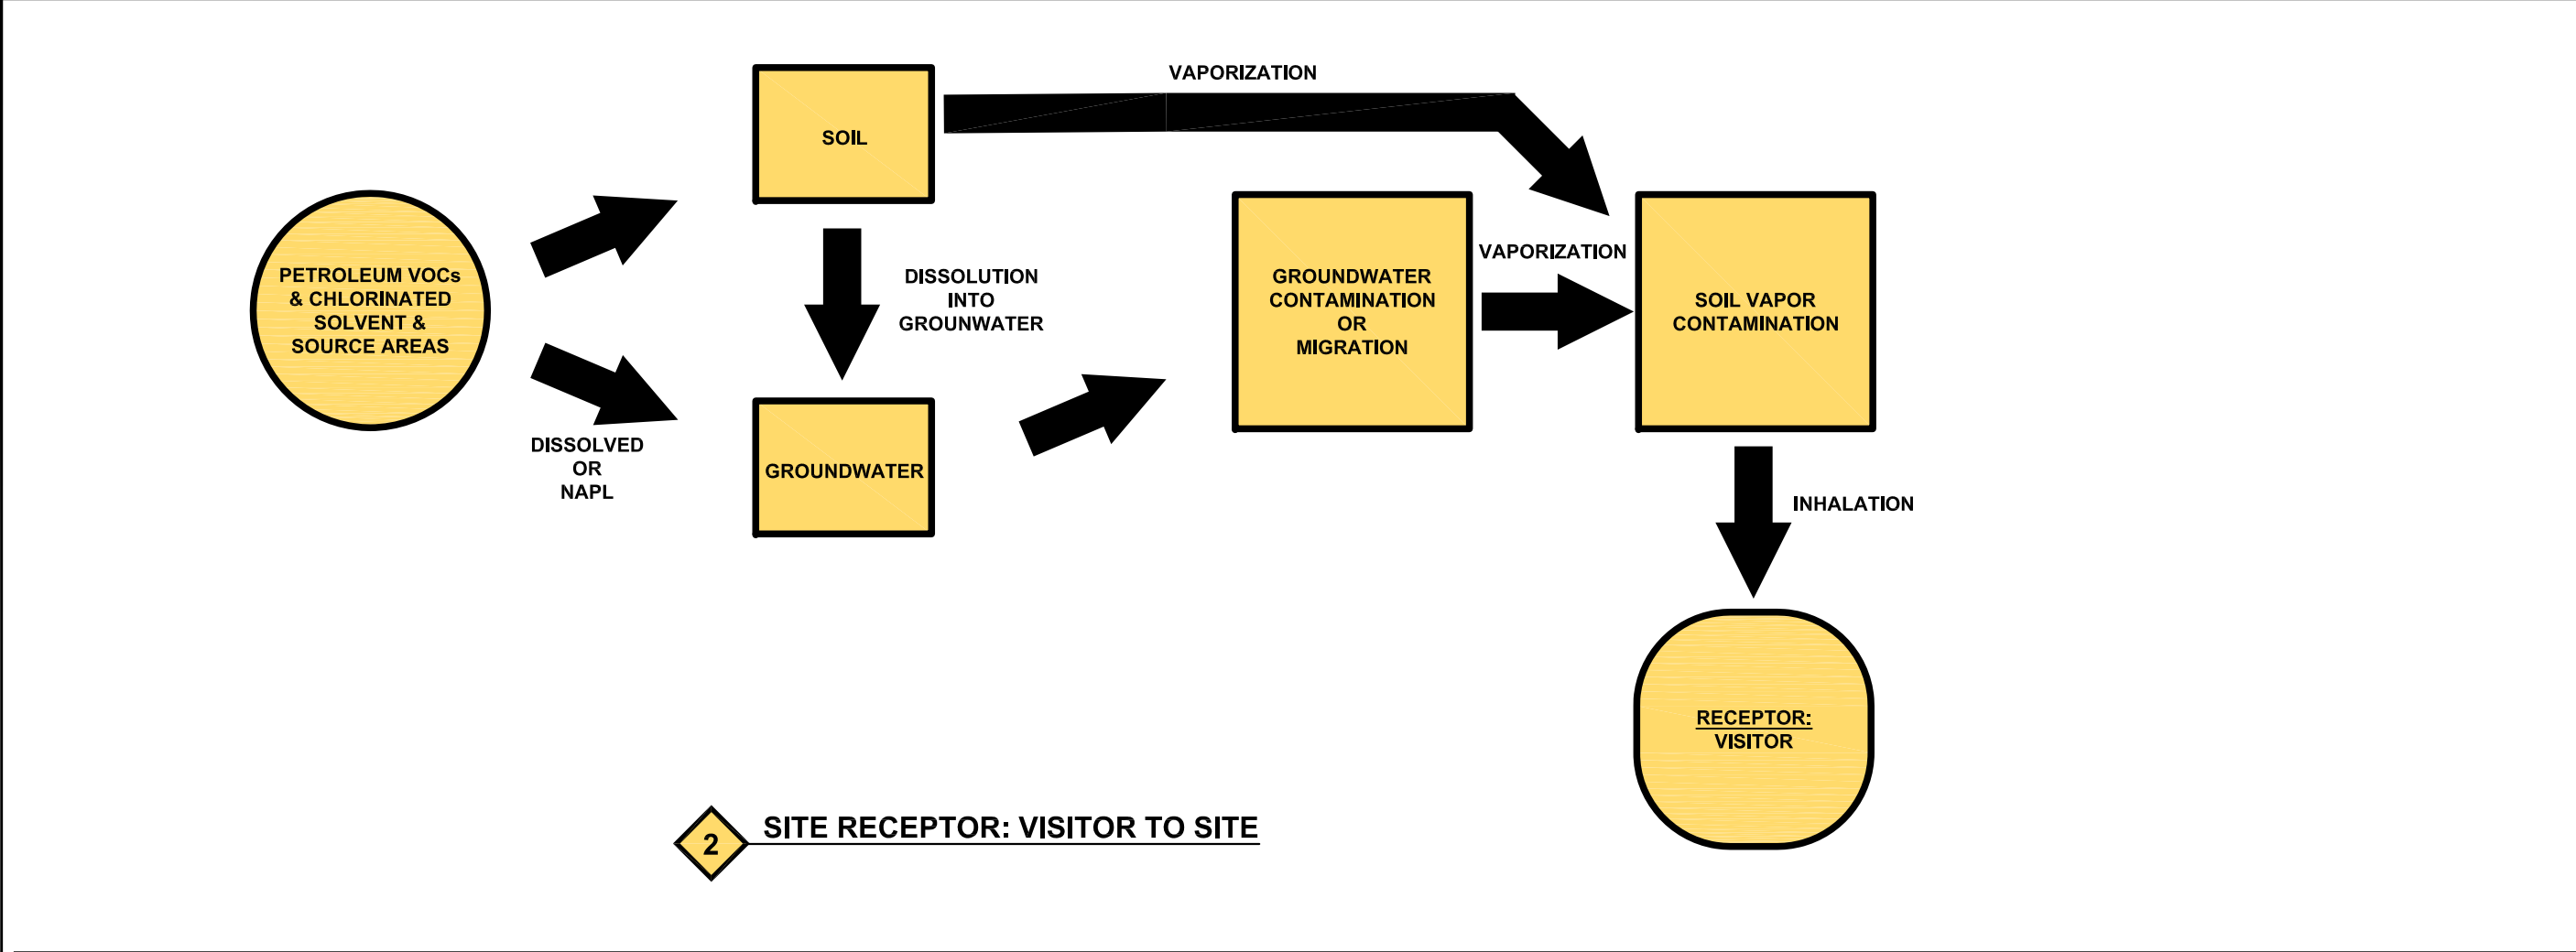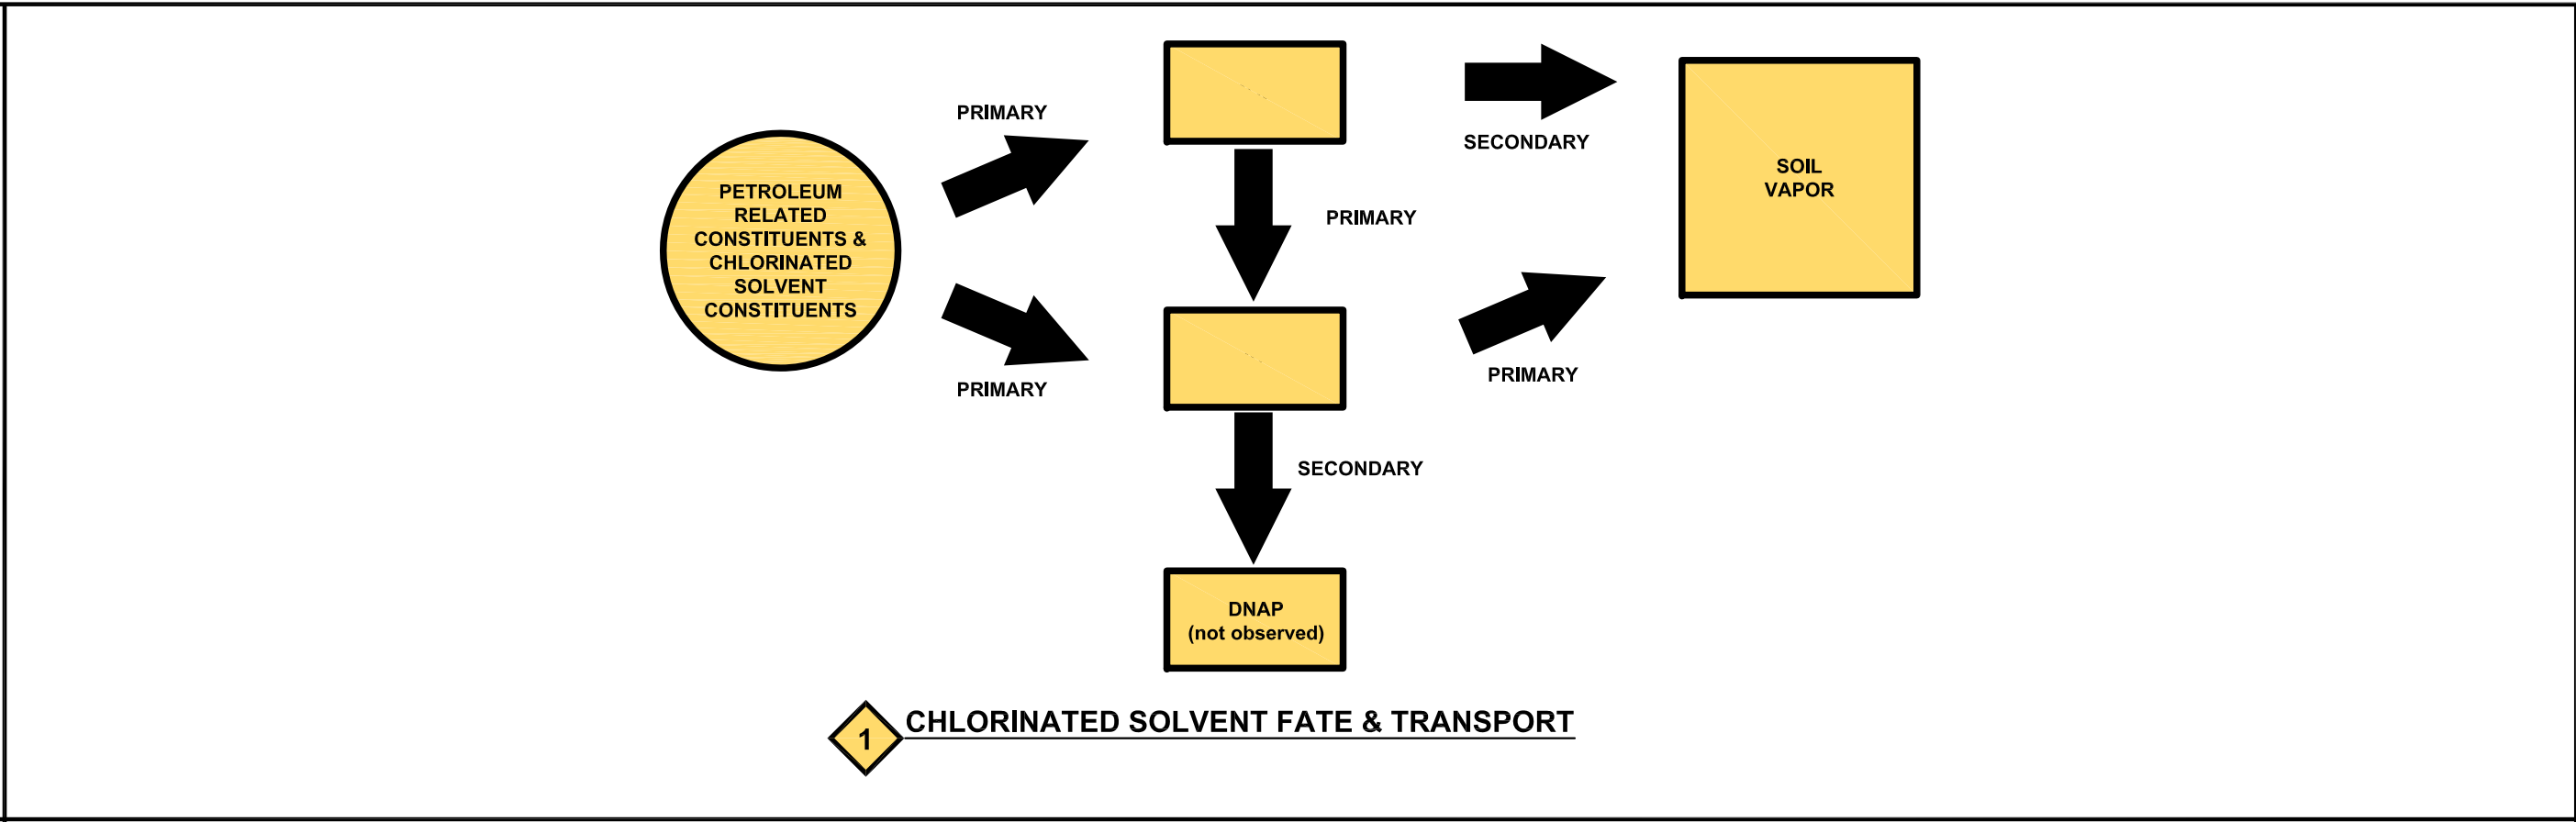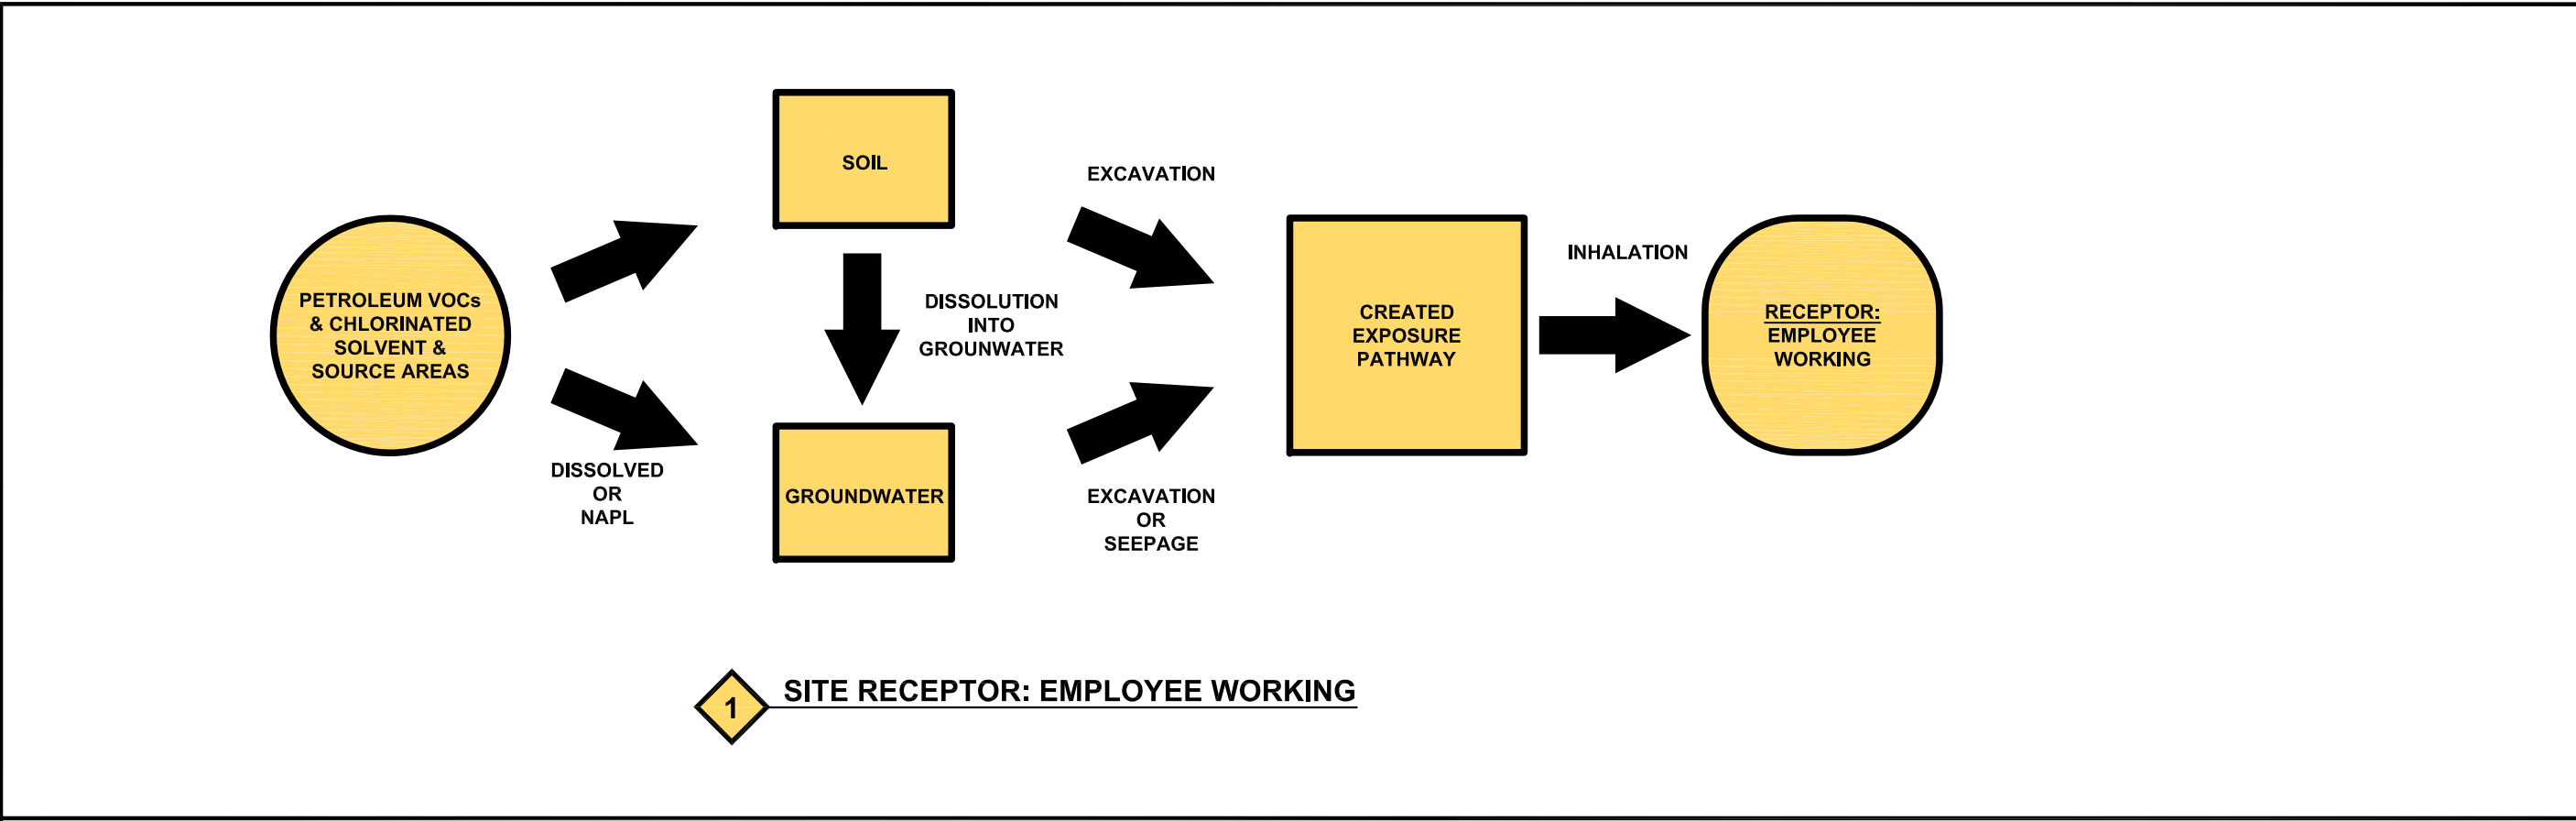

On-Site Buildings (to be demolished)
Buildings presumably currently contain:
-Asbestos containing materials
-Lead based paint
-Universal waste
-Mercury switches
-Polychlorinated biphenyls in lighting ballasts

Building ID's and current usages
336 - General office/commercial space and small materials laboratory
304 - Owned by STS Steel
306 - Occupied by various commercial firms (HVAC company, composite materials fabricator)
308 - Unoccupied
316 - Temporary storage facility/unoccupied
318 - Occupied by inactive industrial waste water equipment
320 - Storage for landscaping equipment and vehicles/unoccupied
322 - Unoccupied
324 - Storage of furniture/unoccupied
332/334 - Used by STS Steel; building and roofing material storage
336 - Former pump house for paint thinner
338 - Gas meter house
340 - Unoccupied
342 - General but incomplete decommissioning in process
344 - Occupied by a landscape company
346 - Occupied by Dimension Fabricators to prepare pre-fabricated re-bar structures


Constituents of Potential Concern Locations		
Identified Areas of Concern		
Parcel	Area	COPCs
324	1	Petroleum
322 and portion of 3.11	2	Petroleum
3.11	3	Petroleum
3.11	4	Petroleum (NAPL)
3.11, 304 and 306	5	Petroleum (NAPL ?)
3.11, 344 and 346	6	Chlorinated solvents
Other Areas of Concern		
Parcel	Area	COPCs
3.11 and portions of 344 and 346	EVI	PAHs - Subsurface
	Building 308	Possibly PAHs, Metals and Petroleum
	Former Erie Boulevard	Mineral oil and Chlorinated solvents
	3.11 Substation	Petroleum, PAHs, Metals
	College Creek	Petroleum
	A43 Outfall Sewers	Petroleum, PAHs, Metals
	D42 Outfall Sewers	Metals

LEGEND

PROPERTY BOUNDARY

AREA DEFINITIONS

- AREAS 1, 2 - AREAS ORIGINALLY DEFINED AS PETROLEUM IMPACTED
- AREAS 3, 4, 5 - AREAS SUSPECTED OF FUEL-OIL IMPACTS
- AREA 6 - AREA SUSPECTED OF CHLORINATED SOLVENT IMPACT
- BUILDINGS/STRUCTURES
- EVI PARCEL
- SUSPECTED LNAPL LOCATION
- "RPI" PARCEL
- OTHER PROPERTIES NO PART OF SITE
- REMEDATION AREA
- FORMER UST/AST LOCATIONS

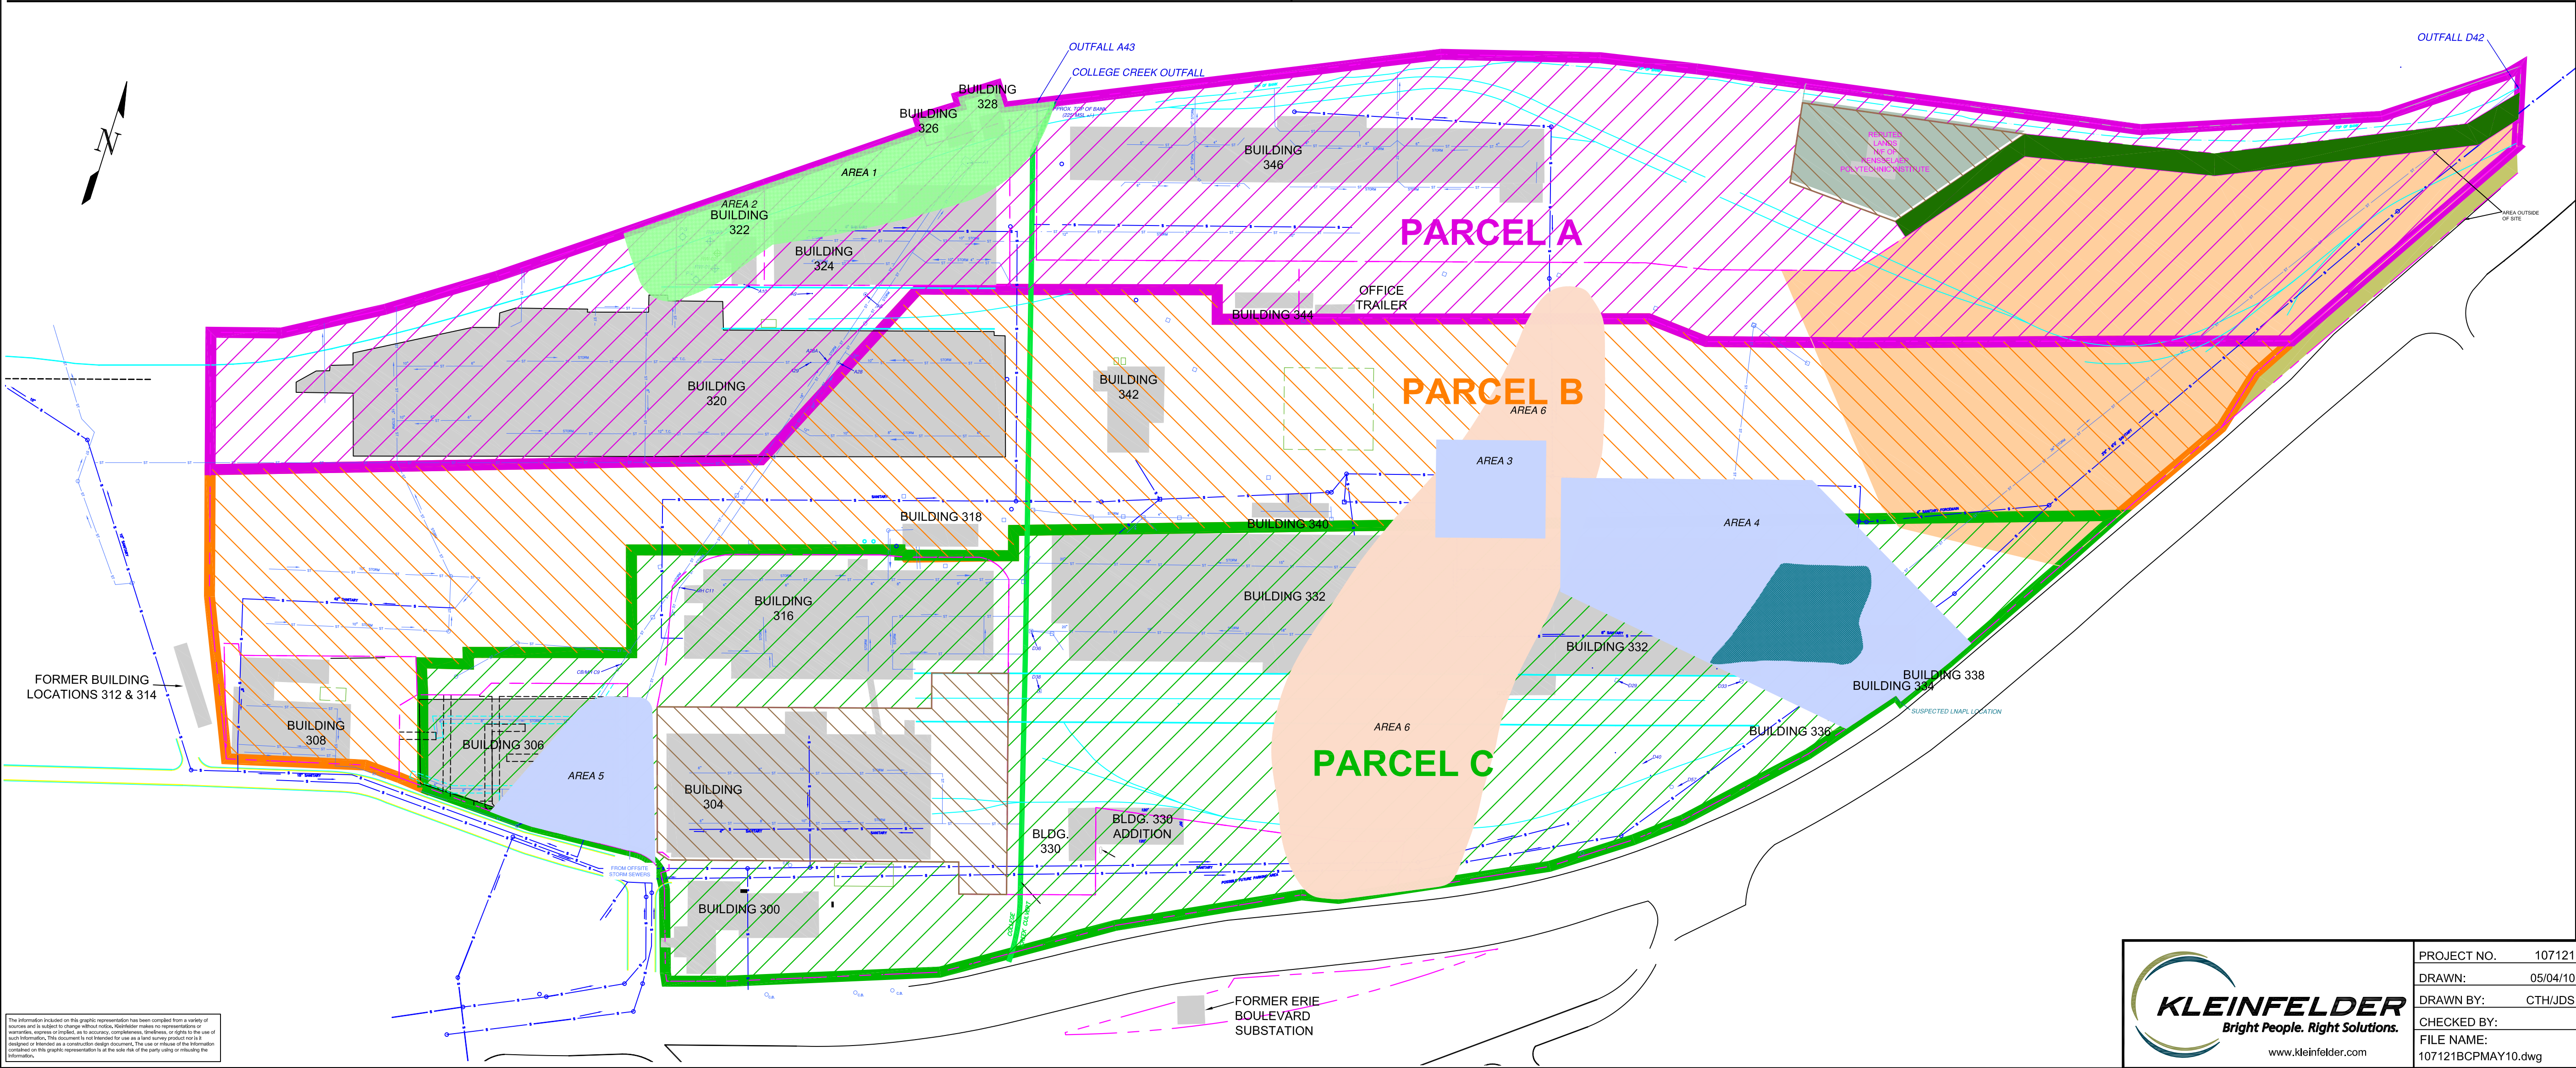

This information included on this graphic representation has been compiled from a variety of sources and is subject to change without notice. The data is not intended to be used for any purpose other than that for which it was originally intended. The user of this information is responsible for its proper use and for the accuracy of the data used in its preparation.

KLEINFELDER
Bright People. Right Solutions.
www.kleinfelder.com


PROJECT NO. 107121
DRAWN: 05/04/10
DRAWN BY: CTH/JDS
CHECKED BY:
FILE NAME: 107121BCPMAY10.dwg

CONCEPTUAL SITE MODEL

YOUNG-SOMMER/MAXON
ALCO-MAXON SITE
SCHENECTADY, NEW YORK

PLATE

3

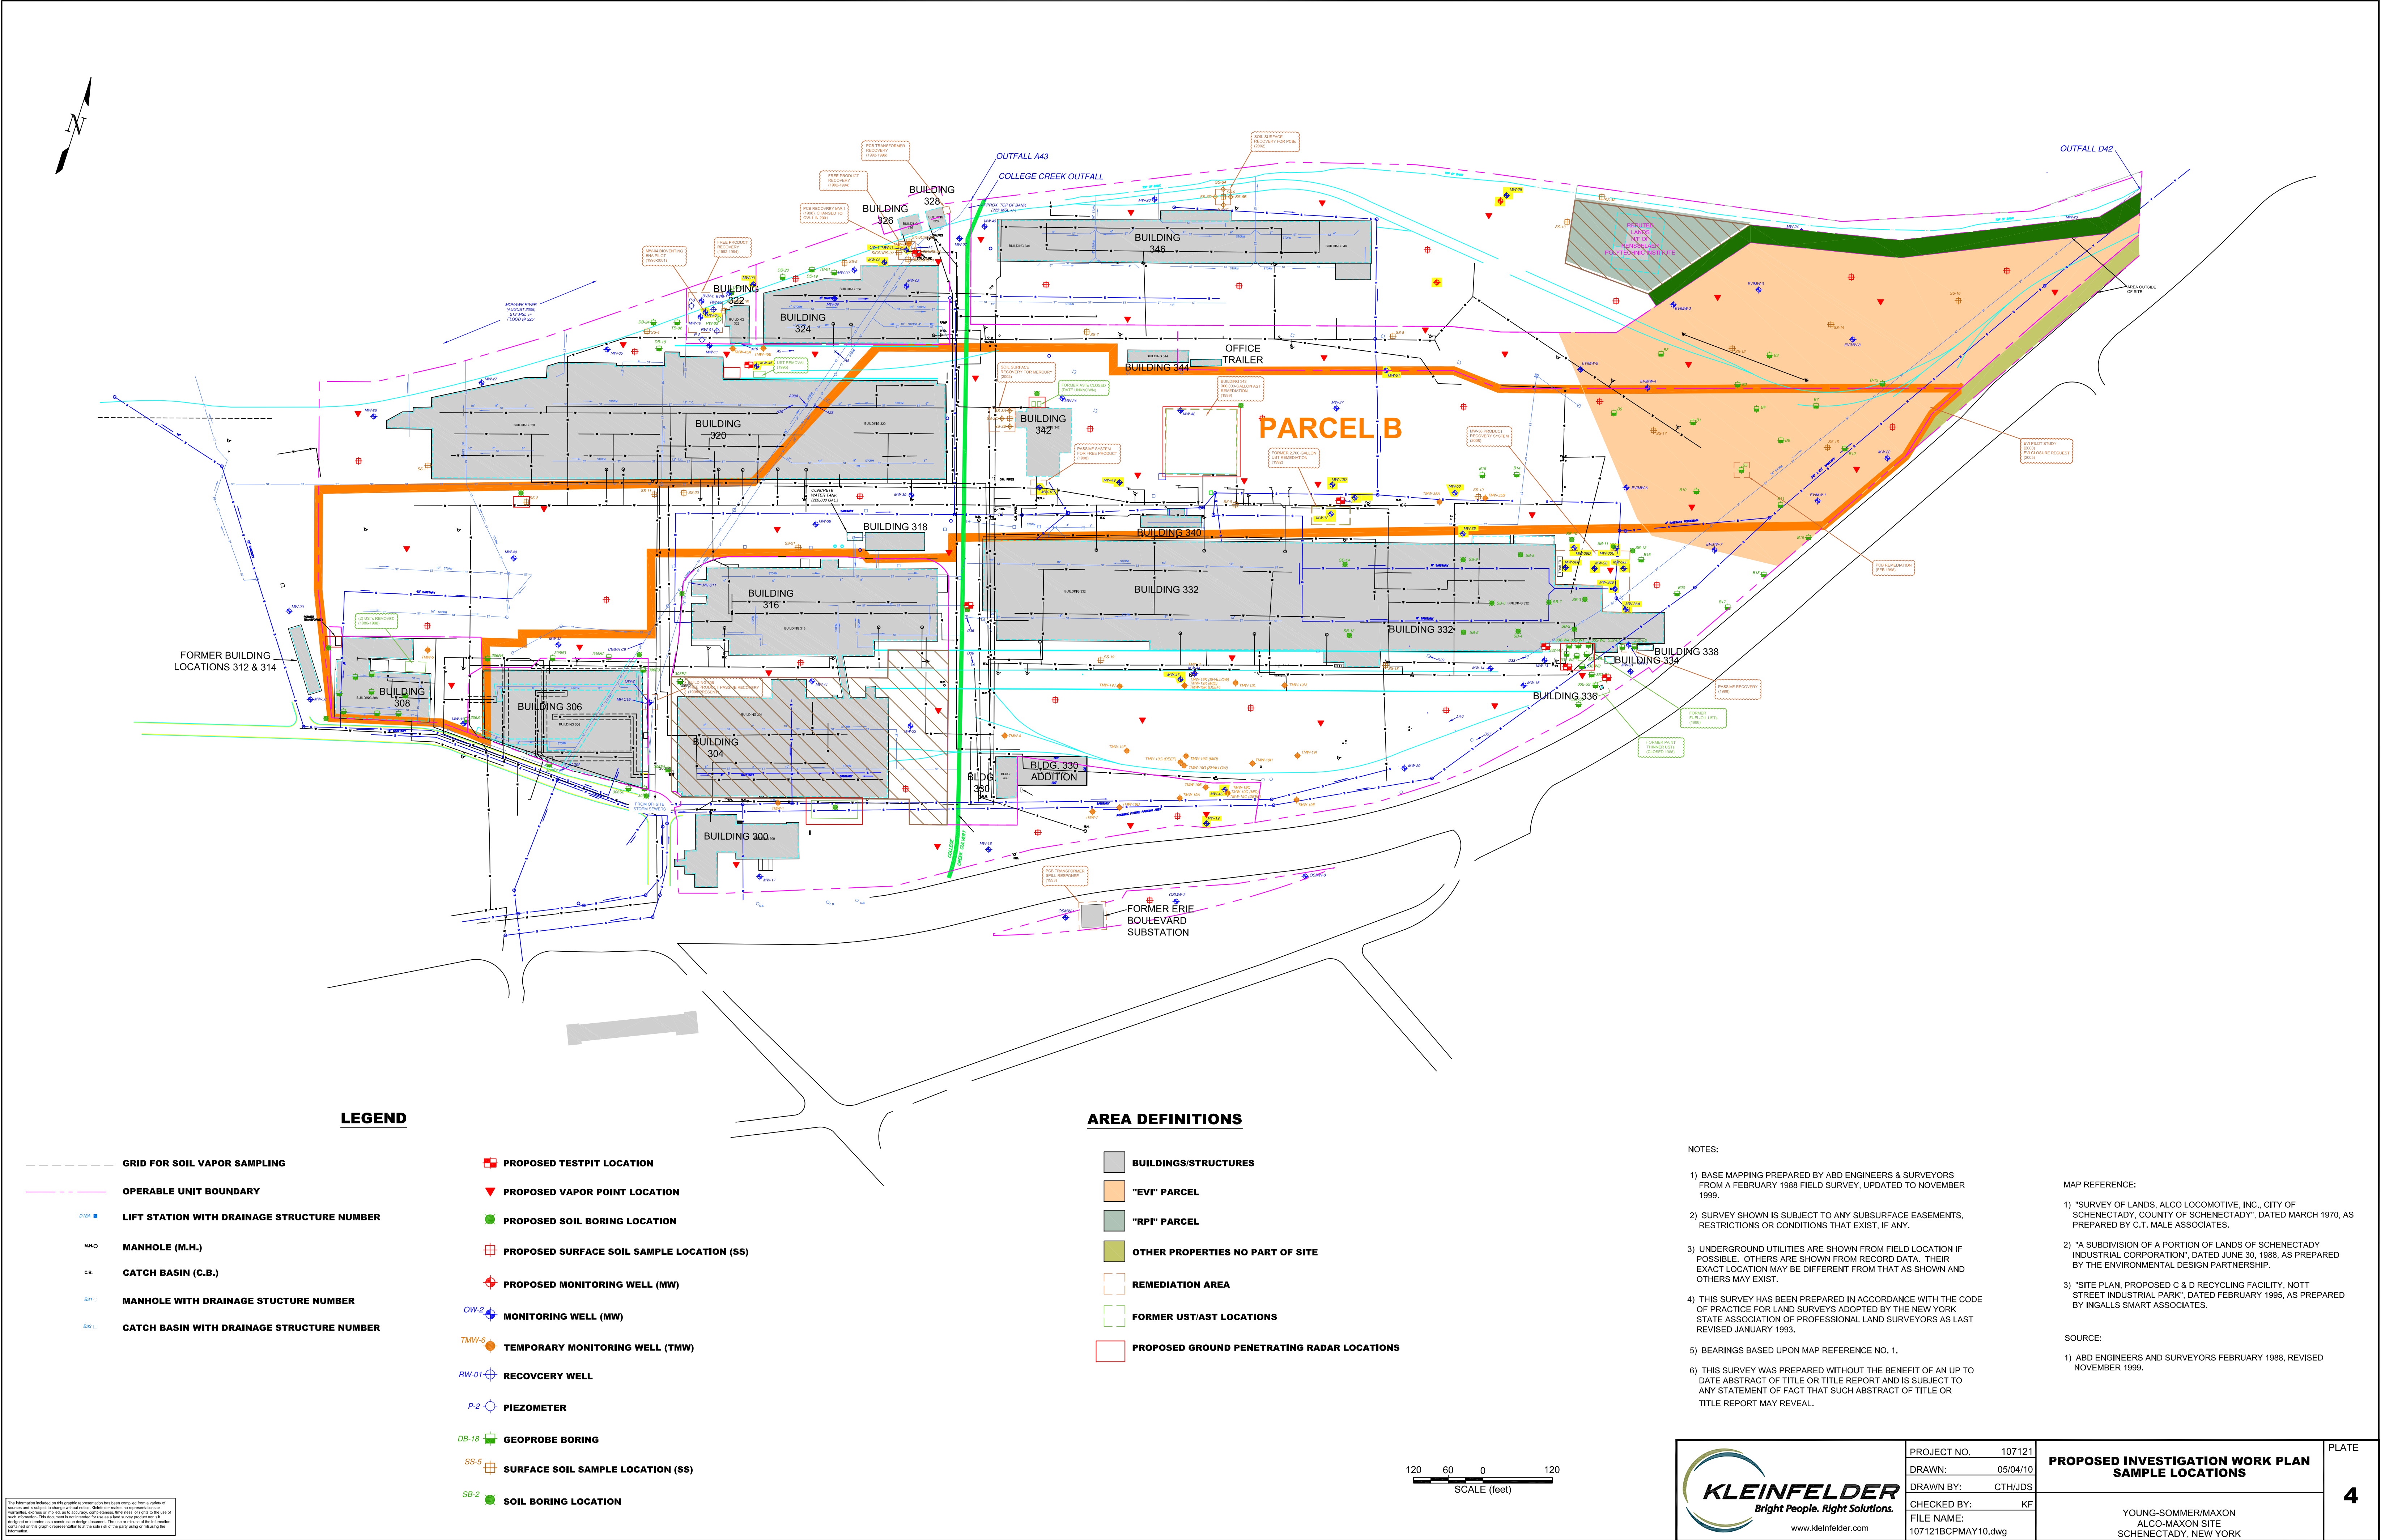



APPENDIX A

HISTORIC ENVIRONMENTAL DATA AND REC SUMMARY

APPENDIX A

PROJECT ENVIRONMENTAL HISTORY

Environmental Reports

During April 1992, Coyne Textile Services (CTS), with operations on Front Street, adjacent to the ALCO Industrial Site, had a major fuel oil release that partially escaped into the storm drain sewer system which flows under Parcels A, B and C, discharging to the Mohawk River at the College Creek Outfall. During inspection of this release, the New York State Department of Conservation (NYSDEC) reportedly observed petroleum seeping from riprap along the bank of the Mohawk River adjacent to Buildings 320 (which lies within both Parcels A and B) and 324 (located within Parcel A). The NYSDEC requested that a subsurface investigation be performed onshore adjacent to the petroleum seep areas. Following this release, Schenectady Industrial Corporation (SIC) entered into an Order on Consent (OC) (Index No. R4-1338-92-05) with the NYSDEC.

In 1992, SIC performed a subsurface investigation in Parcel A that included advancing a series of five hand-excavated test pits (TP-A1 through TP-E1) along the riverbank. Soil analytical results indicated total petroleum hydrocarbon (TPH) concentrations up to 12,000 parts per million (ppm). Following these results, two deep soil borings and five shallow soil borings were advanced adjacent to the test pits. The five shallow soil borings were completed at groundwater monitoring wells. Free-phase petroleum was found in two wells and the free-phase petroleum in one well was found to contain low levels of polychlorinated biphenyls (PCBs). Groundwater analytical results indicated TPH concentrations ranging from 4.6 ppm to 32,200 ppm. Volatile organic compound (VOC) concentrations were detected.

Historically there have been many environmental investigations completed at the former ALCO Industrial property since the initial investigation in 1992. These investigations, some of which were conducted in conjunction with NYSDEC oversight, have taken place across all three of the ALCO-Maxon Site, which has been separated into Parcels A, B and C. These investigations are summarized below. In addition to the environmental investigations conducted throughout the former ALCO Industrial property, underground storage tank (UST) removals and remedial activities have been completed on the ALCO-Maxon Site parcels. Summaries of the UST removals and remedial activities follow below.

The Applicant is providing a comprehensive recitation of all of the investigations and past response activities across the entire ALCO-Maxon Site parcels in each of the BCP Applications for Parcels A, B and C because at the time of the investigations and response actions, the former ALCO Industrial property was treated as one undivided site. Because some of the investigation data involves contamination that spans across

what are now the three separate Parcels (A, B, and C). For example, contamination condition associated with prior spills impacted groundwater that migrates under each of the parcels, including a plume of chlorinated volatile organic contamination that originates in the Parcel C area and migrates under both Parcels B and A. As a result, the investigation and remediation of the three Brownfields sites will require coordination and technical assessment that will require, in some locations, a multi-parcel response. As such, as noted below, and in the attached data tables and sampling results, the entire ALCO-Maxon Site property, involving distinct parcels A, B and C, are impacted by past industrial spills and releases, causing contaminant conditions that have complicated the redevelopment and reuse of the property and the individual parcels.

Plate 2 (attached hereto) shows the location of the sampling locations in Parcel B, along with the sampling locations in Parcels A and C.

Sampling Data

The following tables present analytical data for the entire ALCO-Maxon Site.

- Table 1—Surface Soil Data
- Table 2—Soil Boring Data
- Table 3—Groundwater Data
- Table 4—Surface Water Data
- Table 5—Monitoring Well Data
- Table 6—Building Are Specific Investigation Data
- Table 7—UST Closure Program Data
- Table 8—Remediation Program Data
- Table 9—Chlorinated Solvent Data

Suspected Contaminants & Sources

Table 10 presents the current list of Recognized Environmental Conditions.

SUMMARY OF ENVIRONMENTAL INVESTIGATIONS

The following is a summary of each environmental investigation conducted at the former ALCO Industrial property from 1992 through 2009, in historic time order.

In April 1992, a business operating adjacent to the Property had a major fuel oil release that partially escaped into the storm drain sewer system, discharging to the Mohawk River at the College Creek Outfall. During inspection of this release, the New York State Department of Conservation (NYSDEC) reportedly observed petroleum discharges seeping from riprap along the bank of the Mohawk River adjacent to Buildings 320 and 324 in Parcel A. The NYSDEC requested that a subsurface investigation be performed onshore adjacent to the petroleum seep areas. Schenectady Industrial Corporation (SIC) entered into an Order on Consent (OC) (Index No. R4-1338-92-05).

Interim Investigation, July-August 1992—Interim Report Tasks 1 Through 4 Drainage System Assessment, Nott Street Industrial Park (Dames & Moore, 1993)

During July and August 1992, Dames & Moore performed an interim investigation on behalf of SIC. This investigation included evaluating the sewer system; visual site inspection and records review to evaluate potential on-site petroleum sources; and, collecting and analyzing three Mohawk River surface water samples from locations adjacent to and downstream of the reported soil seep areas.

From this investigation, Dames & Moore recommended maintaining contaminant booms in the vicinity of the College Creek outfall; removing oil from surcharged manholes and catch basins; monitor sewer system for on- and off-site discharges of oil; and, exploring the feasibility of separating the Park from the City of Schenectady's storm sewer system. In addition, Dames & Moore found several on-site structures that could be potential petroleum sources. Finally, results of the Mohawk River water samples indicated that volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), pesticides, poly chlorinated biphenyls (PCBs), and Priority Pollutant Metals (PP Metals) were not detected above the laboratory reporting limits.

Follow-up Investigation, July-September 1992—Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent, File No. R4-1338-92-05 (Dames & Moore, 1993)

To address various other issues, Dames & Moore performed several additional investigation activities from July through September 1992. The additional activities discussed in the report included analytical results of free-product samples collected from monitoring wells MW-01 and MW-04; analytical results from water samples collected from the storm sewer system near monitoring well MW-01; analytical results



from additional water samples collected from the Mohawk River; free-product recovery from monitoring wells MW-01 and MW-04; Identification and removal of PCB-containing transformers; and deployment of oil containment absorbent booms.

The results of this investigation indicated that the free-phase product in MW-01 and MW-04 was either highly weathered diesel oil or No. 2 fuel oil and likely resulted from historical operations in Building 324 or from former ASTs or USTs that were removed. These samples also contained other COCs such as PBCs, VOCs, and metals. One storm sewer sample contained PCBs and an absorbent boom was placed in the manhole. Two water samples collected from the Mohawk River near MW-01 and MW-04 did not contain petroleum ID, PCBs, VOCs, SVOCs or PP Metals. Six downstream water samples collected from the Mohawk River did not contain PCBs.

Free-phase petroleum was hand bailed from wells MW-01 and MW-04, from October 1992 through December 1992 and January 1993, respectively. In January 1993, free-phase product skimming systems were installed and became operational in these wells.

Oil-containment and absorbent booms were placed on the Mohawk River adjacent to the petroleum seeps in November 1992. In addition, three transformers adjacent to Building 328 were removed and disposed of in February 1993.

Delineation Boring Program, October-November 1992—Summary of Activities Related to Delineation Boring Program (Dames & Moore, 1993)

Dames & Moore performed a soil-boring program in October and November 1992. The scope of this work included the drilling and sampling of 29 soil borings. Four of these borings were converted to 6-inch-diameter groundwater/product recovery wells (RW-01 through RW-04). These wells were installed in the immediate vicinity of areas where free-phase petroleum was detected. A step drawdown test and a pump test were performed on well RW-02. The pump test results indicated that a recovery system could be operated with one recovery well in each of the two identified areas of free-phase petroleum.

In addition to the four borings converted to recovery wells, 10 of the remaining 25 borings were converted to piezometers (P-1 through P-10). Following installation, free-phase petroleum was observed in three of the recovery wells (RW-01, RW-02, and RW-03) and in two of the piezometers (P-1 and P-3) adjacent to monitoring well MW-04. Soil sample results suggested that relatively elevated total petroleum hydrocarbons (TPH) concentrations were limited to an area along the edge of the river in the vicinity of monitoring well MW-04.

Surface, Subsurface & Groundwater Investigation, March-May 1994—*Summary of Investigations* (Dames & Moore, 1994)

Additional investigation activities were performed between March 28 and May 5, 1994. The investigation was performed in three areas (Area 1 defined as the area near monitoring well MW-01 between Buildings 324 and 326/328 in Parcel A; Area 2 defined as the area near monitoring well MW-04 to the west of Building 322 and north of Building 320 in Parcels A and B; and Area 3 defined as the area near the former hazardous waste UST adjacent to the north side of Building 332 (which is within Parcel B) and consisted of the collection of eight surficial soil samples, installation of five shallow groundwater monitoring wells, installation of two intermediate-depth groundwater monitoring wells, and collection and analysis of groundwater samples from 12 monitoring wells.

The Summary Report concluded that based on the results of the investigation, it appeared that the extent of free-phase petroleum in the groundwater was limited to two small areas at the Park. One of these areas was at monitoring well MW-01 and the second area was at monitoring well MW-04. Further, the report concluded that the only area where PCBs had been detected was in the vicinity of monitoring well MW-01. Low levels of dissolved hydrocarbons had been detected at three areas at the Park: the vicinity of monitoring well MW-01, the vicinity of monitoring well MW-04, and an area west of Building 332 (monitoring well MW-12), where a UST was formerly located. In addition, Dames & Moore recommended continuing the operation of the temporary free-product skimming systems in monitoring wells MW-01 and MW-04.

Building 332 and 342 Subsurface investigation, August 1995—*Subsurface Investigation - Building 332 & 342* (ABB, 1995)

During the summer of 1993, excavations were performed adjacent to the southeast corner of Building 332 (in Parcel C) to install storm sewer infrastructure. Petroleum-stained soil was encountered during this excavation program and was observed by the NYSDEC. Chemical analyses indicated that the staining was a result of weathered No. 2 fuel oil. During a meeting with the NYSDEC on June 19, 1995, it was agreed that an investigation would be performed near Building 332.

ABB Environmental Services, Inc. (ABB), which succeeded Dames & Moore as SIC's consultant, implemented a drilling program between August 15 and 16, 1995. The program included the installation of three groundwater monitoring wells (MW-13, MW-14, and MW-15) around the estimated perimeter of the subsurface oil-stained soil area observed in 1993 adjacent to Building 332 during an infrastructure improvement excavation. No free product was observed in the Building 332 wells. Based on the petroleum identification analysis, weathered No. 2 fuel oil was identified in all soil



samples. VOCs, SVOCs, or PCBs were not detected in the groundwater samples. One inorganic (arsenic) was detected.

During the summer of 1993, an oily sheen was observed in a Building 342 (which is within Parcel B) basement sump. Based on this observation, ABB installed one groundwater monitoring well (MW-16) on the east side of the building to characterize subsurface conditions in this area. Results of soil sample analysis identified weathered No. 2 fuel oil. In groundwater two SVOCs and zinc were detected that exceed the NYSDEC Class GA groundwater quality standards. During the groundwater sampling event, a floating layer of free-phase product approximately 1/8-inch thick was observed in monitoring well MW-16. An absorbent pad was installed in the well and upon removal had oily staining, although no floating product was observed in the well.

Building 326 Transformer Pit Inspection & Sampling, June 1996—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

On June 14, 1996, sludge samples were collected from the two transformer pits in Building 326, in Parcel A, and analyzed for PCBs. PCBs were detected from within the right pit of Building 326 at concentrations of 0.340 parts per million (ppm) and 0.058 ppm for Aroclors 1248 and 1260, respectively. In addition, low levels of VOCs and metals were detected in both pits.

EVI Parcel Screening Investigation, July-August 1996—Subsurface Investigation - Proposed EVI Building 1996 (ABB, 1996)

The area identified as the EVI Parcel (within the northeast corner of the property and which extends from Parcel C through Parcel B and into Parcel A) is an approximate 5.5-acre portion of the property located northwest of Building 332 which includes property within Parcels A, B and C. This investigation was part of a general environmental due diligence for the proposed EVI building to be used for a commercial recycling operation, and was conducted as an investigation program in conjunction with a voluntary agreement (R4-VA-02-96-09) between SIC and the NYSDEC. This investigation consisted of advancing three soil borings and completing each as a groundwater monitoring well.

Groundwater was encountered at approximately 12 feet bgs, and the stratigraphy was determined to be fill (foundry debris) overlying silty clay, overlying till. Slight fuel oil odors were encountered at or above the water table. The analytical results for the three soil samples analyzed were all non-detect; however, seven base neutrals (B/Ns) compounds and three metals were detected in the groundwater. The B/Ns were detected in the sample obtained from monitoring well EVIMW-2. The seven compounds detected were all above the applicable NYSDEC drinking water criteria (GA Standards). ABB subsequently recommended that monitoring well EVIMW-2 be re-sampled for B/Ns



to determine if the polycyclic aromatic hydrocarbons (PAH) compounds detected were a localized occurrence or part of a larger groundwater plume.

EVI Parcel Investigation Program, May-June 1997—*Subsurface Investigation - Proposed EVI Facility (ABB, 1997)*

ABB subsequently conducted additional investigation on behalf of the SIC in May and June 1997. The investigation consisted of advancing 20 soil borings and the construction of five monitoring wells.

The results from the field investigation indicated that stained soils were observed at 18 of the 25 locations explored. The monitoring wells were subsequently sampled in June 1997, and neither light non-aqueous phase liquid (LNAPL) nor dense NAPL (DNAPL) was detected in any of the eight wells. The results of the laboratory analyses indicated that VOCs, B/Ns, PCBs, pesticides/herbicides were detected in soil samples, and VOCs, B/Ns, PCBs and one PP Metal were detected in groundwater samples. Nine of the B/N compounds and one pesticide/herbicide compound exceeded the NYSDEC soil cleanup criteria. In addition, two VOC compounds exceeded NYSDEC groundwater criteria.

The report indicated that most of the compounds detected could be associated with medium- to heavy-end petroleum products (i.e., No. 2 fuel oil/diesel fuel; No. 4 and No. 6 fuel oils). Based upon the analytical results, ABB identified four potential sources and concluded that the oil-like material below the water table migrated beneath the EVI Parcel and was not located within the EVI Parcel. The potential sources identified included: 1) the site-wide fill encountered within the upper 3 to 5 feet of most of the borings; 2) a large former AST that was located northeast of the parcel across Erie Boulevard; 3) historical operations that occurred at Building 332 in Parcel C, including the stained soil area southeast of Building 332; and 4) the former UST on the north side of Building 332.

Based upon the results of the investigation, Harding Lawson Associates (HLA; formerly ABB) proposed to the SIC that the soil containing PCBs be excavated and properly disposed of off-site.

Building 330 RCRA Closure Investigation, December 1997—as cited in *Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)*

In December 1997, in preparation for the RCRA closure of Building 330 in Parcel C, 14 samples of the concrete floor were collected and analyzed for VOCs, SVOCs, and metals, using the TCLP method. The concrete floor samples were also analyzed for total PCBs. With the exception of barium (detected at 14 locations) and chromium (detected at one location), all TCLP results were below the laboratory detection limit. Detections of barium and chromium metals were well below the TCLP regulatory levels.



The PCB levels ranged from below the laboratory detection limit to 13 ppm (Aroclor 1254).

Building 306 Geoprobe® Investigation, December 1998—*Subsurface Investigation Report, Building 306* (HLA, April 1999)

On November 4, 1998, free-product petroleum was observed by HLA in an excavation that was being performed involving installation of a new catch basin structure adjacent to the north side of Building 306 in Parcel C. Response activities included the installation of a passive free product recovery system, which is discussed further below.

To better characterize subsurface conditions near Building 306, HLA performed a subsurface investigation on December 11, 1998. Eleven borings were advanced to the water table and soil samples collected. Weathered diesel fuel was detected in nine of the 11 samples, with TPH ranging from 270 ppm to 6,800 ppm. HLA suggested that the occurrence of petroleum in soil samples located approximately 100 feet downgradient of Building 306 indicated that petroleum staining might have extended beneath the paved parking lot downgradient of Building 306. Additionally, HLA suggested that due to the detection of weathered diesel fuel in the samples collected upgradient of the building along Front Street, an off-site source may be responsible for at least a portion of the subsurface petroleum staining in this area.

Building 332 Geoprobe Investigation, December 1998—*Subsurface Investigation Report Former Tank Farm - Building 332* (HLA, April 1999)

On December 10, 1998, HLA conducted a subsurface investigation of the USTs at the southeast end of Building 332 in Parcel C. Twelve subsurface borings were advanced to the water table. One sample was collected from each boring directly above the water table. These samples were submitted for TPH analysis. In addition, three of the samples were analyzed for VOCs, SVOCs, PCBs, and PP Metals. Nine of the samples contained petroleum hydrocarbons ranging from 190 ppm to 13,000 ppm. Two SVOC compounds were detected in one sample above the NYSDEC recommended soil cleanup objectives.

In addition, five piezometers were installed. The piezometers were assessed for free product using a narrow-diameter bailer on January 8, 1999. Free product was observed in two piezometers; the NYSDEC was notified following the discovery of the free product. Response activities included the installation of a passive free product recovery system.

HLA recommended that additional subsurface investigations downgradient of Building 332 be considered to address the presence of free product from the former tank farm, as well as to determine the need for remediation in this area.

Building 308 Geoprobe Investigation, April 1999—Building 308, Environmental Assessment Report (Letter Report) (HLA, June 14, 1999)

In response to the SIC's plan to lease Building 308 (which lies within Parcel B), HLA performed a limited subsurface environmental assessment of Building 308. A total of eight Geoprobe explorations were completed through the concrete floor within a pipe trench system that was used in conjunction with diesel engine testing. Two soil samples were collected from each exploration, and five of the eight sample sets were analyzed for TPH, VOCs, SVOCs, and PCBs. Petroleum staining of subsurface soils was noted, but there were no chemical constituents above the NYSDEC recommended soil cleanup objectives. One of the five samples analyzed had a TPH diesel concentration of 5,500 ppm. This was determined to be consistent with the historical use of this building, which included diesel engine testing. The letter report indicated that the planned reuse for Building 308 was to be heavy industrial activities, and that the SIC plans to fill in the trench system. Therefore, according to HLA, potential exposure routes for workers within the building would be eliminated.

Perimeter Investigation (PI), November-December 1999 & January 2000—Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

In November and December 1999 and January 2000 a series of perimeter investigations were conducted at the Park to obtain initial subsurface soil and groundwater information around the perimeter of the Park. The perimeter investigations included soil boring and monitoring well installation and sampling. Fifteen new monitoring wells were installed at locations around the perimeter of the ALCO Industrial property. These wells were then sampled to evaluate the quality of the groundwater entering and leaving the property. In addition, subsurface soil samples were obtained from the borings for the new wells, and groundwater samples were collected from selected existing wells. Soil and groundwater samples were analyzed for VOCs, SVOCs, PCBs, and TAL metals. Selected soil samples were also analyzed for TPH.

In addition to the well borings, four exploratory borings were drilled adjacent to perimeter wells MW-31, MW-20, MW-25, and MW-27 for observation of the stratigraphy at these locations. The new and existing wells were surveyed, and water level elevations were measured to evaluate the hydraulic gradients and groundwater flow directions. During water level measurement, the wells were inspected for the presence of NAPL.

A supplemental groundwater sampling event was performed that included the collection of additional groundwater samples using the low-flow sampling method and measurement of the groundwater elevations within a 1-day period. In addition, groundwater samples were obtained from three temporary wells installed directly downgradient (north) of perimeter monitoring well MW-19. This well was found to contain elevated levels of VOCs.

Overall, the PI confirmed what was already generally known about the subsurface from previous investigations, namely that: 1) subsurface petroleum staining is nearly ubiquitous at the Park, generally beginning at the water table; 2) upgradient sources of environmental degradation appear to be impacting the Park and or that contamination flows across the site, from Parcel C, across Parcel B to Parcel A; 3) groundwater quality is impacted; and 4) PCBs were detected at low concentrations at a limited number of wells.

Site Investigation (SI), Fall 2000 & Spring 2001—Site Investigation Summary Report, Nott Street Industrial Park, Schenectady, New York (BBL, February 2002)

BBL performed investigation activities as a follow-up to previous investigations. The SI activities were performed during Fall 2000. Based on the results of the initial activities, additional investigation activities performed during spring 2001.

Twenty-one surface soil samples (0- to 2-inch depth) were collected and analyzed to evaluate conditions at former storage areas and other potential areas of concern across the interior of the Park. The results for these samples indicate slightly elevated concentrations of mercury and PCBs in the areas around SS-3 and SS-6, respectively. The SS-3 sampling point is located on the west side of Building 342 in Parcel B) in what is now Parcel B and SS-6 on the north side of Building 346 in Parcel A.

Fifteen new monitoring wells and 24 temporary wells were installed and analyzed within the interior of the Park to characterize groundwater quality within the shallow groundwater zone. With the exception of well MW-35, no LNAPL was observed in the new wells.

Soil Samples were collected from 21 well borings to characterize subsurface soil conditions within the interior of the Park. Subsurface soils at certain locations beneath the Park contained petroleum hydrocarbon compounds that mainly had been identified as residual diesel fuel, fuel oil (no. 4), and lubricating oil. The sources of petroleum were not specifically known but the occurrences appeared to be localized proximal to the sample locations.

Additional near-surface and vertical delineation soil sampling for mercury in the proximity of SS-3 based on the detection of mercury during the Fall 2000 fieldwork. The additional delineation suggested that the detection of mercury at SS-3 was an isolated result since further samples showed a pronounced decline within a distance of 5 feet from the original sample location. The pattern of delineation sample results also suggested that this impact was localized to an area close to the side of the building.

Additional near-surface and vertical delineation soil sampling for PCBs in proximity to SS-6 based on the detection of PCBs during the Fall 2000 fieldwork. Concentrations of



total PCBs were also elevated (1.03 to 5.51 ppm) in the samples collected 5 feet south, east, and west of original sample location. The total PCB concentration in the sample collected 5 feet to the north was only 0.476 mg/kg, suggesting that the elevated PCB levels were probably localized proximal to the building.

Three deep (overburden) wells hydraulically downgradient of perimeter monitoring well MW-19 were installed. Results from groundwater sampling performed during the SI activities indicated that the area in proximity to and hydraulically downgradient of MW-19 was of concern. Groundwater samples collected at the MW-19 well during sampling events contained elevated levels of chlorinated solvent compounds.

A temporary background depth-profile well was installed on the south side of Erie Boulevard, hydraulically upgradient of perimeter monitoring well MW-19. Results from groundwater samples collected from the temporary well on the south side of Erie Boulevard indicated that solvent compounds were also present, but at concentrations one to two orders of magnitude lower on Park values. This suggested that a potential source of these constituents may be at or closer to the MW-19 area.

Soil samples from the deep well borings were collected. Subsurface soil samples collected directly above the water table and at the top of a silty clay unit contained concentrations of chlorinated VOCs above criteria. Additionally, PCBs were detected at a concentration above the criteria.

Additional groundwater sampling was completed at seven existing monitoring wells. PCB results for groundwater samples collected during the Fall 2000 and Spring 2001 indicated that by reducing agitation of fines in the wells and turbidity in the groundwater samples using low-flow purging and sampling, the presence of PCBs in unfiltered samples was greatly reduced. In the limited instances where concentrations of total PCBs were above the Class GA criteria in the unfiltered samples, the concentrations were below this value in the respective filtered samples, with one exception. According to BBL, these results suggested that any presence of PCBs in groundwater was likely associated with solids that were present in turbid water samples during some of the sampling events.

Four temporary piezometers were installed to measure water levels and oil thickness (if present) in proximity to interior monitoring wells MW-35 and MW-45. During the May 29, 2001 groundwater gauging event, LNAPL was detected in MW-35. LNAPL was also detected in temporary monitoring wells TMW-35A and TMW-35B. These temporary wells are located approximately downgradient of MW-35. LNAPL was also detected in temporary monitoring well TMW-45B, which was installed directly downgradient of MW-45. However, LNAPL was not measured in MW-45.

Measurement of water levels was completed at the 54 existing shallow wells and three new deep wells. The results of these measurements were consistent with the data

collected during the PI fieldwork activities suggesting that the groundwater gradient in both the shallow and deep portions of the aquifer is generally north/northwest towards the Mohawk River.

Specific-capacity testing to determine the hydraulic conductivity at eight wells at the Park was completed. Hydraulic conductivity (K) values were calculated for wells EVIMW-2, MW-4, MW-19, MW-21, MW-35, MW-46, MW-47 and MW-48. The K values ranged from 2.22E-06 cm/sec (6.30E-03 ft/day) at MW-21 to 3.56E-02 cm/sec (1.01E+02 ft/day) at MW-47. BBL stated that the wide range in K values was reflective of the lower permeability of the silty clay soil prevalent at MW-21, and the higher permeability of the sandier soil prevalent at MW-47.

Soil Excavation and Well Install Activities, September 2003—Soil Excavation and Monitoring Well Installation Activities Report, Nott Street Industrial Park, Schenectady, New York (VHB, December 17, 2003)

On September 4, 2003, nine cubic yards of PCB-impacted soil was removed from the north side of the office attached to building 346 in Parcel A. Following review of results of soil sampling within the excavation, on September 9, 2003, another 0.21 cubic yards of impacted soil was removed from the southern side of the initial excavation. Post excavation soil samples indicated that PCB concentrations were below regulatory criteria.

On September 9, 2003, ten cubic yards of low-level mercury-impacted soil was excavated at the northwest corner of building 342 in Parcel B. Following review of results of soil sampling within the excavation, on September 17, 2003, another 1.1 cubic yards of impacted soil was removed from the northern side of the initial excavation. Post excavation soil samples indicated that mercury concentrations were below regulatory criteria.

On September 2 and 3, 2003, five monitoring wells were installed in the vicinity of MW-36. Soils encountered during drilling included two to four feet of fill material underlain by interbedded medium to very coarse sands and silty to fine sandy clay. During development activities, the presence of a petroleum-like odor and oil sheen on the drummed purge water was observed.

Site Characterization (SC) EVI Parcel, January 2005—Site Characterization Report, Draft, Nott Street Industrial Park, Schenectady, New York (GSC, January 2005)

This report provided a historical summary of all activities that have take place on the EVI Parcel (the Parcel). The report concluded that upon review of all the data collected from the Parcel, COCs (mainly PAHs, PCBs, and inorganic materials) were present in surface soil, subsurface soil and groundwater. The report detailed that potential future exposure to COCs through contact with surface and sub-surface soils could be removed



through the installation and maintenance of an engineered cap. Site investigation indicated petroleum impacted soil and minimal groundwater contamination, that is primarily semi-volatile organics (poly-aromatic hydrocarbons or PAHs).

Memo Regarding College Creek Outfall Release, October 2005—Memo, Nott Street Industrial Park, College Creek Outfall Releases of October 13 & 14, Schenectady, New York (Environmental Risk Group [ERG], October 17, 2005)

A sheen was observed coming from the College Creek Outfall (CCO) on October 13, 2005. The sheen was traced on the ground and in rain puddles to an overland flow emanating from STS Steel diesel above-ground storage tanks (ASTs). The NYDEC was notified and spill number 0508410 was assigned. Absorbent boom and the dry chemical absorbent Speedy-Dry was applied to the area of the spill on October 13. Absorbents were also placed in four locations downgradient of the STS diesel ASTs and around catch basin D38. It was recommended that a secondary containment system should be placed around all diesel ASTs in the Park; that all tenants with ASTs have emergency spill kits available; that SIC store several hundred feet of absorbent boom for emergency placement at the CCO; and that an investigation of soil contamination will be required around STS Steel's diesel ASTs and their new building.

Chlorinated Solvent Plume Update, September 2007—Nott Street Industrial Park, SIC, Chlorinated Solvent Plume Update, Schenectady, New York (Kleinfelder, September 2007)

Kleinfelder summarized the historic investigations regarding the chlorinated solvent plume in what was characterized as Area 6, now identified as Parcel C. The report concluded that findings of investigations by Arcadis/BBL indicated that the on-site origin of the chlorinated solvent plume appeared to have been in the relative vicinity of MW-19. The report indicated that the chlorinated solvent plume was estimated to be approximately 900 feet long, extending from MW-19 to at least MW-51, following the hydraulic gradient with respect to flow direction and moving deeper in the aquifer. As such, this plume likely impacts Parcels C, B and A. Additional investigation was recommended to better define the nature and extent of the plume.

Environmental Investigations, September 2009—Off-Property Groundwater Evaluation, Nott Street Industrial Park, Schenectady, New York (Kleinfelder, September 2009)

Kleinfelder installed three off-property monitoring wells across Maxon Road from the Park and specifically MW-19. All seven soil samples collected during this investigation contained VOCs and SVOCs at concentrations below regulatory criteria. In addition, one soil sample contained SVOCs at concentrations above applicable regulatory criteria. PCBs were not detected in any of the seven soil samples collected. Only two groundwater samples could be collected because two of the newly installed wells were dry upon gauging. Groundwater samples were collected from one newly installed and



one existing monitoring well. Analytical results indicated that VOCs were present at concentrations above applicable regulatory criteria in both groundwater samples.

SUMMARY OF TANK REMOVAL ACTIONS

A number of underground and above ground tank (UST & AST) investigation, closure and remediation actions have occurred at the property over the course of its operational history. Information regarding some these of programs is very limited. These tank programs are chronologically summarized in the following sections:

Building 304 UST Closure, 1986—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

Three USTs located to the south of the Building 304 (in Parcel C) were reportedly closed in 1986. The closure of these USTs did not involve sampling and all of the tanks were closed-in-place.

Building 332 UST Closure, 1986—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

It has been reported that four USTs next to Building 332 in Parcel C were closed in 1986 (by filling them with sand/concrete) that were used to store either diesel fuel or motor oil. Tank testing and/or soil sampling was not conducted during the closure of the USTs. However, several subsurface soil and groundwater investigations have occurred in this area that identified the presence of petroleum products.

Building 308 UST Closure & Transformer Removal, 1986 & circa 1988—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

In 1986, two fuel oil USTs were closed-in-place by filling each one with sand or concrete at Building 308 in Parcel B. These USTs are located to the northeast of the building and have capacities of 16,000 and 12,000 gallons. It is unknown if soil sampling was conducted during the closure of these tanks. Additionally, sometime following 1988, six transformers were removed from a concrete pad located adjacent to the northwest corner of the building.

Building 336 UST Closure, 1986—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

Originally, Building 336 in Parcel C was used as a pump house for paint thinner that was located in two adjacent USTs. In 1986, the USTs were closed.

Building 332 UST Removal, November 1992—Closure of a 2,700-gallon Concrete Underground Storage Tank (UST) Located at GE's Nott Street Facility (Letter Report) (GE, December 1992)

A 2,700-gallon capacity concrete UST located adjacent to the north side of Building 332 in Parcel B was excavated and removed on November 6, 1992. There was no evidence this UST was used to store petroleum products; however, several of the compounds detected in the three soil samples taken as part of closure indicated that light- to medium-end petroleum products may have been present at this location. Compounds detected that exceeded either STARS or TAGM 4046 criteria were ethylbenzene (28 to 3,900 ppb), toluene (2 to 1,400 ppb), xylenes (92 to 18,000 ppb), 1,1-DCA (20 ppb), 1,1,1-TCA (11 to 790 ppb).

Building 320 UST Removal, November 1995—UST Removal, Building 320, November 1995 (Letter Report) (ABB, April 1996)

On November 25, 1995, a concrete UST of unknown capacity located adjacent to the south side of Building 320 in Parcel A was removed. After the tank was removed, stained soil was observed in the tank excavation and the NYSDEC was properly notified. Four soil samples were obtained from the sidewalls and bottom of the excavation. A south excavation sidewall sample could not be obtained since the UST was located adjacent to footing for Building 320. The results of the four samples analyzed indicated that residual amounts of certain compounds were present in one sample. The compounds that exceeded their associated STARS Memo No. 1 cleanup criteria in sample BLDG320G were benzene (0.95 ppb), n-butyl benzene (8.57 ppb), sec-butyl benzene (10.4 ppb), and n-propyl benzene (23.5 ppb).

ABB reported that approximately 10 cubic yards of affected soil was removed and disposed of, and that the excavation was discontinued at the base of the building footing due to stability concerns (i.e., to prevent building collapse). The excavation was subsequently backfilled with clean sand. These procedures were observed by NYSDEC representatives whom concurred with ABB's decision to discontinue and backfill the excavation.

In addition to the above referenced UST, it has also been reported that five USTs, of unknown capacity, were either removed and/or closed-in-place in the vicinity of the building.

Building 342 Fuel Oil AST Removal, March 2000—Historic Release from Building 342 Aboveground Storage Tank, Work Order #12360-001-003 (Letter Report) (Weston, May 10, 2000)

In March 2000, the 300,000 gallon AST located within a concrete berm approximately 100 feet east of Building 342 in Parcel B and which formerly stored No. 6 fuel oil that was used to fire the buildings boiler, was decommissioned. Weston visited the Park on



March 20, 2000 to inspect the former tank area. Weston observed the AST bedding sand immediately beneath the tank was not discolored. Weston also observed several small areas (six square feet in size) of discolored soil within the tank footprint approximately one foot beneath the AST that were exposed by excavation equipment that was re-grading the Park. Two soil samples in the areas that visually appeared most discolored were collected by Weston. Analytical results revealed the presence of weathered diesel fuel in each sample. One soil sample was subsequently analyzed for STARS list constituents; no STARS list constituents were detected. Subsequently, Weston contacted the NYSDEC, on March 21, 2000, and described their observations and discussed the analytical results. Weston concluded that: 1) the staining was attributable to a minor historical petroleum release(s) during filling operations; 2) the staining may be partially attributable to coal dust (coal may have been stored in the area historically); and 3) the staining does not represent a matter of environmental significance.

Additionally, two former AST locations were also identified to the east and west of the building. These former ASTs had capacities of 500 and 2,000 gallons each. No additional information with regard to contents, spills, leaks, or dates of closure is available.

SUMMARY OF REMEDIAL ACTIONS

A number of remedial activities have been implemented at the property since 1992, which are chronologically summarized below.

Free Product Petroleum Recovery From Monitoring Wells MW-01 & MW-04, 1992-1994—Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent, File No. R4-1338-92-05 (Dames & Moore, 1993)

Hand bailing was initiated during October 1992 in response to the presence of free product in monitoring wells MW-01 and MW-04 and continued until December 1992 and January 1993, respectively. Temporary free-product skimming systems were installed in monitoring wells MW-01 and MW-04 in December 1992 and January 1993, respectively. The recovery systems were operated for approximately two years, when the systems were permanently shut down as a result of negligible product recovery. During this time period, approximately 550 gallons and 385 gallons of an oil/water mixture was collected and properly disposed of from monitoring wells MW-01 and MW-04, respectively. The oil collected from monitoring well MW-01 was sampled again for PCBs on September 14, 1994, and results indicated 0.003 ppm PCBs.



Deployment of Oil Containment & Absorbent Booms in the Mohawk River, 1992-2002—Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent, File No. R4-1338-92-05 (Dames & Moore, 1993)

The prior owner first deployed oil containment and absorbent booms adjacent to the locations where sheens were reported, during November 1992 and continued to deploy these devices until 2001. Booms were deployed in the spring and retrieved in early winter before the Mohawk River iced over. This included the areas upstream and downstream of College Creek, where sheens associated with off-site sources had been observed in the past.

Building 328 Transformer Inspection, Removal & Follow-Up Investigation/Remediation, November 1992, January-February 1993 & May 1996—Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent, File No. R4-1338-92-05 (Dames & Moore, 1993)

On November 6, 1992, Dames & Moore inspected three electrical transformers located on a concrete pad north of Building 328 in Parcel A. The inspection identified an area of staining on the pad; the transformers and pad were subsequently sampled and the transformers removed. In summary, a wipe sample of the stained area indicated a PCB concentration of 106.7 micrograms/100 square centimeters. The regulatory agencies were notified and the stained area was triple-scrubbed with hexane. The transformers were subsequently sampled, and analytical results indicated PCB concentrations ranging from 90.9 ppm to 517.5 ppm (Aroclor 1260). The transformer oil was removed from the transformers and appropriately disposed of on January 11, 1993. The transformers were removed and appropriately disposed of on February 4, 1993.

According to records, on May 20 and 26, 1996 concrete pad wipes, soil, and wire samples were collected and analyzed for PCBs from the former transformer pad located north of Building 328. Results indicated that pad wipes were non-detect, one wire sample had a low level PCB concentration (0.24 ppm), and PCBs were detected in the soil around the concrete pad at a concentration up to 17 ppm. Soils in this area were reportedly excavated and transported off-site for appropriate disposal.

PCB Transformer Spill, February 1993—as cited in Site Investigation Work Plan, Nott Street Industrial Park, Schenectady, New York (BBL, July 2000)

On February 1, 1993, the NYSDEC spill hotline was notified of leakage from transformers located on a concrete pad (approximately 1 quart) at a Nott Street Substation located on Erie Boulevard that served the Park (NYSDEC Spill No. 92-12366). This portion of the property lies within Parcel C. Absorbents were applied and sampling was subsequently performed. Two oil sample results indicated PCB (Aroclor 1260) concentrations of 528 ppm and 569 ppm. Four wipe sample results indicated PCB (Aroclor 1260) concentrations ranging from 7.1 $\mu\text{g}/100\text{-cm}^2$ to 244 $\mu\text{g}/100\text{-cm}^2$;

and six soil sample results indicated PCB (Aroclor 1260) concentrations ranging from 4.3 ppm to 128.6 ppm. One of the transformers and the affected soil was subsequently removed and appropriately disposed between September and October 1993. Confirmatory sampling for PCBs was also performed at that time and indicated 4 soil samples with concentrations ranging from 0.13 to 3.88 ppm and one wipe sample at a concentration of 1.4 µg/100-cm².

Building 342 Passive Free Product Removal, August 1995—*Subsurface Investigation - Building 332 & 342 (ABB, 1995)*

One groundwater monitoring well (MW-16) was installed adjacent to the east foundation wall of Building 342 in Parcel B on the basis of observations of petroleum seeping through cracks on the inside of the east foundation wall. Oil sheens were periodically noted in monitoring well MW-16 shortly after it was installed. An absorbent bailer was installed during that time period and is currently maintained in MW-16. The bailer is inspected monthly and replaced, as required.

Monitoring Well MW-04 Pilot Bioventing System, December 1996—Schenectady Industrial Corp., Nott Street Industrial Park, Draft Follow-up Subsurface Investigation Report, Bioventing System Subsurface Soil Assessment (Letter Report) (VHB, September 2001)

To further address the presence of subsurface petroleum near monitoring well MW-04, the prior owner installed a pilot bioventing system during December 1996. Additionally, an absorbent bailer has been installed in monitoring well MW-04, which is inspected biweekly and replaced as necessary. The bioventing system consists of a self-contained blower assembly connected to wells RW-03 and BVM-2, which is utilized to aerate subsurface soils immediately above the water table. The system has operated continuously since December 1996 to May 2001, with the exception of brief outages for routine maintenance.

To assess the effectiveness of the bioventing system, HLA performed a Geoprobe subsurface investigation on December 8, 1998. The results of this investigation were reported in an April 14, 1999 letter from HLA to the NYSDEC. The investigation involved the advancement of 11 Geoprobe borings radially located around both bioventing injection points. A minimum of two soil samples from each boring at the 10- to 12-foot and 12- to 14-foot depth intervals (the saturated/unsaturated interface) were collected and analyzed for TPH. TPH was detected in the 10- to 12-foot interval at concentrations as high as 1,100 ppm and in the 12- to 14-foot interval at concentrations as high as 24,000 ppm. Based on the results, it was concluded that the bioventing system was successfully treating the subsurface oil-stained soils, although with diminishing effectiveness farther away from the injection points.

HLA recommended that the bioventing system continue to operate, and that a follow-up Geoprobe assessment be performed during 2000 to monitor the effectiveness of the

system. It was also recommended Oxygen Release Compound (ORC[®]) “socks” be deployed in several wells in the vicinity of monitoring well MW-04 to assess the effectiveness of this proprietary product in enhancing the natural bioremediation of petroleum contaminated groundwater this portion of the property.

Late in 2001, VHB, in a letter to Alan Geisendorfer of Region IV NYSDEC, argued that the Bioventing and ORC efforts cease as the remaining materials were residual petroleum hydrocarbons recalcitrant to further treatment in the foregoing fashion. NYSDEC subsequently approved the cessation of treatment.

Monitoring Well MW-01 PCB Source Removal, February 1998—MW-01 PCB Remediation Program Report, DEC Order on Consent R4-1338-92-05 (HLA, July 1998)

Based on the discovery of PCB in excess of 55 ppm in free product in monitoring well MW-01 and after recoverable free product accumulations were removed, SIC authorized HLA to remediate the soils in the vicinity of this area. The excavation proceeded in two steps. The first step was to remove the clean overburden soil to a depth of approximately 10 feet and stockpile the soils to be used as backfill. The interface between clean and affected soil was assessed visually; petroleum-impacted soil in this area has been historically encountered at a depth of approximately 10 feet and consists of visual staining and a petroleum odor. Secondly, visually affected soil was excavated in lifts and placed in segregated stockpiles. Three stockpiles were created based on excavation intervals of 10 to 12 feet, 12 to 13 feet, and 13 to 15 feet. Based on field screening for PCBs, the excavation was terminated at the excavation depth interval of 15 feet (approximately 4 feet beneath the water table).

Samples from each stockpile were initially field screened using CHLOR-N-SOIL PCB field screening kits in which the sensitivity provides a “presence/absence” indication of PCB concentrations less than 50 ppm. Field screening results were less than 50 ppm for each stockpile. D-TECH field screening kits, with a sensitivity of approximately 5 to 20 ppm, were then used to screen the stockpiles further. The field screening results indicated that each stockpile was less than 5 ppm PCBs. Following field screening activities, five verification samples were collected (one from the bottom and one each from the north, south, east, and west excavation sidewalls). Each soil sample was subject to PCB and TPH analyses. One sample (west wall) was also subjected to PETID analysis via NYSDEC Method 310-14. The analytical results indicated that PCBs were not detected in four of the five samples; however, PCBs were detected in one sample (north wall) at a concentration of 4.06 ppm. TPH concentrations ranged from 1,200 ppm (east wall) to 43,000 ppm (west wall) (with a bottom TPH result of 2,800 ppm). The PETID analysis indicated that the petroleum staining was the result of weathered No. 2 fuel oil. Analytical results are provided in Appendix A.

Before the excavation was backfilled, a passive recovery system was installed in the vicinity of former monitoring well MW-01. Following installation of the passive recovery



system, backfill was then placed to the surface. To date, additional oil has not been observed in this passive recovery system. HLA also performed follow-up sampling of sediment in sewers up and downstream of the excavation area at DEC's request; PCBs were not detected above industrial background concentrations.

EVI Parcel PCB Remediation/Excavation, February 1998—Investigation Work Plan PCB Soil Remediation (HLA, 1998)

During the aforementioned EVI Parcel (which lies across all three parcels [A, B, & C]) investigation, PCBs at concentrations in excess of NYSDEC cleanup objectives were detected at a depth of approximately four feet in one boring location (B-5). On February 5, 1998, a remedial excavation was conducted in the area of this boring. Approximately 4 cubic yards was excavated immediately after completing the monitoring well MW-01 PCB remediation program discussed above. After the excavation was completed, one confirmatory soil sample was obtained from the bottom of the excavation and submitted for PCB analysis. The analytical results were non-detect for PCBs. HLA subsequently concluded in a letter report to the NYSDEC dated July 9, 1998 that PCB remediation for the EVI parcel was complete and that no further action with respect to PCBs was recommended for the 5.5-acre parcel. The soils excavated during the remediation program were properly characterized and disposed.

Passive Free Product Recovery System Building 306, December 1998—Subsurface Investigation Report Building 306 (HLA, April 1999)

Based on the discovery of small quantities of free product petroleum in an excavation adjacent to the north side of Building 306 in Parcel C during November 1998, SIC installed a passive free product recovery system. The system is inspected monthly and booms replaced, as required. No free product has been observed since the system was installed.

Passive Free Product Recovery System Building 332, December 1998—Subsurface Investigation Report Former Tank Farm - Building 332 (HLA, April 1999)

Based on the discovery of free product petroleum adjacent to the former Building 332 USTs (MW-12D) in Parcel B during November 1998 SIC installed a passive free-product recovery system. The system was installed between January 13 and 14, 1999. The recovery system was installed between the piezometers where free product was observed. Daily monitoring of the system began on January 14, 1999, and was reduced to weekly monitoring after two weeks, due to lack of significant free product accumulation or recovery. Currently, the system is monitored monthly, and the absorbent media are replaced, as required.

ENA Pilot Study EVI Parcel, March-December 2000—Final Report, Enhanced Natural Attenuation Pilot Study, Nott Street Industrial Park (VHB, April 2000)

A remedial alternative evaluation for the EVI Parcel is documented in the HLA report entitled *Remedial Alternatives Evaluation Report* (HLA, 1998). The report concluded that based on strictly technical considerations, in-situ chemical oxidation was the only established technology then available that could effectively reduce the petroleum concentrations in the subsurface at this area. However, the established cost of this technology was prohibitive given the limited exposure potential and the value per acre. An alternative recommendation was made by HLA to implement an enhanced natural attenuation (ENA) pilot-testing program to assess this remediation technology.

A Phase I ENA Pilot Study was conducted by Weston during March 2000. Phase I activities included: 1) sampling of existing groundwater monitoring wells in the vicinity of the pilot study area; 2) testing groundwater for geochemical parameters to determine whether subsurface conditions were favorable for natural attenuation; 3) collecting subsurface soil samples beneath the water table within the ENA pilot study area, adjacent to the wells indicated above, to establish baseline conditions; and 4) preparing a report summarizing the Phase I program. Results of the Phase I study indicated that subsurface conditions were favorable for ENA. The Phase I results are presented in a Weston report entitled *Enhanced Natural Attenuation Pilot Study Phase I Investigation Results* (Weston, May 2000).

Based on the results of the Phase I ENA Pilot Study, Weston concluded that biodegradation was occurring at a moderate to high rate in the vicinity of monitoring wells EVIMW-6 and EVIMW-7. In addition, it was concluded that biodegradation was occurring at monitoring wells EVIMW-3 and EVIMW-8 at a slow to moderate rate and that biodegradation was not occurring at EVIMW-1 and EVIMW-2. The limiting factor was concluded to be the availability of oxygen in the subsurface. Therefore, Weston recommended that a Phase II Study be conducted to determine if the injection of slow-release oxygen compounds into the subsurface will likely increase the biodegradation rates and accelerate Park remediation.

Phase 2 activities began on May 23 and 24, 2000, when three 20-foot deep groundwater monitoring wells (ENAP-01, -02 and -03) were installed in a line approximately 15 feet from each other within the EVI parcel. Groundwater was encountered at a depth of approximately 13 feet. The wells were installed to assess groundwater conditions during the six-month Oxygen Release Compound (ORC) assessment period. Groundwater sampling was performed on the morning of June 8, 2000, to establish baseline groundwater conditions prior to ORC injection. On June 8 and 9, 2000, approximately 60 pounds each of ORC was direct injected at two upgradient locations from each well (total of six injection points) using a Geoprobe. The



ORC powder was mixed with water to create a slurry and injected at a depth of approximately 13-15 feet.

Subsequent to the ORC injection, monthly groundwater sampling was performed from July through December 2000, to measure PAH, dissolved oxygen, carbon dioxide and iron concentrations, pH, and temperature. After two months of groundwater monitoring, it became clear that the groundwater PAH concentrations were essentially “non-detect”. The analytical suite was then altered; PAH analyses were omitted and total petroleum hydrocarbons (TPH) analysis was instead performed. TPH concentrations were also very low during the testing period. VHB noted that the goal of the pilot study was to assess effects on soil remediation and not to demonstrate that the ORC could significantly reduce groundwater petroleum hydrocarbon concentrations. Rather, the primary reasons for monitoring groundwater were, first to measure the ENA activity indicators (oxygen and carbon dioxide) and, second, to assess if any beneficial effects on groundwater petroleum hydrocarbon concentrations were observed.

At the end of the six month period, Geoprobe explorations were advanced within the oxygenated area to assess the effectiveness of ORC at reducing TPH concentrations within the test area. Results of this sampling indicate that, while the number of samples in which PAHs were detected generally decreased from the baseline sampling, the concentrations in those samples where PAHs were detected generally increased. The highest concentrations were detected in ENAGP-05 and ENAGP-06.

Based on the results of the pilot study, VHB concluded that ORC assisted ENA is not a viable remediation technology for the Park. Although the Phase 1 test results showed that subsurface conditions were favorable for ENA, the ORC failed to demonstrate ability to enhance/accelerate the reduction of subsurface petroleum hydrocarbon concentrations, either in soil or groundwater. VHB theorized that that the ORC was ineffective because the subsurface petroleum may be too weathered, rendering the material highly resistant to further biological degradation. Further, VHB recommended that no additional effort be invested in testing this technology based on the results of the pilot study.

Soil Excavation and Well Install Activities—Soil Excavation and Monitoring Well Installation Activities Report, Nott Street Industrial Park, Schenectady, New York (VHB, December 17, 2003)

On September 4, 2003, nine cubic yards of PCB-impacted soil were removed from the north side of the office attached to Building 346 in Parcel A. Following review of results of soil sampling within the excavation, on September 9, 2003, another 0.21 cubic yards of impacted soil was removed from the southern side of the initial excavation. Post excavation soil samples indicated that PCB concentrations were below regulatory criteria.



On September 9, 2003, ten cubic yards of low-level mercury-impacted soil was excavated at the northwest corner of Building 342 in Parcel B. Following review of results of soil sampling within the excavation, on September 17, 2003, another 1.1 cubic yards of impacted soil was removed from the northern side of the initial excavation. Post excavation soil samples indicated that mercury concentrations were below regulatory criteria.

On September 2 and 3, 2003, five monitoring wells were installed near MW-36. Soils encountered during drilling included two to four feet of fill material underlain by interbedded medium to very coarse sands and silty to fine sandy clay. During development activities, the presence of a petroleum-like odor and oil sheen on the drummed purge water was observed.

Area 4 LNAPL Recovery Active Treatment System for MW-36 Series—Area 3 and 4 Report for Stipulation #R4-391, Corrective Action Plan Items, Kleinfelder, 2007

In response to an NYSDEC directive (May 2005), SIC had Kleinfelder design and install an active LNAPL recovery system. The Ferret Pump system, which removes floating LNAPL from MW-36, MW-36B, and MW-36C, went on line on January 12, 2006. This system was chosen as the results of the drawdown test in 2005 indicated a pump and treat type system would produce large quantities of water with a localized to no capture zone. The system continues to operate.

Surface Soil Samples**Table 1a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)**

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-1	SS-2	SS-3	SS-4	SS-5	SS-5DUP	SS-6
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00
Acetone	0.2	0.057 U	0.051 UJ	0.056 UJ	0.053 UJ	0.055 U	0.056 U	0.057 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on page 4.

Surface Soil Samples**Table 1a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)**

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-7	SS-8	SS-9	SS-10	SS-11	SS-12	SS-13
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/28/00	11/28/00	11/28/00
Acetone	0.2	.059 UJ	0.055 UJ	R	0.058 U	0.05 U	0.052 U	0.060 UJ

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on page 4.

Surface Soil Samples**Table 1a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)**

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-14	SS-15	SS-16	SS-16DUP	SS-17	SS-18	SS-19
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00
Acetone	0.2	0.054 UJ	0.052 UJ	0.054 U	0.055 UJ	0.055 UJ	0.050 UJ	0.052 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on page 4.

Surface Soil Samples

Table 1a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date	
Source:		1	1
Sample ID:		SS-20	SS-21
Depth (ft):	NYSDEC	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00
Acetone	0.2	0.048 UJ	0.051 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process. The data should not be used for any qualitative or quantitative purposes.

Surface Soil Samples

Table 1b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-1	SS-2	SS-3	SS-4	SS-5	SS-5DUP	SS-6
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00
2-Methylnaphthalene	36.4	0.47 UJ	0.36 U	0.39 UJ	0.042 J	4.0 U	0.38 U	0.38 U
3,3'-Dichlorobenzidine	ns	0.38 UJ	0.36 U	0.39 UJ	0.37 U	4.0 U	0.38 U	0.38 U
4-Methylphenol	0.9	0.38 U	0.36 U	0.39 U	0.37 U	4.0 U	0.38 U	0.38 U
Acenaphthene	50.0	2.2 J	0.68	1 J	0.13 J	0.97 J	0.16 J	0.34 J
Acenaphthylene	41.0	0.28 J	0.091 J	0.096 J	0.37 U	0.81 J	0.81	0.37 J
Anthracene	50.0	4.2 J	1.1	1.5 J	0.16 J	1.8 J	0.78	0.96
Benzo(a)anthracene	0.224 or MDL	14 DJ	7.0 D	7.9 DJ	1	8.3	5.9	4
Benzo(a)pyrene	0.061 or MDL	11 DJ	4.8	4.8 J	1.2	9.9	8.9 D	3.2
Benzo(b)fluoranthene	1.1	18 DJ	12 D	5.1 J	2.4	24	20 D	4.1
Benzo(g,h,i)perylene	50.0	4.8 J	2.7	3 J	0.95	8.2	5	1.3
Benzo(k)fluoranthene	1.1	4.4 J	2.4	1.9 J	0.89	0.89	3.8 U	1.6
Bis(2-ethylhexyl) phthalate	50.0	0.38 UJ	0.36 U	0.39 UJ	0.37 U	0.37 U	0.38 U	0.38 U
Butylbenzylphthalate	50.0	0.38 UJ	0.36 U	0.39 UJ	0.37 U	0.37 U	0.18 J	0.38 U
Carbazole	ns	1.8 J	0.59	0.39 UJ	0.072 J	0.072 J	0.33 J	0.43
Chrysene	0.4	12 DJ	5.4	5.3 J	1	1	8.7 D	2.8
Di-n-butyl phthalate	8.1	0.38 UJ	0.36 U	0.82 J	0.37 U	0.37 U	0.044 J	0.38 U
Di-n-octyl phthalate	50.0	0.38 UJ	0.36 U	0.35 J	0.37 U	0.37 U	0.04 J	0.38 U
Dibenzo(a,h)anthracene	0.014 or MDL	2.1 J	0.85	0.073 J	0.37 U	0.37 U	1.4	0.73
Dibenzofuran	6.2	0.85 J	0.28 J	0.39 UJ	0.04 J	0.040 J	0.13 J	0.23 J
Diethyl phthalate	7.1	0.38 UJ	0.055 J	0.39 UJ	0.37 U	0.37 U	0.38 U	0.38 U
Dimethyl phthalate	2.0	0.38 UJ	0.36 U	0.39 UJ	0.37 U	0.37 U	0.38 U	0.38 U
Fluoranthene	50.0	31 DJ	14 D	14 DJ	1.1	1.1	13 D	9.9 D
Fluorene	50.0	1.3 J	0.4	0.48 J	0.042 J	0.042 J	0.1 J	0.28 J
Indeno(1,2,3-cd)pyrene	3.2	5.1 J	2.8	2.6 J	0.37 U	0.37 U	5	1.6
N-nitrosodiphenylamine	ns	0.38 UJ	0.36 U	0.39 UJ	0.37 U	0.37 U	0.38 U	0.38 U
Naphthalene	13.0	0.71 U	0.36 U	0.39 U	0.062 J	0.062 J	0.38 U	0.41 U
Phenanthrene	50.0	20 DJ	7.9 D	7.9 DJ	0.79	0.79	2.2	4.5
Pyrene	50.0	31 DJ	13 D	15 DJ	2.2	2.2	16 D	9.3 D

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Surface Soil Samples

Table 1b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-7	SS-8	SS-9	SS-10	SS-11	SS-12	SS-13
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/28/00	11/28/00	11/28/00
2-Methylnaphthalene	36.4	0.55 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	1.5 J
3,3'-Dichlorobenzidine	ns	0.42 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
4-Methylphenol	0.9	0.069 J	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Acenaphthene	50.0	1.4	0.14 J	0.39 U	0.39 U	3.6 U	3.6 U	0.43 J
Acenaphthylene	41.0	0.41 J	0.2 J	0.39 U	0.39 U	3.6 U	3.6 U	3.1 J
Anthracene	50.0	3.3 U	0.37 J	0.39 U	0.39 U	1 J	3.6 U	3.2 J
Benzo(a)anthracene	0.224 or MDL	11 D	1.6	0.08 J	0.091 J	1.1 J	3.6 U	15
Benzo(a)pyrene	0.061 or MDL	9.4 D	1.7	0.13 J	0.11 J	0.96 J	3.6 U	16
Benzo(b)fluoranthene	1.1	15 D	2.5	0.23 J	0.17 J	1.9 J	3.6 U	40
Benzo(g,h,i)perylene	50.0	4.1	1.2	0.096 J	0.068 J	3.6 U	3.6 U	13
Benzo(k)fluoranthene	1.1	3.6	0.73	0.074 J	0.1 J	2 J	3.6 U	16
Bis(2-ethylhexyl) phthalate	50.0	0.42 U	0.15 J	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Butylbenzylphthalate	50.0	0.093 J	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Carbazole	ns	2 U	0.22 J	0.39 U	0.39 U	3.6 U	3.6 U	0.63 J
Chrysene	0.4	9.3 D	1.3	0.097 J	0.085 J	0.86 J	3.6 U	18
Di-n-butyl phthalate	8.1	0.42 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Di-n-octyl phthalate	50.0	0.42 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Dibenzo(a,h)anthracene	0.014 or MDL	1.4	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	5.4
Dibenzofuran	6.2	0.96	0.075 J	0.39 U	0.39 U	3.6 U	3.6 U	0.67 J
Diethyl phthalate	7.1	0.42 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Dimethyl phthalate	2.0	0.42 U	0.19 J	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Fluoranthene	50.0	27 D	2.9	0.16 J	0.13 J	1.9 J	3.6 U	30
Fluorene	50.0	1.1	0.099 J	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Indeno(1,2,3-cd)pyrene	3.2	4.3	1.1	0.39 U	0.39 U	0.7 J	3.6 U	59
N-nitrosodiphenylamine	ns	0.42 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	3.9 U
Naphthalene	13.0	1.5 U	0.38 U	0.39 U	0.39 U	3.6 U	3.6 U	1.2 J
Phenanthrene	50.0	20 D	1.7	0.069 J	0.057 J	1 J	3.6 U	5.9
Pyrene	50.0	29 D	3.4	0.19 J	0.15 J	2.1 J	3.6 U	40

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Surface Soil Samples

Table 1b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-14	SS-15	SS-16	SS-16DUP	SS-17	SS-18	SS-19
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00
2-Methylnaphthalene	36.4	3.7 U	3.7 U	5.7	4.1	0.38 U	3.5 U	3.6 U
3,3'-Dichlorobenzidine	ns	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
4-Methylphenol	0.9	3.7 U	3.7 U	3.8 U	3.9	0.38 U	3.5 U	3.6 U
Acenaphthene	50.0	0.47 J	3.7 U	7.3	5.4	0.38 U	3.5 U	3.6 U
Acenaphthylene	41.0	3.7 U	3.7 U	0.45 J	3.9	0.38 U	3.5 U	3.6 U
Anthracene	50.0	0.82 J	1.4 J	14	9.5	0.38 U	3.5 U	3.6 U
Benzo(a)anthracene	0.224 or MDL	2.1 J	1.6 J	49	35	0.38 U	0.78 J	1.1 J
Benzo(a)pyrene	0.061 or MDL	2.1 J	1.7 J	33	28	0.38 U	0.85 J	1.3 J
Benzo(b)fluoranthene	1.1	3.1 J	2.7 J	54	44	0.38 U	1.8 J	1.7 J
Benzo(g,h,i)perylene	50.0	1.2 J	0.98 J	16	13	0.38 U	0.65 J	3.6 U
Benzo(k)fluoranthene	1.1	1.9 J	1 J	23	17	0.38 U	0.73 J	0.88 J
Bis(2-ethylhexyl) phthalate	50.0	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Butylbenzylphthalate	50.0	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Carbazole	ns	0.49 J	3.7 U	9.7	6.3	0.38 U	3.5 U	3.6 U
Chrysene	0.4	1.9 J	1.2 J	38	28	0.38 U	0.68 J	1.1 J
Di-n-butyl phthalate	8.1	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Di-n-octyl phthalate	50.0	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Dibenzo(a,h)anthracene	0.014 or MDL	3.7 U	3.7 U	8.2	7	0.38 U	3.5 U	3.6 U
Dibenzofuran	6.2	3.7 U	3.7 U	4.5	3 J	0.38 U	3.5 U	3.6 U
Diethyl phthalate	7.1	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Dimethyl phthalate	2.0	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Fluoranthene	50.0	5.3	3.9	77 D	62 D	0.38 U	1.6 J	2.2 J
Fluorene	50.0	0.43 J	3.7 U	5.4	3.6 J	0.38 U	3.5 U	3.6 U
Indeno(1,2,3-cd)pyrene	3.2	3.7 U	3.7 U	95 J	73 J	0.38 U	3.3 J	4.5
N-nitrosodiphenylamine	ns	3.7 U	3.7 U	3.8 U	3.9 U	0.38 U	3.5 U	3.6 U
Naphthalene	13.0	0.39 J	3.7 U	6.8	4.1	0.38 U	3.5 U	3.6 U
Phenanthrene	50.0	3.8	1.4 J	57 D	55	0.38 U	0.89 J	1.3 J
Pyrene	50.0	5.7	3.2 J	77 D	56 D	0.38 U	1.4 J	2.7 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Surface Soil Samples

Table 1b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte		Sample Collection Designation & Collection Date	
Source:		1	1
Sample ID:		SS-20	SS-21
Depth (ft):	NYSDEC	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00
2-Methylnaphthalene	36.4	3.5 U	3.4 U
3,3'-Dichlorobenzidine	ns	3.5 U	3.4 U
4-Methylphenol	0.9	3.5 U	3.4 U
Acenaphthene	50.0	3.5 U	3.4 U
Acenaphthylene	41.0	3.5 U	3.4 U
Anthracene	50.0	3.5 U	3.4 U
Benzo(a)anthracene	0.224 or MDL	3.5 U	3.4 U
Benzo(a)pyrene	0.061 or MDL	3.5 U	0.36 J
Benzo(b)fluoranthene	1.1	3.5 U	0.51 J
Benzo(g,h,i)perylene	50.0	3.5 U	3.4 U
Benzo(k)fluoranthene	1.1	3.5 U	3.4 U
Bis(2-ethylhexyl) phthalate	50.0	3.5 U	3.4 U
Butylbenzylphthalate	50.0	3.5 U	3.4 U
Carbazole	ns	3.5 U	3.4 U
Chrysene	0.4	3.5 U	3.4 U
Di-n-butyl phthalate	8.1	3.5 U	3.4 U
Di-n-octyl phthalate	50.0	3.5 U	3.4 U
Dibenzo(a,h)anthracene	0.014 or MDL	3.5 U	3.4 U
Dibenzofuran	6.2	3.5 U	3.4 U
Diethyl phthalate	7.1	3.5 U	3.4 U
Dimethyl phthalate	2.0	3.5 U	3.4 U
Fluoranthene	50.0	3.5 U	0.43 J
Fluorene	50.0	3.5 U	3.4 U
Indeno(1,2,3-cd)pyrene	3.2	3.5 U	3.4 U
N-nitrosodiphenylamine	ns	3.5 U	3.4 U
Naphthalene	13.0	3.5 U	3.4 U
Phenanthrene	50.0	3.5 U	3.4 U
Pyrene	50.0	3.5 U	0.53 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

D = Identifies all compounds analyzed at a secondary dilution.

ns = No standard. Recommended soil cleanup objective is not available.

Surface Soil Samples

Table 1c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	1	1	1
Sample ID:		SICSURS-1	SICSURS-2	SICSURS-3	SICSURS-4	SS-1	SS-2	SS-3
Depth (ft):	NYSDEC	0-0.5	0-0.5	0-0.5	0-0.5	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	3/30/94	3/30/94	3/30/94	3/30/94	11/27/00	11/27/00	11/27/00
Aroclor-1248	ns	NA	NA	NA	NA	0.057 U	0.054 U	0.057 U
Aroclor-1254	ns	0.13	1.6	0.16	0.35	0.057 U	0.054 U	0.057 U
Aroclor-1260	ns	NA	NA	NA	NA	0.057 U	0.054 U	0.057 U
Total PCBs	1.0	NA	NA	NA	NA	0.057 U	0.054 U	0.057 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 5.

Surface Soil Samples

Table 1c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-4	SS-5	SS-5DUP	SS-6	SS-6	SS-6A	SS-6B
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0.5-1	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	6/5/01	6/5/01	6/5/01
Aroclor-1248	ns	0.052 U	0.060 U	0.054 U	0.56 U	0.045 U	0.041 U	0.042 U
Aroclor-1254	ns	0.052 U	0.060 U	0.054 U	6.2	0.12	0.4	0.85
Aroclor-1260	ns	0.052 U	0.060 U	0.054 U	0.56 U	0.082	0.076	0.18
Total PCBs	1.0	0.052 U	0.060 U	0.054 U	6.2	0.202	0.476	1.03

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 5.

Surface Soil Samples

Table 1c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-6C	SS-6D	SS-7	SS-8	SS-9	SS-10	SS-11
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	6/5/01	6/5/01	11/27/00	11/27/00	11/27/00	11/27/00	11/28/00
Aroclor-1248	ns	0.42 U	0.4 U	0.064 U	0.056 U	0.054 U	0.43	0.055 U
Aroclor-1254	ns	3.7	4.8	0.064 U	0.056 U	0.054 U	0.059 U	0.055 U
Aroclor-1260	ns	0.46	0.71	0.064 U	0.056 U	0.054 U	0.059 U	0.11
Total PCBs	1.0	4.16	5.51	0.064 U	0.056 U	0.054 U	0.43	0.11

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 5.

Surface Soil Samples

Table 1c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-12	SS-13	SS-14	SS-15	SS-16	SS-16DUP	SS-17
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00
Aroclor-1248	ns	0.8	0.059 U	0.055 U	0.10 U	0.11 U	0.12 U	0.052 UJ
Aroclor-1254	ns	0.054 U	0.059 U	0.055 U	0.10 U	0.11 U	0.12 U	0.052 UJ
Aroclor-1260	ns	0.054 U	0.059 U	0.055 U	0.10 U	0.11 U	0.12 U	0.052 UJ
Total PCBs	1.0	0.80	0.059 U	0.055 U	0.10 U	0.11 U	0.12 U	0.052 UJ

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 5.

Surface Soil Samples

Table 1c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date			
Source:		1	1	1	1
Sample ID:		SS-18	SS-19	SS-20	SS-21
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00
Aroclor-1248	ns	0.053 U	0.054 U	0.11 U	0.049 U
Aroclor-1254	ns	0.053 U	0.054 U	0.39	0.12
Aroclor-1260	ns	0.053 U	0.054 U	0.11 U	0.099
Total PCBs	1.0	0.053 U	0.054 U	0.39	0.22

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

ns = No standard. Recommended soil cleanup objective is not available.

NA = Sample was not analyzed for this constituent.

Surface Soil Samples
Table 1d - Summary of Total Petroleum Hydrocarbon (TPH) Results

Analyte		Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	2	
Sample ID:		SICSURS-01	SICSURS-1A	SICSURS-2	SICSURS-3	SICSURS-4	SICSURS-5	SICSURS-6	
Depth (ft):	NYSDEC	0-0.5	0-0.5	0-0.5	0-0.5	0-0.5	0-0.5	0-0.5	
Sample Date:	TAGM 4046	3/30/94	4/14/94	3/30/94	3/30/94	3/30/94	4/1/94	4/1/94	
Total Petroleum Hydrocarbons		ns	214	124	223	330	130	100	43.6 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

See notes on page 2.

Surface Soil Samples

Table 1d - Summary of Total Petroleum Hydrocarbon (TPH) Results

Analyte		Sample Collection Designation & Collection Date			
Source:		2	2	2	
Sample ID:		SICSURS-07	SICSURS-8	SICSURS-9	
Depth (ft):	NYSDEC	0-0.5	0-0.5	0-0.5	
Sample Date:	TAGM 4046	4/1/94	4/1/94	4/1/94	
Total Petroleum Hydrocarbons		ns	46.9 U	58.8 U	45.8 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

ns = No standard. Recommended soil cleanup objective is not available.

Surface Soil Samples

Table 1e - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-1	SS-2	SS-3	SS-4	SS-5	SS-6	SS-7
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00
Diesel Fuel	ns	11 U	10 U	12 U	11 U	12 U	12 U	12 U
Fuel Oil (#4)	ns	11 U	10 U	110 JN	11 U	12 U	12 U	12 U
Fuel Oil (#6)	ns	180	140	12 U	11 U	85	84	170
Kerosene	ns	11 U	11 U	12 U	11 U	12 U	12 U	13 U
Lubricating Oil	ns	11 U	11 U	12 U	180	160	12 U	13 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1e - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-8	SS-9	SS-10	SS-11	SS-12	SS-13	SS-14
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/28/00	11/28/00	11/28/00	11/28/00
Diesel Fuel	ns	11 U	12 U	12 U	11 U	11 U	12 U	11 U
Fuel Oil (#4)	ns	11 U	12 U	12 U	11 U	11 U	12 U	11 U
Fuel Oil (#6)	ns	33	12 U	12 U	11 U	11 U	370	21
Kerosene	ns	11 U	12 U	12 U	11 U	11 U	12 U	11 U
Lubricating Oil	ns	11 U	12 U	12 U	350	1,300	12 U	11 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1e - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-15	SS-16	SS-16DUP	SS-17	SS-18	SS-19	SS-20
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00
Diesel Fuel	ns	10 U	11 U	12 U	11 U	11 U	11 U	110 U
Fuel Oil (#4)	ns	10 U	11 U	12 U	11 U	11 U	11 U	110 U
Fuel Oil (#6)	ns	10 U	220	220	11 U	11 U	27	110 U
Kerosene	ns	11 U	12 U	12 U	12 U	11 U	11 U	110 U
Lubricating Oil	ns	490	12 U	12 U	12 U	11 U	11 U	2,000

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1e - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte			Sample Collection Designation & Collection Date		
Source:			1		
Sample ID:			SS-21		
Depth (ft):	NYSDEC		0-0.17		
Sample Date:	TAGM 4046		11/28/00		
Diesel Fuel	ns		95	U	
Fuel Oil (#4)	ns		95	U	
Fuel Oil (#6)	ns		95	U	
Kerosene	ns		99	U	
Lubricating Oil	ns		2,300		

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

JN = The compound or analyte was tentatively identified and the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process.

ns = No standard. Recommended soil cleanup objective is not available.

Surface Soil Samples

Table 1f - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-1	SS-2	SS-3	SS-4	SS-5	SS-5DUP	SS-6
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00	11/27/00
Aluminum	SB	6,040	8,880	10,200	6,500	7,290	9,520	7,700
Antimony	SB	3.17 UJ	3.06 UJ	3.06 UJ	3.58 J	3.34 UJ	2.88 UJ	3.5 UJ
Arsenic	7.5 or SB	19.8	14.2	8.59	5.29 U	19.6	30.8	26.3
Barium	300 or SB	172 J	77.7 J	82.9 J	263 J	92.6 J	110 J	105 J
Beryllium	0.16 or SB	0.416	0.663	0.84	0.36 U	.405 U	0.353	0.696
Cadmium	1 or SB	1.25	0.727	0.93	1.36	.806	1.07	0.754
Calcium	SB	46,200	85,700	71,500	41,300	34,800	32,600	21,500
Chromium	10 or SB	41.2	26.2	15.3	18.2	50.6	61.6	32
Cobalt	30 or SB	8.95	6.44	3.33	5.29	7.49	10.1	12.5
Copper	25 or SB	159 J	49.7 J	35.7 J	57.6 J	51.2 J	80 J	101 J
Iron	2,000 or SB	42,100	25,100	8,550	14,400	37,100	57,000	44,700
Lead	SB	279	63.7	58.2	86.7	153	185	100
Magnesium	SB	18,300	37,800	20,200	11,900	17,100	15,400	9,360
Manganese	SB	380 J	319 J	392 J	252 J	280 J	417 J	314 J
Mercury	0.1	0.575	0.288	5.18	0.102	.564	0.584	1.19
Nickel	13 or SB	43.9	20.9	24.4	13.1	21.8	37.6	47.1
Potassium	SB	1,520 J	4,860 J	1,710 J	1,420 J	1,570 J	1,900 J	1,730 J
Silver	SB	0.688	0.514 U	0.513 U	0.498 U	.560 U	0.613	0.587 U
Sodium	SB	119 J	112 J	409 J	100 J	109 J	134 J	302 J
Vanadium	150 or SB	22.9	21.5	63	19.4	27.4	32.4	29.4
Zinc	20 or SB	161 J	41.5 J	206 J	1,450 J	120 J	124 J	89.9 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1f - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-7	SS-8	SS-9	SS-10	SS-11	SS-12	SS-13
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/27/00	11/27/00	11/27/00	11/27/00	11/28/00	11/28/00	11/28/00
Aluminum	SB	10,600	11,600	11,700	10,800	7,870	9,520	13,400
Antimony	SB	3.24 UJ	3.26 UJ	3.42 UJ	3.24 UJ	3.19 U	3.08 U	3.33 U
Arsenic	7.5 or SB	13.3	5.82 U	6.11 U	5.79 U	11.1	5.5 U	12.6
Barium	300 or SB	143 J	117 J	52.5 J	45.6 J	117	49.9	64.7
Beryllium	0.16 or SB	0.609	0.743	0.416 U	0.394 U	0.387 U	0.374 U	0.425
Cadmium	1 or SB	1.09	0.721	0.514 U	0.486 U	3.89	0.462 U	0.512
Calcium	SB	39,800	75,000	3,310	3,080	110,000 J	102,000 J	17,300 J
Chromium	10 or SB	43.5	24.5	13	13.1	51.9 J	10.7 J	35.4 J
Cobalt	30 or SB	8.19	4.86	4.26	4.08	8.29	3.68	4.08
Copper	25 or SB	74.9 J	58 J	11 J	11 J	113 J	7.6 J	34.8 J
Iron	2,000 or SB	27,100	18,800	13,100	12,400	56,000	9,750	25,200
Lead	SB	148	66.6	11.3	10.9	85.6	13.2	104
Magnesium	SB	16,000	25,300	2,930	2,570	37,600 J	13,700 J	9,110 J
Manganese	SB	429 J	326 J	197 J	178 J	558 J	164 J	212 J
Mercury	0.1	0.832	0.256	0.117	0.0647	0.146	0.0328	0.18
Nickel	13 or SB	80.9	24.5	9.84	8.98	57.9	9.54	26.5
Potassium	SB	2,580 J	2,350 J	2,410 J	2,150 J	3,980 J	3,300 J	1,420 J
Silver	SB	0.544 U	0.547 U	0.575 U	0.544 U	0.779	0.517 U	0.559 U
Sodium	SB	205 J	323 J	122 J	111 J	149 J	153 J	191 J
Vanadium	150 or SB	120	30.7	25.5	23.5	32.1 J	32.2 J	34.2 J
Zinc	20 or SB	262 J	161 J	35.5 J	34.5 J	191 J	29.2 J	110 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1f - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		SS-14	SS-15	SS-16	SS-16DUP	SS-17	SS-18	SS-19
Depth (ft):	NYSDEC	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00	11/28/00
Aluminum	SB	12,900	12,600	11,600	7,330	4,880	3,060	2,510
Antimony	SB	3.22 U	2.96 U	3.05 U	3.5	3.04 U	2.9 U	3.08 U
Arsenic	7.5 or SB	5.74 U	5.28 U	10.4	8.39	5.43 U	11.4	11.6
Barium	300 or SB	76.6	107	124	106	18.2	70.2	79.5
Beryllium	0.16 or SB	0.476	0.472	1.28	0.724	0.369 U	0.367	0.374 U
Cadmium	1 or SB	0.483 U	0.444 U	0.542	0.524 U	0.456 U	0.438	0.937
Calcium	SB	20,600 J	87,500 J	29,900 J	19,100 J	828 J	129,000 J	103,000 J
Chromium	10 or SB	16.2 J	15.2 J	65.7 J	20.1 J	6.55 J	19.9 J	49.6 J
Cobalt	30 or SB	5.36	5.27	4.9	4.97	2.79	5.21	6.84
Copper	25 or SB	17.4 J	12.2 J	22.6 J	21.5 J	6.71 J	49.9 J	379 J
Iron	2,000 or SB	14,700	12,700	18,800	17,200	8,550	19,400	40,800
Lead	SB	31.8	17.2	68.9	69.5	5.43 U	26	58.3
Magnesium	SB	6,730 J	24,500 J	6,100 J	7,620 J	1,340 J	45,800 J	41,300 J
Manganese	SB	303 J	323 J	1890 J	309 J	105 J	261 J	395 J
Mercury	0.1	0.0703	0.0312	0.138	0.132	0.0242 U	0.0684	0.0935
Nickel	13 or SB	12.7	12	21.8	18.9	5.74	51.7	89.8
Potassium	SB	3,800 J	4,140 J	1,470 J	1,350 J	768 J	1,660 J	985 J
Silver	SB	0.54 U	0.497 U	0.511 U	0.587 U	0.51 U	0.487 U	0.587
Sodium	SB	206 J	234 J	630 J	329 J	72.4 J	122 J	119 J
Vanadium	150 or SB	35.5 J	35.8 J	50.6 J	49.5 J	14.5 J	17.9 J	18.5 J
Zinc	20 or SB	60.1 J	40.6 J	65.9 J	70.1 J	21.4 J	66.2 J	97.2 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 4.

Surface Soil Samples

Table 1f - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date	
Source:		1	1
Sample ID:		SS-20	SS-21
Depth (ft):	NYSDEC	0-0.17	0-0.17
Sample Date:	TAGM 4046	11/28/00	11/28/00
Aluminum	SB	2,850	3,240
Antimony	SB	3.11 U	2.87 U
Arsenic	7.5 or SB	11.5	9.73
Barium	300 or SB	35.8	44.1
Beryllium	0.16 or SB	0.377 U	0.348 U
Cadmium	1 or SB	0.466 U	0.514
Calcium	SB	83,000 J	91,500 J
Chromium	10 or SB	11 J	47.8 J
Cobalt	30 or SB	5.2	6.5
Copper	25 or SB	65.1 J	130 J
Iron	2,000 or SB	26,300	37,500
Lead	SB	78	83.6
Magnesium	SB	37,600 J	38,800 J
Manganese	SB	241 J	364 J
Mercury	0.1	0.177	0.197
Nickel	13 or SB	17.5	70.4
Potassium	SB	1,110 J	1,010 J
Silver	SB	0.521 U	0.481 U
Sodium	SB	377 J	470 J
Vanadium	150 or SB	27.9 J	60.9 J
Zinc	20 or SB	24.3 J	52.9 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

SB = Site background

Data in this workbook is taken from the following sources:

- 1 Blasland, Bouck & Lee, Inc., February 2002, Draft Site Investigation Summary Report.
- 2 Dames & Moore, July 1994, Summary of Investigations.

Note:

The source of the data is identified in the source row for each sample.

NYSDEC TAGM #4046 values are taken from New York State Department of Environmental Conservation Division of Environmental Remediation Guidance Document, Technical and Administrative Guidance Memorandum #4046, Determination of Soil Cleanup Objectives and Cleanup Levels, Appendix A Recommended Soil Cleanup Objectives, January 24, 1994.

As per the TAGM, total VOCs must be less than 10 mg/kg, total SVOCs must be less than 500 mg/kg and individual SVOCs must be less than 50 mg/kg.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		3	3	3	1	1	1	1	
Sample ID:		B5-14	B6-15.5	B10-13.5	MW-6	MW-7	MW-8	MW-9	
Depth (ft):	NYSDEC	14-15	15.5-16.5	13.5-14.5	23-25	9-11	5-7	6-8	
Sample Date:	TAGM 4046	5/14/97	5/13/97	5/14/97	4/1/1994	3/31/1994	3/31/1994	3/28/1994	
1,2,4-Trimethylbenzene	ns	NA	NA	670	NA	NA	NA	NA	
2-Butanone	0.3	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	ns	NA	910	860	NA	NA	NA	NA	
Acetone	0.2	NA	NA	NA	NA	NA	NA	NA	
Ethylbenzene	5.5	NA	NA	NA	NA	NA	NA	NA	
m&p Xylene	ns	NA	NA	NA	NA	NA	NA	NA	
Methylene Chloride	0.1	NA	NA	NA	0.0043	0.0059	0.0027	0.0054	
Naphthalene	13.0	NA	NA	2,700	NA	NA	NA	NA	
n-Butylbenzene	ns	680	2,100	1,700	NA	NA	NA	NA	
o-Xylene	ns	NA	NA	NA	NA	NA	NA	NA	
sec-Butylbenzene	ns	NA	760	680	NA	NA	NA	NA	
Tetrachloroethene	1.4	NA	NA	NA	0.002 U	0.002 U	0.002 U	0.002 U	
Toluene	1.5	NA	NA	NA	NA	NA	NA	NA	
Trichloroethene	0.7	NA	NA	NA	NA	NA	NA	NA	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	
Xylenes (total)	1.2	NA	NA	NA	NA	NA	NA	NA	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	2	2	2	2	
Sample ID:		MW-9 DUP	MW-11	MW-12	MW-12 DUP	MW-17	MW-18	MW-19	
Depth (ft):	NYSDEC	6-8	9-11	7-9	7-9	12-14	10-12	12-14	
Sample Date:	TAGM 4046	3/28/1994	3/29/1994	3/31/1994	34424	11/23/99	11/17/99	11/29/99	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
2-Butanone	0.3	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	
Acetone	0.2	NA	NA	NA	NA	0.064 U	0.046 U	0.032 JN	
Ethylbenzene	5.5	NA	NA	NA	NA	NA	NA	NA	
m&p Xylene	ns	NA	NA	NA	NA	NA	NA	NA	
Methylene Chloride	0.1	0.0039	0.0295	0.0042	0.0025	0.056 J	0.021 J	0.058 U	
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
o-Xylene	ns	NA	NA	NA	NA	NA	NA	NA	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	1.4	0.002 U	0.002 U	0.0033	0.002 U	0.064 U	0.046 U	0.0076 J	
Toluene	1.5	NA	NA	NA	NA	NA	NA	NA	
Trichloroethene	0.7	NA	NA	NA	NA	NA	NA	NA	
Vinyl Chloride	0.2	NA	NA	NA	NA	0.064 U	0.046 U	0.0061 J	
Xylenes (total)	1.2	NA	NA	NA	NA	NA	NA	NA	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	2	
Sample ID:		MW-20	MW-20	MW-22	MW-25	MW-26	MW-27	MW-28	
Depth (ft):	NYSDEC	10-12	12-14	10-12	12-14	12-14	12-14	12-14	
Sample Date:	TAGM 4046	11/18/99	11/18/99	11/29/99	11/17/99	11/17/99	11/18/99	11/18/99	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	NA	NA	NA	NA	NA	NA	NA	NA
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.1 U	0.1 U	0.026 JN	0.055 U	0.053 U	0.044 U	0.056 U	
Ethylbenzene	5.5	NA	NA	NA	NA	NA	NA	NA	NA
m&p Xylene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Methylene Chloride	0.1	0.051 J	0.061 J	0.058 U	0.0070 J	0.023 J	0.0084 J	0.026 J	
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	NA	NA	NA	NA	NA	NA	NA	NA
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.1 U	0.1 U	0.058 U	0.055 U	0.053 U	0.044 U	0.056 U	
Toluene	1.5	NA	NA	NA	NA	NA	NA	NA	NA
Trichloroethene	0.7	NA	NA	NA	NA	NA	NA	NA	NA
Vinyl Chloride	0.2	0.1 U	0.1 U	0.058 U	0.055 U	0.053 U	0.044 U	0.056 U	
Xylenes (total)	1.2	NA	NA	NA	NA	NA	NA	NA	NA

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-28	MW-29	MW-31	MW-32	MW-32	MW-32	MW-32	
Depth (ft):	NYSDEC	14-16	10-12	12-14	0-1	1-3	3-5	9-11	
Sample Date:	TAGM 4046	11/18/99	11/18/99	11/30/99	11/08/00	11/08/00	11/08/00	11/08/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.056 U	0.062 U	0.020 JN	0.051 UJ	0.051 UJ	0.051 UJ	0.054 UJ	
Ethylbenzene	5.5	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
m&p Xylene	ns	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
Methylene Chloride	0.1	0.034 J	0.046 J	0.063 UJ	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.053 U	0.062 U	0.063 U	0.051 U	0.051 U	0.051 U	0.054 U	
Toluene	1.5	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
Trichloroethene	0.7	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	
Vinyl Chloride	0.2	0.053 U	0.062 U	0.063 U	NA	NA	NA	NA	NA
Xylenes (total)	1.2	NA	NA	NA	0.051 U	0.051 U	0.051 U	0.054 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-33	MW-33	MW-33	MW-33	MW-34	MW-34	MW-34	
Depth (ft):	NYSDEC	0-2	2-4	4-6	10-12	0-2	2-4	4-6	
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/13/00	11/09/00	11/09/00	11/09/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.048 U	0.055 U	0.053 U	0.061 U	0.048 UJ	0.053 UJ	0.047 UJ	UJ
Ethylbenzene	5.5	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
m&p Xylene	ns	0.048 U	0.055 U	0.053 U	0.061 U	0.0074 J	0.053 U	0.047 U	U
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
Toluene	1.5	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
Trichloroethene	0.7	0.048 U	0.055 U	0.053 U	0.061 U	0.048 U	0.053 U	0.047 U	U
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	0.048 U	0.055 U	0.053 U	0.061 U	0.0074	0.053 U	0.047 U	U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-34	MW-34	MW-35	MW-35	MW-35	MW-35	MW-35	
Depth (ft):	NYSDEC	8-10	12-14	0-2	2-4	4-6	8-10	20-22	
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/13/00	11/13/00	11/13/00	11/13/00	11/13/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
2-Butanone	0.3	1.1 U	1.2 U	0.052 UJ	0.058 U	1.2 U	1.2 U	0.053 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	
Acetone	0.2	0.34 J	0.50 J	0.052 UJ	0.058 U	1.2 U	1.2 U	0.053 U	
Ethylbenzene	5.5	1.1 U	1.2 U	0.052 UJ	0.058 UJ	1.2 U	1.2 U	0.053 U	
m&p Xylene	ns	1.1 U	1.2 U	0.052 UJ	0.016 J	1.2 U	1.2 U	0.01 J	
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
o-Xylene	ns	1.1 U	1.2 U	0.052 UJ	0.0065 J	1.2 U	1.2 U	0.053 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	1.4	1.1 U	1.2 U	0.052 UJ	0.058 UJ	1.2 U	1.2 U	0.053 U	
Toluene	1.5	1.1 U	1.2 U	0.052 UJ	0.0082 J	1.2 U	1.2 U	0.0055 J	
Trichloroethene	0.7	1.1 U	1.2 U	0.052 UJ	0.058 U	1.2 U	1.2 U	0.053 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	
Xylenes (total)	1.2	1.1 U	1.2 U	0.052 UJ	0.024 J	1.2 U	1.2 U	0.01 J	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-36	MW-36	MW-36	MW-36	MW-36	MW-36A	MW-36A	
Depth (ft):	NYSDEC	0-2	2-4	4-6	8-10	20-22	0-2	2-4	
Sample Date:	TAGM 4046	11/14/00	11/14/00	11/14/00	11/14/00	11/14/00	11/15/00	11/15/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.049 UJ	0.075 U	1 U	1.1 U	0.052 U	0.053 UJ	0.048 U	
Ethylbenzene	5.5	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
m&p Xylene	ns	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
Toluene	1.5	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
Trichloroethene	0.7	0.049 U	0.051 U	1 U	1.1 U	0.052 U	0.053 U	0.048 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	0.049 U	0.051 UJ	1 U	1.1 U	0.052 U	0.053 U	0.048 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-36A	MW-36A	MW-36A	MW-37	MW-37	MW-37	MW-38	
Depth (ft):	NYSDEC	4-6	8-10	10-12	2-4	8-10	15-17	0-2	
Sample Date:	TAGM 4046	11/15/00	11/15/00	11/15/00	11/10/00	11/10/00	11/10/00	11/09/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	0.27 J	0.050 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.052 UJ	1.1 U	1.1 U	0.049 U	0.050 UJ	0.34 J	0.050 UJ	
Ethylbenzene	5.5	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
m&p Xylene	ns	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
Toluene	1.5	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
Trichloroethene	0.7	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	0.052 U	1.1 U	1.1 U	0.049 U	0.050 U	1.2 U	0.050 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-38	MW-38	MW-39	MW-39	MW-39	MW-39	MW-39	
Depth (ft):	NYSDEC	6-8	10-12	0-2	2-4	4-6	6-8	12-14	
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
2-Butanone	0.3	1.3 U	1.2 U	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	
Acetone	0.2	0.34 J	0.46 J	0.02 UJ	0.051 UJ	0.050 UJ	1.2 U	0.32 J	
Ethylbenzene	5.5	0.45 J	0.14 J	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
m&p Xylene	ns	0.98 J	0.38 J	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
o-Xylene	ns	0.29 J	0.13 J	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	1.4	1.3 U	1.2 U	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
Toluene	1.5	0.31 J	1.2 U	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
Trichloroethene	0.7	1.3 U	1.2 U	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	
Xylenes (total)	1.2	1.3	0.51	0.046 U	0.051 U	0.050 U	1.2 U	1.2 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-39	MW-40	MW-40	MW-40	MW-41	MW-41	MW-41
Depth (ft):	NYSDEC	20-22	2-4	12-14	18-20	0-2	2-4	8-10
Sample Date:	TAGM 4046	11/09/00	11/08/00	11/08/00	11/08/00	11/10/00	11/10/00	11/10/00
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 U	1.2 U
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.38 J	0.049 UJ	1.3 U	1.2 U	R	R	0.61 J
Ethylbenzene	5.5	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.06 U	1.2 U
m&p Xylene	ns	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 UJ	0.12 J
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 U	1.2 U
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.069 J	0.61 J
Toluene	1.5	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 U	1.2 U
Trichloroethene	0.7	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 U	1.2 U
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	1.2 U	0.049 U	1.3 U	1.2 U	0.051 U	0.060 UJ	0.12

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-42	MW-42	MW-42	MW-42	MW-42	MW-43	MW-46	
Depth (ft):	NYSDEC	0-2	2-4	4-6	8-10	14-16	20-22	12-14	
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/14/00	5/23/01	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	0.87 U	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	0.052 UJ	0.052 UJ	0.047 UJ	1.1 U	0.42 J	0.088 U	0.87 U	
Ethylbenzene	5.5	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	0.43 U	
m&p Xylene	ns	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U		NA
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U		NA
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	11	
Toluene	1.5	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	0.43 U	
Trichloroethene	0.7	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	0.43 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	0.052 U	0.052 U	0.047 U	1.1 U	1.2 U	0.060 U	0.87 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1	
Sample ID:		MW-46	MW-47	MW-48	MW-48DUP	TMW-1	TMW-3	TMW-3	
Depth (ft):	NYSDEC	22-24	14-14.9	12-13	12-13	8-10	6-8	10-12	
Sample Date:	TAGM 4046	5/23/01	5/21/01	5/22/01	5/22/01	11/16/00	11/9/00	11/9/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
2-Butanone	0.3	3.4 U	0.014 U	0.013 U	0.013 U	0.064	0.06 U	0.28 J	
4-Isopropyltoluene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	0.2	3.4 U	0.028 U	0.027 U	0.026 U	0.087 UJ	0.06 UJ	0.38 J	
Ethylbenzene	5.5	1.7 U	0.0071 U	0.0067 U	0.0065 U	0.064 U	0.06 U	1.2 U	
m&p Xylene	ns	NA	NA	NA	NA	0.0052 J	0.06 U	0.34 J	
Methylene Chloride	0.1	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13.0	NA	NA	NA	NA	NA	NA	NA	NA
n-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
o-Xylene	ns	NA	NA	NA	NA	0.064 U	0.06 U	1.2 U	
sec-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	NA
Tetrachloroethene	1.4	22,000 D	0.0071 U	0.0067 U	0.0065 U	0.064 U	0.06 U	1.2 U	
Toluene	1.5	1.7 U	0.0071 U	0.012	0.0065 U	0.0099 J	0.06 U	0.53 J	
Trichloroethene	0.7	57	0.0071 U	0.0067 U	0.0065 U	0.064 U	0.06 U	1.2 U	
Vinyl Chloride	0.2	NA	NA	NA	NA	NA	NA	NA	NA
Xylenes (total)	1.2	3.4 U	0.014 U	0.013 U	0.013 U	0.0052	0.06 U	0.34	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 13.

Soil Boring Samples

Table 2a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte		Sample Collection Designation & Collection Date			
Source:		1	1	1	
Sample ID:		TMW-4	TMW-5	TMW-5	
Depth (ft):	NYSDEC	8-10	8-10	12-14	
Sample Date:	TAGM 4046	11/15/00	11/16/00	11/16/00	
1,2,4-Trimethylbenzene	ns	NA	NA	NA	
2-Butanone	0.3	0.053 U	1.2 U	1.3 U	
4-Isopropyltoluene	ns	NA	NA	NA	
Acetone	0.2	0.053 U	1.2 U	1.3 U	
Ethylbenzene	5.5	0.053 U	1.2 U	1.3 U	
m&p Xylene	ns	0.053 U	1.2 U	1.3 U	
Methylene Chloride	0.1	NA	NA	NA	
Naphthalene	13.0	NA	NA	NA	
n-Butylbenzene	ns	NA	NA	NA	
o-Xylene	ns	0.053 U	1.2 U	1.3 U	
sec-Butylbenzene	ns	NA	NA	NA	
Tetrachloroethene	1.4	0.053 U	1.2 U	1.3 U	
Toluene	1.5	0.018 J	1.2 U	0.14 J	
Trichloroethene	0.7	0.053 U	1.2 U	1.3 U	
Vinyl Chloride	0.2	NA	NA	NA	
Xylenes (total)	1.2	0.053 U	1.2 U	1.3 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process. The data should not be used for any qualitative or quantitative purposes.

JN = The compound or analyte was tentatively identified and the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process.

ns = No standard. Recommended soil cleanup objective is not available.

NA = Sample was not analyzed for this constituent.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Depth (ft): Sample Date:	NYSDEC TAGM 4046	3 B1-15 15-16.5 5/14/1997	3 B2-1 1-2.5 5/14/97	3 B2-16 16-16.5 5/14/97	3 B5-14 14-15 5/14/97	3 B6-15.5 15.5-16.5 5/13/97	3 B7-15 15-16 5/13/97	3 B8-14 14-14.5 5/14/97
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	NA	NA	NA	2,100	2,500	NA	NA
3,3'-Dichlorobenzidine	ns	NA	NA	NA	NA	NA	NA	NA
3-Nitroaniline	0.500 or MDL	NA	NA	780	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	NA	NA	NA	NA	NA	NA	NA
Acenaphthene	50.0	2,600	NA	470	1,300	2,700	NA	NA
Acenaphthylene	41.0	NA	NA	NA	NA	NA	NA	NA
Anthracene	50.0	NA	NA	1,600	NA	1,200	NA	NA
Benzo(a)anthracene	0.224 or MDL	NA	430	2,300	810	480	1,600	840
Benzo(a)pyrene	0.061 or MDL	NA	500	510	NA	NA	1,200	490
Benzo(b)fluoranthene	1.1	NA	660	NA	NA	NA	2,100	620
Benzo(g,h,i)perylene	50.0	NA	420	NA	NA	NA	1,100	NA
Benzo(k)fluoranthene	1.1	NA	NA	NA	NA	NA	700	NA
bis(2-Ethylhexyl)phthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Butylbenzylphthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA
Chrysene	0.4	NA	600	2,100	980	510	2,000	850
Dibenzo(a,h)anthracene	0.014 or MDL	NA	NA	NA	NA	NA	420	NA
Dibenzofuran	6.2	NA	NA	NA	NA	960	NA	NA
Diethyl phthalate	7.1	NA	NA	NA	NA	NA	NA	NA
Dimethyl phthalate	2.0	NA	NA	NA	NA	NA	NA	NA
Di-n-butyl phthalate	8.1	NA	NA	NA	NA	NA	NA	NA
Di-n-octyl phthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Fluoranthene	50.0	NA	600	NA	870	840	1,700	2,200
Fluorene	50.0	3,600	NA	NA	3,100	5,400	NA	NA
Indeno(1,2,3-cd)pyrene	3.2	NA	420	NA	NA	NA	1,000	NA
Naphthalene	13.0	NA	NA	NA	1,400	2,300	NA	NA
N-Nitrosodiphenylamine	ns	NA	NA	NA	NA	NA	NA	NA
Phenanthrene	50.0	NA	NA	1,700	950	1,800	800	1,300
Pyrene	50.0	NA	610	4,000	3,000	2,000	1,700	1,500

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		3	3	3	3	3	3	3
Sample ID:		B10-13.5	B12-10	EVI-4,11	EVI-5,9	EVI-6,10	EVI-7, 13.5	EVI-8,11
Depth (ft):	NYSDEC	13.5-14.5	10-12	11-11.5	9-10	10-11	13.5 - 14.2	11-12
Sample Date:	TAGM 4046	5/14/97	5/13/97	5/12/1997	5/12/1997	5/12/1997	5/12/1997	5/12/1997
2,4-Dinitrotoluene	ns	NA	NA	570	NA	NA	520	
2-Methylnaphthalene	36.4	NA	NA	NA	NA	NA	640	550
3,3'-Dichlorobenzidine	ns	NA	NA	NA	NA	NA	NA	NA
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	NA	NA	NA	NA	NA	NA	NA
Acenaphthene	50.0	NA	NA	NA	NA	NA	NA	NA
Acenaphthylene	41.0	NA	NA	NA	NA	NA	NA	NA
Anthracene	50.0	NA	NA	690	NA	NA	NA	NA
Benzo(a)anthracene	0.224 or MDL	NA	NA	1,100	590	2,300	NA	1,300
Benzo(a)pyrene	0.061 or MDL	NA	NA	850	490	2,300	NA	1,000
Benzo(b)fluoranthene	1.1	NA	640	1,100	960	3,700	NA	1,300
Benzo(g,h,i)perylene	50.0	NA	400	500	NA	NA	NA	740
Benzo(k)fluoranthene	1.1	NA	NA	NA	NA	NA	NA	440
bis(2-Ethylhexyl)phthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Butylbenzylphthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA
Chrysene	0.4	NA	NA	1,200	800	3,400	NA	1,500
Dibenzo(a,h)anthracene	0.014 or MDL	NA	NA	NA	NA	NA	NA	NA
Dibenzofuran	6.2	NA	NA	NA	NA	NA	NA	NA
Diethyl phthalate	7.1	NA	NA	NA	NA	NA	NA	NA
Dimethyl phthalate	2.0	NA	NA	NA	NA	NA	NA	NA
Di-n-butyl phthalate	8.1	NA	NA	NA	NA	NA	NA	NA
Di-n-octyl phthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Fluoranthene	50.0	410,000	400	2,600	1,000	2,200	NA	2,800
Fluorene	50.0	NA	NA	NA	NA	NA	NA	NA
Indeno(1,2,3-cd)pyrene	3.2	NA	NA	460	NA	NA	NA	710
Naphthalene	13.0	NA	NA	420	NA	NA	NA	NA
N-Nitrosodiphenylamine	ns	NA	NA	NA	NA	NA	NA	NA
Phenanthrene	50.0	440,000	NA	3,200	490	2,400	460	2,200
Pyrene	50.0	360,000	390	2,000	670	2,800	NA	1,800

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Depth (ft): Sample Date:	2 MW-17 10-12 NYSDEC TAGM 4046	2 MW-17 12-14 11/23/99	2 MW-18 10-12 11/17/99	2 MW-19 12-14 11/29/99	2 MW-20 10-12 11/18/99	2 MW-20 12-14 11/18/99	2 MW-21 12-14 11/23/99		
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA		
2-Methylnaphthalene	36.4	0.4 U	0.42 U	0.81 J	0.4 U	5.1	6.0		
3,3'-Dichlorobenzidine	ns	NA	NA	NA	NA	NA	NA		
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA		
4-Bromophenyl-phenylether	ns	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
4-Chloro-3-Methylphenol	0.240 or MDL	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
4-Chlorophenyl-phenylether	ns	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
4-Methylphenol	0.9	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
Acenaphthene	50.0	0.98 JN	0.22 J	1.1 J	0.4 U	0.50 JN	0.70 JN		
Acenaphthylene	41.0	0.4 U	0.42 U	0.50 J	0.4 U	0.41 U	0.42 U		
Anthracene	50.0	0.4 U	0.14 J	3.2	0.4 U	0.41	0.65		
Benzo(a)anthracene	0.224 or MDL	0.4 U	0.42 U	4.8	0.4 U	0.41 U	0.42 U		
Benzo(a)pyrene	0.061 or MDL	0.4 U	0.42 U	3.5	0.4 U	0.41 U	0.42 U		
Benzo(b)fluoranthene	1.1	0.4 U	0.42 U	4.6	0.4 U	0.41 U	0.42 U		
Benzo(g,h,i)perylene	50.0	0.4 U	0.42 U	2.3 J	0.4 U	0.41 U	0.42 U		
Benzo(k)fluoranthene	1.1	0.4 U	0.42 U	1.7 J	0.4 U	0.41 U	0.42 U		
bis(2-Ethylhexyl)phthalate	50.0	0.4 U	1.3	0.44 J	0.4 U	0.048 J	0.091 J		
Butylbenzylphthalate	50.0	NA	NA	NA	NA	NA	NA		
Carbazole	ns	0.4 U	0.4 U	1.8 J	0.4 U	0.41 U	0.42 U		
Chrysene	0.4	0.4 U	0.42 U	4.5	0.4 U	0.41 U	0.42 U		
Dibenzo(a,h)anthracene	0.014 or MDL	0.4 U	0.42 U	0.75 J	0.4 U	0.41 U	0.42 U		
Dibenzofuran	6.2	0.4 U	0.42 U	1.3 J	0.4 U	0.41 U	0.42 U		
Diethyl phthalate	7.1	NA	NA	NA	NA	NA	NA		
Dimethyl phthalate	2.0	NA	NA	NA	NA	NA	NA		
Di-n-butyl phthalate	8.1	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
Di-n-octyl phthalate	50.0	NA	NA	NA	NA	NA	NA		
Fluoranthene	50.0	0.060 J	0.059 J	12	0.4 U	0.066 J	0.10 J		
Fluorene	50.0	0.96	0.50	1.7 J	0.4 U	0.61	0.82		
Indeno(1,2,3-cd)pyrene	3.2	0.4 U	0.42 U	1.6 J	0.4 U	0.41 U	0.42 U		
Naphthalene	13.0	0.4 U	0.42 U	2.1	0.4 U	0.41 U	0.42 U		
N-Nitrosodiphenylamine	ns	0.4 U	0.42 U	1.9 U	0.4 U	0.41 U	0.42 U		
Phenanthrene	50.0	2.7	0.17 J	13	0.4 U	1.6	2.5		
Pyrene	50.0	0.14 J	0.024 J	11	0.4 U	0.16 J	0.23 J		

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	2
Sample ID:		MW-22	MW-23	MW-24	MW-24	MW-25	MW-26	MW-27
Depth (ft):		10-12	12-14	12-14	18-20	12-14	12-14	12-14
Sample Date:		11/29/99	11/24/99	11/19/00	11/19/99	11/17/99	11/17/99	11/18/99
	NYSDEC							
	TAGM 4046							
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.062 J	0.35 J	0.38 U	0.39 U	0.39 U	0.4 U	0.38 U
3,3'-Dichlorobenzidine	ns	NA	NA	NA	NA	NA	NA	NA
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	0.41 U	0.44 U	0.38 U	0.039 JN	0.39 U	0.4 U	0.38 U
4-Chloro-3-Methylphenol	0.240 or MDL	0.41 U	0.44 U	0.38 U	0.39 U	0.39 U	0.4 U	0.38 U
4-Chlorophenyl-phenylether	ns	0.41 U	0.44 U	0.38 U	0.044 J	0.39 U	0.4 U	0.38 U
4-Methylphenol	0.9	0.41 U	0.44 U	0.38 U	0.39 U	0.39 U	0.4 U	0.38 U
Acenaphthene	50.0	0.095 J	0.44 U	0.043 JN	0.084 J	0.049 JN	0.040 JN	0.38 U
Acenaphthylene	41.0	0.41 U	0.44 U	0.38 U	0.049 J	0.39 U	0.4 U	0.38 U
Anthracene	50.0	0.24 J	0.44 U	0.38 U	0.18 J	0.075 J	0.085 J	0.38 U
Benzo(a)anthracene	0.224 or MDL	0.77	0.44 U	0.38 U	1.4	0.38 J	0.26 J	0.38 U
Benzo(a)pyrene	0.061 or MDL	0.81	0.045 J	0.38 U	1.4	0.45	0.24 J	0.042 J
Benzo(b)fluoranthene	1.1	1.3	0.44 U	0.38 U	2.7	0.68	0.27 J	0.051 J
Benzo(g,h,i)perylene	50.0	0.46	0.44 U	0.38 U	0.79	0.32 J	0.11 J	0.38 U
Benzo(k)fluoranthene	1.1	0.40 J	0.44 U	0.38 U	0.80	0.21 J	0.13 J	0.38 U
bis(2-Ethylhexyl)phthalate	50.0	0.41 U	0.44 U	0.15 J	0.18 J	1.1	0.091 J	0.052 J
Butylbenzylphthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Carbazole	ns	0.11 J	0.44 U	0.38 U	0.15 J	0.39 U	0.4 U	0.38 U
Chrysene	0.4	0.85	0.44 U	0.38 U	1.6	0.37 J	0.20 J	0.040 J
Dibenzo(a,h)anthracene	0.014 or MDL	0.21 J	0.44 U	0.38 U	0.41	0.12 J	0.049 JN	0.38 U
Dibenzofuran	6.2	0.075 J	0.44 U	0.38 U	0.059 J	0.39 U	0.4 U	0.38 U
Diethyl phthalate	7.1	NA	NA	NA	NA	NA	NA	NA
Dimethyl phthalate	2.0	NA	NA	NA	NA	NA	NA	NA
Di-n-butyl phthalate	8.1	0.41 U	0.44 U	0.38 U	0.39 U	0.39 U	0.4 U	0.38 U
Di-n-octyl phthalate	50.0	NA	NA	NA	NA	NA	NA	NA
Fluoranthene	50.0	1.3	0.075 J	0.38 U	1.7	0.61	0.44	0.064 J
Fluorene	50.0	0.11 J	0.44 U	0.38 U	0.084 J	0.39 U	0.4 U	0.38 U
Indeno(1,2,3-cd)pyrene	3.2	0.45	0.44 U	0.38 U	0.75	0.31 J	0.12 J	0.38 U
Naphthalene	13.0	0.094 J	0.44 U	0.38 U	0.042 J	0.39 U	0.4 U	0.38 U
N-Nitrosodiphenylamine	ns	0.41 U	0.44 U	0.38 U	0.39 U	0.39 U	0.4 U	0.38 U
Phenanthrene	50.0	1.2	0.050 J	0.38 U	0.51	0.33 J	0.20 J	0.077 J
Pyrene	50.0	1.8	0.074 J	0.38 U	1.8	0.58	0.45	0.056 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	1
Sample ID:		MW-28	MW-28	MW-29	MW-30	MW-30	MW-31	MW-32
Depth (ft):		12-14	14-16	10-12	12-14	14-16	12-14	0-1
Sample Date:	NYSDEC TAGM 4046	11/18/99	11/18/99	11/18/99	11/19/99	11/19/99	11/30/99	11/08/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.4 U	0.4 U	0.42 U	0.41 U	0.12 J	0.4 U	6.8 U
3,3'-Dichlorobenzidine	ns	NA	NA	NA	NA	NA	NA	6.8 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	0.4 U	0.4 U	0.42 U	0.41 U	0.4 U	0.4 U	NA
4-Chloro-3-Methylphenol	0.240 or MDL	0.4 U	0.4 U	0.42 U	R	0.40	0.4 U	NA
4-Chlorophenyl-phenylether	ns	0.4 U	0.4 U	0.42 U	0.41 U	0.4 U	0.4 U	NA
4-Methylphenol	0.9	0.4 U	0.4 U	0.42 U	R	0.4 U	0.4 U	6.8 U
Acenaphthene	50.0	0.4 U	0.4 U	0.42 U	0.41 U	0.17 J	0.4 U	6.8 U
Acenaphthylene	41.0	0.4 U	0.4 U	0.42 U	0.41 U	0.085 J	0.4 U	6.8 U
Anthracene	50.0	0.4 U	0.61	0.42 U	0.69 JN	0.36 J	0.4 U	6.8 U
Benzo(a)anthracene	0.224 or MDL	0.4 U	0.4 U	0.42 U	0.11 J	0.56	0.4 U	1.1 J
Benzo(a)pyrene	0.061 or MDL	0.4 U	0.4 U	0.42 U	0.11 JN	0.45	0.4 U	1.5 J
Benzo(b)fluoranthene	1.1	0.4 U	0.4 U	0.42 U	0.41 U	0.62	0.4 U	1.7 J
Benzo(g,h,i)perylene	50.0	0.4 U	0.4 U	0.42 U	0.41 U	0.24 J	0.4 U	6.8 U
Benzo(k)fluoranthene	1.1	0.4 U	0.4 U	0.42 U	0.41 U	0.24 J	0.4 U	0.81 J
bis(2-Ethylhexyl)phthalate	50.0	0.4 U	0.4 U	0.42 U	0.17 J	0.20 J	0.4 U	6.8 U
Butylbenzylphthalate	50.0	NA	NA	NA	NA	NA	NA	6.8 U
Carbazole	ns	0.4 U	0.4 U	0.42 U	0.41 U	0.16 J	0.4 U	6.8 U
Chrysene	0.4	0.4 U	0.4 U	0.42 U	0.41 UJ	0.44	0.4 U	1 J
Dibenzo(a,h)anthracene	0.014 or MDL	0.4 U	0.4 U	0.42 U	0.41 U	0.12 J	0.4 U	6.8 U
Dibenzofuran	6.2	0.4 U	0.4 U	0.42 U	0.41 U	0.14 J	0.4 U	6.8 U
Diethyl phthalate	7.1	NA	NA	NA	NA	NA	NA	6.8 U
Dimethyl phthalate	2.0	NA	NA	NA	NA	NA	NA	6.8 U
Di-n-butyl phthalate	8.1	0.4 U	0.4 U	0.42 U	0.41 U	0.057 J	0.4 U	6.8 U
Di-n-octyl phthalate	50.0	NA	NA	NA	NA	NA	NA	6.8 U
Fluoranthene	50.0	0.4 U	0.074 J	0.42 U	0.41 U	1.3	0.4 U	2.5 J
Fluorene	50.0	0.4 U	0.61	0.42 U	0.41 U	0.15 J	0.4 U	6.8 U
Indeno(1,2,3-cd)pyrene	3.2	0.4 U	0.4 U	0.42 U	0.41 U	0.26 J	0.4 U	6.8 U
Naphthalene	13.0	0.4 U	0.4 U	0.42 U	0.41 U	0.099 J	0.4 U	6.8 U
N-Nitrosodiphenylamine	ns	0.4 U	0.4 U	0.42 U	0.41 U	0.25 J	0.4 U	6.8 U
Phenanthrene	50.0	0.4 U	0.19 JN	0.42 U	0.41 J	1.2	0.4 U	1.6 J
Pyrene	50.0	0.4 U	0.15 J	0.42 U	1.5 J	1.3	0.4 U	2.2 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1
Sample ID:		MW-32	MW-32	MW-32	MW-33	MW-33	MW-33	MW-33
Depth (ft):		1-3	3-5	9-11	0-2	2-4	4-6	10-12
Sample Date:	NYSDEC TAGM 4046	11/08/00	11/08/00	11/08/00	11/13/00	11/13/00	11/13/00	11/13/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.38 J	0.17 J	0.38 UJ	0.096 U	0.060 J	0.36 U	0.081 J
3,3'-Dichlorobenzidine	ns	3.5 U	0.37 U	0.38 UJ	0.35 U	0.40 U	0.36 U	0.41 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	3.5 U	0.37 U	0.38 U	0.35 U	0.40 U	0.36 U	0.055 J
Acenaphthene	50.0	3.5 U	0.37 U	0.38 UJ	0.11 J	0.061 J	0.36 U	0.08 J
Acenaphthylene	41.0	3.5 U	0.37 U	0.38 UJ	0.35 U	0.40 U	0.36 U	0.41 U
Anthracene	50.0	3.5 U	0.087 J	0.38 UJ	0.21 J	0.21 J	0.046 J	0.072 J
Benzo(a)anthracene	0.224 or MDL	0.77 J	0.23 J	0.38 UJ	3.8	0.69	0.15 J	0.17 J
Benzo(a)pyrene	0.061 or MDL	0.99 J	0.17 J	0.040 J	4.3	0.7	0.20 J	0.19 J
Benzo(b)fluoranthene	1.1	1.6 J	0.37 J	0.38 UJ	11 D	1.5	0.34 J	0.4 J
Benzo(g,h,i)perylene	50.0	0.74 J	0.14 J	0.38 UJ	3.9	0.53	0.12 J	0.15 J
Benzo(k)fluoranthene	1.1	3.5 U	0.088 J	0.38 UJ	2.6	0.46	0.11 J	0.17 J
bis(2-Ethylhexyl)phthalate	50.0	1.1 J	1.4	0.19 J	2.6	3.8	0.61	6.1
Butylbenzylphthalate	50.0	0.87 J	0.37 U	0.38 UJ	4.4	0.40 U	0.36 U	0.41 U
Carbazole	ns	3.5 U	0.37 U	0.38 UJ	0.10 J	0.076 J	0.36 U	0.41 U
Chrysene	0.4	0.63 J	0.26 J	0.38 UJ	4	0.65	0.15 J	0.22 J
Dibenzo(a,h)anthracene	0.014 or MDL	3.5 U	0.038 J	0.068 J	0.35 U	0.40 U	0.36 U	0.41 U
Dibenzofuran	6.2	3.5 U	0.37 U	0.38 UJ	0.35 U	0.066 J	0.039 J	0.41 U
Diethyl phthalate	7.1	3.5 U	0.082 J	0.38 UJ	0.35 U	0.40 U	0.36 U	0.41 U
Dimethyl phthalate	2.0	3.5 U	0.37 U	0.38 UJ	0.35 U	0.40 U	0.36 U	0.41 U
Di-n-butyl phthalate	8.1	3.5 U	0.37 U	0.38 UJ	1.8	0.28 J	0.36 U	0.050 J
Di-n-octyl phthalate	50.0	3.5 U	0.056 J	0.38 UJ	0.055 J	0.40 U	0.36 U	0.41 U
Fluoranthene	50.0	1.6 J	0.44	0.052 J	2.4	1.2	0.30 J	0.25 J
Fluorene	50.0	3.5 U	0.37 U	0.38 UJ	0.067 J	0.075 J	0.36 U	0.41 U
Indeno(1,2,3-cd)pyrene	3.2	3.5 U	0.14 J	0.38 UJ	4.1	0.59	0.14 J	0.15 J
Naphthalene	13.0	3.5 U	0.37 U	0.38 UJ	0.35 UJ	0.40 UJ	0.36 UJ	0.41 U
N-Nitrosodiphenylamine	ns	3.5 U	0.067 J	0.38 UJ	0.097 U	0.058 J	0.043 J	0.079 J
Phenanthrene	50.0	1 J	0.46	0.062 J	1.2	0.82	0.28 J	0.22 J
Pyrene	50.0	1.5 J	0.35 J	0.078 J	3	0.79	0.17 J	0.21 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1
Sample ID:		MW-34	MW-34	MW-34	MW-34	MW-34	MW-35	MW-35
Depth (ft):		0-2	2-4	4-6	8-10	12-14	0-2	2-4
Sample Date:	NYSDEC TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/13/00	11/13/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.66 J	R	0.34 J	6.4	2.7 J	0.068 J	0.27 J
3,3'-Dichlorobenzidine	ns	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.40 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	3.6 U	3.5 UJ	0.35 U	3.8 U	4.1 U	0.39 U	0.40 U
Acenaphthene	50.0	2.2 J	R	1.3 J	1.6 J	4.1 U	0.066 J	0.076 J
Acenaphthylene	41.0	3.6 U	R	0.11 J	3.8 U	4.1 U	0.13 J	0.12 J
Anthracene	50.0	5.4 J	R	2.9 J	1.8 J	2.6 J	0.17 J	0.38 J
Benzo(a)anthracene	0.224 or MDL	11	R	8.3 J	3.7 J	4.1 U	0.48	0.87
Benzo(a)pyrene	0.061 or MDL	11	R	5.1 J	3.2 J	4.1 U	0.49	0.83
Benzo(b)fluoranthene	1.1	18	R	7.9 J	4.7	4.1 U	0.64	1.1
Benzo(g,h,i)perylene	50.0	6.5	R	2.6 J	1.7 J	4.1 U	0.5	0.5
Benzo(k)fluoranthene	1.1	5.5	R	2.0 J	1.5 J	4.1 U	0.19 J	0.39 J
bis(2-Ethylhexyl)phthalate	50.0	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.15 J	0.47
Butylbenzylphthalate	50.0	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.4 U
Carbazole	ns	2.5 J	R	1.5 J	1.2 J	4.1 U	0.06 J	0.081 J
Chrysene	0.4	9.3	R	5.1 J	3.1 J	4.1 U	0.41	0.73
Dibenzo(a,h)anthracene	0.014 or MDL	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.40 U
Dibenzofuran	6.2	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.40 U
Diethyl phthalate	7.1	3.6 U	R	1.4 J	3.8 U	4.1 U	0.39 U	0.059 JB
Dimethyl phthalate	2.0	3.6 U	R	0.63 J	3.8 U	4.1 U	0.39 U	0.40 U
Di-n-butyl phthalate	8.1	3.7	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.40 U
Di-n-octyl phthalate	50.0	1.5 J	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.13 J
Fluoranthene	50.0	26 J	R	4.4 D	6.5	0.53 J	0.77	2.3
Fluorene	50.0	2.5 J	R	1.1 J	2.4 J	2.6 J	0.39 U	0.12 J
Indeno(1,2,3-cd)pyrene	3.2	7.5	R	3.2 J	1.9 J	4.1 U	0.4	0.47
Naphthalene	13.0	3.6 U	R	0.35 UJ	3.8 U	4.1 U	0.39 U	0.40 U
N-Nitrosodiphenylamine	ns	2.2 J	R	0.35 UJ	3.8 U	4.1 U	0.058 J	0.19 J
Phenanthrene	50.0	21 J	R	12 J	6.1	1.2 J	0.59	1.5
Pyrene	50.0	17 J	R	3.7 D	4.6	0.65 J	0.63	1.6

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Depth (ft): Sample Date:	NYSDEC TAGM 4046	1 MW-35 4-6 11/13/00	1 MW-35 8-10 11/13/00	1 MW-35 20-22 11/13/00	1 MW-36 0-2 11/14/00	1 MW-36 2-4 11/14/00	1 MW-36 4-6 11/14/00	1 MW-36 8-10 11/14/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.59 J	3.7	0.3 J	3.4 U	3.7 U	9.1	46
3,3'-Dichlorobenzidine	ns	0.42 UJ	0.41 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	0.42 U	4.1 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
Acenaphthene	50.0	0.42 UJ	0.41 U	0.1 J	3.4 U	3.7 U	1.2 J	3.7 J
Acenaphthylene	41.0	0.42 UJ	0.41 U	0.14 J	3.4 U	3.7 U	3.5 U	3.7 U
Anthracene	50.0	1.1 J	4.8	0.45	3.4 U	1.2 J	2.3 J	4.2
Benzo(a)anthracene	0.224 or MDL	0.25 J	0.43	0.95	0.97 J	4.6	0.49 J	3.7 U
Benzo(a)pyrene	0.061 or MDL	0.25 J	0.33 J	0.87	1.4 J	4.4	0.55 J	3.7 U
Benzo(b)fluoranthene	1.1	0.37 J	0.44	1.2	3.7	6.5	0.81 J	3.7 U
Benzo(g,h,i)perylene	50.0	0.31 J	0.18 J	0.5	1.7 J	3.0 J	3.5 U	3.7 U
Benzo(k)fluoranthene	1.1	0.12 J	0.14 J	0.33 J	1 J	2.6 J	0.37 J	3.7 U
Bis(2-ethylhexyl) phthalate	50.0	0.66 J	0.99	0.4 U	3.4 U	0.41 J	0.89 J	1.2 J
Butylbenzylphthalate	50.0	0.42 UJ	0.41 U	0.4 U	0.38 J	3.7 U	3.5 U	3.7 U
Carbazole	ns	0.42 UJ	0.41 U	0.11 J	3.4 U	3.7 U	3.5 U	3.7 U
Chrysene	0.4	0.24 J	0.54	0.73	1.2 J	3.9	0.51 J	3.7 U
Dibenzo(a,h)anthracene	0.014 or MDL	0.42 UJ	0.41 U	0.17 J	3.4 U	3.7 U	3.5 U	3.7 U
Dibenzofuran	6.2	0.42 UJ	0.41 U	0.16 J	3.4 U	3.7 U	3.5 U	3.7 U
Diethyl phthalate	7.1	0.42 UJ	0.41 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
Dimethyl phthalate	2.0	0.42 UJ	0.41 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
Di-n-butyl phthalate	8.1	0.22 J	0.41 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
Di-n-octyl phthalate	50.0	0.42 UJ	0.41 U	0.4 U	3.4 U	3.7 U	3.5 U	3.7 U
Fluoranthene	50.0	0.38 J	0.91	2.6	1 J	8.7	1.1 J	0.60 J
Fluorene	50.0	0.61 J	1.8	0.14 J	3.4 U	3.7 U	2.0 J	5.2
Indeno(1,2,3-cd)pyrene	3.2	0.33 J	0.22 J	0.51	1.7 J	2.9 J	3.5 U	3.7 U
Naphthalene	13.0	0.3 J	0.41 U	0.22 J	3.4 U	3.7 U	3.5 U	3.7 U
N-nitrosodiphenylamine	ns	0.42 UJ	0.41 UJ	0.4 UJ	3.4 U	3.7 U	3.5 U	3.7 U
Phenanthrene	50.0	1.4 J	11 D	2	0.44 J	3.4 J	3 J	11
Pyrene	50.0	0.59 J	1.5	1.8	0.73 J	6.9	0.77 J	0.99 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1
Sample ID:		MW-36	MW-36A	MW-36A	MW-36A	MW-36A	MW-36A	MW-37
Depth (ft):	NYSDEC	20-22	0-2	2-4	4-6	8-10	10-12	2-4
Sample Date:	TAGM 4046	11/14/00	11/15/00	11/15/00	11/15/00	11/15/00	11/15/00	11/10/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	3.4 U	0.41 J	3.6 UJ	3.5 UJ	3.6 U	21	0.049 J
3,3'-Dichlorobenzidine	ns	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.37 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	3.4 U	3.7 U	3.6 U	3.5 U	3.6 U	3.8 U	0.36 U
Acenaphthene	50.0	3.4 U	3.7 UJ	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.12 J
Acenaphthylene	41.0	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Anthracene	50.0	3.4 U	0.89 J	3.6 UJ	0.39 J	3.6 U	3.1 J	0.36 U
Benzo(a)anthracene	0.224 or MDL	0.74 J	2.6 J	3.6 UJ	0.87 J	3.6 U	3.8 U	1.7
Benzo(a)pyrene	0.061 or MDL	1 J	2 J	3.6 UJ	0.8 J	3.6 U	3.8 U	2.4
Benzo(b)fluoranthene	1.1	2.6 J	3.8	3.6 UJ	1.2 J	3.6 U	3.8 U	4
Benzo(g,h,i)perylene	50.0	1.1 J	1.1 J	3.6 UJ	3.5 UJ	3.6 U	3.8 U	1.6
Benzo(k)fluoranthene	1.1	1.1 J	1.6 J	3.6 UJ	0.47 J	3.6 U	3.8 U	1.3
Bis(2-ethylhexyl) phthalate	50.0	3.4 U	0.62 J	0.52 J	3.5 UJ	0.86 J	2.1 J	0.91 U
Butylbenzylphthalate	50.0	3.4 U	0.57 J	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Carbazole	ns	3.4 U	0.62 J	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Chrysene	0.4	0.79 J	2.4 J	3.6 UJ	0.71 J	3.6 U	3.8 U	1.7
Dibenzo(a,h)anthracene	0.014 or MDL	0.7 J	0.37 J	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Dibenzofuran	6.2	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.039 J
Diethyl phthalate	7.1	3.4 U	3.7 U	3.6 UJ	3.5 UJ	0.66 J	3.8 U	0.36 U
Dimethyl phthalate	2.0	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Di-n-butyl phthalate	8.1	3.4 U	3.7 U	0.40 J	0.44 J	3.6 U	3.8 U	0.36 U
Di-n-octyl phthalate	50.0	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.038 J
Fluoranthene	50.0	0.64 J	7	0.40 J	2.2 J	3.6 U	3.8 U	1.7
Fluorene	50.0	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	2.1 J	0.043 J
Indeno(1,2,3-cd)pyrene	3.2	1.2 J	1.2 J	3.6 UJ	3.5 UJ	3.6 U	3.8 U	1.5
Naphthalene	13.0	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.11 J
N-nitrosodiphenylamine	ns	3.4 U	3.7 U	3.6 UJ	3.5 UJ	3.6 U	3.8 U	0.36 U
Phenanthrene	50.0	0.39 J	4.8	3.6 UJ	1.6 J	3.6 U	4	0.63
Pyrene	50.0	0.5 J	4.9 J	0.66 J	1.9 J	0.40 J	0.97 J	2.1

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Depth (ft): Sample Date:	NYSDEC TAGM 4046	1 MW-37 8-10 11/10/00	1 MW-37 15-17 11/10/00	1 MW-38 0-2 11/09/00	1 MW-38 6-8 11/09/00	1 MW-38 10-12 11/09/00	1 MW-39 0-2 11/09/00	1 MW-39 2-4 11/09/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.37 U	1.3 J	R	4.1 J	4 U	5.2 U	3.6 U
3,3'-Dichlorobenzidine	ns	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	0.37 U	0.41 U	R	4.3 UJ	4 U	5.2 U	3.6 U
Acenaphthene	50.0	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 UJ	3.6 U
Acenaphthylene	41.0	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Anthracene	50.0	0.37 U	0.3 J	R	2.4 J	1.7 J	5.2 U	3.6 U
Benzo(a)anthracene	0.224 or MDL	0.2 J	0.41 UJ	R	4.3 U	4 U	5.2 U	0.48 J
Benzo(a)pyrene	0.061 or MDL	0.3 J	0.41 UJ	0.042 J	4.3 U	4 U	5.2 U	3.6 U
Benzo(b)fluoranthene	1.1	0.43	0.41 UJ	0.069 J	4.3 U	4 U	5.2 U	0.71 J
Benzo(g,h,i)perylene	50.0	0.25 J	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Benzo(k)fluoranthene	1.1	0.17 J	0.41 UJ	0.043 J	4.3 U	4 U	5.2 U	0.41 J
Bis(2-ethylhexyl) phthalate	50.0	0.58	0.26 J	0.19 J	4.3 U	4 U	0.80 J	0.47 J
Butylbenzylphthalate	50.0	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Carbazole	ns	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Chrysene	0.4	0.22 J	0.41 UJ	0.041 J	4.3 U	1.2 J	5.2 U	0.39 J
Dibenzo(a,h)anthracene	0.014 or MDL	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Dibenzofuran	6.2	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Diethyl phthalate	7.1	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Dimethyl phthalate	2.0	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Di-n-butyl phthalate	8.1	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Di-n-octyl phthalate	50.0	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Fluoranthene	50.0	0.25 J	0.41 UJ	0.074 J	4.3 U	4 U	5.2 U	1.1 J
Fluorene	50.0	0.37 U	0.41 UJ	R	3.6 J	3.4 J	5.2 U	3.6 U
Indeno(1,2,3-cd)pyrene	3.2	0.24 J	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Naphthalene	13.0	0.37 U	0.41 UJ	R	2.9 J	0.72 J	5.2 U	3.6 U
N-nitrosodiphenylamine	ns	0.37 U	0.41 UJ	R	4.3 U	4 U	5.2 U	3.6 U
Phenanthrene	50.0	0.13 J	0.56 J	0.064 J	1.9 J	4.4	5.2 U	1.2 J
Pyrene	50.0	0.2 J	0.072 J	0.097 J	4.4	5.2	0.72 J	0.97 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Depth (ft): Sample Date:	NYSDEC TAGM 4046	1 MW-39 4-6 11/09/00	1 MW-39 6-8 11/09/00	1 MW-39 12-14 11/09/00	1 MW-39 20-22 11/09/00	1 MW-40 2-4 11/08/00	1 MW-40 12-14 11/08/00	1 MW-40 18-20 11/08/00
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.16 J	0.44 U	0.42 U
3,3'-Dichlorobenzidine	ns	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	0.36 U	R	R	R	0.36 U	0.44 U	0.42 U
Acenaphthene	50.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.12 J	0.44 U	0.42 U
Acenaphthylene	41.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
Anthracene	50.0	0.36 UJ	2.1 J	0.8 J	0.71	0.55 U	0.52 U	0.49 U
Benzo(a)anthracene	0.224 or MDL	0.36 UJ	0.40 UJ	0.43 J	0.41 U	4.8 D	0.44 U	0.42 U
Benzo(a)pyrene	0.061 or MDL	0.36 UJ	0.11 J	0.39 UJ	0.41 U	5.6 U	0.091 J	0.42 U
Benzo(b)fluoranthene	1.1	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	7.4 D	0.1 J	0.42 U
Benzo(g,h,i)perylene	50.0	0.36 UJ	0.099 J	0.39 UJ	0.41 U	2.6 U	0.44 U	0.42 U
Benzo(k)fluoranthene	1.1	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	2.5 U	0.44 U	0.42 U
Bis(2-ethylhexyl) phthalate	50.0	0.28 J	0.31 J	0.43 J	0.46	0.8 U	0.47 U	0.68 U
Butylbenzylphthalate	50.0	0.039 J	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
Carbazole	ns	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.16 J	0.44 U	0.42 U
Chrysene	0.4	0.36 UJ	0.40 UJ	0.37 J	0.21 J	4.8 U	0.062 J	0.42 U
Dibenzo(a,h)anthracene	0.014 or MDL	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	1 U	0.44 U	0.42 U
Dibenzofuran	6.2	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.099 J	0.44 U	0.42 U
Diethyl phthalate	7.1	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
Dimethyl phthalate	2.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
Di-n-butyl phthalate	8.1	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.038 J	0.071 J	0.077 J
Di-n-octyl phthalate	50.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
Fluoranthene	50.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	12 D	0.11 J	0.062 J
Fluorene	50.0	0.36 UJ	1.1 J	0.9 J	0.85 J	0.075 J	0.57 U	0.45 U
Indeno(1,2,3-cd)pyrene	3.2	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	2.7 U	0.052 J	0.42 U
Naphthalene	13.0	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	0.42 U
N-nitrosodiphenylamine	ns	0.36 UJ	0.40 UJ	0.39 UJ	0.41 U	0.36 U	0.44 U	3.1 U
Phenanthrene	50.0	0.36 UJ	1.5 J	1.8 J	1.9	2.5 U	1.2 U	1.2 U
Pyrene	50.0	0.36 UJ	3.7 J	1.8 J	1.2	8 D	0.2 J	0.18 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1
Sample ID:		MW-41	MW-41	MW-41	MW-42	MW-42	MW-42	MW-42
Depth (ft):		0-2	2-4	8-10	0-2	2-4	4-6	8-10
Sample Date:		11/10/00	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00
	NYSDEC							
	TAGM 4046							
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	0.38 J	0.39 J	1.1 J	0.19 J	0.35 UJ	0.35 UJ	1.8 J
3,3'-Dichlorobenzidine	ns	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	R	0.40 U	0.41 UJ	0.35 U	0.35 U	0.35 U	3.8 U
Acenaphthene	50.0	0.3 J	0.40 U	R	0.86	0.35 UJ	0.35 UJ	3.8 U
Acenaphthylene	41.0	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Anthracene	50.0	0.15 J	0.14 J	0.28 J	3.2	0.037 J	0.037 J	0.65 J
Benzo(a)anthracene	0.224 or MDL	0.34 J	0.26 J	R	4.7 D	0.52 J	0.15 J	3.8 U
Benzo(a)pyrene	0.061 or MDL	0.094 J	0.24 J	0.76 J	4.0 D	0.64 J	0.19 J	3.8 U
Benzo(b)fluoranthene	1.1	0.57	0.48	0.88 J	5.7 D	1.8 J	0.34 J	3.8 U
Benzo(g,h,i)perylene	50.0	0.14 J	0.096 J	0.74 J	3.4	0.5 J	0.12 J	3.8 U
Benzo(k)fluoranthene	1.1	0.17 J	0.11 J	0.28 J	3.1	0.49 J	0.098 J	3.8 U
Bis(2-ethylhexyl) phthalate	50.0	0.69	0.56	0.74 J	0.35 U	0.21 J	0.062 J	0.69 J
Butylbenzylphthalate	50.0	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Carbazole	ns	0.07 J	0.40 U	0.064 J	0.8	0.35 UJ	0.35 UJ	3.8 U
Chrysene	0.4	0.4	0.34 J	0.52 J	3.9 D	0.6 J	0.14 J	3.8 U
Dibenzo(a,h)anthracene	0.014 or MDL	0.38 U	0.40 U	R	1.4	0.16 J	0.065 J	3.8 U
Dibenzofuran	6.2	0.1 J	0.40 U	R	0.44	0.35 UJ	0.35 UJ	3.8 U
Diethyl phthalate	7.1	0.082 J	0.17 J	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Dimethyl phthalate	2.0	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Di-n-butyl phthalate	8.1	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Di-n-octyl phthalate	50.0	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Fluoranthene	50.0	0.65	0.46	0.61 J	10 D	0.6 J	0.28 J	0.4 J
Fluorene	50.0	0.048 J	0.07 J	R	0.92	0.35 UJ	0.35 UJ	3.8 U
Indeno(1,2,3-cd)pyrene	3.2	0.16 J	0.40 U	R	3.6	0.51 J	0.35 UJ	3.8 U
Naphthalene	13.0	0.23 J	0.24 J	0.68 J	0.35 U	0.35 UJ	0.35 UJ	3.8 U
N-nitrosodiphenylamine	ns	0.38 U	0.40 U	R	0.35 U	0.35 UJ	0.35 UJ	3.8 U
Phenanthrene	50.0	0.84	0.8	0.91 J	7.9 D	0.15 J	0.19 J	0.77 J
Pyrene	50.0	0.54	0.37 J	0.96 J	10 D	0.44 J	0.17 J	3.8 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source:		1	1	1	1	1	1	1
Sample ID:		MW-42	MW-43	TMW-1	TMW-3	TMW-3	TMW-4	TMW-5
Depth (ft):		14-16	20-22	8-10	6-8	10-12	8-10	8-10
Sample Date:		11/09/00	11/14/00	11/16/00	11/09/00	11/09/00	11/15/00	11/16/00
	NYSDEC							
	TAGM 4046							
2,4-Dinitrotoluene	ns	NA	NA	NA	NA	NA	NA	NA
2-Methylnaphthalene	36.4	6.2	0.42 UJ	0.13 J	0.42 UJ	2.1	0.099 J	R
3,3'-Dichlorobenzidine	ns	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
3-Nitroaniline	0.500 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Bromophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA	NA	NA	NA	NA	NA	NA
4-Chlorophenyl-phenylether	ns	NA	NA	NA	NA	NA	NA	NA
4-Methylphenol	0.9	4.2 U	0.42 U	0.45 U	0.42 UJ	R	0.38 U	R
Acenaphthene	50.0	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Acenaphthylene	41.0	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Anthracene	50.0	0.76 J	0.42 UJ	0.12 J	0.061 J	1.8	0.056 J	R
Benzo(a)anthracene	0.224 or MDL	4.2 U	0.42 UJ	0.36 J	0.42 UJ	0.54	R	R
Benzo(a)pyrene	0.061 or MDL	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.18 J	R	R
Benzo(b)fluoranthene	1.1	4.2 U	0.42 UJ	0.45 J	0.043 J	0.26 J	R	R
Benzo(g,h,i)perylene	50.0	4.2 U	0.42 UJ	0.15 J	0.42 UJ	0.092 J	R	R
Benzo(k)fluoranthene	1.1	4.2 U	0.42 UJ	0.23 J	0.42 UJ	0.085 J	R	R
Bis(2-ethylhexyl) phthalate	50.0	4.2 U	0.055 J	0.45 UJ	0.42 UJ	0.41 U	0.089 J	R
Butylbenzylphthalate	50.0	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Carbazole	ns	4.2 U	0.42 UJ	0.051 J	0.42 UJ	0.41 U	R	R
Chrysene	0.4	4.2 U	0.42 UJ	0.32 J	0.067 J	0.71	R	R
Dibenzo(a,h)anthracene	0.014 or MDL	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	0.042 J	R
Dibenzofuran	6.2	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Diethyl phthalate	7.1	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Dimethyl phthalate	2.0	4.2 U	0.42 UJ	0.046 J	0.42 UJ	0.41 U	R	R
Di-n-butyl phthalate	8.1	4.2 U	0.42 UJ	0.45 UJ	0.075 J	0.41 U	R	R
Di-n-octyl phthalate	50.0	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Fluoranthene	50.0	4.2 U	0.42 UJ	0.84 J	0.072 J	0.93	R	R
Fluorene	50.0	0.78 J	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Indeno(1,2,3-cd)pyrene	3.2	4.2 U	0.42 UJ	0.19 J	0.42 UJ	0.097 J	R	R
Naphthalene	13.0	4.2 U	0.42 UJ	0.45 UJ	0.063 J	1.2	R	R
N-nitrosodiphenylamine	ns	4.2 U	0.42 UJ	0.45 UJ	0.42 UJ	0.41 U	R	R
Phenanthrene	50.0	1.6 J	0.42 UJ	0.55 J	0.11 J	2.3	0.1 J	R
Pyrene	50.0	4.2 U	0.42 UJ	0.83 J	0.085 J	1.2	R	R

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 15.

Soil Boring Samples

Table 2b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date	
Source:	1	
Sample ID:	TMW-5	
Depth (ft):	12-14	
Sample Date:	NYSDEC TAGM 4046	11/16/00
2,4-Dinitrotoluene	ns	NA
2-Methylnaphthalene	36.4	0.12 J
3,3'-Dichlorobenzidine	ns	R
3-Nitroaniline	0.500 or MDL	NA
4-Bromophenyl-phenylether	ns	NA
4-Chloro-3-Methylphenol	0.240 or MDL	NA
4-Chlorophenyl-phenylether	ns	NA
4-Methylphenol	0.9	R
Acenaphthene	50.0	R
Acenaphthylene	41.0	R
Anthracene	50.0	0.08 J
Benzo(a)anthracene	0.224 or MDL	0.28 J
Benzo(a)pyrene	0.061 or MDL	0.27 J
Benzo(b)fluoranthene	1.1	0.42 J
Benzo(g,h,i)perylene	50.0	0.13 J
Benzo(k)fluoranthene	1.1	0.13 J
Bis(2-ethylhexyl) phthalate	50.0	R
Butylbenzylphthalate	50.0	R
Carbazole	ns	R
Chrysene	0.4	0.24 J
Dibenzo(a,h)anthracene	0.014 or MDL	R
Dibenzofuran	6.2	R
Diethyl phthalate	7.1	R
Dimethyl phthalate	2.0	R
Di-n-butyl phthalate	8.1	R
Di-n-octyl phthalate	50.0	R
Fluoranthene	50.0	0.51 J
Fluorene	50.0	R
Indeno(1,2,3-cd)pyrene	3.2	0.14 J
Naphthalene	13.0	R
N-nitrosodiphenylamine	ns	R
Phenanthrene	50.0	0.22 J
Pyrene	50.0	0.46 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 15.

Notes:

MDL = Method Detection Limit

NA = Sample was not analyzed for this constituent.

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL)

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process. The data should not be used for any qualitative or quantitative purposes.

JN = The compound or analyte was tentatively identified and the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process

ns = No standard. Recommended soil cleanup objective is not available.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:		3	2	2	2	2	2	2	
Sample ID:		B5-1	MW-17	MW-17	MW-18	MW-19	MW-20	MW-20	
Depth (ft):	NYSDEC	1-2.5	10-12	12-14	10-12	12-14	10-12	12-14	
Sample Date:	TAGM 4046	5/14/97	11/23/99	11/23/99	11/17/99	11/29/99	11/18/99	11/18/99	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.767	NA	NA	NA	NA	NA	NA	
Aroclor-1260	ns	NA	0.059 U	0.063 U	0.056 U	0.062 U	0.061 U	0.059 U	
Total PCBs	10	NA	0.059 U	0.063 U	0.056 U	0.062 U	0.061 U	0.059 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-21	MW-22	MW-23	MW-24	MW-24	MW-25	MW-26
Depth (ft):	NYSDEC	12-14	10-12	12-14	12-14	18-20	12-14	12-14
Sample Date:	TAGM 4046	11/23/99	11/29/99	11/24/99	11/19/00	11/19/99	11/17/99	11/17/99
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1254	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1260	ns	0.18	0.19	0.061 U	0.056 U	0.059 U	3.2	0.058 U
Total PCBs	1.0	0.18	0.19	0.061 U	0.056 U	0.059 U	3.2	0.058 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-27	MW-28	MW-28	MW-29	MW-30	MW-30	MW-31
Depth (ft):	NYSDEC	12-14	12-14	14-16	10-12	12-14	14-16	12-14
Sample Date:	TAGM 4046	11/18/99	11/18/99	11/18/99	11/18/99	11/19/99	11/19/99	11/30/99
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1254	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1260	ns	0.057 U	0.06 U	0.059 U	0.057 U	0.06 U	0.059 U	0.063 U
Total PCBs	1.0	0.057 U	0.06 U	0.059 U	0.057 U	0.06 U	0.059 U	0.063 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	1	1	1
Sample ID:		MW-32	MW-32	MW-32	MW-32	MW-33	MW-33	MW-33
Depth (ft):	NYSDEC	0-1	1-3	3-5	9-11	0-2	2-4	4-6
Sample Date:	TAGM 4046	11/08/00	11/08/00	11/08/00	11/08/00	11/13/00	11/13/00	11/13/00
Aroclor-1248	ns	0.050 U	0.051 U	0.052 U	0.054 U	2.7	0.26	0.063 U
Aroclor-1254	ns	0.050 U	0.051 U	0.052 U	0.054 U	0.21 U	0.052 U	0.063 U
Aroclor-1260	ns	0.050 U	0.051 U	0.052 U	0.054 U	0.21 U	0.052 U	0.063 U
Total PCBs	1.0	0.050 U	0.051 U	0.052 U	0.054 U	2.7	0.26	0.063 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-33	MW-34	MW-34	MW-34	MW-34	MW-34	MW-35
Depth (ft):	NYSDEC	10-12	0-2	2-4	4-6	8-10	12-14	0-2
Sample Date:	TAGM 4046	11/13/00	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/13/00
Aroclor-1248	ns	3.4	0.053 U	0.052 U	0.052 U	0.053 U	0.057 U	0.057 U
Aroclor-1254	ns	0.25 U	0.053 U	0.052 U	0.052 U	0.053 U	0.057 U	0.057 U
Aroclor-1260	ns	0.25 U	0.053 U	0.052 U	0.052 U	0.053 U	0.057 U	0.057 U
Total PCBs	1.0	3.4	0.053 U	0.052 U	0.052 U	0.053 U	0.057 U	0.057 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-35	MW-35	MW-35	MW-35	MW-36	MW-36	MW-36
Depth (ft):	NYSDEC	2-4	4-6	8-10	20-22	0-2	2-4	4-6
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/13/00	11/14/00	11/14/00	11/14/00
Aroclor-1248	ns	0.056 U	0.058 U	0.056 U	0.50	1.2	0.30	0.14
Aroclor-1254	ns	0.056 U	0.058 U	0.056 U	0.056 U	0.1 U	0.055 U	0.050 U
Aroclor-1260	ns	0.056 U	0.058 U	0.056 U	0.056 U	0.1 U	0.055 U	0.050 U
Total PCBs	1.0	0.056 U	0.058 U	0.056 U	0.50	1.2	0.30	0.14

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-36	MW-36	MW-36A	MW-36A	MW-36A	MW-36A	MW-36A
Depth (ft):	NYSDEC	8-10	20-22	0-2	2-4	4-6	8-10	10-12
Sample Date:	TAGM 4046	11/14/00	11/14/00	11/15/00	11/15/00	11/15/00	11/15/00	11/15/00
Aroclor-1248	ns	0.92	0.050 U	0.055 U	0.05 U	0.05 U	0.053 U	0.054 U
Aroclor-1254	ns	0.11 U	0.050 U	0.055 U	0.05 U	0.05 U	0.053 U	0.054 U
Aroclor-1260	ns	0.11 U	0.050 U	0.055 U	0.05 U	0.05 U	0.053 U	0.054 U
Total PCBs	1.0	0.92	0.050 U	0.055 U	0.05 U	0.05 U	0.053 U	0.054 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-37	MW-37	MW-37	MW-38	MW-38	MW-38	MW-39
Depth (ft):	NYSDEC	2-4	8-10	15-17	0-2	6-8	10-12	0-2
Sample Date:	AGM 404	11/10/00	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00
Aroclor-1248	ns	0.052 U	0.057 U	0.062 U	0.054 U	0.061 U	0.059 U	0.050 U
Aroclor-1254	ns	0.052 U	0.057 U	0.062 U	0.054 U	0.061 U	0.059 U	0.078
Aroclor-1260	ns	0.052 U	0.057 U	0.062 U	0.054 U	0.061 U	0.059 U	0.050 U
Total PCBs	1.0	0.052 U	0.057 U	0.062 U	0.054 U	0.061 U	0.059 U	0.078

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-39	MW-39	MW-39	MW-39	MW-39	MW-40	MW-40
Depth (ft):	NYSDEC	2-4	4-6	6-8	12-14	20-22	2-4	12-14
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/08/00	11/08/00
Aroclor-1248	ns	0.051 U	0.051 U	0.059 U	0.058 U	0.059 U	0.05 U	0.063 U
Aroclor-1254	ns	0.17	0.051 U	0.059 U	0.058 U	0.059 U	0.05 U	0.063 U
Aroclor-1260	ns	0.051 U	0.051 U	0.059 U	0.058 U	0.059 U	0.05 U	0.063 U
Total PCBs	1.0	0.17	0.051 U	0.059 U	0.058 U	0.059 U	0.05 U	0.063 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-40	MW-41	MW-41	MW-41	MW-42	MW-42	MW-42
Depth (ft):	NYSDEC	18-20	0-2	2-4	8-10	0-2	2-4	4-6
Sample Date:	TAGM 4046	11/08/00	11/10/00	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00
Aroclor-1248	ns	0.061 U	0.054 U	0.055 U	0.061 U	0.049 U	0.049 U	0.052 U
Aroclor-1254	ns	0.061 U	0.054 U	0.055 U	0.061 U	0.049 U	0.049 U	0.052 U
Aroclor-1260	ns	0.061 U	0.054 U	0.055 U	0.061 U	0.049 U	0.049 U	0.052 U
Total PCBs	1.0	0.061 U	0.054 U	0.055 U	0.061 U	0.049 U	0.049 U	0.052 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-42	MW-42	MW-43	MW-46	MW-46	MW-47	MW-48
Depth (ft):	NYSDEC	8-10	14-16	20-22	12-14	22-24	14-14.9	12-14
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/14/00	5/23/01	5/23/01	5/21/01	5/22/01
Aroclor-1248	ns	0.055 U	0.059 U	0.31	0.046 U	0.23 U	0.048 U	0.045 U
Aroclor-1254	ns	0.055 U	0.059 U	0.062 U	0.024 J	3.8	0.048 U	0.045 U
Aroclor-1260	ns	0.055 U	0.059 U	0.062 U	0.046 U	0.23 U	0.048 U	0.045 U
Total PCBs	1.0	0.055 U	0.059 U	0.31	0.024	3.8	0.048 U	0.045 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-48DUP	TMW-1	TMW-3	TMW-3	TMW-4	TMW-5	TMW-5
Depth (ft):	NYSDEC	12-14	8-10	6-8	10-12	8-10	12-14	8-10
Sample Date:	TAGM 4046	5/22/01	11/16/00	11/09/00	11/09/00	11/15/00	11/16/00	11/16/00
Aroclor-1248	ns	0.044 U	0.065 U	0.061 U	0.056 U	3.1	0.059 U	0.06 U
Aroclor-1254	ns	0.044 U	0.065 U	0.061 U	0.056 U	0.11 U	0.059 U	0.06 U
Aroclor-1260	ns	0.044 U	0.065 U	0.061 U	0.056 U	2.6	0.059 U	0.06 U
Total PCBs	1.0	0.044 U	0.065 U	0.061 U	0.056 U	5.7	0.059 U	0.06 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.
See notes on Page 13.

Soil Boring Samples

Table 2c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date			
Source:		1	1	1	1
Sample ID:		TMW-6	TMW-6	TMW-6DUP	TMW-7
Depth (ft):	NYSDEC	10-12	12-14	12-14	10-12
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/13/00
Aroclor-1248	ns	0.063 U	0.061 U	0.062 U	0.054 U
Aroclor-1254	ns	0.25	0.073	0.066	0.054 U
Aroclor-1260	ns	0.17	0.061 U	0.084	0.054 U
Total PCBs	1.0	0.42	0.073	0.15	0.054 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

TAGM 4046 values for PCBs are 1.0 mg/kg for surface soils and 10 mg/kg for subsurface soils. The vast majority of sample results presented here are for subsurface soil samples; consequently, the recommended soil cleanup objective for subsurface soils is presented in the table.

Notes:

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

ns = Identifies all parameters that were analyzed with no known standard.

NA = Sample was not analyzed for this constituent.

Soil Boring Samples

Table 2d - Summary of Herbicide and Pesticide Results

Analyte	Sample Collection Designation					
	Source:	3	3	3	3	3
	Sample ID:	B2-1	B2-16	B3-1	B7-1	B10-13.5
	Depth (ft):	NYSDEC	1-2.5	16-16.5	1-3	13.5-14.5
	Sample Date:	TAGM 4046	5/14/97	5/14/97	5/13/97	5/14/97
beta-BHC	200	U	19.4	U	U	U
p,p-DDE	2,100	10.3	U	111	69	U
p,p-DDD	2,900	U	U	15.3	40	U
p,p-DDT	2,100	11.7	U	156	U	U
Endosulfan sulfate	1,000	U	U	U	U	281
technical Chlordane	540	U	U	U	549	U

All results reported in micrograms per kilogram (ug/kg), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

Soil Boring Samples
Table 2e - Summary of Total Petroleum Hydrocarbon (TPH) Results

Analyte		Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	2	
Sample ID:		NYSDEC	DB-17	DB-18	DB-19	DB-20	DB-21	DB-22	DB-23
Sample Date:		TAGM 4046	10-11/93	10-11/93	10-11/93	10-11/93	10-11/93	10-11/93	10-11/93
Total Petroleum Hydrocarbons		ns	62 U	68	23,000	14,000	60,000	68 U	54 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

See notes on page 2.

Soil Boring Samples

Table 2e - Summary of Total Petroleum Hydrocarbon (TPH) Results

Analyte		Sample Collection Designation & Collection Date			
Source:		2	2	2	
Sample ID:		NYSDEC	DB-24	P-2	P-3
Sample Date:		TAGM 4046	10-11/93	10-11/93	10-11/93
Total Petroleum Hydrocarbons		ns	1,300	220	1,100

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-17	MW-17	MW-18	MW-19	MW-20	MW-20	MW-21
Depth (ft):	NYSDEC	10-12	12-14	10-12	12-14	10-12	12-14	12-14
Sample Date:	TAGM 4046	11/23/99	11/23/99	11/17/99	11/29/99	11/18/99	11/18/99	11/23/99
Diesel Fuel	ns	1,800 JN	270 JN	11 U	12 U	970	1,900	45 U
Fuel Oil (#4)	ns	NA	NA	NA	NA	NA	NA	NA
Fuel Oil (#6)	ns	110 U	12 U	460	12 U	59 U	120 U	45 U
Kerosene	ns	NA	NA	NA	NA	NA	NA	NA
Lubricating Oil	ns	590 U	62 U	55 U	81 JN	310 U	610 U	470 JN

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-22	MW-23	MW-24	MW-24	MW-25	MW-26	MW-27
Depth (ft):	NYSDEC	10-12	12-14	12-14	18-20	12-14	12-14	12-14
Sample Date:	TAGM 4046	11/29/99	11/24/99	11/19/00	11/19/99	11/17/99	11/17/99	11/18/99
Diesel Fuel	ns	12 U	13 U	11 U	59 U	12 U	11 U	11 U
Fuel Oil (#4)	ns	NA	NA	NA	NA	NA	NA	NA
Fuel Oil (#6)	ns	12 U	13 U	11 U	59 U	29 JN	110 JN	11 U
Kerosene	ns	NA	NA	NA	NA	NA	NA	NA
Lubricating Oil	ns	62 U	68 U	58 U	2,200	60 U	59 U	57 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date							
Source:		2	2	2	2	2	2	1	
Sample ID:		MW-28	MW-28	MW-29	MW-30	MW-30	MW-31	MW-32	
Depth (ft):	NYSDEC	12-14	14-16	10-12	12-14	14-16	12-14	0-1	
Sample Date:	TAGM 4046	11/18/99	11/18/99	11/18/99	11/19/99	11/19/99	11/30/99	11/08/00	
Diesel Fuel	ns	12 U	170 JN	12 U	2,200 JN	84 JN	12 U	10 U	
Fuel Oil (#4)	ns	NA	NA	NA	NA	NA	NA	110	
Fuel Oil (#6)	ns	12 U	12 U	12 U	120 U	12 U	12 U	10 U	
Kerosene	ns	NA	NA	NA	NA	NA	NA	10 U	
Lubricating Oil	ns	62 U	63 U	65 U	640 U	60 U	64 U	52 U	

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-32	MW-32	MW-32	MW-33	MW-33	MW-33	MW-33
Depth (ft):	NYSDEC	1-3	3-5	9-11	0-2	2-4	4-6	10-12
Sample Date:	TAGM 4046	11/08/00	11/08/00	11/08/00	11/13/00	11/13/00	11/13/00	11/13/00
Diesel Fuel	ns	10 U	11 U	11 U	10 U	11 U	12 U	12 U
Fuel Oil (#4)	ns	92	11 U	630	10 U	11 U	12 U	12 U
Fuel Oil (#6)	ns	10 U	11 U	11 U	71	52	12 U	66
Kerosene	ns	11 U	12 U	12 U	11 U	12 U	12 U	12 U
Lubricating Oil	ns	53 U	120	59 U	11 U	12 U	12 U	12 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-34	MW-34	MW-34	MW-34	MW-34	MW-35	MW-35
Depth (ft):	NYSDEC	0-2	2-4	4-6	8-10	12-14	0-2	2-4
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/13/00	11/13/00
Diesel Fuel	ns	11 U	11 U	11 U	110 U	120 U	34 U	11 U
Fuel Oil (#4)	ns	11 U	11 U	11 U	2,400	3,500	34 U	11 U
Fuel Oil (#6)	ns	210	11 U	82	110 U	120 U	34 U	32
Kerosene	ns	11 U	11 U	11 U	120 U	130 U	36 U	12 U
Lubricating Oil	ns	11 U	11 U	11 U	120 U	120 U	690	12 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-35	MW-35	MW-35	MW-36	MW-36	MW-36	MW-36
Depth (ft):	NYSDEC	4-6	8-10	20-22	0-2	2-4	4-6	8-10
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/14/00	11/14/00	11/14/00	11/14/00
Diesel Fuel	ns	3,100	16,000	11 U	10 U	11 U	3,100	6,800
Fuel Oil (#4)	ns	60 U	590 U	11 U	10 U	11 U	100 U	110 U
Fuel Oil (#6)	ns	60 U	590 U	49	10 U	80 J	100 U	110 U
Kerosene	ns	63 U	620 U	12 U	11 U	11 U	110 U	120 U
Lubricating Oil	ns	62 U	610 U	12 U	430	11 U	100 U	120 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-36	MW-36A	MW-36A	MW-36A	MW-36A	MW-36A	MW-37
Depth (ft):	NYSDEC	20-22	0-2	2-4	4-6	8-10	10-12	2-4
Sample Date:	TAGM 4046	11/14/00	11/15/00	11/15/00	11/15/00	11/15/00	11/15/00	11/10/00
Diesel Fuel	ns	12	11 U	9.9 U	10 U	2,300	7,300	11 U
Fuel Oil (#4)	ns	10 U	11 U	9.9 U	10 U	56 U	110 U	11 U
Fuel Oil (#6)	ns	10 U	11 U	9.9 U	10 U	56 U	110 U	11 U
Kerosene	ns	10 U	26	10 U	11 U	58 U	120 U	11 U
Lubricating Oil	ns	10 U	200	560	11 U	58 U	120 U	11 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-37	MW-37	MW-38	MW-38	MW-38	MW-39	MW-39
Depth (ft):	NYSDEC	8-10	15-17	0-2	6-8	10-12	0-2	2-4
Sample Date:	TAGM 4046	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00
Diesel Fuel	ns	11 U	1,800	11 U	260 U	120 U	200 U	11 U
Fuel Oil (#4)	ns	11 U	35 U	11 U	16,000	5,300	200 U	11 U
Fuel Oil (#6)	ns	11 U	35 U	11 U	260 U	120 U	200 U	11 U
Kerosene	ns	11 U	36 U	12 U	270 U	130 U	210 U	11 U
Lubricating Oil	ns	11 U	36 U	160	270 U	120 U	5,900	880

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-39	MW-39	MW-39	MW-39	MW-40	MW-40	MW-40
Depth (ft):	NYSDEC	4-6	6-8	12-14	20-22	2-4	12-14	18-20
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/08/00	11/08/00	11/08/00
Diesel Fuel	ns	53 U	120 U	230 U	240 U	11 U	340	380
Fuel Oil (#4)	ns	53 U	6,100	9,900	10,000	11 U	13 U	13 U
Fuel Oil (#6)	ns	53 U	120 U	230 U	240 U	140	13 U	13 U
Kerosene	ns	56 U	130 U	250 U	260 U	11 U	14 U	13 U
Lubricating Oil	ns	3,200	120 U	240 U	250 U	55 U	68 U	66 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-41	MW-41	MW-41	MW-42	MW-42	MW-42	MW-42
Depth (ft):	NYSDEC	0-2	2-4	8-10	0-2	2-4	4-6	8-10
Sample Date:	TAGM 4046	11/10/00	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00
Diesel Fuel	ns	11 U	11 U	460	11 U	10 U	11 U	3,400
Fuel Oil (#4)	ns	11 U	11 U	12 U	11 U	10 U	11 U	110 U
Fuel Oil (#6)	ns	11 U	11 U	12 U	190	27	11 U	110 U
Kerosene	ns	12 U	12 U	13 U	11 U	11 U	11 U	120 U
Lubricating Oil	ns	12 U	12 U	13 U	11 U	11 U	11 U	120 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-42	TMW-1	TMW-3	TMW-3	TMW-4	TMW-5	TMW-5
Depth (ft):	NYSDEC	14-16	8-10	6-8	10-12	8-10	8-10	12-14
Sample Date:	TAGM 4046	11/09/00	11/16/00	11/09/00	11/09/00	11/15/00	11/16/00	11/16/00
Diesel Fuel	ns	2,800	12 U	12 U	240 U	31 U	11 U	1,300
Fuel Oil (#4)	ns	130 U	12 U	110	8,100	31 U	760	35 U
Fuel Oil (#6)	ns	130 U	12 U	12 U	240 U	31 U	11 U	35 U
Kerosene	ns	130 U	13 U	13 U	260 U	33 U	12 U	36 U
Lubricating Oil	ns	130 U	13 U	64 U	1,300 U	1,600	12 U	36 U

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

See notes on page 12.

Soil Boring Samples

Table 2f - Summary of Hydrocarbon Fingerprinting Results (NYS Method DOH 310-13/14)

Analyte		Sample Collection Designation & Collection Date			
Source:		1	1	1	1
Sample ID:		TMW-6	TMW-6	TMW-6DUP	TMW-7
Depth (ft):	NYSDEC	10-12	12-14	12-14	10-12
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/13/00
Diesel Fuel	ns	2,200	3,000 J	9,600 J	32 U
Fuel Oil (#4)	ns	36 U	61 U	240 U	32 U
Fuel Oil (#6)	ns	36 U	61 U	240 U	32 U
Kerosene	ns	38 U	64 U	250 U	34 U
Lubricating Oil	ns	37 U	64 U	250 U	1,800

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent.

Notes:

DUP = Duplicate sample

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

JN = The compound or analyte was tentatively identified and the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process.

ns = Identifies all parameters that were analyzed with no known standard.

NA = Sample was not analyzed for this constituent.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-17	MW-17	MW-18	MW-19	MW-20	MW-20	MW-21
Depth (ft):	NYSDEC	10-12	12-14	10-12	12-14	10-12	12-14	12-14
Sample Date:	TAGM 4046	11/23/99	11/23/99	11/17/99	11/29/99	11/18/99	11/18/99	11/23/99
Aluminum	SB	13,600	17,200	7,810 J	14,300 *	21,700	17,700	11,300
Antimony	SB	R	R	R	R	R	R	R
Arsenic	7.5 or SB	4 J	3.50 J	6.30 J	3.60	8.20 J	4.70 J	18 J
Barium	300 or SB	57.1 J	82.4 J	54.3	130	99.2 J	82.4 J	139 J
Beryllium	0.16 or SB	0.430	0.60	0.38 U	0.38 U	0.520	0.600	0.390
Cadmium	1 or SB	NA	NA	NA	NA	NA	NA	NA
Calcium	SB	1,520	23.5	2,630 J	2,450	1,630	2,050	9,490
Chromium	10 or SB	16.1 *	23 *	13.3 J	18.2	25.3 *	23.1 *	58.3 *
Cobalt	30 or SB	7.70 *	13.7 *	7 J	8.30	9.70 *	8.90 *	11.9 *
Copper	25 or SB	15.1 J	21.8 J	59.7 J	19.1	18.5 J	17 J	475 J
Iron	2,000 or SB	20,500 *	25,900 *	21,000	19,000 J	27,800 *	24,900 *	70,600 *
Lead	SB	9.80	15.8	123 J	R	16.1	14.5	622 *
Magnesium	SB	2,800 *	4,500 *	1,590 J	3,370 J	4,370 *	3,950 *	5,370 *
Manganese	SB	205 *	627 *	783 J	184 J	472 *	376 *	719 *
Mercury	0.1	0.0200	0.05	0.570	0.0700	0.0600	0.0600	0.02 U
Nickel	13 or SB	16.8 J	31.5 J	16 J	19	23.4 J	21.9 J	40.1 J
Potassium	SB	2,660 J	2,890 J	1,040	2,830 *	4,100 J	3,240 J	2,410 J
Selenium	2 or SB	0.310 UJ	0.350 UJ	1.40 J	0.330 UJ	0.350 UJ	0.330 UJ	0.92 J
Silver	SB	NA	NA	NA	NA	NA	NA	NA
Sodium	SB	283 J	359 J	178	304 J	145 J	118 J	286 J
Vanadium	150 or SB	30.4 J	30.8 J	20.6 J	29.4	39.3 J	34.7 J	38.1 J
Zinc	20 or SB	50.5 J	75.8 J	79.7 J	R	64.3 J	57.8 J	125 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	2
Sample ID:		MW-22	MW-23	MW-24	MW-24	MW-25	MW-26	MW-27
Depth (ft):	NYSDEC	10-12	12-14	12-14	18-20	12-14	12-14	12-14
Sample Date:	TAGM 4046	11/29/99	11/24/99	11/19/00	11/19/99	11/17/99	11/17/99	11/18/99
Aluminum	SB	14,000 *	19,600	5,010 J	6,220 J	5,530 J J	7,550 J	5,860 J
Antimony	SB	R	R	R	R	R	R	R
Arsenic	7.5 or SB	7.2 J	6.5 J	25.8 J	3.3 J	20.7 J	3.2 J	10.4 J
Barium	300 or SB	92.4	128 J	30.9	9.10	101	44	28.3
Beryllium	0.16 or SB	0.38 U	0.570	0.38 U	0.38 U	0.39 U	0.5 U	0.35 U
Cadmium	1 or SB	NA	NA	NA	NA	NA	NA	NA
Calcium	SB	48,100	12,100	1,110 J	3,160 J	12,800 J	6,740 J	1,250 J
Chromium	10 or SB	20	26.3 *	31.3 J	13.6 J	15.8 J	15 J	9.6 J
Cobalt	30 or SB	8.10	9.20 *	8.60 J	3.8 J	7.2 J	9 J	6.6 J
Copper	25 or SB	28.5	43.9 J	162 J	132 J	74 J	24.3 J	16,200 J
Iron	2,000 or SB	22,300 J	26,000 *	82,900	89,900	18,000	19,600	26,200
Lead	SB	R	129 *	66.7 J	57.7 J	47.9 J	38.6 J	464 J
Magnesium	SB	7,650 J	6,860 *	R	R	5,650 J	4,820 J	R
Manganese	SB	353 J J	514 *	253 J	682 J	83.9 J	284 J	195 J
Mercury	0.1	0.310	0.120	0.0800	0.0600	0.0700	0.200	0.110
Nickel	13 or SB	21	26.6 J	22.4 J	15 J	21.7 J	22.2 J	17.4 J
Potassium	SB	3,760 *	4,930 J	772	467	1,050	1,260	582
Selenium	2 or SB	0.340 UJ	0.350 UJ	0.51 J	0.340 UJ	0.350 UJ	0.450 UJ	1.3 J
Silver	SB	NA	NA	NA	NA	NA	NA	NA
Sodium	SB	167	197 J	131	96.9	173	116	100
Vanadium	150 or SB	26.9	37.4 J	51.7 J	26.6 J	20.2 J	18.7 J	18.9 J
Zinc	20 or SB	R	81.6 J	67.7 J	32.2 J	63.1 J	94.7 J	403 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		2	2	2	2	2	2	1
Sample ID:		MW-28	MW-28	MW-29	MW-30	MW-30	MW-31	MW-32
Depth (ft):	NYSDEC	12-14	14-16	10-12	12-14	14-16	12-14	0-1
Sample Date:	TAGM 4046	11/18/99	11/18/99	11/18/99	11/19/99	11/19/99	11/30/99	11/08/00
Aluminum	SB	10,800 J	8,020 J	14,800	15,700 J	16,800 J	21,100 *	4710
Antimony	SB	R	R	R	R	R	R	4.2
Arsenic	7.5 or SB	4.8 J	3 J	3.8 J	5 J	6.9 J	7	11
Barium	300 or SB	69.7	49.1	80.3 J	61.4	96.8	114	66
Beryllium	0.16 or SB	0.36 U	0.36 U	0.520	0.39 U	0.36 U	0.510	0.340 U
Cadmium	1 or SB	NA	NA	NA	NA	NA	NA	0.630 J
Calcium	SB	2,400 J	1,410 J	2,310	2,050 J	3,030 J	2,290	99,700
Chromium	10 or SB	18.2 J	12 J	20.8 *	17.9 J	24.4 J	25.3	30.0 J
Cobalt	30 or SB	11.7 J	7.4 J	8.90 *	10.3 J	10.3 J	11.7	7.8
Copper	25 or SB	15 J	11.1 J	14.7 J	27.4 J	47.2 J	25.1	118
Iron	2,000 or SB	23,900	17,800	22,600 *	25,100	30,700	30,000 J	38,700
Lead	SB	11.6 J	10.6 J	8.40	12.7 J	55.4 J	R	260 J
Magnesium	SB	3670 J	2,640 J	3,530 *	R	R	4,570 J	34,700 J
Manganese	SB	599 J	362 J	515 *	227 J	401 J	754 J	281 J
Mercury	0.1	0.0500	0.0300	0.0400	0.0700	0.0700	0.0500	0.5
Nickel	13 or SB	25.9 J	18.8 J	20.9 J	24.5 J	25.7 J	25.9	46 J
Potassium	SB	1,920	1,190	3,300 J	1,950	2,990	4,510 *	1,620 J
Selenium	2 or SB	0.320 UJ	0.320 UJ	0.350 UJ	0.350 UJ	0.320 UJ	0.360 UJ	NA
Silver	SB	NA	NA	NA	NA	NA	NA	0.470 U
Sodium	SB	94.8	59.8	486 J	157	230	198 J	223 J
Vanadium	150 or SB	25 J	18.9 J	31.4 J	25.8 J	33.4 J	39.9	27
Zinc	20 or SB	88.9 J	56.3 J	63.5 J	64.4 J	80.2 J	R	74 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-32	MW-32	MW-32	MW-33	MW-33	MW-33	MW-33
Depth (ft):	NYSDEC	1-3	3-5	9-11	0-2	2-4	4-6	10-12
Sample Date:	TAGM 4046	11/08/00	11/08/00	11/08/00	11/13/00	11/13/00	11/13/00	11/13/00
Aluminum	SB	3,260	2,780	2,020	6,350	6,440	10,800	9,770
Antimony	SB	4.3	3	2.90 U	2.89 UJ	2.92 UJ	2.92 UJ	2.53 UJ
Arsenic	7.5 or SB	11	26	11	5.15 U	10.1	5.51	8.39
Barium	300 or SB	79	53	47	58.4	68.9	66.1	75.3
Beryllium	0.16 or SB	0.340 U	0.330 U	0.350 U	0.350 U	0.53	0.583	0.552
Cadmium	1 or SB	0.700 J	0.510 J	0.430 U	0.433 UJ	1.8 J	0.438 UJ	0.379 UJ
Calcium	SB	73,600	3,780	4,530	38,900	74,700	27,900	6,000
Chromium	10 or SB	54 J	403 J	25 J	22.2	16.7	16	15.8
Cobalt	30 or SB	11	15	8.4	3.38	5.35	6.46	7.58
Copper	25 or SB	273	420	103	38.3	179	58.8	61.1
Iron	2,000 or SB	66,300	138,000	28,800	14,900	35,700	20,500	21,300
Lead	SB	297 J	138 J	62 J	59.7	125	86.9	595
Magnesium	SB	22,600 J	940 J	1,480 J	16,000	31,100	11,800	2,520
Manganese	SB	399 J	352 J	192 J	199	326	275	177
Mercury	0.1	0.39	0.28	0.16	0.502	0.67	0.321	0.567
Nickel	13 or SB	100 J	80 J	50 J	18.3 J	24.7 J	16.6 J	15 J
Potassium	SB	643 J	470 J	316 J	1,710 J	1,750 J	2,800 J	1,880 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.98	0.450 U	0.51	0.484 U	0.491 U	0.49 U	0.424 U
Sodium	SB	276 J	166 J	163 J	115 J	170 J	158 J	158 J
Vanadium	150 or SB	27	105	11	19.7	19.8	24.4	28.3
Zinc	20 or SB	103 J	34 J	46 J	1,780 J	1,340 J	206 J	185 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-34	MW-34	MW-34	MW-34	MW-34	MW-35	MW-35
Depth (ft):	NYSDEC	0-2	2-4	4-6	8-10	12-14	0-2	2-4
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00	11/13/00	11/13/00
Aluminum	SB	8,340	5,630	6,970	7,920	9,430	7,180	4,880
Antimony	SB	2.93 UJ	2.92 UJ	2.69 UJ	3.05 UJ	3.34 UJ	3.02 UJ	2.89 UJ
Arsenic	7.5 or SB	5.23 U	5.21 U	4.80 U	5.44 U	5.96 U	29.5	23.7
Barium	300 or SB	42.3	20.2	26.9	30.2	41.5	84	67.9
Beryllium	0.16 or SB	0.452	0.354 U	0.451	0.39	0.466	0.367 U	0.738
Cadmium	1 or SB	0.439 UJ	0.438 UJ	0.403 UJ	0.457 UJ	0.500 UJ	0.706 J	0.434 UJ
Calcium	SB	14,300	24,200	23,500	30,100	16,000	88,000	19,100
Chromium	10 or SB	17.4 J	19.1 J	10.6 J	11.7 J	11.6 J	174	92.2
Cobalt	30 or SB	5.12	2.96	3.08	3.43	5.19	10.8	12.8
Copper	25 or SB	46.7 J	8.59 J	12.8 J	22.7 J	14.2 J	203	80.5
Iron	2,000 or SB	18,300 J	9,770 J	10,600 J	11,300 J	13,900 J	73,000	45,300
Lead	SB	55.1	5.21 U	8.04	13.2	11.5	104	33.8
Magnesium	SB	5,150	2,200	3,020	4,120	3,780	20,400	2,920
Manganese	SB	251 J	202 J	194 J	180 J	230 J	587	353
Mercury	0.1	0.398	0.0207 U	0.0441	0.0458	0.0395	0.0527	0.0403
Nickel	13 or SB	15.8	12.6	8.69	10.2	11.7	93.4 J	30 J
Potassium	SB	1,330 J	1,380 J	1,890 J	1,590 J	2,360 J	2,020 J	726 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.492 UJ	0.490 UJ	0.451 UJ	0.511 UJ	0.560 UJ	0.507 U	0.485 U
Sodium	SB	112 J	64.3 J	92.3 J	92.4 J	108 J	427 J	249 J
Vanadium	150 or SB	33.7 J	12.6 J	19.8 J	26.6 J	22.4 J	41.3	32
Zinc	20 or SB	61.4 J	21.5 J	24.9 J	28.6 J	37.1 J	87.1 J	27.7 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-35	MW-35	MW-35	MW-36	MW-36	MW-36	MW-36
Depth (ft):	NYSDEC	4-6	8-10	20-22	0-2	2-4	4-6	8-10
Sample Date:	TAGM 4046	11/13/00	11/13/00	11/13/00	11/14/00	11/14/00	11/14/00	11/14/00
Aluminum	SB	3,940	6,220	7,050	14,100	9,930	9,280	7,560
Antimony	SB	3.64	4.24 J	3.23 UJ	2.83 UJ	2.92 UJ	2.83 UJ	3.12 UJ
Arsenic	7.5 or SB	26.7	56.7	30.5	5.05 U	9.02	5.05 U	5.57 U
Barium	300 or SB	41.7	51.1	101	87.5	60.2	39.1	25.9
Beryllium	0.16 or SB	0.411 U	0.345 U	1.02	0.582	0.687	0.418	0.413
Cadmium	1 or SB	1.02 J	0.879 J	0.491 J	0.889	0.451	0.424 U	0.468 U
Calcium	SB	34,600	43,000	17,600	49,300	12,000	23,100	23,400
Chromium	10 or SB	137	131	113	27.8 J	25.2 J	9.82 J	7.83 J
Cobalt	30 or SB	16.7	19.9	15.8	6.59	8.15	3.53	4.61
Copper	25 or SB	693	709	95.0	25.9 J	114 J	8.5 J	10.8 J
Iron	2,000 or SB	122,000	134,000	50,900	21,400	32,300	11,000	13,500
Lead	SB	609	248	38.2	21.4 J	93.7 J	5.05 UJ	5.57 UJ
Magnesium	SB	6,150	8,130	3,680	19,000	4,550	2,450	2,920
Manganese	SB	856	571	284	380	447	283	253
Mercury	0.1	0.12	0.129	0.0351	0.106	0.177	0.0185 U	0.0209 U
Nickel	13 or SB	49.1 J	55.8 J	37.0 J	18.5 J	19.7 J	7.84 J	10.9 J
Potassium	SB	776 J	1,430 J	1,370 J	4,360	1,960	2,920	1,640
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.568 U	0.651	0.543 U	0.475 U	0.49 U	0.475 U	0.523 U
Sodium	SB	486 J	285 J	378 J	415 J	333 J	263 J	190 J
Vanadium	150 or SB	96.8	45.8	38.9	31.9 J	29.1 J	19.6 J	15.6 J
Zinc	20 or SB	174 J	129 J	37.2 J	57.4 J	44.3 J	23.3 J	30.8 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-36	MW-36A	MW-36A	MW-36A	MW-36A	MW-36A	MW-37
Depth (ft):	NYSDEC	20-22	0-2	2-4	4-6	8-10	10-12	2-4
Sample Date:	TAGM 4046	11/14/00	11/15/00	11/15/00	11/15/00	11/15/00	11/15/00	11/10/00
Aluminum	SB	21,600	7,640	6,400	4,270	4,650	3,860	8,170
Antimony	SB	2.9 UJ	7.06 J	2.82 UJ	2.88 UJ	3.08 UJ	3.15 UJ	2.56 UJ
Arsenic	7.5 or SB	5.18 U	18.9	5.03 U	5.14 U	5.50 U	5.63 U	4.58 U
Barium	300 or SB	132	71.2	34.5	23.2	15.1	14.6	31.4
Beryllium	0.16 or SB	0.802	0.727	0.391	0.35 U	0.374 U	0.383 U	0.342
Cadmium	1 or SB	0.937	0.443 U	0.423 U	0.432 U	0.462 U	0.473 U	0.384 UJ
Calcium	SB	38,600	8,300	32,400	33,700	14,100	33,900	22,600
Chromium	10 or SB	33.2 J	43.7 J	12.7 J	14.1 J	156 J	5.21 J	8.64
Cobalt	30 or SB	7.97	8.05	4.15	3.18	3.54	3.45	3.34
Copper	25 or SB	27.3 J	463 J	13.7 J	14.1 J	9.77 J	7.58 J	14.0
Iron	2,000 or SB	24,300	40,400	12,400	10,000	9,570	11,600	11,300
Lead	SB	15.4 J	250 J	9.34 J	16.7 J	5.50 U	5.63 U	11.8
Magnesium	SB	15,600	3,450	8,100	4,790	1,950	2,280	2,350
Manganese	SB	473	301	247	214	94.4	662	184
Mercury	0.1	0.0611	0.658	0.0411	0.0304	0.0265	0.0223 U	0.0762
Nickel	13 or SB	19.6 J	21 J	10.4 J	7.83 J	7.96 J	7.59 J	7.8 J
Potassium	SB	8,160	1,540	1,640	788	848	677	1,660 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.487 U	0.496 U	0.473 U	0.483 U	0.517 U	0.529 U	0.430 U
Sodium	SB	550 J	142 J	159 J	91.3 J	208 J	256 J	103 J
Vanadium	150 or SB	44.9 J	22.6 J	23.9 J	11.8 J	12.4 J	10.5 J	17.4
Zinc	20 or SB	67 J	73.8 J	31.6 J	38.6 J	23.6 J	21.3 J	44.5 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-37	MW-37	MW-38	MW-38	MW-38	MW-39	MW-39
Depth (ft):	NYSDEC	8-10	15-17	0-2	6-8	10-12	0-2	2-4
Sample Date:	TAGM 4046	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00	11/09/00
Aluminum	SB	9,710	18,700	6,950	12,900	5,190	3,730	5,530
Antimony	SB	2.70 UJ	3.18 UJ	2.92 UJ	3.33 UJ	2.72 UJ	2.05 UJ	3.07 UJ
Arsenic	7.5 or SB	4.83 U	5.67 U	5.22 U	6.33	4.85 U	8.08	5.49 U
Barium	300 or SB	44.6	102	66.9	60.9	19.5	45.5	33.5
Beryllium	0.16 or SB	0.375	0.667	0.355 U	0.886	0.361	0.337	0.46
Cadmium	1 or SB	0.406 UJ	0.476 UJ	0.439 UJ	0.673 J	0.407 UJ	0.308 UJ	0.461 UJ
Calcium	SB	44,900	8,670	3,610	6,110	16,000	131,000	46,200
Chromium	10 or SB	9.2	21	11.0 J	17.5 J	6.56 J	12.4 J	10.8 J
Cobalt	30 or SB	3.57	8.07	3.8	17	3.65	3	4.22
Copper	25 or SB	8.76	12.4	24.6 J	84.1 J	10.8 J	21.2 J	27.9 J
Iron	2,000 or SB	11,400	21,000	15,600 J	13,700 J	9,300 J	9,380 J	14,200 J
Lead	SB	6.06	11	11.3	24.3	4.85 U	23.2	42.5
Magnesium	SB	3,360	5,340	1,810	2,190	2,120	57,400	13,800
Manganese	SB	290	391	180 J	124 J	146 J	264 J	192 J
Mercury	0.1	0.0346	0.0304	0.0579	0.0695	0.0288	0.0807	0.296
Nickel	13 or SB	7.81 J	17.7 J	8.54	43.3	9.59	10.7	10.1
Potassium	SB	2640 J	4,980 J	1,210 J	1,880 J	1,290 J	1,680 J	1,550 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.454 U	0.533 U	1.42 J	1.22 J	0.456 UJ	0.345 UJ	0.516 UJ
Sodium	SB	838 J	2,160 J	163 J	243 J	126 J	128 J	120 J
Vanadium	150 or SB	20.6	36.9	17.5 J	25.5 J	13.1 J	35.4 J	19.6 J
Zinc	20 or SB	27.4 J	48.4 J	35.2 J	119 J	26 J	29 J	27.5 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-39	MW-39	MW-39	MW-39	MW-40	MW-40	MW-40
Depth (ft):	NYSDEC	4-6	6-8	12-14	20-22	2-4	12-14	18-20
Sample Date:	TAGM 4046	11/09/00	11/09/00	11/09/00	11/09/00	11/08/00	11/08/00	11/08/00
Aluminum	SB	4,850	4,980	6,160	12,500	7,400	17,800	11,100
Antimony	SB	2.9 UJ	2.93 UJ	3.36 UJ	3.16 UJ	3.1 U	3 U	2.80 U
Arsenic	7.5 or SB	5.18 U	5.22 U	5.99 U	5.65 U	7.5	7.2	5.00 U
Barium	300 or SB	17.3	18.7	28.3	68.0	43	115	59
Beryllium	0.16 or SB	0.352 U	0.355 U	0.407 U	0.528	0.37 U	0.92	0.52
Cadmium	1 or SB	0.435 UJ	0.439 UJ	0.503 UJ	0.474 UJ	0.46 U	0.520 J	0.42 U
Calcium	SB	16,700	30,400	26,300	8,530	28,300	3,320	1,600
Chromium	10 or SB	6.26 J	6.24 J	8.72 J	15.3 J	15 J	27.0 J	14 J
Cobalt	30 or SB	2.57	2.62	3.29	6.88	6.2	12	8.9
Copper	25 or SB	5.06 J	5.98 J	10.3 J	12.8 J	82.0	58.0	13.0
Iron	2,000 or SB	9,050 J	10,700 J	10,800 J	18,700 J	34,800	45,500	19,300
Lead	SB	5.18 U	5.22 U	10.2	8.61	202 J	38 J	8.9 J
Magnesium	SB	3,120	3,880	3,260	4,590	5,230 J	4,260 J	2,950 J
Manganese	SB	108 J	129 J	168 J	360 J	335 J	450 J	289 J
Mercury	0.1	0.0232 U	0.0247 U	0.0302	0.0257	0.1	0.15	0.025
Nickel	13 or SB	5.32	5.4	7.2	16.1	15 J	27.0 J	19 J
Potassium	SB	1,040 J	1,070 J	1,590 J	2,690 J	1,540 J	3,980 J	1,750 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.487 UJ	0.491 UJ	0.563 UJ	0.531 UJ	0.57	0.51 U	0.47 U
Sodium	SB	86 J	79.8 J	101 J	106 J	231 J	263 J	106 J
Vanadium	150 or SB	13.2 J	17.3 J	19 J	27.9 J	20.0	41.0	24.0
Zinc	20 or SB	16.2 J	17.9 J	22 J	43.3 J	59 J	68.0 J	44 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-41	MW-41	MW-41	MW-42	MW-42	MW-42	MW-42
Depth (ft):	NYSDEC	0-2	2-4	8-10	0-2	2-4	4-6	8-10
Sample Date:	TAGM 4046	11/10/00	11/10/00	11/10/00	11/09/00	11/09/00	11/09/00	11/09/00
Aluminum	SB	9,860	5,710	10,000	9,260	5,390	8,500	10,800
Antimony	SB	4.81 J	3.08 UJ	3.20 UJ	2.86 UJ	2.62 UJ	2.71 UJ	2.88 UJ
Arsenic	7.5 or SB	32.4	16.8	10.4	6.28	4.68 U	4.84 U	5.14 U
Barium	300 or SB	8,320	1,140	133	52.8	25.0	32.8	44.0
Beryllium	0.16 or SB	1.24	0.798	0.389 U	0.569	0.346	0.421	0.421
Cadmium	1 or SB	0.616 J	0.763 J	0.481 UJ	0.43 UJ	0.393 UJ	0.407 UJ	0.432 UJ
Calcium	SB	20,600	18,200	3,610	71,500	58,200	29,900	34,000
Chromium	10 or SB	117	29.9	18.4	15.7 J	6.62 J	9.65 J	10.7 J
Cobalt	30 or SB	13.7	10.5	10.3	5	2.82	4.2	4.08
Copper	25 or SB	134	44.4	138	32 J	9.62 J	11.1 J	10.4 J
Iron	2,000 or SB	102,000	54,000	90,800	29,000 J	10,000 J	12,800 J	12,500 J
Lead	SB	143	50.7	91.3	29.6	9.42	9.67	8.18
Magnesium	SB	9,250	8,200	1,980	19,000	16,400	3,240	3,450
Manganese	SB	543	141	206	283 J	205 J	248 J	291 J
Mercury	0.1	0.585	0.208	0.233	0.164	0.161	0.0505	0.0263
Nickel	13 or SB	108 J	39.1 J	34.3 J	46.6	7.56	9.23	11.1
Potassium	SB	2,230 J	1,210 J	1,790 J	2,980 J	1,250 J	2,210 J	2,710 J
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.463 U	0.517 U	0.538 U	0.481 UJ	0.440 UJ	0.455 UJ	0.483 UJ
Sodium	SB	237 J	167 J	139 J	156 J	92.2 J	91.8 J	136 J
Vanadium	150 or SB	41.1	21.7	29.1	26.4 J	12.1 J	21.4 J	23.2 J
Zinc	20 or SB	98.9 J	33.2 J	67 J	48.6 J	25.9 J	67.1 J	28.7 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent
See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date						
Source:		1	1	1	1	1	1	1
Sample ID:		MW-42	MW-43	TMW-1	TMW-3	TMW-3	TMW-3	TMW-4
Depth (ft):	NYSDEC	14-16	20-22	8-10	6-8	10-12	12-14	8-10
Sample Date:	TAGM 4046	11/09/00	11/14/00	11/16/00	11/09/00	11/09/00	11/09/00	11/15/00
Aluminum	SB	24,000	17,400	9,380	25,100	12,000	20,700	22,800
Antimony	SB	2.63 UJ	2.71 UJ	2.88 UJ	3.44 UJ	3.42 UJ	2.03 U	2.50 UJ
Arsenic	7.5 or SB	4.69 U	4.85 U	5.5	6.14 U	6.1 U	3.63 U	4.46 U
Barium	300 or SB	129	102	96.3	132	60.6	107	146
Beryllium	0.16 or SB	0.939	0.824	0.639	0.987	0.76	0.868	1.1
Cadmium	1 or SB	0.394 UJ	0.407 U	0.432 U	0.516 UJ	0.512 UJ	0.305 U	0.374 U
Calcium	SB	9,740	3,290	4,670	9,520	4,570	2,630	4,730
Chromium	10 or SB	25.6 J	20.7 J	16.1 J	26.1 J	21.6 J	22.2	25.9 J
Cobalt	30 or SB	9.41	8.93	7.78	9.28	16.9	9.58	12.8
Copper	25 or SB	16.4 J	16.4 J	64.2 J	18.3 J	40.9 J	16.6	25 J
Iron	2,000 or SB	23,300 J	22,000	22,800	22,500 J	42,000 J	21,900	33,600
Lead	SB	11.8	10.7 J	80.2 J	16.2	35.4	10.2	22.8 J
Magnesium	SB	6,340	4,650	1,520	5,230	2,370	4,240	5,640
Manganese	SB	564 J	239	295	592 J	222 J	379	978
Mercury	0.1	0.0350	0.0358	0.393	0.0719	0.0794	0.0359	0.0653
Nickel	13 or SB	21.2	20.7 J	15.2 J	20.6	26.3	19.9	22.8 J
Potassium	SB	7,070 J	4,330	1,860	7,590 J	2,730 J	5,730	6,480
Selenium	2 or SB	NA	NA	NA	NA	NA	NA	NA
Silver	SB	0.441 UJ	0.456 U	0.483 U	0.577 UJ	0.573 UJ	0.342 U	0.419 U
Sodium	SB	256 J	218 J	1060 J	319 J	237 J	196	206 J
Vanadium	150 or SB	44.1 J	37 J	25.7 J	46 J	32.2 J	39.5	47.1 J
Zinc	20 or SB	58.7 J	59.5 J	55.9 J	3.18 UJ	35.3 J	56.4	71 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

See notes on page 12.

Soil Boring Samples

Table 2g - Summary of Inorganic Results (EPA Method 6000/7000)

Analyte		Sample Collection Designation & Collection Date	
Source:		1	1
Sample ID:		TMW-5	TMW-5
Depth (ft):	NYSDEC	8-10	12-14
Sample Date:	TAGM 4046	11/16/00	11/16/00
Aluminum	SB	24,900	21,900
Antimony	SB	2.84 UJ	2.55 UJ
Arsenic	7.5 or SB	5.17	6.04
Barium	300 or SB	151	114
Beryllium	0.16 or SB	0.982	0.999
Cadmium	1 or SB	0.426 U	0.383 U
Calcium	SB	2,320	1,970
Chromium	10 or SB	29.4 J	24.7 J
Cobalt	30 or SB	11	12
Copper	25 or SB	26.5 J	19.3 J
Iron	2,000 or SB	24,800	28,500
Lead	SB	65.5 J	12.9 J
Magnesium	SB	4,230	4,470
Manganese	SB	373	318
Mercury	0.1	0.699	0.0512
Nickel	13 or SB	22.4 J	25.2 J
Potassium	SB	6,860	5,690
Selenium	2 or SB	NA	NA
Silver	SB	0.476 U	0.428 U
Sodium	SB	244 J	170 J
Vanadium	150 or SB	46.9 J	45.7 J
Zinc	20 or SB	98.9 J	66.1 J

All results reported in milligrams per kilogram (mg/kg), or parts per million (ppm)

Results in bold indicate results which exceed NYSDEC TAGM #4046 recommended soil cleanup objective for a given constituent

Notes:

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the PQL, or MDL.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process. The data should not be used for any qualitative or quantitative purposes.

NA = Sample was not analyzed for this constituent.

* = Laboratory duplicate analysis was outside control limits.

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL)

S = The reported value was determined by the Method of Standard Additions.

B = Indicates an estimated value between the instrument detection limit and the CLP-required detection limit

SB = site background

Data in this workbook is taken from the following sources:

- 1 Blasland, Bouck & Lee, Inc. , February 2002, Draft Site Investigation Summary Report.
- 2 Blasland, Bouck & Lee, Inc., July 2000, Site Investigation Work Plan.
- 3 ABB Environmental Services, Inc., September 1997, Investigation Program Report Subsurface Investigation Proposed EVI Facility.
- 4 Dames & Moore, May 1993, Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent File No. R4-1338-92-05, Job #24707-001-017.

Note:

The source of the data is identified in the source row for each sample.

NYSDEC TAGM #4046 values are taken from New York State Department of Environmental Conservation Division of Environmental Remediation Guidance Document, Technical and Administrative Guidance Memorandum #4046, Determination of Soil Cleanup Objectives and Cleanup Levels, Appendix A Recommended Soil Cleanup Objectives, January 24, 1994.

As per the TAGM, total VOCs must be less than 10 mg/kg, total SVOCs must be less than 500 mg/kg and individual SVOCs must be less than 50 mg/kg.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date							
	Source:	NYSDEC	1	1	1	2	2	2
	Sample ID:	TOGS 1.1.1	DP-BG1	DP-BG1	DP-BG1	EVIMW-1	EVIMW-2	EVIMW-6
	Sample Date:	Class GA	5/31/01	5/31/01	6/5/01	12/8/99	12/8/99	12/8/99
1,1,1-Trichloroethane	5	1 U	1 U	1 U	5 U	NA	NA	NA
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA
1,1-Dichloroethane	5	1 U	1 U	1 U	5 U	10 U	10 U	10 U
1,1-Dichloroethene	5	1 U	1 U	1 U	5 U	10 U	10 U	10 U
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA
1,2-Dichloroethene (total)	5	3.2	5.1	16	10 U	10 U	10 U	10 U
2-Butanone	50	20 U	20 U	10 U	NA	NA	NA	NA
2-Hexanone	50	NA	NA	NA	10 U	10 U	10 U	10 U
Acetone	50	10 J	12 J	9.9 J	10 U	10 U	10 U	10 U
Benzene	1	NA	NA	NA	10 U	10 U	10 U	10 U
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA
Chloroform	7	NA	NA	NA	10 U	10 U	10 U	10 U
Chloromethane	5	1 U	1 U	5 U	10 U	10 U	10 U	10 U
cis-1,2-Dichloroethene	5	NA	NA	NA	10 U	10 U	10 U	10 U
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA
Ethylbenzene	5	NA	NA	NA	10 U	10 U	10 U	10 U
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA
meta and or para-Xylene	5	NA	NA	NA	10 U	10 U	10 U	10 U
Naphthalene	10	NA	NA	NA	NA	NA	NA	NA
Methylene Chloride	5	1 U	1 U	5 U	10 U	10 U	10 U	10 U
ortho-Xylene	5	NA	NA	NA	10 U	10 U	10 U	10 U
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA
Styrene	5	NA	NA	NA	10 U	10 U	10 U	10 U
Tetrachloroethene	5	4.4	7	14	10 U	10 U	10 U	10 U
Toluene	5	0.58 J	0.61 J	5 U	10 U	10 U	10 U	10 U
trans-1,2-Dichloroethene	5	NA	NA	NA	10 U	10 U	10 U	10 U
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA
Trichloroethene	5	1	1.4	2.9 J	10 U	10 U	10 U	10 U
Vinyl Chloride	2	2.2	3.9	45 D	10 U	10 U	10 U	10 U
Xylenes (total)	5	1 U	0.99 J	10 U	10 U	10 U	10 U	10 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
	Source:	NYSDEC	3	3	3	2	3	4	2
	Sample ID:	TOGS 1.1.1	FB	MW-1	MW-2	MW-2	MW-3	MW-3	MW-3
	Sample Date:	Class GA	9/2/1992	9/2/1992	9/2/1992	11/29/99	9/2/1992	5/5/1994	11/29/99
1,1,1-Trichloroethane	5		1 U	20 U	2 U	NA	2 U	NA	NA
1,1,2,2-Tetrachloroethane	5		1 U	20 U	12	NA	2 U	NA	NA
1,1-Dichloroethane	5		NA	NA	NA	10 U	NA	NA	10 U
1,1-Dichloroethene	5		1 U	20 U	2 U	10 U	2 U	NA	10 U
1,2,4-Trimethylbenzene	5		0.8 J	9.7 J	2 U	NA	2 U	NA	NA
1,3,5-Trimethylbenzene	5		0.1 J	8 J	0.2 JB	NA	0.3 J	NA	NA
1,3-Dichlorobenzene	3		1 U	20 U	2 U	NA	2 U	NA	NA
1,4-Dichlorobenzene	3		1 U	20 U	2 U	NA	2 U	NA	NA
1,2-Dichloroethene (total)	5		NA	NA	NA	10 U	NA	NA	10 U
2-Butanone	50		NA	NA	NA	NA	NA	NA	NA
2-Hexanone	50		NA	NA	NA	10 U	NA	NA	10 U
Acetone	50		NA	NA	NA	10 U	NA	NA	10 U
Benzene	1		0.3 J	1.9 J	2 U	10 U	2 U	NA	10 U
Bromodichloromethane	50		0.6 J	20 U	2 U	NA	2 U	NA	NA
Butylbenzene	5		1 U	20 U	2 U	NA	2 U	NA	NA
Chlorobenzene	5		1 U	20 U	2 U	NA	2 U	NA	NA
Chloroform	7		2.4	20 U	2 U	10 U	2 U	NA	10 U
Chloromethane	5		1 U	20 U	2 U	10 U	0.4 J	NA	10 U
cis-1,2-Dichloroethene	5		NA	NA	NA	10 U	NA	NA	10 U
Dibromochloromethane	50		0.4 J	20 U	2 U	NA	2 U	NA	NA
Ethylbenzene	5		0.1 J	20 U	2 U	10 U	2 U	NA	10 U
Inert-Butylbenzene	ns		1 U	18 J	1.6 J	NA	1.9 J	NA	NA
Isopropylbenzene	5		1 U	18 J	10	NA	13	NA	NA
meta and or para-Xylene	5		0.5 JB	20 U	0.3 JB	10 U	0.3 JB	NA	10 U
Naphthalene	10		1 U	140	2 U	NA	2 U	NA	NA
Methylene Chloride	5		NA	NA	NA	10 U	NA	NA	10 U
ortho-Xylene	5		0.2 J	20 U	0.3 JB	10 U	0.7 J	NA	10 U
p-Isopropyltoluene	5		1 U	47 B	5.8 B	NA	6.3 B	NA	NA
Propylbenzene	5		1 U	16 JB	1.1 JB	NA	2 U	NA	NA
sec-Butylbenzene	5		1 U	85	6.8	NA	7.3	NA	NA
Styrene	5		1 U	20 U	2 U	10 U	2 U	NA	10 U
Tetrachloroethene	5		1 U	20 U	2 U	10 U	2 U	NA	10 U
Toluene	5		1.2	2.7 J	2 U	10 U	0.3 J	NA	10 U
trans-1,2-Dichloroethene	5		1 U	20 U	2 U	10 U	2 U	NA	10 U
Trichlorofluoromethane	5		1 U	20 U	2 U	NA	2 U	NA	NA
Trichloroethene	5		1 U	3.3 J	2 U	10 U	0.2 J	2 U	10 U
Vinyl Chloride	2		NA	NA	NA	10 U	NA	NA	10 U
Xylenes (total)	5		NA	NA	NA	10 U	NA	5.1	10 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	1 MW-3 12/11/2000	3 MW-4 9/2/1992	2 MW-4 12/8/99	3 MW-5 9/2/1992	3 MW-5 DUP 9/2/1992	2 MW-5 11/29/99	2 MW-6 12/6/1999	
1,1,1-Trichloroethane	5	10 U	20 U	NA	1 U	1 U	NA	NA	
1,1,2,2-Tetrachloroethane	5	NA	36	NA	1 U	1 U	NA	NA	
1,1-Dichloroethane	5	10 U	NA	50 U	NA	NA	10 U	10 U	
1,1-Dichloroethene	5	10 UJ	20 U	50 U	1 U	1 U	10 U	10 U	
1,2,4-Trimethylbenzene	5	10 U	87	NA	1 U	1 U	NA	NA	
1,3,5-Trimethylbenzene	5	10 U	20 U	NA	1 U	1 U	NA	NA	
1,3-Dichlorobenzene	3	10 U	20 U	NA	1 U	1 U	NA	NA	
1,4-Dichlorobenzene	3	10 U	20 U	NA	1 U	1 U	NA	NA	
1,2-Dichloroethene (total)	5	10 U	NA	8.7	NA	NA	10 U	10 U	
2-Butanone	50	10 U	NA	NA	NA	NA	NA	NA	
2-Hexanone	50	NA	NA	50 U	NA	NA	10 U	10 U	
Acetone	50	10 UJ	NA	50 U	NA	NA	10 U	10 U	
Benzene	1	NA	23	50 U	1 U	1 U	10 U	10 U	
Bromodichloromethane	50	10 U	20 U	NA	1 U	1 U	NA	NA	
Butylbenzene	5	10 U	20 U	NA	1 U	1 U	NA	NA	
Chlorobenzene	5	10 U	20 U	NA	1 U	1 U	NA	NA	
Chloroform	7	NA	20 U	50 U	1 U	1 U	10 U	10 U	
Chloromethane	5	2.3 J	20 U	50 U	1 U	1 U	10 U	10 U	
cis-1,2-Dichloroethene	5	10 U	NA	50 U	NA	NA	10 U	10 U	
Dibromochloromethane	50	10 U	20 U	NA	1 U	1 U	NA	NA	
Ethylbenzene	5	NA	8.5 J	50 U	0.3 J	0.3 J	10 U	10 U	
Inert-Butylbenzene	ns	10 U	20 U	NA	1 U	1 U	NA	NA	
Isopropylbenzene	5	10 U	24	NA	1 U	1 U	NA	NA	
meta and or para-Xylene	5	10 U	4.9 JB	50 U	1.5 B	1.6 B	10 U	10 U	
Naphthalene	10	10 U	98	NA	1 U	1 U	NA	NA	
Methylene Chloride	5	10 U	NA	50 U	NA	NA	10 U	10 U	
ortho-Xylene	5	10 U	0.8 J	50 U	0.8 J	0.7 J	10 U	10 U	
p-Isopropyltoluene	5	10 U	16 JB	NA	1 U	1 U	NA	NA	
Propylbenzene	5	10 U	30 B	NA	1 U	1 U	NA	NA	
sec-Butylbenzene	5	10 U	18 J	NA	1 U	0.8 J	NA	NA	
Styrene	5	NA	20 U	50 U	1 U	1 U	10 U	10 U	
Tetrachloroethene	5	10 U	20 U	50 U	1 U	1 U	10 U	10 U	
Toluene	5	10 U	2.2 J	50 U	1 U	1 U	10 U	10 U	
trans-1,2-Dichloroethene	5	10 U	20 U	50 U	1 U	1 U	10 U	10 U	
Trichlorofluoromethane	5	10 U	20 U	NA	1 U	1 U	NA	NA	
Trichloroethene	5	10 U	20 U	50 U	1 U	1 U	10 U	10 U	
Vinyl Chloride	2	10 U	NA	50 U	NA	NA	10 U	10 U	
Xylenes (total)	5	10 U	NA	50 U	NA	NA	10 U	10 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	2 MW-7 12/1/1999	4 MW-8 5/5/1994	2 MW-8 12/6/1999	2 MW-11 11/29/99	4 MW-12 5/5/1994	5 MW-12 8/0/1995	5 MW-12 12/0/96	
1,1,1-Trichloroethane	5	NA	NA	NA	NA	24	NA	NA	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	NA	10 U	10 U	61	NA	NA	
1,1-Dichloroethene	5	10 U	NA	10 U	10 U	NA	NA	NA	
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	3.08	U	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	10 U	NA	10 U	10 U	NA	NA	NA	
2-Butanone	50	NA	NA	NA	NA	NA	NA	NA	
2-Hexanone	50	10 U	NA	10 U	10 U	NA	NA	NA	
Acetone	50	4.1 JN	NA	10 U	10 U	NA	NA	NA	
Benzene	1	10 U	NA	10 U	10 U	NA	NA	NA	
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chloroform	7	10 U	NA	10 U	10 U	NA	NA	NA	
Chloromethane	5	10 U	NA	10 U	10 U	NA	NA	NA	
cis-1,2-Dichloroethene	5	10 U	NA	1.7 J	10 U	NA	NA	NA	
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Ethylbenzene	5	10 U	NA	10 U	10 U	72	57.7	56.2	
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	NA	10 U	10 U	NA	87.7	240	
Naphthalene	10	NA	NA	NA	NA	NA	10 U	6.44	
Methylene Chloride	5	10 U	NA	10 U	10 U	NA	NA	NA	
ortho-Xylene	5	10 U	NA	10 U	10 U	NA	5.63	71.6	
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Styrene	5	10 U	NA	10 U	10 U	NA	NA	NA	
Tetrachloroethene	5	10 U	NA	10 U	10 U	NA	NA	NA	
Toluene	5	10 U	NA	10 U	10 U	NA	NA	NA	
trans-1,2-Dichloroethene	5	10 U	NA	10 U	10 U	NA	NA	NA	
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA	
Trichloroethene	5	10 U	2.5	10 U	10 U	NA	NA	NA	
Vinyl Chloride	2	10 U	NA	10 U	10 U	NA	NA	NA	
Xylenes (total)	5	10 U	2 U	10 U	10 U	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	5 MW-12 6/0/97	2 MW-12 12/1/99	2 MW-12D 1/12/00	2 MW-13 12/1/99	2 MW-14 12/1/99	2 MW-15 12/8/99	2 MW-16 12/1/99	
1,1,1-Trichloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	NA	19	10 U	10 U	10 U	10 U	10 U	
1,1-Dichloroethene	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
1,2,4-Trimethylbenzene	5	10 U	10 U	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
2-Butanone	50	NA	NA	NA	NA	NA	NA	NA	
2-Hexanone	50	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Acetone	50	NA	4.3 JN	3.1 J	3.3 JN	4.9 JN	10 U	6.3 JN	
Benzene	1	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Bromodichloromethane	50	NA	10 U	NA	NA	NA	NA	NA	
Butylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Chlorobenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Chloroform	7	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Chloromethane	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
cis-1,2-Dichloroethene	5	NA	1 J	10 U	10 U	10 U	10 U	10 U	
Dibromochloromethane	50	NA	10 U	NA	NA	NA	NA	NA	
Ethylbenzene	5	80.4	57	10 U	10 U	10 U	10 U	10 U	
Inert-Butylbenzene	ns	NA	10 U	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
meta and or para-Xylene	5	335	94	10 U	10 U	4.7 J	1.2 J	10 U	
Naphthalene	10	10 U	10 U	NA	NA	NA	NA	NA	
Methylene Chloride	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
ortho-Xylene	5	88.9	3.1 J	10 U	10 U	10 U	1.7 J	10 U	
p-Isopropyltoluene	5	NA	10 U	NA	NA	NA	NA	NA	
Propylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Styrene	5	NA	10 U	10 U	10 U	8.4 J	10 U	10 U	
Tetrachloroethene	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Toluene	5	NA	10 U	10 U	10 U	10 U	1.4 J	10 U	
trans-1,2-Dichloroethene	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Trichlorofluoromethane	5	NA	10 U	NA	NA	NA	NA	NA	
Trichloroethene	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Vinyl Chloride	2	NA	10 U	10 U	10 U	10 U	10 U	10 U	
Xylenes (total)	5	NA	97	10 U	10 U	4.7	2.9	10 U	
All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).									

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	2 MW-17 12/10/99	2 MW-18 12/9/99	1 MW-18 12/08/00	2 MW-19 12/10/99	2 MW-19 DUP 12/10/99	1 MW-19 12/10/00	1 MW-19 5/30/01	
1,1,1-Trichloroethane	5	NA	NA	10 U	NA	NA	10 U	1 U	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	1.4 J	1.9 J	10 U	10 U	10 U	1 U	
1,1-Dichloroethene	5	10 U	10 U	10 UJ	10 U	10 U	10 UJ	1 U	
1,2,4-Trimethylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	1.8 JN	10 U	10 U	10 U	10 U	310	160 D	
2-Butanone	50	NA	NA	10 U	NA	NA	10 U	20 U	
2-Hexanone	50	10 U	10 U	NA	10 U	10 U	NA	NA	
Acetone	50	5.6 JN	10 U	10 U	5.1 JN	4.1 JN	10 UJ	20 U	
Benzene	1	10 U	10 U	NA	10 U	10 U	NA	NA	
Bromodichloromethane	50	NA	10 U	NA	NA	NA	NA	NA	
Butylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Chlorobenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Chloroform	7	10 U	10 U	NA	10 U	10 U	NA	NA	
Chloromethane	5	10 U	10 U	10 U	10 U	10 U	10 U	1 U	
cis-1,2-Dichloroethene	5	10 U	10 U	10 U	110	110	300 D	NA	
Dibromochloromethane	50	NA	10 U	NA	NA	NA	NA	NA	
Ethylbenzene	5	10 U	10 U	NA	10 U	10 U	NA	NA	
Inert-Butylbenzene	ns	NA	10 U	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	
Naphthalene	10	NA	10 U	NA	NA	NA	NA	NA	
Methylene Chloride	5	10 U	10 U	10 U	10 U	10 U	10 U	1 U	
ortho-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	
p-Isopropyltoluene	5	NA	10 U	NA	NA	NA	NA	NA	
Propylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	10 U	NA	NA	NA	NA	NA	
Styrene	5	10 U	10 U	NA	10 U	10 U	NA	NA	
Tetrachloroethene	5	10 U	10 U	10 U	64	70	200 D	220 D	
Toluene	5	10 U	10 U	10 U	10 U	10 U	10 U	1 U	
trans-1,2-Dichloroethene	5	10 U	10 U	10 U	2.2 U	1.8 JN	7.8 J	NA	
Trichlorofluoromethane	5	NA	10 U	NA	NA	NA	NA	NA	
Trichloroethene	5	10 U	10 U	10 U	7 J	6.9 JN	32	47 D	
Vinyl Chloride	2	10 U	10 U	10 U	170	150	64	5.7	
Xylenes (total)	5	10 U	10 U	10 U	10 U	10 U	100 U	2 U	
All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).									

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
	Source:	NYSDEC	2	1	2	2	2	3	2
	Sample ID:	TOGS 1.1.1	MW-20	MW-20	MW-21	MW-22	MW-23	MW-24	MW-24
	Sample Date:	Class GA	12/10/99	12/8/00	12/10/99	12/10/99	12/10/99	9/2/1992	12/9/99
1,1,1-Trichloroethane	5	NA	10 U	NA	NA	NA	NA	7.9 J	NA
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	25 U	NA
1,1-Dichloroethane	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	10 U
1,1-Dichloroethene	5	10 U	10 UJ	10 U	10 U	10 U	10 U	5.8 J	10 U
1,2,4-Trimethylbenzene	5	NA	10 U	NA	NA	NA	NA	130	NA
1,3,5-Trimethylbenzene	5	NA	10 U	NA	NA	NA	NA	25 U	NA
1,3-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	13 J	NA
1,4-Dichlorobenzene	3	NA	10 U	NA	NA	NA	NA	8.1 J	NA
1,2-Dichloroethene (total)	5	10 U	10 U	2.6 JN	10 U	10 U	10 U	NA	10 U
2-Butanone	50	NA	10 U	NA	NA	NA	NA	NA	NA
2-Hexanone	50	10 U	NA	10 U	10 U	10 U	10 U	NA	10 U
Acetone	50	10 U	10 UJ	26	3 JN	4.3 JN	NA	NA	10 U
Benzene	1	10 U	NA	10 U	10 U	10 U	10 U	40	10 U
Bromodichloromethane	50	NA	10 U	NA	NA	NA	NA	25 U	NA
Butylbenzene	5	NA	10 U	NA	NA	NA	NA	29	NA
Chlorobenzene	5	NA	10 U	NA	NA	NA	NA	7.4 J	NA
Chloroform	7	10 U	NA	10 U	10 U	10 U	10 U	4.7 J	10 U
Chloromethane	5	10 U	10 U	10 U	10 U	10 U	10 U	25 U	10 U
cis-1,2-Dichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	10 U
Dibromochloromethane	50	NA	10 U	NA	NA	NA	NA	25 U	NA
Ethylbenzene	5	10 U	NA	10 U	10 U	10 U	10 U	15 J	10 U
Inert-Butylbenzene	ns	NA	10 U	NA	NA	NA	NA	25 U	NA
Isopropylbenzene	5	NA	10 U	NA	NA	NA	NA	25	NA
meta and/or para-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	20 JB	10 U
Naphthalene	10	NA	10 U	NA	NA	NA	NA	280	NA
Methylene Chloride	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	10 U
ortho-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	8 J	10 U
p-Isopropyltoluene	5	NA	10 U	NA	NA	NA	NA	23 JB	NA
Propylbenzene	5	NA	10 U	NA	NA	NA	NA	35	NA
sec-Butylbenzene	5	NA	10 U	NA	NA	NA	NA	23 J	NA
Styrene	5	10 U	NA	10 U	10 U	10 U	10 U	7.6 J	10 U
Tetrachloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 J	10 U
Toluene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 J	10 U
trans-1,2-Dichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	4 J	10 U
Trichlorofluoromethane	5	NA	10 U	NA	NA	NA	NA	24 J	NA
Trichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	18 J	10 U
Vinyl Chloride	2	10 U	10 U	10 U	10 U	10 U	10 U	NA	10 U
Xylenes (total)	5	10 U	10 U	10 U	10 U	10 U	10 U	NA	10 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	2 MW-25 12/9/99	2 MW-26 12/9/99	2 MW-27 12/10/99	2 MW-28 12/10/99	2 MW-29 12/10/99	2 MW-30 12/10/99	2 MW-30 DUP 12/10/99	
1,1,1-Trichloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	10 U	R	R	R	R	10 U	
1,1-Dichloroethene	5	10 U	10 U	R	R	R	R	10 U	
1,2,4-Trimethylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	NA	10 U	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	NA	10 U	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	10 U	NA	NA	NA	NA	NA	NA	
2-Butanone	50	NA	10 U	R	R	R	R	10 U	
2-Hexanone	50	10 U	10 U	R	R	R	R	10 U	
Acetone	50	10 U	10 U	R	R	R	R	3.2 JN	
Benzene	1	10 U	10 U	R	R	R	R	10 U	
Bromodichloromethane	50	NA	NA	10 U	NA	NA	NA	NA	
Butylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Chlorobenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Chloroform	7	10 U	10 U	R	R	R	R	10 U	
Chloromethane	5	10 U	10 U	R	R	R	R	10 U	
cis-1,2-Dichloroethene	5	10 U	10 U	R	R	R	R	10 U	
Dibromochloromethane	50	NA	NA	10 U	NA	NA	NA	NA	
Ethylbenzene	5	10 U	10 U	R	R	R	R	10 U	
Inert-Butylbenzene	ns	NA	NA	10 U	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	10 U	R	R	R	R	10 U	
Naphthalene	10	NA	NA	10 U	NA	NA	NA	NA	
Methylene Chloride	5	10 U	10 U	R	R	R	R	10 U	
ortho-Xylene	5	10 U	10 U	R	R	R	R	10 U	
p-Isopropyltoluene	5	NA	NA	10 U	NA	NA	NA	NA	
Propylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Styrene	5	10 U	10 U	R	R	R	R	10 U	
Tetrachloroethene	5	10 U	10 U	R	R	R	R	10 U	
Toluene	5	10 U	10 U	R	R	R	R	10 U	
trans-1,2-Dichloroethene	5	10 U	10 U	R	R	R	R	10 U	
Trichlorofluoromethane	5	NA	NA	10 U	NA	NA	NA	NA	
Trichloroethene	5	10 U	10 U	R	R	R	R	10 U	
Vinyl Chloride	2	10 U	10 U	R	R	R	R	10 U	
Xylenes (total)	5	10 U	10 U	R	R	R	R	10 U	
All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).									

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	2 MW-31 12/10/99	1 MW-32 12/6/2000	1 MW-33 12/11/2000	1 MW-33 DUP 12/11/2000	1 MW-34 12/6/00	1 MW-35 12/6/00	1 MW-36 12/6/00	
1,1,1-Trichloroethane	5	NA	10 U	10 U	10 U	10 U	10 U	10 U	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
1,1-Dichloroethene	5	10 U	10 U	10 J	10 J	10 U	10 U	10 U	
1,2,4-Trimethylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	NA	10 U	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	NA	10 U	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	NA	10 UJ	10 U	10 U	10 UJ	10 U	10 U	
2-Butanone	50	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
2-Hexanone	50	10 U	NA	NA	NA	NA	NA	NA	
Acetone	50	10 U	10 UJ	10 U	10 U	10 UJ	10 U	10 U	
Benzene	1	10 U	NA	NA	NA	NA	NA	NA	
Bromodichloromethane	50	NA	NA	10 U	NA	NA	NA	NA	
Butylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Chlorobenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Chloroform	7	10 U	NA	NA	NA	NA	NA	NA	
Chloromethane	5	10 U	10 U	10 U	10 U	10 U	6.9 J	10 UJ	
cis-1,2-Dichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Dibromochloromethane	50	NA	NA	10 U	NA	NA	NA	NA	
Ethylbenzene	5	10 U	NA	NA	NA	NA	NA	NA	
Inert-Butylbenzene	ns	NA	NA	10 U	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Naphthalene	10	NA	NA	10 U	NA	NA	NA	NA	
Methylene Chloride	5	10 U	10 UJ	10 U	10 U	10 U	10 U	10 U	
ortho-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	1.8 J	
p-Isopropyltoluene	5	NA	NA	10 U	NA	NA	NA	NA	
Propylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	NA	10 U	NA	NA	NA	NA	
Styrene	5	10 U	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Toluene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
trans-1,2-Dichloroethene	5	10 U	10 UJ	10 U	10 U	10 UJ	10 U	10 U	
Trichlorofluoromethane	5	NA	NA	10 U	NA	NA	NA	NA	
Trichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Vinyl Chloride	2	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Xylenes (total)	5	10 U	10 U	10 U	10 U	10 U	10 U	1.8	
All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).									

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	1 MW-36A 12/7/00	1 MW-37 12/6/00	1 MW-38 12/6/00	1 MW-39 12/7/00	1 MW-40 12/07/00	1 MW-41 12/7/00	1 MW-42 12/8/00	
1,1,1-Trichloroethane	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
1,1-Dichloroethene	5	10 UJ	10 UJ	10 U	10 UJ	10 UJ	10 UJ	10 UJ	
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
2-Butanone	50	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
2-Hexanone	50	NA	NA	NA	NA	NA	NA	NA	
Acetone	50	11 U	11 U	10 U	10 U	10 U	13 U	11 U	
Benzene	1	NA	NA	NA	NA	NA	NA	NA	
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chloroform	7	NA	NA	NA	NA	NA	NA	NA	
Chloromethane	5	3.5 J	3.5 J	10 U	10 U	10 U	2.8 J	3.4 J	
cis-1,2-Dichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Ethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	10 U	10 J	10 U	10 U	10 U	10 U	
Naphthalene	10	NA	NA	NA	NA	NA	NA	NA	
Methylene Chloride	5	10 UJ	10 UJ	10 J	10 UJ	10 UJ	10 UJ	10 U	
ortho-Xylene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Styrene	5	NA	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Toluene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
trans-1,2-Dichloroethene	5	10 U	10 U	10 J	10 U	10 U	10 U	10 U	
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA	
Trichloroethene	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Vinyl Chloride	2	10 U	10 U	10 U	10 U	10 U	10 U	10 U	
Xylenes (total)	5	10 U	10 U	10 U	10 U	10 U	10 U	10 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
	Source:	NYSDEC	1	1	1	1	1	1	3
	Sample ID:	TOGS 1.1.1	MW-43	MW-44	MW-45	MW-46	MW-47	MW-48	TB
	Sample Date:	Class GA	12/8/00	5/31/01	5/31/01	5/30/01	6/1/01	5/31/01	9/2/1992
1,1,1-Trichloroethane	5	10 U	1 U	1 U	1 U	100 U	1 U	1 U	1 U
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	1 U
1,1-Dichloroethane	5	10 U	1 U	1 U	1 U	100 U	1 U	1 U	NA
1,1-Dichloroethene	5	10 UJ	1 U	1 U	1 U	100 U	3.3	6.5	1 U
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	1 U
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	1 U
1,2-Dichloroethene (total)	5	2.2 J	1 U	1 U	160	91 D	1,900 D	NA	NA
2-Butanone	50	10 U	20 U	20 U	2,000 U	20 U	20 U	NA	NA
2-Hexanone	50	NA	NA	NA	NA	NA	NA	NA	NA
Acetone	50	11 U	20 U	20 U	2,000 U	20 U	20 U	NA	NA
Benzene	1	NA	NA	NA	NA	NA	NA	NA	1 U
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA	1 U
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Chloroform	7	NA	NA	NA	NA	NA	NA	NA	0.1 J
Chloromethane	5	2.0 J	1 U	1 U	100 U	1 U	1 U	1 U	1 U
cis-1,2-Dichloroethene	5	2.2 J	NA	NA	NA	NA	NA	NA	NA
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA	1 U
Ethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	1 U
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
meta and or para-Xylene	5	10 U	NA	NA	NA	NA	NA	NA	1 U
Naphthalene	10	NA	NA	NA	NA	NA	NA	NA	1 U
Methylene Chloride	5	10 U	1 U	0.001 U	100 U	1 U	1 U	1 U	NA
ortho-Xylene	5	10 U	NA	NA	NA	NA	NA	NA	1 U
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Styrene	5	NA	NA	NA	NA	NA	NA	NA	1 U
Tetrachloroethene	5	10 U	1 U	1 U	9,500 D	1 U	24	0.2 J	1 U
Toluene	5	6.6 J	1 U	1 U	100 U	1 U	1 U	1 U	1 U
trans-1,2-Dichloroethene	5	10 U	NA	NA	NA	NA	NA	NA	1 U
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA	1 U
Trichloroethene	5	10 U	1 U	1 U	420	73 D	81 D	1 U	1 U
Vinyl Chloride	2	10 U	1 U	1 U	100 U	24	1,100 D	NA	NA
Xylenes (total)	5	10 U	1 U	1 U	200 U	1 U	1 U	NA	NA

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	2	2
Sample ID:	TOGS 1.1.1	TMW-1	TMW-3	TMW-4	TMW-5	TMW-8	TMW-19A	TMW-19B
Sample Date:	Class GA	12/5/00	11/14/00	12/5/00	12/5/00	12/5/00	1/17/00	1/17/00
1,1,1-Trichloroethane	5	10 U	10 U	10 U	50 U	100 U	NA	NA
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA
1,1-Dichloroethane	5	10 U	10 U	10 U	50 U	100 U	10 U	10 U
1,1-Dichloroethene	5	10 U	10 U	10 U	50 U	100 U	10 U	4.3 J
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA
1,2-Dichloroethene (total)	5	10 U	10 U	1.2 J	50 U	100 U	NA	NA
2-Butanone	50	10 U	10 U	10 U	50 U	100 U	10 U	13 U
2-Hexanone	50	NA	NA	NA	NA	NA	10 U	10
Acetone	50	10 UJ	10 UJ	10 U	50 UJ	100 UJ	10 U	23 U
Benzene	1	NA	NA	NA	NA	NA	10 U	1.3 UJ
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA
Chloroform	7	NA	NA	NA	NA	NA	10 U	10
Chloromethane	5	10 U	R	10 U	50 U	100 U	10 U	3.1 J
cis-1,2-Dichloroethene	5	10 U	10 U	1.2 J	50 U	100 U	300	8,600
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA
Ethylbenzene	5	NA	NA	NA	NA	NA	10 U	1.9 J
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA
meta and or para-Xylene	5	10 U	10 U	10 U	50 U	100 U	10 U	3.3 J
Naphthalene	10	NA	NA	NA	NA	NA	NA	NA
Methylene Chloride	5	10 UJ	10 U	10 U	50 UJ	100 UJ	10 U	10
ortho-Xylene	5	10 U	10 U	10 U	50 U	100 U	10 U	3.3 J
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA
Styrene	5	NA	NA	NA	NA	NA	10 U	10
Tetrachloroethene	5	10 U	10 U	10 U	50 U	100 U	510	4,700
Toluene	5	10 U	10 U	10 U	50 U	100 U	1.1 J	6.4 J
trans-1,2-Dichloroethene	5	10 U	10 U	10 U	50 U	100 U	6.1 J	53
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA
Trichloroethene	5	10 U	10 U	10 U	50 U	100 U	30	5,400
Vinyl Chloride	2	10 U	10 U	10 U	50 U	100 U	20	870
Xylenes (total)	5	10 U	10 U	10 U	50 U	100 U	10 U	6.6

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
	Source:	NYSDEC	2	1	1	1	1	1	1
	Sample ID:	TOGS 1.1.1	TMW-19C	TMW-19C (DEEP)	TMW-19C (MID)	TMW-19D	TMW-19E	TMW-19F	TMW-19G
	Sample Date:	Class GA	1/19/00	12/4/00	12/4/00	11/8/00	11/8/00	11/8/00	11/8/00
1,1,1-Trichloroethane	5		NA	10 U	10 U	10 U	NA	10 U	10 U
1,1,2,2-Tetrachloroethane	5		NA	NA	NA	NA	NA	NA	NA
1,1-Dichloroethane	5		7 J	10 U	10 U	10 U	10 U	10 U	10 U
1,1-Dichloroethene	5		10 U	10 UJ	10 UJ	10 U	10 U	10 U	10 U
1,2,4-Trimethylbenzene	5		NA	NA	NA	NA	NA	NA	NA
1,3,5-Trimethylbenzene	5		NA	NA	NA	NA	NA	NA	NA
1,3-Dichlorobenzene	3		NA	NA	NA	NA	NA	NA	NA
1,4-Dichlorobenzene	3		NA	NA	NA	NA	NA	NA	NA
1,2-Dichloroethene (total)	5		NA	420 D	350 D	10 U	10 U	10 U	29 U
2-Butanone	50		10 U	10 U	10 U	2.2 J	10 U	10 U	1.1 J
2-Hexanone	50		10 U	NA	NA	NA	NA	NA	NA
Acetone	50		10 U	10 U	10 U	15 UJ	10 UJ	10 UJ	10 UJ
Benzene	1		10 U	NA	NA	NA	NA	NA	NA
Bromodichloromethane	50		NA	NA	NA	NA	NA	NA	NA
Butylbenzene	5		NA	NA	NA	NA	NA	NA	NA
Chlorobenzene	5		NA	NA	NA	NA	NA	NA	NA
Chloroform	7		4.2 J	NA	NA	NA	NA	NA	NA
Chloromethane	5		10 U	10 U	10 U	10 U	10 U	10 U	10 U
cis-1,2-Dichloroethene	5		1,500	420 D	350 D	10 U	10 U	10 U	29 U
Dibromochloromethane	50		NA	NA	NA	NA	NA	NA	NA
Ethylbenzene	5		10 U	NA	NA	NA	NA	NA	NA
Inert-Butylbenzene	ns		NA	NA	NA	NA	NA	NA	NA
Isopropylbenzene	5		NA	NA	NA	NA	NA	NA	NA
meta and or para-Xylene	5		1.5 J	10 U	10 U	2.1 J	10 U	10 U	10 U
Naphthalene	10		NA	NA	NA	NA	NA	NA	NA
Methylene Chloride	5		10 U	10 U	10 U	10 U	10 U	10 U	10 U
ortho-Xylene	5		10 U	10 U	10 U	1.3 J	10 U	10 U	10 U
p-Isopropyltoluene	5		NA	NA	NA	NA	NA	NA	NA
Propylbenzene	5		NA	NA	NA	NA	NA	NA	NA
sec-Butylbenzene	5		NA	NA	NA	NA	NA	NA	NA
Styrene	5		10 U	NA	NA	NA	NA	NA	NA
Tetrachloroethene	5		37,000	3,400 D	1,700 D	10 U	10 U	10 U	210 D
Toluene	5		1.2 J	10 U	10 U	10 U	10 U	10 U	10 U
trans-1,2-Dichloroethene	5		6.6 J	3.3 J	3.8 J	10 U	10 U	10 U	10 U
Trichlorofluoromethane	5		NA	NA	NA	NA	NA	NA	NA
Trichloroethene	5		1,000	660 D	140 D	10 U	10 U	10 U	19 U
Vinyl Chloride	2		7.4 J	50	18	10 U	10 U	10 U	3.7 J
Xylenes (total)	5		1.5 J	1,000 U	1,000 U	3.4	10 U	10 U	10 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	1 TMW-19G (DEEP) 12/4/00	1 TMW-19G (MID) 12/4/00	1 TMW-19H 11/8/00	1 TMW-19H 11/8/00	1 TMW-19I 11/9/00	1 TMW-19J 11/15/00	1 TMW-19J DUP 11/15/00	
1,1,1-Trichloroethane	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA	NA	NA	
1,1-Dichloroethane	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
1,1-Dichloroethene	5	10 UJ	10 UJ	100 U	100 U	100 U	10 U	10 U	
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA	NA	NA	
1,2-Dichloroethene (total)	5	66	340 D	100 U	100 U	100 U	10 U	10 U	
2-Butanone	50	10 U	10 U	100 U	100 U	11 J	10 U	10 U	
2-Hexanone	50	NA	NA	NA	NA	NA	NA	NA	
Acetone	50	10 U	10 UJ	100 UJ	19 J	100 UJ	10 U	10 U	
Benzene	1	NA	NA	NA	NA	NA	NA	NA	
Bromodichloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
Chloroform	7	NA	NA	NA	NA	NA	NA	NA	
Chloromethane	5	10 U	10 U	100 U	100 U	100 U	R	R	
cis-1,2-Dichloroethene	5	66	330 D	100 U	100 U	100 U	10 U	10 U	
Dibromochloromethane	50	NA	NA	NA	NA	NA	NA	NA	
Ethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
meta and or para-Xylene	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
Naphthalene	10	NA	NA	NA	NA	NA	NA	NA	
Methylene Chloride	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
ortho-Xylene	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
p-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Styrene	5	NA	NA	NA	NA	NA	NA	NA	
Tetrachloroethene	5	28	9.3 J	100 U	100 U	100 U	10 U	10 U	
Toluene	5	10 U	10 U	100 U	100 U	100 U	10 U	10 U	
trans-1,2-Dichloroethene	5	10 U	6.3 J	100 U	100 U	100 U	10 U	10 U	
Trichlorofluoromethane	5	NA	NA	NA	NA	NA	NA	NA	
Trichloroethene	5	74	9.3 J	100 U	100 U	100 U	10 U	10 U	
Vinyl Chloride	2	14	24	100 U	100 U	100 U	10 U	10 U	
Xylenes (total)	5	10 U	100 U	100 U	100 U	100 U	10 U	10 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Groundwater Samples

Table 3a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 8260)

Analyte	Sample Collection Designation & Collection Date					
Source: Sample ID: Sample Date:	NYSDEC TOGS 1.1.1 Class GA	1 TMW-19K 11/15/00	1 TMW-19K (DEEP) 12/4/00	1 TMW-19K (MID) 12/4/00	1 TMW-19L 11/15/00	1 TMW-19M 11/15/00
1,1,1-Trichloroethane	5	2.2 J	10 U	10 U	10 U	50 U
1,1,2,2-Tetrachloroethane	5	NA	NA	NA	NA	NA
1,1-Dichloroethane	5	1.0 J	10 U	10 U	1.2 U	50 U
1,1-Dichloroethene	5	10 U	10 UJ	10 UJ	10 J	50 U
1,2,4-Trimethylbenzene	5	NA	NA	NA	NA	NA
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA
1,3-Dichlorobenzene	3	NA	NA	NA	NA	NA
1,4-Dichlorobenzene	3	NA	NA	NA	NA	NA
1,2-Dichloroethene (total)	5	10 U	300 D	10 U	10 U	50 U
2-Butanone	50	10 U	10 U	10 U	10 U	50 U
2-Hexanone	50	NA	NA	NA	NA	NA
Acetone	50	10 UJ	10 U	10 U	10 U	50 U
Benzene	1	NA	NA	NA	NA	NA
Bromodichloromethane	50	NA	NA	NA	NA	NA
Butylbenzene	5	NA	NA	NA	NA	NA
Chlorobenzene	5	NA	NA	NA	NA	NA
Chloroform	7	NA	NA	NA	NA	NA
Chloromethane	5	R	10 U	10 U	R	R
cis-1,2-Dichloroethene	5	10 U	300 D	10 U	10 U	50 U
Dibromochloromethane	50	NA	NA	NA	NA	NA
Ethylbenzene	5	NA	NA	NA	NA	NA
Inert-Butylbenzene	ns	NA	NA	NA	NA	NA
Isopropylbenzene	5	NA	NA	NA	NA	NA
meta and or para-Xylene	5	10 U	10 U	10 U	10 U	50 U
Naphthalene	10	NA	NA	NA	NA	NA
Methylene Chloride	5	10 U	10 U	10 U	10 U	50 U
ortho-Xylene	5	10 U	10 U	10 U	10 U	50 U
p-Isopropyltoluene	5	NA	NA	NA	NA	NA
Propylbenzene	5	NA	NA	NA	NA	NA
sec-Butylbenzene	5	NA	NA	NA	NA	NA
Styrene	5	NA	NA	NA	NA	NA
Tetrachloroethene	5	10 U	2.7 J	1.2 J	10 U	50 U
Toluene	5	10 U	10 U	10 U	10 U	50 U
trans-1,2-Dichloroethene	5	10 U	2.4 J	10 U	10 U	50 U
Trichlorofluoromethane	5	NA	NA	NA	NA	NA
Trichloroethene	5	10 U	68	10 U	10 U	50 U
Vinyl Chloride	2	10 U	11	10 U	10 U	50 U
Xylenes (total)	5	10 U	10 U	10 U	10 U	50 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 16.

Notes:

All groundwater samples collected using low-flow purging/sampling, except those collected at the DP-BG1 location. During drilling at this location, a groundwater sample was collected on 5/31/01 using a Hydropunch® (20-20.3 feet below the ground surface [BGS]). After a temporary well was installed at the DP-BG1 location, another groundwater sample was collected on 6/5/01 using a disposable bailer (10.7-15.7 feet BGS).

NA = Sample was not analyzed for this constituent.

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the practical quantitation limit (PQL).

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process.

The data should not be used for any qualitative or quantitative purposes.

D = Identifies all compounds analyzed at a secondary dilution.

E = Identifies compounds whose concentration exceeds the calibration range of the instruments.

ns = No standard. Value is not available in TOGS.

N = This qualifier indicates that the compound was analyzed for but not requested as an analyte. Value will not be listed on tabular result sheet.

B - Indicates an estimated value between the instrument detection limit and the CLP-required detection limit.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	5 EVIMW-1 6/5/1997	2 EVIMW-1 12/8/99	5 EVIMW-2 7/24/96	2 EVIMW-2 12/8/99	1 EVIMW-2 12/11/00	1 EVIMW-2 5/30/01	4 EVIMW-3 6/5/97	
1,2,4-Trichlorobenzene	5	NA	1.4 J	NA	9.3 U	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	NA	4.4 J	NA	1.5 J	1.4 J	10 U	NA	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	9.3 U	10 U	NA	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	NA	9.3 U	NA	9.3 U	NA	NA	NA	
Acenaphthene	0.02	NA	9.3 U	NA	9.3 U	9.3 U	10 U	NA	
Acenaphthylene	0.02	NA	2.1 JN	NA	9.3 U	NA	NA	NA	
Anthracene	0.05	NA	1.3 J	NA	9.3 U	9.3 U	10 U	NA	
Benzo(a)anthracene	0.002	NA	9.3 U	25	9.3 U	1 J	10 U	NA	
Benzo(a)pyrene	MDL	NA	9.3 U	24	9.3 U	1.2 J	10 U	NA	
Benzo(b)fluoranthene	0.002	NA	9.3 U	47	9.3 U	2.2 J	10 U	NA	
Benzo(g,h,i)perylene	ns	NA	9.3 U	13	9.3 U	NA	NA	NA	
Benzo(k)fluoranthene	0.002	NA	9.3 U	16	9.3 U	1.1 J	10 U	NA	
bis(2-Ethylhexyl)phthalate	5	110	9.3 U	NA	9.3 U	1.8 J	10 U	51	
Carbazole	ns	NA	NA	NA	NA	9.3 U	NA	NA	
Chrysene	0.002	NA	9.3 U	36	9.3 U	1.2 J	10 U	NA	
Dibenzo(a,h)anthracene	50	NA	9.3 U	NA	9.3 U	NA	NA	NA	
Dibenzofuran	5	NA	9.3 U	NA	9.3 U	9.3 U	10 U	NA	
Diethylphthalate	50	NA	9.3 U	NA	9.3 U	9.3 U	10 U	NA	
Di-n-butylphthalate	50	NA	NA	NA	NA	9.3 U	10 U	NA	
Fluoranthene	50	NA	9.3 U	NA	9.3 U	1.5 J	10 U	18	
Fluorene	50	NA	2.5 J	NA	9.3 U	9.3 U	10 U	NA	
Indeno(1,2,3-cd)pyrene	0.002	NA	9.3 U	13	9.3 U	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	NA	3.2 J	NA	9.3 U	9.3 U	10 U	NA	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	9.3 U	10 U	NA	
N-Nitroso-di-n-propylamine	ns	NA	9.3 U	NA	9.3 U	NA	NA	NA	
Phenanthrene	50	NA	5.5 J	NA	1.6 J	1.2 J	10 U	NA	
Phenol	1	NA	9.3 U	NA	9.3 U	NA	NA	NA	
Pyrene	50	NA	1.2 J	NA	9.3 U	1.4 J	10 U	13	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	5 EVMW-5 6/5/97	5 EVMW-6 6/5/97	2 EVMW-6 12/8/99	2 EVMW-8 12/8/99	4 MW-1 5/5/94	4 MW-2 5/5/94	2 MW-2 11/29/99	
1,2,4-Trichlorobenzene	5	NA	NA	9.3 U	9.3 U	2,990	20 U	98 U	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	2,000 U	2,000 U	NA	
2-Methylnaphthalene	ns	NA	NA	2.6 J	1.5 J	1,000 U	1,000 U	98 U	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	5	NA	NA	NA	NA	3,550	20 U	NA	
4-Methylphenol	1	NA	NA	9.3 U	9.3 U	NA	NA	98 U	
Acenaphthene	0.02	NA	NA	1.6 JN	0.93 JN	310	120	98 U	
Acenaphthylene	0.02	NA	NA	9.3 U	9.3 U	NA	NA	98 U	
Anthracene	0.05	NA	NA	1.8 JN	9.3 U	290	10 U	98 U	
Benzo(a)anthracene	0.002	NA	NA	2 J	9.3 U	NA	NA	98 U	
Benzo(a)pyrene	MDL	NA	NA	1.8 J	9.3 UJ	NA	NA	98 U	
Benzo(b)fluoranthene	0.002	NA	NA	2.5 J	9.3 UJ	NA	NA	98 U	
Benzo(g,h,i)perylene	ns	NA	NA	9.3 U	9.3 UJ	NA	NA	98 U	
Benzo(k)fluoranthene	0.002	NA	NA	1.1 JN	9.3 UJ	NA	NA	98 U	
bis(2-Ethylhexyl)phthalate	5	32	32	9.3 U	9.3 U	430 B	16 B	20 J	
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA	
Chrysene	0.002	NA	NA	3.1 J	9.3 U	NA	NA	98 U	
Dibenzo(a,h)anthracene	50	NA	NA	9.3 U	9.3 UJ	NA	NA	98 U	
Dibenzofuran	5	NA	NA	9.3 U	9.3 U	10 U	10 U	98 U	
Diethylphthalate	50	NA	NA	9.3 U	9.3 U	NA	NA	98 U	
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA	
Fluoranthene	50	NA	NA	3	9.3 U	190	10 U	98 U	
Fluorene	50	NA	NA	3.5	1.9 J	100 U	26	72 J	
Indeno(1,2,3-cd)pyrene	0.002	NA	NA	9.3 U	9.3 UJ	NA	NA	98 U	
Isopropylbenzene	5	NA	NA	NA	NA	2,000 U	4.1	NA	
Naphthalene	10	NA	NA	3.4	2 J	7,620	5.3	98 U	
n-Butylbenzene	5	NA	NA	NA	NA	2,430	2 U	NA	
n-Propylbenzene	5	NA	NA	NA	NA	2,000 U	2 U	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA	
N-Nitroso-di-n-propylamine	ns	NA	NA	9.3 U	9.3 U	NA	NA	98 U	
Phenanthrene	50	NA	16	3.8 JN	9.3 U	2,600	29	31 J	
Phenol	1	NA	NA	9.3 U	9.3 U	NA	NA	98 U	
Pyrene	50	NA	11	5.9 J	9.3 U	360	10 U	13 J	
sec-Butylbenzene	5	NA	NA	NA	NA	3,470	2.3	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	2,000 U	2 U	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	4 MW-3 5/5/1994	2 MW-3 11/29/99	1 MW-3 12/11/00	4 MW-4 5/5/94	2 MW-4 12/8/99	1 MW-4 12/11/00	1 MW-4 6/1/01
1,2,4-Trichlorobenzene	5	6.3	100 U	NA	502	46 U	NA	NA
1,3,5-Trimethylbenzene	5	13	NA	NA	1,540	NA	NA	NA
2-Methylnaphthalene	ns	10 U	100 U	9.6 U	3,900	710	250 D	10 U
4-Bromophenyl phenyl ether	ns	NA	NA	9.6 U	NA	NA	9.4 U	10 U
4-Isopropyltoluene	5	2 U	NA	NA	2,490	NA	NA	NA
4-Methylphenol	1	NA	100 U	NA	NA	46 U	NA	NA
Acenaphthene	0.02	56	100 UJ	8 J	2,100	81 JN	21	8.5 J
Acenaphthylene	0.02	NA	100 U	NA	NA	46 U	NA	NA
Anthracene	0.05	22	100 U	1.5 J	500 U	60 JN	9.4 U	10 U
Benzo(a)anthracene	0.002	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
Benzo(a)pyrene	MDL	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
Benzo(b)fluoranthene	0.002	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
Benzo(g,h,i)perylene	ns	NA	100 U	NA	NA	46 U	NA	NA
Benzo(k)fluoranthene	0.002	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
bis(2-Ethylhexyl)phthalate	5	170 B	99 J	6.9 J	500 U	63	9.4 U	7 J
Carbazole	ns	NA	NA	9.6 U	NA	NA	9.4 U	NA
Chrysene	0.002	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
Dibenzo(a,h)anthracene	50	NA	100 U	NA	NA	46 U	NA	NA
Dibenzofuran	5	37	100 U	9.6 U	1,100	46 U	9.4 U	7 J
Diethylphthalate	50	NA	100 U	9.6 U	NA	46 U	9.4 U	10 U
Di-n-butylphthalate	50	NA	NA	9.6 U	NA	NA	9.4 U	10 U
Fluoranthene	50	18	100 U	9.6 U	500 U	8.4 J	9.4 U	10 U
Fluorene	50	10 U	55 J	11	2,600	150	33	14
Indeno(1,2,3-cd)pyrene	0.002	NA	100 U	NA	NA	46 U	NA	NA
Isopropylbenzene	5	21	NA	NA	1,000 U	NA	NA	NA
Naphthalene	10	35.3	100 U	9.6 U	19,200	47	9.4 U	10 U
n-Butylbenzene	5	66.9	NA	NA	5,100	NA	NA	NA
n-Propylbenzene	5	9.5	NA	NA	1,000 U	NA	NA	NA
N-nitroso-di-phenylamine	50	NA	NA	9.6 U	NA	NA	9.4 U	10 U
N-Nitroso-di-n-propylamine	ns	NA	100 U	NA	NA	46 U	NA	NA
Phenanthrene	50	330	35 J	1.8 J	6,400	430	79	16
Phenol	1	NA	100 U	NA	NA	46 U	NA	NA
Pyrene	50	25	100 U	9.6 U	500 U	23 J	6.2 J	10 U
sec-Butylbenzene	5	34.9	NA	NA	1,680	NA	NA	NA
tert-Butylbenzene	5	7.8	NA	NA	1,000 U	NA	NA	NA

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date							
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	2 MW-5 11/29/99	4 MW-6 5/5/94	2 MW-6 12/6/1999	4 MW-7 05/05/94	2 MW-7 12/1/1999	4 MW-8 5/5/1994	2 MW-8 12/6/1999
1,2,4-Trichlorobenzene	5	10 U	NA	13 U	NA	9.7 U	2 U	60 U
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	2 U	NA
2-Methylnaphthalene	ns	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	2 U	NA
4-Methylphenol	1	10 U	NA	13 U	NA	9.7 U	NA	60 U
Acenaphthene	0.02	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
Acenaphthylene	0.02	10 U	NA	13 U	NA	9.7 U	NA	60 U
Anthracene	0.05	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
Benzo(a)anthracene	0.002	10 U	NA	13 U	NA	9.7 U	NA	60 U
Benzo(a)pyrene	MDL	10 U	NA	13 U	NA	9.7 U	NA	8.7 J
Benzo(b)fluoranthene	0.002	10 U	NA	1.4 JN	NA	9.7 U	NA	8.8 J
Benzo(g,h,i)perylene	ns	10 U	NA	13 U	NA	9.7 U	NA	60 U
Benzo(k)fluoranthene	0.002	10 U	NA	13 U	NA	9.7 U	NA	60 U
bis(2-Ethylhexyl)phthalate	5	1 J	51 B	13 U	17 B	1.3 J	34 B	60 U
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA
Chrysene	0.002	10 U	NA	13 U	NA	9.7 U	NA	60 U
Dibenzo(a,h)anthracene	50	10 U	NA	13 U	NA	9.7 U	NA	60 U
Dibenzofuran	5	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
Diethylphthalate	50	10 U	NA	13 U	NA	9.7 U	NA	60 U
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA
Fluoranthene	50	10 U	10 U	13 U	10 U	9.7 U	10 U	10 J
Fluorene	50	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
Indeno(1,2,3-cd)pyrene	0.002	10 U	NA	13 U	NA	9.7 U	NA	60 U
Isopropylbenzene	5	NA	NA	NA	NA	NA	2 U	NA
Naphthalene	10	10 U	10 U	13 U	10 U	9.7 U	2.1	60 U
n-Butylbenzene	5	NA	NA	NA	NA	NA	2 U	NA
n-Propylbenzene	5	NA	NA	NA	NA	NA	2 U	NA
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA
N-Nitroso-di-n-propylamine	ns	10 U	NA	13 U	NA	9.7 U	NA	60 U
Phenanthrene	50	10 U	10 U	13 U	10 U	9.7 U	10 U	60 U
Phenol	1	10 U	NA	13 U	NA	9.7 U	NA	60 U
Pyrene	50	10 U	10 U	13 U	10 U	9.7 U	10 U	14 J
sec-Butylbenzene	5	NA	NA	NA	NA	NA	2 U	NA
tert-Butylbenzene	5	NA	NA	NA	NA	NA	2 U	NA

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	4 MW9 5/5/1994	4 MW-10 5/5/1994	4 MW-11 5/5/1994	2 MW-11 11/29/99	4 MW-12 5/5/94	2 MW-12 12/1/99	2 MW-12D 1/12/00	
1,2,4-Trichlorobenzene	5	2 U	NA	2 U	9.4 U	2 U	10 U	9.5 U	
1,3,5-Trimethylbenzene	5	2 U	NA	2 U	NA	2 U	NA	NA	
2-Methylnaphthalene	ns	10 U	10 U	10 U	9.4 U	10 U	10 U	9.5 U	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	5	2 U	NA	2 U	NA	2 U	NA	NA	
4-Methylphenol	1	NA	NA	NA	9.4 U	NA	16	9.5 U	
Acenaphthene	0.02	10 U	10 U	10 U	5 J	10 U	1.7 JN	9.5 U	
Acenaphthylene	0.02	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Anthracene	0.05	10 U	10 U	10 U	9.4 U	10 U	10 U	9.5 U	
Benzo(a)anthracene	0.002	NA	NA	NA	9.4 U	NA	10 U	2 JN	
Benzo(a)pyrene	MDL	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Benzo(b)fluoranthene	0.002	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Benzo(g,h,i)perylene	ns	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Benzo(k)fluoranthene	0.002	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
bis(2-Ethylhexyl)phthalate	5	56 B	36 B	150 B	1.2 J	43 B	1.7 J	4.6 J	
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA	
Chrysene	0.002	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Dibenzo(a,h)anthracene	50	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Dibenzofuran	5	10 U	10 U	10 U	9.4 U	10 U	1.3 JN	9.5 U	
Diethylphthalate	50	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA	
Fluoranthene	50	10 U	10 U	10 U	9.4 U	10 U	10 U	1.6 JN	
Fluorene	50	10 U	10 U	10 U	3.7 J	10 U	3.9 J	9.5 U	
Indeno(1,2,3-cd)pyrene	0.002	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Isopropylbenzene	5	2 U	NA	2 U	NA	2 U	NA	NA	
Naphthalene	10	2	10 U	4.5	0.97 J	121	10 U	9.5 U	
n-Butylbenzene	5	2 U	NA	2.4	NA	40.1	NA	NA	
n-Propylbenzene	5	2 U	NA	2 U	NA	2 U	NA	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA	
N-Nitroso-di-n-propylamine	ns	NA	NA	NA	9.4 U	NA	10 U	9.5 U	
Phenanthrene	50	10 U	10 U	10 U	9.4 U	10 U	10 U	3.5 JN	
Phenol	1	NA	NA	NA	9.4 U	NA	3.8 J	9.5 U	
Pyrene	50	10 U	10 U	10 U	9.4 U	10 U	10 U	5.7 J	
sec-Butylbenzene	5	2 U	NA	2 U	NA	2 U	NA	NA	
tert-Butylbenzene	5	2 U	NA	2 U	NA	2 U	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date									
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	2 MW-13 12/1/99	2 MW-14 12/1/99	2 MW-15 12/8/99	2 MW-16 8/15-16/95	2 MW-16 12/1/99	2 MW-17 12/10/99	2 MW-18 12/9/99	2 MW-19 12/10/99	
1,2,4-Trichlorobenzene	5	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	2.1 J	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	11 U	9.9 U	1.4 J	NA	9.9 U	1.6 J	1.2 J	9.3 U	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Acenaphthene	0.02	7.9 J	7.6 JN	2.5 J	28	9 JN	8.8 J	9.4 U	9.3 U	
Acenaphthylene	0.02	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Anthracene	0.05	1.3 JN	1.8 JN	9.3 U	NA	2.6 JN	5.4 J	9.4 U	9.3 U	
Benzo(a)anthracene	0.002	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Benzo(a)pyrene	MDL	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Benzo(b)fluoranthene	0.002	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Benzo(g,h,i)perylene	ns	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Benzo(k)fluoranthene	0.002	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
bis(2-Ethylhexyl)phthalate	5	2.3 J	1.7 J	9.3 U	4,700	6 J	93 U	9.4 U	93 U	
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA	NA	
Chrysene	0.002	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Dibenzo(a,h)anthracene	50	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Dibenzofuran	5	11 U	9.9 U	2 J	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Diethylphthalate	50	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA	NA	
Fluoranthene	50	11 U	9.9 U	9.3 U	NA	9.9 U	1.1 J	1.8 J	9.3 U	
Fluorene	50	9.2 J	9.5 J	3.2 J	34	9.8 J	17	9.4 U	9.3 U	
Indeno(1,2,3-cd)pyrene	0.002	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	11 U	9.9 U	1.3 J	NA	9.9 U	1.4 J	2 J	9.3 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA	NA	
N-Nitroso-di-n-propylamine	ns	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Phenanthrene	50	2.9 J	5 J	9.3 U	55	3 J	5.5 J	2.7 J	9.3 U	
Phenol	1	11 U	9.9 U	9.3 U	NA	9.9 U	9.3 U	9.4 U	9.3 U	
Pyrene	50	11 U	1.8 J	9.3 U	NA	2.4 J	9.3 U	1.7 J	9.3 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	2 MW-19 DUP 12/10/99	2 MW-20 12/10/99	2 MW-21 12/10/99	2 MW-22 12/10/99	2 MW-23 12/10/99	2 MW-24 12/9/99	2 MW-25 12/9/99	
1,2,4-Trichlorobenzene	5	2.1 J	1.4 J	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	9.3 U	9.3 U	9.3 U	9.3 U	4.2 J	9.3 U	9.4 U	
Acenaphthene	0.02	9.3 U	9.3 U	9.3 U	9.3 U	1.7 J	9.3 U	9.4 U	
Acenaphthylene	0.02	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Anthracene	0.05	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Benzo(a)anthracene	0.002	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	5 J	9.4 U	
Benzo(a)pyrene	MDL	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	6.2 J	9.4 U	
Benzo(b)fluoranthene	0.002	9.3 U	9.3 U	9.3 U	1.2 J	9.3 U	13	9.4 U	
Benzo(g,h,i)perylene	ns	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	4.7 J	9.4 U	
Benzo(k)fluoranthene	0.002	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	3.4 J	9.4 U	
bis(2-Ethylhexyl)phthalate	5	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA	
Chrysene	0.002	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	7.5 J	9.4 U	
Dibenzo(a,h)anthracene	50	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	1.9 J	9.4 U	
Dibenzofuran	5	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Diethylphthalate	50	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA	
Fluoranthene	50	9.3 U	9.3 U	9.3 U	1.3 J	9.3 U	5.6 J	9.4 U	
Fluorene	50	9.3 U	9.3 U	9.3 U	9.3 U	2 J	9.3 U	9.4 U	
Indeno(1,2,3-cd)pyrene	0.002	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	4.2 J	9.4 U	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	9.3 U	9.3 U	1.4 J	9.3 U	1.1 J	9.3 U	9.4 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA	
N-Nitroso-di-n-propylamine	ns	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.3 U	9.4 U	
Phenanthrene	50	9.3 U	9.3 U	0.93 J	1.3 J	1.3 J	1.3 J	9.4 U	
Phenol	1	9.3 U	9.3 U	1.1 J	9.3 U	9.3 U	9.3 U	9.4 U	
Pyrene	50	9.3 U	9.3 U	9.3 U	1.4	9.3 U	6.8 J	9.4 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	2 MW-26 12/9/99	2 MW-27 12/10/99	2 MW-28 12/10/99	2 MW-29 12/10/99	2 MW-30 12/10/99	2 MW-30 DUP 12/10/99	2 MW-31 12/10/99	
1,2,4-Trichlorobenzene	5	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
4-Bromophenyl phenyl ether	ns	NA	NA	NA	NA	NA	NA	NA	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	11 U	9.3 U	9.6 U	9.3 U	9.3 UJ	9.3 U	9.3 U	
Acenaphthene	0.02	11 U	9.3 U	3.5 J	9.3 U	9.3 U	1.3 J	9.3 U	
Acenaphthylene	0.02	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Anthracene	0.05	11 U	9.3 U	9.6 U	9.3 U	0.93 J	0.93 J	9.3 U	
Benzo(a)anthracene	0.002	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Benzo(a)pyrene	MDL	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Benzo(b)fluoranthene	0.002	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Benzo(g,h,i)perylene	ns	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Benzo(k)fluoranthene	0.002	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
bis(2-Ethylhexyl)phthalate	5	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	1.4 J	
Carbazole	ns	NA	NA	NA	NA	NA	NA	NA	
Chrysene	0.002	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Dibenzo(a,h)anthracene	50	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Dibenzofuran	5	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Diethylphthalate	50	1.1 J	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Di-n-butylphthalate	50	NA	NA	NA	NA	NA	NA	NA	
Fluoranthene	50	11 U	1 J	0.99 J	9.3 U	2.6 J	1.6 J	9.3 U	
Fluorene	50	11 U	9.3 U	4.9 J	9.3 U	9.3 U	9.3 U	9.3 U	
Indeno(1,2,3-cd)pyrene	0.002	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	NA	NA	NA	NA	NA	NA	NA	
N-Nitroso-di-n-propylamine	ns	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Phenanthrene	50	11 U	1.3 J	1.1 J	9.3 U	2.6 J	2.2 J	9.3 U	
Phenol	1	11 U	9.3 U	9.6 U	9.3 U	9.3 U	9.3 U	9.3 U	
Pyrene	50	11 U	9.3 U	9.6 U	9.3 U	2.2 J	1.5 J	9.3 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Buytlbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	1 MW-32 12/6/00	1 MW-33 12/11/00	1 MW-33 DUP 12/11/00	1 MW-34 12/6/00	1 MW-35 12/6/00	1 MW-36 12/6/00	1 MW-36A 12/7/00	
1,2,4-Trichlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	9.3 U	1.3 J	1 J	15 B	9.3 U	9.3 U	18 B	
4-Bromophenyl phenyl ether	ns	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	NA	NA	NA	NA	NA	NA	NA	
Acenaphthene	0.02	9.3 U	10 U	9.8 U	2.5 J	8.8 J	9.3 U	4,300 J	
Acenaphthylene	0.02	NA	NA	NA	NA	NA	NA	NA	
Anthracene	0.05	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Benzo(a)anthracene	0.002	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Benzo(a)pyrene	MDL	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Benzo(b)fluoranthene	0.002	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Benzo(g,h,i)perylene	ns	NA	NA	NA	NA	NA	NA	NA	
Benzo(k)fluoranthene	0.002	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
bis(2-Ethylhexyl)phthalate	5	9.3 U	1.8 J	9.8 U	2.9 J	35	9.5	1.1 J	
Carbazole	ns	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Chrysene	0.002	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Dibenzo(a,h)anthracene	50	NA	NA	NA	NA	NA	NA	NA	
Dibenzofuran	5	9.3 U	10 U	9.8 U	9.3 U	9.3 U	2.3 J	2.9 J	
Diethylphthalate	50	9.3 U	2.3 J	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Di-n-butylphthalate	50	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Fluoranthene	50	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
Fluorene	50	9.3 U	10 U	9.8 U	4.7 J	9.3 U	6.2 J	5.0 J	
Indeno(1,2,3-cd)pyrene	0.002	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	9.3 U	10 U	9.8 U	9.3 U	9.3 U	9.3 U	9.5 U	
N-Nitroso-di-n-propylamine	ns	NA	NA	NA	NA	NA	NA	NA	
Phenanthrene	50	9.3 U	10 U	9.8 U	9.3 U	20	5.7 J	9.5 U	
Phenol	1	NA	NA	NA	NA	NA	NA	NA	
Pyrene	50	9.3 U	10 U	9.8 U	9.3 U	4.9 J	9.3 U	9.5 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	1 MW-37 12/6/00	1 MW-38 12/6/00	1 MW-38 12/6/00	1 MW-39 12/7/00	1 MW-40 12/7/00	1 MW-41 12/7/00	1 MW-42 12/8/00	
1,2,4-Trichlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	110 U	39,000	
4-Bromophenyl phenyl ether	ns	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	NA	NA	NA	NA	NA	NA	NA	
Acenaphthene	0.02	9.3 U	9.3 U	9.3 U	9.4 U	3.8 J	2.8 J	3.8 J	
Acenaphthylene	0.02	NA	NA	NA	NA	NA	NA	NA	
Anthracene	0.05	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
Benzo(a)anthracene	0.002	9.3 U	9.3 U	9.3 U	9.4 U	9.3 UJ	9.3 UJ	9.3 U	
Benzo(a)pyrene	MDL	9.3 U	9.3 U	9.3 U	9.4 U	9.3 UJ	9.3 U	9.3 U	
Benzo(b)fluoranthene	0.002	9.3 U	9.3 U	9.3 U	9.4 U	9.3 UJ	9.3 UJ	9.3 U	
Benzo(g,h,i)perylene	ns	NA	NA	NA	NA	NA	NA	NA	
Benzo(k)fluoranthene	0.002	9.3 U	9.3 U	9.3 U	9.4 U	9.3 UJ	9.3 UJ	9.3 U	
bis(2-Ethylhexyl)phthalate	5	2.6 J	2.6 J	2.5 J	9.4 U	9.3 UJ	9.3 UJ	9.3 U	
Carbazole	ns	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
Chrysene	0.002	9.3 U	9.3 U	9.3 U	9.4 U	9.3 UJ	9.3 UJ	9.3 U	
Dibenzo(a,h)anthracene	50	NA	NA	NA	NA	NA	NA	NA	
Dibenzofuran	5	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
Diethylphthalate	50	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	1.0 J	
Di-n-butylphthalate	50	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
Fluoranthene	50	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
Fluorene	50	9.3 U	2.6 J	9.3 U	9.4 U	1.1 J	3.2 J	4.2 U	
Indeno(1,2,3-cd)pyrene	0.002	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
N-Nitroso-di-n-propylamine	ns	NA	NA	NA	NA	NA	NA	NA	
Phenanthrene	50	9.3 U	1.9 J	1.7 J	9.4 U	9.3 U	2.1 J	1.3 J	
Phenol	1	NA	NA	NA	NA	NA	NA	NA	
Pyrene	50	9.3 U	9.3 U	9.3 U	9.4 U	9.3 U	9.3 U	9.3 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date								
Source: Sample ID: Sample Date:	NYS DEC TOGS 1.1.1 Class GA	1 MW-43 12/8/00	1 MW-44 5/31/01	1 MW-45 5/31/01	1 MW-45 5/31/01	1 TMW-1 12/5/00	1 TMW-3 11/14/00	1 TMW-4 12/5/00	
1,2,4-Trichlorobenzene	5	NA	NA	NA	NA	NA	NA	NA	
1,3,5-Trimethylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
2-Methylnaphthalene	ns	9.3 U	10 U	10 U	10 U	2.3 J	3.1 J	9.3 U	
4-Bromophenyl phenyl ether	ns	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
4-Isopropyltoluene	5	NA	NA	NA	NA	NA	NA	NA	
4-Methylphenol	1	NA	NA	NA	NA	NA	NA	NA	
Acenaphthene	0.02	9.3 U	10 U	7.8 J	7	4.4 J	9.3 U	9.3 U	
Acenaphthylene	0.02	NA	NA	NA	NA	NA	NA	NA	
Anthracene	0.05	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
Benzo(a)anthracene	0.002	9.3 U	10 U	10 U	10 U	9.4 U	2.5 J	9.3 U	
Benzo(a)pyrene	MDL	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
Benzo(b)fluoranthene	0.002	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
Benzo(g,h,i)perylene	ns	NA	NA	NA	NA	NA	NA	NA	
Benzo(k)fluoranthene	0.002	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
bis(2-Ethylhexyl)phthalate	5	2.3 J	10 U	10 U	10 U	2.4 J	4.5 JB	4.5 J	
Carbazole	ns	9.3 U	NA	NA	NA	9.4 U	9.3 U	9.3 U	
Chrysene	0.002	9.3 U	10 U	10 U	10 U	9.4 U	3.8 J	9.3 U	
Dibenzo(a,h)anthracene	50	NA	NA	NA	NA	NA	NA	NA	
Dibenzofuran	5	9.3 U	10 U	4.4 J	4.2 J	9.4 U	9.3 U	9.3 U	
Diethylphthalate	50	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
Di-n-butylphthalate	50	9.3 U	10 U	10 U	10 U	9.4 U	2.4 J	9.3 U	
Fluoranthene	50	9.3 U	10 U	10 U	10 U	9.4 U	9.3 U	9.3 U	
Fluorene	50	9.3 U	10 U	9.9 J	9.6 J	9.4 U	9.3 U	9.3 U	
Indeno(1,2,3-cd)pyrene	0.002	NA	NA	NA	NA	NA	NA	NA	
Isopropylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
Naphthalene	10	9.3 U	10 U	10 U	10 U	9.4 U	2.4 J	9.3 U	
n-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
n-Propylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
N-nitroso-di-phenylamine	50	9.3 U	10 U	10 U	10 U	2.1 J	9.3 U	9.3 U	
N-Nitroso-di-n-propylamine	ns	NA	NA	NA	NA	NA	NA	NA	
Phenanthrene	50	9.3 U	10 U	5.9 J	6.6 J	2.7 J	9.3 U	9.3 U	
Phenol	1	NA	NA	NA	NA	NA	NA	NA	
Pyrene	50	9.3 U	10 U	10 U	10 U	9.4 U	8.7 J	9.3 U	
sec-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	
tert-Butylbenzene	5	NA	NA	NA	NA	NA	NA	NA	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Groundwater Samples

Table 3b - Summary of Semivolatile Organic Compound (SVOC) Results (EPA Method 8270)

Analyte	Sample Collection Designation & Collection Date		
	Source:	1	1
	Sample ID:	TMW-5	TMW-8
	Sample Date:	12/5/00	12/5/00
	NYS DEC TOGS 1.1.1 Class GA		
1,2,4-Trichlorobenzene	5	NA	NA
1,3,5-Trimethylbenzene	5	NA	NA
2-Methylnaphthalene	ns	7.0 J	8,100 D
4-Bromophenyl phenyl ether	ns	9.8 U	50 U
4-Isopropyltoluene	5	NA	NA
4-Methylphenol	1	NA	NA
Acenaphthene	0.02	12	190 J
Acenaphthylene	0.02	NA	NA
Anthracene	0.05	3.2 J	360
Benzo(a)anthracene	0.002	9.8 U	50 U
Benzo(a)pyrene	MDL	9.8 U	50 U
Benzo(b)fluoranthene	0.002	9.8 U	50 U
Benzo(g,h,i)perylene	ns	NA	NA
Benzo(k)fluoranthene	0.002	9.8 U	50 U
bis(2-Ethylhexyl)phthalate	5	9.8 U	50 U
Carbazole	ns	9.8 U	50 U
Chrysene	0.002	9.8 U	50 U
Dibenzo(a,h)anthracene	50	NA	NA
Dibenzofuran	5	9.8 U	50 U
Diethylphthalate	50	9.8 U	50 U
Di-n-butylphthalate	50	2.2 J	50 U
Fluoranthene	50	2.1 J	33 J
Fluorene	50	14	280 J
Indeno(1,2,3-cd)pyrene	0.002	NA	NA
Isopropylbenzene	5	NA	NA
Naphthalene	10	9.8 U	50 U
n-Butylbenzene	5	NA	NA
n-Propylbenzene	5	NA	NA
N-nitroso-di-phenylamine	50	9.8 U	50 U
N-Nitroso-di-n-propylamine	ns	NA	NA
Phenanthrene	50	22	1,300 D
Phenol	1	NA	NA
Pyrene	50	4.0 J	96
sec-Butylbenzene	5	NA	NA
tert-Butylbenzene	5	NA	NA

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 13.

Notes:

ns = No standard. Value is not available in TOGS.

NA = Sample was not analyzed for this constituent.

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the practical quantitation limit (PQL).

when the data evaluation procedure identifies a deficiency in the data generation process.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process.

The data should not be used for any qualitative or quantitative purposes.

U = Identifies all compounds that were not detected.

D = Identifies all compounds analyzed at a secondary dilution.

Groundwater Samples
Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	2	2	2	2	
Sample ID:	TOGS 1.1.1	DP-BG1	DP-BG1	DP-BG1 (filtered)	EVIMW-1	EVIMW-1 (filtered)	EVIMW-1	EVIMW-2	
Sample Date:	Class GA	5/31/01	6/5/01	6/5/01	12/8/99	12/8/99	1/17/00	12/8/99	
Aroclor-1242	ns	0.5 U	0.5 U	0.5 U	0.35 U	0.05 U	0.05 U	0.05 U	
Aroclor-1248	ns	NA	NA	NA	0.35 U	0.05 U	0.05 U	0.05 U	
Aroclor-1254	ns	0.5 U	0.5 U	0.5 U	8.8	0.05 U	0.063	1.3	
Aroclor-1260	ns	0.5 U	0.5 U	0.5 U	6.1	0.05 U	0.05 U	1.1	
Total PCBs	0.09	0.5 U	0.5 U	0.5 U	15	0.05 U	0.063	2.4	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	1	1	1	2	2
Sample ID:	TOGS 1.1.1	EVIMW-2 (filtered)	EVIMW-2	EVIMW-2	EVIMW-2	EVIMW-2 (filtered)	EVIMW-6	EVIMW-6 (filtered)
Sample Date:	Class GA	12/8/99	1/12/00	12/11/00	5/30/01	12/11/00	12/8/1999	12/8/1999
Aroclor-1242	ns	0.05 U	0.05 U	0.5 U	0.5 U	0.05 U	0.05 U	0.05 U
Aroclor-1248	ns	0.05 U	0.05 U	NA	NA	NA	0.05 U	0.05 U
Aroclor-1254	ns	0.05 U	0.05 U	7.1	0.5 U	0.12	1.5	0.05 U
Aroclor-1260	ns	0.05 U	0.05 U	3.5	0.5 U	0.05 U	1 NA	0.05 U
Total PCBs	0.09	0.05 U	0.05 U	10.6	0.5 U	0.12	2.5	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	5	2	2	4	2	2
Sample ID:	TOGS 1.1.1	EVIMW-6	EVIMW-8	EVIMW-8	EVIMW-8 (filtered)	MW-1	MW-2	MW-2 (filtered)
Sample Date:	Class GA	1/17/00	6/6/1997	12/8/99	12/8/99	5/5/1994	11/29/99	11/29/99
Aroclor-1242	ns	0.05 U	NA	0.05 U	0.05 U	1.3 U	0.15 U	0.05 U
Aroclor-1248	ns	0.05 U	0.082	0.05 U	0.05 U	1.3 U	0.15 U	0.05 U
Aroclor-1254	ns	0.05 U	NA	1	0.05 U	1.3 U	3.7 I	0.05 U
Aroclor-1260	ns	0.05 U	NA	0.64	0.05 U	193.5	1.4	0.05 U
Total PCBs	0.09	0.05 U	NA	1.6	0.05 U	193.5	5.1	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	1	1	2
Sample ID:	TOGS 1.1.1	MW-3	MW-3 (filtered)	MW-3	MW-3 DUP (filtered)	MW-3	MW-3 (filtered)	MW-4
Sample Date:	Class GA	11/29/99	11/29/99	1/20/00	11/29/99	12/11/00	12/11/00	12/8/99
Aroclor-1242	ns	0.54 U	0.05 U	0.05 U	0.05 U	0.050 U	0.5 U	0.05 U
Aroclor-1248	ns	0.54 U	0.05 U	0.05 U	0.05 U	NA	NA	0.05 U
Aroclor-1254	ns	16 I	0.05 U	0.069 I	0.05 U	0.43	0.5 U	1.5
Aroclor-1260	ns	4.4	0.05 U	0.05 U	0.05 U	0.26	0.5 U	1.1
Total PCBs	0.09	20	0.05 U	0.069	0.05 U	0.66	0.5 U	2.6

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	2	1	1	1	1	2	2
Sample ID:	TOGS 1.1.1	MW-4 (filtered)	MW-4	MW-4	MW-4 (filtered)	MW-4 (filtered)	MW-4	MW-5
Sample Date:	Class GA	12/8/99	12/11/00	6/1/01	12/11/2000	6/1/2001	1/12/00	11/29/99
Aroclor-1242	ns	0.05 U	1.5 U	0.5 U	0.05 U	0.5 U	0.05 U	0.15 U
Aroclor-1248	ns	0.05 U	NA	NA	NA	NA	0.05 U	0.15 U
Aroclor-1254	ns	0.05 U	18.6	0.24 J	0.05 U	0.5 U	0.05 U	4.6 I
Aroclor-1260	ns	0.05 U	15	0.064 J	0.05 U	0.5 U	0.05 U	1.4
Total PCBs	0.09	0.05 U	34	0.304	0.05 U	0.5 U	0.05 U	6

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-5 (filtered)	MW-6	MW-6 (filtered)	MW-7	MW-7 (filtered)	MW-8	MW-8 (filtered)
Sample Date:	Class GA	11/29/99	12/6/99	12/6/99	12/01/99	12/01/99	12/6/99	12/6/99
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.1 U	0.05 U
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.1 U	0.05 U
Aroclor-1254	ns	0.05 U	1.5	0.05 U	0.59	0.05 U	2	0.05 U
Aroclor-1260	ns	0.05 U	0.05	0.05 U	0.21	0.05 U	1.3	0.05 U
Total PCBs	0.09	0.05 U	2	0.05 U	0.8	0.05 U	3.3	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2	
Sample ID:	TOGS 1.1.1	MW-8	MW-8 (filtered)	MW-11	MW-11 (filtered)	MW-12	MW-12 (filtered)	MW-12D	
Sample Date:	Class GA	1/14/00	1/14/00	11/29/99	11/29/99	12/1/99	12/1/99	12/1/99	
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.2	
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.2	
Aroclor-1254	ns	0.67	0.05 U	1.1 I	0.05 U	0.33	0.05 U	3.1	
Aroclor-1260	ns	0.33	0.05 U	0.37	0.05 U	0.2	0.05 U	2	
Total PCBs	0.09	1	0.05 U	1.5	0.05 U	0.53	0.05 U	5.1	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-12D (filtered)	MW-12D	MW-13	MW-13 (filtered)	MW-14	MW-14 (filtered)	MW-15
Sample Date:	Class GA	12/1/99	1/12/00	12/1/99	12/1/99	12/1/99	12/1/99	12/8/99
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.2 U
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.2 U
Aroclor-1254	ns	0.05 U	0.05 U	0.14	0.05 U	0.15	0.05 U	5
Aroclor-1260	ns	0.05 U	0.05 U	0.054	0.05 U	0.071	0.05 U	4.5
Total PCBs	0.09	0.05 U	0.05 U	0.19	0.05 U	0.22	0.05 U	9.5

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-15 (filtered)	MW-15	MW-16	MW-16 (filtered)	MW-17	MW-17 (filtered)	MW-17
Sample Date:	Class GA	12/8/99	1/14/00	12/1/99	12/1/99	12/10/99	12/10/99	1/13/00
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.4 U	0.05 U	0.05 U
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.4 U	0.05 U	0.05 U
Aroclor-1254	ns	0.05 U	0.05 U	0.38	0.05 U	11	0.05 U	1.8
Aroclor-1260	ns	0.05 U	0.05 U	0.19	0.05 U	2.1	0.05 U	0.4 J
Total PCBs	0.09	0.05 U	0.05 U	0.57	0.05 U	13	0.05 U	2.2

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	2	2	2	2	1	2	2
Sample ID:	TOGS 1.1.1	MW-17 (filtered)	MW-18	MW-18 (filtered)	MW-18	MW-18	MW-18 DUP	MW-19
Sample Date:	Class GA	1/13/00	12/9/99	12/9/99	12/8/00	1/13/00	1/13/00	12/10/99
Aroclor-1242	ns	0.05 U	0.1 U	0.05 U	0.050 U	0.053	0.05 U	0.2 U
Aroclor-1248	ns	0.05 U	0.1 U	0.05 U	NA	0.053 U	0.05 U	0.2 U
Aroclor-1254	ns	0.05 U	2.3	0.05 U	0.050 U	0.053 U	0.05 U	3.9 J
Aroclor-1260	ns	0.05 U	1	0.05 U	0.050 U	0.053 U	0.05 U	0.55 J
Total PCBs	0.09	0.05 U	3.3	0.05 U	0.050 U	0.053	0.05 U	4.5

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	1	2	2	2	2	1
Sample ID:	TOGS 1.1.1	MW-19 (filtered)	MW-19	MW-19	MW-19 (filtered)	MW-19 DUP	MW-19 DUP (filtered)	MW-19
Sample Date:	Class GA	12/10/99	12/8/00	1/14/00	1/14/00	12/10/99	12/10/99	5/30/01
Aroclor-1242	ns	0.052 U	0.050 U	0.05 U	0.053 U	0.15 U	0.05 U	0.5 U
Aroclor-1248	ns	0.19 I	NA	0.05 U	0.062 I	0.15 U	0.05 U	NA
Aroclor-1254	ns	0.11 I	0.050 U	0.37	0.084 I	2.2 J	0.05 U	0.1 J
Aroclor-1260	ns	0.052 U	0.050 U	0.05 U	0.053 U	0.28 J	0.15 I	0.13 J
Total PCBs	0.09	0.3	0.050 U	0.37	0.15	2.5	0.15	0.23

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	2	2	1	1	1	2
Sample ID:	TOGS 1.1.1	MW-19 (filtered)	MW-20	MW-20 (filtered)	MW-20	MW-20	MW-20 (filtered)	MW-20
Sample Date:	Class GA	5/30/01	12/10/99	12/10/99	12/8/00	5/30/01	12/8/00	1/14/00
Aroclor-1242	ns	0.5 U	0.2 U	0.05 U	0.051 U	0.5 U	0.054 U	0.05 U
Aroclor-1248	ns	NA	0.2 U	0.095 I	NA	NA	NA	0.05 U
Aroclor-1254	ns	0.5 U	4.9	0.076 I	0.56	0.5 U	0.062	0.99
Aroclor-1260	ns	0.5 U	0.7	0.05 U	0.3	0.5 U	0.054 U	0.099
Total PCBs	0.09	0.5 U	5.6	0.17	0.86	0.5 U	0.062	1.1

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date					
Source:	NYSDEC	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-20 (filtered)	MW-21 (filtered)	MW-21	MW-21	MW-22 (filtered)	MW-22
Sample Date:	Class GA	1/14/00	12/10/99	12/10/99	1/14/00	12/10/99	1/17/00
Aroclor-1242	ns	0.05 U	0.051 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1248	ns	0.072 I	0.051 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1254	ns	0.05 U	0.051 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1260	ns	0.05 U	0.051 U	0.05 U	0.05 U	0.05 U	0.05 U
Total PCBs	0.09	0.072	0.051 U	0.05 U	0.05 U	0.05 U	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples
Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2	
Sample ID:	TOGS 1.1.1	MW-23	MW-24	MW-24 (filtered)	MW-25	MW-25 (filtered)	MW-25	MW-26	
Sample Date:	Class GA	12/10/99	12/9/99	12/9/99	12/9/99	12/9/99	1/12/00	12/9/99	
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.052 U	0.05 U	0.05 U	
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.052 U	0.05 U	0.05 U	
Aroclor-1254	ns	0.05 U	0.05 U	0.05 U	0.28	0.052 U	0.05 U	0.13	
Aroclor-1260	ns	0.05 U	0.05 U	0.05 U	0.093	0.052 U	0.05 U	0.059	
Total PCBs	0.09	0.05 U	0.05 U	0.05 U	0.37	0.052 U	0.05 U	0.19	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
 See notes on page 25.

Groundwater Samples
Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2	
Sample ID:	TOGS 1.1.1	MW-26 (filtered)	MW-27	MW-27 (filtered)	MW-28	MW-28 (filtered)	MW-29	MW-29 (filtered)	
Sample Date:	Class GA	12/9/99	12/10/99	12/10/99	12/10/99	12/10/99	12/10/99	12/10/99	
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1248	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1254	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1260	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U
Total PCBs	0.09	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	2	2	2	2	2	2	1
Sample ID:	TOGS 1.1.1	MW-30	MW-30 (filtered)	MW-30 DUP (filtered)	MW-30 DUP	MW-31(filtered)	MW-31	MW-32
Sample Date:	Class GA	12/10/99	12/10/99	12/10/99	12/10/99	12/10/99	12/10/99	12/6/00
Aroclor-1242	ns	0.05 U	0.05 U	0.052 U	0.05 U	0.051 U	0.05 U	0.05 U
Aroclor-1248	ns	0.05 U	0.05 U	0.052 U	0.05 U	0.051 U	0.05 U	NA
Aroclor-1254	ns	0.05 U	0.05 U	0.052 U	0.05 U	0.051 U	0.05 U	0.05 U
Aroclor-1260	ns	0.05 U	0.05 U	0.052 U	0.05 U	0.051 U	0.05 U	0.05 U
Total PCBs	0.09	0.05 U	0.05 U	0.052 U	0.05 U	0.051 U	0.05 U	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	MW-33	MW-33 (filtered)	MW-33 (filtered)	MW-33 DUP	MW-34	MW-35	MW-35
Sample Date:	Class GA	12/11/00	12/11/00	12/11/00	12/11/00	12/6/00	12/6/00	5/31/01
Aroclor-1242	ns	0.050 U	0.05 U	0.05 U	0.050 U	0.05 U	0.05 U	0.5 U
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1254	ns	0.65	0.076	0.05 U	0.88	0.05 U	0.05 U	0.5 U
Aroclor-1260	ns	0.22	0.05 U	0.05 U	0.31	0.05 U	0.05 U	0.5 U
Total PCBs	0.09	0.87	0.076	0.05 U	1.2	0.05 U	0.14	0.5 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1	
Sample ID:	TOGS 1.1.1	MW-35 (filtered)	MW-45	MW-45	MW-46	MW-47	MW-48	TMW_1 (filtered)	
Sample Date:	Class GA	12/6/00	5/31/01	5/31/01	5/30/01	6/1/01	5/31/01	12/5/00	
Aroclor-1242	ns	0.05 U	0.5 U	0.5 U	2.5 U	0.5 U	0.5 U	0.05 U	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.05 U	0.5 U	0.5 U	2.5 U	0.5 U	0.5 U	0.05 U	
Aroclor-1260	ns	0.05 U	0.5 U	0.5 U	2.5 U	0.5 U	0.5 U	0.05 U	
Total PCBs	0.09	0.05 U	0.5 U	0.5 U	2.5 U	0.5 U	0.5 U	0.05 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1	
Sample ID:	TOGS 1.1.1	TMW-3 (filtered)	TMW-4 (filtered)	TMW-5 (filtered)	TMW-6 (filtered)	TMW-7 (filtered)	TMW-8 (filtered)	TMW-19C (DEEP[filtered])	
Sample Date:	Class GA	11/14/00	12/5/00	12/5/00	12/5/00	12/5/00	12/5/00	12/4/00	
Aroclor-1242	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.053 U	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.053 U	
Aroclor-1260	ns	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.053 U	
Total PCBs	0.09	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.053 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	TMW-19C (MID[filtr.])	TMW-19D (filtered)	TMW-19E (filtered)	TMW-19F (filtered)	TMW-19G (DEEP[filtr.])	TMW-19G (filtered)	TMW-19G (MID[filtr.])
Sample Date:	Class GA	12/4/00	11/8/00	11/8/00	11/8/00	12/4/00	11/8/00	11/8/00
Aroclor-1242	ns	0.054 U	0.056 U	0.051 U	0.05 U	0.053 U	0.05 U	0.053 U
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1254	ns	0.054 U	0.056 U	0.051 U	0.05 U	0.053 U	0.05 U	0.053 U
Aroclor-1260	ns	0.054 U	0.056 U	0.051 U	0.05 U	0.053 U	0.05 U	0.053 U
Total PCBs	0.09	0.054 U	0.056 U	0.051 U	0.05 U	0.053 U	0.05 U	0.053 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1	
Sample ID:	TOGS 1.1.1	TMW-19H (filtered)	TMW-19I (filtered)	TMW-19J (filtered)	TMW-19J DUP (filtered)	TMW-19K (DEEP[filtered])	TMW-19K (filtered)	TMW-19K (MID[filtered])	
Sample Date:	Class GA	11/8/00	11/9/00	11/15/00	11/15/00	12/4/00	11/15/00	12/4/00	
Aroclor-1242	ns	0.055 U	0.05 U	0.051 U	0.052 U	0.054 U	0.052 U	0.076 U	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.055 U	0.05 U	0.051 U	0.052 U	0.054 U	0.052 U	0.076 U	
Aroclor-1260	ns	0.055 U	0.05 U	0.051 U	0.052 U	0.054 U	0.052 U	0.076 U	
Total PCBs	0.09	0.055 U	0.05 U	0.051 U	0.052 U	0.054 U	0.052 U	0.076 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	TMW-19L (filtered)	TMW-19M (filtered)	TMW-3 (filtered)	TMW-4 (filtered)	TMW-5 (filtered)	TMW-6 (filtered)	TMW-7 (filtered)	
Sample Date:	Class GA	11/15/00	11/15/00	11/14/00	12/5/00	12/5/00	12/5/00	12/5/00	
Aroclor-1242	ns	0.053 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.053 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	
Aroclor-1260	ns	0.053 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	
Total PCBs	0.09	0.053 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date						
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	TMW-8 (filtered)	MW-36	MW-36 (filtered)	MW-36A	MW-36A (filtered)	MW-37	MW-37 (filtered)
Sample Date:	Class GA	12/5/00	12/6/00	12/6/00	12/7/00	12/7/00	12/6/00	12/6/00
Aroclor-1242	ns	0.05 U	0.15 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA
Aroclor-1254	ns	0.05 U	1.4	0.05 U	0.13	0.05 U	0.25	0.05 U
Aroclor-1260	ns	0.05 U	1.4	0.05 U	0.05 U	0.05 U	0.18	0.05 U
Total PCBs	0.09	0.05 U	2.8	0.05 U	0.13	0.05 U	0.43	0.05 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples
Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte		Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1	
Sample ID:	TOGS 1.1.1	MW-38	MW-38	MW-39	MW-40	MW-41	MW-42	MW-43	
Sample Date:	Class GA	12/6/00	12/6/00	12/7/00	12/7/00	12/7/00	12/8/00	12/8/00	
Aroclor-1242	ns	0.050 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	
Aroclor-1248	ns	NA	NA	NA	NA	NA	NA	NA	
Aroclor-1254	ns	0.050 U	0.05 U	0.05 U	0.071	0.05 U	0.05 U	0.05 U	
Aroclor-1260	ns	0.050 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	
Total PCBs	0.09	0.050 U	0.05 U	0.05 U	0.071	0.05 U	0.05 U	0.05 U	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
See notes on page 25.

Groundwater Samples

Table 3c - Summary of Polychlorinated Biphenyls (PCBs) Results (EPA Method 8082)

Analyte	Sample Collection Designation & Collection Date	
Source:	NYSDEC	1
Sample ID:	TOGS 1.1.1	MW-44
Sample Date:	Class GA	5/31/01
Aroclor-1242	ns	0.5 U
Aroclor-1248	ns	NA
Aroclor-1254	ns	0.5 U
Aroclor-1260	ns	0.5 U
Total PCBs	0.09	0.5 U

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

Notes:

All groundwater samples collected using low-flow purging/sampling, except those collected at the DP-BG1 location. During drilling at this location, a groundwater sample was collected on 5/31/01 using a Hydropunch® (20-20.3 feet below the ground surface [BGS]). After a temporary well was installed at the DP-BG1 location, another groundwater sample was collected on 6/5/01 using a disposable bailer (10.7-15.7 feet BGS).

Groundwater samples tested for dissolved PCBs were passed through a 0.45 micron filter.

NA = Sample was not analyzed for this constituent.

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the practical quantitation limit (PQL).

ns = No standard. Value is not available in TOGS.

U = Identifies all compounds that were not detected.

Groundwater Samples

Table 3d - Summary of Total Petroleum Hydrocarbon (TPH) Results

Analyte		Sample Collection Designation & Collection Date					
Source:	NYSDEC	3	3	3	3	3	3
Sample ID:	TOGS 1.1.1	MW-1	MW-2	MW-3	MW-4	MW-4D	MW-5
Sample Date:	Class GA	9/2/92	9/2/92	9/2/92	9/2/92	9/2/92	9/2/92
Total Petroleum Hydrocarbons		ns	832	4.6	174	32,200	12,800
							37.4

All results reported in milligrams per Liter (mg/L), or parts per million (ppm).

Notes:
ns = No standard. Value is not available in TOGS.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	5	2	2	5	2	5	2
Sample ID:	TOGS 1.1.1	EVIMW-1	EVIMW-1	EVIMW-1	EVIMW-2	EVIMW-2	EVIMW-3	EVIMW-6
Sample Date:	Class GA	7/24/96	12/8/99	1/17/00	7/24/96	12/8/99	7/24/96	12/8/99
Aluminum	ns	NA	76,500 *	5,230	NA	10,700 *	NA	9,690 *
Antimony	3	NA	30.8 U	30.8 U	NA	30.8 U	NA	30.8 U
Arsenic	25	NA	33.9 J	6.6 UW	NA	R	NA	14.4 J
Barium	1,000	NA	630	136	NA	19.2	NA	193
Beryllium	3	NA	3.7 U	3.7 U	NA	3.7 U	NA	3.7 U
Cadmium	5	NA	4.6 U	4.6 U	NA	4.6 U	NA	4.6 U
Calcium	ns	NA	244,000	161,000	NA	60,000	NA	196,000
Chromium	50	NA	131	14.4	NA	4.6 U	NA	4.6 U
Cobalt	ns	NA	31	22 U	NA	22 U	NA	22 U
Copper	200	14 U	89.2	13.2 U	15	38.8	14 U	18.6
Iron	300	NA	77,500	5,540	NA	2,970	NA	18,800
Lead	25	NA	41.8 S	3.3 U	NA	7.3	NA	15.8
Magnesium	35,000	NA	80,400	68,300	NA	12,100	NA	32,800
Manganese	300	NA	2,500	378 J	NA	9.8	NA	627
Mercury	0.7	NA	0.39	0.2 U	NA	0.2 U	NA	0.2 U
Nickel	100	16 U	80.1 *	17.6 U	16 U	63.1 *	16	17.6 U*
Potassium	ns	NA	36,900	12,300	NA	5.3	NA	16,600
Selenium	10	NA	330 UJ	3.3 UJ	NA	330 UJ	NA	330 UJ
Sodium	20,000	NA	134,000	106,000	NA	19,500	NA	37,600 U
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	NA	142	22 U	NA	22 U	NA	22 U
Zinc	2,000	7.4 U	213 J	22 J	14	30.5 J	26	255 J

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	6	2	4	4	2	4	2
Sample ID:	TOGS 1.1.1	EVIMW-8	EVIMW-8	MW-1	MW-2	MW-2	MW-3	MW-3
Sample Date:	Class GA	6/6/1997	12/8/99	5/5/94	5/5/94	11/29/99	5/5/94	11/29/99
Aluminum	ns	NA	957 *	NA		1,150	NA	130 U
Antimony	3	NA	30.8 U	10 U	10 U	30.8 U	12	30.8 U
Arsenic	25	10	65.2 J	6 U	7	24.8 J	6 U	6.6 U
Barium	1,000	NA	59.7	NA	NA	134 B	NA	79.2 B
Beryllium	3	NA	3.7 U	NA	NA	3.7 U	NA	3.7 U
Cadmium	5	NA	4.6 U	10 U	10	4.6 U	10 U	4.6 U
Calcium	ns	NA	92,500	NA	NA	181,000 J	NA	76,900 J
Chromium	50	NA	4.6 U	NA	NA	4.6 U	NA	4.6 U
Cobalt	ns	NA	22 U	NA	NA	22 U	NA	22 U
Copper	200	NA	75.7	39	52	13.2 U	52	13.2 U
Iron	300	NA	38,000	NA	NA	47,100	NA	35,700
Lead	25	NA	8.4	7	17	4.2	92	5.6
Magnesium	35,000	NA	18,300	NA	NA	1,310 J	NA	12,000 J
Manganese	300	NA	376	NA	NA	20,000 J	NA	564 J
Mercury	0.7	NA	0.2 U	0.2 U	0.2 U	0.22 U	2 U	0.2 U
Nickel	100	NA	17.6 U*	40 U	40 U	17.6 U	40 U	21,900 J
Potassium	ns	NA	7,360	NA	NA	11,100	NA	3,940 B
Selenium	10	NA	3.3 U	NA	NA	3.3 U	NA	3.3 U
Sodium	20,000	NA	26,100	NA	NA	130,000	NA	17,800
Thallium	0.5	NA	NA	6 U	6 U	NA	6 U	NA
Vanadium	ns	NA	22 U	NA	NA	22 U	NA	22 U
Zinc	2,000	NA	92.8 J	28	44	13.4 J	36	8.8 UN*

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	4	2	2	4	2	4	2
Sample ID:	TOGS 1.1.1	MW-4	MW-4	MW-4	MW-5	MW-5	MW-6	MW-6
Sample Date:	Class GA	5/5/94	12/8/99	1/12/2000	5/5/94	11/29/1999	5/5/94	12/6/1999
Aluminum	ns	NA	217 *	251	NA	2,730 J	NA	1,210 J
Antimony	3	10 U	30.8 U	30.8 U	10 U	30.8 U	10 U	30.8 U
Arsenic	25	54	128 J	87.4	25	84 J	8	11.8 J
Barium	1,000	NA	265	278	NA	210 B	NA	247
Beryllium	3	NA	3.7 U	3.7 U	NA	3.7 U	NA	3.7 U
Cadmium	5	11	4.6 U	4.6 U	11	4.6 U	12	4.6 U
Calcium	ns	NA	87,000	96,700	NA	117,000	NA	152,000 J
Chromium	50	NA	4.6 U	11.1	NA	4.6 U	NA	4.6 U
Cobalt	ns	NA	22 U	22 U	NA	22 U	NA	22 U
Copper	200	20 U	13.2 U	19.2	21	13.2 U	44	16.2 B
Iron	300	NA	52,800	72,000	NA	25,700	NA	34,500
Lead	25	3 U	4.1	3.3 U	10	5.6	12	14.1
Magnesium	35,000	NA	16,000	18,000	NA	17,600 J	NA	18,200 J
Manganese	300	NA	1,300	1,950	NA	4,110 J	NA	604 J
Mercury	0.7	0.2 U	0.2 U	0.2 U	0.2 U	0.24	0.2 U	0.35
Nickel	100	40 U	17.6 U*	33.6	40 U	17.6 U	40 U	17.6 U
Potassium	ns	NA	6,120	6,950 J	NA	5,010 B	NA	1,350 B
Selenium	10	NA	33 UJ	3.3 UJ	NA	3.3 U	NA	16.5 UJ
Sodium	20,000	NA	21,000	23,600	NA	18,100	NA	125,000
Thallium	0.5	6 U	NA	NA	6 U	NA	6 U	NA
Vanadium	ns	NA	22 U	22 U	NA	22 U	NA	22 U
Zinc	2,000	23	175 J	77.8	30	10.6 J	75	R

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	4	2	4	2	2	2	4
Sample ID:	TOGS 1.1.1	MW-7	MW-7	MW-8	MW-8	MW-8	MW-8 (filtered)	MW-9
Sample Date:	Class GA	5/5/94	12/1/99	5/5/94	12/6/99	1/14/00	1/14/00	5/5/94
Aluminum	ns	NA	3,370 J	NA	5,940 J	45,100 J	130 U	NA
Antimony	3	10 U	30.8 U	10 U	30.8 U	30.8 U	30.8 U	10 U
Arsenic	25	36	26 J	20	23.3 J	107	19	6 U
Barium	1,000	NA	226	NA	215 B	713	120	NA
Beryllium	3	NA	3.7 U	NA	3.7 U	3.7 U	3.7 U	NA
Cadmium	5	12	4.6 U	10 U	4.6 U	5.3	4.6 U	10
Calcium	ns	NA	139,000 J	NA	128,000 J	141,000	105,000	NA
Chromium	50	NA	4.6 U	NA	32.6	211 *	4.6 U	NA
Cobalt	ns	NA	22 U	NA	22 U	66.7	22 U	NA
Copper	200	230	13.2 U	130	34.2	398	13.2 U	20 U
Iron	300	NA	47,600	NA	55,000	165,000	46,000	NA
Lead	25	270	12.3	72	127	471	3.3 U	6
Magnesium	35,000	NA	14,700 J	NA	14,100 J	31,000	12,700	NA
Manganese	300	NA	287 J	NA	244 J	1,340	390 J	NA
Mercury	0.7	0.6	0.2 U	0.2 U	0.24	0.8	0.2 U	0.2 U
Nickel	100	87	17.6 U	58	17.6 U	138	17.6 U	40 U
Potassium	ns	NA	7,410	NA	10,100	13,200	7,090	NA
Selenium	10	NA	3.3 U	NA	16.5 UJ	33 UJ	3.3 UJ	NA
Sodium	20,000	NA	71,300	NA	80,000	69,100	61,300	NA
Thallium	0.5	6 U	NA	6 U	NA	NA	NA	6 U
Vanadium	ns	NA	22 U	NA	22 U	151	22 U	NA
Zinc	2,000	620	212 J	180	R	735 J	9.2	20

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date								
Source:	NYSDEC	4	4	2	4	2	2	2	
Sample ID:	TOGS 1.1.1	MW-10	MW-11	MW-11	MW-12	MW-12	MW-12D	MW-13	
Sample Date:	Class GA	5/5/94	5/5/94	11/29/99	5/5/94	12/1/99	12/1/99	12/1/99	
Aluminum	ns	NA	NA	1,250 J	NA	836	1,430 J	4,450 J	
Antimony	3	10 U	10 U	30.8 U	10 U	30.8 U	30.8 U	30.8 U	
Arsenic	25	6 U	6 U	16.9 J	10	6.6 UWN	6.6 UN	6.6 UN	
Barium	1,000	NA	NA	75.4 B	NA	64.5 B	72.2 B	78 B	
Beryllium	3	NA	NA	3.7 U	NA	3.7 U	3.7 U	3.7 U	
Cadmium	5	12	10 U	5.3 B	17	4.6 U	4.6 U	4.6 U	
Calcium	ns	NA	NA	50,300 J	NA	96,800 J	211,000	150,000 J	
Chromium	50	NA	NA	4.6 U	NA	4.6 U	4.6 U	4.6 U	
Cobalt	ns	NA	NA	22 U	NA	22 U	22 U	22 U	
Copper	200	20 U	34	13.2 U	56	13.2 U	13.2 U	13.2 U	
Iron	300	NA	NA	21,200	NA	2,450	2,350	5,080	
Lead	25	9	6	5.9	21	3.3 U	4.4	4.1	
Magnesium	35,000	NA	NA	5,570 J	NA	5,970 J	14,600 J	18,700 J	
Manganese	300	NA	NA	388 J	NA	253 J	1,100 J	1,180 J	
Mercury	0.7	0.2 U	0.2 U	0.2 U	0.2 U	0.2 U	0.2 U	0.2 U	
Nickel	100	40 U	40 U	17.6 U	52	17.6 U	17.6 U	17.6 U	
Potassium	ns	NA	NA	4,300 B	NA	3,590 B	7,900	4,430 B	
Selenium	10	NA	NA	3.3 U	NA	3.3 U	3.3 U	3.3 U	
Sodium	20,000	NA	NA	16,400	NA	426,000	96,400	25,400	
Thallium	0.5	6 U	6 U	NA	6 U	NA	NA	NA	
Vanadium	ns	NA	NA	22 U	NA	22 U	22 U	22 U	
Zinc	2,000	22	50	21.8 J	80	99.4 J	121 J	125 J	

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples
Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-14	MW-14	MW-15	MW-15	MW-16	MW-16	MW-17
Sample Date:	Class GA	8/15-16/95	12/1/99	12/8/99	1/14/00	8/15-16/95	12/1/99	12/10/99
Aluminum	ns	NA	3,040 J	6,630 *	530 J	NA	153 B	83,000 *
Antimony	3	NA	30.8 U	30.8 U	30.8 U	NA	30.8 U	30.8 U
Arsenic	25	0.0087	26.3 J	46 J	18.2	NA	6.6 UWN	42.6 J
Barium	1,000	NA	126 B	219	206	NA	63.7 B	1,620
Beryllium	3	NA	3.7 U	3.7 U	3.7 U	NA	3.7 U	4.6
Cadmium	5	NA	4.6 U	4.6 U	4.6 U	NA	4.6 U	4.6 U
Calcium	ns	NA	252,000 J	233,000	225,000	NA	156,000 J	369,000 J
Chromium	50	NA	6.7 B	4.6 U	4.6 U*	0.0037	4.6 U	115 *
Cobalt	ns	NA	22 U	22 U	22 U	NA	22 U	64.2
Copper	200	NA	13.2 U	13.2 U	13.2 U	NA	13.2 U	157
Iron	300	NA	29,200	38,200	42,900	NA	4,370	136,000 *
Lead	25	NA	5.7	33.6	5.3 *	NA	3.3 U	108
Magnesium	35,000	NA	15,100 J	20,000	20,700	NA	10,300 J	72,000
Manganese	300	NA	1,270 J	2,790	3,350	NA	728 J	11,600 *
Mercury	0.7	NA	0.2 U	0.23	0.2 U	NA	0.2 U	0.2 U
Nickel	100	NA	17.6 U	17.6 U*	17.6 U	NA	23.1 B	139 *
Potassium	ns	NA	9,680	15,300	12,800	NA	6,750	28,100
Selenium	10	NA	5.5 J	330 UJ	16 UJ	NA	3.3 UJ	R
Sodium	20,000	NA	20,900	73,900	84,800	NA	35,200	266,000
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	NA	22 U	22 U	22 U	NA	22 U	497 J
Zinc	2,000	NA	R	38.9 J	25.2 J	0.53	440 J	160

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
 See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-17	MW-18	MW-18	MW-19	MW-19	MW-19 DUP	MW-20
Sample Date:	Class GA	1/13/2000	12/9/99	1/13/00	12/10/99	1/14/00	12/10/99	12/10/99
Aluminum	ns	418	74,200 *	1,320	49,300 *	4,310 J	48,800 *	28,600 *
Antimony	3	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U
Arsenic	25	6.6 UW	35 J	12.1	77.9 J	19	R	13.9 J
Barium	1,000	880	607	246	550	273	500	207
Beryllium	3	3.7 U	3.7 U	4.6 U	3.7 U	3.7 U	3.7 U	3.7 U
Cadmium	5	4.6 U	4.6 U	3.7 U	4.6 U	4.6 U	261,000 J	4.6 U
Calcium	ns	297,000	225,000	212,000	260,000 J	217,000	66.8 *	170,000 J
Chromium	50	4.6 U	86.5	7.6	65.3 *	6.4 *	114,000 *	39.5 *
Cobalt	ns	22 U	22 U	22 U	30.2	22 U	4.6 U	22 U
Copper	200	13.2 U	84.2	13.2 U	107	13.2 U	29	29.9
Iron	300	16,300	84,700	30,200	123,000 *	27,800	68.8	28,400 *
Lead	25	3.3 U	11.4 W	3.3 U	72.2	6.8 *	100	14.7
Magnesium	35,000	48,800	25,600 J	18,700	32,500	21,900	31,800	28,800
Manganese	300	10,400 J	1,650	1070 J	5,000 *	6,980	5,020 *	8,330 *
Mercury	0.7	0.2 U	0.49	0.2 U	0.2	0.2 U	0.2 U	0.2 U
Nickel	100	17.6 U	68.9 *	17.6 U	78.6 *	17.6 U	82.7 *	20.8 *
Potassium	ns	6,090	39,100	14,400	25,400	15,900	25,800	10,200
Selenium	10	33 UJ	330 UJ	33 UJ	R	16 UJ	R	R
Sodium	20,000	291,000	150,000	153,000	366,000	358,000	355,000	42,800
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	22 U	127	22 U	106	22 U	102	45.4
Zinc	2,000	8.8 U	170 J	115 J	261 UJ	23.9 J	252 UJ	125 UJ

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-21	MW-21	MW-21 (filtered)	MW-22	MW-22	MW-23	MW-24
Sample Date:	Class GA	12/10/99	1/14/00	1/14/00	12/10/99	1/17/00	12/10/99	12/9/99
Aluminum	ns	408,000 *	31,900	130 U	55,400 *	2,750	14,200 *	13,500 *
Antimony	3	44	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U
Arsenic	25	313 J	16.6	6.6 U	51.6 J	6.6 UW	24.3 J	48.8 J
Barium	1,000	2,620	448 J	182 J	509	82.6	179	120
Beryllium	3	18.7	3.7 U	3.7 U	3.7 U	3.7 U	3.7 U	3.7 U
Cadmium	5	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U
Calcium	ns	1,060,000 J	126,000	65,900	321,000 J	121,000	168,000 J	133,000
Chromium	50	2,290 *	198	4.6 U	170 *	7.8	36.5 *	47.4
Cobalt	ns	325	22 U	22 U	42.6	22 U	22 U	22 U
Copper	200	2,690	143	13.2 U	158	13.2 U	43.4	318
Iron	300	847,000 *	53,100	24.2 U	129,000 *	10,200	29,000 *	222,000
Lead	25	2,130	139	3.3 U	194	4.7	34.2	201
Magnesium	35,000	454,000	65,400	42,300	33,400	36,400	32,600	23,900 J
Manganese	300	14,800 *	1,130 J	156 J	2,670 *	481 J	1,470 *	5,050
Mercury	0.7	2.7	0.24	0.2 U	0.88	0.2 U	0.34	0.33
Nickel	100	827 *	49.1	17.6 U	98.7 *	17.6 U	19.7 *	55.9 *
Potassium	ns	118,000	37,200	27,400	32,900	14,300	8,270	14,000
Selenium	10	R	33 UJ	3.3 UJ	R	3.3 UJ	R	33 UJ
Sodium	20,000	259,000	124,000	137,000	125,000	104,000	11,400	19,100
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	701	60.6	22 U	103	22 U	23.1	64.5
Zinc	2,000	1,940 J	149 J	8.8 U	175 UJ	157 J	166 UJ	260 J

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples
Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	2
Sample ID:	TOGS 1.1.1	MW-24	MW-25	MW-26	MW-27	MW-27	MW-28	MW-28
Sample Date:	Class GA	1/11/00	12/9/99	12/9/99	12/10/99	1/12/00	12/10/1999	1/12/2000
Aluminum	ns	1,030 J	13,500 *	10,400 *	11,900 *	292	94,400 *	4,170
Antimony	3	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U
Arsenic	25	6.6 U	13.9 J	14.7 J	27 J	6.6 U	R	9.1
Barium	1,000	37.6	167	201	114	45.9	587	103
Beryllium	3	3.7 U	3.7 U	3.7 U	3.7 U	3.7 U	5.9	3.7 U
Cadmium	5	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U
Calcium	ns	125,000	120,000	131,000	80,000	49,100	103,000 J	95,000
Chromium	50	4.6 U	17.3	16	21.9 *	5.8	177 *	8.1
Cobalt	ns	22 U	22 U	22 U	22 U	22 U	67.4	22 U
Copper	200	19	22.3	21.9	264	13.2 U	288	13.6
Iron	300	31,500	15,000	18,200	24,300 *	735	215,000 *	3.8
Lead	25	3.3 U	16.5	13.5	70.1	3.3 U	205	0.22 U
Magnesium	35,000	20,200 J	21,600 J	15,500 J	12,200	8,960	35,100	9,580
Manganese	300	6,440 J	1,240	1,550	4,260 *	2,850	12,900 *	12,100
Mercury	0.7	0.22 U	0.2 U	0.2 U	0.2 U	0.2 U	1.2	2,580
Nickel	100	38.6	28.9 *	17.6 U*	24.6 *	17.6 U	198 *	17.6 U
Potassium	ns	10,700 J	9,020	7,850	3,530	1,710 J	14,300	6,220 J
Selenium	10	3.3 UJ	R	R	R	3.3 UJ	R	3.3 UJ
Sodium	20,000	36,000	21,000	20,300	9,250	7,310	16,000	16,000
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	22 U	22 U	22 U	26.2	22 U	221	22 U
Zinc	2,000	61.3	163 J	161 J	78 UJ	11.1	567 J	35.1

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.
 See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	2	2	2	2	2	2	1
Sample ID:	TOGS 1.1.1	MW-29	MW-30	MW-30	MW-30 DUP	MW-31	MW-31	MW-32
Sample Date:	Class GA	12/10/1999	12/10/1999	1/11/2000	12/10/1999	12/10/1999	1/11/2000	12/6/00
Aluminum	ns	30,400 *	245,000 *	6,740 J	226,000 *	176,000 *	2,630 J	130 U
Antimony	3	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	30.8 U	NA
Arsenic	25	R	R	11.7	R	R	6.6 U	55 U
Barium	1,000	284	1,430	154	1,370	913	40	67.5
Beryllium	3	3.7 U	12.9	3.7 U	12.3	15.3	3.7 U	NA
Cadmium	5	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	4.6 U	NA
Calcium	ns	138,000 J	749,000 J	191,000	779,000 J	191,000 J	60,400	92,900
Chromium	50	45.6 *	316 *	11.8	314 *	230 *	5.1	4.62 U
Cobalt	ns	22 U	170	22 U	167	165	22 U	NA
Copper	200	52.1	523	17.5	501	617	15	13.2 U
Iron	300	46,100 *	401,000 *	10,300	378,000 *	404,000 *	2,120	6,940
Lead	25	46.3	469	6.9	478	252	3.3 U	NA
Magnesium	35,000	17,200	138,000	33,900 J	136,000	56,400	7,080 J	11,000
Manganese	300	1,040 *	14,600 *	8,870 J	14,300 *	19,300 *	375 J	132 EJ
Mercury	0.7	0.22	0.98	0.22 U	0.92	0.98	0.22 U	NA
Nickel	100	39.6 *	382 *	17.6 U	346 *	402 *	17.6 U	17.6 U
Potassium	ns	14,700	50,100	6,310 J	44,500	40,400	7,970 J	6,240
Selenium	10	R	R	33 UJ	R	R	3.3 UJ	NA
Sodium	20,000	177,000	193,000	219,000	190,000	206,000	94,700	75,600
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	57.2	471	22 U	430	393	22 U	NA
Zinc	2,000	403 J	1,070 J	34.3	1,080 J	1,260 J	25.2	11.5 J

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	MW-33	MW-33DUP	MW-34	MW-36	MW-36	MW-36A	MW-37
Sample Date:	Class GA	12/11/00	12/11/00	12/6/00	12/6/00	12/6/00	12/7/00	12/7/00
Aluminum	ns	427	358	179	217	471	159	723
Antimony	3	NA	NA	NA	NA	NA	NA	NA
Arsenic	25	55 U	55 U	55 U	55 U	55 U	55 U	55 U
Barium	1,000	115	113	25	226	202	96.3	50.2
Beryllium	3	NA	NA	NA	NA	NA	NA	NA
Cadmium	5	NA	NA	NA	NA	NA	NA	NA
Calcium	ns	189,000	188,000	93,600	162,000	212,000	146,000	35,600
Chromium	50	4.64 U	4.62 U	4.62 U	4.62 U	14.8	7.33	8.26
Cobalt	ns	NA	NA	NA	NA	NA	NA	NA
Copper	200	13.2 U	13.2 U	13.2 U	13.2 U	13.2 U	13.2 U	13.2 U
Iron	300	24,100	24,000	2,110	32,200	38,400	8,840	1,180
Lead	25	NA	NA	NA	NA	NA	NA	NA
Magnesium	35,000	16,400	16,700	6,070	18,600	16,200	7,800	3,240
Manganese	300	624	622	709 EJ	500 EJ	1,190 EJ	1,050	120 EJ
Mercury	0.7	NA	NA	NA	NA	NA	NA	NA
Nickel	100	17.6 U	17.6 U	17.6 U	17.6 U	17.6 U	17.6 U	17.6 U
Potassium	ns	9,940	9,950	1,580	12,300	7,610	9,160	17,800
Selenium	10	NA	NA	NA	NA	NA	NA	NA
Sodium	20,000	65,000	64,600	8,650	77,800	400,000	75,300	2,410,100
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	NA	NA	NA	NA	NA	NA	NA
Zinc	2,000	55.9	13	8.8 U	8.8 U	19.9 J	14.7	13.7 J

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	MW-38	MW-38	MW-39	MW-40	MW-41	MW-42	MW-43
Sample Date:	Class GA	12/6/00	12/6/00	12/7/00	12/7/00	12/7/00	12/8/00	12/8/00
Aluminum	ns	223	199	130 U	4,920	395	130 U	1,560
Antimony	3	NA	NA	NA	NA	NA	NA	NA
Arsenic	25	55 U	55 U	55 U	55 U	55 U	55 U	55 U
Barium	1,000	100	96.2	42	127	146	0.0884	213
Beryllium	3	NA	NA	NA	NA	NA	NA	NA
Cadmium	5	NA	NA	NA	NA	NA	NA	NA
Calcium	ns	234,000	224,000	146,000	75,100	55,500	182,000	86,400
Chromium	50	4.81	4.62 U	5.94	68.4	4.62 U	4.62 U	4.62 U
Cobalt	ns	NA	NA	NA	NA	NA	NA	NA
Copper	200	13.2 U	13.2 U	13.2 U	17.1	13.2 U	13.2 U	13.2 U
Iron	300	6,200	5,730	857	12,800	25,700	12,600	27,000
Lead	25	NA	NA	NA	NA	NA	NA	NA
Magnesium	35,000	25,300	24,200	11,200	11,300	8,320	9,950	8,960
Manganese	300	792 EJ	772 EJ	671	3,120	736	1,230	1,370
Mercury	0.7	NA	NA	NA	NA	NA	NA	NA
Nickel	100	17.6 U	17.6 U	17.6 U	55.1	17.6 U	17.6 U	17.6 U
Potassium	ns	6,200	6,030	3,470	5,140	6,700	10,500	25,700
Selenium	10	NA	NA	NA	NA	NA	NA	NA
Sodium	20,000	194,000	200,000	4,690	55,200	37,900	11,700	64,000
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	NA	NA	NA	NA	NA	NA	NA
Zinc	2,000	86.5 J	95.9 J	88 U	36.8	8.8 U	15.9	22.8

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte	Sample Collection Designation & Collection Date							
Source:	NYSDEC	1	1	1	1	1	1	1
Sample ID:	TOGS 1.1.1	MW-44	MW-45	MW-45	TMW-1 (filtered)	TMW-3 (filtered)	TMW-4 (filtered)	TMW-5 (filtered)
Sample Date:	Class GA	5/31/01	5/31/01	5/31/01	12/5/00	11/14/00	12/5/00	12/5/00
Aluminum	ns	NA	NA	NA	130 U	130 U	130 U	130 U
Antimony	3	NA	NA	NA	NA	NA	NA	NA
Arsenic	25	4.32 J	12.7	12.3	55 U	55 U	55 U	55 U
Barium	1,000	200 U	413	418	68.8	167 J	210	46.1
Beryllium	3	NA	NA	NA	NA	NA	NA	NA
Cadmium	5	0.92 J	10 U	10 U	NA	NA	NA	NA
Calcium	ns	NA	NA	NA	14,100	105,000	157,000	76,100
Chromium	50	25 U	4.18 J	3.23 J	4.62 U	4.62 U	4.62 U	6.75
Cobalt	ns	NA	NA	NA	NA	NA	NA	NA
Copper	200	100 U	100 U	100 U	13.2 U	13.2 U	13.2 U	13.2 U
Iron	300	NA	NA	NA	2,000	6,010 J	473	1,400
Lead	25	7.23	4.55 J	5 U	NA	NA	NA	NA
Magnesium	35,000	NA	NA	NA	18,900	14,700 J	18,900	5,210
Manganese	300	NA	NA	NA	8,030	1,340 J	1,190	260
Mercury	0.7	NA	NA	NA	NA	NA	NA	NA
Nickel	100	40 U	40 U	40 U	17.6 U	17.6 U	17.6 U	17.6 U
Potassium	ns	NA	NA	NA	7,990	4,850 J	11,800	5,390
Selenium	10	NA	NA	NA	NA	NA	NA	NA
Sodium	20,000	NA	NA	NA	105,000	33,900	73,300	5,650
Thallium	0.5	NA	NA	NA	NA	NA	NA	NA
Vanadium	ns	4.33 J	50 U	50 U	NA	NA	NA	NA
Zinc	2,000	30	22.8	50	10.3 J	8.8 U	8.8 U	14.3 J

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

See notes on page 14.

Groundwater Samples

Table 3e - Summary of Inorganic Results

Analyte			Sample Collection Designation & Collection Date	
Source:	NYSDEC	1		
Sample ID:	TOGS 1.1.1	TMW-8 (filtered)		
Sample Date:	Class GA	12/5/00		
Aluminum	ns	130 U		
Antimony	3	NA		
Arsenic	25	56.7		
Barium	1,000	314		
Beryllium	3	NA		
Cadmium	5	NA		
Calcium	ns	128,000		
Chromium	50	4.62 U		
Cobalt	ns	NA		
Copper	200	13.2 U		
Iron	300	56,500		
Lead	25	NA		
Magnesium	35,000	24,100		
Manganese	300	556		
Mercury	0.7	NA		
Nickel	100	17.6 U		
Potassium	ns	9,870		
Selenium	10	NA		
Sodium	20,000	80,600		
Thallium	0.5	NA		
Vanadium	ns	NA		
Zinc	2,000	9.84 J		

All results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Results in bold indicate results which exceed NYSDEC TOGS 1.1.1. Class GA standards and/or guidance values for a given constituent.

Notes:

NA = Sample was not analyzed for this constituent.

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the practical quantitation limit (PQL).

JN = The compound or analyte was tentatively identified and the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process.

R = Indicates that the previously reported detection limit or sample result has been rejected due to a significant deficiency in the data generation process. The data should not be used for any qualitative or quantitative purposes.

ns = No standard. Value is not available in TOGS.

* = Laboratory duplicate analysis was outside control limits.

B = Indicates an estimated value between the instrument detection limit and the CLP-required detection limit.

N = Sample matrix spike analysis was outside control limits.

W = Analytical spike (AS) sample analysis recovery criteria for inorganic furnace atomic absorption (AA) analysis is not within the required spike recovery control limits of 85 and 115 percent.

S = The reported value was determined by the Method of Standard Additions.

U = The compound or analyte was not detected at the Practical Quantitation (PQL), or Method Detection Limit (MDL).

Data in this workbook is taken from the following sources:

- 1 Blasland, Bouck & Lee, Inc. , February 2002, Draft Site Investigation Summary Report.
- 2 Blasland, Bouck & Lee, Inc., July 2000, Site Investigation Work Plan.
- 3 Dames & Moore, June 1993, Interim Report, Tasks 1 through 4 Drainage System Assessment, Job #24707-001-017.
- 4 Dames & Moore, July 1994, Summary of Investigations.
- 5 ABB Environmental Services, Inc., September 1997, Investigation Program Report Subsurface Investigation Proposed EVI Facility.

Note:

The source of the data is identified in the source row for each sample.

NYSDEC TOGS 1.1.1 - New York State Department of Environmental Conservation, Division of Water Technical and Operational Guidance Series (1.1.1), Ambient Water Quality Standards and Guidance Values and Groundwater Effluent Limitations, June 1998.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Surface Water Samples**Table 4a - Summary of Volatile Organic Compound (VOC) Results (EPA Method 524.2)****Mohawk River Water Quality**

Analyte		Sample Collection Designation & Collection Date	
	NYSDEC		
Sample ID:	TOGS 1.1.1	SICWSP-3	
Sample Date:	Class A	7/23/1992	
Toluene	5	0.2 J	

Results reported in micrograms per Liter (ug/L), or parts per billion (ppb).

Notes:

U = Identifies all compounds that were not detected.

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration. This qualifier is used when the data evaluation procedure identifies a deficiency in the data generation process. This qualifier is also used when a compound or analyte is detected at estimated concentrations less than the practical quantitation limit (PQL).

Source: Dames & Moore, June 1993, Interim Report, Tasks 1 through 4 Drainage System Assessment, Job #24707-001-017.

NYSDEC TOGS 1.1.1 - New York State Department of Environmental Conservation, Division of Water Technical and Operational Guidance Series (1.1.1), Ambient Water Quality Standards and Guidance Values and Groundwater Effluent Limitations, June 1998.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
EVIMW-1	6/5/97	230.93	230.37	6.95	19.60	ND	0	NA	223.42	4	
	5/29/01	230.97	230.43	6.42	19.54	NA	0	NA	224.01	1	
EVIMW-2	6/5/97	226.45	225.72	11.52	18.47	ND	0	NA	214.2	4	
	5/29/01	226.52	225.87	11.59	18.53	NA	0	NA	214.28	1	
EVIMW-3	6/5/97	226.19	225.6	12.61	19.50	ND	0	NA	212.99	4	
	5/29/01	226.23	225.64	12.7	19.59	NA	0	NA	212.94	1	
EVIMW-4	6/5/97	226.73	226.46	11.35	19.73	ND	0	NA	215.11	4	
	5/29/01	226.80	226.53	11.09	19.73	NA	0	NA	215.44	1	
EVIMW-5	6/5/97	225.14	224.89	9.79	17.75	ND	0	NA	215.1	4	
	5/29/01	225.21	224.95	9.45	17.85	NA	0	NA	215.5	1	
EVIMW-6	6/5/97	228.44	228.09	10.91	18.65	ND	0	NA	217.18	4	
	5/29/01	228.46	228.13	11.08	19.07	NA	0	NA	217.05	1	Absorbent pad removed prior to measurement
EVIMW-7	6/5/97	229.05	228.63	11.6	19.58	ND	0	NA	217.03	4	
	5/29/01	228.78	228.5	11.48	15.91	NA	0	NA	217.02	1	Absorbent pad removed prior to measurement
EVIMW-8	6/5/97	228.72	228.33	13.98	19.61	ND	0	NA	214.35	4	
	5/29/01	228.81	228.43	14.03	19.50	NA	0	NA	214.4	1	
MH-A1	12/5/94	NA	225.68	15.57	NA	Sheen	Sheen	NA	210.11	5	
	12/12/94	NA	225.68	15.11	NA	Trace	Trace	NA	210.57	5	
	12/21/94	NA	225.68	15.56	NA	Trace	Trace	NA	210.12	5	
	12/28/94	NA	225.68	15.5	NA	Trace	Trace	NA	210.18	5	
MW-1	11/6/92	224.55	225.03	11.34	20.00	ND	0	10.0 - 20.0	213.69	2	
	2/26/93	224.55	225.03	15.3	20.00	14.78	0.52	10.0 - 20.0	210.2	2	
	8/3/93	224.55	225.03	13.32	20.00	12.52	0.80	10.0 - 20.0	212.43	2	
	4/4/94	224.55	225.03	NA	20.00	NA	NA	10.0 - 20.0	NA	2	
	5/3/94	224.55	225.03	13.7	20.00	13.30	0.40	10.0 - 20.0	211.96	2	
	12/5/94	224.55	225.03	15.87	20.00	14.68	1.19	10.0 - 20.0	210.5	5	
	12/12/94	224.55	225.03	14.46	20.00	14.22	0.24	10.0 - 20.0	211.06	5	
	12/21/94	224.55	225.03	14.96	20.00	14.61	0.35	10.0 - 20.0	210.66	5	
	12/28/94	224.55	225.03	14.83	20.00	14.76	0.07	10.0 - 20.0	210.53	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-2	8/9/93	225.25	224.8	11.58	21.00	ND	0	11.0 - 21.0	213.22	2	
	4/4/94	225.25	224.8	9.69	21.00	ND	0	11.0 - 21.0	215.11	2	
	5/3/93	225.25	224.8	11.2	21.00	ND	sheen	11.0 - 21.0	213.6	2	
	12/5/94	225.25	224.8	12.73	21.00	12.50	0.23	11.0 - 21.0	212.28	5	
	12/12/94	225.25	224.8	12.56	21.00	12.41	0.15	11.0 - 21.0	212.38	5	
	12/21/94	225.25	224.8	12.66	21.00	12.49	0.17	11.0 - 21.0	212.29	5	
MW-3	12/28/94	225.25	224.8	12.61	21.00	12.44	0.17	11.0 - 21.0	212.34	5	
	5/29/01	225.25	224.81	11.76	20.19	NA	0	11.0 - 21.0	213.05	2	
	11/11/92	226.65	226.14	13.17	23.00	ND	0	13.0 - 23.0	212.97	2	
	11/11/92	226.65	226.14	13.15	23.00	ND	0	13.0 - 23.0	212.99	2	
	11/11/92	226.65	226.14	13.21	23.00	ND	0	13.0 - 23.0	212.93	2	
	11/12/92	226.65	226.14	12.89	23.00	sheen	sheen	13.0 - 23.0	213.25	2	
	11/12/92	226.65	226.14	12.87	23.00	ND	0	13.0 - 23.0	213.27	2	
	11/12/92	226.65	226.14	12.78	23.00	ND	0	13.0 - 23.0	213.36	2	
	11/12/92	226.65	226.14	12.62	23.00	ND	0	13.0 - 23.0	213.52	2	
	11/13/92	226.65	226.14	12.62	23.00	ND	0	13.0 - 23.0	213.52	2	
	11/13/92	226.65	226.14	12.68	23.00	ND	0	13.0 - 23.0	213.46	2	
	11/13/92	226.65	226.14	12.72	23.00	ND	0	13.0 - 23.0	213.42	2	
	11/13/92	226.65	226.14	12.87	23.00	ND	0	13.0 - 23.0	213.27	2	
	11/16/92	226.65	226.14	12.87	23.00	ND	0	13.0 - 23.0	213.27	2	
	11/17/92	226.65	226.14	13.25	23.00	13.24	0.01	13.0 - 23.0	212.9	2	
	8/9/93	226.65	226.14	13.53	23.00	ND	0	13.0 - 23.0	212.61	2	
	4/4/94	226.65	226.14	11.12	23.00	ND	0	13.0 - 23.0	215.02	2	
	5/3/94	226.65	226.14	13.7	23.00	ND	0	13.0 - 23.0	212.44	2	
	12/5/94	226.65	226.14	15.89	23.00	15.72	0.17	13.0 - 23.0	210.4	5	
	12/12/94	226.65	226.14	15.35	23.00	NA	0	13.0 - 23.0	210.79	5	
	12/21/94	226.65	226.14	15.83	23.00	15.80	0.03	13.0 - 23.0	210.34	5	
	12/28/94	226.65	226.14	15.67	23.00	NA	0	13.0 - 23.0	210.47	5	
	5/29/01	226.65	226.14	13.53	22.62	NA	0	13.0 - 23.0	212.61	2	Absorbent pad removed prior to measurement

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-4	11/6/92	227.28	226.8	14.23	24.00	12.93	1.30	14.0 - 24.0	213.75	2	
	11/10/92	227.28	226.8	14.58	24.00	13.61	0.97	14.0 - 24.0	213.1	2	
	11/11/92	227.28	226.8	15.25	24.00	13.21	2.04	14.0 - 24.0	213.4	2	
	11/11/92	227.28	226.8	14.46	24.00	13.69	0.77	14.0 - 24.0	213.04	2	
	11/11/92	227.28	226.8	14.34	24.00	13.51	0.83	14.0 - 24.0	213.21	2	
	11/12/92	227.28	226.8	14.16	24.00	13.22	0.94	14.0 - 24.0	213.49	2	
	11/12/92	227.28	226.8	14.23	24.00	13.16	1.07	14.0 - 24.0	213.54	2	
	11/12/92	227.28	226.8	13.59	24.00	13.12	0.47	14.0 - 24.0	213.64	2	
	11/12/92	227.28	226.8	13.44	24.00	12.86	0.58	14.0 - 24.0	213.89	2	
	11/13/92	227.28	226.8	13.2	24.00	13.16	0.04	14.0 - 24.0	213.64	2	
	11/13/92	227.28	226.8	13.72	24.00	13.32	0.40	14.0 - 24.0	213.44	2	
	11/13/92	227.28	226.8	13.77	24.00	13.24	0.53	14.0 - 24.0	213.51	2	
	11/13/92	227.28	226.8	14.28	24.00	13.45	0.83	14.0 - 24.0	213.27	2	
	11/16/92	227.28	226.8	14.52	24.00	13.34	1.18	14.0 - 24.0	213.35	2	
	11/17/92	227.28	226.8	15.2	24.00	13.51	1.69	14.0 - 24.0	213.13	2	
	2/26/93	227.28	226.8	16.5	24.00	16.10	0.40	14.0 - 24.0	210.66	2	
	8/9/93	227.28	226.8	16.25	24.00	13.75	2.50	14.0 - 24.0	212.82	2	
	4/4/93	227.28	226.8	NA	24.00	NA	0	14.0 - 24.0	NA	2	
	5/3/94	227.28	226.8	16.5	24.00	14.55	1.95	14.0 - 24.0	210.7	2	
	12/5/94	227.28	226.8	16.97	24.00	15.79	1.18	14.0 - 24.0	210.89	5	
	12/12/94	227.28	226.8	15.93	24.00	15.78	0.15	14.0 - 24.0	211.01	5	
MW-5	12/21/94	227.28	226.8	16.49	24.00	16.08	0.41	14.0 - 24.0	210.68	5	
	8/9/93	227.28	226.8	13.91	24.00	ND	0	14.0 - 24.0	215.02	2	
	4/4/94	227.28	226.8	11.29	24.00	ND	0	14.0 - 24.0	212.44	2	
	5/3/94	227.28	226.8	14.25	24.00	ND	0	14.0 - 24.0	212.25	2	
	12/28/94	227.28	226.8	16.24	24.00	15.89	0.35	14.0 - 24.0	210.88	5	
	5/29/01	227.28	226.8	14.86	20.28	NA	0	14.0 - 24.0	226.8	2	Absorbent pad removed prior to measurement
	12/5/94	227.29	226.5	16.1	25.00	NA	0	15.0 - 25.0	210.4	5	
	12/12/94	227.29	226.5	15.7	25.00	NA	0	15.0 - 25.0	210.8	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-5	12/21/94	227.29	226.5	16.12	25.00	NA	0	15.0 - 25.0	210.38	5	
	12/28/94	227.29	226.5	16	25.00	NA	0	15.0 - 25.0	210.5	5	
MW-6	5/29/01	227.29	226.5	NA	25.00	NA	0	15.0 - 25.0	NA	2	Well covered with gravel.
	4/4/94	225.71	225.46	10.34	34.50	ND	0	29.5 - 34.5	215.37	2	
	5/3/94	225.71	225.46	13.17	34.50	ND	0	29.5 - 34.5	212.54	2	
	12/5/94	225.71	225.46	14.81	34.50	NA	0	29.5 - 34.5	210.90	5	
	12/12/94	225.71	225.46	14.60	24.50	NA	0	29.5 - 34.5	211.11	5	
MW-6	12/21/94	225.71	225.46	14.94	24.50	NA	0	29.5 - 34.5	210.77	5	
	12/28/94	225.71	225.46	14.75	24.50	NA	0	29.5 - 34.5	210.96	5	
	5/29/01	225.71	225.46	12.85	33.89	NA	0	29.5 - 34.5	212.61	2	
MW-7	4/4/94	225.99	225.62	11.61	18.50	ND	0	8.5 - 18.5	214.38	2	
	5/3/94	225.99	225.62	12.79	18.50	ND	0	8.5 - 18.5	211.87	2	
	12/5/94	225.99	225.62	13.76	18.50	NA	0	8.5 - 18.5	210.9	5	
	12/12/94	225.99	225.62	13.53	18.50	NA	0	8.5 - 18.5	211.13	5	
	12/21/94	225.99	225.62	12.97	18.50	NA	0	8.5 - 18.5	211.69	5	
	12/28/94	225.99	225.62	12.94	18.50	NA	0	8.5 - 18.5	211.72	5	
	5/29/01	225.99	225.62	13.18	17.95	NA	0	8.5 - 18.5	212.44	2	
MW-8	4/4/94	227.35	226.98	7.18	12.50	ND	0	5.5 - 12.5	217.48	2	
	5/3/94	227.35	226.98	7.4	12.50	ND	0	5.5 - 12.5	217.8	2	
	12/5/94	227.35	226.98	NA	12.50	NA	NA	5.5 - 12.5	NA	5	
	12/12/94	227.35	226.98	NA	12.50	NA	NA	5.5 - 12.5	NA	5	
	12/21/94	227.35	226.98	NA	12.50	NA	NA	5.5 - 12.5	NA	5	
	12/28/94	227.35	226.98	NA	12.50	NA	NA	5.5 - 12.5	NA	5	
	5/29/01	227.35	226.98	11.29	14.69	NA	0	5.5 - 12.5	215.69	2	
MW-9	4/4/94	225.20	224.78	7.86	16.00	ND	0	6.0 - 16.0	217.34	2	
	5/3/94	225.20	224.78	7.97	16.00	ND	0	6.0 - 16.0	217.23	2	
	12/5/94	225.20	224.78	NA	16.00	NA	NA	6.0 - 16.0	NA	5	
	12/12/94	225.20	224.78	NA	16.00	NA	NA	6.0 - 16.0	NA	5	
	12/21/94	225.20	224.78	NA	16.00	NA	NA	6.0 - 16.0	NA	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-9	12/28/94	225.20	224.78	NA	16.00	NA	NA	6.0 - 16.0	NA	5	
	5/29/01	225.20	224.78	NA	16.00	NA	0	6.0 - 16.0	NA	2	Well not accessible (under stock in Building 324).
MW-10	4/4/94	227.19	226.81	11.62	34.00	ND	0	31.0 - 34.0	215.57	2	
	5/3/94	227.19	226.81	14.43	34.00	ND	0	31.0 - 34.0	212.76	2	
	12/5/94	227.19	226.81	16.24	34.00	NA	0	31.0 - 34.0	210.95	5	
	12/12/94	227.19	226.81	15.92	34.00	NA	0	31.0 - 34.0	211.27	5	
	12/21/94	227.19	226.81	16.34	34.00	NA	0	31.0 - 34.0	210.85	5	
	12/28/94	227.19	226.81	16.19	34.00	NA	0	31.0 - 34.0	211.00	5	
	5/29/01	227.19	226.81	NA	34.00	NA	0	31.0 - 34.0	NA	2	Magnetic pressure gauge connected in well.
MW-11	4/4/94	226.28	225.89	10.11	17.00	ND	0	7.0 - 17.0	216.17	2	
	5/3/94	226.28	225.89	10.44	17.00	ND	0	7.0 - 17.0	215.84	2	
	12/5/94	226.28	225.89	11.59	17.00	NA	0	7.0 - 17.0	214.69	5	
	12/12/94	226.28	225.89	NA	17.00	NA	NA	7.0 - 17.0	NA	5	
	12/21/94	226.28	225.89	11.19	17.00	NA	0	7.0 - 17.0	215.09	5	
	12/28/94	226.28	225.89	11.25	17.00	NA	0	7.0 - 17.0	215.03	5	
	5/29/01	226.28	225.89	10.39	16.40	NA	0	7.0 - 17.0	215.5	2	
MW-12	4/4/94	224.69	224.33	7.14	15.50	ND	0	5.5 - 15.5	217.55	2	
	5/3/94	224.69	224.33	6.66	15.50	ND	0	5.5 - 15.5	218.03	2	
	12/5/94	224.69	224.33	NA	15.50	NA	NA	5.5 - 15.5	NA	5	
	12/12/94	224.69	224.33	NA	15.50	NA	NA	5.5 - 15.5	NA	5	
	12/21/94	224.69	224.33	NA	15.50	NA	NA	5.5 - 15.5	NA	5	
	12/28/94	224.69	224.33	NA	15.50	NA	NA	5.5 - 15.5	NA	5	
	6/5/97	224.69	224.33	7.62	15.50	ND	0	5.5 - 15.5	216.71	4	
	5/29/01	224.69	224.33	7.94	14.91	NA	0	5.5 - 15.5	216.39	2	Absorbent pad removed prior to measurement
MW-12D	5/29/01	225.24	224.62	8.37	15.74	NA	0	NA	216.25	2	Absorbent pad removed prior to measurement
MW-13	5/29/01	225.49	225.07	7.54	16.40	NA	0	NA	217.53	2	
MW-14	5/29/01	225.82	225.35	7.74	15.57	NA	0	NA	217.61	2	
MW-15	5/29/01	226.83	226.39	8.73	14.49	NA	0	NA	217.66	2	
MW-16	5/29/01	225.02	224.63	7.17	15.29	NA	0	NA	217.46	2	Absorbent pad removed prior to measurement

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-17	11/23/99	229.76	229.27	NA	18.44	NA	0	9.54 - 19.54	NA	4	
	5/29/01	229.76	229.27	9.83	18.44	NA	0	9.54 - 19.54	219.44	4	Absorbent pad removed prior to measurement
MW-18	11/15-16/99	230.00	229.76	NA	19.85	NA	0	9.93 - 19.93	NA	4	
	5/29/01	230.00	229.76	11.53	19.85	NA	0	9.93 - 19.93	218.23	4	
MW-19	11/29/99	231.80	230.84	NA	20.04	NA	0	10.03 - 20.03	NA	4	
	5/29/01	231.80	230.84	12.56	20.04	NA	0	10.03 - 20.03	218.28	4	Well not accessible (covered with steel).
MW-20	11/22/99	230.26	229.82	NA	19.86	NA	0	9.93 - 19.93	NA	4	
MW-20	5/29/01	230.26	229.82	12.69	19.86	NA	0	9.93 - 19.93	217.13	4	
MW-21	11/23/99	227.99	227.72	NA	18.80	NA	0	10.1 - 20.1	NA	4	
	5/29/01	227.99	227.72	2.82	18.80	NA	0	10.1 - 20.1	224.9	4	
MW-22	11/29/99	231.24	230.84	NA	17.22	NA	NA	7.75 - 17.75	NA	4	
	5/29/01	231.24	230.84	6.18	17.22	NA	NA	7.75 - 17.75	224.66	4	
MW-23	11/24/99	228.87	228.4	NA	19.82	NA	NA	9.9 - 19.9	NA	4	
	5/29/01	228.87	228.4	15.45	19.82	NA	NA	9.9 - 19.9	212.95	4	
MW-24	11/19/99	225.97	225.62	NA	19.25	NA	NA	9.33 - 19.33	NA	4	
	5/29/01	225.97	225.62	13.04	19.25	NA	NA	9.33 - 19.33	212.58	4	
MW-25	11/17/99	226.33	225.79	NA	19.46	NA	NA	9.58 - 19.58	NA	4	
	5/29/01	226.33	225.79	11.88	19.46	NA	NA	9.58 - 19.58	2132.91	4	
MW-26	11/17/99	226.27	225.62	NA	19.97	NA	NA	10.03 - 20.03	NA	4	
	5/29/01	226.27	225.62	11.68	19.97	NA	NA	10.03 - 20.03	213.94	4	
MW-27	11/18/99	227.87	227.53	NA	19.94	NA	NA	10.0 - 20.0	NA	4	
	5/29/01	227.87	227.53	13.98	19.94	NA	NA	10.0 - 20.0	213.55	4	
MW-28	11/18/99	226.85	226.23	NA	19.86	NA	NA	10.0 - 20.0	NA	4	
	5/29/01	226.85	226.23	13.08	19.86	NA	NA	10.0 - 20.0	213.15	4	
MW-29	11/22/99	224.75	223.87	NA	17.26	NA	NA	8.02 - 18.02	NA	4	
	5/29/01	224.75	223.87	4.1	17.26	NA	NA	8.02 - 18.02	219.77	4	
MW-30	11/19/99	225.81	225.41	NA	18.48	NA	NA	10.0 - 20.0	NA	4	
	5/29/01	225.81	225.41	5.79	18.48	NA	NA	10.0 - 20.0	219.62	4	
MW-31	11/30/99	225.38	225.11	NA	18.91	NA	NA	9.01 - 19.01	NA	4	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-31	5/29/01	225.38	225.11	7.83	18.91	NA	NA	9.01 - 19.01	217.28	4	
MW-32	11/8/00	226.90	226.22	NA	16.45	NA	NA	7.0 - 17.0	NA	4	
	5/29/01	226.90	226.22	7.43	16.45	NA	NA	7.0 - 17.0	218.79	3	Absorbent pad removed prior to measurement
MW-33	11/13/00	228.16	227.54	NA	17.47	NA	NA	8.0 - 18.0	NA	4	
	5/29/01	228.16	227.54	9.84	17.47	NA	NA	8.0 - 18.0	217.7	3	
MW-34	11/9/00	225.35	224.75	NA	15.77	NA	NA	6.0 - 16.0	NA	4	
	5/29/01	225.35	224.75	7.52	15.77	NA	NA	6.0 - 16.0	217.23	3	
MW-35	11/13/00	224.53	223.82	NA	15.96	NA	NA	6.0 - 16.0	NA	4	
	5/29/01	224.53	223.82	8.02	15.96	7.29	0.73	6.0 - 16.0	215.8	3	Absorbent pad removed prior to measurement
MW-36	5/29/01	225.02	224.54	NA	16.00	NA	NA	6.0 - 16.0	NA	3	Well not accessible (Covered by dumpster).
MW-36A	11/10/00	226.12	225.54	NA	16.57	NA	NA	7.0 - 17.0	NA	4	
	5/29/01	226.12	225.54	8.34	16.57	NA	NA	7.0 - 17.0	217.20	3	
MW-37	11/10/00	224.99	224.53	NA	15.79	NA	NA	7.0 - 17.0	NA	4	
	5/29/01	224.99	224.53	7.92	15.79	7.91	0.01	7.0 - 17.0	NA	3	
MW-38	11/9/00	226.88	226.30	NA	13.92	NA	NA	4.0 - 14.0	NA	4	
	5/29/01	226.88	226.30	7.28	13.92	NA	NA	4.0 - 14.0	219.02	3	
MW-39	11/9/00	225.63	225.14	NA	13.81	NA	NA	4.0 - 14.0	NA	4	
	5/29/01	225.63	225.14	5.84	13.81	NA	NA	4.0 - 14.0	219.3	3	
MW-40	11/8/00	229.98	229.42	NA	19.64	NA	NA	10.0 - 20.0	NA	4	
	5/29/01	229.98	229.42	13.82	19.64	NA	NA	10.0 - 20.0	215.6	3	
MW-41	11/10/00	225.75	225.09	NA	15.84	NA	NA	6.0 - 16.0	NA	4	
	5/29/01	225.75	225.09	7.71	15.84	NA	NA	6.0 - 16.0	217.38	3	Absorbent pad removed prior to measurement
MW-42	11/9/00	225.68	225.38	NA	15.86	NA	NA	6.0 - 16.0	NA	4	
	5/29/01	225.68	225.38	8.33	15.86	NA	NA	6.0 - 16.0	217.05	3	
MW-43	11/14/00	226.96	226.33	NA	21.38	NA	NA	11.0 - 21.0	NA	4	
	5/29/01	229.96	226.33	14.93	21.38	NA	NA	11.0 - 21.0	211.4	3	
MW-44	11/15/00	224.70	223.81	NA	16.64	NA	NA	7.0 - 17.0	NA	4	
	5/29/01	224.70	223.81	3.42	16.64	NA	NA	7.0 - 17.0	220.39	3	Absorbent pad removed prior to measurement
MW-45	11/15/00	225.72	225.01	NA	19.38	NA	NA	7.0 - 17.0	NA	4	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
MW-45	5/29/01	225.72	225.01	12.16	19.38	NA	NA	7.0 - 17.0	212.85	3	Absorbent pad removed prior to measurement
MW-46	5/23/01	231.67	231.19	NA	43.04	NA	NA	33.0 - 43.0	NA	4	
	5/29/01	231.67	231.19	23.89	43.04	NA	NA	33.0 - 43.0	207.3	3	
MW-47	5/21/01	224.98	224.73	NA	53.09	NA	NA	45.2 - 55.2	NA	4	
	5/29/01	224.98	224.73	11.04	53.09	NA	NA	45.2 - 55.2	213.69	3	
MW-48	5/22/01	225.18	224.98	NA	65.34	NA	NA	55.0 - 65.0	NA	4	
	5/29/01	225.18	224.98	11.53	65.34	NA	NA	55.0 - 65.0	213.45	3	
P-1	11/5/92	226.51	228.27	14.19	22.0	skim	skim	12.0 - 22.0	214.08	2	
	11/10/92	226.51	228.27	14.77	22.0	ND	0	12.0 - 22.0	213.5	2	
	11/11/92	226.51	228.27	14.69	22.0	ND	0	12.0 - 22.0	213.58	2	
	11/11/92	226.51	228.27	14.78	22.0	ND	0	12.0 - 22.0	213.49	2	
	11/11/92	226.51	228.27	14.76	22.0	ND	0	12.0 - 22.0	213.51	2	
	11/12/92	226.51	228.27	14.54	22.0	ND	0	12.0 - 22.0	213.73	2	
	11/12/92	226.51	228.27	14.56	22.0	ND	0	12.0 - 22.0	213.71	2	
	11/12/92	226.51	228.27	14.44	22.0	ND	0	12.0 - 22.0	213.83	2	
	11/12/92	226.51	228.27	14.26	22.0	ND	0	12.0 - 22.0	214.01	2	
	11/13/92	226.51	228.27	14.39	22.0	ND	0	12.0 - 22.0	213.88	2	
	11/13/92	226.51	228.27	14.65	22.0	ND	0	12.0 - 22.0	213.62	2	
	11/13/92	226.51	228.27	14.52	22.0	ND	0	12.0 - 22.0	213.75	2	
	11/13/92	226.51	228.27	14.62	22.0	ND	0	12.0 - 22.0	213.65	2	
	11/16/92	226.51	228.27	14.6	22.0	ND	0	12.0 - 22.0	213.67	2	
	11/17/92	226.51	228.27	14.82	22.0	ND	0	12.0 - 22.0	213.45	2	
	2/26/93	226.51	228.27	16.9	22.0	ND	0	12.0 - 22.0	211.37	2	
	8/9/93	226.51	228.27	15.27	22.0	ND	0	12.0 - 22.0	213	2	
	4/4/94	226.51	228.27	13.45	22.0	ND	0	12.0 - 22.0	214.82	2	
	5/3/94	226.51	228.27	13.98	22.0	ND	0	12.0 - 22.0	214.29	2	
	12/5/94	226.51	228.27	16.73	22.0	Sheen	Sheen	12.0 - 22.0	211.54	5	
	12/12/94	226.51	228.27	16.5	22.0	Sheen	Sheen	12.0 - 22.0	211.77	5	
	12/21/94	226.51	228.27	16.68	22.0	Sheen	Sheen	12.0 - 22.0	211.59	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
P-1	12/28/94	226.51	228.27	16.49	22.0	Sheen	Sheen	12.0 - 22.0	211.78	5	
P-2	11/12/92	226.75	228.99	21.95	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/12/92	226.75	228.99	18.32	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/13/92	226.75	228.99	14.73	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/13/92	226.75	228.99	14.73	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/13/92	226.75	228.99	14.72	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/13/92	226.75	228.99	14.73	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/16/92	226.75	228.99	14.74	20.0	ND	0	19.0 - 20.0	SSD	2	
	11/17/92	226.75	228.99	14.75	20.0	ND	0	19.0 - 20.0	SSD	2	
	2/26/93	226.75	228.99	15.25	20.0	ND	0	19.0 - 20.0	211.5	2	
	8/9/93	226.75	228.99	14.92	20.0	ND	0	19.0 - 20.0	211.83	2	
	4/4/94	226.75	228.99	14.16	20.0	ND	0	19.0 - 20.0	214.83	2	
	5/3/94	226.75	228.99	14.6	20.0	ND	0	19.0 - 20.0	214.39	2	
	12/5/94	226.75	228.99	15.88	20.0	NA	0	19.0 - 20.0	213.11	5	
	12/12/94	226.75	228.99	15.71	20.0	NA	0	19.0 - 20.0	213.38	5	
	12/21/94	226.75	228.99	15.79	20.0	15.38	0	19.0 - 20.0	213.2	5	
	12/28/94	226.75	228.99	15.72	20.0	15.27	0	19.0 - 20.0	213.27	5	
P-3	11/12/92	227.18	228.98	15.52	20.0	15.37	0.15	10.0 - 20.0	213.6	2	
	11/13/92	227.18	228.98	15.78	20.0	15.46	0.32	10.0 - 20.0	213.49	2	
	11/13/92	227.18	228.98	15.95	20.0	15.57	0.38	10.0 - 20.0	213.37	2	
	11/13/92	227.18	228.98	15.98	20.0	15.62	0.36	10.0 - 20.0	213.33	2	
	11/13/92	227.18	228.98	16.12	20.0	15.80	0.32	10.0 - 20.0	213.15	2	
	11/16/92	227.18	228.98	15.92	20.0	15.77	0.15	10.0 - 20.0	213.2	2	
	11/17/92	227.18	228.98	16.38	20.0	16.13	0.25	10.0 - 20.0	212.83	2	
	2/26/93	227.18	228.98	18.85	20.0	18.54	0.31	10.0 - 20.0	210.41	2	
	8/9/93	227.18	228.98	16.59	20.0	16.50	0.09	10.0 - 20.0	212.47	2	
	4/4/94	227.18	228.98	13.97	20.0	13.92	0.05	10.0 - 20.0	215.06	2	
	5/3/94	227.18	228.98	16.8	20.0	ND	0	10.0 - 20.0	212.18	2	
	12/5/94	227.18	228.98	18.68	20.0	Trace	Trace	10.0 - 20.0	210.3	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
P-3	12/12/94	227.18	228.98	18.19	20.0	Trace	Trace	10.0 - 20.0	210.79	5	
	12/21/94	227.18	228.98	18.66	20.0	Trace	Trace	10.0 - 20.0	210.32	5	
	12/28/94	227.18	228.98	18.47	20.0	Trace	Trace	10.0 - 20.0	210.51	5	
P-4	11/13/92	226.78	226.49	12.49	15.0	ND	0	10.0 - 15.0	214	2	
	11/16/92	226.78	226.49	12.39	15.0	ND	0	10.0 - 15.0	214.1	2	
	11/17/92	226.78	226.49	12.42	15.0	ND	0	10.0 - 15.0	214.07	2	
	8/9/93	226.78	226.49	12.6	15.0	ND	0	10.0 - 15.0	213.89	2	
	4/4/94	226.78	226.49	11.66	15.0	ND	0	10.0 - 15.0	214.83	2	
	5/3/94	226.78	226.49	12.19	15.0	ND	0	10.0 - 15.0	214.3	2	
	12/5/94	226.78	226.49	12.89	15.0	NA	0	10.0 - 15.0	213.6	5	
	12/12/94	226.78	226.49	12.68	15.0	NA	0	10.0 - 15.0	213.81	5	
	12/21/94	226.78	226.49	18.66	15.0	NA	0	10.0 - 15.0	213.54	5	
	12/28/94	226.78	226.49	12.97	15.0	NA	0	10.0 - 15.0	213.52	5	
P-5	11/12/92	226.52	226.28	12.68	20.0	ND	0	10.0 - 20.0	213.6	2	
	8/9/93	226.52	226.28	13.65	20.0	ND	0	10.0 - 20.0	212.63	2	
	4/4/94	226.52	226.28	11.24	20.0	ND	0	10.0 - 20.0	215.04	2	
	5/3/94	226.52	226.28	13.74	20.0	ND	0	10.0 - 20.0	212.54	2	
	12/5/94	226.52	226.28	15.98	20.0	NA	0	10.0 - 20.0	210.3	5	
	12/12/94	226.52	226.28	15.5	20.0	NA	0	10.0 - 20.0	210.78	5	
	12/21/94	226.52	226.28	15.16	20.0	NA	0	10.0 - 20.0	211.12	5	
	12/28/94	226.52	226.28	15.04	20.0	NA	0	10.0 - 20.0	211.24	5	
	11/12/92	226.20	225.85	12.27	20.0	ND	0	10.0 - 20.0	213.58	2	
P-6	8/9/93	226.20	225.85	13.29	20.0	ND	0	10.0 - 20.0	212.56	2	
	4/4/94	226.20	225.85	10.79	20.0	ND	0	10.0 - 20.0	215.06	2	
	5/3/94	226.20	225.85	15.15	20.0	ND	0	10.0 - 20.0	210.7	2	
	12/5/94	226.20	225.85	15.4	20.0	NA	0	10.0 - 20.0	210.45	5	
	12/12/94	226.20	225.85	NA	20.0	NA	NA	10.0 - 20.0	NA	5	
	12/21/94	226.20	225.85	12.43	20.0	Sheen	Sheen	10.0 - 20.0	213.42	5	
	12/28/94	226.20	225.85	12.06	20.0	12.05	0.01	10.0 - 20.0	213.8	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
P-7	11/12/92	226.02	225.57	11.93	20.0	ND	0	10.0 - 20.0	213.64	2	
	8/9/93	226.02	225.57	11.8	20.0	ND	0	10.0 - 20.0	213.77	2	
	4/4/94	226.02	225.57	9.95	20.0	ND	0	10.0 - 20.0	215.62	2	
	5/3/94	226.02	225.57	10.6	20.0	ND	0	10.0 - 20.0	214.97	2	
	12/5/94	226.02	225.57	13.22	20.0	NA	0	10.0 - 20.0	212.35	5	
	12/12/94	226.02	225.57	12.86	20.0	NA	0	10.0 - 20.0	212.71	5	
	12/21/94	226.02	225.57	12.56	20.0	NA	0	10.0 - 20.0	213.01	5	
	12/28/94	226.02	225.57	12.4	20.0	Sheen	Sheen	10.0 - 20.0	213.17	5	
P-8	11/12/92	225.91	225.61	11.92	20.3	ND	0	10.3 - 20.3	213.69	2	
	8/9/93	225.91	225.61	11.9	20.3	ND	0	10.3 - 20.3	213.71	2	
	4/4/94	225.91	225.61	10.09	20.3	ND	0	10.3 - 20.3	215.52	2	
	5/3/94	225.91	225.61	10.8	20.3	ND	0	10.3 - 20.3	214.81	2	
	12/5/94	225.91	225.61	13.27	20.3	NA	0	10.3 - 20.3	212.34	5	
	12/12/94	225.91	225.61	12.92	20.3	NA	0	10.3 - 20.3	212.69	5	
	12/21/94	225.91	225.61	12.64	20.3	Sheen	Sheen	10.3 - 20.3	212.97	5	
	12/28/94	225.91	225.61	12.49	20.3	NA	0	10.3 - 20.3	213.12	5	
P-9	11/12/92	225.74	225.47	12.08	20.2	ND	0	10.2 - 20.2	213.69	2	
	8/9/93	225.74	225.47	12.42	20.2	ND	0	10.2 - 20.2	213.71	2	
	4/4/94	225.74	225.47	10.44	20.2	10.43	0.01	10.2 - 20.2	215.52	2	
	5/3/94	225.74	225.47	12.1	20.2	ND	0	10.2 - 20.2	214.81	2	
	12/5/94	225.74	225.47	13.28	20.2	13.22	0.06	10.2 - 20.2	212.24	5	
	12/12/94	225.74	225.47	13.3	20.2	13.09	0.21	10.2 - 20.2	212.36	5	
	12/21/94	225.74	225.47	13.45	20.2	13.14	0.31	10.2 - 20.2	212.3	5	
	12/28/94	225.74	225.47	13.33	20.2	13.13	0.20	10.2 - 20.2	212.32	5	
P-10	11/12/92	225.56	225.15	9.46	18.0	ND	0	8.0 - 18.0	215.69	2	
	8/9/93	225.56	225.15	8.82	18.0	ND	0	8.0 - 18.0	216.33	2	
	4/4/94	225.56	225.15	8.21	18.0	ND	0	8.0 - 18.0	216.94	2	
	5/3/94	225.56	225.15	8.37	18.0	ND	0	8.0 - 18.0	216.78	2	
	12/5/94	225.56	225.15	9.71	18.0	NA	0	8.0 - 18.0	215.44	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
P-10	12/12/94	225.56	225.15	9.67	18.0	NA	0	8.0 - 18.0	215.48	5	
	12/21/94	225.56	225.15	9.73	18.0	NA	0	8.0 - 18.0	215.42	5	
	12/28/94	225.56	225.15	9.7	18.0	NA	0	8.0 - 18.0	215.45	5	
	12/5/94	NA	232.01	21.93	NA	NA	0	NA	210.08	5	
	12/12/94	NA	232.01	21.42	NA	NA	0	NA	210.59	5	
	12/21/94	NA	232.01	21.89	NA	Sheen	Sheen	NA	210.12	5	
RW-1	12/28/94	NA	232.01	21.85	NA	NA	0	NA	210.16	5	
	11/12/92	226.34	227.10	13.99	24.0	ND	0	9.0 - 24.0	213.11	2	
	11/11/92	226.34	227.10	13.89	24.0	ND	0	9.0 - 24.0	213.21	2	
	11/11/92	226.34	227.10	13.99	24.0	ND	0	9.0 - 24.0	213.11	2	
	11/11/92	226.34	227.10	13.9	24.0	ND	0	9.0 - 24.0	213.2	2	
	11/12/92	226.34	227.10	13.57	24.0	ND	0	9.0 - 24.0	213.53	2	
	11/12/92	226.34	227.10	13.59	24.0	ND	0	9.0 - 24.0	213.51	2	
	11/12/92	226.34	227.10	13.54	24.0	ND	0	9.0 - 24.0	213.56	2	
	11/12/92	226.34	227.10	13.16	24.0	ND	0	9.0 - 24.0	213.94	2	
	11/13/92	226.34	227.10	13.35	24.0	ND	0	9.0 - 24.0	213.75	2	
	11/13/92	226.34	227.10	13.58	24.0	ND	0	9.0 - 24.0	213.52	2	
	11/13/92	226.34	227.10	13.54	24.0	ND	0	9.0 - 24.0	213.56	2	
	11/13/92	226.34	227.10	13.73	24.0	ND	0	9.0 - 24.0	213.37	2	
	11/16/92	226.34	227.10	13.68	24.0	ND	0	9.0 - 24.0	213.42	2	
	11/17/92	226.34	227.10	13.96	24.0	ND	0	9.0 - 24.0	213.14	2	
	2/26/93	226.34	227.10	16.31	24.0	16.30	0.01	9.0 - 24.0	210.8	2	
	8/9/93	226.34	227.10	14.2	24.0	ND	0	9.0 - 24.0	212.9	2	
	4/4/94	226.34	227.10	12.25	24.0	ND	0	9.0 - 24.0	214.85	2	
	5/3/94	226.34	227.10	14.07	24.0	14.06	0.01	9.0 - 24.0	213.04	2	
	12/5/94	226.34	227.10	16.18	24.0	NA	0	9.0 - 24.0	210.92	5	
	12/12/94	226.34	227.10	15.86	24.0	NA	0	9.0 - 24.0	211.24	5	
	12/21/94	226.34	227.10	16.18	24.0	NA	0	9.0 - 24.0	210.92	5	
	12/28/94	226.34	227.10	15.98	24.0	NA	0	9.0 - 24.0	211.12	5	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
RW-2	11/5/92	226.55	227.08	13.15	24.0	ND	0	9.0 - 24.0	213.93	2	
	11/10/92	226.55	227.08	13.47	24.0	ND	0	9.0 - 24.0	213.61	2	
	11/11/92	226.55	227.08	13.87	24.0	ND	0	9.0 - 24.0	213.21	2	
	11/11/92	226.55	227.08	13.91	24.0	ND	0	9.0 - 24.0	213.17	2	
	11/11/92	226.55	227.08	13.81	24.0	ND	0	9.0 - 24.0	213.27	2	
	11/12/92	226.55	227.08	13.6	24.0	ND	0	9.0 - 24.0	213.48	2	
	11/12/92	226.55	227.08	13.49	24.0	ND	0	9.0 - 24.0	213.59	2	
	11/12/92	226.55	227.08	13.37	24.0	ND	0	9.0 - 24.0	213.71	2	
	11/12/92	226.55	227.08	13.16	24.0	ND	0	9.0 - 24.0	213.92	2	
	11/13/92	226.55	227.08	13.37	24.0	ND	0	9.0 - 24.0	213.71	2	
	11/13/92	226.55	227.08	13.67	24.0	13.65	0.02	9.0 - 24.0	213.43	2	
	11/13/92	226.55	227.08	13.58	24.0	13.57	0.01	9.0 - 24.0	213.51	2	
	11/13/92	226.55	227.08	13.74	24.0	13.71	0.03	9.0 - 24.0	213.37	2	
	11/16/92	226.55	227.08	13.68	24.0	13.65	0.03	9.0 - 24.0	213.43	2	
	11/17/92	226.55	227.08	14.75	24.0	13.90	0.85	9.0 - 24.0	213.1	2	
	2/26/93	226.55	227.08	16.6	24.0	16.30	0.30	9.0 - 24.0	210.75	2	
	8/9/93	226.55	227.08	14.26	24.0	13.84	0.42	9.0 - 24.0	213.2	2	
	4/4/94	226.55	227.08	12.16	24.0	ND	0	9.0 - 24.0	214.92	2	
	5/3/94	226.55	227.08	13.75	24.0	13.49	0.26	9.0 - 24.0	213.57	2	
	12/5/94	226.55	227.08	15.41	24.0	15.36	0.05	9.0 - 24.0	211.72	5	
	12/12/94	226.55	227.08	16.24	24.0	15.08	1.16	9.0 - 24.0	211.88	5	
RW-3	12/21/94	226.55	227.08	16.62	24.0	15.38	1.24	9.0 - 24.0	211.58	5	
	12/28/94	226.55	227.08	16.42	24.0	15.27	1.15	9.0 - 24.0	211.7	5	
	11/5/92	227.12	228.44	14.61	25.0	ND	0	10.0 - 25.0	213.83	2	
	11/10/92	227.12	228.44	15.07	25.0	15.05	0.02	10.0 - 25.0	213.39	2	
	11/11/92	227.12	228.44	15.11	25.0	15.10	0.01	10.0 - 25.0	213.34	2	
	11/11/92	227.12	228.44	15.21	25.0	15.20	0.01	10.0 - 25.0	213.24	2	
	11/11/92	227.12	228.44	15.17	25.0	15.15	0.02	10.0 - 25.0	213.29	2	
	11/12/92	227.12	228.44	14.93	25.0	14.92	0.01	10.0 - 25.0	213.52	2	

All results reported in feet (ft).

See notes on page 14.

Groundwater Monitoring Well Data

DRAFT

Table 5a - Historical Monitoring Well Elevation and Measurement Data

Well ID	Date (Note 1)	Top of Well Elevation (Note 2)	Top of PVC Elevation (Note 3)	Depth to Water (Note 4)	Total Well Depth	Depth to LNAPL	LNAPL Thickness	Screen Interval (Note 5)	Water Elevation	Source	Comments
RW-3	11/12/92	227.12	228.44	14.88	25.0	14.87	0.01	10.0 - 25.0	213.57	2	
	11/12/92	227.12	228.44	14.88	25.0	14.88	0	10.0 - 25.0	213.56	2	
	11/12/92	227.12	228.44	14.61	25.0	skim	skim	10.0 - 25.0	213.83	2	
	11/13/92	227.12	228.44	14.75	25.0	14.74	0.01	10.0 - 25.0	213.7	2	
	11/13/92	227.12	228.44	15.02	25.0	15.01	0.01	10.0 - 25.0	213.43	2	
	11/13/92	227.12	228.44	14.91	25.0	14.89	0.02	10.0 - 25.0	213.55	2	
	11/13/92	227.12	228.44	15.04	25.0	15.01	0.03	10.0 - 25.0	213.43	2	
	11/16/92	227.12	228.44	15	25.0	14.96	0.04	10.0 - 25.0	213.48	2	
	11/17/92	227.12	228.44	15.23	25.0	15.22	0.01	10.0 - 25.0	213.22	2	
	2/26/93	227.12	228.44	17.8	25.0	17.50	0.30	10.0 - 25.0	210.91	2	
	8/9/93	227.12	228.44	15.48	25.0	15.38	0.10	10.0 - 25.0	213.05	2	
	4/4/94	227.12	228.44	13.47	25.0	ND	0	10.0 - 25.0	214.97	2	
	5/3/94	227.12	228.44	15.48	25.0	15.32	0.16	10.0 - 25.0	213.1	2	
	12/5/94	227.12	228.44	17.21	25.0	16.83	0.38	10.0 - 25.0	211.57	5	
	12/12/94	227.12	228.44	16.94	25.0	16.61	0.33	10.0 - 25.0	211.8	5	
	12/21/94	227.12	228.44	17.31	25.0	16.88	0.43	10.0 - 25.0	211.52	5	
RW-4	12/28/94	227.12	228.44	17.15	25.0	16.78	0.37	10.0 - 25.0	211.62	5	
	11/12/92	225.22	226.01	12.35	20.0	ND	0	10.0 - 20.0	213.66	2	
	2/26/93	225.22	226.01	13.95	20.0	ND	0	10.0 - 20.0	212.06	2	
	8/9/93	225.22	226.01	12.27	20.0	ND	0	10.0 - 20.0	213.74	2	
	4/4/94	225.22	226.01	10.48	20.0	ND	0	10.0 - 20.0	215.53	2	
	5/3/94	225.22	226.01	11.12	20.0	ND	0	10.0 - 20.0	214.89	2	
	12/5/94	225.22	226.01	13.73	20.0	NA	0	10.0 - 20.0	212.28	5	
	12/12/94	225.22	226.01	13.38	20.0	13.38	0	10.0 - 20.0	212.63	5	
	12/21/94	225.22	226.01	13	20.0	Sheen	Sheen	10.0 - 20.0	213.01	5	
	12/28/94	225.22	226.01	12.84	20.0	Sheen	Sheen	10.0 - 20.0	213.17	5	
TMW-35A	5/29/01	NA	NA	11.08	18.59	10.48	0.60	NA	NA	3	No survey.
TMW-35B	5/29/01	NA	NA	10.55	18.65	10.51	0.04	NA	NA	3	No survey.
TMW-45A	5/29/01	226.05	225.96	9.02	16.90	NA	NA	NA	216.94	3	
TMW-45B	5/29/01	225.04	225.01	10.33	16.97	10.01	0.32	NA	214.68	3	

All results reported in feet (ft).

Notes:

NA = Data not available

ND = Not detected

SSD = Site specific datum utilized, top of casing subsequently altered.

LNAPL = Light non-aqueous phase liquid

1. Date of water-level/oil thickness measurement.

2. Flush mount wells installed. Elevation of the top of well is equal to ground surface.

3. All permanent wells shown are constructed with polyvinyl chloride (PVC) risers.

4. Reference point for water-level measurement is top of PVC casing.

5. All permanent wells shown are constructed with PVC well screens with 0.010 slot size.

Groundwater Monitoring Well Data
Table 5b - Vertical Hydraulic Gradient Data

Source:	1	1	1	1	1	1	1
Well ID	Total Well Depth	Water Level	Date Recorded	Top of Well Elevation	Groundwater Elevation	Screen Midpoint Elevation	Vertical Hydraulic Gradient
MW-19 (shallow)	19.97	14.94	12/8/2000	231.8	217.26	216.83	Between MW-19 (shallow) and TMW-19C (mid): 0.49
TMW-19C (deep)	39.33	19.81	12/4/2000	231.52	211.71	197.19	Between TMW-19C (mid) and TMW-19C (deep): 0.19
TMW-19C (mid)	25.97	17.38	12/4/2000	231.66	214.28	210.69	Between MW-19 (shallow) and TMW-19C (deep): 0.28
TMW-19G (shallow)	19.1	10.26	11/8/2000	229.65	219.39	215.55	Between TMW-19G (shallow) and TMW-19G2 (mid): 0.63
TMW-19G2 (mid)	29.32	16.66	12/4/2000	229.65	212.99	205.33	Between TMW-19G (shallow) and TMW-19G3 (deep): 0.37
TMW-19G3 (deep)	39.74	17.9	12/4/2000	229.65	211.75	194.91	Between TMW-19G2 (mid) and TMW-19G3 (deep): 0.12
TMW-19K1 (shallow)	19.91	8.96	11/15/2000	225.12	216.16	210.21	Between TMW-19K1 (shallow) and TMW-19K2 (mid): 0.25
TMW-19K2 (mid)	25.98	10.42	12/4/2000	225.05	214.63	204.07	Between TMW-19K1 (shallow) and TMW-19K3 (deep): 0.23
TMW-19K3 (deep)	38.81	13.37	12/4/2000	225.2	211.83	191.39	Between TMW-19K2 (mid) and TMW-19K3 (deep): 0.22

Notes:

Groundwater level measurements were not taken on the same date. Direct comparisons of these levels are most applicable if measured on the same date.

Ground surface elevation is approximate, well location covered by steel I-beams during survey. Elevation used is from adjacent temporary well.

Results are recorded in feet (ft).

Groundwater Monitoring Well Data

Table 5c - Transmissivity and Hydraulic Conductivity Data

Source: Sample ID	1 Sample Date	1 Transmissivity (gpd/ft)	1 Hydraulic Conductivity (cm/sec)	1 Hydraulic Conductivity (ft/day)
EVIMW-2	5/01	2.00E+02	1.36E-03	3.87E+00
MW-4	5/01	1.78E+00	1.78E-05	5.04E+02
MW-19	5/01	5.93E+01	3.92E-04	1.11E+00
MW-21	5/01	5.67E+01	2.22E-06	6.30E+03
MW-35*	5/01	7.63E+02	4.78E-03	1.36E+01
MW-46	5/01	3.39E+01	1.24E-04	3.50E-01
MW-47**	5/01	9.79E+03/1.49E+04	3.56E-2/5.43E-2	1.01E+02/1.54E+02
MW-48	5/01	1.21E+03	4.76E-03	1.35E+01

Notes:

gpd = gallons per day

ft = feet

cm = centimeters

sec =seconds

* Light Nonaqueous Phase Liquid (LNAPL) present in well.

** Two specific capacity tests were performed.

1. Transmissivity and hydraulic conductivity values calculated using specific capacity test data and QSTRANSX.

Data in this workbook is taken from the following sources:

- 1 Blasland, Bouck & Lee, Inc., February 2002, Draft Site Investigation Summary Report.
- 2 Dames & Moore, July 1994, Summary of Investigations.
- 3 ABD Engineers and Surveyors, Inc., April 1996, Map Showing Well Locations, Schenectady Industrial Corporation.
- 4 Blasland, Bouck & Lee, Inc., July 2000, Site Investigation Work Plan.
- 5 Blasland, Bouck & Lee, Inc., July 2000 Site Investigation Work Plan, Appendices Table 4 Groundwater Elevations, June 1997.

Note:

The source of the data is identified in the source row/column for each sample.

Building/Area Specific Investigation Data
Table 6a - MW-01 and MW-04 Free Product Characterization
Summary of Product Characterization Results

Parameters		
Source:	1	1
Sample ID:	MW-01	MW-04
Sample Date:	10/28-30/92	10/28-30/92
Petroleum ID		
Diesel Fuel	Present	Present
No. 2 Heating Fuel	Present	Present
EPA Method 8080 - PCBs		
Aroclor 1260	55.6	BPQL
Aroclor 1260	58.3 (10/30/92)	NA
EPA Method 624 - VOCs		
Ethylbenzene	ND	70.3
EPA Method 625 - SVOCs		
Naphthalene	ND	1,600
Phenanthrene	600	1,200
RCRA Metals		
Arsenic	2.6	ND
Lead	11.1	ND

All results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

NA = Sample was not analyzed for this constituent.

ND= Not detected.

BPQL = Below Practical Quantitation Limit.

Building/Area Specific Investigation Data
Table 6b - Water Samples Collected in Vicinity of MW-01
Summary of Polychlorinated Biphenyls (PCBs) Results (Method 8080)

Parameter	
Source:	1
Sample ID:	MW-01 MH
Sample Location:	Manhole Adjacent to MW-01 (oil sheen)
Sample Date:	10/92
Polychlorinated Biphenyls	11.2

All results are reported in micrograms per kilogram (ug/kg), or parts per billion (ppb).

Building/Area Specific Investigation Data
Table 6c - Building 332 Subsurface Investigation
Summary of Toxicity Characteristic Leaching Procedure (TCLP) Volatile Organic Compound (VOC) Results

Toxicity Characteristic Leaching Procedure			
Source:	2	2	2
Sample ID:	MW-13	MW-14	MW-15
Sample Date:	8/15-16/95	8/15-16/95	8/15-16/95
Volatile Organic Compounds EPA Method 8020			
Total Xylenes	1.18	4.31	2.35
Results are in micrograms per Liter (ug/L).			

Building/Area Specific Investigation Data
Table 6d - Building 326 Transformer Pit Inspection and Sampling
Summary of Polychlorinated Biphenyls (PCBs) Soil Sample Results (Method 8080)

Analyte		
Source:	3	
Sample ID:	NYSDEC	328-LTRANSFORMER-614
Sample Date:	TAGM 4046	6/14/96
Aroclor-1260	10	107

All results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:
NYSDEC TAGM value presented is for total PCBs in subsurface soil.

Building/Area Specific Investigation Data
Table 6e - Building 326 Transformer Pit Inspection and Sampling
Summary of Sludge Sample Results

Parameters		
Source:	3	3
Sample ID:	326-PITRIGHT-SL-0614	326-PITLEFT-SL-0614
Sample Date:	6/14/96	6/14/1996
Volatile Organics		
2- Butanone	140	100 U
Metals		
Barium TCLP	2	1.6
Cadmium TCLP	0.013	0.0067
PCBs		
Aroclor -1248	340	38 U
Aroclor-1260	58	38 U

All results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

Building/Area Investigation Data
Table 6f - EVI Parcel Screening Investigation
Summary of Results

Initial Sampling

Analyte	Sample Collection Designation & Collection Date			
Source:	4	4	4	
Sample ID:	EVIMW-1	EVIMW-2	EVIMW-3	
Sample Date:	TOGS 1.1.1	7/24/96	7/24/96	7/24/96
<u>Semi-volatile Organics</u>				
Benzo(a)anthracene	0.002	10.0 U	25	9.0 U
Benzo(a)pyrene	ND	10.0 U	24	9.0 U
Benzo(b)fluoranthene	0.002	10.0 U	47	9.0 U
Benzo(g,h,i)perylene	NS	10.0 U	13	9.0 U
Benzo(k)fluoranthene	0.002	10.0 U	16	9.0 U
Chrysene	0.002	10.0 U	36	9.0 U
Indeno(1,2,3-cd)pyrene	0.002	10.0 U	13	9.0 U
<u>Priority Pollutant Metals</u>				
Copper	200	0.014 U	0.015	0.014 U
Nickel	100	0.016 U	0.016 U	0.016
Zinc	2,000	0.0074 U	0.014	0.026

Confirmatory Sampling

Analyte	Sample Collection Designation & Collection Date			
Source:	4	4	4	
Sample ID:	EVIMW-1	EVIMW-2	EVIMW-3	
Sample Date:	TOGS 1.1.1	8/23/96	8/23/96	8/23/96
<u>Semi-volatile Organics</u>				
Benzo(a)anthracene	0.002	NA	10 U	NA
Benzo(a)pyrene	ND	NA	10 U	NA
Benzo(b)fluoranthene	0.002	NA	10 U	NA
Benzo(g,h,i)perylene	NS	NA	10 U	NA
Benzo(k)fluoranthene	0.002	NA	10 U	NA
Chrysene	0.002	NA	10 U	NA
Indeno(1,2,3-cd)pyrene	0.002	NA	10 U	NA

Results are in milligrams per Liter (mg/L).

Notes:

ND = Not detected

U = Indicates that the compound was analyzed for but not detected.

ns = No standard. Value not available in TOGS 1.1.1.

NA = Sample was not analyzed for this constituent.

Building/Area Investigation Data
Table 6g - EVI Parcel Investigation Program
Summary of Soil Boring Sample Results

[illegible]

NS = No standard. Recommended soil cleanup objective is not available.
MDL = Method Detection Limit.
NA = Sample was not analyzed for this constituent.

Building/Area Investigation Data
Table 6g - EVI Parcel Investigation Program
Summary of Soil Boring Sample Results

Analyte									
Source:		4	4	4	4	4	4	4	4
Sample ID:		B5-1	B5-14	B6-15.5	B7-1	B7-15	B8-14	B10-13.5	B12-10
Sample Depth:	NYSDEC	1-2.5'	14-15'	15.5-16.5'	1-3'	15-16'	14-14.5'	13.5-14.5'	10-12'
Sample Date:	TAGM 4046	5/14/97	5/14/97	5/13/97	5/13/97	5/13/97	5/14/97	5/14/97	5/13/97
<u>Volatile Organics (mg/kg)</u>									
1,2,4-Trimethylbenzene	NS	NA	NA	NA	NA	NA	NA	670	NA
sec-Butylbenzene	NS	NA	NA	760	NA	NA	NA	680	NA
4-Isopropyltoluene	NS	NA	NA	NA	NA	NA	NA	860	NA
n-Butylbenzene	NS	NA	680	2,100	NA	NA	NA	1,700	NA
Naphthalene	13,000	NA	NA	910	NA	NA	NA	2,700	NA
<u>Semi-Volatile Organics (mg/kg)</u>									
Acenaphthene	50,000	NA	1,300	2,700	NA	NA	NA	NA	NA
Anthracene	50,000	NA	NA	1,200	NA	NA	NA	NA	NA
Benzo(a)anthracene	224 or MDL	NA	810	480	NA	1,600	840	NA	NA
Benzo(a)pyrene	61 or MDL	NA	NA	NA	NA	1,200	490	NA	NA
Benzo(b)fluoranthene	1,100	NA	NA	NA	NA	2,100	620	NA	640
Benzo(ghi)perylene	50,000	NA	NA	NA	NA	1,100	NA	NA	400
Benzo(k)fluoranthene	1,100	NA	NA	NA	NA	700	NA	NA	NA
Chrysene	400	NA	980	510	NA	2,000	850	NA	NA
Dibenzofuran	6,200	NA	NA	960	NA	NA	NA	NA	NA
Dibenz(ah)anthracene	14 or MDL	NA	NA	NA	NA	420	NA	NA	NA
2,4-Dinitrotoluene	NA	NA	NA	NA	NA	420	NA	NA	NA
Fluoranthene	50,000	NA	870	840	NA	1,700	2,200	410,000	400
Fluorene	50,000	NA	3,100	5,400	NA	NA	NA	NA	NA
Indeno(1,2,3-cd)pyrene	3,200	NA	NA	NA	NA	1,000	NA	NA	NA
2-Methylnaphthalene	36,400	NA	2,100	2,500	NA	NA	NA	NA	NA
3-Nitroaniline	500 or MDL	NA	NA	NA	NA	NA	NA	NA	NA
Naphthalene	13,000	NA	1,400	2,300	NA	NA	NA	NA	NA
Phenanthrene	50,000	NA	950	1,800	NA	800	1,300	440,000	NA
Pyrene	50,000	NA	3,000	2,000	NA	1,700	1,500	360,000	390
<u>PCBs (mg/kg)</u>									
Arcolor-1254	10,000	0.767	NA	NA	NA	NA	NA	NA	NA
<u>Pesticides/Herbicides (mg/kg)</u>									
beta-BHC	200	NA	NA	NA	NA	NA	NA	NA	NA
p,p-DDE	2,100	NA	NA	NA	69	NA	NA	NA	NA
p,p-DDD	2,900	NA	NA	NA	40	NA	NA	NA	NA
p,p-DDT	2,100	NA	NA	NA	NA	NA	NA	NA	NA
Endosulfan sulfate	1,000	NA	NA	NA	NA	NA	NA	281	NA
technical Chlordane	540	NA	NA	NA	549	NA	NA	NA	NA

NS = No standard. Recommended soil cleanup objective is not available.

MDL = Method Detection Limit.

NA = Sample was not analyzed for this constituent.

Building/Area Investigation Data
Table 6h - EVI Parcel Investigation Program
Summary of Groundwater Sample Results

Analyte	Sample Collection Designation, Screen Interval & Collection Date					
	Source:	4	4	4	4	4
	Sample ID:	EVIMW-1	EVIMW-3	EVIMW-5	EVIMW-6	EVIMW-8
	Sample Depth:	10-20'	10-20'	8-18'	9-19'	10-20'
	Sample Date:	TOGS 1.1.1	6/5/97	6/5/97	6/5/97	6/6/97
<u>Semi-volatile Organics (mg/L)</u>						
Bis(2-ethylhexyl)phthalate	5	110	51	32	32	NA
Fluoranthene	50	NA	18	NA	NA	NA
Phenanthrene	50	NA	NA	NA	16	NA
Pyrene	50	NA	13	NA	11	NA
<u>PCBs (mg/L)</u>						
Aroclor-1248	0.09	NA	NA	NA	NA	0.082
<u>Metals (mg/L)</u>						
Arsenic	0.025	NA	NA	NA	NA	0.01

NA = Sample was not analyzed for this constituent.

Building/Area Investigation Data

**Table 6i - Building 330 Resource Conservation and Recovery Act (RCRA) Closure Investigation
Summary of Concrete Sample Toxicity Characteristic Leaching Procedure (TCLP) Metals Results**

Analyte								
Source:		2	2	2	2	2	2	2
Sample ID:	Regulatory	330-01	330-02	330-03	330-04	330-05	330-06	330-07
Sample Date:	Standard	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997
Barium	100	0.22	0.18	1.017	0.01 U	0.36	0.39	0.1
Chromium	5	0.06	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U

Analyte								
Source:		2	2	2	2	2	2	2
Sample ID:	Regulatory	330-08	330-09	330-10	330-11	330-12	330-13	330-14
Sample Date:	Standard	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997
Barium	100	0.28	0.29	0.45	0.11	0.54	0.08	0.05
Chromium	5	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U	0.05 U

All results reported in milligrams per liter (mg/L).

Notes:
Regulatory standard as reported in source.

Building/Area Investigation Data
Table 6j - Building 330 Resource Conservation and Recovery Act (RCRA) Closure Investigation
Summary of Concrete Sample Polychlorinated Biphenyls (PCBs) Results

Analyte							
Source:	2	2	2	2	2	2	2
Sample ID:	330-01	330-02	330-03	330-04	330-05	330-06	330-07
Sample Date:	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997
Aroclor 1254	1	2.9	3.8	1.1	1 U	2	1 U

Analyte							
Source:	2	2	2	2	2	2	2
Sample ID:	330-08	330-09	330-10	330-11	330-12	330-13	330-14
Sample Date:	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997	12/11/1997
Aroclor 1254	1.1	2.3	13	13	1 U	1.3	1 U

All results reported in milligrams per kilogram (mg/kg).

Building/Area Investigation Data
Table 6k - Building 306 Investigation
Summary of Soil Sample Results

Parameter	Source: Sample ID: Sample Date:	2 306-E1 12/11/1998	2 306-E2 12/11/1998	2 306-E3 12/11/1998	2 306-E4 12/11/1998	2 306-N1 12/11/1998	2 306-N2 12/11/1998	2 306-N3 12/11/1998	2 306-N4 12/11/1998	2 306-S1 12/11/1998	2 306-S2 12/11/1998	2 306-S3 12/11/1998
	NYSDEC TAGM 4046											
Full Analytical Suite (Y/N)	--	N	Y	N	N	N	N	N	Y	N	N	Y
Total Petroleum Hydrocarbons	ns	270	2,700	6,100	1,100	2,500	4,600	ND	ND	540	ND	6800
Type of Petroleum	--	Diesel	Diesel	Diesel	Diesel	Diesel	Diesel	ND	ND	Diesel	ND	Diesel
Volatile Organic Compounds												
Acetone	50.0	ND	ND	ND	ND	ND	ND	ND	0.0503	ND	ND	ND
Semivolatile Organic Compounds												
2-Methynaphthalene	36.4	ND	8.49	ND	ND	ND	ND	ND	ND	ND	ND	ND
Acenaphthene	50.0	ND	2.45	ND	ND	ND	ND	ND	ND	ND	ND	ND
Anthracene	0.061 or MDL	ND	0.912	ND	ND	ND	ND	ND	ND	ND	ND	ND
Fluorene	2.0	ND	2.79	ND	ND	ND	ND	ND	ND	ND	ND	ND
Naphthalene	50.0	ND	1.35	ND	ND	ND	ND	ND	ND	ND	ND	ND
Phenanthrene	ns	ND	1.66	ND	ND	ND	ND	ND	ND	ND	ND	ND
Pyrene	13.0	ND	0.769	ND	ND	ND	ND	ND	ND	ND	ND	ND
Metals												
Barium	300 or SB	ND	1.7	ND	ND	ND	ND	ND	ND	ND	ND	ND
Lead	SB	ND	0.38	ND	ND	ND	ND	ND	ND	ND	ND	ND

Results are in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

ND = Not Detected

MDL = Method Detection Limit

mg/L = milligrams per Liter or ppm

SB = Site background

ns = No standard. Recommended soil cleanup objective is not available.

Building/Area Investigation Data
Table 6I - Building 332 Tank Farm Investigation
Summary of Soil Sample Results

Parameter	Source:	2	2	2	2	2	2	2	2	2	2	2	2	2
	Sample ID:	NYSDEC	332-E1	332-E2	332-S1	332-S2	332-S3	332-W1	332-W2	332-W3	332-W4	332-W5	332-W6	332-W7
	Sample Date:	TAGM 4046	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998	12/10/1998
Full Analytical Suite (Y/N)	--	N	Y	Y	N	N	Y	N	N	N	N	N	N	N
Total Petroleum Hydrocarbons	ns	7,800	ND	ND	380	7,000	1,500	470	190	1,700	ND	3,700	13,000	
Type of Petroleum	--	Diesel	ND	ND	Not Diesel	Not Diesel	Not Diesel	Not Diesel	Diesel	Diesel	ND	Diesel	Diesel	
Semivolatile Organic Compounds														
n-Propylbenzene	3.7	ND	ND	ND	ND	ND	0.0275	ND	ND	ND	ND	ND	ND	ND
2-Methynaphthalene	36.4	ND	ND	ND	ND	ND	8.53	ND	ND	ND	ND	ND	ND	ND
Benzo (a) anthracene	1.1	0.752	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Benzo (a) pyrene	50	1.28	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Benzo (b) fluoranthene	1.1	2.23	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Benzo (k) fluoranthene	50	0.919	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Chrysene	8.1	1.11	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Fluoranthene	7.1	0.394	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND
Fluorene	2	ND	ND	ND	ND	ND	0.661	ND	ND	ND	ND	ND	ND	ND
Phenanthrene	ns	ND	ND	ND	ND	ND	1.44	ND	ND	ND	ND	ND	ND	ND
Pyrene	13	0.42	ND	ND	ND	ND	0.518	ND	ND	ND	ND	ND	ND	ND
Metals														
Barium	300 or SB	ND	2	2	ND	ND	1.5	ND	ND	ND	ND	ND	ND	ND

Results are in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

ND = Not Detected

mg/L = milligrams per Liter or ppm

SB = Site background

NS = No standard. Recommended soil cleanup objective is not available.

Data in this workbook is taken from the following sources:

- ¹ Dames & Moore, May 1993, Summary of Activities Related to Selected Issues Noted in NYSDEC Order on Consent File No. R4-1338-92-05, Job #24707-001-017.
- ² Blasland, Bouck & Lee, Inc., July 2000, Site Investigation Work Plan.
- ³ General Electric, March 1999, Building 326 & 328 Demolition Memorandum.
- ⁴ Vanasse Hangen Brustlin, Inc., June 2002, Impact Analysis and Closure Petition, Nott Street Industrial Park, EVI Parcel

Note:

The source of the data is identified in the source row for each sample.

NYSDEC TOGS 1.1.1 - New York State Department of Environmental Conservation, Division of Water Technical and Operational Guidance Series (1.1.1), Ambient Water Quality Standards and Guidance Values and Groundwater Effluent Limitations, June 1998.

NYSDEC TAGM #4046 values are taken from New York State Department of Environmental Conservation Division of Environmental Remediation Guidance Document, Technical and Administrative Guidance Memorandum #4046, Determination of Soil Cleanup Objectives and Cleanup Levels, Appendix A Recommended Soil Cleanup Objectives, January 24, 1994.

As per the TAGM, total VOCs must be less than 10 mg/kg, total SVOCs must be less than 500 mg/kg and individual SVOCs must be less than 50 mg/kg.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

UST Closure Program Data
Table 7a - Building 332 UST Closure
Summary of Field Screening and Analytical Results

Parameters			
Sample ID:	332-NTNKOUT-SS-1105	332-TNKPL-SO-1106	332-TNKPL2FT-SO-1106
Sample Date:	11/5/92	11/6/92	11/6/1992
Sample Location:	Concrete Tank Chip Samples	Soil Directly Under Tank	Soil Two Feet Under Tank
Headspace			
Headspace	--	6	150
Petroleum ID	--	--	Xylenes/Kerosene
Volatile Organics			
1,1,1-Trichloroethane	0.79	0.011	0.51
1,1-Dichloroethane	0.02	--	--
1,1-Dichloroethene	0.011	--	--
Ethylbenzene	0.056	0.028	3.9
Tetrachloroethylene	--	0.001	--
Toluene	0.025	0.002	1.4
Xylenes	0.11	0.092	18
Metals			
Barium	--	0.32	0.14

Results are in milligrams per kilogram (mg/kg), or in parts per million (ppm).

Notes:

-- = Not applicable. Based on available information, it appears that these constituents were not detected but this could not be confirmed.

Source: General Electric, December 1992, Closure of a 2,700-gallon Concrete Underground Storage Tank (UST) Located at GE's Nott Street Facility

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Remediation Program Data

Table 8a - MW-01 Free Product Recovery Summary

Dates of Collection		Recovery (Gallons)	Free Product in Drum	Source
From	To			
2/5/1993	3/15/1993	55	2 inches	1
3/15/1993	3/28/1993	55	1-2 inches	1
3/28/1993	5/24/1993	55	1/4 inch	1
5/24/1993	8/3/1992	55	sheen	1
8/3/1993	3/29/1994	55	sheen	1
3/29/1994	4/22/1994	55	sheen	1
4/22/1994	5/31/1994	55	sheen	1
5/31/1994	6/21/1994	55	2-4 inches	1
6/21/1994	8/9/1994	55	sheen	1
8/9/1994	5/11/1995	55	sheen	1
5/11/1995	2/4/98*	55	no sheen observed	1
TOTAL		550		

* = In service through 2/4/98 (out of service after 2/4/98)

Remediation Program Data**Table 8b - Building 328 Transformer Inspection, Removal and Follow-up Investigation/Remediation
Summary of Polychlorinated Biphenyls (PCBs) Results**

Analyte		Wire Sample	
Source:		2	
Sample ID:		BLDG328-WIRE-LOC3-520	
Sample Date:		5/20/96	
Aroclor-1260		0.24	

All results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Analyte		Soil Samples	
Source:		2	2
Sample ID:		BLDG328-SOIL-LOC1-520	BLDG328-SOIL-LOC2-520
Sample Date:		5/20/1996	5/20/1996
Aroclor-1260		17,000	150

All results are reported in micrograms per kilogram (ug/kg), or parts per billion (ppb).

Remediation Program Data

**Table 8c - Polychlorinated Biphenyls (PCBs) Transformer Spill
Summary of PCB Analytical Results (Method 8080)**

Source:	3	3	3	3	3	3	3
Sample ID:	178 SUB-539-OI-0129	178 SUB-538-OI-0129	178 SUB-BB8-WI-0129	178 SUB-FIN8-WI-0129	178 SUB-BB9-WI-0129	178 SUB-FIN9-WI-0129	178 SUB-5393-SO-0201
Sample Matrix:	Oil	Oil	Wipe	Wipe	Wipe	Wipe	Soil
Sample Date:	1/30/1993	1/30/1993	1/30/1993	1/30/1993	1/30/1993	1/30/1993	2/2/1993
Aroclor-1260	569	528	161	7.1	244	27.6	128.6

Oil sample and soil sample results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Wipe sample results are reported in micrograms/100 square centimeters

Remediation Program Data

Table 8c - Polychlorinated Biphenyls (PCBs) Transformer Spill

Summary of PCB Analytical Results (Method 8080)

Source:	3	3	3	3	3	3	3
Sample ID:	178 SUB-5391-SO-0201	178 SUB-538C-SO-0201	178 SUB-538B-SO-0201	178 SUB-538A-SO-0201	178 SUB-5292-SO-0201	178 SUB-BACK-SO-1004	178 SUB-TOP-WI-1004
Sample Matrix:	Soil	Soil	Soil	Soil	Soil	Soil	Soil
Sample Date:	2/2/1993	2/2/1993	2/2/1993	2/2/1993	2/2/1993	10/5/1993	10/5/1993
Aroclor-1260	66.5	70.4	4.3	40.7	6.8	1	1.4

Oil sample and soil sample results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Wipe sample results are reported in micrograms/100 square centimeters

Remediation Program Data
Table 8c - Polychlorinated Biphenyls (PCBs) Transformer Spill
Summary of PCB Analytical Results (Method 8080)

Source:	3	3
Sample ID:	178-245E-SO-1108	178-254W-SO-1108
Sample Matrix:	Soil	Soil
Sample Date:	11/9/1993	11/9/1993
Aroclor-1260	3.88	4.3

Oil sample and soil sample results are reported in milligrams per kilogram (mg/kg), or parts per million (ppm).
Wipe sample results are reported in micrograms/100 square centimeters

Remediation Program Data
Table 8d - Monitoring Well MW-04 Bioventing System
Summary of Soil Sample Total Petroleum Hydrocarbon Data

Source:	3	3	3	3	3	3	3	3
Sample ID:	BVM2SW 2-14	BVM2SW 5-10-12	BVM2SW 5-14	RW03E 5-10-12	RW03S 10-10-12	RW03S 5-14	RW03W 5-10-12	RW03E 10-14
Depth (ft):	14	10-12	14	10-12	10-12	14	10-12	14
Sample Date:	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98
Total Petroleum Hydrocarbon	20000	820	19000	1100	110	6300	820	24000

Notes:
Sample ID nomenclature e.g. RW03E 5-10-12
RW03 = Well Location
E = Direction (N,E,S,W)
5 = Distance from well
10-12 = Depth Interval

Remediation Program Data
Table 8d - Monitoring Well MW-04 Bioventing System
Summary of Soil Sample Total Petroleum Hydrocarbon Data

Source:	3	3	3	3	3	3	3	3
Sample ID:	RWO3E 15-10-12	RWO3E 15-15	RWO3E 5-14	RWO3S 10-14	RWO3S 15-14	RWO3W 10-14	RWO3W 15-14	RWO3W 5-14
Depth (ft):	10-12	14	14	14	14	14	14	14
Sample Date:	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98	12/8/98
Total Petroleum Hydrocarbon	380	14000	1000	130	3000	1300	4500	3500

Notes:
Sample ID nomenclature e.g. RW03E 5-10-12
RW03 = Well Location
E = Direction (N,E,S,W)
5 = Distance from well
10-12 = Depth Interval

Remediation Program Data
Table 8e - Monitoring Well MW-01 Polychlorinated Biphenyl (PCB) Source Removal
Summary of Endpoint Sample Total Petroleum Hydrocarbon (TPH) and PCB Results

Analyte	4				
	Source:	4	4	4	4
	Sample ID:	North Wall	South Wall	East Wall	West Wall
	Sample Date:	2/4/1998	2/4/1998	2/4/1998	2/4/1998
Total Petroleum Hydrocarbons		23,000	4,100	1,200	43,000
Polychlorinated Biphenyls		4.06	0.921	ND	2.83

Results are in parts per million (ppm).

Notes:
ND = Not detected

Remediation Program Data

Table 8f - EVI Parcel ENA Pilot Study

Summary of Soil Polycyclic Aromatic Hydrocarbon (PAH) Concentrations - ENA Pilot Study 12' Depth (May 1997)

Chemical	NYSDEC TAGM 4046	Frequency of Detection	Range		Average	Median	Source
			Min	Max			
2-Methylnaphthalene	36,400	1/5	550	550	550	550	5
Acenaphthene	50,000	0/5	NA	NA	NA	NA	5
Anthracene	50,000	1/5	690	690	690	690	5
Benzo (a) anthracene	224 or MDL	4/5	590	2,300	1,323	1,200	5
Benzo (a) pyrene	61 or MDL	4/5	490	2,300	1,160	925	5
Benzo (b) fluoranthene	1,100	5/5	640	3,700	1,540	1,100	5
Benzo (ghi) perylene	50,000	3/5	400	740	547	500	5
Benzo (k) fluoranthene	1,100	1/5	440	440	440	440	5
Chrysene	400	4/5	800	3,400	1,725	1,350	5
Dibenzo (ah) anthracene	14 or MDL	0/5	NA	NA	NA	NA	5
Dibenzofuran	6,200	0/5	NA	NA	NA	NA	5
Fluoranthene	50,000	5/5	400	2,800	1,800	2,200	5
Fluorene	50,000	0/5	NA	NA	NA	NA	5
Indeno (1,2,3-cd) pyrene	3,200	2/5	460	710	585	585	5
Naphthalene	13,000	1/5	420	420	420	420	5
Phenanthrene	50,000	4/5	490	3,200	2,073	2,300	5
Pyrene	50,000	5/5	390	2,800	1,532	1,800	5

All concentrations reported in milligrams per kilogram (mg/kg), or parts per million (ppm).

Notes:

Based on data collected from EVI-4, 11-11.5'; EVI-5, 9-10'; EVI-6, 10-11'; EVI-8, 11-12'; and B-12, 10-12'.

NA = Not applicable.

Remediation Program Data
Table 8g - EVI Parcel ENA Pilot Study
Summary of Baseline Soil Sample Results

Parameter	Source: Sample ID: Sample Date:	5 EVIMW-1 3/7/2000	5 EVIMW-2 3/7/2000	5 EVIMW-3 3/7/2000	5 EVIMW-6 3/7/2000	5 EVIMW-6 E (DUP) 3/7/2000	5 EVIMW-7 3/7/2000	5 EVIMW-8 3/7/2000	5 ENAGP-1 3/7/2000	5 ENAGP-2 3/7/2000	5 ENAGP-3 3/7/2000	5 ENAGP-4 3/7/2000	5 ENAGP-5 3/7/2000	5 ENAGP-6 3/7/2000
Total Organic Carbon (mg/kg)		7,370	29,000	21,000	19,600	38,600	4,440	25,000	24,000	11,700	92,400	33,300	39,200	22,400
Total Petroleum Hydrocarbons (mg/kg)		ND	926	1,420	18,300	19,000	9,800	6,020	20,200	12,500	53,900	32,600	17,100	24,800
Polycyclic Aromatic Hydrocarbons (ug/kg)														
2-Methynaphthalene		1,160	3,650	ND	ND	ND	ND	ND	ND	ND	4,690	ND	ND	1,810
Acenaphthene		415	5,830	ND	ND	ND	ND	ND	ND	ND	5,370	2,910	1,890	1,310
Anthracene		638	13,400	ND	2,500	2,840	ND	ND	ND	619	2,800	1,400	1,690	1,470
Benzo (a) anthracene		1,770	18,500	ND	5,420	5,900	ND	ND	ND	ND	ND	ND	ND	ND
Benzo (a) pyrene		1,510	15,800	ND	7,500	6,880	ND	ND	ND	ND	1,710	ND	ND	ND
Benzo (b) fluoranthene		3,250	20,000	ND	8,820	8,030	ND	548	ND	ND	1,300	ND	ND	ND
Benzo (g,h,i) perylene		1,080	7,080	ND	4,660	4,390	ND	ND	ND	ND	ND	ND	ND	ND
Benzo (k) fluoranthene		973	7,750	ND	3,280	3,000	ND	ND	ND	ND	ND	ND	ND	ND
Chrysene		1,870	16,200	ND	4,500	4,850	ND	ND	ND	ND	ND	ND	ND	ND
Fluoranthene		4,770	50,000	ND	12,300	12,500	ND	703	ND	460	2,100	ND	1,030	608
Fluorene		503	6,470	ND	ND	ND	ND	ND	814	1,280	5,110	3,740	3,240	3,320
Indeno (1,2,3-cd) pyrene		993	6,570	ND	3,820	4,040	ND	ND	ND	ND	ND	ND	ND	ND
Naphthalene		868	7,390	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	2,970
Phenanthrene		4,420	58,800	ND	7,510	8,170	4,150	ND	652	788	10,600	3,290	1,300	3,830
Pyrene		3,380	41,500	ND	12,000	13,600	ND	983	824	1,160	3,730	2,970	1,430	2,050

Notes:
ND = Not Detected

Remediation Program Data
Table 8h - EVI Parcel ENA Pilot Study
Summary of Groundwater Laboratory and Field Test Data

Parameter (units)	Source: Sample ID: Sample Date:	5 EVIMW-1 3/8/00	5 EVIMW-2 3/8/00	5 EVIMW-3 3/8/00	5 EVIMW-6 3/8/00	5 EVIMW-7 3/8/00	5 EVIMW-8 3/8/00
Ammonia		< 0.1	< 0.1	0.32	1.51	1.35	0.21
Nitrate as N		0.5	0.7	0.7	1.3	1.2	1
Total Phosphate		< .05	< .05	0.14	0.5	0.1	0.05
Hydrogen Sulfide		< 0.1	< 0.1	< 0.1	0.2	< 0.1	< 0.1
Sulfate		294	179	288	84	85	258
Methane		< 0.02	< 0.03	< 0.02	3.37	1.19	< 0.02
Iron		0.13	0.121	4.14	8.25	9.56	11
Standard Plate Count (col/ml)		880	10	240	280	ns	350
CO ²		10	50	95	155	130	135
Alkalinity		100	15	5	155	95	30
Fe ⁺²		0	0	1.8	2.4	2.3	2.5
Headspace (ppm)		3.4	2.5	31	1.7	0	3.8
Turbidity		NS	2.7	240	5.5	NS	6.8
Temperature (C ^o)		10.75	13.08	13.88	11.09	13.99	13.59
Specific Conductance (uS/cm)		1.562	0.403	0.629	0.966	2.7	0.652
pH (std units)		7.18	5.89	4.58	6.78	6.79	5.8
Oxidation reduction potential (mv)		52.7	160.2	228	-84.3	-62.8	104
Dissolved oxygen		4.04	5.02	1.52	0.79	2.47	1.19

Results are reported in milligrams per Liter (mg/L), unless otherwise noted.

Notes:

col/ml = colony per milliliter

ppm = parts per million.

C^o = degrees Celsius

uS/cm = microsiemens per centimeter

std units = standard units

mv = millivolts

NS = Not sampled

Remediation Program Data

Table 8i - EVI Parcel ENA Pilot Study

Summary of Soil Polycyclic Aromatic Hydrocarbon (PAH) Concentrations - ENA Pilot Study 16' - 18' Depth (March 2000)

Chemical	Frequency of Detection	Range		Average	Median	NYSDEC TAGM 4046	Source
		Min	Max				
2-Chloronaphthalene	0/6	NA	NA	NA	NA	NA	5
2-Methylnaphthalene	2/6	1,810	4,960	3,385	3,385	36,400	5
Acenaphthene	4/6	1,310	5,370	2,870	2,400	50,000	5
Acenaphthylene	0/6	NA	NA	NA	NA	NA	5
Anthracene	5/6	619	2,800	1,596	1,470	50,000	5
Benzo (a) anthracene	0/6	NA	NA	NA	NA	NA	5
Benzo (a) pyrene	1/6	1,710	1,710	1,710	1,710	61 or MDL	5
Benzo (b) fluoranthene	1/6	1,300	1,300	1,300	1,300	1,100	5
Benzo (ghi) perylene	0/6	NA	NA	NA	NA	NA	5
Benzo (k) fluoranthene	0/6	NA	NA	NA	NA	NA	5
Chrysene	0/6	NA	NA	NA	NA	NA	5
Dibenzo (ah) anthracene	0/6	NA	NA	NA	NA	NA	5
Fluoranthene	4/6	460	2,100	1,050	819	50,000	5
Fluorene	6/6	814	5,110	2,917	3,280	50,000	5
Indeno (1,2,3-cd) pyrene	0/6	NA	NA	NA	NA	NA	5
Naphthalene	1/6	2,970	2,970	2,970	2,970	13,000	5
Phenanthrene	6/6	625	10,600	3,406	2,295	50,000	5
Pyrene	6/6	824	3,730	2,027	1,740	50,000	5

All concentrations reported in mg/kg.

Notes:

Results are based on samples collected from ENAGP-1, ENAGP-2, ENAGP-3, ENAGP-4, ENAGP-5, and ENAGP-6.

Remediation Program Data**Table 8j - EVI Parcel ENA Pilot Study****Summary of Soil Polycyclic Aromatic Hydrocarbon (PAH) Concentrations - ENA Pilot Study 12' Depth (December 2000)**

Chemical	Frequency of Detection	Range		Average	Median	NYSDEC TAGM 4046	Source
		Min	Max				
2-Chloronaphthalene	0/8	NA	NA	NA	NA	NA	5
2-Methylnaphthalene	2/8	5,330	115,000	60,165	60,165	36,400	5
Acenaphthene	1/8	4,420	4,420	4,420	4,420	50,000	5
Acenaphthylene	1/8	52,100	52,100	52,100	52,100	41,000	5
Anthracene	4/8	4,060	88,800	28,043	9,655	50,000	5
Benzo (a) anthracene	4/8	10,000	83,700	31,000	15,150	224 or MDL	5
Benzo (a) pyrene	4/8	7,100	73,500	26,900	13,500	61 or MDL	5
Benzo (b) fluoranthene	4/8	9,610	108,000	40,903	23,000	1,100	5
Benzo (ghi) perylene	2/8	6,530	7,340	6,935	6,935	50,000	5
Benzo (k) fluoranthene	3/8	6,450	38,500	17,430	7,340	1,100	5
Carbazole	3/8	4,200	42,900	17,297	4,790	NA	5
Chrysene	4/8	7,680	71,700	27,320	14,950	400	5
Dibenzo (ah) anthracene	0/8	NA	NA	NA	NA	NA	5
Fluoranthene	6/8	4,440	258,000	64,805	35,650	50,000	5
Fluorene	2/8	6,110	71,200	38,655	38,655	50,000	5
Indeno (1,2,3-cd) pyrene	3/8	4,320	7,230	6,037	6,560	3,200	5
Naphthalene	3/8	4,900	448,000	155,767	14,400	13,000	5
Phenanthrene	5/8	6,780	425,000	107,516	31,000	50,000	5
Pyrene	6/8	5,450	244,000	58,015	27,350	50,000	5

All concentrations reported in milligrams per kilogram ($\mu\text{g/kg}$), or parts per million (ppm).

Notes:

Results are based on samples collected from ENAGP-1, ENAGP-2, ENAGP-3, ENAGP-4, ENAGP-5, ENAGP-6, ENAGP-7, and ENAGP-8 all collected from the 12-13.5' depth interval.

NA = Not applicable

Remediation Program Data

Table 8k - EVI Parcel ENA Pilot Study

Summary of Soil Polycyclic Aromatic Hydrocarbon (PAH) Concentrations - ENA Pilot Study 17' - 18' Depth (December 2000)

Chemical	Frequency of Detection	Range		Average	Median	NYSDEC TAGM 4046	Source
		Min	Max				
2-Chloronaphthalene	0/8	NA	NA	NA	NA	NA	5
2-Methylnaphthalene	1/8	7,190	7,190	7,190	7,190	36,400	5
Acenaphthene	2/8	478	7,520	3,999	3,999	50,000	5
Acenaphthylene	0/8	NA	NA	NA	NA	NA	5
Anthracene	2/8	583	10,100	5,342	5,342	50,000	5
Benzo (a) anthracene	2/8	917	13,200	7,059	7,059	224 or MDL	5
Benzo (a) pyrene	2/8	631	9,560	5,096	5,096	61 or MDL	5
Benzo (b) fluoranthene	2/8	1,017	12,800	6,909	6,909	1,100	5
Benzo (ghi) perylene	0/8	NA	NA	NA	NA	NA	5
Benzo (k) fluoranthene	0/8	NA	NA	NA	NA	NA	5
Carbazole ¹	0/8	NA	NA	NA	NA	NA	5
Chrysene	2/8	848	13,000	6,924	6,924	400	5
Dibenz (ah) anthracene	0/8	NA	NA	NA	NA	NA	5
Fluoranthene	5/8	638	33,700	10,352	7,770	50,000	5
Fluorene	3/8	596	13,200	4,826	681	50,000	5
Indeno (1,2,3-cd) pyrene	0/8	NA	NA	NA	NA	NA	5
Naphthalene	2/8	6,500	10,800	8,650	8,650	13,000	5
Phenanthrene	7/8	985	42,900	10,412	5,140	50,000	5
Pyrene	5/8	891	31,600	9,630	6,170	50,000	5

All concentrations reported in mg/kg.

Notes:

Results are based on samples collected from ENAGP-1, ENAGP-2, ENAGP-3, ENAGP-4, ENAGP-5, ENAGP-6, ENAGP-7, and ENAGP-8 all collected from the 17-18' depth interval.

¹ Analysis for carbazole was not performed for the March 2000 samples.

NA = Not applicable

Remediation Program Data
Table 8I - EVI Parcel ENA Pilot Study
Summary of Groundwater Field Parameter Data

Parameter	Source:	5	5	5	5	5	5	5
	Sample ID:	ENAP-01	ENAP-01	ENAP-01	ENAP-01	ENAP-01	ENAP-01	ENAP-01
	Sample Date:	6/1/2000	7/6/2000	8/10/2000	9/7/2000	10/12/2000	11/15/2000	12/5/2000
Ferrous Iron		4.6	3.9	2.2	2.0	2.0	2.0	2.0
CO ₂		255	295	295	280	290	175	170
O ₂		2.17	2.53	22.80	144.10	0.44	1.80	1.80
pH		--	7.0	7.0	7.0	7.0	7.0	7.0
Temperature (deg C)		12.3	12.4	15.6	16.6	13.6	14.1	14.0

Parameter	Source:	5	5	5	5	5	5	5
	Sample ID:	ENAP-02	ENAP-02	ENAP-02	ENAP-02	ENAP-02	ENAP-02	ENAP-02
	Sample Date:	6/1/2000	7/6/2000	8/10/2000	9/7/2000	10/12/2000	11/15/2000	12/5/2000
Ferrous Iron		2.8	3.4	3.4	2.2	1.9	2.2	2.2
CO ₂		280	300	335	325	335	300	290
O ₂		2.10	2.10	25.00	126.80	0.43	2.80	2.70
pH		--	7.0	7.0	7.0	7.0	7.0	7.0
Temperature (deg C)		12.3	12.3	15.6	16.2	14.3	14.6	14.2

Parameter	Source:	5	5	5	5	5	5	5
	Sample ID:	ENAP-03	ENAP-03	ENAP-03	ENAP-03	ENAP-03	ENAP-03	ENAP-03
	Sample Date:	6/1/2000	7/6/2000	8/10/2000	9/7/2000	10/12/2000	11/15/2000	12/5/2000
Ferrous Iron		3.2	3.2	3.0	2.0	2.0	3.0	3.0
CO ₂		240	235	325	350	280	230	230
O ₂		1.24	1.28	34.30	99.20	0.56	2.00	2.00
pH		--	7.0	7.0	7.0	7.0	7.0	7.0
Temperature (deg C)		12.4	12.4	15.6	15.4	14.9	14.0	14.0

-- = No result reported.

Data in this workbook is taken from the following sources:

- 1 Dames & Moore, March 1995, Fourth Quarter Report, 1994 Free Product Recover & Site Inspection Summary, Job #24707-004-L566.
- 2 General Electric, March 1999, Building 326 & 328 Demolition Memorandum
- 3 Blasland, Bouck & Lee, Inc., July 2000, Site Investigation Work Plan.
- 4 Harding Lawson Associates, Inc., July 1998, MW-01 PCB Remediation Program Report DEC Order on Consent R4-1338-92-05, Project #2349.00
- 5 Vanasse Hangen Brustlin, Inc., June 2002, Impact Analysis and Closure Petition, Nott Street Industrial Park, EVI Parcel

Note:

The source of the data is identified in the source row for each sample.

NYSDEC TAGM #4046 values are taken from New York State Department of Environmental Conservation Division of Environmental Remediation Guidance Document, Technical and Administrative Guidance Memorandum #4046, Determination of Soil Cleanup Objectives and Cleanup Levels, Appendix A Recommended Soil Cleanup Objectives, January 24, 1994.

As per the TAGM, total VOCs must be less than 10 mg/kg, total SVOCs must be less than 500 mg/kg and individual SVOCs must be less than 50 mg/kg.

Analytical method information is included in the table headings if available; however, this information was not available for every sample.

Table 9
Chlorinated Solvent Plume (Area 6) Data Summary
Nott Street Industrial Park
Schenectady, NY

Sample ID		MW-19		MW-19		MW-19		MW-19		MW-47		MW-47		MW-47	
Sample Date		12/10/1999		12/8/2000		5/30/2001		7/29/2004		6/1/2001		9/23/2004		10/31/2005	
Well depth (ft bgs)		20		20		20		20		55		55		55	
Screened interval (ft bgs)	Units	10-20		10-20		10-20		10-20		45-55		45-55		45-55	
Volatile Organic Compounds															
1,1-Dichloroethene	µg/l	ND		ND		ND		ND		ND		2.2 J		1.5	
1,2-Dichloroethene (total)	µg/l	110		310		160		100		91 D		160		89.9	
Chloroethane	µg/l	ND		ND		ND		ND		ND		ND		ND	
Tetrachloroethene	µg/l	64		200 D		220 D		210		ND		ND		ND	
Toluene	µg/l	ND		ND		ND		ND		ND		0.83 J		ND	
Trichloroethene	µg/l	7 J		32		47 D		52		73 D		47		45	
Vinyl Chloride	µg/l	170		64		5.7		ND		24		9.9		6.5	

Sample ID		MW-46		MW-46		MW-46		MW-48		MW-48		MW-49		MW-50		MW-51	
Sample Date		5/30/2001		7/29/2004		10/31/2005		7/29/2004		10/31/2005		10/31/2005		11/2/2005		11/2/2005	
Well depth (ft bgs)		43		43		43		65		65		67		57		67	
Screened interval (ft bgs)	Units	33-43		33-43		33-43		55-65		55-65		57-67		47-57		57-67	
Volatile Organic Compounds																	
1,1-Dichloroethene	µg/l	ND		ND		ND		ND		3.66		ND		ND		7.3	
1,2-Dichloroethene (total)	µg/l	160		160		213		3,800		1,545		4.6		2.0		1,733	
Chloroethane	µg/l	ND		ND		ND		7.8		ND		ND		ND		6.0	
Tetrachloroethene	µg/l	9,500 D		1,800		5,080		230		222		ND		ND		95	
Toluene	µg/l	ND		ND		ND		ND		ND		ND		ND		ND	
Trichloroethene	µg/l	420		890		1,060		560		612		1.1		1.1		157	
Vinyl Chloride	µg/l	ND		ND		1.7		270		114		ND		6.4		230	

Notes: ND = Not detected

NA = Not analyzed

D = Identifies all compounds analyzed at a secondary dilution

J = The compound or analyte was positively identified, but the associated numerical value is an estimated concentration

Data Sources: Arcadis BBL: MW-19/MW-46 Additional Investigation; 2004 Groundwater Sampling and Analysis; 2002 Draft Site Investigation Summary

Table 10
Recognized Environmental Conditions
ALCO-Maxon Site (Former Nott Street Industrial Park)
Schenectady, NY

REC #	Parcel	Operable Unit (OU)	REC Description	History	COCs*	Previous Investigation	REC Rationale	Comment	Additional Investigation
Background	N / A	N / A	Upgradient - Erie Blvd	Former Erie Canal stream trace	possible SVOCs, ETPH, PAHs, AVOCs	Perimeter Investigation, November/December 1999 and 2000; Site Investigation, Fall 2000 and Spring 2001.	Stream traces are well known to act as COC transport corridors. Upgradient sites and cross gradients sites may have contributed.		None
Background	N / A	N / A	Upgradient - Front St.	Storm sewer piping carrying off-site water to a Mohawk River outfall. Sanitary force main enters park from Front St./Erie Blvd traveling to the north along Erie Blvd.	SVOCs, ETPH, PAHs, AVOCs	Perimeter Investigation, November/December 1999 and 2000.	Storm sewers known to have been impacted by Coyne Textile Service Facility fuel release in early 1990s		Collect soil samples via test pit and/or install well close to front street sewers where enters the Park. Inspect sewers.
Background	N / A	N / A	Upgradient - College Creek Culvert	Culverted creek and storm water overflow from the City of Schenectady to a Mohawk River outfall.	SVOCs, ETPH, PAHs, AVOCs	None	Impacted storm water is known to have been discharged into the Mohawk River via the College Creek Culvert, which carries storm water from the City of Schenectady beneath the Park.		Collect soil samples via test pit and/or install well close to college creek culvert where enters the Park. Inspect sewers.
Background	N / A	N / A	Upgradient - Sites	Upgradient properties that may pose an environmental threat to the Park include College Park and other former ALCO properties located east of the railroad ROW.	SVOCs, ETPH, PAHs, AVOCs	Perimeter Investigation, November/December 1999 and 2000.	Upgradient releases may have migrated onto the property via preferential pathways created by the storm water conveyance system or with the flow of groundwater.		None
1	324	TBD	Parcel 324 & A43/College Creek Outfalls	A fuel oil release occurred at the adjacent Coyne Textile Services in 1992. The release escaped into the storm sewer system and discharged to the Mohawk River via the College Creek Outfall. Petroleum was observed seeping from the riverbank rip rap adjacent to Building 324 and Outfall A43.	SVOCs, ETPH, PAHs, AVOCs	Test Pit Excavations, July 1992; Drilling Program, August 1992; Follow-Up Investigation, July - September 1992; Delineation Boring Program, October - November 1992; Surface, Subsurface and Groundwater Investigation, March - May 1994; Site Investigation, Fall 2000 and Spring 200; Free Product Petroleum Recovery from Monitoring Wells MW-01 and MW-04; 1992 - 1994; Deployment of Oil Containment and Absorbent Booms in the Mohawk River, 1992 - present; Monitoring Well MW-01 PCB Source Removal, February 1998.	The petroleum substance discharging into the Mohawk River from the rip rap along the riverbank and from the College Creek storm water outfall was identified as No.2 fuel oil associated with the release which occurred at the Coyne Textile Service facility.	Defined as AOC-1	Install soil borings via test pits in this area to determine current impact levels. Collect soil samples above water table. Inspect sewers.
2	322	TBD	Parcel 322 & Building 320 Waste Tank	In 1992, during an investigation following a release of fuel oil to the storm sewer system adjacent to the Park, petroleum was observed seeping from the riverbank rip rap adjacent to Building 322 and Building 320, which at the time was thought to have been a result of the large fuel oil release to the storm sewer system. Upon further investigation the seeping petroleum appeared to be the result of a release from an AST located north of Building 320, which contained an oily wash water mix.	SVOCs, ETPH, PAHs, AVOCs	Test Pit Excavations, July 1992; Drilling Program, August 1992; Follow-Up Investigation, July - September 1992; Delineation Boring Program, October - November 1992; Surface, Subsurface and Groundwater Investigation, March - May 1994; Site Investigation, Fall 2000 and Spring 2001; Free Product Petroleum Recovery from Monitoring Wells MW-01 and MW-04; 1992 - 1994; Deployment of Oil Containment and Absorbent Booms in the Mohawk River, 1992 - present; Monitoring Well MW-04 Pilot Bioventing System, December 1996.	A petroleum release has been confirmed within this area. The presence of a UST presents a material threat of release of COCs to the subsurface.	Defined as AOC-2	Install soil borings via test pits this area to determine the current impact levels. Collect soil samples above water table. Collect groundwater samples from pit and surrounding well. Locate and profile former AST/UST locations.
3	Main	TBD	Building 332 Former Fuel Oil UST	A 2,700-gallon UST, suspected to have been used for the storage of fuel oil, was removed in November 1992. The UST was located adjacent to the north side of Building 332. UST closure samples contained concentrations of VOCs which exceeded regulatory criteria.	SVOCs, ETPH, PAHs, AVOCs	Surface, Subsurface & Groundwater Investigation, March-May 1994; Building 332 and 342 Subsurface Investigation, August 1995; Building 332 Geoprobe Investigation, December 1998; Building 332 UST Removal, November 1992	A petroleum release has been confirmed within this area. The presence of a UST presents a material threat of release of COCs to the subsurface.	Defined as AOC-3	None
4	Main	TBD	Building 332 Former Fuel Oil USTs	Four USTs located adjacent to the southeast side of Building 332, were reportedly closed in 1986 by being filled with sand/concrete. The USTs were used for the storage of diesel fuel or motor oil. Subsurface soil and groundwater investigations have identified the presence of petroleum products in the area of these USTs.	SVOCs, ETPH, PAHs, AVOCs	Surface, Subsurface & Groundwater Investigation, March-May 1994; Building 332 and 342 Subsurface Investigation, August 1995; Building 332 Geoprobe Investigation, December 1998; Building 332 UST Closure, 1986	A petroleum release has been confirmed within this area. The presence of USTs presents a material threat of release of COCs to the subsurface.	Defined as AOC-4	Regular monitoring of groundwater monitoring wells in Area 4 for LNAFL.
5	Main & 306	TBD	Park Entry Area, Parcel 304 & Parcel 306	On-site storm water sewers are located in this area, which carry off-site storm water to the Mohawk River. Small amounts of free product were observed within an excavation adjacent to the north side of Building 306. In addition, free product was observed within observation well OW-2, located between Buildings 306 and 304, in 1998.	SVOCs, ETPH, PAHs, AVOCs	Building 306 Geoprobe Investigation, December 1998; Perimeter Investigation, November/December 1999 and January 2000.	A petroleum release has been confirmed within this area.	Defined as AOC-5	Install a soil boiring or two and/or test pit downgradient of OW-2. Sample both the new well and OW-2 for both VOCs and SVOCs.
6	Main & 344	TBD	Chlorinated Solvent Plume	A chlorinated solvent plume has been identified to be present between MW-19 and MW-51, running beneath Building 332 onto Parcel 344.	Chlorinated VOCs	Perimeter Investigation, November/December 1999 and January 2000; Site Investigation, Fall 2000 and Spring 2001.	A chlorinated solvent plume has been confirmed within this area.	Defined as AOC-6	Samples wells in area. May need to install a well downgradient of MW-51 to determine extent of impact. Sample for chlorinated VOCs.
7	Main	TBD	Erie Blvd. Substation Area	Leakage from substation transformers was observed on February 1, 1993. NYSDEC Spill No. 92-12366, was assigned.	Chlorinated VOCs, Mineral Oil &/or Transformer Oil	PCB Transformer Spill, February 1993; Groundwater Sampling, August 2009; PCB Test, October 2009	Due to the presence of transformers, a material threat of release of COCs to the ground surface exists.		None
8	Main, 342, 346	TBD	EVI Parcel	In 1997, SVOCs, PCBs and herbicides/pesticides were detected at concentrations above regulatory criteria in soil samples collected during an investigation completed as a portion of a voluntary agreement with the NYSDEC.	SVOCs, PAHs, ETPH, PCBs, herbicides/pesticides	Screening investigation July/august 1996, Subsurface Investigation May/June 1997, Remedial Excavation February 1998, Pilot Study March-December 2000; EVI Parcel Remediation/Excavation, February 1998.	A PCB release was confirmed within this area, although remedial activities have been completed.	Wetlands?	None
9A	Main, 342, 346	TBD	PCB Removal	PCBs were encountered during surface soil sampling on the north side of the building.	PCBs	Soil Excavation and Well Install Activities, September 2003	A PCB release was confirmed within this area, although remedial activities have been completed.		None
9B	Main, 342	TBD	Mercury Removal	Mercury was encountered during surface soil sampling on the west side of the building.	Mercury	Soil Excavation and Well Install Activities, September 2003	A mercury release was confirmed within this area, although remedial activities have been completed.		None
10	N / A	N / A	River - Bank / Sediment	Storm water from the City of Schenectady is discharged into the Mohawk River from multiple outfalls along the riverfront of the Park. In addition, a known release of fuel oil was discharged into the Mohawk River from an outfall along the riverfront of the Park.	SVOCs, ETPH, PAHs, AVOCs	Free Product Petroleum Recovery From Monitoring Wells MW-01 & MW-04, 1992-1994; Deployment of Oil Containment & Absorbent Booms in the Mohawk River, 1992-Present	The riverbank has been privy to releases which have occurred along the riverbank over the last century and it is unknown what the environmental condition of the riverbank is currently.		Sampling of riverbank/sediment may be necessary depending upon development plans.
11	300	TBD	Building 300	Former laboratory	Various	None	Laboratory facilities have been housed in this building and many types of chemicals have been used and stored within the building.		Sample building materials for HBM, ACM and UW. Depending upon results it may be necessary to collect soil sample near sanitary/storm connection and anywhere large amounts of chemicals were stored. Sample for VOCs, SVOCs, ETPH, metals and PCBs.
12	304	TBD	Building 304	This building has been used as a truck maintenance facility, a repair shop, a locomotive rebuild facility, a manufacturing facility, valve assembly and testing facility (included a paint booth and hydrostatic testing in steel trenches), a steel processing facility and as a drum storage area (located outside the southeast corner of the building). The building is currently owned by STS Steel.	ASB, LBP, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	None	Due to the age and past usages of this building it is probable it contains one or more of the identified COCs.		Investigate area near drum storage. Identify what was stored and sample accordingly. Sample building materials for HBM, ACM and UW.
13	304	TBD	Building 304 UST	Three USTs located south of the building were reportedly closed in-place in 1986. It is unknown what was stored within these USTs.	SVOCs, ETPH, PAHs, AVOCs	Building 304 UST Closure, 1986	The presence of USTs presents a material threat of release of COCs to the subsurface.		Identify the former UST location and collect soil sample in vicinity of former USTs via test pit. Sample for VOCs, SVOCs, ETPH, Metals.
14	306	TBD	Building 306	This building formerly included manufacturing operations such as a drop forge, a central repair shop, a maintenance facility, a hospital (with an x-ray facility), a storage facility for stock materials and bar form, a sheet metal fabrication facility, a composite materials manufacturing facility and an electronics manufacturing facility.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Subsurface Investigation, December 1998	Due to the age and past usages of this building it is probable it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
15	308	TBD	Building 308	Initially this building was used as a machine shop. Later this building was a research laboratory for testing diesel locomotives and an engineering, bar form, foundry pattern storage area. Most recently the building has been used for concrete reinforcing, bar cutting and bar bending.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Mercury, Other Metals	Geoprobe Investigation, April 1999	During the geoprobe investigation in 1999, petroleum stained soils were observed beneath the building, although none of the COCs detected exceeded the regulatory criteria.		Sample building materials for HBM, ACM and UW.
16	308	TBD	Building 308 UST	In 1986, two fuel oil USTs located west of Building 308 were abandoned in place by filling each one with sand or concrete. It is unknown is soil samples were collected prior to the UST abandonment activities.	SVOCs, ETPH, PAHs, AVOCs	Building 308 UST Closure & Transformer Removal, 1986 & circa 1988	The presence of USTs presents a material threat of release of fuel oil to the subsurface.		Collect soil samples near closed USTs to determine if impact in soil. Sample for fuel oil constituents.

Table 10
Recognized Environmental Conditions
ALCO-Maxon Site (Former Nott Street Industrial Park)
Schenectady, NY

REC #	Parcel	Operable Unit (OU)	REC Description	History	COCs*	Previous Investigation	REC Rationale	Comment	Additional Investigation
17	316	TBD	Building 316	This building formerly included blacksmith operations, a warehouse, a stockroom for assembly of turbine valves and a storage facility for production materials, fabric cutting and dyeing associated with a textile printing company.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	None	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs. In addition, piping from the storm water conveyance system runs beneath the floor of the building and through a sump is piped to Building 318.		Sample building materials for HBM, ACM and UW. Depending upon results, collect soil samples beneath building in vicinity of storm water connections may be necessary.
18	Main	TBD	Building 318	This building has been used for shot blasting and cleaning and as an industrial wastewater treatment plant (IWWTP) and as a textile wastewater treatment plant. Currently, the building houses the IWWTP equipment, although it is inactive.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Site Investigation, Fall 2000 and Spring 2001.	The presence of the IWWTP presented a material threat of release of COCs to both the surface and subsurface. In addition, due to the age and past usage of the building, it is a strong possibility that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW. Depending upon results, collect soil samples beneath building in vicinity of storm water connections may be necessary.
19	Main	TBD	Building 320	This building formerly included a tank shop, a diesel locomotive subassembly and truck shop, a steam turbine diaphragm fabrication facility, an electro-hydraulic control assembly, testing and lagging facility, an oil tank assembly, copper parts machining and generator pipe fabrication facility, a pickling facility, a ferric phosphate sludge dewatering facility, a paint booth/storage area for paint and thinner and a drum and tote pack storage facility. Currently, the majority of the building is unoccupied, but the portion which is in-use, is used by a landscaper to store equipment, trucks and other miscellaneous vehicles.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals, pesticides, herbicides, fertilizers	Drilling Program, August 1992; Follow-Up Investigation, July - September 1992; Delineation Boring Program, October - November 1992; Surface, Subsurface and Groundwater Investigation, March - May 1994; Site Investigation, Fall 2000 and Spring 200; Perimeter Investigation, December/November 1999 and 2000.	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
20A	Main	TBD	Building 320 UST	On November 25, 1995, a concrete UST of unknown capacity located adjacent to the south of Building 320 was removed. The UST previously contained pressure washing residue from manufacturing operations performed by General Electric within the building.	SVOCs, ETPH, PAHs, AVOCs	Site Investigation, Fall 2000 and Spring 2001.	The presence of this UST presented a material threat of release of COCs to the subsurface.		Identify the former UST location and collect soil sample in vicinity of former USTs via test pit. Sample for VOCs, SVOCs, ETPH, Metals.
20B	Main	TBD	Building 320 AST	An AST was formerly located north of Building 320. This AST contained an oily wash water rinse.	SVOCs, ETPH, PAHs, AVOCs	Site Investigation, Fall 2000 and Spring 2001.	The presence of this AST presented a material threat of release of COCs to the ground surface.		Install soil borings via test pits this area to determine the current impact levels. Collect soil samples above water table. Collect groundwater samples from pit and surrounding well. Locate and profile former AST/UST locations.
21	322	TBD	Building 322	This building formerly included shot blasting, miscellaneous storage, a garage, plastics machining, milk storage and milk product distributor stored food stuffs. The building is currently unoccupied.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Test Pit Excavations, July 1992; Drilling Program, August 1992; Follow-Up Investigation, July - September 1992; Delineation Boring Program, October - November 1992; Surface, Subsurface and Groundwater Investigation, March - May 1994; Site Investigation, Fall 2000 and Spring 2001; Free Product Petroleum Recovery from Monitoring Wells MW-01 and MW-04; 1992 - 1994; Deployment of Oil Containment and Absorbent Booms in the Mohawk River, 1992 - present; Monitoring Well MW-04 Pilot Bioventing System, December 1996.	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
22	324	TBD	Building 324	This building formerly included a paint shop/paint booth which included a grit-blasting booth for locomotive manufacturing, a facility called West Paint Shop/Garage, a storage area for drums and tote packs on the south side of the building, a recycling facility for construction and demolition debris and a textile material storage facility. Currently the building is used for the storage of furniture. Storm sewer piping runs beneath the building to the adjacent Outfall A43 in the Mohawk River.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Drilling Program, August 1992; Follow-Up Investigation, July - September 1992; Delineation Boring Program, October - November 1992; Surface, Subsurface and Groundwater Investigation, March - May 1994; Site Investigation, Fall 2000 and Spring 200; Investigation, Fall 2000 and Spring 200;	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
23	Main	TBD	Buildings 326/328	From at least 1930 until 1990, these buildings were used as pump houses. Sometime between 1990 and 1999, the pump house operations in both buildings was discontinued. From 1999 through 2002, the buildings underwent abatement and the intakes from the Mohawk River were sealed. Buildings 326 and 328 have been unoccupied since 2002.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Building 328 Transformer Inspection, Removal & Follow-Up Investigation/Remediation, November 1992, January-February 1993 & May 1996	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
24	300 / Main	TBD	Buildings 330/Addition	Building 330 was formerly used as a coal pulverizing facility; as a maintenance building for truck repair, an oil house and drum storage area and a permitted "less than 90-day" RCRA Hazardous Waste Storage Facility. This building was decommissioned in 1999, which included the removal replacement of six inches of the concrete floor and pressure washing the interior building walls. Following the decommissioning, STS Steel began using the building for steel fabrication. The addition was constructed in 2002.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Building 330 RCRA Closure Investigation, December 1997	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
25	Main	TBD	Building 332	Building 332 was formerly used as a boiler shop, a general welding shop, and engine room, a blacksmith shop, engine welding shop, diesel engine chassis shop, chassis painting shop, a paint storage facility, a diaphragm finishing facility, general machine and equipment fabrication facility and oil tank assembly facility. The building is currently used by STS Steel.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, Metals	Surface, Subsurface & Groundwater Investigation, March -May 1994; Building 332 and 342 Subsurface Investigation, August 1995; Building 332 Geoprobe Investigation, December 1998.	The oil tank assembly process included both manufacturing and painting. In addition, when parts were deburred, an electrochemical process was used. Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
26	Main	TBD	Building 334	This building formerly housed the fuel oil pump and sump.	HBM, ACM,, UW, SVOCs, ETPH, ASB, LBP, PAHs, AVOCs	None	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
27	Main	TBD	Building 336	This building was used as the pump house for paint thinner, as the building was formerly located adjacent to two USTs used for paint thinner storage.	SVOCs, ETPH, PAHs, AVOCs		Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
28	Main	TBD	Building 336 UST	In 1986, two USTs used for the storage of paint thinner were closed. The specifics of the closure program are unknown.	SVOCs, ETPH, PAHs, AVOCs	Building 336 UST Closure, 1986	The presence of USTs presents a material threat of release of fuel oil to the subsurface.		Identify the former UST locations and collect soil sample in vicinity of former USTs via test pit. Sample for VOCs, SVOCs, ETPH, Metals.
29	Main	TBD	Building 338	Building 338 was formerly used as the gas meter house. The main natural gas line came into the Park via this building.	HBM, ACM,, UW	None	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
30	Main	TBD	Building 340	This building was formerly used for the storage of diesel engine chassis materials, maintenance items, wastewater treatment materials and product service. In 1990, the building was used as a construction facility. Park personnel reported that a storage tank once occupied an area northwest of the building; however this has not been verified.	HBM, ACM, UW	None	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
31	Main	TBD	Building 342	This building was formerly used as a boiler and engine room and power supply building, a treatment facility for boiler blow down water and for the storage of and use of boiler treatment and wastewater treatment chemicals. From 1998 through 2000, a general but incomplete decommission process was initiated. In addition, two ASTs, 500-gallon and 2,000-gallon, were reportedly located north and west of Building 342, although no information regarding their closure is available.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs	Building332 and 342 Subsurface Investigation, August 1995; Site Investigation, Fall 2000 and Spring 2001.	Petroleum was observed in a basement sump of Building 342 and was observed seeping through cracks in the foundation. Free product removal was initiated in August 1995. In addition to the petroleum concerns, due to the age and past usages of this building, it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.

Table 10
Recognized Environmental Conditions
ALCO-Maxon Site (Former Nott Street Industrial Park)
Schenectady, NY

REC #	Parcel	Operable Unit (OU)	REC Description	History	COCs*	Previous Investigation	REC Rationale	Comment	Additional Investigation
32	Main	TBD	Building 342 AST	In 1999, a 300,000-gallon fuel oil AST located 100 feet east of Building 342 was decommissioned and dismantled. Following the removal of the AST, discolored soil was observed within the tank footprint.	SVOCs, ETPH, PAHs, AVOCs	Building 342 Fuel Oil AST Removal, March 2000	Soil samples collected from beneath the 300,000-gallon fuel oil AST indicated that the soil was impacted with petroleum.		None
33	344	TBD	Building 344	This building was formerly used for pipe and maintenance storage. It is currently used by a landscape company for unspecified activities.	HBM, ACM, UW, SVOCs, ETPH, PAHs, AVOCs, pesticides, herbicides, fertilizers	None	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.
34	346	TBD	Building 346	This building was formerly used as a lumber shed, an engine parts and machine shop, a diaphragm finish machining facility, a surplus machine storage area, a showroom for surplus machine tools, for steel fabrication and a pre-fabricated wall construction facility. It is currently used to prepare pre-fabricated re-bar structures. In addition, four former USTS located to the west of the building were reportedly closed in 1986 and a concrete structure located north of the building may have housed a 55-gallon oil drum collection.	HBM, ACM,, UW, SVOCs, ETPH, PAHs, AVOCs, chlorinated solvents	Site Investigation, Fall 2000 and Spring 2001.	Due to the age and past usages of this building it is probable that it contains one or more of the identified COCs.		Sample building materials for HBM, ACM and UW.

Notes: REC - recognized environmental condition
COC - constituent of concern
PCBs - polychlorinated biphenyls
SVOCs - semi-volatile organic compounds
ETPH - extractable total petroleum hydrocarbons
PAHs - poly-aromatic hydrocarbons
AVOCs - Aromatic volatile organic compounds
VOCs - volatile organic compounds
RCRA - Resource conservation and recovery act

*The reference to RECs as buildings refers to the structure of the building from the foundation up.
UST - underground storage tank
AST - above ground storage tank
bgs - below ground surface
NYSDEC - New York State Department of Environmental Conservation
HBM - Hazardous building materials
ACM - Asbestos containing materials
UW - Universal Waste
AOC - Area of concern



APPENDIX B

WASTE MANAGEMENT PLAN



The waste management plan establishes procedures for proper collection, storage, transportation, and disposal of investigation-derived waste generated during specific activity or set of activities. As part of the work plan proposed in the Remedial Investigation Work Plan wastes will be generated on-site. These wastes may include:

- Soil removed from the subsurface during drilling activities
- Groundwater removed from the subsurface during monitoring well development and sampling
- Water used for the decontamination of equipment and sampling materials
- Used sampling equipment, and used personal protective equipment

Soil removed from the subsurface during drilling activities will be collected on-site in 55-gallon steel DOT rated drums. These drums will be appropriately labeled and stored on site during the duration of the drilling activities. Following completion of the drilling waste characterization samples will be collected from the drums and submitted for laboratory analysis. Following receipt of the laboratory analytical results a classification of the soil will be made. If the soil is not suitable for re-use on site the drummed soil will be relabeled based on the waste classification in accordance with 49 CFR 172 and will be transported by a waste hauler with appropriate certifications to an approved disposal facility. If the material is classified as hazardous the transportation and disposal will be conducted in compliance with 6 NYCRR Part 372 "Hazardous Waste Manifest System and Related Standards for Generators, Transporters and Facilities".

Groundwater removed from the subsurface during well development and sampling along with water from the decontamination of equipment and sampling materials will be managed as a single waste stream. This water will be collected on site in 55-gallon steel DOT rated drums. These drums will be appropriately labeled and stored on site during the duration of the drilling and sampling activities. Following completion of the groundwater sampling waste characterization samples will be collected from the drums and submitted for laboratory analysis. Following receipt of the laboratory analytical results a classification of the water will be made. If the water is not suitable for on-site infiltration the water will be relabeled based on the waste classification 49 CFR 172 and will be transported by a waste hauler with appropriate certifications to an approved facility for treatment. If the material is classified as hazardous the transportation and disposal will be conducted in compliance with 6 NYCRR Part 372 "Hazardous Waste Manifest System and Related Standards for Generators, Transporters and Facilities".

Used disposable equipment including sample tubing, polyethylene bailers, nitrile gloves, and soil scoops will be collected on-site in 55-gallon steel DOT rated drums. Following completion of the monitoring well installation and groundwater sampling this material will be transported by a waste hauler with appropriate certifications to an approved facility for disposal.



APPENDIX C

HEALTH AND SAFETY PLAN

KLEINFELDER
SITE SPECIFIC HEALTH AND SAFETY PLAN

Maxon-Alco Holdings, LLC.
301 Nott Street
Schenectady, NY 12305

HASP REVISION 2
Revision Date: 5/24/2010

TABLE OF CONTENTS

SECTION	PAGE
I. PROJECT IDENTIFICATION	3
II. EMERGENCY CONTACTS	3
III. SITE BACKGROUND INFORMATION (SEE ATTACHED SITE PLAN AND MAP ON PAGE 6)	5
IV. ANTICIPATED TASKS TO BE PERFORMED: (CHECK ALL APPROPRIATE TASKS.)	6
V. CHEMICAL HAZARDS/PPE (ALSO REFER TO KLEINFELDER SITE HEALTH AND SAFETY PROCEDURES SECTIONS 6.0, 7.0 AND 9.0)	8
VI. PHYSICAL HAZARDS/TRAFFIC CONTROL (REFER TO KLEINFELDER SITE HEALTH AND SAFETY PROCEDURES, SECTION 5.0, 6.0,7.0, AND 8.0)	9
VII. DECONTAMINATION PROCEDURES (ALSO REFER TO KLEINFELDER SITE HEALTH AND SAFETY PROCEDURES SECTION 12.)	10
VIII. TRAINING REQUIREMENTS FOR SITE PERSONNEL (SEE KLEINFELDER SITE HEALTH AND SAFETY PROCEDURES, SECT. 10)	10
IX. LOSS/NEAR LOSS/INJURY REPORTING	11
X. HASP REVISIONS/SITE CONDITION CHANGE FORM	12
ATTACHMENT A – AIR MONITORING DATA OBSERVATION RECORD	13
ATTACHMENT B: AUTHORIZATION FOR MEDICAL TREATMENT/PHYSICIAN'S REPORT	14
ATTACHMENT C: KLEINFELDER LOSS/NEAR LOSS INVESTIGATION REPORT	15
ATTACHMENT D: TRAFFIC CONTROL PROGRAM	20

HASP prepared by: Anna Smith, Senior Project Geologist

HASP approval: _____

Project Manager Approval: Kurt A. Frantzen, PhD, CHMM

KLEINFELDER

SITE HEALTH AND SAFETY PLAN

(For specific Procedures, Refer to KLEINFELDER's Site Health and Safety Procedures Manual)

I. PROJECT IDENTIFICATION

Project Name: Maxon-Alco Holdings, LLC Project #: 107121
Address of Site: 301 Nott Street Site ID#: NA
Client Contact: David Buicko Phone: 518-356-4445
KLF Project Manager: Kurt Frantzen Phone: 860-683-4200 ext 123
Health and Safety Oversight: Matthew Pickard Phone: 845-567-6530

II. EMERGENCY CONTACTS

All field staff will coordinate with the security guard, whenever present, at the entry to the park at 301 Nott St. at the start of each workday. Subsequently, in the event of an emergency staff and contractors will coordinate with the security guard.

Security Guard: (518) 382-5840

Police: 911 **Fire:** 911 **Ambulance:** 911

National Poison control Center: 800-222-1222
NY DOT: 511

Utilities:

Gas: National Grid - 1-800-892-2345
Electric: National Grid - 1-800-867-5222
Water: City of Schenectady - 518-382-5023

Dig Safe: 811

Medical Treatment Facility: Ellis Hospital **Phone #:** 518-243-4000
Address: 1101 Nott St. Schenectady NY

Directions from site: (see attached map showing location of hospital relative to site on page 3)

MAP TO HOSPITAL


Driving directions to Ellis Hospital

1.0 mi – about 2 mins

A 301 Nott St
Schenectady, NY 12305

1. Head **east** on **Nott St** toward **Erie Blvd/Maxon Rd** 1.0 mi
Destination will be on the left

B Ellis Hospital
1101 Nott St
Schenectady, NY

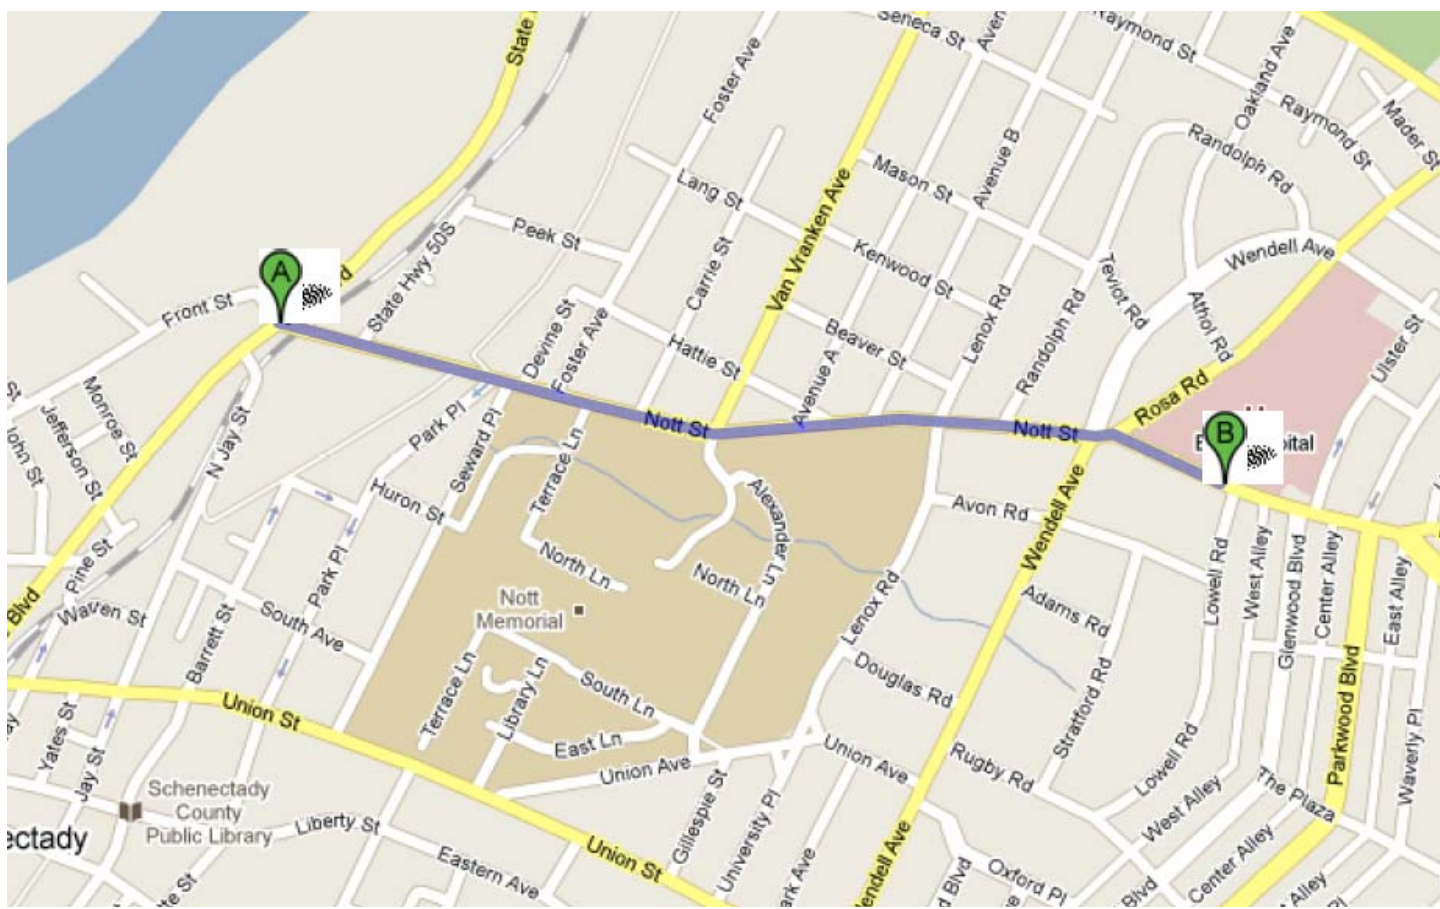

III. SITE BACKGROUND INFORMATION (See attached site plan and map on page 6)

The site is a former Locomotive Manufacturing facility. The environmental investigation was initiated when petroleum hydrocarbons (fuel or diesel oil) were detected in the Mohawk River and traced to on-site soil and groundwater. The larger Site has been the subject of previous investigation, UST removals, and remediation. There is an LNAPL recovery system currently operating in an area of Parcel C of the larger site. There is currently no remediation ongoing within the areas of Parcels A or B.

Investigation activities that employees will conduct on site include soil and groundwater sampling, remedial system operation, soil boring advancement, monitoring well installation, test pit advancement, soil vapor point installation, groundwater monitoring, and soil vapor sample collection. The specific tasks associated with these activities are detailed in section IV.

Chemicals of concern (COCs) at the site include potential exposure to fuel oil, individual constituents of the stored substances identified above. Potential exposures to the COCs are through dermal contact when handling liquid petroleum hydrocarbon (LPH) during removal from wells located on the site, soil and groundwater samples, and inhalation when exposed to fugitive emissions. (See Section V of this Plan). In addition, the site is accessible by Fork lift and tractor trailer truck traffic. Hazards associated with the remedial system operation include exposure to electrical and mechanical aspects of the system, exposure to free flowing LPH .

IV. ANTICIPATED TASKS TO BE PERFORMED: (Check all appropriate tasks.)

<u>Task</u>	<u>Personnel/Contractors Performing Task</u>
☒ Supervision of Soil Boring/Monitoring Well Installation	<u>Subcontractor Personnel</u>
☒ Gauging/Sampling of Monitoring Well	<u>Kleinfelder Personnel</u>
___ Assessment of Tank Excavation	_____
☒ Supervision of General Construction	<u>Kleinfelder Personnel</u>
___ Trenching	_____
___ Dry well excavation	_____
___ Line replacement	_____
___ Soil loading and transport, etc.	_____
☒ Other	<u>Kleinfelder Personnel</u>
☒ Collection of Soil Samples	<u>Kleinfelder Personnel</u>
☒ Split spoon	<u>Kleinfelder Personnel</u>
☒ Hand auger	<u>Kleinfelder Personnel</u>
___ Grab Samples	_____
☒ Jar headspace	<u>Kleinfelder Personnel</u>
☒ Soil Vapor Survey	<u>Kleinfelder Personnel</u>
☒ Soil Vapor Air Sampling	<u>Kleinfelder Personnel</u>
___ Subslab Vapor Sampling	<u>Kleinfelder Personnel</u>
☒ External Ambient Air Sampling	<u>Kleinfelder Personnel</u>
___ Other	_____
___ Remedial System Operation & Maintenance	_____
___ OTHER: _____	_____

SITE MAP INSERT

Plate 4 of the RIWP (appended hereto) will be included in the field version of this HASP.

V. CHEMICAL HAZARDS/PPE (also refer to Kleinfelder Site Health and Safety Procedures sections 6.0, 7.0 and 9.0)

Level of PPE Required: X D Zones established: NA
 C Support (52) Decontamination (CRZ)
 B* Ground Intrusive No Eating, Drinking, Smoking (EZ)

*Level C and B work MAY NOT be done under this HASP. Contact HSO for further direction and assistance!

Specific Site Entry/Access Procedures: If LEL concentrations are >5% LEL, all work must cease and area(s) evacuated.

Potential/Expected Exposure Constituents: (MSDS's are Attached as Appendix)

Contaminant	Source Location	Acute Exposure Symptoms	PEL/TLV Established	Action Level	Level of PPE/Specific PPE required
Liquid Petroleum Hydrocarbons (LPH)	Recovered from GWMW's & in recovery tank	Irritation of eyes, nose, skin; CNS depression; giddiness, nausea, headache	ACGIH TLV 300 ppm STEL 500ppm	Voluntary Action Level 150 ppm	If < Action Level, then Level D
					If > Action Level, then upgrade to Level C
# 2 Fuel Oil	As recovered from GWMW's	Irritation to skin, eyes, nose and respiratory tract. May cause dizziness headache,. Refer to attached MSDS	ACGIH TWA- 0.2 mg/m ³ as oil mist OSHA - 5 mg/m ³	Voluntary Action Level 2.5 mg/ m ³	If < Action Level, then Level D
					If > Action Level, then upgrade to Level C
Naphthalene	As component of #2 Fuel oil	Eye nose throat irritant, head aches confusion, nausea	NIOSH – 10 ppm, STEL – 15 ppm OSHA 10 ppm	Voluntary Action Level 5 ppm	If < Action Level, then Level D
					If > Action Level, then upgrade to Level C
#4 Fuel Oil	As recovered from GW MW's	Irritation to skin, eyes, nose and respiratory tract. May cause dizziness headache,. Refer to attached MSDS	ACGIH TWA- 0.2 mg/m ³ as oil mist OSHA 5 mg/ m ³	Voluntary Action Level 2.5 mg/ m ³	If < Action Level, then Level D
					If > Action Level, then upgrade to Level C

NOTE: IF ANY LEVELS EXCEED THE PEL/TLV BY MORE THAN 10X, ALL WORK MUST CEASE AND SPECIFIC VENTILATION PRACTICES OR RESPIRATORY PROTECTION METHODS EMPLOYED.

Air Monitoring Instruments to be Employed: (also refer to Kleinfelder HASP Manual, section 9.0)

Monitoring Instrumentation To Be Used: (SEE INDIVIDUAL PROCEDURES FOR MONITORING BELOW)

- ☐ Combustible Gas Indicator
 ☐ Radiation Survey Meter w/probe
☐ Oxygen Meter
 ☐ Particulate Monitor
☐ Dual CGI and O2
 ☐ Dosimeter Badges
☐ Flame Ionization Detector (calibration date: _____)
☒ Photo Ionization Detector (calibration date: at least twice per day (AM & PM))
☐ Hydrogen Sulfide Detector
☐ Colorimetric Indicator Tubes
☐ Personnel Sampling Pump w/ media
☒ OTHER: Multirae (LEL Meter)

Specific Personnel Air Monitoring Procedures to be employed: Personnel air monitoring samples are to be collected in workers' breathing zone (18"-24" from mouth/nose) using the monitoring instruments specified above. Air monitoring shall be conducted prior to site activities and at least once every 2 hours. Sampling shall be conducted continuously for 15 minutes per collection. Any sustained readings above the action level shall require notification of the Project Manager and Health & Safety Officer.

VI. Physical Hazards/Traffic Control (refer to Kleinfelder Site Health and Safety Procedures, section 5.0, 6.0, 7.0, and 8.0)

Hazard Description	Location	Control Methods/ Protective Equipment
<u>Slips, Trips, and Falls</u>	<u>Site Wide</u>	<u>Good Housekeeping</u>
<u>Traffic</u>	<u>Site Wide</u>	<u>Set up work area</u>
<u>Hand Safety</u>	<u>Site Wide</u>	<u>Wear Correct PPE</u>
<u>Use of tools</u>	<u>Site Wide</u>	<u>Inspect tools and be trained on how to use them.</u>

Confined Space Entry? Y ☒ N (If Y, then a completed Confined Space Permit must be attached)

Description: _____

Illumination: ☒ Adequate ☐ Inadequate (if inadequate, describe illumination methods to be utilized): _____

Hot Work? ☒ Y ☐ N (If Y, then a Hot Work Permit MUST be completed and attached)

Description: Employ hot work permit for drilling monitoring wells and soil vapor samples and for advancing test pits.

VII. Decontamination Procedures (also refer to Kleinfelder Site Health and Safety Procedures section 12.)

Decontamination required: Personnel? ☒ Y ☐ N Equipment? ☒ Y ☐ N

Method of Decontamination/Procedures to be Implemented: Personnel decontamination will be removing gloves between samples and drilling locations. Equipment will be decontaminated by analconox rinse followed by a water rinse. Then a methanol rinse followed by a final water rinse. All equipment will be decontaminated between sampling locations and drilling locations.

Method of disposal for Contaminated Materials: Soil cuttings will be drummed and shipped off-site via an approved waste transporter.

VIII. Training Requirements for Site Personnel (See Kleinfelder Site Health and Safety Procedures, Sect. 10)

In addition to initial site specific health and safety training, all Kleinfelder Project Field Team Members shall be required to be trained in accordance with 29CFR 1910.120, Hazardous Waste Operations and Emergency Response. Any other personnel visiting the site must check in with the HSO, or designee, for orientation and briefing of site hazards.

Supervisory personnel on-site and specialized site workers may be required to have been trained in accordance with 29CFR 1910.120, depending on the nature of their work, exposure potential, and specific type of activities being conducted. However, each will be trained on site-specific hazards, site conditions and emergency operating procedures as well as other pertinent topics prior to job initiation in the areas of environmental concern (AOEC). All personnel on-site are required to attend pre-work "tailgate" meetings. These meetings shall discuss Health and Safety items related to those activities.

In the event hazardous waste or other conditions are encountered in the AOEC requiring upgrade from level D, all activities in the AOEC will be stopped. Continuation of work and entry into the AOEC will be conducted by personnel trained in accordance with 29 CFR 1910.120.

If respiratory protection is required, certification of mandatory training, medical monitoring and documentation of respirator fit testing shall be provided to the HSO before personnel are permitted on site. These records will be maintained as part of the permanent record.

IX. Loss/Near Loss/Injury Reporting

In the event of an injury, near miss, or incident, site personnel must **IMMEDIATELY**:

- Determine the need for medical treatment and administer First Aid. Immediately call 911 if an injury or illness is obviously serious.
- IMMEDIATELY stop operations and notify Kleinfelder contact on site.
- IMMEDIATELY notify Kleinfelder Project Management/Operations Manager.
- Complete Kleinfelder Loss/Near Loss Investigation report as soon as possible, describing the incident IN DETAIL.
- Refer to Kleinfelder Health and Safety Procedures for detailed responsibilities.

X. HASP REVISIONS/SITE CONDITION CHANGE FORM

Non-Conformance of Health and Safety Procedures/Comments regarding implementation:

Change in Site Conditions: _____

___ Site personnel notified and informed of changes on: Date/Time notified: _____

___ Contractor Notification and Consent Form updated. Date performed: _____

Plan of Action for Non-routine task/HASP Non-Conformance Issues/Change in conditions: _____

Incident Summary: ___ NA ___ Evacuation ___ Hazardous Material Over Exposure

___ Loss ___ Near Loss ___ OTHER: _____

(complete Kleinfelder Loss/Near Loss investigation form, see Kleinfelder SOP Manual, SOP#15 for a complete analysis)

___ PM notified ___ Client notified ___ OSHA notified

___ HASP Revision Document Submitted to H&S Department for HASP revision:

Name of Submittor: _____ DATE: _____

Received By: _____ DATE: _____

FORWARD TO HSO FOR HASP REVISION AS NECESSARY; FILE A COPY UNDER "SITE INSPECTION"
IN AUDIT FILE

ATTACHMENT A – AIR MONITORING DATA OBSERVATION RECORD

PERSONAL AIR MONITORING/OBSERVATION RECORD

***To be used for Industrial Hygiene recordkeeping only**

Date: _____

SITE: **ALCO-Maxon Site**

Instruments: _____

AtmosphericConditions: _____

LOCATION/TIME	CALIBRATION START READING	CALIBRATION END READING	AREA SAMPLED	JOB TYPE
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____
_____	_____	_____	_____	_____

ATTACHMENT B: AUTHORIZATION FOR MEDICAL TREATMENT/PHYSICIAN'S REPORT

PLEASE RENDER TREATMENT TO: Employee _____
for the illness/injury that occurred on: (Date) _____

_____ Conduct an alcohol and drug screen (reasonable cause).

Describe nature and cause of illness/injury including the object, equipment or substance inflicting injury/illness:
(Attach copy of MSDS when a hazardous material is involved)

Authorized by:

Signature & Title Telephone Date

PHYSICIAN'S REPORT

MEDICAL FACILITY: _____

ADDRESS: _____

Treating Physician: _____ Date of illness/injury: _____

Previously treated? (Y / N) If yes, give dates _____

Diagnosis:(Industrial illness/injury only) _____

Treatment:(Industrial illness/injury only) _____

Prescription medication prescribed? Yes _____ No _____

Can employee return to work on next scheduled period? Yes _____ No _____

If no, what date can employee return to work? _____

List any medical/physical restrictions: _____

Number of days of restricted activity: _____

The employee is able to return to regular work on: _____

Follow-up treatment required? Yes _____ No _____; Date _____

Physician's signature: _____

EMPLOYEE MUST RETURN THIS RELEASE TO OPERATIONS OFFICE WITHIN 24 HOURS.

ATTACHMENT C: KLEINFELDER LOSS/NEAR LOSS INVESTIGATION REPORT

KLEINFELDER-EAST INCIDENT/INJURY/NEAR LOSS INVESTIGATION REPORT (Incident # _____)

SECTION 1: INCIDENT INFORMATION (SUBMIT TO DIV. H&S WITHIN 24 HOURS OF INCIDENT)					
KLEINFELDER-EAST Office: ☐ Hamilton, NJ ☐ MA ☐ CT ☐ HV ☐ LI ☐ AL ☐ RO ☐ West Chester, PA ☐ FL ☐ MD ☐ Cranberry, PA ☐ Cinnaminson, NJ BUSINESS CLIENT: ☐ NONE (KLEINFELDER-EAST Internal incident only) ☐ Client and region: _____					INCIDENT STATUS and TYPE: ☐ Initial. Date submitted: _____ ☐ Final. Date submitted: _____ ☐ V&V Complete; incident closed
PERSONNEL INVOLVED ☐ KLEINFELDER-EAST PERSONNEL ☐ SUB CONTRACTOR ☐ CONTRACTOR ☐ THIRD PARTY/GENERAL PUBLIC					
JOB TASK ☐ Carbon Changeout ☐ Gauging/Bailing ☐ Operations/Maintenance ☐ Subsurface Clearance ☐ Demolition ☐ Geoprobe ☐ Pavement Cutting ☐ System Install ☐ Dewatering ☐ Heavy Equip Ops ☐ Pump/Pilot Test ☐ System Startup ☐ Drilling ☐ Mobil Rem/Vac Event ☐ Rigging/Lifting ☐ UST Removal ☐ Excavation/Trenching ☐ Motor Vehicle ☐ Sampling ☐ Waste Management ☐ NAPL Recovery ☐ Other: _____					
COMPANY NAME AND SUBCONTRACTOR COMPANY NAME (IF APPLICABLE)				NAME OF EMPLOYEE INVOLVED	
DATE MM/DD/YY	TIME hh:mm ☐ AM ☐ PM	# OF YEARS WORKED FOR COMPANY	# OF YEARS IN CURRENT POSITION	WAS ALCOHOL / DRUG USE SUSPECTED? ☐ YES ☐ NO	
INCIDENT LOCATION (CITY, STATE AND COUNTRY IF OUTSIDE THE U.S.)			SITE / FACILITY / LOCATION ID#/ PROJ. #	SUPERVISOR'S NAME	
SUPERVISOR'S PHONE NUMBER	CONTACT NAME	CONTACT PHONE NUMBER	DIVISION/CORP. NOTIFICATIONS MADE? ☐ YES ☐ NO		
NAMES OF OTHER INDIVIDUALS INVOLVED		COMPANY NAME / # OF YRS. WORKING / # OF YRS. IN CURRENT POSITION / EXTENT OF INJURIES			
ESTIMATED COST OF INCIDENT: ☐ < \$500 ☐ > \$500		IF A SPILL / RELEASE - MATERIAL INVOLVED:	TOTAL QUANTITY: _____ U.S. GALLONS		

***SUMMARY DESCRIPTION OF INCIDENT / NEAR LOSS (INCLUDE THE SEQUENCE OF EVENTS, THE CAUSAL FACTORS TO EXPLAIN THE PROBLEM AND ALL PERTINENT FACTS ABOUT INJURY AND TREATMENT GIVEN, ACCIDENT, LOSS or NEAR MISS; RESPONSE ACTIONS TAKEN)**

BRIEF DESCRIPTION OF INCIDENT:

POTENTIAL LOSS/INJURY (if Near Loss):

BACKGROUND DETAILS (i.e. overview of activities being performed; locations; etc.):

SECTION 2: INCIDENT DETAILS

TYPE OF INCIDENT: (Check all that apply)

INCIDENT TYPES

☐ INJURY

☐ ILLNESS

-----Severity Level-----

☐ Fatality

☐ Lost Time

☐ Restricted Work

☐ Medical Treatment

☐ First Aid

ENVIRONMENTAL

☐ Spill / Release

☐ Permit Exceedance

☐ Fine / Penalty

☐ NOV

☐ Misdirected Waste

☐ Consent Order

PROPERTY DAMAGE

☐ Property Damage

IF DRUG/ALCOHOL TESTING WAS CONDUCTED, SUMMARIZE ACTIONS TAKEN/ TESTING (NOTE: ANY KA EMPLOYEE INVOLVED IN A MOTOR VEHICLE ACCIDENT, OR SUSTAINS AN INJURY REQUIRING PROFESSIONAL MEDICAL TREATMENT MUST SUBMIT TO A DRUG/ALCOHOL SCREEN).

EQUIPMENT INVOLVED: (Select all that apply)

Fixed – Piping, General

☐ Piping

☐ Piping, Hose

Fixed – Storage/Tankage

☐ Tank, Underground

☐ Tank, Underground Double Wall

Fixed - Vessel

☐ Drum, Separator, Vertical

Instrumentation – Instrument System

☐ Local Control Panel

Machinery – Drilling Equipment

☐ Drill Rig

Machinery - Pump

☐ Pump, Submerged

Support Equipment – Communication/Computing

☐ Audio Communication (Telemetry)

Support Equipment – Maintenance/Testing Tools

☐ Hand Tool, Hammer

☐ Hand Tool, Knife

☐ Hand Tool, Non Powered

☐ Hand Tool, Powered

☐ Hand Tool, Powered, Drill

☐ Hand Tool, Powered, Grinder

☐ Hand Tool, Powered, Hydraulic Torque

☐ Hand Tool, Powered, Saw

☐ Hand Tool, Powered, Wrench

☐ Hand Tool, Saw

☐ Hand Tool, Screwdriver

☐ Hand Tool, Shears

☐ Hand Tool, Shovel

☐ Hand Tool, Wrench

☐ Ladder, Extension

☐ Ladder, Platform

☐ Ladder, Step

☐ Maintenance Tool, General

☐ Space Heater, Electric

Support Equipment – Oil Spill Response

☐ Boom Material

Support Equipment – Remediation Equipment

☐ Blower

☐ Carbon Drum/Vessel

☐ Compressor

☐ Critical Equipment

☐ Drilling Equipment, Vacuum

☐ Exclusion Zone Equipment

☐ Fencing

☐ Filter

☐ Fire Extinguisher

☐ Manifold

☐ Oxidizer

☐ PPE - Eye

☐ PPE - Fall

☐ PPE - Foot

☐ PPE - Hand

☐ PPE - Head

☐ PPE - Hearing

☐ PPE - Respiratory

☐ PPE – Vest/Clothing

☐ PPE - Other

☐ Pumps (transfer, electrical)

☐ Remediation Shed/Trailer

☐ Separator

☐ Surge Tanks

☐ System - Air Sparging

☐ System - Carbon Treatment

☐ System - Chemical Oxidation

☐ System - Dual Phase Product Recovery

☐ System - Groundwater Pump and Treat

☐ System - Vapor Extraction

☐ System - Vapor Phase Treatment

☐ System - Other

☐ Well - Extraction

☐ Well - Monitoring

☐ Well - Recovery

Support Equipment – Sampling Equipment

☐ Bailer

☐ Geoprobe

☐ Hand Auger

☐ Photo-ionization Device

☐ Sample Container

☐ Split Spoon Sampler

Support Equipment - Snow Removal

☐ Snow Plow

Work Equipment – Crane

☐ Crane, Mobile

Work Equipment – Earth Moving Equip.

☐ Bulldozer

☐ Dump Truck

☐ Excavator/Power Shovel

☐ Front End Loader

☐ Grader

Work Equipment – Lifting Equipment

☐ Chain Block

☐ Forklift

☐ Hoist

☐ Hook/Clamp/Buckle etc.

☐ Jack

☐ Manlift/Basket/Cherry Picker

☐ Rope

☐ Sling

☐ Winch

☐ Wire Rope

Work Equipment - Transportation

☐ Automobile

☐ Tractor Trailer

☐ Truck, Flatbed

☐ Truck, Pick-up

☐ Truck, Tank Truck

☐ Truck, Vacuum

Other: _____

TYPE OF INJURY/ILLNESS (OR POTENTIAL IF NEAR LOSS)

☐ Amputation/Avulsion

☐ Bruise/Contusion

☐ Burn - Chemical

☐ Burn - Thermal or Electrical

☐ Concussion/Unconscious

☐ Crush

☐ Cut/Scrape/Puncture

☐ Dislocation

☐ Foreign Object in Eye

☐ Fracture

☐ Hernia/Rupture

☐ Irritation

☐ Poisoning

☐ Sprain/Strain

☐ Sting/Bite

☐ Heat Stress/Exhaustion/Sunstroke

☐ Hypothermia

☐ Physical Agents - Radiation, etc.

☐ Repeat Trauma - CTS

☐ Repeat Trauma - Other Disorder

☐ Respiratory - Toxic Agents

☐ Skin Disease or Disorder

☐ Other _____

☐ Unknown

BODY PART AFFECTED (OR LIKELY PRIMARY INJURY IF NEAR LOSS)

☐ Abdomen/Groin

☐ Ankle

☐ Back/Spine

☐ Calf/Shin

☐ Central Nervous

☐ Chest

☐ Circulatory/Blood

☐ Ear

☐ Elbow

☐ Eye

☐ Face

☐ Fingers

☐ Foot

☐ Forearm

☐ Hand

☐ Hip

☐ Internal Organs

☐ Jaw

☐ Knee

☐ Neck

☐ Nose

☐ Respiratory

☐ Ribs

☐ Scalp

☐ Shoulder

☐ Skull

☐ Thigh

☐ Toes

☐ Tongue

☐ Tooth/Teeth

☐ Upper Arm

☐ Urinary

☐ Wrist

SOURCE OF INCIDENT					
Body Position/Force ☐ Line of Fire ☐ Overexertion/Strain ☐ Personal Energy ☐ Struck Against Object ☐ Struck By Object ☐ Buried ☐ Caught In, Under, Between		Chemical Exposure ☐ Inhalation ☐ Ingestion ☐ Physical Contact Contact By ☐ Animal/Insect/Plant ☐ Blood/Potentially Infectious Materials ☐ Electricity ☐ Noise ☐ Other Physical Agents ☐ Radiation ☐ Temperature Extremes		☐ Drowning Falls ☐ Fall, From Elevation ☐ Fall, Same Level ☐ Slip or Trip Without Fall ☐ Other ☐ Suffocate/Asphyxiate (Lack of Oxygen) ☐ Transportation Incident	
LOST TIME or RESTRICTED WORK:	START DATE	# OF ESTIMATED DAYS	# OF ACTUAL DAYS	☐ No Reassignment ☐ Permanently Reassigned ☐ Temporarily Reassigned	
ATTACHED INFORMATION: ☐ NEWSPAPERS ☐ PHOTO ☐ SKETCHES ☐ VEHICLE REPORT (ATTACHMENT 21A) ☐ OTHER (Check all that apply)					
NAME OF OWNER		ADDRESS		PHONE	
DESCRIPTION OF INJURY / DAMAGE					
NAME		STREET ADDRESS		CITY/STATE	PHONE
AUTHORITIES NOTIFIED					
PUBLICITY					
COMMENTS					
PREPARED BY		PREPARER'S TITLE	PHONE	DATE PREPARED MM/DD/YY	
SECTION 3: INVESTIGATION INFORMATION					
INVESTIGATION AND CONCLUSIONS: DESCRIBE IN DETAIL THE CAUSAL FACTORS; WHY THE INCIDENT OCCURRED AND IDENTIFY THE ROOT CAUSES					
List all factors relevant to the incident					
Brief summary of incident/near loss: Potential loss/injury (if near loss): Brief background description (i.e. locations; activities being performed; general background of task):					
ROOT CAUSE ANALYSIS AND RECOMMENDATIONS: HOW TO PREVENT INCIDENT FROM RECURRING					
FACTOR #	ROOT CAUSE #	Recommendations	PERSON RESPONSIBLE	AGREED DUE DATE	COMPLETION DATE

INVESTIGATION TEAM			
PRINT NAME	JOB POSITION	DATE	SIGNATURE

REVIEWED BY:			
PRINT NAME	JOB POSITION	DATE	SIGNATURE

SECTION 4: STEWARDSHIP ACTIONS

QUALITY REVIEW QUESTIONS			
Were the root causes identified? ☐ YES If no, explain: _____			
Do root cause and recommendation "match?" ☐ YES If no, explain: _____			
Is the recommendation feasible and maintainable? ☐ YES If no, explain: _____			
Is this a repeat incident? ☐ NO If yes, explain: _____			
QUALITY REVIEWED BY: (See questions above)			
PRINT NAME	JOB POSITION	DATE	SIGNATURE

RESULTS OF VERIFICATION AND VALIDATION					
Verification: Were the solutions implemented? ☐ YES ☐ NO					
VERIFICATION BY:					
SOL #	VERIFIER'S NAME	JOB POSITION (COMPANY)	DATE VERIFIED	DETAILS	SIGNATURE

Validation: Were the solutions effective in addressing the root causes? ☐ YES ☐ NO					
VALIDATION BY:					
SOL #	VALIDATOR'S NAME	JOB POSITION (COMPANY)	DATE VALIDATED	DETAILS	SIGNATURE



APPENDIX D

NYSDOH INDOOR AIR QUALITY QUESTIONNAIRE AND BUILDING INVENTORY CENTER FOR ENVIRONMENTAL HEALTH

New York State Department of Health Generic Community Air Monitoring Plan

A Community Air Monitoring Plan (CAMP) requires real-time monitoring for volatile organic compounds (VOCs) and particulates (i.e., dust) at the downwind perimeter of each designated work area when certain activities are in progress at contaminated sites. The CAMP is not intended for use in establishing action levels for worker respiratory protection. Rather, its intent is to provide a measure of protection for the downwind community (i.e., off-site receptors including residences and businesses and on-site workers not directly involved with the subject work activities) from potential airborne contaminant releases as a direct result of investigative and remedial work activities. The action levels specified herein require increased monitoring; corrective actions to abate emissions, and/or work shutdown. Additionally, the CAMP helps to confirm that work activities did not spread contamination off-site through the air.

The generic CAMP presented below will be sufficient to cover many, if not most, sites. Specific requirements should be reviewed for each situation in consultation with NYSDOH to ensure proper applicability. In some cases, a separate site-specific CAMP or supplement may be required. Depending upon the nature of contamination, chemical-specific monitoring with appropriately-sensitive methods may be required. Depending upon the proximity of potentially exposed individuals, more stringent monitoring or response levels than those presented below may be required. Special requirements will be necessary for work within 20 feet of potentially exposed individuals or structures and for indoor work with co-located residences or facilities. These requirements should be determined in consultation with NYSDOH.

Reliance on the CAMP should not preclude simple, common-sense measures to keep VOCs, dust, and odors at a minimum around the work areas.

Community Air Monitoring Plan

Depending upon the nature of known or potential contaminants at each site, real-time air monitoring for volatile organic compounds (VOCs) and/or particulate levels at the perimeter of the exclusion zone or work area will be necessary. Most sites will involve VOC and particulate monitoring; sites known to be contaminated with heavy metals alone may only require particulate monitoring. If radiological contamination is a concern, additional monitoring requirements may be necessary per consultation with appropriate NYSDOH staff.

Continuous monitoring will be required for all ground intrusive activities and during the demolition of contaminated or potentially contaminated structures. Ground intrusive activities include, but are not limited to, soil/waste excavation and handling, test pitting or trenching, and the installation of soil borings or monitoring wells.

Periodic monitoring for VOCs will be required during non-intrusive activities such as the collection of soil and sediment samples or the collection of groundwater samples from existing monitoring wells. "Periodic" monitoring during sample collection might reasonably consist of taking a reading upon arrival at a sample location, monitoring while opening a well cap or overturning soil, monitoring during well baling/purging, and taking a reading prior to leaving a sample location. In some instances, depending upon the proximity of potentially exposed individuals, continuous monitoring may be required during sampling activities. Examples of such situations include groundwater sampling at wells on the curb of a busy urban street, in the midst of a public park, or adjacent to a school or residence.

VOC Monitoring, Response Levels, and Actions

Volatile organic compounds (VOCs) must be monitored at the downwind perimeter of the immediate work area (i.e., the exclusion zone) on a **continuous** basis or as otherwise specified. Upwind concentrations should be measured at the start of each workday and periodically thereafter to establish background conditions. The monitoring work should be performed using equipment appropriate to measure the types of contaminants known or suspected to be present. The equipment should be calibrated at least daily for the contaminant(s) of concern or for an appropriate surrogate. The equipment should be capable of calculating 15-minute running average concentrations, which will be compared to the levels specified below.

- If the ambient air concentration of total organic vapors at the downwind perimeter of the work area or exclusion zone exceeds 5 parts per million (ppm) above background for the 15-minute average, work activities must be temporarily halted and monitoring continued. If the total organic vapor level readily decreases (per instantaneous readings) below 5 ppm over background, work activities can resume with continued monitoring.
- If total organic vapor levels at the downwind perimeter of the work area or exclusion zone persist at levels in excess of 5 ppm over background but less than 25 ppm, work activities must be halted, the source of vapors identified, corrective actions taken to abate emissions, and monitoring continued. After these steps, work activities can resume provided that the total organic vapor level 200 feet downwind of the exclusion zone or half the distance to the nearest potential receptor or residential/commercial structure, whichever is less - but in no case less than 20 feet, is below 5 ppm over background for the 15-minute average.
- If the organic vapor level is above 25 ppm at the perimeter of the work area, activities must be shutdown.

All 15-minute readings must be recorded and be available for State (DEC and DOH) personnel to review. Instantaneous readings, if any, used for decision purposes should also be recorded.

Particulate Monitoring, Response Levels, and Actions

Particulate concentrations should be monitored **continuously** at the upwind and downwind perimeters of the exclusion zone at temporary particulate monitoring stations. The particulate monitoring should be performed using real-time monitoring equipment capable of measuring particulate matter less than 10 micrometers in size (PM-10) and capable of integrating over a period of 15 minutes (or less) for comparison to the airborne particulate action level. The equipment must be equipped with an audible alarm to indicate exceedance of the action level. In addition, fugitive dust migration should be visually assessed during all work activities.

- If the downwind PM-10 particulate level is 100 micrograms per cubic meter (mcg/m^3) greater than background (upwind perimeter) for the 15-minute period or if airborne dust is observed leaving the work area, then dust suppression techniques must be employed. Work may continue with dust suppression techniques provided that downwind PM-10 particulate levels do not exceed $150 \text{ mcg}/\text{m}^3$ above the upwind level and provided that no visible dust is migrating from the work area.
- If, after implementation of dust suppression techniques, downwind PM-10 particulate levels are greater than $150 \text{ mcg}/\text{m}^3$ above the upwind level, work must be stopped and a re-evaluation of activities initiated. Work can resume provided that dust suppression measures and other controls are successful in reducing the downwind PM-10 particulate concentration to within $150 \text{ mcg}/\text{m}^3$ of the upwind level and in preventing visible dust migration.

All readings must be recorded and be available for State (DEC and DOH) personnel to review.

June 20, 2000

P:\Bureau\Common\CommunityAirMonitoringPlan (CAMP)\GCAMPRI.DOC

**NEW YORK STATE DEPARTMENT OF HEALTH
INDOOR AIR QUALITY QUESTIONNAIRE AND BUILDING INVENTORY
CENTER FOR ENVIRONMENTAL HEALTH**

This form must be completed for each residence involved in indoor air testing.

Preparer's Name _____ Date/Time Prepared _____

Preparer's Affiliation _____ Phone No. _____

Purpose of Investigation _____

1. OCCUPANT:

Interviewed: Y / N

Last Name: _____ First Name: _____

Address: _____

County: _____

Home Phone: _____ Office Phone: _____

Number of Occupants/persons at this location _____ Age of Occupants _____

2. OWNER OR LANDLORD: (Check if same as occupant ____)

Interviewed: Y / N

Last Name: _____ First Name: _____

Address: _____

County: _____

Home Phone: _____ Office Phone: _____

3. BUILDING CHARACTERISTICS

Type of Building: (Circle appropriate response)

Residential
Industrial

School
Church

Commercial/Multi-use
Other: _____

If the property is residential, type? (Circle appropriate response)

Ranch	2-Family	3-Family
Raised Ranch	Split Level	Colonial
Cape Cod	Contemporary	Mobile Home
Duplex	Apartment House	Townhouses/Condos
Modular	Log Home	Other:_____

If multiple units, how many? _____

If the property is commercial, type?

Business Type(s) _____

Does it include residences (i.e., multi-use)? Y / N If yes, how many? _____

Other characteristics:

Number of floors _____ Building age _____

Is the building insulated? Y / N How air tight? Tight / Average / Not Tight

4. AIRFLOW

Use air current tubes or tracer smoke to evaluate airflow patterns and qualitatively describe:

Airflow between floors

Airflow near source

Outdoor air infiltration

Infiltration into air ducts

5. BASEMENT AND CONSTRUCTION CHARACTERISTICS (Circle all that apply)

- a. Above grade construction: wood frame concrete stone brick
- b. Basement type: full crawlspace slab other _____
- c. Basement floor: concrete dirt stone other _____
- d. Basement floor: uncovered covered covered with _____
- e. Concrete floor: unsealed sealed sealed with _____
- f. Foundation walls: poured block stone other _____
- g. Foundation walls: unsealed sealed sealed with _____
- h. The basement is: wet damp dry moldy
- i. The basement is: finished unfinished partially finished
- j. Sump present? Y / N
- k. Water in sump? Y / N / not applicable

Basement/Lowest level depth below grade: _____(feet)

Identify potential soil vapor entry points and approximate size (e.g., cracks, utility ports, drains)

6. HEATING, VENTING and AIR CONDITIONING (Circle all that apply)

Type of heating system(s) used in this building: (circle all that apply – note primary)

Hot air circulation	Heat pump	Hot water baseboard	
Space Heaters	Stream radiation	Radiant floor	
Electric baseboard	Wood stove	Outdoor wood boiler	Other _____

The primary type of fuel used is:

Natural Gas	Fuel Oil	Kerosene
Electric	Propane	Solar
Wood	Coal	

Domestic hot water tank fueled by: _____

Boiler/furnace located in: Basement Outdoors Main Floor Other _____

Air conditioning: Central Air Window units Open Windows None

Are there air distribution ducts present? Y / N

Describe the supply and cold air return ductwork, and its condition where visible, including whether there is a cold air return and the tightness of duct joints. Indicate the locations on the floor plan diagram.

7. OCCUPANCY

Is basement/lowest level occupied? Full-time Occasionally Seldom Almost Never

Level **General Use of Each Floor (e.g., familyroom, bedroom, laundry, workshop, storage)**

Basement	
1 st Floor	
2 nd Floor	
3 rd Floor	
4 th Floor	

8. FACTORS THAT MAY INFLUENCE INDOOR AIR QUALITY

- | | |
|--|------------------------------------|
| a. Is there an attached garage? | Y / N |
| b. Does the garage have a separate heating unit? | Y / N / NA |
| c. Are petroleum-powered machines or vehicles stored in the garage (e.g., lawnmower, atv, car) | Y / N / NA
Please specify <hr/> |
| d. Has the building ever had a fire? | Y / N When? <hr/> |
| e. Is a kerosene or unvented gas space heater present? | Y / N Where? <hr/> |
| f. Is there a workshop or hobby/craft area? | Y / N Where & Type? <hr/> |
| g. Is there smoking in the building? | Y / N How frequently? <hr/> |
| h. Have cleaning products been used recently? | Y / N When & Type? <hr/> |
| i. Have cosmetic products been used recently? | Y / N When & Type? <hr/> |

- j. Has painting/staining been done in the last 6 months? Y / N Where & When? _____
- k. Is there new carpet, drapes or other textiles? Y / N Where & When? _____
- l. Have air fresheners been used recently? Y / N When & Type? _____
- m. Is there a kitchen exhaust fan? Y / N If yes, where vented? _____
- n. Is there a bathroom exhaust fan? Y / N If yes, where vented? _____
- o. Is there a clothes dryer? Y / N If yes, is it vented outside? Y / N
- p. Has there been a pesticide application? Y / N When & Type? _____

Are there odors in the building?

Y / N

If yes, please describe: _____

Do any of the building occupants use solvents at work?

Y / N

(e.g., chemical manufacturing or laboratory, auto mechanic or auto body shop, painting, fuel oil delivery, boiler mechanic, pesticide application, cosmetologist)

If yes, what types of solvents are used? _____

If yes, are their clothes washed at work?

Y / N

Do any of the building occupants regularly use or work at a dry-cleaning service? (Circle appropriate response)

Yes, use dry-cleaning regularly (weekly)

Yes, use dry-cleaning infrequently (monthly or less)

Yes, work at a dry-cleaning service

No

Unknown

Is there a radon mitigation system for the building/structure? Y / N Date of Installation: _____

Is the system active or passive? Active/Passive

9. WATER AND SEWAGE

Water Supply: Public Water Drilled Well Driven Well Dug Well Other: _____

Sewage Disposal: Public Sewer Septic Tank Leach Field Dry Well Other: _____

10. RELOCATION INFORMATION (for oil spill residential emergency)

a. Provide reasons why relocation is recommended: _____

b. Residents choose to: remain in home relocate to friends/family relocate to hotel/motel


c. Responsibility for costs associated with reimbursement explained? Y / N

d. Relocation package provided and explained to residents? Y / N


11. FLOOR PLANS

Draw a plan view sketch of the basement and first floor of the building. Indicate air sampling locations, possible indoor air pollution sources and PID meter readings. If the building does not have a basement, please note.

Basement:

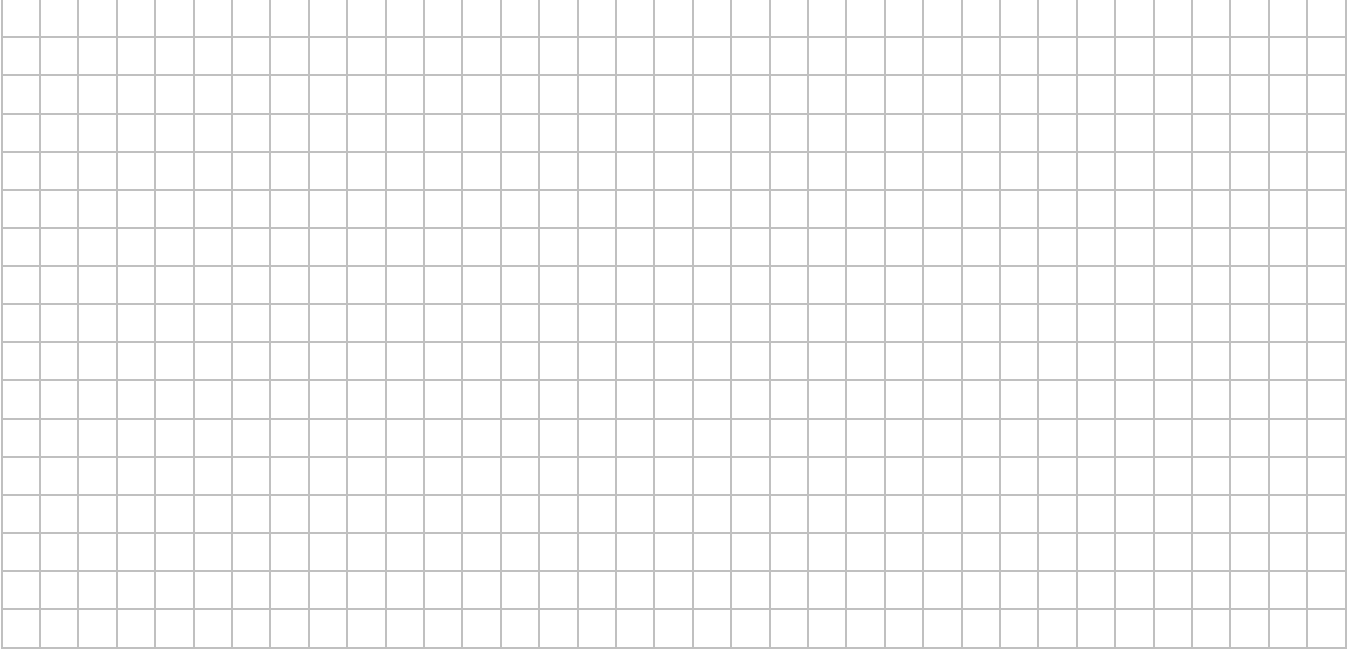


First Floor:

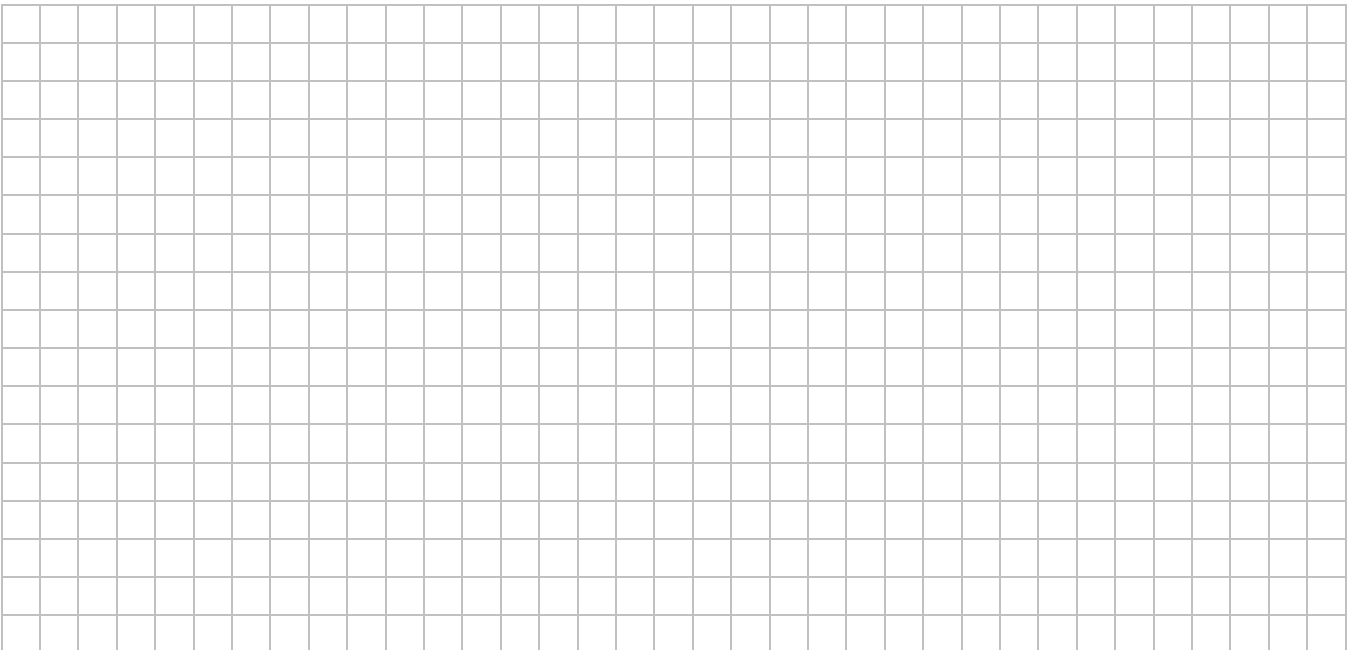

12. OUTDOOR PLOT

Draw a sketch of the area surrounding the building being sampled. If applicable, provide information on spill locations, potential air contamination sources (industries, gas stations, repair shops, landfills, etc.), outdoor air sampling location(s) and PID meter readings.

Also indicate compass direction, wind direction and speed during sampling, the locations of the well and septic system, if applicable, and a qualifying statement to help locate the site on a topographic map.

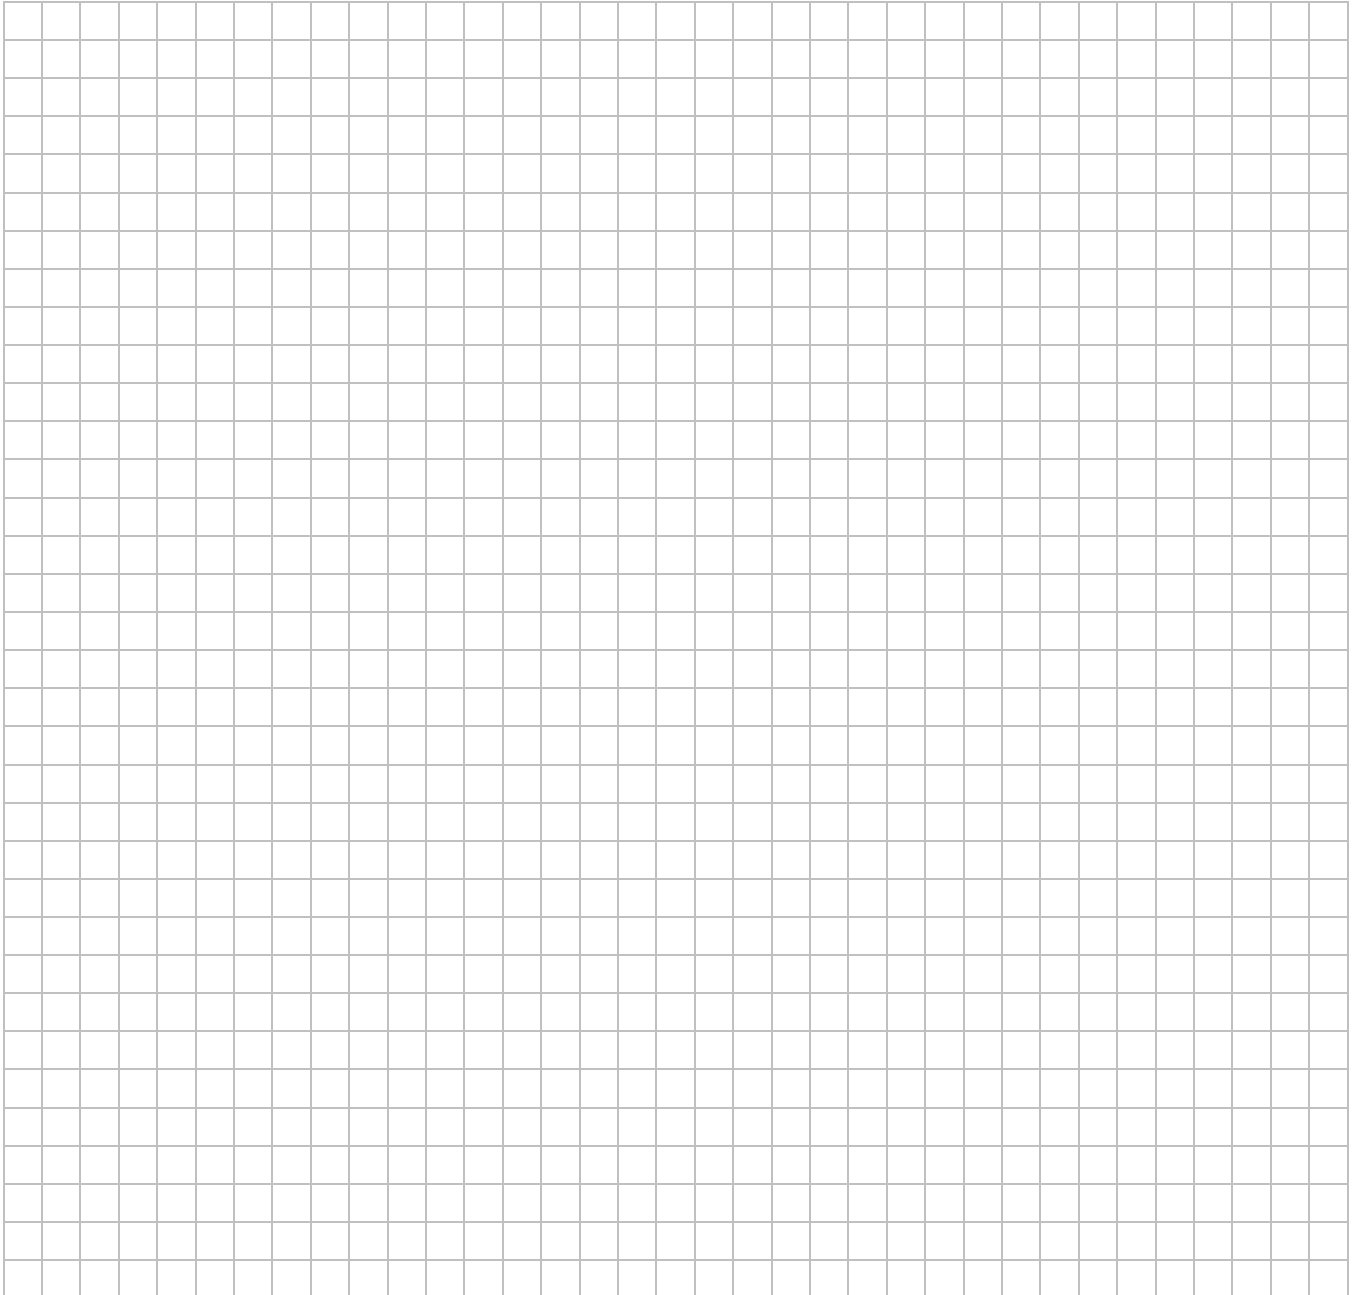

13. PRODUCT INVENTORY FORM

Make & Model of field instrument used: _____

List specific products found in the residence that have the potential to affect indoor air quality.

[illegible]

* Describe the condition of the product containers as **Unopened (UO)**, **Used (U)**, or **Deteriorated (D)**

**** Photographs of the front and back of product containers can replace the handwritten list of chemical ingredients. However, the photographs must be of good quality and ingredient labels must be legible.**



APPENDIX E

INVESTIGATION TEAM QUALIFICATIONS

INVESTIGATION TEAM

Project Manager – Kurt Frantzen

Asst Project Manager – Ben Rieger

Field Manager – Anna Smith

Health & Safety – Matthew Pickard

KURT A. FRANTZEN, PhD, CHMM

Risk Analysis & Toxicology Eastern Division Practice Leader

Education

- PhD, Life Sciences/
Biochemistry, University of
Nebraska, Lincoln
- American Cancer Society Post-
Doctoral Fellowship, Univ. of
Washington, Seattle (1985-1986)
- MS, Plant Pathology, Kansas
State University, Manhattan
- BS, Biology, University of
Nebraska, Omaha

Registrations

- Certified Hazardous Materials
Manager (CHMM), 2007, #14143

Professional Affiliations

- Society for Risk Analysis
- American Association. for the
Advancement of Science
- American Chemistry Society
- American Institute of Biological
Sciences

Recent Publications

- Editor and senior author of Risk-
Based Analysis for
Environmental Managers printed
by Lewis Publishers/CRC Press
in 2001

Recent Invited Presentations

- Remedying Risk to Achieve
Redevelopment, Lecture to the
Land Reclamation and
Technology Course, Harvard
University, Graduate School of
Design, Boston, MA, March
2008, March 2007, March 2006 &
March 2005
- Managing the Risks in
Redeveloping Brownfields Sites,
Co-taught Lecture for the
Brownfields Course, NJIT,
Newark, NJ, February 2008, Co-
Lectures: MH Marcus and JJ
Campanile

Summary of Experience

Using risk-based approaches that limit remedial cost, Dr. Frantzen serves clients by interfacing science, engineering, and planning to resolve complex property contamination matters. With extensive risk assessment experience and with large investigation/remediation project management experience, he is a hands-on practitioner achieving high equity results for clients. A biochemist by training, he has twenty years of experience in environmental risk analysis, hazardous waste site / Brownfields investigation / remediation, environmental R&D, and cost accountable management. He has worked on state-led, Superfund, DOE and DOD sites around the US.

Select Project Experience

SELECT RISK ASSESSMENT EXPERIENCE

**Screening Ecological Risk Assessment for Owens Dry Lake
Evaluating Potential Impacts from Two Dust Control
Measures, Keeler, CA, 2007**

Risks associated with stressors (chemical, physical, habitat and others) arising from the application of the dust control measures: shallow flooding, and moat and row. For Great Basin Unified Air Pollution Control District via Sapphos Environmental, Inc.

**Baseline Ecological (Fish and Wildlife Resource) Risk
Assessment of Al Tech/REALCO Incorporated Site, Dunkirk,
NY, 2006**

Risks associated with PCB release to off-site stream and wetland. For NYSDEC via Benchmark Engineering and Environmental Sciences, PLLC.

**Screening Ecological Risk Assessment for Peter
Cooper/Markhams Site, Dayton, NY, 2005**

Assessment of upland and wetland resources at hide/glue manufacturing waste landfill containing chromium, arsenic, zinc and various organic solvents. For PRP Group via Benchmark EE&S, PLLC.

**Zoning Variance Opinion Letter Concerning Storage of
Isopropyl Alcohol, Boston, MA, 2004**

Addressed potential impacts from a future alcohol release at a warehouse property. For Gutierrez Company.



Environmental Risk Management Review of a Mercury-Contaminated Building Planned for Office Space, Danvers, MA, 2000 – 2001

Evaluated the former OSRAM Sylvania Manufacturing Facility: reviewed investigation data, remedial effort and post-remedial clearance data; developed comparative internal surface (floor, wall and ceiling) health risk-based criteria; advised on cleanup efficiency. For private redeveloper.

Development and Negotiation of Cleanup Goals for the Nof-Yam Explosives and Propellants Facility, Herzeliya, Israel, 1996

Part of the Remedial Investigation and Feasibility Study for the decommissioning, demolition, and redevelopment of the facility. This was the first set of cleanup goals developed for a large (45-hectare) contaminated site along the Mediterranean coast (near the ancient city of Apollonia-Arsuf) worth US\$3 Billion. Negotiations conducted with the Senior Deputy Director General of the Ministry of Environment. For Israel Military Industries.

Ecological Risk Assessment for the Hinkley Site, CA, 1988

Natural gas transmission pipeline compressor station in Mojave Desert with hexavalent chromium release to groundwater. Evaluated fate and transport, the baseline ecological risks and risks associated with remedial alternatives. Concept creator of the implemented remedial alternative that involved pumping and treatment by natural attenuation. For Pacific Gas and Electric Co.

SELECT BROWNFIELDS AND PROPERTY MANAGEMENT EXPERIENCE

Nott Street Industrial Park, Schenectady, NY, 2001-present

Environmental oversight, Park is under Stipulation and VCA. For Schenectady Industrial Corp.

Orangetown Shopping Center, Orangeburg, NY, 2004-present

Environmental site assessments (Phase I-Phase II Site Characterization to date), and NYS BCP support to assess nature and extent and remediate a chlorinated solvent release. For JLJ Management.

Environmental Management Support, Beacon Parcel Development, Marlborough, MA, 2005-present

Performed site assessment, prepared Soil Management Plan, provided technical communication support, to assist in site development and to address residual pesticides (lead arsenate, DDT, and dieldrin) in the soils of a former orchard site. The Gutierrez Company, Burlington, MA

Risk Appraisal of Large Land Tract for Development, Virginia Beach, VA, 2002-2003

Appraised environmental liabilities associated with 400-acre undeveloped tract near a mixed residential and university setting in preparation of development, as part of an overall real estate feasibility study. Included a Phase I ESA update for the entire property and risk profiling and liability estimation for the specific 50-acre site slated for initial development. For CBN.

Risk Appraisal of Transit Depot/Garaging Facility, Richmond, VA, 2002

Appraised environmental liabilities associated with 6-acre transit facility in a highly urban area in use for >100-years, as part of an overall real estate feasibility study. Included Phase I ESA, risk profiling, and liability estimation. For Greater Richmond Transit Company.



SELECT MANUFACTURED GAS PLANT EXPERIENCE

Environmental Risk Management Program Consultant (1993–2004)—portfolio of former MGP sites and ancillary properties for Brooklyn Union and KeySpan

Scope: M&A due diligence, RI/FS, exposure/risk assessment (soil / garden / groundwater / sediment / surface water / indoor & ambient air), cleanup goal development, insurance & litigation support, participated in strategic and tactical planning and negotiations, served as technical spokesperson in public forums. Significant experience with NY (e.g., Coney Island, Bay Shore, Glenwood, Newtown, Clifton, Sag Harbor, Rockaway) and MA (e.g., Everett) sites.

Method 3 Risk Characterization & FS Support, Lawn Street & Mendon Road Sites, Attleboro, MA
Ferricferrocyanide disposal, for Eastern Utilities/Blackstone Valley Electric Corp.

Baseline Risk Assessment for former MGP site, Plattsburgh, NY (NYSEG)

Method 3 Risk Characterization for a former MGP site in Southbridge, MA (Mass Electric)

Risk Evaluation of two small former MGP sites, Downstate NY (Orange and Rockland Utilities)

RI/Risk Assessment Support, former MGP sites, St Augustine and Sanborn, FL (AGL)

Risk Assessment & Cleanup Goal Development, former MGP site, Cambridge, MD

Public Health and Environmental Evaluation and Cleanup Goal Negotiation for the Midway-Bayshore Site, Daly City, CA (PG&E)

SELECT LITIGATION EXPERIENCE

PRP Cost Recovery Action under RCRA, Niagara Falls, NY, 2006

Expert testimony [deposition] concerning imminent and substantial endangerment.

Environmental Insurance Claim Litigation, Providence, RI, 2006

Technical strategy and expert opinion concerning: operational perspectives/industrial usage of chlorinated ethenes and environmental chemistry and investigative methods in the early 1960s.

Risk Appraisal of Retail Fuel Oil Business Property under Probate, Medway, MA, 2004

Environmental liability assessment and estimation.

Beryllium Exposure Reconstruction, Ohio, 2003

Developed technical analysis to support expert opinion.

Environmental Insurance Claim Litigation, New York, NY, 2003

MGP site, fact deposition.

Asbestos Exposure Reconstruction, New York, NY, 2003

Technical analysis for expert opinion.

Environmental Damage Claim, 1994, 1996-1997

Technical justification of claim for intermediate term and chronic public health effects from Gulf War I; Part of Kuwait's reparation process against Iraq under the United Nations Claims Commission.



Risks from Dioxin and Other Emissions From Tooele Chemical Agent Disposal Facility, 1996

US District Court/Utah Central Division Civil #2:96-CV-425C. Technical analysis for expert opinion.

Toxic Tort Litigation Associated with the Midway-Bayshore Site, Daly City, CA, 1995

Technical analysis for expert opinion.

Natural Resource Damage Assessment: Integration into the Remedial Investigation/Feasibility Study Process, INEEL DOE-Idaho, 1994

Natural Resource Damage Claim Vulnerability Analysis, INEEL DOE-Idaho, 1993

BENJAMIN RIEGER, LEED, AP
Project Manager

Education

- BS, Biology, Houghton College, New York, 1997
- MS, Environmental Studies, State University of New York System: College of Environmental Science & Forestry, New York, 2002

Registrations

- LEED, U.S. Green Building Council, December 2007

Professional Affiliations

- Environmental Professionals of Connecticut (EPOC)
- Real Estate Finance Association
- The Real Estate Exchange
- International Council of Shopping Centers (ICSC)

Publications and Presentations

- Presentation, "Onieda Indian Use of the Canastota Mucklands", SWS 2002 Annual Meeting
- Presentation, "Wetland Heritage Values of the Canastota Mucklands", NYS Wetlands Forum, Spring 2002

Summary of Experience

Mr. Rieger is currently a project manager, based out of Kleinfelder's Connecticut and Massachusetts offices. His responsibilities include development and management of new client relationships and the management of multiple environmental assessment, remediation and natural resource projects in New England.

Prior to his current role, Mr. Rieger served as program manager for a petrochemical client. His responsibilities included management of junior and senior staff working on more than 160 environmental projects across the New England region, programmatic client account management, scope of work and cost development, project coordination and implementation, direction and oversight of field activities and report preparation and review.

Mr. Rieger oversees environmental data warehousing and geographic information systems in the Connecticut office. In this capacity Mr. Rieger facilitates the collection of spatial data and the integration of spatial data with an EPA Region 5 format environmental database.

Mr. Rieger has conducted and supervised subsurface investigations on more than 50 commercial sites in Connecticut, Massachusetts, New Hampshire, New York, Rhode Island and Maine. Responsibilities have included historical and regulatory research, wetland delineation and ecological resource assessment, NEPA reviews, environmental permitting, design and implementation of sampling programs for soil, soil vapor and groundwater, well installation (monitoring wells, multi-level piezometers, bedrock wells), data evaluation and report preparation and review.

Mr. Rieger has participated in the design and overseen the implementation of wetland enhancements and constructed wetlands.

Mr. Rieger has extensive experience in evaluating the ecological and cultural values of wetland systems.

Mr. Rieger has installed environmental remediation systems to address soil and groundwater contamination at various petroleum sites in Connecticut, Rhode Island and New Hampshire. These installation included contractor safety oversight and system performance optimization during the initial period of operation.

Select Project Experience

Stonington, CT – Breslin Realty Development Corp.

Mr. Rieger conducted pond ecosystem impact analysis including and analysis of the pond hydro period following rain events pre and posted development and an evaluation of the potential impacts to the biota associated with this wetland community. Mr. Rieger provided support in the permit application process and through a series of public hearings gained approval for the project.

Old Lyme, CT – Region 18 School District

Mr. Rieger conducted a wetland impact assessment and tidal influence evaluation in support of a IWWC permit application to discharge athletic field and running track drained to the upland review area adjacent to the Duck River. Mr. Rieger provided testimony to the IWWC and responded to the concerns of the neighboring property owners during public hearing. The permit was approved with conditions recommended by Mr. Rieger. Mr. Rieger also provided planning plans and construction document narrative in support of the stormwater management plan for this project.

Manchester, CT – Optasite Tower

Mr. Rieger oversaw the preparation of a Phase I Environmental Site Assessment, NEPA and SHPO documents associated with the FCC filing for the proposed tower location. Mr. Rieger provided testimony regarding natural and cultural resource impacts to the Connecticut Siting Council in support of this project.

Stratford, CT – Confidential development site

Mr. Rieger conducted initial environmental due diligence for the site and worked with the project ecologist to establish wetland lines. Mr. Rieger supported an appeal for wetland variance to the town commission including presentation at public meetings to address public questions and questions from the opposition's attorney.

Stonington, CT – Confidential development site

Mr. Rieger conducted a Connecticut Wetland Delineation for a 54-acre parcel abutting the Shunock River under the supervision of a Connecticut Certified Soil Scientist

Multiple locations, CT – Southern Connecticut Gas SPCC planning

Mr. Rieger conducted regulatory analysis on behalf of Southern Connecticut Gas, worked with the Connecticut Department of Environmental Protection (CTDEP) to clarify ambiguities in the regulations and developed SPCC plan recommendations for Southern Connecticut Gas to include in their SPCC plans.

Canastota Muck Lands, Canastota, NY

Mr. Rieger conducted a natural and cultural resources review for the wetland complex in for the Great Swamp Conservancy in support of a US FWS and NRCS wetland conservation and constructed wetland project. The resources review included current and historical wetland system values.

MTBE Impacted Bedrock Aquifer

Mr. Rieger oversaw groundwater monitoring and remedial system operation for a property currently under a CTDEP Consent Order. Evaluated data from site monitoring wells and twenty three active drinking water wells; managed interaction with State and local regulators and residents. The groundwater extraction system pumped and treated in excess of six million gallons of water. Contaminant concentrations surrounding bedrock wells decreased by four orders of magnitude during system operation.



Emergency Spill Response Activities

Mr. Rieger served as incident commander for a 21,000-gallon gasoline release in Rhode Island. Gasoline was released to groundwater surface in an excavation due to contractor error. Mr. Rieger coordinated response contractors, Rhode Island Department of Environmental Management (RI DEM) spill response staff, two fire companies and Kleinfelder staff during the incident. Mr. Rieger was responsible for the Health and Safety of all personnel on site and in the surrounding neighborhood. Over the first two days of the response action approximately 18,000 gallons of gasoline was recovered.

Multi Site Property Transaction Due Diligence

Mr. Rieger oversaw a dedicated project team which conducted thirty Phase 1 Environmental Site Assessments to support the sale of a group of commercial properties. To allow his client adequate time for document review and decision making within the contract due diligence period these assessments were completed within 35 days of project initiation.

New York State Brownfields Program Chlorinated Solvent Assessment

Working as part of a project team, Mr. Rieger developed a site assessment plan including multilevel groundwater monitoring wells installed using sonic drilling, analysis of naturally occurring dehalogenating bacteria by polymerase chain reaction, and subslab and indoor air quality sampling. This plan went through public comment and New York Department of Environmental Conservation and Department of Health review prior to approval. Mr. Rieger is currently managing the execution of the work plan.



ANNA SMITH
Geologist

Education

- BS, Geology, Rensselaer Polytechnic Institute, 2003

Summary of Experience

Ms. Smith is currently a Geologist at GSC|Kleinfelder. Her responsibilities in this position include management of junior staff, scope of work and cost development, project coordination and implementation, direction and oversight of field activities and technical report preparation for eighteen active environmental sites. Her area of expertise is planning, coordination and implementation of assessment and investigation projects.

Ms. Smith has conducted and/or supervised a variety of Environmental Site Assessments (ESAs) on commercial properties throughout Connecticut and Rhode Island. These assessments involved historical and regulatory research, design and implementation of sampling programs for soil, soil vapor and groundwater, the planning, coordination and oversight of all field activities, including impact assessment, subsurface investigation, soil excavations and geotechnical sampling. Ms. Smith's responsibilities have also included soil vapor extraction and pump and treat system design, permitting, installation and safety oversight. Ms. Smith is also involved with all applicable report generation for clients and working closely with the Connecticut Department of Environmental Protection (CTDEP), the Connecticut Department of Transportation (CTDOT) and the Rhode Island Department of Environmental Management (RIDEM).

Select Project Experience

Emergency Response/Site Assessment and Remediation, Retail Petroleum Facility, Narragansett, Rhode Island

Ms. Smith assisted in the immediate emergency response after a large product loss. Following the immediate response Ms. Smith coordinated and directed six different contractors to mitigate the impact to the surrounding residential area. Vertical and horizontal delineation of soil and groundwater was conducted, as well as classification and characterization of all soils. Following the site assessment, Ms. Smith coordinated a temporary pump and treat remediation system installation while designing and conducting cost development for a long term pump and treat and soil vapor extraction system. This project included scope of work development, financial planning and cost development, field oversight of soil boring and monitoring well installation utilizing direct push and hollow stem auger methods, remediation system design, permitting and installation at an active retail petroleum facility, communication with regulatory agencies, and health and safety oversight. Ms. Smith was required to work very closely with local authorities and utilities, as well as with state agencies regarding construction and permitting.

Subsurface Investigation, Former Retail Petroleum Facility, Cromwell, CT

Ms. Smith planned, coordinated and conducted a subsurface investigation at a former retail petroleum facility after MTBE was detected in a nearby potable well. The investigation included the vertical and horizontal delineation of soil and groundwater, geotechnical sampling and geophysical logging of a bedrock borehole to determine the bedrock geology in the immediate area of the former facility. Ms. Smith was responsible for work plan development, bid solicitation/review, contractor selection, contractor management/oversight, soil sampling, classification and characterization utilizing the Unified Soil Classification System (USCS), waste disposal management, evaluation of soil and ground water quality data and evaluation of geotechnical data.

Once the results of this investigation were reviewed, Ms. Smith was responsible for the coordination and oversight of the installation of a potable treatment system on a residential well. Coordination of the installation of a city water main on a residential street and the connection of the residence to that water main have also recently been completed.

Site Assessment/Investigation, Former Retail Petroleum Facility, Greenwich, CT

Ms. Smith conducted an environmental site assessment at a property which had stored petroleum products for more than eighty years. The purpose of the assessment was to determine the level of petroleum and MTBE impact on the property and then delineate the horizontal and vertical limits of the impact. The initial investigation determined that impact was migrating off-site and therefore another investigation was conducted on off-site properties.

Ms. Smith was responsible for scope of work development, financial planning, contractor selection and management, coordination with current property owners, off-site access and permitting, field activity/contractor oversight, USCS soil characterization, evaluation of data and groundwater modeling and health and safety oversight.

These investigations lead to the installation of a remediation system and continued environmental monitoring.



MATTHEW W. PICKARD, C.I.H.
Divisional Safety Manager

Education

- BS, Environmental Toxicology/Industrial Hygiene, Clarkson University, 1999

Registrations

- Certified Industrial Hygienist (C.I.H.), No. 9240CP, American Board of Industrial Hygienists, 2006

Certifications

- OSHA 40-Hour HAZWOPER
- Loss Prevention System Training Certification

Professional Affiliations

- Member of the American Society of Safety Engineers
- Member of American Industrial Hygiene Association

Seminars/Training

- Emergency Program Manager IS-1. This independent study course provides an introduction to Comprehensive Emergency Management (CEM) and the Integrated emergency Management System (IEMS).
- Emergency Preparedness IS-2. This independent study course provides an advanced level of Comprehensive Emergency Management (CEM) and the Integrated emergency Management System (IEMS).
- Radiological Emergency Management IS-3. This independent study course is intended to provide individuals with an overview of several types of radiological emergencies.

Summary of Experience

Mr. Pickard is the Divisional Health and Safety Manager for the Great Lakes Region. He is a Certified Industrial Hygienist, and is based out of the Newburgh, NY, office. He is responsible for the management of the corporate health and safety program in nine area offices, and in addition, he is also responsible for the development and delivery of industrial hygiene services. His fields of competence include occupational health and safety program development, compliance and liability auditing, employee work task hazard evaluations, building decontamination and demolition, safety and industrial hygiene management, and accident investigation.

Select Project Experience

HEALTH AND SAFETY MANAGEMENT PROJECT EXPERIENCE

St. Lawrence River PCB Remediation Project - From 9/1/2001 To 9/16/2002

Mr. Pickard managed the health and safety for all land based operations involving 50 people at the St. Lawrence River PCB Remediation Project. This included, conducting scheduled and unscheduled field audits to ensure worker compliance with mandated health and safety/personal protective equipment procedures. Additionally, Mr. Pickard was responsible for health and safety plan development and compliance including field investigative techniques and accuracy of sampling methodology, equipment calibration and quality control procedures during the performance of remedial investigations.

Demolition of Defense Supply Center for the Department of Defense - From 2/1/99 To 8/2/99

Mr. Pickard managed the health and safety for demolition activities involving 20 people at the Demolition of the Defense Supply Center. This included, conducting scheduled and unscheduled field audits to ensure worker compliance with mandated health and safety/personal protective equipment procedures. Additionally, Mr. Pickard was responsible for health and safety plan development and compliance including field investigative techniques.



Implosion of Three Rivers Stadium City of Pittsburgh - From 1/1/2001 To 5/22/2001

Mr. Pickard managed the health and safety of 200 individuals and 30 different subcontractors over three shifts at the Implosion of Three Rivers Stadium Project. Mr. Pickard's duties included, coordination of subcontractor activities, conducting scheduled and unscheduled field audits to ensure worker compliance with mandated health and safety/personal protective equipment procedures. Additionally, Mr. Pickard was responsible for health and safety plan development and compliance including field investigative techniques and accuracy of sampling methodology, equipment calibration and quality control procedures during the performance of remedial investigations.

New York City Transit Authority, Long Island Rail Road and Metro North Rail Roads - From 9/1/2002 To 9/2/2003

Mr. Pickard managed the health and safety of 200 individuals at multiple rail yards within the New York City Metropolitan area during the installation of new subway cars for the NYCTA, Long Island Railroad, and Metro North Railroads. Mr. Pickard was responsible for the generation and institution of a uniform Blue Flag Policy within his organization. Additionally, Mr. Pickard generated and instituted formal a Job Hazard Analyses Policy.

Environmental Health and Safety Audits for General Electric and NBC Universal

Mr. Pickard reviewed on-site records for injuries, training, and process specific activities. Work processes and on-site employee activities were observed. Recommendations for compliance were developed from record review and observations.

Industrial Hygiene Assessment of Tubing Manufacturing Facility - From 10/16/06 To 10/22/06

Mr. Pickard reviewed on-site records for injuries, training, and process specific activities. Work processes and on-site employee activities were observed. Recommendations for compliance were developed from record review and observations. Additionally, Mr. Pickard performed exposure assessments for operations involving cyclohexanone and soldering flux to assess employee exposure during these activities. Moreover, Mr. Pickard assisted the facility's Health and Safety committee in generating a Hazard Communication Policy.

Mold Investigations and Assessment of Indoor Air Quality

Mr. Pickard has inspected multiple office facilities. Varied construction types and different extent of water intrusion make each project unique. Mr. Pickard is experienced in visually identifying mold contamination and understands the different types of samples that can be collected to ensure that potential mold contamination is identified.

Drafted and Implemented Lead Health Protection Plans for the Demolition of Catenary Structures Transit Authority Railroad

Mr. Pickard drafted and implemented Lead Health Protection Plans for the abatement and demolition of various lead coated steel catenary structures. The plans included outlining acceptable work practices, engineering and administrative controls, determining similar exposure groups and instituting representative air monitoring and wipe sampling plans to assess employee exposures. Additionally, Mr. Pickard provided consultation on medical surveillance results and drafted and implemented a respiratory protection plan for those employees involved in lead emitting operations.

Hydrated Lime Exposure Assessment at Local Water Bureau

Mr. Pickard determined similar exposure groups and implemented a representative sampling plan for respirable dusts within individuals breathing zones during pH adjustment operations. Moreover, Mr. Pickard assessed the efficacy of the existing engineering controls and work procedures.



Exposure Assessment for the Application of Alkyd Base Enamel Paint

The exposure assessment consisted of the review of pertinent Material Safety Data Sheets (MSDSs), the review of existing standard operating procedures, and the subsequent generation and implementation of a personnel sampling plan outlining the chemical constituents of concern associated with Alkyd Oil Base Enamel with a volatile organic compound (VOC) mass to volume ratio of 380 grams/liter. Moreover, the use of dilution ventilation as an engineering control was assessed.

UST Removal Program

Mr. Pickard managed the health and safety for a UST removal program involving multiple retail gasoline sites. The management of the program included, conducting scheduled and unscheduled field audits to ensure worker compliance with mandated health and safety/personal protective equipment procedures. Additionally, Mr. Pickard was responsible for the management of health and safety plan development and compliance including field investigative techniques. Moreover, Mr. Pickard oversaw the implementation of a behavior based safety system including the management of the incident investigation program.

NOISE ASSESSMENT PROJECT EXPERIENCE

Noise Impact Analysis for Proposed Mining Operation, NY

Mr. Pickard conducted a noise assessment of a proposed ten (10) acre mining site located in Ghent, New York. The noise assessment consisted of two parts: 1) an ambient sound monitoring program in the vicinity of the proposed facility whose purpose was to characterize the existing noise environment; and 2) a noise impact evaluation of the proposed site. The noise impact evaluation consisted of performing computer noise modeling of the major noise producing equipment and evaluating the increased noise due to the proposed mining operations as compared with the project impact criteria. For this noise assessment the impact criteria was considered to be a six (6)dB or more elevation in the A-weighted sound level, above the Leq.

Noise Assessment

Mr. Pickard conducted a noise assessment during construction operations at a local Water Bureau's Facility. The purpose of the noise assessment was to determine employees' noise exposure in specified areas of the facility. The noise assessment included the collection of area noise samples, utilizing four (4) Quest Q-300 Dosimeters. Area sampling occurred at fixed sampling points throughout the facility and during normal working hours and activities. The Quest Q-300 Dosimeters were programmed for A-scale slow response data collection and the subsequent data was logged over a seven (7) hour period at one (1) minute intervals.

Noise Impact Analysis of Remedial System Operation, NY

Mr. Pickard conducted a noise impact analysis during the operation of a remedial system in New York, New York. The purpose of the impact analysis was to determine the amount of noise the treatment facility contributed to the environment and the surrounding community. Monitoring points were selected based on their locality to on-site equipment. These locations were identified through the use of topographic maps and later confirmed through the course of the noise monitoring program.

The system was shutdown and background noise levels were established and recorded. The background noise monitoring was conducted using a QUEST 2900 precision Type 1 Sound Level Meter. Prior to the start of the monitoring event, the sound level meter was calibrated with a Calibrator QC-10 Noise Dosimeter with a single output of 114 dB and the instrument was configured to measure and store the Leq, L90, and L10. A-weighted Leq, L90, and L10 data collected during the noise monitoring event were compared with both the State and Local impact criteria.



MATTHEW W. PICKARD, C.I.H.
Divisional Safety Manager

ADDITIONAL EXPERIENCE

Conducted scheduled and unscheduled field audits to ensure worker compliance with mandated health and safety/personal protective equipment procedures.

Conducted facility audits for a variety of manufacturers to evaluate compliance with state and federal employee safety, health and environmental regulations.

Responsible for the development and implementation of health and safety procedures during the excavation and processing of chemical, biological and high hazard materials.

Evaluated worker exposures to a variety of chemicals for comparison to applicable permissible exposure limits and appropriate personal protective equipment.

Responsible for health and safety plan development and compliance including field investigative techniques and accuracy of sampling methodology, equipment calibration and quality control procedures during the performance of remedial investigations and corrective actions conducted at hazardous waste sites and various manufacturing and industrial facilities.

Supervised Lead-Based Paint (LBP) surveys to identify potential risks with both interior and exterior LBP.

Responsible for development and implementation of blue flag and railcar offloading policies and procedures in accordance with Federal Railroad Administration guidelines within an active rail yard and subsequent shops.