ROUX ENVIRONMENTAL ENGINEERING AND GEOLOGY, D.P.C.

DAILY FIELD ACTIVITY REPORT

Client:	ExxonMobil	Roux Field Representatives:	Shane McKenna
Location:	410 Kingsland Ave, Brooklyn. NY	Weather:	53-67°F, Cloudy
Project Number:	0172.0030Y123		H: 83%, P: 30.41 inHg
Job:	ExxonMobil Greenpoint Petroleum	Wind:	NNE @ 6-27 mph
	Remediation Project	Date:	Thursday, September 24, 2026

Personnel Onsite

Shane McKenna(Roux)

- Monitoring Well Installation Contractor (ADT)

Brian Karshick	Foreman
Jimmy McGill	Laborer
Germen Torres	Laborer

Equipment Onsite

Hand Auger
Digger Bar
Bobcat Skid Steer 576
TSi 150CC Sonic Drill Rig

Description of Work Performed:

- ADT continued sonic drilling and installing 4" polyvinyl chloride (PVC) casing and screen at monitoring well D-104, bottom of screen was set at 44 feet below land surface (ft bls).

- ADT sonic drilled and installed 4" polyvinyl chloride (PVC) casing and screen at monitoring well D-114, bottom of 20-ft screen was set at 48 ft bls.

Description of Upcoming Work Activities:

- ADT will continue sonic drilling at monitoring well locations S-105.
- ADT will continue sonic drilling 8" boreholes and install 4" PVC casing 20 ft bls or above the confining layer for monitoring well S-105.
- ADT will continue to sonic drill 4" boreholes within previously grouted LCS casing and install 4" PVC casing 20 ft below the confining layer at monitoring well D-105.
- ADT will begin well development at monitoring wells D-103, D-104, D-105, D-114, D-116, S-104, and S-105.

Material Delivered To Site:

- None.

Material Removed From Site:

- None.

Sampling Performed:

- None.

CAMP Performed:

- The community air monitoring program (CAMP) was performed from approximately 7:45 AM - 2:45 PM during all subsurface activities. No exceedances were observed. Dust suppression measures were implemented as necessary throughout the duration.

DAILY FIELD ACTIVITY REPORT

Photographs of Work Performed:

Date: Thursday, September 24, 2026



Photo 1: View facing southeast. View of ADT sonic drilling 4" borehole for PVC casing/screen installation at monitoring well D-114.



Photo 2: View facing down. View of sonic drilled material at monitoring well D-104 at 35-40 ft bls.

DAILY FIELD ACTIVITY REPORT

Photographs of Work Performed: Date: Thursday, September 24, 2026



Photo 3: View facing east. View of general work zone and ADT sonic drilling and installing 4" PVC casing/screen at monitoring well D-104.



Photo 4: View facing down. View of sonic drilled material at monitoring well D-114 at 30-35 ft bls.

Roux Environmental Engineering and Geology, D.P.C.
Community Air Monitoring Program - DUST

Project: ExxonMobil Greenpoint Petroleum Remediation Project - Monitoring Well Installation
PM: Jacqueline Carames
Location: 410 Kingsland Ave, Brooklyn. NY
Date: 9/24/2026

Upwind Serial Number 8530172602
Downwind Serial Number 8530182512

Upwind		Downwind		Corrected Downwind	Comments
Time	Concentration [mg/m3]	Time	Concentration [mg/m3]	Concentration [mg/m3]	
8:00 AM	0.018	8:00 AM	0.020	0.002	
8:15 AM	0.011	8:15 AM	0.007	-0.004	
8:30 AM	0.010	8:30 AM	0.007	-0.003	
8:45 AM	0.015	8:45 AM	0.009	-0.006	
9:00 AM	0.018	9:00 AM	0.012	-0.006	
9:15 AM	0.021	9:15 AM	0.009	-0.012	
9:30 AM	0.019	9:30 AM	0.014	-0.005	
9:45 AM	0.019	9:45 AM	0.010	-0.009	
10:00 AM	0.026	10:00 AM	0.018	-0.008	
10:15 AM	0.022	10:15 AM	0.016	-0.006	
10:30 AM	0.028	10:30 AM	0.020	-0.008	
10:45 AM	0.019	10:45 AM	0.016	-0.002	
11:00 AM	0.021	11:00 AM	0.018	-0.002	
11:15 AM	0.019	11:15 AM	0.021	0.002	
11:30 AM	0.009	11:30 AM	0.020	0.011	
11:45 AM	0.014	11:45 AM	0.021	0.006	
12:00 PM	0.019	12:00 PM	0.017	-0.003	
12:15 PM	0.013	12:15 PM	0.019	0.005	
12:30 PM	0.011	12:30 PM	0.015	0.004	
12:45 PM	0.011	12:45 PM	0.027	0.017	
1:00 PM	0.011	1:00 PM	0.017	0.006	
1:15 PM	0.010	1:15 PM	0.028	0.018	
1:30 PM	0.009	1:30 PM	0.021	0.012	
1:45 PM	0.019	1:45 PM	0.017	-0.001	
2:00 PM	0.021	2:00 PM	0.019	-0.003	
2:15 PM	0.022	2:15 PM	0.016	-0.006	
2:30 PM	0.019	2:30 PM	0.020	0.001	
2:45 PM	0.017	2:45 PM	0.024	0.007	

Notes:
1. NM - Not Measured

Roux Environmental Engineering and Geology, D.P.C.
Community Air Monitoring Program - VOC

Project: ExxonMobil Greenpoint Petroleum Remediation Project - Monitoring Well Installation
PM: Jacqueline Carames
Location: 410 Kingsland Ave, Brooklyn. NY
Date: 9/24/2026

Upwind Serial Number 592-600931
Downwind Serial Number 592-921005

Upwind		Downwind		Corrected Downwind	Comments
Time	VOC Average (ppm)	Time	VOC Average (ppm)	VOC Average (ppm)	
7:59 AM	0.0	7:59 AM	0.0	0.0	
8:14 AM	0.0	8:14 AM	0.0	0.0	
8:14 AM	0.0	8:14 AM	0.0	0.0	
8:29 AM	0.0	8:29 AM	0.0	0.0	
8:44 AM	0.0	8:44 AM	0.0	0.0	
8:59 AM	0.0	8:59 AM	0.0	0.0	
8:59 AM	0.0	8:59 AM	0.0	0.0	
9:14 AM	0.0	9:14 AM	0.0	0.0	
9:29 AM	0.0	9:29 AM	0.0	0.0	
9:44 AM	0.0	9:44 AM	0.0	0.0	
9:59 AM	0.0	9:59 AM	0.0	0.0	
10:14 AM	0.0	10:14 AM	0.0	0.0	
10:29 AM	0.0	10:29 AM	0.0	0.0	
10:44 AM	0.0	10:44 AM	0.0	0.0	
10:59 AM	0.0	10:59 AM	0.0	0.0	
11:14 AM	0.0	11:14 AM	0.0	0.0	
11:29 AM	0.0	11:29 AM	0.0	0.0	
11:44 AM	0.0	11:44 AM	0.0	0.0	
11:59 AM	0.0	11:59 AM	0.0	0.0	
12:14 PM	0.0	12:14 PM	0.0	0.0	
12:29 PM	0.0	12:29 PM	0.0	0.0	
12:44 PM	0.0	12:44 PM	0.0	0.0	
12:59 PM	0.0	12:59 PM	0.0	0.0	
1:14 PM	0.0	1:14 PM	0.0	0.0	
1:29 PM	0.0	1:29 PM	0.0	0.0	
1:44 PM	0.0	1:44 PM	0.0	0.0	
1:59 PM	0.0	1:59 PM	0.0	0.0	
2:14 PM	0.0	2:14 PM	0.0	0.0	
2:29 PM	0.0	2:29 PM	0.0	0.0	
2:44 PM	0.0	2:44 PM	0.0	0.0	

Notes:
1. NM - Not Measured

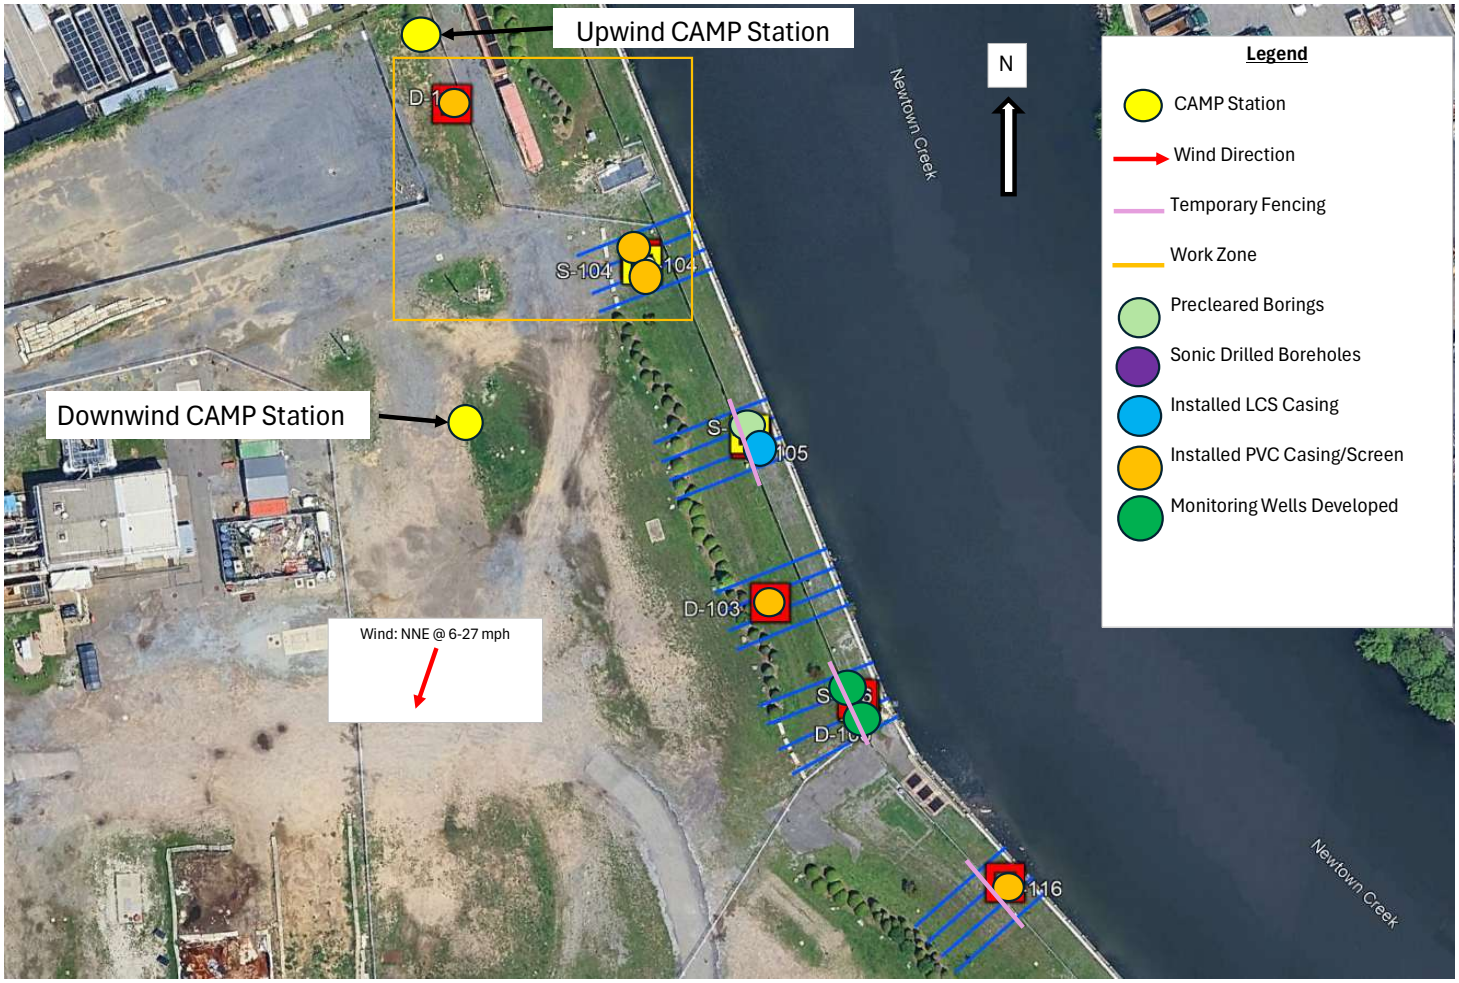


Figure 1: 410 Kingsland Property Site Map - September 24, 2026